

R25



Total Station Instruction Manual

Dear Customer:

Congratulations! We, STONEX are proud to present you with a R25 instrument. Your total station is a rugged and reliable instrument whose performance and design are not surpassed.

To fully appreciate and protect your investment, we suggest that you take the necessary time to read and fully understand this manual. We have a dedicated service organization. If the need arises, please don't hesitate to call us.

Thank you for your trust and confidence.

NOTE:

Don't collimate the sun directly

Avoid insulating the instrument, and don't collimate the sun directly for protecting eyes and instrument.

Set up the instrument on the tripod

When using it please insure the connection between tripod and instrument is firm. It is better to work with wooden tripod for the measurement accuracy.

Assemble the tribrach on the instrument

The setting of tribrach would influence the accuracy. The tribrach should be checked frequently, the screw which connects the tribrach and alidade must be locked tightly. And the central fixing screw should be tight.

Avoiding the librations on the instrument

When transporting, keep the instrument in the case and try your best to lighten librations.

Carry the instrument

When carrying, the instrument handle must be held tight.

High temperature condition

If put the instrument in high temperature condition for a long time, it is bad for the instrument performance.

Temperature changing sharply

The sharp temperature changing on the instrument or prism will shorten the distance measurement range, for example, after taking the instrument out from a warm car to a cold condition, wait for some time, it can be used when it adapts to the surrounding condition.

Check the battery power

Before using it, you should check the power whether it is enough.

Take out the battery

It is not suggested to take out the battery when the instrument is on, otherwise, the stored data may be lost, so it is better to replace the battery after power off the instrument.

Stored data responsibility

STONEX should not be held liability for the lost data because of wrong operation.

The noise from the instrument

When the instrument is working, it is normal if you hear the noise from instrument motor, it will not affect the instrument work.

Definition of Indication

For the safety of your product and prevention of injury to operators and other persons as well as prevention of property damage, items which should be observed are indicated by an exclamation point within a triangle used with WARNING and CAUTION statements in this manual.

The definitions of the indication are listed below. Be sure you understand them before reading the manual's main text.

	WARNING:	Ignoring this indication and making an operation error could possibly result in death or serious injury to the operator.
	CAUTION:	Ignoring this indication and making an operation error could possibly result in personal injury or property damage.

PRECAUTIONS FOR SAFE OPERATION



WARNING

- Only STONEX authorized distributors can disassemble or rebuild the instrument.
- Do not collimate the sun directly. The eye injury or blind could result.
- Cover the charger maybe result in fire when charging.
- If use defection power cable, socket or plug, there is danger of fire, or electronic shock.
- Using wet battery or charger maybe result in fire, or electronic shock.
- Do not close the instrument to burning gas or liquid, and do not use the instrument in coal mine. Blast could happen.
- Do not put the battery in the fire or high temperature condition. Explosion, damage could result.
- If use the battery which is not specified by STONEX, there is danger of fire, electric shock or burn.
- If use the power cable which is not specified by STONEX, there is danger of fire.
- If short circuit of the battery, there is danger of fire..
- When this product encounters disturbance of severe Electrostatic Discharge, perhaps it will have some degradation of performance like switching on/off automatically and so on.



CAUTION

- If touch the instrument with wet hand, there is danger of electric shock.
- Stand or seat on the carrying case, or turn over the carrying case arbitrarily, the instrument maybe damaged.
- Be careful of the tripod tiptoe when setup or move it.
- Drop the instrument or the carrying case, or use defective belt, agraffe or hinge, instrument damage could result.
- Do not touch liquid leaking from the instrument or battery. Harmful chemicals could cause burn or blisters.
- Please assemble the tribrach carefully, if the tribrach is not stable, series damage could result.
- Drop the instrument or tripod, series damage could result. Before use it, check the central screw is tight.

User

1) This product is for professional user only!

The user is required to be a qualified surveyor or have a good knowledge of surveying, in order to understand the user manual and safety instructions, before operating, inspecting or adjusting.

2) Wear the required protectors (safety shoes, helmet, etc.) when operating.

Exceptions from Responsibility

1) The user of this product is expected to follow all operating instructions and make periodic checks of the product's performance.

2) The manufacturer assumes no responsibility for results of a faulty or intentional usage or misuse including any direct, indirect, consequential damage, and loss of profits.

3) The manufacturer assumes no responsibility for consequential damage, and loss of profits by any disaster, (an earthquake, storms, floods etc.).

4) The manufacturer assumes no responsibility for any damage, and loss of profits due to a change of data, loss of data, an interruption of business etc., caused by using the product or an unusable product.

5) The manufacturer assumes no responsibility for any damage, and loss of profits caused by usage except for explained in the user manual.

6) The manufacturer assumes no responsibility for damage caused by wrong transport, or action due to connecting with other products.

Safety Standards for Laser(RTS series)

R25 adopts the safe and visible laser on the basis of “Specification Standard of radiant products” (FDA CDRH.21CFR Part 1040.10 and 1040.11) and “Safety of laser products – parts 1: Equipment classification, requirements and user’s guide” (IEC 60825-1:2001). According to above standards, R25 is class IIIa/3R laser products. When the prism or reflective sheet is selected in Config mode as target, the output is equivalent to the safer class 1.

Once the instrument is damaged, do not disassemble it. You’d better contact STONEX or local dealer.

Labels

Follow the safety instructions on the labels as well as in this manual to ensure safe use.



Note for Safety



WARNING

- Never point the laser beam at other’s eyes, it could cause serious injury.
- Never look directly into the laser beam source, it could cause permanent eye damage.
- Never stare at the laser beam, it could cause permanent eye damage.
- Never look at the laser beam through a telescope or other optical devices, it could cause permanent eye damage.

CONTENT

1.Introduction	4
1.1 Nomenclature	4
1.2 Operating the instrument	6
1.2.1 Keypad	6
1.2.2 Trigger key	7
1.2.3 Softkeys	7
1.2.4 Symbols	8
1.3 Display	8
1.4 Menu Diagram.....	8
1.5 Power On/Off	11
1.5.1 Power On.....	11
1.5.2 Power Off	11
1.6 How to Configure.....	11
1.6.1 Light	11
1.6.2 Contrast	11
1.6.3 Reticle Illumination.....	12
1.6.4 Tilt correction	12
1.6.5 Laser-Point	12
1.7 How to Set Parameters	12
2. Preparation before Measurement.....	12
2.1About Battery	12
2.1.1 Battery Power Symbol.....	12
2.1.2 Replace and mount battery	13
2.1.3 Recharge battery	13
2.2 Setting up the instrument.....	14
2.3 Centering	14
2.3.1 Centering with Optical Plummet (Optional)	14
2.3.2 Centering with Laser Plummet	15
2.4 Levelling-Up	15
2.4.1 Basic Levelling-Up with the circular level	15
2.4.2 Accurate Levelling-Up with plate level.....	16
2.4.3 Accurate Levelling-Up with Electronic Level on the screen.....	16
2.5 Input mode.....	17
2.5.1 Insert characters.....	17
2.5.2 Delete characters	17
2.5.3 Clear characters	17

2.5.4 Toggle through characters	17
2.6 Pointsearch	17
2.7 Wildcard search	18
2.8 Measuring	18
3 Function key	18
4 Programs	22
4.1 Application presettings	22
4.1.1 Setting job	23
4.1.2 Setting Station	23
4.1.3 Setting Orientation	23
4.2 Applications	24
4.2.1 Abstract	24
4.2.2 Measuring Duties	25
5 Settings	65
6 EDM Settings	68
6.1 EDM Mode	68
6.2 Prism Type	69
6.3 Prism Constant	69
6.4 Guide Light	69
7 File Management	70
7.1 Job	71
7.2 Fixpoints	71
7.3 Measurements	71
7.4 Codes	72
7.5 Initialize Memory	72
7.6 Memory Statistic	73
7.7 Memory Select	73
7.8 USB	73
8 Start-up sequence	73
9 Check and Adjust	74
9.1 Horizontal Collimation Error and Vertical Index Error	74
9.1.1 Horizontal Collimation Error C	74
9.1.2 Vertical Index Error	76
9.2 Plate Level and Circular Level	77
9.2.1 Plate Level	77
9.2.2 Circular Level	77
9.3 Optical Plummet and Laser Plummet	78
9.3.1 Optical Plummet(factory optional)	78


9.3.2 Laser Plummet.....	79
9.4 The Optical Sight.....	80
9.5 Vertical Cross-hair on Telescope	80
9.6 EDM Optical Axis and the Telescope Sighting Axis Error	81
10 Comm Parameters	82
11 Data Transfer	82
12 System Information	83
13 Instrument Maintenance.....	84
13.1 Cleaning and Drying	84
13.2 Storage.....	84
13.3 Transportation.....	84
13.4 Check.....	84
14 Specifications	85
15 Standard components	88
Appendix I: Atmospheric correction formula and chart(Just for reference).....	89
Appendix II: Correction for refraction and earth curvature	91
Appendix III: Assembling and disassembling for three-jaw tribrach.....	92

1.Introduction

R25 is a high-quality electronic Total Station designed for the construction site. Its innovative technology makes the daily surveying jobs easier. The instrument is ideally suited for simple construction surveys and stake out tasks. The easy operation of the instrument functions can be learned without problems in no time.

1.1 Nomenclature



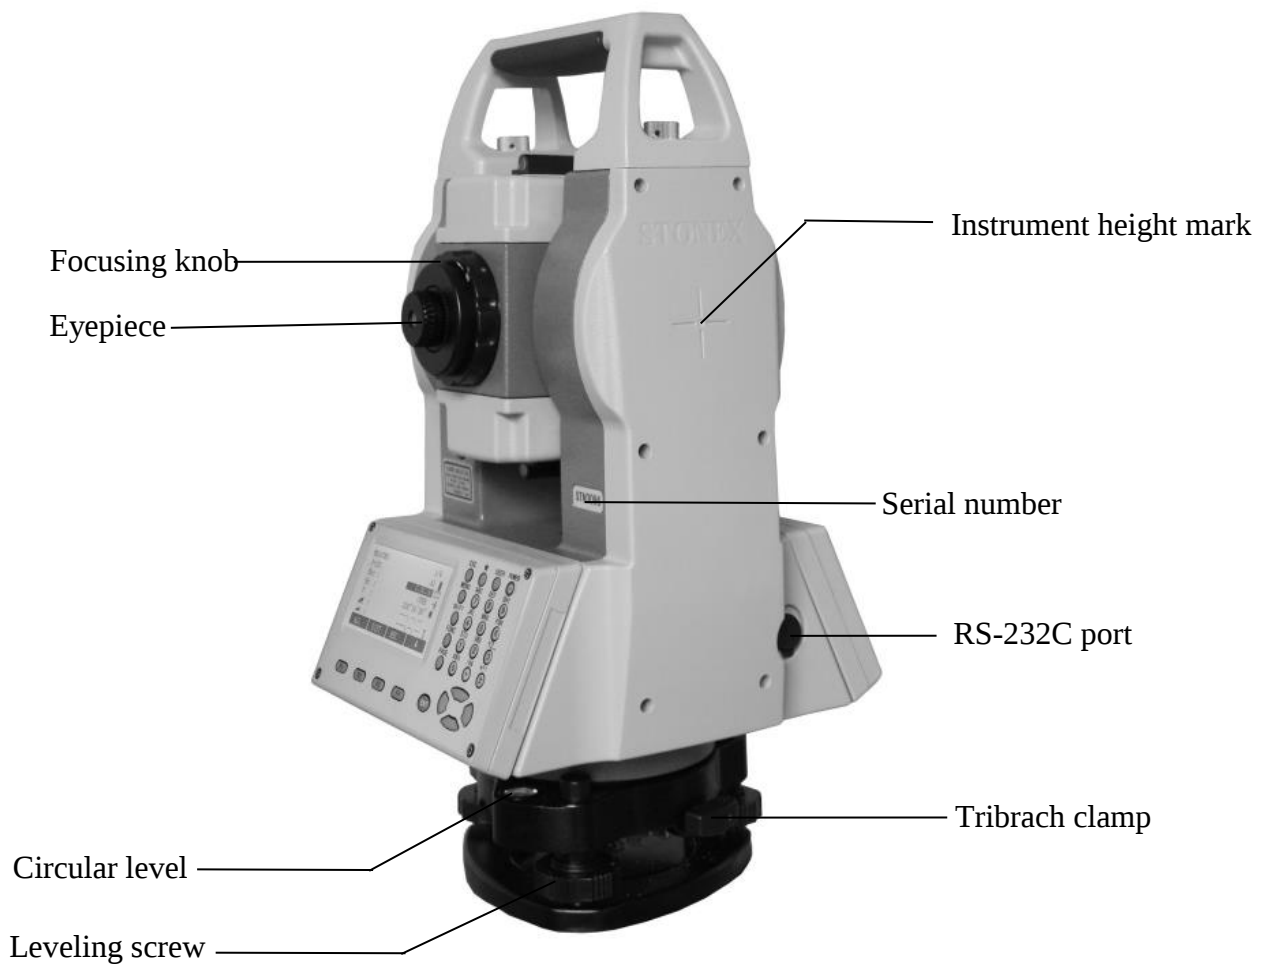

1.2 Operating the instrument

1.2.1 Keypad



Fixed Keys	Name	Functions
F1~F4	Select key	Select the functions matching the softkeys
0~9/ A~!	Alphanumeric keypad	Enter letters numerical values or other characters
Shift	Shift key for character entry	1.Shift between number and alphabet when inputting.2.Shift targets model when measuring
★	Star key	Essential configurations including illumination etc can be set here
User	User key	Key, programmable with function from the Func menu.
Page	Page key	Scroll to next page when a dialogue-consists of several pages.
Menu	Menu key	Access comprehensive menu display including measuring programs,specific settings,the data manager, adjustments, communications parameters,system information and data transfer.
Enter	Enter key	Confirm an entry or selection
ESC	Escape key	Quit a screen or edit mode without saving changes.
Func	Function key	Perform sorts of fast function settings defined by program screen
◀▲▼▶	Navigation key	Control the focus bar within the screen and the entry bar within a field
①	Power key	Turn on/off the instrument

1.2.2 Softkeys

Under softkeys, a selection of commands and functions is listed at the bottom of the screen. They can be activated with the corresponding function keys. The available scope of each function depends on the applications currently active.

General softkeys:

[ALL] Start distance and angle measurements and saves measured values.

[DIST] Start distance and angle measurements without saving measured values.

[REC] Save displayed values.

[ENT] Delete current value in the display and is ready for the input of a new value.

[ENH] Open the coordinate input mode.

[LIST] Display the list of available points.

[FIND] Start the search for the point entered.

[EDM] Display EDM settings.

[PREV] Return last active dialog.

[NEXT] Continue to next dialog. Returns to highest softkey level. To next softkey level.

[OK] Set displayed message or dialog and quit dialog.

[SHIFT=0] Set the value to zero.

[STOP] Stop procedure being carried out.

-
-
-

1.2.3 Symbols

Depending on software version different symbols are displayed indicating a particular operating status.

1)  A double arrow indicates choice fields.

2)  Indicates telescope position I or II.

3)  The battery symbol indicates the level of the remaining battery capacity (75% full shown in the example).

4)  Compensator is on.
 Compensator is off.

5)  Numeric Mode

 Alphabet Mode

1.3 Display


R25 is equipped with two large LCD screens(240×128dots).The LCD could display 8 lines with 24 characters per line.


Note:Do not touch the screen with sharp things.

1.4 Menu Diagram

[MENU]→F1-F4:Confirm menu selection

[PAGE]→Scroll to next page

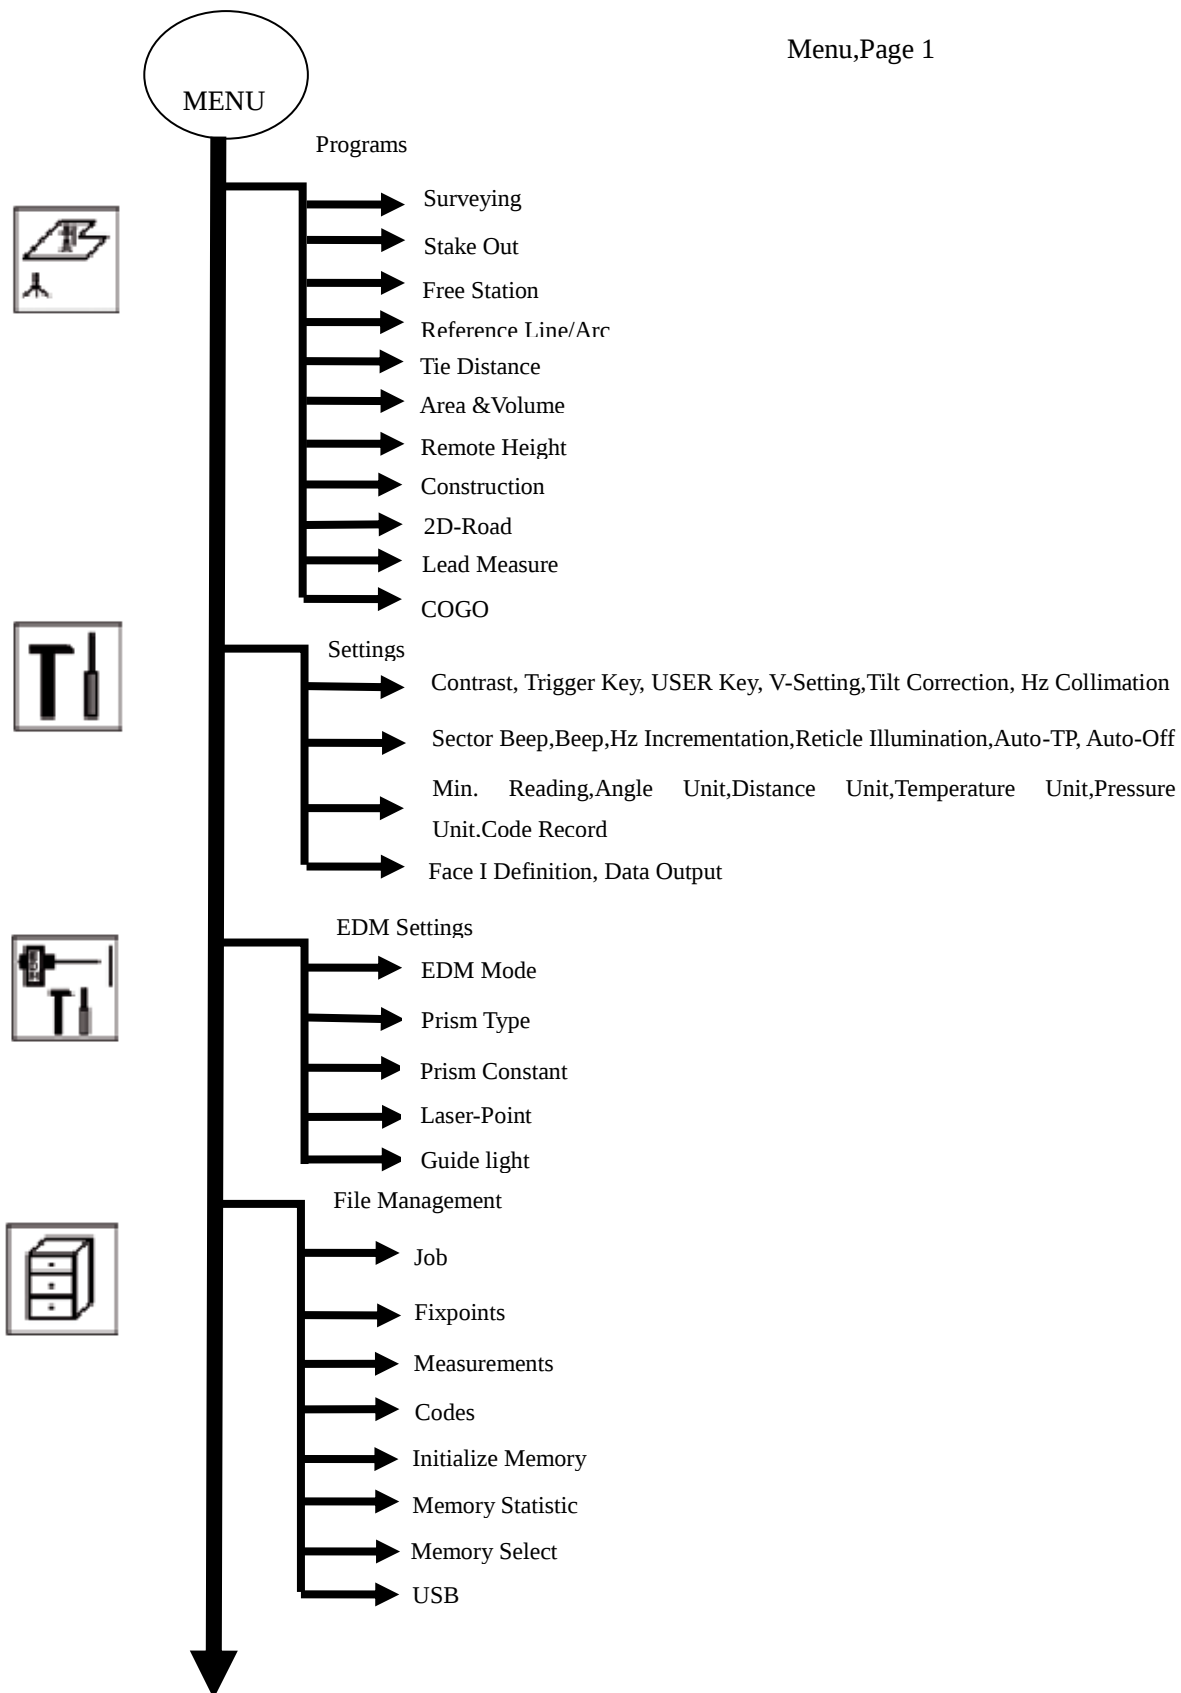

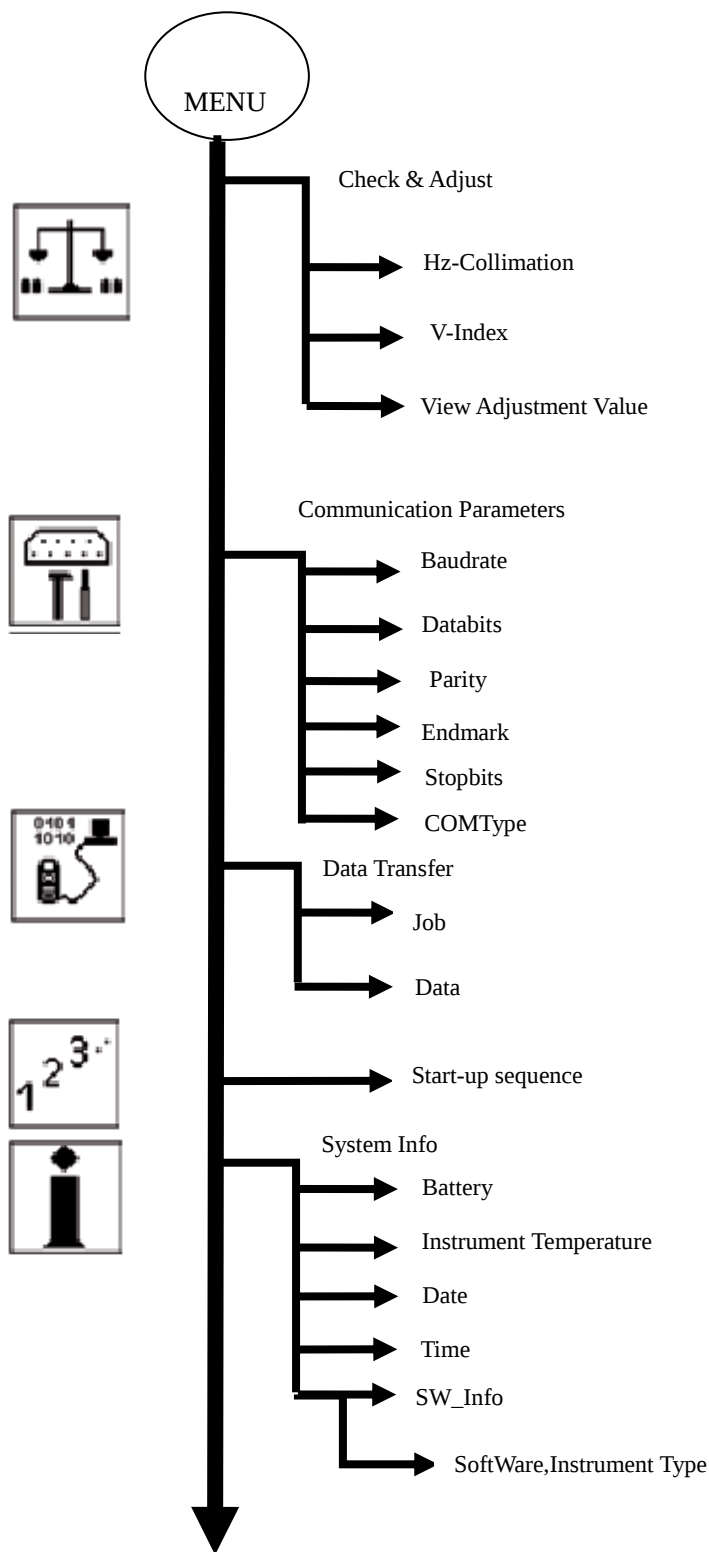


1.5 Power On/Off

1.5.1 Power On

1) Confirm the instrument is leveling, then press the red key [Power], and it will be turned on in no time.




2) The instrument will display the status screen.

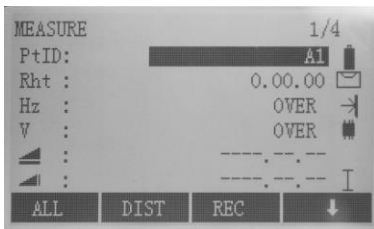


1.5.2 Power Off

Press the [Power] key again and the screen will remind whether to power off.

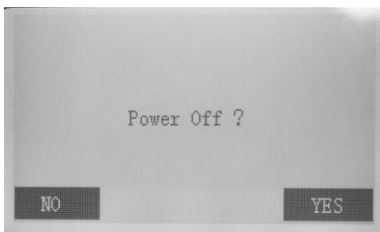

1.6 How to Configure

Press key [★] on panel to access star settings mode, and do some basic essential settings. Change settings if necessary. Use up and down direction keys to select items and utilize left and right direction keys to set the options.

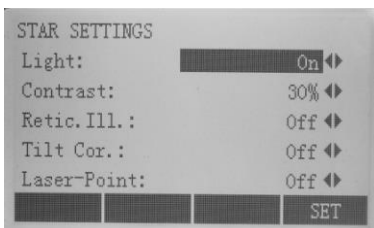

1.6.1 Light

Press left or right direction keys to turn on or off the backlight.

1.6.2 Contrast

Press left or right direction keys to adjust it. There are ten levels (10%-100%) which can be

set.

1.6.3 Reticle Illumination

Press left or right direction keys to adjust it(on or off).

1.6.4 Tilt correction


Press left or right direction keys to adjust it.And it gives the possibility to choose among three options(1-axis,2-axis and off).

1.6.5 Laser-Point

Press left or right direction keys to turn on or off laser beam.

1.7 How to Set Parameters


Press key [MENU] on panel to enter into comprehensive menu mode,then select [SETS] item,where relevant parameters can be set.Detailed operation can be referred to settings in chapter 4.2.

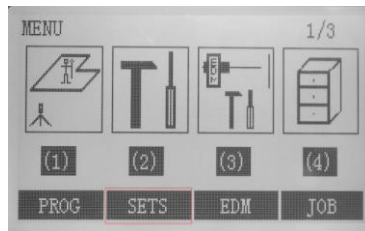

2. Preparation before Measurement

2.1 About Battery

2.1.1 Battery Power Symbol

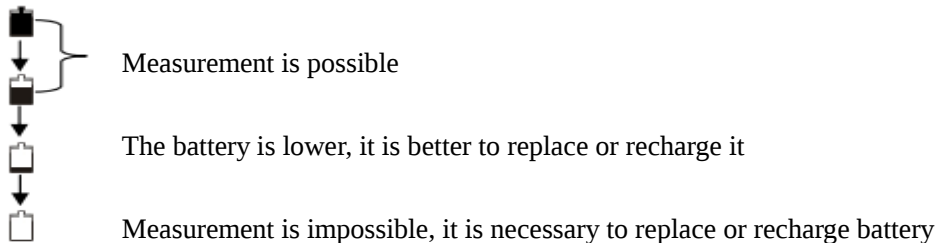

Note:

1)The battery's working time will be affected by many factors, such as ambient temperature, recharging time, recharging and discharging times. So we suggest the users recharge the battery full or prepare several full batteries before operation.

2)The battery symbol only indicates power capability for current measurement mode. The power consumption in distance measurement mode is more than in angle mode, if the instrument enters into distance measurement mode from angle mode, the power maybe auto-off because of lower battery.

3)The symbol only indicates the supply power but not the instantaneous power change.

And if the measurement mode changes, the symbol will not show the power's decrease or increase immediately.

4) It is suggested that user should check every battery power before field work.

2.1.2 Replace and mount battery

1) Replace battery

- ① Press the button downward as shown left.
- ② Remove the battery by pulling it toward you.

2) Mount battery

- ① Insert the battery to the instrument.
- ② Press the top of the battery until you hear a click.




2.1.3 Recharge battery

1) Connect the charger connector to the battery.

2) Plug the charger on 100V/240 power supply. The red lamp becomes lighting, which indicates recharging. If interval-time is longer, the connector isn't fixed well.

3) That the green lamp flashes means recharging is complete.

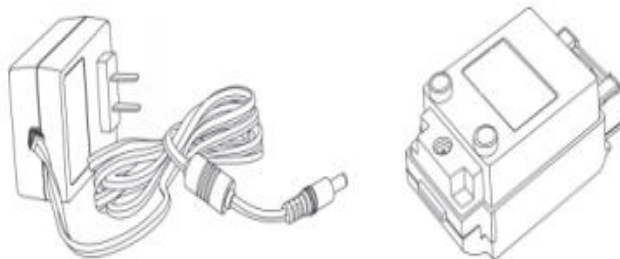


Note:


1 New battery (or battery does not used for several months) should be recharged for several times. Please recharge it more than 10 hours, and then the battery can attain best status.

2 Please recharge the battery continuously for another 1~2 hours after the light green, which is good for the battery.

2.2 Setting up the instrument

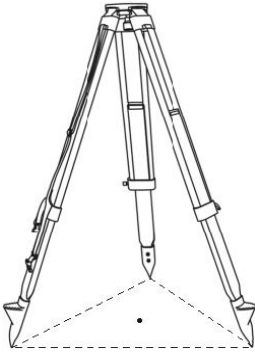



1) Set up the tripod first: Extend the extension legs to suitable lengths and tighten the screws on the legs. Make sure the legs are spaced at equal intervals and the head is approximately level. Set the tripod so that the head is positioned over the surveying point. Make sure the tripod shoes are firmly fixed in the ground.

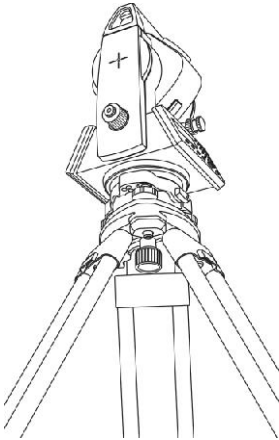

2) Attaching the instrument on the tripod head: Mount the instrument carefully on the tripod head. Supporting it with one hand, tighten the centering screw on the bottom of the unit to make sure it is secured to the tripod.

2.3 Centering

2.3.1 Centering with Optical Plummet (Optional)

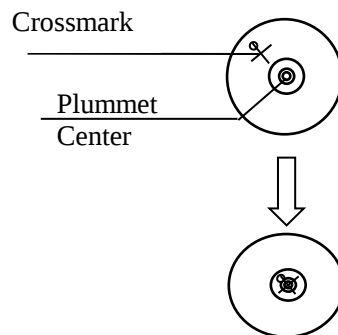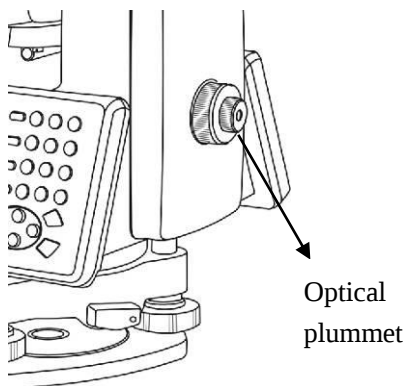


Turn the focusing ring of the optical plummet to focus the ground mark point. Then adjust three foot-screws to center the bubble of the circular level. If the plate level is not leveling-up, you can loosen the center screw of the tripod, and move the instrument to

center the bubble of the plate level. At last tighten the center screw. Repeat above steps until the center of reticule always coincides with the mark point when rotating alidade of instrument.

Note: Use the three leveling screws and tripod to center the instrument.

2.3.2 Centering with Laser Plummet

External influences and the surface conditions may lead to the requirement of the adjustment of the laser intensity. The laser can be adjusted in 25% steps as required. If the instrument is equipped with laser plummet, after activating electronic level, the laser plummet adjusting bar will display. With pressing up or down keys the laser lightness can be adjusted.

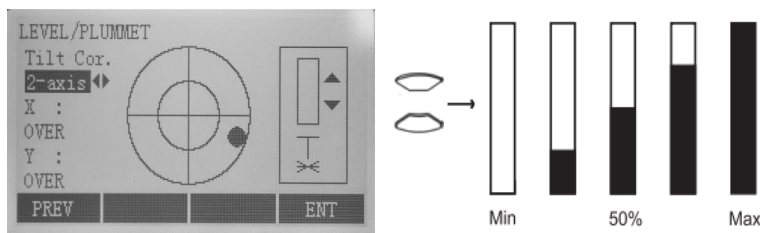

Operation Steps:


- 1) Press the "Func" key, and then click "F1" to enter into the display as shown in the upper figure. With pressing up or down direction keys you can turn on or off laser plummet and set it as four levels of brightness. Thus, that laser emits downwards can be seen.
- 2) Loosen the center screw of tripod, and move the base plate on tripod head until the laser spot coincides with ground mark point. Then tighten the center screw.
- 3) Repeat leveling and two steps until the instrument keeps leveling and the laser spot coincides with ground mark point when rotating alidade of instrument in any direction.
- 4) After centering, please turn off laser plummet to save power.

2.4 Levelling-Up

2.4.1 Basic Levelling-Up with the circular level

The diagram shows the circular level with three adjustment screws labeled 'Screw A', 'Screw B', and 'Screw C'. Arrows indicate the direction of rotation for each screw. A circular bubble is shown in the center, and a line is drawn through it, indicating the path of movement.

1. Move the foot screws A and B in opposite direction till the circular bubble is perpendicular to a line shaped with screw A and B. The direction of rotation in left thumb indicates the movement of the circular bubble.

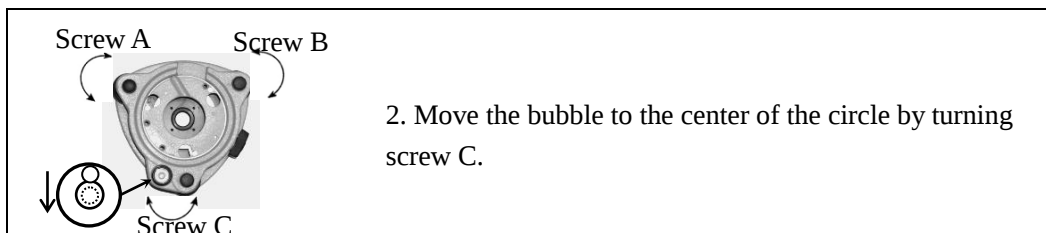


2.4.2 Accurate Levelling-Up with plate level

	1. Loosen the horizontal motion clamp, and turn the instrument till the plate level is parallel to a line shaped with screws A and B. Adjust the screws A and B to make the bubble in the center of the level.
	2. Loosen the horizontal motion clamp, and turn the instrument approximately 90°. Adjust the screw C until the bubble in the center of the level.
3. Repeat above steps until the bubble remains in the center of the plate level while the instrument is rotated to any position.	

2.4.3 Accurate Levelling-Up with Electronic Level on the screen

It is convenient for R25 to level up with electronic level, especially when it is difficult to observe the circular level and plate level.

- 1) Firstly, power on the instrument, press “Func” button, and then select F1 (Level/Plummet). The electronic level displays on screen.
- 2) Secondly, level it by turning three foot screws and ensure the bubble is in the plate level. Make sure the black spot is in the center.

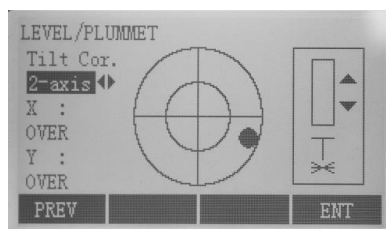

Note: On this menu you can turn on/off the X/Y compensator by pressing left or right

direction key.

2.5 Input mode

Due to the alphanumeric keypad you can enter characters directly.

- 1) Numeric fields: Can only contain numerical values. By pressing a button of the numeric keypad the number will be displayed.
- 2) Alphanumeric fields: Can contain numbers and letters. By pressing a button of the alphanumeric keypad the input opens. By pressing several times you can toggle through the characters. For example: 7->A->B->C->7->A....

2.5.1 Insert characters

If a character was skipped (e.g. 13 instead of 123), you can insert it later.

Place cursor on "1" → Insert an empty character on the right of "1" (Press F1 key) →
Input the new character "2" → Confirm input.

2.5.2 Delete characters

Place cursor on character to be deleted → Delete this character (Press F2 key) →
Confirm delete.

2.5.3 Clear characters

Place cursor on any position among character fields → Clear characters (Press F3 key) →
Confirm Clear.

2.5.4 Toggle through characters


By pressing a button of the alphanumeric keypad the input opens. By pressing F4 key you can switch between numbers and letters. Here at entry status pressing F4 is equivalent to pressing shift key.

2.6 Pointsearch

Pointsearch is a global function used by applications to e.g. find internally saved measured or fixed points. It is possible for the user to limit the point search to a particular job or to search the whole storage. The search procedure always finds fixed points before measured points that fulfill the same search criteria. If several points meet the search criteria, then the points are listed according to their age. The instrument finds the most current (youngest) fixed point first.

Direct search

By entering an actual point number (e.g. "A10") all points with the corresponding point number are found.

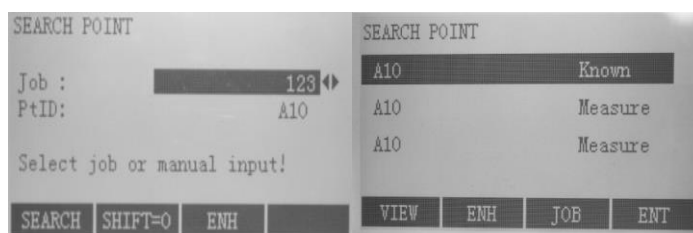

[VIEW]:Displays the coordinates of the selected point.


[ENH]:For manual input of coordinates.

[JOB]:To select a different job.

[ENT]:Confirm selected point.

2.7 Wildcard search

The Wildcard search is indicated by a "*". The asterisk is a place holder for any following sequence of characters.Wildcards are always used if the point number is not fully known, or if a batch of points is to be searched for.

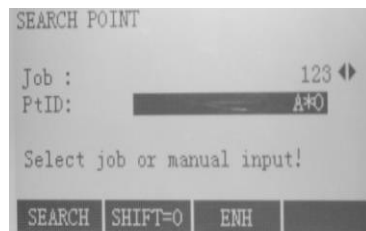

Examples:

* : All points of any length are found.

PT :All points with exactly the point number "PT" are found.


PT* :All points of any length starting with "PT" are found (e.g.:PT1, PT12, PTAB).

*1 :All points of any length with a "1" as the second character are found (e.g.: A1, B12, A1C).


A*1 :All points of any length with an "A" as the first character and a "1" as the third character are found. (e.g.:AB1, AA123, AT17).

2.8 Measuring

After switching on and setting up correctly, the Total Station is immediately ready for measuring.On the measurement display it is possible to call up functions of fixed keys and function keys.

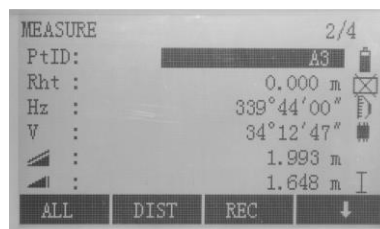

3 Function key

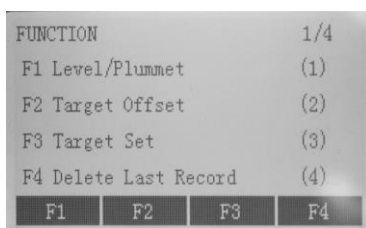

Under “FUNC” menu several functions can be activated.Functions can also be started directly from the different applications.Each function from the FUNC



menu can be assigned to the “USER” key. The detailed applications are described below.

1) Level/Plummet

This function triggers the electronic bubble and enables the settings of intensity for the laser plummet.

2) Target Offset

If it is not possible to set up the reflector directly, or it is not possible to aim at the target point directly, the offset values (length, cross and/or height offset) can be entered. The values for the angle and distances are calculated directly for the target point.

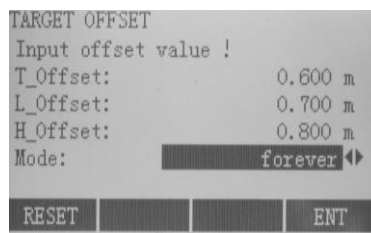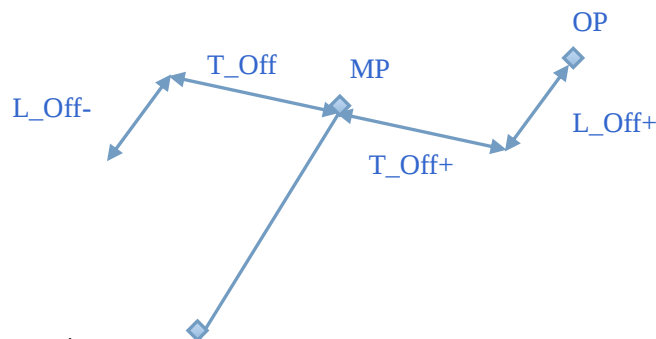

Procedure:

1. Input the offset values (length, cross and/or height) according to the sketch.
2. Define the period during which the offset is to apply. Two modes are available: Reset and Forever. Reset: The offset values are reset to 0 after the point is saved. Forever: The offset values are applied to all further measurements.
3. [RESET]: Sets eccentricity to zero.
4. [ENT]: Calculate the corrected values and jump to the application from which the offset function was started. The corrected angle and distances are displayed once a valid distance measurement has been triggered.

3) Target Set

Change among three types(Prism,Sheet and NoPrism).

Prism:Distance measurements with prisms.

Sheet:Distance measurements with sheets.

NoPrism:Distance measurements without prisms.

Note:After type selection,press “F4” to return previous page and simultaneously save setting result.

4) Delete Last Record

This function deletes the last recorded data block. This can be either a measurement block or a code block.

Note:Deleting the last record is not reversible!

Only records can be deleted which were recorded in "Surveying" or in "Measuring".


5) Height Transfer

This function determines the height of the instrument from measurements to a maximum of 5 target points, with known heights, in two faces.With measurements to several targets,the improvement is indicated in the "delta" value.

FUNCTION	2/4		
F1 Height Transfer	(5)		
F2 Hidden Point	(6)		
F3 Free-Coding	(7)		
F4 Laser Pointer	(8)		
F1	F2	F3	F4

Procedure:

- ①Select known point and input reflector height.
- ②After triggering the measurement with [ALL],the calculated height “H0” is displayed.

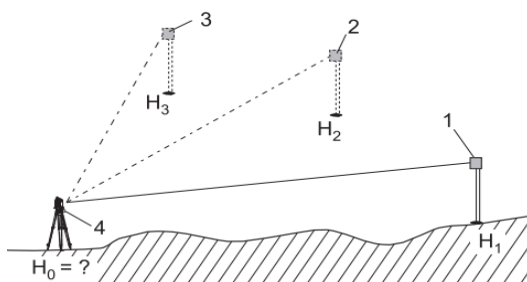

- 1) Reflector 1
- 2) Reflector 2
- 3) Reflector 3
- 4) Instrument


[ADDP] Add another height of a known point.

[FACE II] Measure the same target in the second face.

- ③[SET] Save the changes and set the station.

6) Hidden Point

The program allows measuring a point that is not directly visible,using a special hidden point rod.

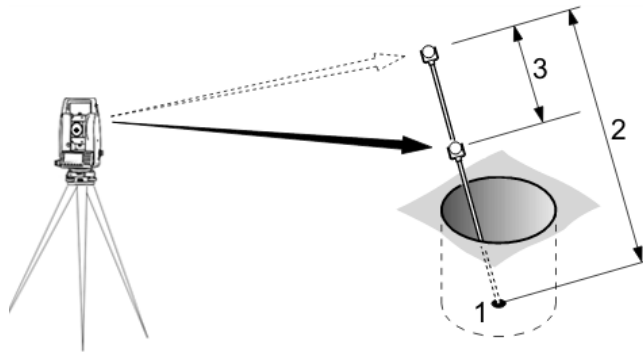

- 1.E, N, H of Hidden Point
- 2.Rod Length
- 3.Distance R15-R25

Procedure:

① Measure the first prism (P1).

[All] Start measuring and proceed to procedure 2.

[ROD/ED] Allow you to define the rod and the EDM-Settings.

EDM Mode:Change the EDM Mode.

Prism Type:Change the prism type.

Prism Const:Display the prism constant.

Rod Length:Total length of hidden-point rod.

Dist. R15-R25:Spacing between the centers of reflector R15 and prism R25.

Meas.Tol:Limit for the difference between the given and measured spacing of the reflectors. If the tolerance value is exceeded, the program will eject a warning.

② [All] Start measuring and proceed to the result.

③ Result is displayed.

HIDDEN POINT RESULT	
PtID:	A16
Desc.	
North :	2.136 m
East :	3.206 m
Height:	5.010 m
END	NEWP

[END] Return calling application.


[NEWP] Return procedure 1.

7) Free-Coding

Select code from the codelist or enter a new code.

8) Laser Pointer

Switch on or off the visible laser beam for illuminating the target point. The new settings are displayed for about one second and then saved.

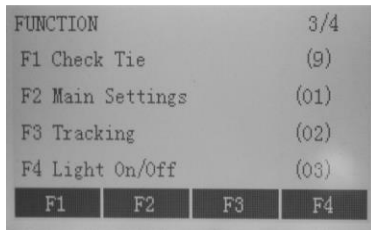

9) Check Tie

Calculation and display of the slope and horizontal distance, height difference, azimuth, grade, and coordinate differences between the last two measured points. Valid distance measurements are required for the calculation. If there exist less than 2 valid

measurements, the values can't be calculated.

10) Main Settings

Enable you to change the most important settings which all exist in [SETS] under [MENU].


11) Tracking

Switch on or off the tracking measurement mode. The new setting is displayed for approximately one second and then set. The function can only be activated from within the same EDM mode and prism type. The last active measurement mode remains set when the instrument is switched off.

12) Light On/Off

Turn on or off display illumination.

13) Units

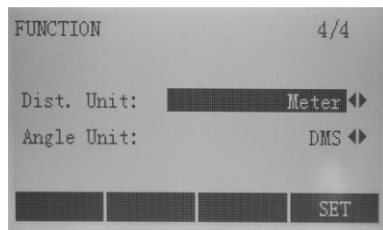


It displays the current distance and angle units and gives the possibility to change them by left or right direction keys.

4 Programs

4.1 Application presettings

These are programs that precede the application programs and are used to set up and organize data collection. They are displayed after selecting an application. The user can select the start programs individually.

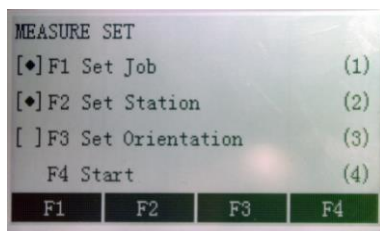

[•] Settings made.

[] Settings not made.

4.1.1 Setting job

All data is saved in JOBS like directories. Jobs contain measurement data of different types (e.g. fixed points, measurements, codes, stations,...) and are individually manageable and can be readout, edited or deleted separately.

Procedure:

1) Creating a new job. Press [F1], then select [add] key to access the “NEW JOB” screen. Then name the job, record the operator, and make notes.

2) After setting the job, back to start-up programs.

Note: All recorded data is stored in this job. Besides, if no job was defined and an application was started or if [ALL] key was triggered, the system would automatically create a new job and name it “DEFAULT”.

4.1.2 Setting Station

Each coordinate computation relates to the set station. At least plan coordinates (E, N) are required for the station. The station height can be entered if required. The coordinates can be entered either manually or read from the internal memory.

Press [F2], namely set station. Afterwards choose either of the two following methods to complete the application of setting station.

1) Set manually

① Select [ENH] to call up manual coordinate input dialogue.

② Input PtID and coordinates (North, East and H).

③ Choose [ENT] to Save station coordinates, the input of the instrument height continued.

④ Choose [ENT] to finish station setting.

2) Known Point

① Press [FIND] or [LIST] to select a PtID stored in internal memory.

② Input instrument height.

③ Choose [ENT] to finish station setting.

4.1.3 Setting Orientation

With the orientation, Horizontal direction can be input manually or points with known coordinates can be set.

1) Manual Input

① Choose [F1] to access Manual Input screen. Here need to input Backsight PointID, Reflector height and Hz-direction (Azimuth).

② Press [ALL] to start trigger measurement, data saved and orientation set.

2) With Coordinates

Choose [F2] to access Coordinate Orientation screen. There are two methods for orientating with coordinates. Orientation coordinates can be either obtained from the internal memory or entered manually.

① Input the orientation point number and determine the point found before. To determine the orientation, a target with known coordinates can be used. Thus press [LIST] to read out PtID stored in internal memory.

② Press [ENH] to input backsight PointID and coordinate, after confirming this input continue entering reflector height and meantime sighting the target. At last press [ALL] to start trigger measurement, data saved and orientation set.

Note: To determine the orientation precisely a maximum of 5 target points with known coordinates can be used for checking.

4.2 Applications


4.2.1 Abstract

Applications are predefined programs that cover a wide spectrum of surveying duties and facilitate daily work in the field. How to access: Press [MENU] fixed key. → Selecting the "Program" option. → Press F1-F4 to call up applications and activate start programs. → Press [PAGE] fixed key to scroll to next page.

The following applications are available:

- 1) Surveying
- 2) Stake Out
- 3) Free Station
- 4) COGO
- 5) Tie Distance
- 6) Area & Volume
- 7) Remote Height
- 8) Reference Line/Arc
- 9) Construction
- 10) Lead Measure
- 11) 2D-Road

4.2.2 Measuring Duties

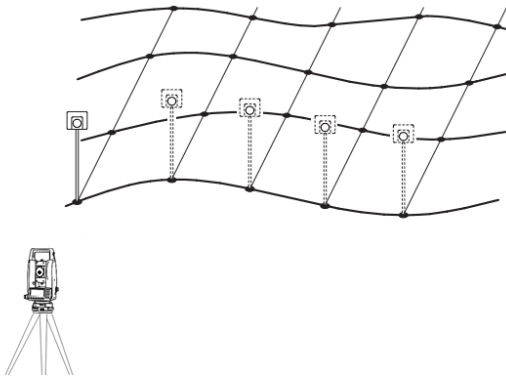

1) Surveying

With this program the measurement of an unlimited number of points is supported. It is comparable to “Meas & Rec”, but includes stationing, orientation and coding.

Procedure:

- ① Input PtID, codes and reflector height if demanded.
- ② [ALL] Trigger and record measurements.

[IndivPt] Switch between individual and current point number.

Three coding methods are available:

- ① Simple coding:

Input a code into the relevant box. The code is stored along with the corresponding measurement.

- ② Expanded coding:

Press the [CODE] softkey. The code that was input can be searched for within the codelist and it gives the possibility to add attributes to the code.

- ③ Quick coding:

Press the [Q-Code] softkey and enter the shortcut to the code. The code is selected and the measurement starts.

2) Stake Out

This program calculates the required elements to stake out points from coordinates or manually entered angles, horizontal distances and heights. Stake out differences can be displayed continuously.

Stake out coordinates from memory.

Procedure:

- ◀▶ Select the point.

[DIST] Start measuring and calculation of the stake-out elements.


[REC] Save the displayed values.

[B&D] Input direction and Hz-distance of stake out point.

[MANUAL] Enable simplified input of a point without PtID and without the possibility of storing the data of the point.

① Polar Stake out

Normal indication of polar stake out offsets.

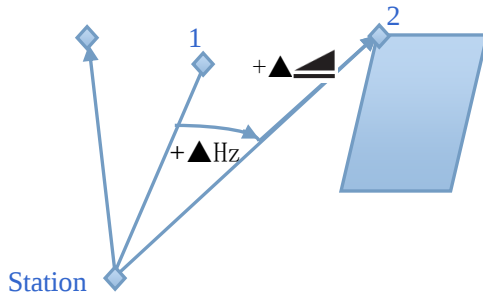

a) Actual

b) Point to stake out

ΔH_z : Angle offset: positive if point to stake out is to the right of the actual direction.

Δ (triangle with horizontal line): Longitudinal offset: Positive if point to stake out is further away.


Δ (triangle with vertical line): Height offset: Positive if point to stake out is higher than measured point.

② Orthogonal Stake out

The position offset between measured point and stake out point is indicated in a longitudinal and transversal element.

a) Actual

b) Point to stake out

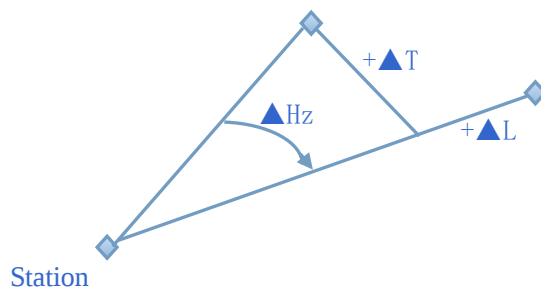

ΔL : Longitudinal offset: Positive if nominal point is further away.


ΔT : Transversal offset, perpendicular to line-of-sight: Positive if nominal point is to the right of measured point.

③ Cartesian Stake out

Stake out is based on a coordinate system and the offset is divided into a north and east element.

a) Actual

b) Point to stake out

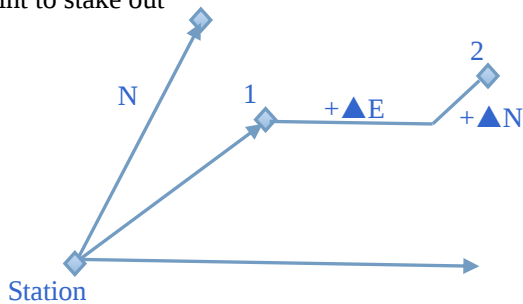


▲E:Easting offset between stake out and actual point.

▲N: Northing offset between stake out and actual point.

3) Free Station

The application is used to determine the instrument position from measurements to a minimum of two known points and a maximum of five known points.

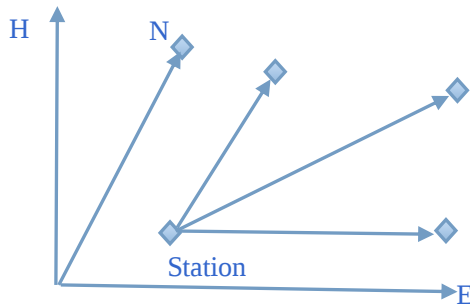

The following measurements sequences to target points are possible:

- a) Horizontal and Vertical angles only (resection)
- b) Distances and Horizontal and Vertical angles (3 points resection)
- c) Horizontal and Vertical angles to some point(s) and Horizontal and Vertical angles plus distances to other point(s).

The final computed results are Easting,Northing and Height of the present instrument station,including the instruments Horizontal Circle Orientation.Standard deviations and residuals for accuracy assessments are provided.

①Measuring facilities

Single face I or II or dual face I + II measurements are always possible. No specific point sequence or specific face sequences are required. Gross errors checks are made for dual face measurements to ensure the same point(s) are sighted with the other face.

Note: If a target point is measured several times in the same telescope position the last valid measurement is used for computation.

Measurement Disciplines:

•2 face measurements

When measuring the same target in both faces, the reflector height mustn't be changed when changing the telescope position.

•Target points with 0.000 height

Target points with 0.000 height are discarded for height processing. If target points have a valid height of 0.000 m, use 0.001 m to enable it for height processing.

②Computation procedure

The measuring procedure automatically determines the method of evaluation, e.g. resection, 3 point resection, etc. If more than the minimum required measurements are performed, the processing routine uses a least squares adjustment to determine the plane position and averages orientation and heights.

a) The original averaged measurements of face I and face II are called into the computation process.

b) All measurements are treated with the same accuracy, whether these are measured in single or dual face.


c) Easting and northing is determined by the method of least squares, including standard deviation and improvements for horizontal direction and horizontal distances.

d) The final height (H) is computed from averaged height differences based on the original measurements.


e) The horizontal circle orientation is computed with the original averaged measurements of face I and face II and the final computed plane position.

Procedure:

a) Set job

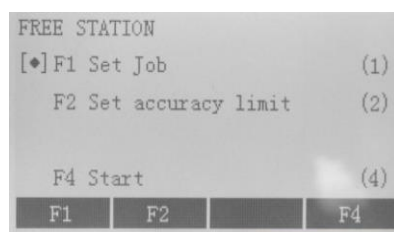

b) Set accuracy limit:

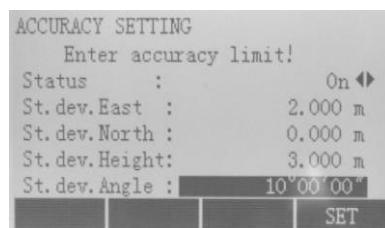

Here you can define a limit for the standard deviation values. If the calculated deviation exceeds the limit, a warning dialog box ejects, which reminds you whether to proceed or not.

LIMIT CHECK

St.dev.East :	0.000 m
St.dev.North :	0.000 m
St.dev.Height:	12.243 m
Ori.Ang Diff.:	0°00'00"
Continue?	

NO YES

c) Input of the name of the station and the height of the instrument.

FREE STATION - STATION

PtID: A2

Hi: 3.500 m

ENT

d) Input of the target PtID and the reflector height.

FREE STATION - TARGET POINT

PtID:

Rht : 2.000 m

FIND LIST ENT ↓

e) Measure

FREE STATION - MEASURE

PtID: A5

Rht : 2.000 m

Hz : 321°25'05"

V : 60°30'18"

2.113 m

COMPUTE AddPt ALL ↓

[ALL]: Trigger angle and distance measurements (3 point resection).

[REC]: Save horizontal direction and vertical angle (resection).

[AddPt]: Input another backsight point.

[COMPUTE]: I'll calculate and display the station coordinates, if at least 2 points and a distance are measured.

③Results

Calculated station coordinates displays:

STATION COORDINATE	
Station:	A1
Hi:	3.000 m
North :	-18.258 m
East :	15.345 m
Height:	5.374 m
PREV	RESID
STDEV	ENT

[PREV]:Return previous page.

[RESID]:Display residuals.

[STDEV]:Display standard deviation.

[ENT]:Set the displayed coordinates and instrument height as new station.

Note:If the instrument height was set to 0.000 in the setup screen, then the station height refers to height of trunnion axis.

Standard deviation displays:

STATION STANDARD DEVIATION	
St.dev.East :	0.000 m
St.dev.North :	0.000 m
St.dev.Height:	2.505 m
Ori.Ang Diff.:	0°00'00"
PREV	ENT

St.dev.East,North,Height:Standard deviation of the station coordinates.

Ori.Ang Diff.:Standard deviation of the orientation.

The computed residuals displays:


Residual = Calculated value - Measured value

TARGET POINT CORRECTION DATA	
PtID:	2◀▶
dHz :	0°00'00"
dHD :	23.526 m
dVD :	-2.355 m
PREV	ENT

◀▶:With the function key,scroll between the residuals of the individual backsight points.

4)Reference Line/Arc

This program facilitates the easy stake out or checking of lines for buildings, sections of road, simple excavations, etc.

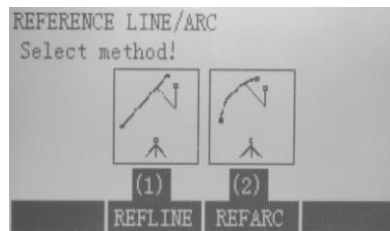


①Reference Line


A reference line can be defined by referencing a known base line. The reference line can be offset either longitudinally, in parallel or perpendicularly to the base line, or be rotated around the first base point as desired. Besides the reference height can be selected as first point, second point or interpolated along the reference line.

Procedure:

a) Definition of the Base line

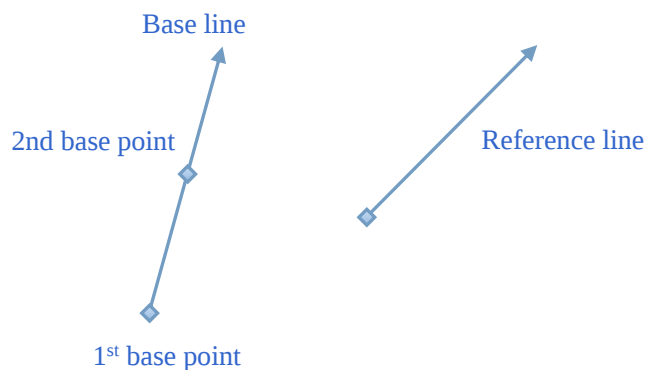


The base line is determined by two base points that can be defined in three ways: Measured points (Input PtID and measure base points with [ALL] or [DIST]/[REC]), Input coordinates manually (Press [ENH] to input), or Find points from memory (Press [FIND] to search for PtID entered or Press [LIST] to choose from a series of points).

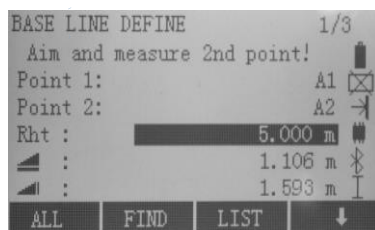

b) Rotating the base line

After defined, the base line can be offset longitudinally, parallel and perpendicularly or rotated. This new line is called the reference line. All measured data refers to the reference line.

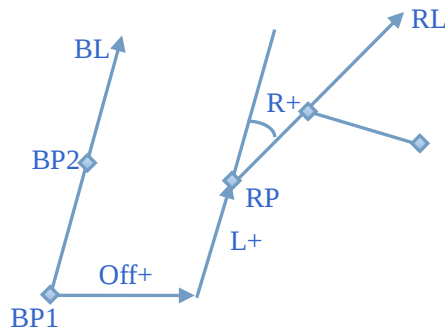

BP: Base point

BL: Base line

RP: Reference point

RL: Reference line

Off: Parallel offset

L: Longitudinal offset

R: Rotation parameter

Use navigation keys to input remotion parameter

REFERENCE LINE - MAIN		1/2
dHD :	10.400 m	
Input remotion parameter!		
Offset:	1.000 m	
Line:	0.000 m	
Height:	0.000 m	
Rotate:	22°00'00"	
NewBL	MEASURE	STAKE
		SHIFT=0

The following entries are possible:

Offset+: Parallel offset of the reference line to the right, referred to the base line (BP1-BP2).

Line+: Longitudinal offset of the reference point of the reference line in the direction of base point BP2.

Height+: Height offset. The reference line is higher than the selected reference height.

Rotate+: Rotation of the reference line clockwise around the reference point.

REFERENCE LINE - MAIN		2/2
Point 1:	A1	
Point 2:	A4	
dHD :	10.400 m	
Select ref. height		
RefH:	PT1	
NewBL	MEASURE	STAKE
SHIFT=0		

Ref.height:

Point 1:Height differences are computed relative to the height of the first base point.

Point 2:Height differences are computed relative to the height of the second base point.

Interpolated:Height differences are computed along the reference line.

No Height:Height differences are not computed and shown.


c)Decide to measure or stake out

[MEASURE] Press the key to activate Line & Offset measuring.

[STAKE] Start the application to stake out.

d)Line & Offset Measuring

The “Line & Offset” application calculates from measurements or coordinates longitudinal,parallel offsets and height differences of the target point in relation to the reference line.

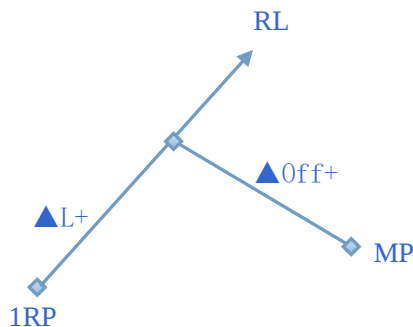

1RP:1st reference point

MP:Measured point

RL:Reference line


▲L:Longitudinal offset

▲Off:Parallel offset

LINE OFFSET MEASURE	
PtID:	A5
Rht :	2.000 m
Line:	14.346 m
Offset:	-8.380 m
VD:	-0.051 m
ENH	VIEW FIND

The calculated height difference is relative to the selected reference height (VD).

Example "relative to first reference point"

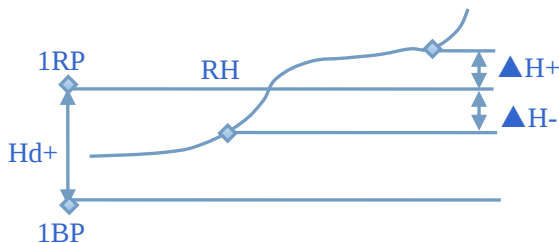

1RP:1st reference point

1BP:1st base point

RH:Reference height

Hd:Height difference between reference and base point

▲H:Height difference from reference height

e)"Stake out" application

You can enter longitudinal,transverse and height offsets for the target points to be set-out relative to the reference line. The program calculates the difference between a measured point and the calculated point. The program displays the orthogonal (Line,Offset,▲H) and the polar (dHz,dHD,dVD) differences.


Procedure:

1. Input the orthogonal stake out elements.

ORTHOGONAL ELEMENT INPUT	
Input orthogonal data !	
PtID:	A5
Rht :	2.000 m
Line:	4.000 m
Offset:	1.000 m
Height:	3.000 m
PREV	SHIFT=0 ENT

2. Press [ENT] to confirm data entry and start calculation.

Example "orthogonal Stake out"

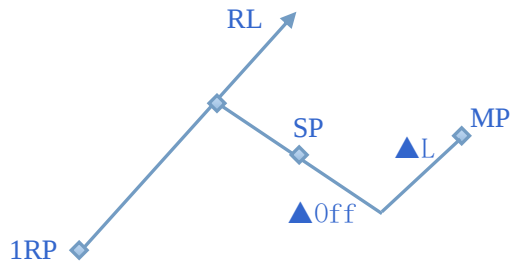

1RP: 1st reference point

MP: Measured point

SP: Stake out point

RL: Reference line

▲L: Longitudinal offset

▲Off: Parallel offset

ORTHOGONAL STAKE OUT 1/2				ORTHOGONAL STAKE OUT 2/2			
PtID:		A5		PtID:		A5	
Rht :		2.000 m		Rht :		2.000 m	
dHz :	→	126°18'55"		Line:	↓	-12.233 m	
dHD :	↑	14.229 m		Offset:	→	11.687 m	
dVD :	↑	29.936 m		▲ :	↑	29.936 m	
DIST	REC	AddPt	↓	DIST	REC	AddPt	↓


+dHz: Turn telescope clockwise to the stake out point.

+dHD: The stake out point is further away than the point measured.

+dVD: The stake out point is higher than the measured point.

② Reference Arc

This application permits the user to define a Reference Arc and then measure or stake out in relation to the arc.

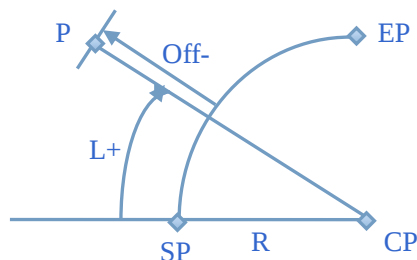

SP: Start point of arc

EP: End point of arc

CP: Centre point of circle

P: Point to stake

R: Radius of circle

L: Distance from start of arc along with the curve

Off: Vertical distance from arc


Procedure:

a) Define the arc


When starting the application you were offered two methods to define reference arc:

1 Center Point & Start Point

2 Start Point, End Point, Radius

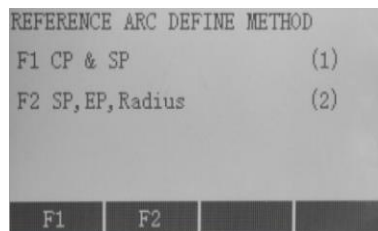

Depending on the type you have chosen, you also have to define points(like Definition of the Base line) to determine the arc and proceed.

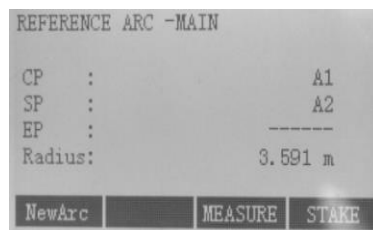


b)Decide to Measure or Stake Out

[MEASURE] Press the key to activate Line & Offset measuring.


[STAKE] Start the program to stake out.

c)"Line & Offset" Measuring

Here you can measure,select points from memory or input coordinates manually and then Line and Offset values refering to the arc will display.

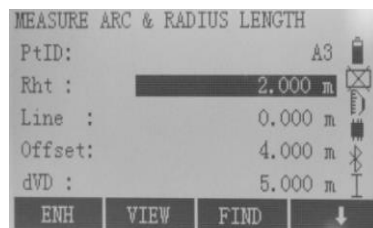

d)"Stake Out" application

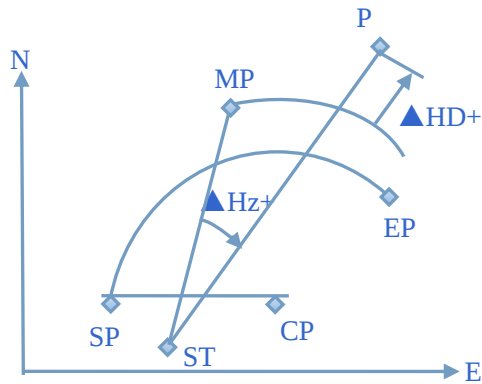

ST: Station

SP: Start point of arc

EP: End point of arc

CP: Centre point of circle

P: Point to stake out

MP: Measured point

▲Hz: Difference in horizontal angle


▲HD: Difference in distance measurement

Notably there are four ways available for this application: **Stake Out Point, Stake Out Arc, Stake Out Chord, Stake Out Angle.**

REFERENCE ARC - STAKE OUT			
F1 Stake Out Point	(1)		
F2 Stake Out Arc	(2)		
F3 Stake Out Chord	(3)		
F4 Stake Out Angle	(4)		
F1	F2	F3	F4

1 Stake Out Point

This allows to stake out a point by entering a line and an offset value.

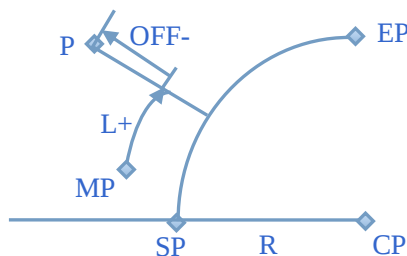

SP: Start point of arc

EP: End point of arc

CP: Centre point of circle

P: Point to stake out

MP: Measured point

R: Radius of circle


L: Line

Off: Vertical distance from arc

STAKE OUT - POINT		REFERENCE ARC STAKE OUT	
PtID:	A3	PtID:	A3
Line :	3.000 m	Rht :	2.000 m
Offset:	2.000 m	dHz :	-27°10'39"
		dHD :	14.576 m
		dVD :	32.745 m
RESET	ENT	DIST	REC AddPt

2 Stake Out Arc

This gives possibility to stake out a series of equidistant points along with the arc.

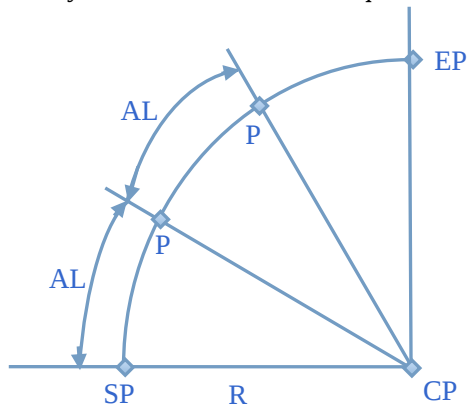

SP: Start point of arc

EP: End point of arc

CP: Centre point of circle

P: Point(s) to stake out

AL: Arc length

STAKE OUT - ARC		REFERENCE ARC STAKE OUT	
PtID:	A3	PtID:	A3
Misclosure:	Start Point	Rht :	2.000 m
Arc Length:	8.000 m	dHz :	108°22'59"
Line :	14.561 m	dHD :	14.576 m
Offset:	0.000 m	dVD :	32.745 m
RESET	PT- PT+ ENT	DIST	REC AddPt


If the input arc length is not an integer of the whole arc, there will be a closure. And three distribution ways are provided: Start Point, End Point and Average.

[1] Start Point: All of the closure will be added to the first segment of arc.

- [2] End Point: All of the closure will be added to the last segment of arc.
- [3] Average: The closure will be equally distributed among all segments.
- [4] Arc Length: Input the length of the arc-segment which you want to stake out.
- [5] Line: Display the line-value of the stake out point. This is calculated by the arc length and the selected closure distribution.
- [6] Offset: Input the offset value here.
- [7][RESET]: Set all values to 0.
- [8][PT +][PT -]: Toggle through the calculated stake out points.
- [9][ENT]: Proceed to Stake Out display.

3 Stake Out Chord

This allows to stake out series of equidistant chords along with the arc. The contents and the softkey functions are the same as described in "Stake Out Arc" section.

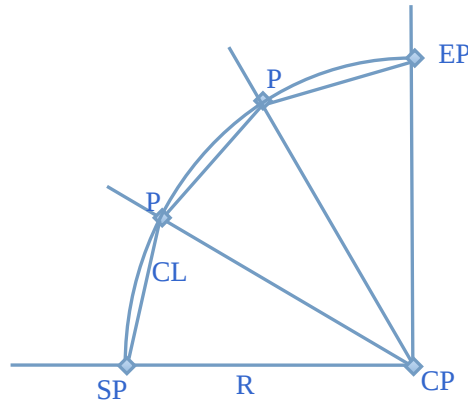


CL: Chord length

STAKE OUT - CHORD		REFERENCE ARC STAKE OUT	
PtID:	A3	PtID:	A3
Misclosure:	Start Point	Rht :	2.000 m
Chord Length:	4.000 m	dHz :	→ 30°51'35"
Line :	5.591 m	dHD :	↑ 14.576 m
Offset:	0.000 m	dVD :	↑ 32.745 m
RESET	PT-	PT+	ENT
		DIST	REC
		AddPt	↓

4 Stake Out Angle

This allows to stake out series of angles which are determined by the points of arc and whose values are equiangular. The contents and the softkey functions are the same as described in "Stake Out Arc" section.

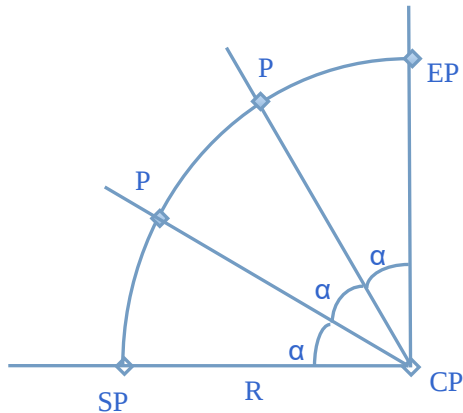


α :Angle

STAKE OUT - ANGLE				REFERENCE ARC STAKE OUT			
PtID:	A3	Misclosure:	Start Point	PtID:	A3	Rht :	2.000 m
Angle:	20°00'00"	Line :	1.253 m	dHz :	←	-48°00'37"	
Offset:	0.000 m	dHD :	↑	14.576 m	dVD :	↑	32.745 m
RESET	PT-	PT+	ENT	DIST	REC	AddPt	↓


5)Tie Distance

The application calculates slope distance, horizontal distance, height difference and azimuth of two target points measured in real time, selected from Memory or entered using the Keypad.


The instrument can accomplish this in two ways: Polygonal (A-B, B-C), Radial (A-B, A-C)

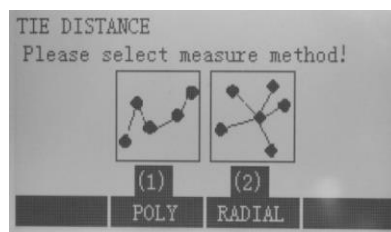

①Polygonal Method(A-B, B-C):Measurement is A-B, B-C, C-D,

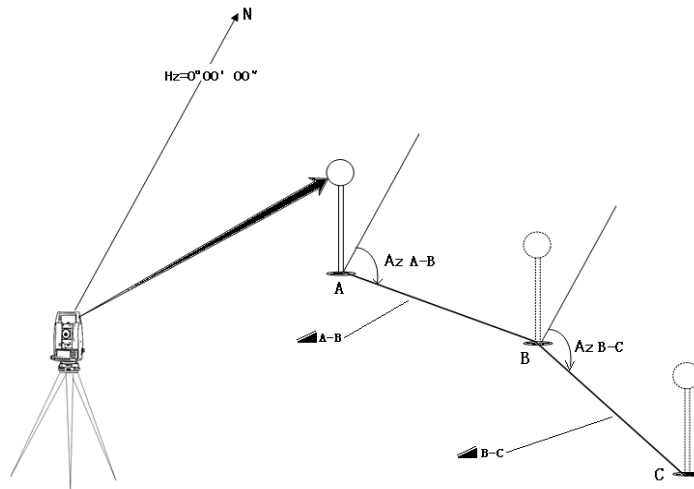

② Radial (A-B, A-C): Measurement is A-B, A-C, A-D,

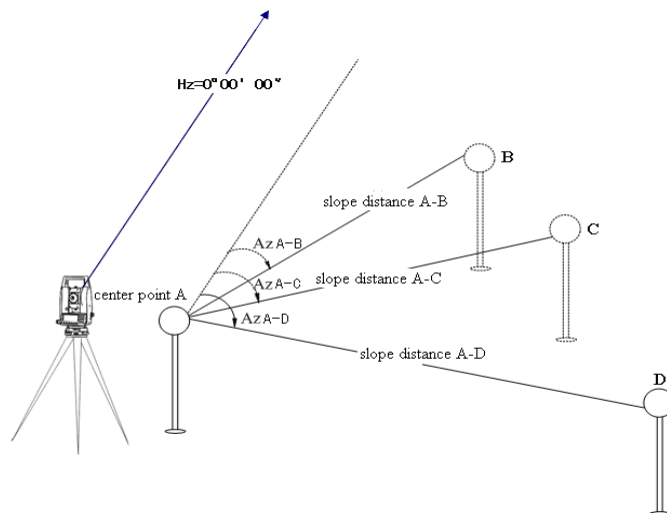

Procedure of Polygonal Method (A-B, B-C) is nearly the same as Radial (A-B, A-C) Method. Any differences will be described.

Procedure(same):

a) Determine the first target point.

[ALL] Start measuring the target point.

[FIND] Search for certain entered point from memory.

b) Determine the second target point.

Proceed as with the first target point.

c) Result is displayed.

TIE DISTANCE RESULT		1/2	TIE DISTANCE RESULT		2/2
Point 1:	A1		Point 1:	A1	
Point 2:	A2		Point 2:	A2	
Gradient:	100.0 %		HzCor:	90°00'00"	
dSD :	1.414 m				
dHD :	1.000 m				
dVD :	1.000 m				
NewTie	NEWP	RADIAL	NewTie	NEWP	RADIAL

HzCor:Azimuth between point1 and point2.

dSD:Slope distance between point1 and point2.

dHD:Horizontal distance between point1 and point2.

dVD:Height difference between point1 and point2.

Gradient:Grade [%] between point1 and point2.

Softkeys(different):

In polygonal method:

NewTie:An additional missing line will be computed.Program starts again(at point 1).

NEWP:Point 2 is set as starting point of a new missing line.Program starts from point 2.

RADIAL:Switch to radial method.

In radial method:


[CentPt] Determine new centre point.

[RadPt] Determine new radial point.

[POLY] Switch to polygonal method.

6)Area & Volume

The application is used to calculate areas of points connected by straights in real time.The target points can be measured in real time,selected from memory or entered via keypad.

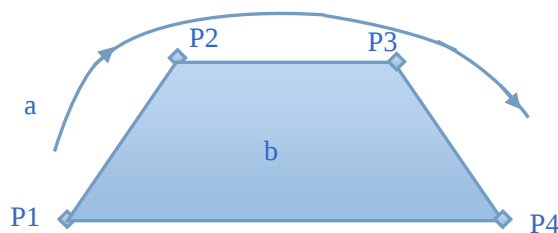

P0:Station

P1:Start point

P2:Target point


P3:Target point

P4:Target point

a:Perimeter,polygonal length from start point to the current measured point.

b:Calculated area always closed to the start point.

The calculated area is projected onto the horizontal plane (2D) or projected onto the sloped reference plane defined by 3 points (3D). Furthermore a volume with constant height can be calculated with respect to the area (2D/3D).

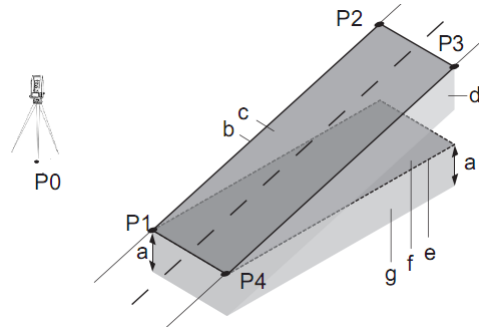

P0:Station

P1:Target point which defines the sloped reference plane

P2:Target point which defines the sloped reference plane

P3:Target point which defines the sloped reference plane

P4:Target point

a:constant height

b:Perimeter (3D), polygonal length from the start point to the current measured point of the area (3D)

c:Area (3D), projected onto the sloped reference plane

d:Volume (3D) = $a \times c$

e:Perimeter (2D), polygonal length from the start point to the current measured point of the area (2D)

f:Area (2D), projected onto the horizontal plane

g:Volume (2D) = $f \times a$

Procedure:

① Determine area points

[ALL]:Start the measurement to the point.

[FIND]/[LIST]:Search for point from internal memory.

[ENH]:Input the coordinates manually.

[DecPt]:Undo measurement or selection of last point.

② Results

[Def. 3D]:Define the sloped reference plane by selecting or measuring three points.


[VOLUME]:Calculate a volume with constant height which has to be input or measured.

[COMPUTE]:Display and record additional results (perimeter, volume).

7)Remote Height

The Remote Height program calculates the height difference of a remote object relative to

ground. When using a prism height, the measurement will start from the prism (reference point). If no prism height is used, the measurement will start from any reference point in which the vertical angle is established. In both modes, the reference point should be perpendicular to the remote object.

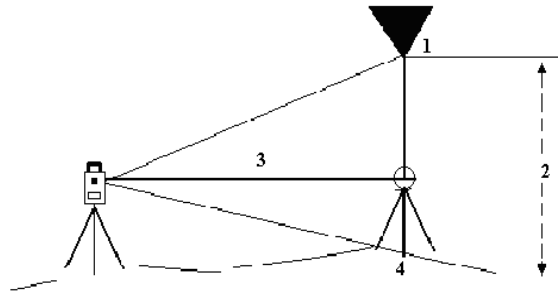

- 1) Remote point
- 2) Height difference
- 3) Slope distance
- 4) Base point

Procedure:

① Input BP and prism height

[ALL]: Start measuring base point and proceed to procedure 2.

[Hr?]: Start the program that determines an unknown prism height.

1.1 [ALL]: Start measuring base point.

1.2 Aim at top of prism and confirm with [ENT].

② Aim at inaccessible remote point

[SAVE]: Save the measured data.

[BasePt]: Input and start measuring a new base point.

8) Construction

This application allows defining a construction site by combining set-up of the instrument along with a construction line, measuring and stake out points relative to the line. After starting this program, there will be four options provided: Set Job, Set EDM, New construction site, Continue previous site.

Procedure:


New construction site:

① Measure start point of this construction line.

② Measure second end point of this construction line.

Check display:

This dialog shows you the Line, Offset and dVD (Height of a measured point in relation to the line).

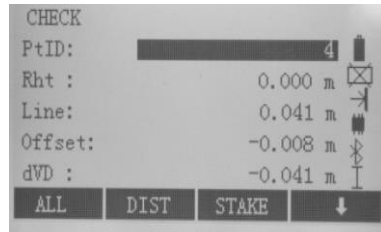

[MAxis]:Allow you to input values for shifting the line.

[STAKE]:Switch to stake out mode.


Note: “Line” is positive:Measured point is in the direction from line start point to line end point.

“Offset” is positive:Measured point is on the right of this line.

“dVD” is positive:Measured point is above line start point.

Stake out display:

Here you can search or enter points for setting out related to the measured line.

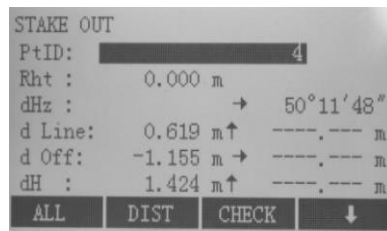

[MAxis]:Allow you to input values for shifting the line.

[Check]:Switch to check mode.

The figure shows you the position of the prism in relation to the stake out point.Furthermore,the accurate values are displayed,combined with the arrows indicating the direction.

“d Line” is positive (arrow up):Target point is further away than the measured point.


“d Off” is positive (arrow right):Target point is on the right of the measured point.

“dH” is positive (arrow up):Target point is higher than the measured point.


9)2D-Road

Procedure:


① Start the program “2D-Road” and access the below display.Then finish job,station and orientation settings continuously.

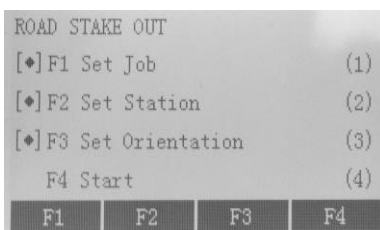

②Press F4 to enter into Road Menu which includes Road Define,Road Stake Out,Data View and Data Transfer.

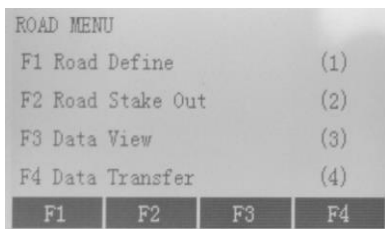


③Choose softkey F1 or numberkey 1,and then display Road Define dialog.

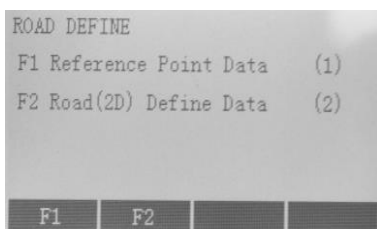


a)Reference Point Data

Point here means reference point(control point) including each grade of known plane point and known elevation point that can be used for setting station and orientation.In the dialog of Reference Point View,existed control points only can be available for scan and deletion but not edit.

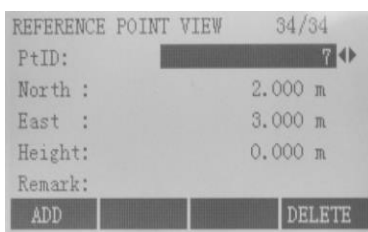

[ADD]:Input of new reference point,as shown in the below figure.

[DELETE]:Delete current displayed reference point and the erased data can't resume.

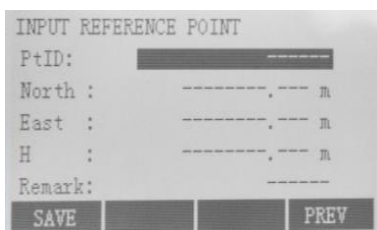


[SAVE]:Save the new input of reference point.

[PREV]:Return Road Define dialog.

Note:Under inputting reference point mode,press the fixed key [ESC] to withdraw and return Reference Point View dialog.


b)Road(2D) Define Data

This application is used to describe and determine road centerlines.As shown,there are two models available for definition of road(2D):Main Point,Intersection Point.

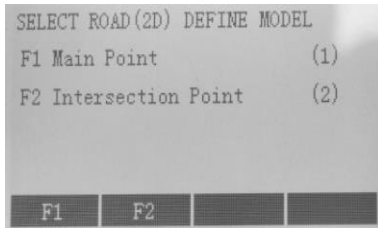


[1] Main Point

This application utilizes main point information relative to the line to describe the entire road.Main point is the key point where the linetype changes along with the line.It includes start point,end point and so on.This method can solve any complicated linetype including ramp.In the dialog of View Road(2D)-Main Point,existed main points only can be available for scan and deletion but not edit.

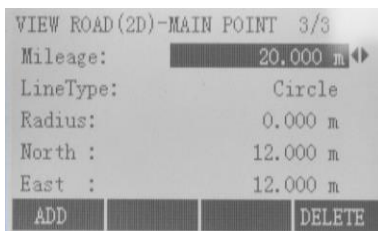

[ADD]:Input of new main point,as shown in the below figure.

[DELETE]:Delete current displayed main point and the erased data can't resume.

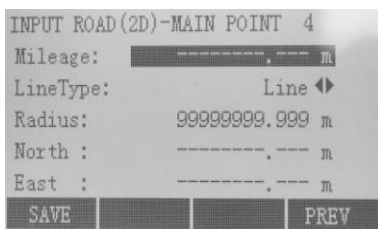

[SAVE]:Save the new input of main point.

[PREV]:Return Road Define dialog.


Note:Under main point inputting mode,press the fixed key [ESC] to withdraw and return View Road(2D)-Main Point.

Display Content:

Mileage:The stake mark of mainpoint on the road centreline.Within the input format can not be included certain characters “K”、“k” and “+” etc.For example,2224.224 can be input instead of K2+224.224.

LineType:The litype of route preceding main point(Big stake mark direction) can be selected from four options:Line,Circle(Round Curve),Spiral(Easement Curve) and End Point.

Radius:Except the end point of route,the “Radius” of any point represents the radius of curvature(“R” in the below figure) of one side preceding main point(Big stake mark direction).When route turns left,the radius will be negative;Conversely,the radius will be positive.When radius of curvature is infinite,the radius value should be set to:99999999.999 or -99999999.999.

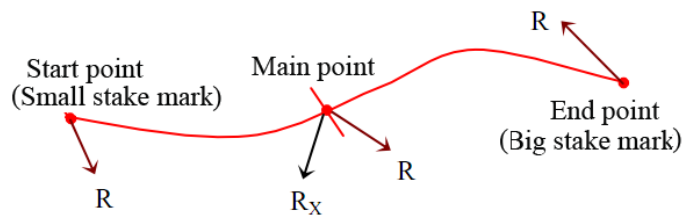


North:Ordinate of main point

East:Abscissa of main point

[2] Intersection Point

This application is to describe the entire road with informaiton of intersection point of the route.This method is appropriate for the linetype whose intersection points are symmetrical,and start point and end point of the route must be on the straight line segment or its vertex points.That intersection points are symmetrical means their corresponding tangent lines are equilong.In the dialog of View Road(2D)-Intersection,existed main points only can be available for scan and deletion but not edit.

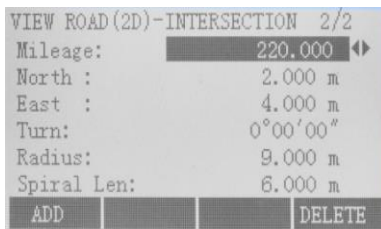

[ADD]:Input of new intersection point,as shown in the below figure.

[DELETE]:Delete current displayed intersection point and other intersection points whose mileage is larger than the current one,the erased data can't resume.It's worth noting that,different from main point method,pressing [DELETE] key may lead to erasion of several intersection points.

INPUT ROAD(2D)-INTERSECTION 3

Mileage: _____ m

North : _____ m

East : _____ m

Turn: _____ °

Radius: _____ m

Spiral Len: _____ m

SAVE PREV

[SAVE]:Save the new input of intersection point.

[PREV]:Return Road Define dialog.

Note:Under intersection point inputting mode,press the fixed key [ESC] to withdraw and return View Road(2D)-Intersection.

Display Content:

Mileage:The stake mark of intersection point.Within the input format can not be included certain characters “K”、“k” and “+” etc.For example,2224.224 can be input instead of K2+224.224.

North:Ordinate of intersection point

East:Abscissa of intersection point

Turn:Turn angle of one intersection point relative to the route(Turn angles of start point and end point should be set to 0).

Radius:The radius of curvature of circular curve corresponding to intersection point. When route turns left,the radius will be negative;Conversely,the radius will be positive.At the place of start point and end point of route,the curvature radius value must be set to:99999999.999 or -99999999.999.

Spiral len:Easement curve length relevant to intersection point.Set to 0 in the situation where there's no easement curve.

Note:1.When using intersection point method,input data successively in accordance with mileage(small to large) of intersection point.And the first and the last intersection point must be on the straight line segment of the road centreline.

2.When using main point method,you can input data out of accordance with mileage of main point,but don't miss out any main point finally.It's recommended to input data successively according to mileage magnitude in support of check and verification.

3.The datum input with main point method can't be viewed and edited in the form of intersection point method,i.e.,intersection point method will be disabled if import in the form of main point;But differently the datum entered in the form of intersection point can be viewed and added in the form of main point,except for deletion.

4.Affected by precision of turn angle,there may exists deviation in main point datum converted by intersection point datum.

5.No matter what kind of method(main point or intersection point) you choose,normal stake out and measuring can be executed based on the requirement of input


of at least two valid records(two valid main points or intersection points).

6.It is advisable to input data with main point method and directly upload plane alignment data to instrument with desktop tool.The plane alignment data uploaded directly can't be viewed and edited in the form of intersection point.

7.No matter what kind of method(main point or intersection point),its maximum mileage mustn't be greater than 4294000.000m,i.e.,the route's maximum mileage mustn't be more than K4294+000.000m.


④Road Stake Out

Choose softkey F2 or numberkey 2,and then display Road Stake Out dialog.As shown,this function is mainly used to realize Peg Stake Out and Transect Measure.

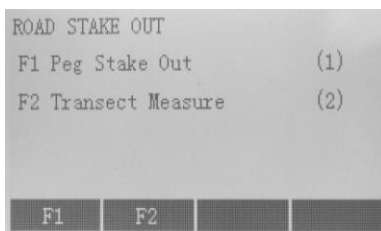

a)Peg Stake Out

On “Road Stake Out” display,press softkey F1 or numberkey 1 to access “Peg Stake Out” dialog.Before stake out,as required press “PAGE” key and switch to the second page in order to set “Stake Distance”,“Offset” and “Deviation Angle”.

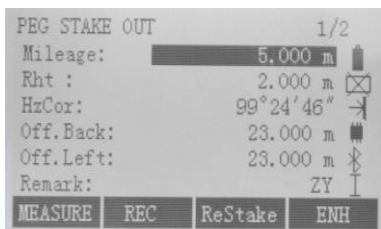

[MEASURE]:Measuring distance and angle.

[REC]:Save stake out result,and make stake mark increase by stake distance.

[ReStake]:Make stake mark decrease by stake distance.

[ENH]:Access “Stake Out Point Coordinates” dialog,and view design coordinates of point to be stake out.

Display Content:

Mileage:The stake mark of point to be stake out.Within the input format can not be included certain characters “K”、“k” and “+” etc.For example,2224.224 can be input instead of K2+224.224.

Rht:Input the accurate prism height before measuring.


Hxcor:Included angle between current collimation axis direction and theoretical

direction(point to the point to be stake out).That this value becomes 0 means the instrument points to the point to be stake out.

Off.Back:Take the direction where prism worker faces the instrument as reference direction.And if the value is positive,prism worker should be aloof from the instrument.Conversely,prism worker should be close to the instrument.

Off.Left:Take the direction where prism worker faces the instrument as reference direction.And if the value is positive,prism worker should move left.Conversely,prism worker should move right.

Remark:Simple description of the current point.

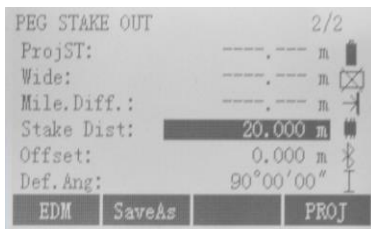

[EDM]:Switch to “EDM Settings” dialog.

[SaveAs]:Store current measured point as reference point(control point) whose name is current mileage.

[PROJ]:Set mileage as current **ProjST**(projection stake).This function is useful when add stakes on terrain or surface features to set out.

Display Content:

ProjST:Stake mark corresponding to current measured point projected onto route centreline.

Wide:Distance of offset that current measured point deviates from centreline.

Mile.Diff:Difference between ProjSt and Mileage.


Stake Distance:Mileage increment when stake out.And this value will be negative when stake out from big stake mark to small stake mark.

Offset:Distance between the point to be stake out and its corresponding mileage of centreline(Not always the perpendicular distance from stake out point to centreline).That this value is 0 indicates middle-stake.But if this value is negative,it means left side-stake;Otherwise,it means right side-stake.

Def.Ang(Deviation Angle):Included angle generated from centreline and connecting line between the point to be stake out and its corresponding mileage of centreline.And its range is $(0, \pi)$.It's necessary to refer to deviation angle when set out particular point(such as bridge pier) and side-stake whose connecting line is not orthogonal but intersected with the route.

Specific meaning with respect to **Stake Distance**,**Offset** and **Deviation Angle** is

shown in the below figure:

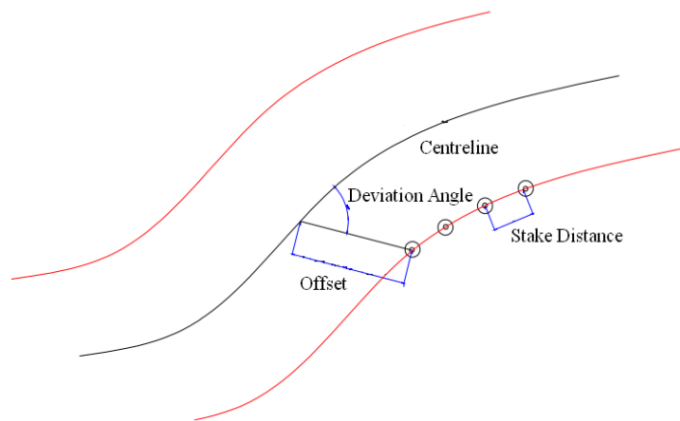


Note: 1. Make sure **Offset**, **Deviation Angle** and **Stake Distance** are set correctly when peg stake out.

2. With the increment of main point datum of plane alignment, running speed of certain links during peg stake out can be slowed down.

3. Peg stake out result can be used as transect measure result.

b) Transect Measure

On “Road Stake Out” display, press softkey F2 or numberkey 2 to access “Transect Measure” dialog.

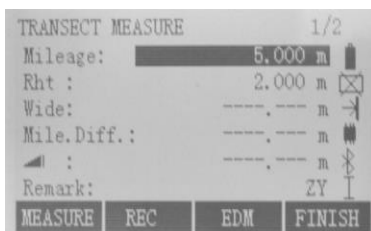

[MEASURE]: Measuring distance and angle.

[REC]: Save current measurement result.

[EDM]: Switch to “EDM Settings” dialog.

[FINISH]: Complete current transect measuring, and make mileage successively increase to next transect by stake distance.

Display Content:

Mileage: Stake mark corresponding to transect to be measured.

Rht: Input the accurate prism height before measuring.

Wide: Distance of offset that current measured point deviates from centreline.

Mile.Diff: It means the one that is the projection onto current sideline of difference between mileage corresponding to current measured point and specified mileage. The

value will be positive if mileage corresponding to current measured point is greater than specified mileage; Conversely, it is negative. Prism worker can move the prism to specified transect according to this field value.

▲: The height difference between current measured point and the last one.

Remark: It can be used when saved as reference point, and its simple description of the reference point to be stored.

TRANSECT MEASURE 2/2

Stn Mileage:	-----	m	⊗
North :	-----	m	⊗
East :	-----	m	⊗
Height:	-----	m	⊗
Stake Dist:	20.000	m	⊗
HZCor:	0°00'00"		⊗

MEASURE SaveAs

[SaveAs]: Store current measured point as reference point (control point) whose name is Stn Mileage.

Display Content:

Stn Mileage: Stake mark of current occupied point (station); (When save as, this field will be made as point number).

North: Ordinate of current measured point.

East: Abscissa of current measured point.

Height: Elevation of current measured point.

Stake Distance: Mileage increment when transect measuring. And this value will be negative when measuring from big stake mark to small stake mark.


HZCor: Included angle between current collimation axis direction and “normal” direction of mileage of occupied point which is perpendicular to the transect route. If measuring the transect where occupied point lies, adjust this angle to 0 degree or 180 degrees.

Note: 1. During stake out and measuring, if the elevation of occupied point is unknown, this value will be defaulted to “-9999.000” meters.

2. During transect measuring, if current measured point is not within the control of plane alignment, valid width and mileage difference can't be calculated, thus this measured point will not be saved.

⑤ Data View

Under Road Menu, choose softkey F3 or numberkey 3, and then display “Road Data View” dialog. As shown, this function is to realize data view of peg stake out and transect measure. All the results can be available for scan and deletion but not edit and modification.

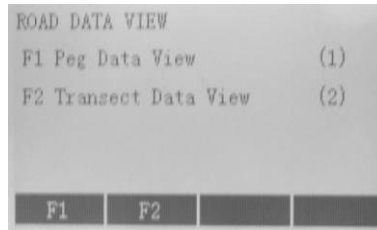

a) On “Road Data View” display, press softkey F1 or numberkey 1 to access “Peg Data View” dialog.

[PREV]: Return “Road Data View” dialog.

[CLEAR]: Delete all results of peg stake out in current job. Deleted data can’t resume.

[DELETE]: Delete current displayed records. Deleted data can’t resume.

Display Content:

Mileage: Mileage of specified stake out point.

Offset: Distance of offset that specified stake out point deviates from centreline, namely, “Offset” on “Peg Stake Out” display.

North: Ordinate of actual measured point.

East: Abscissa of actual measured point.

Height: Elevation of actual measured point.

Remark: Simple description of actual measured point.

b) On “Road Data View” display, press softkey F2 or numberkey 2 to access “Transect Data View” dialog.

[PREV]: Return “Road Data View” dialog.

[CLEAR]: Delete all results of transect measure in current job. Deleted data can’t resume.

[DELETE]: Delete current displayed records. Deleted data can’t resume.

Display Content:


Mileage: Mileage corresponding to the transect.

Wide:Distance of offset that cross-sectional point deviates from centreline.

H:Actual elevation of this measured point.

⑥Data Transfer

Under Road Menu,choose softkey F4 or numberkey 4,and then display “Data Transfer” dialog.This function is to realize known data uploading(Control point and Plane alignment) and results downloading of stake out and measuring.

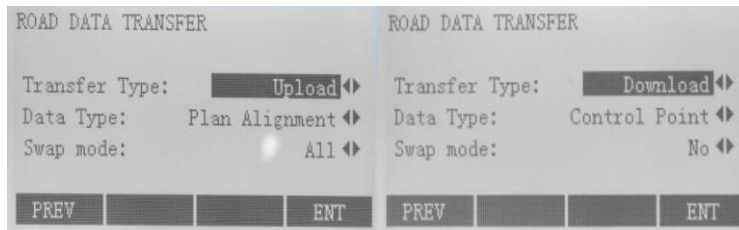

As shown,transfer type contains two options:Upload,Download.Upload:It helps to upload data to total station via PC.And this operation is only appropriate for known data(Control point and Plane alignment);Download:It helps to send data to PC via total station,and this operation is appropriate for all types of data.

Data type contains four options:Control point,Plane alignment,Cross-sectional and Stake out Results.

Swap mode only includes two choice:All,No.All:It'll delete the same types of all existed data in current job.No:It won't delete the same types of existed data.

Note:When selecting upload,swap mode will be limited to All.It's recommended that better download original data and backup them before uploading.When selecting download,swap mode will be limited to No.

10)Lead Measure

This application is used for survey of hierarchical control traversing and mapping traversing etc. and adjustment and computation of closure.

①Introduction

a)fundamental

- Station distribution method(closure adjustment method of azimuth)
- Distance distribution method(closure adjustment method of coordinate)

b)Applied Characteristics

[1]Program Capacity

- Six sets of observation is upper limit to every survey station.
- The maximum number of observing directions is 2 as for survey station(i.e. only traverse point measuring supported except for branch point measuring).
- The maximum number of survey stations is 30 as for single lead.

[2] Available lead type



Point whose coordinate is known



Side whose azimuth is known

 


Point whose coordinate is unknown




Side whose azimuth is unknown


I .Coordinates of occupied point and backsight point of the first survey station are known,so are coordinates of occupied point and foresight point of the last survey station.



II .Coordinates of the first traverse point(point 1) and the last one(point 5) on the lead are known.

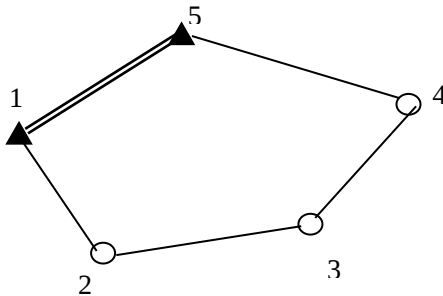


III.Coordinates of the first traverse point(point 1) on the lead and another point(point 0) off the lead are known.

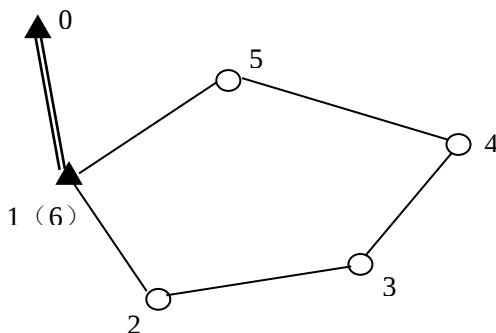

Note:As to this type of traverse measuring,the last survey station must be measured again on where point 1 is,but occupied point can't be set to point 1,otherwise this operation will make measurements of the first survey station covered.For example,occupied point of the last survey station can be set to point 6 whose coordinate inputting is the same as point


1's.

IV.Coordinates of occupied point and backsight point of the first survey station are known,namely,it's open(branch) traverse as shown in below figure.

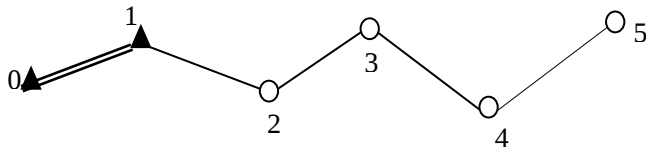


②Procedure

a)As shown,press F1 to set job.After job prepared,back to start-up display.

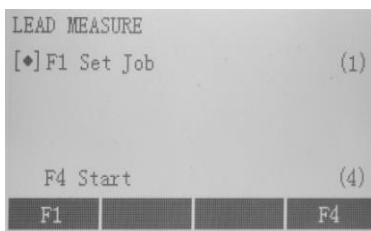


b)Press F4 to start operation of lead measure.It contains two pages,as shown,through which you can toggle by “PAGE” key.

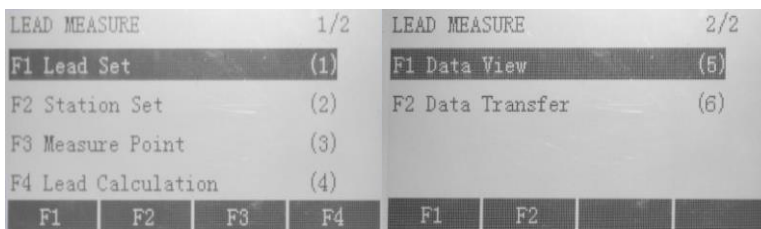

[1]Lead Set

On the first page of “Lead Measure” press F1 to activate lead setting which consists of three pages.

At first input “Lead Name”,“Lead Desc” and “Meas Num”.

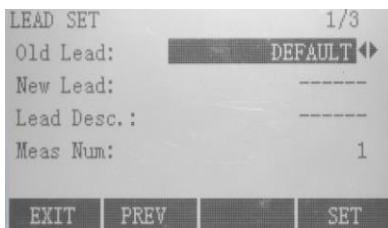

Display Content:

Old Lead:Existed old lead name.

New Lead:New lead name.

Lead Desc:Lead Description.

Meas Num:The number of observation sets.

Next,press “PAGE” key or “SET” key to proceed.On the second page,you can input “First Stn”,“Lead Bs Pt” and “Start Brg”.After inputting press “SET” key to quit “Lead Set” dialog and return “Lead Measure” dialog.

LEAD SET 2/3
Lead Name: DEFAULT
First Stn: A1
Lead Bs Pt: A2
Start Brg: 62°22'36"
EXIT PREV SET

Display Content:

Lead Name:Determined lead name.

First Stn:The first survey station.

Lead Bs Pt:Lead backsight point.

Start Brg: Initial azimuth.

Note:1.When moving screen cursor to “First Stn” and “Lead Bs Pt” in order to import point name,you can press “ENT” key to search and determine the point you need,as shown.

SEARCH POINT
Job : 123
PtID: A1
Select job or manual input!
SEARCH SHIFT=0 ENH

[SEARCH]:To search existed known point.

[SHIFT=0]:To set all coordinates to 0.

[ENH]:To input coordinates,as below figure shows.

If the point is known point,it will display like this:

SEARCH POINT
A1 Known
A1 Measure
A1 Measure
A1 Measure
VIEW ENH JOB ENT

2.It is allowable to delay inputting coordinates of the first station and lead backsight point for the moment.And you can proceed with “Station Set” and “Measure Point” followed by “Lead Calculation” before which continue entering coordinates of the first

station and lead backsight point on “Lead Set” dialog. This function is convenient for field survey where lead measure can go on in certain case that coordinates of known point can’t be attained temporarily.

3. In addition, if continuing unfinished lead, you can select the lead which needs proceeding on the first page of “Lead Set” dialog, then end lead setting by pressing “SET” key.

Step three, press “PAGE” key to set tolerance on the third page, as shown.

LEAD SET		3/3
Lead Name:	DEFAULT	
V_Obs_Tol.:	0°00'10"	
Vindex Tol.:	0°00'10"	
Hz_2c_Tol.:	0°00'18"	
Hz_Obs_Tol.:	0°00'12"	
EXIT	PREV	SET

Display Content:

Lead Name: Determined lead name.

V_Obs_Tol: Discrepancy tolerance of vertical angles among observation sets.

Vindex Tol: Discrepancy tolerance of vertical index error.

Hz_2c_Tol: Discrepancy tolerance of horizontal collimation error C.

Hz_Obs_Tol: Discrepancy tolerance of horizontal angles among observation sets.

Note: Horizontal angle defaults to tolerance of engineering first-order traverse, and vertical angle defaults to tolerance of the fifth class triangular elevation.

[2] Station Set

On the first page of “Lead Measure” dialog press F2 to activate station setting, as shown.

STATION SET	
Known Stn:	
New Stn:	A1
Hi:	0.000 m
BsPt:	A2
Point:	
PREV	SET

Display Content:

Known Stn: Known survey station.

New Stn: New survey station.

Hi: Height of instrument.

BsPt: Backsight point.

Point: Foresight point.

Note: 1. Here foresight point must be input. Then press “SET” key to finish station setting and return “Lead Measure” dialog. It's worth noting that instrument height is defaulted to 0. And you must input accurate “Hi” before pressing “SET”, otherwise the buzzer sounds

and proceeding operation is impossible.

2.If mistake is found after station setting succeeds,you need to press “ESC” key to quit the entire program and reenter.

[3]Measure Point

On the first page of “Lead Measure” press F3 to access “Measure Lead Point” dialog which consists of three pages,as shown.

MEASURE LEAD POINT 1/3		MEASURE LEAD POINT 2/3	
Station:	A1	ObsPt:	A2
ObsPt:	A2	Rht :	0.000 m
Rht :	0.000 m	Meas Num:	1
Meas Num:	1	V :	37°46'21"
Hz :	56°35'01"	North :	m
V :	37°46'21"	East :	m
		H :	m
ALL	DIST	REC	ORI

MEASURE LEAD POINT 3/3	
ObsPt:	A2
Rht :	0.000 m
Meas Num:	1
North :	m
East :	m
H :	m
ALL	DIST
REC	ORI

Display Content:

Station:Current survey station.

ObsPt:Observed point.

Rht:Prism height.

Meas Num:The number of observation sets.

Hz:Horizontal angle.

V:Vertical angle.

North:Ordinate of measured lead point.


East:Abscissa of measured lead point.

H:Elevation of measured lead point.

A popup dialog displays after semiobservation:

MEASURE LEAD POINT 1/3	
Please turn face!	

A popup dialog displays after one observation set:

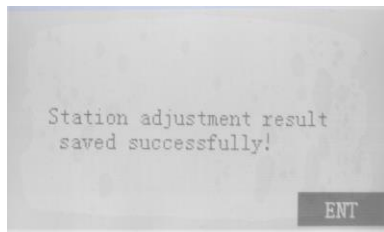


Note:1.Prism heights of foresight and backsight must be input during the first semiobservation of the first observation set.It's worth noting that these prism heights are defaulted to 0.And you must input accurate “Rht” before pressing “DIST” or “ALL”,otherwise the buzzer sounds and proceeding operation is impossible.

2.All foresight observed points need distance measuring unless foresight points are known.Distance measuring of backsight points can be ignored,but it is proposed.


[4]Lead Calculation

Repeat “Station Set” and “Measure Point” until all station surveys are complete.Thus lead calculation can be carried on.

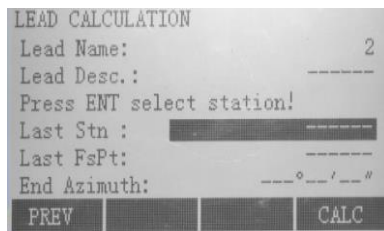


Similar with “Lead Set”,when moving screen cursor to “Last Stn” and “Last FsPt”,you can press “ENT” key to search the point you need or input coordinates.

Note:1.If the lead belongs to branch traverse,directly press “CALC” key to compute coordinates of each lead point of branch traverse.

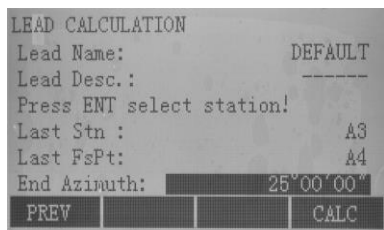

After pressing “CALC”, a dialog about lead closure will eject.

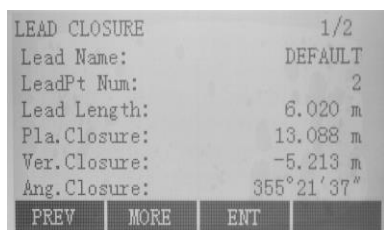

Press “PAGE” to switch to page 2,as shown.

LEAD CLOSURE		2/2
Lead Name:	DEFAULT	
dX/N:	-9.070 m	
dY/E:	-9.436 m	
dH :	-5.213 m	
P_Precision:	0.460	
V_Precision:	1.155	
PREV	MORE	ENT

Press “more” to check “calculation results”,especially coordinates of each lead point after computing.

ADJUSTMENT RESULTS	
Point:	◀▶
North :	0.000 m
East :	0.000 m
Height:	0.000 m
PREV	ENT

Note:

◀▶:With the function key,scroll between observed points.

[5]Data View


Press “PAGE” button to switch to page 2 of “Lead Measure”,and then select “F1” or “5” to enter into “Data View” where you can know about information according to the lead you choose.

VIEW	
Lead Name:	DEFAULT ▶◀
VIEW	

VIEW		1 ▶◀
Type:	Lead_Info	LEAD MEAS
Lead Name:	DEFAULT	
Lead Desc.:	-----	
Meas Num:	1	
Vindex Tol.:	0°00'10"	
EXIT		

[5]Data Transfer

Press “PAGE” button to switch to page 2 of “Lead Measure”,and then select “F2” or “6” to enter into “Data Transfer” where you can send data to PC.

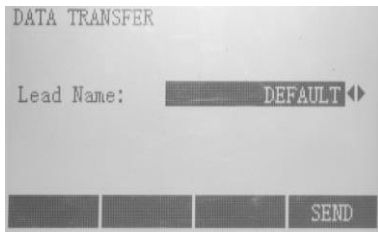

11) COGO

COGO is an application program to perform coordinate geometry calculations such as:

- coordinates of points
- bearings between points
- distances between points

The COGO calculation methods are:

- Inverse
- Intersection
- Traverse

Softkeys:

[MEAS]:Jump to the Measurement dialog to measure the point.

[Calc]:Start the calculation,when all required data are entered.

[STAKE]:When the calculated point is displayed you have the option to stake out this point directly.

① Inverse & Traverse

Inverse:

Known

P1 First known point

P2 Second known point

Unknown

α Direction from P1 to P2

d1 Slope distance between P1 and P2

d2 Horizontal distance between P1 and P2

d3 Height difference between P1 and P2

Traverse:

Known

P1 Known point

α Direction from P1 to P2

d1 Distance between P1 and P2

d2 Positive offset to the right

d3 Negative offset to the left

Unknown

P2 COGO point without offset
P3 COGO point with positive offset
P4 COGO point with negative offset

② Intersections

Bearing - Bearing

Known

P1 First known point

P2 Second known point

α 1 Direction from P1 to P3

α 2 Direction from P2 to P3

Unknown

P3 COGO point

Bearing - Distance

Known

P1 First known point

P2 Second known point

α Direction from P1 to P3 and P4

r Radius, as defined by the distance from P2 to
P4 and P3

Unknown

P3 First COGO point

P4 Second COGO point

Distance - Distance

Known

P1 First known point

P2 Second known point

r1 Radius, as defined by the distance from P1 to
P3 or P4

R25 Radius, as defined by the distance from P2 to
P3 or P4

Unknown

P3 First COGO point

P4 Second COGO point

By Points

Known

P1 First known point

P2 Second known point

P3 Third known point

P4 Fourth known point

a Line from P1 to P2

b Line from P3 to P4

Unknown

P5 COGO point

Offset

Distance - Offset

Known

P1 Baseline start point

P2 Baseline end point

P3 Lateral point

Unknown

a Difference in length/abzissa (HD)

b Lateral deviation/ordinate (Offset)

P4 Base point

Set Point by ...

Known

P1 Baseline start point

P2 Baseline end point

a Difference in length/abzissa (HD)

b Lateral deviation/ordinate (Offset)

Unknown

P3 Lateral point

Extention

The "Extention" routine computes extend point from base line.

Known

P1 Baseline start point

P3 Baseline end point

☐ L1 or ☐ L2 Distance

Unknown


P2, P4 Extended point

5 Settings

1) Contrast

It's possible to set the same contrast as in the above star settings.

2) USER Key

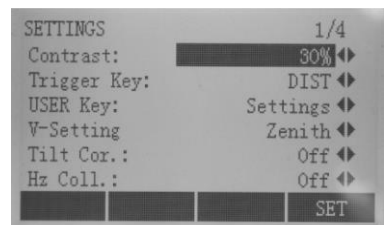

Press left or right direction keys to adjust it. Each function from the [FUNC] menu can be set as the [USER] key, which makes [USER] key on keypad act as a shortcut key.

3) V-setting

The "0"- orientation of the vertical circle can be either selected for the zenith, the horizontal plane or in %.

Zenith: Zenith=0°, Horizontal=90°

Horizon: Zenith=90°, Horizontal=0°

V-(%): 45°=100%, Horizontal=0°

4) Tilt Correction

It's possible to set the same tilt correction as in the above star settings.


5) Horizontal Collimation

Press left or right direction keys to adjust it.

On: Hz Collimation is switched ON.

Off : Hz Collimation is switched OFF.

If Hz Collimation is On, each measured Hz-angle is corrected (depending on V-angle). For normal operation the Hz-collimation remains switched on.

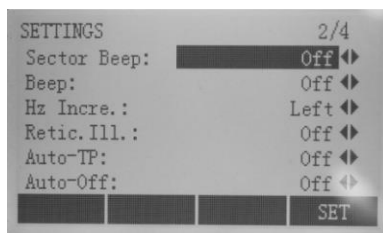

6) Sector Beep


Press left or right direction keys to adjust it.

Off: Sector Beep switched off.

On: Sector Beep sounds at right angles (0°, 90°, 180°, 270° or 0, 100, 200, 300 gon)

Example Sector Beep:

From 95.0 to 99.5 gon (or from 105.0 to 100.5 gon) a "Fast beep" sounds while from 99.5 to 99.995 gon (or from 100.5 to 100.005 gon) a "Permanent beep" sounds.

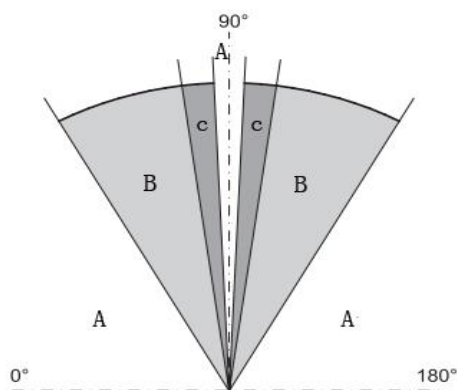

A: No beep

B: Fast beep

C: Permanent beep

7) Beep

Press left or right direction keys to shift. The beep is an acoustic signal after each key stroke.

Off: Beep switched off

On:Beep switched on

8) Horizontal Incrementation

Right:Set right Hz for "Clockwise direction measurement".

Left: Set left Hz for "Anti-clockwise direction measurement". "Anti-clockwise" directions are only displayed but saved as "Clockwise direction".

9) Reticle Illumination

It's possible to set the same reticle illumination as in the above star settings.

10) Auto-TP(Liquid crystal heating)

On:When LCD heating is switched on,it helps with normal working under cold conditions.

Off:LCD heating is switched off.

11) Auto-Off

On:The instrument is switched off after 20 minutes without any action.

Off:The instrument is switched on permanently. Battery discharges quicker.

12) Min. Reading

The displayed angle format can be selected in three steps.

For DMS(DEGREE,MINUTE,SECOND): 0°00'01" / 0°00'05" / 0°00'10"

Always " are indicated.

For DEGREE:0.0005°/0.001°/0.0001°

For GON:0.0005 gon/0.001 gon/0.0001 gon

For MIL:0.01 mil/0.05 mil/0.10 mil

13) Angle Unit

DMS (degree sexagesimal):possible angle values is 0° to 359°59'59"

DEGREE(degree decimal):possible angle values: 0° to 359.999°

GON:possible angle values: 0 gon to 399.999 gon

MIL: possible angle values: 0 to 6399.99mil

The setting of the angle units can be changed at any time.

The actual corresponding displayed values are converted according to the selected unit.

14) Distance Unit

Meter:Meter


ft-in1/16:US-feet-Inch-1/16 inch

US-ft:US-feet

INT-ft:International feet

15) Temperature Unit

°C:Degree Celsius

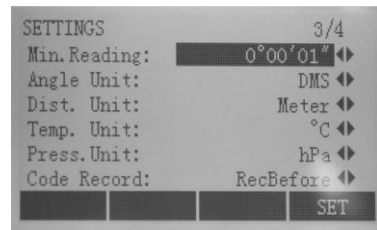

°F:Degree Fahrenheit

16) Pressure Unit

Mbar:Millibar


hPa:Hecto Pascal

mmHg:Millimeter mercury column

inHg:Inch mercury column

17) Code Record

It contains RecBefore and RecAfter here.You can set according to the necessity whether codeblock is saved before or after the measurement.

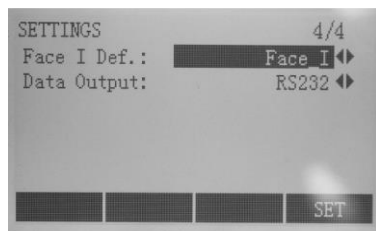

18) Face I Definition

Defining the telescope face I means face left.Similarly,defining the telescope face II indicates face right.


19) Data Output

RS232:Data is recorded via the serial interface. For this purpose, a data storage device must be connected.

Intern:All data is recorded in the internal memory.

6 EDM Settings

The EDM settings contain a detailed menu which consists of EDM Mode,Prism Type,Prism Const,Laser-Point and Guide Light.

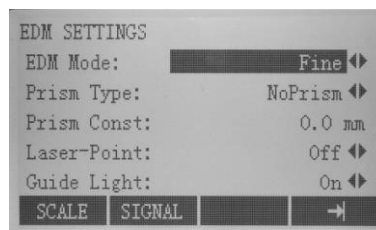

6.1 EDM Mode

The EDM Mode possesses three sorts of modes(Quick,Track and Fine) for availability.Worth noting that along with selected measuring mode the selections of prism types are different.

Quick	Quick measuring mode with higher measuring speed and reduced accuracy
-------	---

Track	Continuous distance measuring
Fine	Fine measuring mode for high precision measurements

6.2 Prism Type

Calling the function in the EDM settings.

STONEX Prisms		Constants(mm)
Prism	Circle Prism	0
	MINI	17.2
	JPMINI	34.4
	360°	23.1
	360°Mini	30
	User Define	Self-adjustment
Sheet	Sheet	/
	User Define	/
NoPrism (Reflecto rless)	NoPrism	/
	User Define	/

6.3 Prism Constant

Calling the function in the EDM settings. Entry of a user specific prism constant can only be made in User Define mode. Limit value: -999.9 mm to +999.9 mm.

6.4 Guide Light

The person at the prism can be guided by the flashing lights directly to the line of sight. The light points are visible up to a distance of 150 meters. This is useful when stake out points.

[ATMOS]: Input of atmospheric parameters.

Atmospheric Data(ppm): Distance measuring is influenced directly by the atmospheric conditions of the air where distance measuring is carried out.

In order to take into consideration these influences distance measuring is corrected using atmospheric correction parameters.

ATMOSPHERIC DATA (PPM)			
Ht. a. MSL:	9999	m	
Temperature:	15.0	°C	
Pressure :	1013.2	hPa	
Atmos PPM:	0.0	PPM	
Refract.:	0.10		
Humidity:	0	%	
PREV	PPM=0		SET

1)Ht. a. MSL: Height above sea level at instrument location.

2)Temperature: Air temperature at instrument location.


3)Pressure:Air pressure at instrument location.

4)Atmos PPM:Calculated and indicated atmospheric PPM.

5)Refract:Input of refraction coefficient for the atmospheric conditions.The refraction correction is taken into account in the calculation of the height differences and the horizontal distance.


6)Humidity:Input of atmospheric humidity.

[TIMES]:Input of distance measuring times.

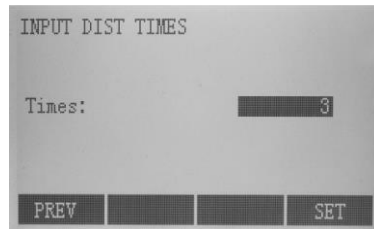

[SCALE]:Scale of projection.


Scale factor:Entering the scale of projection.Measured values and coordinates are corrected with the PPM parameter.Limit value: 0.50 to 1.999999.

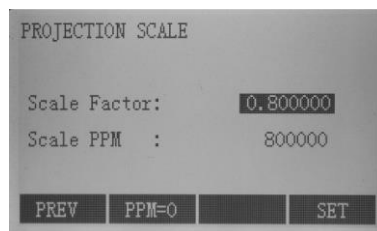

PPM: Input of individual scaling parameters.

[PPM=0] Set default parameters.

[Signal]:Display EDM signal intensity(reflection intensity) in steps of 1%.Permit optimal aiming at distant barely visible targets.

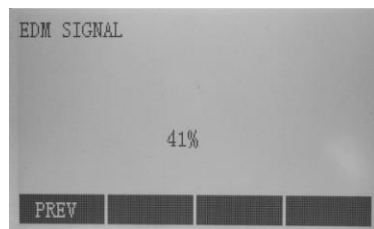

7 File Management

The File Manager contains all functions for entering,editing and for checking data in the field.

FILE MANAGEMENT	1/2	FILE MANAGEMENT	2/2
F1 Job	(1)	F1 Initialize Memory	(5)
F2 Fixpoints	(2)	F2 Memory Statistic	(6)
F3 Measurements	(3)	F3 Mem Select	(7)
F4 Codes	(4)	F4 USB	(8)
F1	F2	F3	F4

7.1 Job

Jobs are a summary of data of different types, e.g. fixed points, measurements, codes, results, etc. The job definition consists of the input of job name and user. Additionally, the system generates time and date at the time of creation.

```

VIEW JOB                23/23
Job:                    SHE
Operator:               SH
Date:                   08.06.2013
Time:                   08:52:19
Note 1:
Note 2:
DELETE  ADD  ENT

```

View Job:

◀▶ Switch among created jobs.

[DELETE] Delete selected job.

[ADD] Start a new job.

[ENT] Set the selected job.

7.2 Fixpoints

Valid fixed points contain at least the PtID and the coordinates (East, North) or (Height).

```

VIEW FIXPOINTS          8/8
Job:                    SHE
PtID:                   6
North :                 7.000 m
East :                  8.000 m
Height:                 9.000 m
FIND  DELETE  ADD  EDIT

```

View Fixpoints:

[FIND] :Start point search. Exact PtIDs can be entered or the * wildcard-criteria used.

[DELETE] :Delete selected fixed point.

[ADD] :Open input for new PtID and coordinates.

[EDIT] :Edit known data.

7.3 Measurements

Measurement data stored in the internal memory can be searched, displayed or erased.

VIEW MEASURE DATA

Job: SHE

Station: *

F3 Search Define Point

F4 View All Measure Data

PT VIEW

View Measure Data:

[PT] Start point search dialogue.

[VIEW] Display all measurements.

7.4 Codes

In relation to codelist input,code,corresponding description and its maximum of 8 attributes(Info1 to Info8) with up to 16 characters can be assigned.

INPUT CODELIST

Code: L1

Desc: HZ1

Info1 :

Info2 :

Info3 :

Info4 :

Info5 :

Info6 :

Info7 :

Info8 :

VIEW SAVE VIEW SAVE

[SAVE] Save data.

[VIEW] Start search dialogue.

7.5 Initialize Memory

Delete jobs, single data areas of a job or all data.

INITIALIZE MEMORY

Job: SHE

Data: Measure


ALL DELETE

[DELETE]:Start deleting process within the selected area.

[ALL]:Delete all data in memory. All data will be lost!

Deleting the memory can't be undone.After confirming the message all data will be lost permanently.


7.6 Memory Statistic

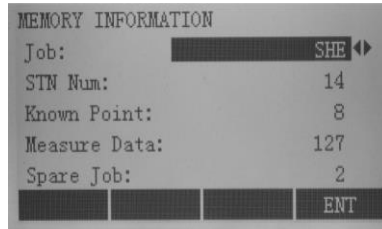

Display job's specific memory information such as:


- 1)STN Num: Number of stations
- 2)Known Point: Number of stored known points.
- 3)Measure Data: Number of recorded data blocks (measured points, codes, etc.).
- 4)Spare Job: Number of free or not defined jobs.

7.7 Memory Select

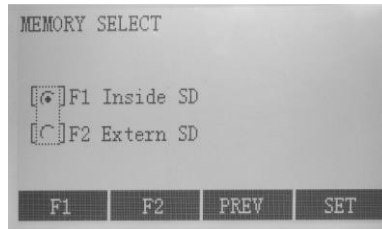

Provide two methods of memory selecting including Inside SD and Extern SD.


7.8 USB

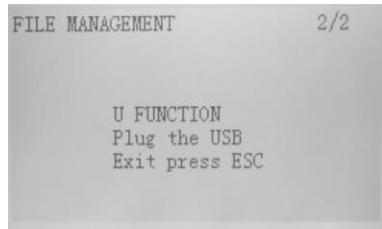

Conveniently, plug flash disk into the USB interface for data sending and selecting.

8 Start-up sequence

Start-up screen setting begins when this function status is activated (switched on). E.g. the electronic bubble can be displayed at every start.

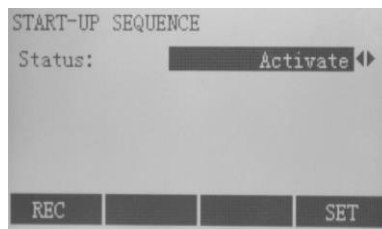

[REC]:Give the definition that start-up sequence will be executed automatically on triggering the key.


[SET]:Store current settings.

Detailed steps:

After confirming the record boot sequence, the "Meas & Rec" screen is displayed. A maximum of 16 of the next key presses are stored. The sequence is ended with [ESC]. If the start sequence is modified, the stored key presses will be executed automatically when the instrument is switched on.

9 Check and Adjust

9.1 Horizontal Collimation Error and Vertical Index Error

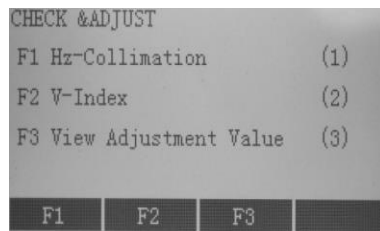

F1:Hz-collimation

F2:V-index

F3:View adjustment value:(Display saved values)

9.1.1 Horizontal Collimation Error C

If the telescope's sight line isn't perpendicular to the horizontal axis, the collimation error will appear. The assembling, transportation and operation will cause this error.

Note: After the program correction this deviation error is also on the instrument.

1) Check


- ① Set-up the instrument on tripod or adjustment platform and leveling accurately.
- ② Aim at the cross-hairs of collimator or the obvious target at a distance. Get the face left angle reading F1 and the face right angle reading F2.
- ③ Calculating the horizontal collimation error C according to $C = (F1 - F2 \pm 180^\circ) / 2$, if $C < 8''$, no adjustment will be necessary. If $C > 8''$, proceed with the following adjustment.

2) Adjustment by program


Set up the instrument on tripod or adjustment platform, and leveling accurately.

Procedure:


- ① Power on, run the "Hz-Collimation" to access collimation error process.
- ② Aim at the cross-hair of collimator at telescope left, and it'll display the horizontal and vertical angles.

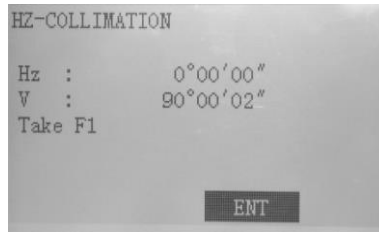


③ Aim at the cross-hair of collimator at telescope right, and it'll display the horizontal and vertical angles.

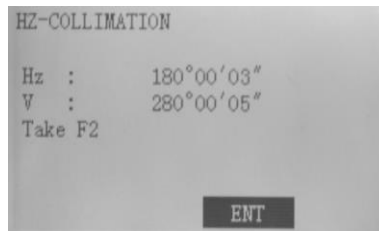

④ The software will calculate the new collimation error and vertical index error automatically.

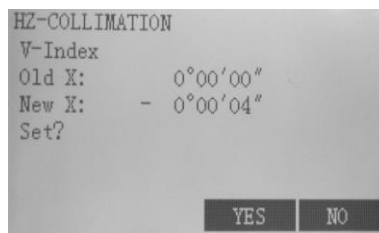

⑤ Press F3 to view "Calibrate Data".

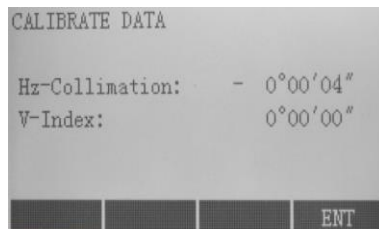


Note:

The adjustment can be performed by the program when $C < 30''$, if $C > 30''$, adjust the reticle.

Reticle Adjusting:

① Rotate the instrument in face right position, turning horizontal tangent screw until $F2' = F2 + C$.

② Loosen the shield of telescope's reticle.

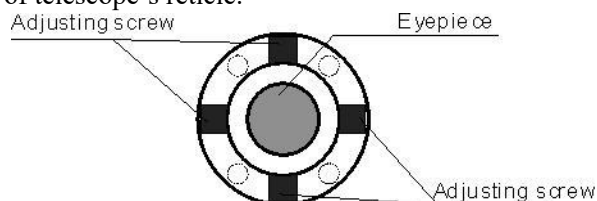

③ Adjusting two screws at left and at right until the vertical hairs of telescope's reticle coincides with the cross-hairs of collimator or target.

④ Repeat the check and adjustment procedure until the error is accepted.

Note:

① When adjust the screws of reticle, firstly loosen the screw on the moving direction of reticle, secondly tighten another screw by the same mount, clockwise turning is for tightening, and anticlockwise turning is for loosening, the turning mount for tightening or loosening should be same.

② After the reticle adjustment, it is necessary to adjust the vertical index error by program.

9.1.2 Vertical Index Error

The deviation between vertical circle zero position and horizontal direction is vertical index (i), it is necessary to concern this error when measure vertical angle. The instrument program applied a formula to remove this error. This correction can offer the index for the formula.

Warning: Before starting this operation, be sure to read manual carefully, otherwise it may cause data faulty.

Because of the close relationship between vertical index and compensator zero position, it is necessary to check and adjust compensator zero position when adjust the vertical circle, the value should be stable when reading.

1) Check

Please adjust the reticle of telescope and correct the collimation error before this operation.

① Mount the instrument at the tripod or a stable device and level it accurately, then turn on the instrument.

② Aim at the cross-hairs of collimator or the obvious target at a distance, VA should be about $\pm 10^\circ$. Read the face left angle F1 and face right angle F2.

③ Calculate the index error according to the formula below:

$$i = (F1 + F2 - 360^\circ) / 2$$

④ If $i < 10''$, no adjustment is necessary, or you have to adjust it.

2) Adjustment by program

Set-up the instrument on tripod or adjustment platform, and leveling accurately.

Procedure:

① Power on, run the "V-Index" to access vertical index error process.

② Aim at the cross-hair of collimator at telescope left, and it'll display the horizontal and vertical angles.

③ Aim at the cross-hair of collimator at telescope right, and it'll display the horizontal and vertical angles.

④ The software will calculate the new collimation error and vertical index error

automatically.

⑤ Press F3 to view “Calibrate Data”.

9.2 Plate Level and Circular Level

9.2.1 Plate Level

1)Check

① Mount the instrument on a stable device (as tripod , adjusting device),and fix it.

② Level the instrument until the plate level is parallel to a line linking leveling foot screws A and B, then adjust the two screws to center the air bubble.

③ Turn the instrument 180°, observe the moving direction of the bubble, if it is still centered, no adjustment is necessary, if not, you have to adjust it.

2)Adjustment



① Mount the instrument on a stable device and fix it.

② Level it roughly.


③ Turn the instrument and make the plate level be parallel to a line linking two leveling foot screws, then adjust the two screws to center the air bubble .

④ Turn the instrument 180°, adjust the Adj-screw with adjustment pin slightly to correct half of the bubble's displacement when it doesn't move.

⑤ Repeat the operation ③ and ④ until the air bubble remains centered in any position .

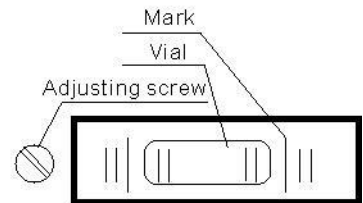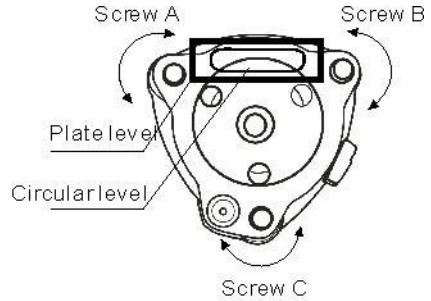

Turn the instrument 180°

 

9.2.2 Circular Level

1)Check

① Mount the instrument on a stable device and fix it.

② Level it accurately by the plate level.



③ Observe the bubble of the circular level, if it is centered, no adjustment is necessary, if not, you have to adjust it.

2)Adjustment

① Mount the instrument on a stable device and fix it.

② Level it accurately by the plate level.

③ Adjust the three adjusting screws to center the bubble by a wrench.

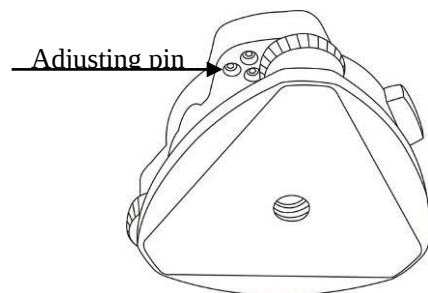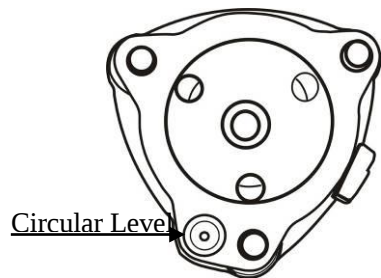

Note: Be careful when adjusting the three screws, and the tightening tension is identical for them.

9.3 Optical Plummet and Laser Plummet


9.3.1 Optical Plummet(factory optional)

1) Check

- ①Mount the instrument at the tripod and fix it.
- ②Set a cross mark under the instrument
- ③Coincide the center mark of the optical plummet with the cross mark by adjusting three leveling foot screws.
- ④Turn the instrument 180° , check the center mark and cross mark, if they are coincide, no adjustment is necessary, if not, adjust it.

2) Adjustment

- ①Set the instrument on stable device and fix it.
- ②Set a cross mark under the instrument.
- ③Use the three leveling screws and coincide the center mark of plummet and cross mark on the ground.
- ④Rotate the instrument 180° around and take off the cover of the optical plummet eyepiece, adjust the four adjusting screws with the adjusting pin to shift the center mark to the cross mark, correct only one-half of the displacement in this manner.
- ⑤ Repeat the operation in ③ and ④ until coincide the center mark of the plummet and cross mark on the ground.

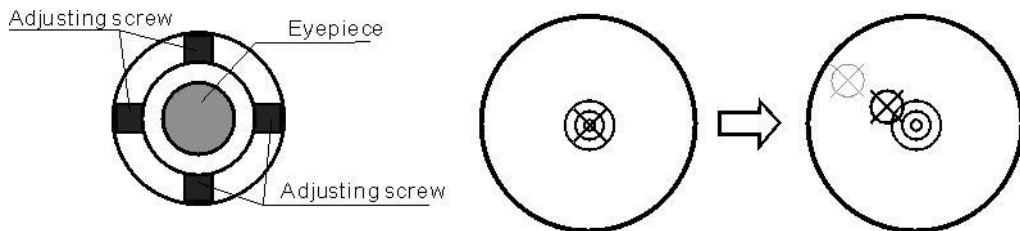


Note:

When adjust the screws of plummet reticle, firstly loosen the screw on the moving direction of reticle, secondly tighten another screw by the same mount, clockwise turning is for tightening, and anticlockwise turning is for loosening, the turning mount for tightening or loosening should be same.

9.3.2 Laser Plummet

1) Check


- ① Set the instrument on stable device and fix it.
- ② Set a cross mark on the ground under the instrument.
- ③ Turn the laser switch on and focus it accurately.
- ④ Turn the three leveling screws until the instrument keeps leveling and the laser spot coincides with the cross mark on the ground.
- ⑤ Rotate the instrument 180° (200g) around and check the laser spot and cross mark, if they coincide, adjustment is not required. Otherwise, adjust it.

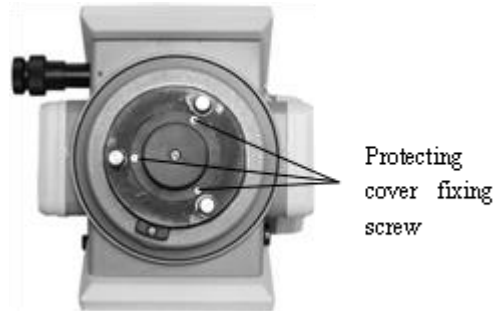

2) Adjustment

- ① Setting up the instrument on the checking tool or tripod which is 1.5m apart from ground.
- ② Turn on laser plummet, turn tribrach foot screws until laser spot coincides with cross mark. If you use tripod, make a cross mark on the laser spot directly.
- ③ Rotate instrument 180° around, if the laser spot is over 2mm apart from cross mark, remove the protecting cover firstly, adjust two screws with 1.5mm hexagon wrench to move laser spot to the cross mark, correct only one-half of the displacement in this manner. Adjusting details see attached figure.
- ④ Repeat steps 2 and 3 until laser spot coincides with cross mark always when rotate instrument.


Note: There are three screws mounted around laser plummet part, only two screws are used for laser accuracy adjustment.

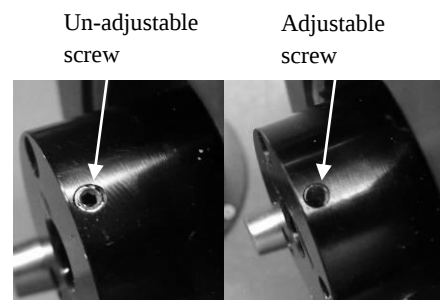

9.4 The Optical Sight


1) Check

- ① Mount the instrument on a tripod and fix it.
- ② Set a cross mark target which apart from the instrument about 50m.
- ③ Take the telescope sight the cross mark.
- ④ Observe the optical sight collimator whether collimating the cross mark, if collimate the mark, adjustment is not necessary; if not, adjust it.

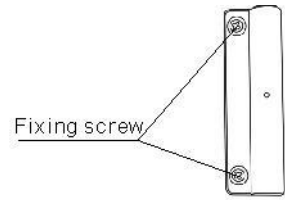

2) Adjustment


- ① Mount the instrument at the tripod and fix it.
- ② Set a cross mark target which apart from the instrument about 50m.
- ③ Take the telescope sight the cross mark.
- ④ Loosen two fixing screws, adjust the collimator, then fix the two screws again.

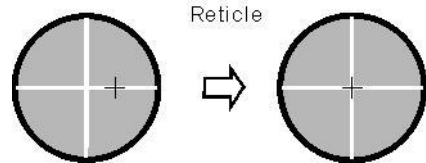

9.5 Vertical Cross-hair on Telescope


1) Check

- ① Set the instrument up the tripod and carefully level it.
- ② Set a point A front the instrument 50m apart;
- ③ Collimate the point A and adjust the vertical tangent screw; If the point appears to move continuously on the hair, adjustment is not required. Otherwise, adjust it.

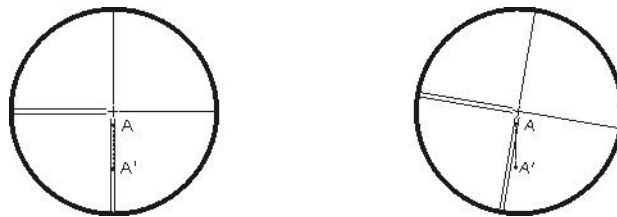

2) Adjustment

- ① Set the instrument, and set the point A front the instrument 50m apart.
- ② Take off cover of telescope eyepiece, there are 4 screws for the reticle part.

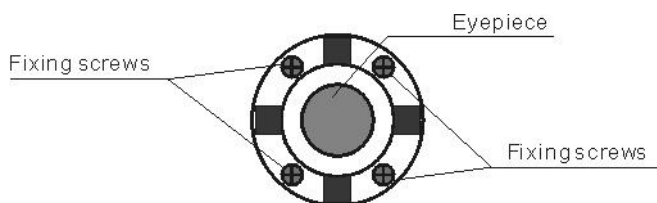

- ③Loosen all four fixing screws slightly with the cross screw-drive.
- ④Revolve the eyepiece section so that the vertical cross-hair coincides to point A, finally, re-tighten the four screws.
- ⑤Repeat the checking and adjusting until there is no deviation.

Note:


- ①After the adjustment of cross-hair, please check the collimation error and vertical index error.
- ②Refer to the chapter “9.8 EDM Optical Axis and the Telescope Sighting Axis Error” to check the axis. At last check the collimator error again.

9.6 EDM Optical Axis and the Telescope Sighting Axis Error

It is necessary to check this error after the adjustment of telescope reticle error.

1)Checking

- ①Install the instrument at the tripod or a stable device and level it accurately, then power on the instrument.
- ②Set a prism about 2m far away from the instrument.
- ③Aim at the prism center with telescope reticle.

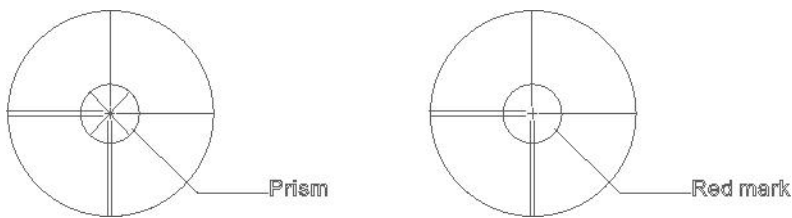

- ④Enter EDM signal testing screen.
- ⑤Observe through eyepiece, turn the focusing knob until the red mark is clear, if the deviation between mark and cross-hair is not over 1/5 of red mark diameter, adjustment is unnecessary.

2)Checking

- ①Install the instrument at the tripod or a stable device and level it accurately, then power on the instrument.
- ②Set a reflective sheet about 5m-20m far away from the instrument.
- ③Aim at the sheet cross-mark with telescope reticle.



- ④Enter EDM signal testing screen.

⑤Observe the laser spot, if the laser spot coincides with the cross-mark of reflective sheet, adjustment is unnecessary.

Note:


Laser radiation,do not stare at laser beam.

3)Adjustment

If the instrument needs adjustment, please contact with our dealers.

10 Comm Parameters

For data transfer between PC and instrument the communication parameters of the serial interface RS232 must be set.

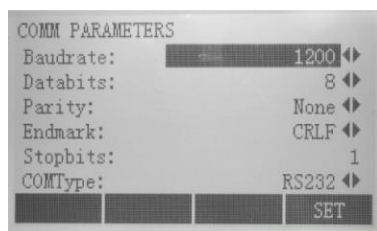

Baudrate

Data transfer speed:1200,2400, 4800, 9600, 19200,TOPCON,SOKKIA

(UNIT: [bits / second])

Databits

7:Data transfer is realized with 7 databits.Is set automatically if parity is "Even" or "Odd".

8:Data transfer is realized with 8 databits.Is set automatically if parity is "None".

Parity

Even:Even parity

Odd:Odd parity

None:No parity (if data bit is set to 8)

Endmark

CRLF:Carriage return; line feed

CR:Carriage return

Stopbits


Fixed setting 1.

COMType

RS232.

11 Data Transfer

With the help of this function measured data can be transferred via the serial interface to a receiver (e.g. a laptop).

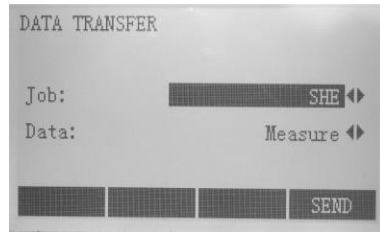


Job: Selection of job from which data should be transferred.

Data: Select the data range to be transferred (measurements, fixed points).

[SEND] : Start transmission.

12 System Information

Display helpful information and date / time can be set here.

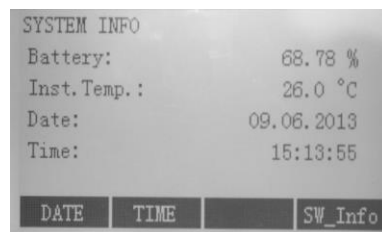

1) Battery

Remaining battery power (e.g. 90.26%).

2) Inst.Temp

Measured instrument temperature.


3) Date

Show the current date.

4) Time

Display current time.

[DATE]: Change date and format.

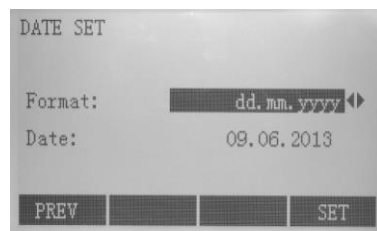


Format: There are three formats:

- DD.MM.YYYY
- MM.DD.YYYY
- YYYY.MM.DD

Date: Input date

[TIME]: Set time.

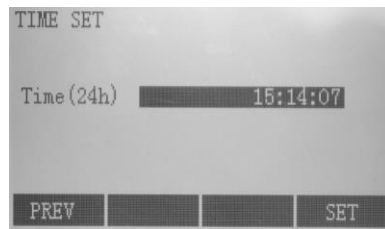

[SW-Info]



- Display current software version
- Inst.Type indicates specific type of this instrument.

13 Instrument Maintenance

13.1 Cleaning and Drying

- Wipe up painted surface.
- Blow dust off lenses.
- Use only a clean degreasing cotton for cleaning up. If necessary, moisten the cotton with little pure alcohol. Do not use other liquids (oil, gasoline, water, etc) which may attack the polymer components.
- Never touch the glass with your fingers.
- Be careful to wipe damp instrument. Take out the instrument from case and make it completely dry. Do not store the instrument in case. Besides, keep the case clean inside and outside, and keep it dry.

13.2 Storage

When the instrument is stored for a long term, take it out from case in order to allow the air to circulate and avoid lens's mildew. Storage must be under the conditions of dust prevention, air circulation and low humidity. In wet areas use desiccator and fuming cupboard. In cold regions, do not move the instrument indoors during the period of not using it and it's supposed to remain in safe places under ambient temperature, which can prevent water vapour from condensing on optical glasses and inside the instrument.

13.3 Transportation

Put instrument into the case which includes foam inserts or other shockproof stuff for long-distance transportation.

13.4 Check

Better check instrument on a regular basis, and adjust it according to instruction manual if

necessary.

14 Specifications

R25

Telescope

Length	156mm
Image	Erect
Magnification	30×
Aperture	45 mm
Field of view	1°30'
Minimum focus	1.0m

Angle measurement

Reading system	Absolute encoder
Angle unit	360degree/400gon/6400mil, selectable
Display resolution	0.5"/ 1 "/5"(or 0.1/0.2/1mgon)
	0.1mgon/0.2mgon/1mgon, selectable
Accuracy	2"/5"

Distance measurement(R600)

Display resolution(m/inch selectable)	0.1mm/1mm
Laser class	Prism Class 1 Reflectorless/Reflective sheet Class 3R
Measurement range(good condition)	Single prism 1 to 3000m Reflective sheet/RP60 1 to 800m Reflectorless 1 to 500m
Accuracy	Prism:2mm+2ppm/1mm+1.5ppm(Optional) Reflective sheet/RP60:3mm+2ppm Reflectorless:1-200m:3mm+2ppm/≥200:5mm+3ppm
Measurement time	Initial: 2.5s
Prism	typ.1.0-1.5s
Reflective sheet/RP60	typ.1.5s
Reflectorless	typ.1.5-5s,max.20s

Distance measurement(R1000)

Laser class	
Prism standard mode/Prism long mode	Class 1/ Class 2
Reflective sheet	Class 2
Reflectorless standard mode	Class 2
Reflectorless long mode	Class 3R

Measurement range(good condition)

Standard mode/Prism	1 to 3500m
Long mode/Prism	1 to 6000m
Reflective sheet/RP60	1 to 1200m
Reflectorless	1 to 1000m

Accuracy/typical measuring time(max.20s)

Prism standard mode:1mm+1.5ppm/1.0s-5.0s
Prism long mode:2mm+2.5ppm/0.7s-6s
Reflective sheet/RP60:2mm+2ppm/1s-5s
Reflectorless:1-500m:2mm+2ppm/0.7s-6s>500m:4mm+2ppm/3s-12s

Level vial sensitivity

Plate level	30" / 2 m m
Circular level	8' / 2 m m

Compensation

	Dual-axis
Range	± 3 '
Resolving power	1"

Optical plummet(Factory optional)

Accuracy	±0.8mm/1.5m
Image	Erect
Magnification	3×
Focusing range	0.5 m ~ ∞
Field of view	4°

Laser plummet(Standard)

Accuracy	±1.0mm/1.5m
Laser class	Class 2/IEC60825-1
Laser spot size/brightness	Adjustable
Laser wave length	635nm
Endless drive	H&V

Display

LCD	Large LCD(240×128dots)
-----	------------------------

Power

Battery	3400 mAh Li-ion Rechargeable battery
Voltage	7.4 V DC
Continuous operation time	About 19 hours(single distance measurement every 30 seconds)
Charger	FDJ6-Li(110V to 240V)
Charging time (at +20°C)	Approx. 4 hours

Application programs

Data collection/Stake out/Resection/REM/MLM/Point to line

AREA/Z coordinate/OFFset/3D Road

Others

CPU	32bit
Memory	128M internal memory,SD card
Guide Light System	Factory optional
Sensors	Built-in temperature and pressure sensors
Keyboard	Alphanumeric illuminated key board,both sides
Operating temperature	-20°~+50°C
Storage temperature	-40°~+70°C
Dimension(W×D×H)	210×210×360 m m
Weight(including batteries)	6kg
Dimensions(W×D×H)	185×220×360mm
Interface	USB/RS-232C
Water and dust protection	IP55 (IEC60529)
Data collector	PS236,fully rugged PDA(Optional)

15 Standard components

● Carrying case	1 each
● Instrument	1 each
● Battery	2 each
● Charger	1 each
● Adjusting pins	2 each
● Cleaning cloth	1 each
● Cleaning brush	1 each
● Screwdriver	1 each
● Wrench	2 each
● Silica gel	1 each
● Instruction manual	2 each
● CD	1 each
● USB Communication cable	1 each
● RS232C Communication cable	1 each
● Rainproof	1 each
● Reflective sheet/RP30	4 each(Only for RTS series)
● Reflective sheet/RP60	1 each(Only for RTS series)
● Laser caution sign board	1 each(Only for RTS series)

Appendix I: Atmospheric correction formula and chart(Just for reference)

Factory setting: temperature: 20°C, pressure:1013hpa, 0ppm (RTS)

temperature: 20°C, pressure:1013hpa, 0ppm (RTS)

The correction:

$$K_{pt} = 274.417 - 0.2905 * p / (1 + 0.0036 * t) \dots \dots \dots \text{RTS}$$

$$K_{pt} = 278.960 - 0.2902 * p / (1 + 0.0036 * t) \dots \dots \dots \text{RTS}$$

Where: p--Pressure value (hPa)

t--Temperature value (°C)

K_{pt}--Atmospheric correction (ppm)

Example:

t=20°C, p=1013hpa, L₀=1000m.


Then: K_{pt}=0ppm (RTS) K_{pt}=4ppm (RTS)

$$L = L_0(1 + K_{pt}) = 1000 \times (1 + 0 \times 10^{-6}) = 1000.000\text{m (RTS)}$$

$$L = L_0(1 + K_{pt}) = 1000 \times (1 + 4 \times 10^{-6}) = 1000.004\text{m (RTS)}$$

The atmospheric value is obtained easily with the atmospheric correction chart. Find the measured temperature in horizontal axis, and pressure in vertical axis on the chart.

Read the value from the diagonal line, which is the required atmospheric correction value.

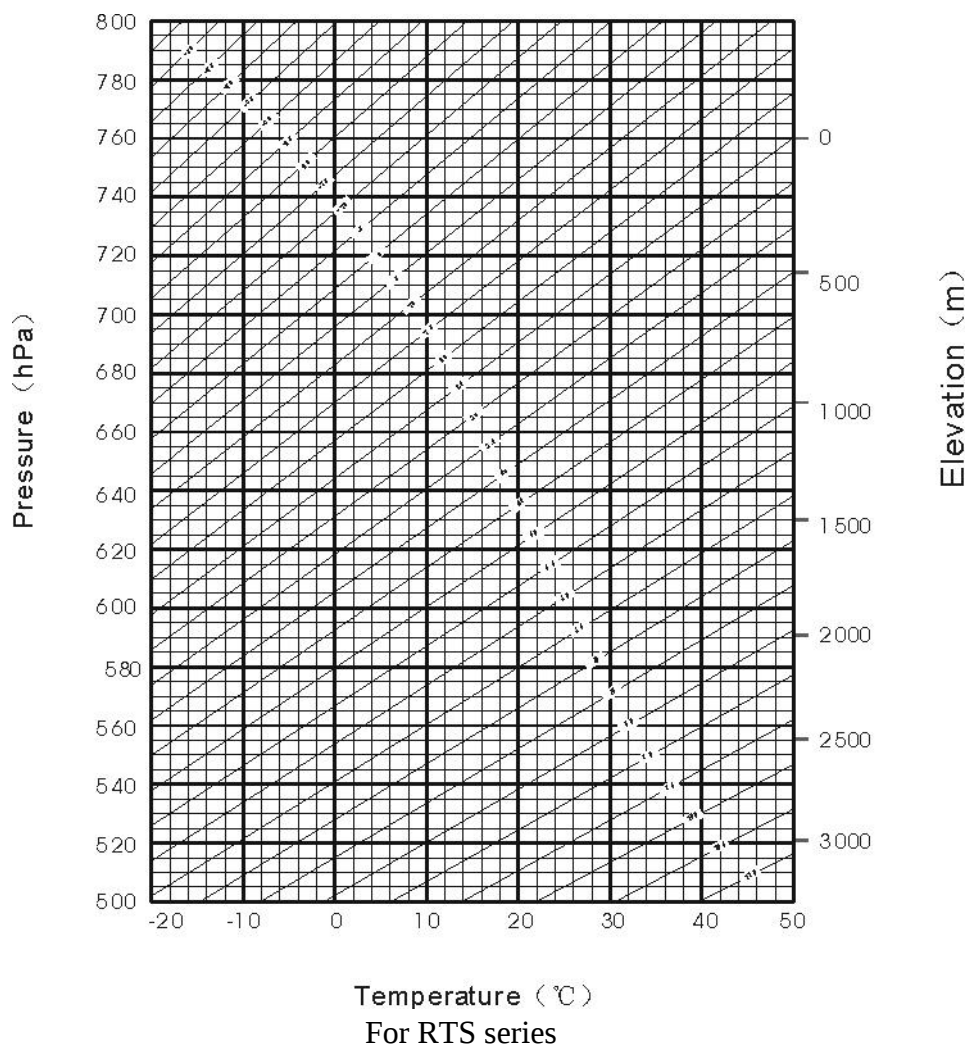

Appendix II: Correction for refraction and earth curvature

Considering the correction of refraction and earth curvature for distance measurement, the formula for slope distance, horizontal distance and vertical distance applied in the instrument are as followings:

$$SD = D_0 \times (1 + ppm \times 10^{-6}) + mm$$

SD — — Displayed slope distance (m)

D_0 — — Real measured distance (m)

ppm — — Scale coefficient (mm/km)

mm — — Target constant (mm)

$$HD = Y - A \times X \times Y$$

$$VD = X + B \times Y^2$$


HD — — Horizontal distance (mm)

VD — — Vertical distance (mm)

$$Y = SD \cdot |\sin \xi|$$

$$X = SD \cdot \cos \xi$$

ξ — — Zenith angle

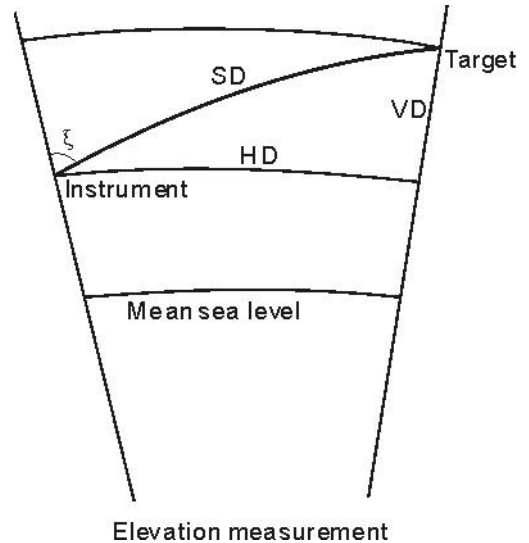

$$A = \frac{1 - \frac{K}{2}}{R}$$

$$B = \frac{1 - \frac{K}{2}}{2R}$$

$$K = 0.142 \text{ or } 0.20$$

$$R = 6.37 \times 10^6 \text{ (m)}$$

The conversion formula for horizontal and vertical distance is as follows when correction for refraction and earth curvature is not applied:

$$HD = SD \cos \xi$$

$$VD = SD \sin \xi$$

Note:

The factory setting for the refraction coefficient K is 0.142.

Refer to the section 3.10 to change the value of K.

Appendix III: Assembling and disassembling for three-jaw tribrach


It is convenient to assemble or disassemble the instrument from tribrach by loosen or tighten the tribrach clamp.

Disassemble

- (1) Rotate the tribrach clamp anticlockwise until the lever is loosen.
- (2) One hand hold up the tribrach, another hand hold the carry handle of the instrument and lift out the instrument from the tribrach.

Assemble

- (1) Put the instrument into the tribrach lightly, let the communication port against in the indentation of the tribrach..
- (2) Rotate the tribrach clamp clockwise until the lever is tighten.

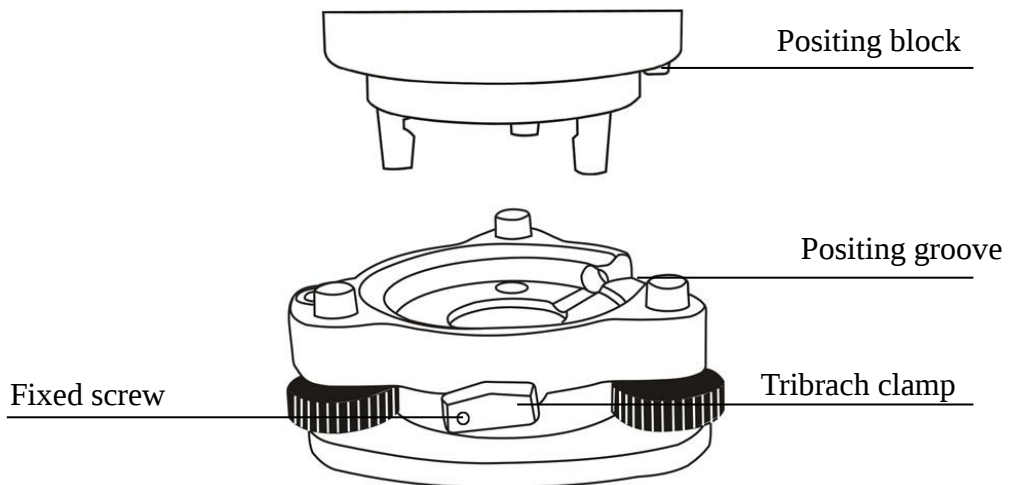

Note: Fix the tribrach clamp

If the instrument don't need assembly or disassembly from tribrach frequently, it is necessary to fix the tribrach clamp by fixed screw to avoid the disassembly by accident.

Screw out the fixed screw by driver to fix the clamp.

NOTE:

These designs, figures and specifications are subject to change without notice. We shall not be held liable for damages resulting from errors in this instruction manual.

Warning Statement

This device complies with part 15 of the FCC Rules. Operation is subject to the following two conditions: (1) This device may not cause harmful interference, and (2) this device must accept any interference received, including interference that may cause undesired operation.

Any Changes or modifications not expressly approved by the party responsible for compliance could void the user's authority to operate the equipment.

Note: This equipment has been tested and found to comply with the limits for a Class B digital device, pursuant to part 15 of the FCC Rules. These limits are designed to provide reasonable protection against harmful interference in a residential installation. This equipment generates uses and can radiate radio frequency energy and, if not installed and used in accordance with the instructions, may cause harmful interference to radio communications. However, there is no guarantee that interference will not occur in a particular installation. If this equipment does cause harmful interference to radio or television reception, which can be determined by turning the equipment off and on, the user is encouraged to try to correct the interference by one or more of the following measures:

- Reorient or relocate the receiving antenna.
- Increase the separation between the equipment and receiver.
- Connect the equipment into an outlet on a circuit different from that to which the receiver is connected.
- Consult the dealer or an experienced radio/TV technician for help.

The device has been evaluated to meet general RF exposure requirement. The device can be used in portable exposure condition without restriction.