

Appendix Test Data

Project No.:	18220WC10147201	Test Date:	2021.7.1
Test Engineer:	<i>Tomy He</i>	Auditor:	<i>Edward Pan</i>
Temperature:	22.3°C	Relative Humidity:	55 %
Pressure:	1012 hPa		

1. Bandwidth


1.1 OBW

1.1.1 Test Result


Mode	TX Type	Frequency (MHz)	Packet Type	Ant	99% Occupied Bandwidth (MHz)	Limit	Verdict
GFSK	SISO	2402	DH5	1	0.90	/	Pass
		2441	DH5	1	0.90	/	Pass
		2480	DH5	1	0.90	/	Pass
$\pi/4$ -DQPSK	SISO	2402	2DH5	1	1.18	/	Pass
		2441	2DH5	1	1.17	/	Pass
		2480	2DH5	1	1.18	/	Pass
8DPSK	SISO	2402	3DH5	1	1.19	/	Pass
		2441	3DH5	1	1.18	/	Pass
		2480	3DH5	1	1.18	/	Pass

1.1.2 Test Graph



GFSK_DH5_LCH_2402MHz_Ant1_NTNV

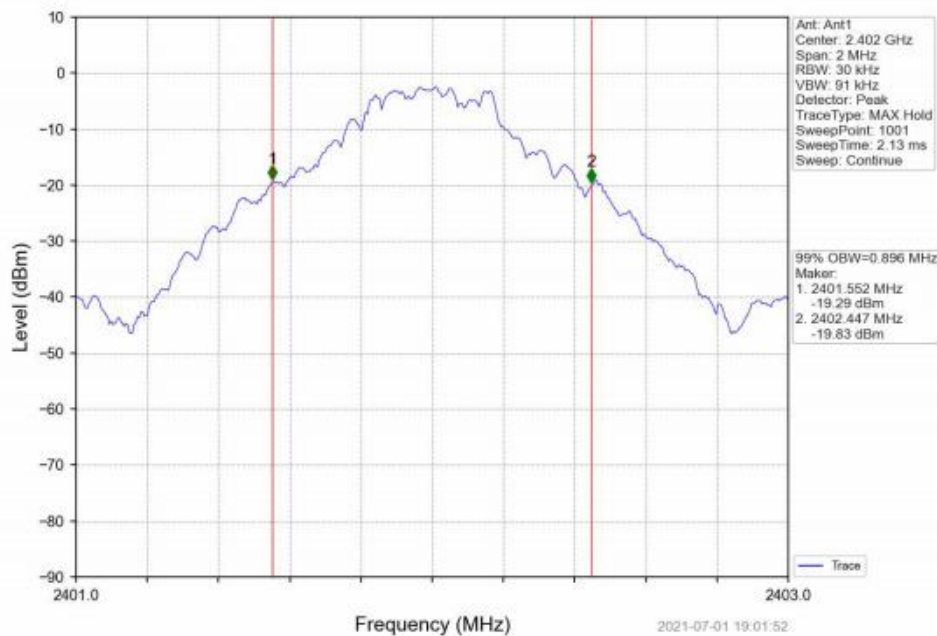

GFSK_DH5_MCH_2441MHz_Ant1_NTNV

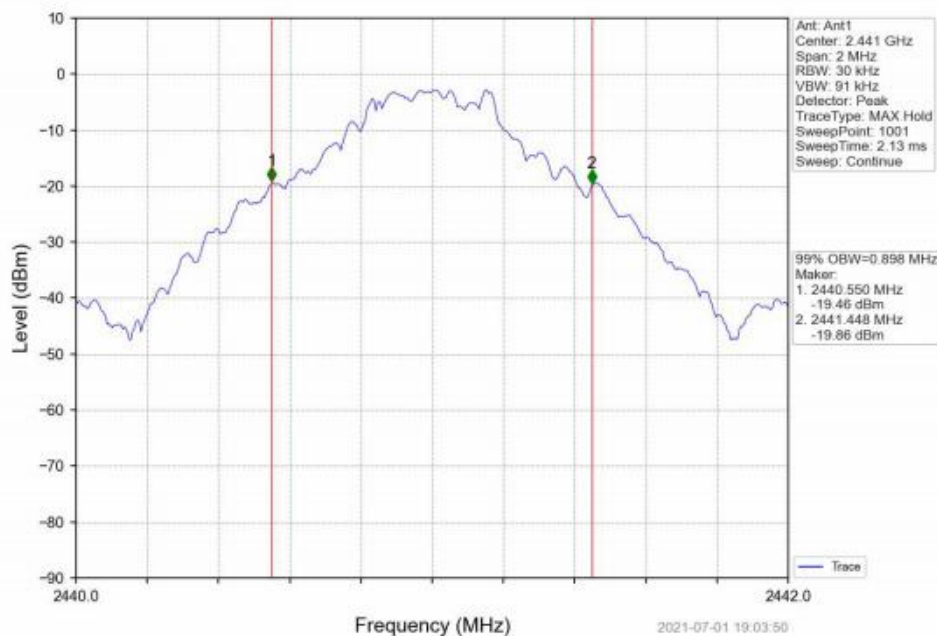

GFSK_DH5_HCH_2480MHz_Ant1_NTNV

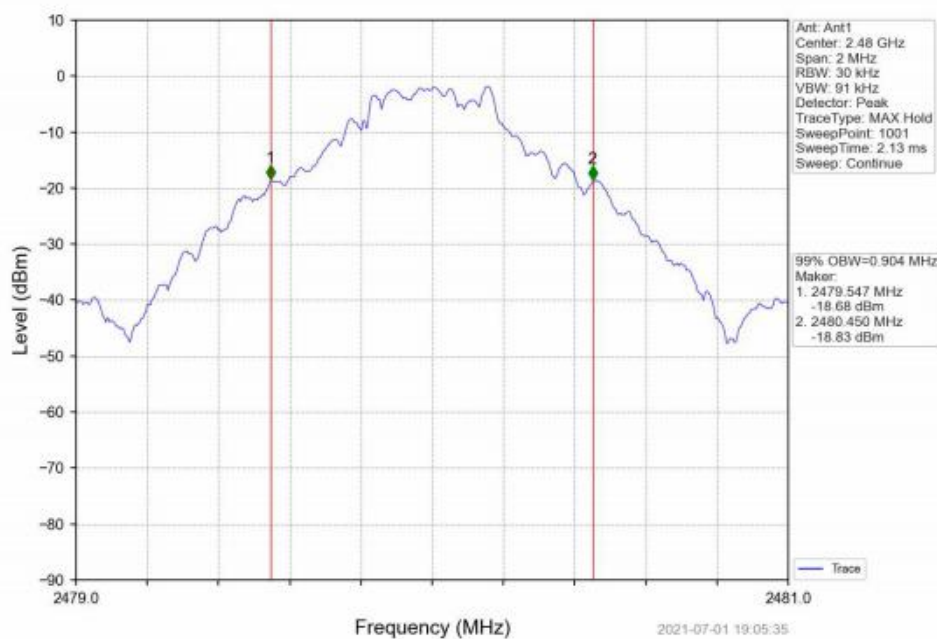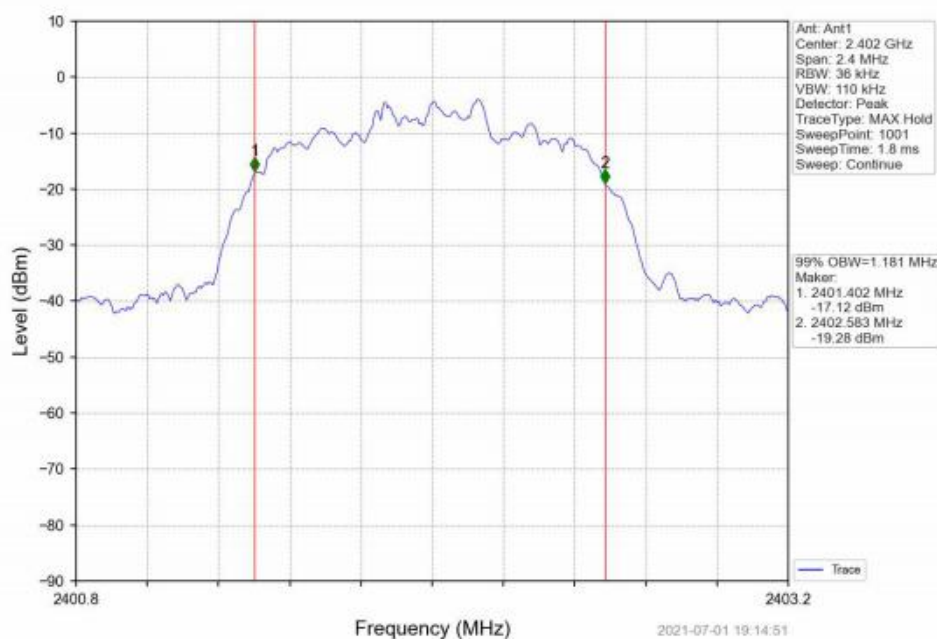 π /4-DQPSK_2DH5_LCH_2402MHz_Ant1_NTNV**Shenzhen Anbotech Compliance Laboratory Limited**

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community,
Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.



Tel: (86) 755-26066440 Fax: (86) 755-26014772 Email: service@anbotech.com



Hotline

400-003-0500

www.anbotech.com

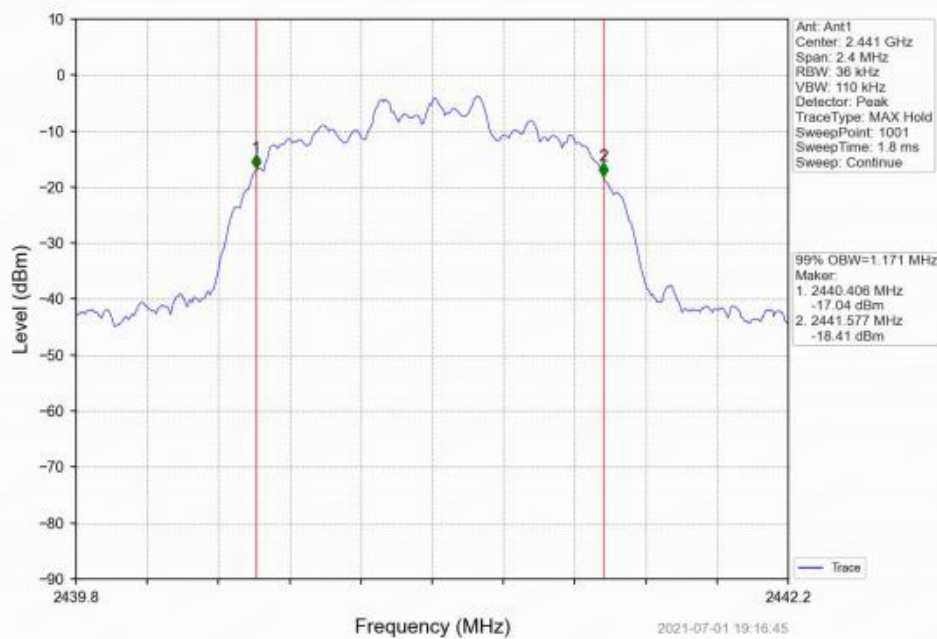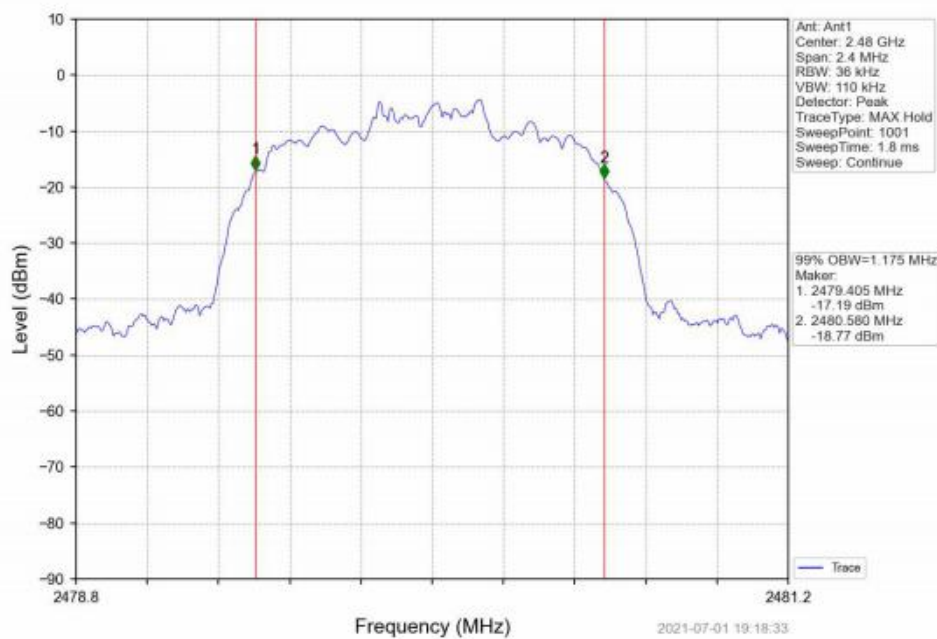π /4-DQPSK_2DH5_MCH_2441MHz_Ant1_NTNV π /4-DQPSK_2DH5_HCH_2480MHz_Ant1_NTNV**Shenzhen Anbotech Compliance Laboratory Limited**

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.

Tel: (86) 755-26066440 Fax: (86) 755-26014772 Email: service@anbotech.com




Hotline


400-003-0500


www.anbotech.com

8DPSK_3DH5_LCH_2402MHz_Ant1_NTNV

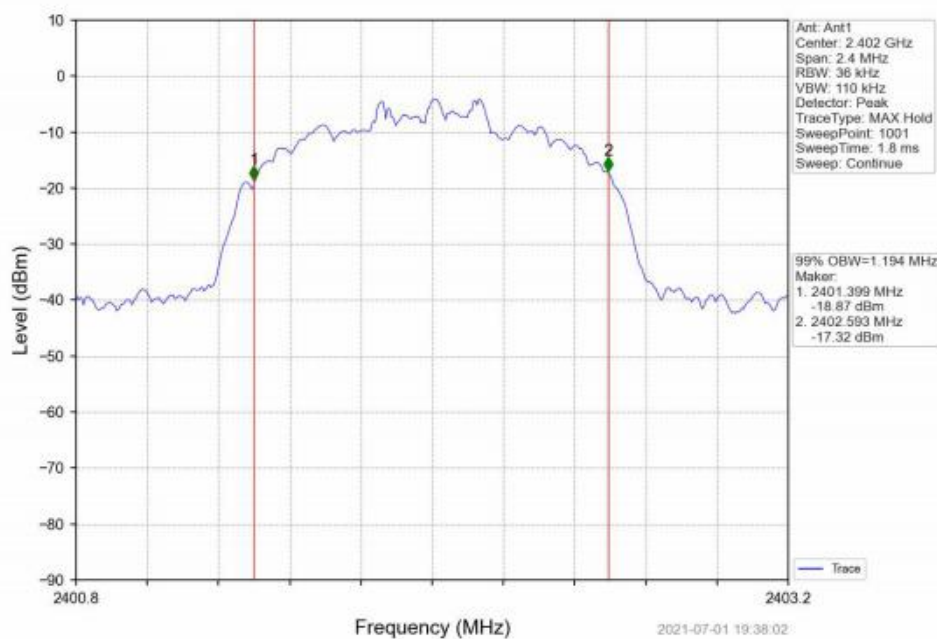

8DPSK_3DH5_MCH_2441MHz_Ant1_NTNV

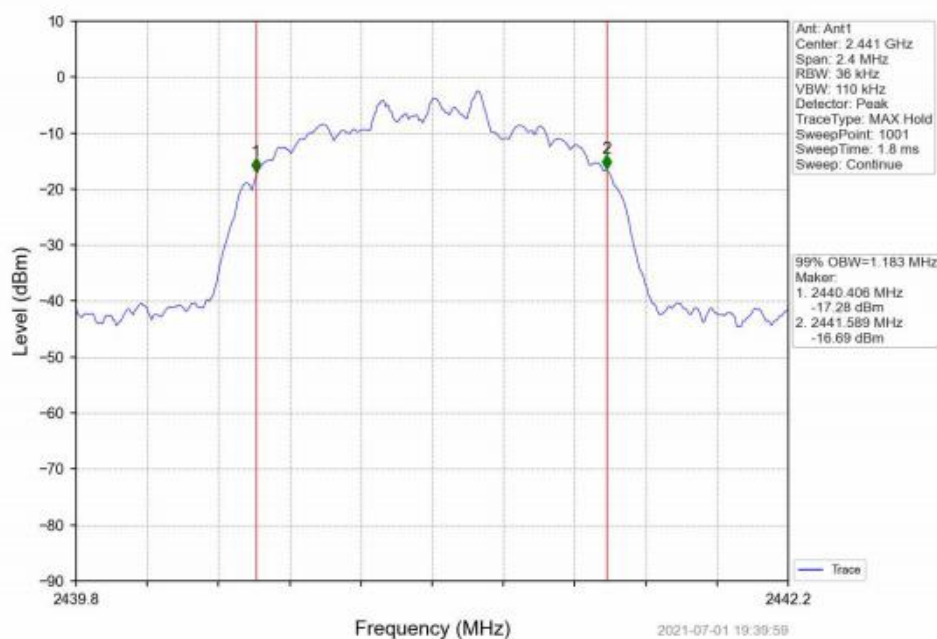

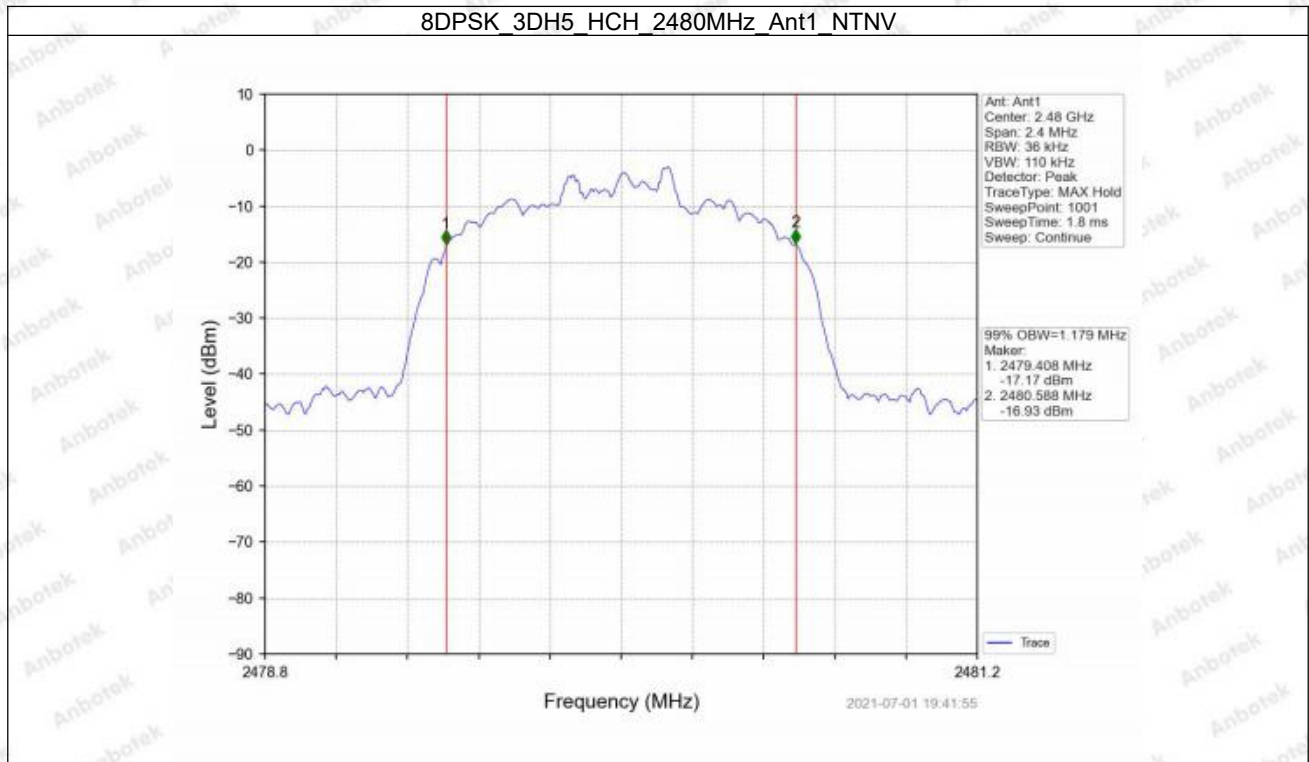

Shenzhen Anbotech Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.

Tel: (86) 755-26066440 Fax: (86) 755-26014772 Email: service@anbotech.com

Hotline
400-003-0500
www.anbotech.com


1.2 20dB BW

1.2.1 Test Result


Mode	TX Type	Frequency (MHz)	Packet Type	Ant	20dB Bandwidth (MHz)	Limit	Verdict
GFSK	SISO	2402	DH5	1	1.03	/	Pass
		2441	DH5	1	1.03	/	Pass
		2480	DH5	1	1.04	/	Pass
$\pi/4$ -DQPSK	SISO	2402	2DH5	1	1.32	/	Pass
		2441	2DH5	1	1.32	/	Pass
		2480	2DH5	1	1.31	/	Pass
8DPSK	SISO	2402	3DH5	1	1.31	/	Pass
		2441	3DH5	1	1.30	/	Pass
		2480	3DH5	1	1.30	/	Pass

1.2.2 Test Graph


GFSK_DH5_LCH_2402MHz_Ant1_NTNV

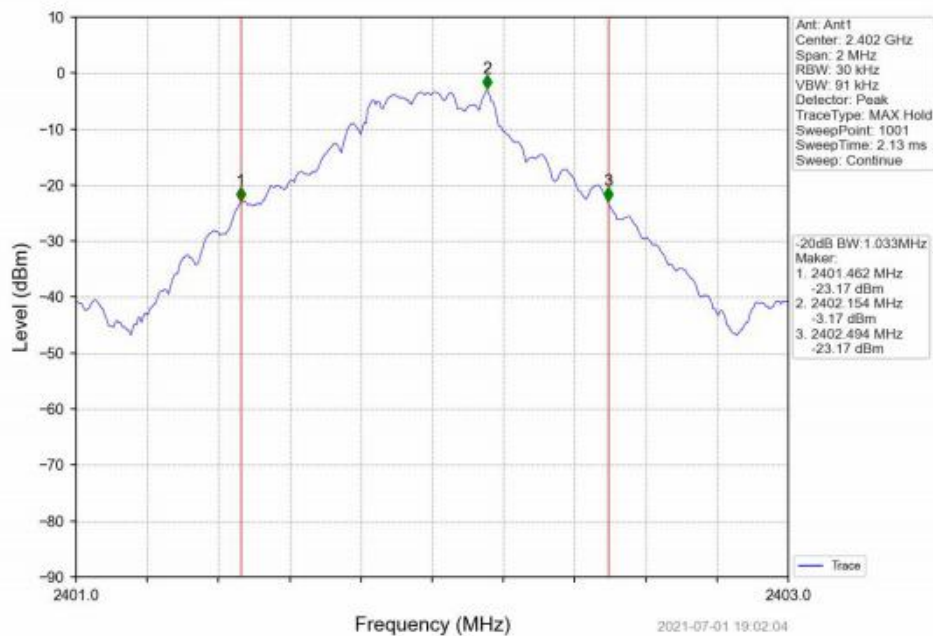


GFSK_DH5_MCH_2441MHz_Ant1_NTNV

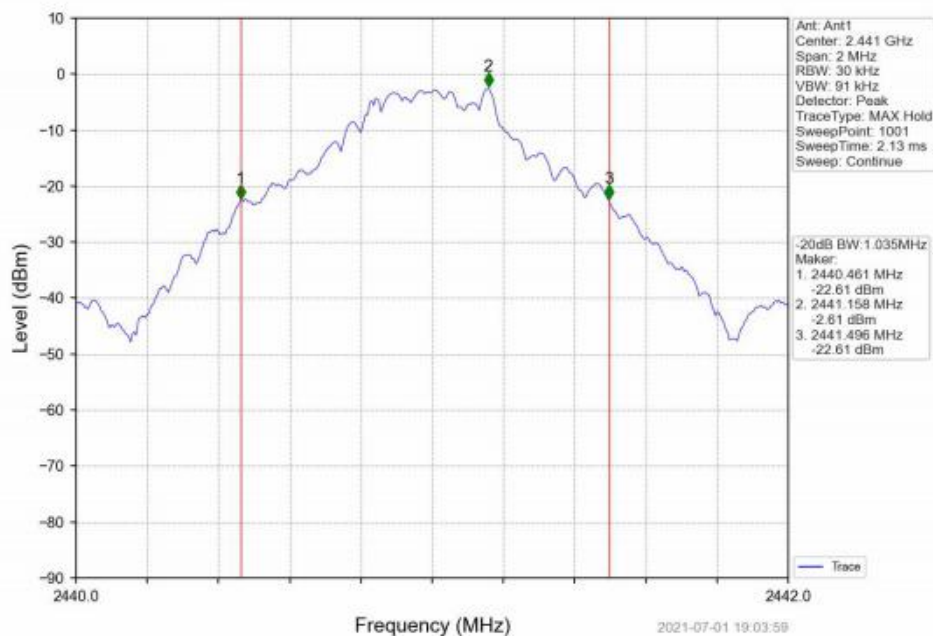


GFSK_DH5_HCH_2480MHz_Ant1_NTNV

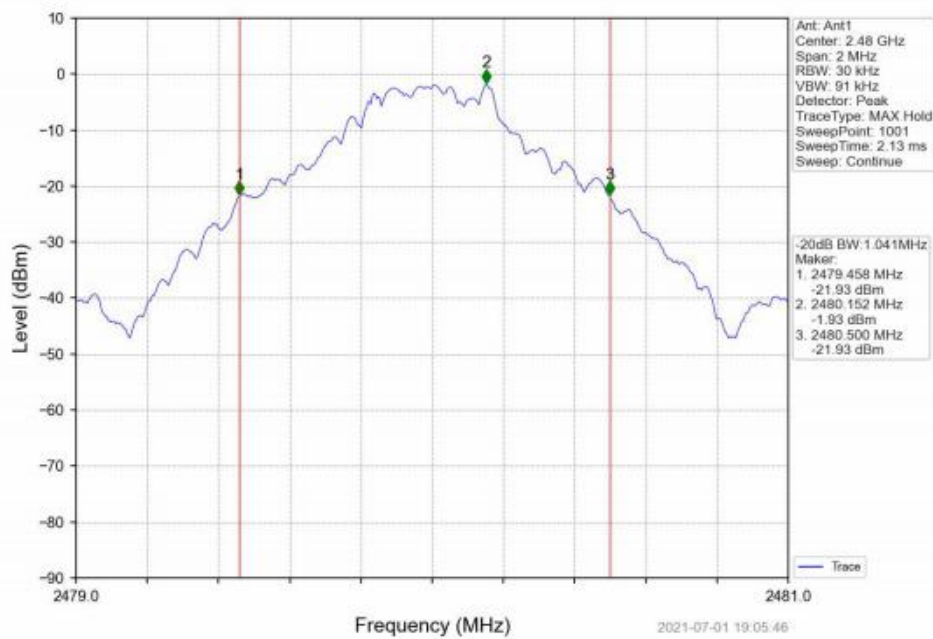


π /4-QPSK_2DH5_LCH_2402MHz_Ant1_NTNV

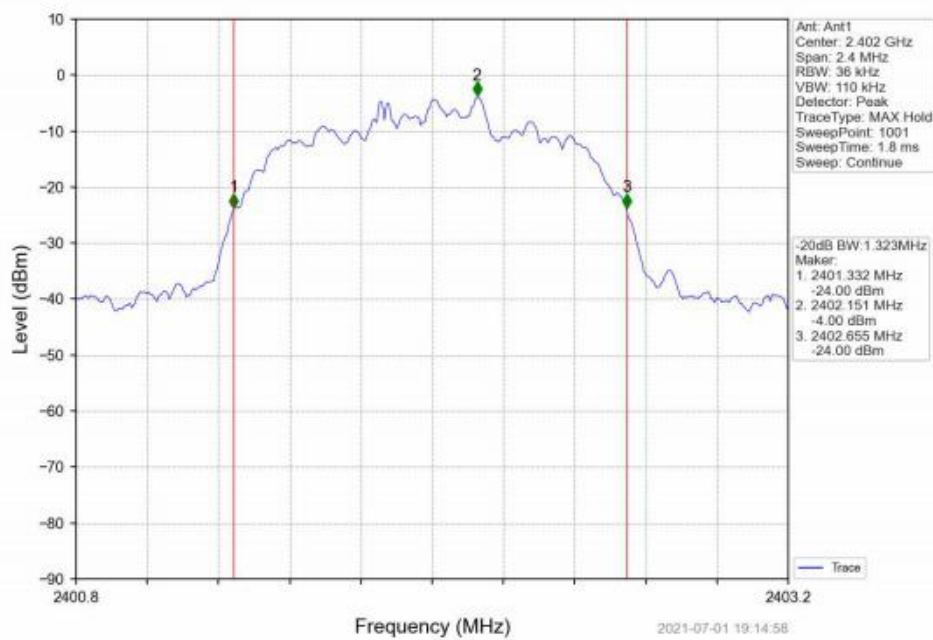


π /4-DQPSK_2DH5_MCH_2441MHz_Ant1_NTNV

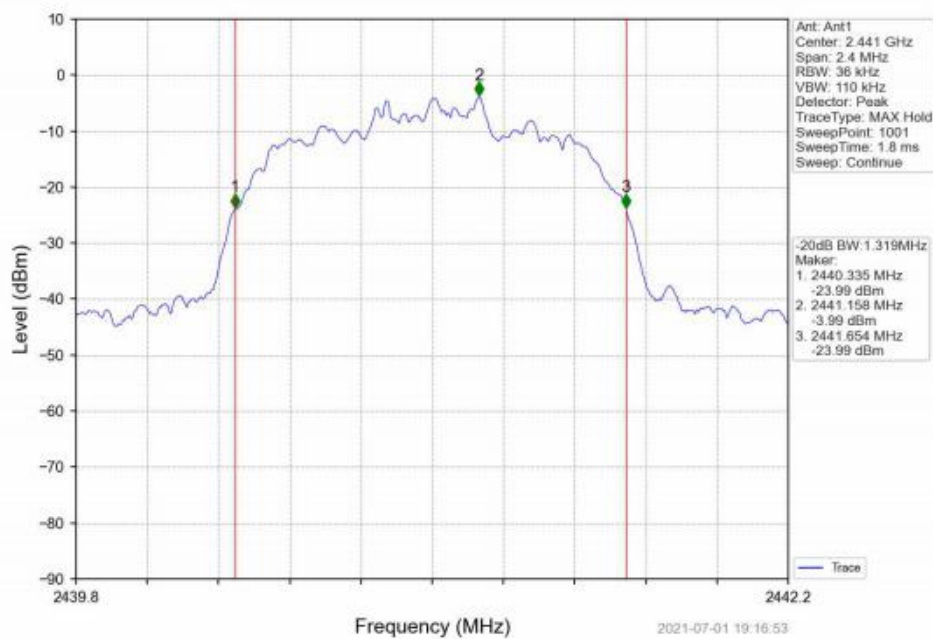


π /4-DQPSK_2DH5_HCH_2480MHz_Ant1_NTNV

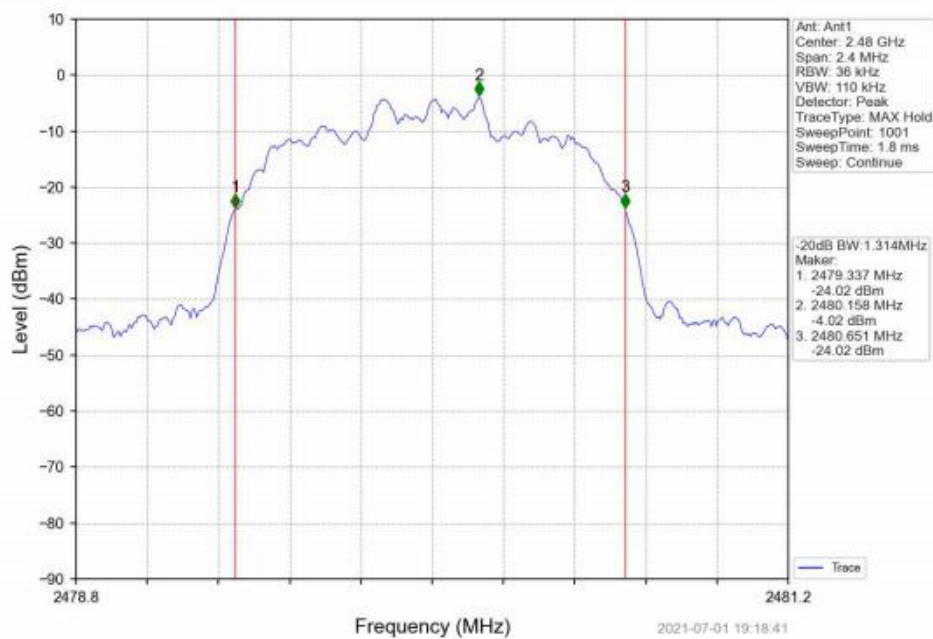


8DPSK_3DH5_LCH_2402MHz_Ant1_NTNV

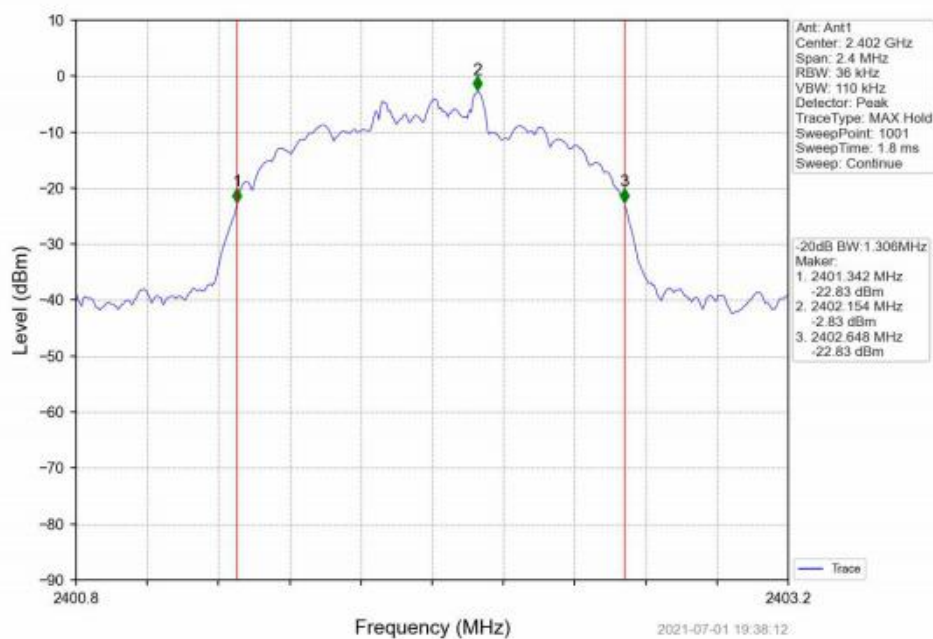

8DPSK_3DH5_MCH_2441MHz_Ant1_NTNV

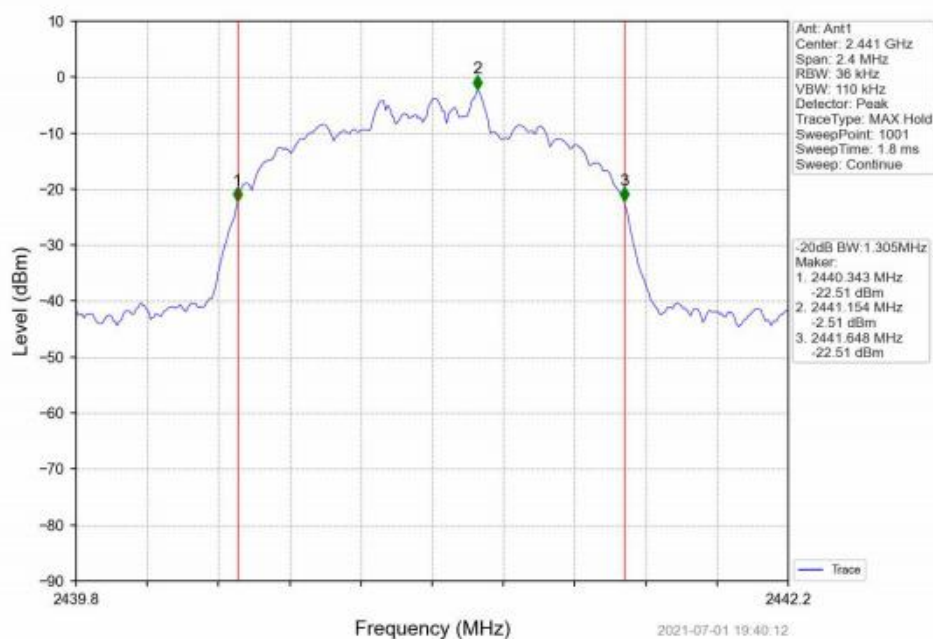

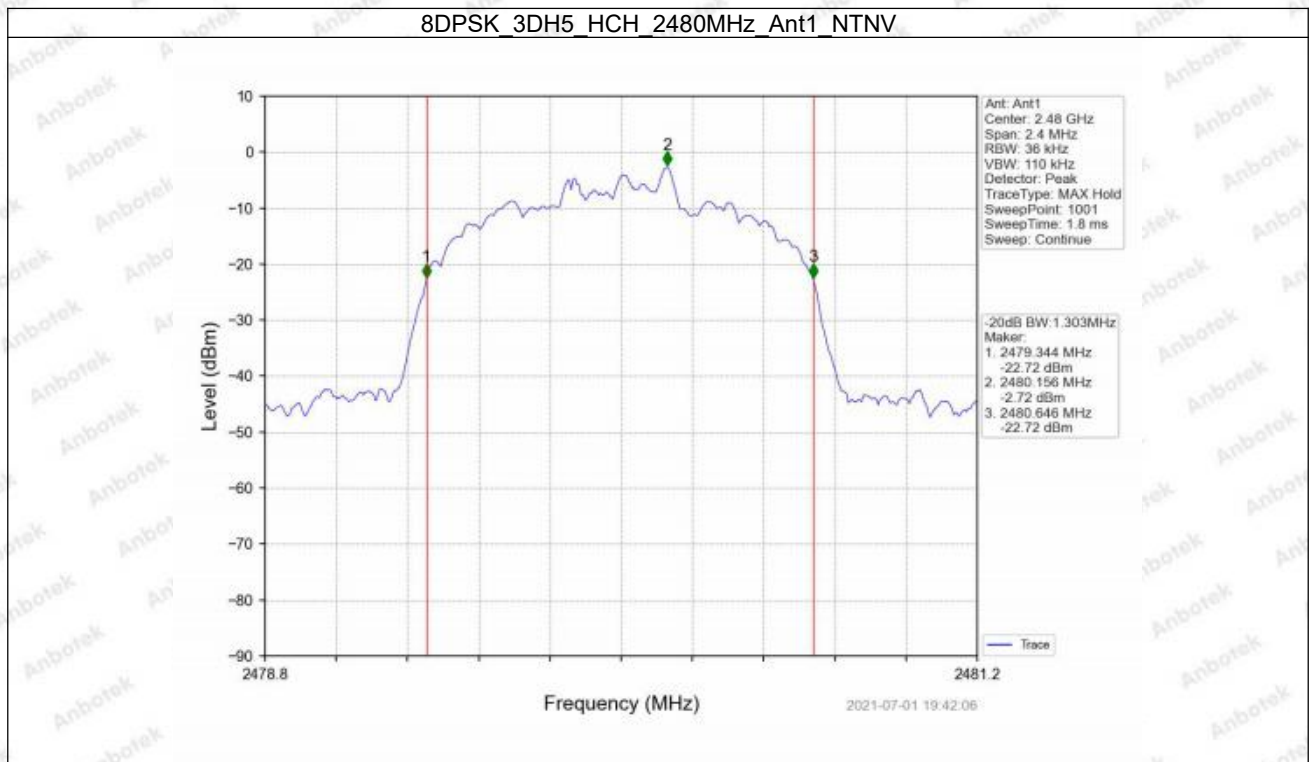

Shenzhen Anbotech Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.

Tel: (86) 755-26066440 Fax: (86) 755-26014772 Email: service@anbotech.com

Hotline
400-003-0500
www.anbotech.com

2. Maximum Conducted Output Power

2.1 Power


2.1.1 Test Result

Mode	TX Type	Frequency (MHz)	Packet Type	Measured Peak Output Power (dBm)	Limit (dBm)	Verdict
				Ant1		
GFSK	SISO	2402	DH5	-0.61	<=20.97	Pass
		2441	DH5	-0.28	<=20.97	Pass
		2480	DH5	0.58	<=20.97	Pass
$\pi/4$ -DQPSK	SISO	2402	2DH5	-0.76	<=20.97	Pass
		2441	2DH5	-0.39	<=20.97	Pass
		2480	2DH5	-0.37	<=20.97	Pass
8DPSK	SISO	2402	3DH5	-0.33	<=20.97	Pass
		2441	3DH5	0.14	<=20.97	Pass
		2480	3DH5	0.07	<=20.97	Pass


Note1: Antenna Gain: Ant1: 0.00dBi;

2.1.2 Test Graph



GFSK_DH5_LCH_2402MHz_Ant1_NTNV

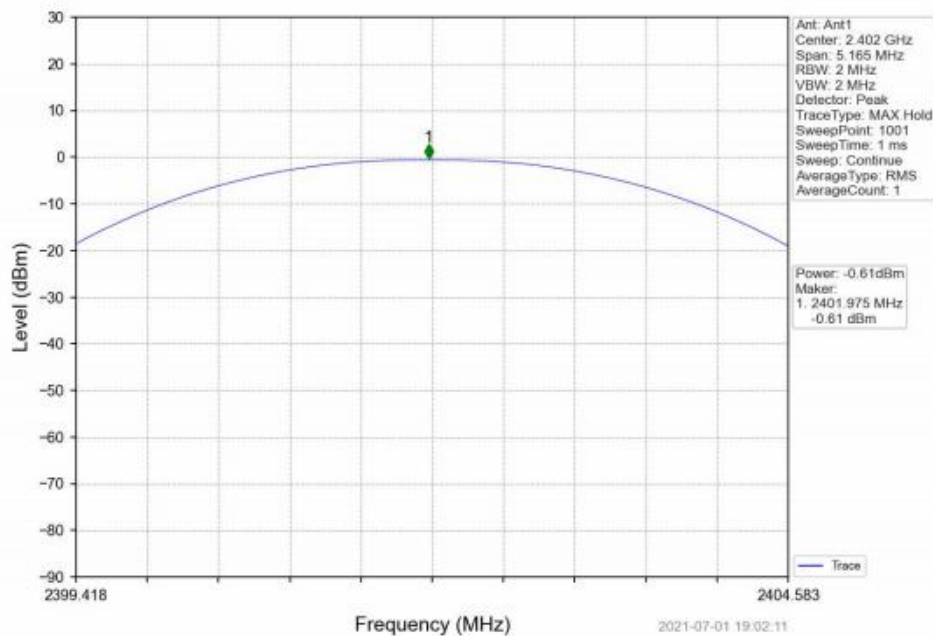

GFSK_DH5_MCH_2441MHz_Ant1_NTNV

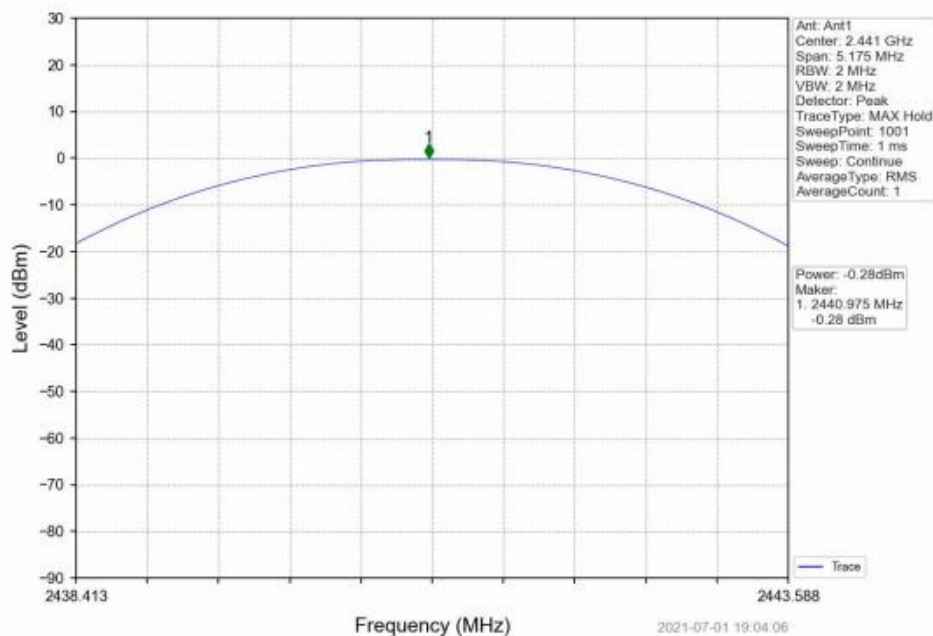

GFSK_DH5_HCH_2480MHz_Ant1_NTNV

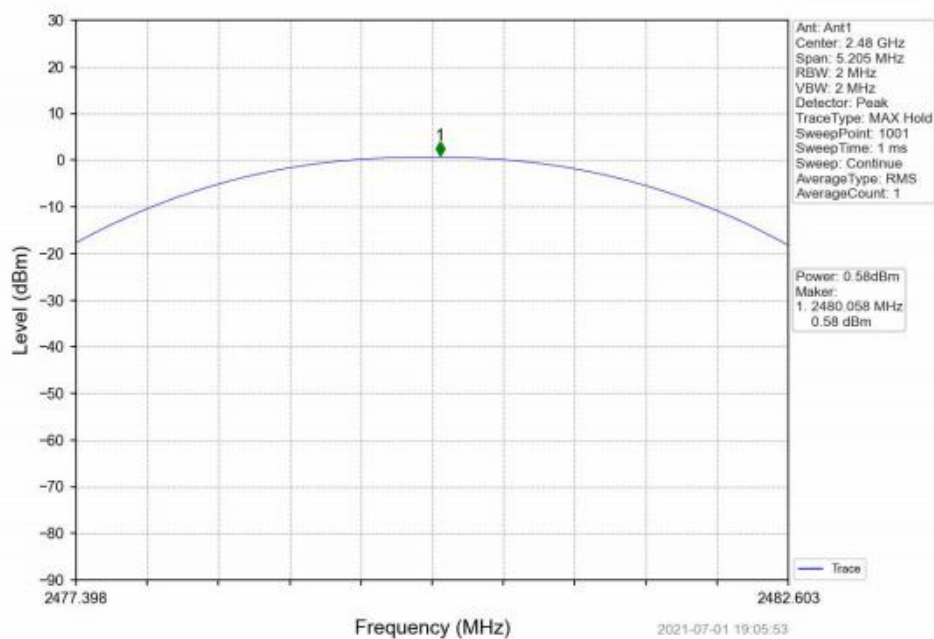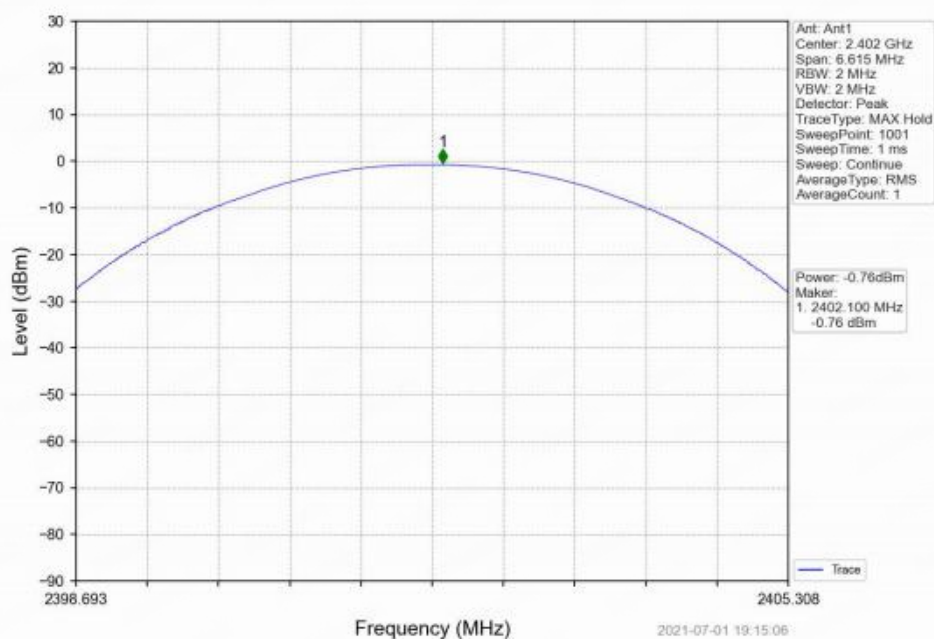 π /4-DQPSK_2DH5_LCH_2402MHz_Ant1_NTNV**Shenzhen Anbotek Compliance Laboratory Limited**

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.



Tel: (86) 755-26066440 Fax: (86) 755-26014772 Email: service@anbotek.com



Hotline

400-003-0500

www.anbotek.com

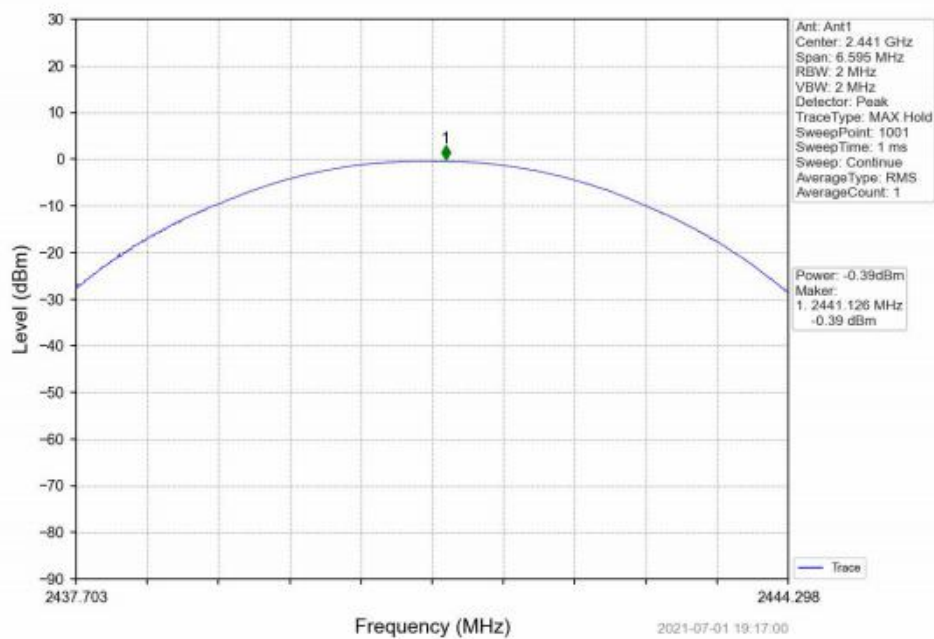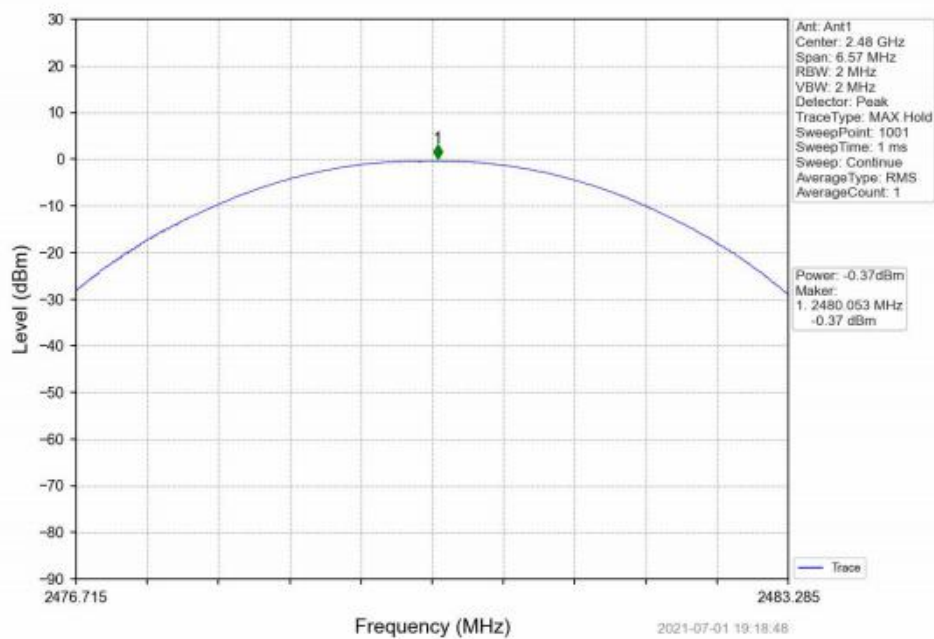π /4-DQPSK_2DH5_MCH_2441MHz_Ant1_NTNV π /4-DQPSK_2DH5_HCH_2480MHz_Ant1_NTNV**Shenzhen Anbotech Compliance Laboratory Limited**

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.

Tel: (86) 755-26066440 Fax: (86) 755-26014772 Email: service@anbotech.com




Hotline


400-003-0500

www.anbotech.com

8DPSK_3DH5_LCH_2402MHz_Ant1_NTNV

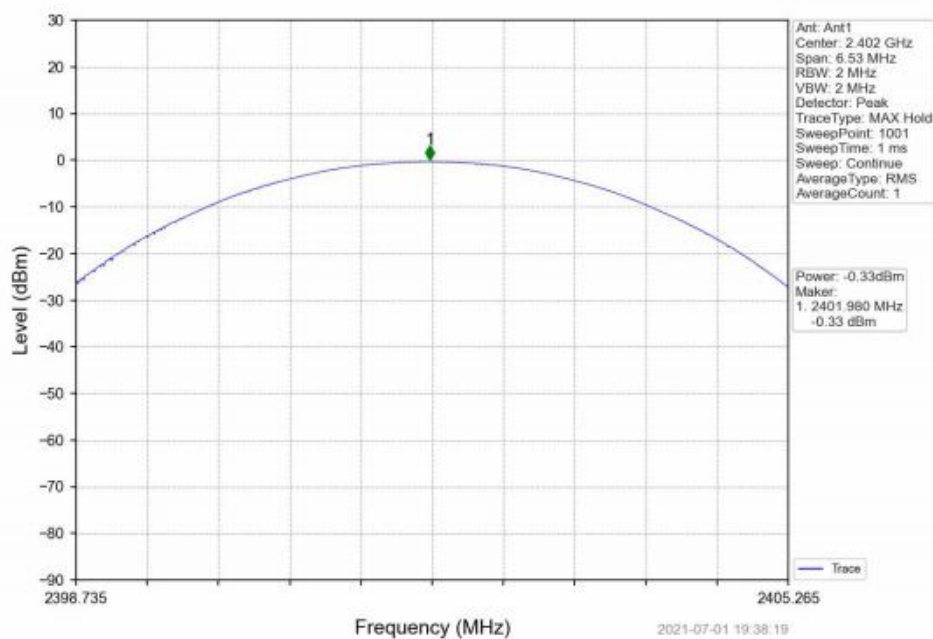

8DPSK_3DH5_MCH_2441MHz_Ant1_NTNV

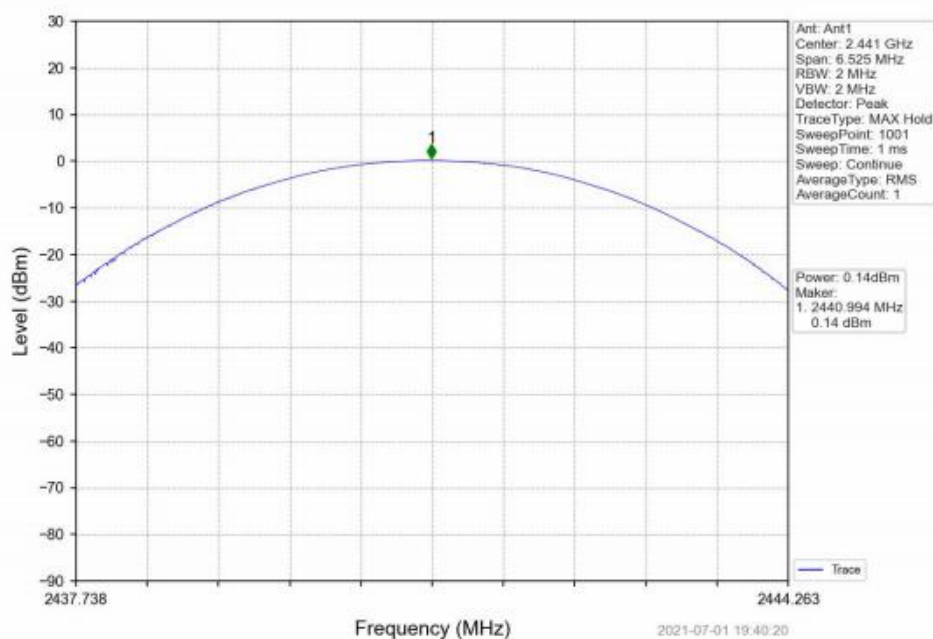


Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.

Tel: (86) 755-26066440 Fax: (86) 755-26014772 Email: service@anbotek.com

Hotline
400-003-0500
www.anbotek.com

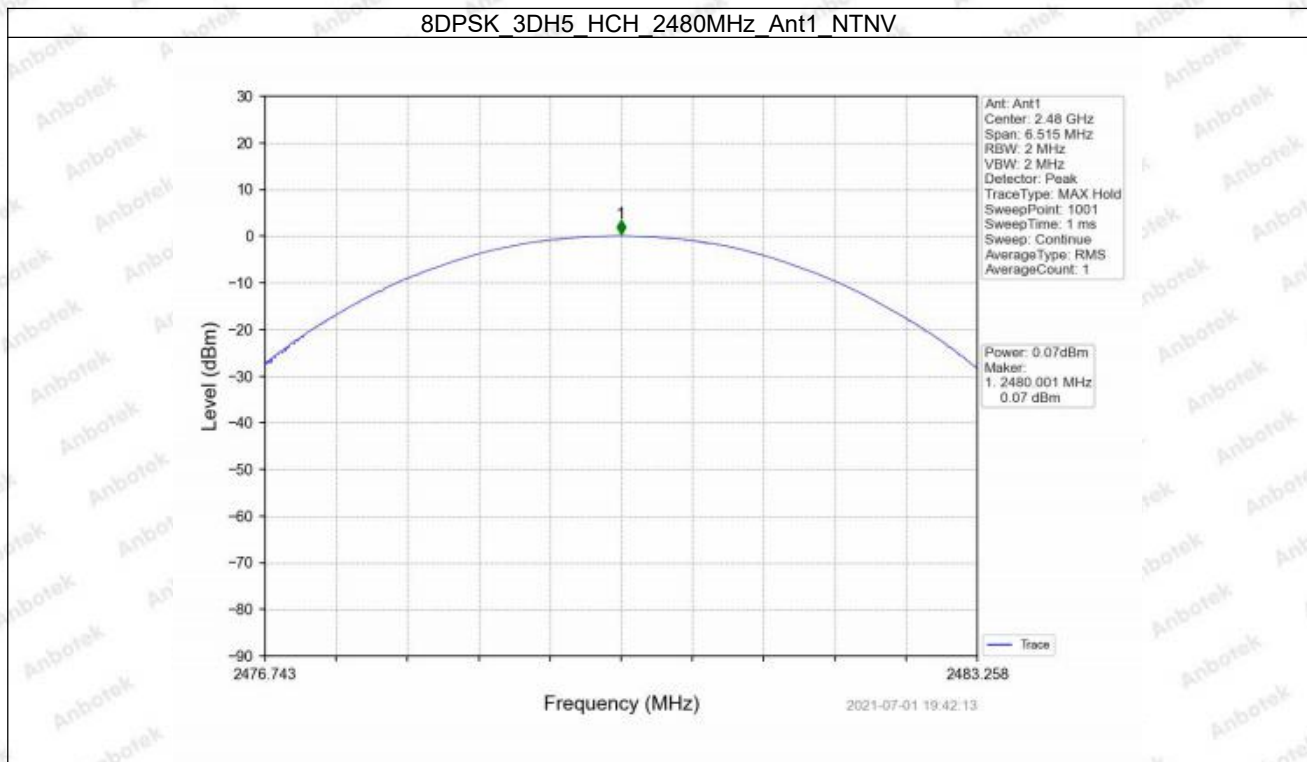**Shenzhen Anbotek Compliance Laboratory Limited**

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.

Tel: (86) 755-26066440 Fax: (86) 755-26014772 Email: service@anbotek.com



Hotline

400-003-0500

www.anbotek.com


3. Carrier Frequency Separation


3.1 Ant1

3.1.1 Test Result

Ant1							
Mode	TX Type	Frequency (MHz)	Packet Type	Channel Separation (MHz)	20dB Bandwidth (MHz)	Limit (MHz)	Verdict
GFSK	SISO	HOPP	DH5	1.00	1.03	≥ 0.689	Pass
$\pi/4$ -DQPSK	SISO	HOPP	2DH5	1.00	1.32	≥ 0.882	Pass
8DPSK	SISO	HOPP	3DH5	0.99	1.31	≥ 0.871	Pass

3.1.2 Test Graph

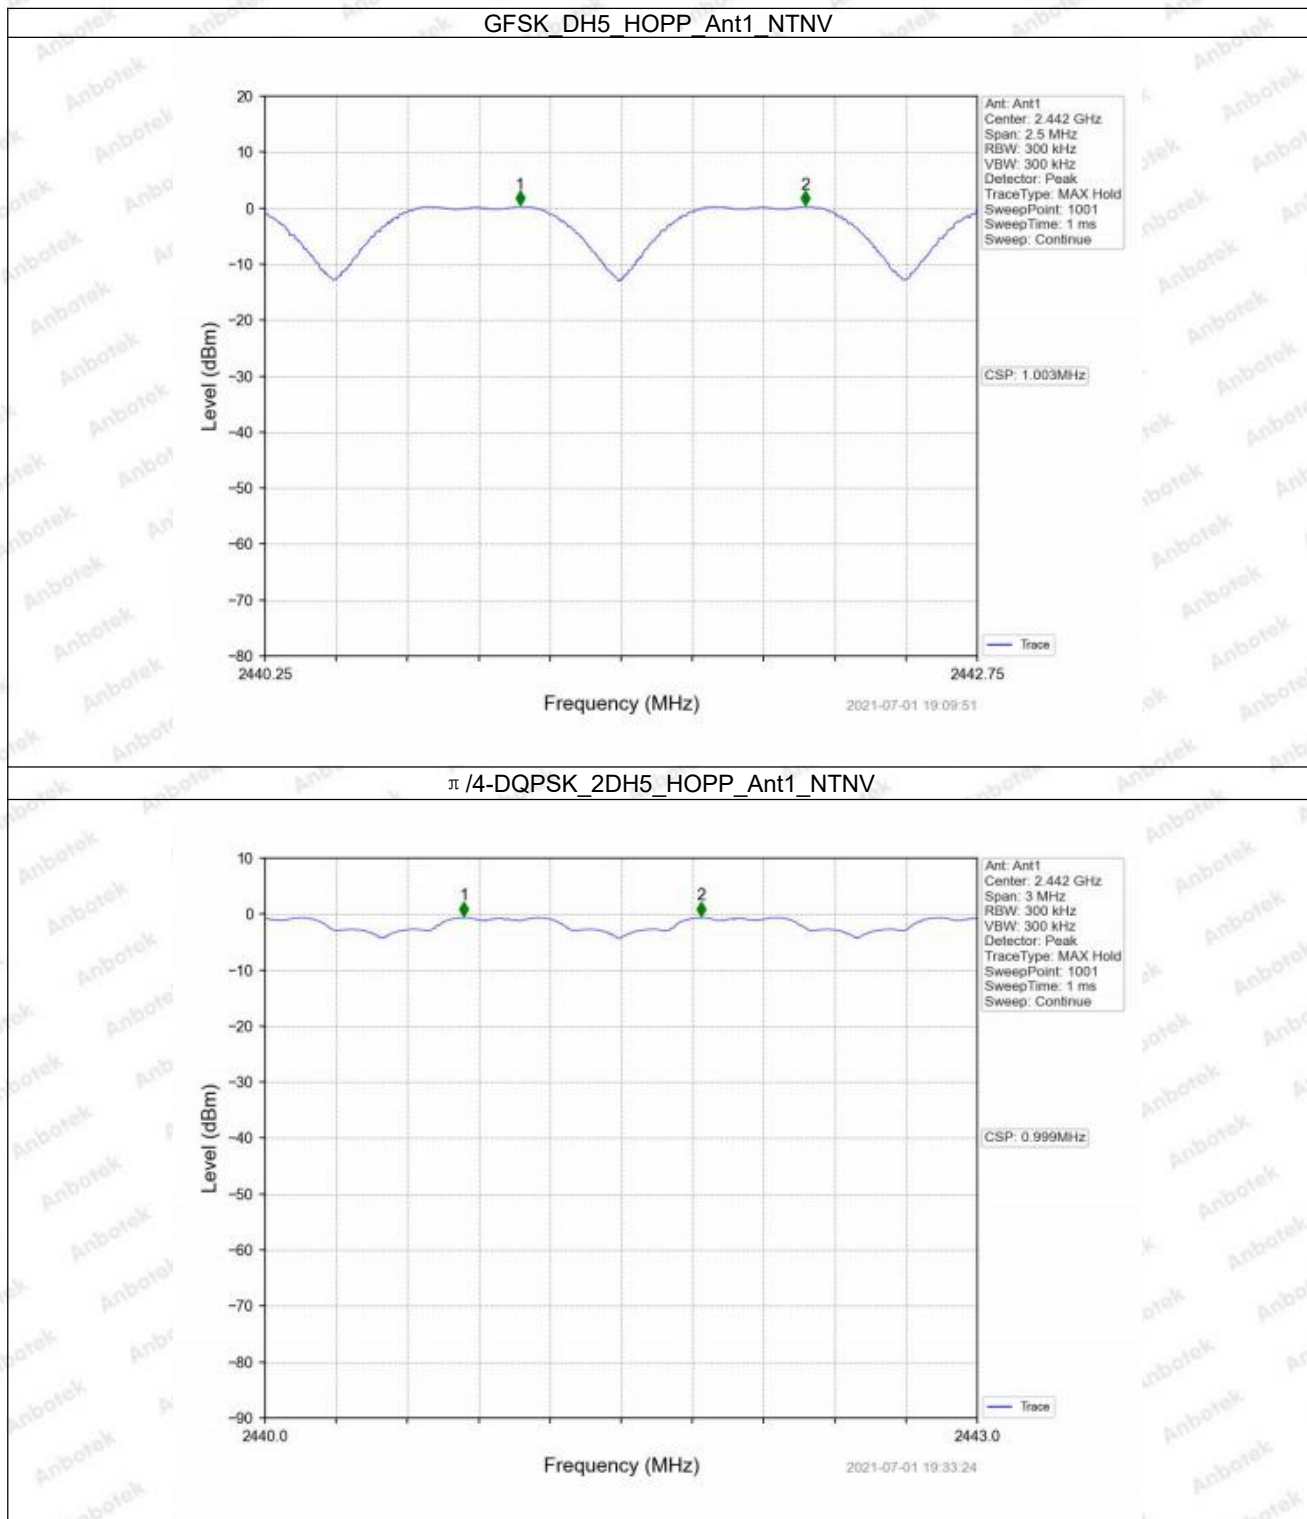

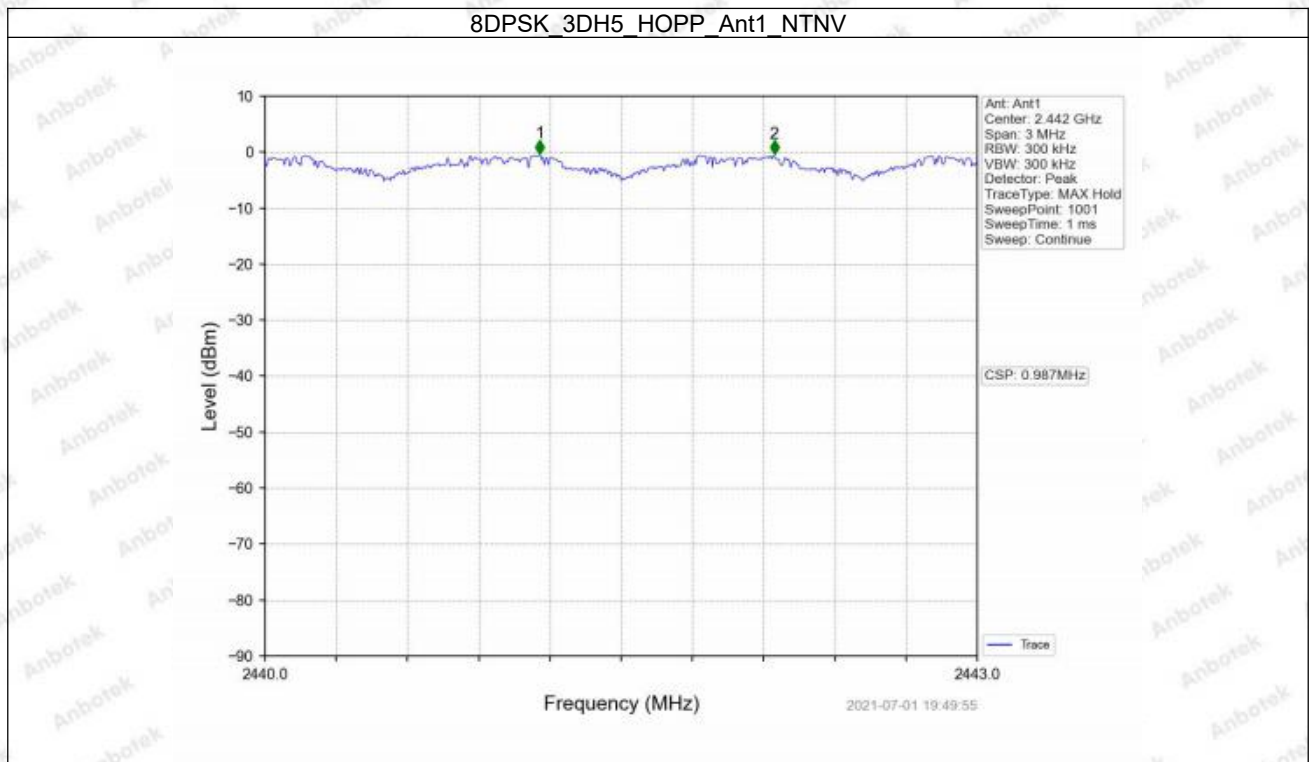

Shenzhen Anbotech Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.

Tel: (86) 755-26066440 Fax: (86) 755-26014772 Email: service@anbotech.com



Hotline
400-003-0500
www.anbotech.com


4. Number of Hopping Frequencies

4.1 HopNum

4.1.1 Test Result

Mode	TX Type	Frequency (MHz)	Packet Type	Num of Hopping Frequencies	Limit	Verdict
				Ant1		
GFSK	SISO	HOPP	DH5	79	>=15	Pass
$\pi/4$ -DQPSK	SISO	HOPP	2DH5	79	>=15	Pass
8DPSK	SISO	HOPP	3DH5	79	>=15	Pass

4.1.2 Test Graph

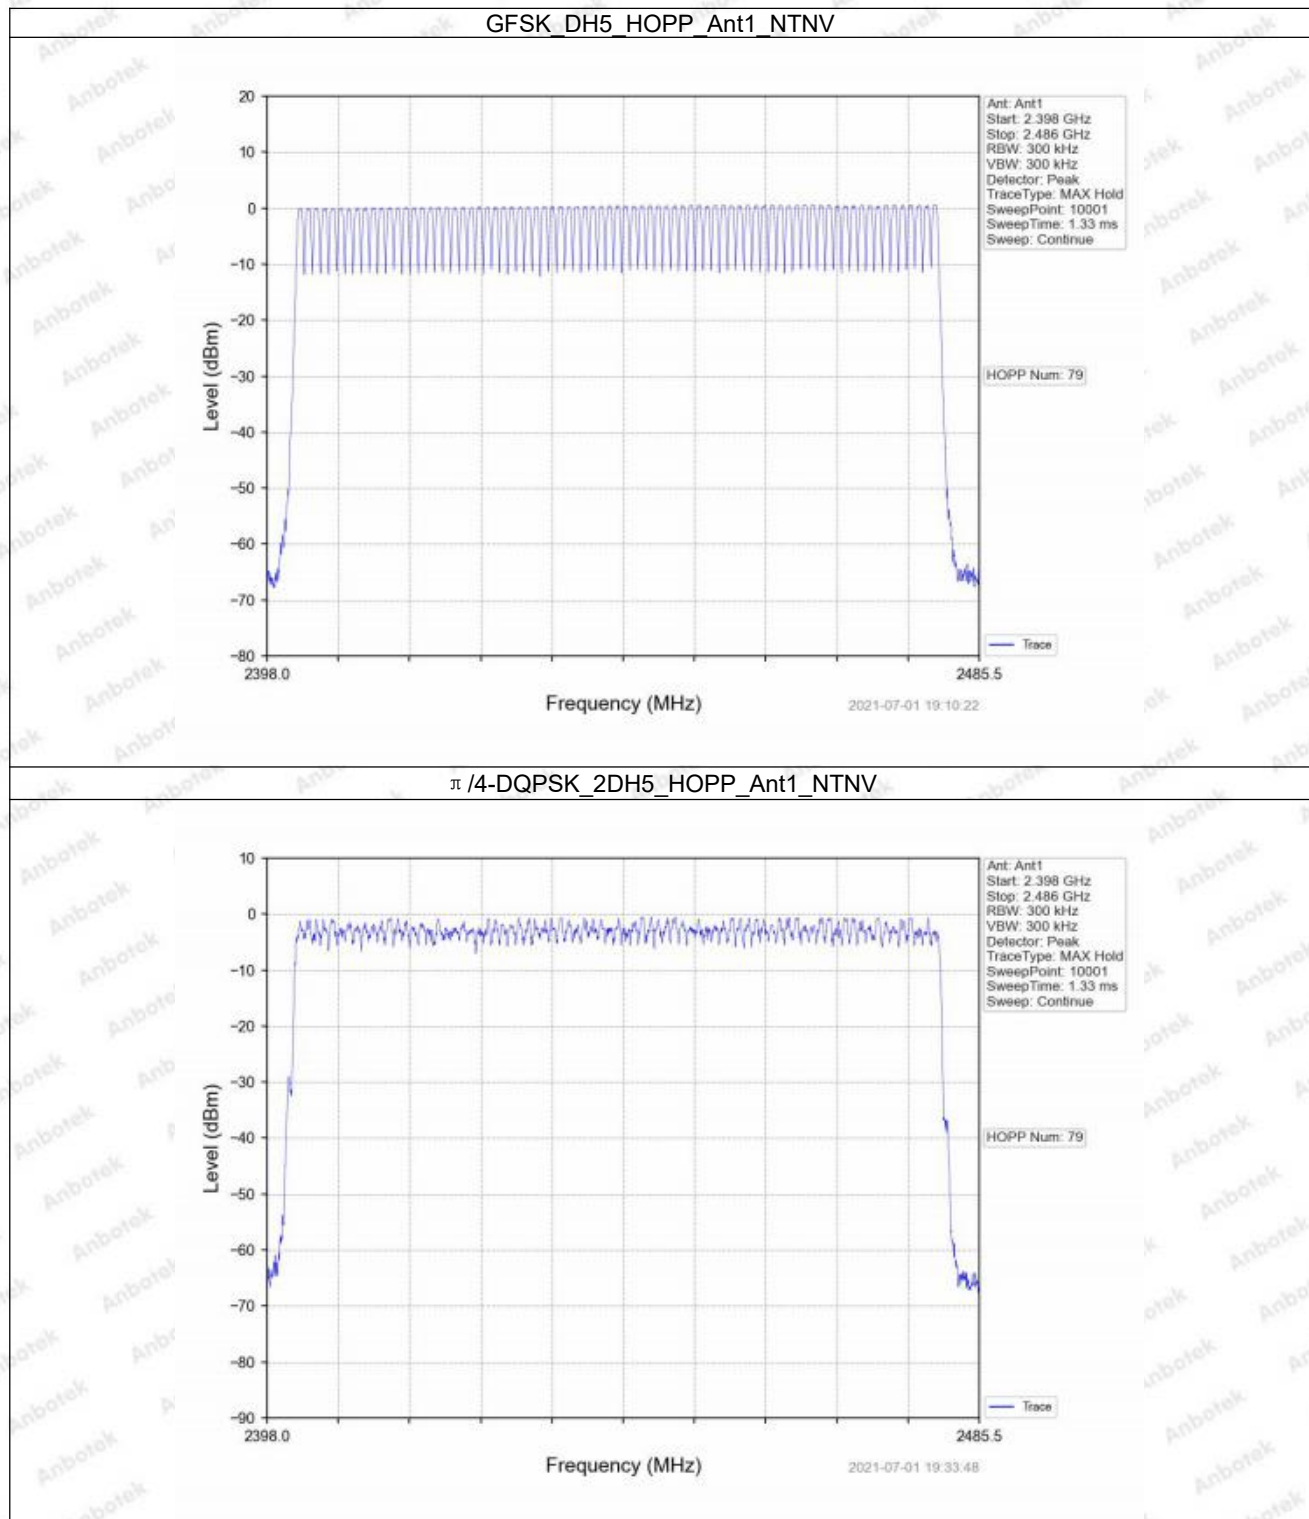

Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.


Tel: (86) 755-26066440 Fax: (86) 755-26014772 Email: service@anbotek.com



Hotline

400-003-0500

www.anbotek.com

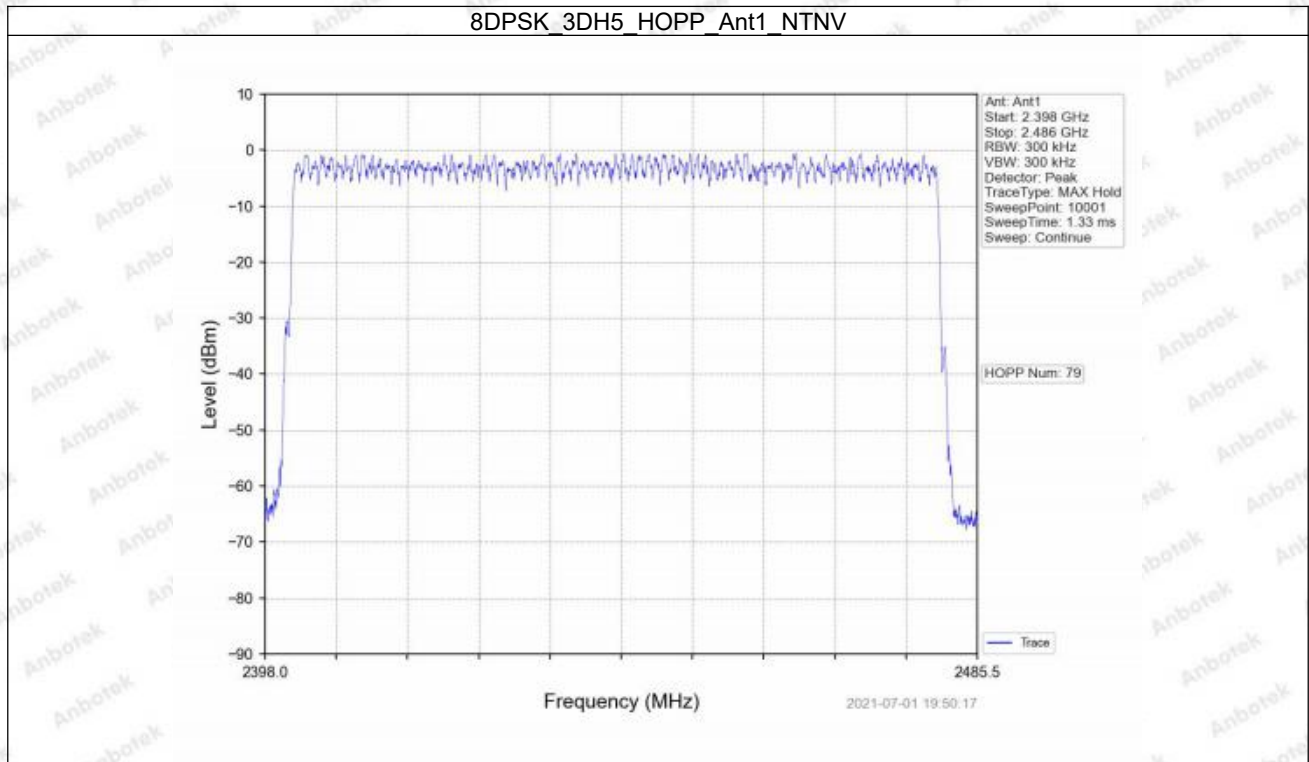

Shenzhen Anbotech Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.

Tel: (86) 755-26066440 Fax: (86) 755-26014772 Email: service@anbotech.com



Hotline

400-003-0500

www.anbotech.com


5. Time of Occupancy (Dwell Time)

5.1 Ant1

5.1.1 Test Result

Ant1									
Mode	TX Type	Frequency (MHz)	Packet Type	Duration of Single Pulse (ms)	Observation Period (s)	Num of Pulse in Observation Period	Dwell Time (ms)	Limit (ms)	Verdict
GFSK	SISO	HOPP	DH1	0.38	31.60	319	120.58	<=400	Pass
			DH3	1.63	31.60	162	264.71	<=400	Pass
			DH5	2.88	31.60	112	323.01	<=400	Pass
$\pi/4$ -DQPSK	SISO	HOPP	2DH1	0.39	31.60	319	123.13	<=400	Pass
			2DH3	1.64	31.60	164	268.30	<=400	Pass
			2DH5	2.89	31.60	111	320.35	<=400	Pass
8DPSK	SISO	HOPP	3DH1	0.39	31.60	319	123.77	<=400	Pass
			3DH3	1.64	31.60	162	265.36	<=400	Pass
			3DH5	2.89	31.60	111	320.57	<=400	Pass

5.1.2 Test Graph

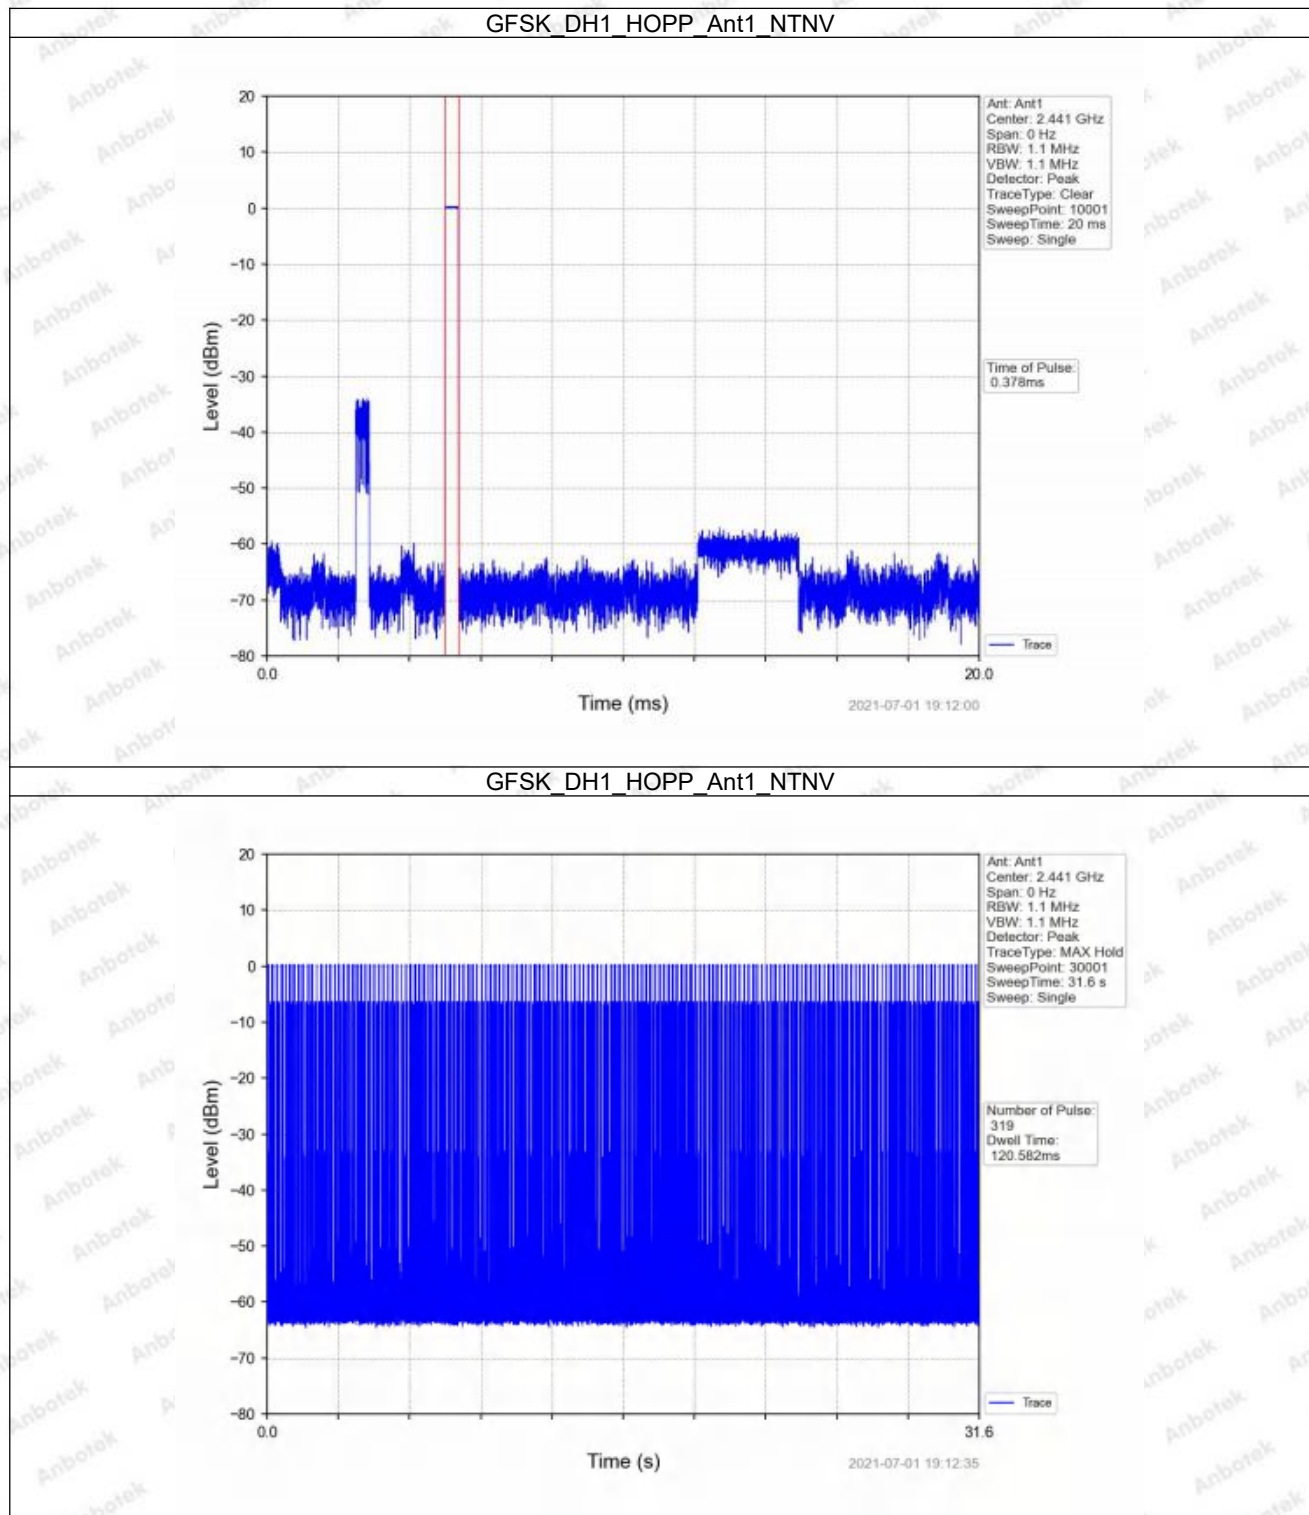


Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.


Tel: (86) 755-26066440 Fax: (86) 755-26014772 Email: service@anbotek.com

Hotline
400-003-0500
www.anbotek.com


GFSK_DH3_HOPP_Ant1_NTNV

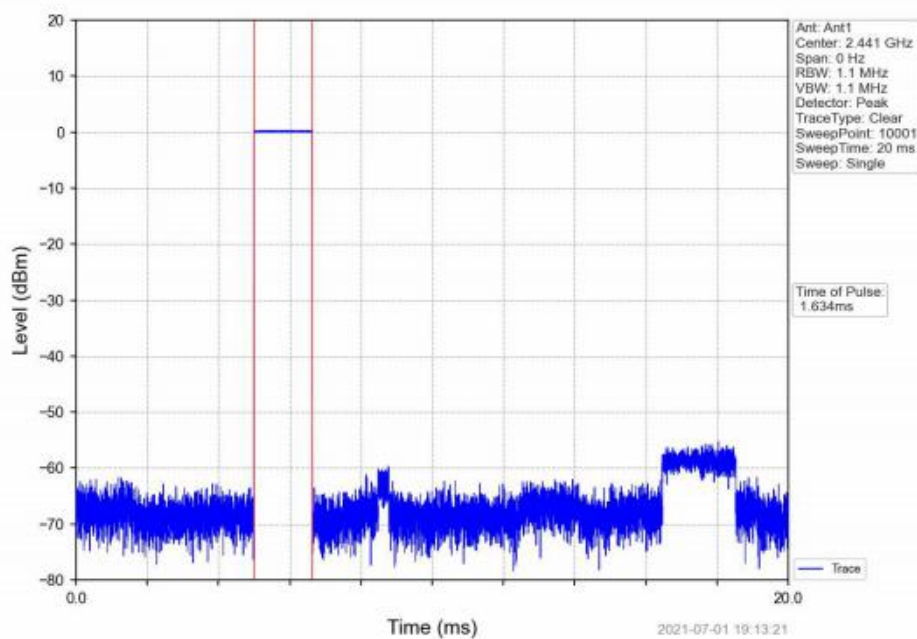


GFSK_DH3_HOPP_Ant1_NTNV

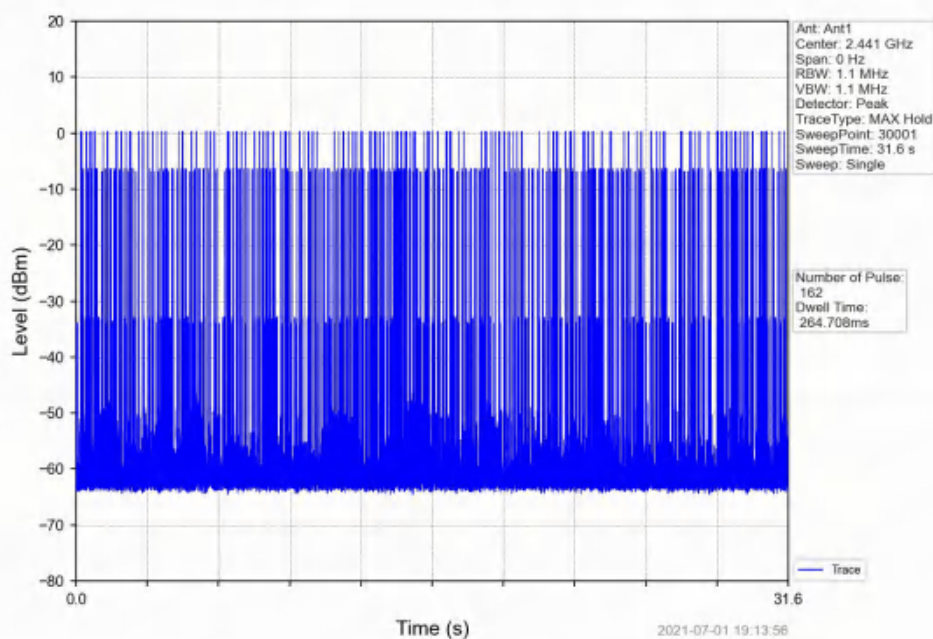


GFSK_DH5_HOPP_Ant1_NTNV

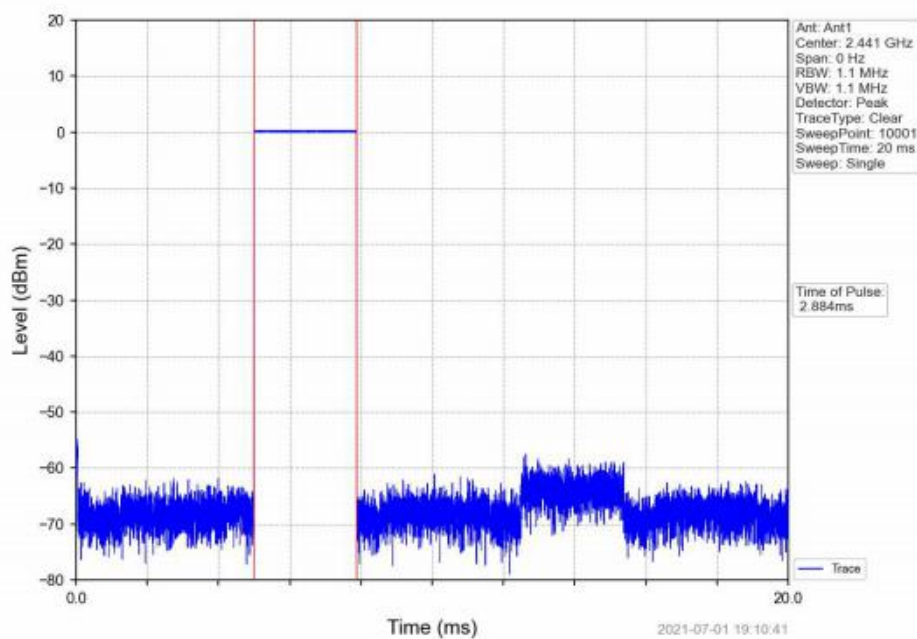


GFSK_DH5_HOPP_Ant1_NTNV


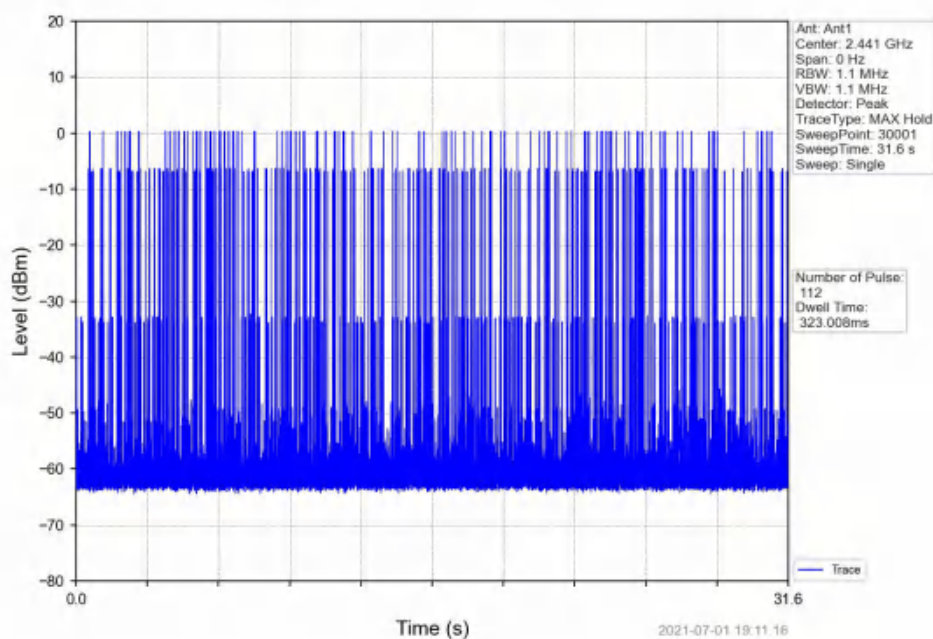




$\pi/4$ -DQPSK_2DH1_HOPP_Ant1_NTNV

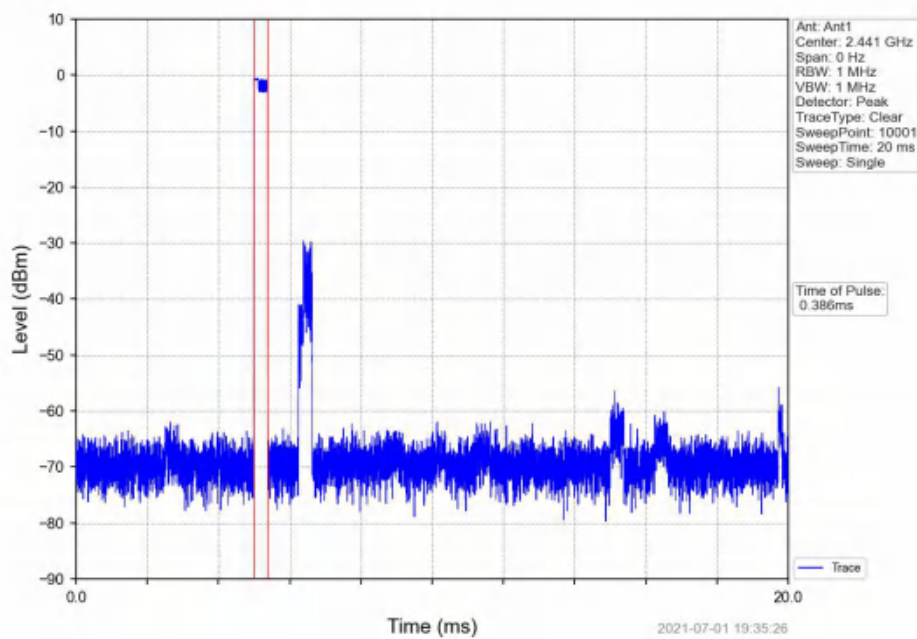


$\pi/4$ -DQPSK_2DH1_HOPP_Ant1_NTNV

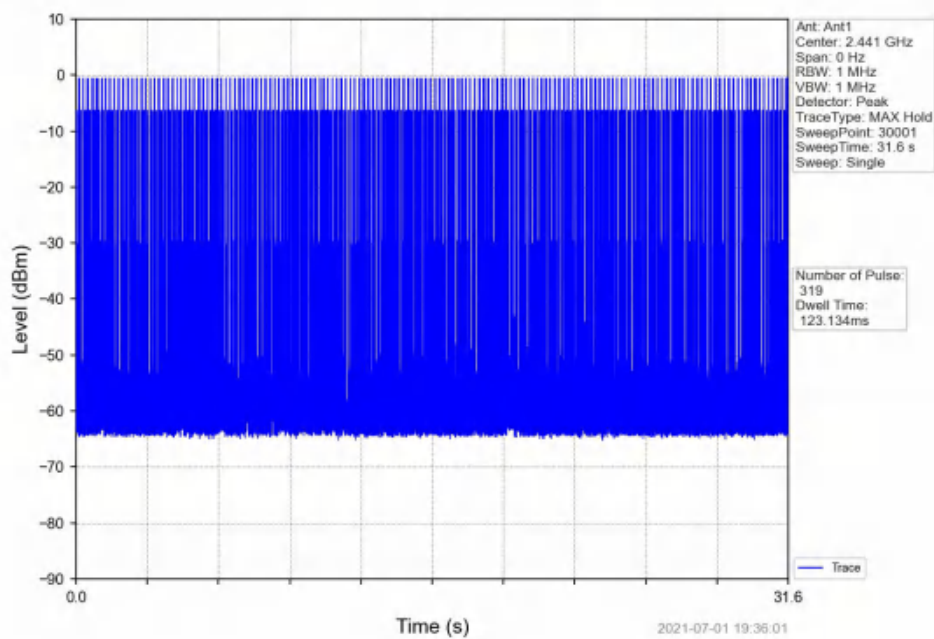

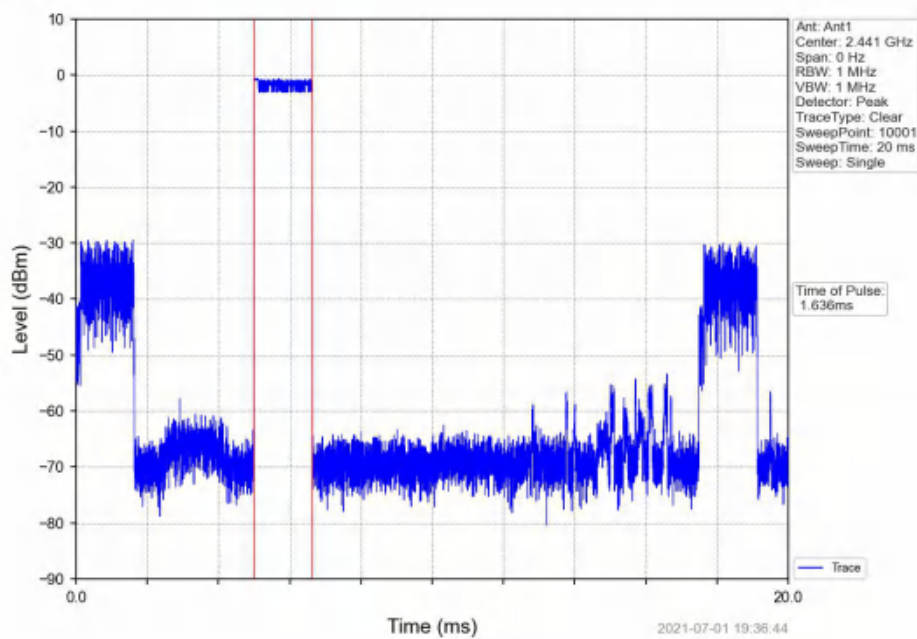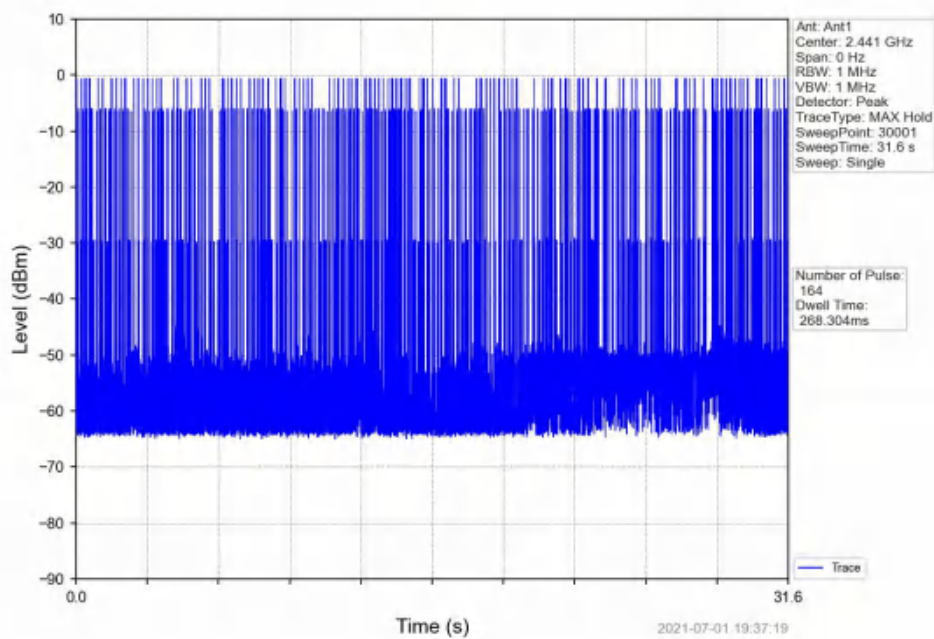
$\pi/4$ -DQPSK_2DH3_HOPP_Ant1_NTNV $\pi/4$ -DQPSK_2DH3_HOPP_Ant1_NTNV

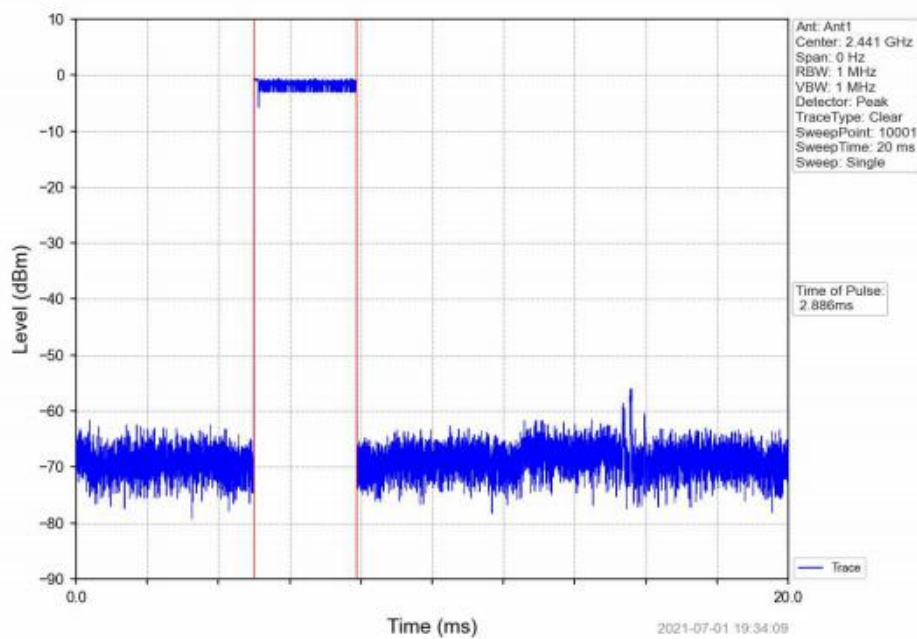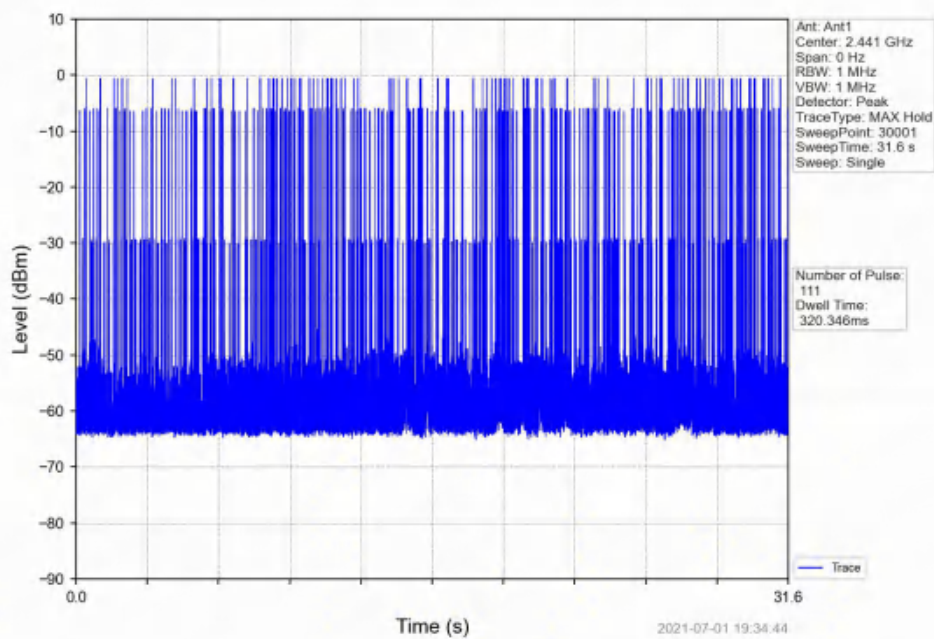$\pi/4$ -DQPSK_2DH5_HOPP_Ant1_NTNV $\pi/4$ -DQPSK_2DH5_HOPP_Ant1_NTNV

8DPSK_3DH1_HOPP_Ant1_NTNV

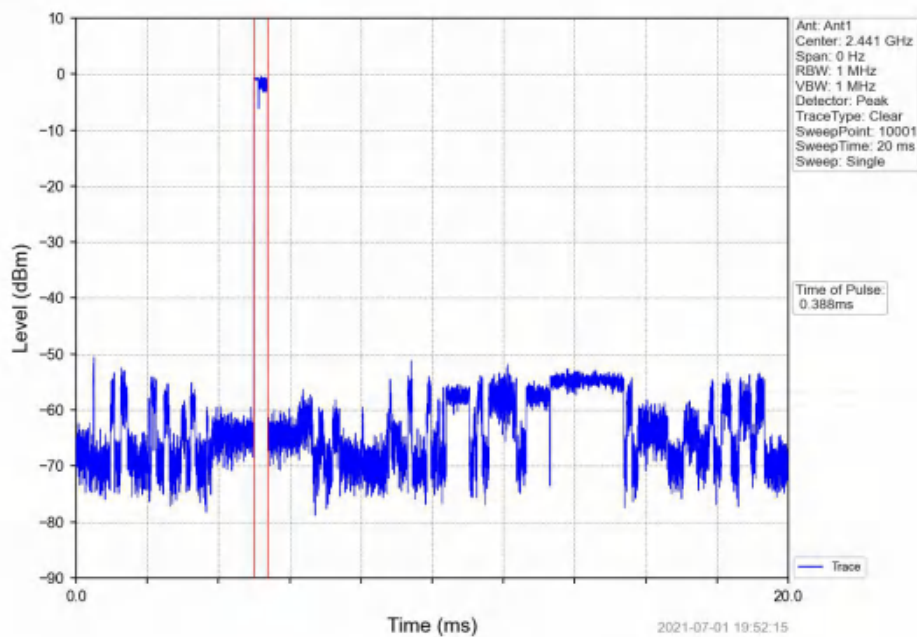

8DPSK_3DH1_HOPP_Ant1_NTNV

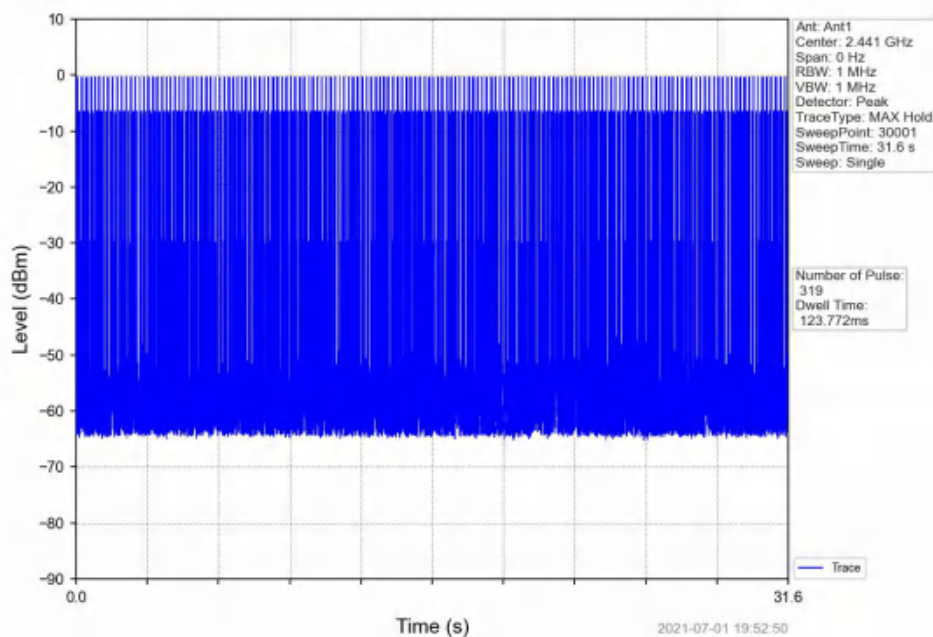


Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.


Tel: (86) 755-26066440 Fax: (86) 755-26014772 Email: service@anbotek.com

Hotline
400-003-0500
www.anbotek.com


8DPSK_3DH3_HOPP_Ant1_NTNV

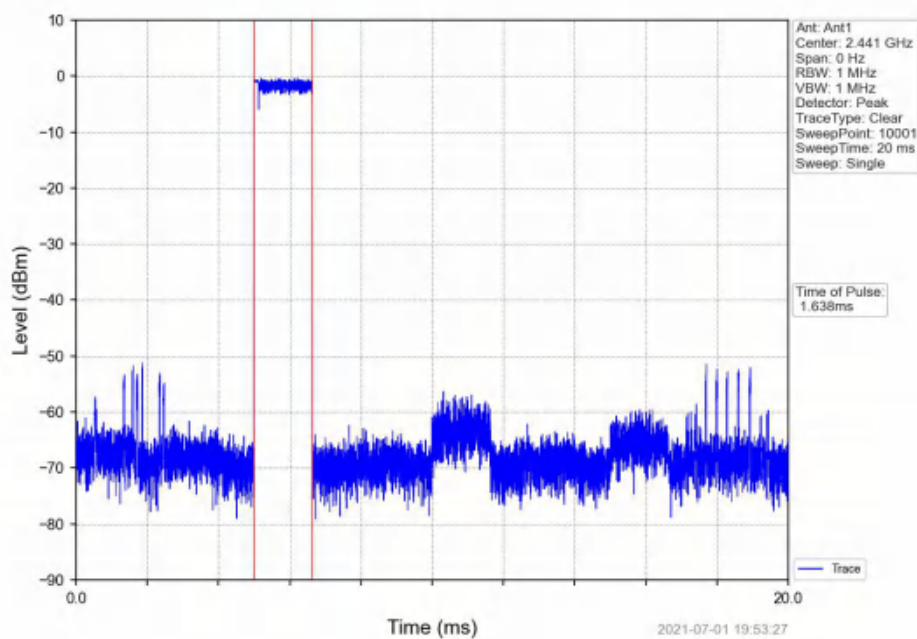


8DPSK_3DH3_HOPP_Ant1_NTNV

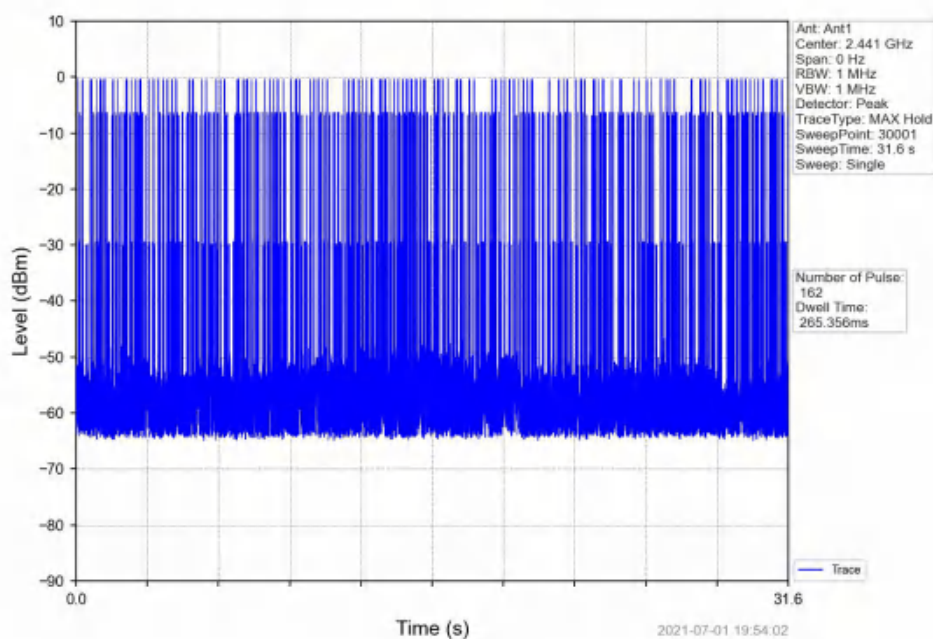

8DPSK_3DH5_HOPP_Ant1_NTNV

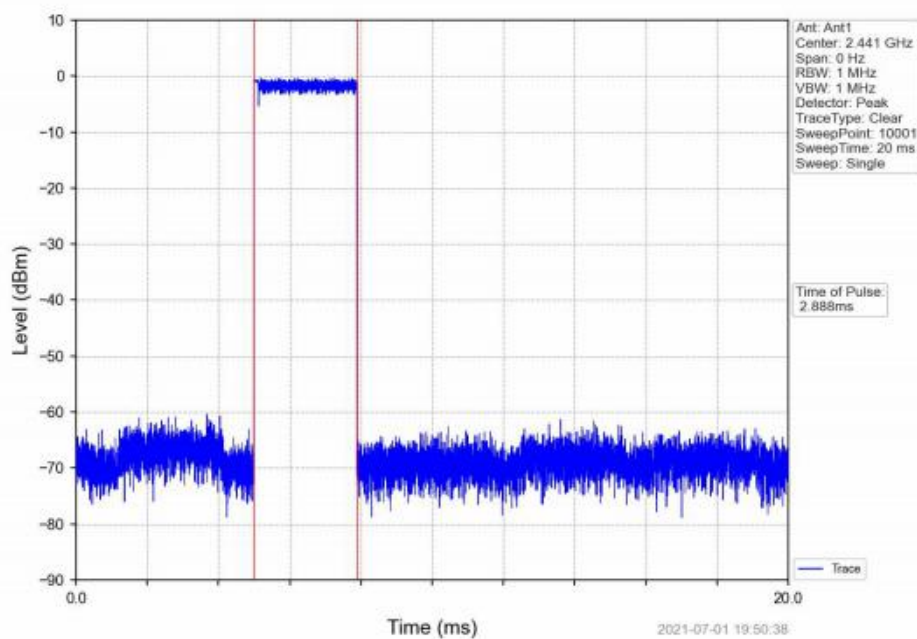

8DPSK_3DH5_HOPP_Ant1_NTNV

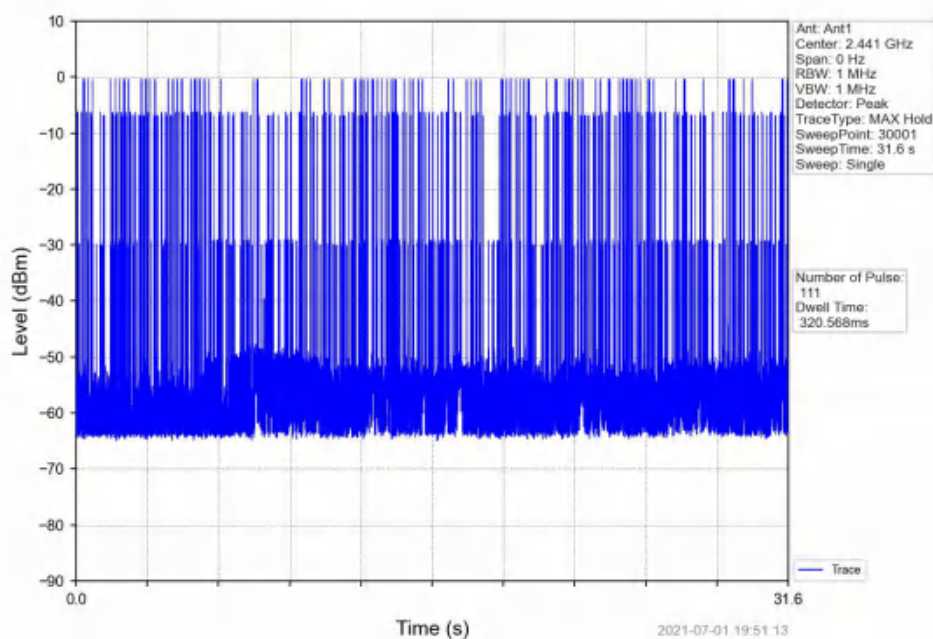

6. Unwanted Emissions In Non-restricted Frequency Bands

6.1 Ref


6.1.1 Test Result

Mode	TX Type	Frequency (MHz)	Packet Type	Ant	Level of Reference (dBm)	Limit (dBm)	Verdict
GFSK	SISO	2402	DH5	1	-0.98	/	/
		2441	DH5	1	-0.47	/	/
		2480	DH5	1	0.28	/	/
$\pi/4$ -DQPSK	SISO	2402	2DH5	1	-1.39	/	/
		2441	2DH5	1	-1.14	/	/
		2480	2DH5	1	-1.24	/	/
8DPSK	SISO	2402	3DH5	1	-1.16	/	/
		2441	3DH5	1	-0.74	/	/
		2480	3DH5	1	-1.14	/	/


Note1: Refer to FCC Part 15.247 (d) and ANSI C63.10-2020, the channel contains the maximum PSD level was used to establish the reference level.

6.1.2 Test Graph


GFSK_DH5_LCH_2402MHz_Ant1_NTNV

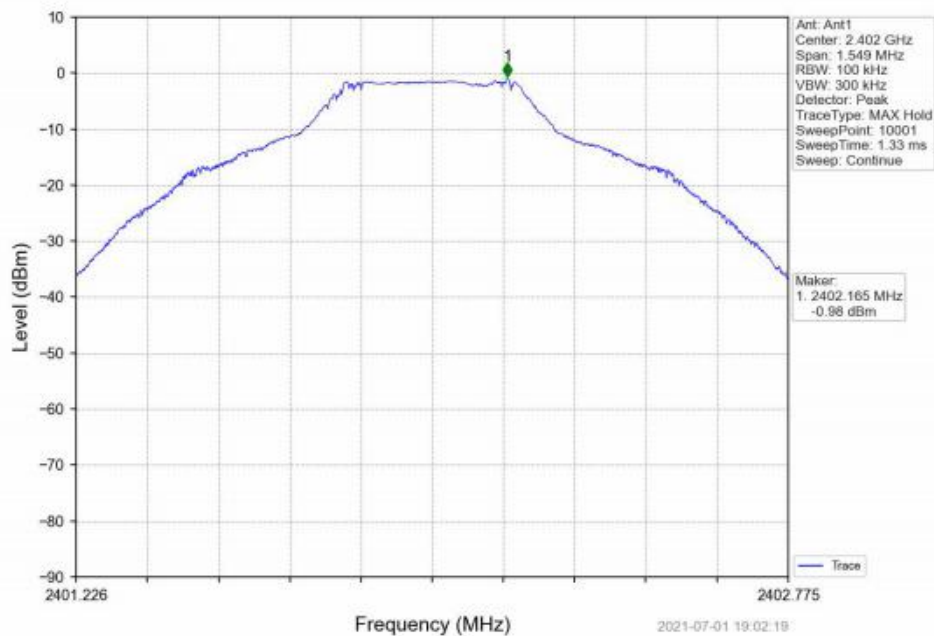


GFSK_DH5_MCH_2441MHz_Ant1_NTNV


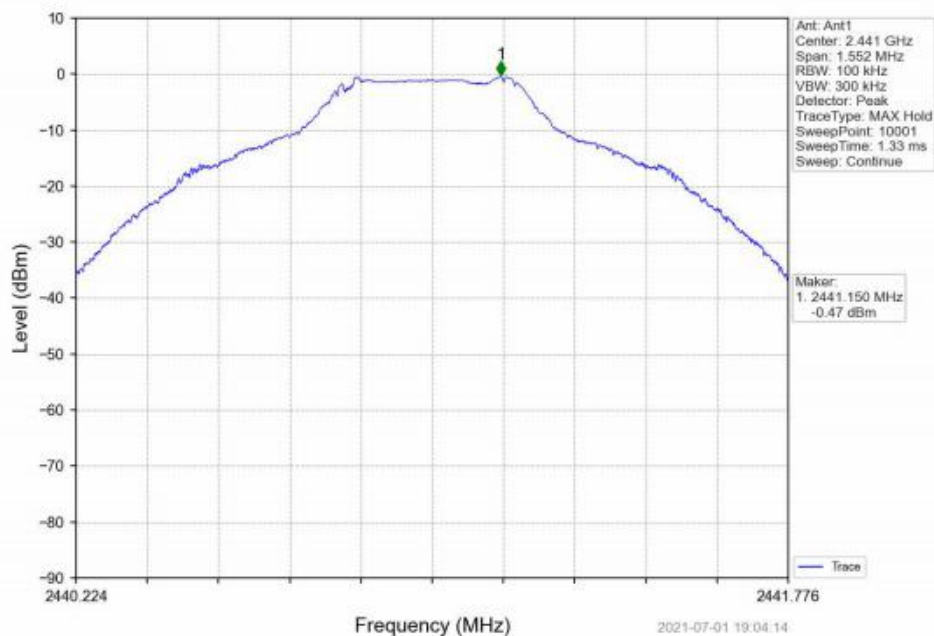


GFSK_DH5_HCH_2480MHz_Ant1_NTNV

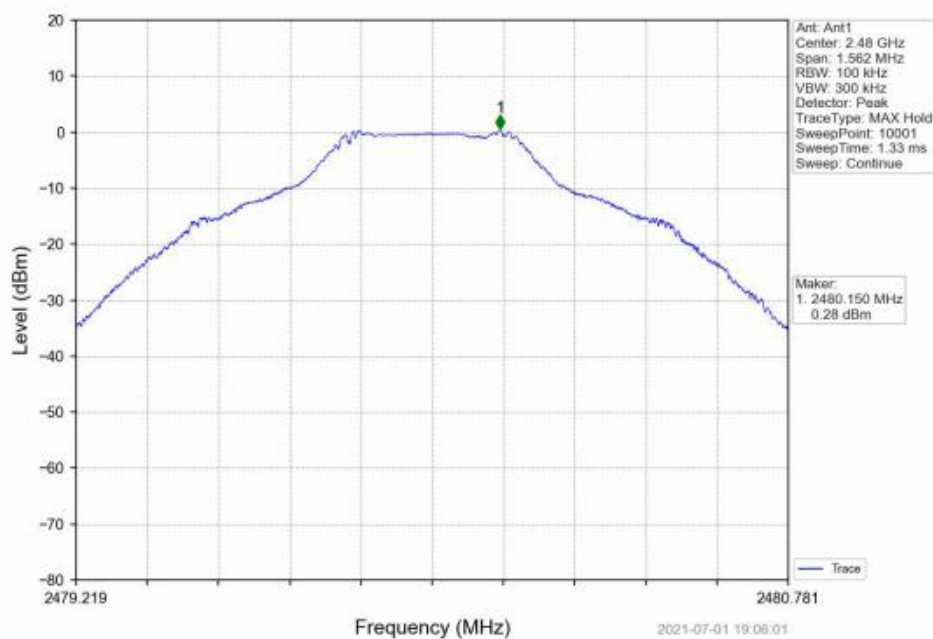

π /4-DQPSK_2DH5_LCH_2402MHz_Ant1_NTNV

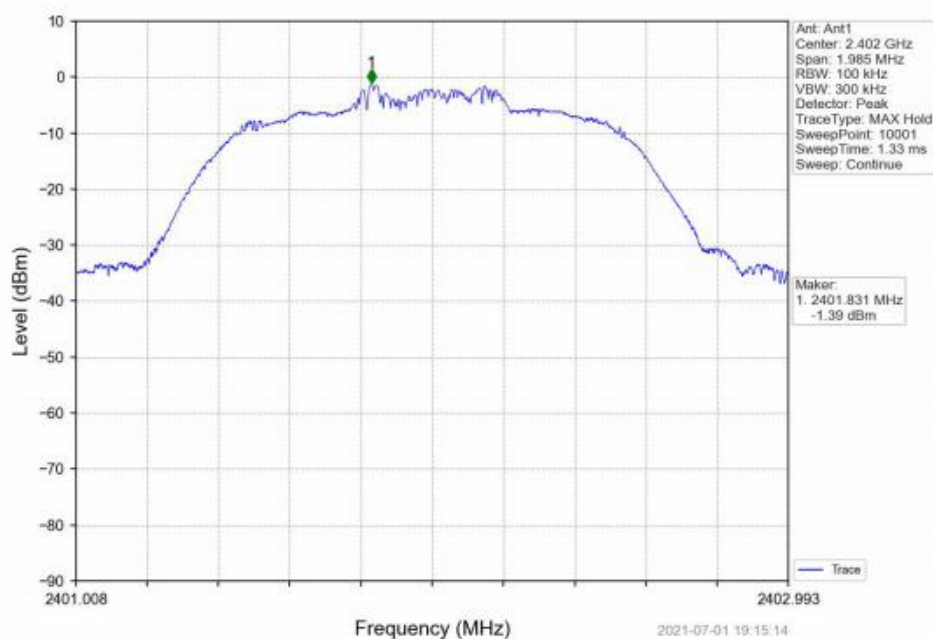

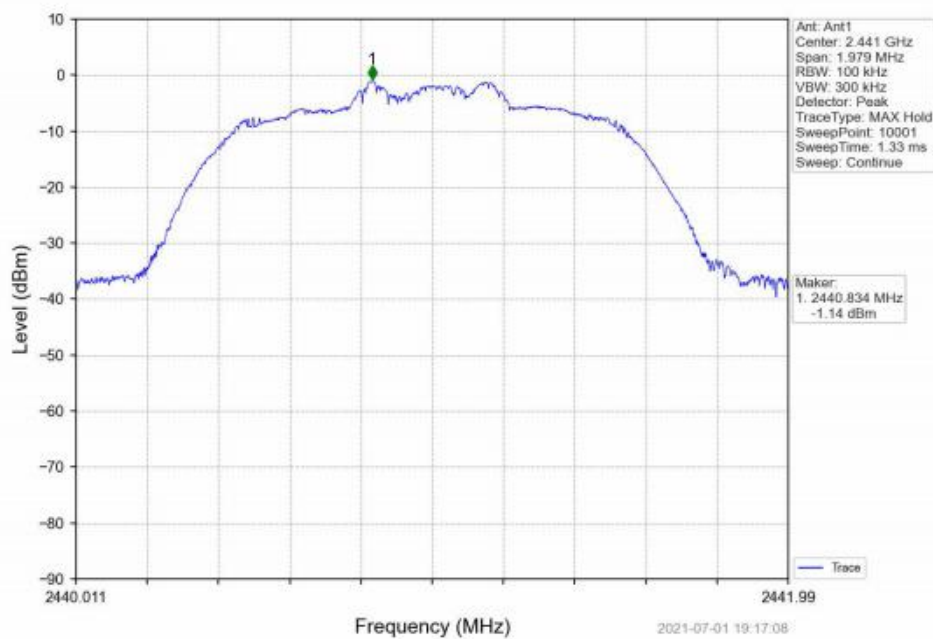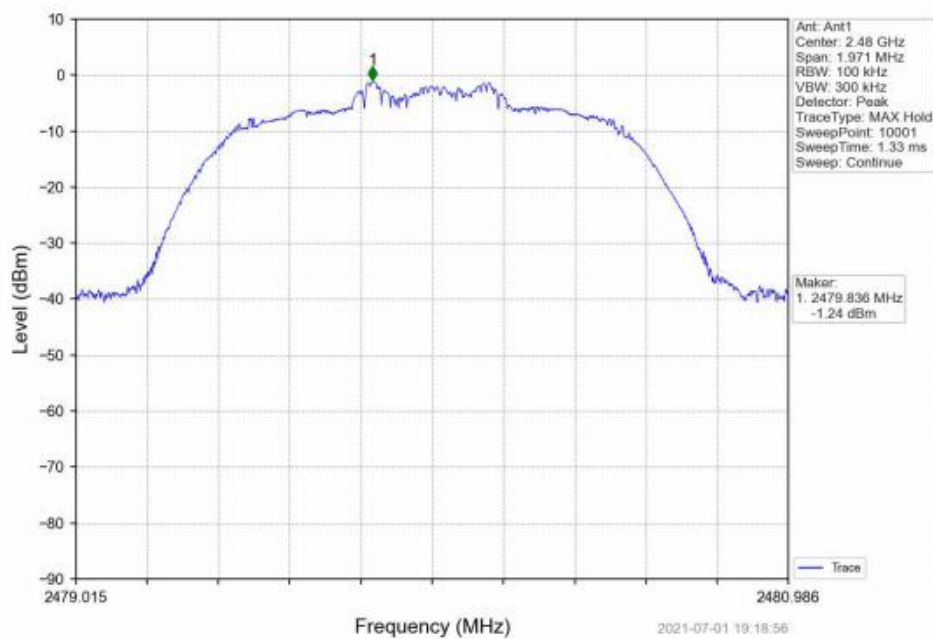π /4-DQPSK_2DH5_MCH_2441MHz_Ant1_NTNV π /4-DQPSK_2DH5_HCH_2480MHz_Ant1_NTNV**Shenzhen Anbotech Compliance Laboratory Limited**

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.

Tel: (86) 755-26066440 Fax: (86) 755-26014772 Email: service@anbotech.com




Hotline


400-003-0500


www.anbotech.com

8DPSK_3DH5_LCH_2402MHz_Ant1_NTNV

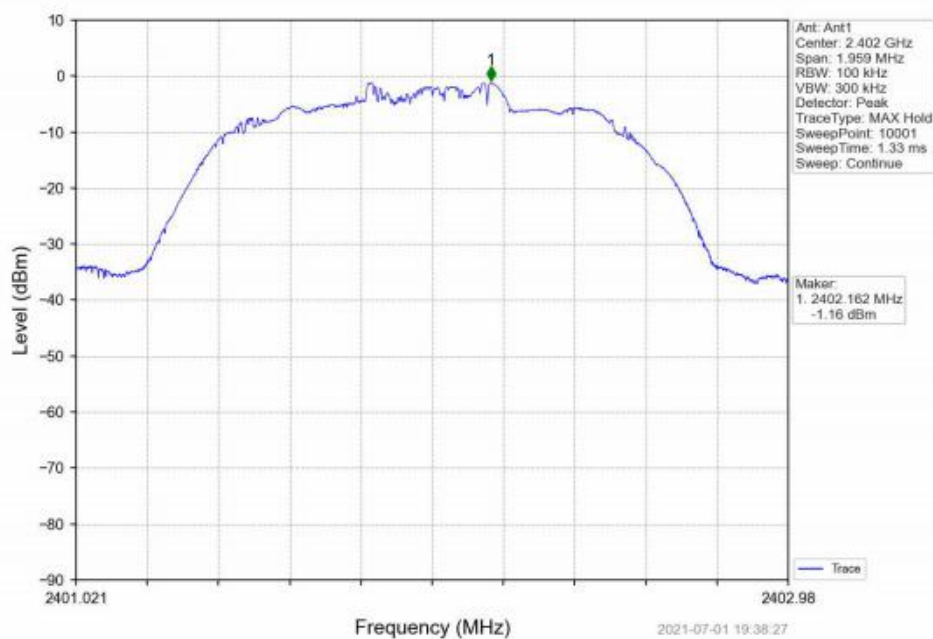

8DPSK_3DH5_MCH_2441MHz_Ant1_NTNV

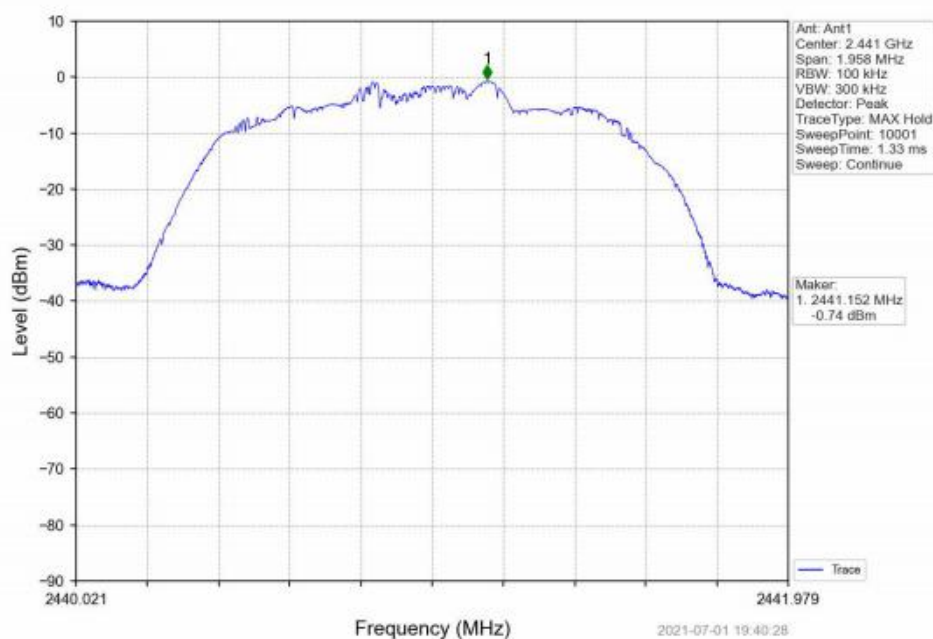

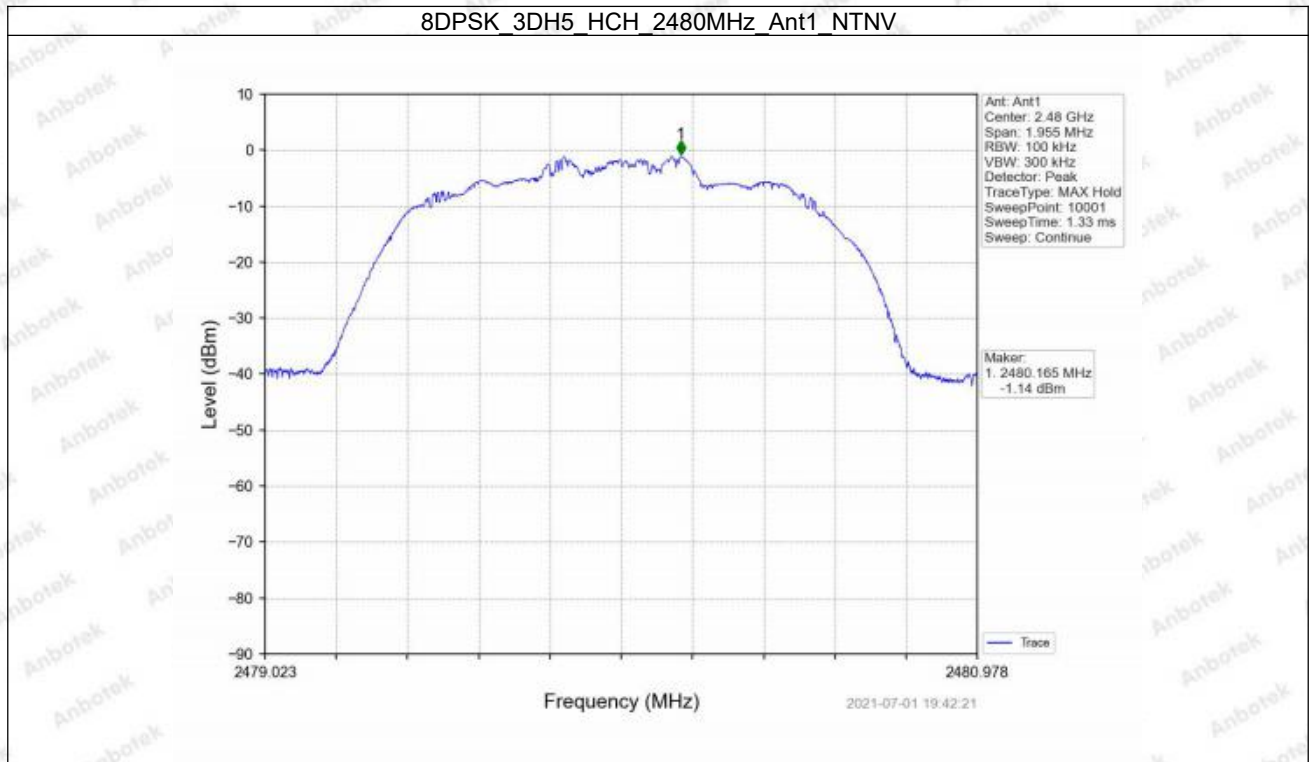

Shenzhen Anbotech Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.

Tel: (86) 755-26066440 Fax: (86) 755-26014772 Email: service@anbotech.com



Hotline

400-003-0500

www.anbotech.com

6.2 CSE


6.2.1 Test Result

Mode	TX Type	Frequency (MHz)	Packet Type	Ant	Level of Reference (dBm)	Limit (dBm)	Verdict
GFSK	SISO	2402	DH5	1	Refer To Test Graph	Refer To Test Graph	Pass
		2441	DH5	1	Refer To Test Graph	Refer To Test Graph	Pass
		2480	DH5	1	Refer To Test Graph	Refer To Test Graph	Pass
		HOPP	DH5	1	Refer To Test Graph	Refer To Test Graph	Pass
$\pi/4$ -DQPSK	SISO	2402	2DH5	1	Refer To Test Graph	Refer To Test Graph	Pass
		2441	2DH5	1	Refer To Test Graph	Refer To Test Graph	Pass
		2480	2DH5	1	Refer To Test Graph	Refer To Test Graph	Pass
		HOPP	2DH5	1	Refer To Test Graph	Refer To Test Graph	Pass
8DPSK	SISO	2402	3DH5	1	Refer To Test Graph	Refer To Test Graph	Pass
		2441	3DH5	1	Refer To Test Graph	Refer To Test Graph	Pass
		2480	3DH5	1	Refer To Test Graph	Refer To Test Graph	Pass
		HOPP	3DH5	1	Refer To Test Graph	Refer To Test Graph	Pass


Note1: Refer to FCC Part 15.247 (d) and ANSI C63.10-2020, the channel contains the maximum PSD level was used to establish the reference level.

6.2.2 Test Graph


GFSK DH5 LCH_2402MHz Ant1 NTN

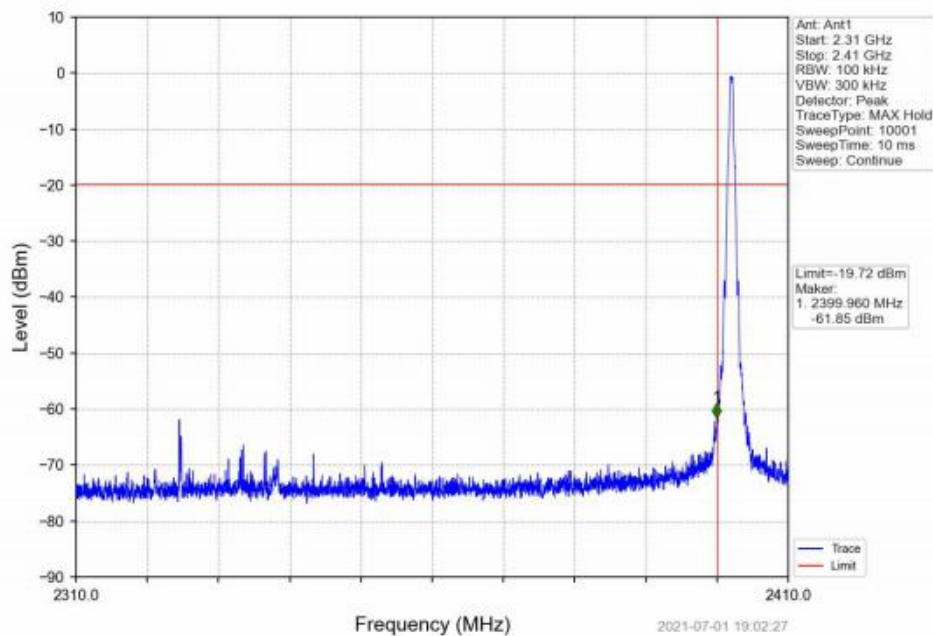


GFSK DH5 LCH_2402MHz Ant1 NTN

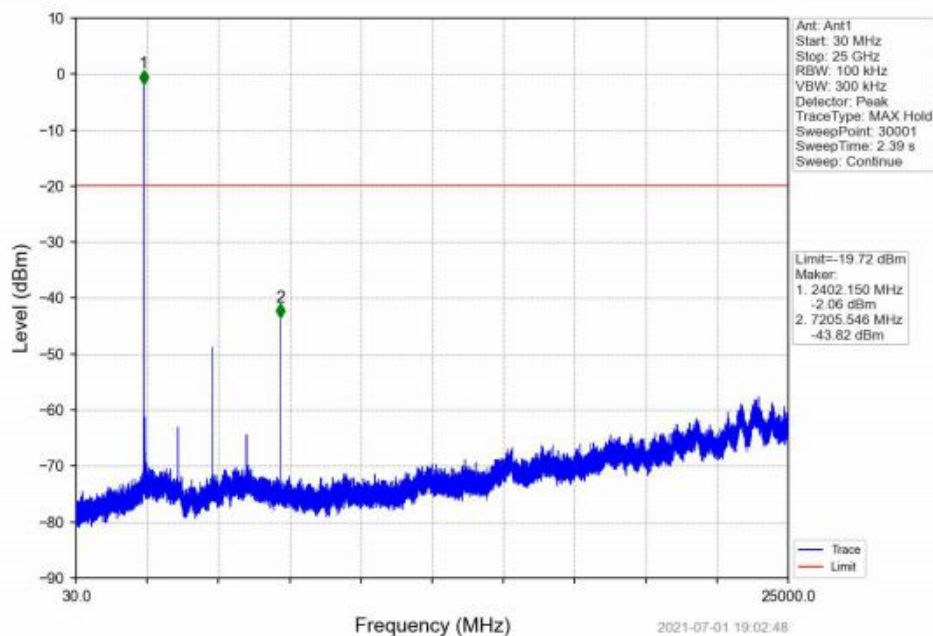


GFSK_DH5_MCH_2441MHz_Ant1_NTNV

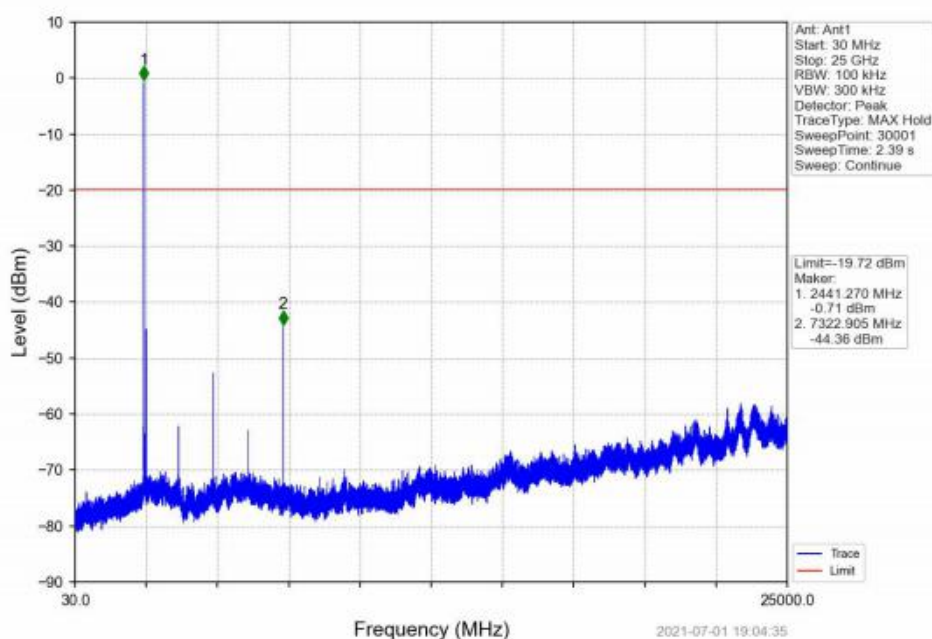


GFSK_DH5_HCH_2480MHz_Ant1_NTNV

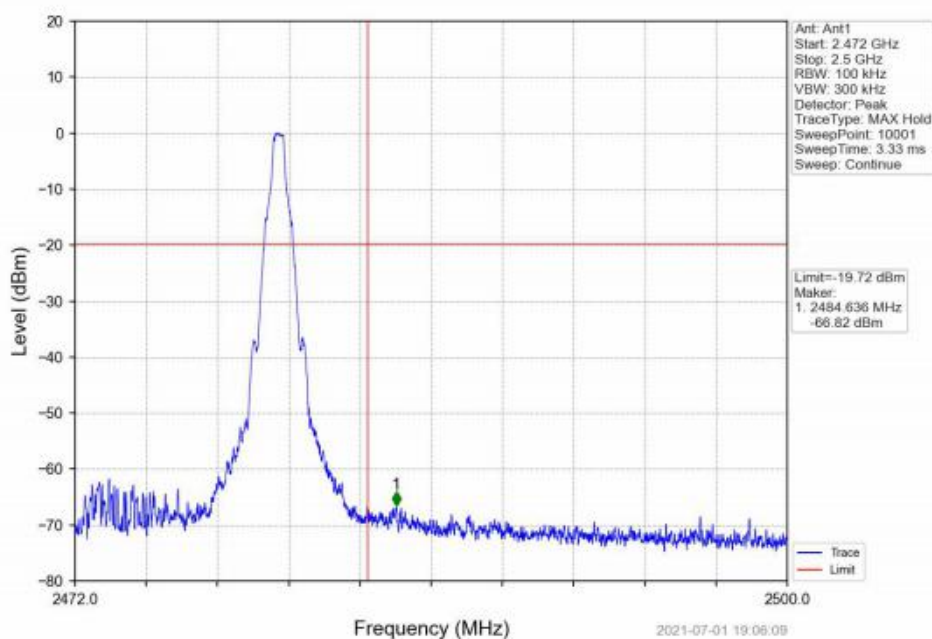

GFSK_DH5_HCH_2480MHz_Ant1_NTNV

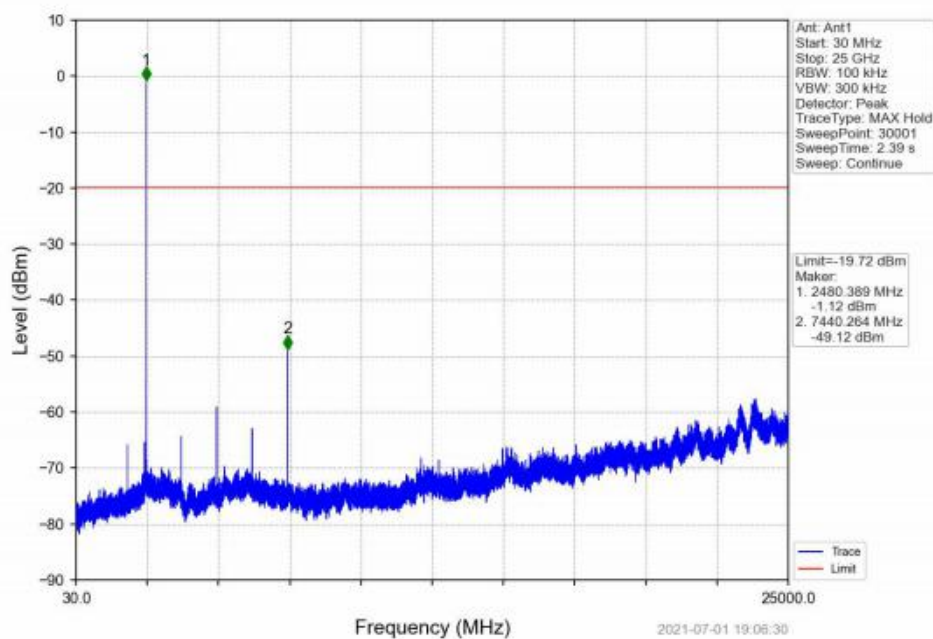

GFSK_DH5_HOPP_Ant1_NTNV

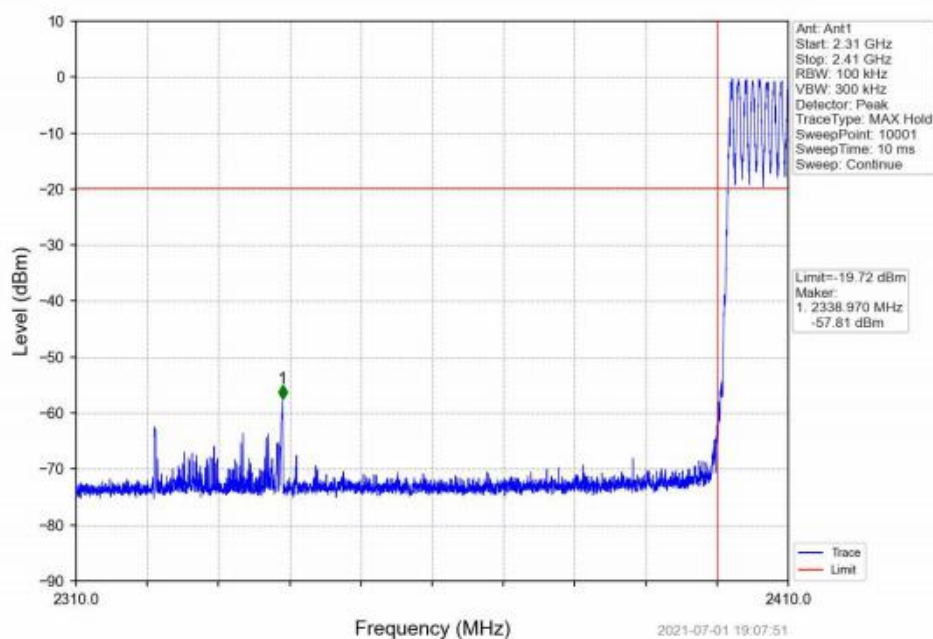**Shenzhen Anbotech Compliance Laboratory Limited**

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.

Tel: (86) 755-26066440 Fax: (86) 755-26014772 Email: service@anbotech.com





Hotline

400-003-0500

www.anbotech.com

GFSK_DH5_HOPP_Ant1_NTNV

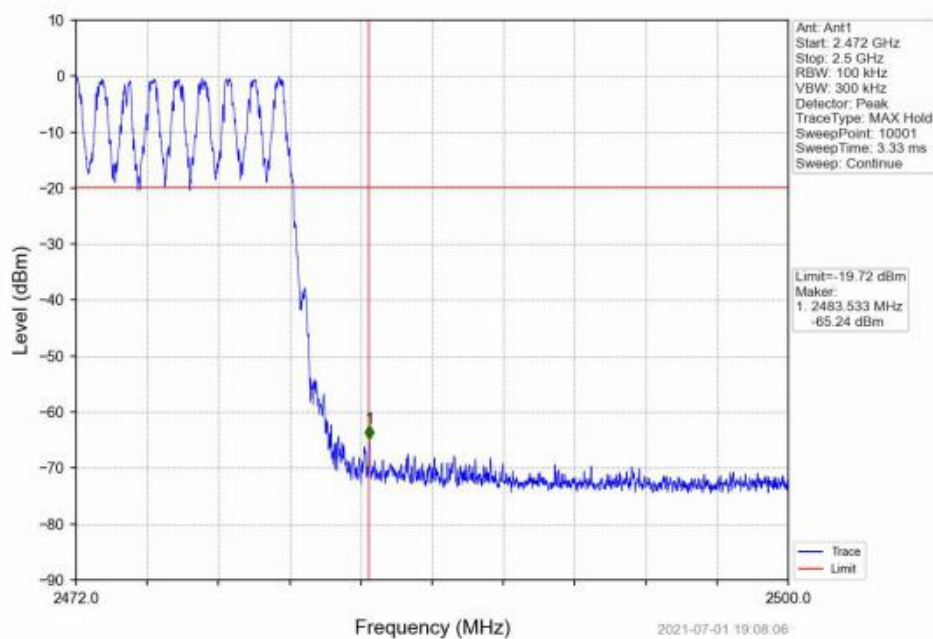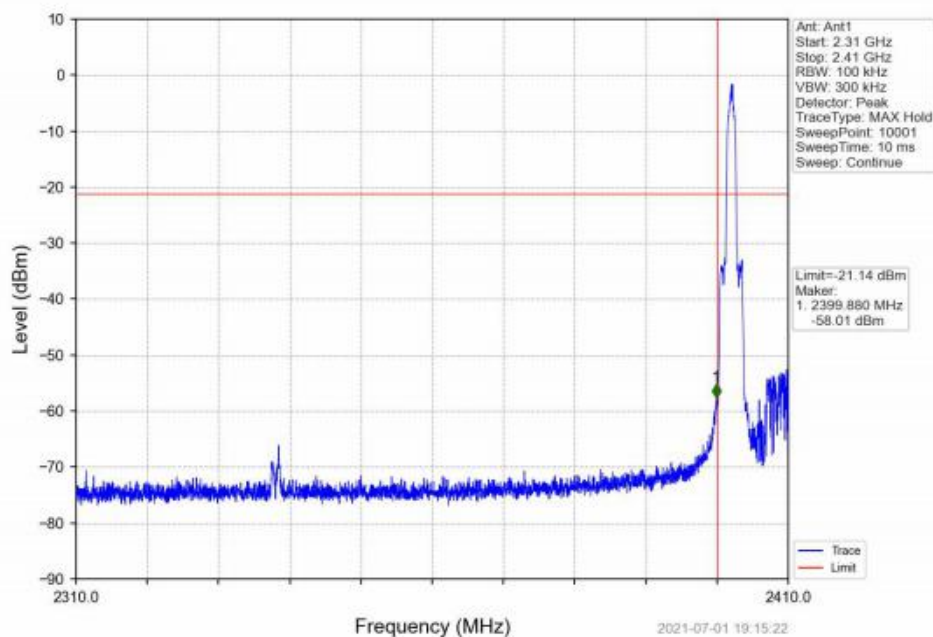 $\pi/4$ -QPSK_2DH5_LCH_2402MHz_Ant1_NTNV**Shenzhen Anbotek Compliance Laboratory Limited**

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.

Tel: (86) 755-26066440 Fax: (86) 755-26014772 Email: service@anbotek.com




Hotline


400-003-0500

www.anbotek.com

π /4-DQPSK_2DH5_LCH_2402MHz_Ant1_NTNV

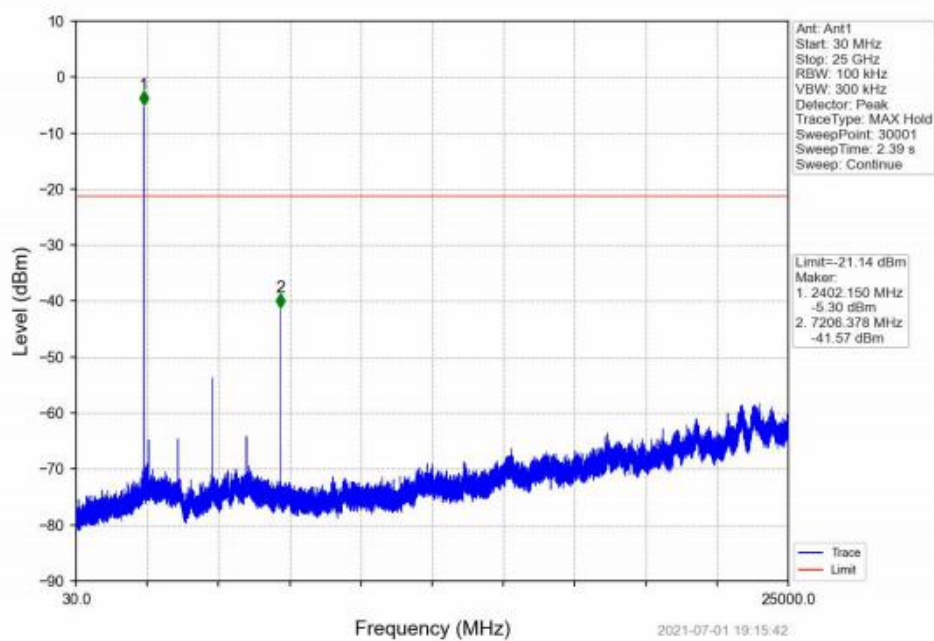

π /4-DQPSK_2DH5_MCH_2441MHz_Ant1_NTNV

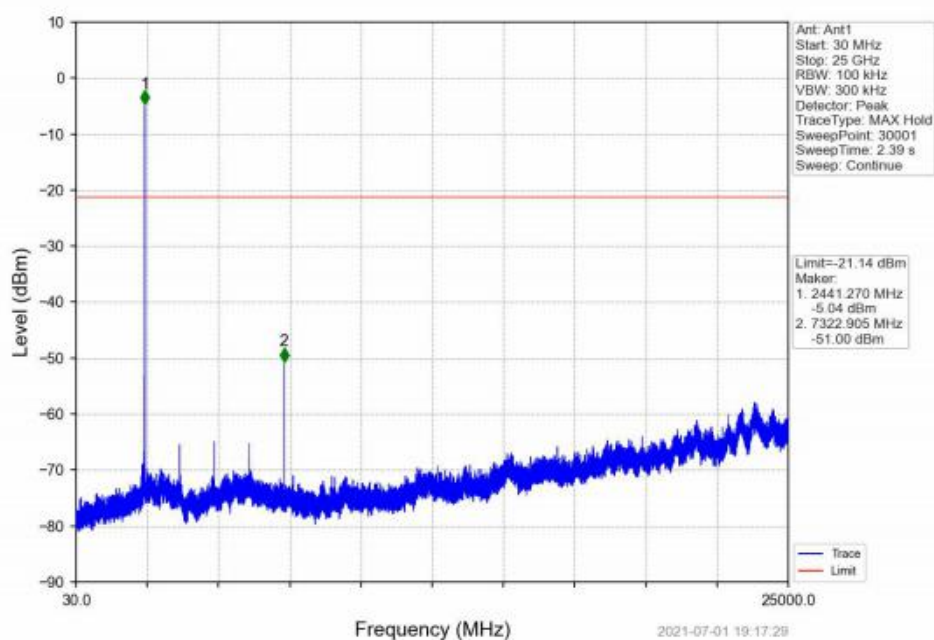


Shenzhen Anbotech Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.


Tel: (86) 755-26066440 Fax: (86) 755-26014772 Email: service@anbotech.com

Hotline
400-003-0500
www.anbotech.com

π /4-DQPSK_2DH5_HCH_2480MHz_Ant1_NTNV

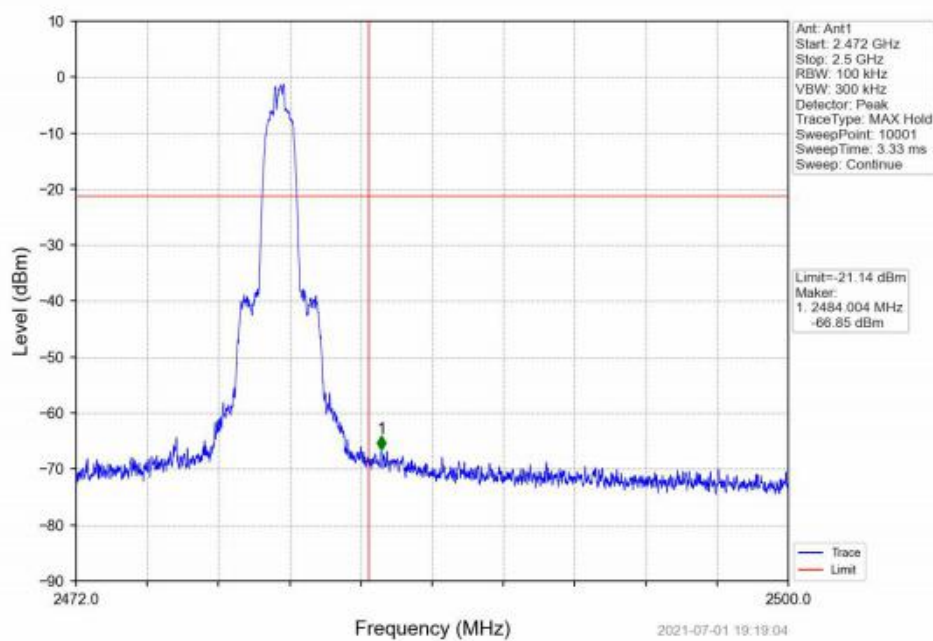

π /4-DQPSK_2DH5_HCH_2480MHz_Ant1_NTNV


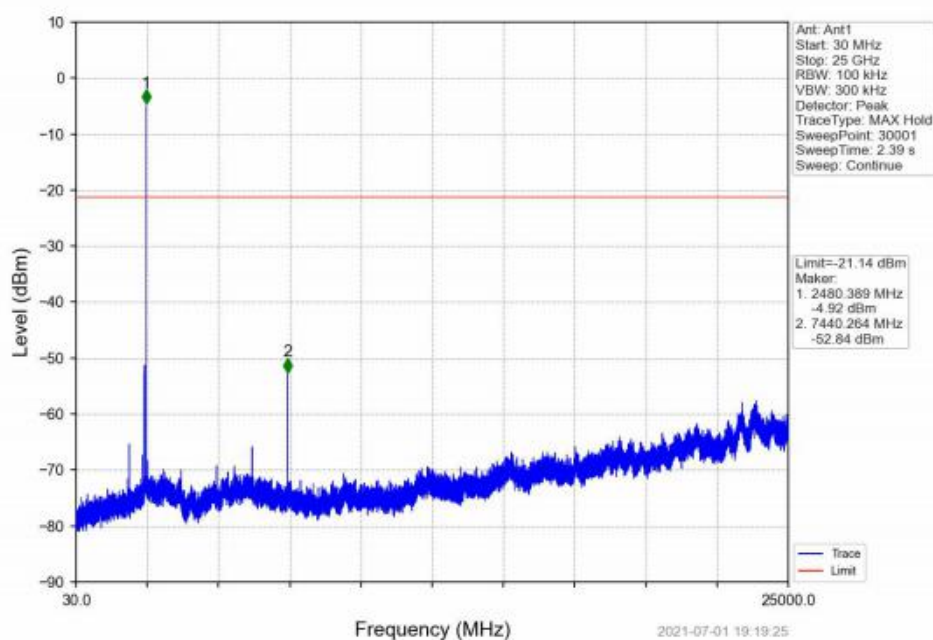


Shenzhen Anbotech Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.

Tel: (86) 755-26066440 Fax: (86) 755-26014772 Email: service@anbotech.com

Hotline
400-003-0500
www.anbotech.com

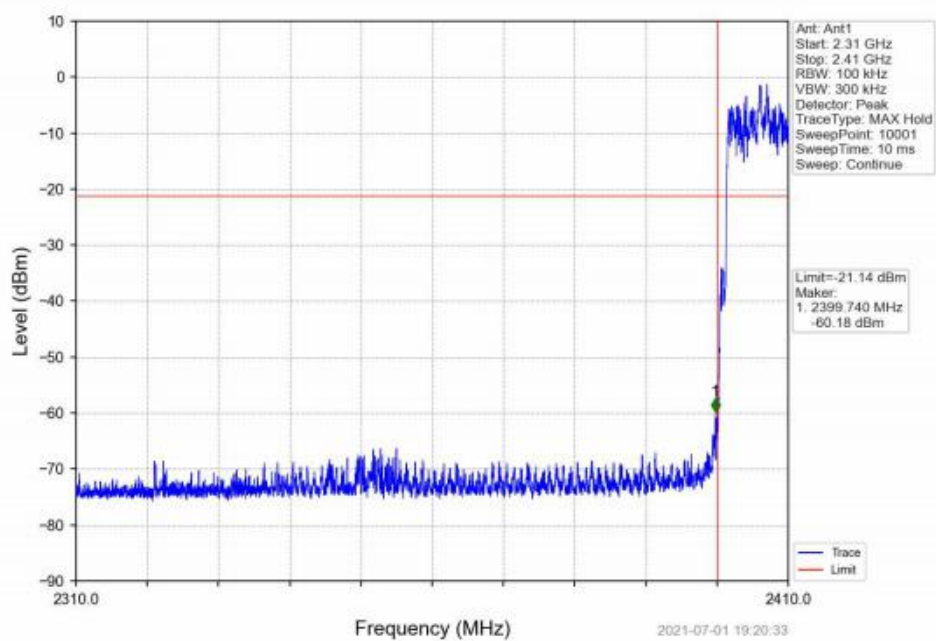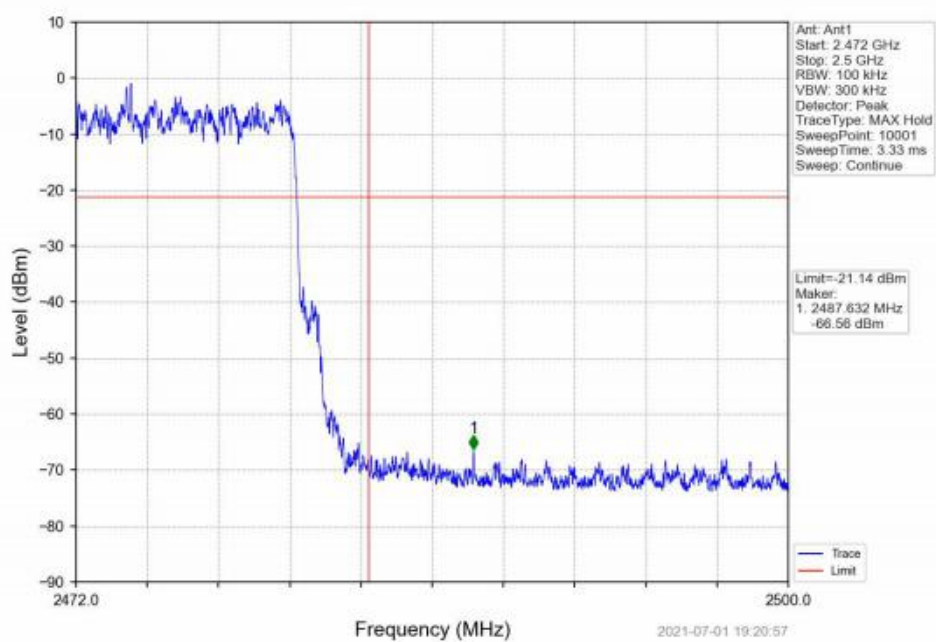π /4-DQPSK_2DH5_HOPP_Ant1_NTNV π /4-DQPSK_2DH5_HOPP_Ant1_NTNV**Shenzhen Anbotech Compliance Laboratory Limited**

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.

Tel: (86) 755-26066440 Fax: (86) 755-26014772 Email: service@anbotech.com




Hotline


400-003-0500

www.anbotech.com

8DPSK_3DH5_LCH_2402MHz_Ant1_NTNV

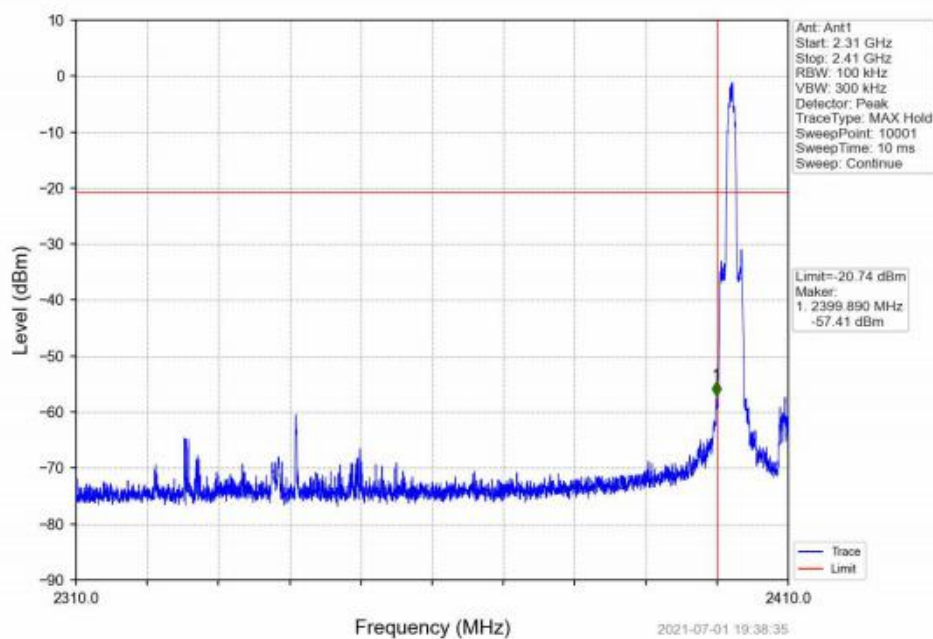

8DPSK_3DH5_LCH_2402MHz_Ant1_NTNV

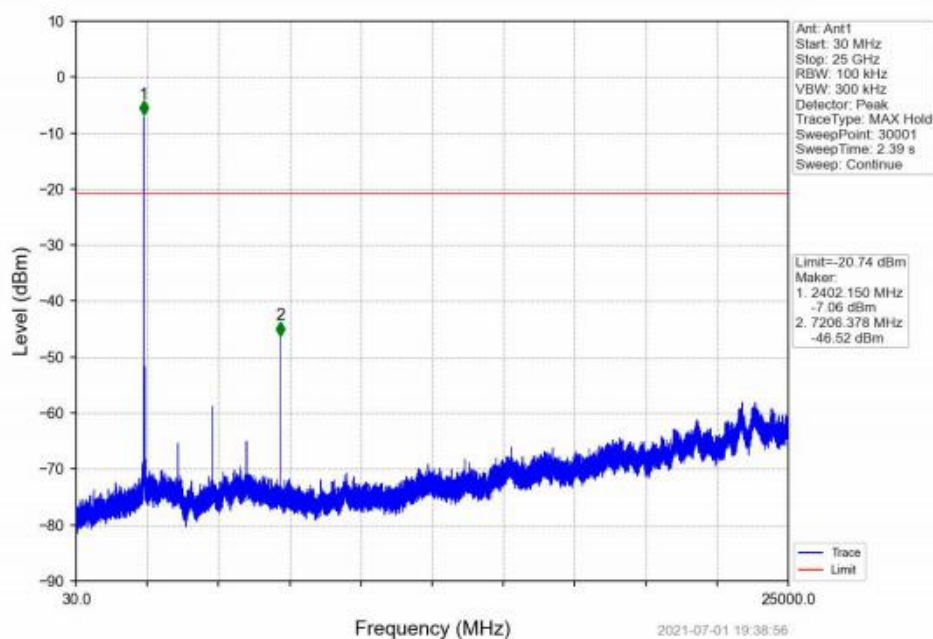**Shenzhen Anbotek Compliance Laboratory Limited**

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.

Tel: (86) 755-26066440 Fax: (86) 755-26014772 Email: service@anbotek.com




Hotline


400-003-0500

www.anbotek.com

8DPSK_3DH5_MCH_2441MHz_Ant1_NTNV

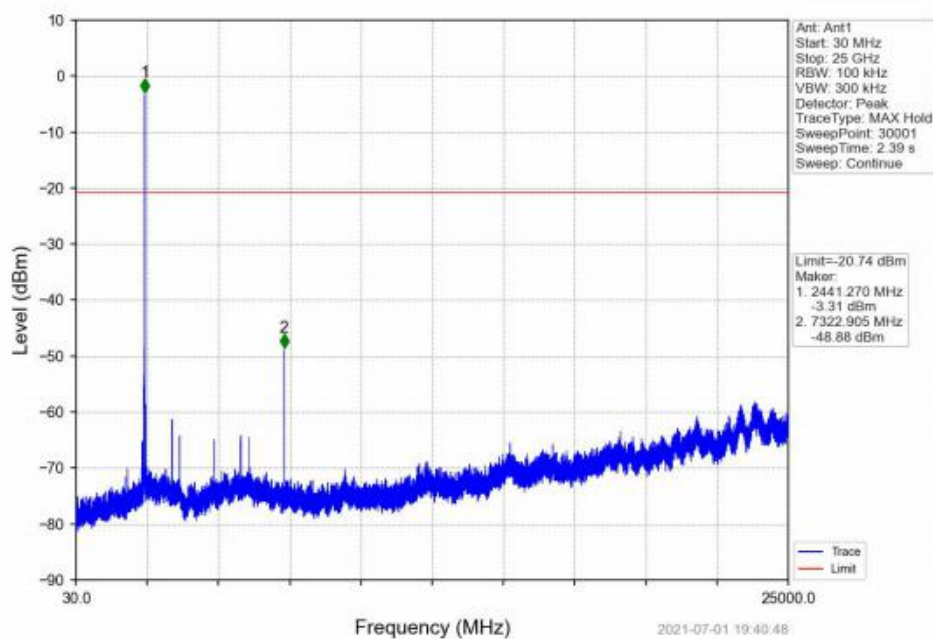

8DPSK_3DH5_HCH_2480MHz_Ant1_NTNV

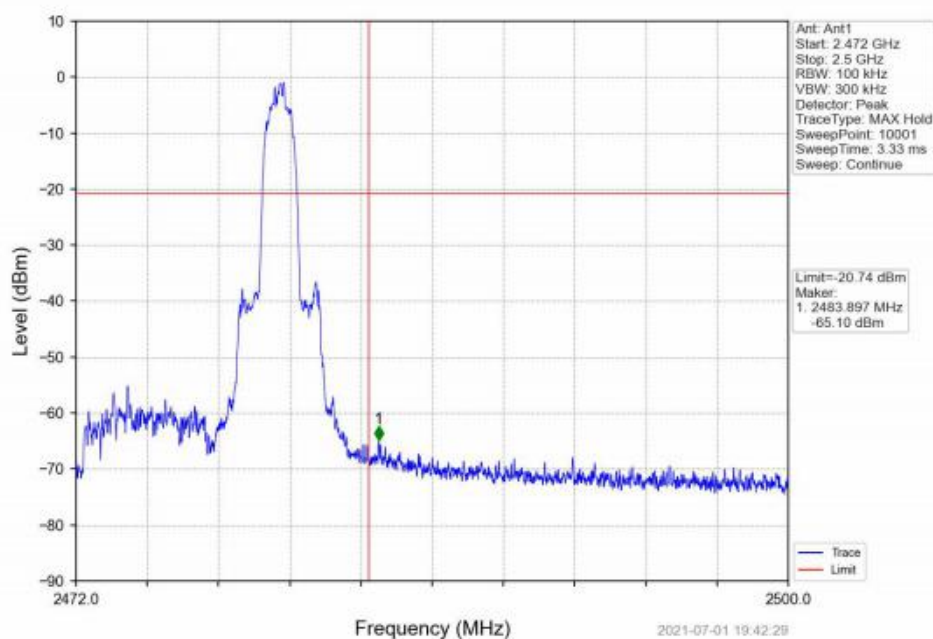


Shenzhen Anbotech Compliance Laboratory Limited


Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.
Tel: (86) 755-26066440 Fax: (86) 755-26014772 Email: service@anbotech.com

Hotline
400-003-0500
www.anbotech.com

8DPSK_3DH5_HCH_2480MHz_Ant1_NTNV

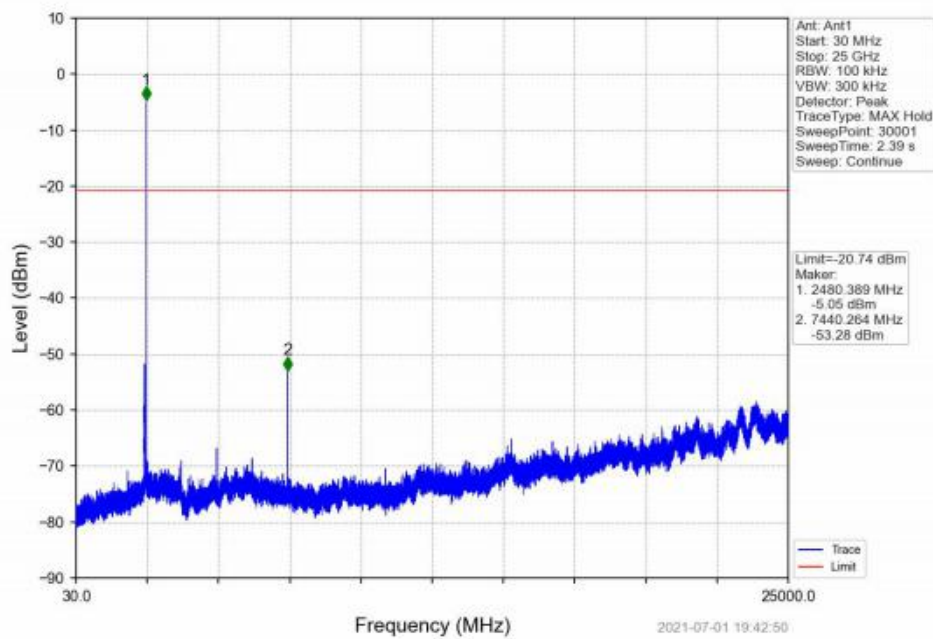

8DPSK_3DH5_HOPP_Ant1_NTNV

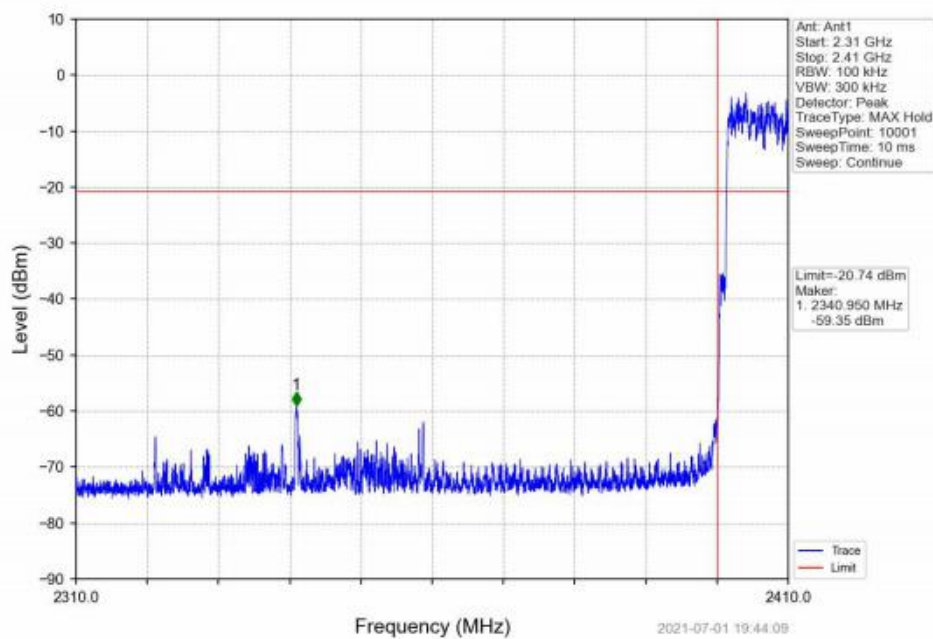


Shenzhen Anbotech Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.

Tel: (86) 755-26066440 Fax: (86) 755-26014772 Email: service@anbotech.com

Hotline
400-003-0500
www.anbotech.com

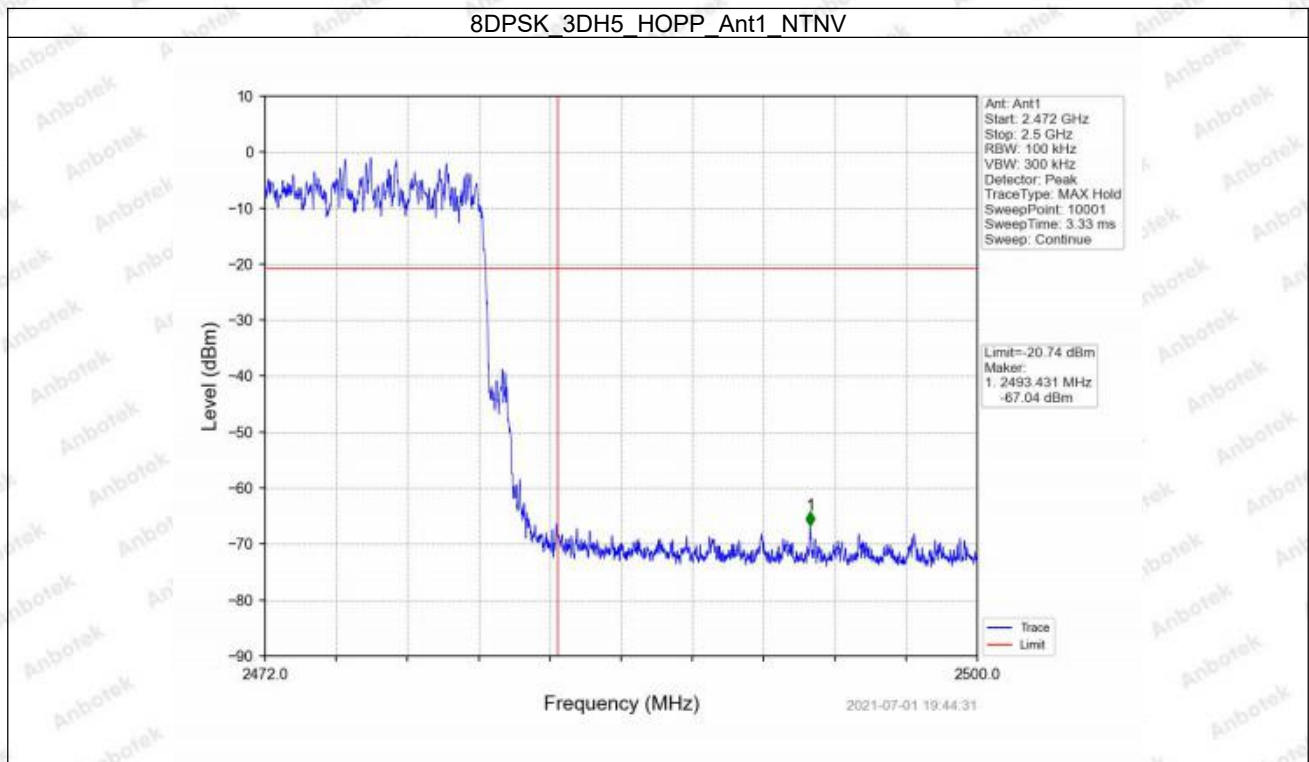

---End---