



NVNT	ac20	5260	Ant2	4959.42	-46.61	3.3	-	51.92	Peak	74	Pass
NVNT	ac20	5260	Ant2	4787.82	-55.98	3.3	0.28	42.83	Average	54	Pass
NVNT	ac20	5260	Ant2	5150	-48.38	3.3	-	50.15	Peak	74	Pass
NVNT	ac20	5260	Ant2	5150	-56.34	3.3	0.28	42.47	Average	54	Pass
NVNT	ac20	5320	Ant2	5350	-40.6	3.3	-	57.93	Peak	74	Pass
NVNT	ac20	5320	Ant2	5350	-54.29	3.3	0.28	44.52	Average	54	Pass
NVNT	ac20	5320	Ant2	5352.8	-38.96	3.3	-	59.57	Peak	74	Pass
NVNT	ac20	5320	Ant2	5350.4	-53.67	3.3	0.28	45.14	Average	54	Pass
NVNT	ac20	5320	Ant2	5460	-48.82	3.3	-	49.71	Peak	74	Pass
NVNT	ac20	5320	Ant2	5460	-57.98	3.3	0.28	40.83	Average	54	Pass
NVNT	ac40	5270	Ant2	4500	-51.03	3.3	-	47.50	Peak	74	Pass
NVNT	ac40	5270	Ant2	4500	-59.08	3.3	0.12	39.57	Average	54	Pass
NVNT	ac40	5270	Ant2	4772.97	-45.89	3.3	-	52.64	Peak	74	Pass
NVNT	ac40	5270	Ant2	4806.18	-53.92	3.3	0.12	44.73	Average	54	Pass
NVNT	ac40	5270	Ant2	5150	-49.15	3.3	-	49.38	Peak	74	Pass
NVNT	ac40	5270	Ant2	5150	-56.87	3.3	0.12	41.78	Average	54	Pass
NVNT	ac40	5310	Ant2	5350	-40.88	3.3	-	57.65	Peak	74	Pass
NVNT	ac40	5310	Ant2	5350	-53.24	3.3	0.12	45.41	Average	54	Pass
NVNT	ac40	5310	Ant2	5350.4	-38.4	3.3	-	60.13	Peak	74	Pass
NVNT	ac40	5310	Ant2	5350.4	-51.73	3.3	0.12	46.92	Average	54	Pass
NVNT	ac40	5310	Ant2	5460	-50.22	3.3	-	48.31	Peak	74	Pass
NVNT	ac40	5310	Ant2	5460	-57.84	3.3	0.12	40.81	Average	54	Pass
NVNT	ac80	5290	Ant2	4500	-49.3	3.3	-	49.23	Peak	74	Pass
NVNT	ac80	5290	Ant2	4500	-58.66	3.3	0.25	40.12	Average	54	Pass
NVNT	ac80	5290	Ant2	5015.91	-46.09	3.3	-	52.44	Peak	74	Pass
NVNT	ac80	5290	Ant2	5143.8	-56.56	3.3	0.25	42.22	Average	54	Pass
NVNT	ac80	5290	Ant2	5150	-47.52	3.3	-	51.01	Peak	74	Pass
NVNT	ac80	5290	Ant2	5150	-57.15	3.3	0.25	41.63	Average	54	Pass
NVNT	ac80	5290	Ant2	5350	-44.11	3.3	-	54.42	Peak	74	Pass
NVNT	ac80	5290	Ant2	5350	-54.38	3.3	0.25	44.40	Average	54	Pass
NVNT	ac80	5290	Ant2	5350.25	-41.79	3.3	-	56.74	Peak	74	Pass
NVNT	ac80	5290	Ant2	5350.25	-53.43	3.3	0.25	45.35	Average	54	Pass
NVNT	ac80	5290	Ant2	5460	-50.36	3.3	-	48.17	Peak	74	Pass
NVNT	ac80	5290	Ant2	5460	-58.16	3.3	0.25	40.62	Average	54	Pass



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China


Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity




Test Graphs

Restrict Band NVNT a 5260MHz Ant2 Peak

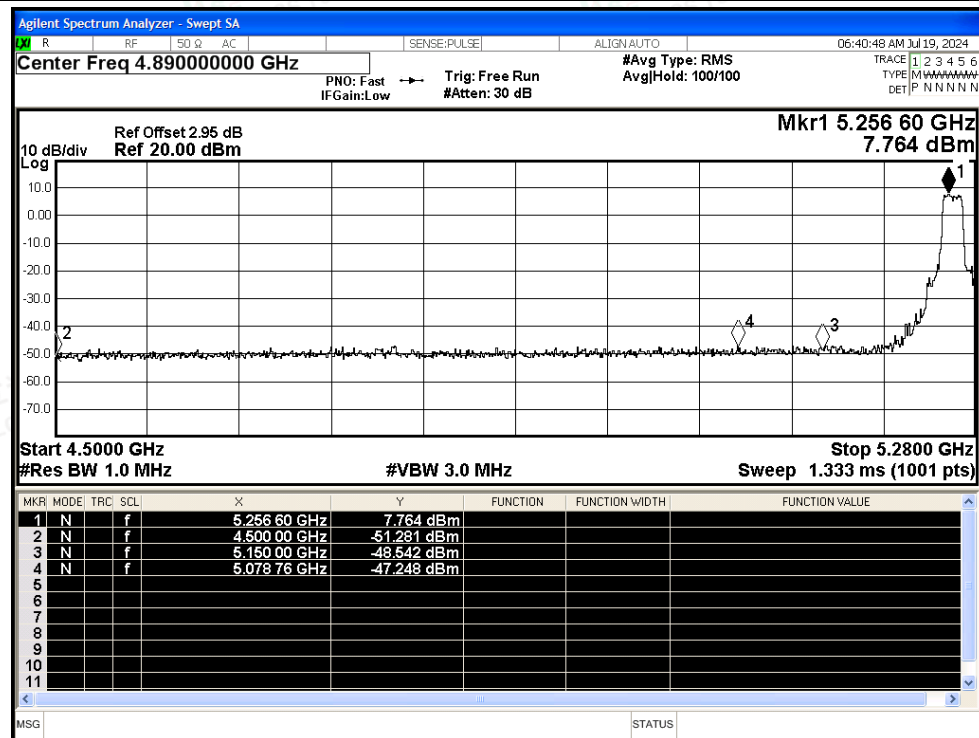

Restrict Band NVNT a 5260MHz Ant2 Average

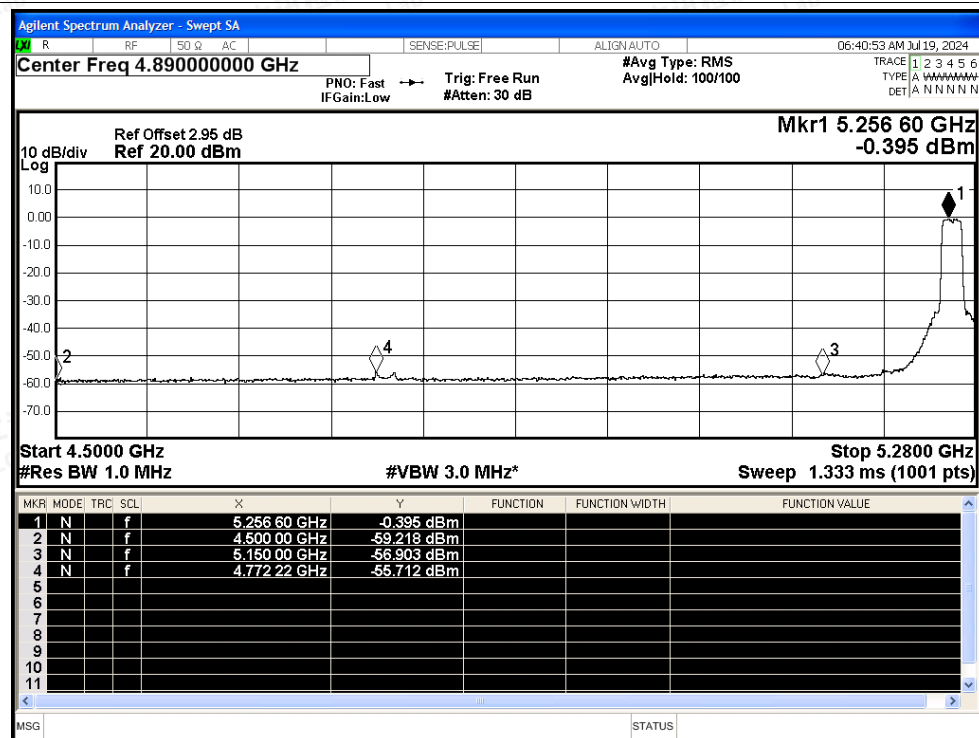

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT a 5320MHz Ant2 Peak

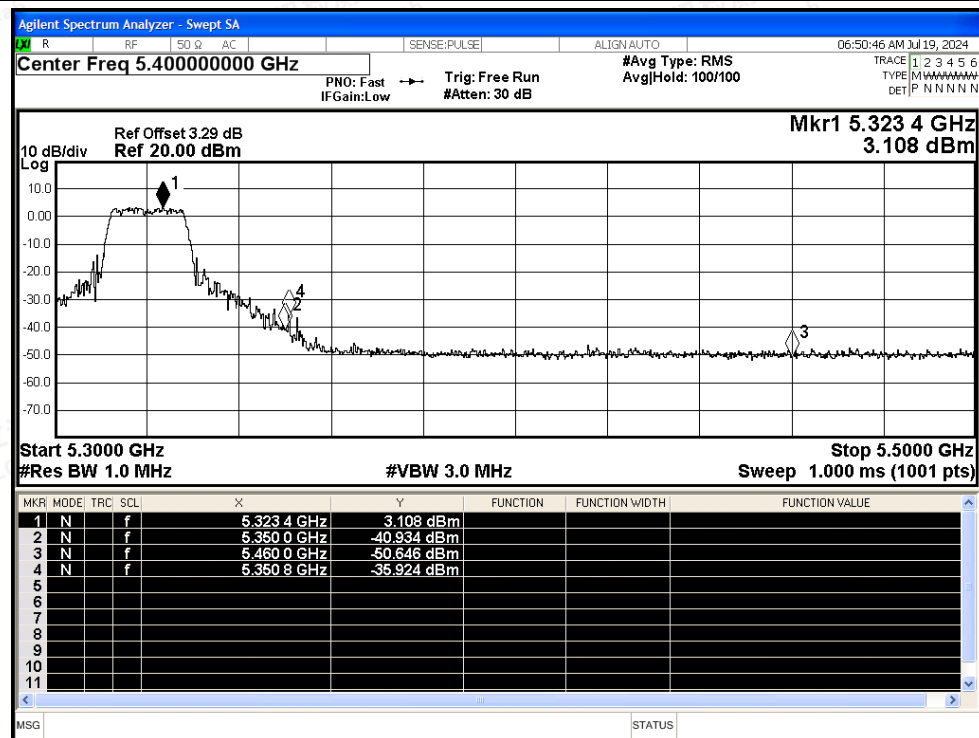

Restrict Band NVNT a 5320MHz Ant2 Average

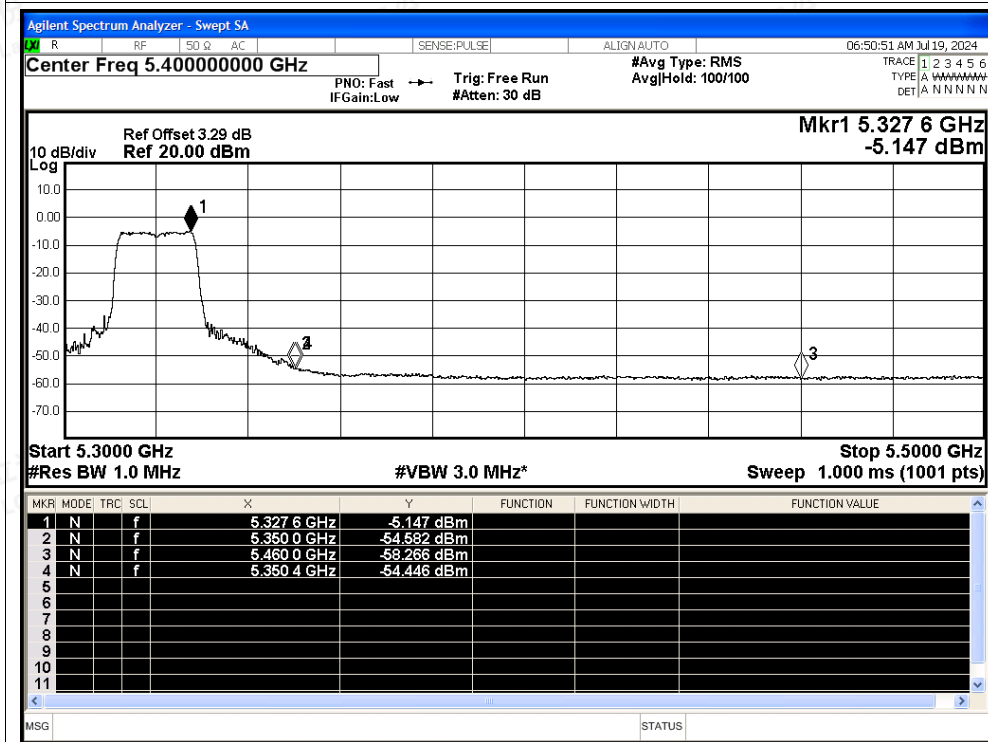

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT n20 5260MHz Ant2 Peak

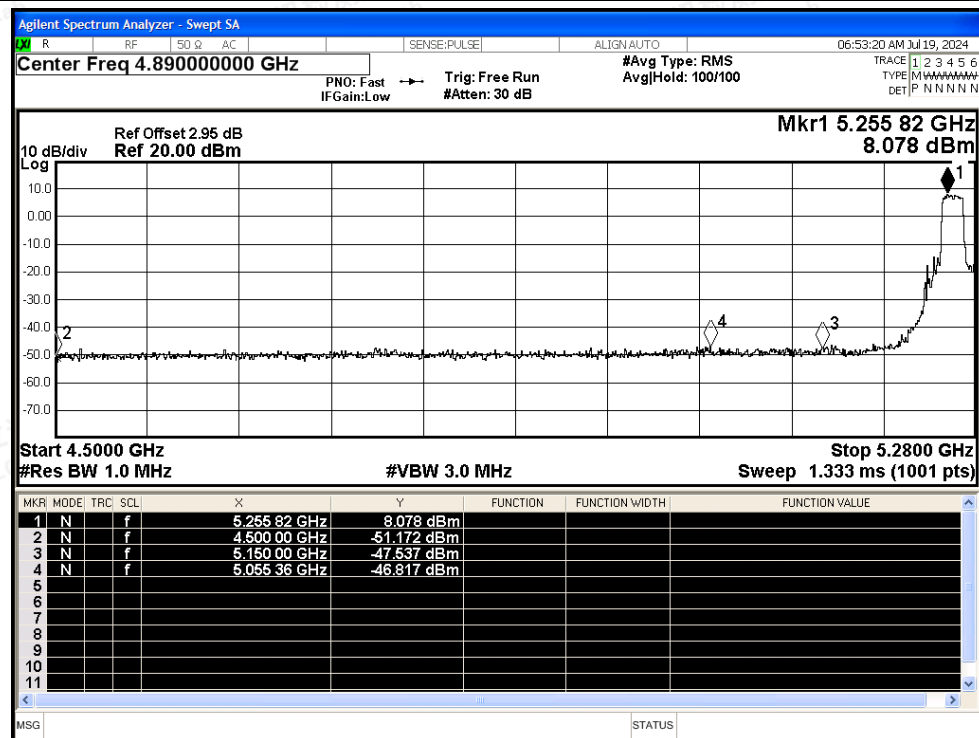

Restrict Band NVNT n20 5260MHz Ant2 Average

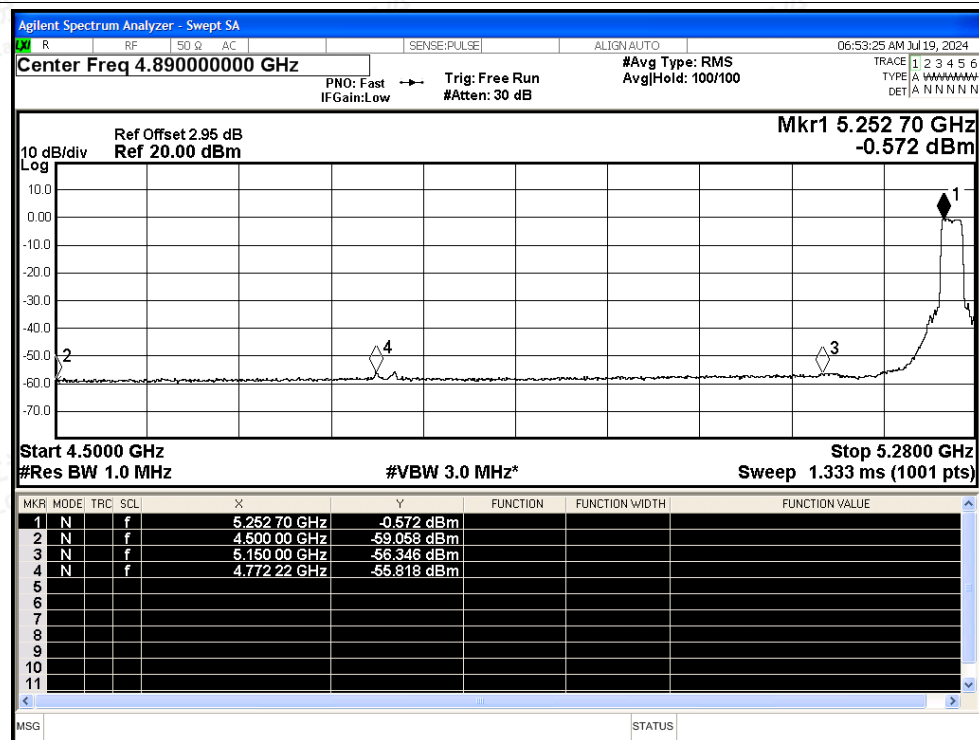

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT n20 5320MHz Ant2 Peak

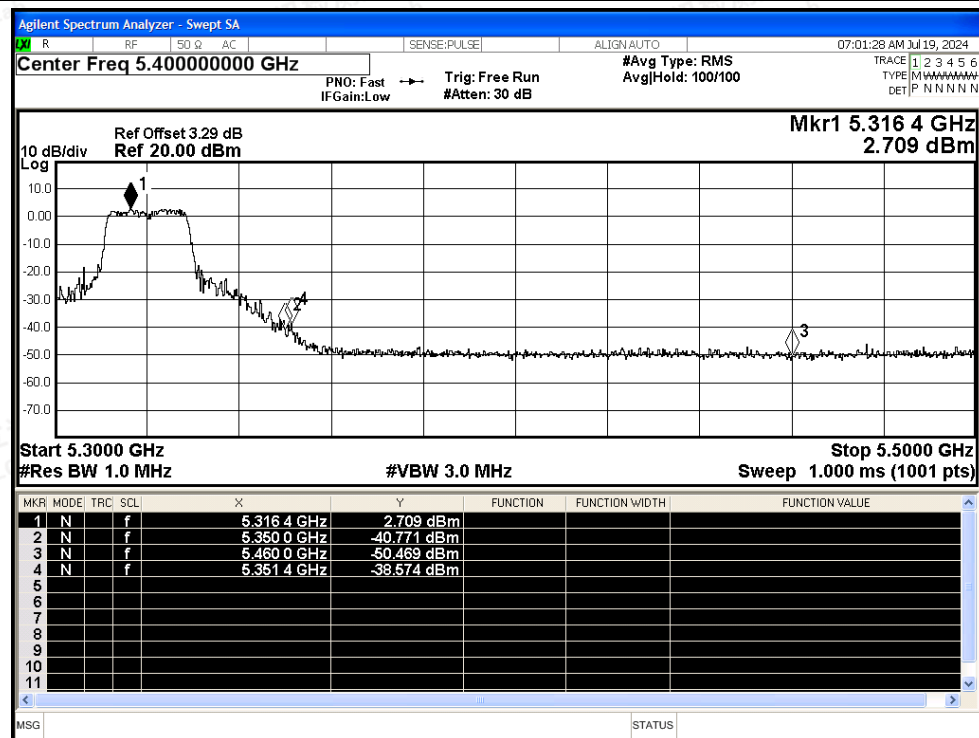

Restrict Band NVNT n20 5320MHz Ant2 Average

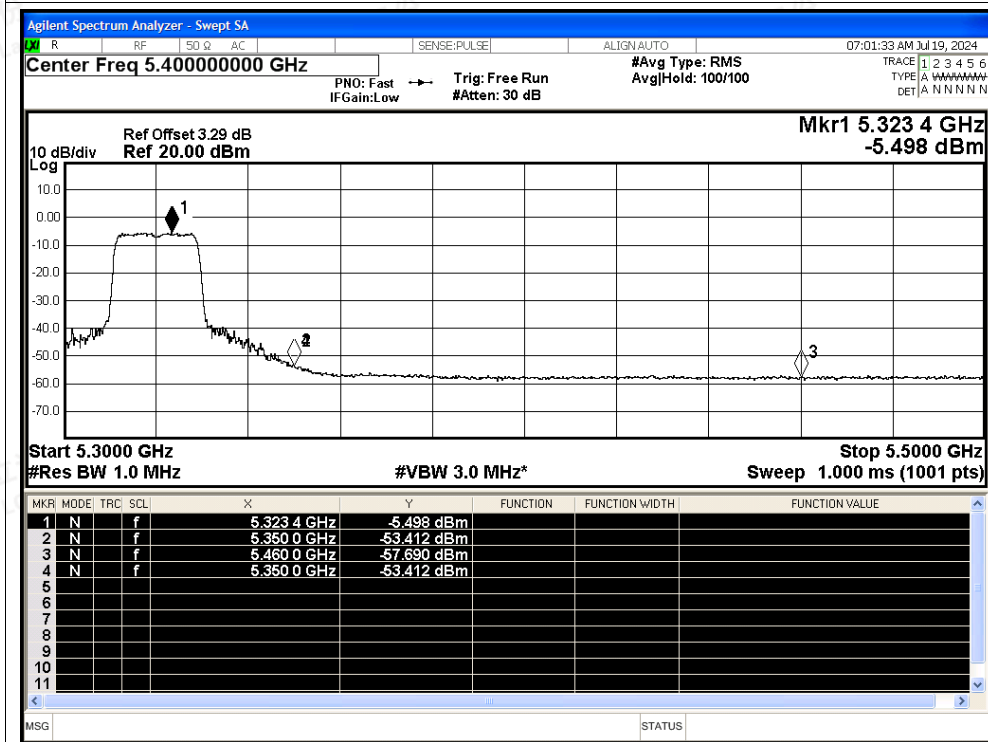

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT n40 5270MHz Ant2 Peak

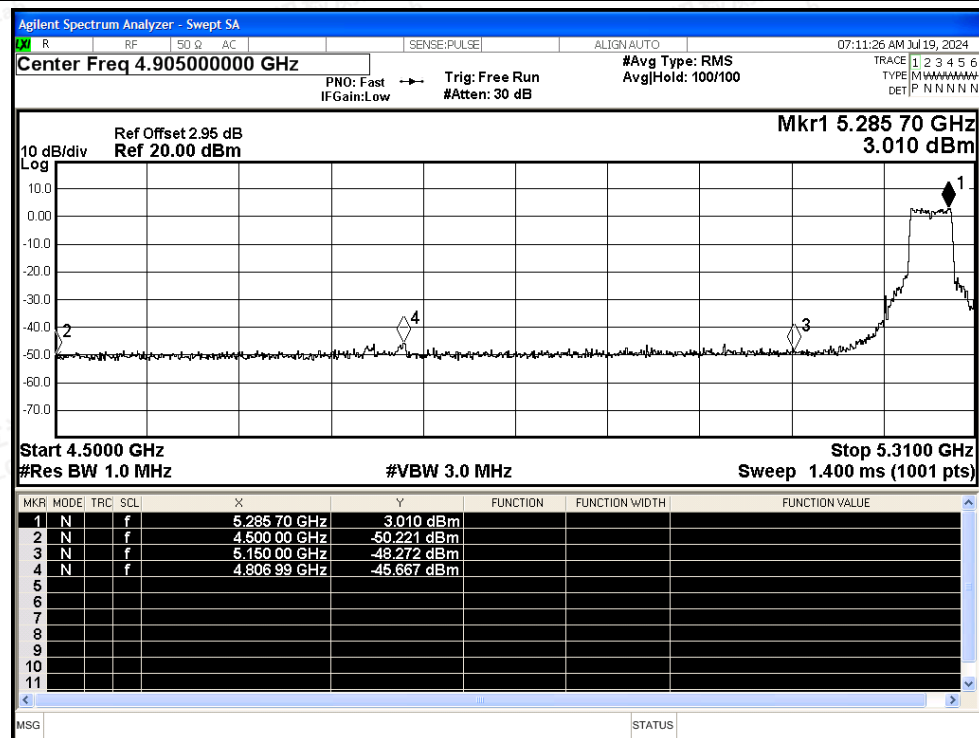

Restrict Band NVNT n40 5270MHz Ant2 Average

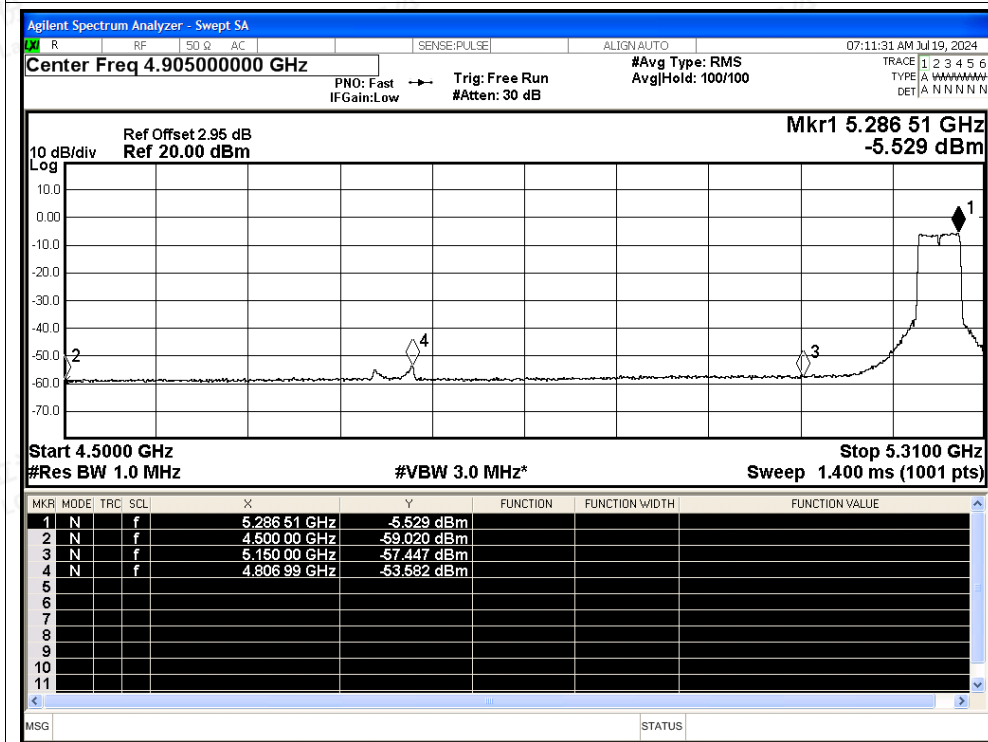

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT n40 5310MHz Ant2 Peak

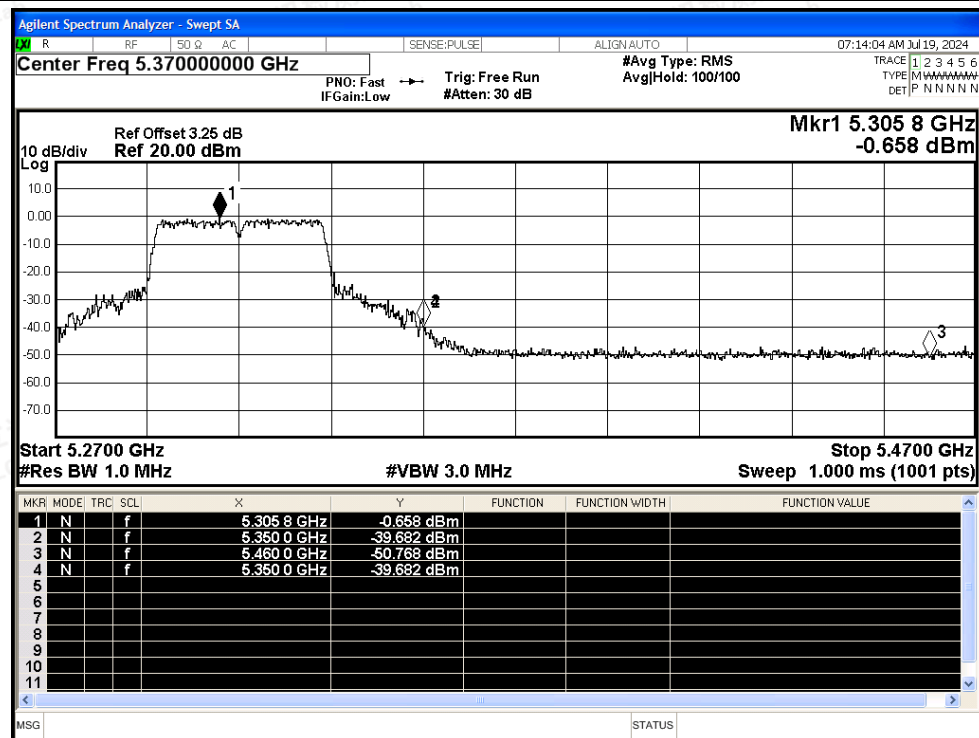

Restrict Band NVNT n40 5310MHz Ant2 Average

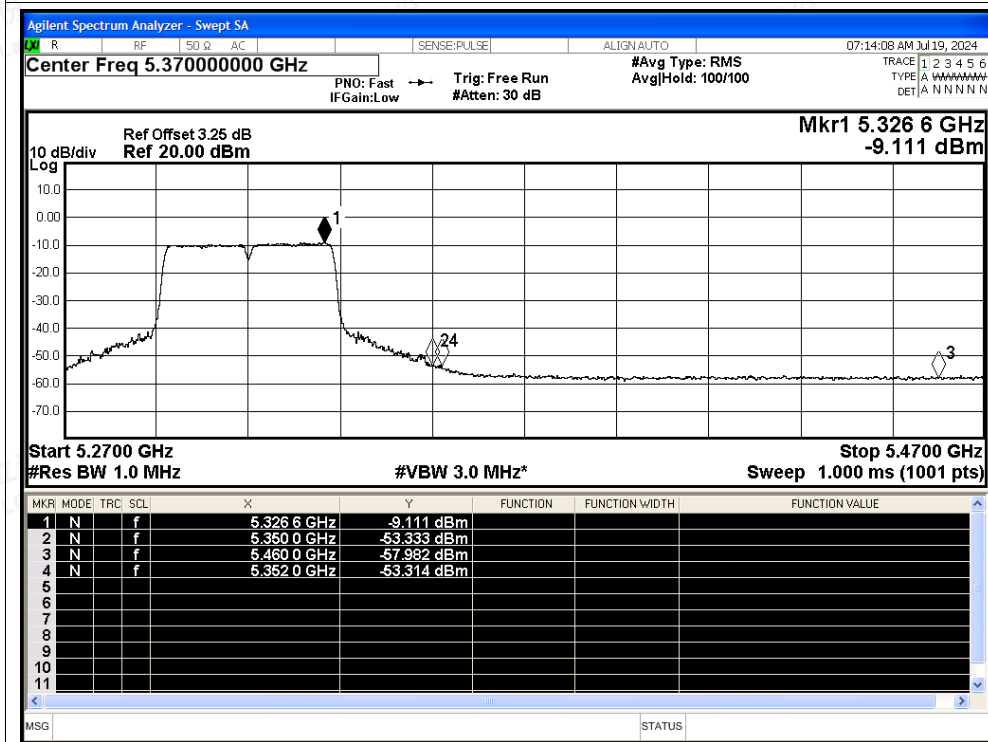

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ac20 5260MHz Ant2 Peak

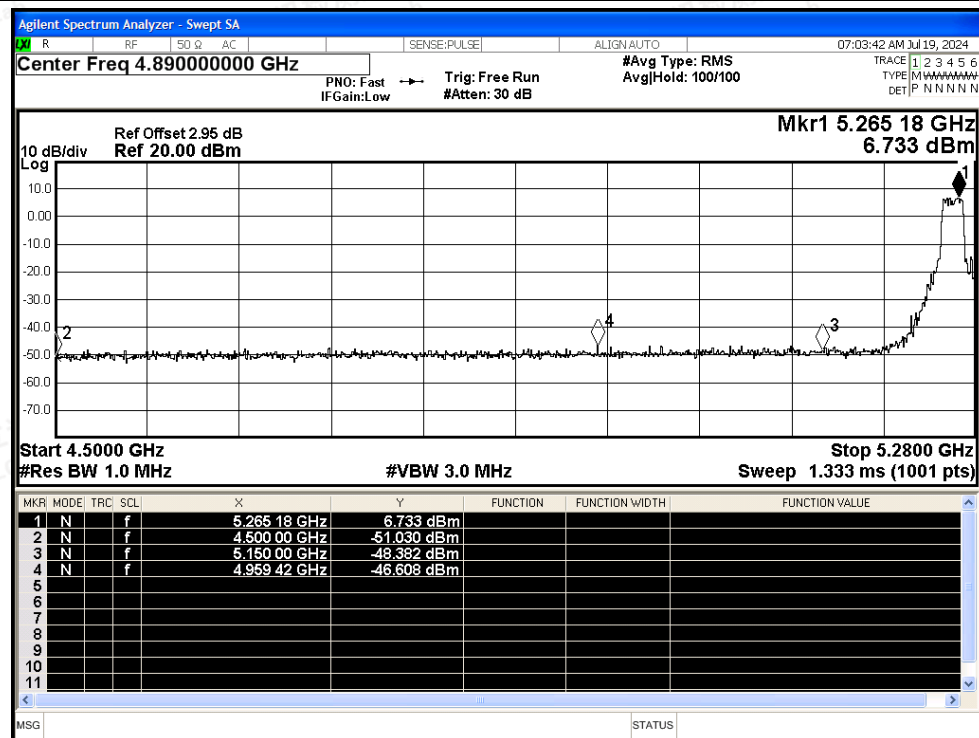

Restrict Band NVNT ac20 5260MHz Ant2 Average

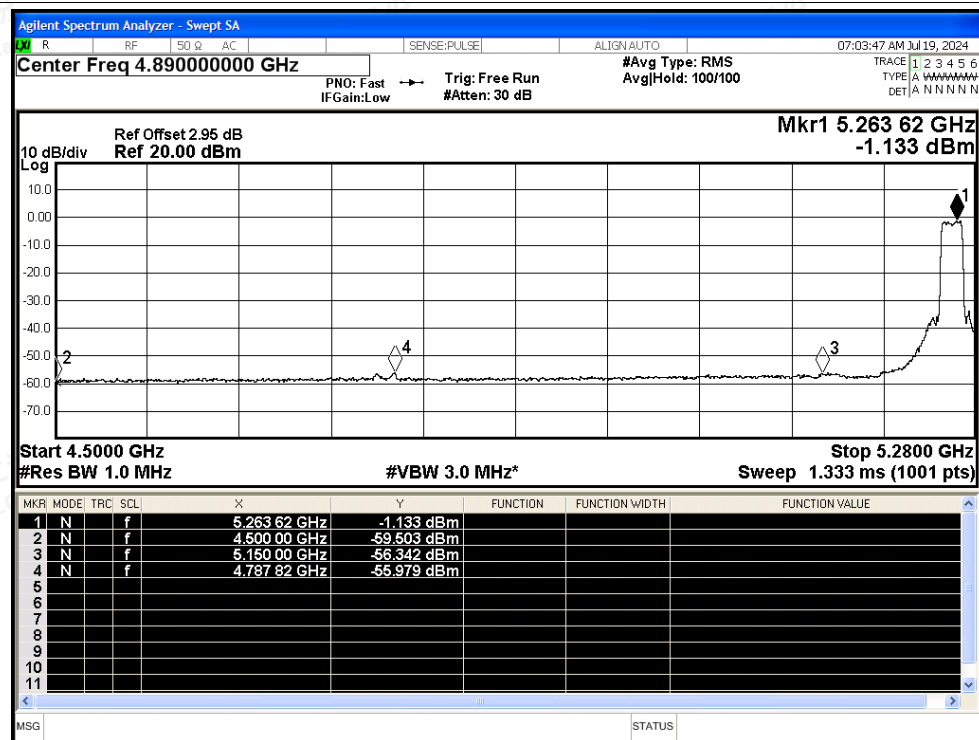

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ac20 5320MHz Ant2 Peak

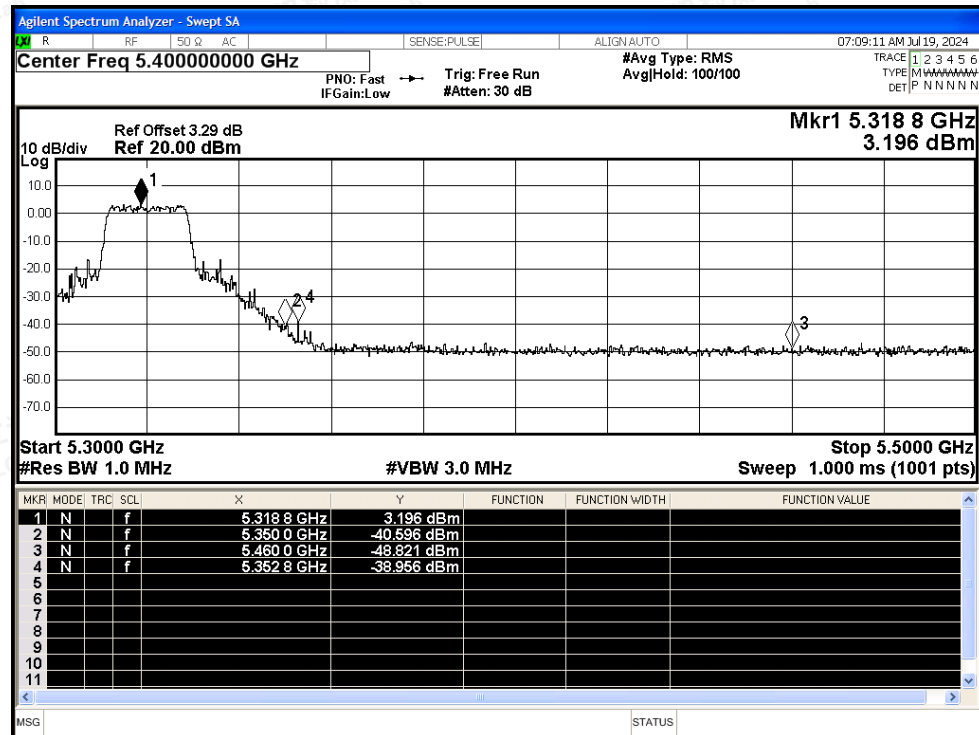

Restrict Band NVNT ac20 5320MHz Ant2 Average

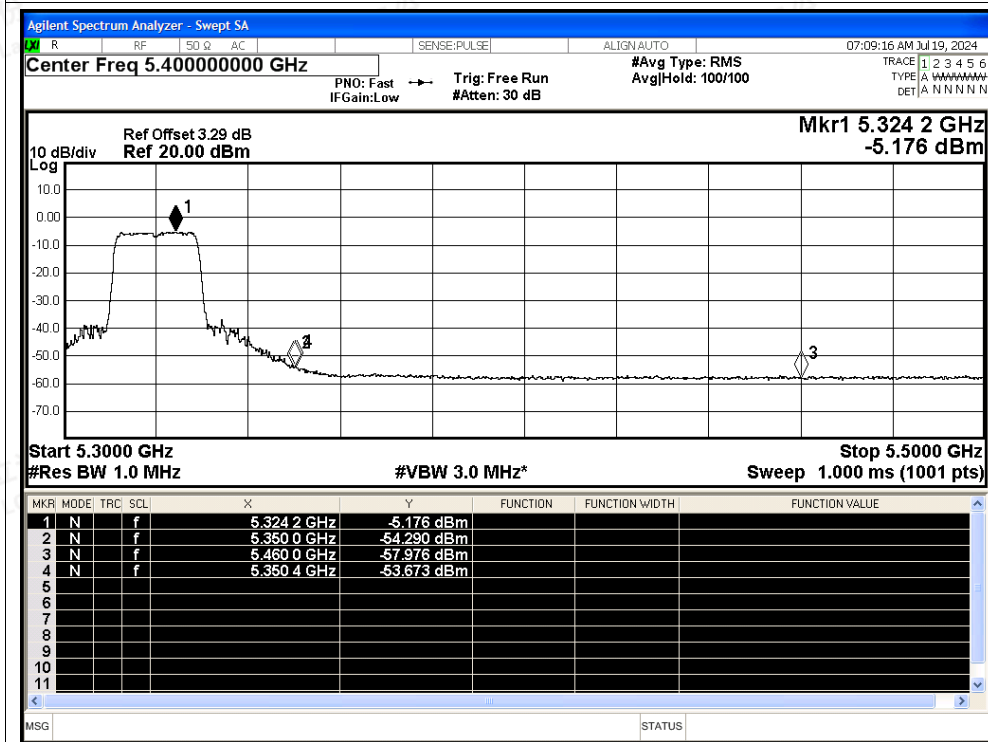

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ac40 5270MHz Ant2 Peak

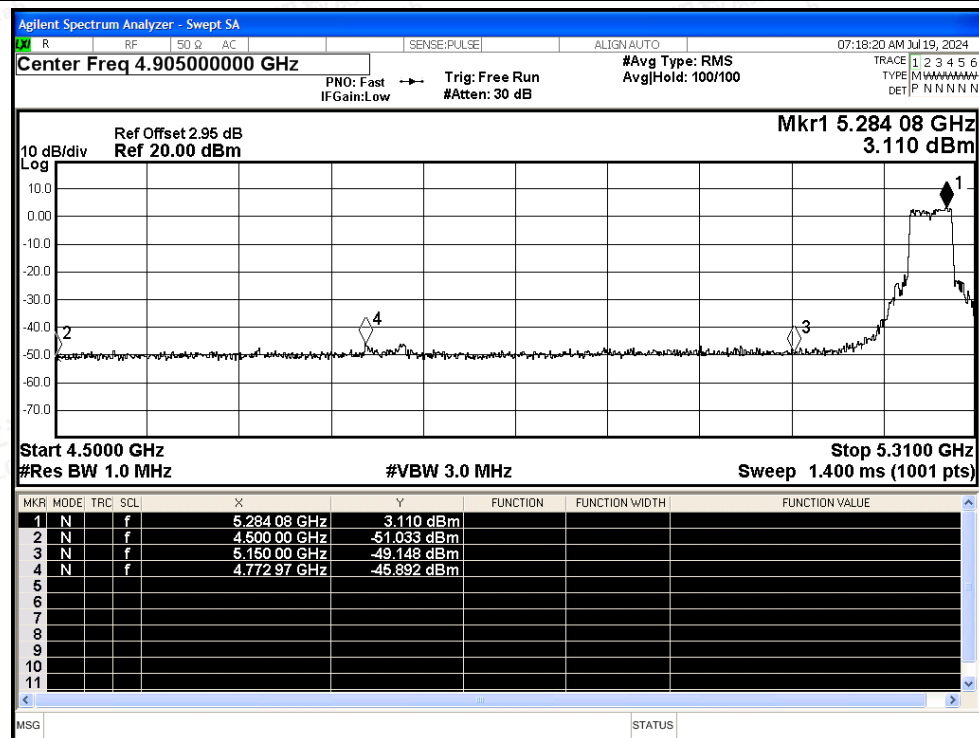

Restrict Band NVNT ac40 5270MHz Ant2 Average

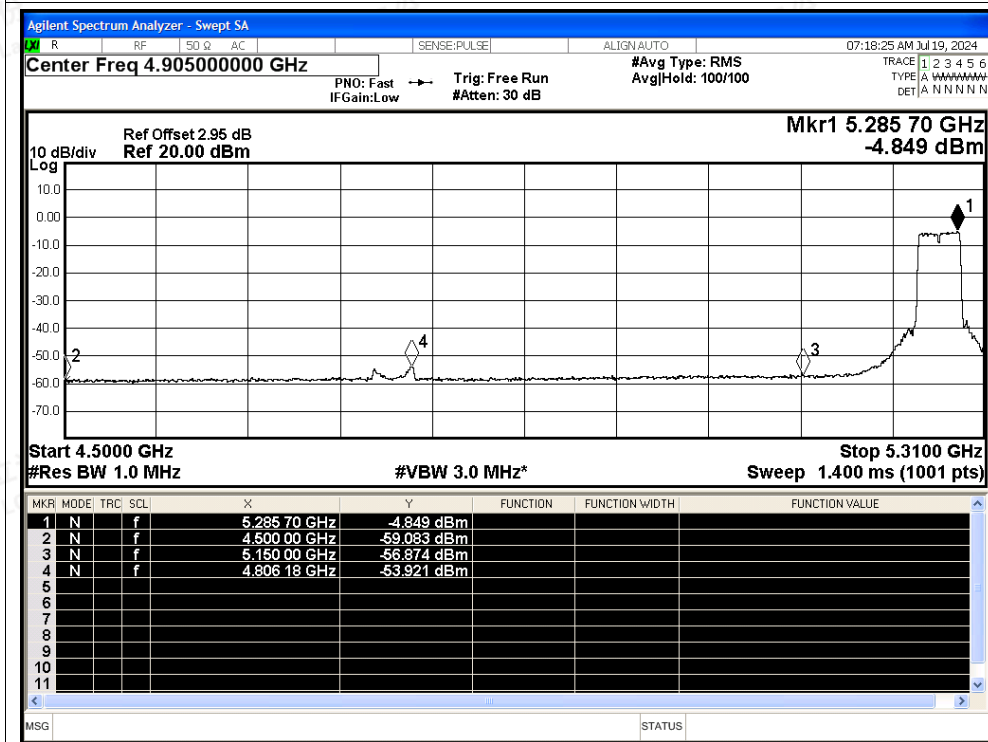

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ac40 5310MHz Ant2 Peak

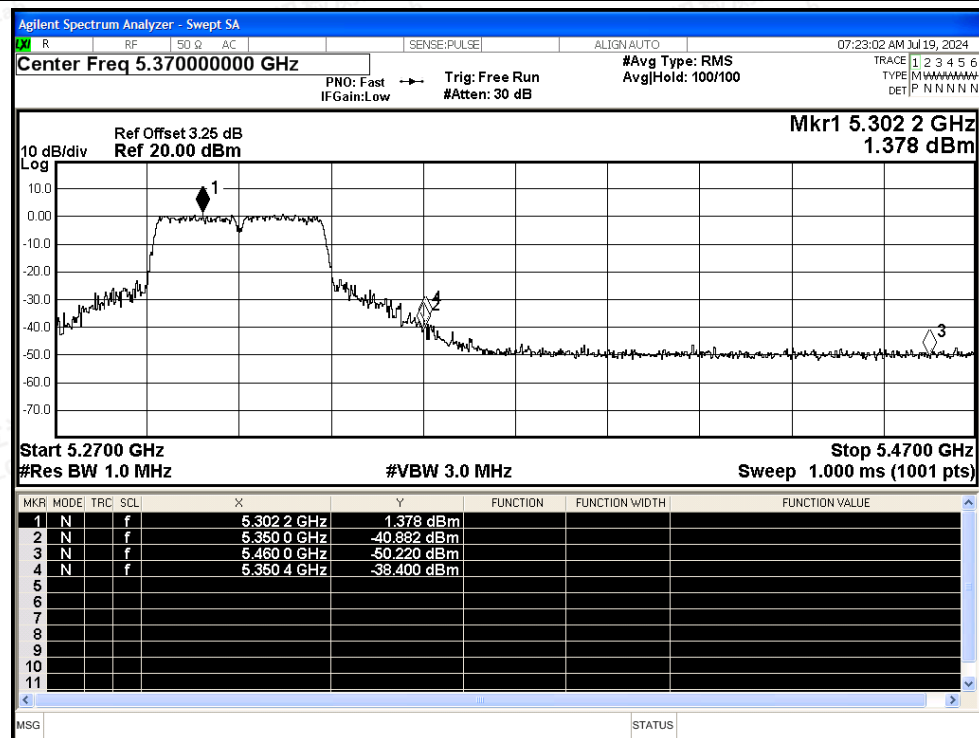

Restrict Band NVNT ac40 5310MHz Ant2 Average

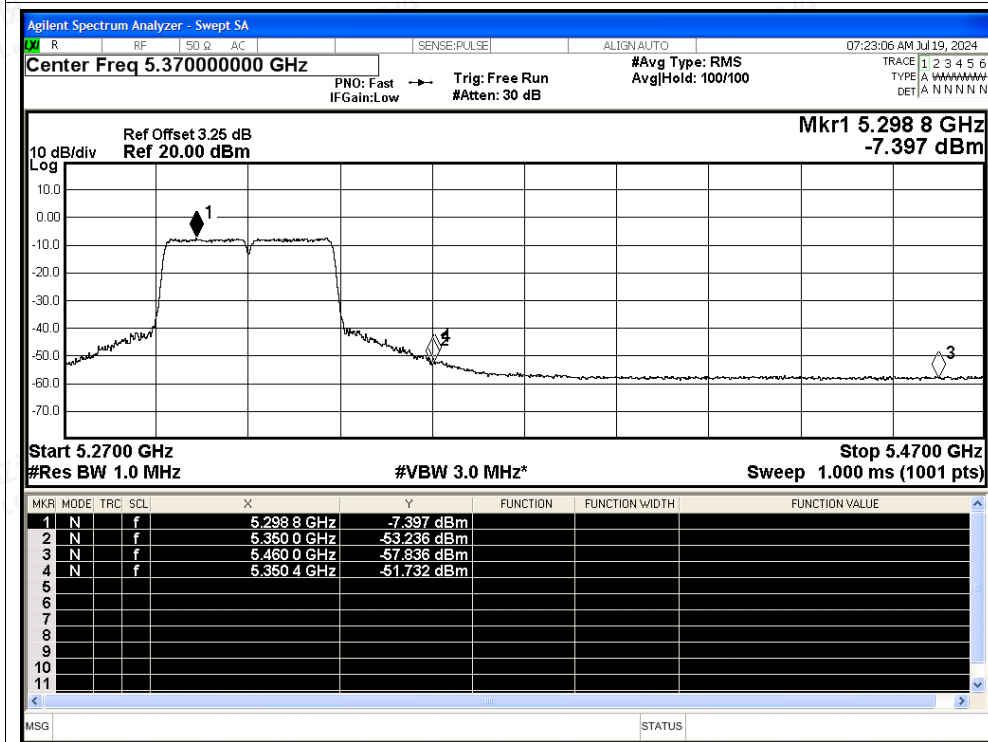

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ac80 5290MHz Ant2 Peak

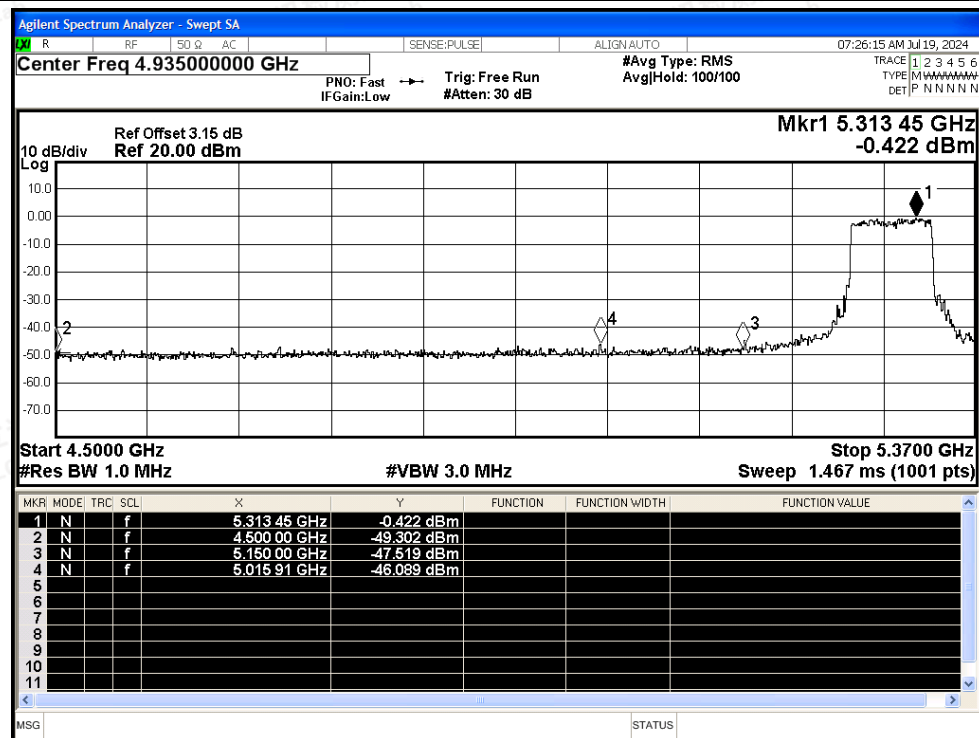

Restrict Band NVNT ac80 5290MHz Ant2 Average

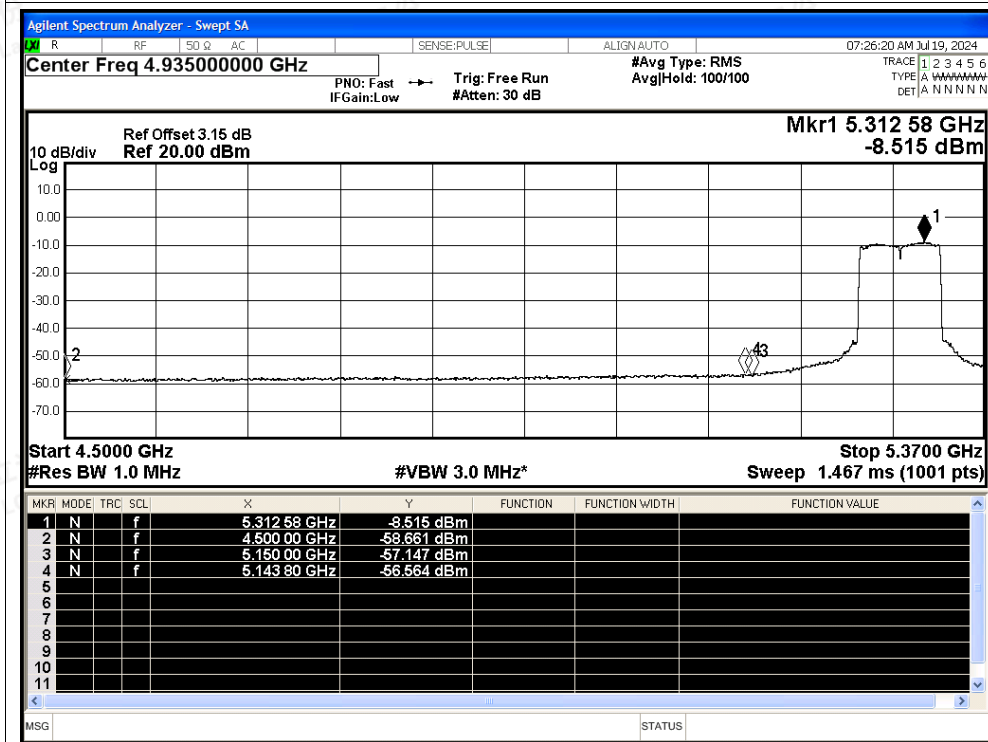

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ac80 5290MHz Ant2 Peak

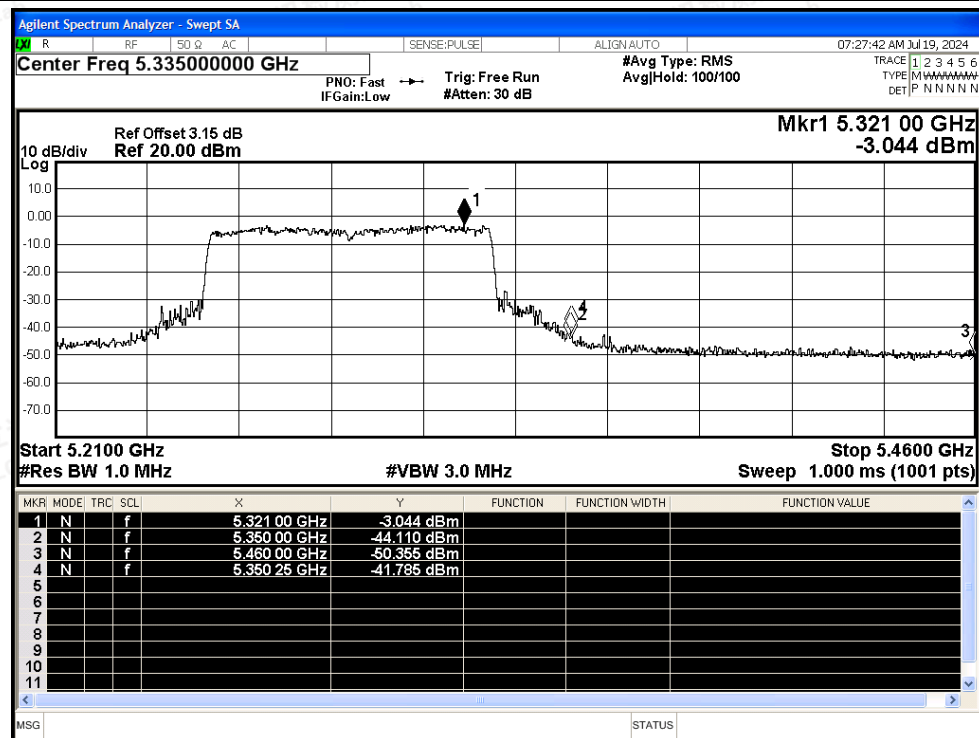

Restrict Band NVNT ac80 5290MHz Ant2 Average

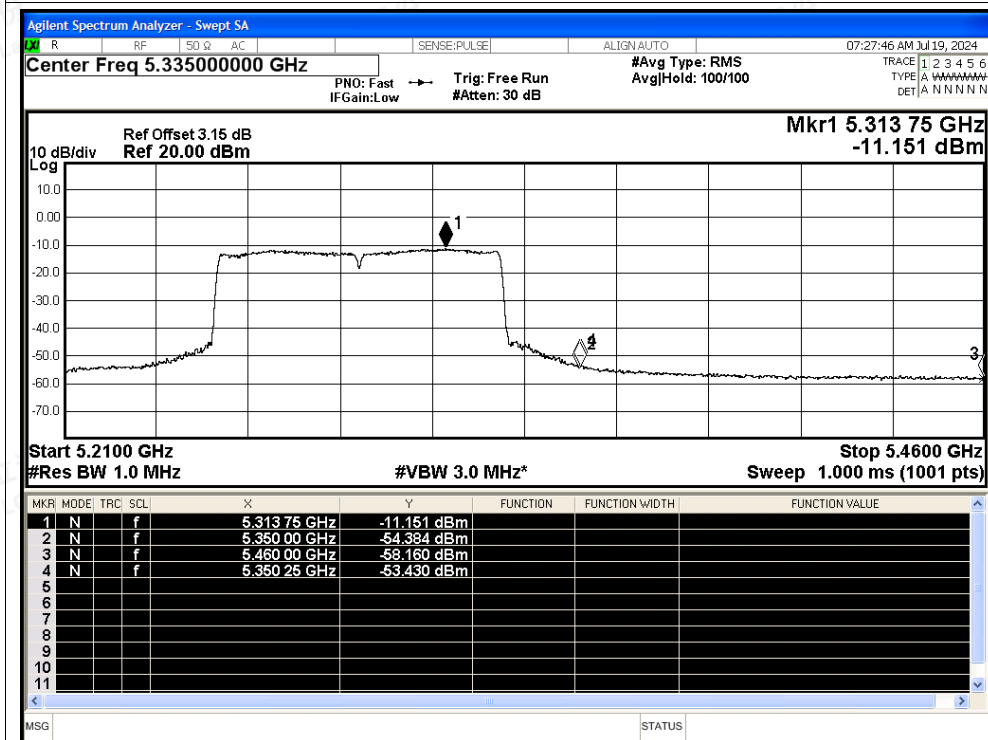

Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



MIMO

Condition	Mode	Frequency (MHz)	Spur Freq (MHz)	Ant1 Power (dBm)	Ant2 Power (dBm)	Gain (dBi)	E (dBuV/m)	Detector	Limit (dBuV/m)	Verdict
NVNT	n20	5260	4500	-50.41	-51.17	6.31	53.77	Peak	74	Pass
NVNT	n20	5260	4500	-59.59	-59.06	6.31	45.23	Average	54	Pass
NVNT	n20	5260	5037.42	-46.97	-46.82	6.31	57.65	Peak	74	Pass
NVNT	n20	5260	5136.48	-55.7	-55.82	6.31	48.79	Average	54	Pass
NVNT	n20	5260	5150	-49	-47.54	6.31	56.34	Peak	74	Pass
NVNT	n20	5260	5150	-57.15	-56.35	6.31	47.82	Average	54	Pass
NVNT	n20	5320	5350	-41.14	-40.77	6.31	63.60	Peak	74	Pass
NVNT	n20	5320	5350	-53.15	-53.41	6.31	51.27	Average	54	Pass
NVNT	n20	5320	5350.2	-35.42	-38.57	6.31	67.83	Peak	74	Pass
NVNT	n20	5320	5350.4	-51.91	-57.69	6.31	50.65	Average	54	Pass
NVNT	n20	5320	5460	-50.81	-50.47	6.31	53.91	Peak	74	Pass
NVNT	n20	5320	5460	-58.92	-53.41	6.31	49.20	Average	54	Pass
NVNT	n40	5270	4500	-50.35	-50.22	6.31	54.26	Peak	74	Pass
NVNT	n40	5270	4500	-58.76	-59.02	6.31	45.66	Average	54	Pass
NVNT	n40	5270	4807.8	-45.36	-45.67	6.31	59.04	Peak	74	Pass
NVNT	n40	5270	4806.99	-53.5	-53.58	6.31	51.01	Average	54	Pass
NVNT	n40	5270	5150	-48.67	-48.27	6.31	56.08	Peak	74	Pass
NVNT	n40	5270	5150	-57.39	-57.45	6.31	47.13	Average	54	Pass
NVNT	n40	5310	5350	-37.92	-39.68	6.31	65.84	Peak	74	Pass
NVNT	n40	5310	5350	-51.95	-53.33	6.31	51.96	Average	54	Pass
NVNT	n40	5310	5350.4	-36.56	-50.77	6.31	65.14	Peak	74	Pass
NVNT	n40	5310	5350.2	-51.49	-53.31	6.31	52.24	Average	54	Pass
NVNT	n40	5310	5460	-49.6	-39.68	6.31	62.28	Peak	74	Pass
NVNT	n40	5310	5460	-57.77	-57.98	6.31	46.67	Average	54	Pass
NVNT	ac20	5260	4500	-51.43	-51.03	6.31	53.32	Peak	74	Pass
NVNT	ac20	5260	4500	-59.04	-59.5	6.31	45.28	Average	54	Pass
NVNT	ac20	5260	4983.6	-46.33	-46.61	6.31	58.08	Peak	74	Pass
NVNT	ac20	5260	5093.58	-55.41	-55.98	6.31	48.86	Average	54	Pass
NVNT	ac20	5260	5150	-48.03	-48.38	6.31	56.35	Peak	74	Pass
NVNT	ac20	5260	5150	-56.87	-56.34	6.31	47.95	Average	54	Pass
NVNT	ac20	5320	5350	-38.83	-40.6	6.31	64.92	Peak	74	Pass
NVNT	ac20	5320	5350	-51.2	-54.29	6.31	52.07	Average	54	Pass
NVNT	ac20	5320	5350.4	-36.83	-38.96	6.31	66.78	Peak	74	Pass
NVNT	ac20	5320	5351.8	-58.11	-53.67	6.31	49.20	Average	54	Pass
NVNT	ac20	5320	5460	-49.22	-48.82	6.31	55.53	Peak	74	Pass
NVNT	ac20	5320	5460	-51.2	-57.98	6.31	51.17	Average	54	Pass
NVNT	ac40	5310	5350	-49.49	-51.03	6.31	54.36	Peak	74	Pass



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



NVNT	ac40	5310	5350	-59.25	-59.08	6.31	45.38	Average	54	Pass
NVNT	ac40	5310	5351	-43.87	-45.89	6.31	59.78	Peak	74	Pass
NVNT	ac40	5310	5350	-52.77	-53.92	6.31	51.24	Average	54	Pass
NVNT	ac40	5310	5460	-48.44	-49.15	6.31	55.77	Peak	74	Pass
NVNT	ac40	5310	5460	-56.77	-56.87	6.31	47.73	Average	54	Pass
NVNT	ac40	5310	5350	-41.87	-40.88	6.31	63.20	Peak	74	Pass
NVNT	ac40	5310	5350	-53.15	-53.24	6.31	51.35	Average	54	Pass
NVNT	ac40	5310	5351	-37.44	-38.4	6.31	66.65	Peak	74	Pass
NVNT	ac40	5310	5350	-52.87	-51.73	6.31	52.29	Average	54	Pass
NVNT	ac40	5310	5460	-50.74	-50.22	6.31	54.08	Peak	74	Pass
NVNT	ac40	5310	5460	-57.67	-57.84	6.31	46.79	Average	54	Pass
NVNT	ac80	5290	4500	-50.2	-49.3	6.31	54.82	Peak	74	Pass
NVNT	ac80	5290	4500	-58.47	-58.66	6.31	45.98	Average	54	Pass
NVNT	ac80	5290	4878.45	-46.56	-46.09	6.31	58.23	Peak	74	Pass
NVNT	ac80	5290	5075.07	-56.38	-56.56	6.31	48.08	Average	54	Pass
NVNT	ac80	5290	5150	-49.52	-47.52	6.31	56.14	Peak	74	Pass
NVNT	ac80	5290	5150	-56.71	-57.15	6.31	47.62	Average	54	Pass
NVNT	ac80	5290	5350	-43.34	-44.11	6.31	60.84	Peak	74	Pass
NVNT	ac80	5290	5350	-51.96	-54.38	6.31	51.54	Average	54	Pass
NVNT	ac80	5290	5351	-38.36	-41.79	6.31	64.80	Peak	74	Pass
NVNT	ac80	5290	5352	-58.09	-53.43	6.31	49.39	Average	54	Pass
NVNT	ac80	5290	5460	-50.53	-50.36	6.31	54.10	Peak	74	Pass
NVNT	ac80	5290	5460	-51.96	-58.16	6.31	50.51	Average	54	Pass



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



E.5 Frequency Stability

Condition	Mode	Frequency (MHz)	Antenna	Measured Frequency (MHz)	Frequency Error (Hz)	Deviation (ppm)	Limit (ppm)	Verdict
NVNT	ac20	5260	Ant1	5259.98	-20000	-3.8	25	Pass
NVNT	ac20	5300	Ant1	5299.96	-40000	-7.55	25	Pass
NVNT	ac20	5320	Ant1	5319.98	-20000	-3.76	25	Pass
NVNT	ac40	5270	Ant1	5270	0	0	25	Pass
NVNT	ac40	5310	Ant1	5309.96	-40000	-7.53	25	Pass
NVNT	ac80	5290	Ant1	5290	0	0	25	Pass



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China


Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity




Test Graphs

Freq. Stability NVNT ac20 5260MHz Ant1

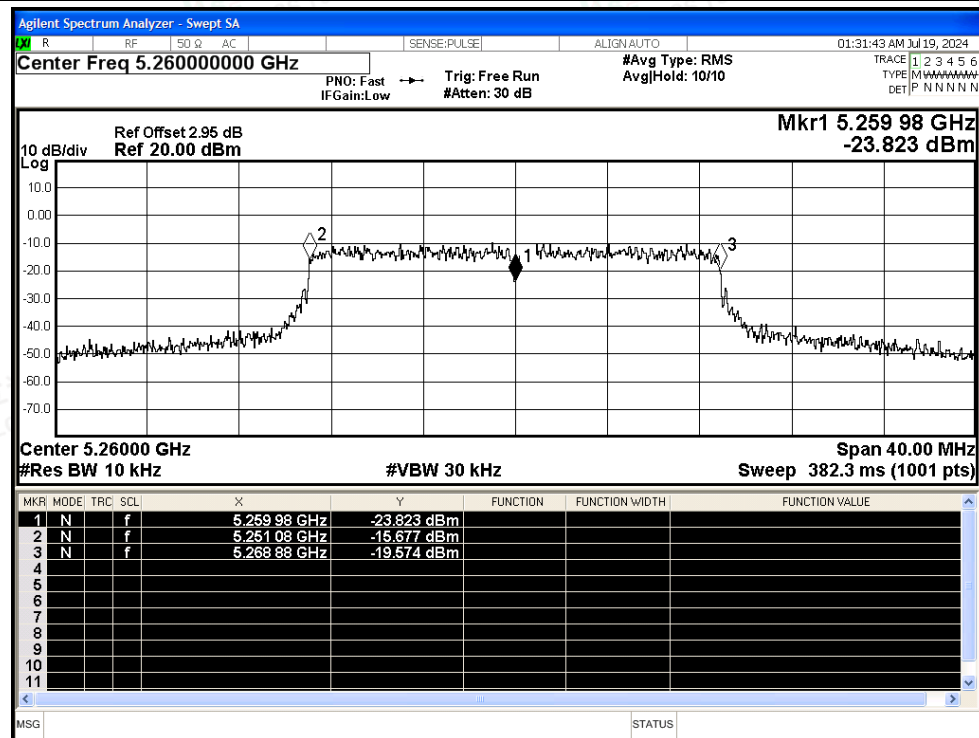

Freq. Stability NVNT ac20 5300MHz Ant1

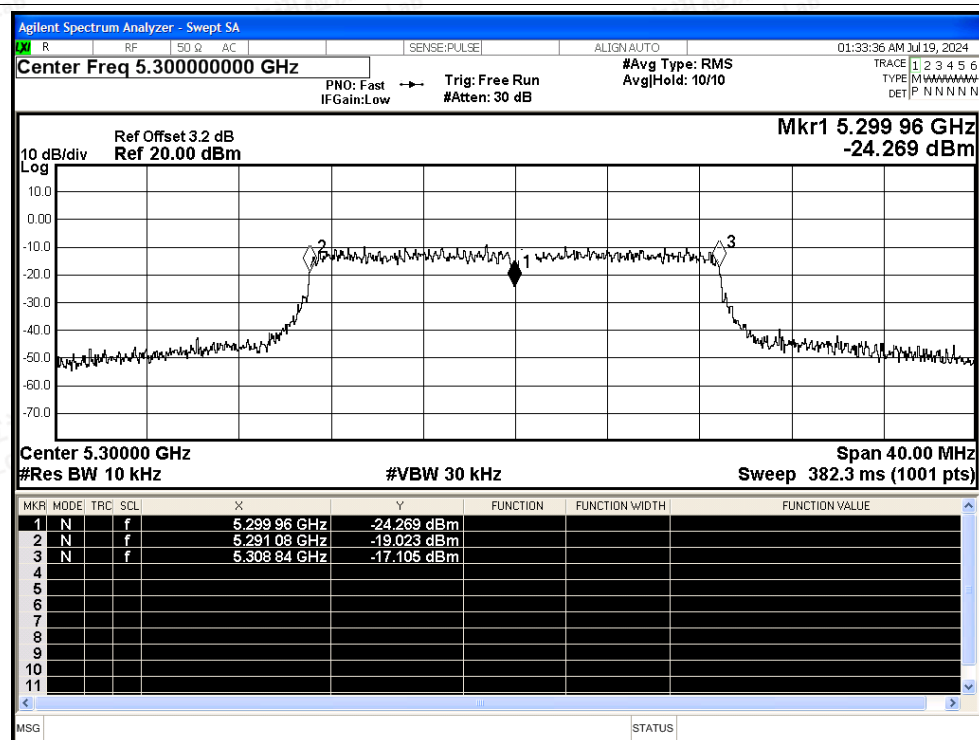

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Freq. Stability NVNT ac20 5320MHz Ant1

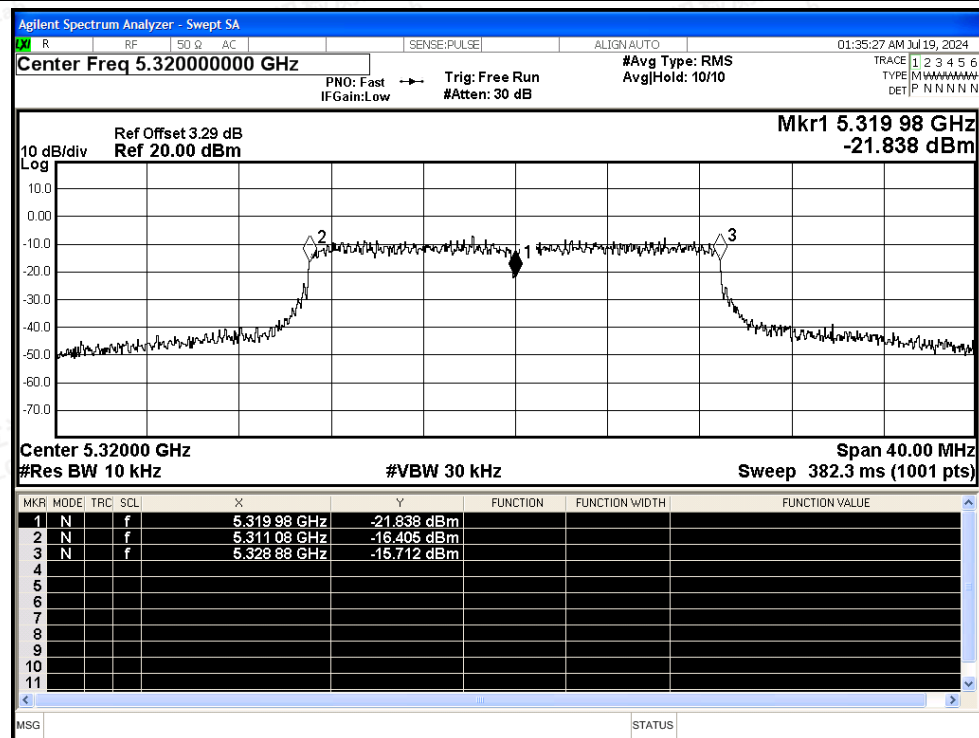

Freq. Stability NVNT ac40 5270MHz Ant1

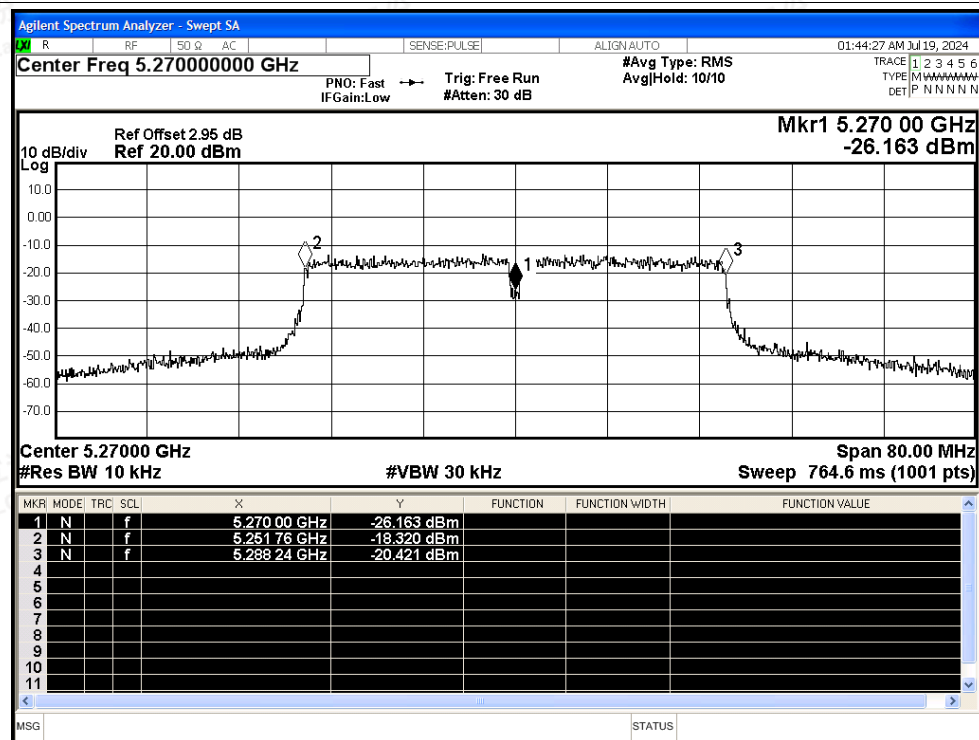

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Freq. Stability NVNT ac40 5310MHz Ant1

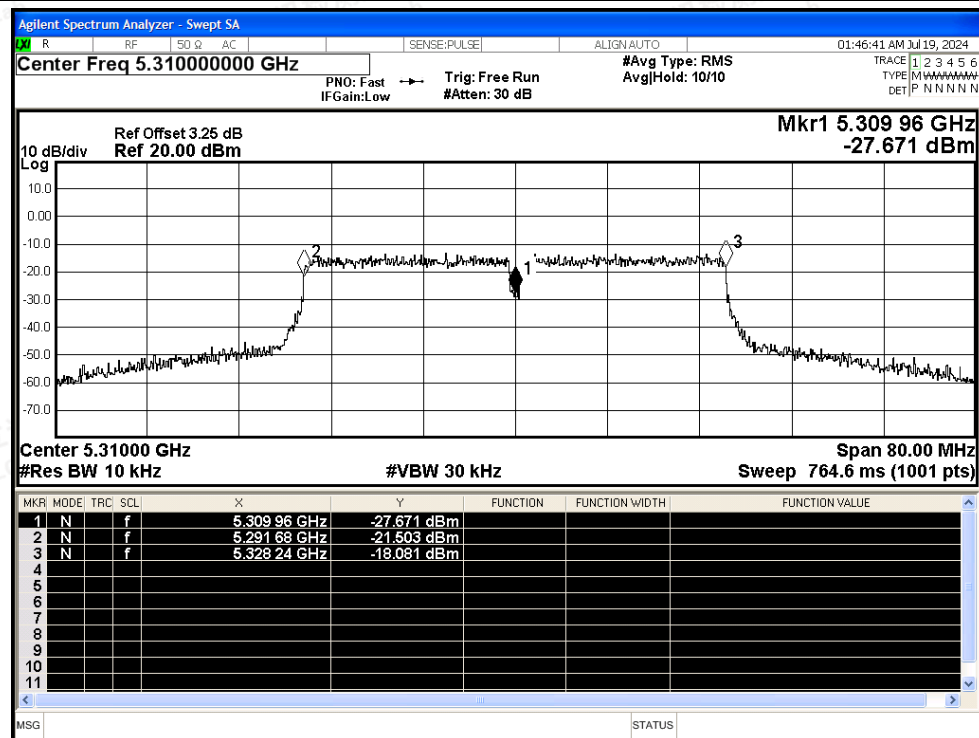

Freq. Stability NVNT ac80 5290MHz Ant1

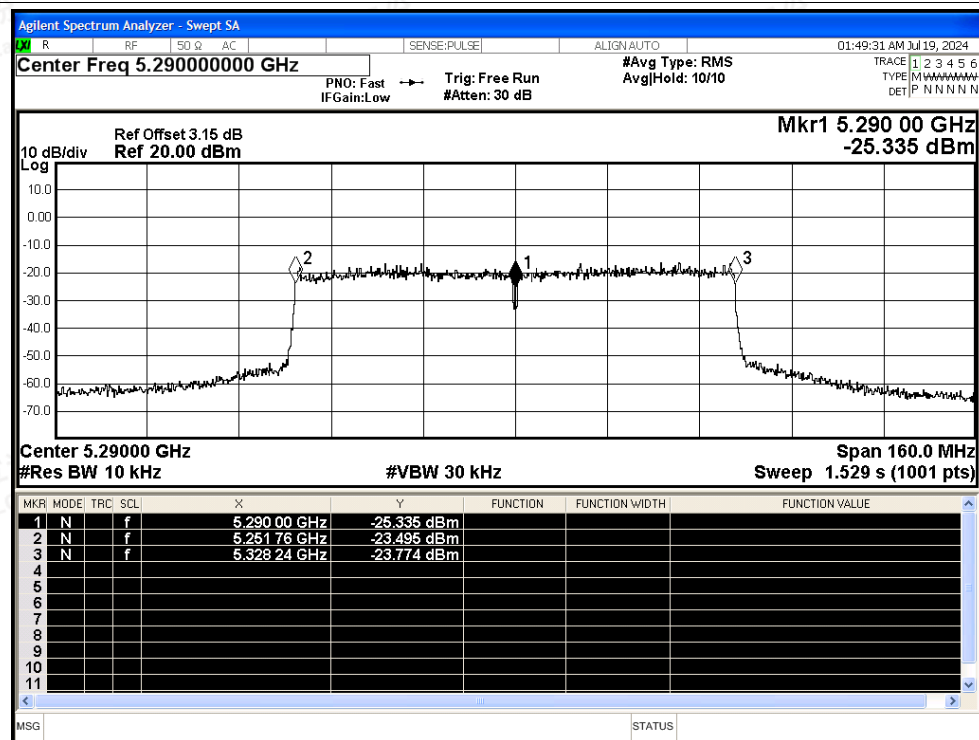

Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity




Condition	Mode	Frequency (MHz)	Antenna	Measured Frequency (MHz)	Frequency Error (Hz)	Deviation (ppm)	Limit (ppm)	Verdict
NVNT	ac20	5260	Ant2	5259.96	-40000	-7.6	25	Pass
NVNT	ac20	5300	Ant2	5299.98	-20000	-3.77	25	Pass
NVNT	ac20	5320	Ant2	5319.96	-40000	-7.52	25	Pass
NVNT	ac40	5270	Ant2	5269.96	-40000	-7.59	25	Pass
NVNT	ac40	5310	Ant2	5309.96	-40000	-7.53	25	Pass
NVNT	ac80	5290	Ant2	5290	0	0	25	Pass






Test Graphs

Freq. Stability NVNT ac20 5260MHz Ant2

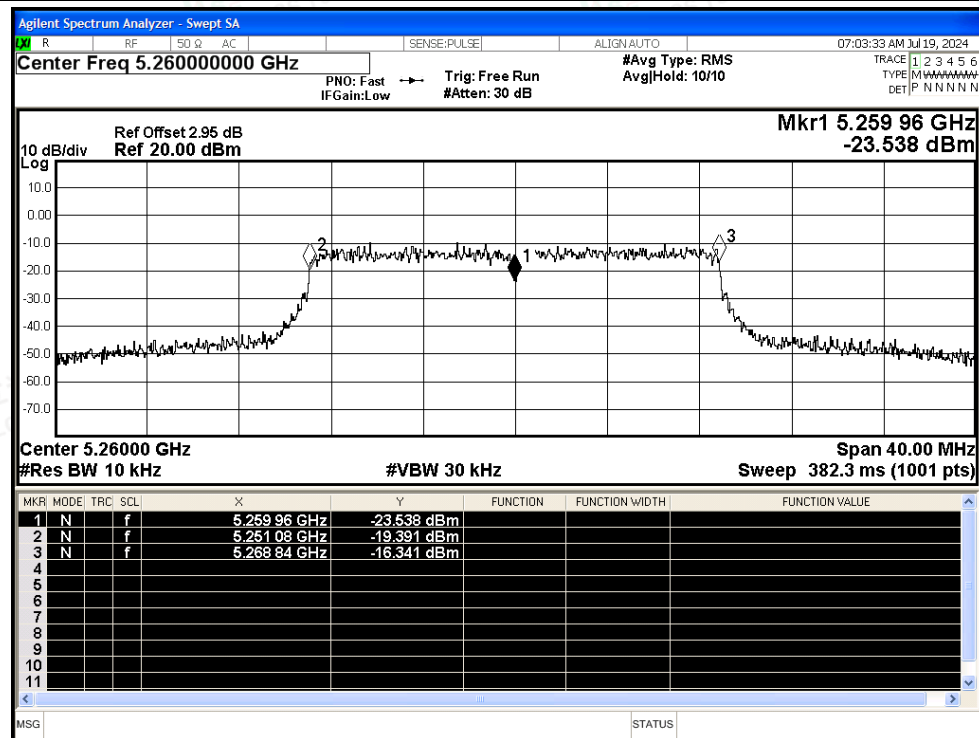

Freq. Stability NVNT ac20 5300MHz Ant2

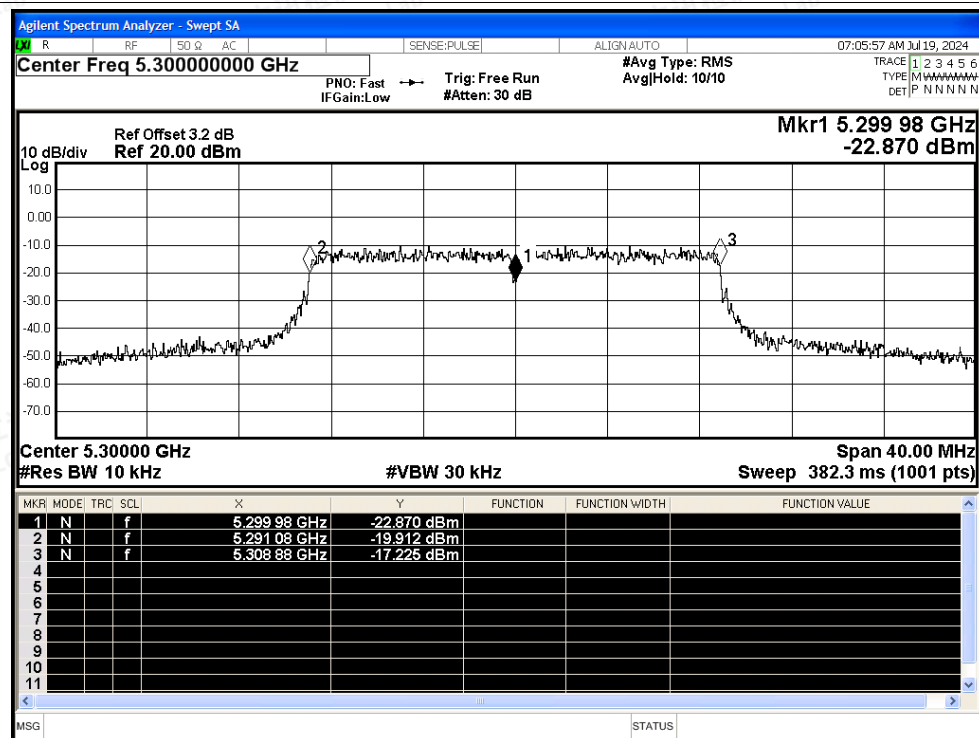

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Freq. Stability NVNT ac20 5320MHz Ant2

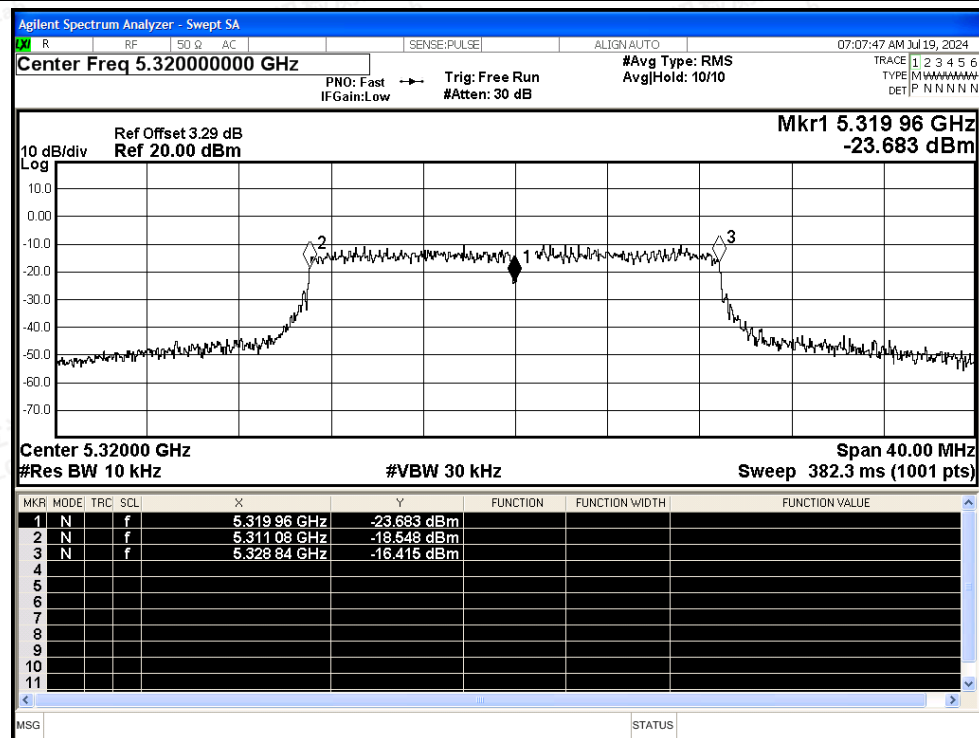

Freq. Stability NVNT ac40 5270MHz Ant2


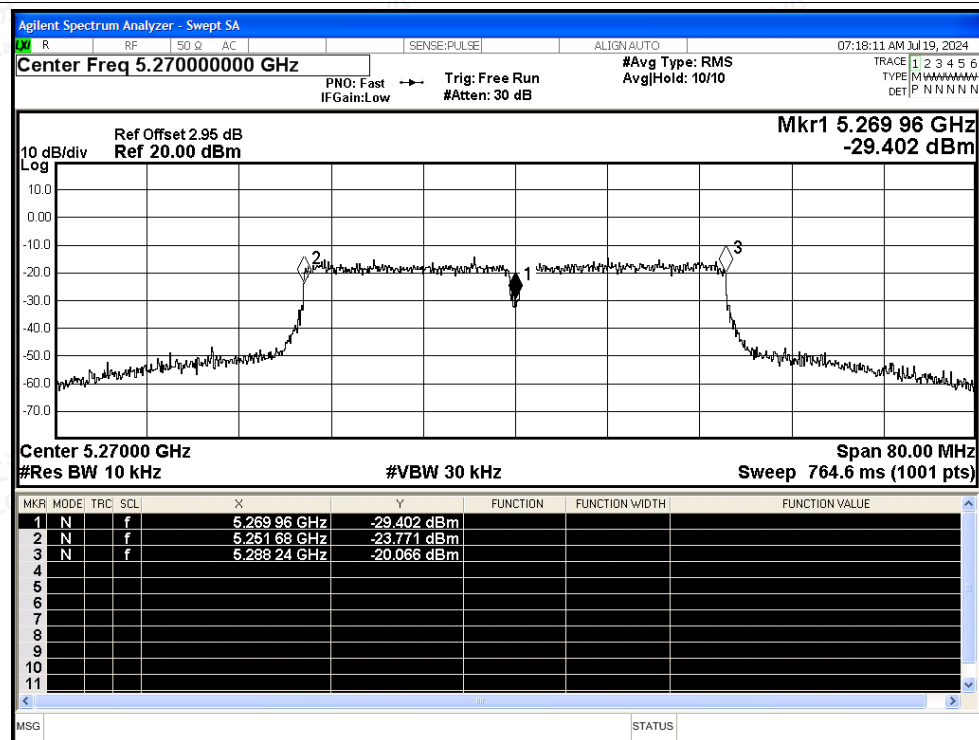


Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

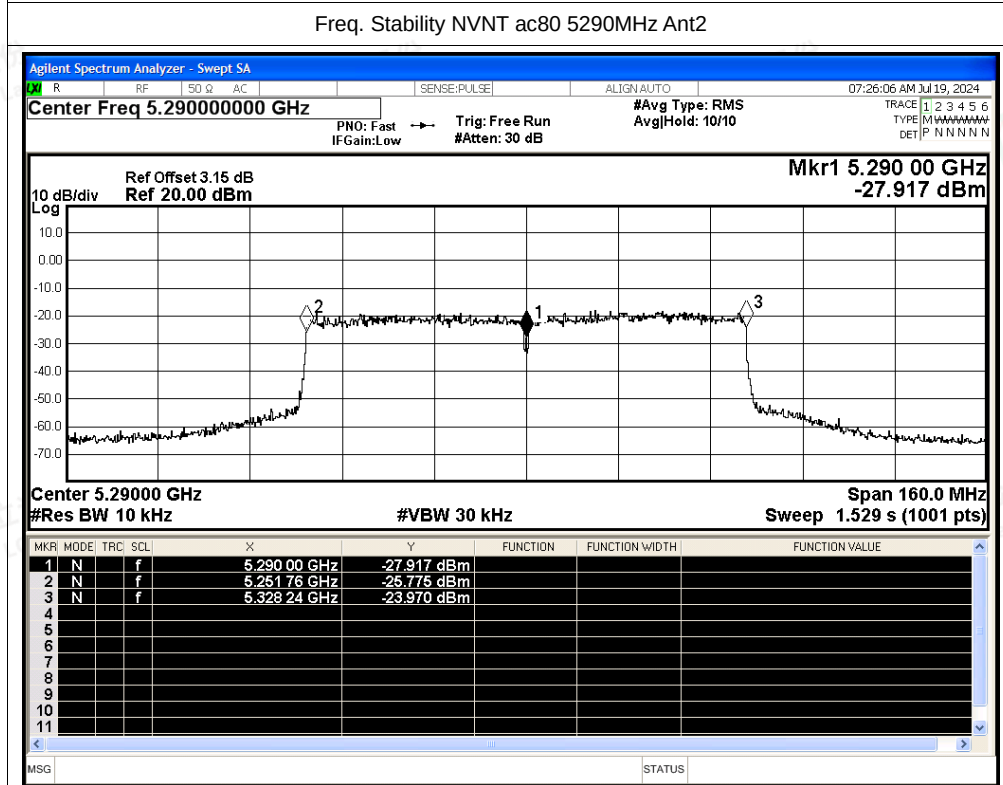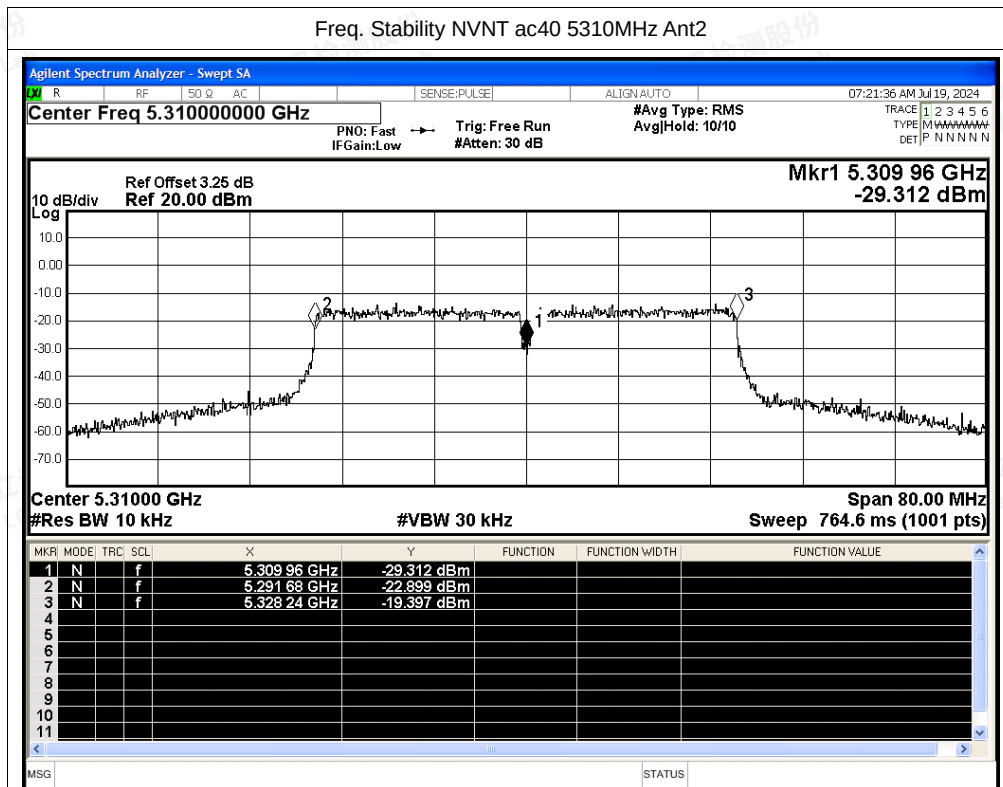

Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



E.6 Duty Cycle

Condition	Mode	Frequency (MHz)	Antenna	Duty Cycle (%)	Correction Factor (dB)	1/T (kHz)
NVNT	a	5260	Ant1	94.56	0.24	0.91
NVNT	a	5300	Ant1	94.65	0.24	0.91
NVNT	a	5320	Ant1	94.56	0.24	0.91
NVNT	n20	5260	Ant1	93.67	0.28	1.07
NVNT	n20	5300	Ant1	93.77	0.28	1.07
NVNT	n20	5320	Ant1	93.77	0.28	1.07
NVNT	n40	5270	Ant1	90.14	0.45	1.74
NVNT	n40	5310	Ant1	90.3	0.44	1.73
NVNT	ac20	5260	Ant1	93.82	0.28	1.06
NVNT	ac20	5300	Ant1	93.72	0.28	1.06
NVNT	ac20	5320	Ant1	93.72	0.28	1.06
NVNT	ac40	5270	Ant1	90.2	0.45	1.72
NVNT	ac40	5310	Ant1	90.36	0.44	1.72
NVNT	ac80	5290	Ant1	86.79	0.62	2.42



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China


Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity




Test Graphs

Duty Cycle NVNT a 5260MHz Ant1

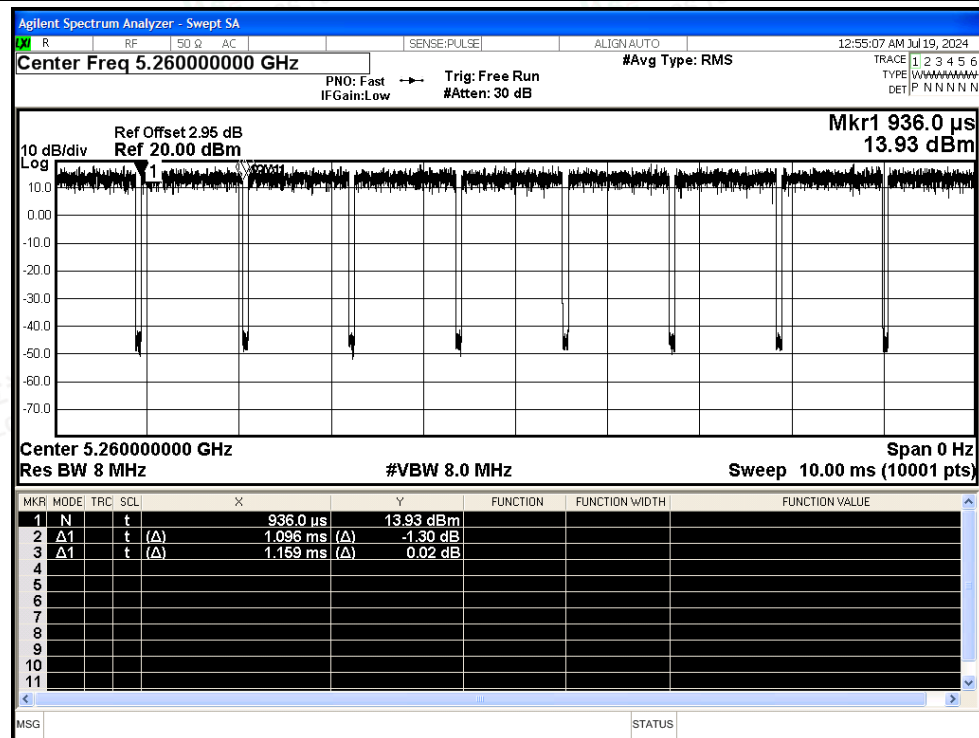

Duty Cycle NVNT a 5300MHz Ant1

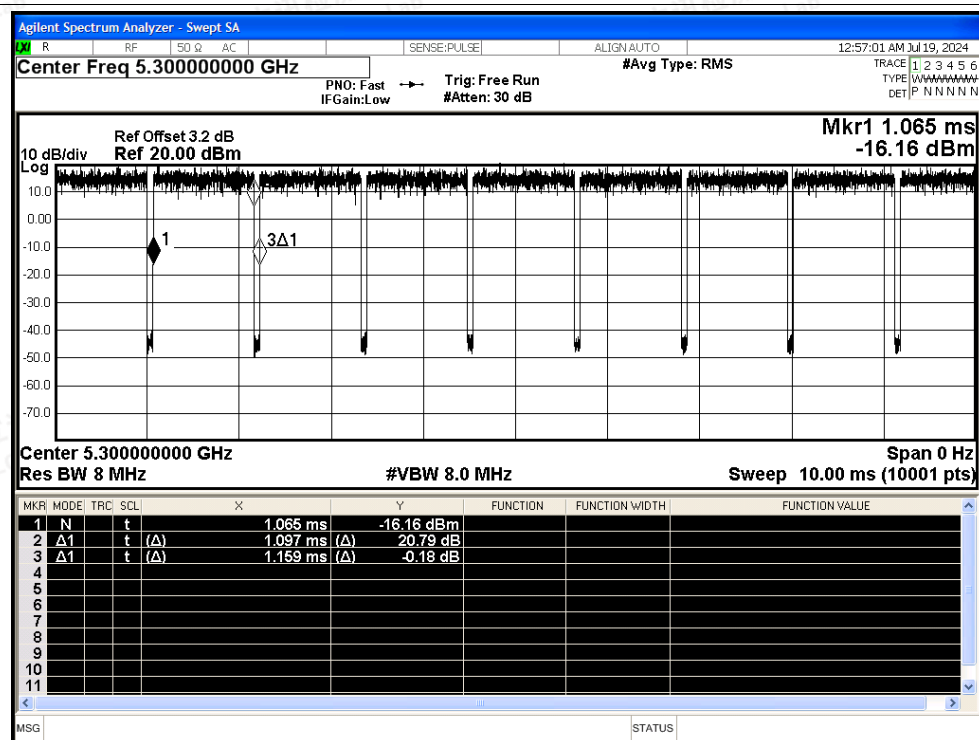

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Duty Cycle NVNT a 5320MHz Ant1

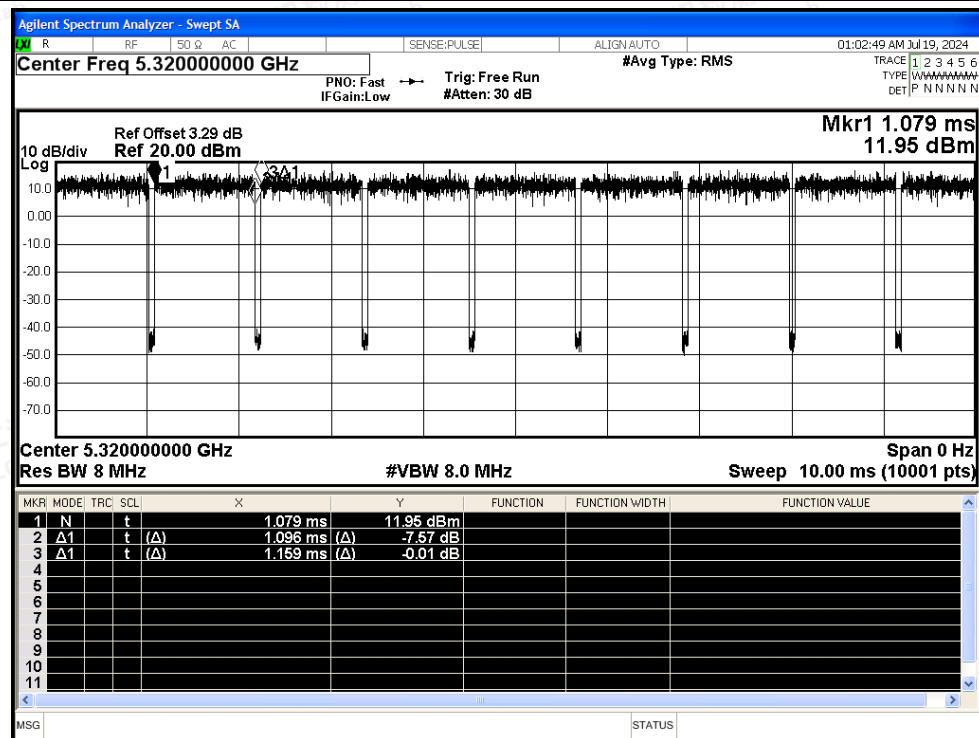

Duty Cycle NVNT n20 5260MHz Ant1


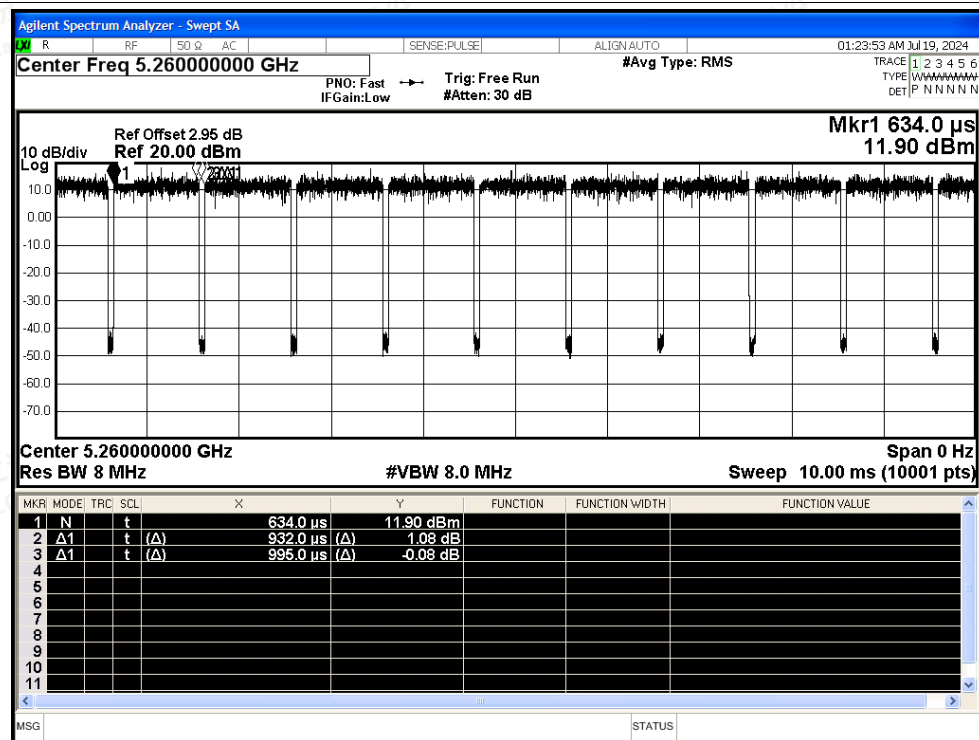


Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

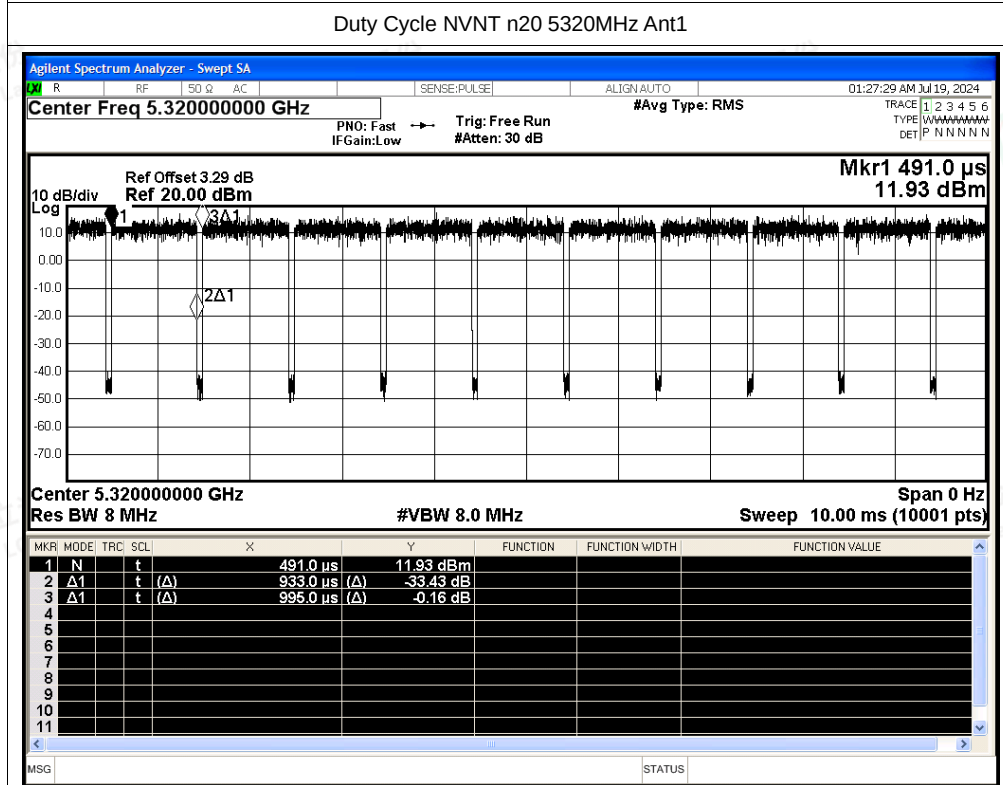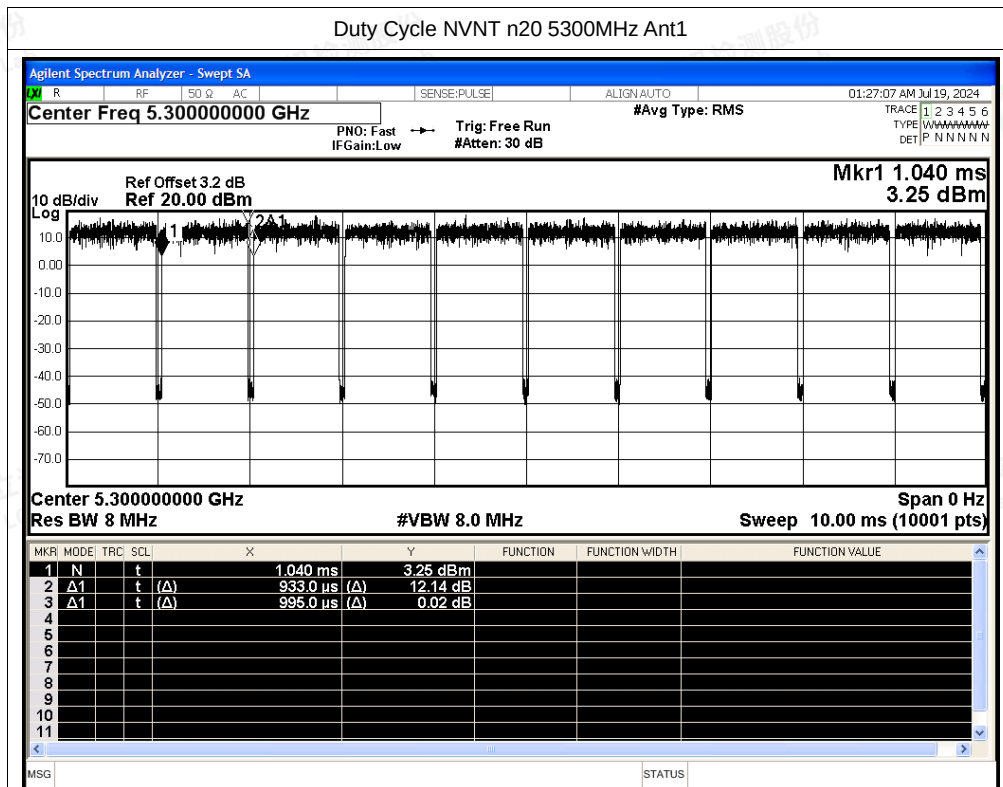

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Duty Cycle NVNT n40 5270MHz Ant1

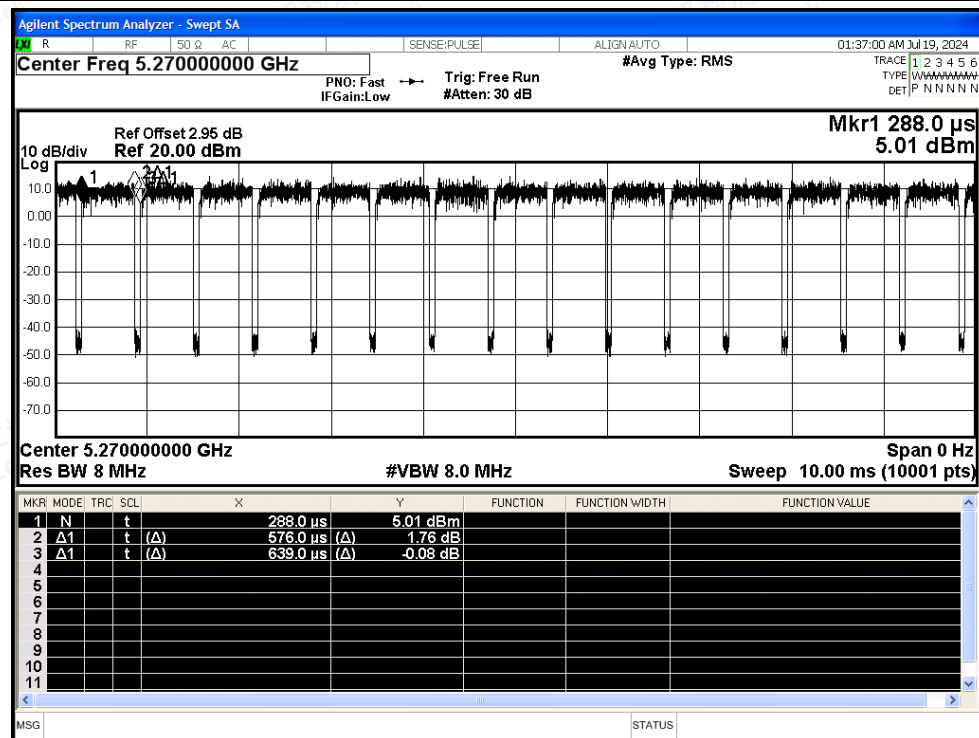

Duty Cycle NVNT n40 5310MHz Ant1

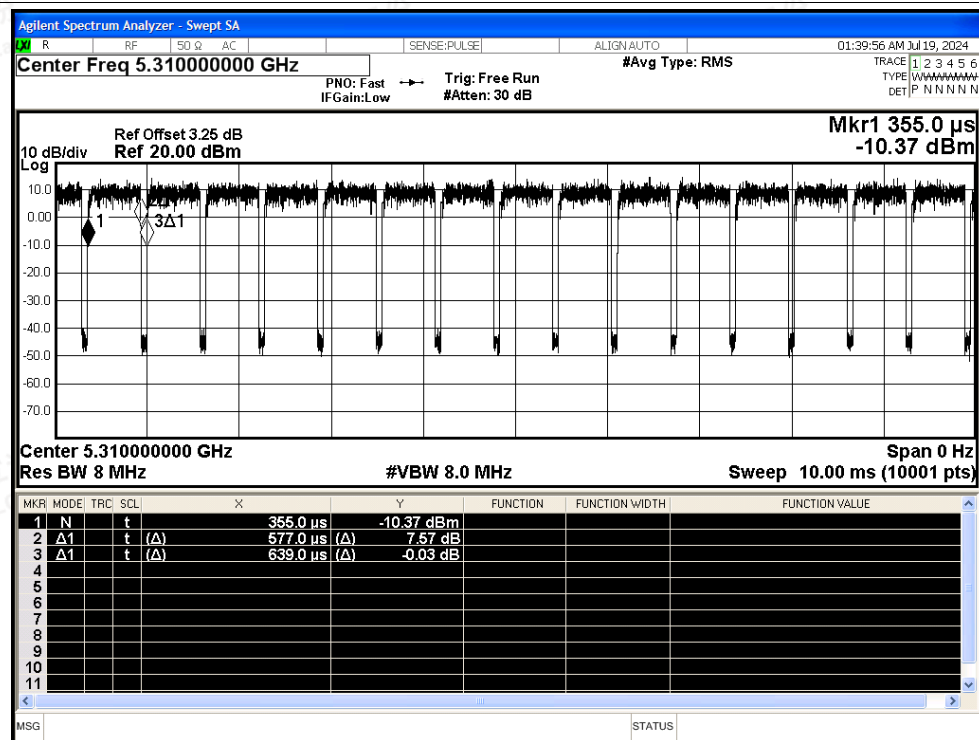

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Duty Cycle NVNT ac20 5260MHz Ant1

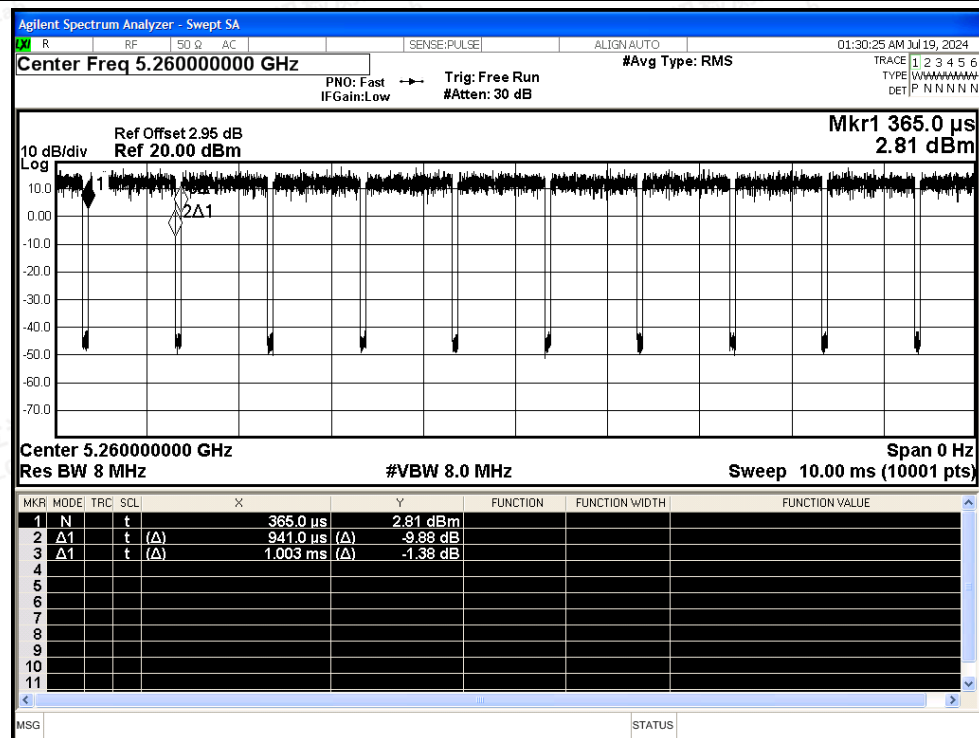

Duty Cycle NVNT ac20 5300MHz Ant1

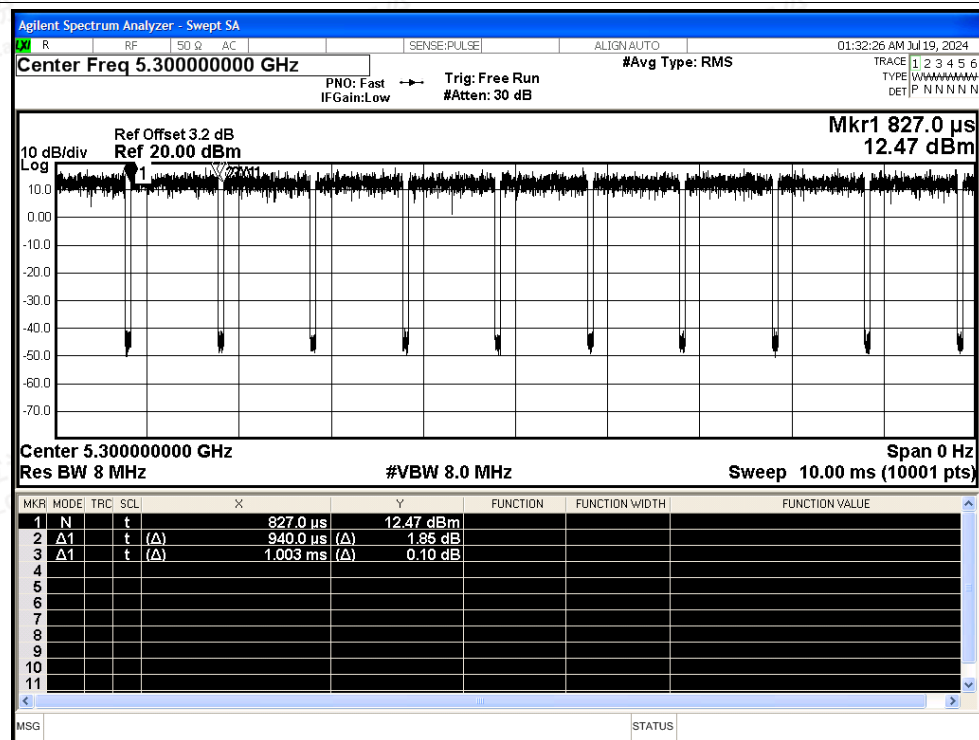

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Duty Cycle NVNT ac20 5320MHz Ant1

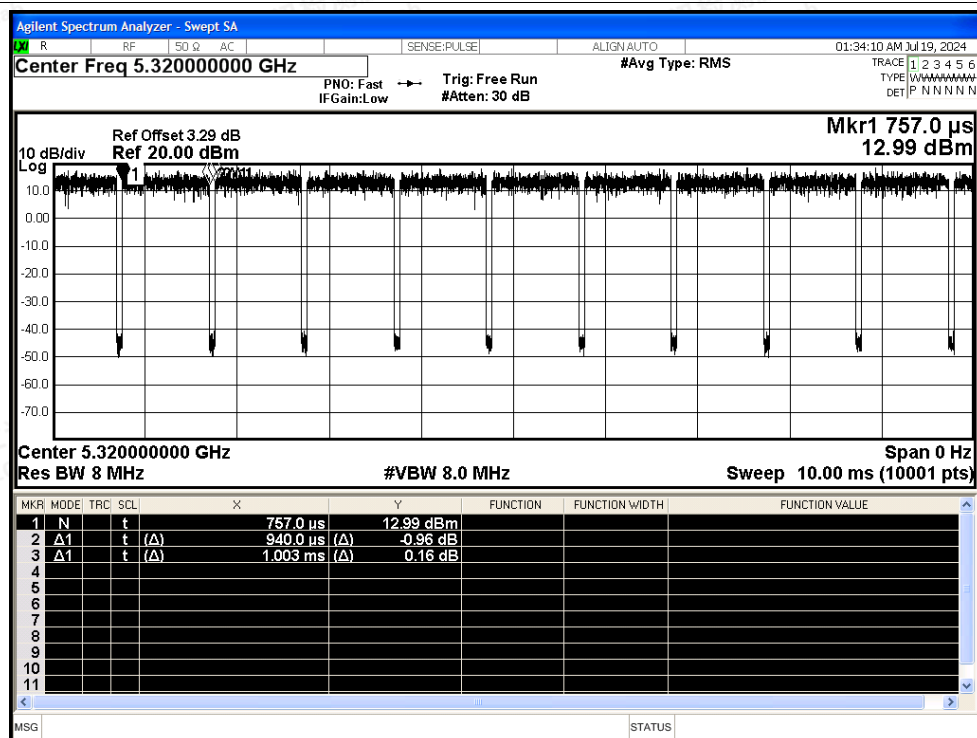

Duty Cycle NVNT ac40 5270MHz Ant1

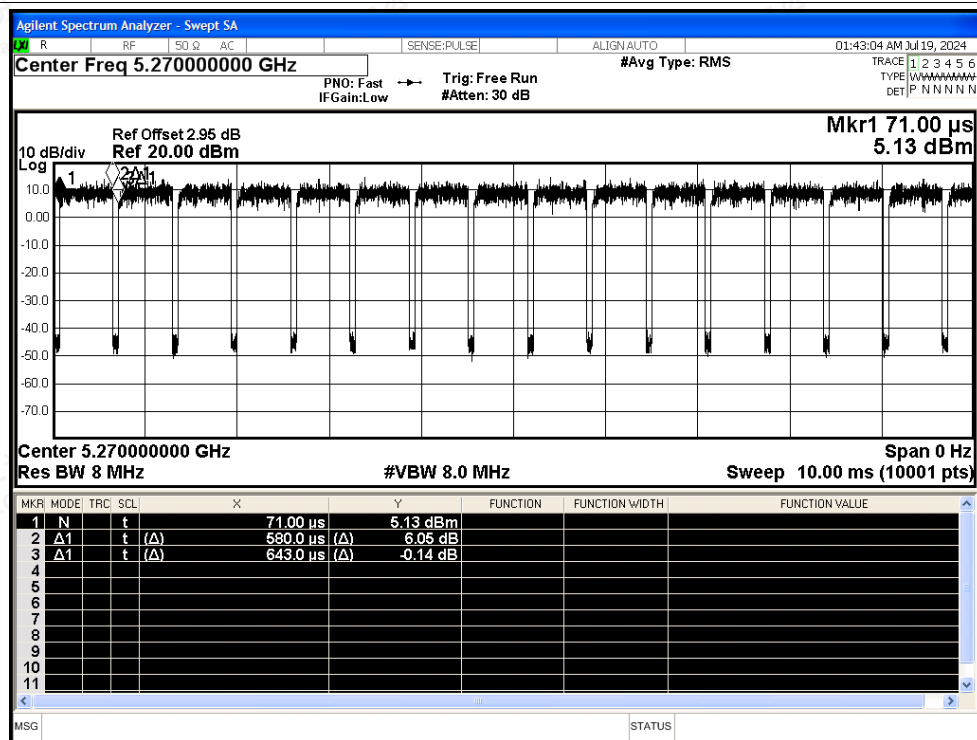

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Duty Cycle NVNT ac40 5310MHz Ant1

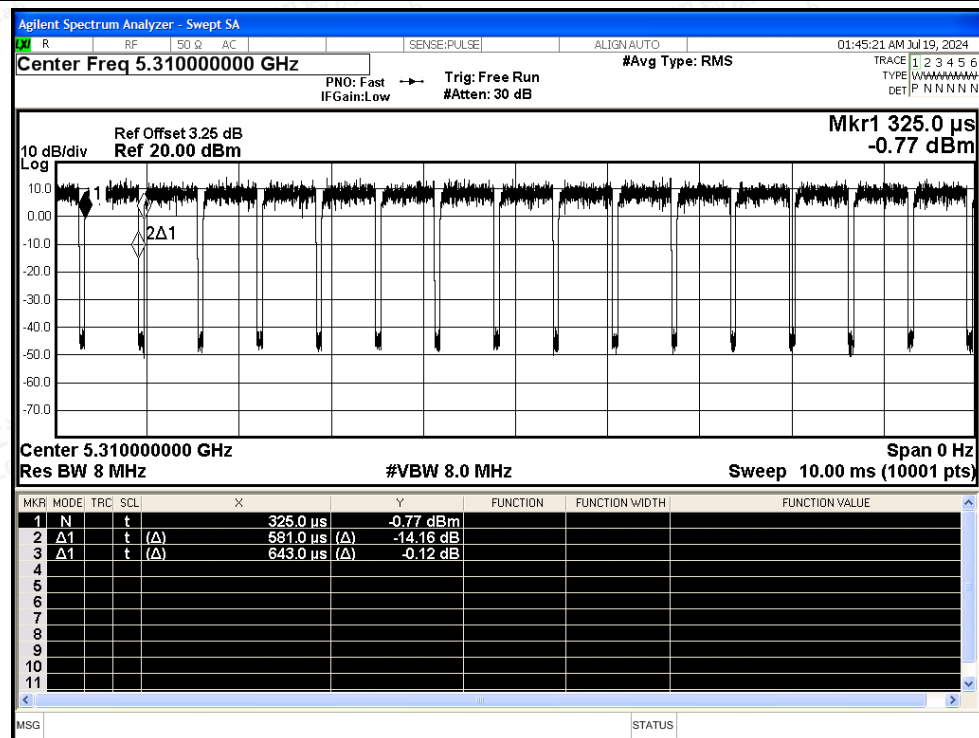

Duty Cycle NVNT ac80 5290MHz Ant1

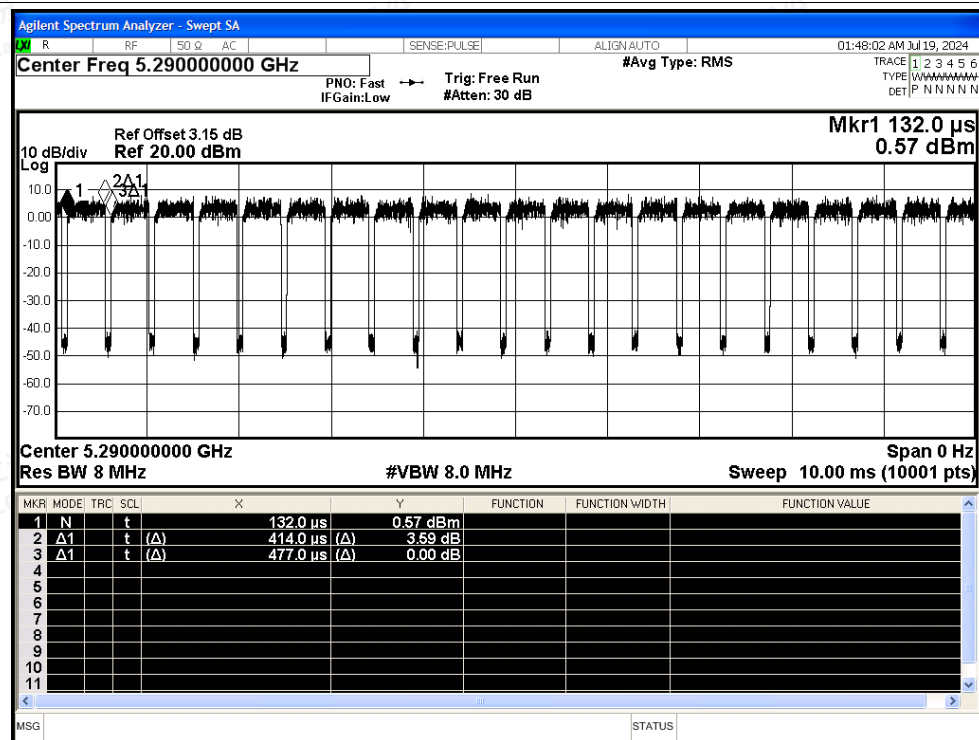

Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



Condition	Mode	Frequency (MHz)	Antenna	Duty Cycle (%)	Correction Factor (dB)	1/T (kHz)
NVNT	a	5260	Ant2	94.65	0.24	0.91
NVNT	a	5300	Ant2	94.65	0.24	0.91
NVNT	a	5320	Ant2	94.65	0.24	0.91
NVNT	n20	5260	Ant2	93.67	0.28	1.07
NVNT	n20	5300	Ant2	93.77	0.28	1.07
NVNT	n20	5320	Ant2	93.77	0.28	1.07
NVNT	n40	5270	Ant2	88.14	0.55	2.14
NVNT	n40	5310	Ant2	88.14	0.55	2.14
NVNT	ac20	5260	Ant2	93.72	0.28	1.06
NVNT	ac20	5300	Ant2	93.72	0.28	1.06
NVNT	ac20	5320	Ant2	93.72	0.28	1.06
NVNT	ac40	5270	Ant2	97.19	0.12	0.46
NVNT	ac40	5310	Ant2	97.19	0.12	0.46
NVNT	ac80	5290	Ant2	94.32	0.25	0.97



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China


Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity




Test Graphs

Duty Cycle NVNT a 5260MHz Ant2

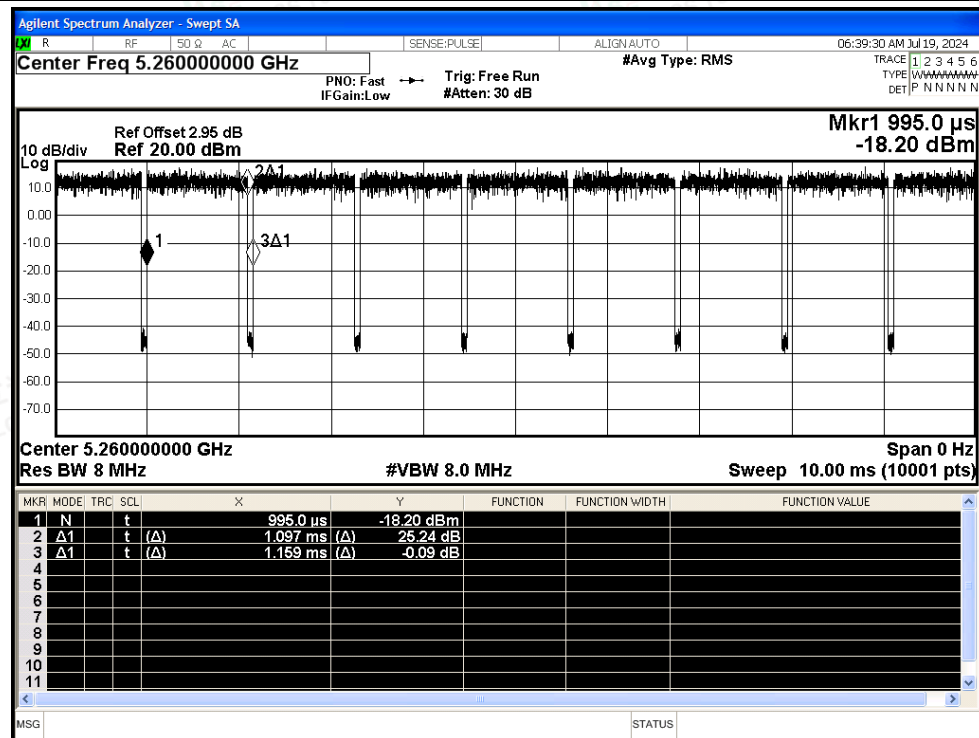

Duty Cycle NVNT a 5300MHz Ant2

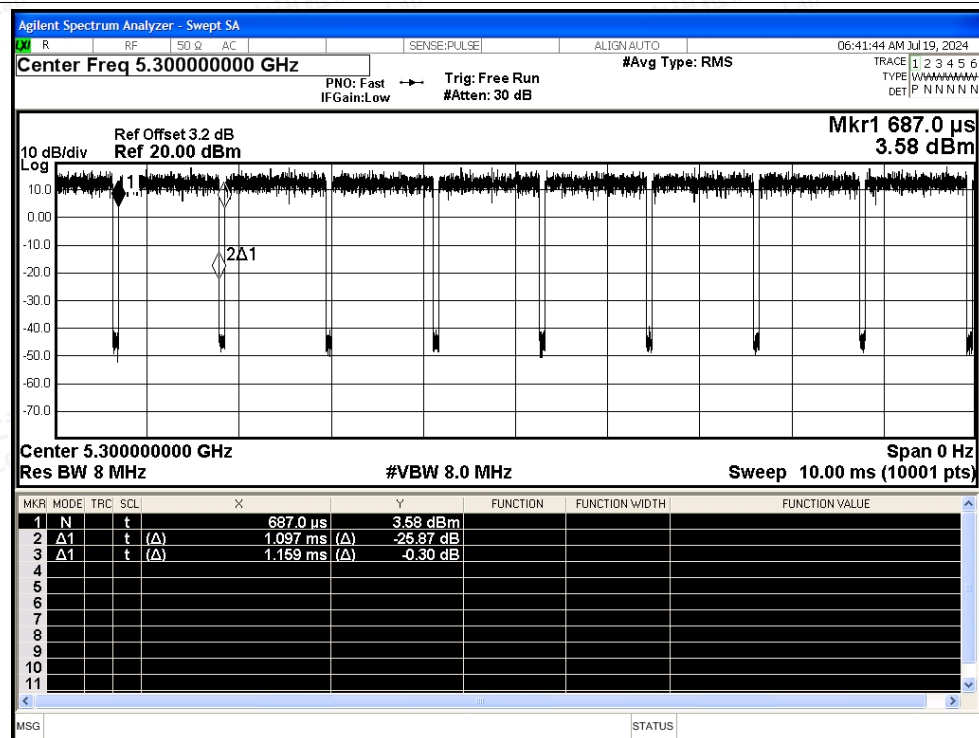

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Duty Cycle NVNT a 5320MHz Ant2

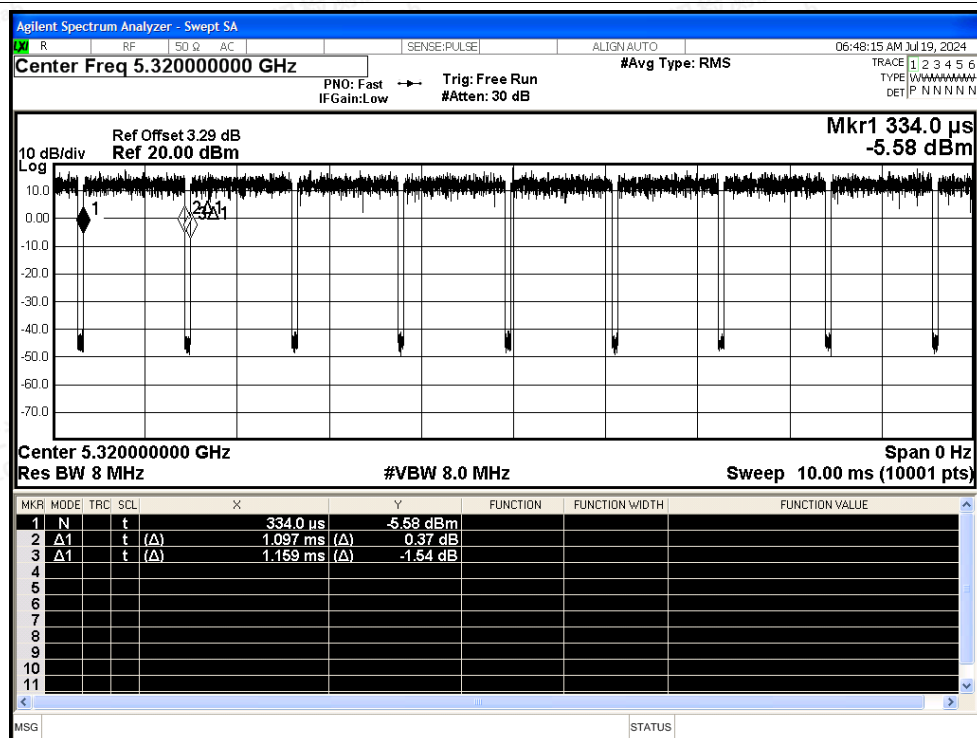

Duty Cycle NVNT n20 5260MHz Ant2

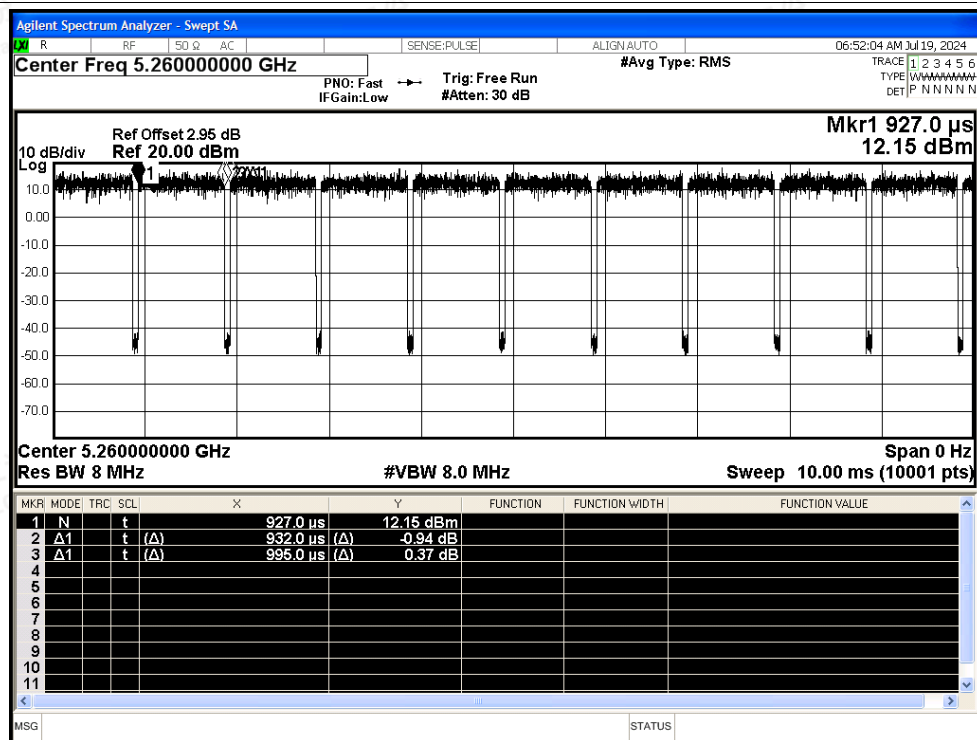

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Duty Cycle NVNT n20 5300MHz Ant2

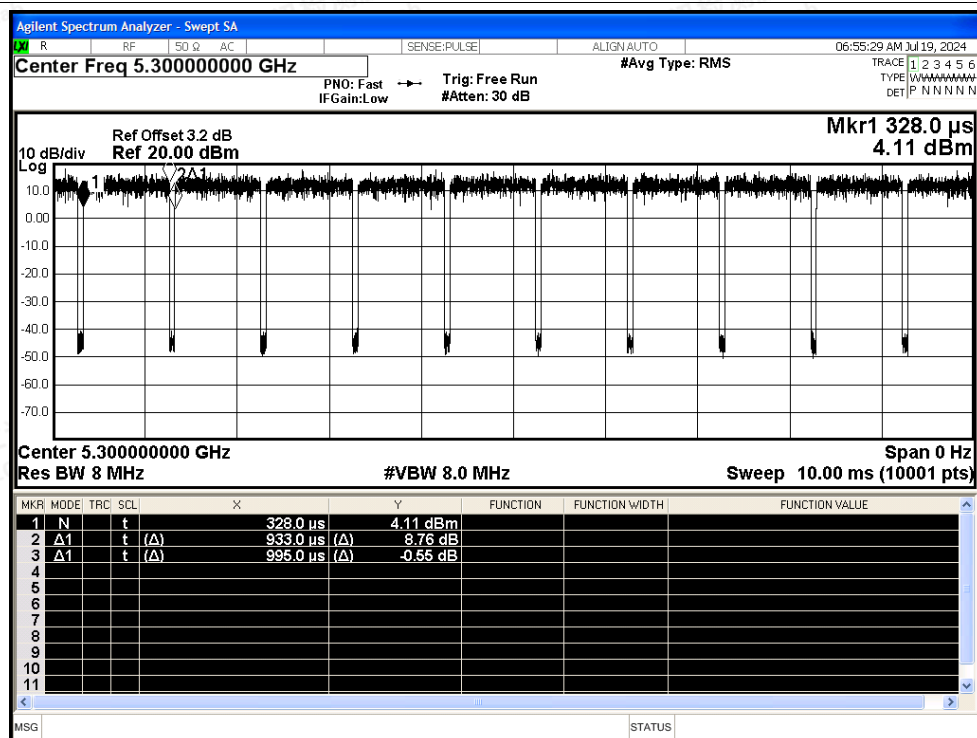

Duty Cycle NVNT n20 5320MHz Ant2

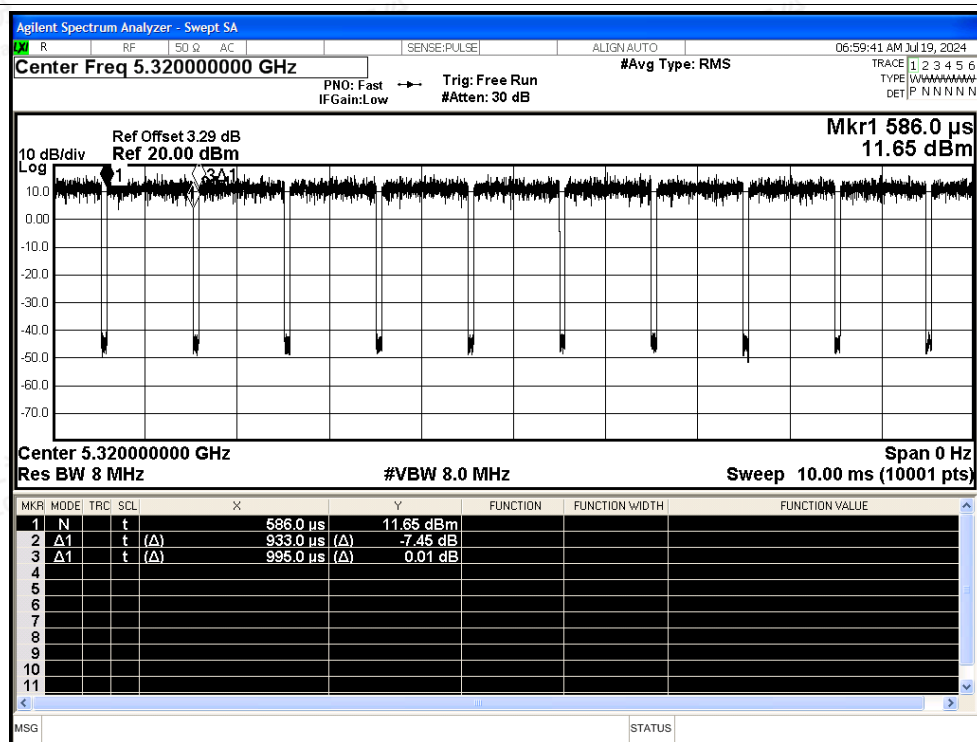

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Duty Cycle NVNT n40 5270MHz Ant2

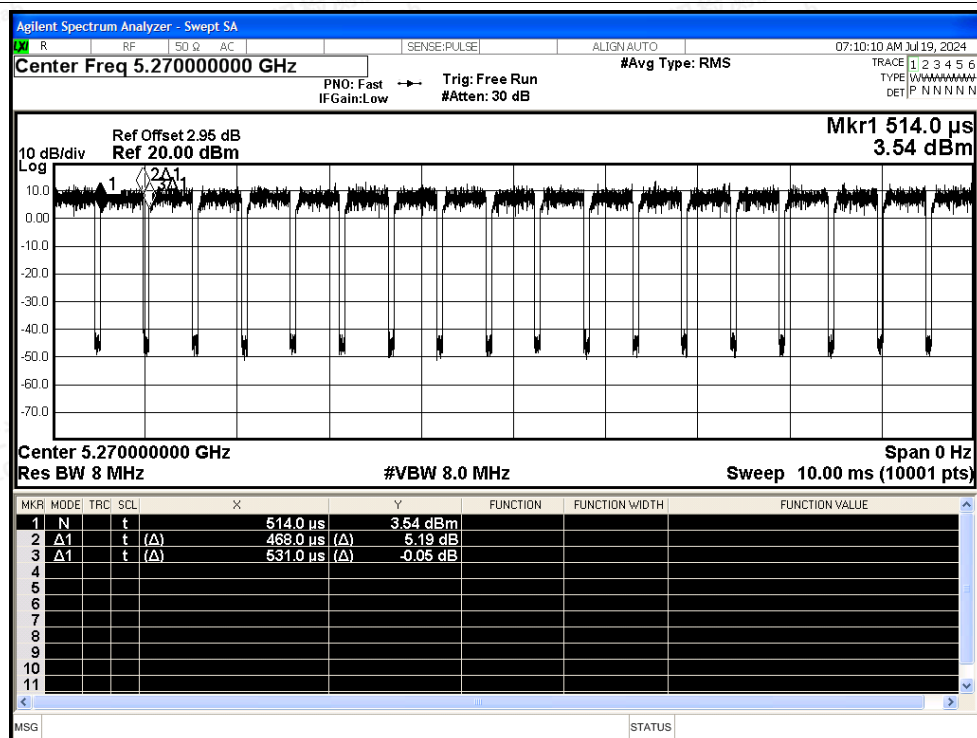

Duty Cycle NVNT n40 5310MHz Ant2

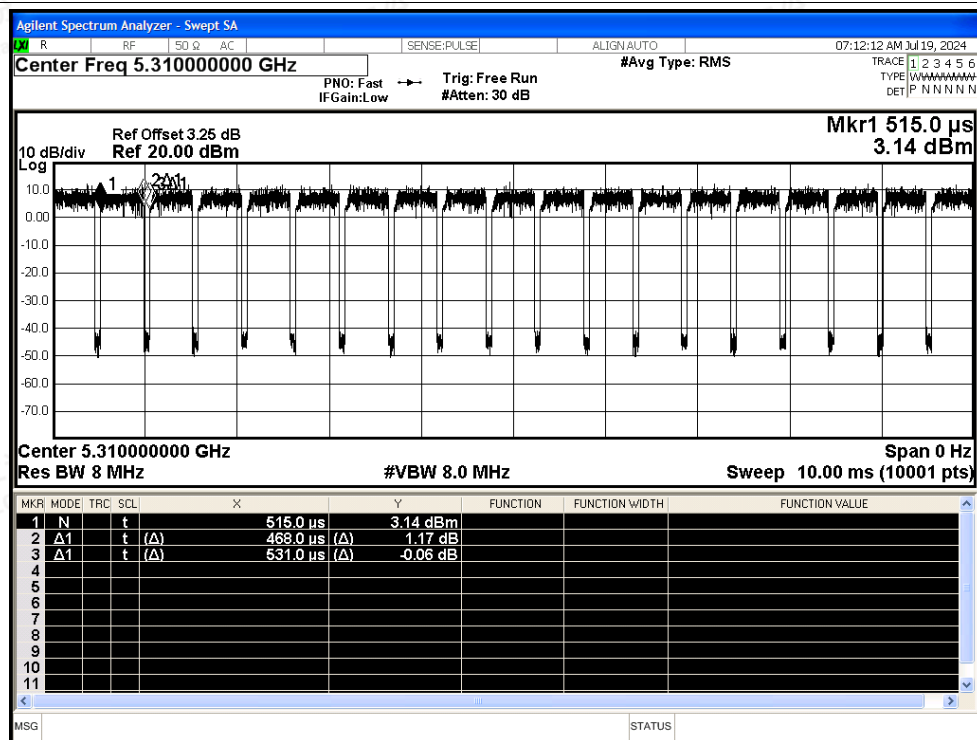

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Duty Cycle NVNT ac20 5260MHz Ant2

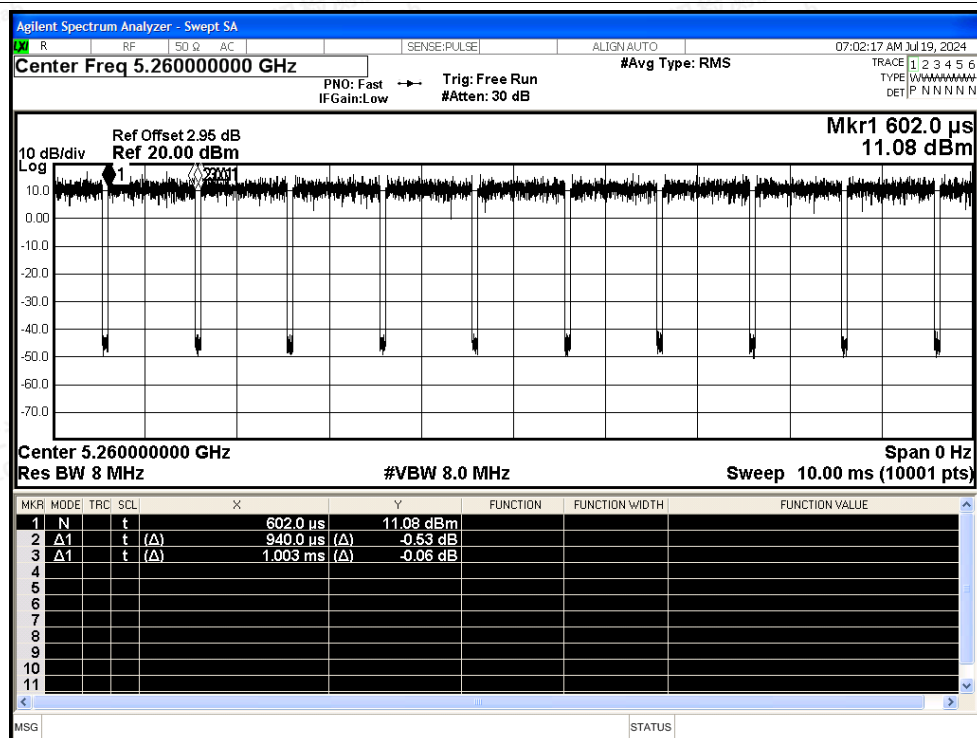

Duty Cycle NVNT ac20 5300MHz Ant2

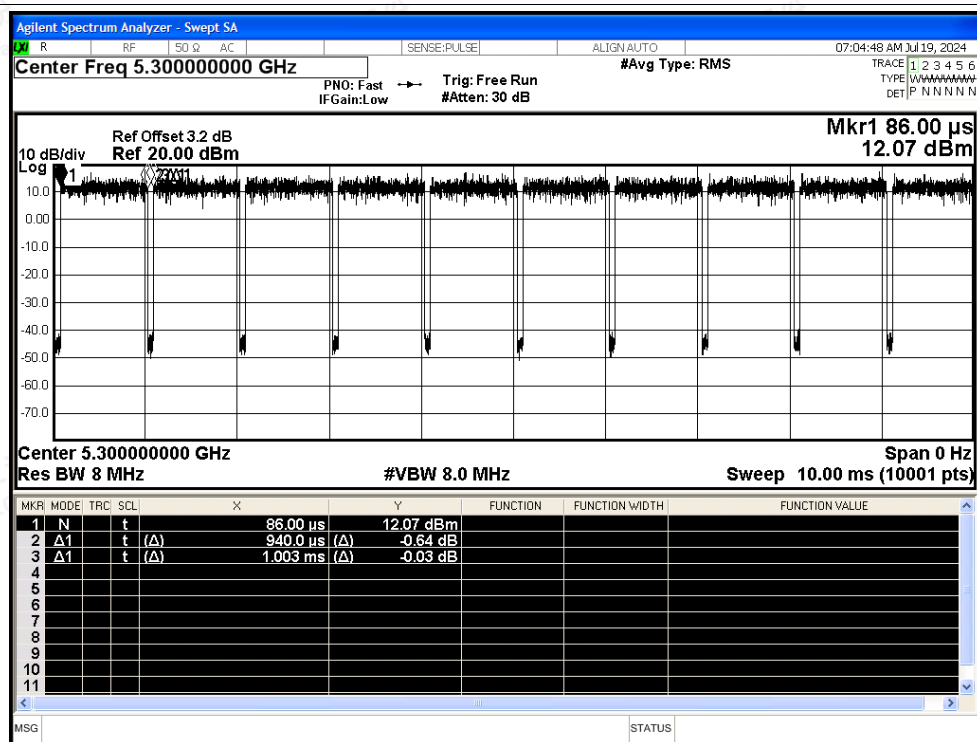

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Duty Cycle NVNT ac20 5320MHz Ant2

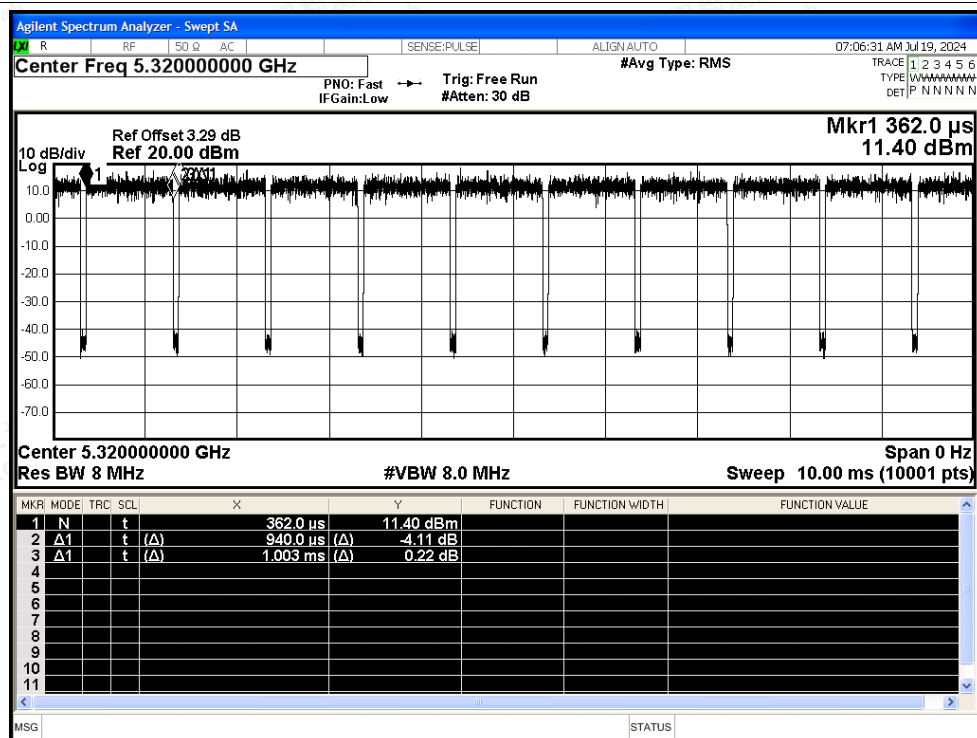

Duty Cycle NVNT ac40 5270MHz Ant2

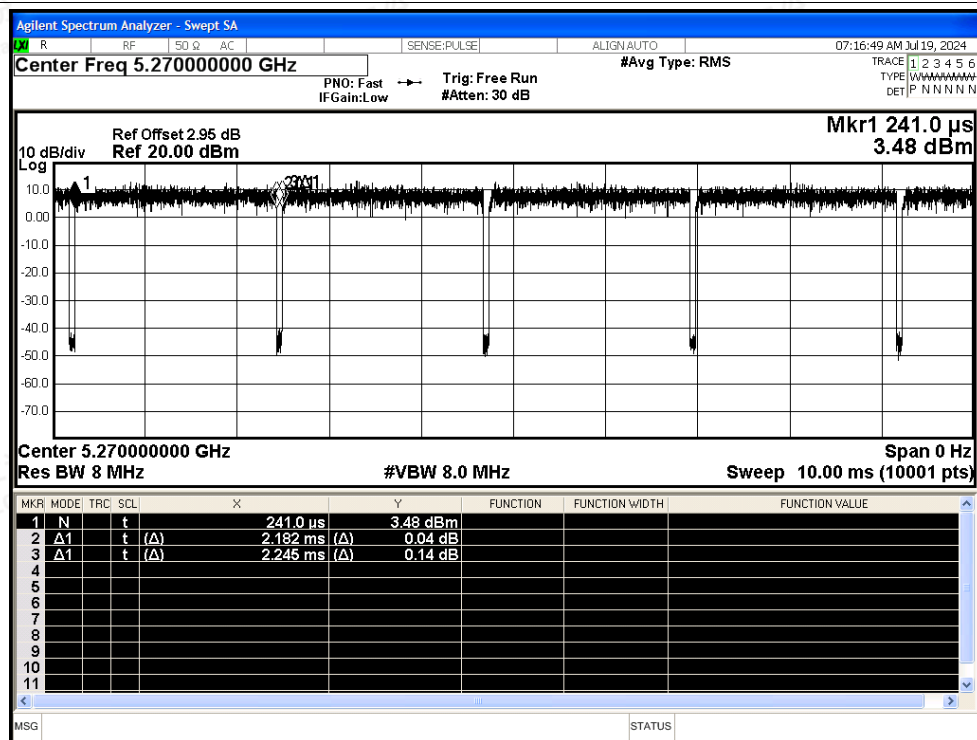

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Duty Cycle NVNT ac40 5310MHz Ant2

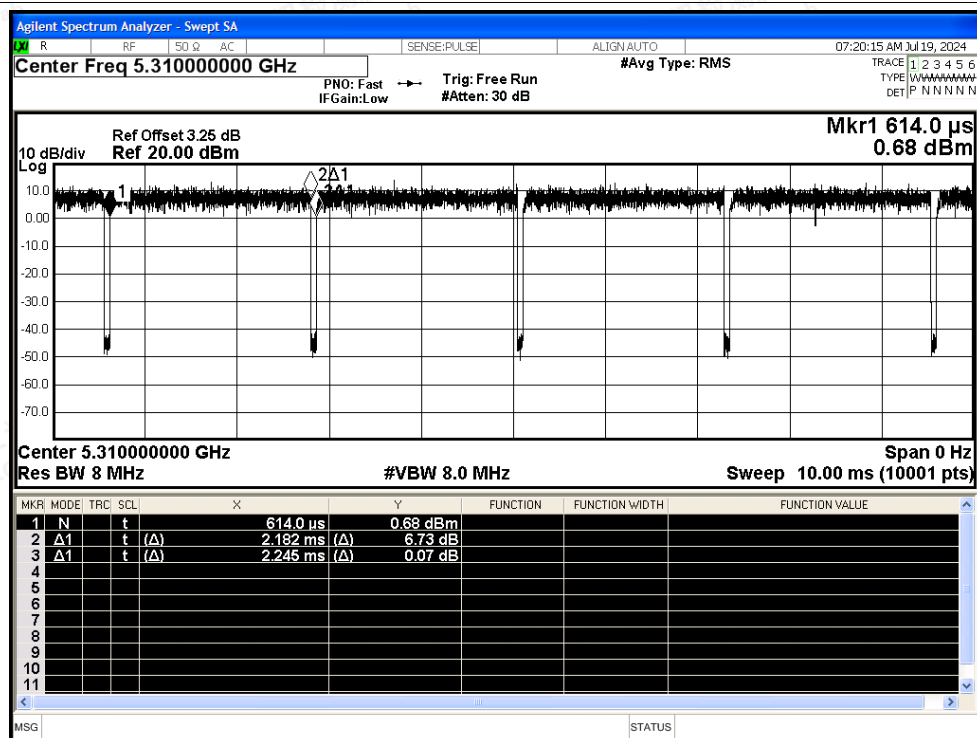

Duty Cycle NVNT ac80 5290MHz Ant2

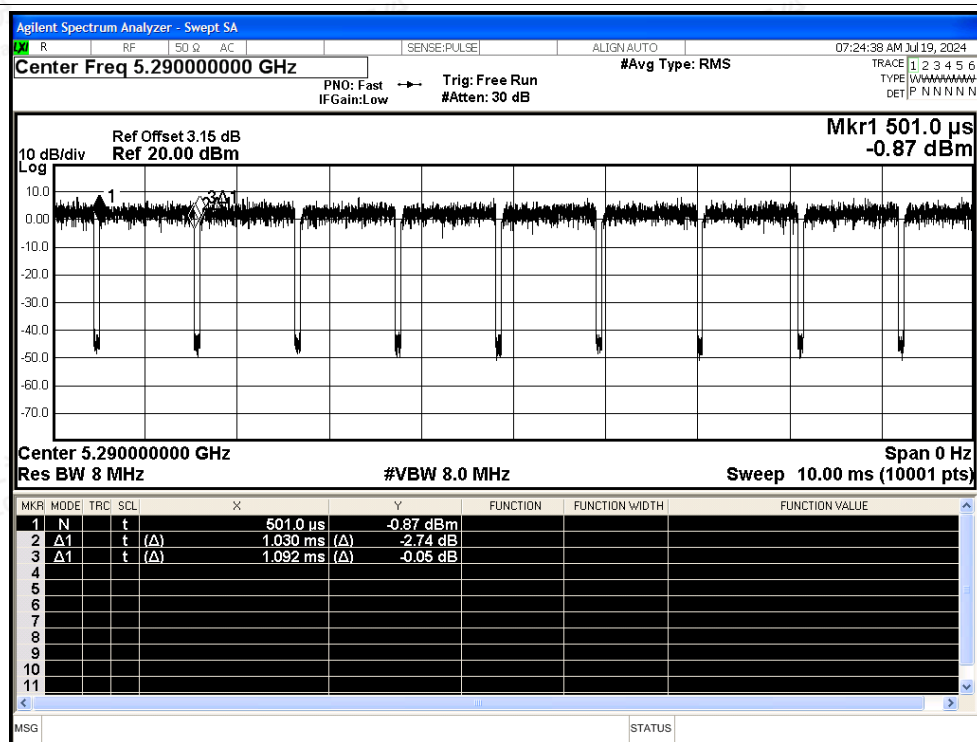

Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity