





## Restrict Band NVNT n40 5755MHz Ant2 Peak

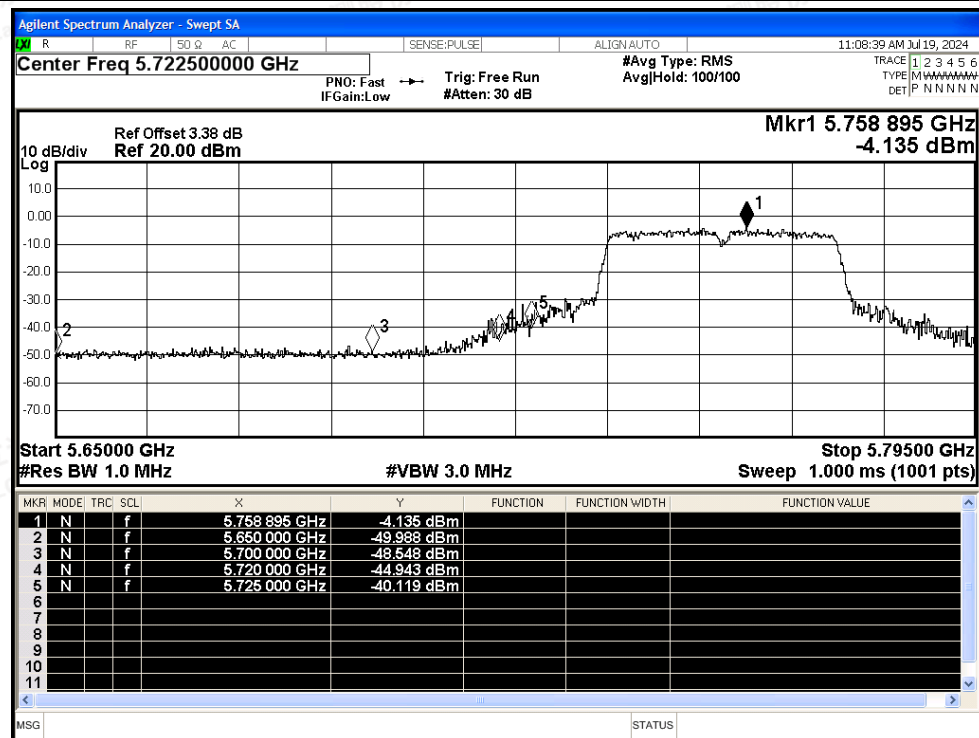

## Restrict Band NVNT n40 5755MHz Ant2 Average

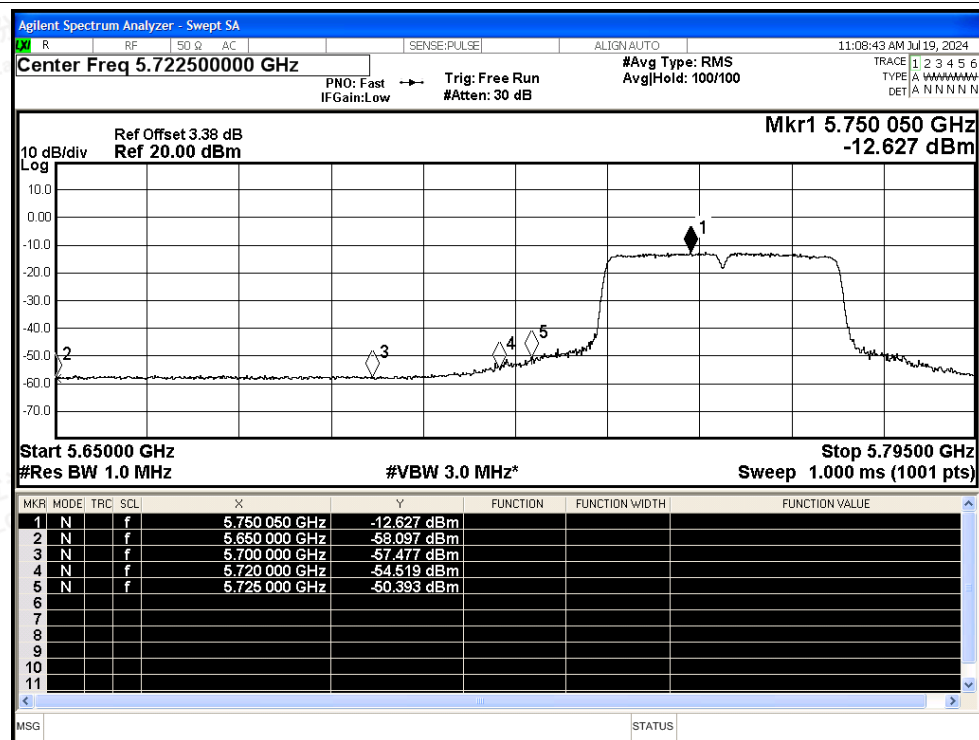

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A &amp; 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



## Restrict Band NVNT n40 5795MHz Ant2 Peak

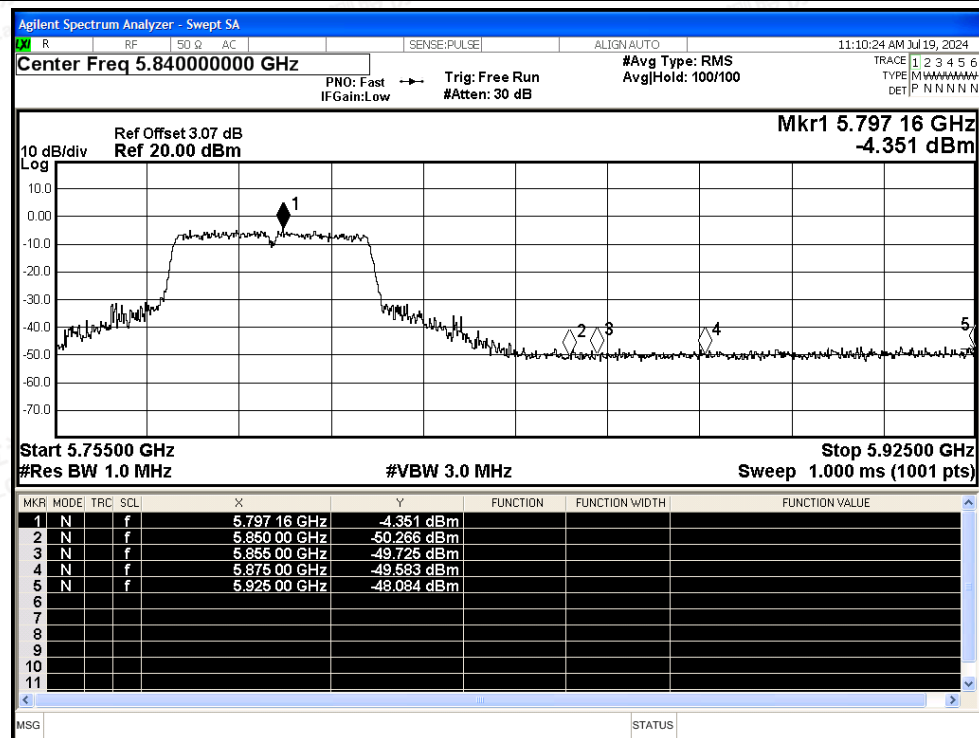

## Restrict Band NVNT n40 5795MHz Ant2 Average

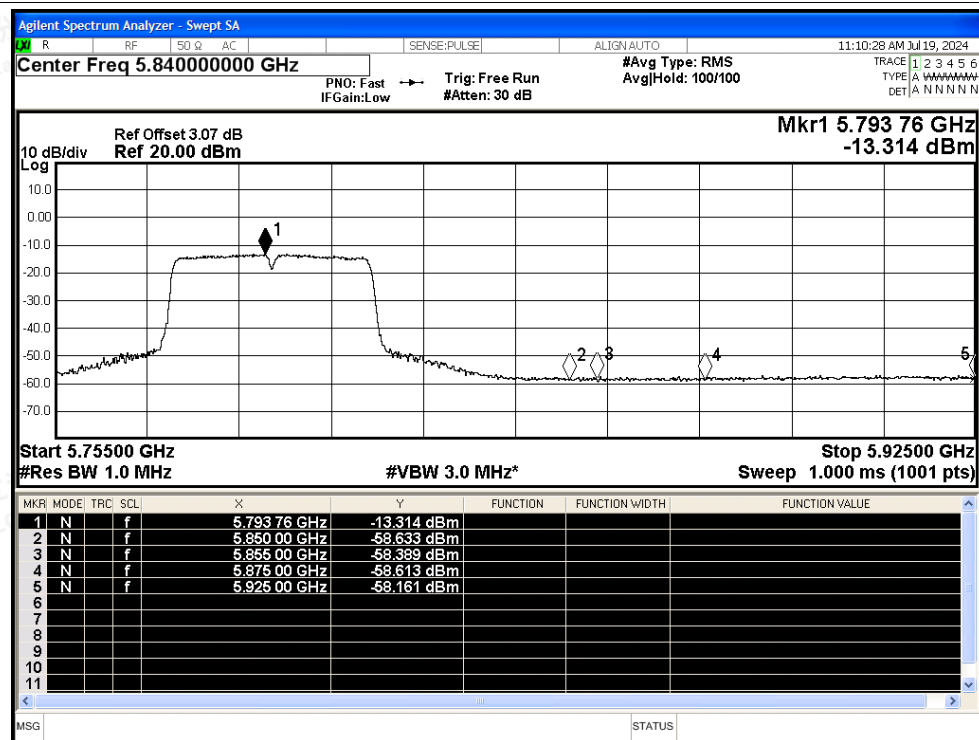

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A &amp; 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



## Restrict Band NVNT ac20 5745MHz Ant2 Peak

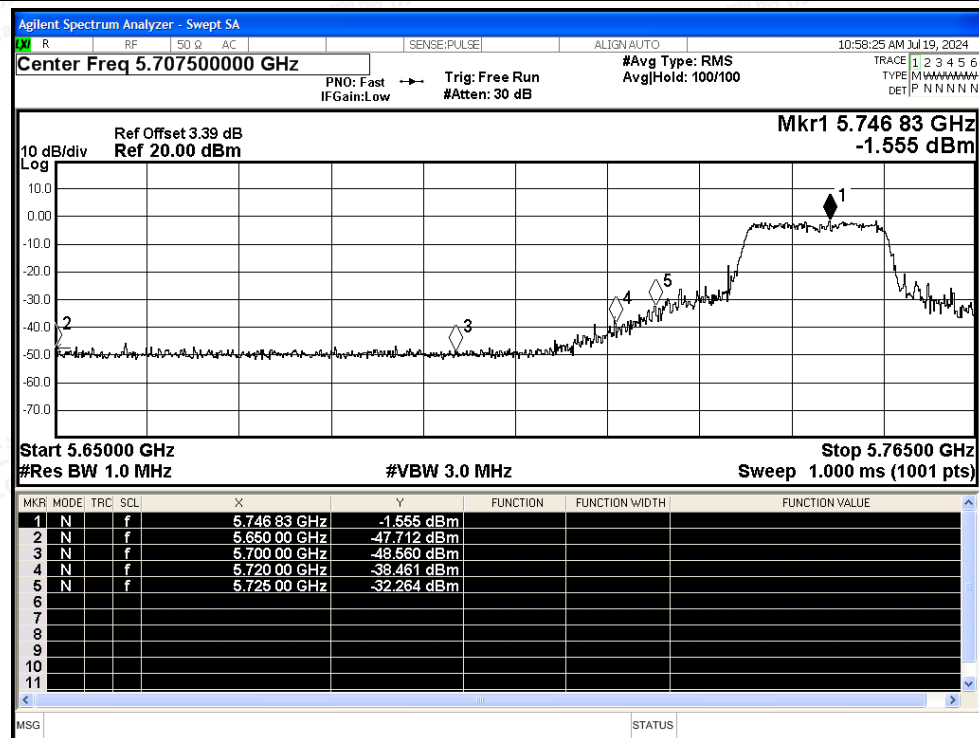

## Restrict Band NVNT ac20 5745MHz Ant2 Average

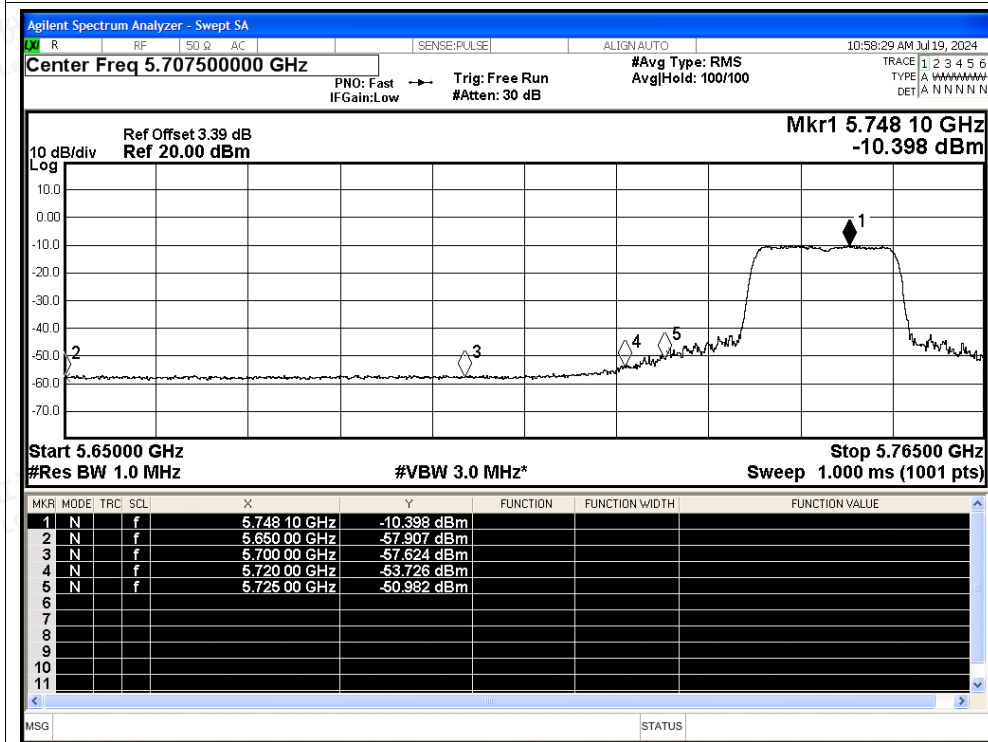

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A &amp; 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



## Restrict Band NVNT ac20 5825MHz Ant2 Peak

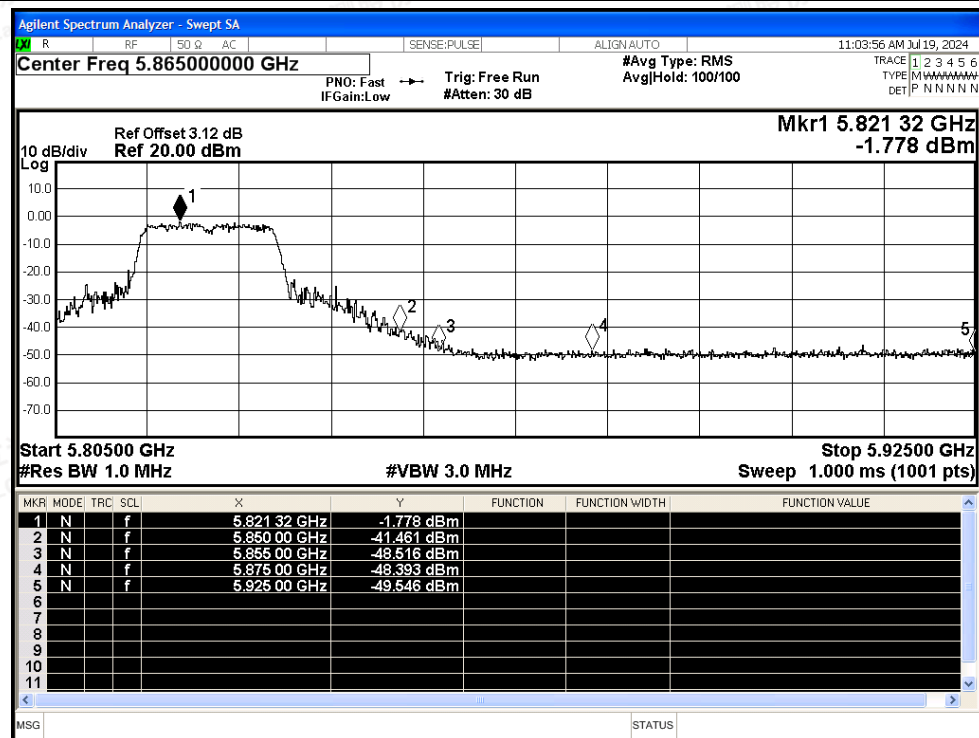

## Restrict Band NVNT ac20 5825MHz Ant2 Average

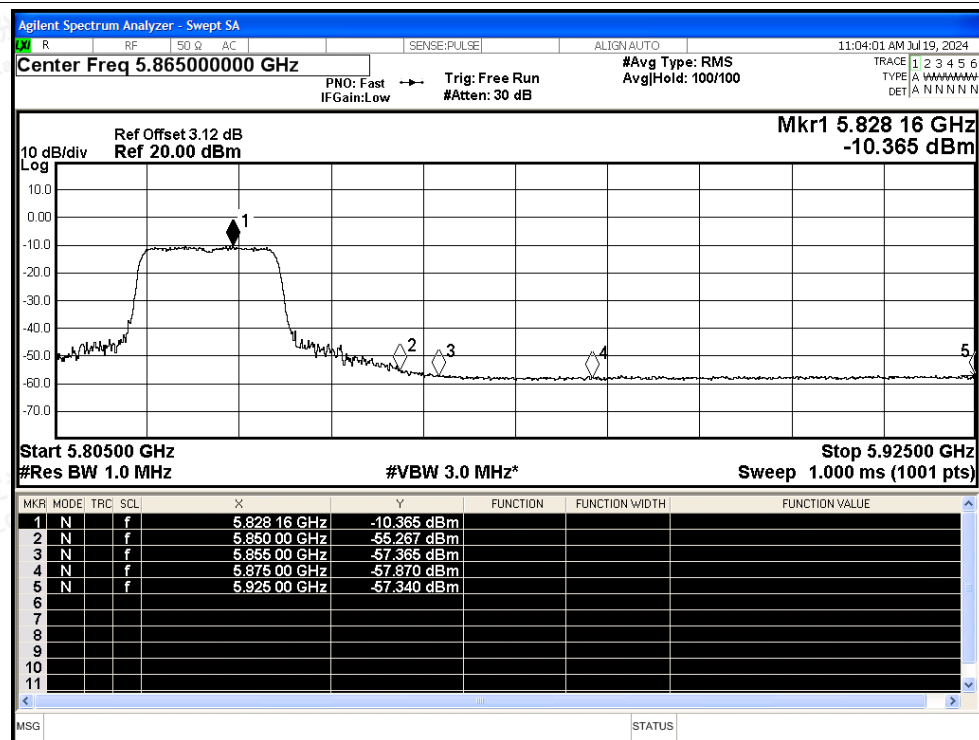

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A &amp; 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



## Restrict Band NVNT ac40 5755MHz Ant2 Peak

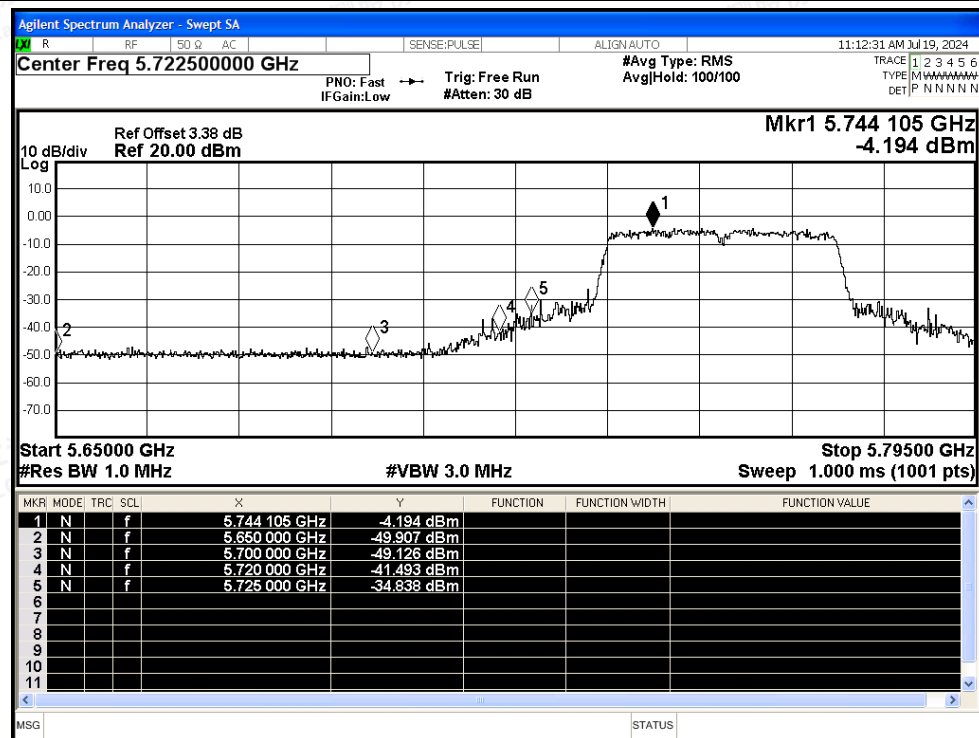

## Restrict Band NVNT ac40 5755MHz Ant2 Average

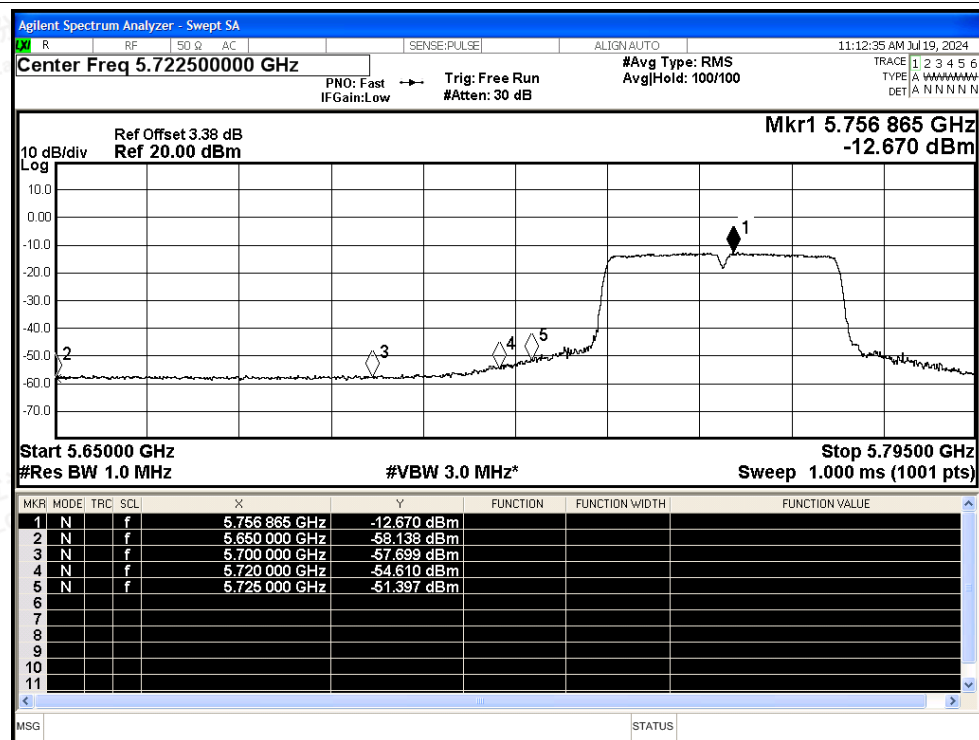

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A &amp; 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



## Restrict Band NVNT ac40 5795MHz Ant2 Peak

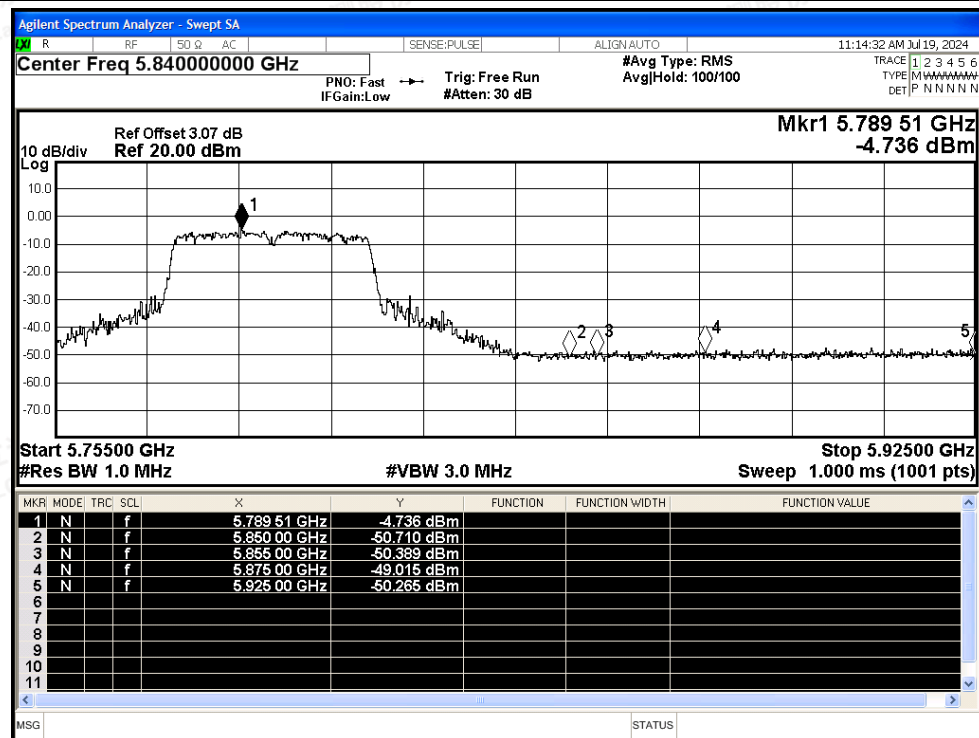

## Restrict Band NVNT ac40 5795MHz Ant2 Average

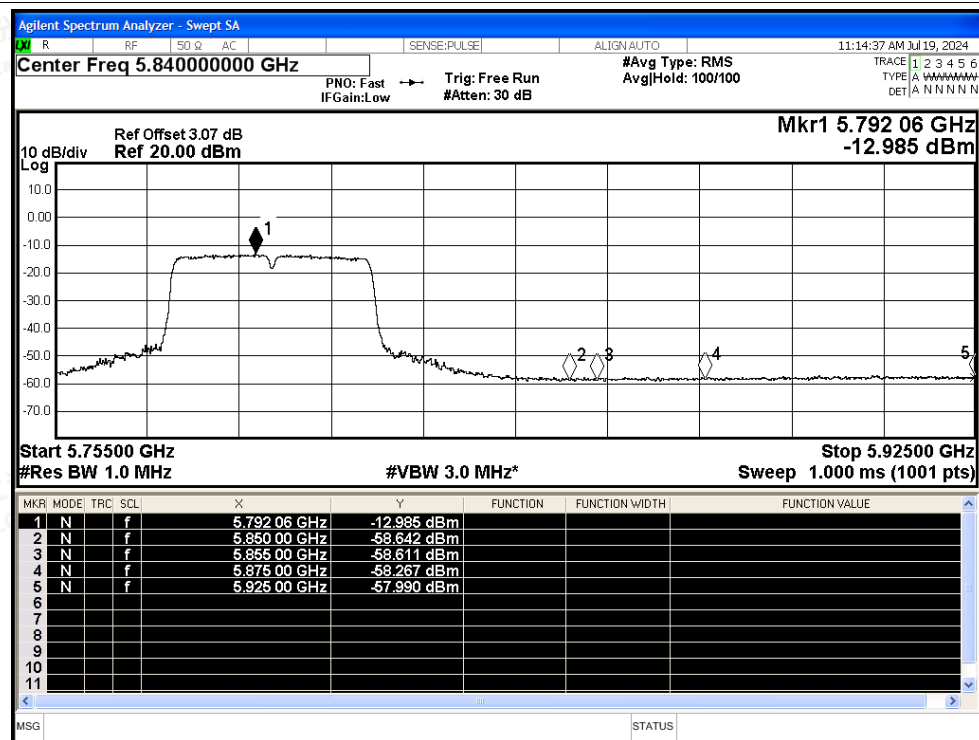

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A &amp; 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



## Restrict Band NVNT ac80 5775MHz Ant2 Peak

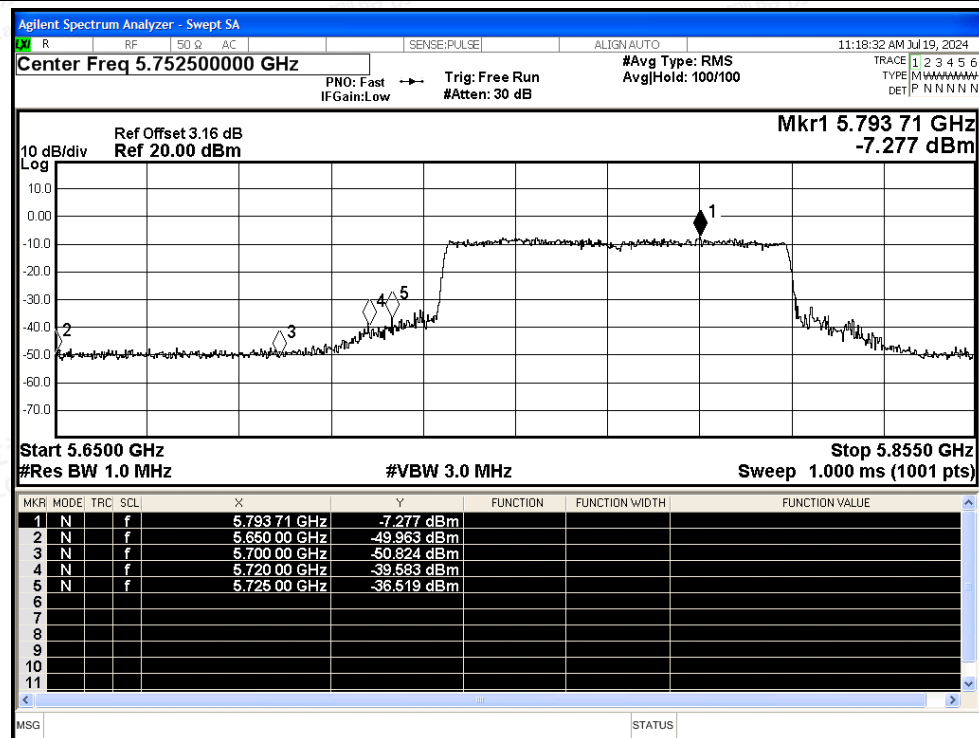

## Restrict Band NVNT ac80 5775MHz Ant2 Average

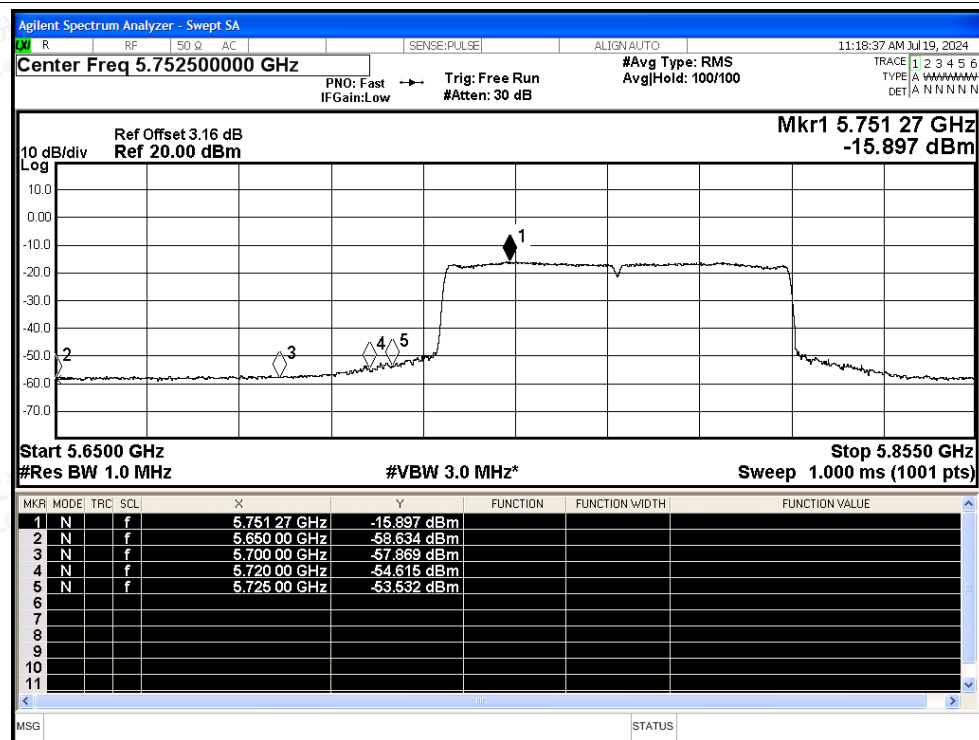

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A &amp; 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



## Restrict Band NVNT ac80 5775MHz Ant2 Peak

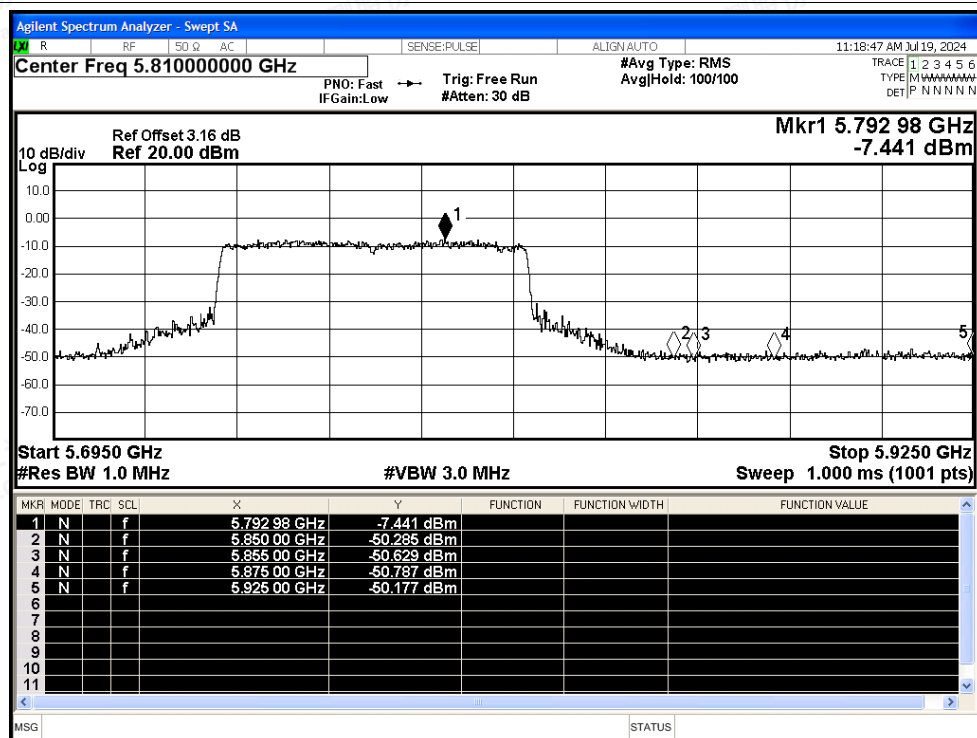

## Restrict Band NVNT ac80 5775MHz Ant2 Average

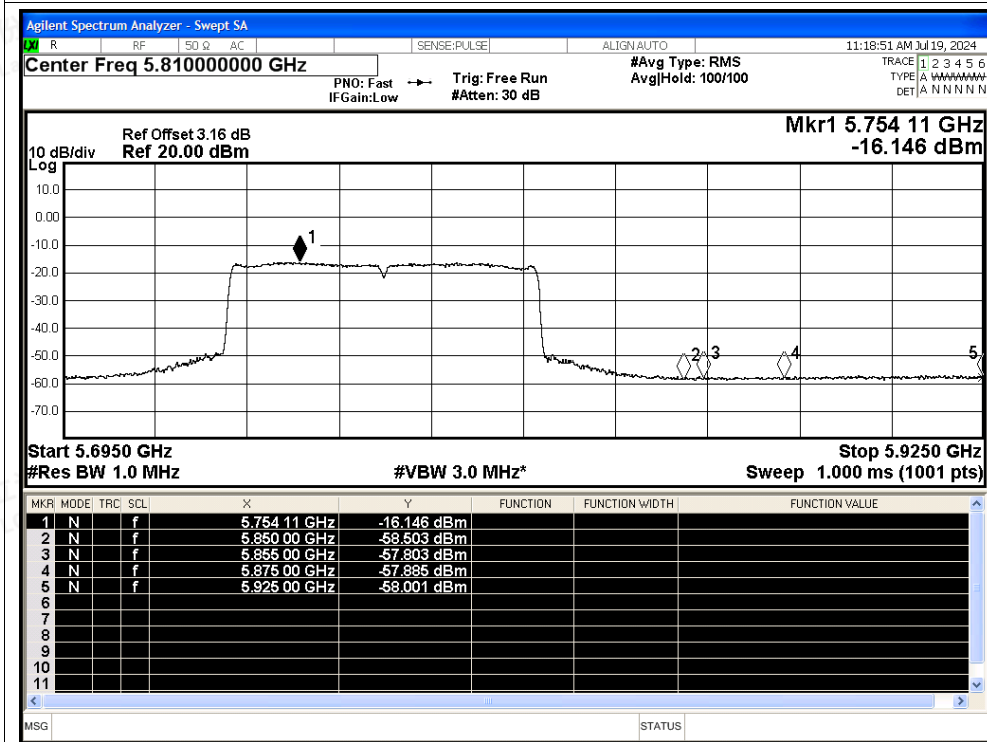

Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A &amp; 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



## MIMO

| Condition | Mode | Frequency (MHz) | Ant1 Power (dBm) | Ant2 Power (dBm) | Gain (dBi) | EIRP Power (dBm) | Detector | Limit (dBm) | Verdict |
|-----------|------|-----------------|------------------|------------------|------------|------------------|----------|-------------|---------|
| NVNT      | n20  | 5745            | -49.77           | -49.94           | 6.31       | -40.53           | Peak     | -27         | Pass    |
| NVNT      | n20  | 5745            | -57.56           | -57.91           | 6.31       | -48.41           | Average  | -27         | Pass    |
| NVNT      | n20  | 5745            | -50.22           | -49.76           | 6.31       | -40.66           | Peak     | 10          | Pass    |
| NVNT      | n20  | 5745            | -57.58           | -57.03           | 6.31       | -47.98           | Average  | 10          | Pass    |
| NVNT      | n20  | 5745            | -37.38           | -40.58           | 6.31       | -29.37           | Peak     | 15.6        | Pass    |
| NVNT      | n20  | 5745            | -55.26           | -55.76           | 6.31       | -46.18           | Average  | 15.6        | Pass    |
| NVNT      | n20  | 5745            | -35.85           | -35.64           | 6.31       | -26.42           | Peak     | 27          | Pass    |
| NVNT      | n20  | 5745            | -52.57           | -50.38           | 6.31       | -42.02           | Average  | 27          | Pass    |
| NVNT      | n20  | 5825            | -40.83           | -44.53           | 6.31       | -32.98           | Peak     | 27          | Pass    |
| NVNT      | n20  | 5825            | -55.15           | -54.33           | 6.31       | -45.40           | Average  | 27          | Pass    |
| NVNT      | n20  | 5825            | -48.72           | -47.06           | 6.31       | -38.49           | Peak     | 15.6        | Pass    |
| NVNT      | n20  | 5825            | -57.09           | -57.18           | 6.31       | -47.81           | Average  | 15.6        | Pass    |
| NVNT      | n20  | 5825            | -49.67           | -50.93           | 6.31       | -40.93           | Peak     | 10          | Pass    |
| NVNT      | n20  | 5825            | -58.19           | -57.57           | 6.31       | -48.55           | Average  | 10          | Pass    |
| NVNT      | n20  | 5825            | -48.8            | -50.32           | 6.31       | -40.17           | Peak     | -27         | Pass    |
| NVNT      | n20  | 5825            | -57.42           | -57.86           | 6.31       | -48.31           | Average  | -27         | Pass    |
| NVNT      | n40  | 5755            | -50.08           | -49.99           | 6.31       | -40.71           | Peak     | -27         | Pass    |
| NVNT      | n40  | 5755            | -57.55           | -58.1            | 6.31       | -48.50           | Average  | -27         | Pass    |
| NVNT      | n40  | 5755            | -50.74           | -48.55           | 6.31       | -40.19           | Peak     | 10          | Pass    |
| NVNT      | n40  | 5755            | -57.49           | -57.48           | 6.31       | -48.16           | Average  | 10          | Pass    |
| NVNT      | n40  | 5755            | -42.88           | -44.94           | 6.31       | -34.47           | Peak     | 15.6        | Pass    |
| NVNT      | n40  | 5755            | -53.95           | -54.52           | 6.31       | -44.91           | Average  | 15.6        | Pass    |
| NVNT      | n40  | 5755            | -36.59           | -40.12           | 6.31       | -28.69           | Peak     | 27          | Pass    |
| NVNT      | n40  | 5755            | -50.87           | -50.39           | 6.31       | -41.30           | Average  | 27          | Pass    |
| NVNT      | n40  | 5795            | -48.09           | -50.27           | 6.31       | -39.72           | Peak     | 27          | Pass    |
| NVNT      | n40  | 5795            | -58.13           | -58.63           | 6.31       | -49.05           | Average  | 27          | Pass    |
| NVNT      | n40  | 5795            | -50.67           | -49.73           | 6.31       | -40.85           | Peak     | 15.6        | Pass    |
| NVNT      | n40  | 5795            | -58.52           | -58.39           | 6.31       | -49.13           | Average  | 15.6        | Pass    |
| NVNT      | n40  | 5795            | -50.51           | -49.58           | 6.31       | -40.70           | Peak     | 10          | Pass    |
| NVNT      | n40  | 5795            | -57.89           | -58.61           | 6.31       | -48.91           | Average  | 10          | Pass    |
| NVNT      | n40  | 5795            | -49.66           | -48.08           | 6.31       | -39.48           | Peak     | -27         | Pass    |
| NVNT      | n40  | 5795            | -58.57           | -58.16           | 6.31       | -49.04           | Average  | -27         | Pass    |
| NVNT      | ac20 | 5745            | -49.65           | -47.71           | 6.31       | -39.25           | Peak     | -27         | Pass    |
| NVNT      | ac20 | 5745            | -57.6            | -57.91           | 6.31       | -48.43           | Average  | -27         | Pass    |
| NVNT      | ac20 | 5745            | -49.53           | -48.56           | 6.31       | -39.70           | Peak     | 10          | Pass    |
| NVNT      | ac20 | 5745            | -57.39           | -57.62           | 6.31       | -48.18           | Average  | 10          | Pass    |
| NVNT      | ac20 | 5745            | -40.16           | -38.46           | 6.31       | -29.91           | Peak     | 15.6        | Pass    |
| NVNT      | ac20 | 5745            | -54.4            | -53.73           | 6.31       | -44.73           | Average  | 15.6        | Pass    |
| NVNT      | ac20 | 5745            | -41.37           | -32.26           | 6.31       | -25.45           | Peak     | 27          | Pass    |



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A &amp; 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



|      |      |      |        |        |      |        |         |      |      |
|------|------|------|--------|--------|------|--------|---------|------|------|
| NVNT | ac20 | 5745 | -50.62 | -50.98 | 6.31 | -41.48 | Average | 27   | Pass |
| NVNT | ac20 | 5825 | -38.07 | -41.46 | 6.31 | -30.12 | Peak    | 27   | Pass |
| NVNT | ac20 | 5825 | -55.47 | -55.27 | 6.31 | -46.05 | Average | 27   | Pass |
| NVNT | ac20 | 5825 | -47.98 | -48.52 | 6.31 | -38.92 | Peak    | 15.6 | Pass |
| NVNT | ac20 | 5825 | -56.79 | -57.37 | 6.31 | -47.75 | Average | 15.6 | Pass |
| NVNT | ac20 | 5825 | -49.86 | -48.39 | 6.31 | -39.74 | Peak    | 10   | Pass |
| NVNT | ac20 | 5825 | -58.09 | -57.87 | 6.31 | -48.66 | Average | 10   | Pass |
| NVNT | ac20 | 5825 | -48.35 | -49.55 | 6.31 | -39.59 | Peak    | -27  | Pass |
| NVNT | ac20 | 5825 | -57.35 | -57.34 | 6.31 | -48.02 | Average | -27  | Pass |
| NVNT | ac40 | 5755 | -48.82 | -49.91 | 6.31 | -40.01 | Peak    | -27  | Pass |
| NVNT | ac40 | 5755 | -57.37 | -58.14 | 6.31 | -48.42 | Average | -27  | Pass |
| NVNT | ac40 | 5755 | -51.23 | -49.13 | 6.31 | -40.73 | Peak    | 10   | Pass |
| NVNT | ac40 | 5755 | -57.8  | -57.7  | 6.31 | -48.43 | Average | 10   | Pass |
| NVNT | ac40 | 5755 | -40.13 | -41.49 | 6.31 | -31.44 | Peak    | 15.6 | Pass |
| NVNT | ac40 | 5755 | -54.17 | -54.61 | 6.31 | -45.06 | Average | 15.6 | Pass |
| NVNT | ac40 | 5755 | -34.21 | -34.84 | 6.31 | -25.19 | Peak    | 27   | Pass |
| NVNT | ac40 | 5755 | -51.14 | -51.4  | 6.31 | -41.95 | Average | 27   | Pass |
| NVNT | ac40 | 5795 | -49.98 | -50.71 | 6.31 | -41.01 | Peak    | 27   | Pass |
| NVNT | ac40 | 5795 | -58.67 | -58.64 | 6.31 | -49.33 | Average | 27   | Pass |
| NVNT | ac40 | 5795 | -50.62 | -50.39 | 6.31 | -41.18 | Peak    | 15.6 | Pass |
| NVNT | ac40 | 5795 | -57.99 | -58.61 | 6.31 | -48.97 | Average | 15.6 | Pass |
| NVNT | ac40 | 5795 | -51.23 | -49.02 | 6.31 | -40.67 | Peak    | 10   | Pass |
| NVNT | ac40 | 5795 | -58.5  | -58.27 | 6.31 | -49.06 | Average | 10   | Pass |
| NVNT | ac40 | 5795 | -48.35 | -50.27 | 6.31 | -39.88 | Peak    | -27  | Pass |
| NVNT | ac40 | 5795 | -57.68 | -57.99 | 6.31 | -48.51 | Average | -27  | Pass |
| NVNT | ac80 | 5775 | -49.68 | -49.96 | 6.31 | -40.50 | Peak    | -27  | Pass |
| NVNT | ac80 | 5775 | -58.15 | -58.63 | 6.31 | -49.06 | Average | -27  | Pass |
| NVNT | ac80 | 5775 | -49.2  | -50.82 | 6.31 | -40.61 | Peak    | 10   | Pass |
| NVNT | ac80 | 5775 | -57.8  | -57.87 | 6.31 | -48.51 | Average | 10   | Pass |
| NVNT | ac80 | 5775 | -40.93 | -39.58 | 6.31 | -30.88 | Peak    | 15.6 | Pass |
| NVNT | ac80 | 5775 | -54.26 | -54.62 | 6.31 | -45.12 | Average | 15.6 | Pass |
| NVNT | ac80 | 5775 | -39.28 | -36.52 | 6.31 | -28.36 | Peak    | 27   | Pass |
| NVNT | ac80 | 5775 | -51.61 | -53.53 | 6.31 | -43.14 | Average | 27   | Pass |
| NVNT | ac80 | 5775 | -48.27 | -50.29 | 6.31 | -39.84 | Peak    | 27   | Pass |
| NVNT | ac80 | 5775 | -58.34 | -58.5  | 6.31 | -49.10 | Average | 27   | Pass |
| NVNT | ac80 | 5775 | -49.37 | -50.63 | 6.31 | -40.63 | Peak    | 15.6 | Pass |
| NVNT | ac80 | 5775 | -58.1  | -57.8  | 6.31 | -48.63 | Average | 15.6 | Pass |
| NVNT | ac80 | 5775 | -50.7  | -50.79 | 6.31 | -41.42 | Peak    | 10   | Pass |
| NVNT | ac80 | 5775 | -58.32 | -57.89 | 6.31 | -48.78 | Average | 10   | Pass |
| NVNT | ac80 | 5775 | -51.08 | -50.18 | 6.31 | -41.29 | Peak    | -27  | Pass |
| NVNT | ac80 | 5775 | -57.86 | -58    | 6.31 | -48.61 | Average | -27  | Pass |



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A &amp; 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



## G.5 Frequency Stability


| Condition | Mode | Frequency (MHz) | Antenna | Measured Frequency (MHz) | Frequency Error (Hz) | Deviation (ppm) | Limit (ppm) | Verdict |
|-----------|------|-----------------|---------|--------------------------|----------------------|-----------------|-------------|---------|
| NVNT      | ac20 | 5745            | Ant1    | 5744.98                  | -20000               | -3.48           | 25          | Pass    |
| NVNT      | ac20 | 5785            | Ant1    | 5785                     | 0                    | 0               | 25          | Pass    |
| NVNT      | ac20 | 5825            | Ant1    | 5824.98                  | -20000               | -3.43           | 25          | Pass    |
| NVNT      | ac40 | 5755            | Ant1    | 5755                     | 0                    | 0               | 25          | Pass    |
| NVNT      | ac40 | 5795            | Ant1    | 5794.96                  | -40000               | -6.9            | 25          | Pass    |
| NVNT      | ac80 | 5775            | Ant1    | 5775                     | 0                    | 0               | 25          | Pass    |






## Test Graphs

## Freq. Stability NVNT ac20 5745MHz Ant1

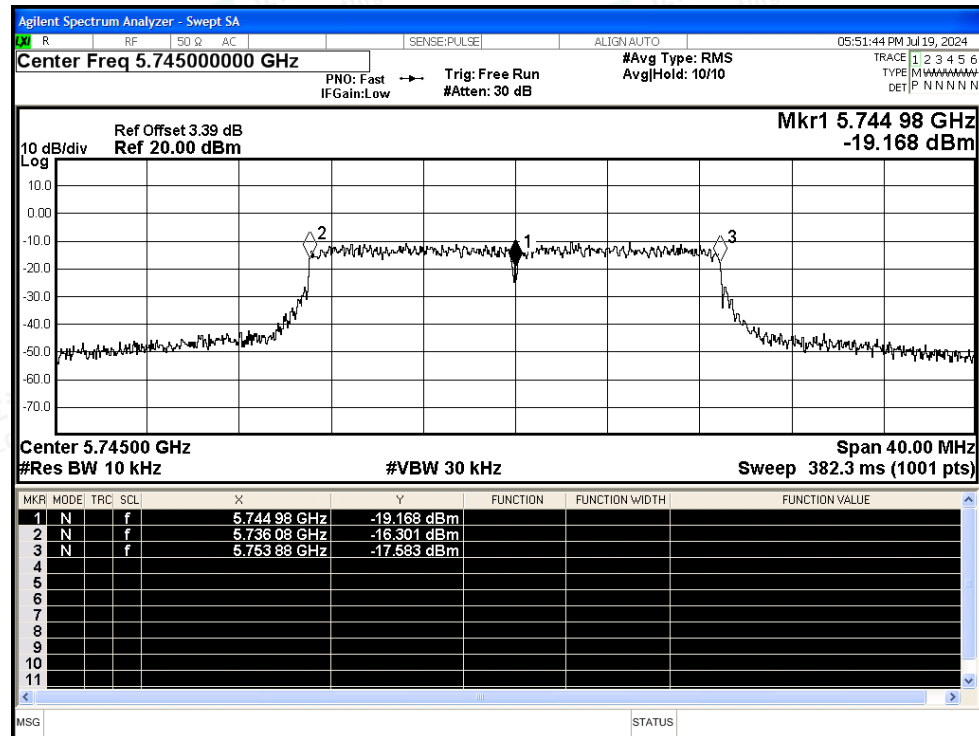

## Freq. Stability NVNT ac20 5785MHz Ant1

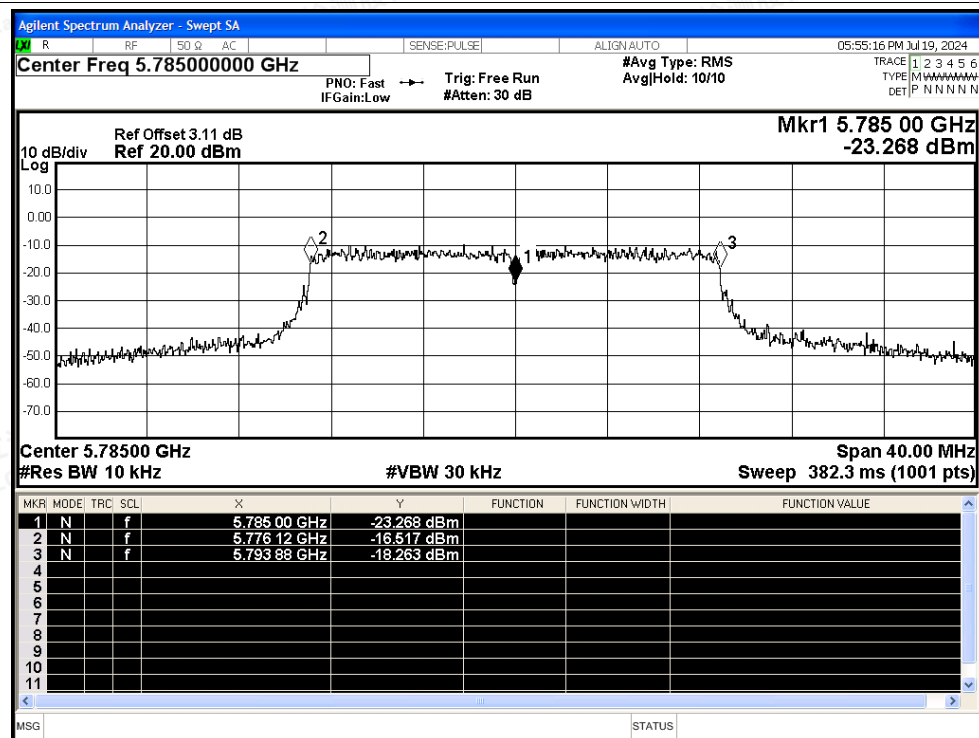

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A &amp; 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



## Freq. Stability NVNT ac20 5825MHz Ant1

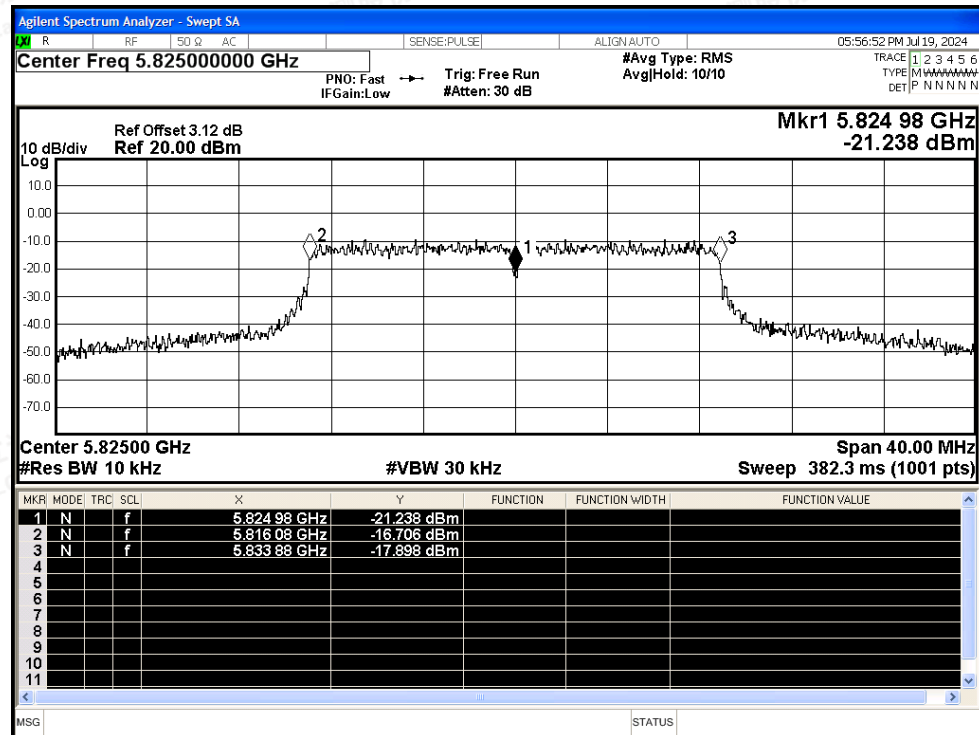

## Freq. Stability NVNT ac40 5755MHz Ant1

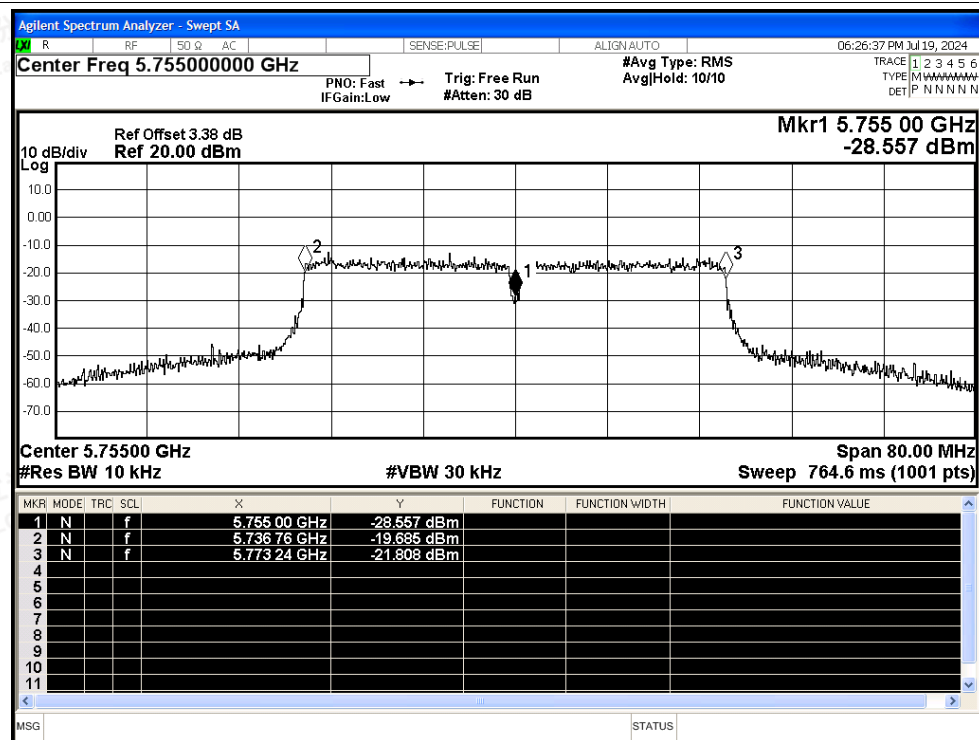

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A &amp; 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



## Freq. Stability NVNT ac40 5795MHz Ant1

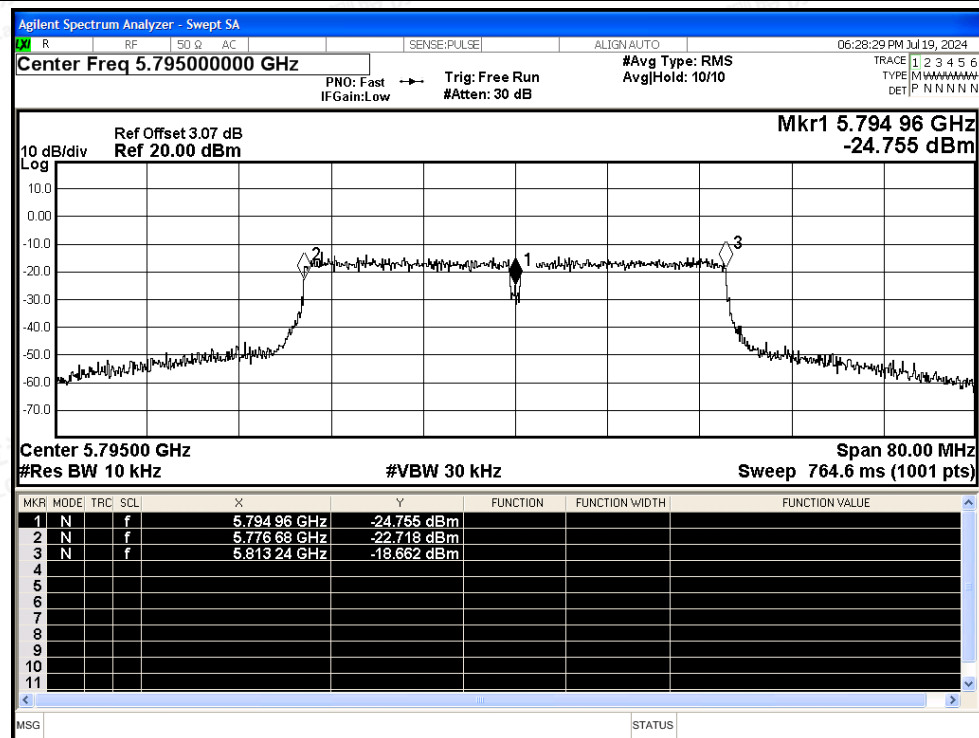

## Freq. Stability NVNT ac80 5775MHz Ant1

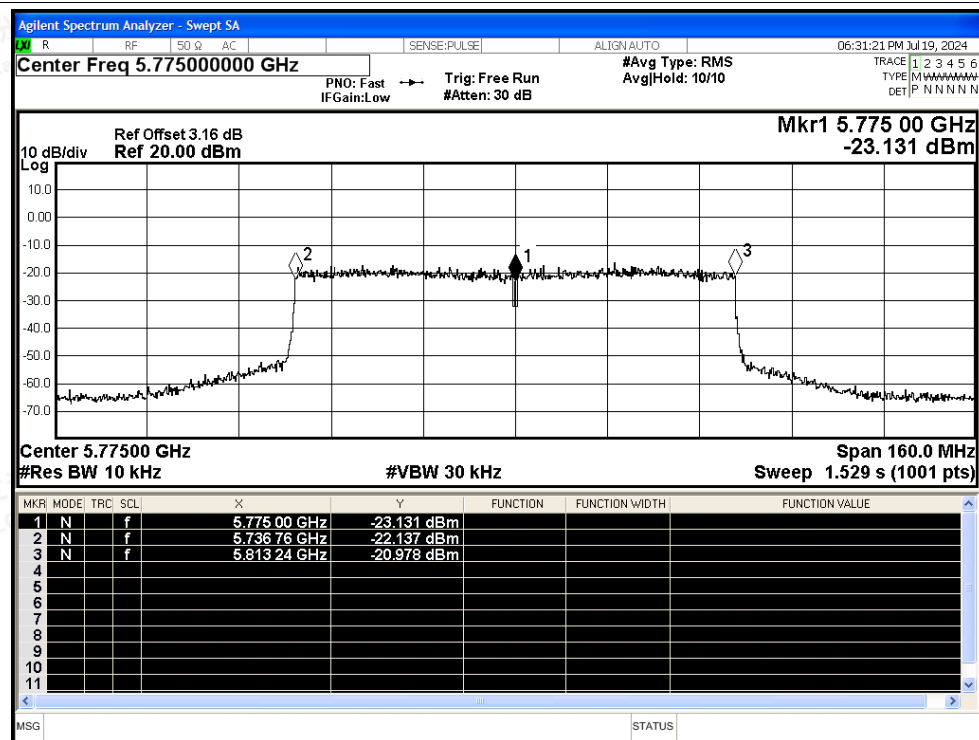

Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A &amp; 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity




| Condition | Mode | Frequency (MHz) | Antenna | Measured Frequency (MHz) | Frequency Error (Hz) | Deviation (ppm) | Limit (ppm) | Verdict |
|-----------|------|-----------------|---------|--------------------------|----------------------|-----------------|-------------|---------|
| NVNT      | ac20 | 5745            | Ant2    | 5744.98                  | -20000               | -3.48           | 25          | Pass    |
| NVNT      | ac20 | 5785            | Ant2    | 5785                     | 0                    | 0               | 25          | Pass    |
| NVNT      | ac20 | 5825            | Ant2    | 5825                     | 0                    | 0               | 25          | Pass    |
| NVNT      | ac40 | 5755            | Ant2    | 5754.96                  | -40000               | -6.95           | 25          | Pass    |
| NVNT      | ac40 | 5795            | Ant2    | 5794.96                  | -40000               | -6.9            | 25          | Pass    |
| NVNT      | ac80 | 5775            | Ant2    | 5775                     | 0                    | 0               | 25          | Pass    |






## Test Graphs

## Freq. Stability NVNT ac20 5745MHz Ant2

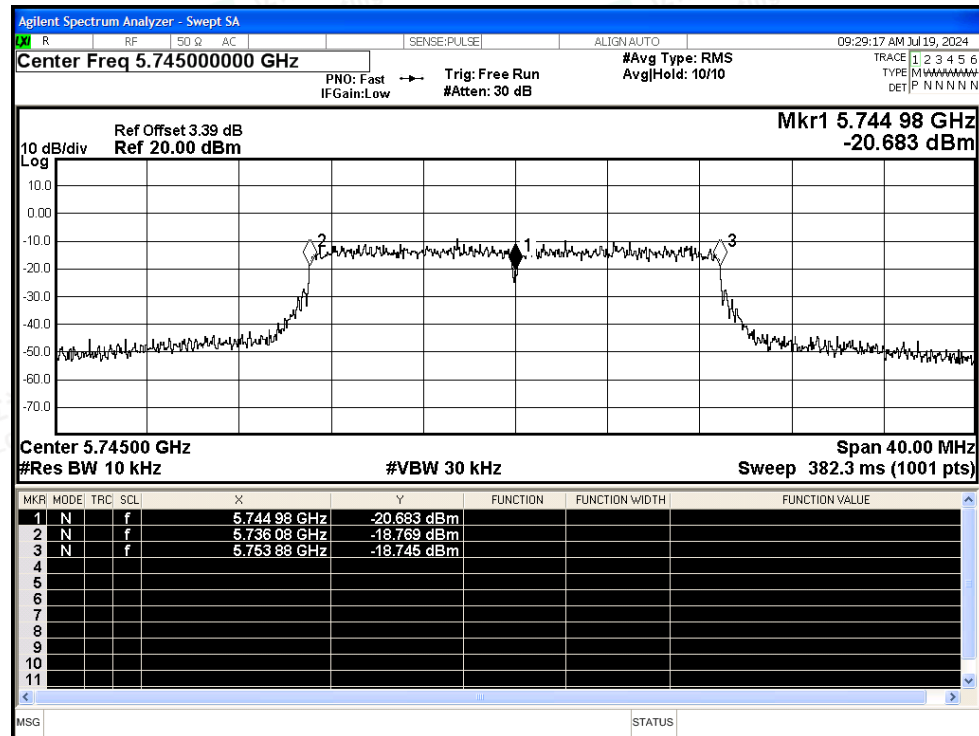

## Freq. Stability NVNT ac20 5785MHz Ant2


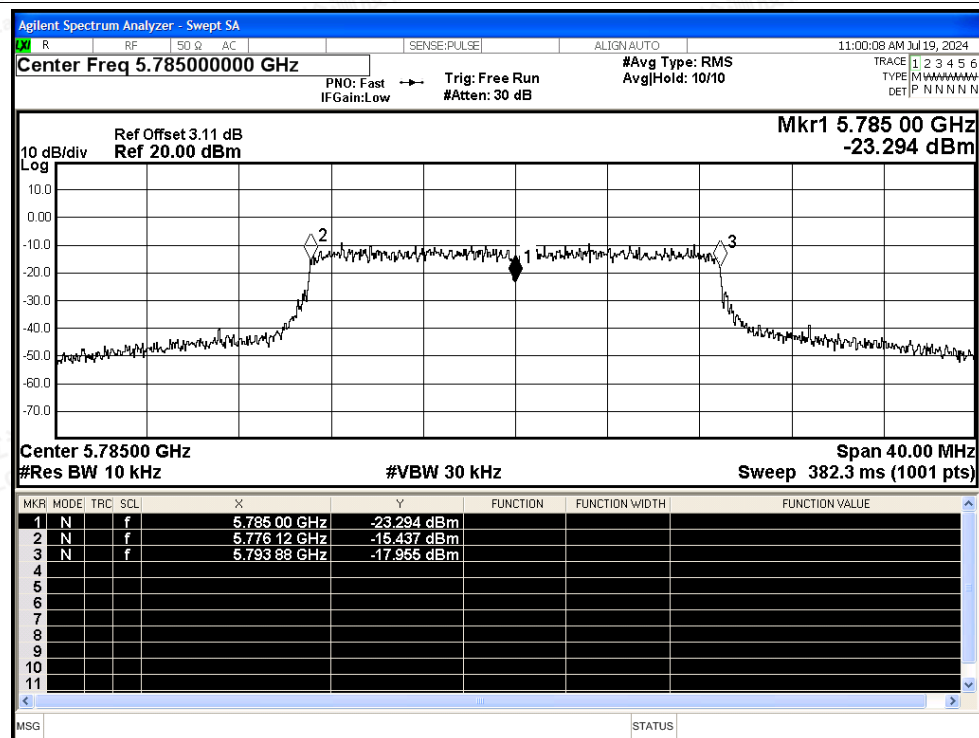


Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A &amp; 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

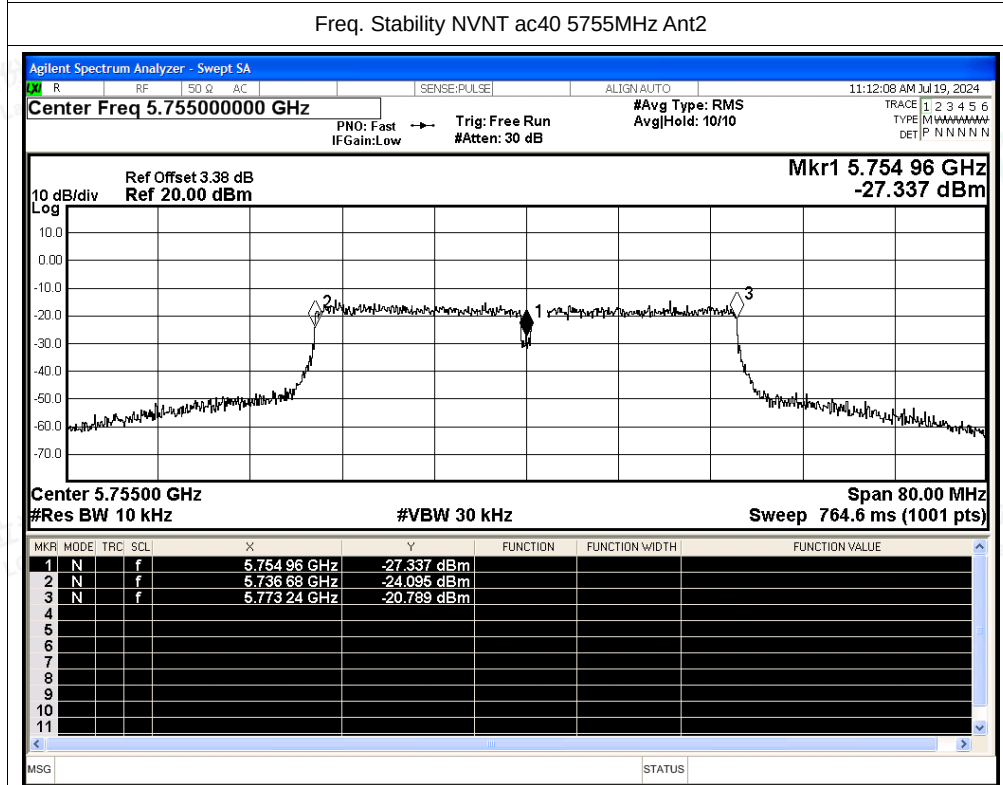
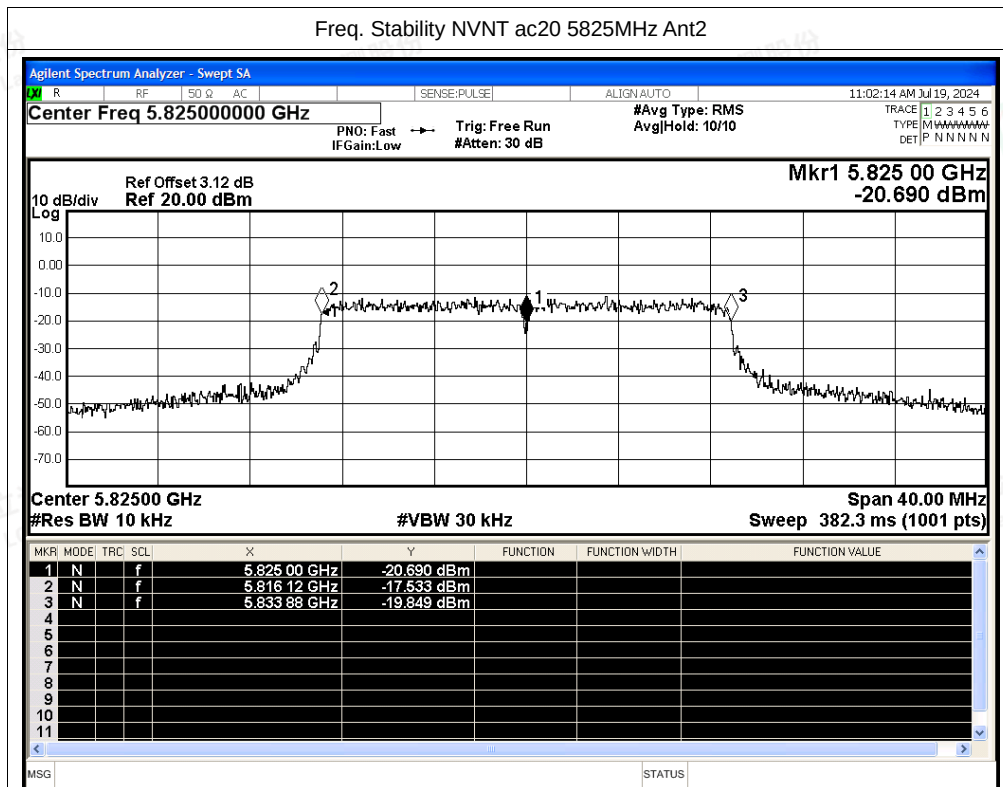


Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A &amp; 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

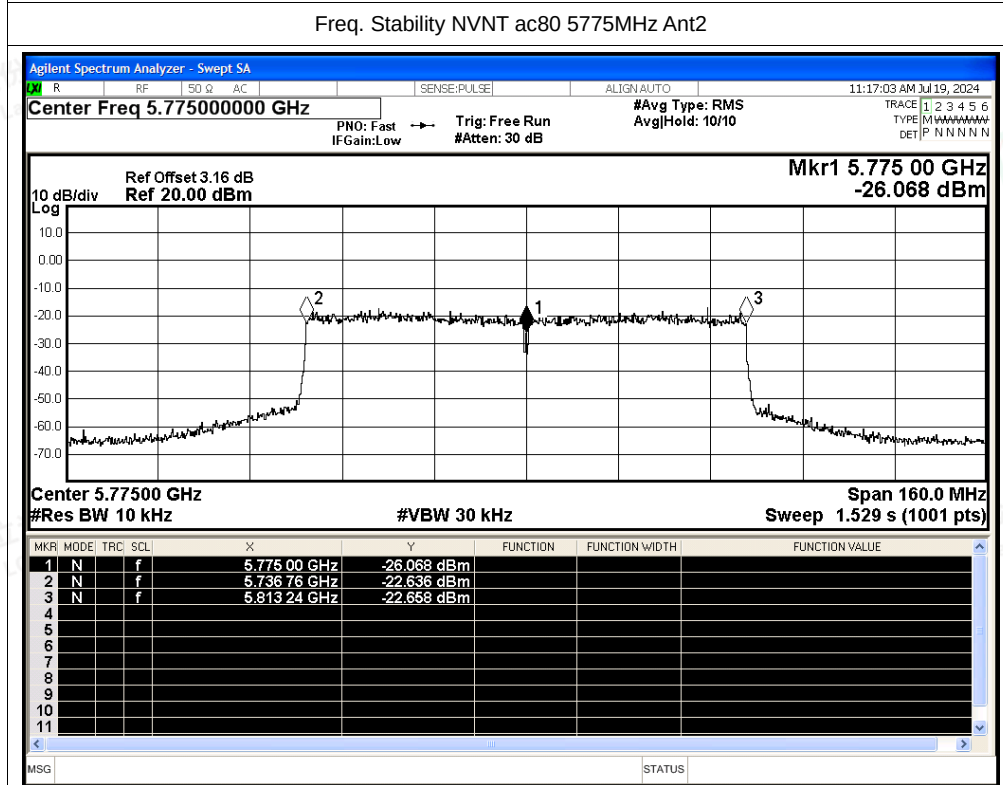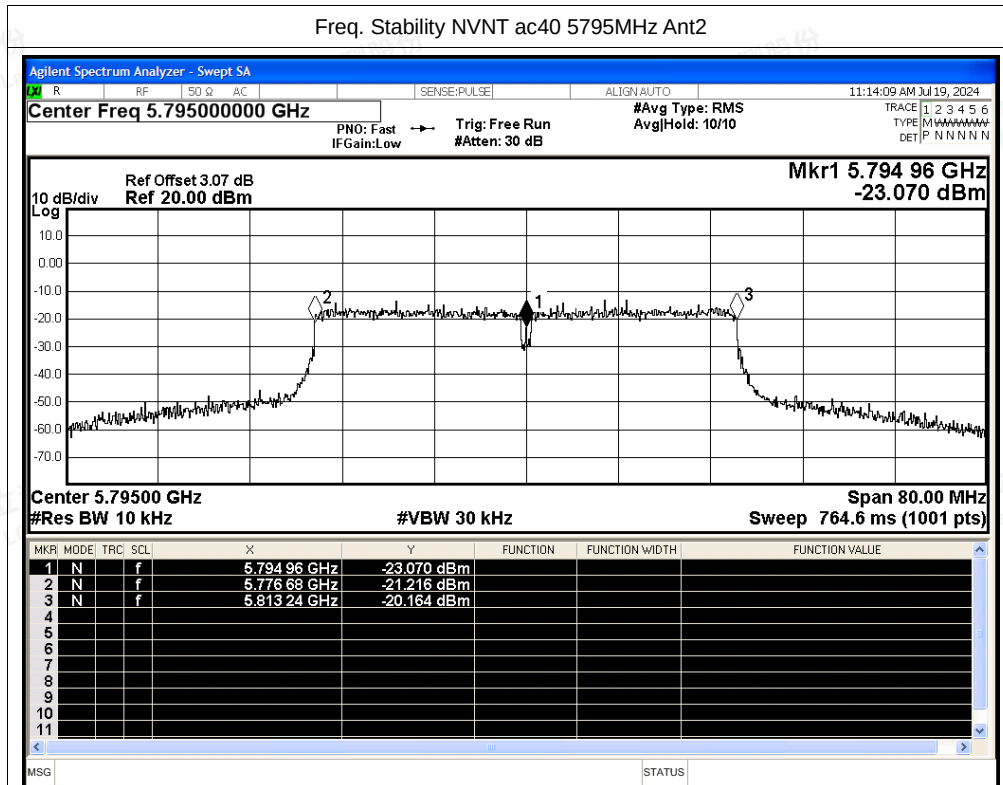

Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A &amp; 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



## G.6 Duty Cycle


| Condition | Mode | Frequency (MHz) | Antenna | Duty Cycle (%) | Correction Factor (dB) | 1/T (kHz) |
|-----------|------|-----------------|---------|----------------|------------------------|-----------|
| NVNT      | a    | 5745            | Ant1    | 94.56          | 0.24                   | 0.91      |
| NVNT      | a    | 5785            | Ant1    | 94.56          | 0.24                   | 0.91      |
| NVNT      | a    | 5825            | Ant1    | 94.65          | 0.24                   | 0.91      |
| NVNT      | n20  | 5745            | Ant1    | 93.77          | 0.28                   | 1.07      |
| NVNT      | n20  | 5785            | Ant1    | 93.77          | 0.28                   | 1.07      |
| NVNT      | n20  | 5825            | Ant1    | 93.77          | 0.28                   | 1.07      |
| NVNT      | n40  | 5755            | Ant1    | 88.14          | 0.55                   | 2.14      |
| NVNT      | n40  | 5795            | Ant1    | 88.32          | 0.54                   | 2.13      |
| NVNT      | ac20 | 5745            | Ant1    | 93.82          | 0.28                   | 1.06      |
| NVNT      | ac20 | 5785            | Ant1    | 93.72          | 0.28                   | 1.06      |
| NVNT      | ac20 | 5825            | Ant1    | 93.72          | 0.28                   | 1.06      |
| NVNT      | ac40 | 5755            | Ant1    | 97.24          | 0.12                   | 0.46      |
| NVNT      | ac40 | 5795            | Ant1    | 97.19          | 0.12                   | 0.46      |
| NVNT      | ac80 | 5775            | Ant1    | 94.32          | 0.25                   | 0.97      |






## Test Graphs

## Duty Cycle NVNT a 5745MHz Ant1

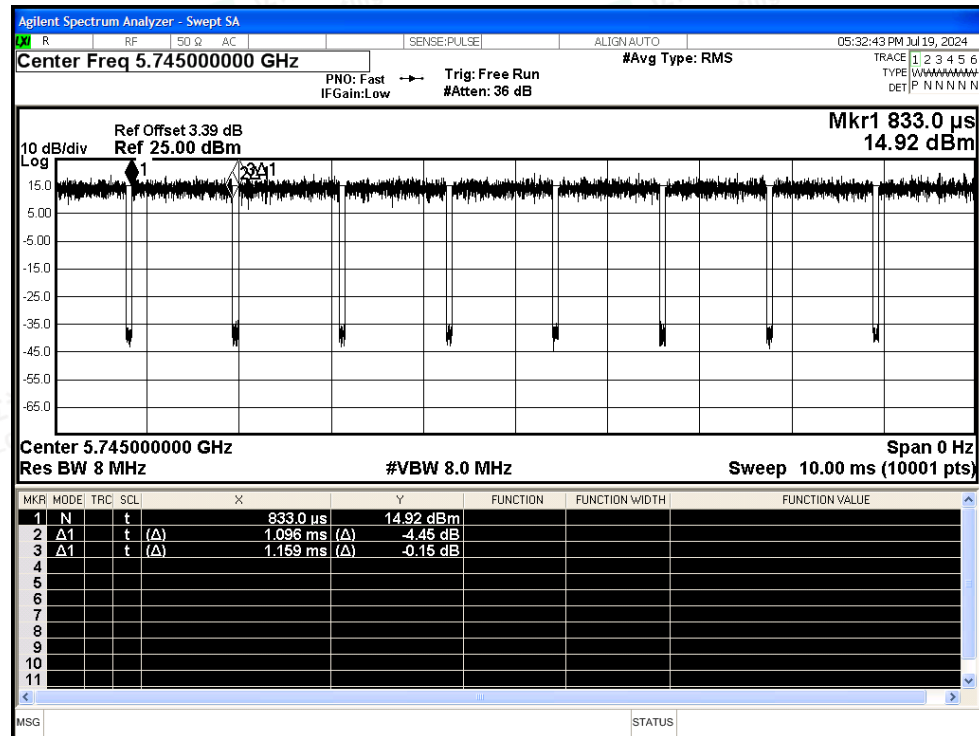

## Duty Cycle NVNT a 5785MHz Ant1

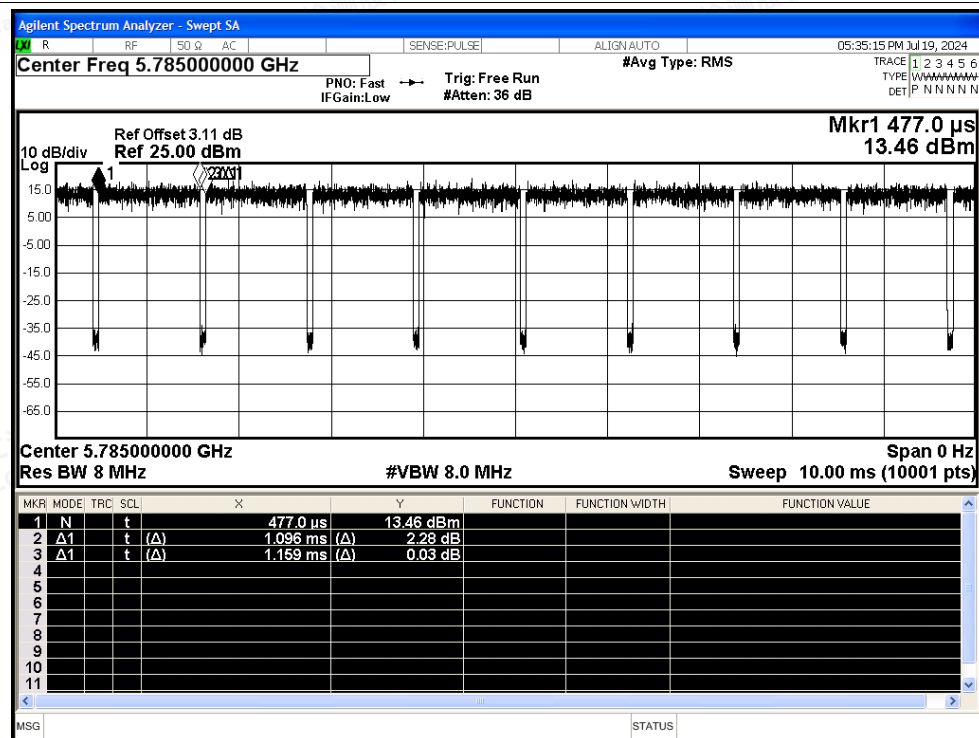

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A &amp; 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



## Duty Cycle NVNT a 5825MHz Ant1

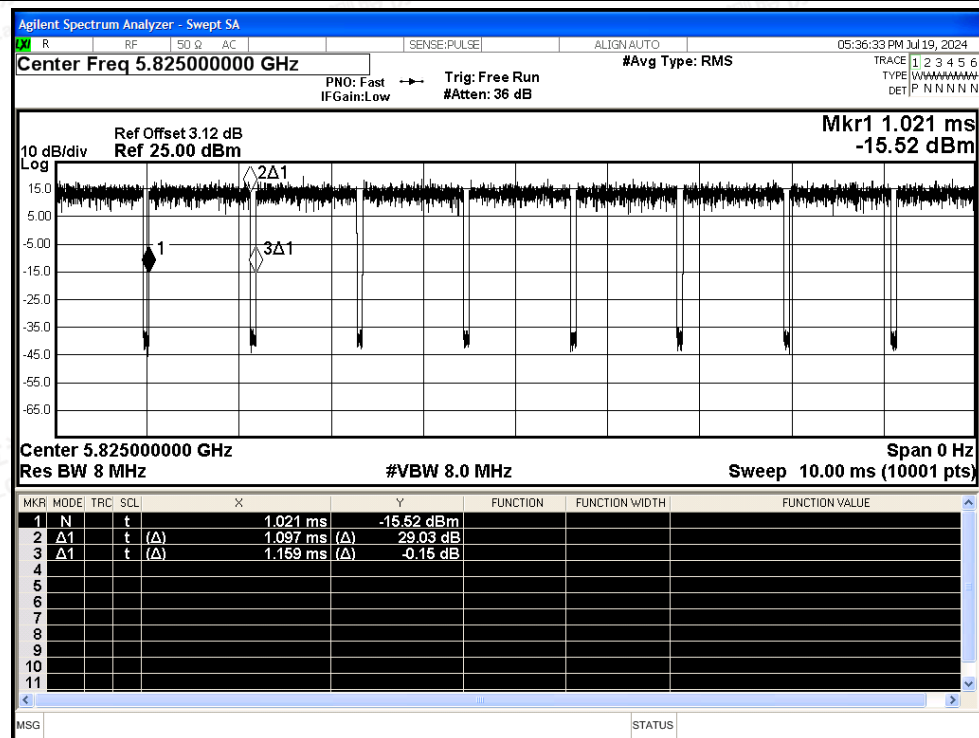

## Duty Cycle NVNT n20 5745MHz Ant1

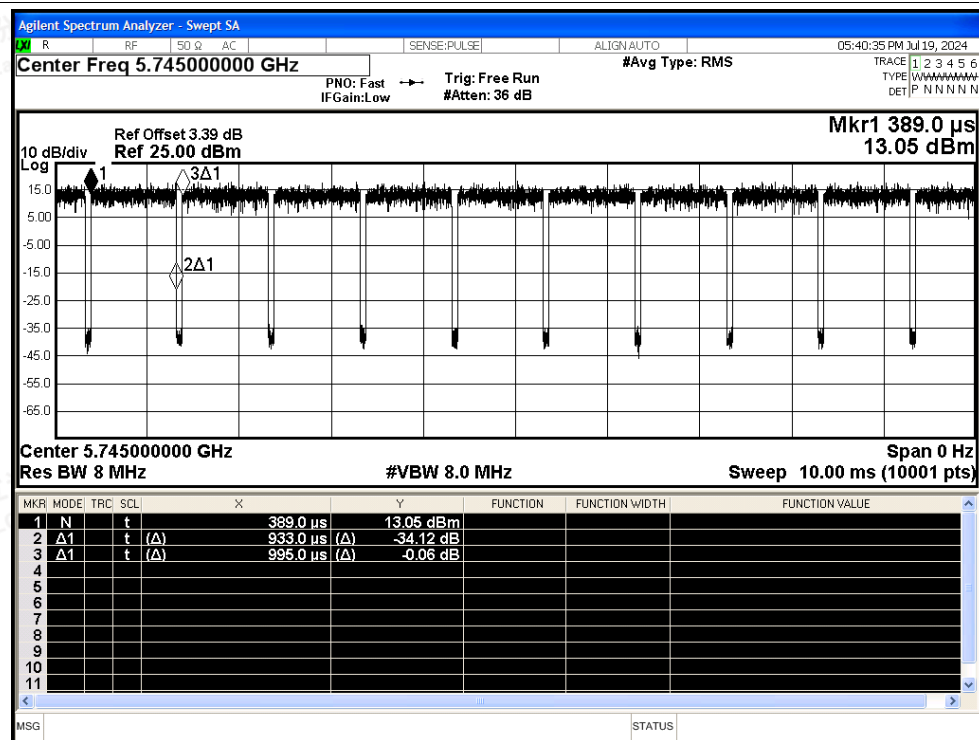

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A &amp; 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



## Duty Cycle NVNT n20 5785MHz Ant1

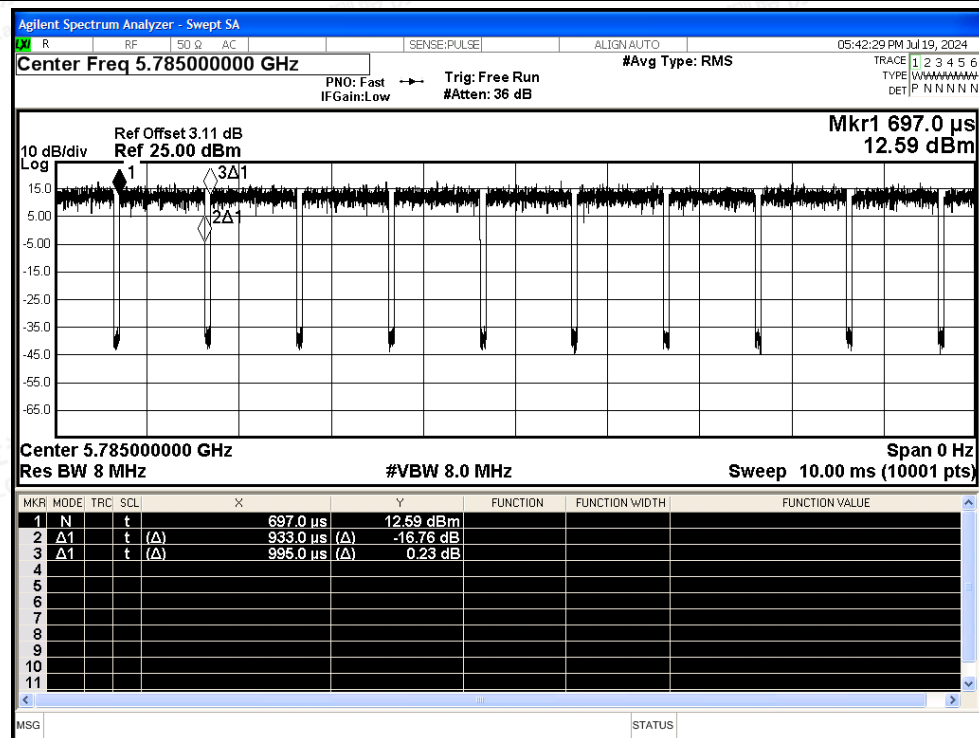

## Duty Cycle NVNT n20 5825MHz Ant1

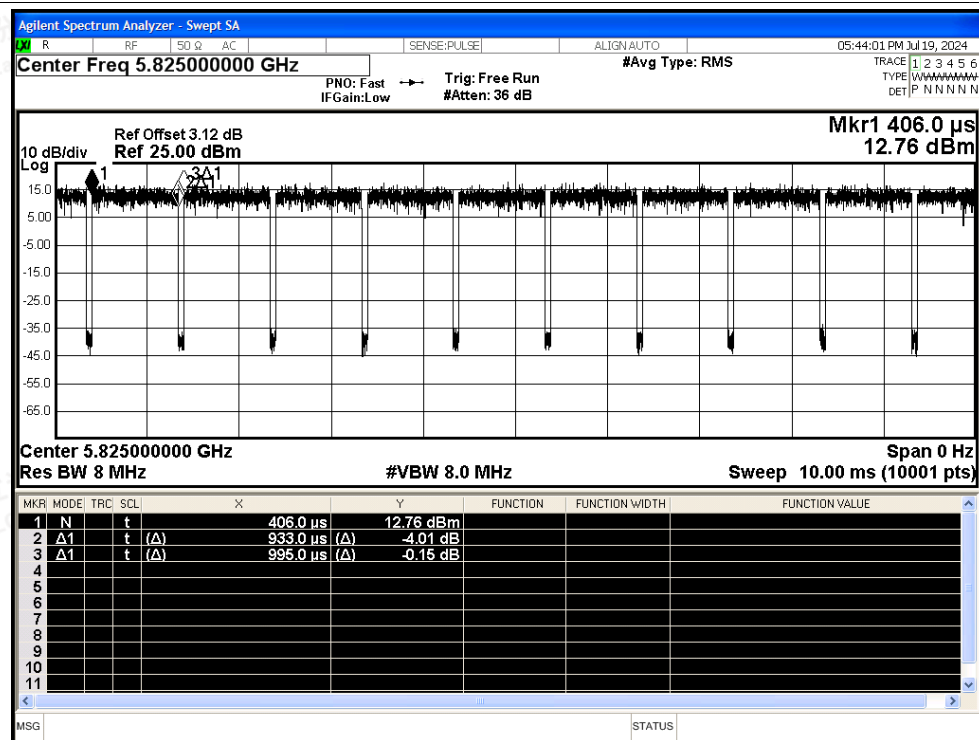

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A &amp; 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



## Duty Cycle NVNT n40 5755MHz Ant1

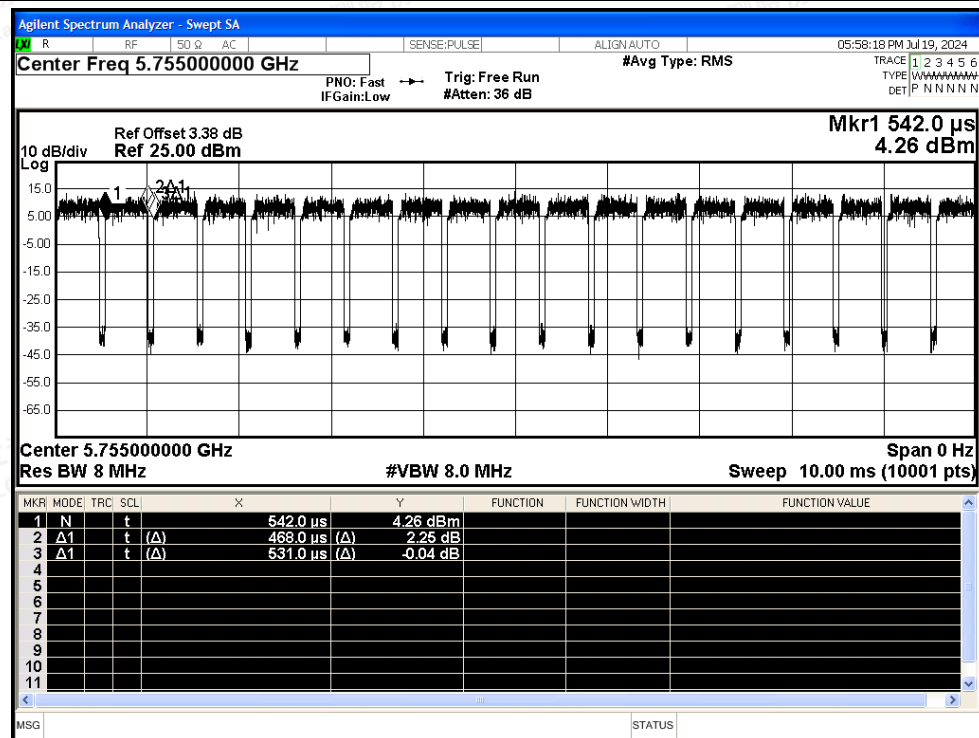

## Duty Cycle NVNT n40 5795MHz Ant1

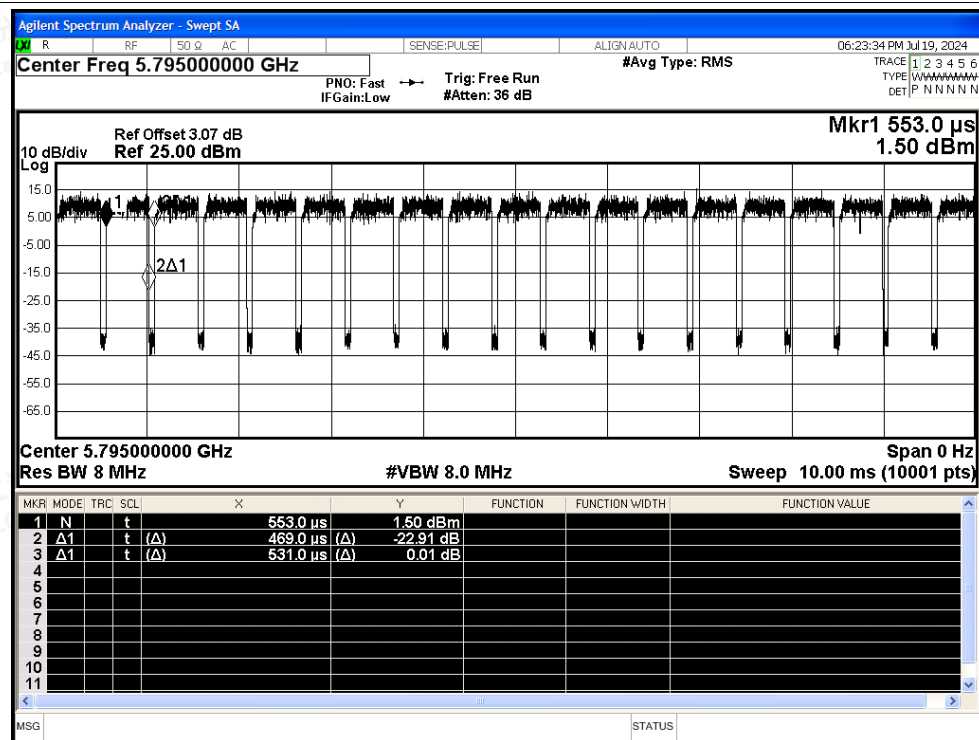

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A &amp; 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



## Duty Cycle NVNT ac20 5745MHz Ant1

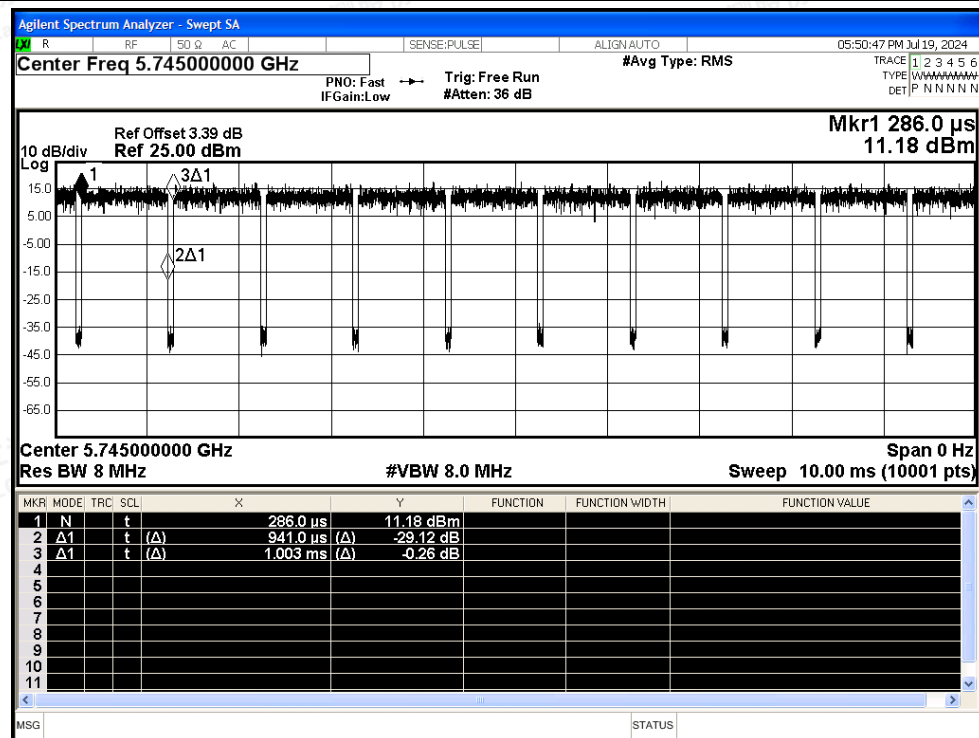

## Duty Cycle NVNT ac20 5785MHz Ant1

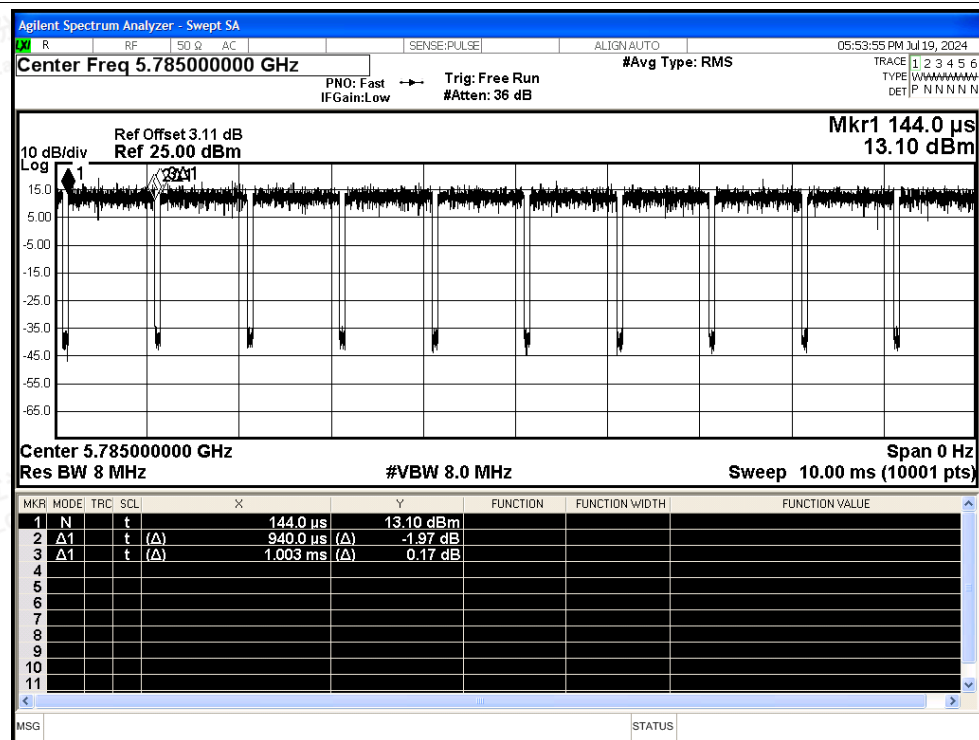

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A &amp; 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



## Duty Cycle NVNT ac20 5825MHz Ant1

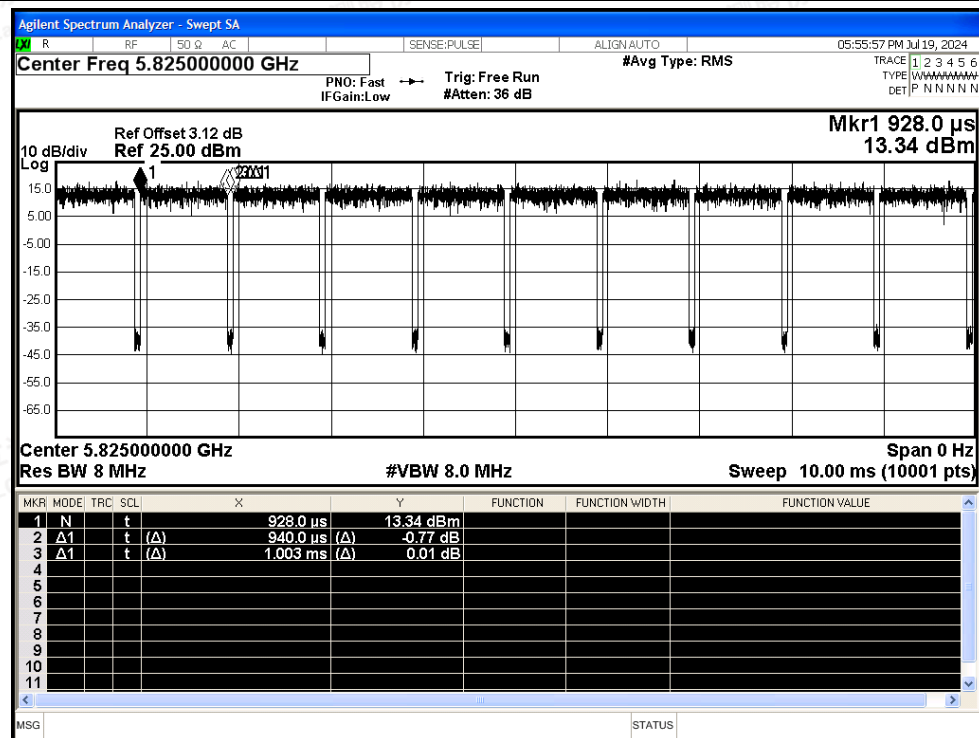

## Duty Cycle NVNT ac40 5755MHz Ant1

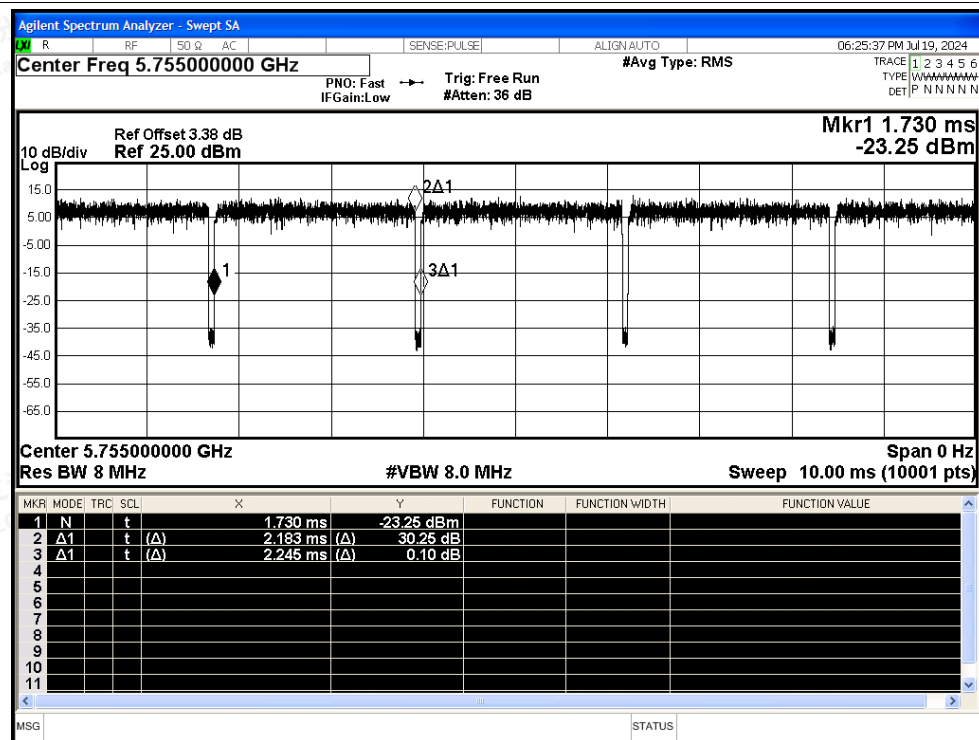

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A &amp; 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



## Duty Cycle NVNT ac40 5795MHz Ant1

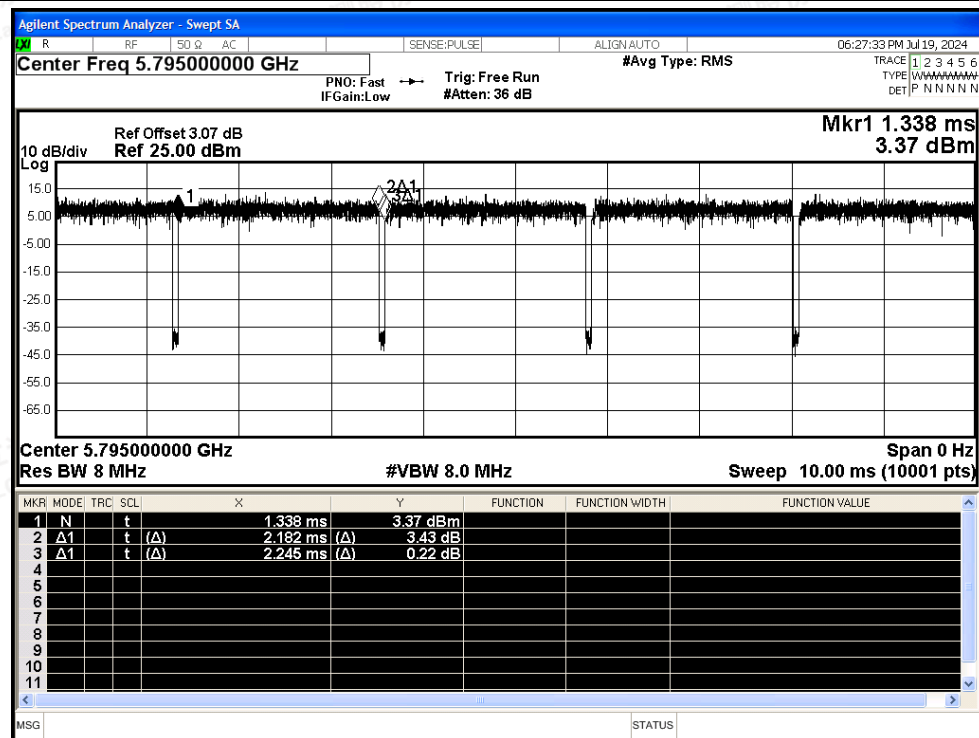

## Duty Cycle NVNT ac80 5775MHz Ant1

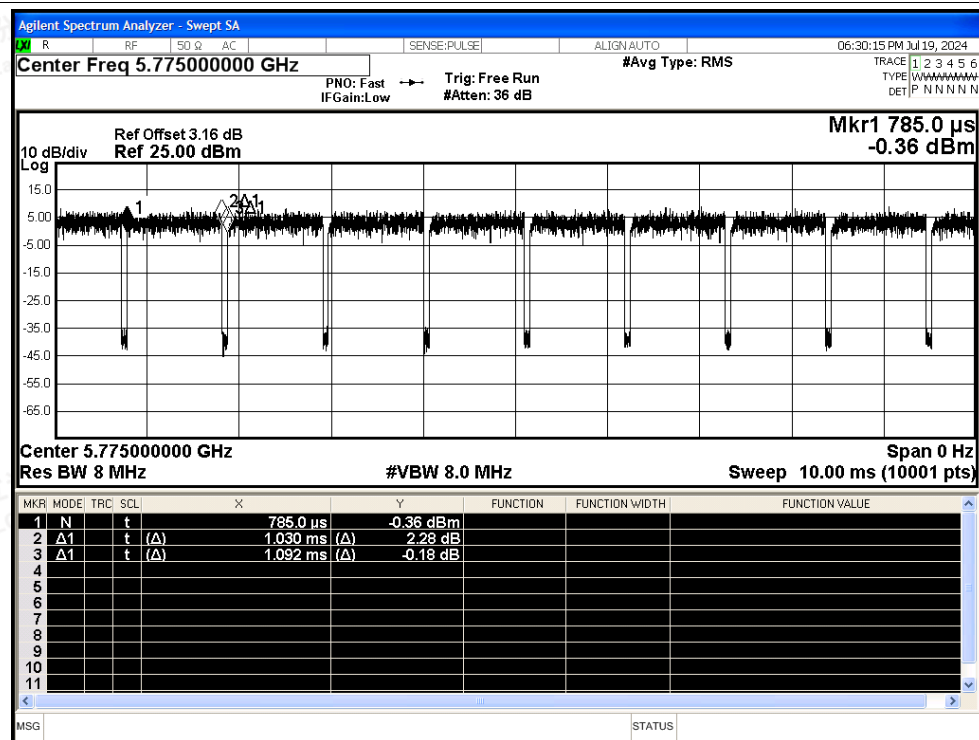

Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A &amp; 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity




| Condition | Mode | Frequency (MHz) | Antenna | Duty Cycle (%) | Correction Factor (dB) | 1/T (kHz) |
|-----------|------|-----------------|---------|----------------|------------------------|-----------|
| NVNT      | a    | 5745            | Ant2    | 94.56          | 0.24                   | 0.91      |
| NVNT      | a    | 5785            | Ant2    | 94.56          | 0.24                   | 0.91      |
| NVNT      | a    | 5825            | Ant2    | 94.56          | 0.24                   | 0.91      |
| NVNT      | n20  | 5745            | Ant2    | 93.77          | 0.28                   | 1.07      |
| NVNT      | n20  | 5785            | Ant2    | 93.77          | 0.28                   | 1.07      |
| NVNT      | n20  | 5825            | Ant2    | 93.67          | 0.28                   | 1.07      |
| NVNT      | n40  | 5755            | Ant2    | 97.23          | 0.12                   | 0.46      |
| NVNT      | n40  | 5795            | Ant2    | 97.18          | 0.12                   | 0.46      |
| NVNT      | ac20 | 5745            | Ant2    | 93.72          | 0.28                   | 1.06      |
| NVNT      | ac20 | 5785            | Ant2    | 93.72          | 0.28                   | 1.06      |
| NVNT      | ac20 | 5825            | Ant2    | 93.72          | 0.28                   | 1.06      |
| NVNT      | ac40 | 5755            | Ant2    | 97.19          | 0.12                   | 0.46      |
| NVNT      | ac40 | 5795            | Ant2    | 97.19          | 0.12                   | 0.46      |
| NVNT      | ac80 | 5775            | Ant2    | 94.32          | 0.25                   | 0.97      |






## Test Graphs

## Duty Cycle NVNT a 5745MHz Ant2

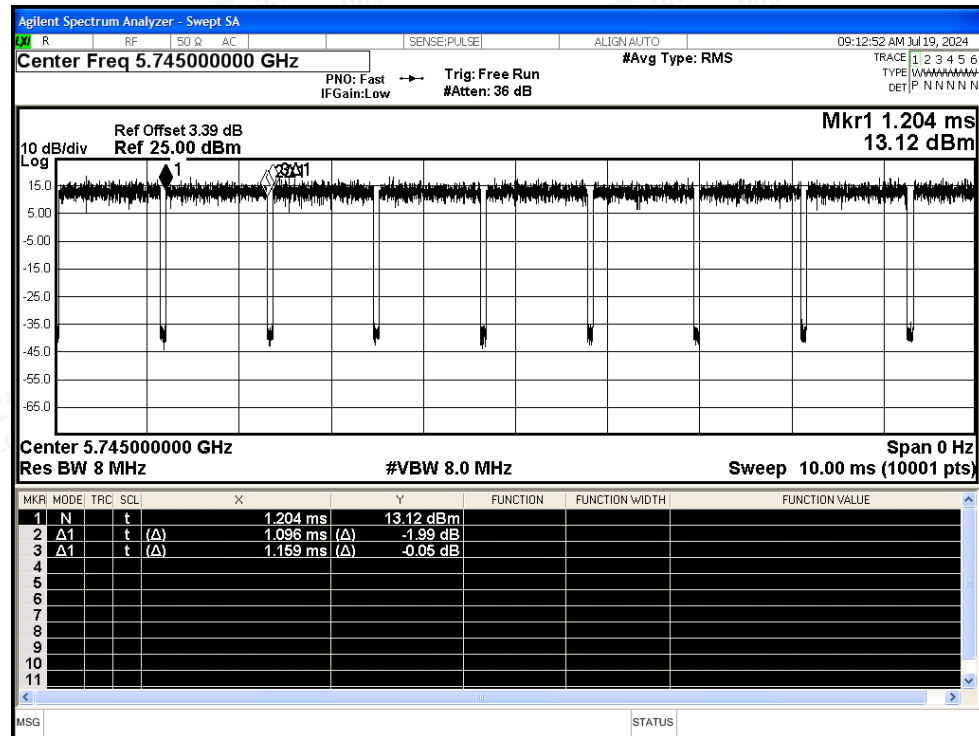

## Duty Cycle NVNT a 5785MHz Ant2

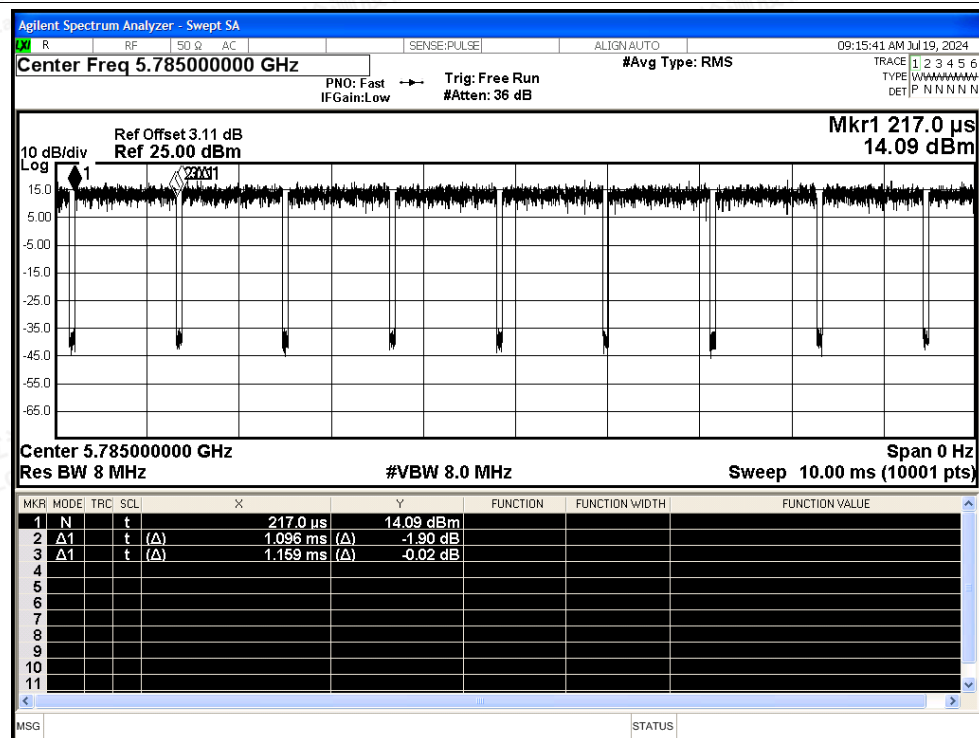

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A &amp; 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



## Duty Cycle NVNT a 5825MHz Ant2

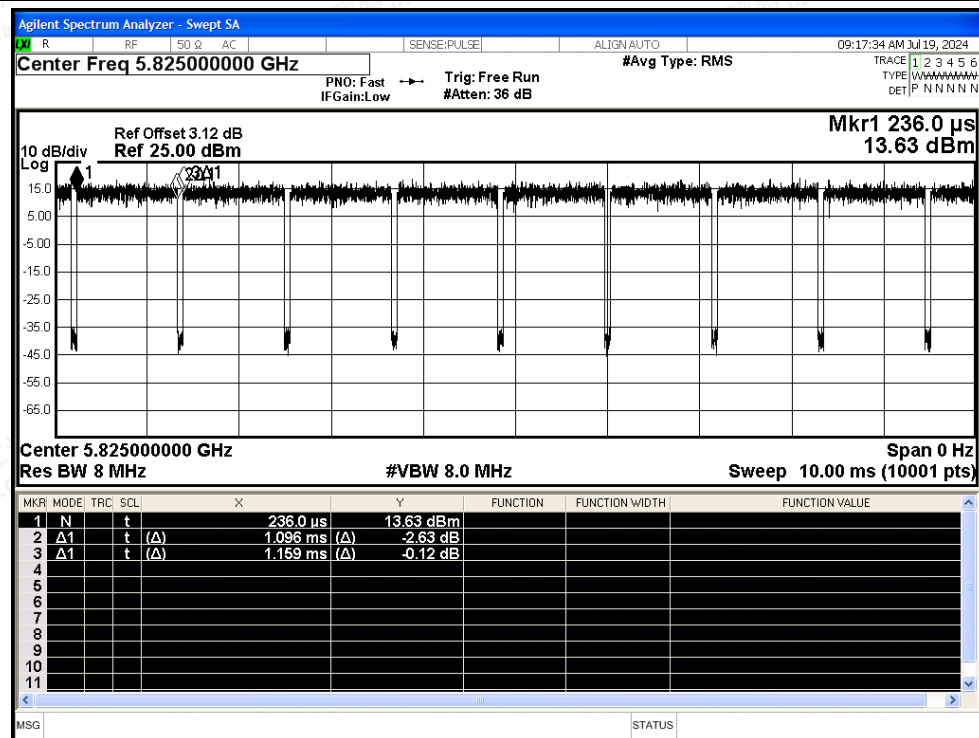

## Duty Cycle NVNT n20 5745MHz Ant2

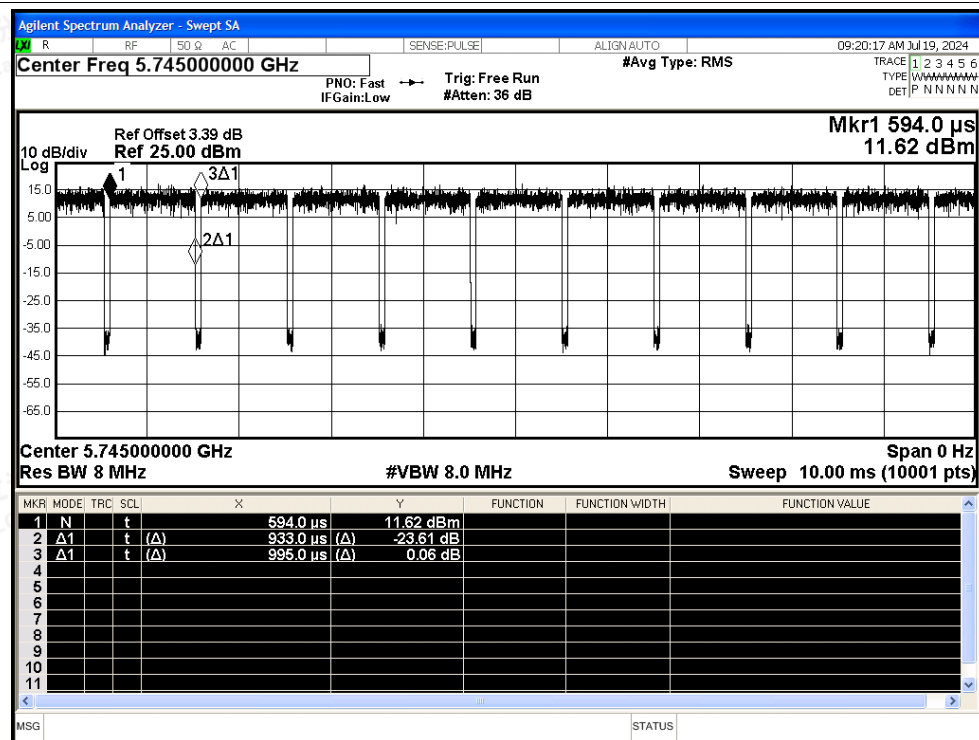

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A &amp; 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



## Duty Cycle NVNT n20 5785MHz Ant2

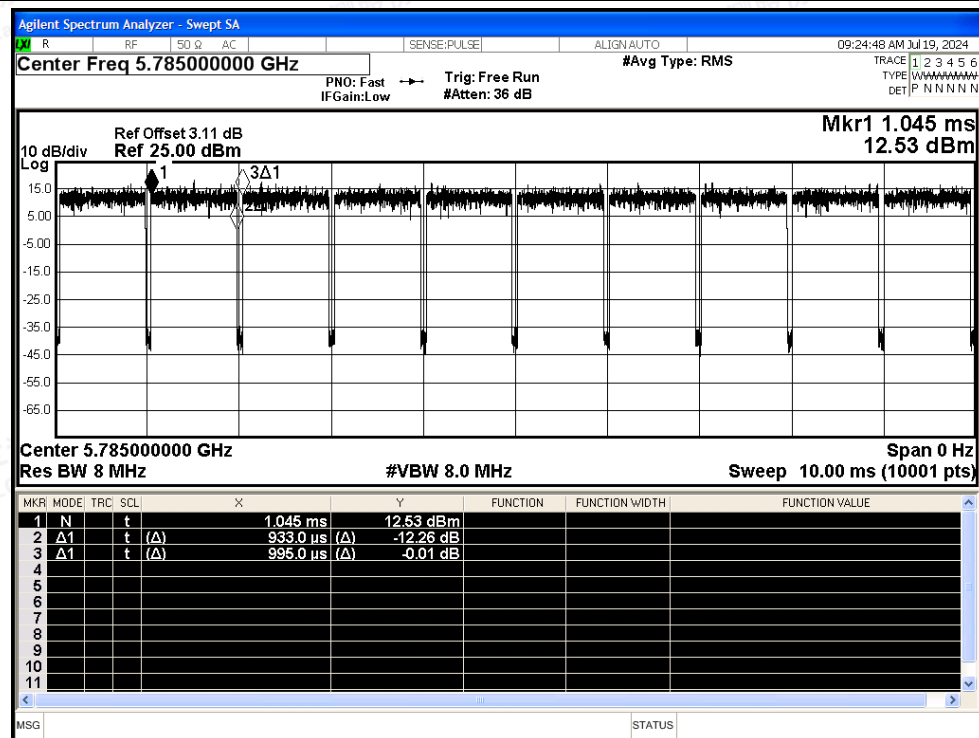

## Duty Cycle NVNT n20 5825MHz Ant2

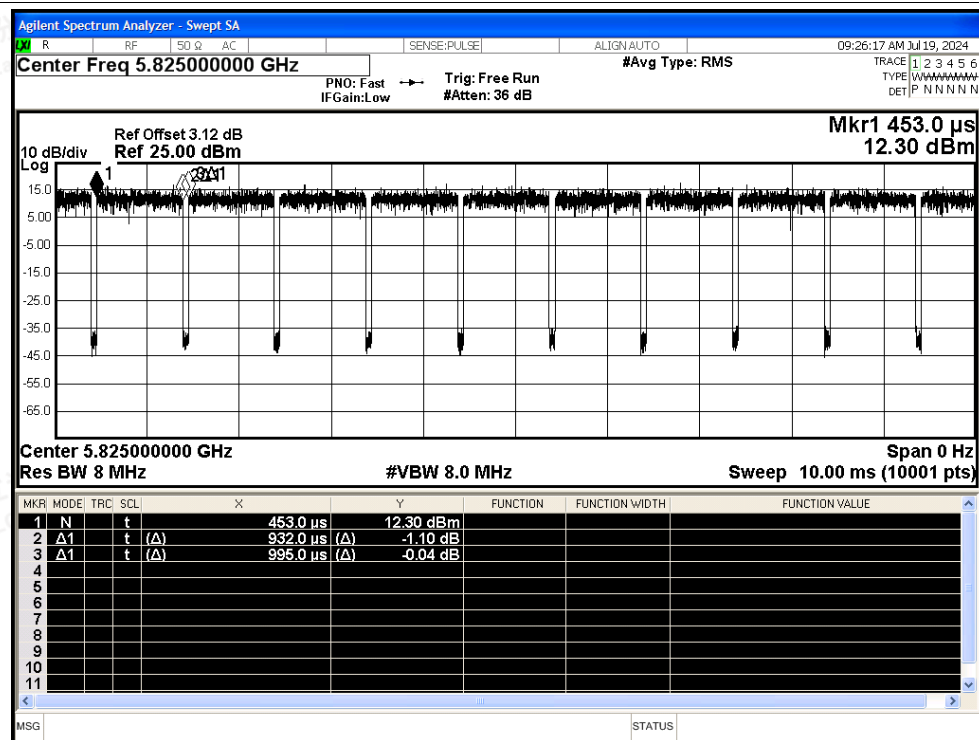

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A &amp; 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



## Duty Cycle NVNT n40 5755MHz Ant2

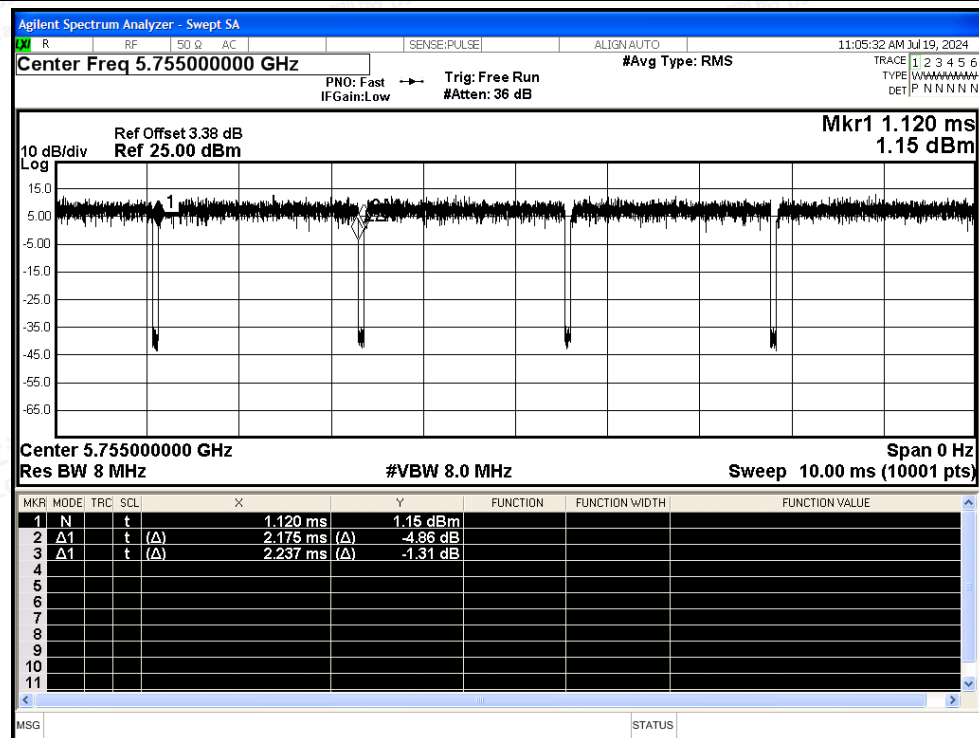

## Duty Cycle NVNT n40 5795MHz Ant2

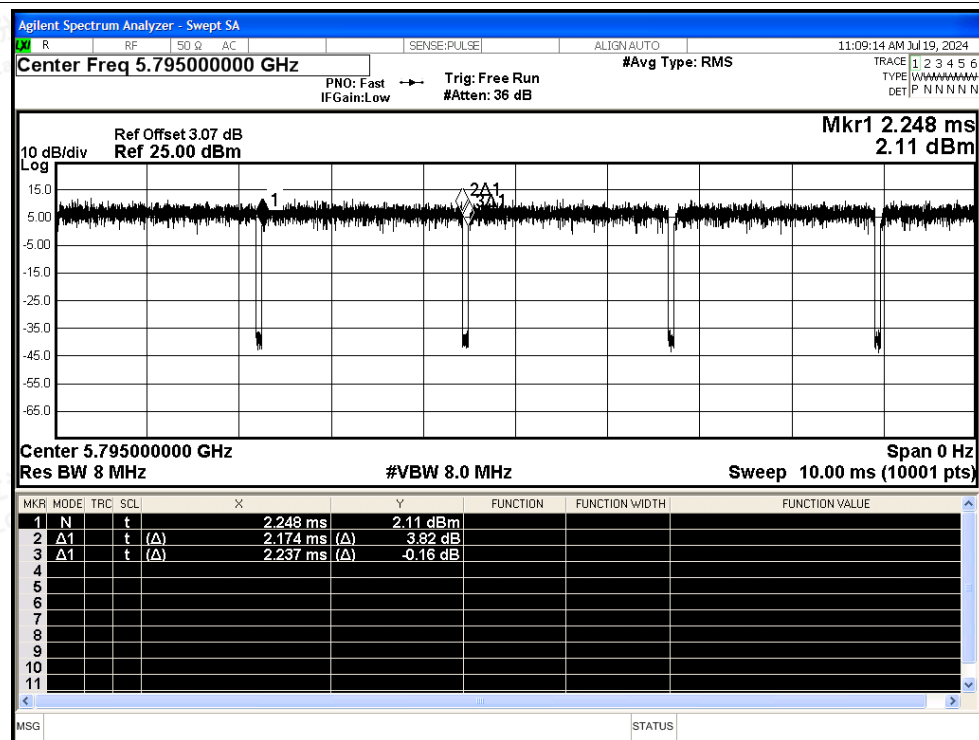

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A &amp; 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



## Duty Cycle NVNT ac20 5745MHz Ant2

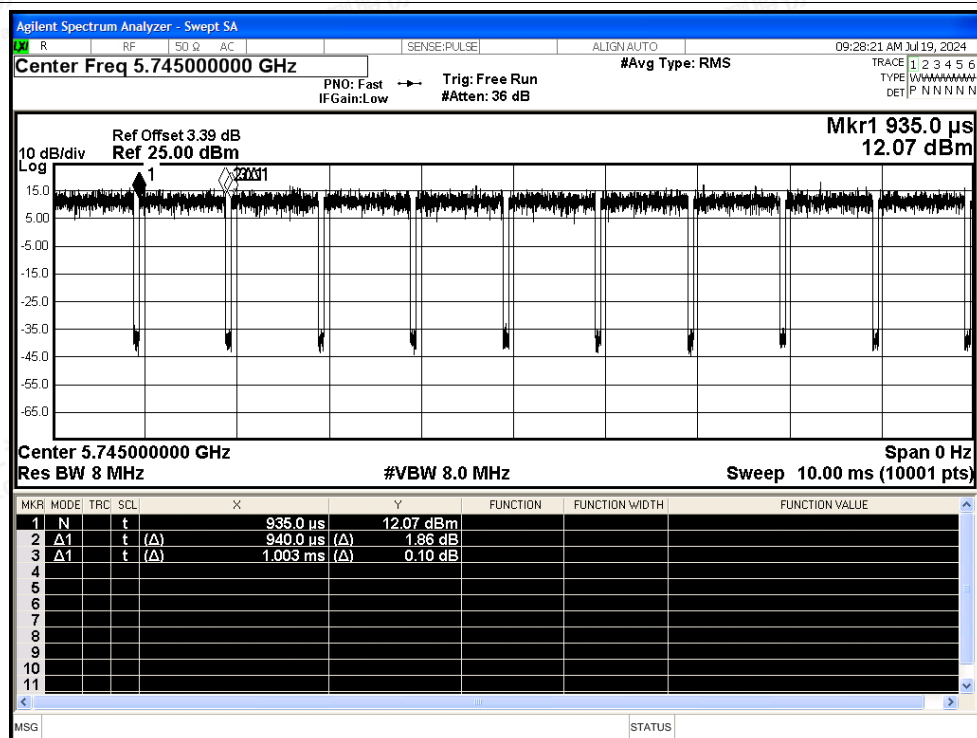

## Duty Cycle NVNT ac20 5785MHz Ant2

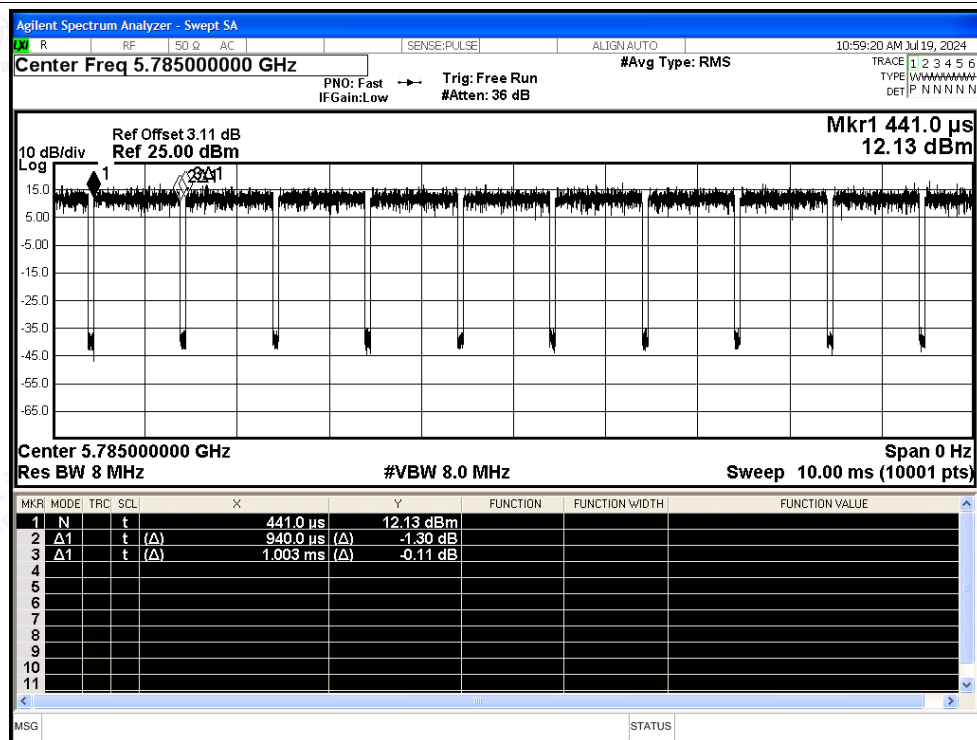

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A &amp; 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



## Duty Cycle NVNT ac20 5825MHz Ant2

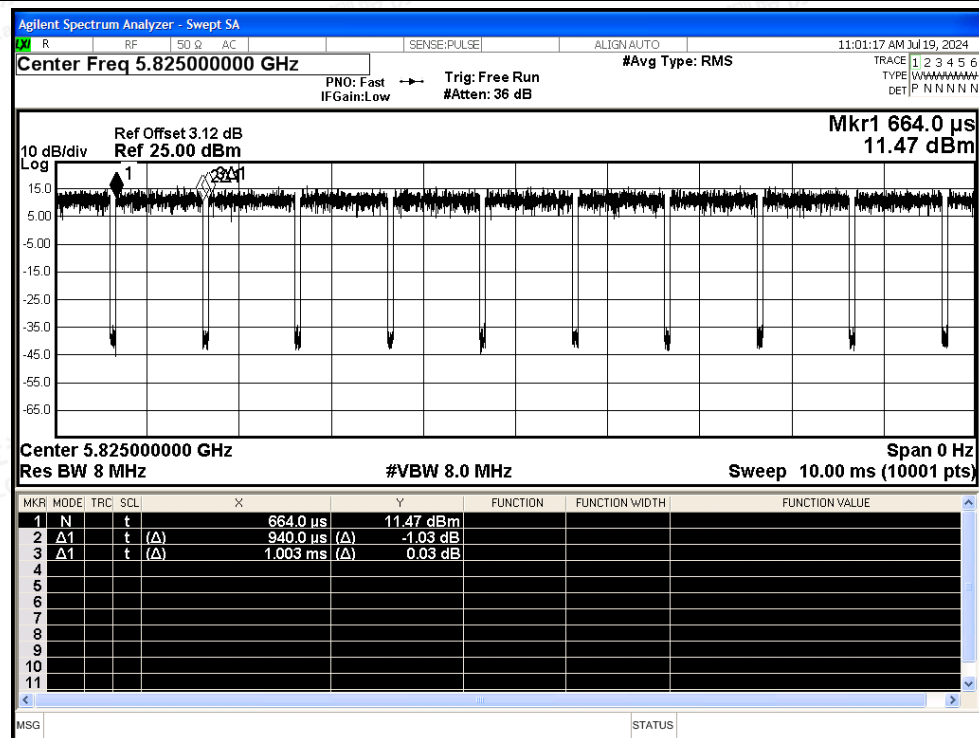

## Duty Cycle NVNT ac40 5755MHz Ant2

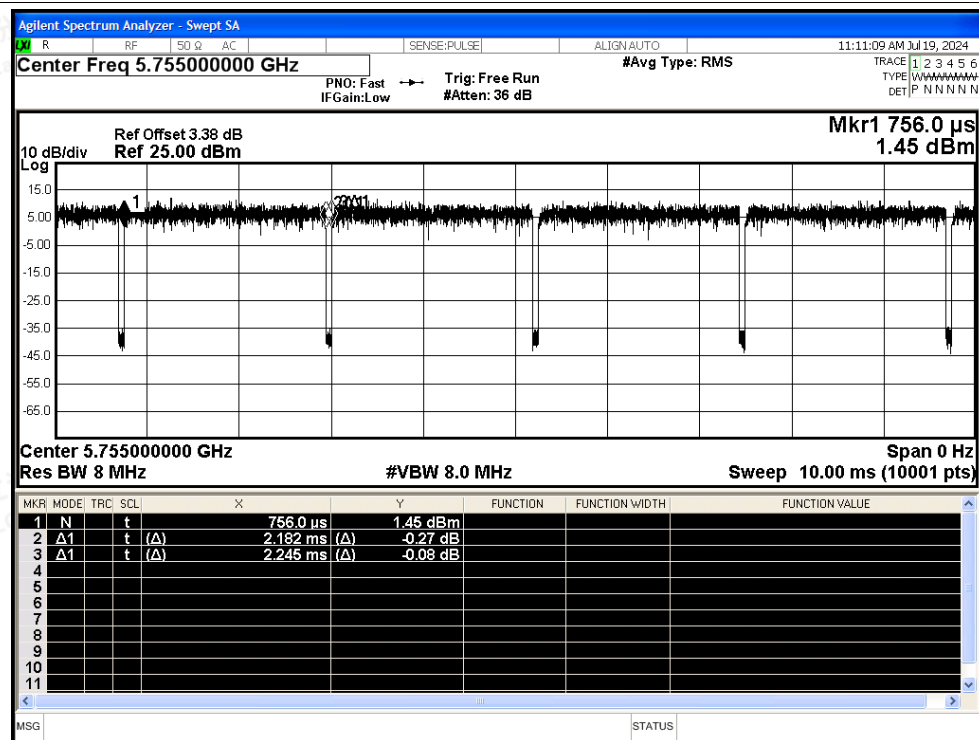

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A &amp; 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



## Duty Cycle NVNT ac40 5795MHz Ant2

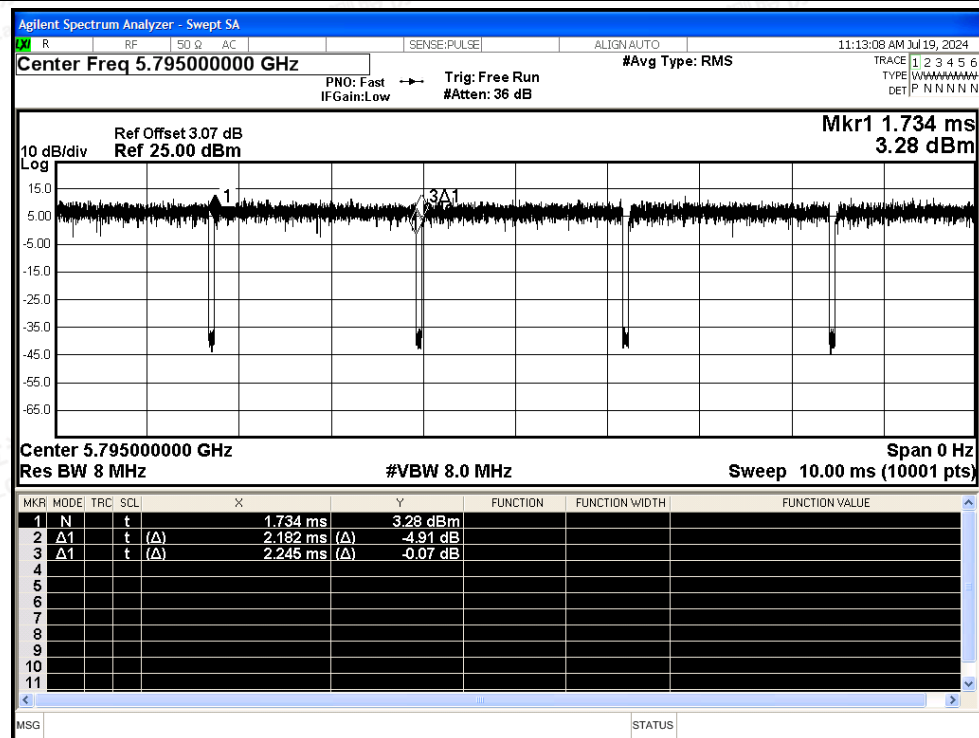

## Duty Cycle NVNT ac80 5775MHz Ant2

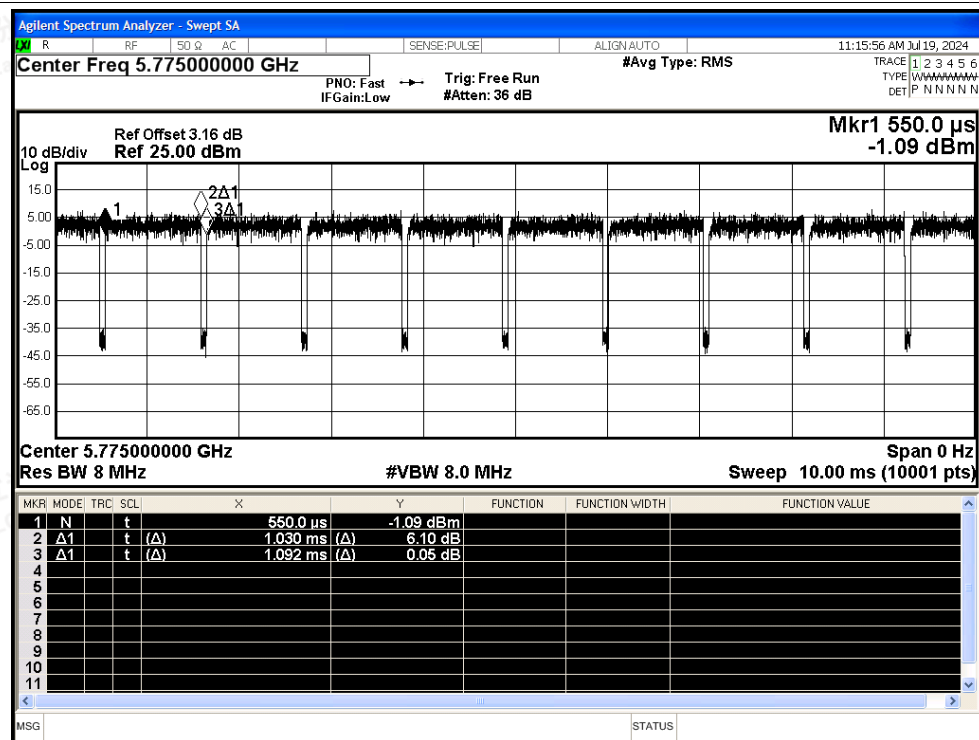

Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A &amp; 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity