



Appendix M: Test Data for E-UTRA Band 41

Product Name: Tablet

Test Model: Puya Plus

Environmental Conditions

Temperature:	23.8° C
Relative Humidity:	52.1%
ATM Pressure:	100.0 kPa
Test Engineer:	Paddi Chen
Supervised by:	Nick Peng





M.1 Conducted Output Power Data

Test Result

Band	Bandwidth	Modulation	Channel	RB Configuration	Result(dBm)	Verdict
Band41	5MHz	QPSK	39675	1RB#0	22.40	PASS
Band41	5MHz	16QAM	39675	1RB#0	21.61	PASS
Band41	5MHz	QPSK	39675	1RB#12	22.64	PASS
Band41	5MHz	16QAM	39675	1RB#12	21.71	PASS
Band41	5MHz	QPSK	39675	1RB#24	22.42	PASS
Band41	5MHz	16QAM	39675	1RB#24	21.46	PASS
Band41	5MHz	QPSK	39675	12RB#0	21.62	PASS
Band41	5MHz	16QAM	39675	12RB#0	20.57	PASS
Band41	5MHz	QPSK	39675	12RB#6	21.61	PASS
Band41	5MHz	16QAM	39675	12RB#6	20.47	PASS
Band41	5MHz	QPSK	39675	12RB#13	21.63	PASS
Band41	5MHz	16QAM	39675	12RB#13	20.60	PASS
Band41	5MHz	QPSK	39675	25RB#0	21.59	PASS
Band41	5MHz	16QAM	39675	25RB#0	20.49	PASS
Band41	5MHz	QPSK	40620	1RB#0	22.34	PASS
Band41	5MHz	16QAM	40620	1RB#0	21.61	PASS
Band41	5MHz	QPSK	40620	1RB#12	22.36	PASS
Band41	5MHz	16QAM	40620	1RB#12	21.70	PASS
Band41	5MHz	QPSK	40620	1RB#24	22.23	PASS
Band41	5MHz	16QAM	40620	1RB#24	21.50	PASS
Band41	5MHz	QPSK	40620	12RB#0	21.37	PASS
Band41	5MHz	16QAM	40620	12RB#0	20.19	PASS
Band41	5MHz	QPSK	40620	12RB#6	21.31	PASS
Band41	5MHz	16QAM	40620	12RB#6	20.26	PASS
Band41	5MHz	QPSK	40620	12RB#13	21.44	PASS
Band41	5MHz	16QAM	40620	12RB#13	20.16	PASS
Band41	5MHz	QPSK	40620	25RB#0	21.32	PASS
Band41	5MHz	16QAM	40620	25RB#0	20.40	PASS
Band41	5MHz	QPSK	41565	1RB#0	21.69	PASS
Band41	5MHz	16QAM	41565	1RB#0	20.99	PASS
Band41	5MHz	QPSK	41565	1RB#12	21.94	PASS
Band41	5MHz	16QAM	41565	1RB#12	21.16	PASS
Band41	5MHz	QPSK	41565	1RB#24	21.75	PASS
Band41	5MHz	16QAM	41565	1RB#24	20.99	PASS
Band41	5MHz	QPSK	41565	12RB#0	20.92	PASS



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



Band41	5MHz	16QAM	41565	12RB#0	19.85	PASS
Band41	5MHz	QPSK	41565	12RB#6	20.93	PASS
Band41	5MHz	16QAM	41565	12RB#6	19.72	PASS
Band41	5MHz	QPSK	41565	12RB#13	20.95	PASS
Band41	5MHz	16QAM	41565	12RB#13	19.87	PASS
Band41	5MHz	QPSK	41565	25RB#0	20.90	PASS
Band41	5MHz	16QAM	41565	25RB#0	19.90	PASS
Band41	10MHz	QPSK	39700	1RB#0	22.69	PASS
Band41	10MHz	16QAM	39700	1RB#0	21.73	PASS
Band41	10MHz	QPSK	39700	1RB#24	22.72	PASS
Band41	10MHz	16QAM	39700	1RB#24	21.86	PASS
Band41	10MHz	QPSK	39700	1RB#49	22.51	PASS
Band41	10MHz	16QAM	39700	1RB#49	21.64	PASS
Band41	10MHz	QPSK	39700	25RB#0	21.52	PASS
Band41	10MHz	16QAM	39700	25RB#0	20.66	PASS
Band41	10MHz	QPSK	39700	25RB#12	21.70	PASS
Band41	10MHz	16QAM	39700	25RB#12	20.79	PASS
Band41	10MHz	QPSK	39700	25RB#25	21.54	PASS
Band41	10MHz	16QAM	39700	25RB#25	20.62	PASS
Band41	10MHz	QPSK	39700	50RB#0	21.70	PASS
Band41	10MHz	16QAM	39700	50RB#0	20.48	PASS
Band41	10MHz	QPSK	40620	1RB#0	22.42	PASS
Band41	10MHz	16QAM	40620	1RB#0	21.59	PASS
Band41	10MHz	QPSK	40620	1RB#24	22.62	PASS
Band41	10MHz	16QAM	40620	1RB#24	21.66	PASS
Band41	10MHz	QPSK	40620	1RB#49	22.37	PASS
Band41	10MHz	16QAM	40620	1RB#49	21.43	PASS
Band41	10MHz	QPSK	40620	25RB#0	21.51	PASS
Band41	10MHz	16QAM	40620	25RB#0	20.40	PASS
Band41	10MHz	QPSK	40620	25RB#12	21.47	PASS
Band41	10MHz	16QAM	40620	25RB#12	20.49	PASS
Band41	10MHz	QPSK	40620	25RB#25	21.34	PASS
Band41	10MHz	16QAM	40620	25RB#25	20.44	PASS
Band41	10MHz	QPSK	40620	50RB#0	21.42	PASS
Band41	10MHz	16QAM	40620	50RB#0	20.51	PASS
Band41	10MHz	QPSK	41540	1RB#0	21.99	PASS
Band41	10MHz	16QAM	41540	1RB#0	21.08	PASS
Band41	10MHz	QPSK	41540	1RB#24	22.07	PASS
Band41	10MHz	16QAM	41540	1RB#24	21.32	PASS
Band41	10MHz	QPSK	41540	1RB#49	21.97	PASS
Band41	10MHz	16QAM	41540	1RB#49	21.04	PASS



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



Band41	10MHz	QPSK	41540	25RB#0	20.85	PASS
Band41	10MHz	16QAM	41540	25RB#0	20.05	PASS
Band41	10MHz	QPSK	41540	25RB#12	20.94	PASS
Band41	10MHz	16QAM	41540	25RB#12	20.05	PASS
Band41	10MHz	QPSK	41540	25RB#25	20.85	PASS
Band41	10MHz	16QAM	41540	25RB#25	19.85	PASS
Band41	10MHz	QPSK	41540	50RB#0	20.87	PASS
Band41	10MHz	16QAM	41540	50RB#0	19.86	PASS
Band41	15MHz	QPSK	39725	1RB#0	22.54	PASS
Band41	15MHz	16QAM	39725	1RB#0	21.72	PASS
Band41	15MHz	QPSK	39725	1RB#38	22.65	PASS
Band41	15MHz	16QAM	39725	1RB#38	21.82	PASS
Band41	15MHz	QPSK	39725	1RB#74	22.38	PASS
Band41	15MHz	16QAM	39725	1RB#74	21.35	PASS
Band41	15MHz	QPSK	39725	38RB#0	21.62	PASS
Band41	15MHz	16QAM	39725	38RB#0	21.66	PASS
Band41	15MHz	QPSK	39725	38RB#18	21.63	PASS
Band41	15MHz	16QAM	39725	38RB#18	21.51	PASS
Band41	15MHz	QPSK	39725	38RB#37	21.59	PASS
Band41	15MHz	16QAM	39725	38RB#37	21.63	PASS
Band41	15MHz	QPSK	39725	75RB#0	21.64	PASS
Band41	15MHz	16QAM	39725	75RB#0	20.61	PASS
Band41	15MHz	QPSK	40620	1RB#0	22.45	PASS
Band41	15MHz	16QAM	40620	1RB#0	21.55	PASS
Band41	15MHz	QPSK	40620	1RB#38	22.44	PASS
Band41	15MHz	16QAM	40620	1RB#38	21.50	PASS
Band41	15MHz	QPSK	40620	1RB#74	22.27	PASS
Band41	15MHz	16QAM	40620	1RB#74	21.38	PASS
Band41	15MHz	QPSK	40620	38RB#0	21.58	PASS
Band41	15MHz	16QAM	40620	38RB#0	21.53	PASS
Band41	15MHz	QPSK	40620	38RB#18	21.48	PASS
Band41	15MHz	16QAM	40620	38RB#18	21.58	PASS
Band41	15MHz	QPSK	40620	38RB#37	21.56	PASS
Band41	15MHz	16QAM	40620	38RB#37	21.58	PASS
Band41	15MHz	QPSK	40620	75RB#0	21.46	PASS
Band41	15MHz	16QAM	40620	75RB#0	20.46	PASS
Band41	15MHz	QPSK	41515	1RB#0	21.93	PASS
Band41	15MHz	16QAM	41515	1RB#0	21.12	PASS
Band41	15MHz	QPSK	41515	1RB#38	22.01	PASS
Band41	15MHz	16QAM	41515	1RB#38	20.97	PASS
Band41	15MHz	QPSK	41515	1RB#74	21.94	PASS



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



Band41	15MHz	16QAM	41515	1RB#74	20.87	PASS
Band41	15MHz	QPSK	41515	38RB#0	21.09	PASS
Band41	15MHz	16QAM	41515	38RB#0	21.04	PASS
Band41	15MHz	QPSK	41515	38RB#18	20.95	PASS
Band41	15MHz	16QAM	41515	38RB#18	20.95	PASS
Band41	15MHz	QPSK	41515	38RB#37	21.04	PASS
Band41	15MHz	16QAM	41515	38RB#37	20.92	PASS
Band41	15MHz	QPSK	41515	75RB#0	21.05	PASS
Band41	15MHz	16QAM	41515	75RB#0	19.92	PASS
Band41	20MHz	QPSK	39750	1RB#0	22.41	PASS
Band41	20MHz	16QAM	39750	1RB#0	21.35	PASS
Band41	20MHz	QPSK	39750	1RB#49	22.71	PASS
Band41	20MHz	16QAM	39750	1RB#49	21.74	PASS
Band41	20MHz	QPSK	39750	1RB#99	22.00	PASS
Band41	20MHz	16QAM	39750	1RB#99	21.16	PASS
Band41	20MHz	QPSK	39750	50RB#0	21.56	PASS
Band41	20MHz	16QAM	39750	50RB#0	20.54	PASS
Band41	20MHz	QPSK	39750	50RB#25	21.44	PASS
Band41	20MHz	16QAM	39750	50RB#25	20.57	PASS
Band41	20MHz	QPSK	39750	50RB#50	21.39	PASS
Band41	20MHz	16QAM	39750	50RB#50	20.53	PASS
Band41	20MHz	QPSK	39750	100RB#0	21.42	PASS
Band41	20MHz	16QAM	39750	100RB#0	20.43	PASS
Band41	20MHz	QPSK	40620	1RB#0	22.34	PASS
Band41	20MHz	16QAM	40620	1RB#0	21.29	PASS
Band41	20MHz	QPSK	40620	1RB#49	22.72	PASS
Band41	20MHz	16QAM	40620	1RB#49	21.46	PASS
Band41	20MHz	QPSK	40620	1RB#99	22.24	PASS
Band41	20MHz	16QAM	40620	1RB#99	21.19	PASS
Band41	20MHz	QPSK	40620	50RB#0	21.34	PASS
Band41	20MHz	16QAM	40620	50RB#0	20.47	PASS
Band41	20MHz	QPSK	40620	50RB#25	21.51	PASS
Band41	20MHz	16QAM	40620	50RB#25	20.50	PASS
Band41	20MHz	QPSK	40620	50RB#50	21.47	PASS
Band41	20MHz	16QAM	40620	50RB#50	20.49	PASS
Band41	20MHz	QPSK	40620	100RB#0	21.48	PASS
Band41	20MHz	16QAM	40620	100RB#0	20.43	PASS
Band41	20MHz	QPSK	41490	1RB#0	21.94	PASS
Band41	20MHz	16QAM	41490	1RB#0	20.88	PASS
Band41	20MHz	QPSK	41490	1RB#49	22.09	PASS
Band41	20MHz	16QAM	41490	1RB#49	21.05	PASS



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



Band41	20MHz	QPSK	41490	1RB#99	21.72	PASS
Band41	20MHz	16QAM	41490	1RB#99	20.62	PASS
Band41	20MHz	QPSK	41490	50RB#0	21.02	PASS
Band41	20MHz	16QAM	41490	50RB#0	19.95	PASS
Band41	20MHz	QPSK	41490	50RB#25	21.13	PASS
Band41	20MHz	16QAM	41490	50RB#25	19.93	PASS
Band41	20MHz	QPSK	41490	50RB#50	20.74	PASS
Band41	20MHz	16QAM	41490	50RB#50	19.71	PASS
Band41	20MHz	QPSK	41490	100RB#0	20.99	PASS
Band41	20MHz	16QAM	41490	100RB#0	19.85	PASS





M.2 Peak-to-Average Ratio(CCDF)


Test Result


Band	Bandwidth	Modulation	Channel	RB Configuration	Result(dB)	Limit(dB)	Verdict
Band41	5MHz	QPSK	39675	25RB#0	9.91	13	PASS
Band41	5MHz	16QAM	39675	25RB#0	10.74	13	PASS
Band41	5MHz	QPSK	40620	25RB#0	10.15	13	PASS
Band41	5MHz	16QAM	40620	25RB#0	10.89	13	PASS
Band41	5MHz	QPSK	41565	25RB#0	10.42	13	PASS
Band41	5MHz	16QAM	41565	25RB#0	11.14	13	PASS
Band41	10MHz	QPSK	39700	50RB#0	10.18	13	PASS
Band41	10MHz	16QAM	39700	50RB#0	10.68	13	PASS
Band41	10MHz	QPSK	40620	50RB#0	10.17	13	PASS
Band41	10MHz	16QAM	40620	50RB#0	11.07	13	PASS
Band41	10MHz	QPSK	41540	50RB#0	10.48	13	PASS
Band41	10MHz	16QAM	41540	50RB#0	11.13	13	PASS
Band41	15MHz	QPSK	39725	75RB#0	10.30	13	PASS
Band41	15MHz	16QAM	39725	75RB#0	11.13	13	PASS
Band41	15MHz	QPSK	40620	75RB#0	10.15	13	PASS
Band41	15MHz	16QAM	40620	75RB#0	10.97	13	PASS
Band41	15MHz	QPSK	41515	75RB#0	10.72	13	PASS
Band41	15MHz	16QAM	41515	75RB#0	11.76	13	PASS
Band41	20MHz	QPSK	39750	100RB#0	10.03	13	PASS
Band41	20MHz	16QAM	39750	100RB#0	10.73	13	PASS
Band41	20MHz	QPSK	40620	100RB#0	10.12	13	PASS
Band41	20MHz	16QAM	40620	100RB#0	10.61	13	PASS
Band41	20MHz	QPSK	41490	100RB#0	10.20	13	PASS
Band41	20MHz	16QAM	41490	100RB#0	10.97	13	PASS






Test Graphs

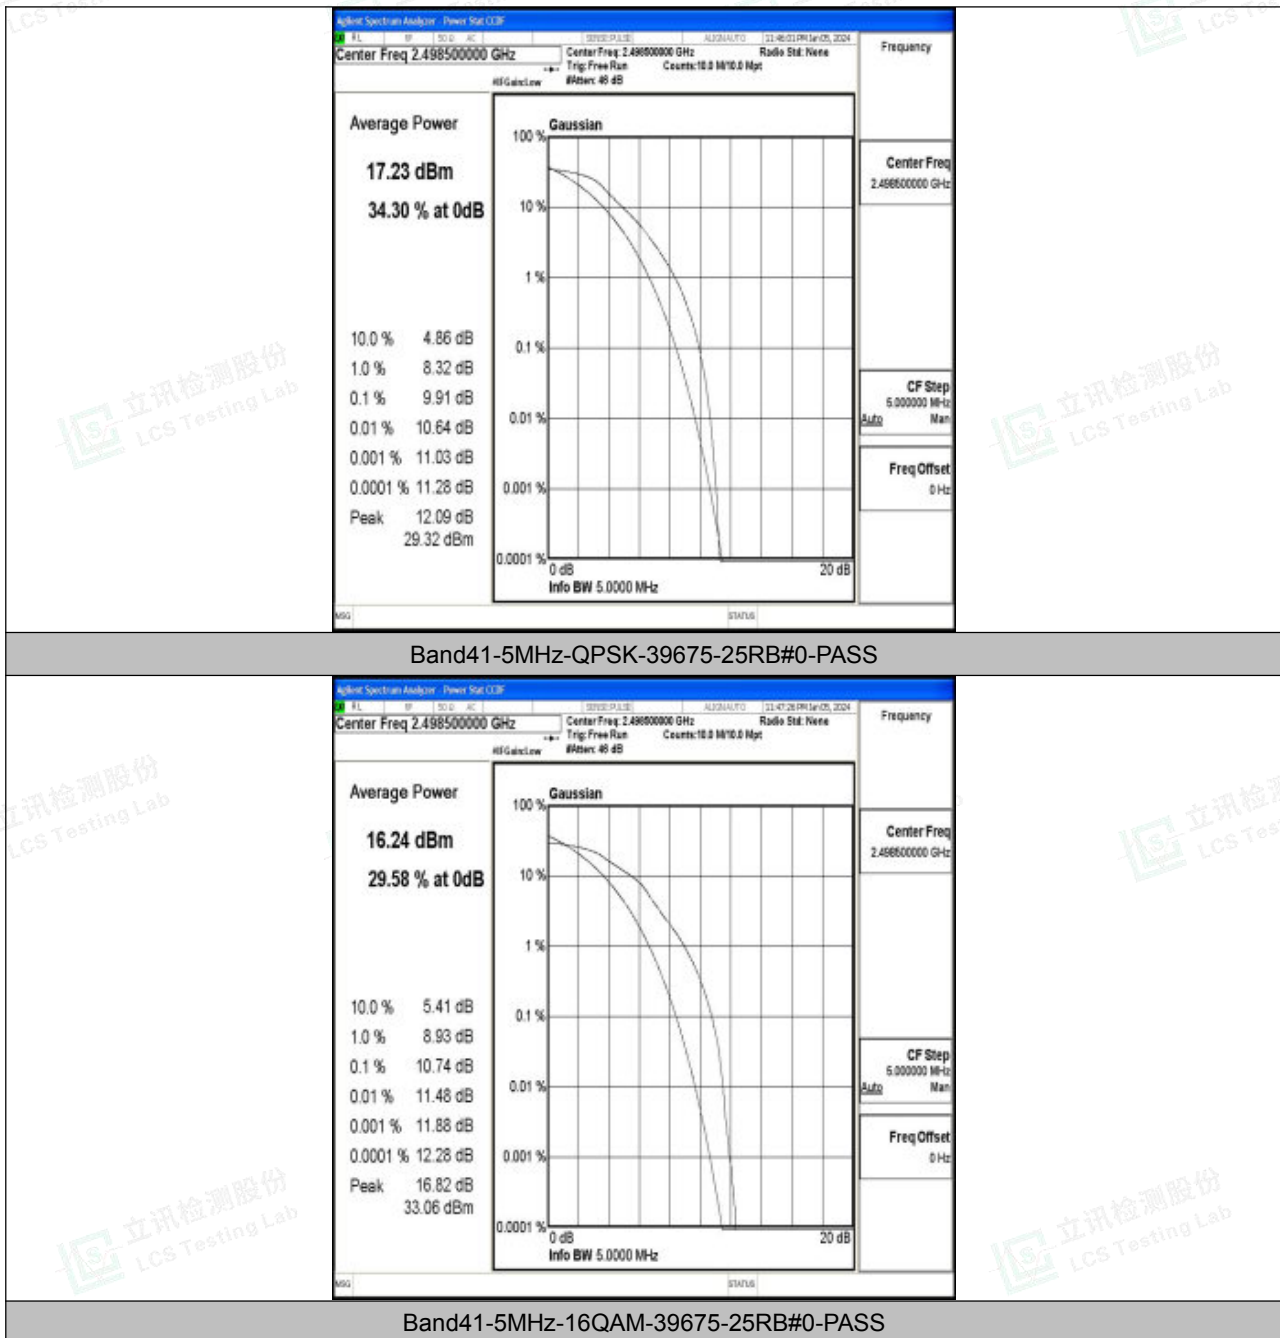

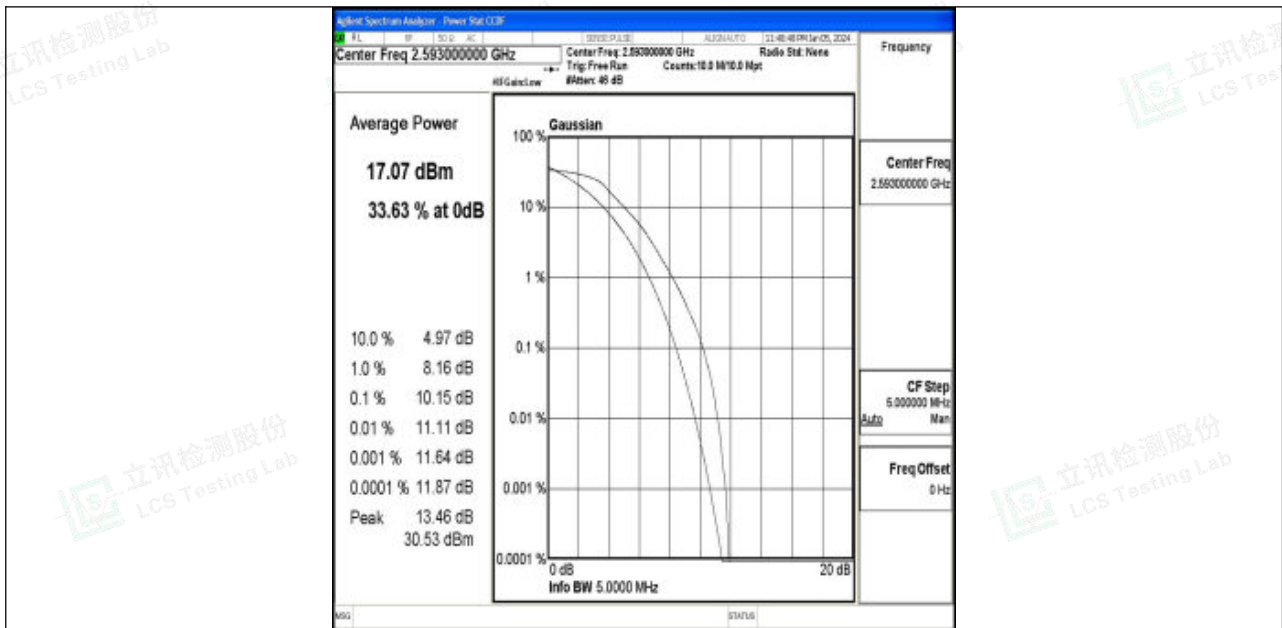


Band41-5MHz-QPSK-40620-25RB#0-PASS

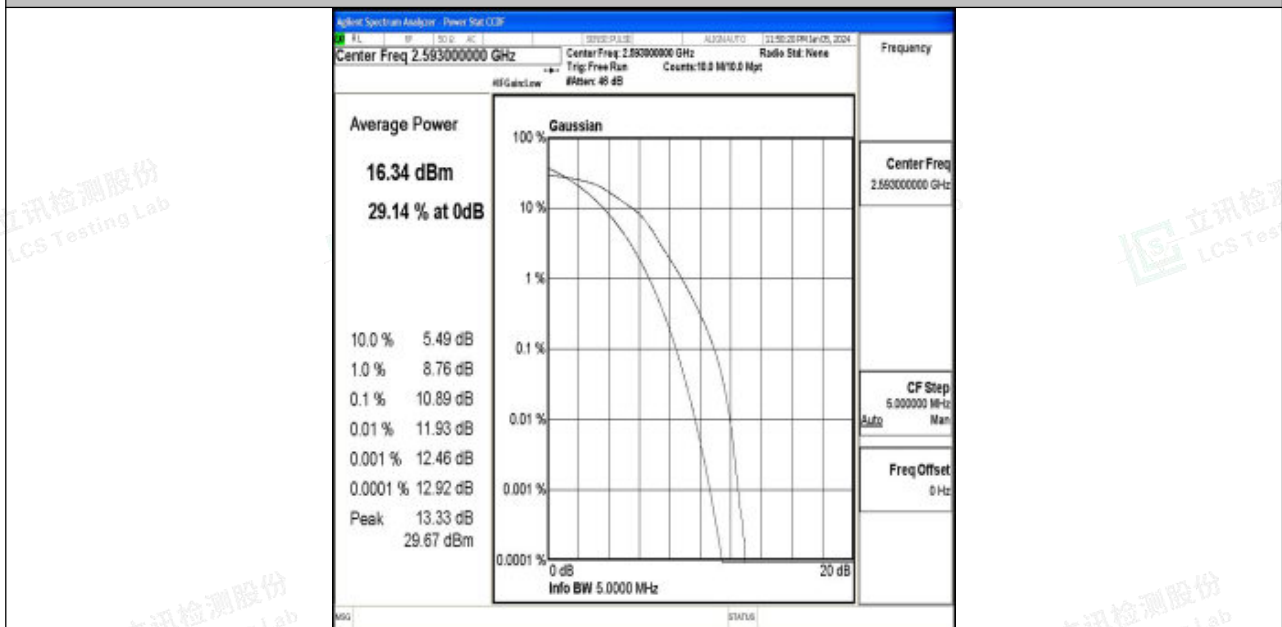


Band41-5MHz-16QAM-40620-25RB#0-PASS



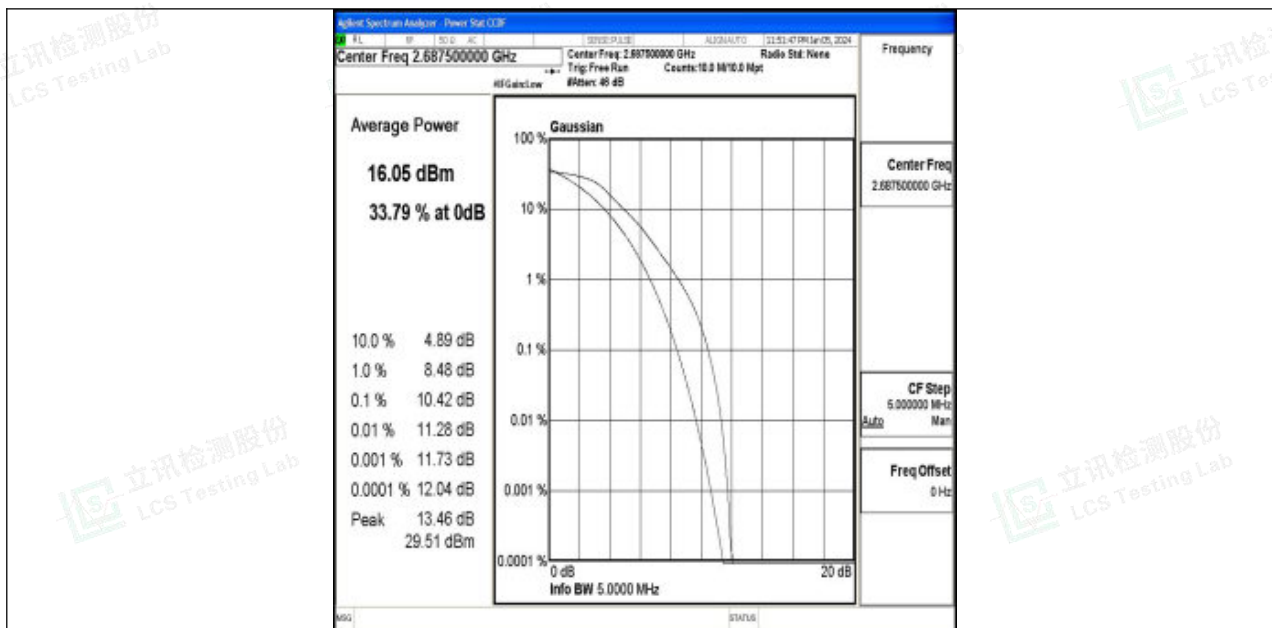

Band41-5MHz-QPSK-41565-25RB#0-PASS

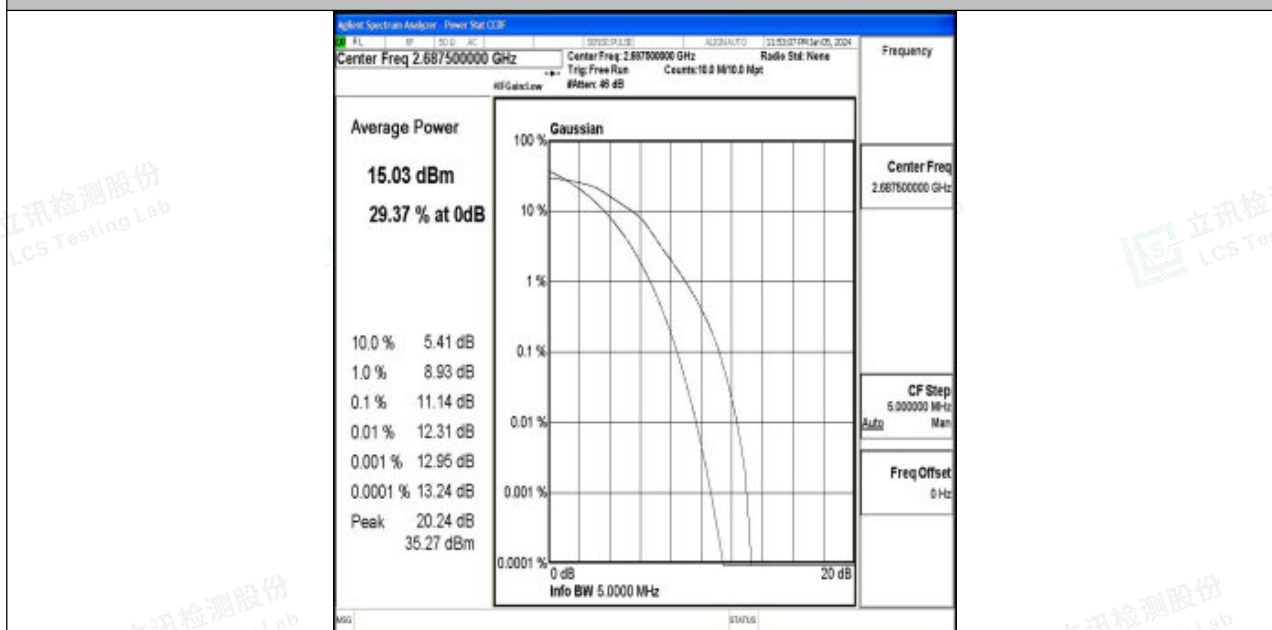

Band41-5MHz-16QAM-41565-25RB#0-PASS




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

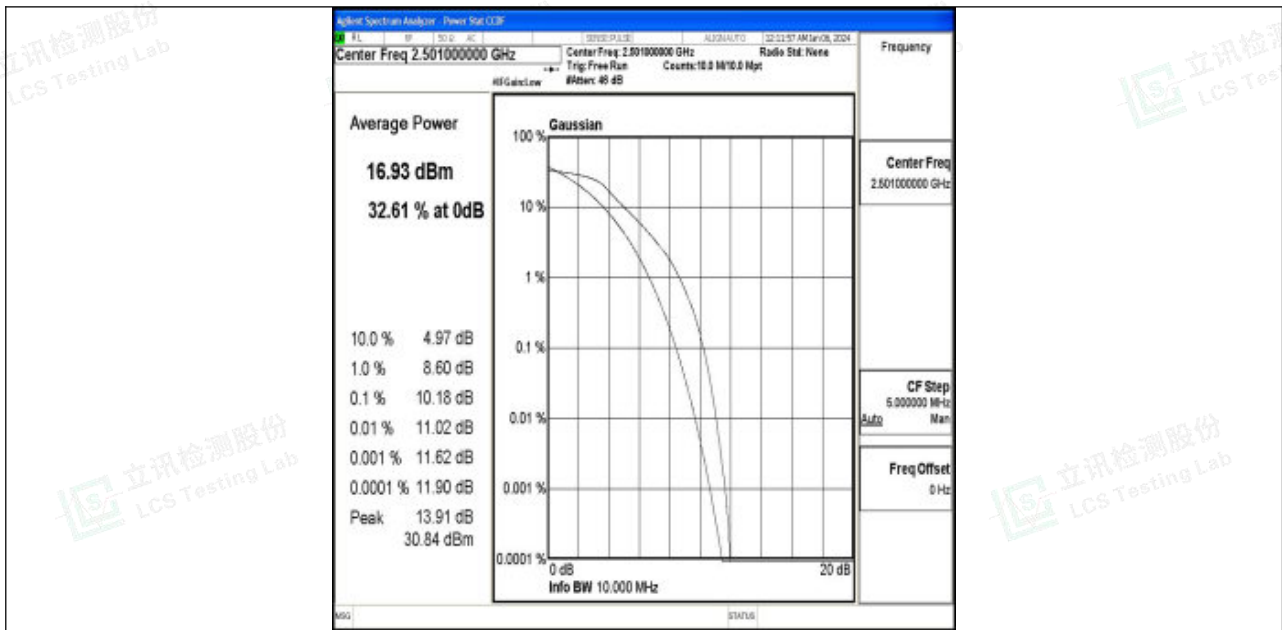

Band41-10MHz-QPSK-39700-50RB#0-PASS

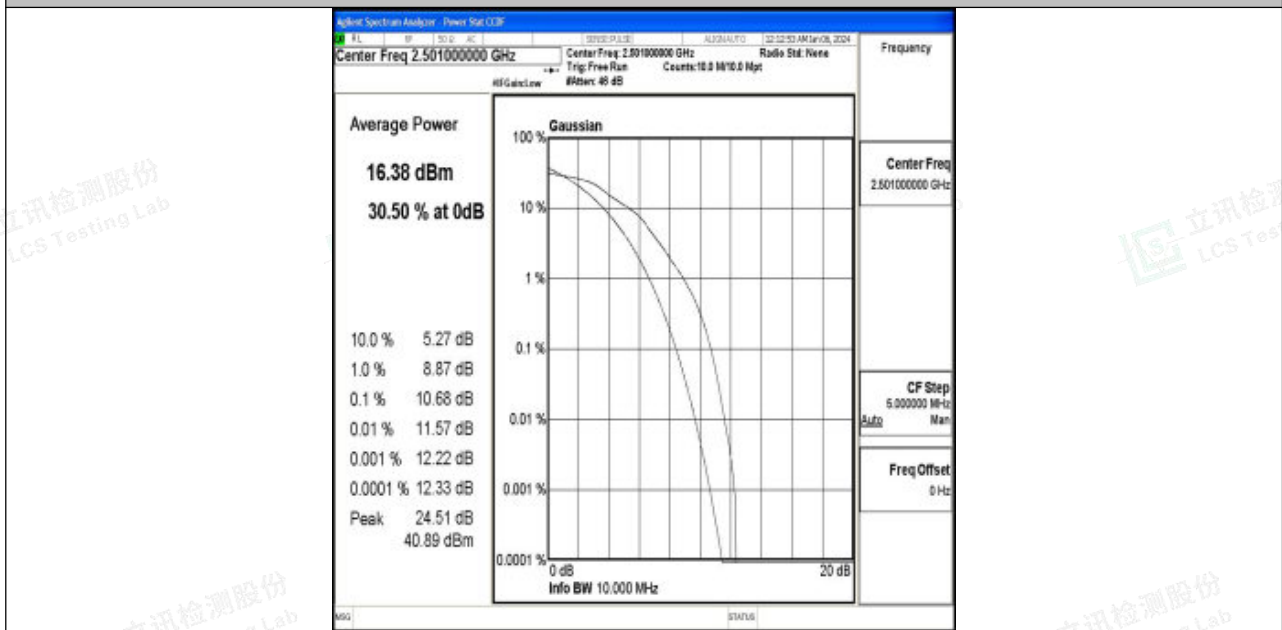

Band41-10MHz-16QAM-39700-50RB#0-PASS




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

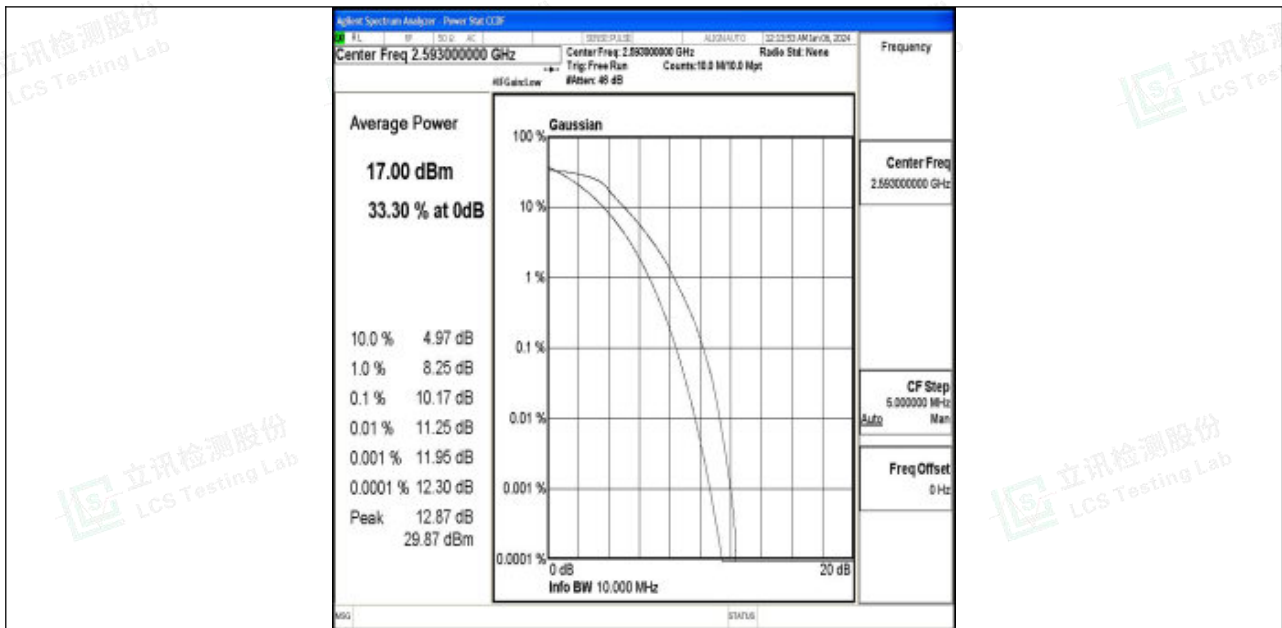

Band41-10MHz-QPSK-40620-50RB#0-PASS

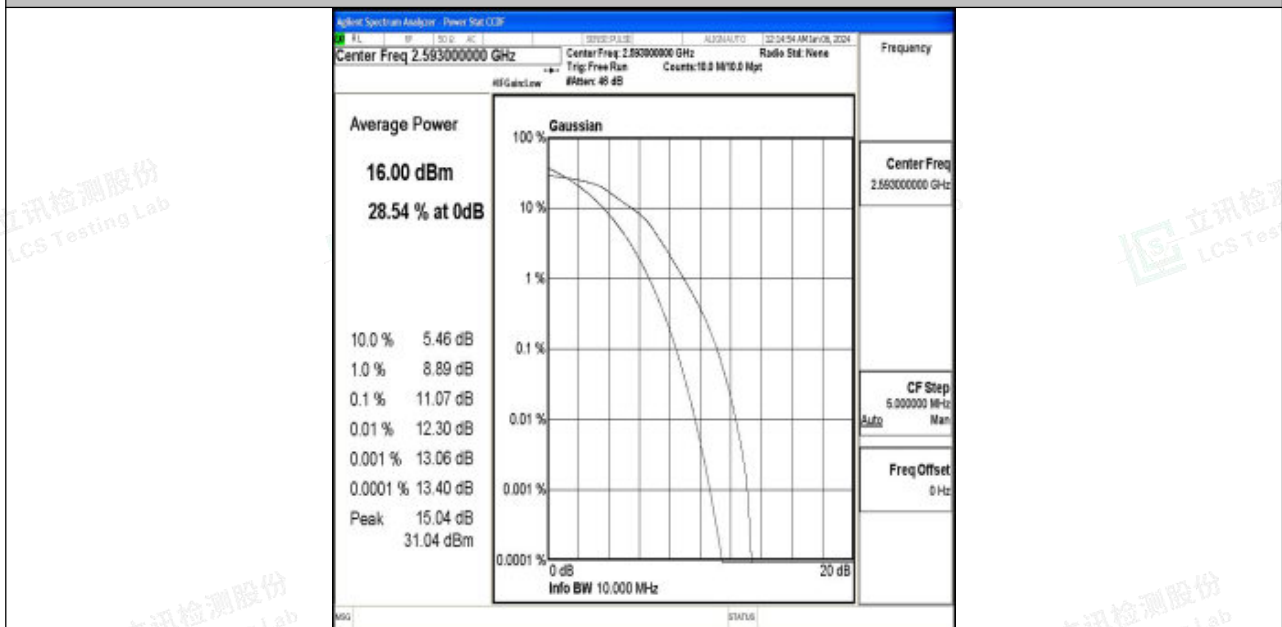

Band41-10MHz-16QAM-40620-50RB#0-PASS




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity


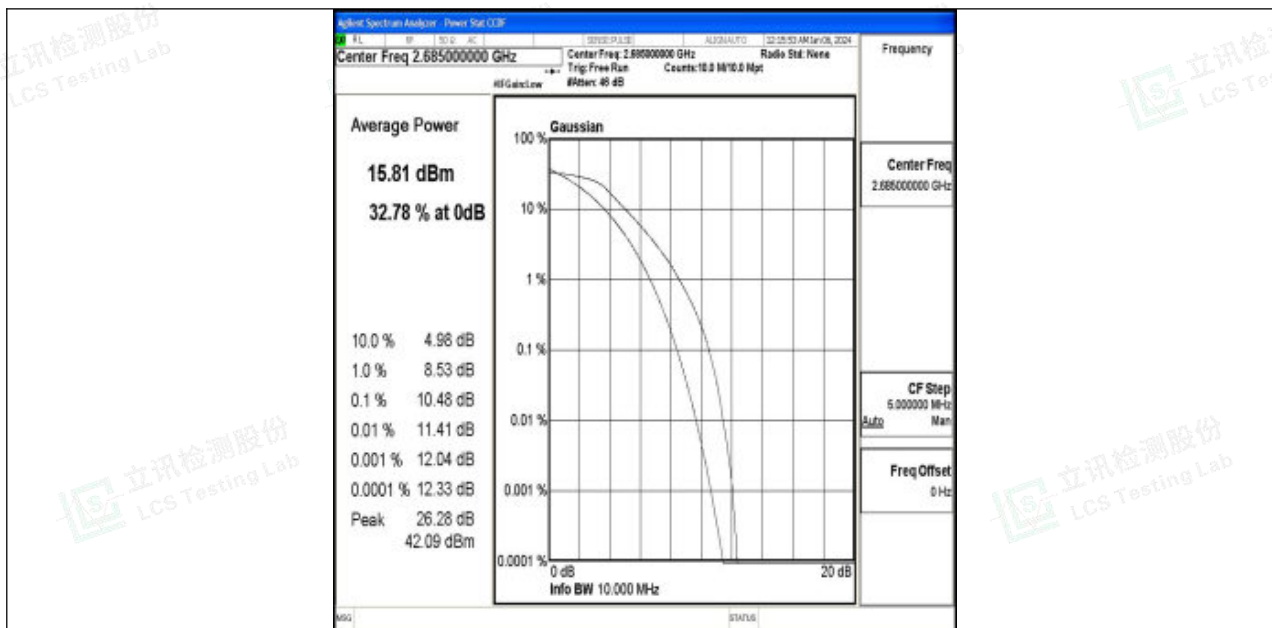


Band41-10MHz-QPSK-41540-50RB#0-PASS

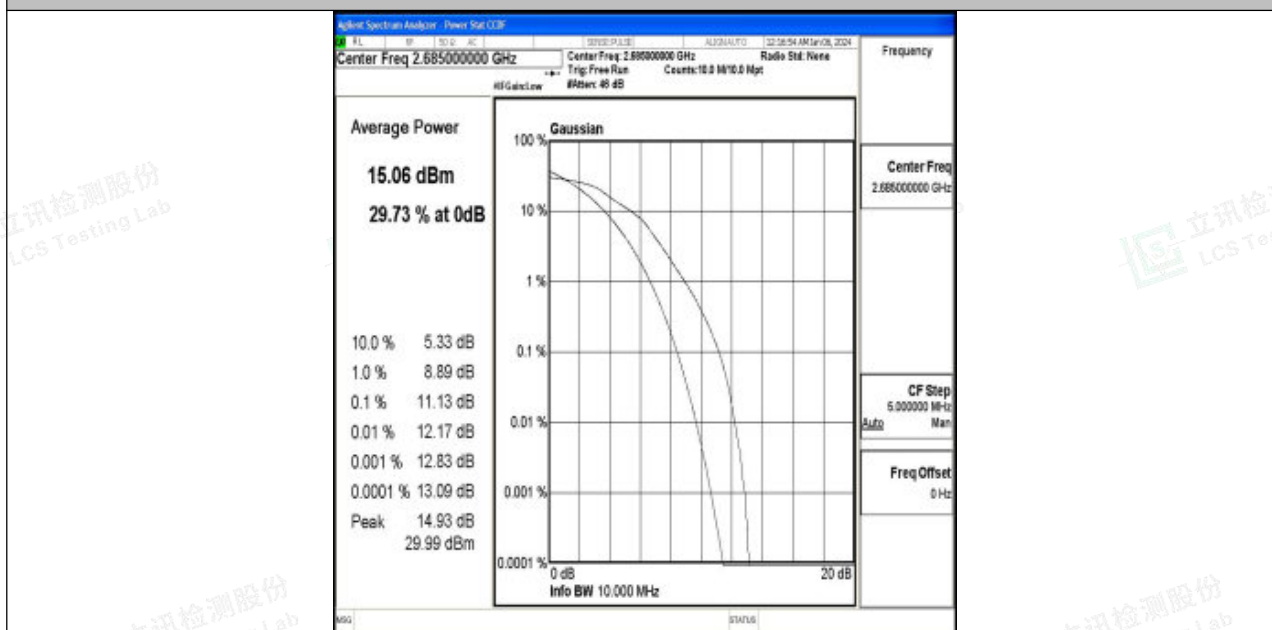

Band41-10MHz-16QAM-41540-50RB#0-PASS



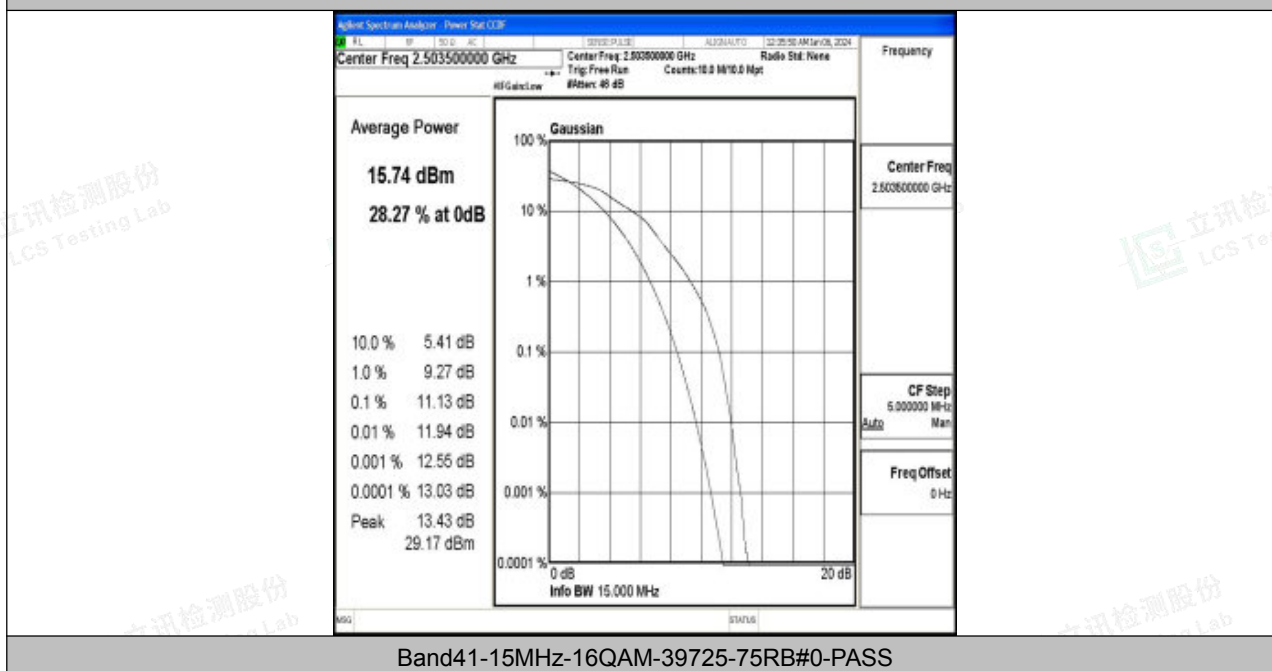
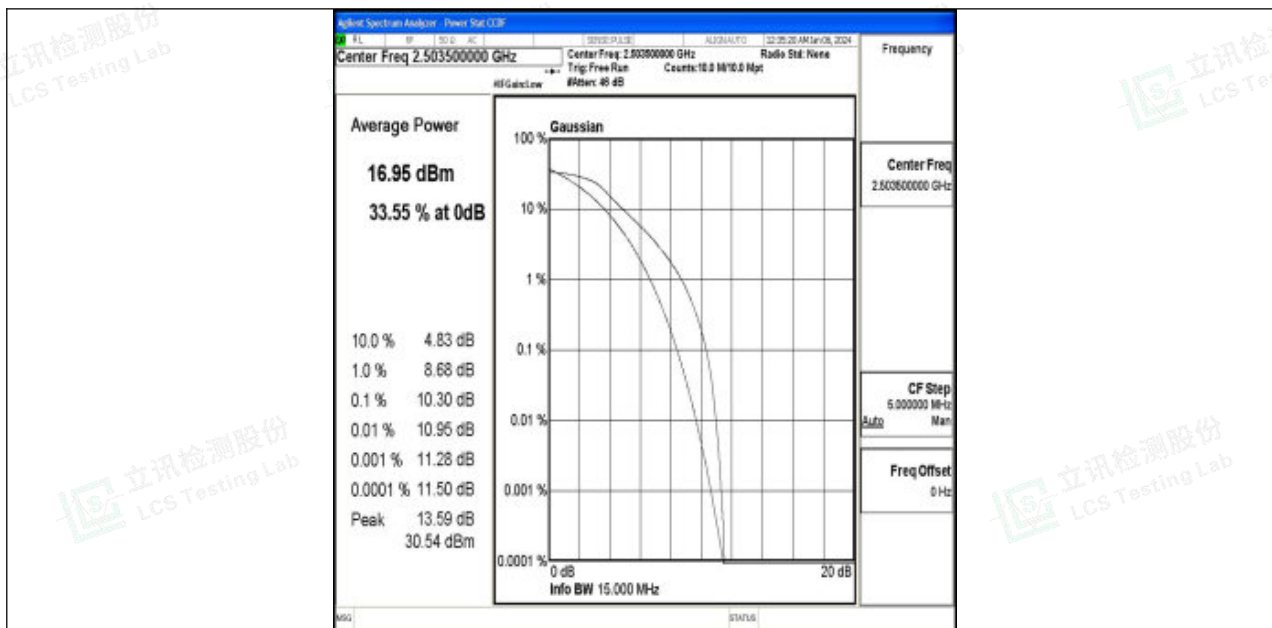


Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

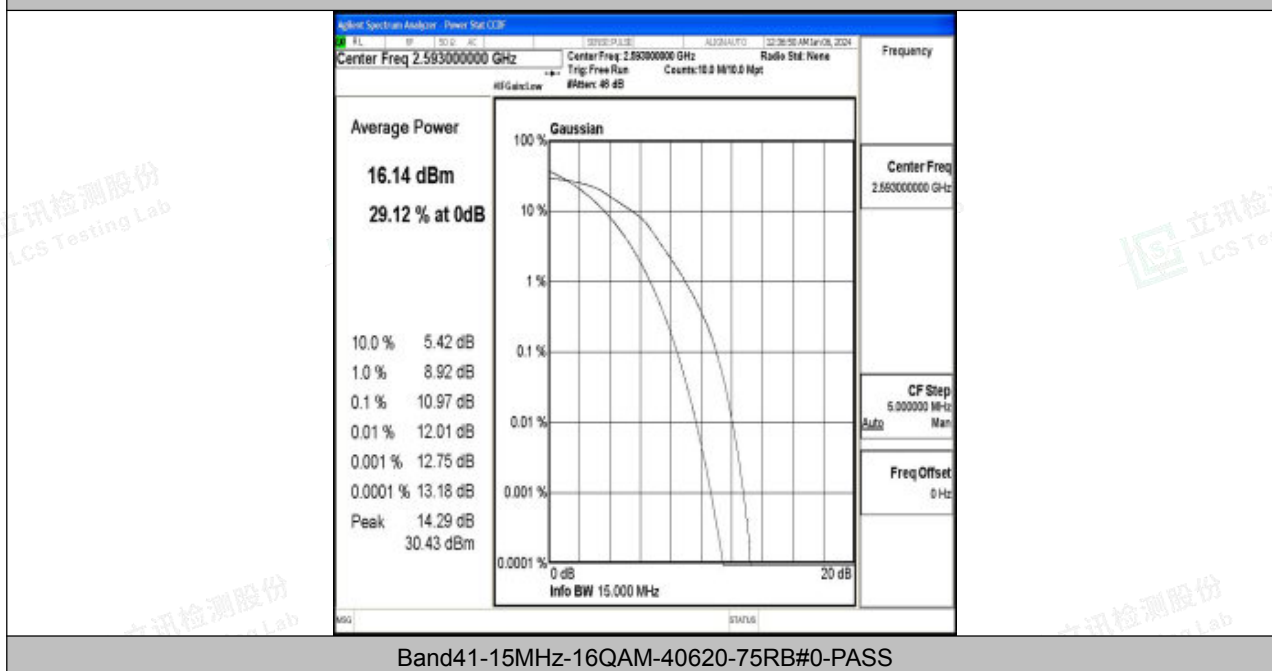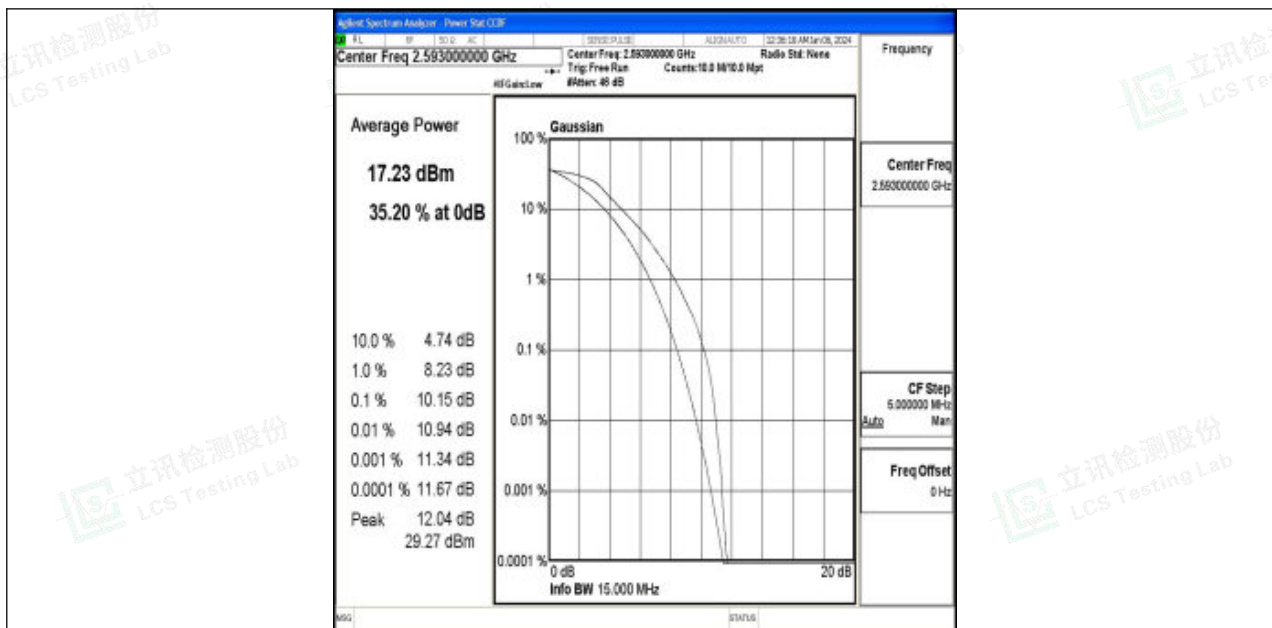


Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

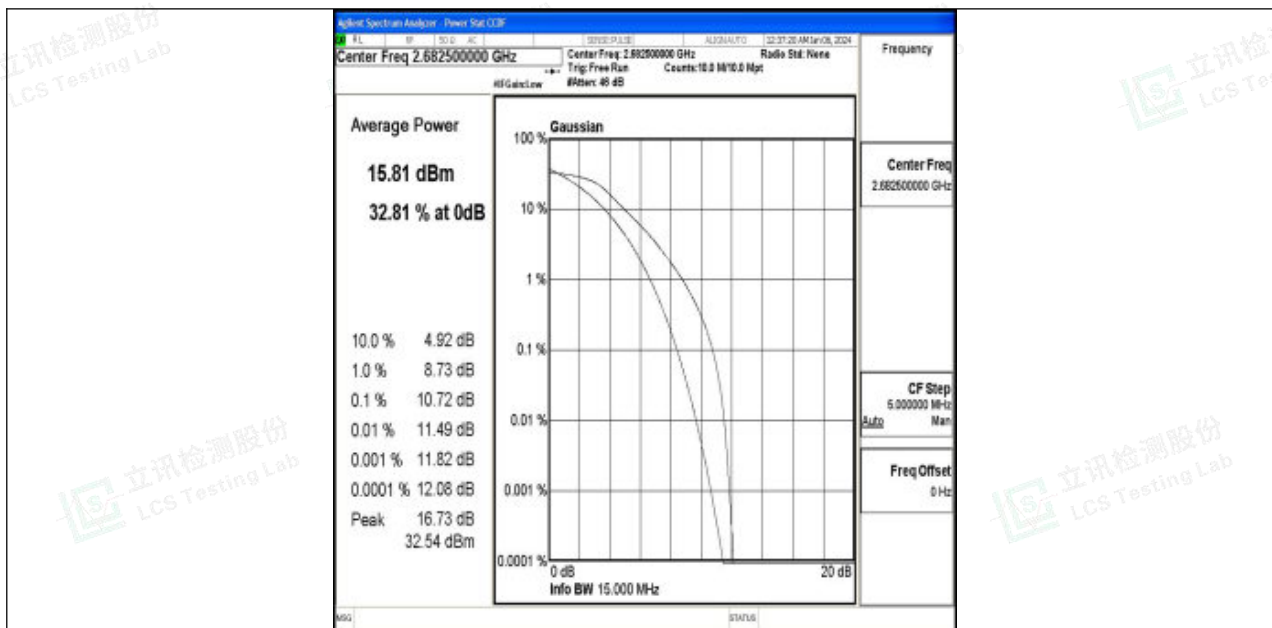

Band41-15MHz-QPSK-41515-75RB#0-PASS

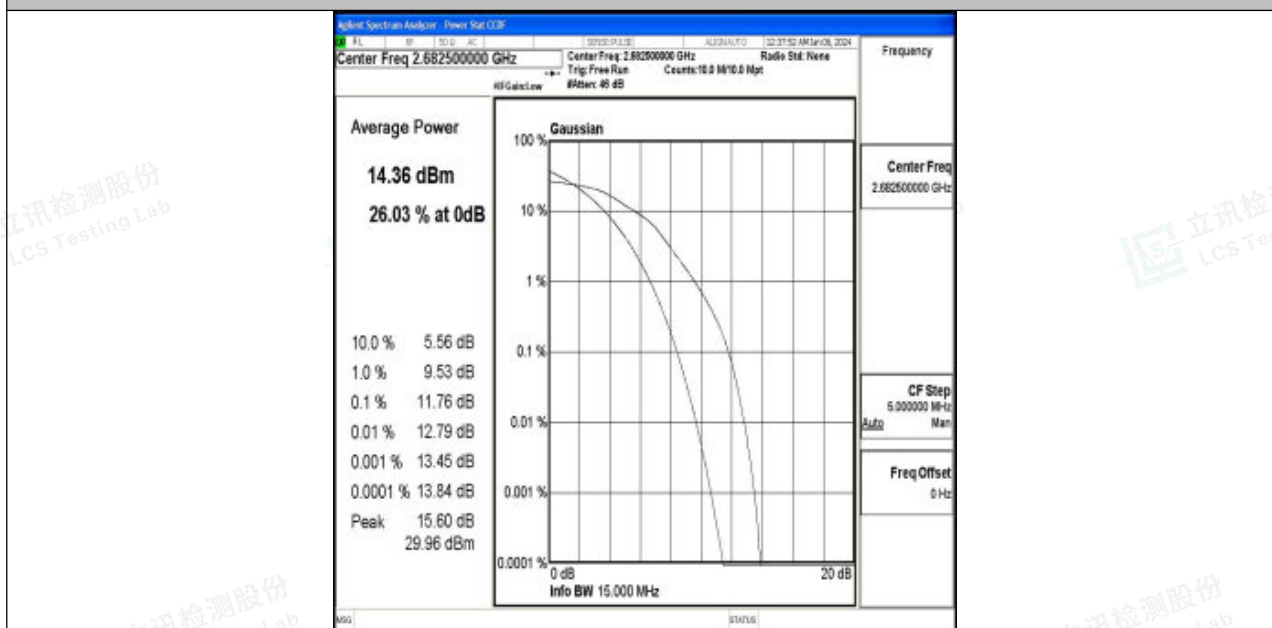

Band41-15MHz-16QAM-41515-75RB#0-PASS




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

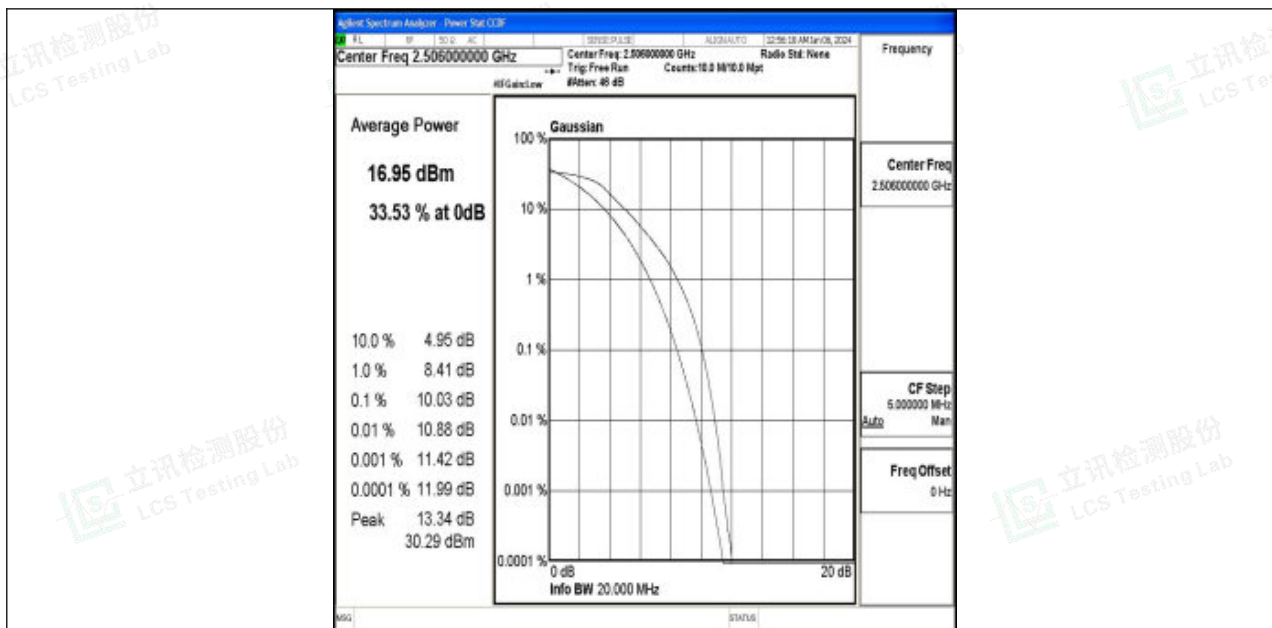

Band41-20MHz-QPSK-39750-100RB#0-PASS

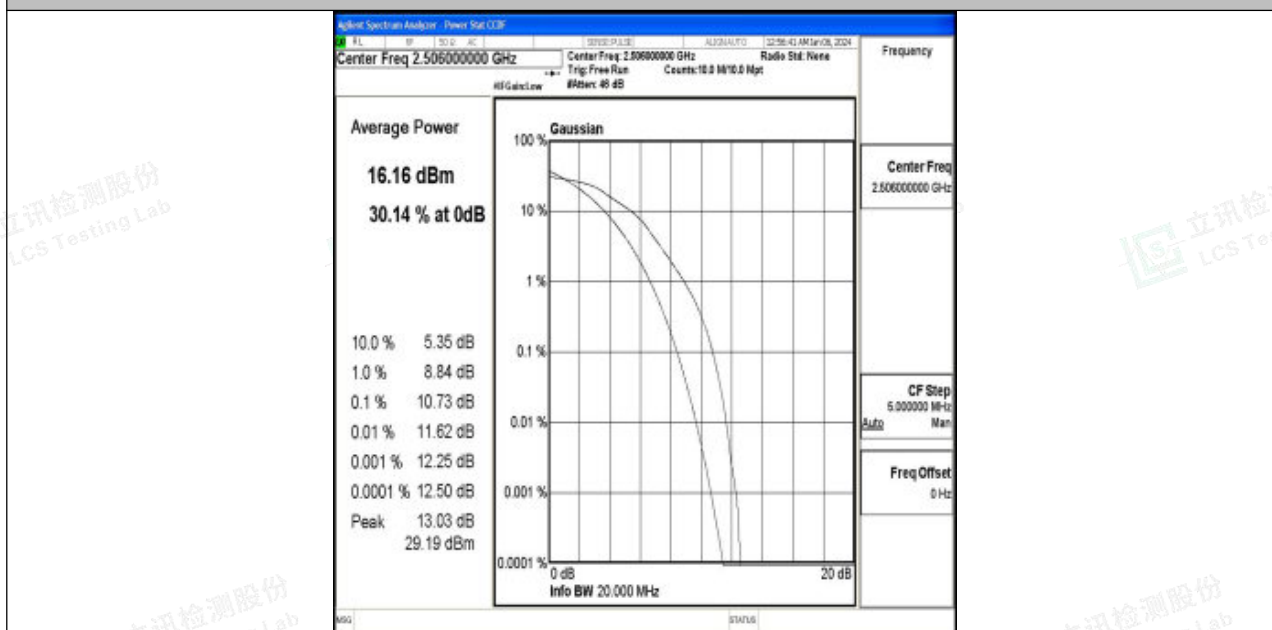

Band41-20MHz-16QAM-39750-100RB#0-PASS




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

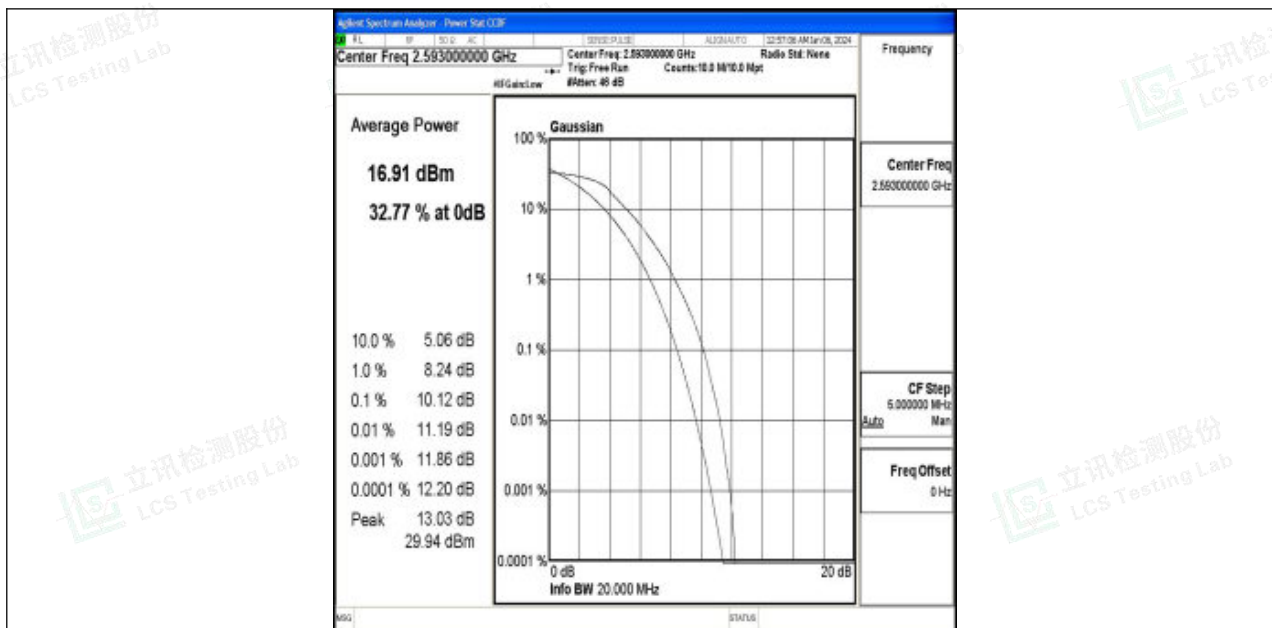

Band41-20MHz-QPSK-40620-100RB#0-PASS

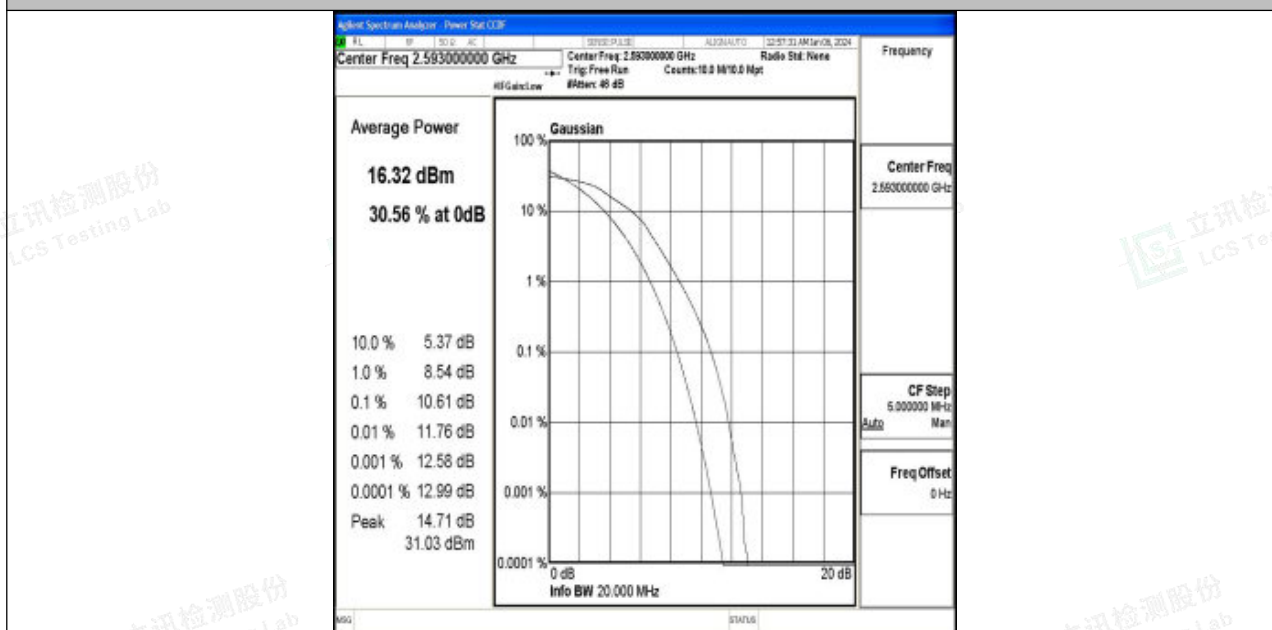

Band41-20MHz-16QAM-40620-100RB#0-PASS




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

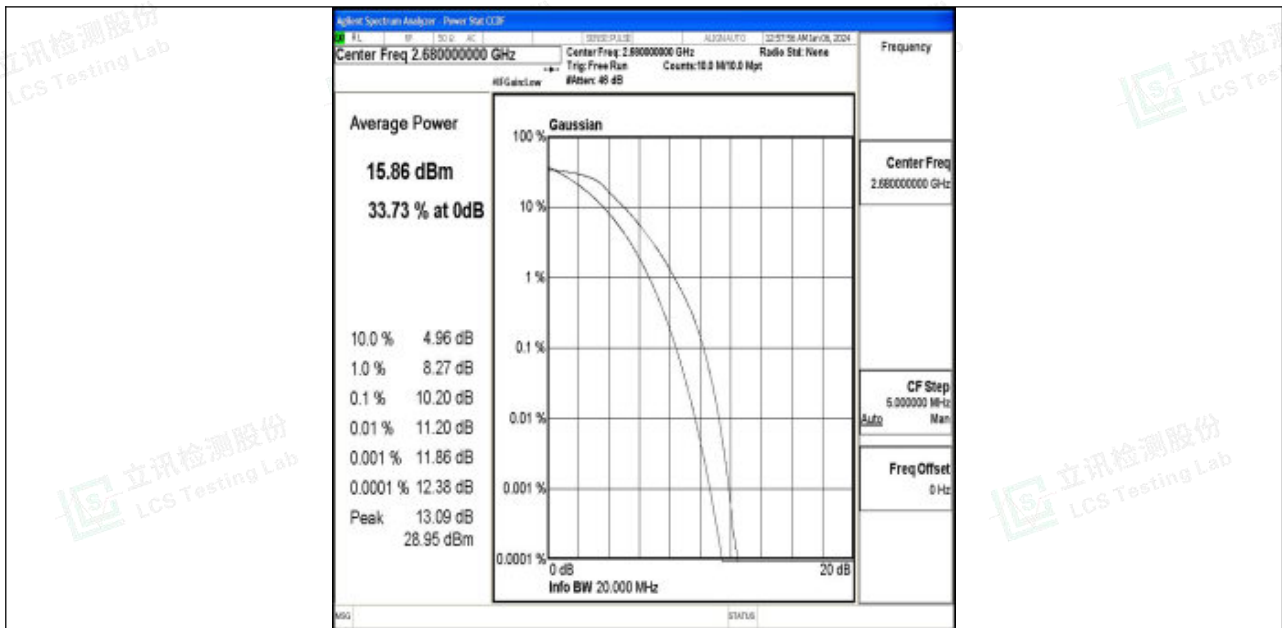

Band41-20MHz-QPSK-41490-100RB#0-PASS

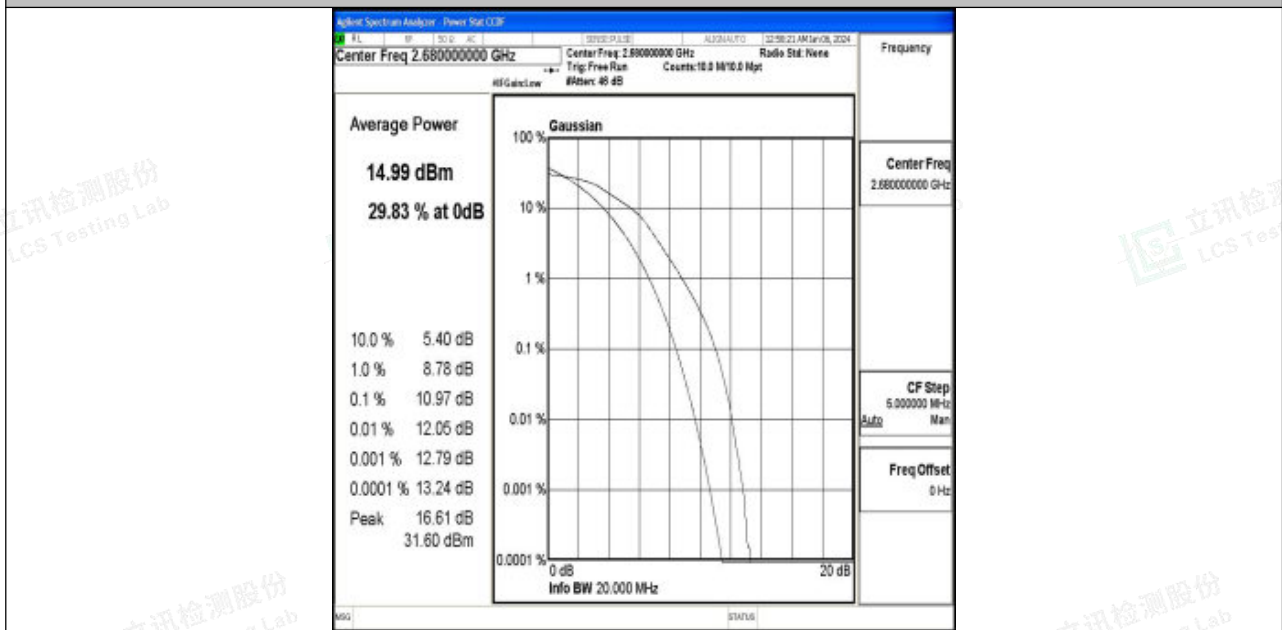

Band41-20MHz-16QAM-41490-100RB#0-PASS



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



M.3 26dB Bandwidth and Occupied Bandwidth


Test Result

Band	Bandwidth	Modulation	Channel	RB Configuration	Occupied Bandwidth (MHz)	26dB Bandwidth (MHz)	Verdict
Band41	5MHz	QPSK	39675	25RB#0	4.5139	5.776	PASS
Band41	10MHz	16QAM	41540	50RB#0	9.0427	15.28	PASS
Band41	15MHz	QPSK	39725	75RB#0	13.537	15.94	PASS
Band41	15MHz	16QAM	39725	75RB#0	13.554	19.10	PASS
Band41	15MHz	QPSK	40620	75RB#0	13.553	15.04	PASS
Band41	15MHz	16QAM	40620	75RB#0	13.545	16.44	PASS
Band41	15MHz	QPSK	41515	75RB#0	13.509	15.97	PASS
Band41	15MHz	16QAM	41515	75RB#0	13.556	15.50	PASS
Band41	20MHz	QPSK	39750	100RB#0	18.001	22.51	PASS
Band41	20MHz	16QAM	39750	100RB#0	18.040	24.81	PASS
Band41	20MHz	QPSK	40620	100RB#0	17.983	19.99	PASS
Band41	20MHz	16QAM	40620	100RB#0	18.006	20.39	PASS
Band41	20MHz	QPSK	41490	100RB#0	18.002	21.25	PASS
Band41	20MHz	16QAM	41490	100RB#0	17.981	28.56	PASS
Band41	5MHz	16QAM	39675	25RB#0	4.5111	6.231	PASS
Band41	5MHz	QPSK	40620	25RB#0	4.5143	5.415	PASS
Band41	5MHz	16QAM	40620	25RB#0	4.5103	5.152	PASS
Band41	5MHz	QPSK	41565	25RB#0	4.5257	5.753	PASS
Band41	5MHz	16QAM	41565	25RB#0	4.5185	6.440	PASS
Band41	10MHz	QPSK	39700	50RB#0	9.0376	13.36	PASS
Band41	10MHz	16QAM	39700	50RB#0	9.0099	10.26	PASS
Band41	10MHz	QPSK	40620	50RB#0	9.0493	10.16	PASS
Band41	10MHz	16QAM	40620	50RB#0	9.0043	10.62	PASS
Band41	10MHz	QPSK	41540	50RB#0	9.0264	12.59	PASS





Test Graphs

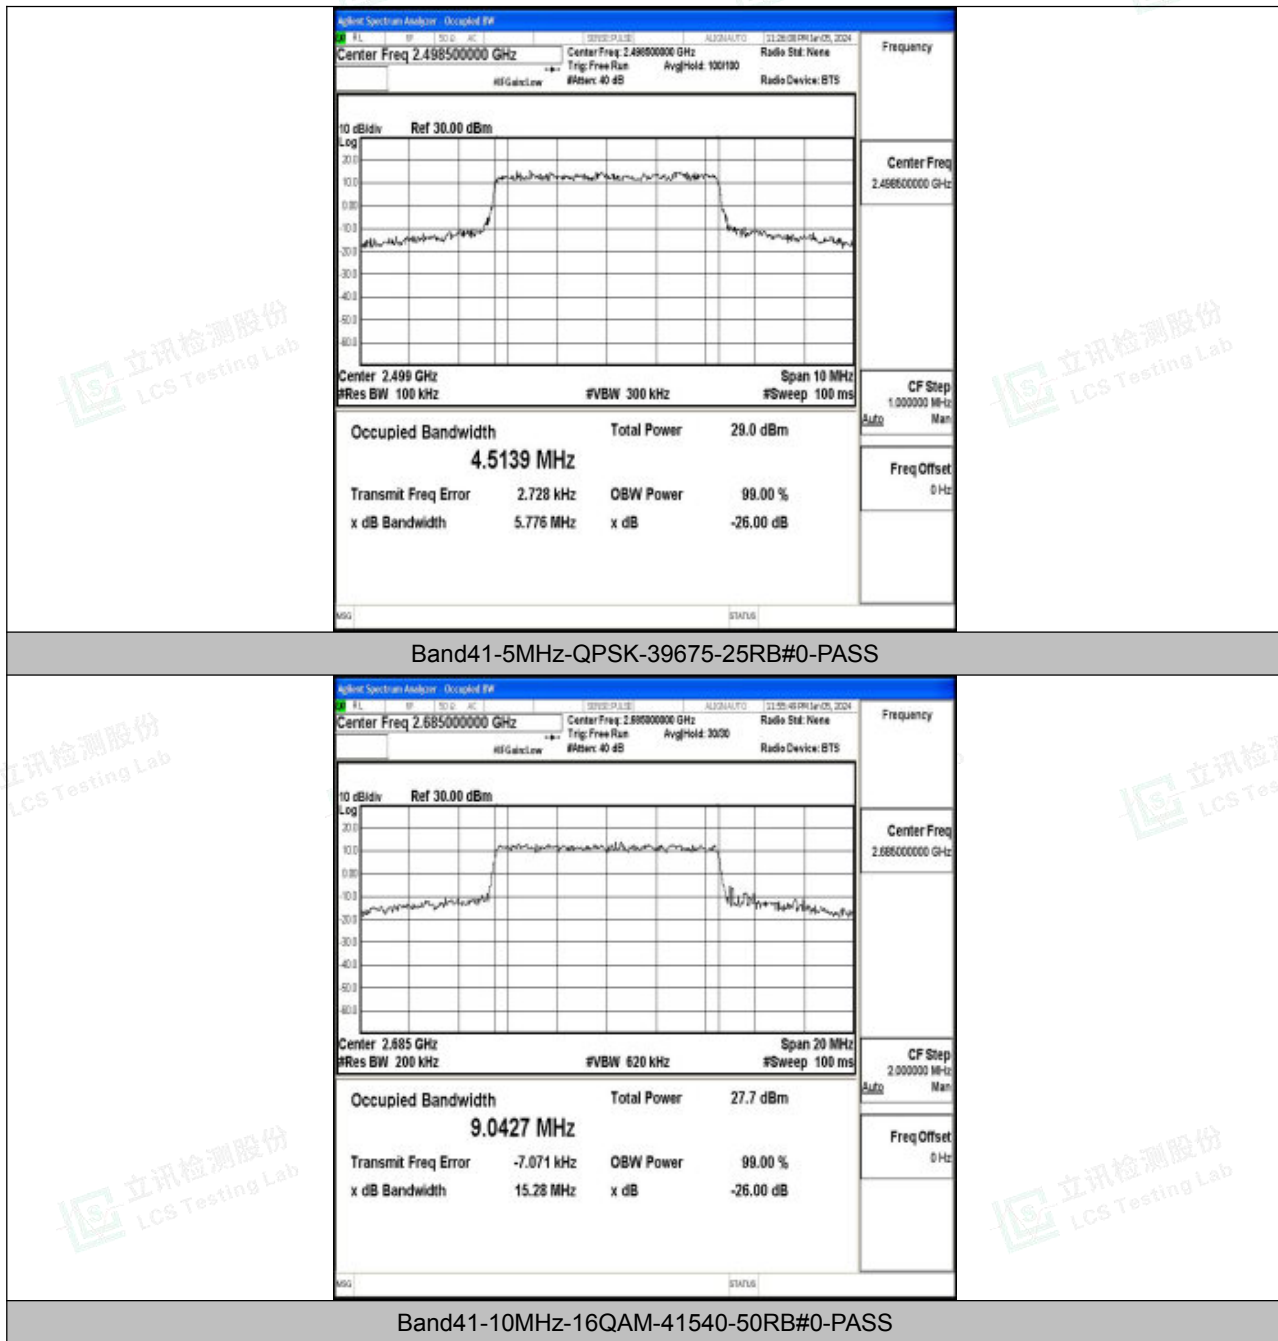


Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

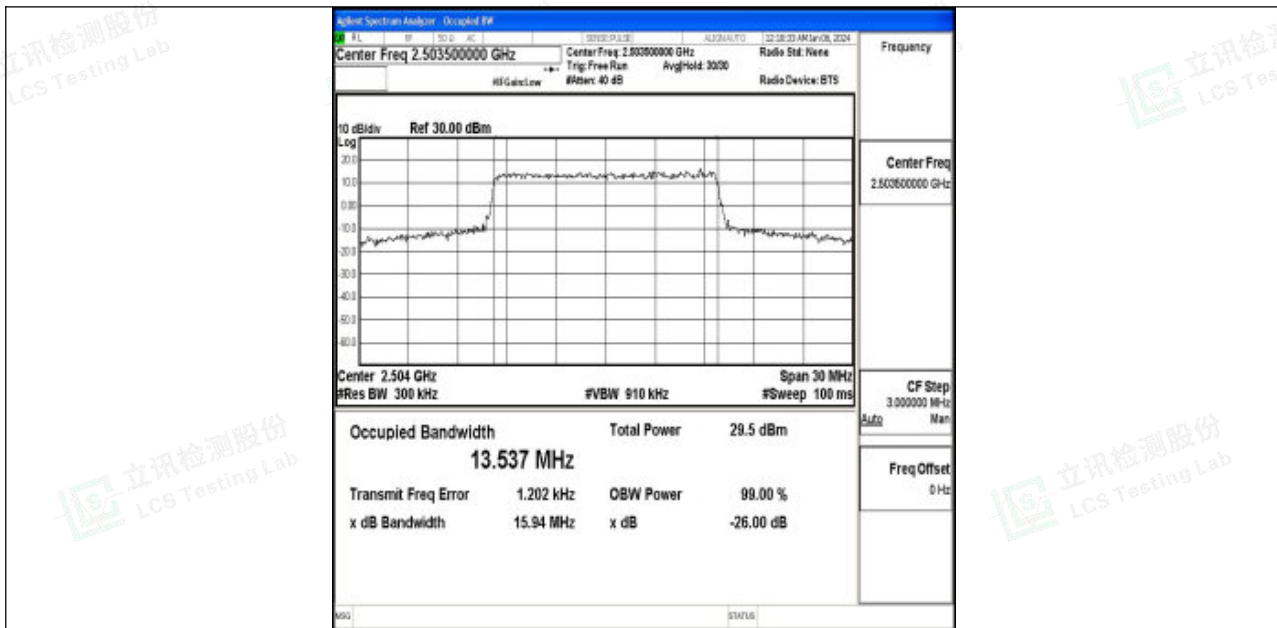

Band41-15MHz-QPSK-39725-75RB#0-PASS

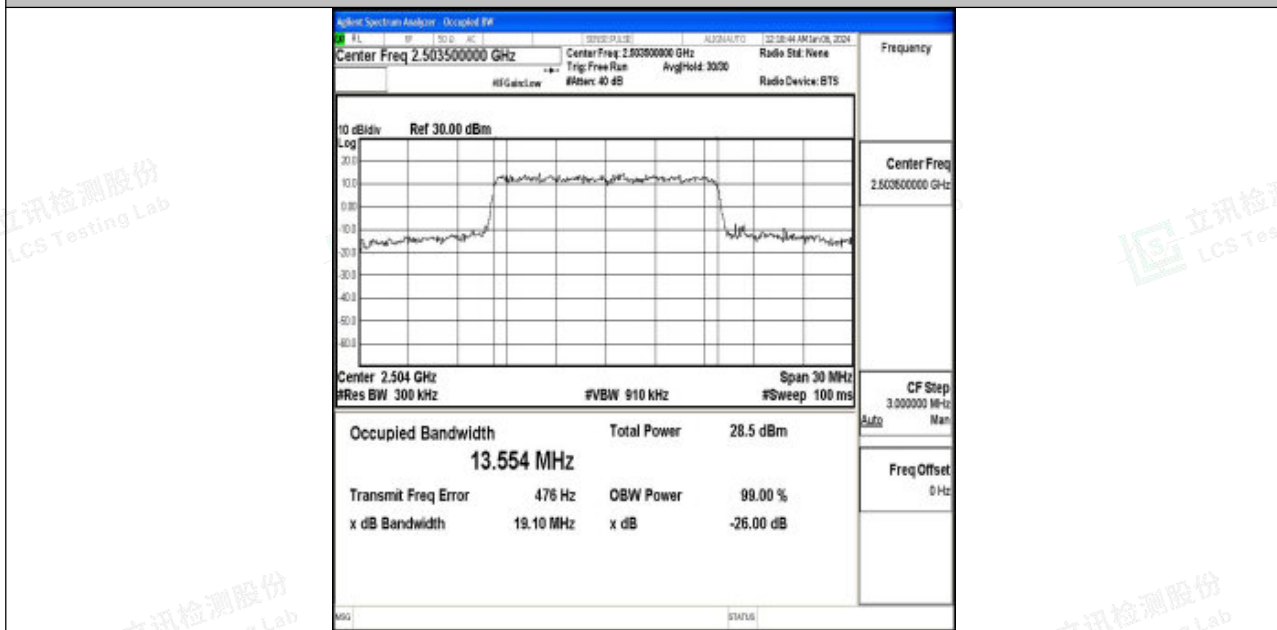

Band41-15MHz-16QAM-39725-75RB#0-PASS





Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

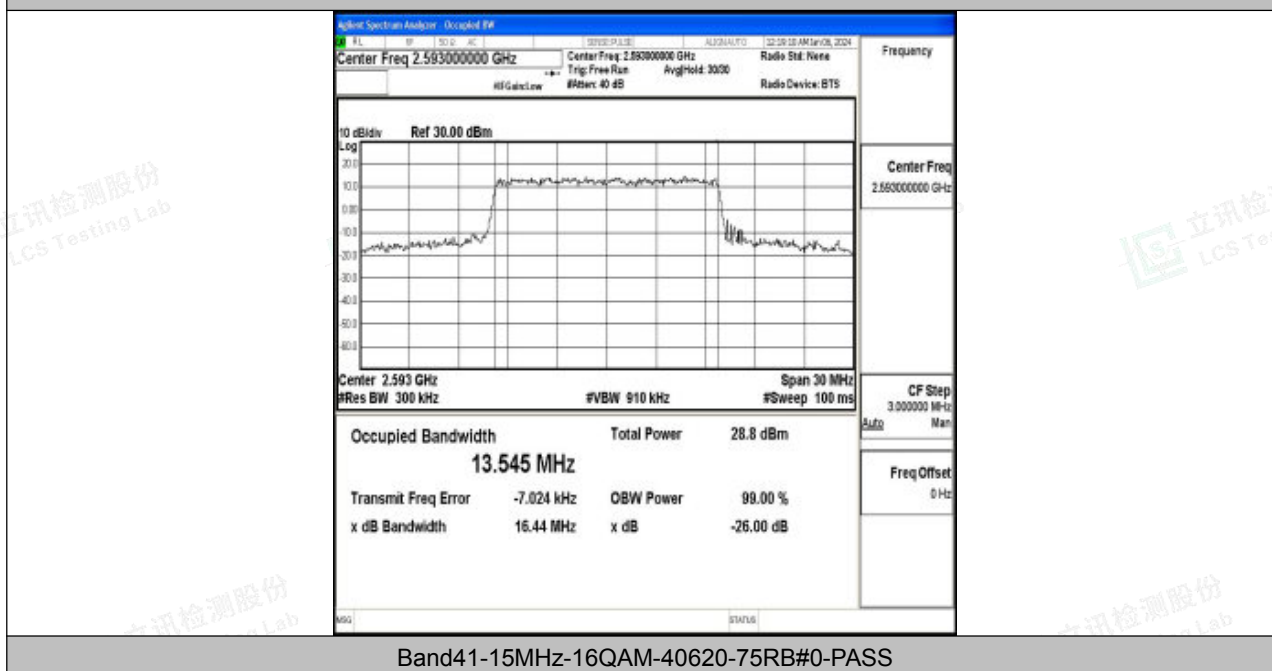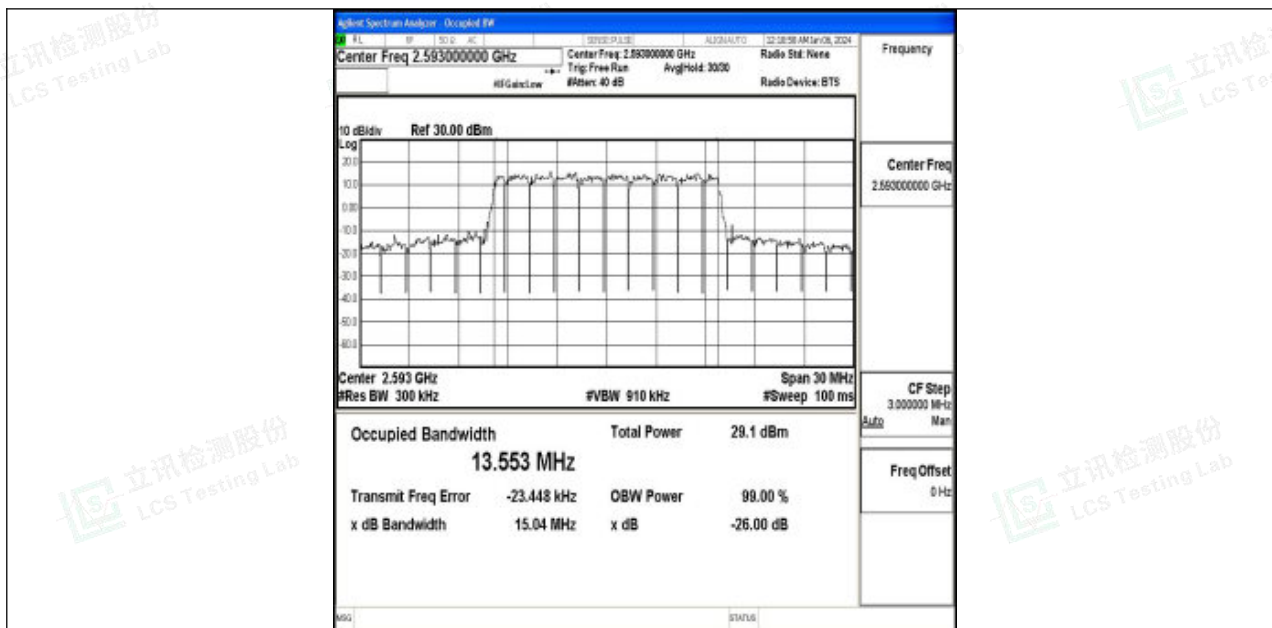


Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

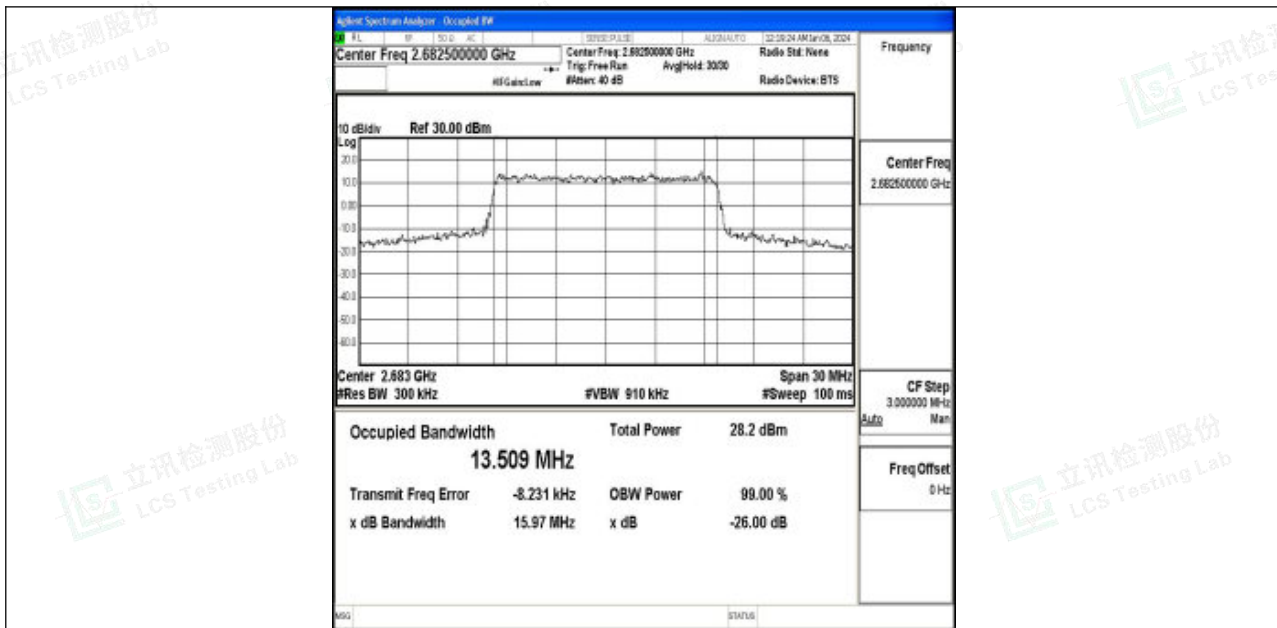

Band41-15MHz-QPSK-41515-75RB#0-PASS

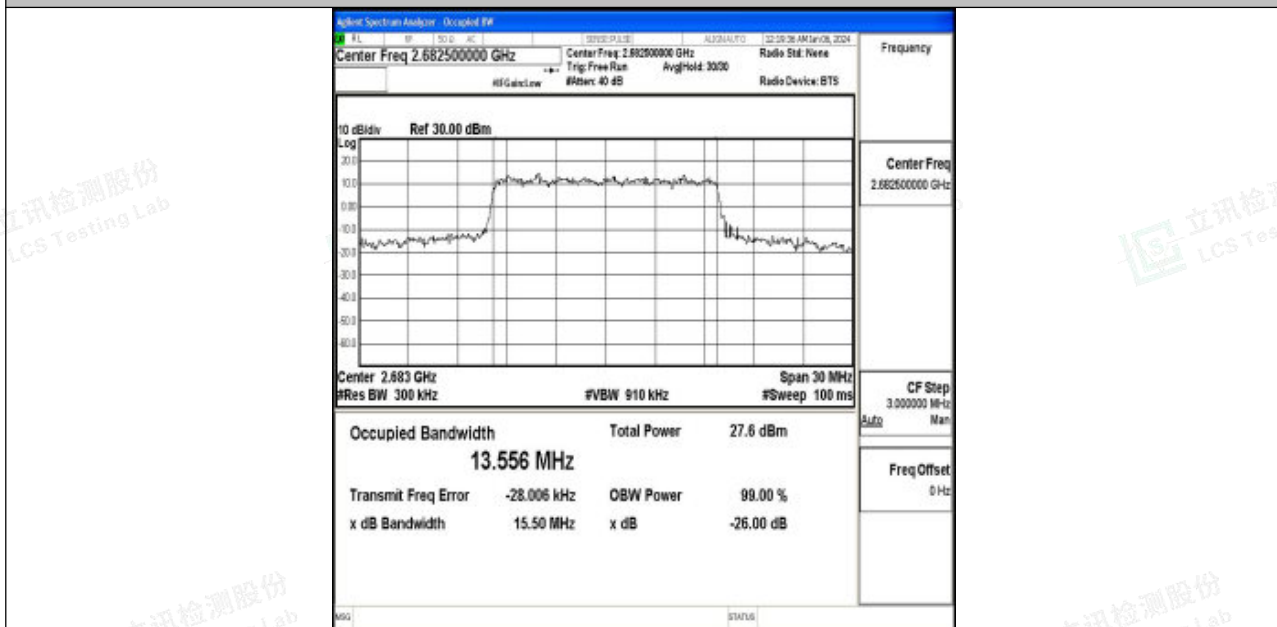

Band41-15MHz-16QAM-41515-75RB#0-PASS




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

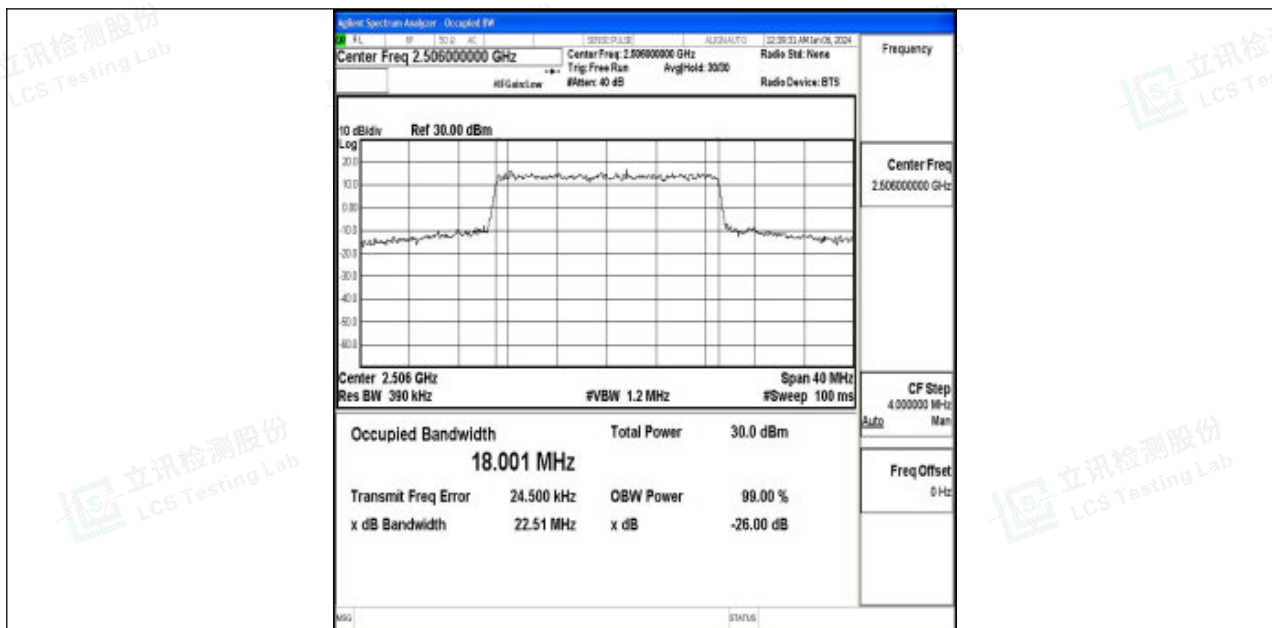

Band41-20MHz-QPSK-39750-100RB#0-PASS

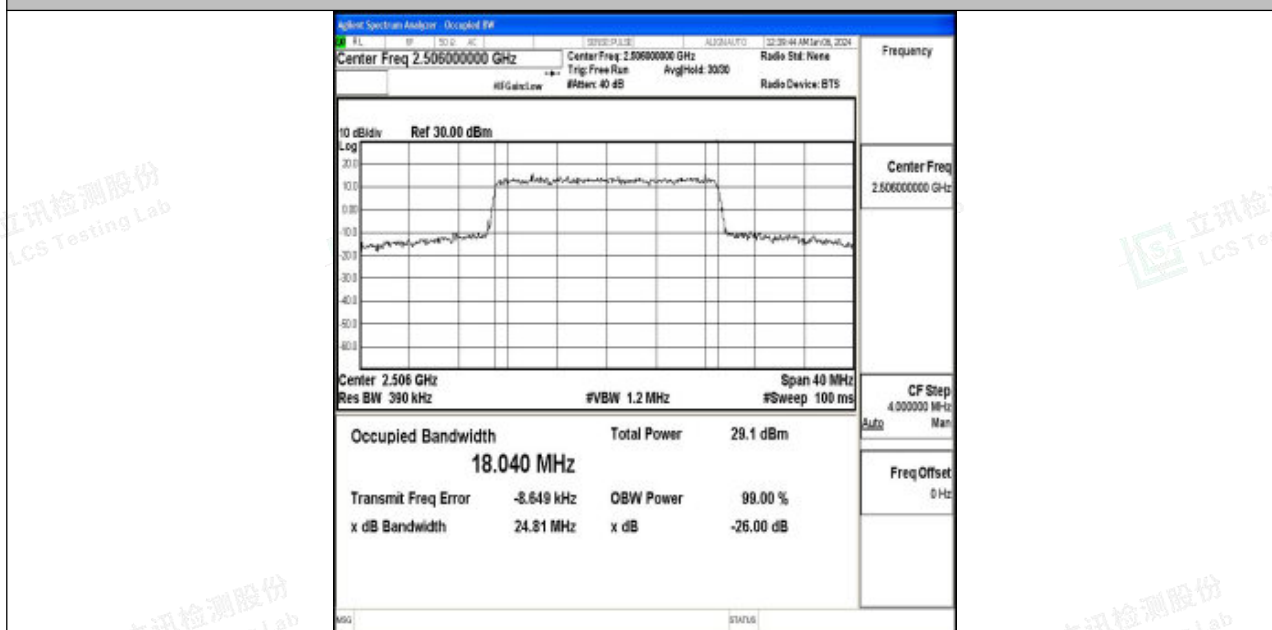

Band41-20MHz-16QAM-39750-100RB#0-PASS




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

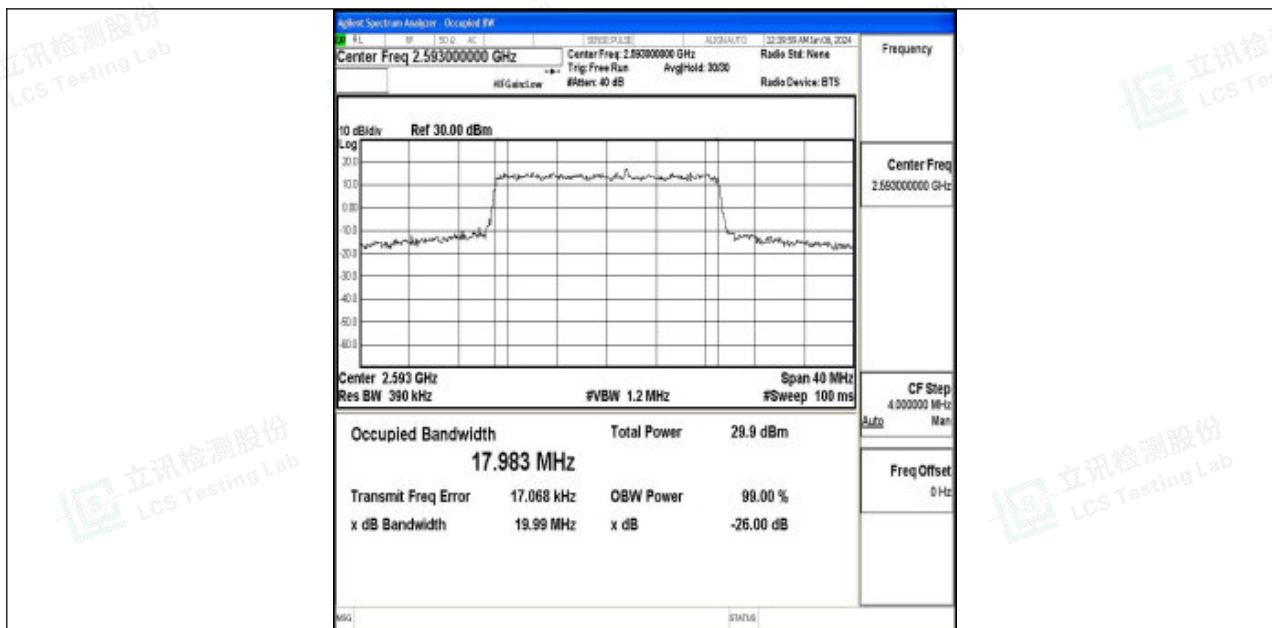

Band41-20MHz-QPSK-40620-100RB#0-PASS

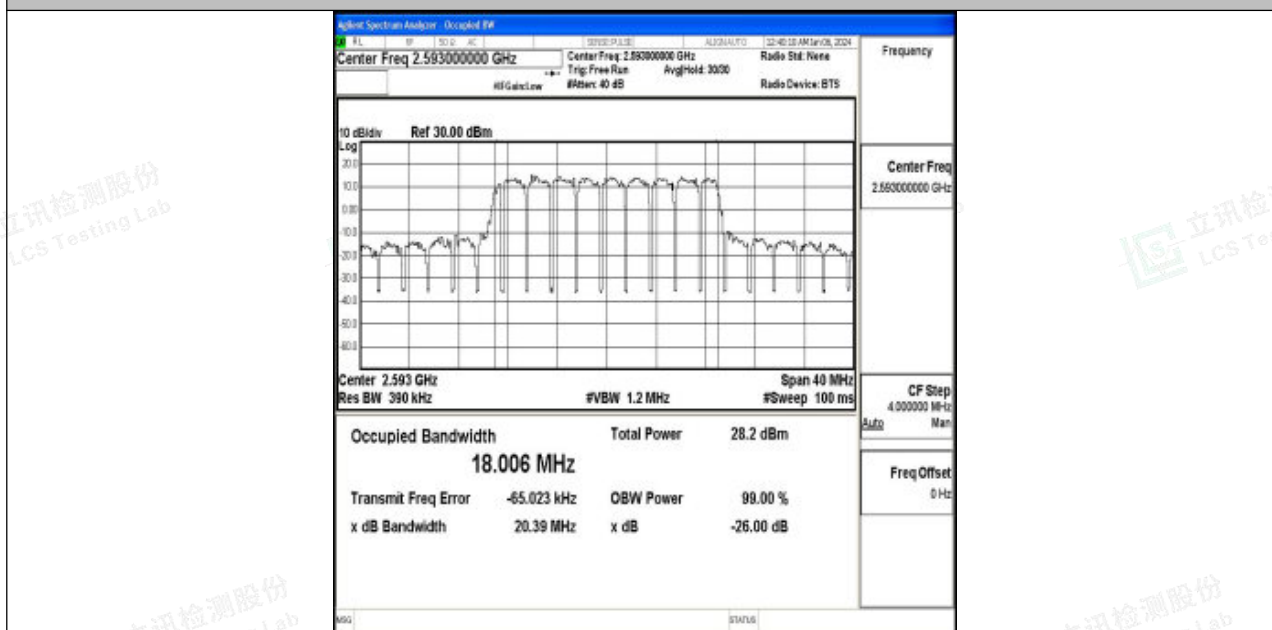

Band41-20MHz-16QAM-40620-100RB#0-PASS




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

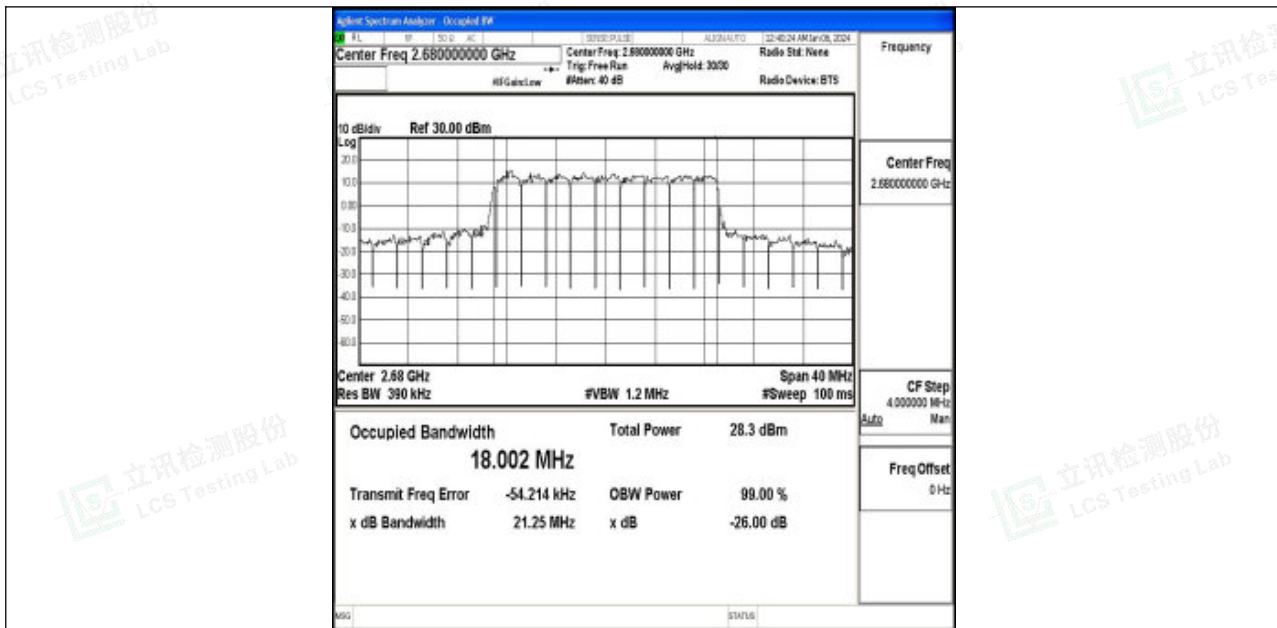

Band41-20MHz-QPSK-41490-100RB#0-PASS

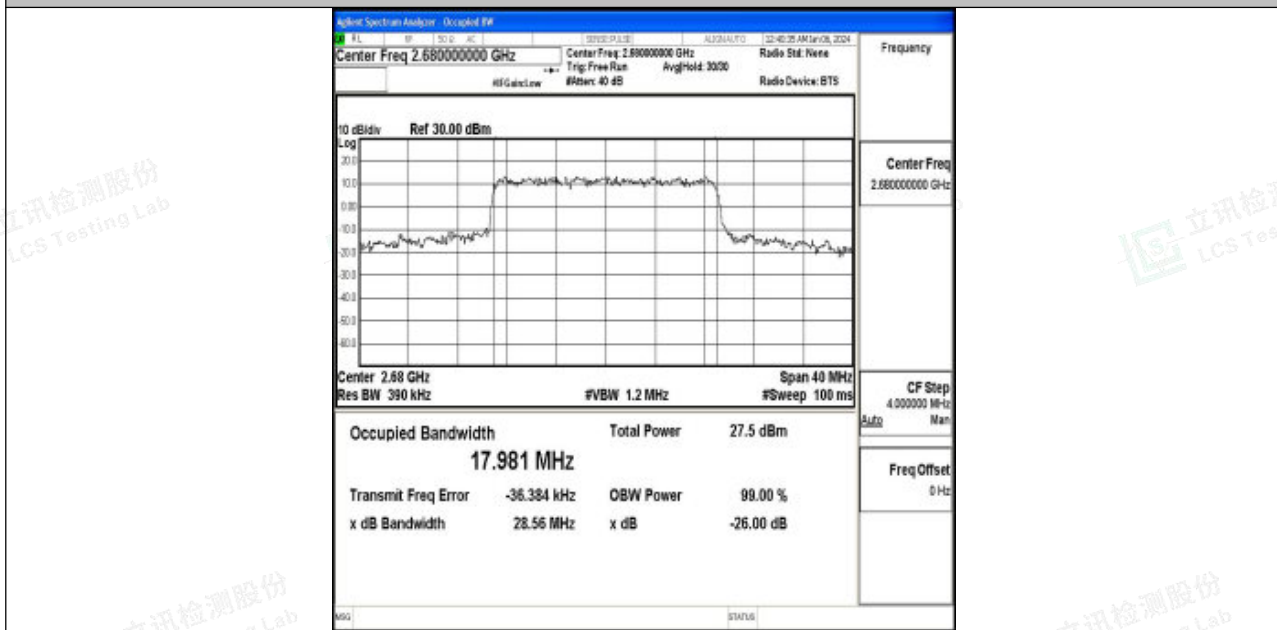

Band41-20MHz-16QAM-41490-100RB#0-PASS




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

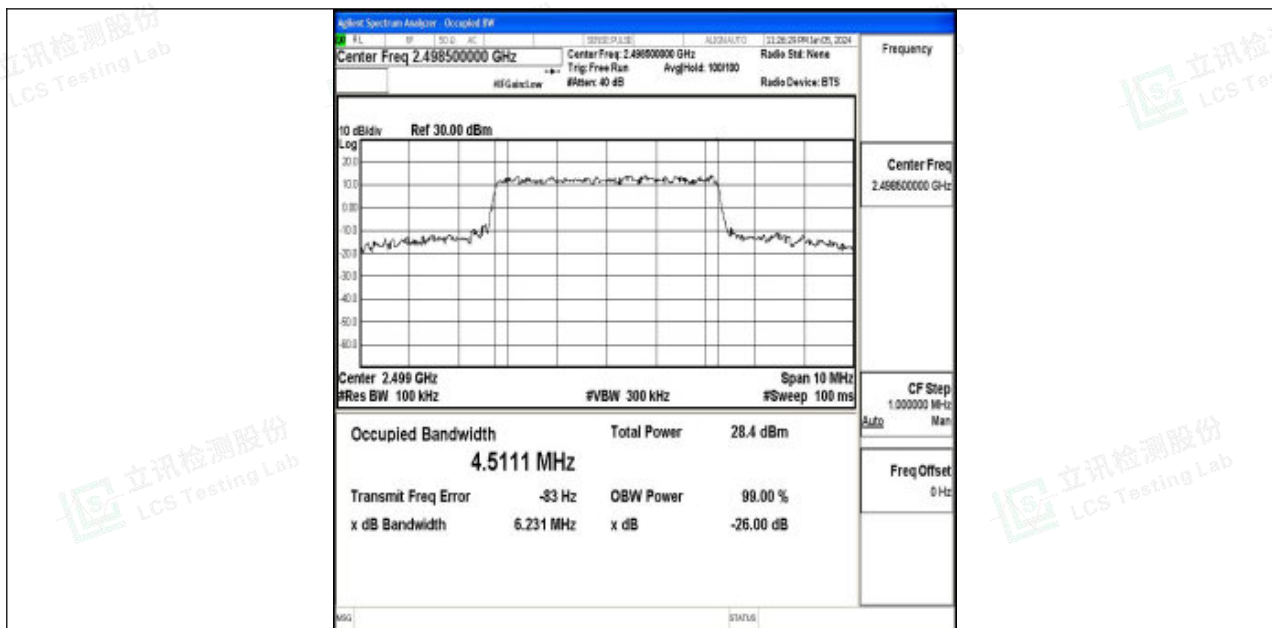

Band41-5MHz-16QAM-39675-25RB#0-PASS

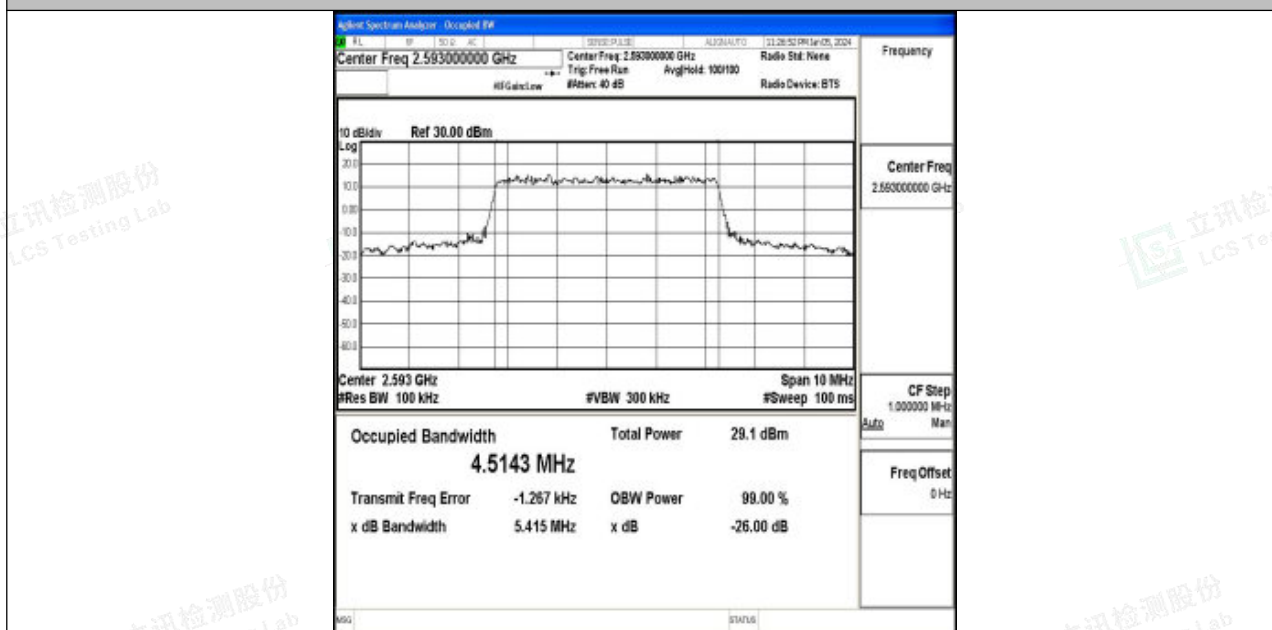

Band41-5MHz-QPSK-40620-25RB#0-PASS




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

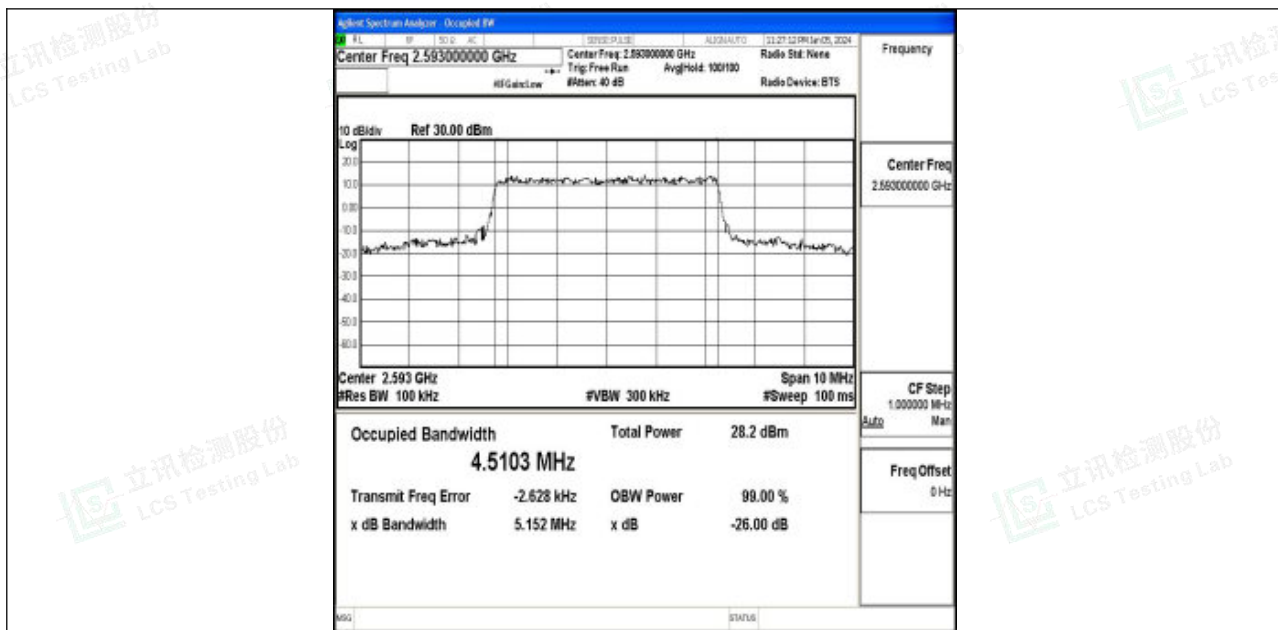

Band41-5MHz-16QAM-40620-25RB#0-PASS

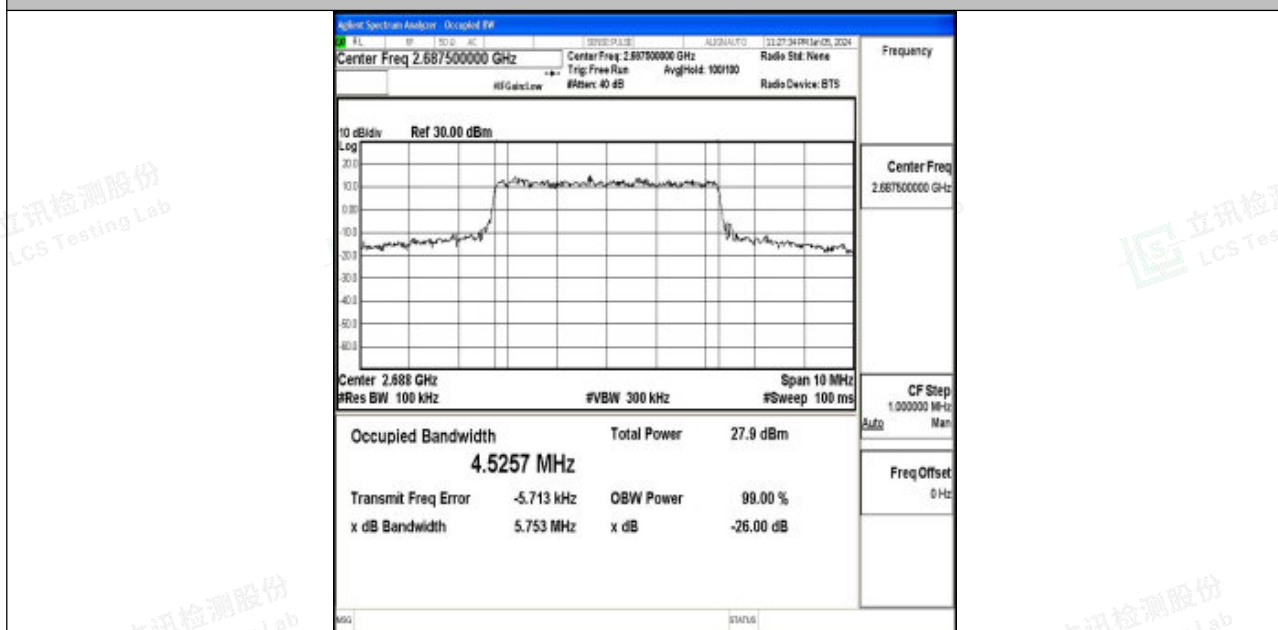

Band41-5MHz-QPSK-41565-25RB#0-PASS




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

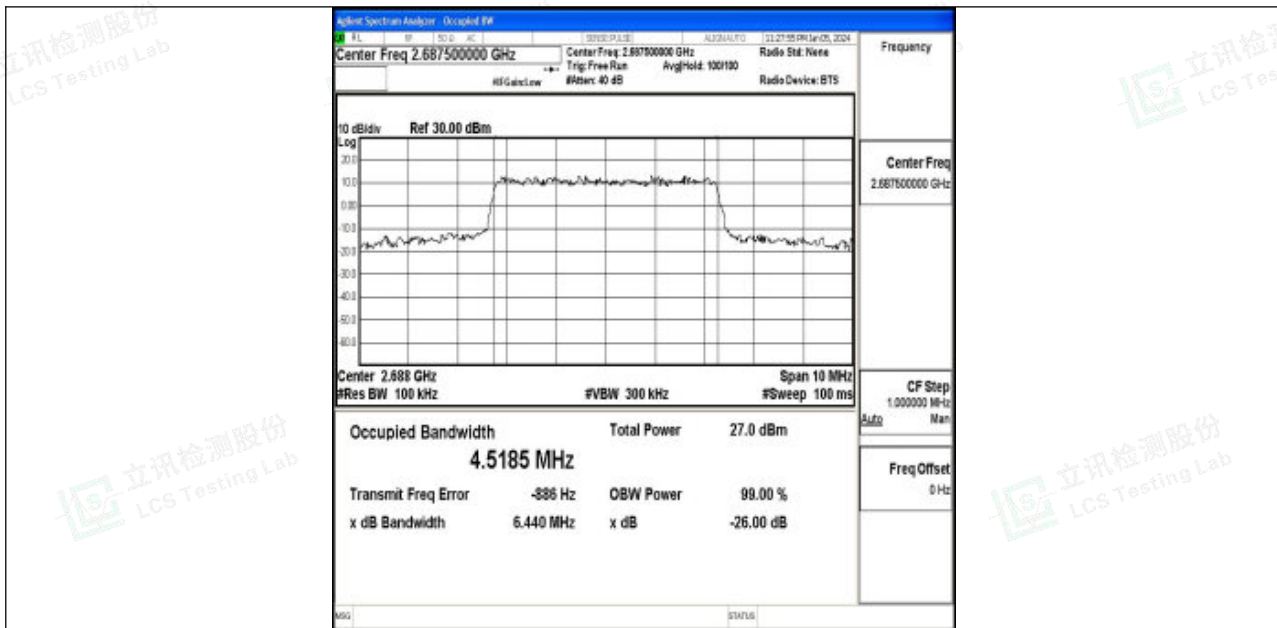

Band41-5MHz-16QAM-41565-25RB#0-PASS

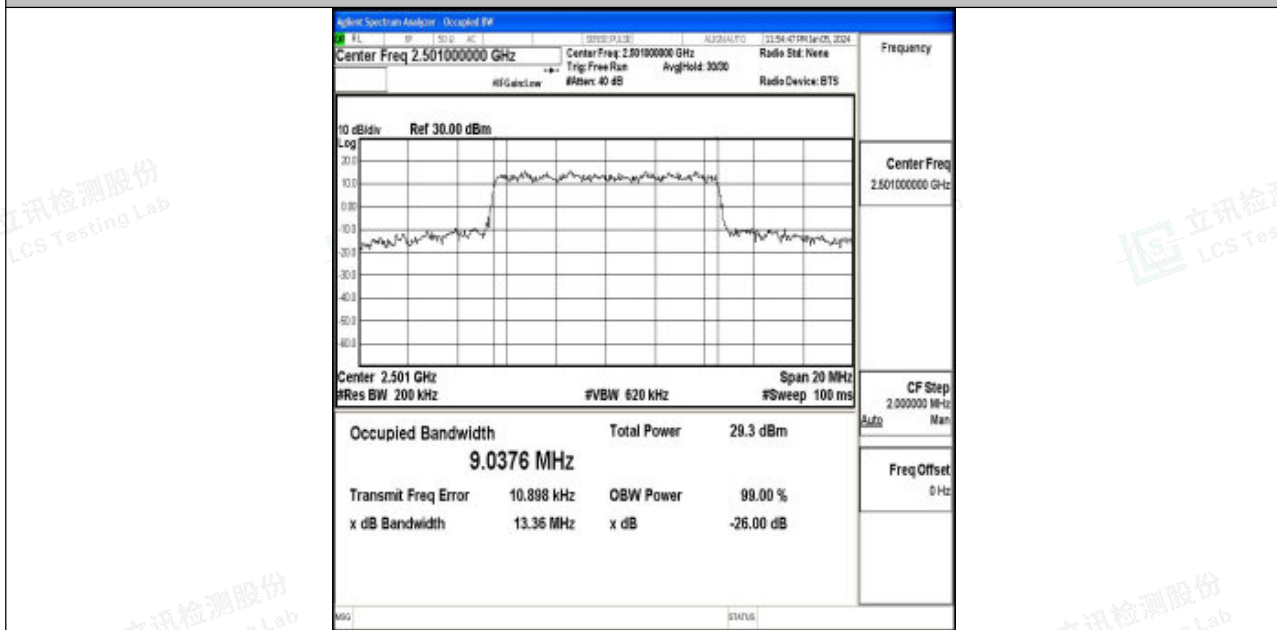

Band41-10MHz-QPSK-39700-50RB#0-PASS




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

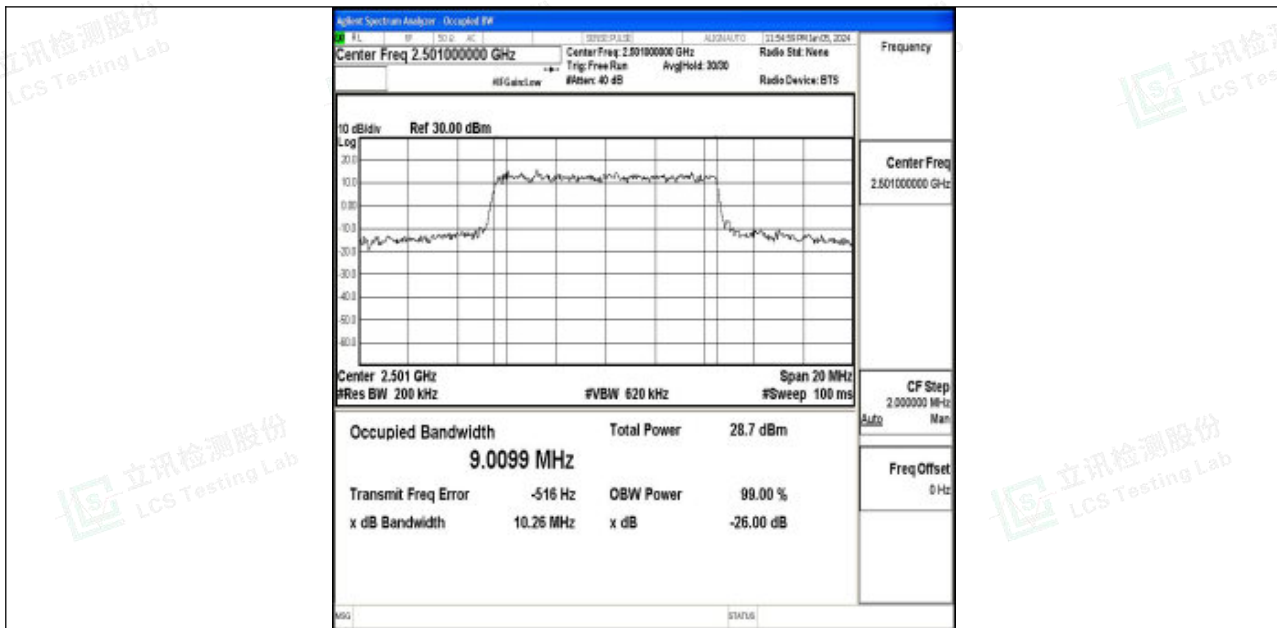

Band41-10MHz-16QAM-39700-50RB#0-PASS

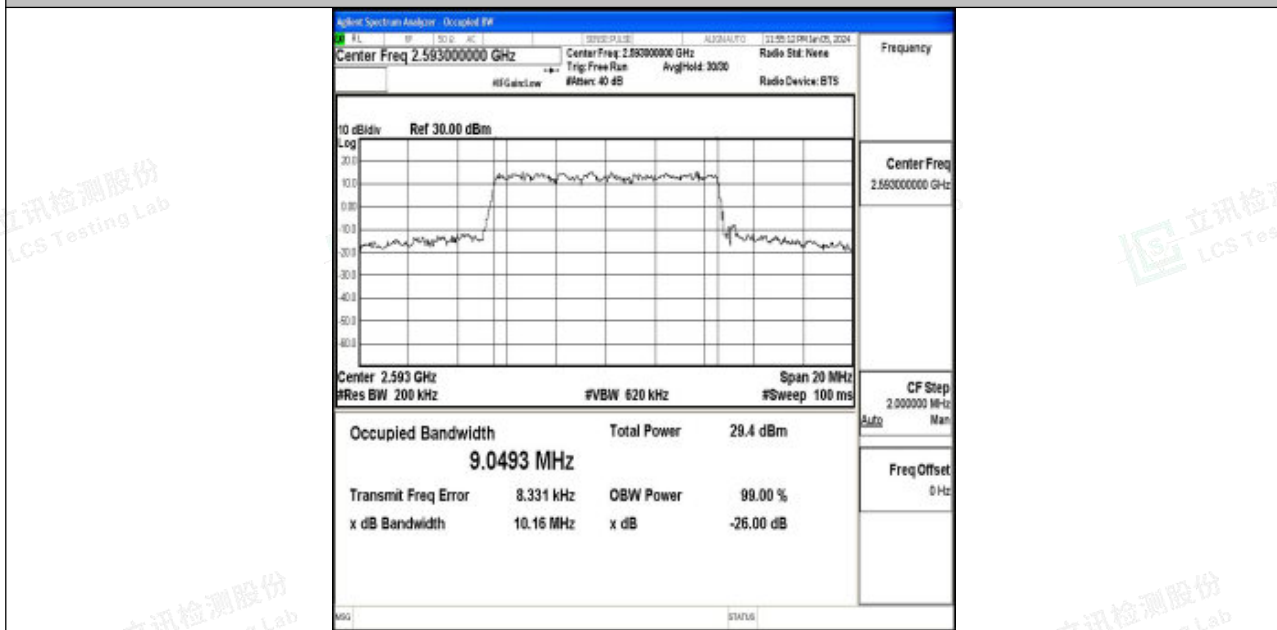

Band41-10MHz-QPSK-40620-50RB#0-PASS




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

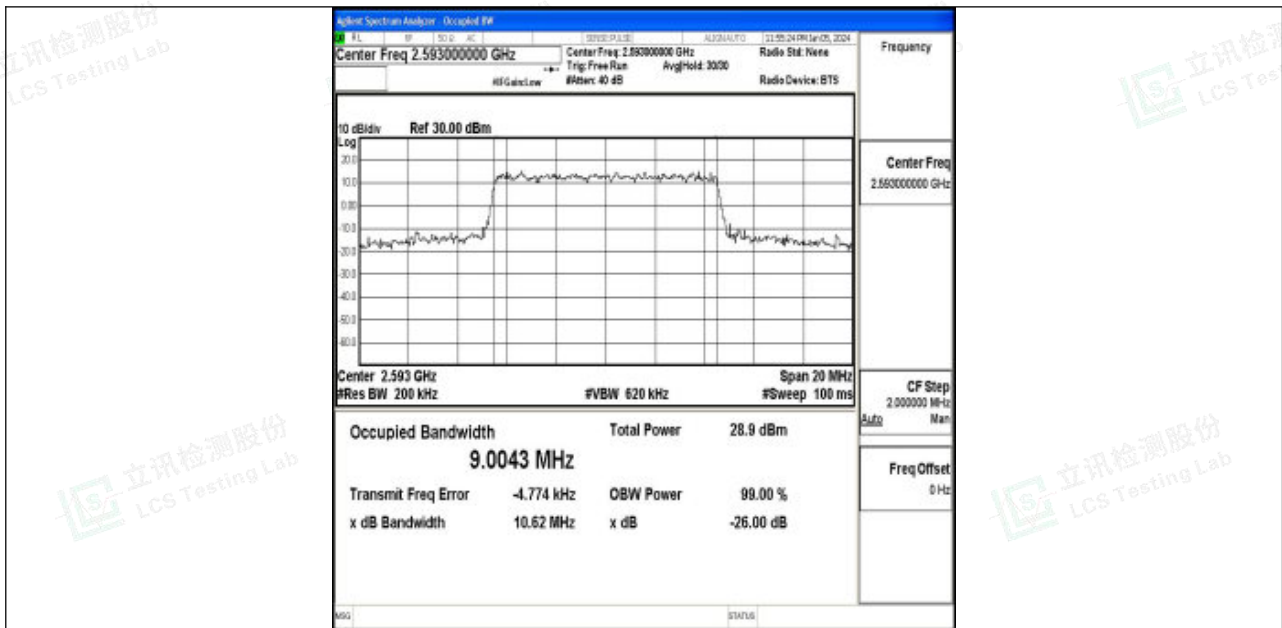

Band41-10MHz-16QAM-40620-50RB#0-PASS

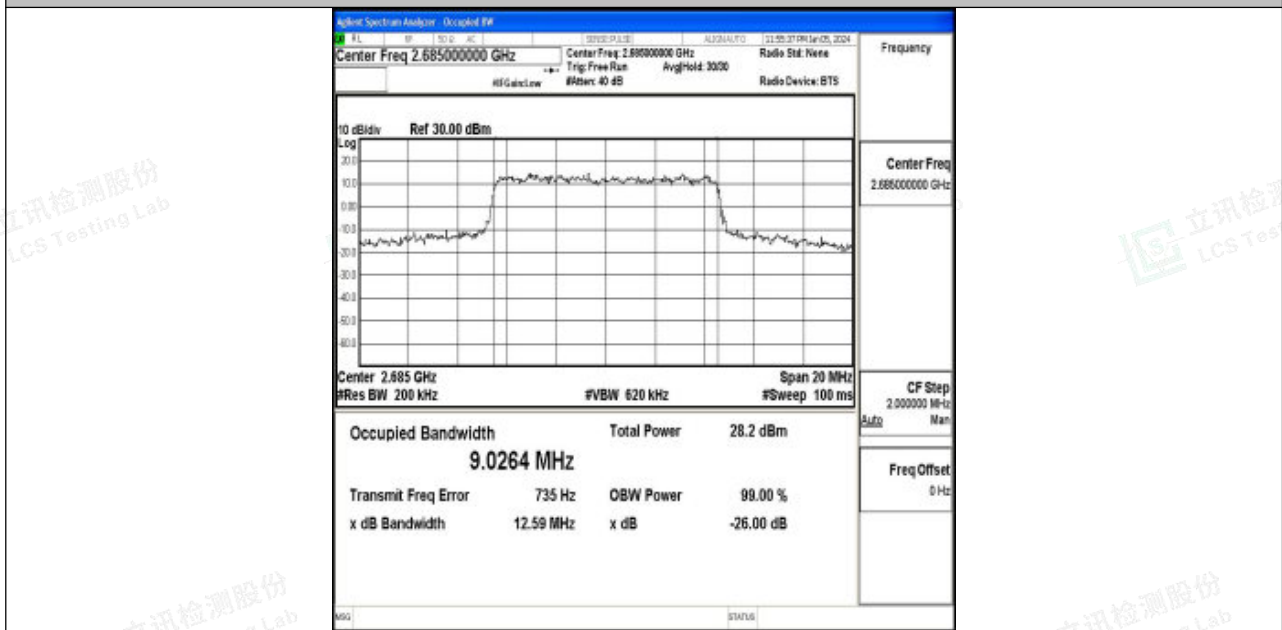

Band41-10MHz-QPSK-41540-50RB#0-PASS



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



Test Result

Band	Bandwidth	Modulation	Channel	RB Configuration	Peak Frenquency	Result(dBm)	Verdict
Band41	5MHz	QPSK	39675	25RB#0	2494.76	-36.34	PASS
Band41	5MHz	16QAM	39675	25RB#0	2490.46	-49.35	PASS
Band41	5MHz	QPSK	41565	25RB#0	2697.32	-45.13	PASS
Band41	5MHz	16QAM	41565	25RB#0	2696.24	-45.56	PASS
Band41	10MHz	QPSK	39700	50RB#0	2490.36	-40.55	PASS
Band41	10MHz	16QAM	39700	50RB#0	2490.30	-41.73	PASS
Band41	10MHz	QPSK	41540	50RB#0	2700.13	-44.00	PASS
Band41	10MHz	16QAM	41540	50RB#0	2700.18	-43.94	PASS
Band41	15MHz	QPSK	39725	75RB#0	2489.66	-37.49	PASS
Band41	15MHz	16QAM	39725	75RB#0	2489.79	-39.35	PASS
Band41	15MHz	QPSK	41515	75RB#0	2706.29	-41.94	PASS
Band41	15MHz	16QAM	41515	75RB#0	2706.36	-42.81	PASS
Band41	20MHz	QPSK	39750	100RB#0	2490.30	-38.76	PASS
Band41	20MHz	16QAM	39750	100RB#0	2490.49	-39.61	PASS
Band41	20MHz	QPSK	41490	100RB#0	2712.39	-42.55	PASS
Band41	20MHz	16QAM	41490	100RB#0	2710.46	-42.72	PASS

Agilent Spectrum Analyzer - Sweep 54

Center Freq 2.494500000 GHz

Ref Offset 8.48 dB

Ref 38.00 dBm

Mkr1 2.497 009 GHz

5.051 dBm

Trace 1 Pass


Start 2.488000 GHz


Stop 2.501000 GHz

#Res BW 51 kHz


#Sweep 1.000 s (1001 pts)

Band41 5MHz QPSK 39675 25RB#0

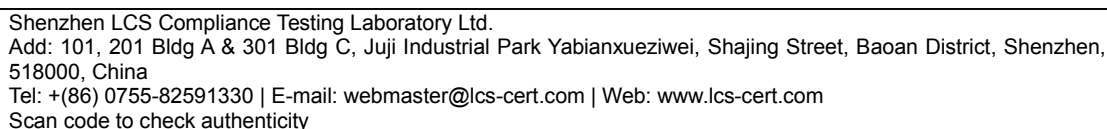

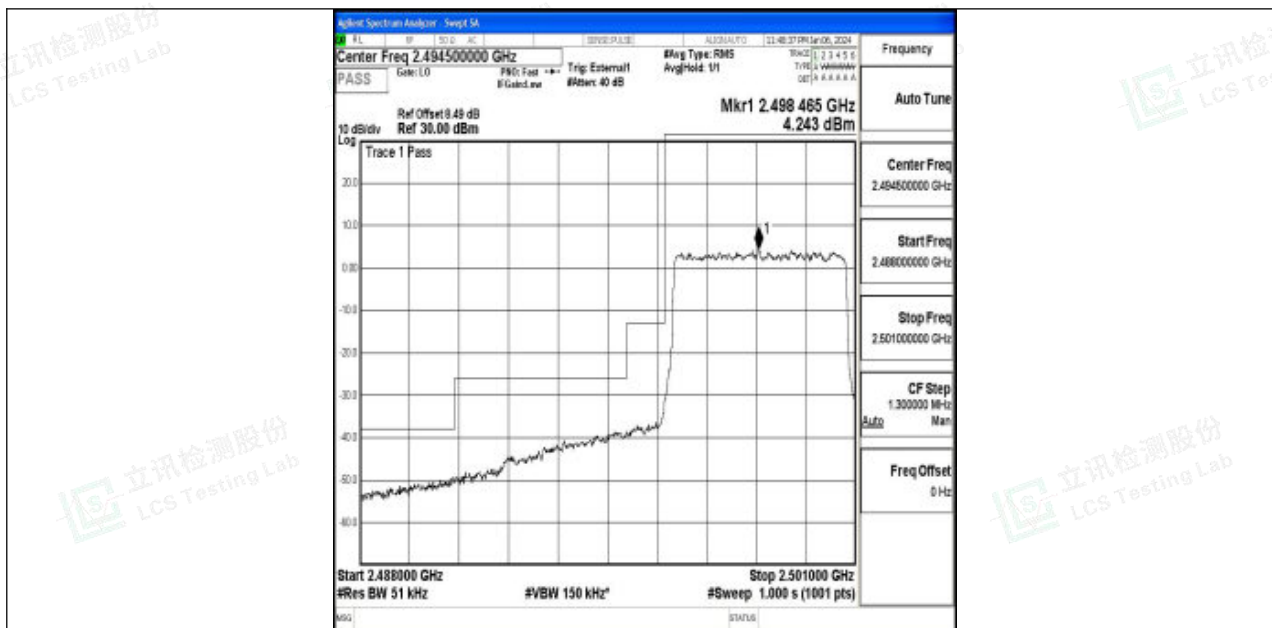

Band41_5MHz_16QAM_39675_25RB#0

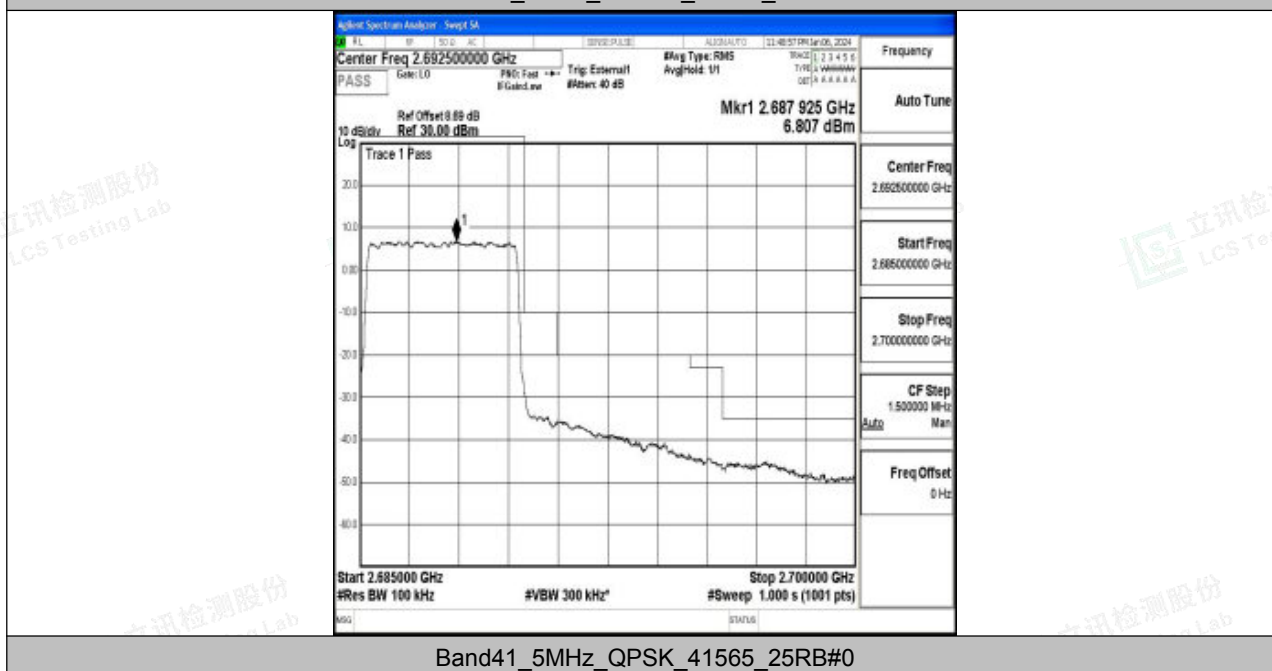

Band41_5MHz_QPSK_41565_25RB#0




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

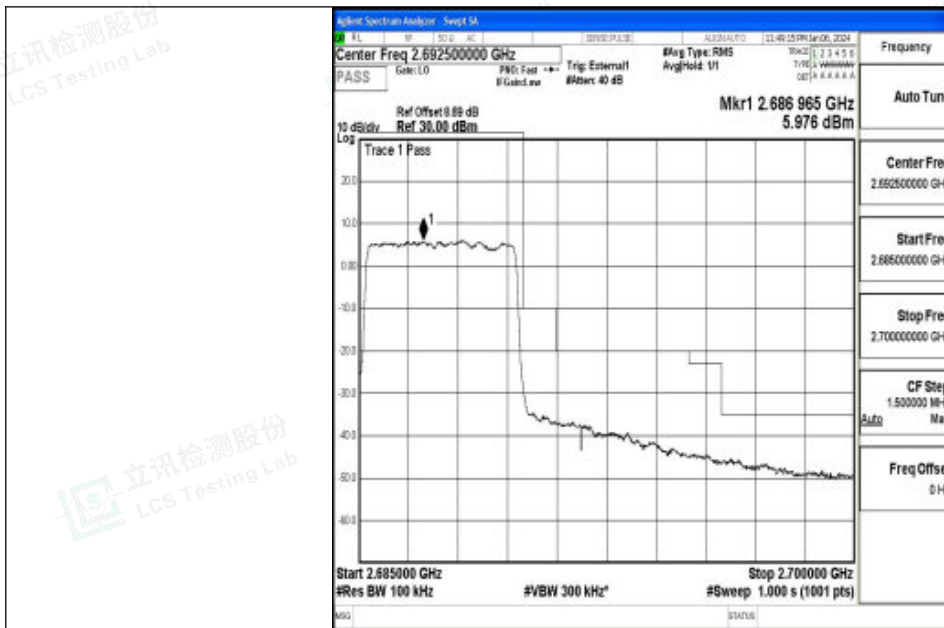


Band41_5MHz_16QAM_41565_25RB#0

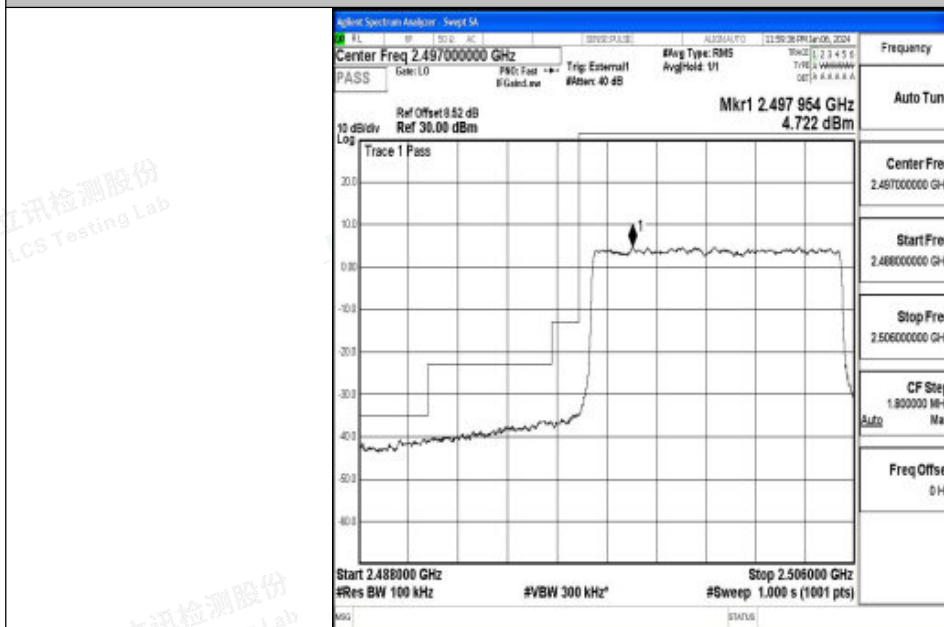


Band41_10MHz_QPSK_39700_50RB#0



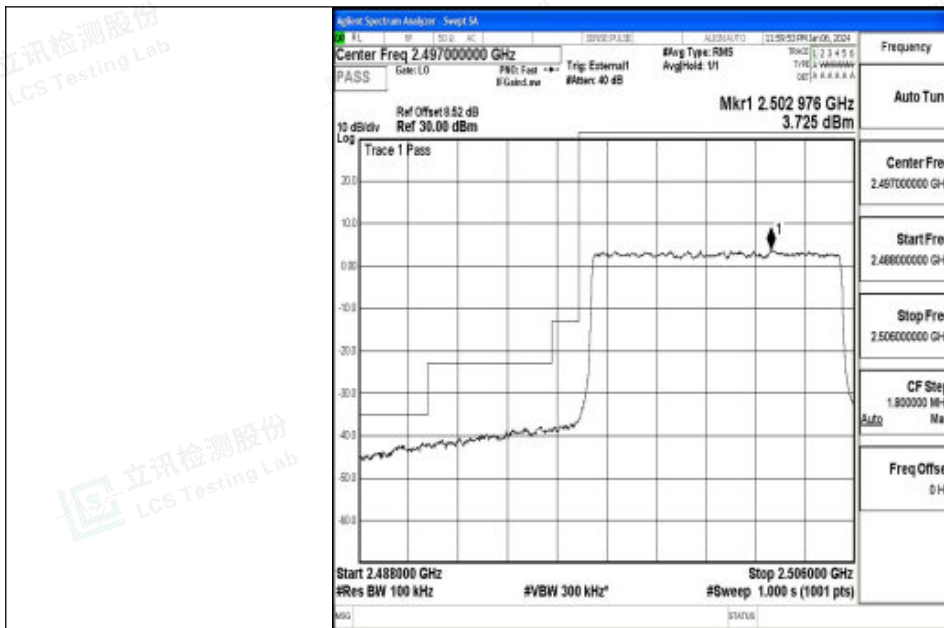

Band41_10MHz_16QAM_39700_50RB#0

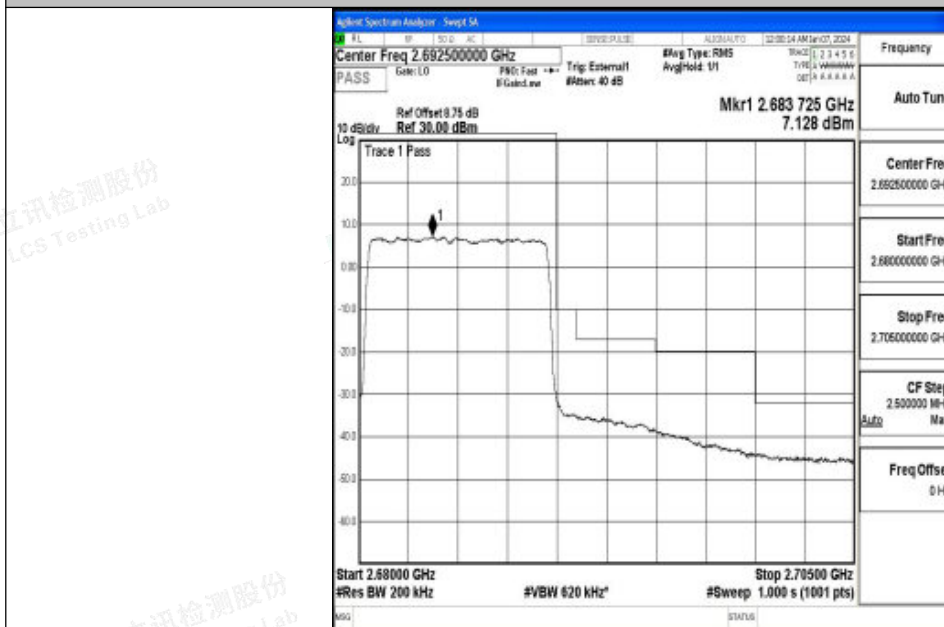

Band41_10MHz_QPSK_41540_50RB#0




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

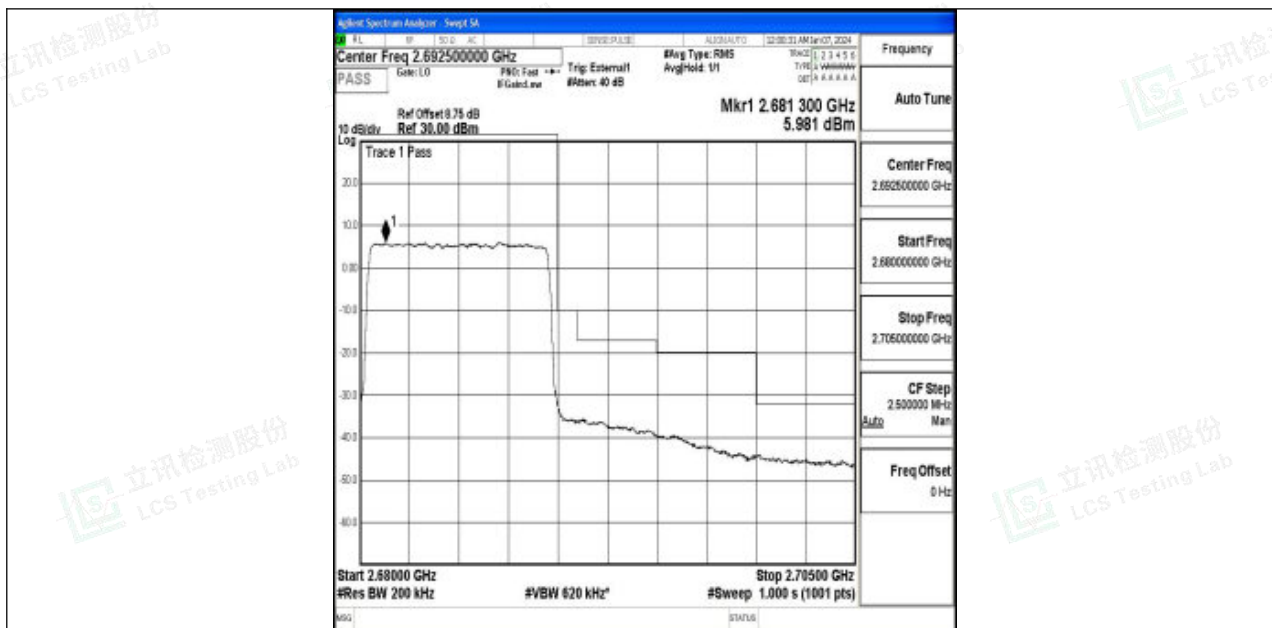

Band41_10MHz_16QAM_41540_50RB#0

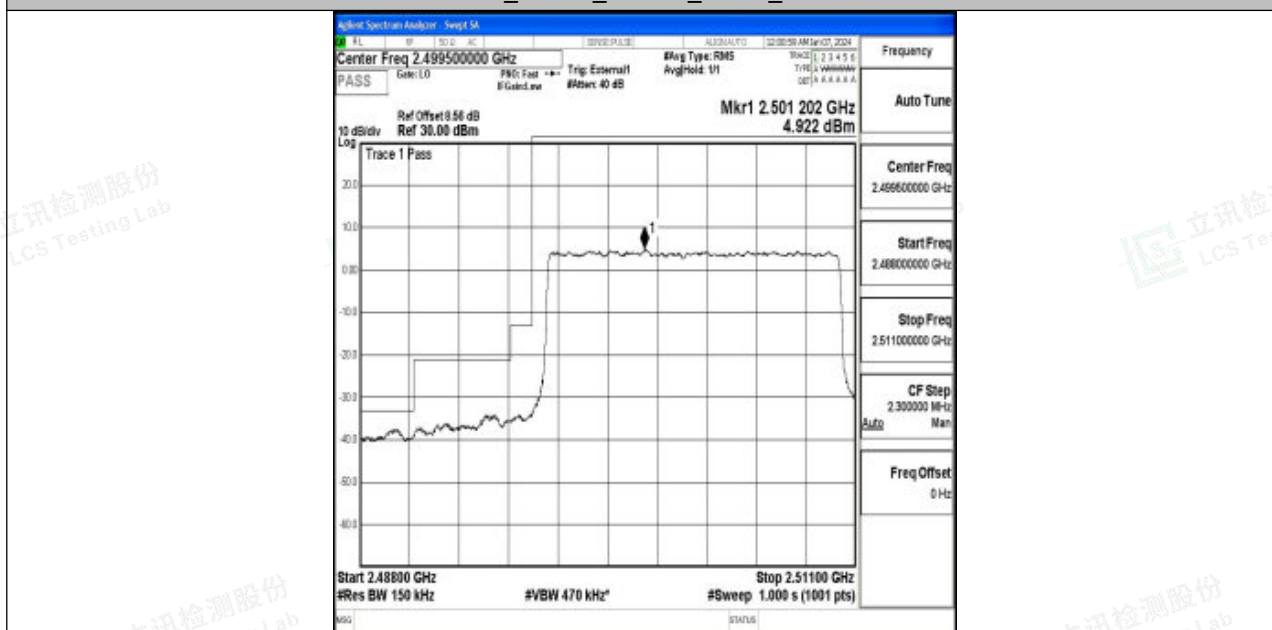

Band41_15MHz_QPSK_39725_75RB#0




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

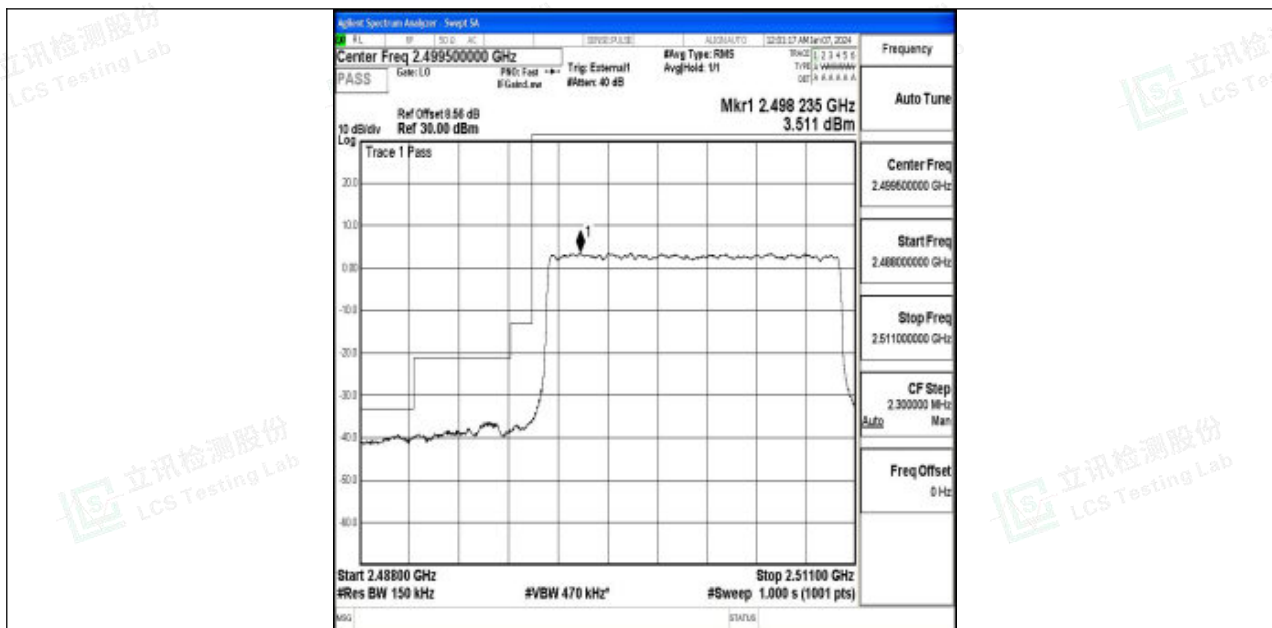

Band41_15MHz_16QAM_39725_75RB#0

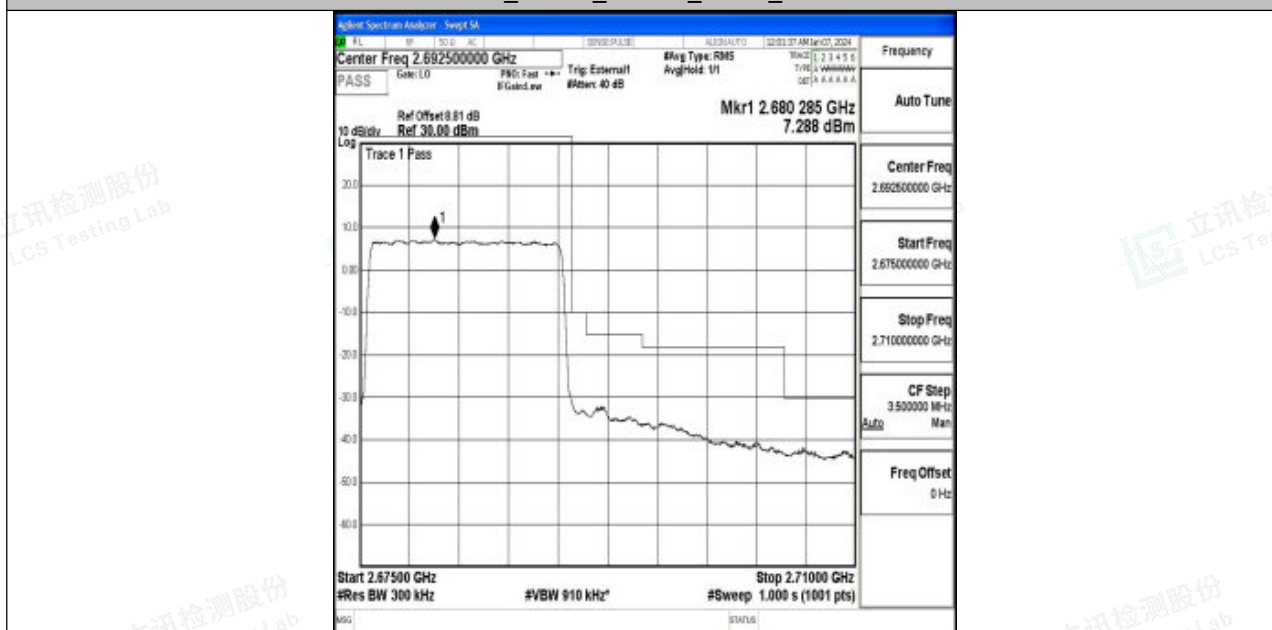

Band41_15MHz_QPSK_41515_75RB#0




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

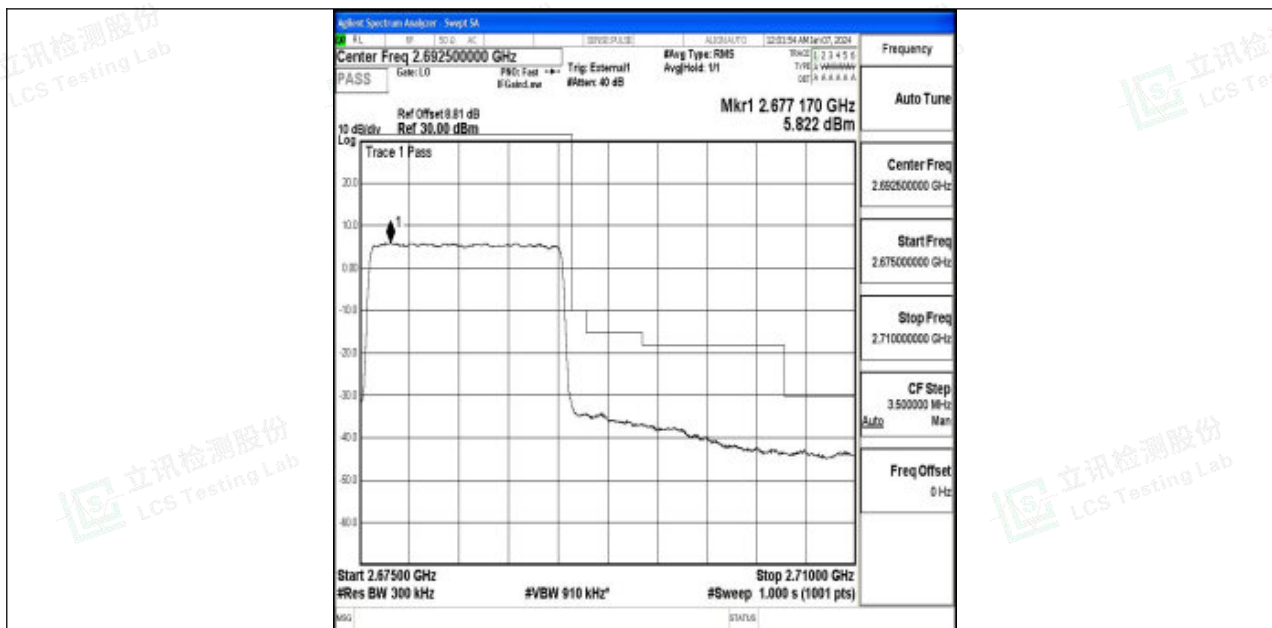

Band41_15MHz_16QAM_41515_75RB#0

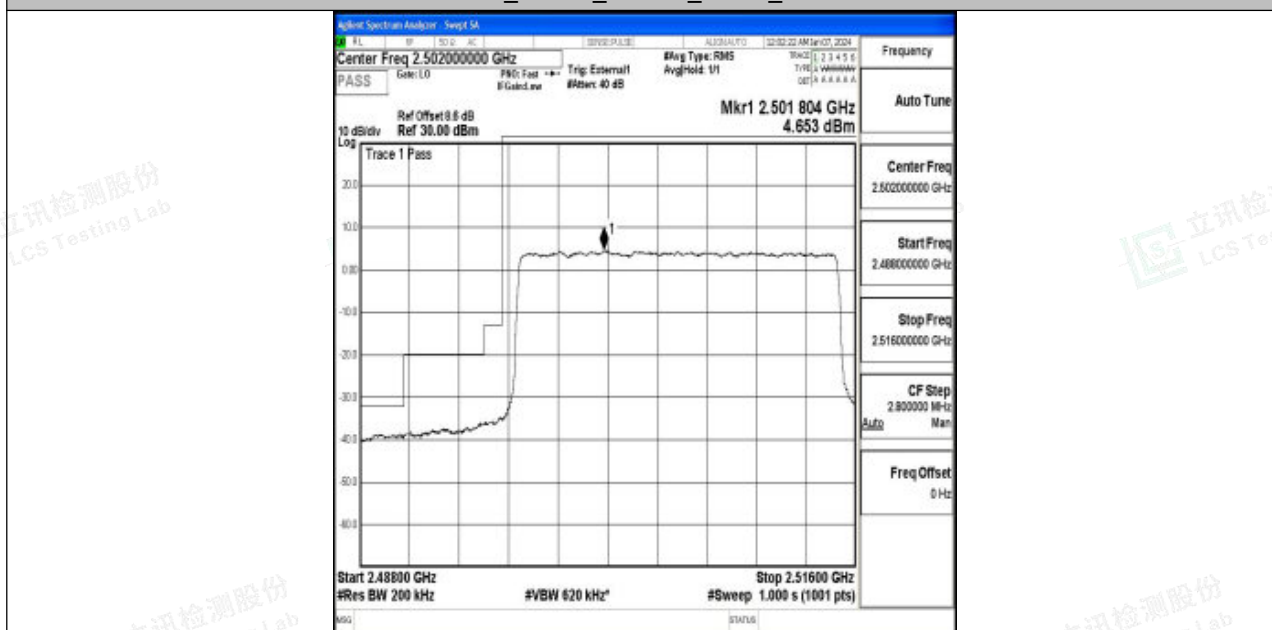

Band41_20MHz_QPSK_39750_100RB#0




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

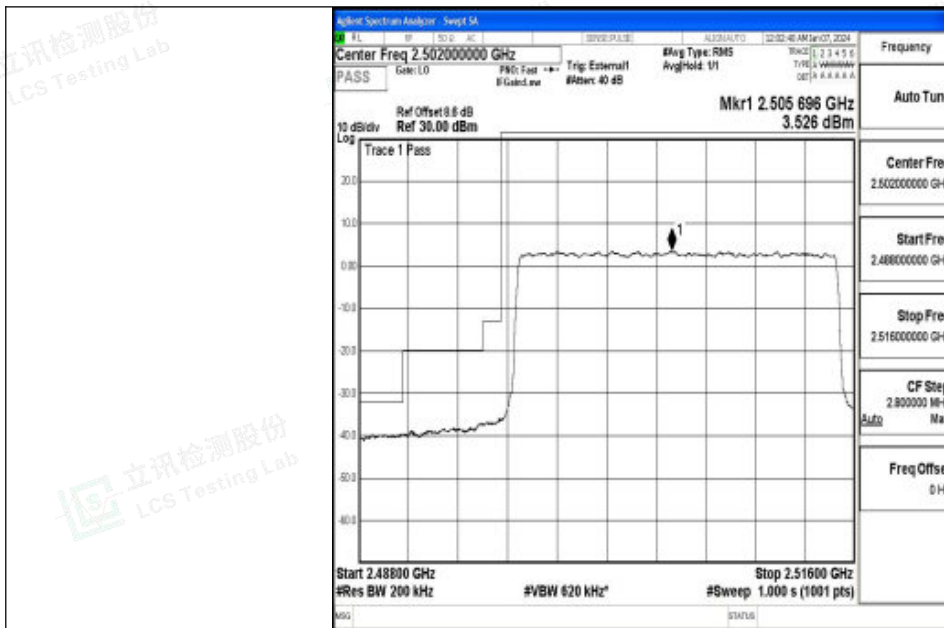


Band41_20MHz_16QAM_39750_100RB#0

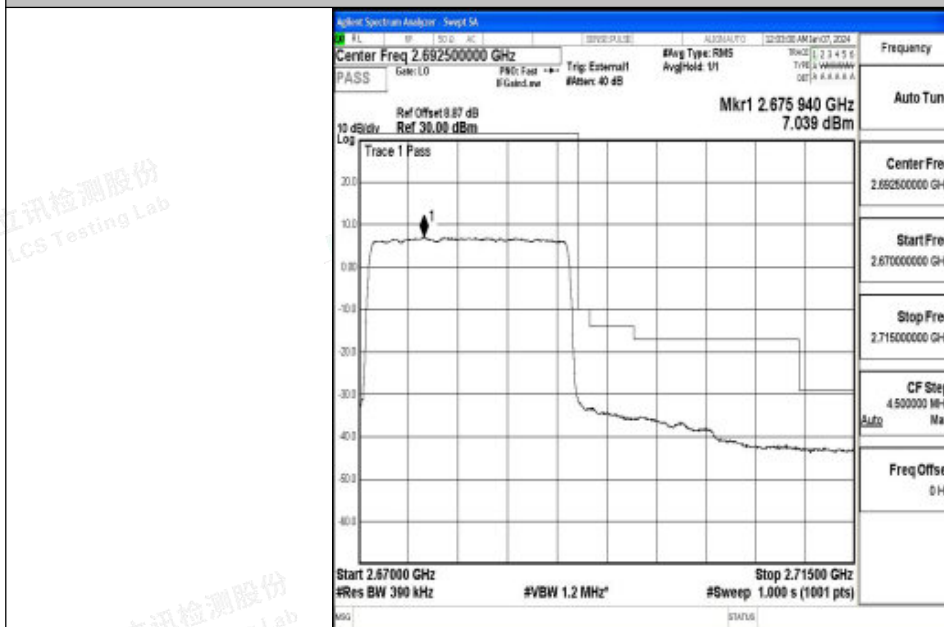

Band41_20MHz_QPSK_41490_100RB#0



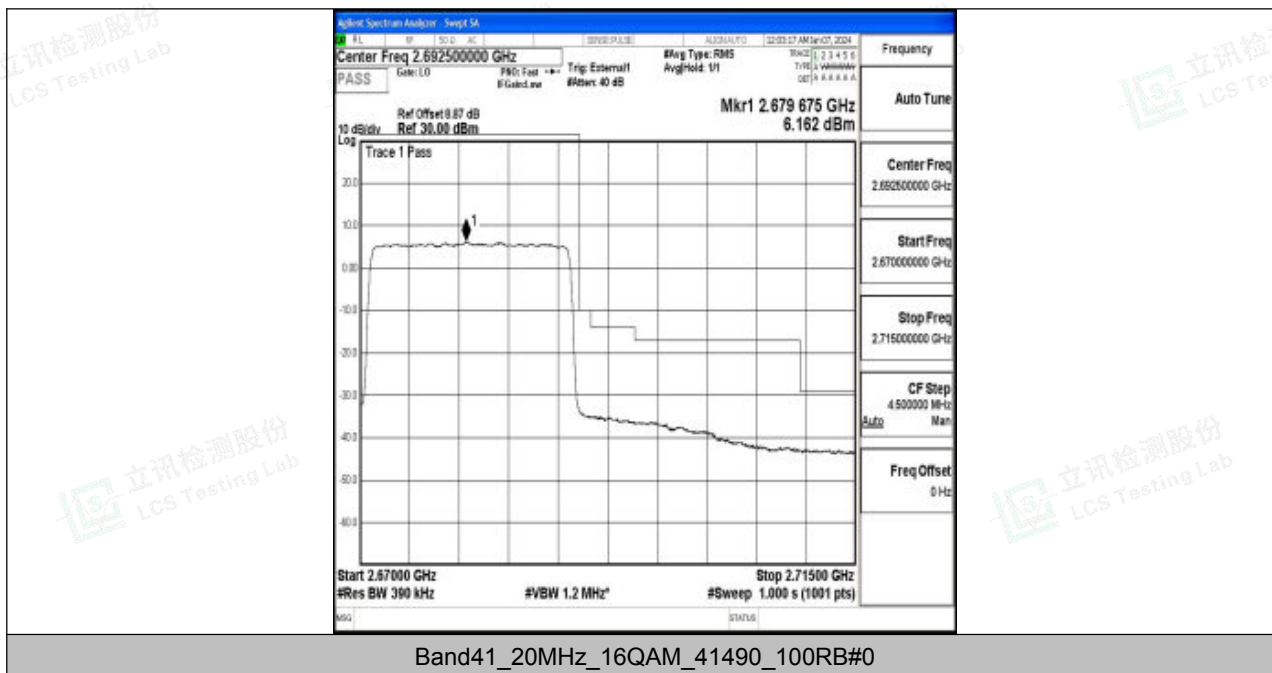



M.5 Conducted Spurious Emission

Test Result

Band	Bandwidth	Modulation	Channel	RB Configuration	Frequency Range	Result (dBm)	Verdict
Band41	5MHz	QPSK	39675	1RB#0	0.009~0.15	-58.10	PASS
Band41	5MHz	QPSK	39675	1RB#0	0.15~30	-59.21	PASS
Band41	5MHz	QPSK	39675	1RB#0	30~1000	-62.25	PASS
Band41	5MHz	QPSK	39675	1RB#0	1000~20000	-33.45	PASS
Band41	5MHz	QPSK	39675	1RB#0	20000~27000	-34.90	PASS
Band41	5MHz	16QAM	39675	1RB#0	0.009~0.15	-58.44	PASS
Band41	5MHz	16QAM	39675	1RB#0	0.15~30	-59.03	PASS
Band41	5MHz	16QAM	39675	1RB#0	30~1000	-62.10	PASS
Band41	5MHz	16QAM	39675	1RB#0	1000~20000	-33.02	PASS
Band41	5MHz	16QAM	39675	1RB#0	20000~27000	-35.09	PASS
Band41	5MHz	QPSK	40620	1RB#0	0.009~0.15	-59.39	PASS
Band41	5MHz	QPSK	40620	1RB#0	0.15~30	-60.34	PASS
Band41	5MHz	QPSK	40620	1RB#0	30~1000	-62.00	PASS
Band41	5MHz	QPSK	40620	1RB#0	1000~20000	-33.07	PASS
Band41	5MHz	QPSK	40620	1RB#0	20000~27000	-35.11	PASS
Band41	5MHz	16QAM	40620	1RB#0	0.009~0.15	-58.13	PASS
Band41	5MHz	16QAM	40620	1RB#0	0.15~30	-62.70	PASS
Band41	5MHz	16QAM	40620	1RB#0	30~1000	-61.99	PASS
Band41	5MHz	16QAM	40620	1RB#0	1000~20000	-33.04	PASS
Band41	5MHz	16QAM	40620	1RB#0	20000~27000	-35.22	PASS
Band41	5MHz	QPSK	41565	1RB#0	0.009~0.15	-58.18	PASS
Band41	5MHz	QPSK	41565	1RB#0	0.15~30	-58.90	PASS
Band41	5MHz	QPSK	41565	1RB#0	30~1000	-62.23	PASS
Band41	5MHz	QPSK	41565	1RB#0	1000~20000	-32.78	PASS
Band41	5MHz	QPSK	41565	1RB#0	20000~27000	-35.29	PASS
Band41	5MHz	16QAM	41565	1RB#0	0.009~0.15	-56.93	PASS
Band41	5MHz	16QAM	41565	1RB#0	0.15~30	-59.81	PASS
Band41	5MHz	16QAM	41565	1RB#0	30~1000	-62.27	PASS
Band41	5MHz	16QAM	41565	1RB#0	1000~20000	-33.20	PASS
Band41	5MHz	16QAM	41565	1RB#0	20000~27000	-35.10	PASS
Band41	10MHz	QPSK	39700	1RB#0	0.009~0.15	-57.20	PASS
Band41	10MHz	QPSK	39700	1RB#0	0.15~30	-59.51	PASS
Band41	10MHz	QPSK	39700	1RB#0	30~1000	-62.26	PASS
Band41	10MHz	QPSK	39700	1RB#0	1000~20000	-33.31	PASS
Band41	10MHz	QPSK	39700	1RB#0	20000~27000	-35.14	PASS



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



Band41	10MHz	16QAM	39700	1RB#0	0.009~0.15	-58.57	PASS
Band41	10MHz	16QAM	39700	1RB#0	0.15~30	-62.74	PASS
Band41	10MHz	16QAM	39700	1RB#0	30~1000	-61.70	PASS
Band41	10MHz	16QAM	39700	1RB#0	1000~20000	-33.41	PASS
Band41	10MHz	16QAM	39700	1RB#0	20000~27000	-35.27	PASS
Band41	10MHz	QPSK	40620	1RB#0	0.009~0.15	-58.25	PASS
Band41	10MHz	QPSK	40620	1RB#0	0.15~30	-58.67	PASS
Band41	10MHz	QPSK	40620	1RB#0	30~1000	-62.35	PASS
Band41	10MHz	QPSK	40620	1RB#0	1000~20000	-33.29	PASS
Band41	10MHz	QPSK	40620	1RB#0	20000~27000	-35.05	PASS
Band41	10MHz	16QAM	40620	1RB#0	0.009~0.15	-58.87	PASS
Band41	10MHz	16QAM	40620	1RB#0	0.15~30	-57.76	PASS
Band41	10MHz	16QAM	40620	1RB#0	30~1000	-62.22	PASS
Band41	10MHz	16QAM	40620	1RB#0	1000~20000	-32.83	PASS
Band41	10MHz	16QAM	40620	1RB#0	20000~27000	-35.00	PASS
Band41	10MHz	QPSK	41540	1RB#0	0.009~0.15	-57.83	PASS
Band41	10MHz	QPSK	41540	1RB#0	0.15~30	-58.59	PASS
Band41	10MHz	QPSK	41540	1RB#0	30~1000	-62.14	PASS
Band41	10MHz	QPSK	41540	1RB#0	1000~20000	-33.09	PASS
Band41	10MHz	QPSK	41540	1RB#0	20000~27000	-35.01	PASS
Band41	10MHz	16QAM	41540	1RB#0	0.009~0.15	-57.43	PASS
Band41	10MHz	16QAM	41540	1RB#0	0.15~30	-59.01	PASS
Band41	10MHz	16QAM	41540	1RB#0	30~1000	-62.15	PASS
Band41	10MHz	16QAM	41540	1RB#0	1000~20000	-33.18	PASS
Band41	10MHz	16QAM	41540	1RB#0	20000~27000	-34.92	PASS
Band41	15MHz	QPSK	39725	1RB#0	0.009~0.15	-57.54	PASS
Band41	15MHz	QPSK	39725	1RB#0	0.15~30	-59.52	PASS
Band41	15MHz	QPSK	39725	1RB#0	30~1000	-62.31	PASS
Band41	15MHz	QPSK	39725	1RB#0	1000~20000	-33.14	PASS
Band41	15MHz	QPSK	39725	1RB#0	20000~27000	-35.21	PASS
Band41	15MHz	16QAM	39725	1RB#0	0.009~0.15	-56.68	PASS
Band41	15MHz	16QAM	39725	1RB#0	0.15~30	-59.86	PASS
Band41	15MHz	16QAM	39725	1RB#0	30~1000	-62.23	PASS
Band41	15MHz	16QAM	39725	1RB#0	1000~20000	-32.86	PASS
Band41	15MHz	16QAM	39725	1RB#0	20000~27000	-35.22	PASS
Band41	15MHz	QPSK	40620	1RB#0	0.009~0.15	-56.51	PASS
Band41	15MHz	QPSK	40620	1RB#0	0.15~30	-65.18	PASS
Band41	15MHz	QPSK	40620	1RB#0	30~1000	-62.25	PASS
Band41	15MHz	QPSK	40620	1RB#0	1000~20000	-33.21	PASS
Band41	15MHz	QPSK	40620	1RB#0	20000~27000	-34.82	PASS
Band41	15MHz	16QAM	40620	1RB#0	0.009~0.15	-58.02	PASS



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



Band41	15MHz	16QAM	40620	1RB#0	0.15~30	-61.46	PASS
Band41	15MHz	16QAM	40620	1RB#0	30~1000	-62.00	PASS
Band41	15MHz	16QAM	40620	1RB#0	1000~20000	-33.13	PASS
Band41	15MHz	16QAM	40620	1RB#0	20000~27000	-35.34	PASS
Band41	15MHz	QPSK	41515	1RB#0	0.009~0.15	-56.03	PASS
Band41	15MHz	QPSK	41515	1RB#0	0.15~30	-58.95	PASS
Band41	15MHz	QPSK	41515	1RB#0	30~1000	-62.43	PASS
Band41	15MHz	QPSK	41515	1RB#0	1000~20000	-32.97	PASS
Band41	15MHz	QPSK	41515	1RB#0	20000~27000	-35.26	PASS
Band41	15MHz	16QAM	41515	1RB#0	0.009~0.15	-56.19	PASS
Band41	15MHz	16QAM	41515	1RB#0	0.15~30	-58.75	PASS
Band41	15MHz	16QAM	41515	1RB#0	30~1000	-62.24	PASS
Band41	15MHz	16QAM	41515	1RB#0	1000~20000	-33.03	PASS
Band41	15MHz	16QAM	41515	1RB#0	20000~27000	-34.69	PASS
Band41	20MHz	QPSK	39750	1RB#0	0.009~0.15	-57.80	PASS
Band41	20MHz	QPSK	39750	1RB#0	0.15~30	-59.26	PASS
Band41	20MHz	QPSK	39750	1RB#0	30~1000	-62.07	PASS
Band41	20MHz	QPSK	39750	1RB#0	1000~20000	-32.89	PASS
Band41	20MHz	QPSK	39750	1RB#0	20000~27000	-35.08	PASS
Band41	20MHz	16QAM	39750	1RB#0	0.009~0.15	-57.75	PASS
Band41	20MHz	16QAM	39750	1RB#0	0.15~30	-59.70	PASS
Band41	20MHz	16QAM	39750	1RB#0	30~1000	-61.76	PASS
Band41	20MHz	16QAM	39750	1RB#0	1000~20000	-32.59	PASS
Band41	20MHz	16QAM	39750	1RB#0	20000~27000	-35.38	PASS
Band41	20MHz	QPSK	40620	1RB#0	0.009~0.15	-55.51	PASS
Band41	20MHz	QPSK	40620	1RB#0	0.15~30	-60.39	PASS
Band41	20MHz	QPSK	40620	1RB#0	30~1000	-62.22	PASS
Band41	20MHz	QPSK	40620	1RB#0	1000~20000	-33.15	PASS
Band41	20MHz	QPSK	40620	1RB#0	20000~27000	-35.29	PASS
Band41	20MHz	16QAM	40620	1RB#0	0.009~0.15	-57.24	PASS
Band41	20MHz	16QAM	40620	1RB#0	0.15~30	-61.05	PASS
Band41	20MHz	16QAM	40620	1RB#0	30~1000	-61.99	PASS
Band41	20MHz	16QAM	40620	1RB#0	1000~20000	-33.09	PASS
Band41	20MHz	16QAM	40620	1RB#0	20000~27000	-35.26	PASS
Band41	20MHz	QPSK	41490	1RB#0	0.009~0.15	-58.06	PASS
Band41	20MHz	QPSK	41490	1RB#0	0.15~30	-60.81	PASS
Band41	20MHz	QPSK	41490	1RB#0	30~1000	-62.04	PASS
Band41	20MHz	QPSK	41490	1RB#0	1000~20000	-33.29	PASS
Band41	20MHz	QPSK	41490	1RB#0	20000~27000	-35.16	PASS
Band41	20MHz	16QAM	41490	1RB#0	0.009~0.15	-56.29	PASS
Band41	20MHz	16QAM	41490	1RB#0	0.15~30	-60.35	PASS



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China


Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity




Band41	20MHz	16QAM	41490	1RB#0	30~1000	-62.28	PASS
Band41	20MHz	16QAM	41490	1RB#0	1000~20000	-33.04	PASS
Band41	20MHz	16QAM	41490	1RB#0	20000~27000	-34.94	PASS

Test Graphs

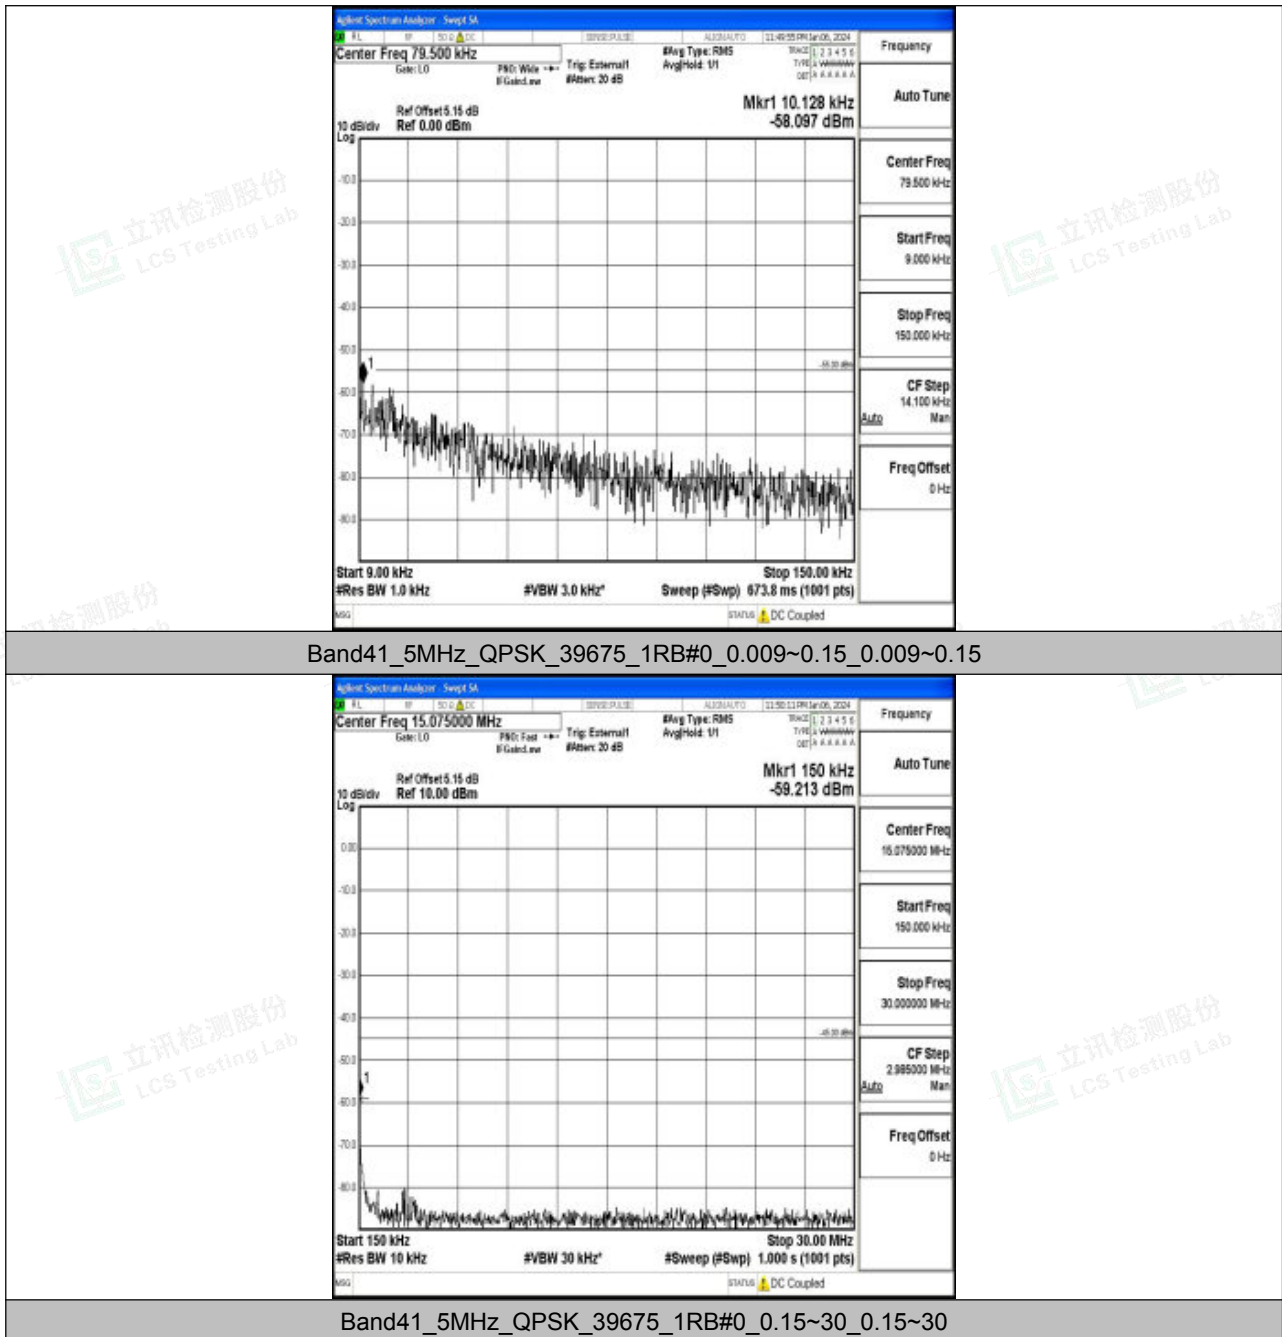

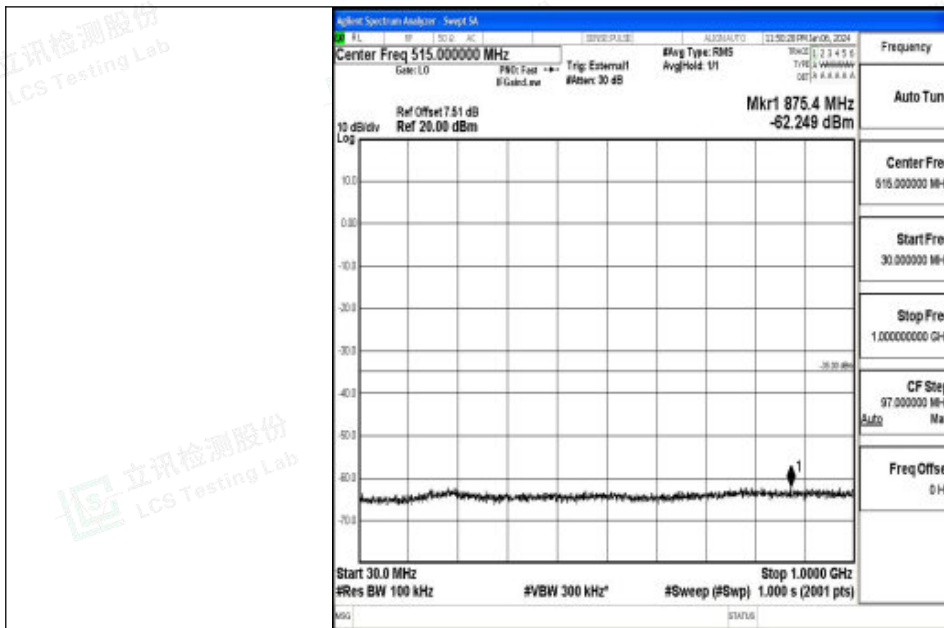


Band41_5MHz_QPSK_39675_1RB#0_30~1000_30~1000

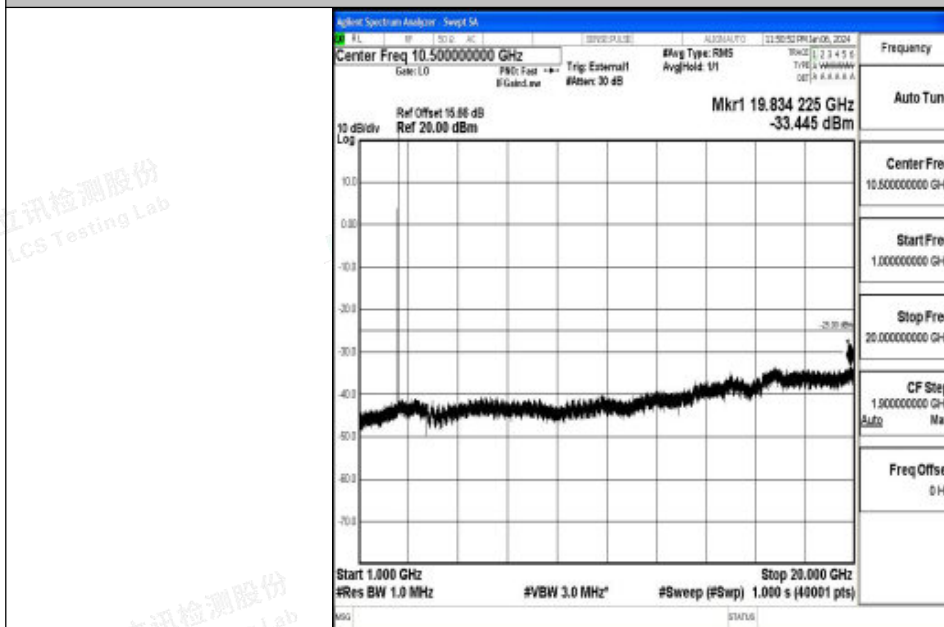


Band41_5MHz_QPSK_39675_1RB#0_1000~20000_1000~20000



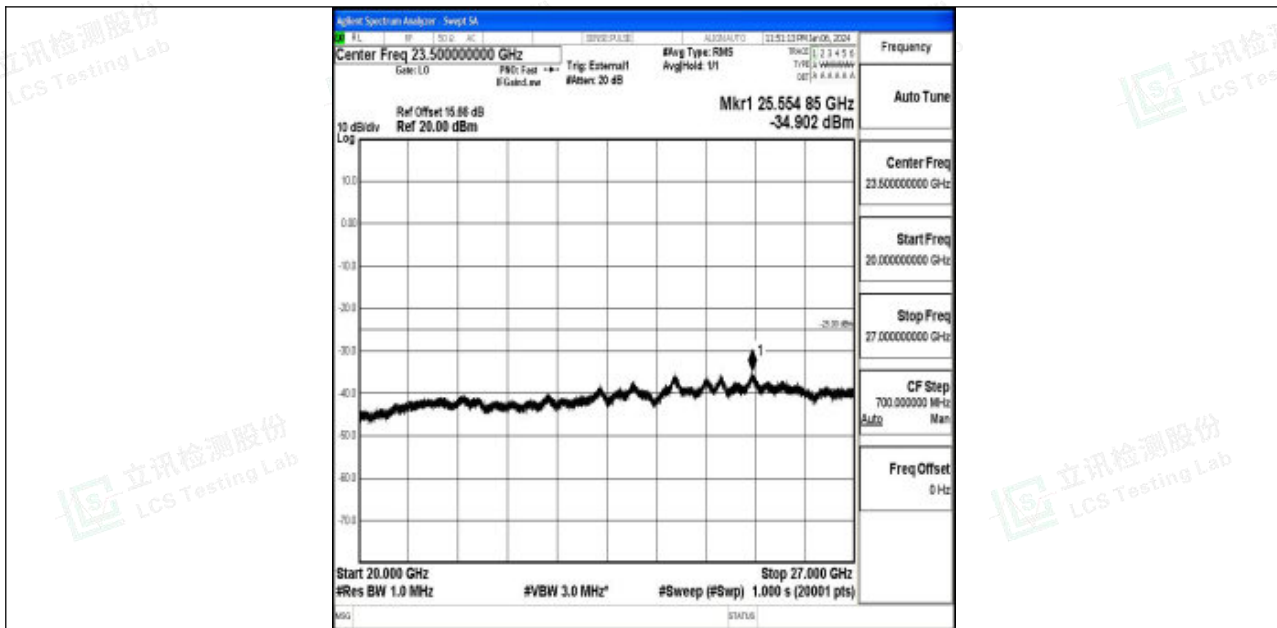


Band41_5MHz_QPSK_39675_1RB#0_20000~27000_20000~27000

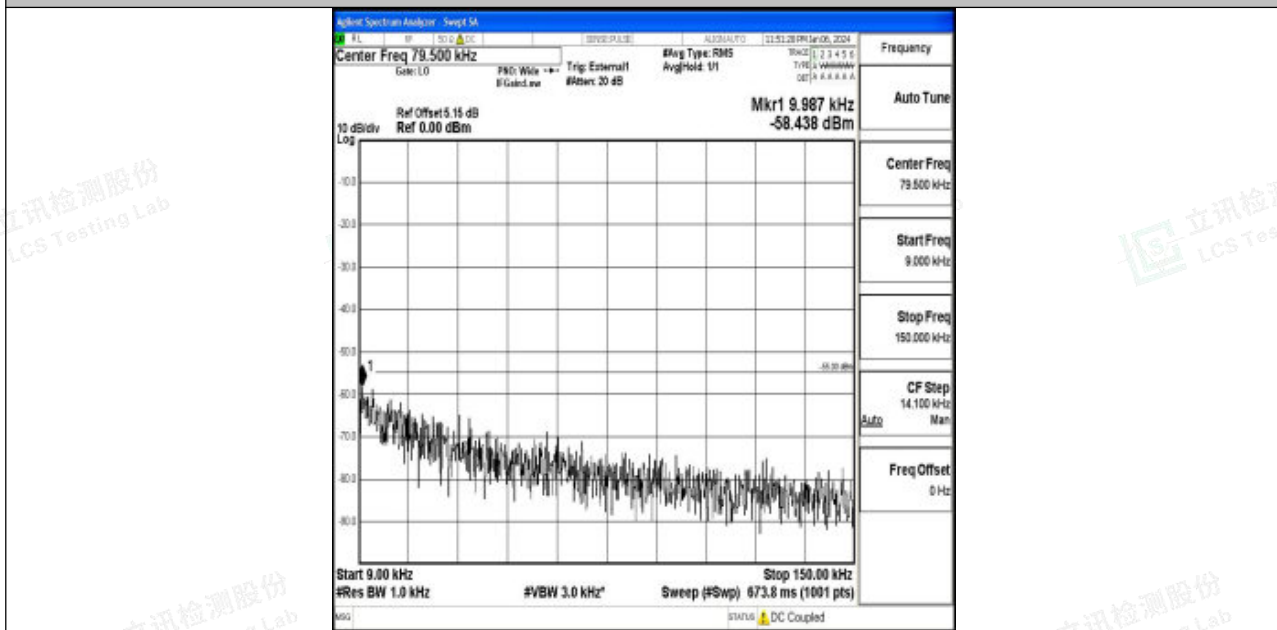

Band41_5MHz_16QAM_39675_1RB#0_0.009~0.15_0.009~0.15



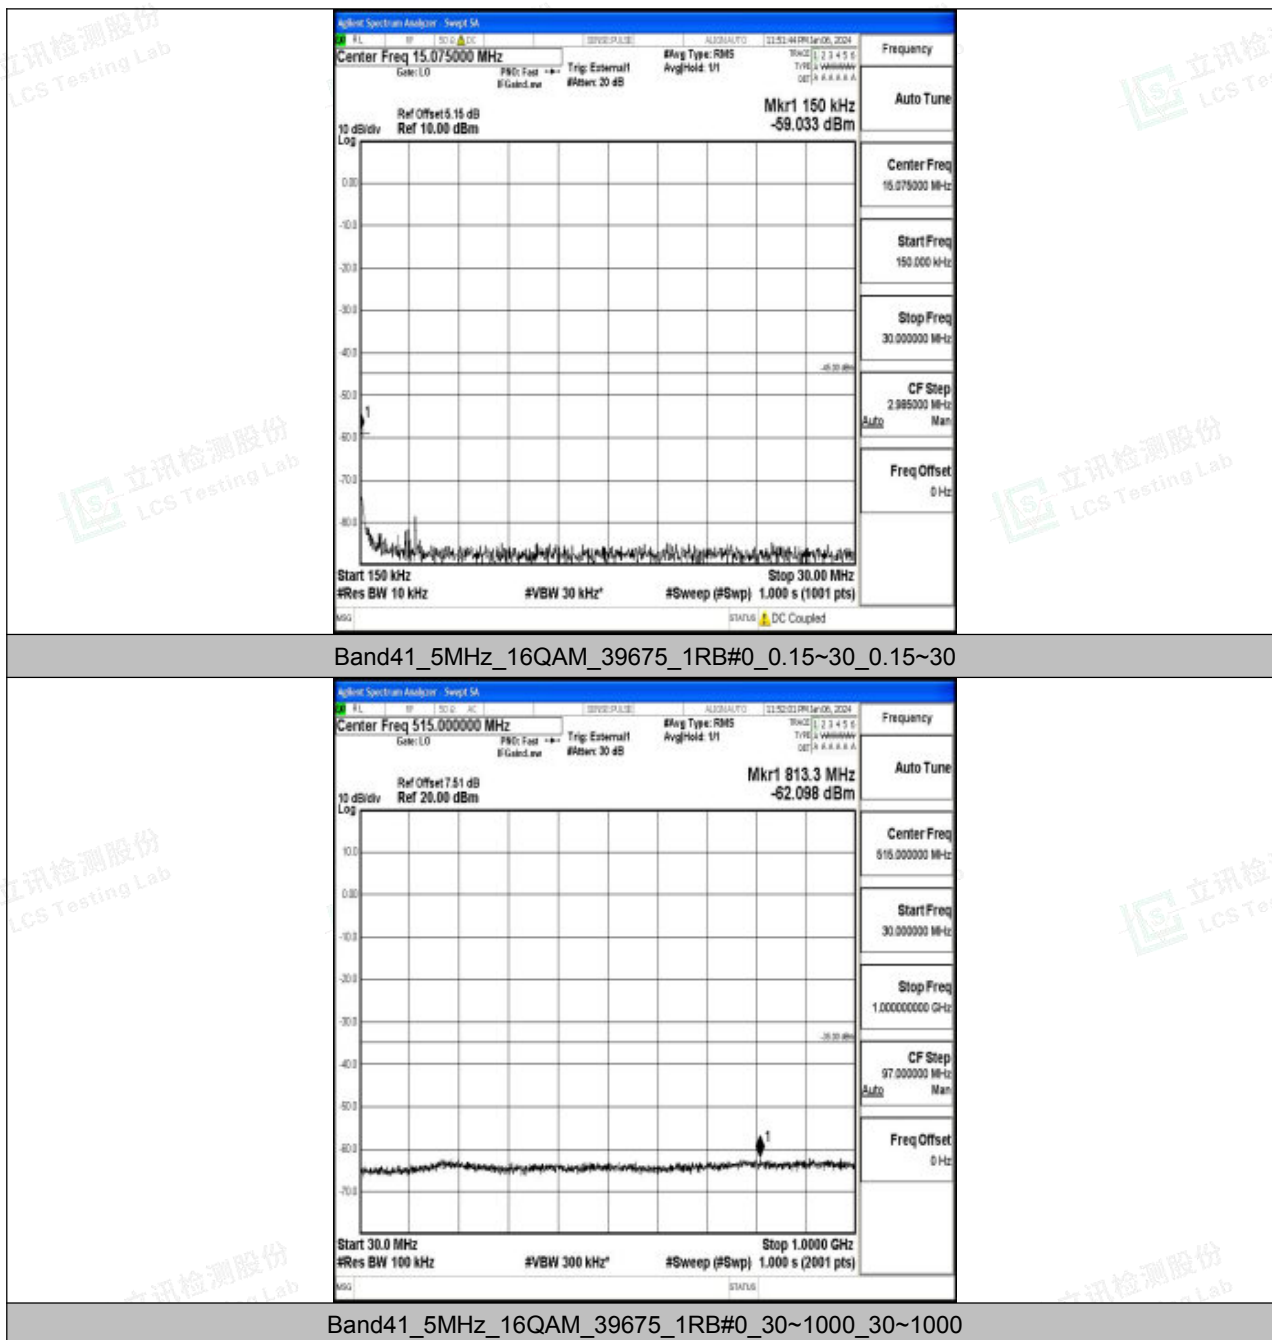


Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

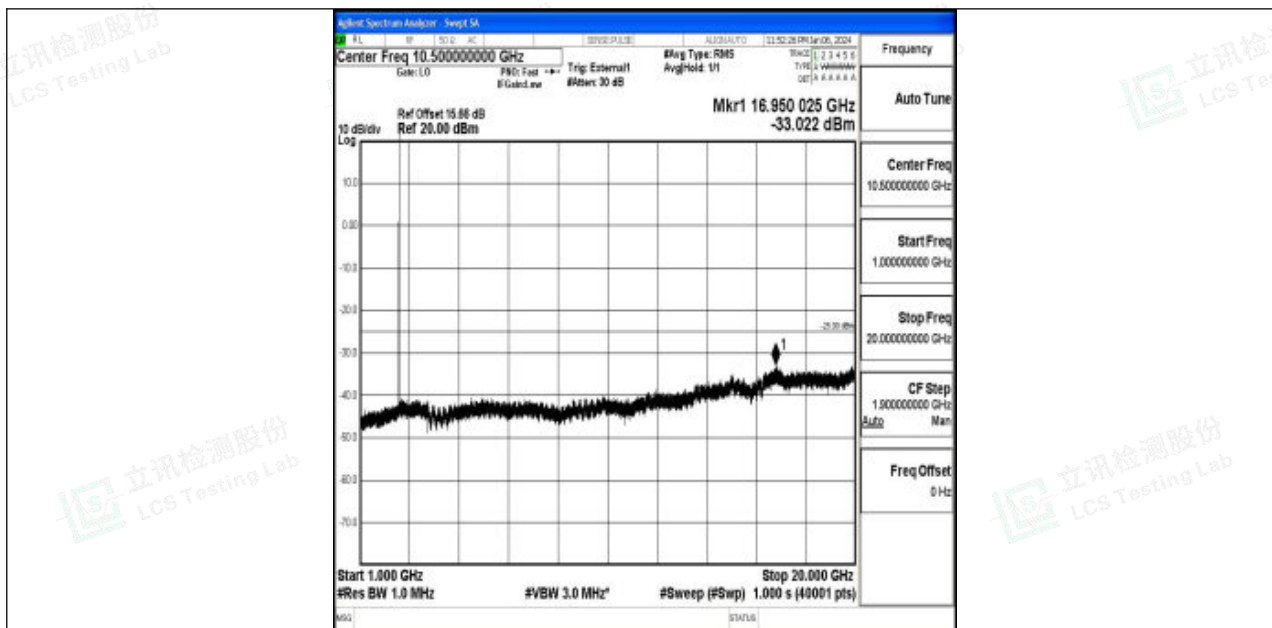

Band41_5MHz_16QAM_39675_1RB#0_1000~20000_1000~20000

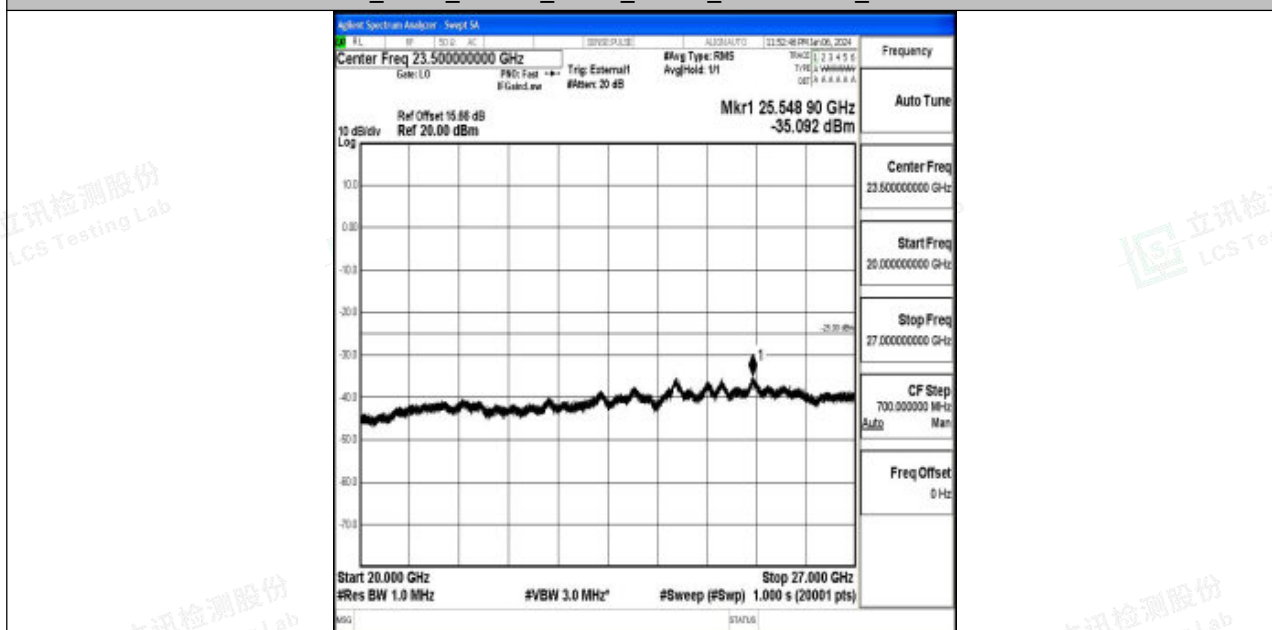

Band41_5MHz_16QAM_39675_1RB#0_20000~27000_20000~27000




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

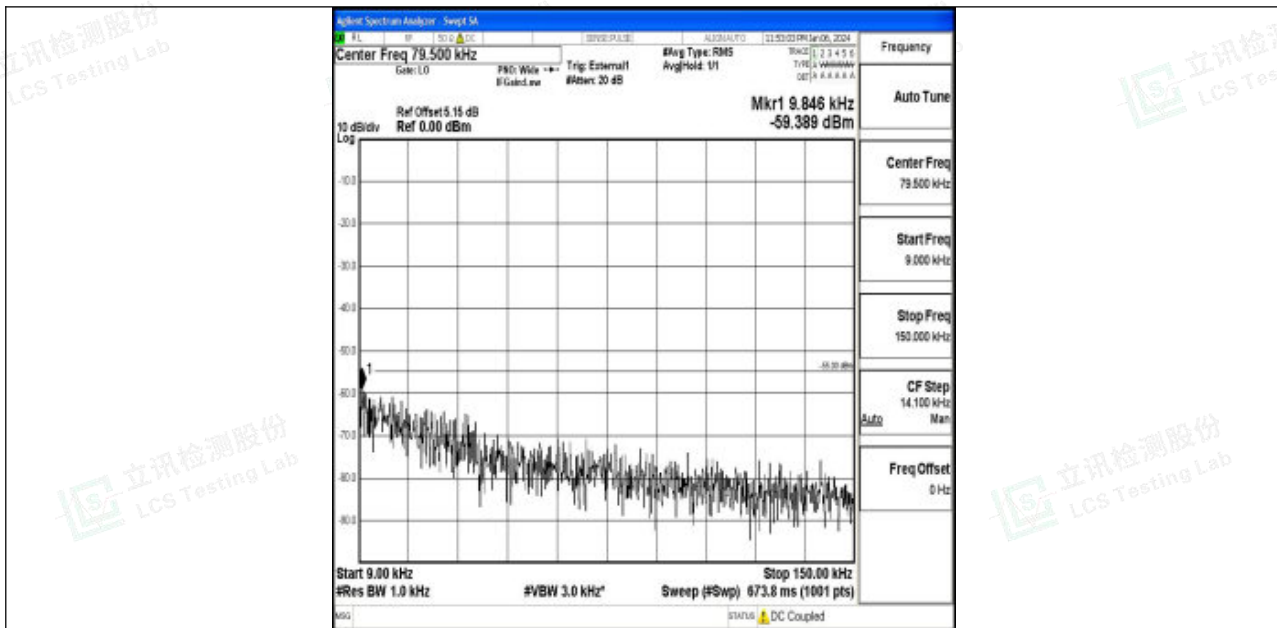


Band41_5MHz_QPSK_40620_1RB#0_0.009~0.15_0.009~0.15

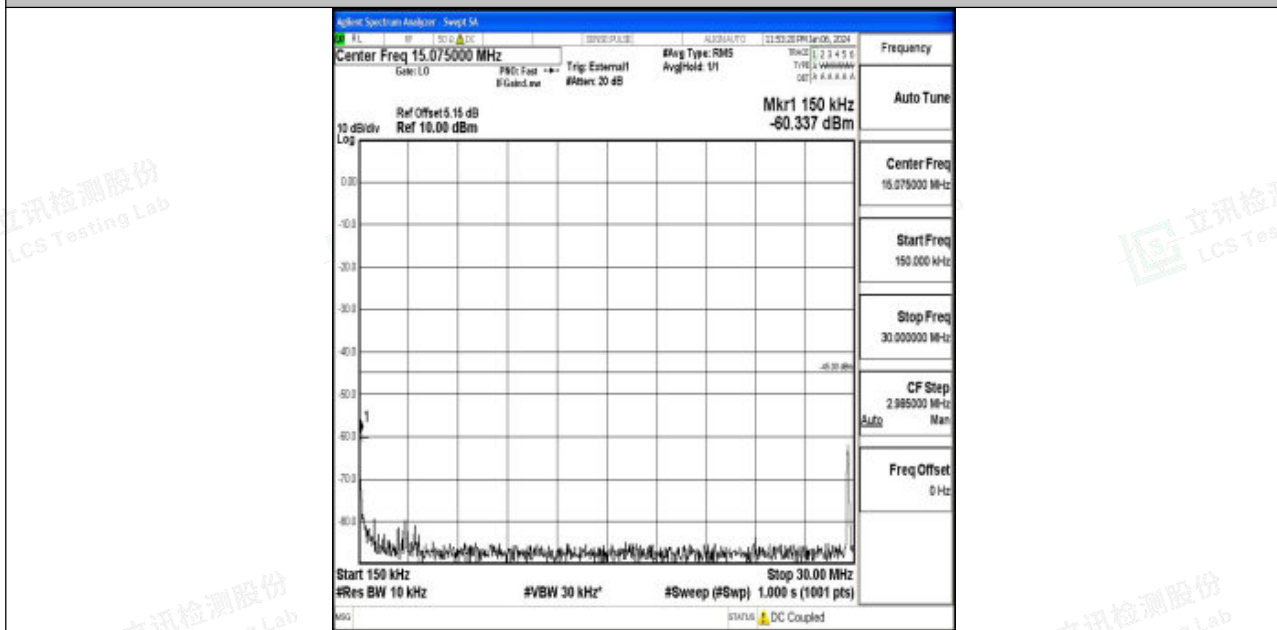


Band41_5MHz_QPSK_40620_1RB#0_0.15~30_0.15~30



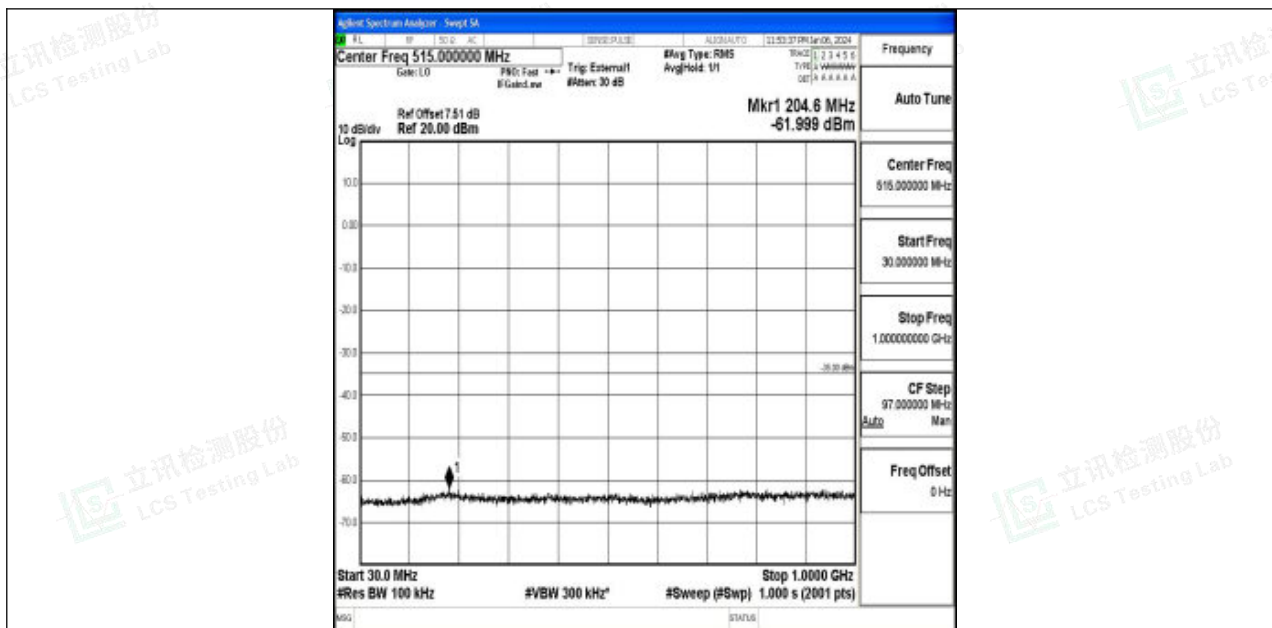

Band41_5MHz_QPSK_40620_1RB#0_30~1000_30~1000

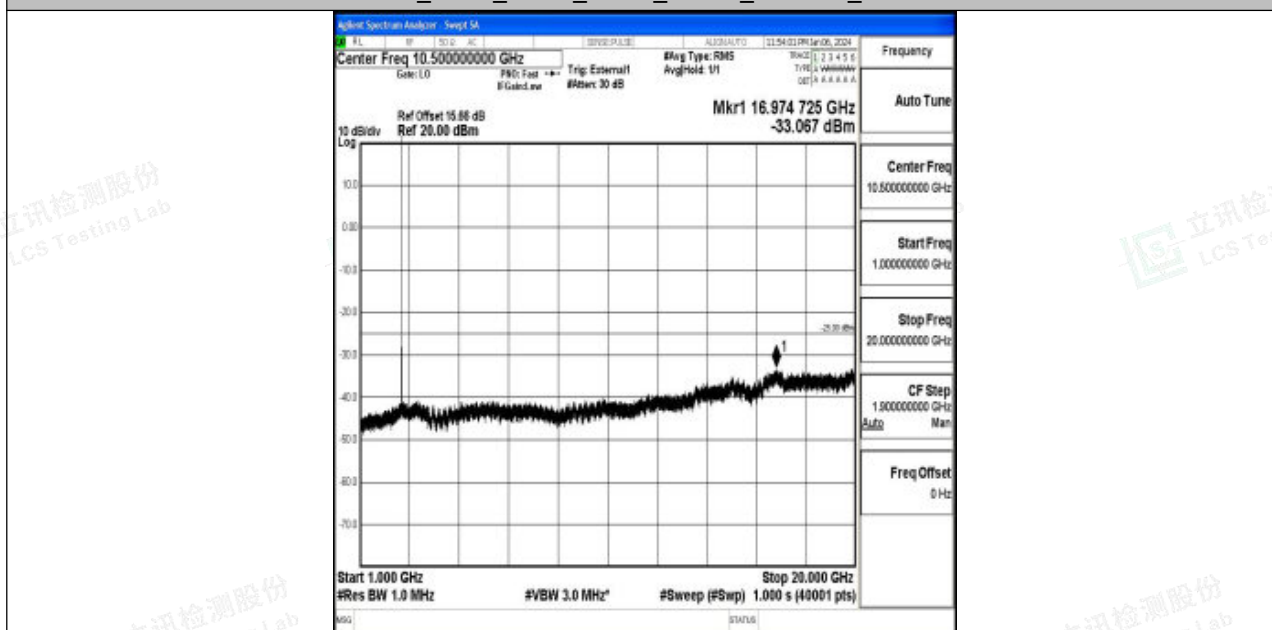

Band41_5MHz_QPSK_40620_1RB#0_1000~20000_1000~20000




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

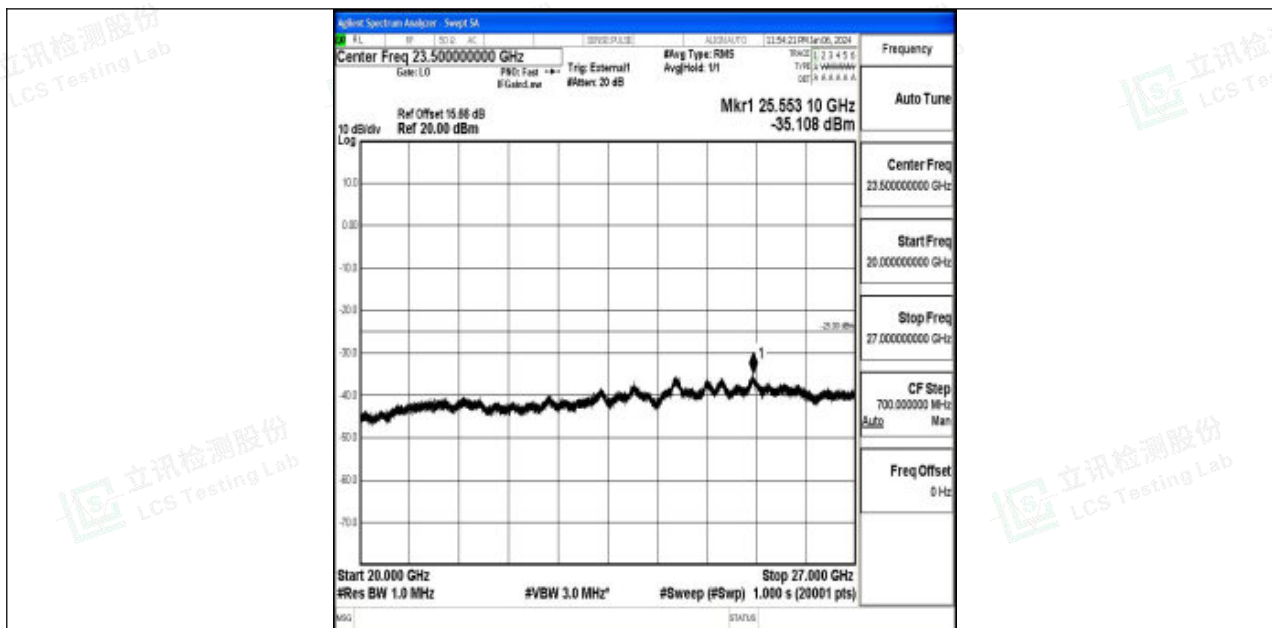

Band41_5MHz_QPSK_40620_1RB#0_20000~27000_20000~27000

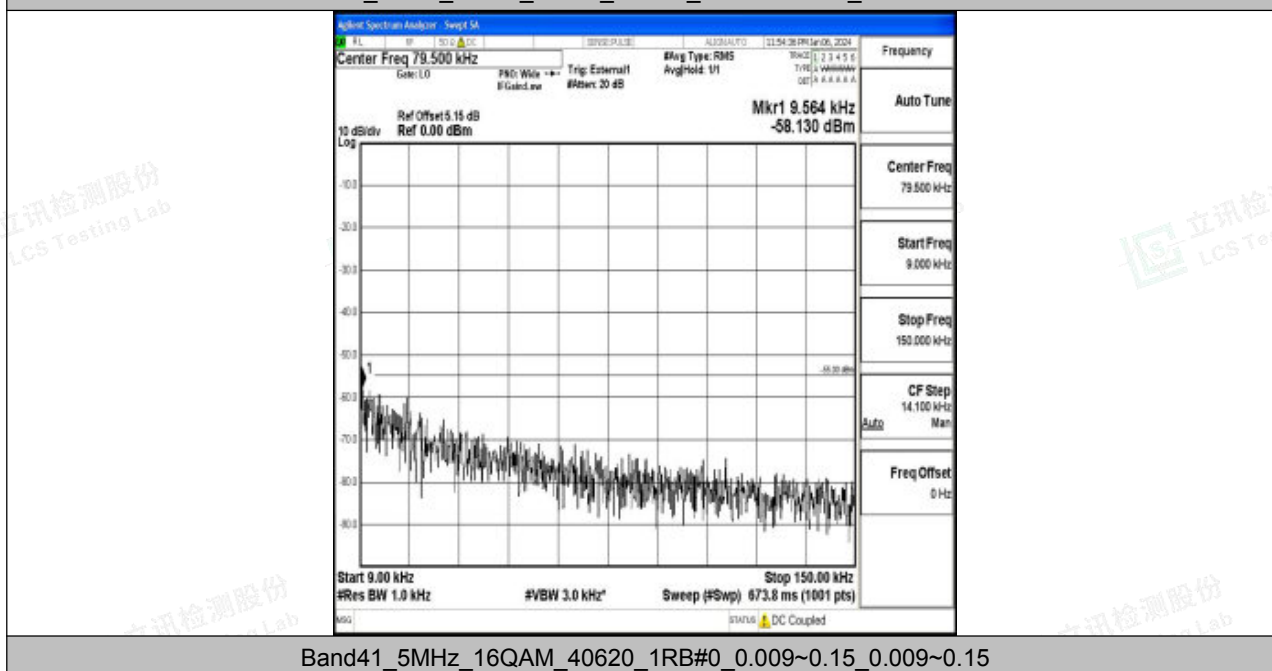

Band41_5MHz_16QAM_40620_1RB#0_0.009~0.15_0.009~0.15




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

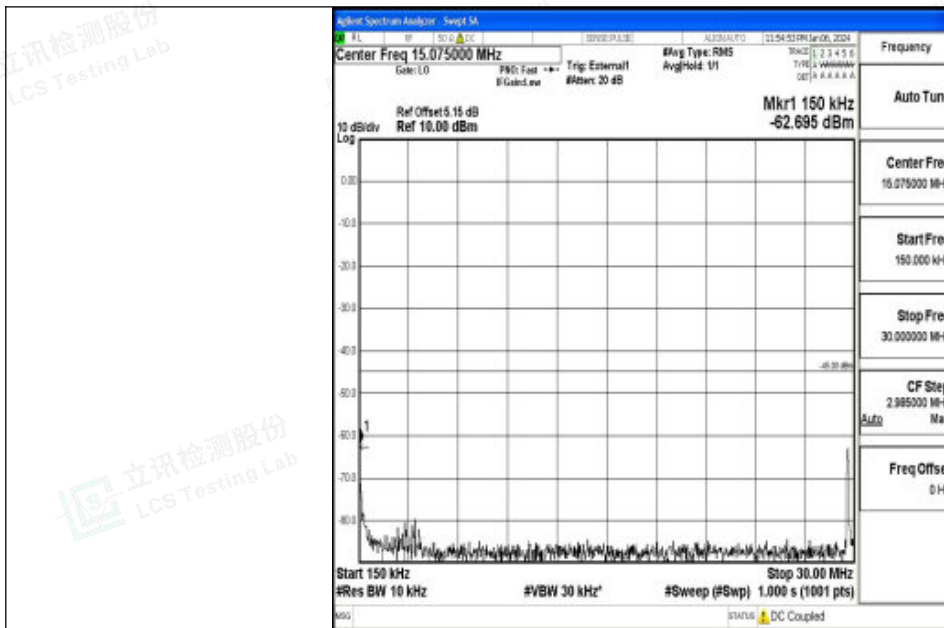


Band41_5MHz_16QAM_40620_1RB#0_0.15~30_0.15~30

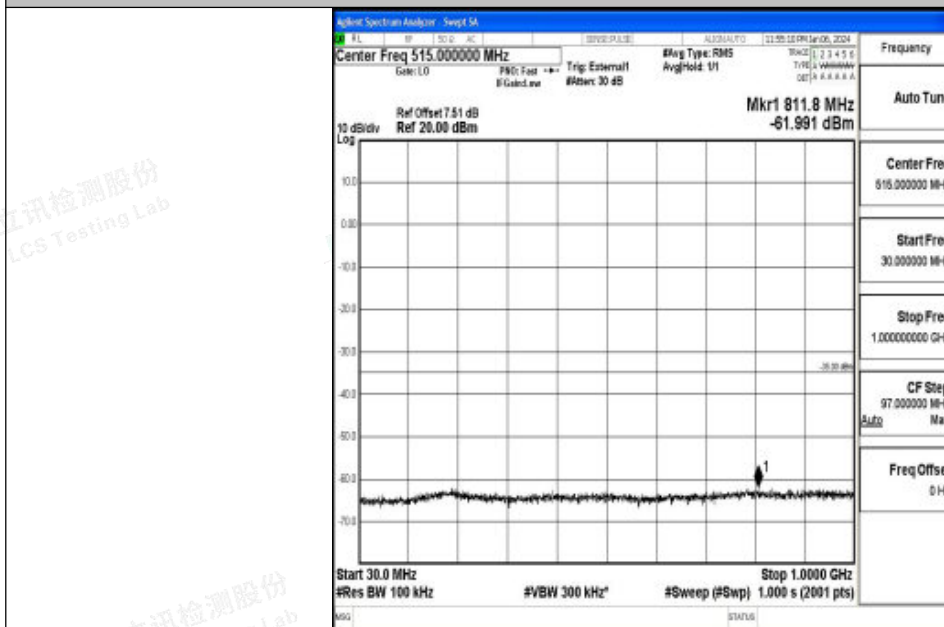


Band41_5MHz_16QAM_40620_1RB#0_30~1000_30~1000



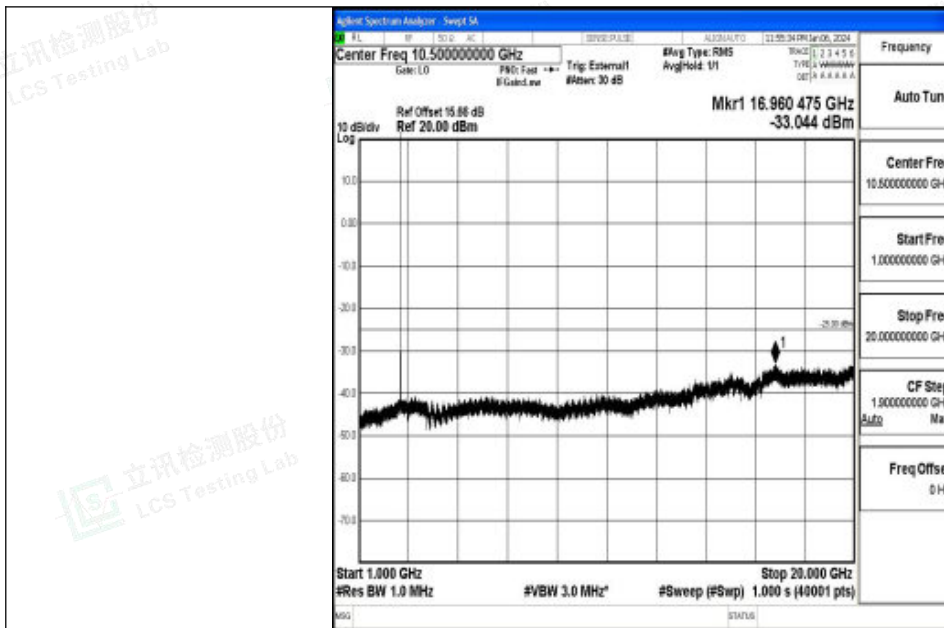

Band41_5MHz_16QAM_40620_1RB#0_1000~20000_1000~20000

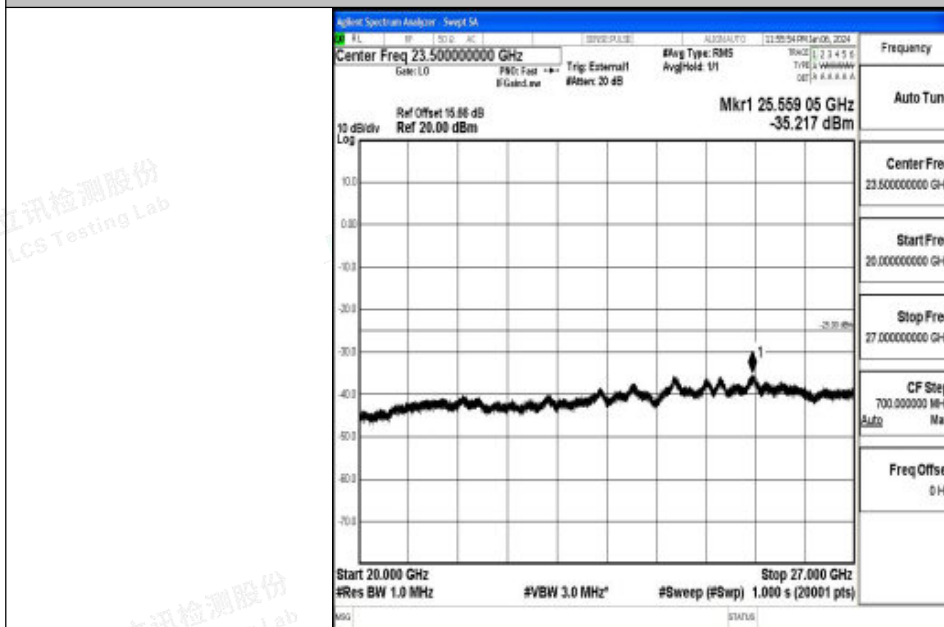

Band41_5MHz_16QAM_40620_1RB#0_20000~27000_20000~27000




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

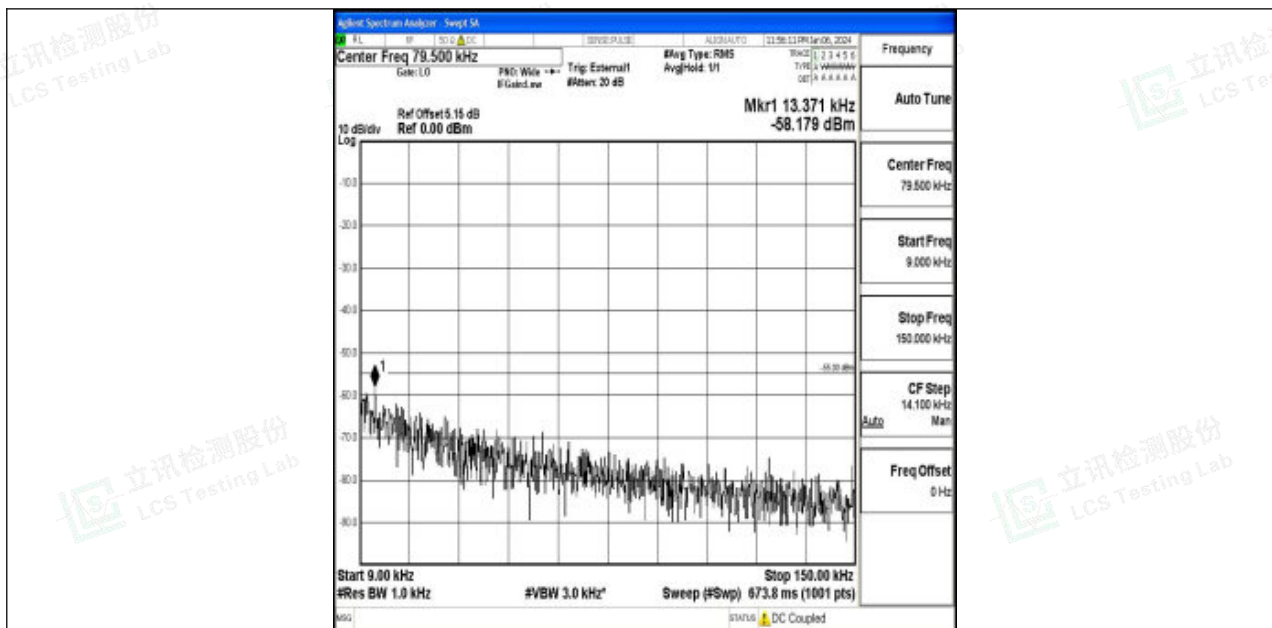

Band41_5MHz_QPSK_41565_1RB#0_0.009~0.15_0.009~0.15

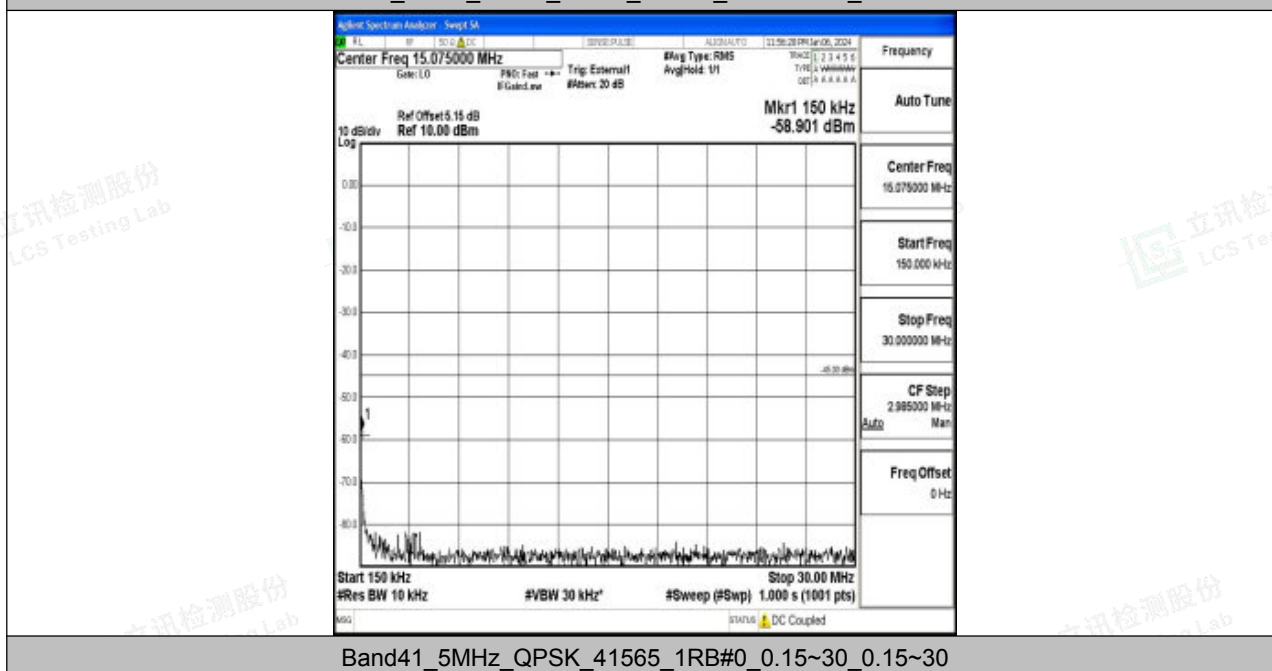

Band41_5MHz_QPSK_41565_1RB#0_0.15~30_0.15~30




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

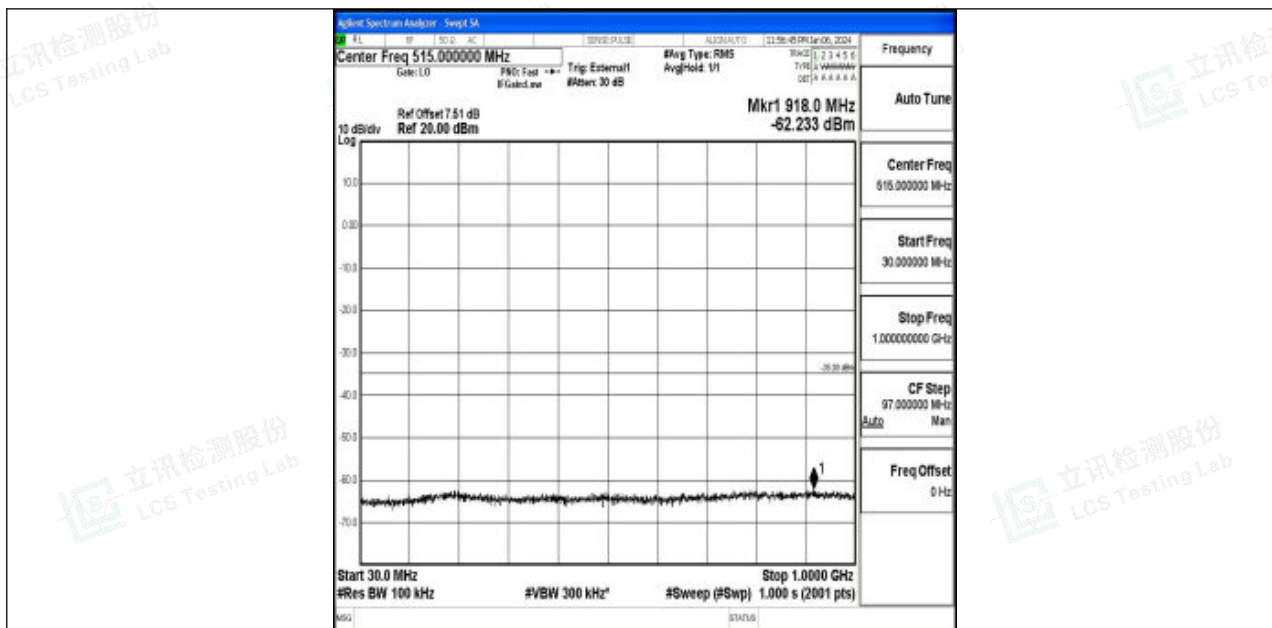

Band41_5MHz_QPSK_41565_1RB#0_30~1000_30~1000

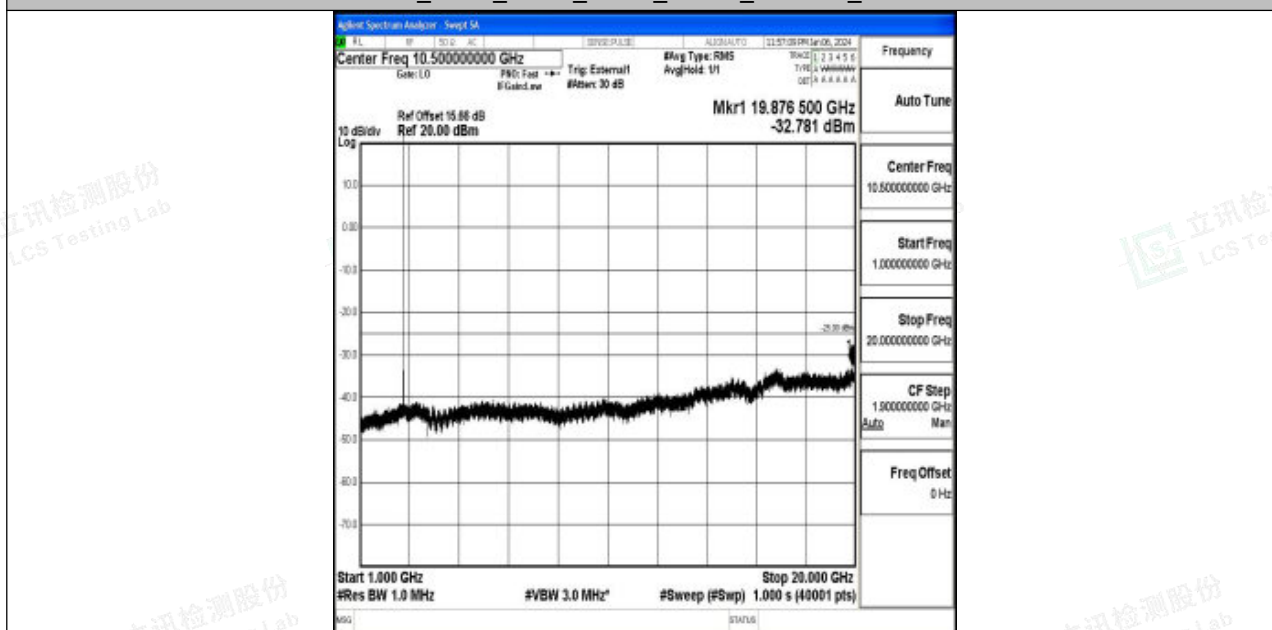

Band41_5MHz_QPSK_41565_1RB#0_1000~20000_1000~20000




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

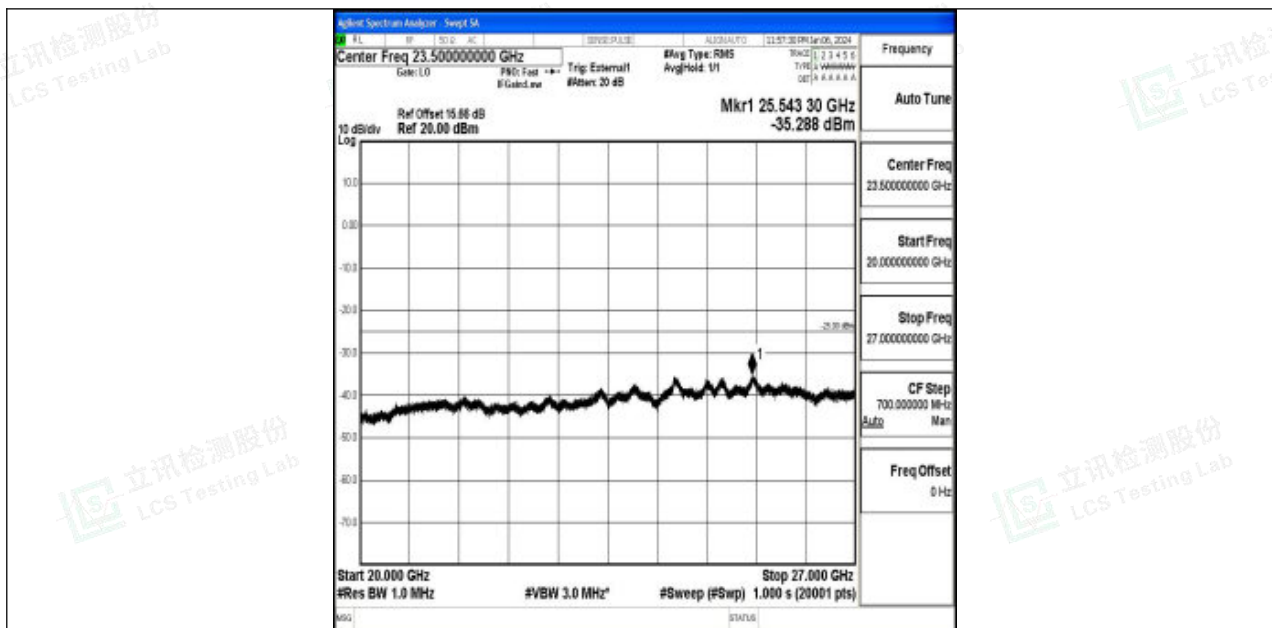

Band41_5MHz_QPSK_41565_1RB#0_20000~27000_20000~27000

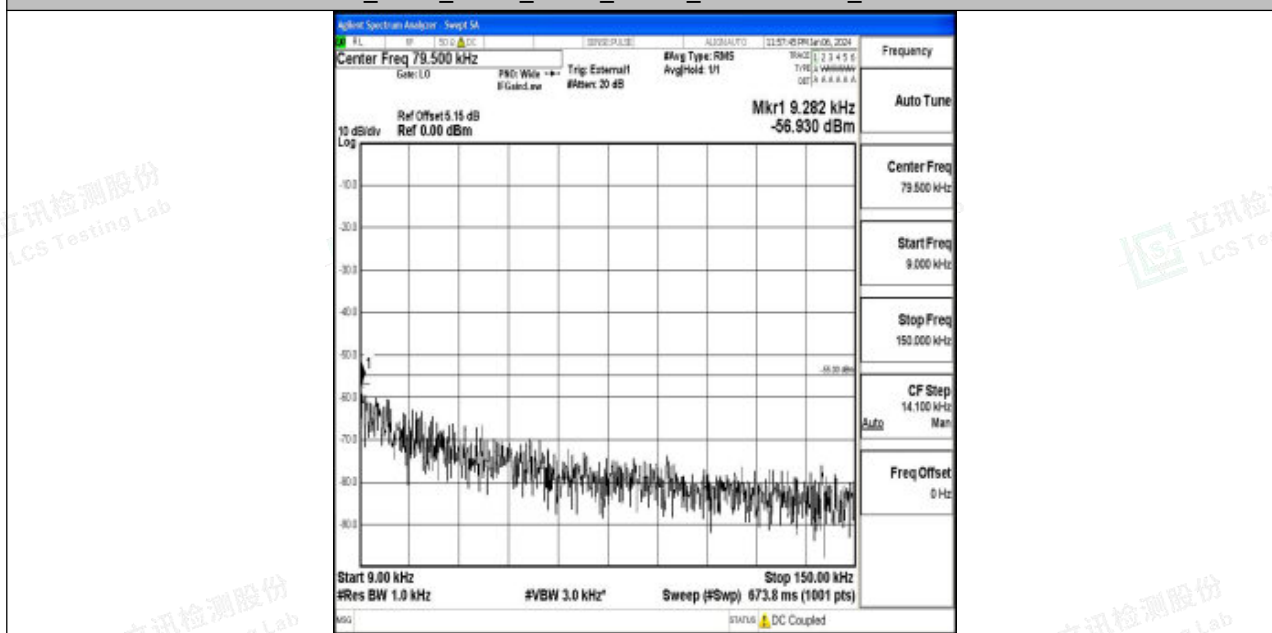

Band41_5MHz_16QAM_41565_1RB#0_0.009~0.15_0.009~0.15





Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China


Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

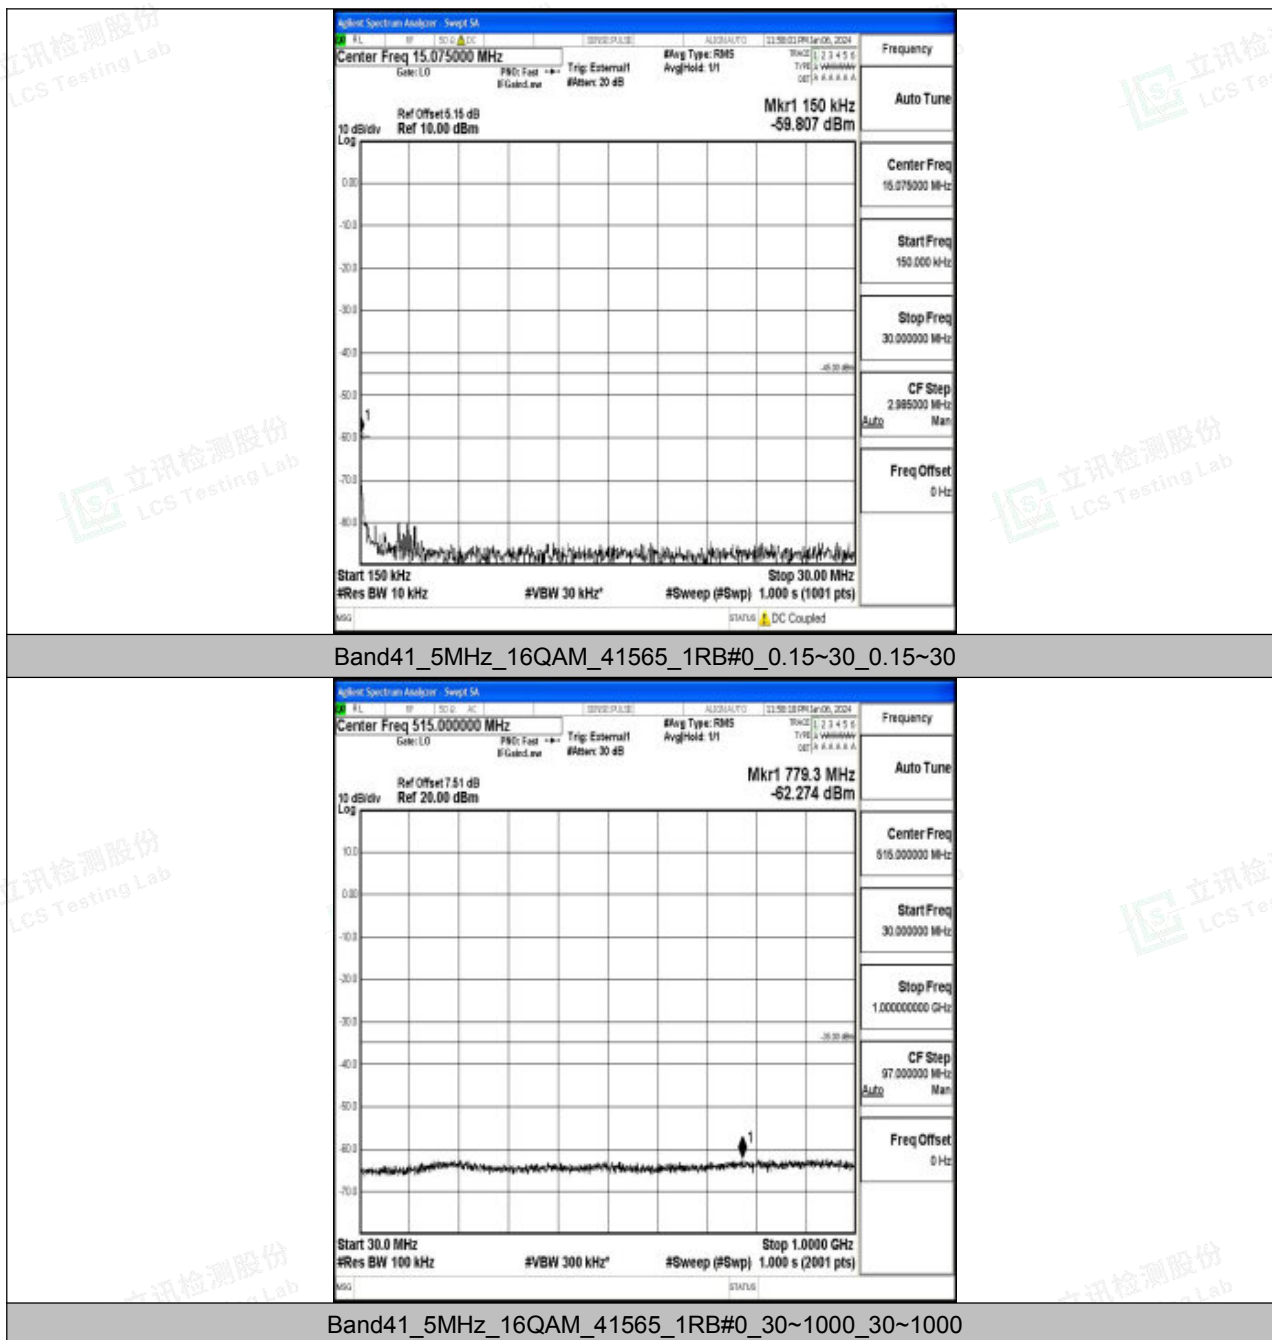

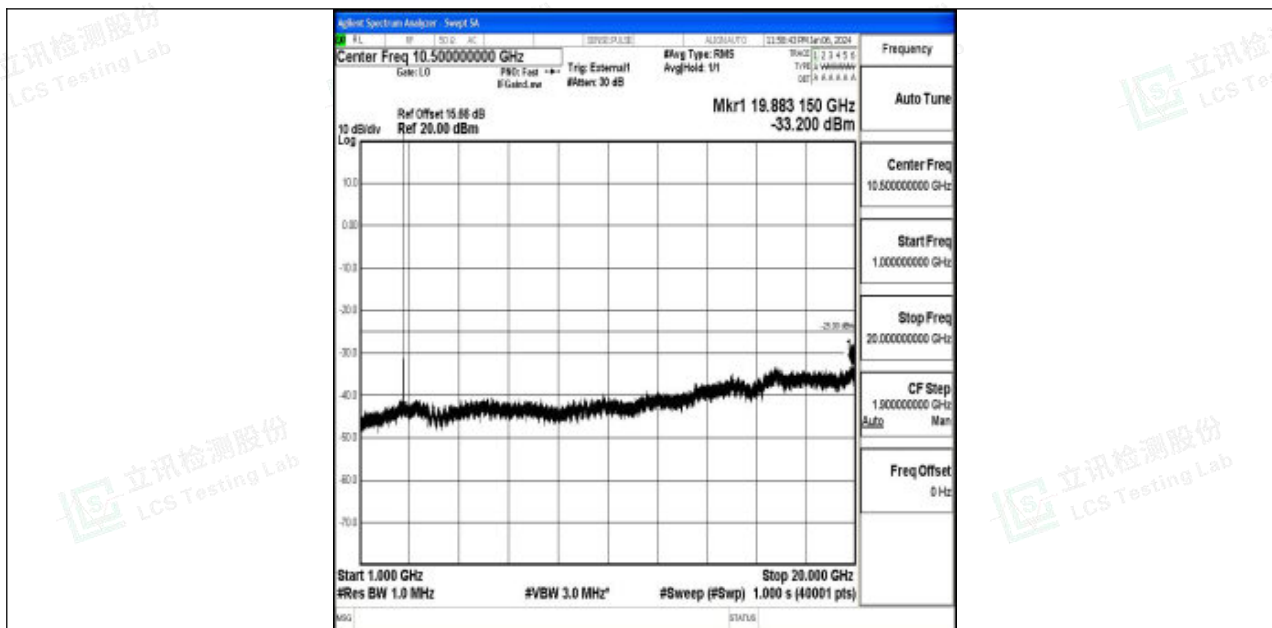

Band41_5MHz_16QAM_41565_1RB#0_1000~20000_1000~20000

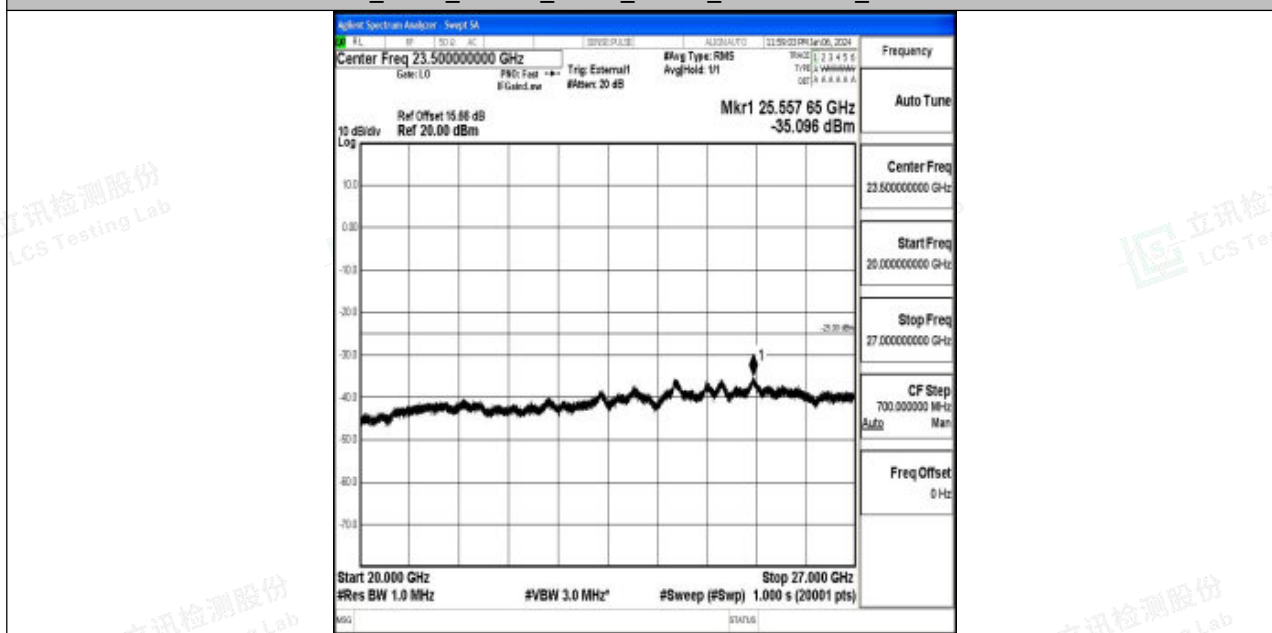

Band41_5MHz_16QAM_41565_1RB#0_20000~27000_20000~27000




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

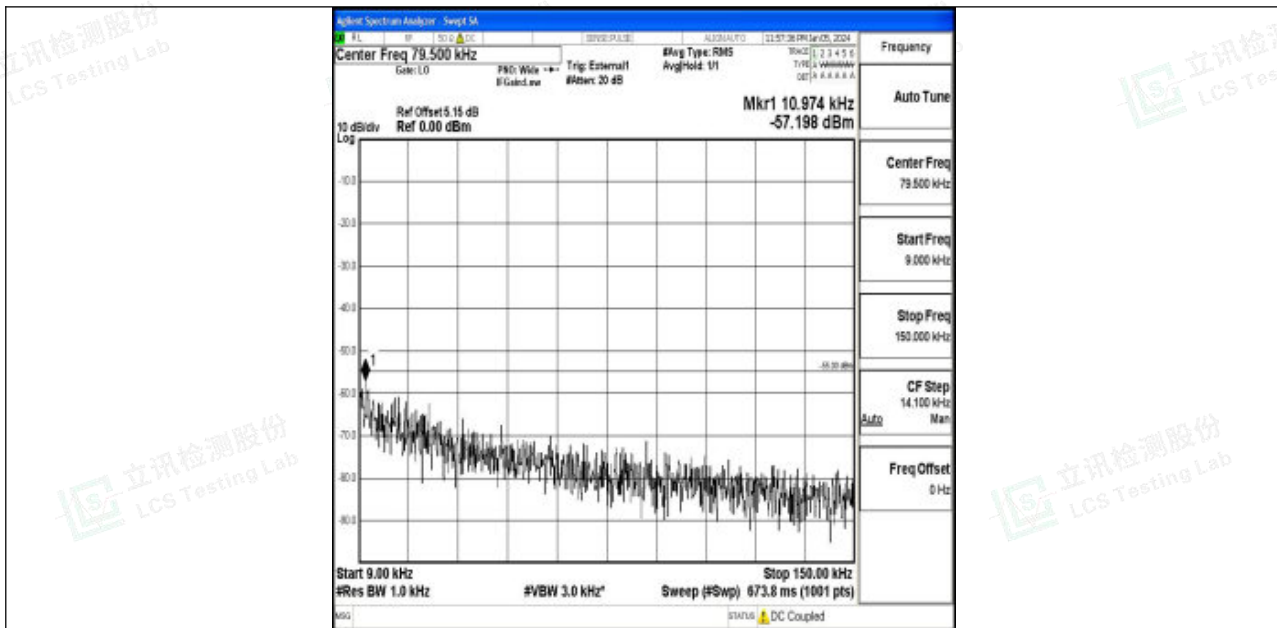

Band41_10MHz_QPSK_39700_1RB#0_0.009~0.15_0.009~0.15

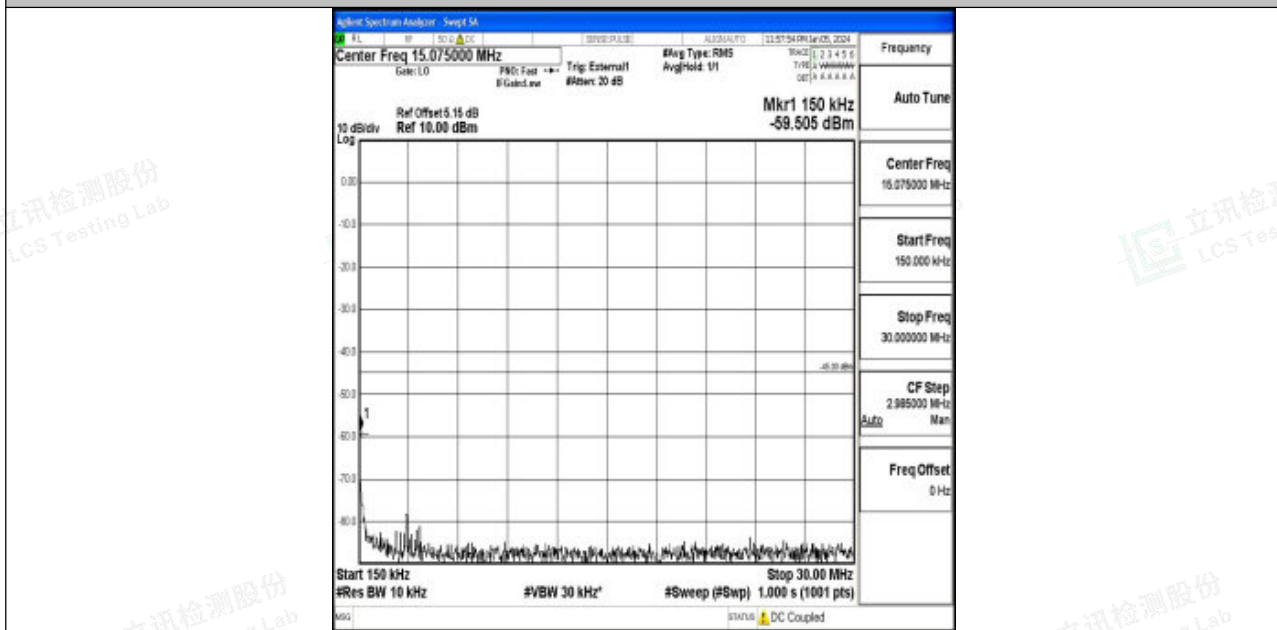

Band41_10MHz_QPSK_39700_1RB#0_0.15~30_0.15~30

