

Appendix Test Data

Report No.:	1812C50568512501-01	Test Sample No.:	1-2-2
Start Test Date:	2025-10-31	Finish Test Date:	2025-12-1
Test Engineer:	Alex Peng	Auditor:	Justin Feng
Temperature:	25.9°C	Relative Humidity:	51%
Pressure:	101kPa		




Appendix A: 20dB Bandwidth

Test Result

Test Mode	Antenna	Frequency [MHz]	20db EBW[MHz]	FL[MHz]	FH[MHz]	Limit[MHz]	Verdict
DH5	Ant1	2402	1.041	2401.481	2402.522	---	---
DH5	Ant1	2441	1.047	2440.481	2441.528	---	---
DH5	Ant1	2480	1.050	2479.478	2480.528	---	---
2DH5	Ant1	2402	1.317	2401.355	2402.672	---	---
2DH5	Ant1	2441	1.296	2440.370	2441.666	---	---
2DH5	Ant1	2480	1.341	2479.331	2480.672	---	---
3DH5	Ant1	2402	1.305	2401.358	2402.663	---	---
3DH5	Ant1	2441	1.302	2440.358	2441.660	---	---
3DH5	Ant1	2480	1.308	2479.352	2480.660	---	---


Test Graphs

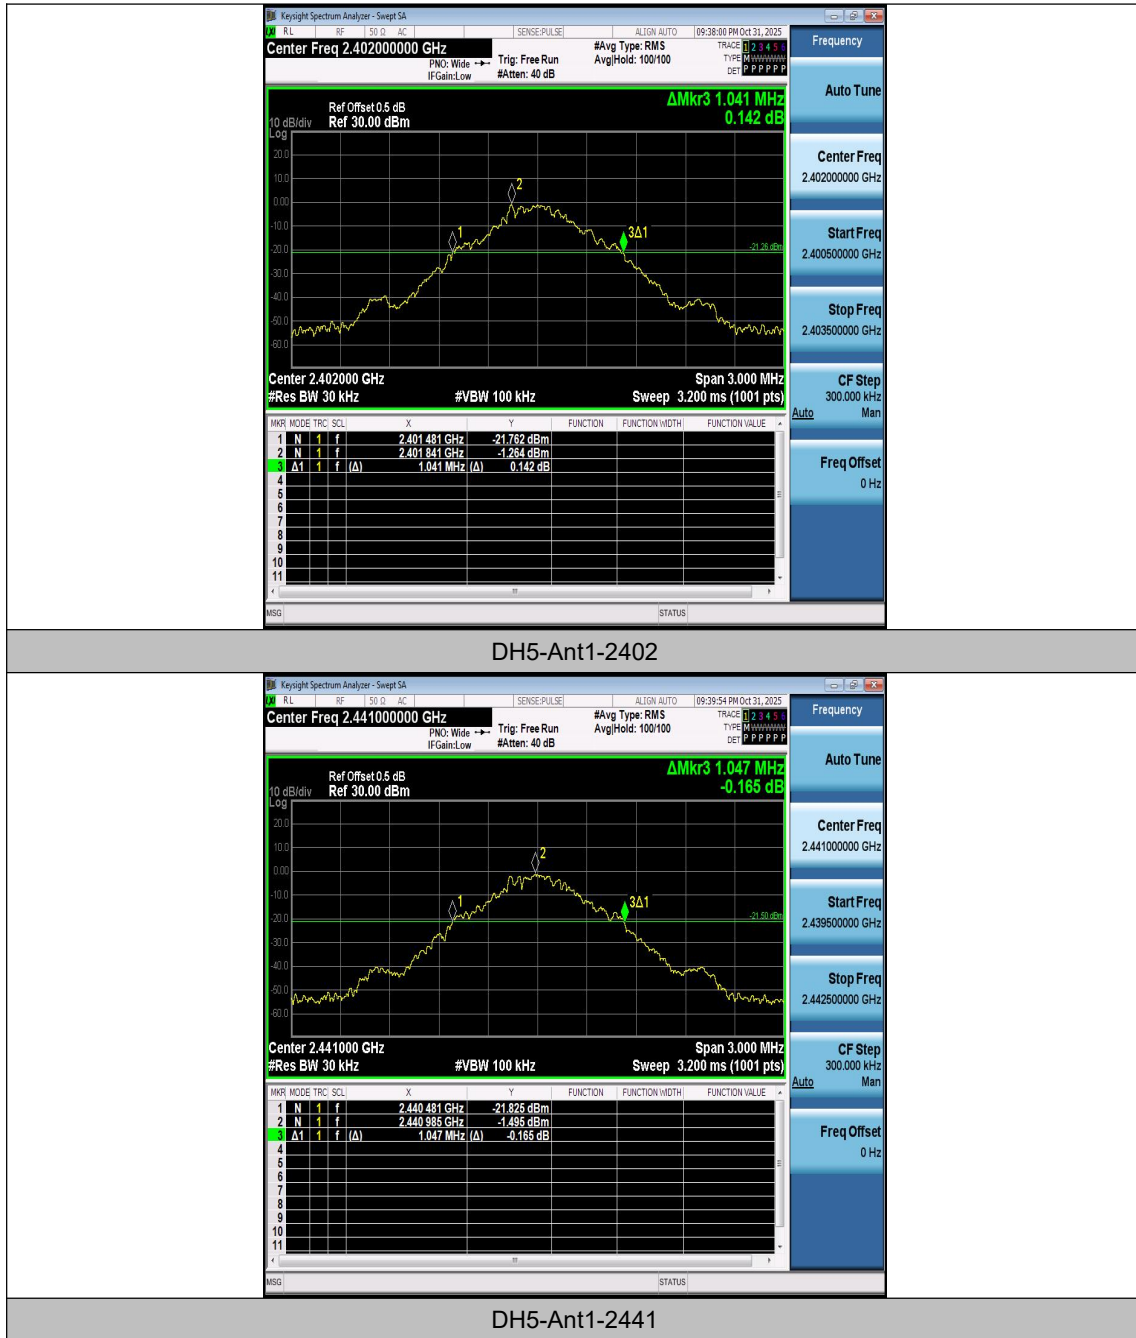



Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

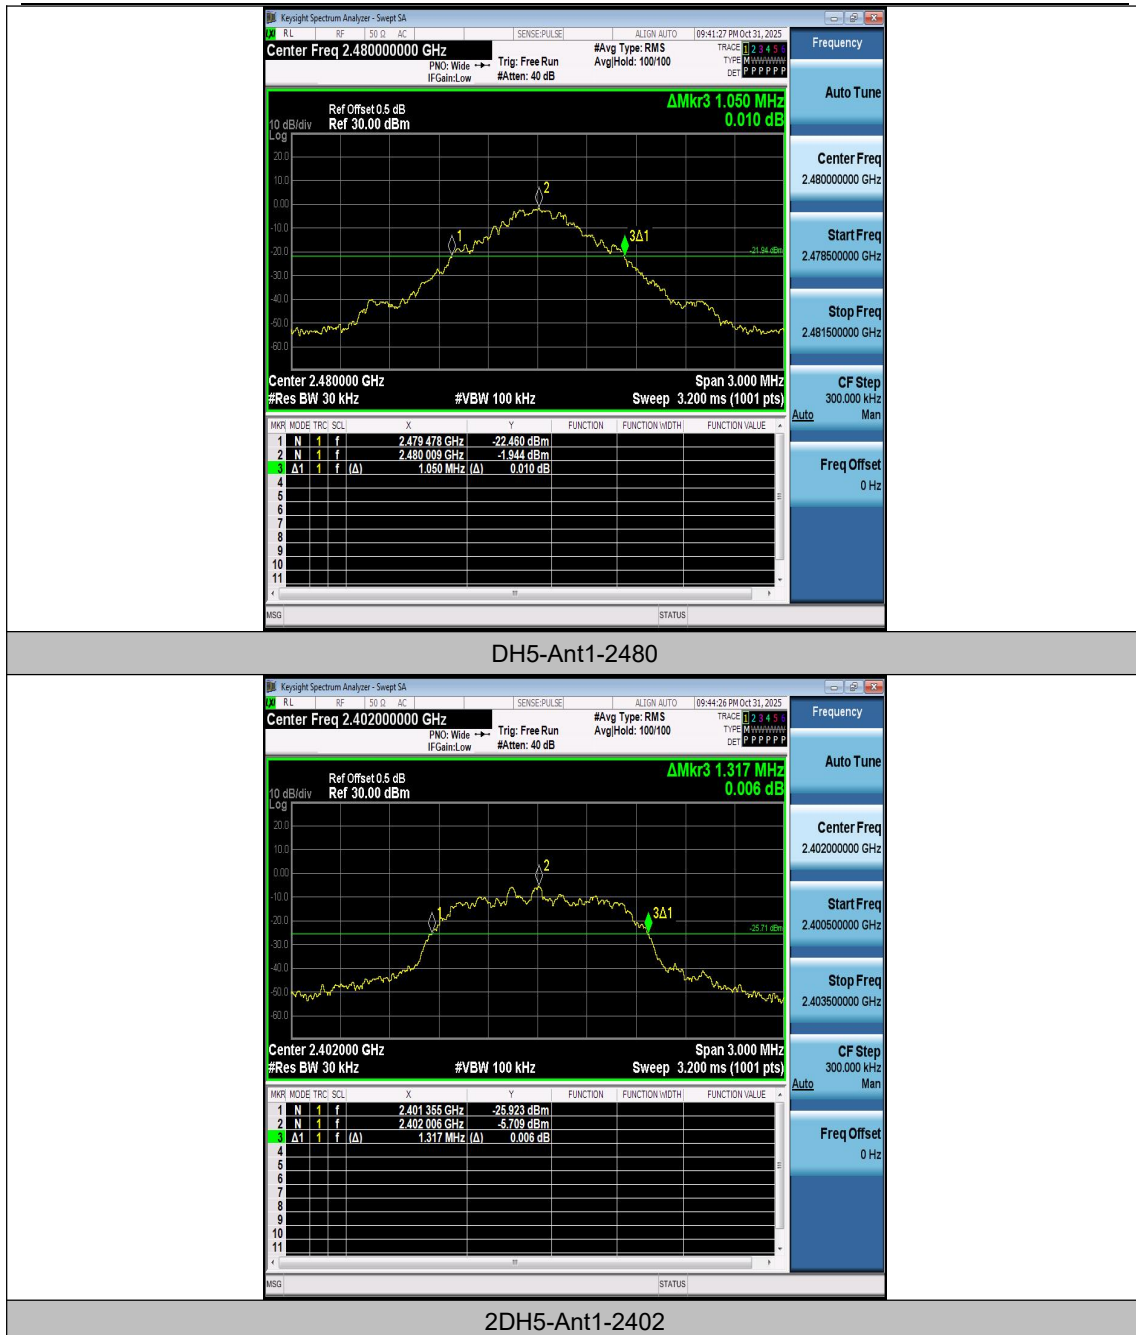

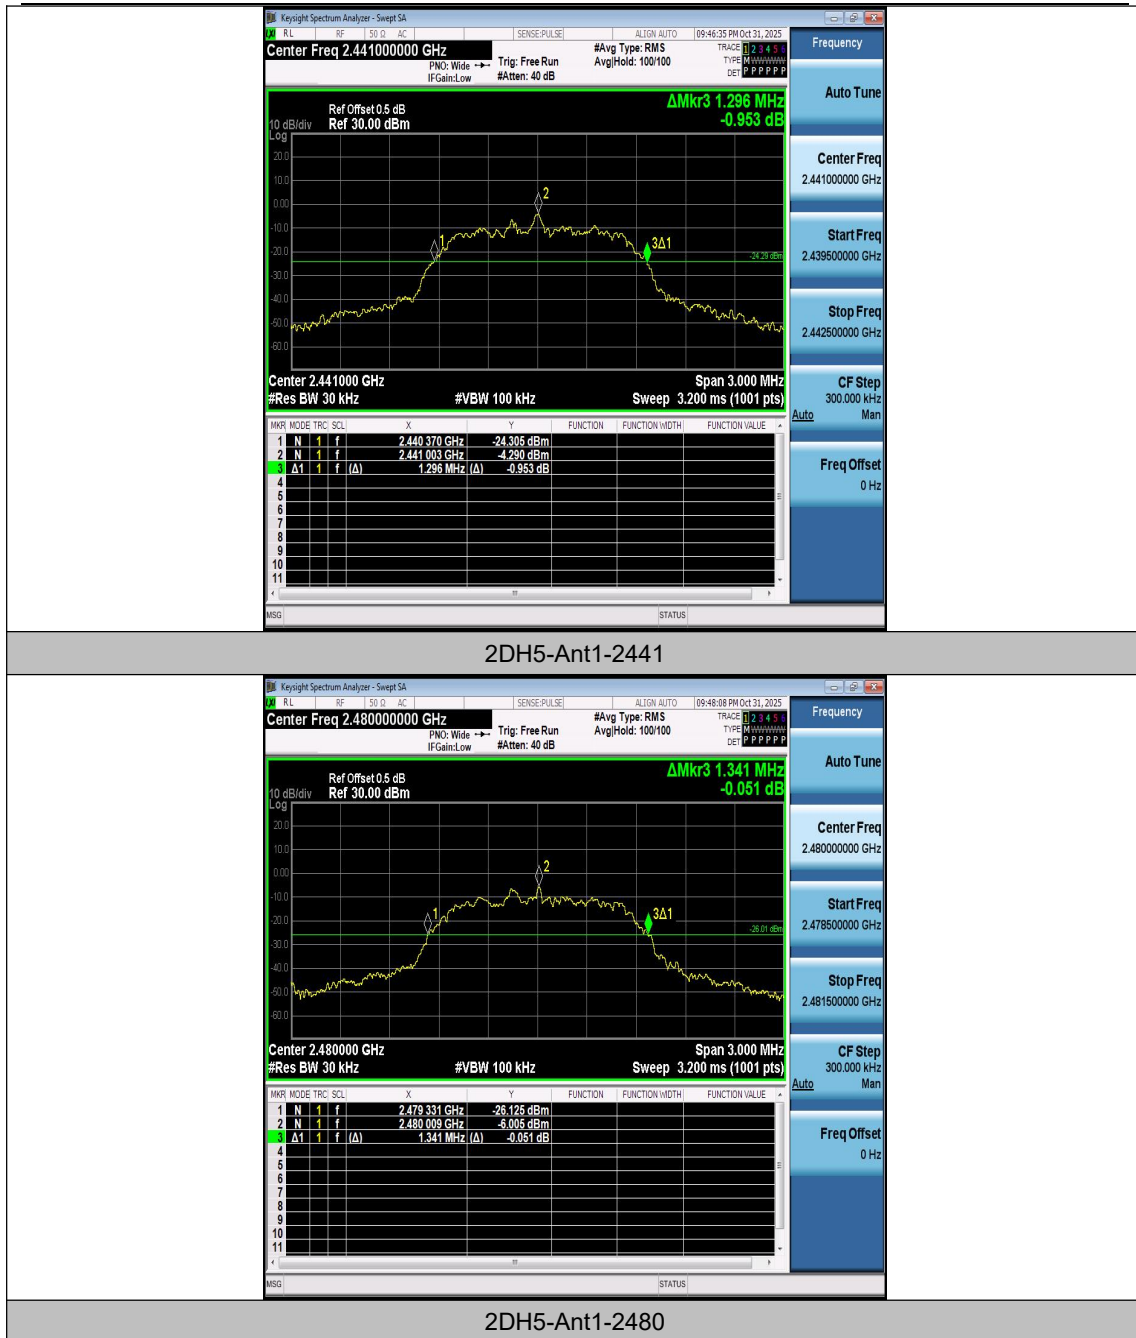

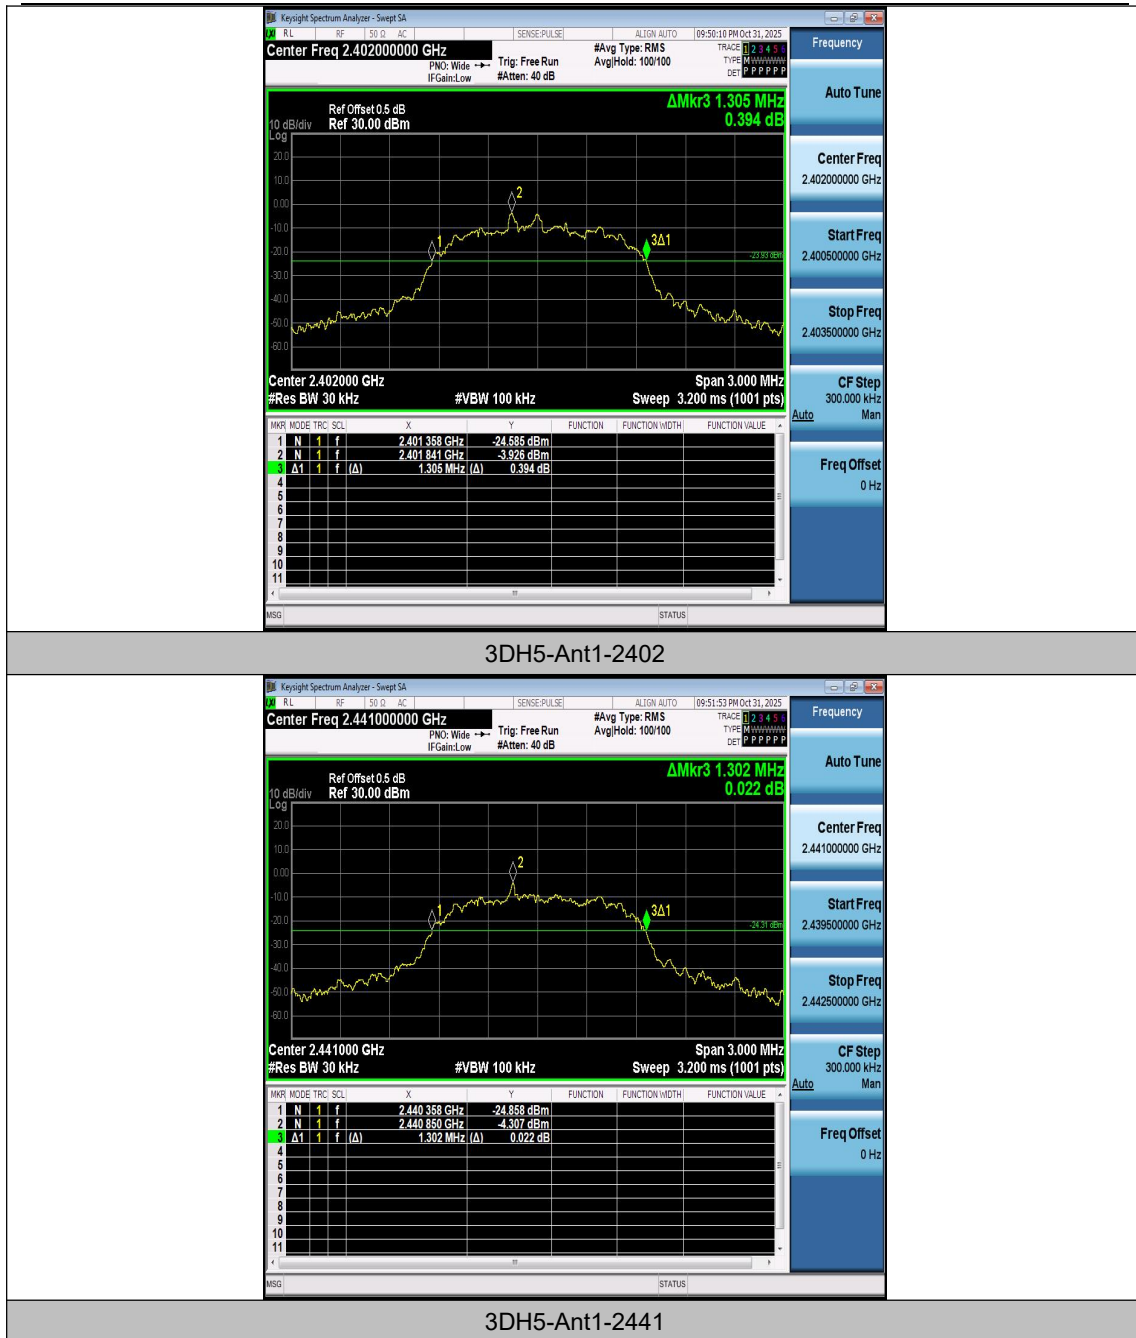

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com



Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

Appendix B: 99% Occupied Bandwidth

Test Result

Test Mode	Antenna	Frequency [MHz]	OCB [MHz]	FL[MHz]	FH[MHz]	Limit[MHz]	Verdict
DH5	Ant1	2402	0.91725	2401.5407	2402.4580	---	---
DH5	Ant1	2441	0.94664	2440.5294	2441.4760	---	---
DH5	Ant1	2480	0.93371	2479.5313	2480.4650	---	---
2DH5	Ant1	2402	1.1855	2401.4109	2402.5964	---	---
2DH5	Ant1	2441	1.2027	2440.4065	2441.6092	---	---
2DH5	Ant1	2480	1.2042	2479.4073	2480.6115	---	---
3DH5	Ant1	2402	1.2074	2401.3995	2402.6069	---	---
3DH5	Ant1	2441	1.2249	2440.3912	2441.6161	---	---
3DH5	Ant1	2480	1.1991	2479.4087	2480.6078	---	---

Test Graphs



Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com



Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com






Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

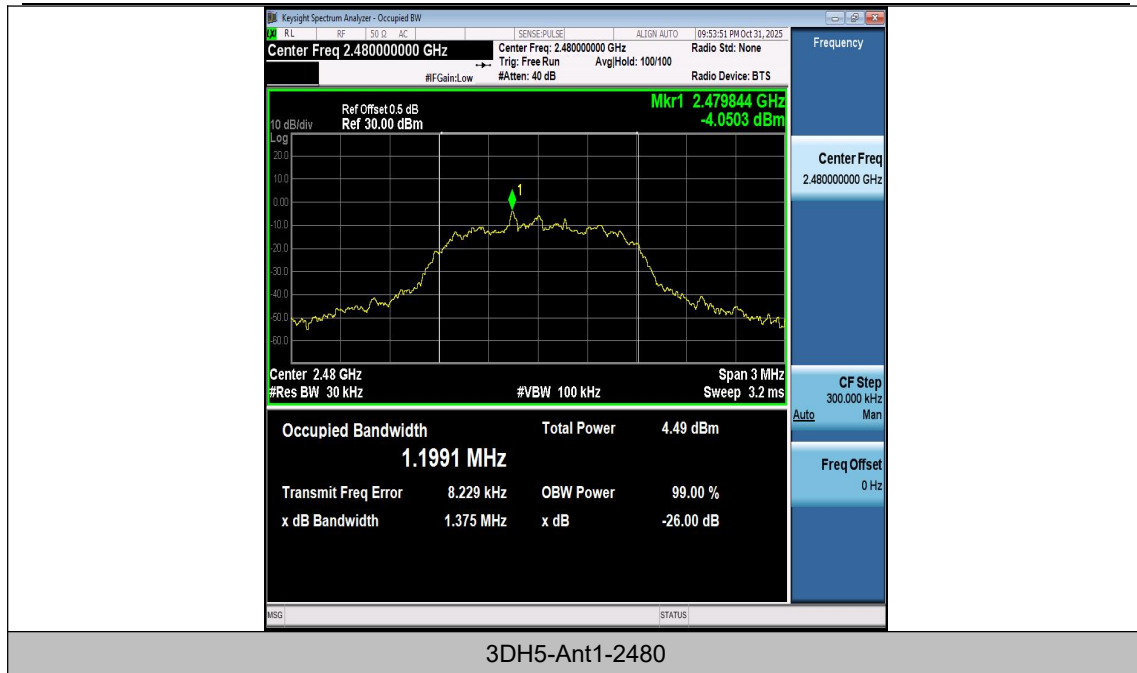

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com


Appendix C: Maximum Conducted Output Power

Test Result Peak (Left earphone)

Test Mode	Antenna	Frequency[MHz]	Conducted Peak Power[dBm]	Conducted Limit[dBm]	Verdict
DH5	Ant1	2402	1.23	≤20.97	PASS
DH5	Ant1	2441	1.27	≤20.97	PASS
DH5	Ant1	2480	1.05	≤20.97	PASS
2DH5	Ant1	2402	-0.62	≤20.97	PASS
2DH5	Ant1	2441	-0.66	≤20.97	PASS
2DH5	Ant1	2480	-0.80	≤20.97	PASS
3DH5	Ant1	2402	-0.16	≤20.97	PASS
3DH5	Ant1	2441	-0.18	≤20.97	PASS
3DH5	Ant1	2480	-0.42	≤20.97	PASS

Test Graphs

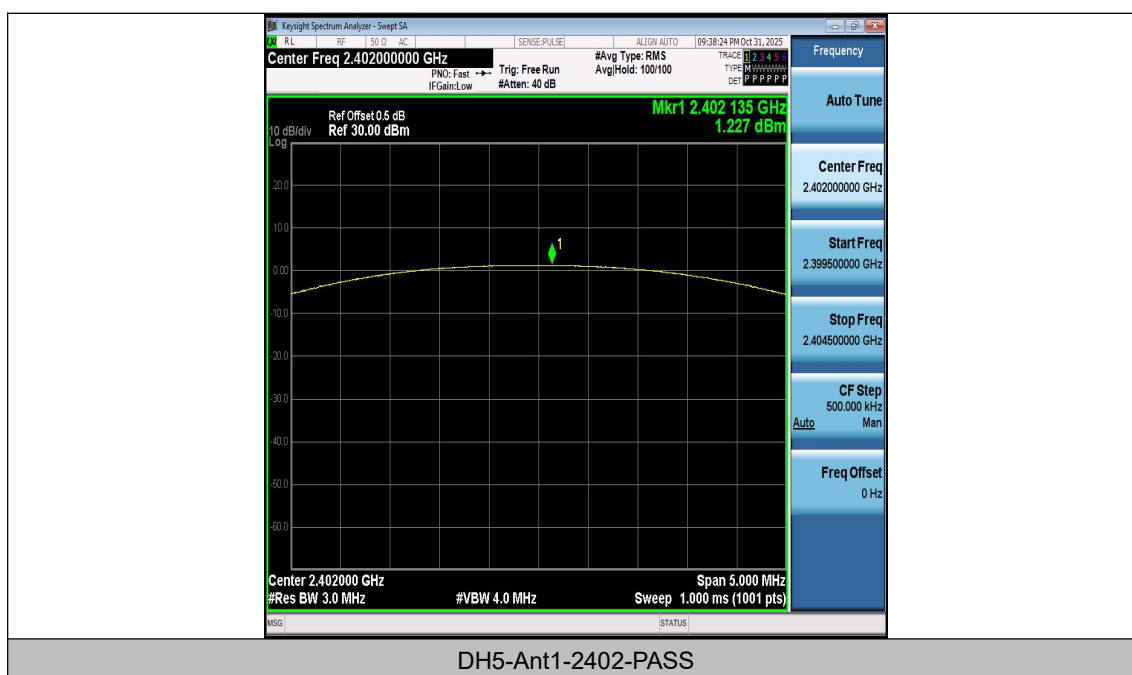


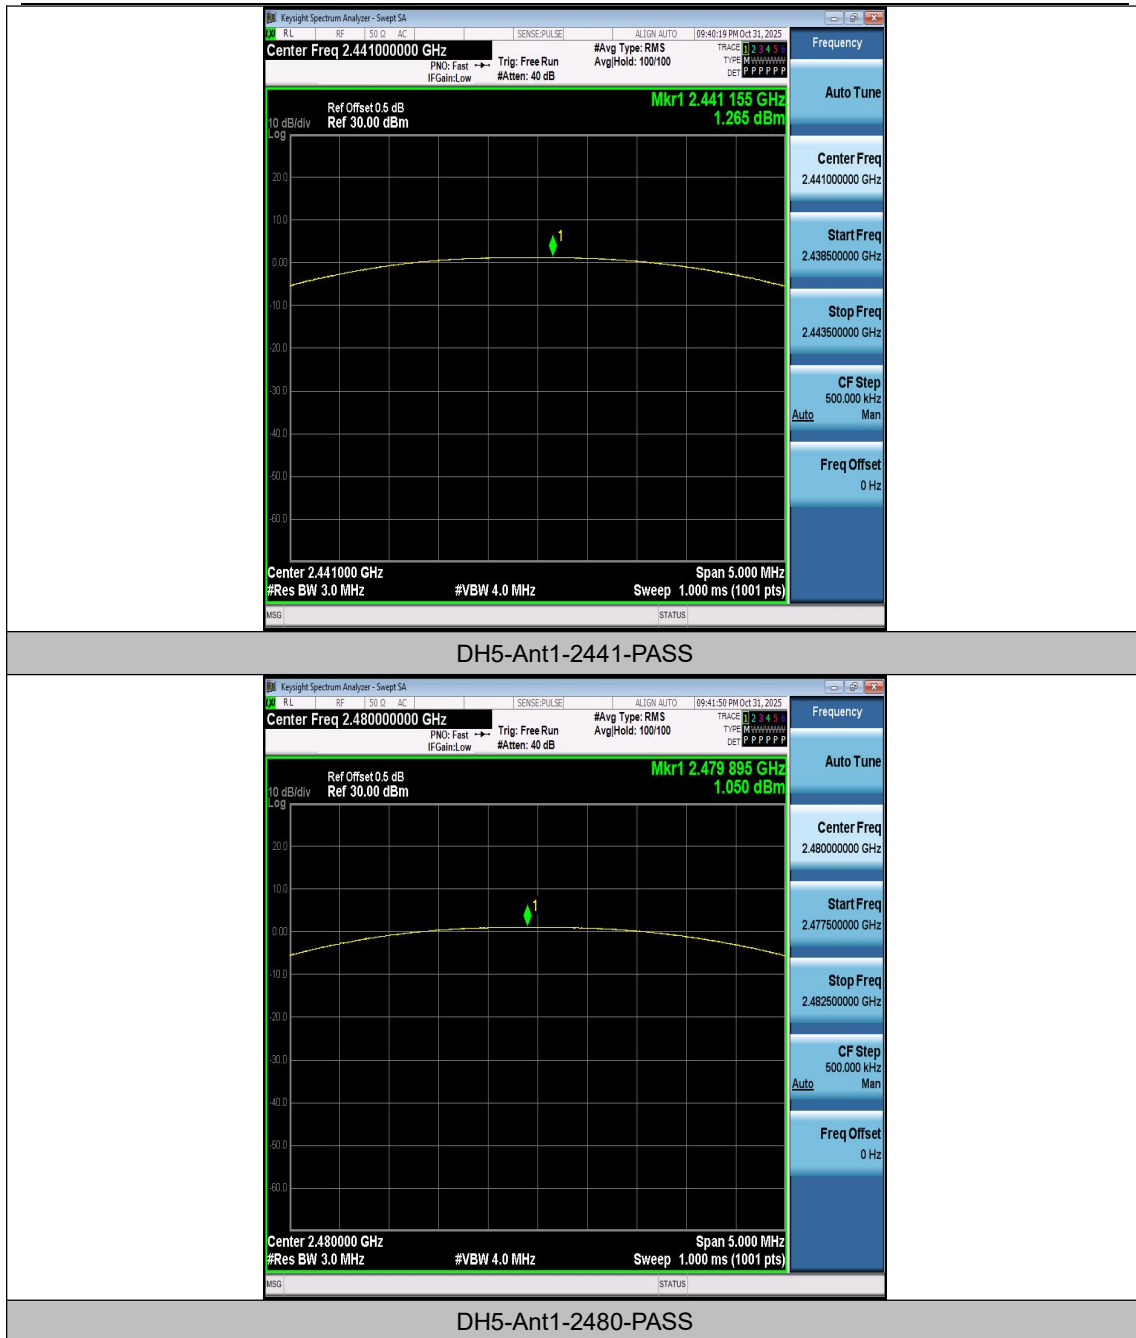

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

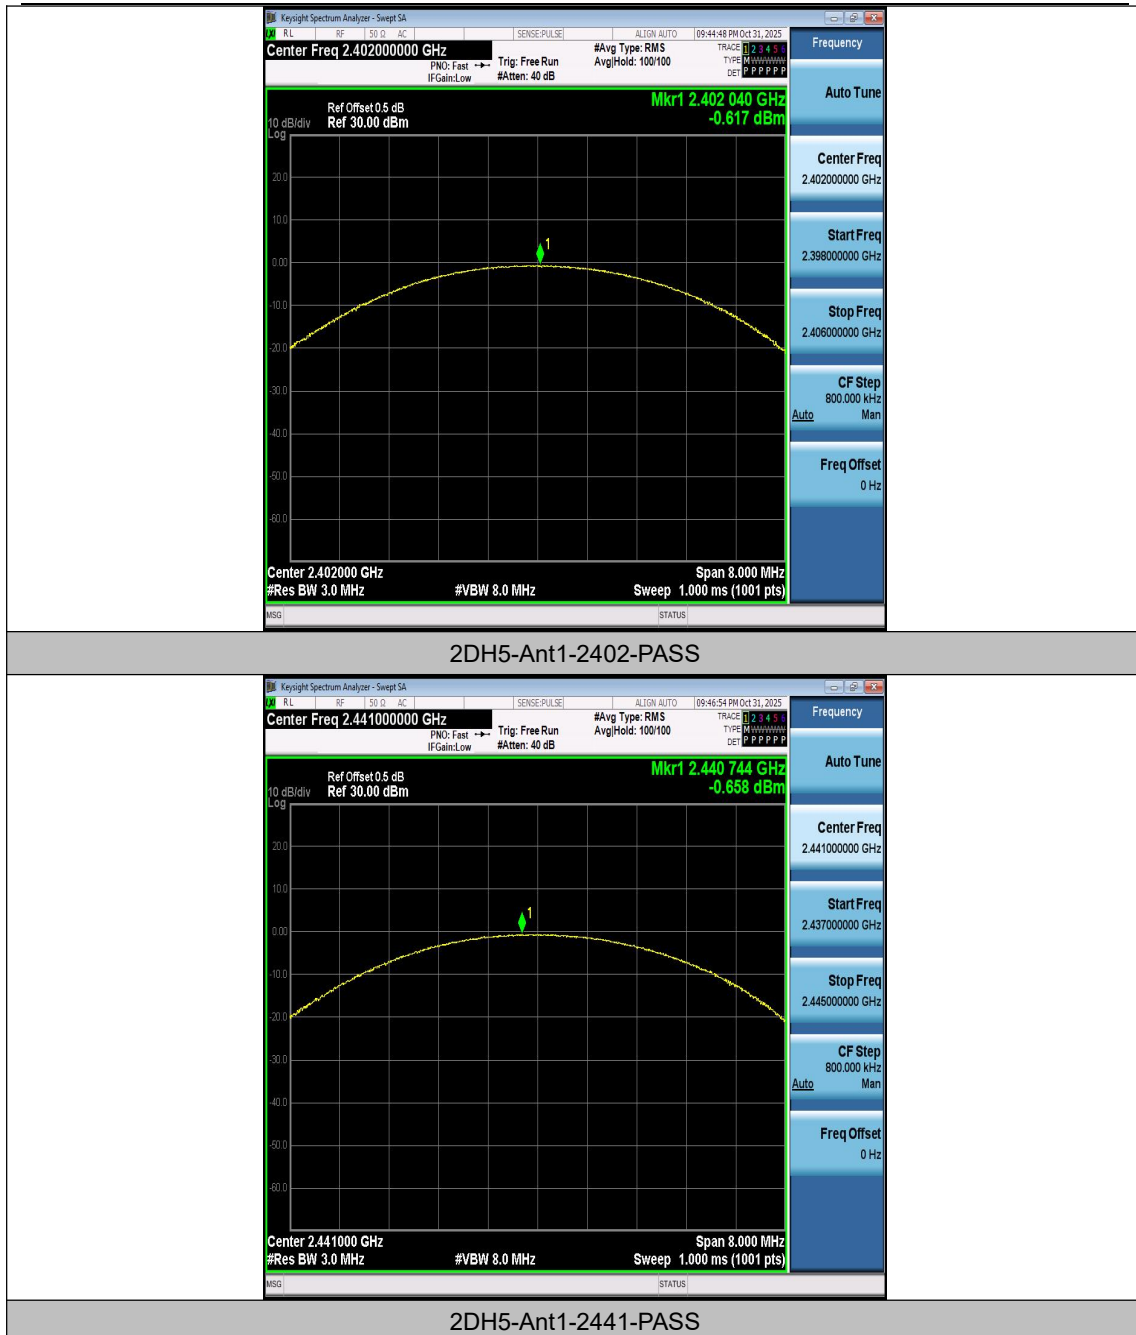

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

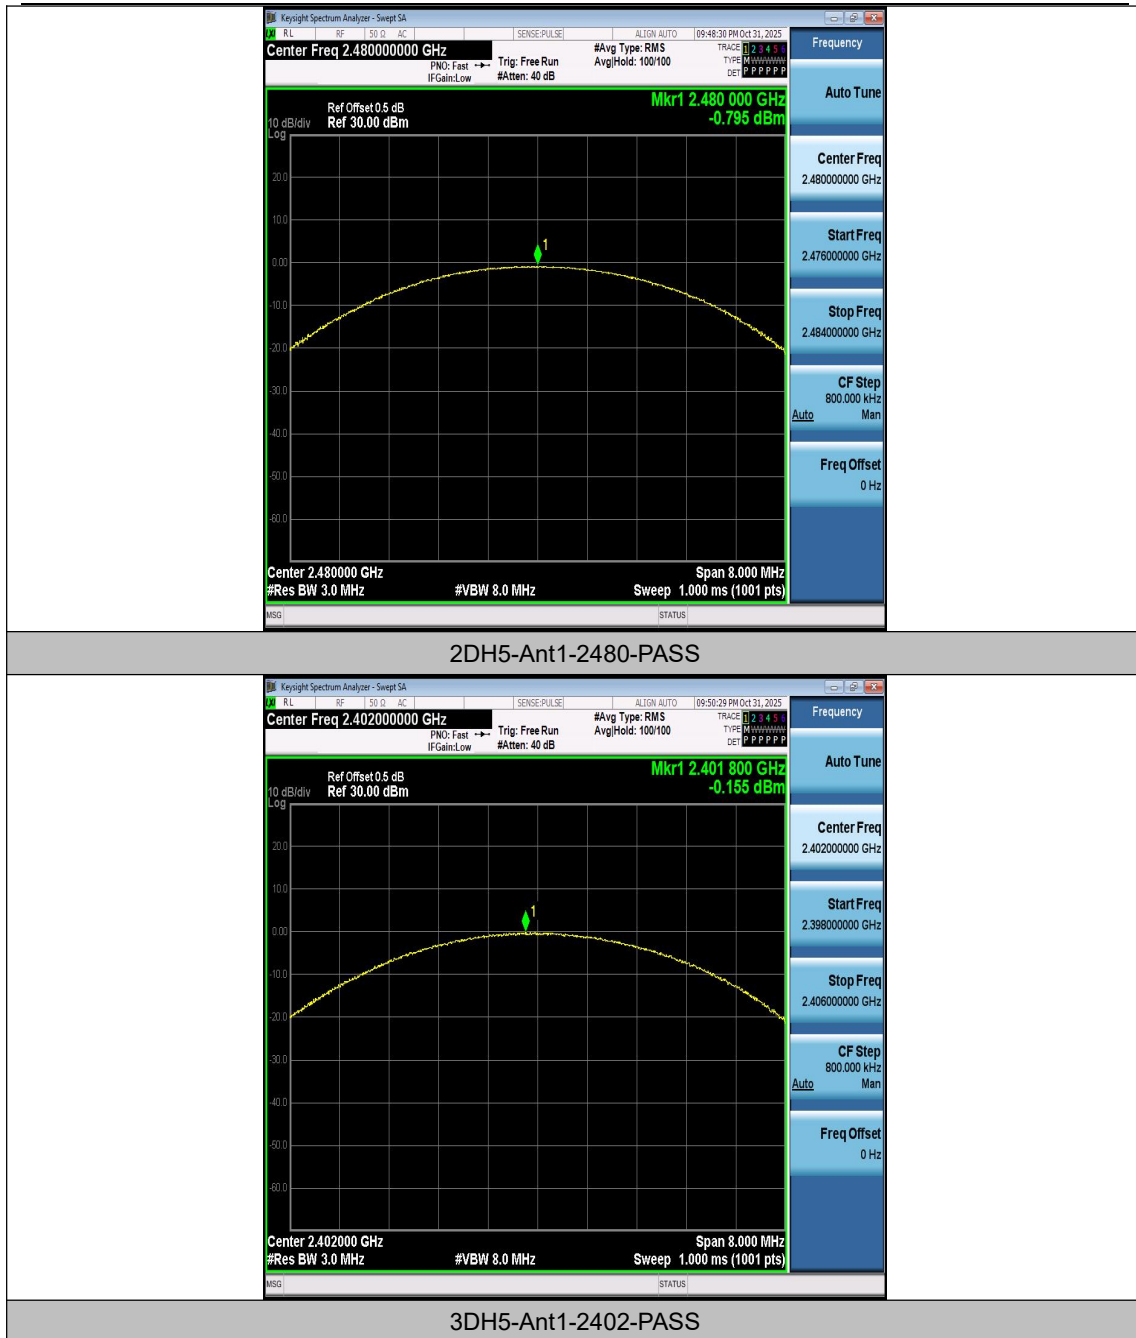

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

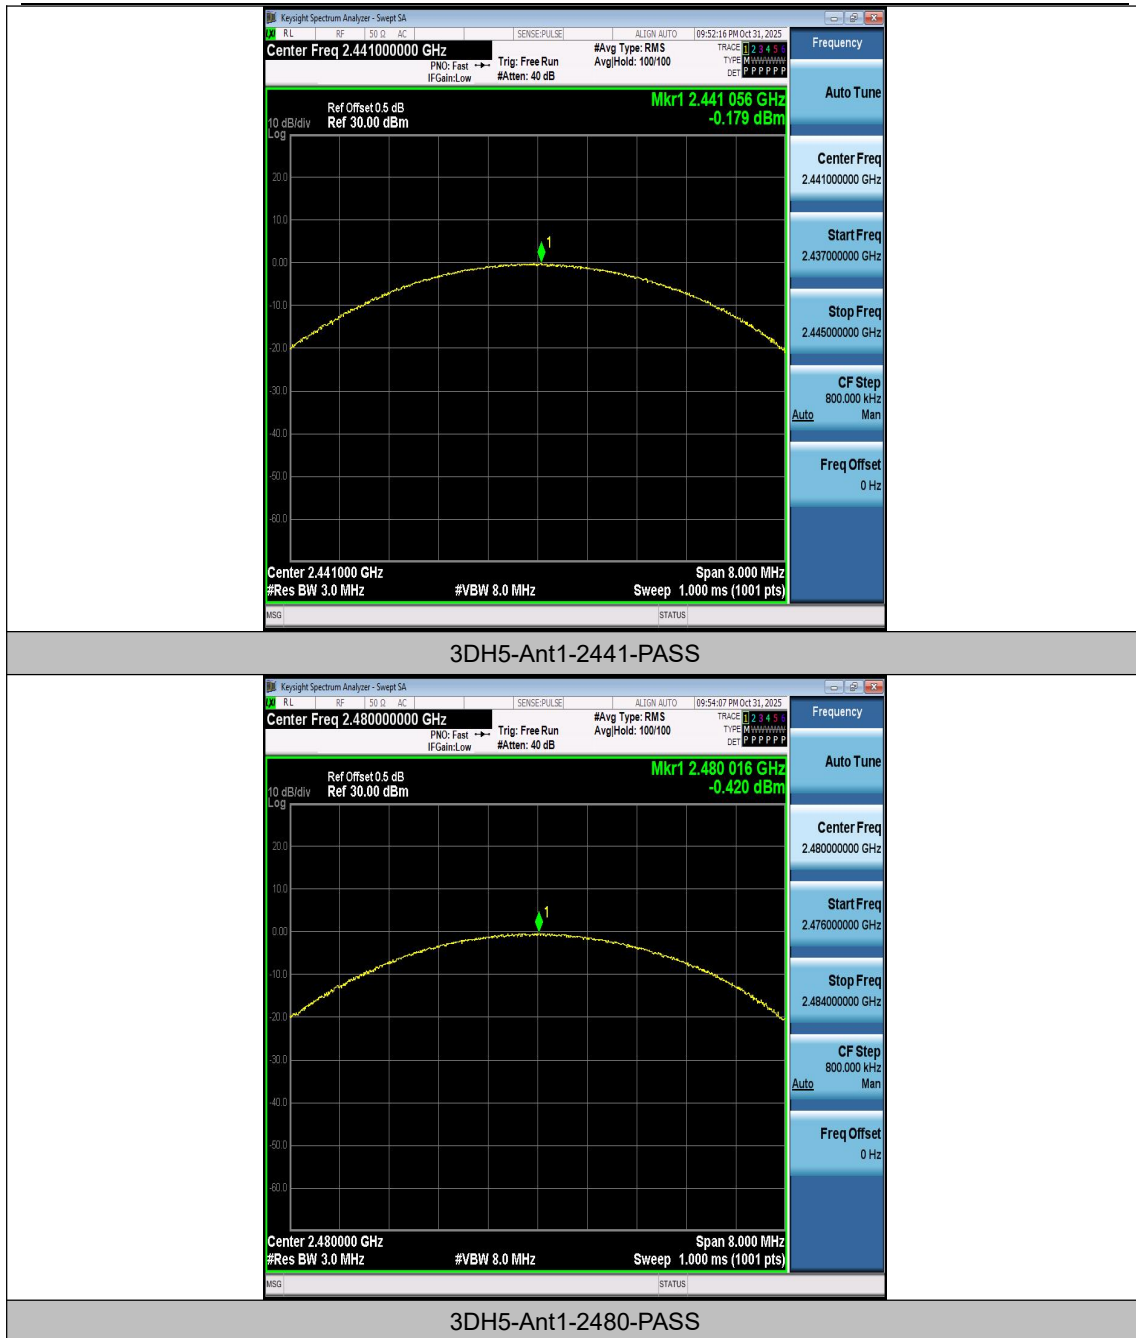

Shenzhen Anbotek Compliance Laboratory Limited


Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

Test Result Peak (Right earphone)

Test Mode	Antenna	Frequency[MHz]	Conducted Peak Power[dBm]	Conducted Limit[dBm]	Verdict
DH5	Ant1	2402	0.17	≤20.97	PASS
DH5	Ant1	2441	0.80	≤20.97	PASS
DH5	Ant1	2480	1.08	≤20.97	PASS
2DH5	Ant1	2402	0.99	≤20.97	PASS
2DH5	Ant1	2441	1.64	≤20.97	PASS
2DH5	Ant1	2480	1.91	≤20.97	PASS
3DH5	Ant1	2402	1.09	≤20.97	PASS
3DH5	Ant1	2441	1.74	≤20.97	PASS
3DH5	Ant1	2480	1.96	≤20.97	PASS

Test Graphs

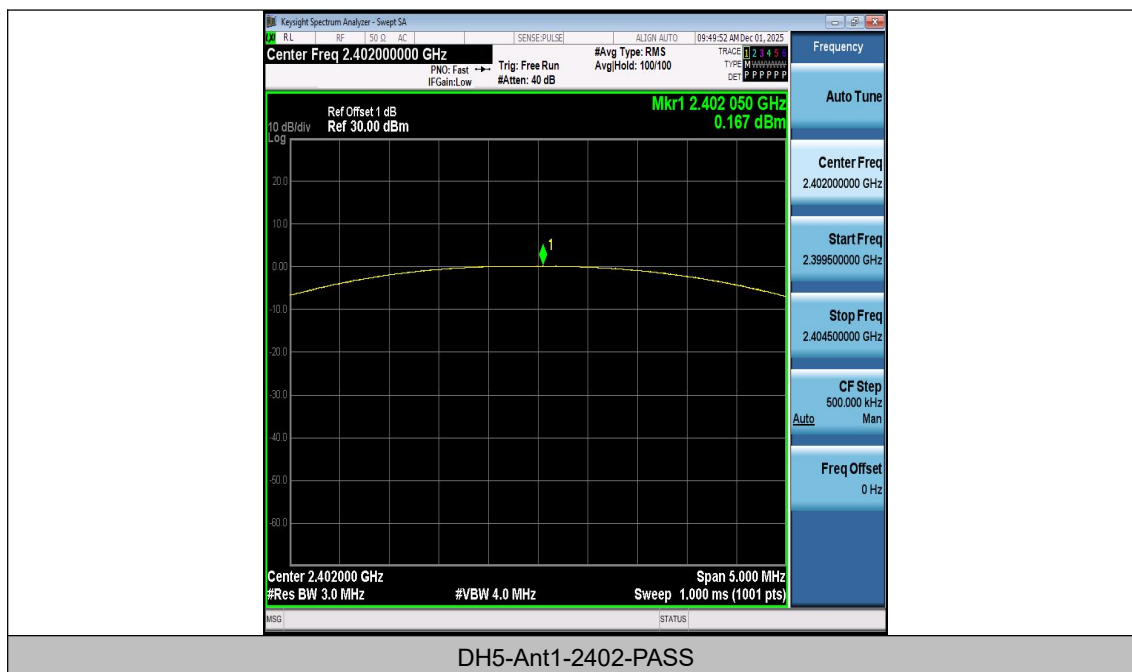




Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

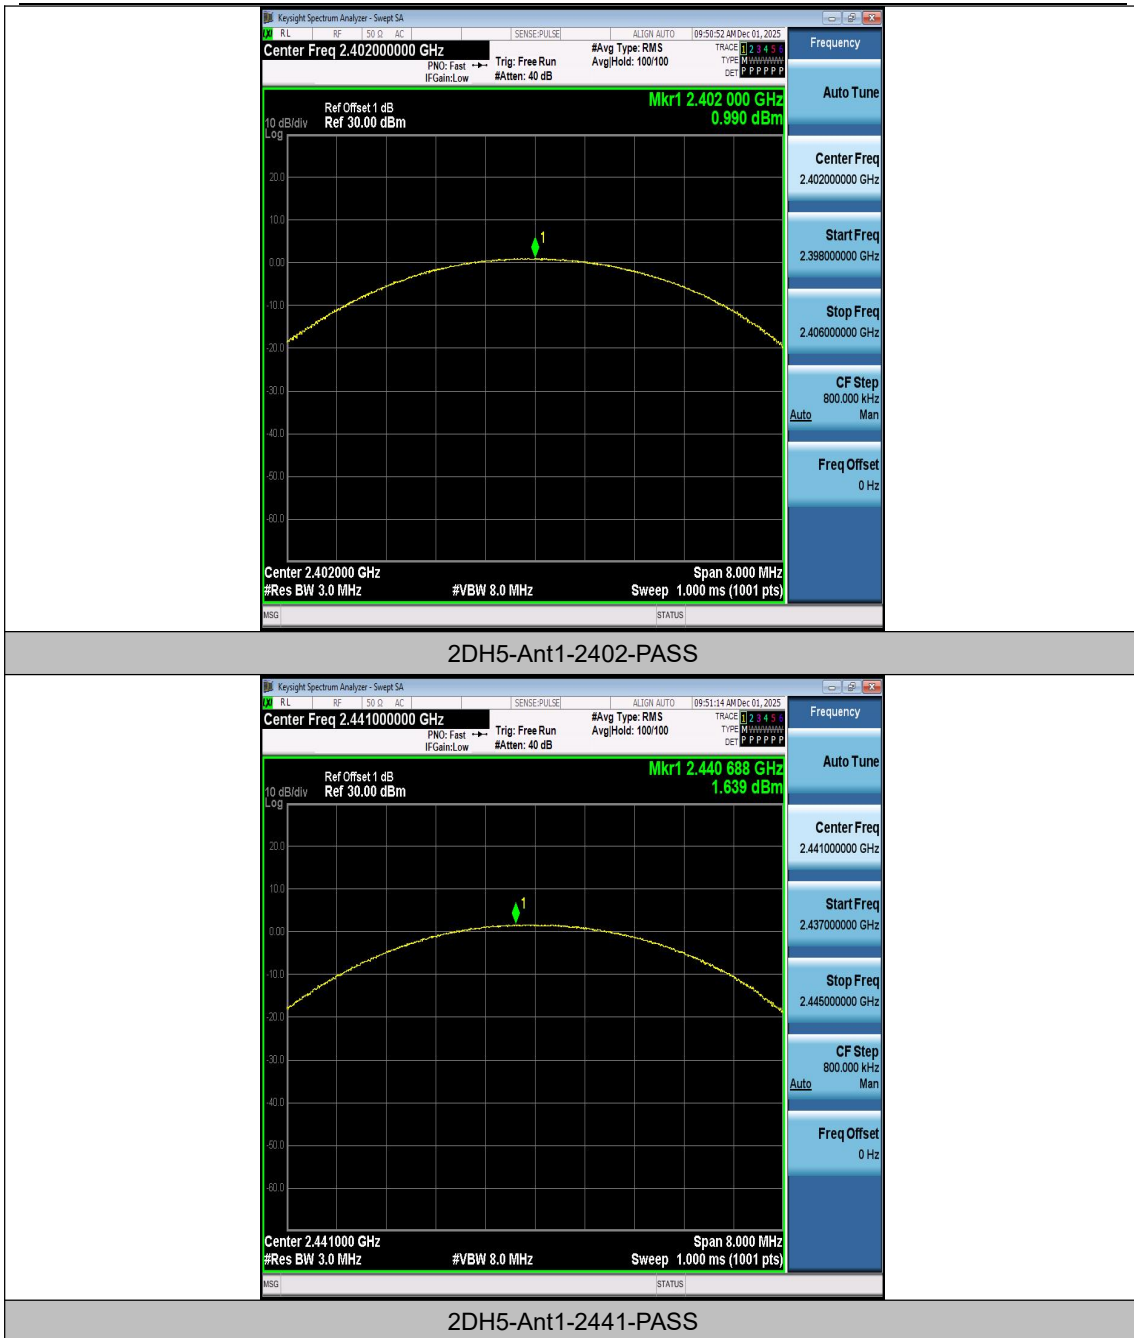

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

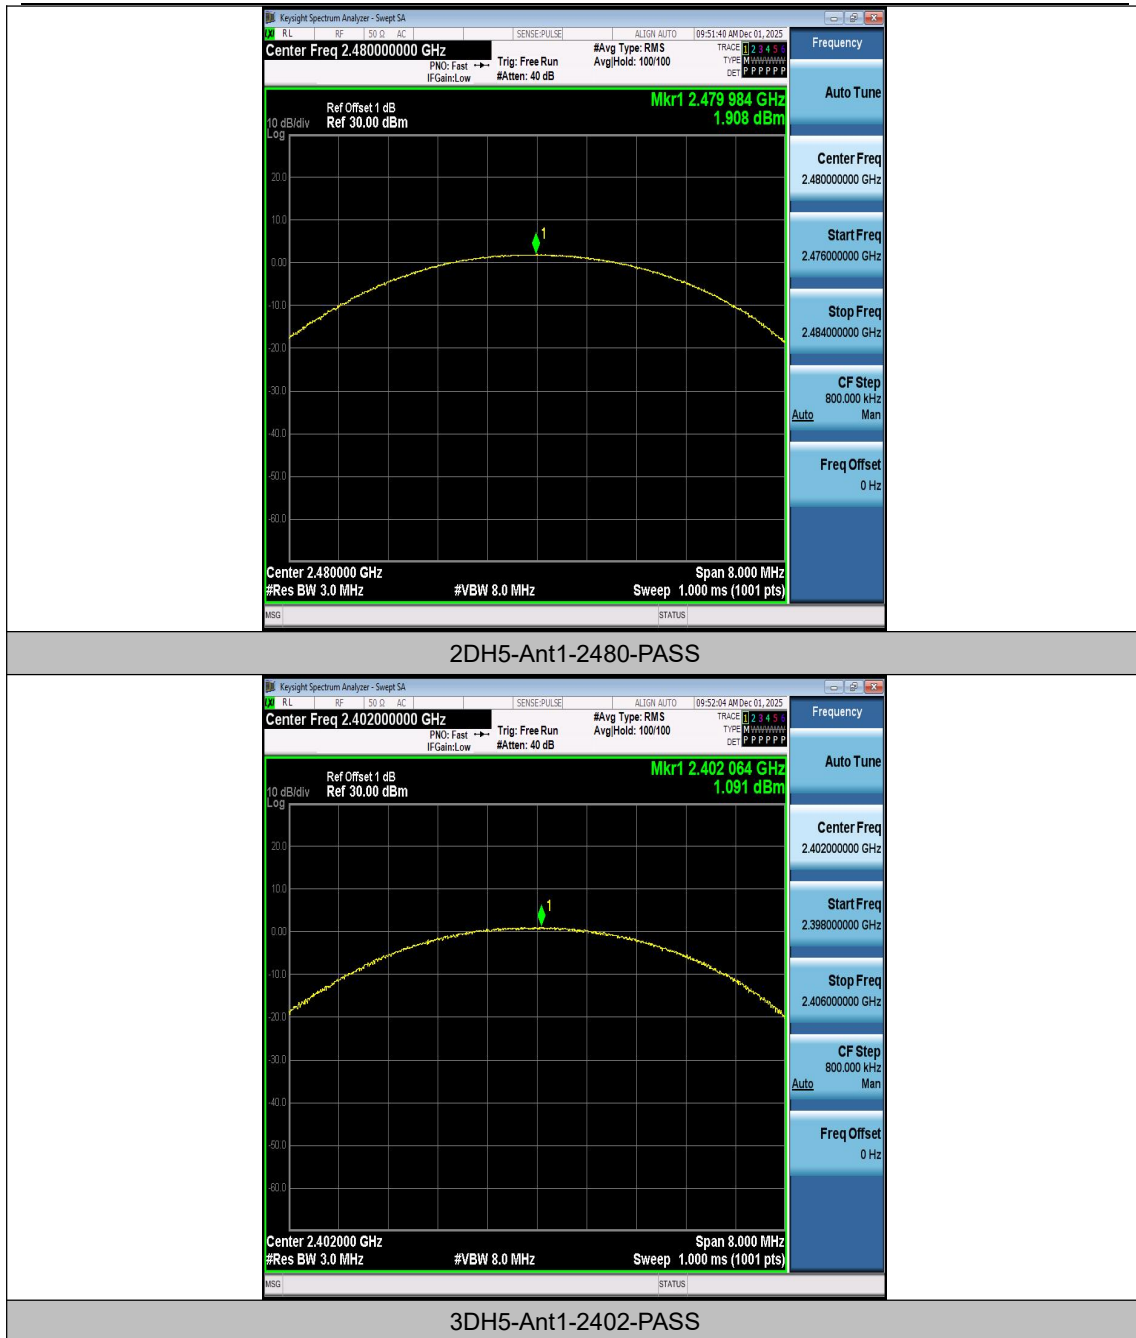

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

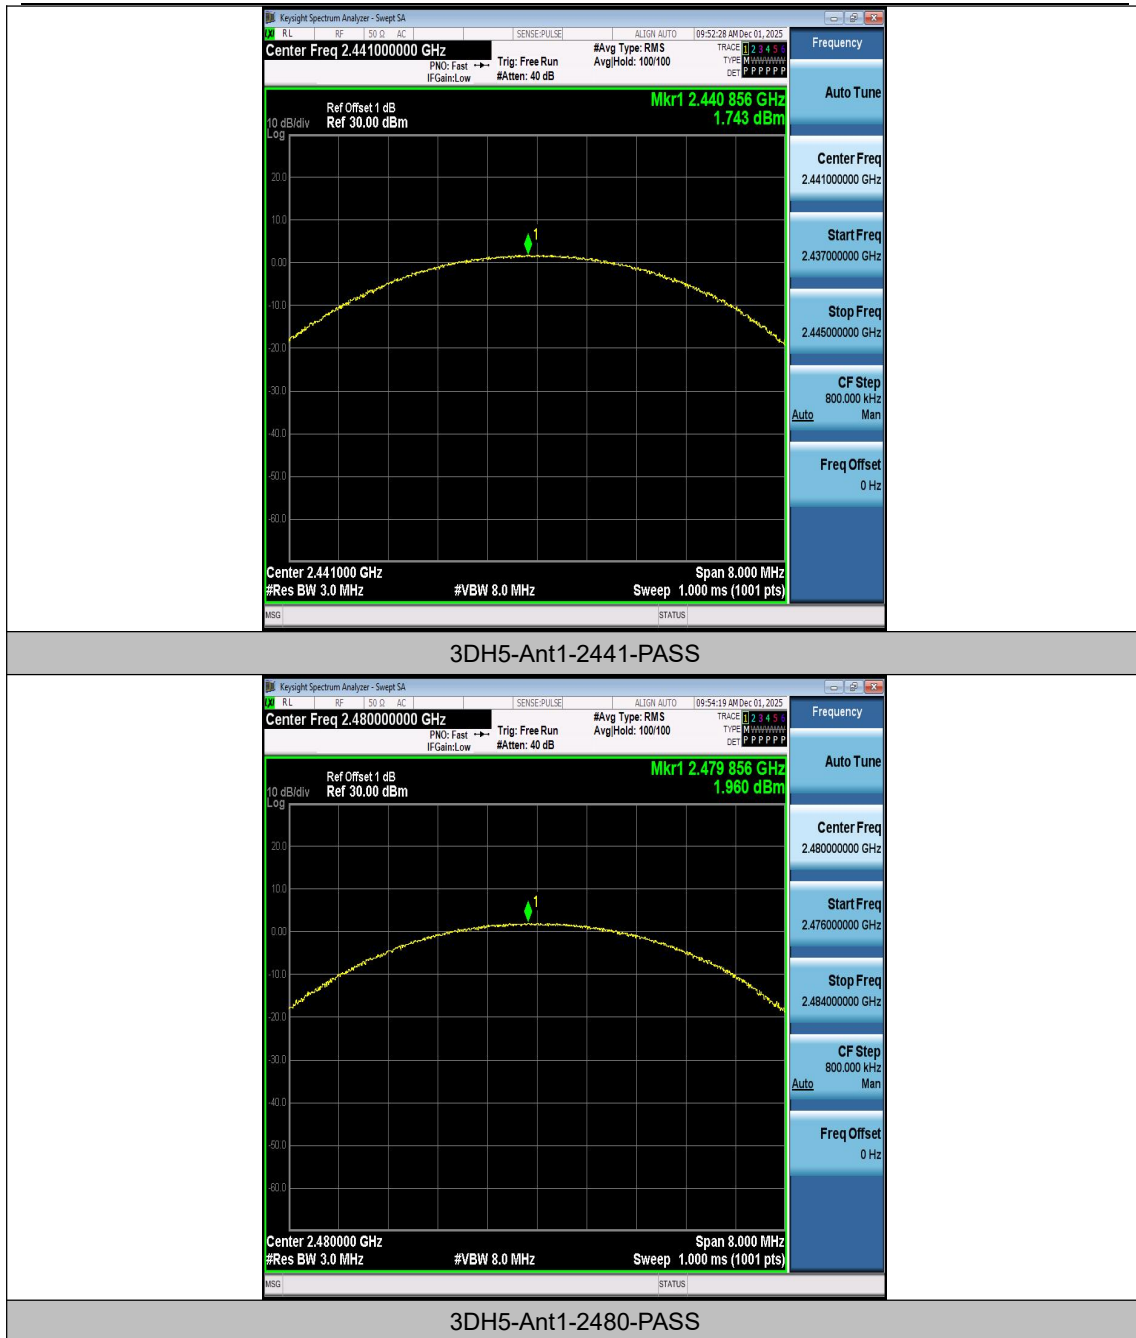

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

Appendix D: Carrier frequency separation

Test Result

Test Mode	Antenna	Frequency [MHz]	Result [MHz]	Limit[MHz]	Verdict
DH5	Ant1	Hop	1.298	≥ 0.7	PASS
2DH5	Ant1	Hop	1.28	≥ 0.894	PASS
3DH5	Ant1	Hop	1.296	≥ 0.872	PASS

Test Graphs

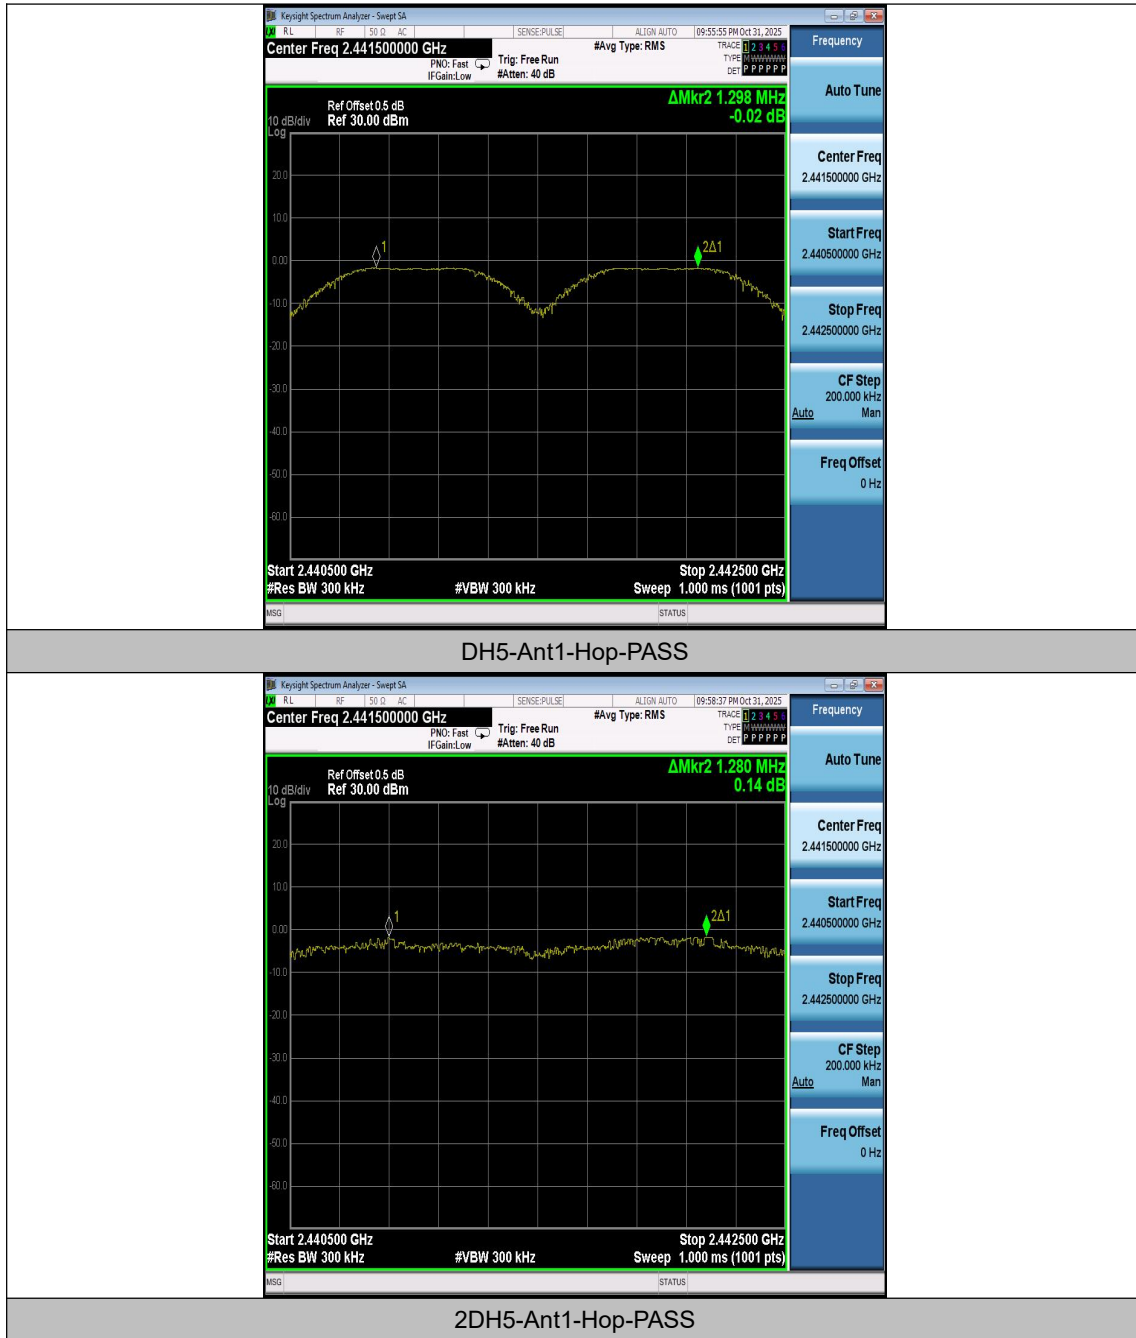

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com



Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com