



Condition	Mode	Frequency (MHz)	Antenna	Spur Freq (MHz)	Power (dBm)	Gain (dBi)	E (dBuV/m)	Detector	Limit (dBuV/m)	Verdict
NVNT	a	5180	Ant2	4500	-61.84	2	35.39	Peak	68.2	Pass
NVNT	a	5180	Ant2	4500	-69.02	2	28.21	Average	54	Pass
NVNT	a	5180	Ant2	5149.6	-52.5	2	44.73	Peak	68.2	Pass
NVNT	a	5180	Ant2	5149.6	-62.65	2	34.58	Average	54	Pass
NVNT	a	5180	Ant2	5150	-56.7	2	40.53	Peak	68.2	Pass
NVNT	a	5180	Ant2	5150	-62.25	2	34.98	Average	54	Pass
NVNT	a	5240	Ant2	5350	-51.27	2	45.96	Peak	68.2	Pass
NVNT	a	5240	Ant2	5350	-57.87	2	39.36	Average	54	Pass
NVNT	a	5240	Ant2	5412.96	-46.93	2	50.3	Peak	68.2	Pass
NVNT	a	5240	Ant2	5441.28	-57.23	2	40	Average	54	Pass
NVNT	a	5240	Ant2	5460	-49.3	2	47.93	Peak	68.2	Pass
NVNT	a	5240	Ant2	5460	-57.45	2	39.78	Average	54	Pass
NVNT	n20	5180	Ant2	4500	-52.82	2	44.41	Peak	68.2	Pass
NVNT	n20	5180	Ant2	4500	-59.12	2	38.11	Average	54	Pass
NVNT	n20	5180	Ant2	5106.2	-47.15	2	50.08	Peak	68.2	Pass
NVNT	n20	5180	Ant2	5149.6	-56.3	2	40.93	Average	54	Pass
NVNT	n20	5180	Ant2	5150	-48.2	2	49.03	Peak	68.2	Pass
NVNT	n20	5180	Ant2	5150	-56.21	2	41.02	Average	54	Pass
NVNT	n20	5240	Ant2	5350	-51.6	2	45.63	Peak	68.2	Pass
NVNT	n20	5240	Ant2	5350	-57.83	2	39.4	Average	54	Pass
NVNT	n20	5240	Ant2	5409.84	-47.68	2	49.55	Peak	68.2	Pass
NVNT	n20	5240	Ant2	5425.68	-57.27	2	39.96	Average	54	Pass
NVNT	n20	5240	Ant2	5460	-50.65	2	46.58	Peak	68.2	Pass
NVNT	n20	5240	Ant2	5460	-57.53	2	39.7	Average	54	Pass
NVNT	n40	5190	Ant2	4500	-61.71	2	35.52	Peak	68.2	Pass
NVNT	n40	5190	Ant2	4500	-68.76	2	28.47	Average	54	Pass
NVNT	n40	5190	Ant2	5147.51	-53.15	2	44.08	Peak	68.2	Pass
NVNT	n40	5190	Ant2	5149.7	-59.42	2	37.81	Average	54	Pass
NVNT	n40	5190	Ant2	5150	-55.24	2	41.99	Peak	68.2	Pass
NVNT	n40	5190	Ant2	5150	-58.5	2	38.73	Average	54	Pass
NVNT	n40	5230	Ant2	5350	-50.72	2	46.51	Peak	68.2	Pass
NVNT	n40	5230	Ant2	5350	-57.79	2	39.44	Average	54	Pass
NVNT	n40	5230	Ant2	5396.82	-47.92	2	49.31	Peak	68.2	Pass
NVNT	n40	5230	Ant2	5425.17	-57	2	40.23	Average	54	Pass
NVNT	n40	5230	Ant2	5460	-51.21	2	46.02	Peak	68.2	Pass
NVNT	n40	5230	Ant2	5460	-57.2	2	40.03	Average	54	Pass
NVNT	ac20	5180	Ant2	4500	-51.12	2	46.11	Peak	68.2	Pass
NVNT	ac20	5180	Ant2	4500	-59.08	2	38.15	Average	54	Pass



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



NVNT	ac20	5180	Ant2	5097.1	-46.99	2	50.24	Peak	68.2	Pass
NVNT	ac20	5180	Ant2	5149.6	-56.34	2	40.89	Average	54	Pass
NVNT	ac20	5180	Ant2	5150	-49.62	2	47.61	Peak	68.2	Pass
NVNT	ac20	5180	Ant2	5150	-56.18	2	41.05	Average	54	Pass
NVNT	ac20	5240	Ant2	5350	-51.33	2	45.9	Peak	68.2	Pass
NVNT	ac20	5240	Ant2	5350	-57.94	2	39.29	Average	54	Pass
NVNT	ac20	5240	Ant2	5437.2	-47.64	2	49.59	Peak	68.2	Pass
NVNT	ac20	5240	Ant2	5450.64	-57.24	2	39.99	Average	54	Pass
NVNT	ac20	5240	Ant2	5460	-50.39	2	46.84	Peak	68.2	Pass
NVNT	ac20	5240	Ant2	5460	-57.43	2	39.8	Average	54	Pass
NVNT	ac40	5190	Ant2	4500	-52.6	2	44.63	Peak	68.2	Pass
NVNT	ac40	5190	Ant2	4500	-58.88	2	38.35	Average	54	Pass
NVNT	ac40	5190	Ant2	5082.54	-46.95	2	50.28	Peak	68.2	Pass
NVNT	ac40	5190	Ant2	5149.7	-55.71	2	41.52	Average	54	Pass
NVNT	ac40	5190	Ant2	5150	-49.8	2	47.43	Peak	68.2	Pass
NVNT	ac40	5190	Ant2	5150	-55.6	2	41.63	Average	54	Pass
NVNT	ac40	5230	Ant2	5350	-50.92	2	46.31	Peak	68.2	Pass
NVNT	ac40	5230	Ant2	5350	-57.73	2	39.5	Average	54	Pass
NVNT	ac40	5230	Ant2	5369.55	-47.97	2	49.26	Peak	68.2	Pass
NVNT	ac40	5230	Ant2	5441.37	-56.8	2	40.43	Average	54	Pass
NVNT	ac40	5230	Ant2	5460	-49.52	2	47.71	Peak	68.2	Pass
NVNT	ac40	5230	Ant2	5460	-57.31	2	39.92	Average	54	Pass
NVNT	ac80	5210	Ant2	5350	-50.95	2	46.28	Peak	68.2	Pass
NVNT	ac80	5210	Ant2	5350	-57.05	2	40.18	Average	54	Pass
NVNT	ac80	5210	Ant2	5453.73	-46.37	2	50.86	Peak	68.2	Pass
NVNT	ac80	5210	Ant2	5405.22	-56.25	2	40.98	Average	54	Pass
NVNT	ac80	5210	Ant2	5460	-48.31	2	48.92	Peak	68.2	Pass
NVNT	ac80	5210	Ant2	5460	-56.31	2	40.92	Average	54	Pass
NVNT	ac80	5210	Ant2	4500	-51.59	2	45.64	Peak	68.2	Pass
NVNT	ac80	5210	Ant2	4500	-58.65	2	38.58	Average	54	Pass
NVNT	ac80	5210	Ant2	4721.2	-47.2	2	50.03	Peak	68.2	Pass
NVNT	ac80	5210	Ant2	5149.38	-55.3	2	41.93	Average	54	Pass
NVNT	ac80	5210	Ant2	5150	-49.49	2	47.74	Peak	68.2	Pass
NVNT	ac80	5210	Ant2	5150	-55.25	2	41.98	Average	54	Pass
NVNT	ax20	5180	Ant2	4500	-50.91	2	46.32	Peak	68.2	Pass
NVNT	ax20	5180	Ant2	4500	-59.08	2	38.15	Average	54	Pass
NVNT	ax20	5180	Ant2	5065.6	-46.8	2	50.43	Peak	68.2	Pass
NVNT	ax20	5180	Ant2	5149.6	-56.32	2	40.91	Average	54	Pass
NVNT	ax20	5180	Ant2	5150	-49.36	2	47.87	Peak	68.2	Pass
NVNT	ax20	5180	Ant2	5150	-55.99	2	41.24	Average	54	Pass
NVNT	ax20	5240	Ant2	5350	-51.01	2	46.22	Peak	68.2	Pass



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China


Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity




NVNT	ax20	5240	Ant2	5350	-57.92	2	39.31	Average	54	Pass
NVNT	ax20	5240	Ant2	5398.08	-47.17	2	50.06	Peak	68.2	Pass
NVNT	ax20	5240	Ant2	5448	-57.28	2	39.95	Average	54	Pass
NVNT	ax20	5240	Ant2	5460	-51.19	2	46.04	Peak	68.2	Pass
NVNT	ax20	5240	Ant2	5460	-57.39	2	39.84	Average	54	Pass
NVNT	ax40	5190	Ant2	4500	-52.13	2	45.1	Peak	68.2	Pass
NVNT	ax40	5190	Ant2	4500	-58.95	2	38.28	Average	54	Pass
NVNT	ax40	5190	Ant2	5035.09	-46.6	2	50.63	Peak	68.2	Pass
NVNT	ax40	5190	Ant2	5149.7	-55.59	2	41.64	Average	54	Pass
NVNT	ax40	5190	Ant2	5150	-49.37	2	47.86	Peak	68.2	Pass
NVNT	ax40	5190	Ant2	5150	-55.51	2	41.72	Average	54	Pass
NVNT	ax40	5230	Ant2	5350	-50.34	2	46.89	Peak	68.2	Pass
NVNT	ax40	5230	Ant2	5350	-57.7	2	39.53	Average	54	Pass
NVNT	ax40	5230	Ant2	5422.47	-46.74	2	50.49	Peak	68.2	Pass
NVNT	ax40	5230	Ant2	5440.56	-56.99	2	40.24	Average	54	Pass
NVNT	ax40	5230	Ant2	5460	-49.07	2	48.16	Peak	68.2	Pass
NVNT	ax40	5230	Ant2	5460	-57.16	2	40.07	Average	54	Pass
NVNT	ax80	5210	Ant2	5350	-59.85	2	37.38	Peak	68.2	Pass
NVNT	ax80	5210	Ant2	5350	-66.67	2	30.56	Average	54	Pass
NVNT	ax80	5210	Ant2	5414.79	-56	2	41.23	Peak	68.2	Pass
NVNT	ax80	5210	Ant2	5447.13	-66.22	2	31.01	Average	54	Pass
NVNT	ax80	5210	Ant2	5460	-61.09	2	36.14	Peak	68.2	Pass
NVNT	ax80	5210	Ant2	5460	-66.82	2	30.41	Average	54	Pass
NVNT	ax80	5210	Ant2	4500	-52.18	2	45.05	Peak	68.2	Pass
NVNT	ax80	5210	Ant2	4500	-58.81	2	38.42	Average	54	Pass
NVNT	ax80	5210	Ant2	5143.85	-46.61	2	50.62	Peak	68.2	Pass
NVNT	ax80	5210	Ant2	5149.38	-55.29	2	41.94	Average	54	Pass
NVNT	ax80	5210	Ant2	5150	-47.47	2	49.76	Peak	68.2	Pass
NVNT	ax80	5210	Ant2	5150	-55.27	2	41.96	Average	54	Pass



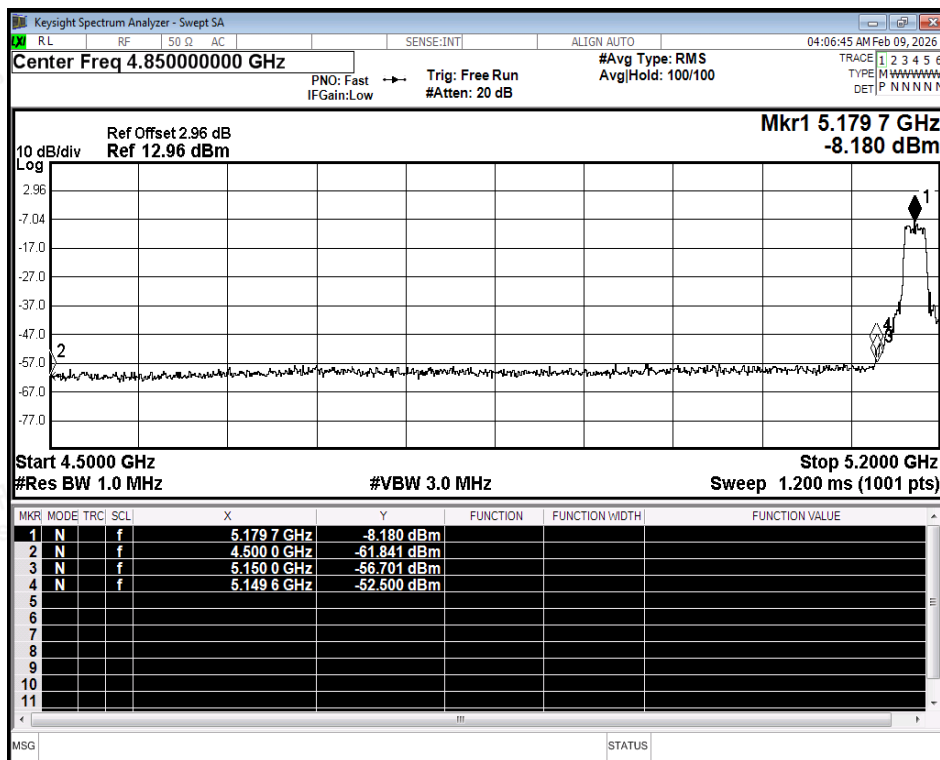

Restrict Band NVNT a 5180MHz Ant2 Peak

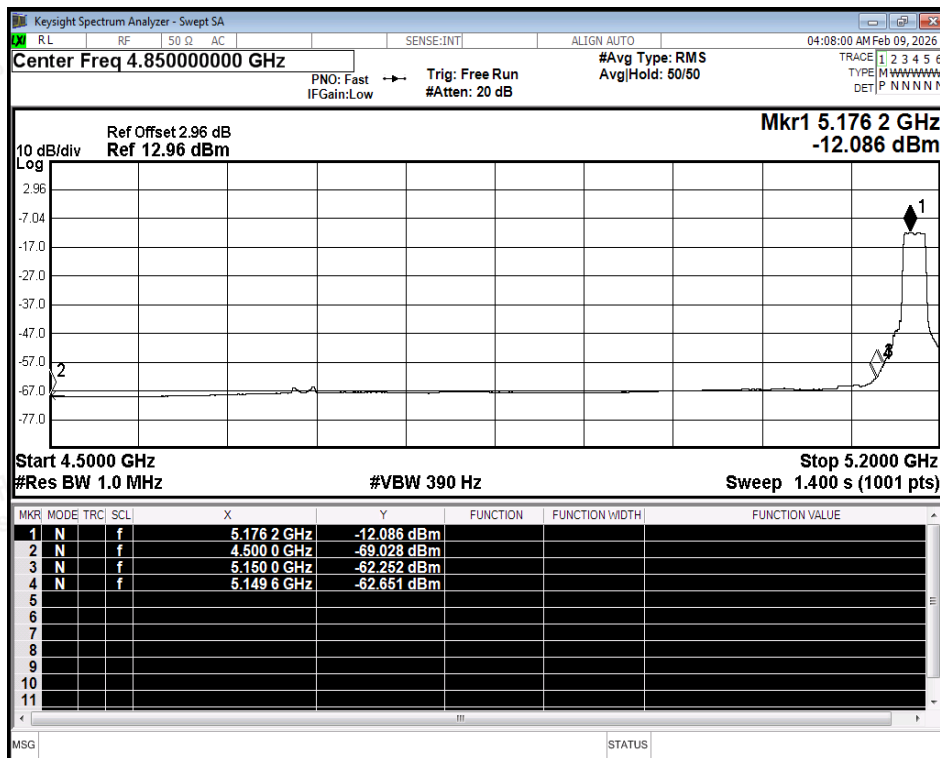

Restrict Band NVNT a 5180MHz Ant2 Average




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

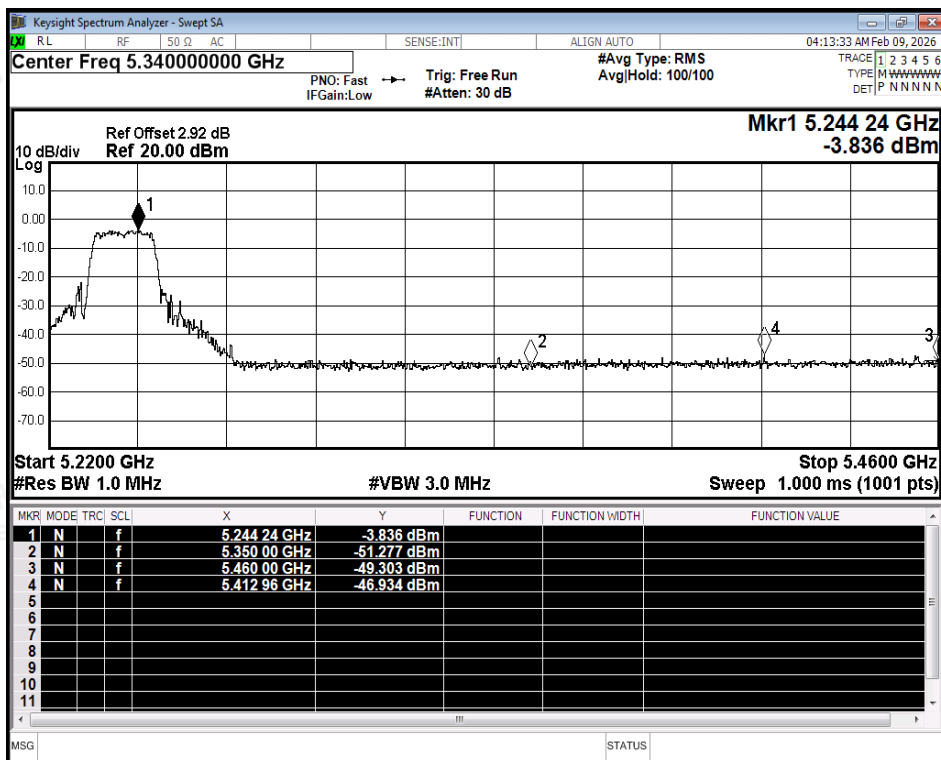

Restrict Band NVNT a 5240MHz Ant2 Peak

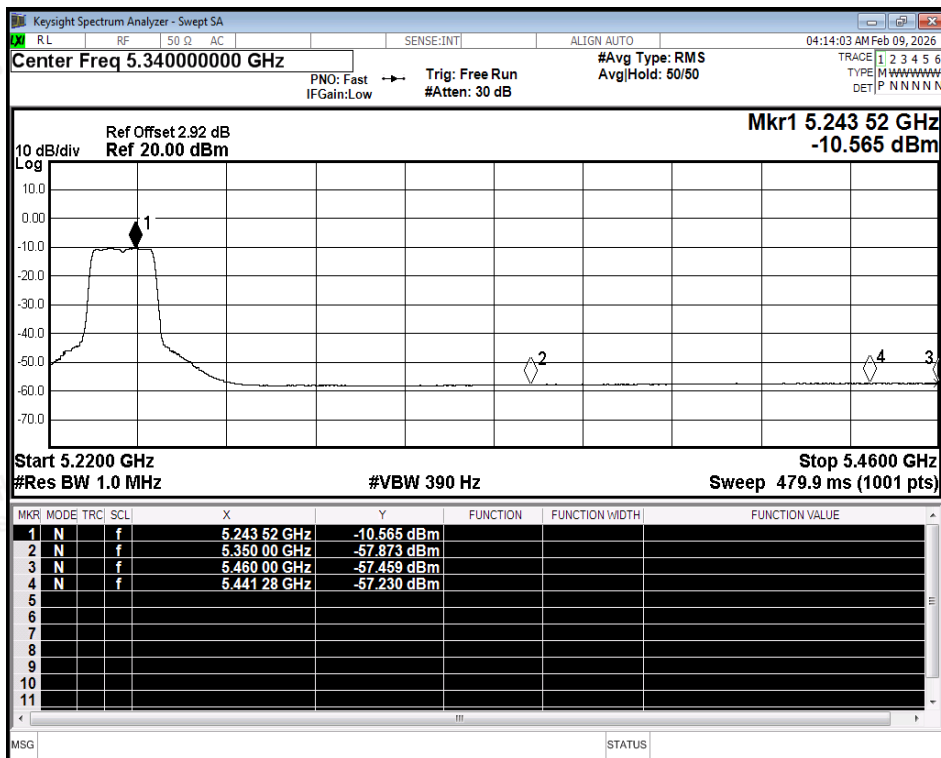

Restrict Band NVNT a 5240MHz Ant2 Average




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

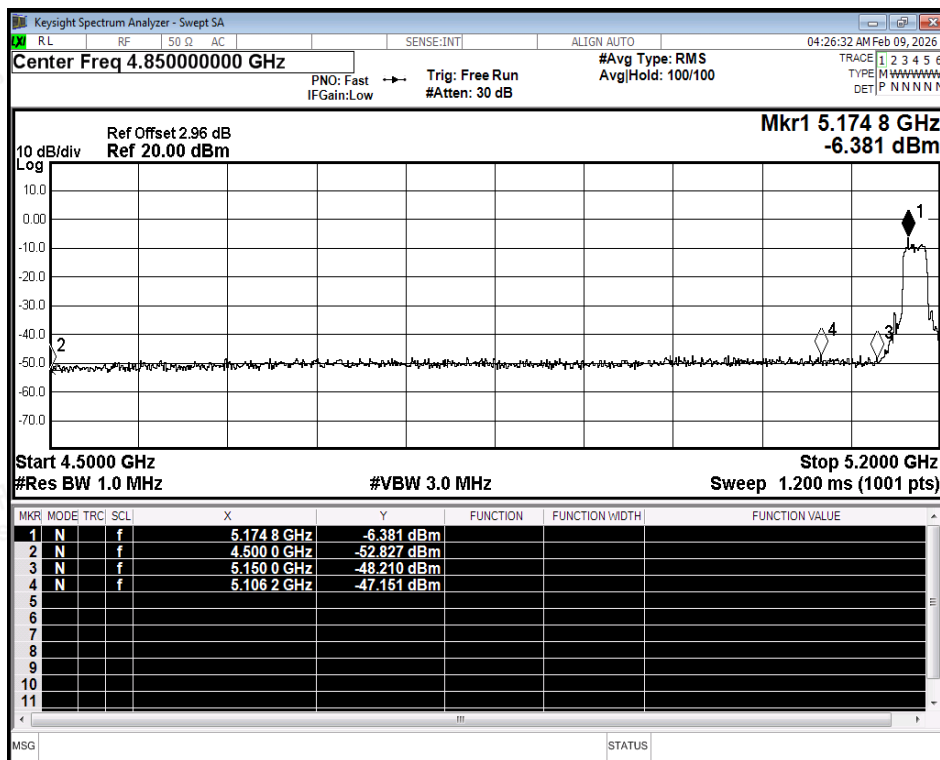

Restrict Band NVNT n20 5180MHz Ant2 Peak

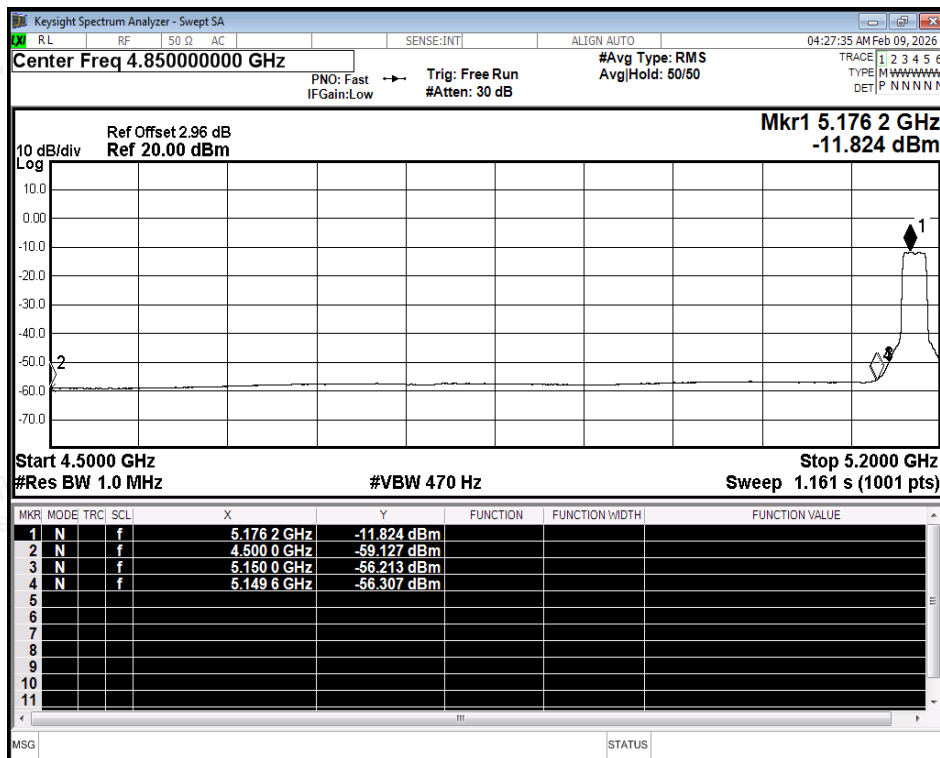

Restrict Band NVNT n20 5180MHz Ant2 Average




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

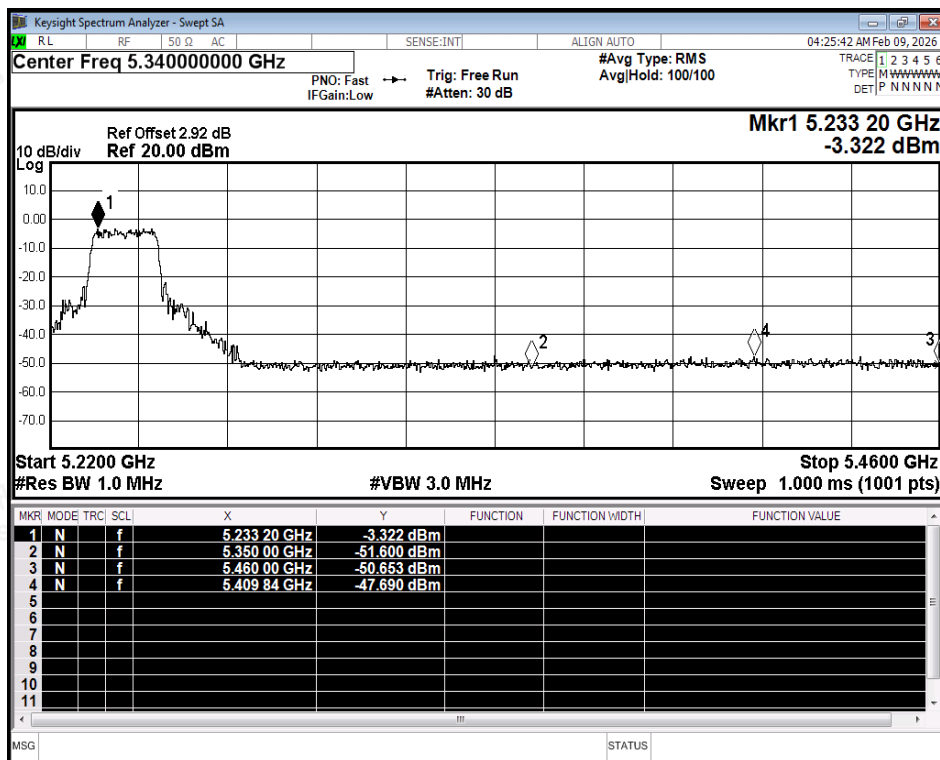

Restrict Band NVNT n20 5240MHz Ant2 Peak

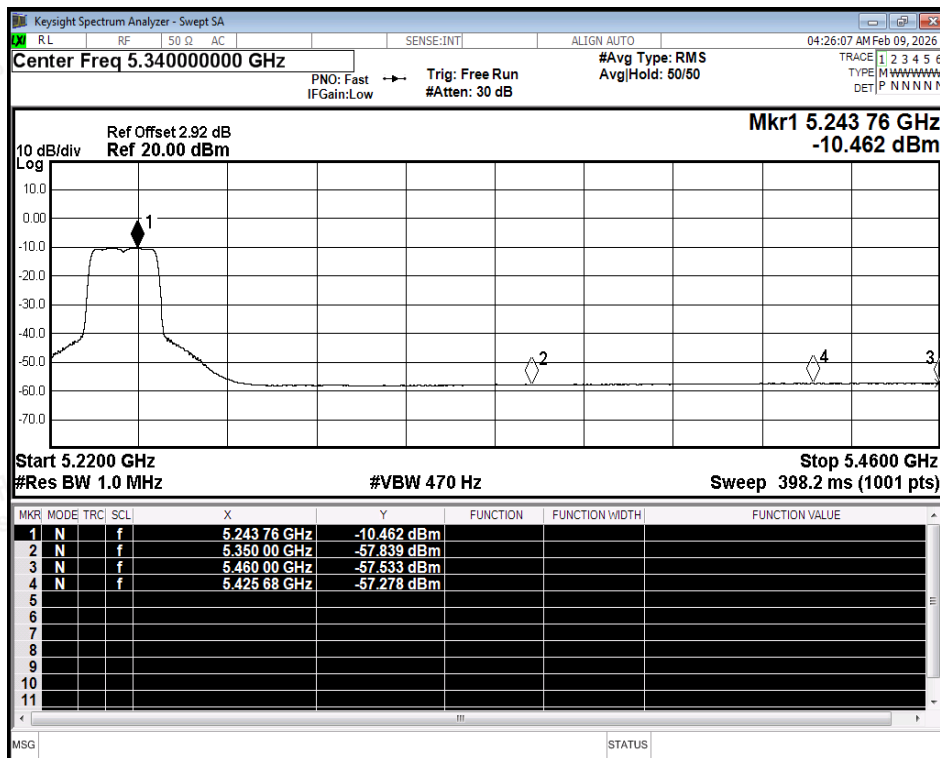

Restrict Band NVNT n20 5240MHz Ant2 Average




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

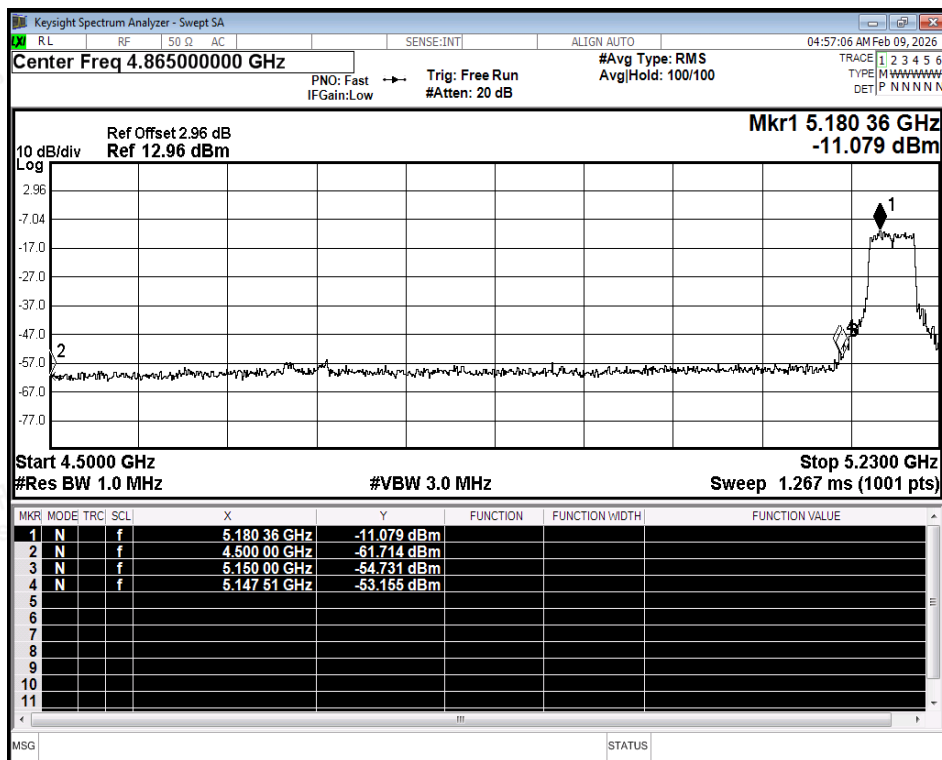

Restrict Band NVNT n40 5190MHz Ant2 Peak

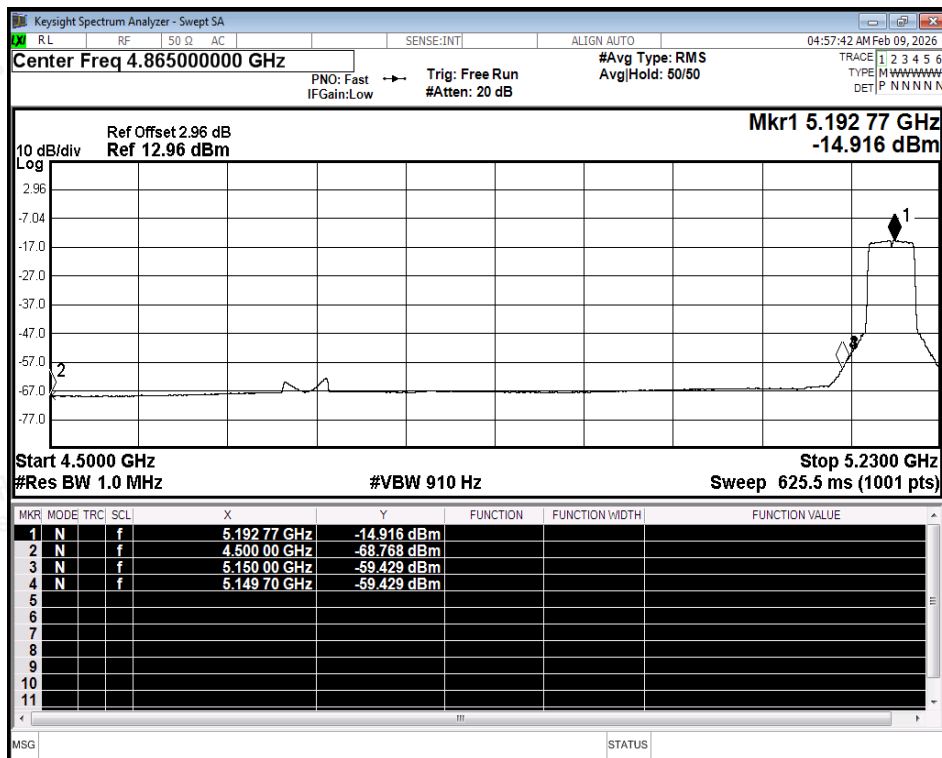

Restrict Band NVNT n40 5190MHz Ant2 Average




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

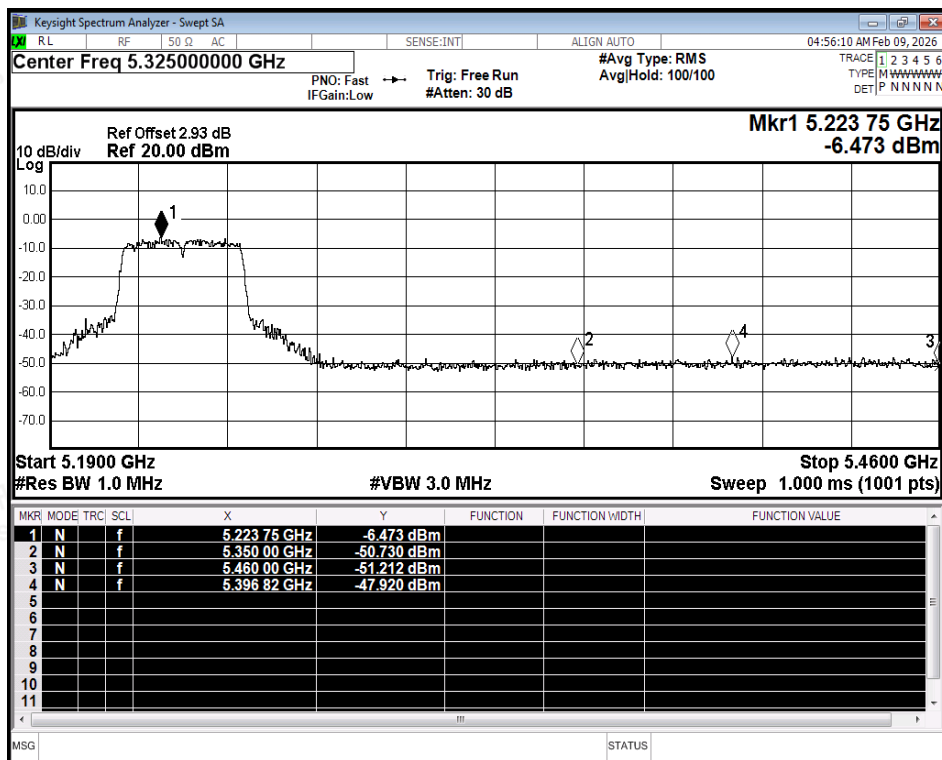

Restrict Band NVNT n40 5230MHz Ant2 Peak

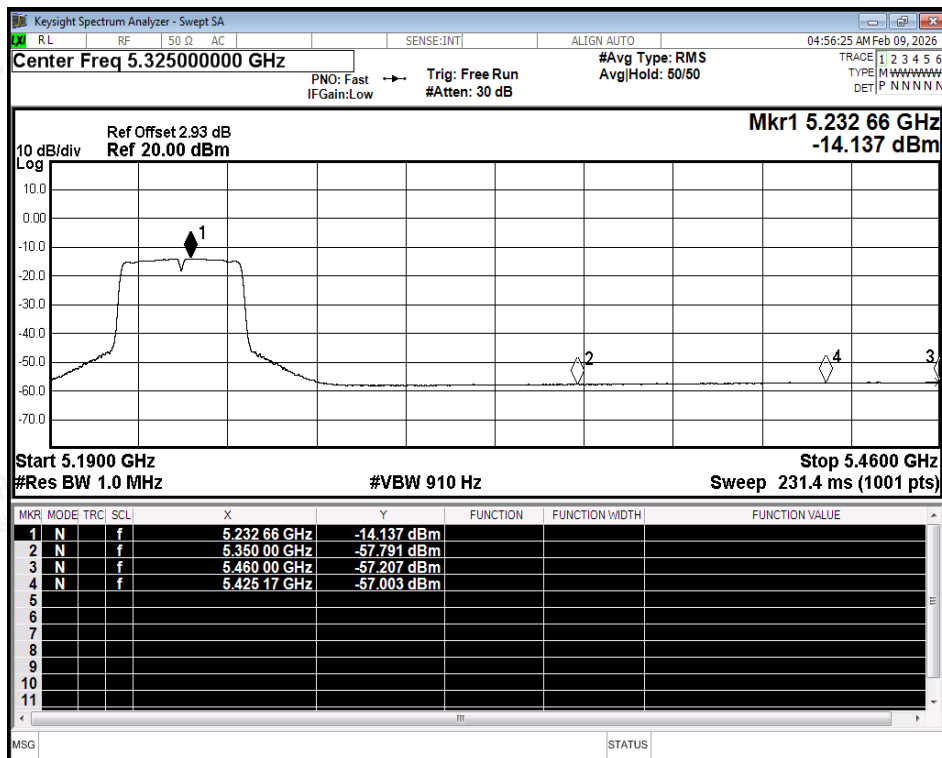

Restrict Band NVNT n40 5230MHz Ant2 Average




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

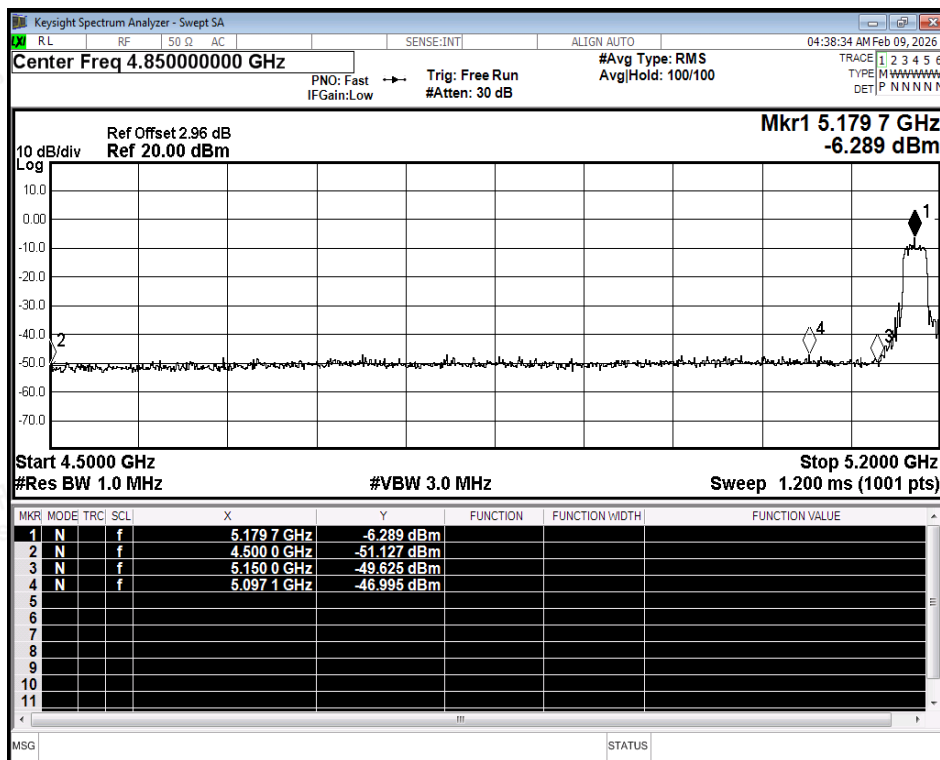

Restrict Band NVNT ac20 5180MHz Ant2 Peak

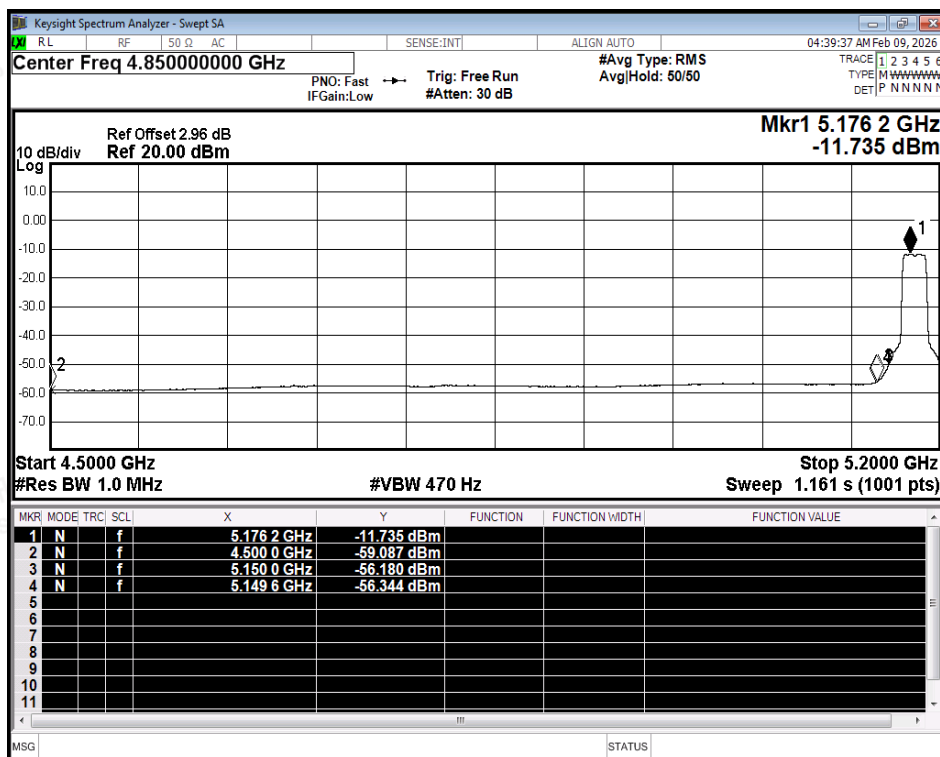

Restrict Band NVNT ac20 5180MHz Ant2 Average




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

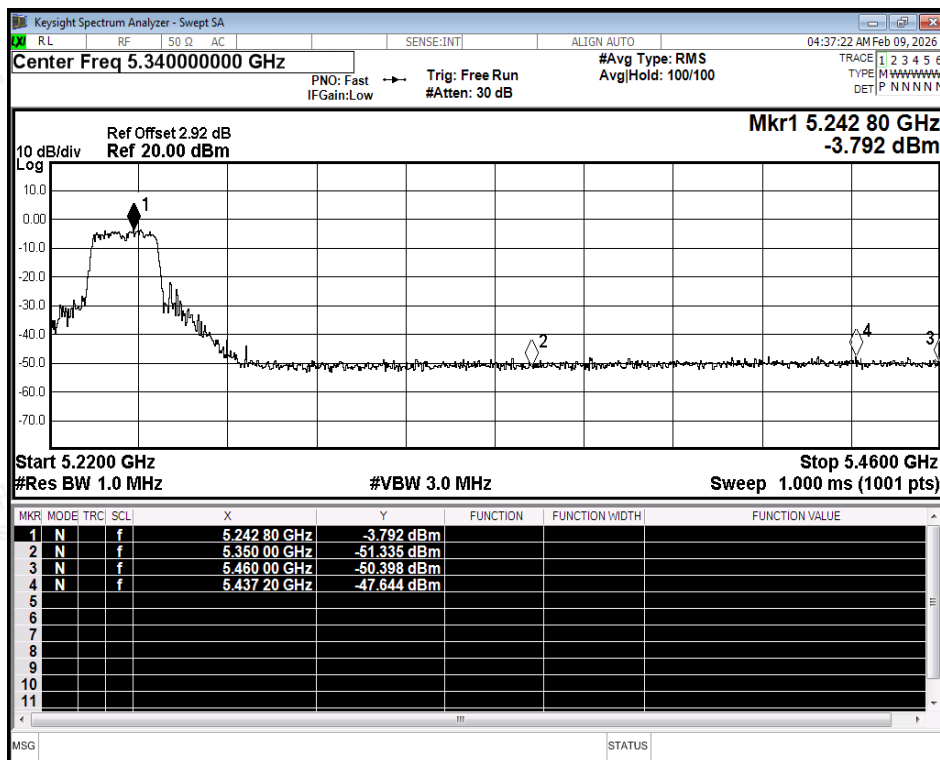

Restrict Band NVNT ac20 5240MHz Ant2 Peak

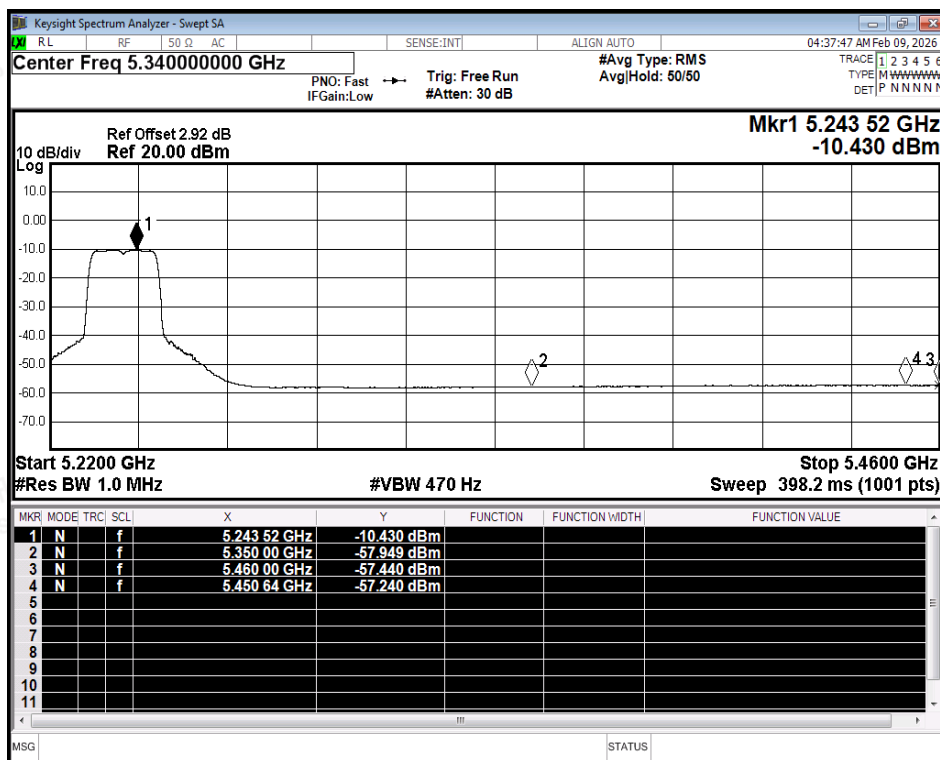

Restrict Band NVNT ac20 5240MHz Ant2 Average




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

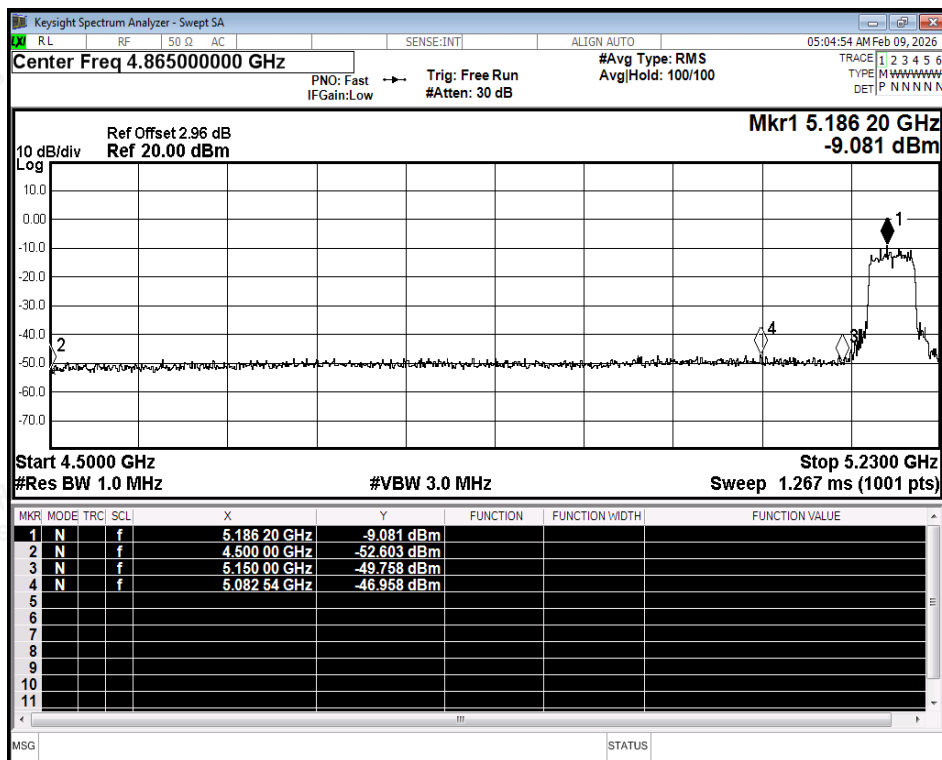

Restrict Band NVNT ac40 5190MHz Ant2 Peak

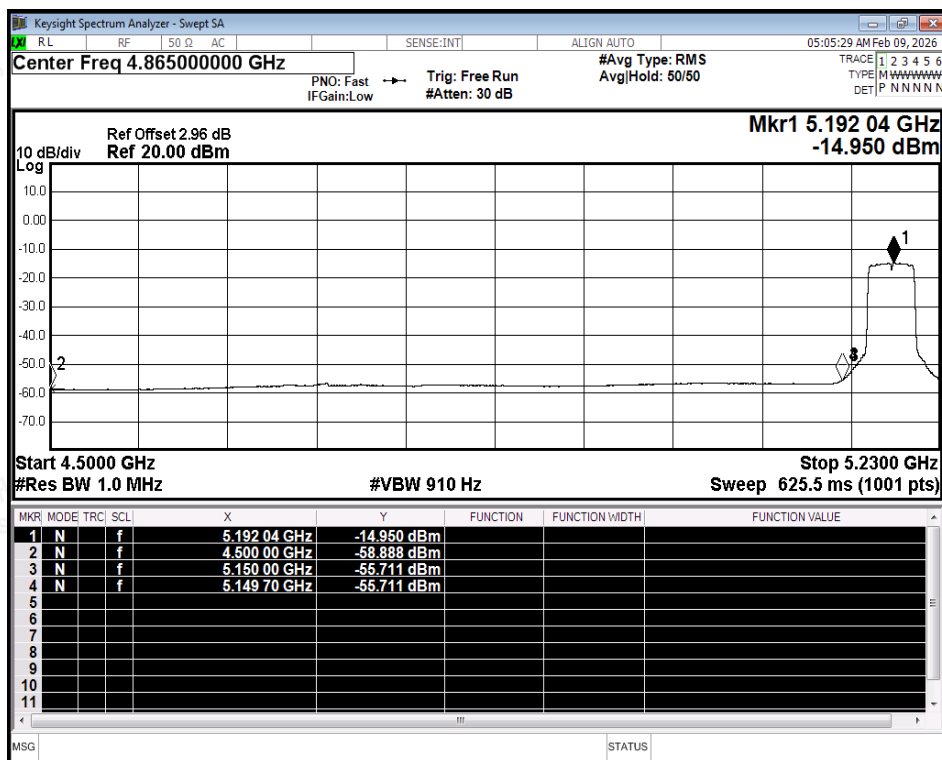

Restrict Band NVNT ac40 5190MHz Ant2 Average




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

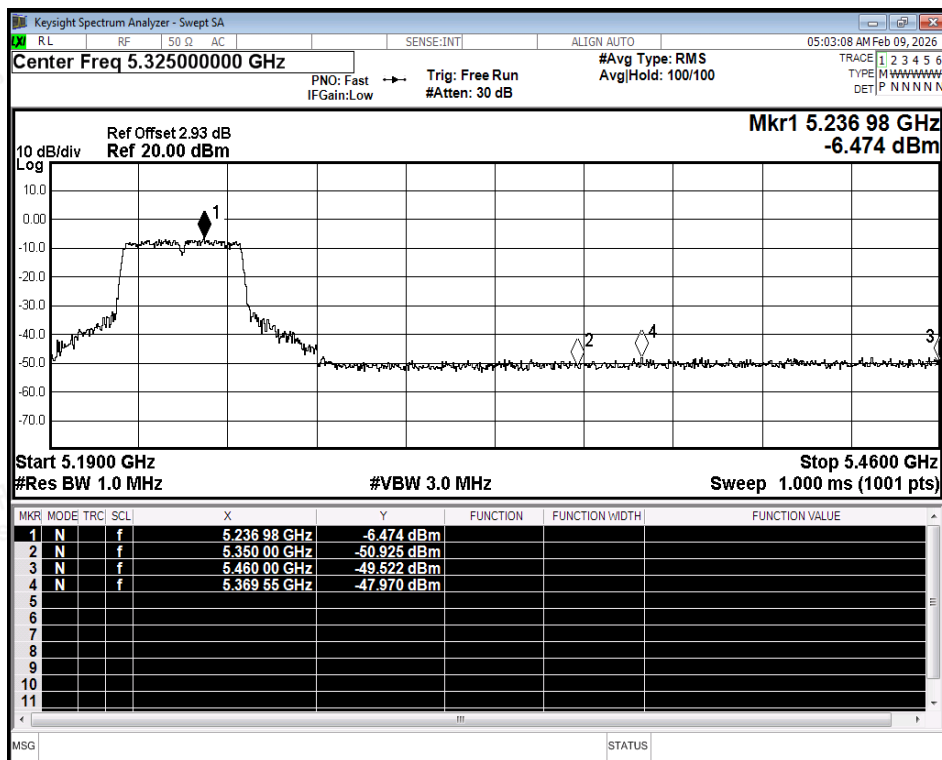

Restrict Band NVNT ac40 5230MHz Ant2 Peak

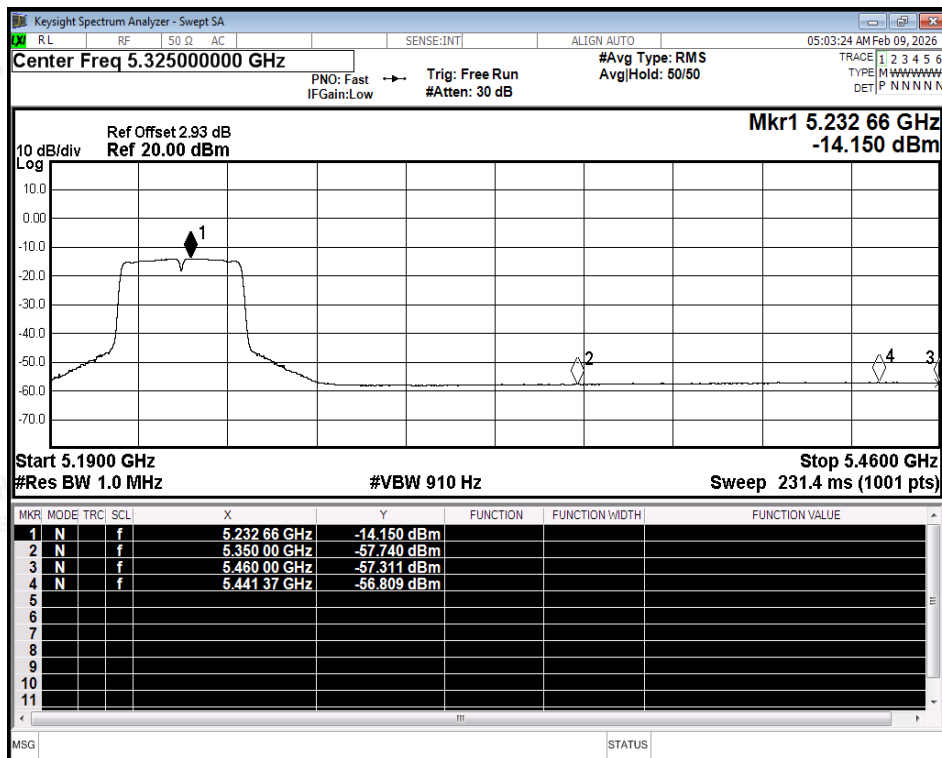

Restrict Band NVNT ac40 5230MHz Ant2 Average




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

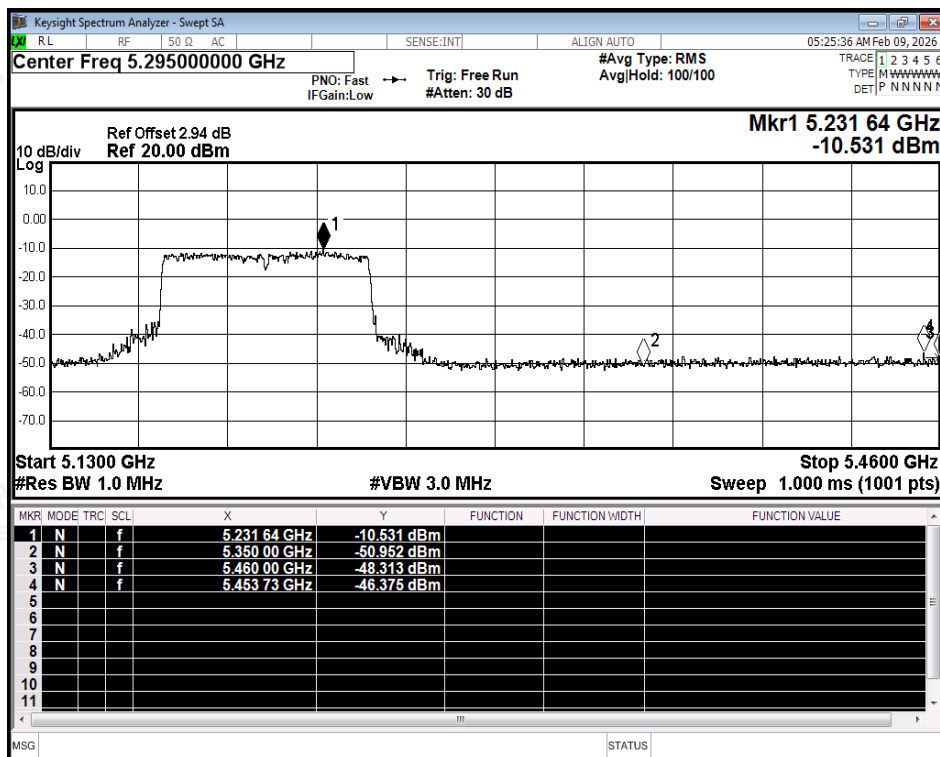

Restrict Band NVNT ac80 5210MHz Ant2 Peak

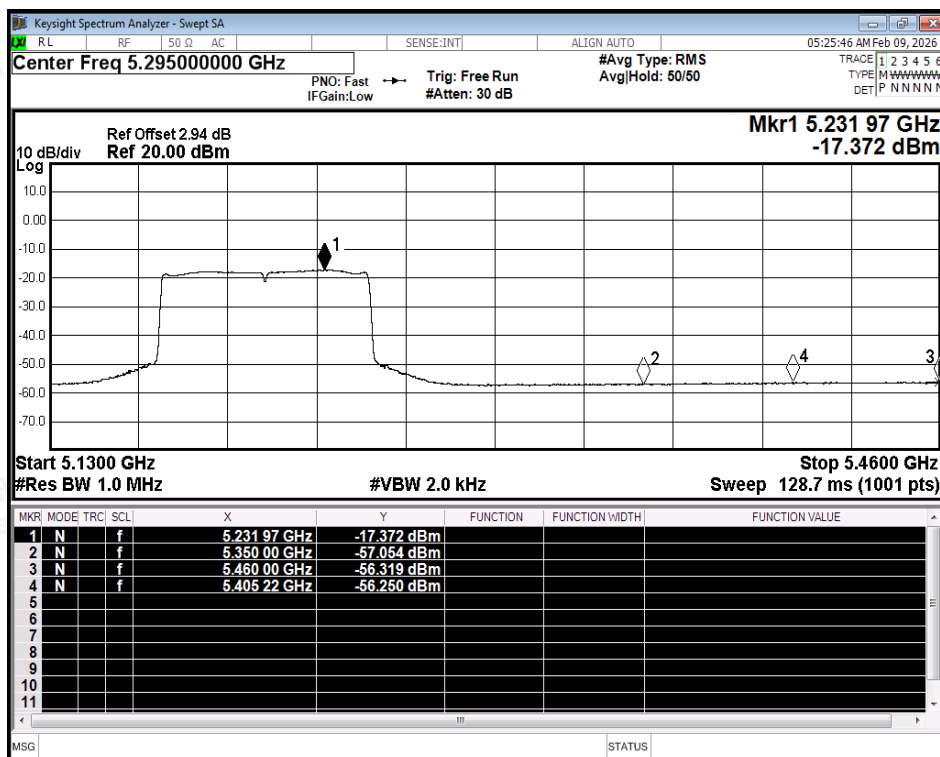

Restrict Band NVNT ac80 5210MHz Ant2 Average




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

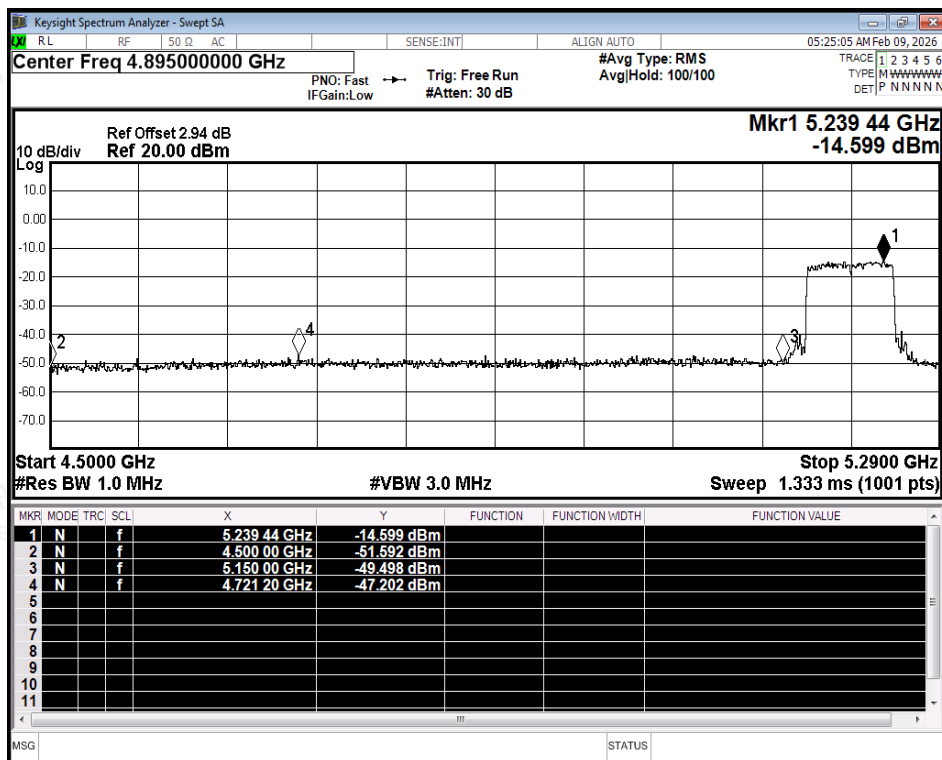

Restrict Band NVNT ac80 5210MHz Ant2 Peak

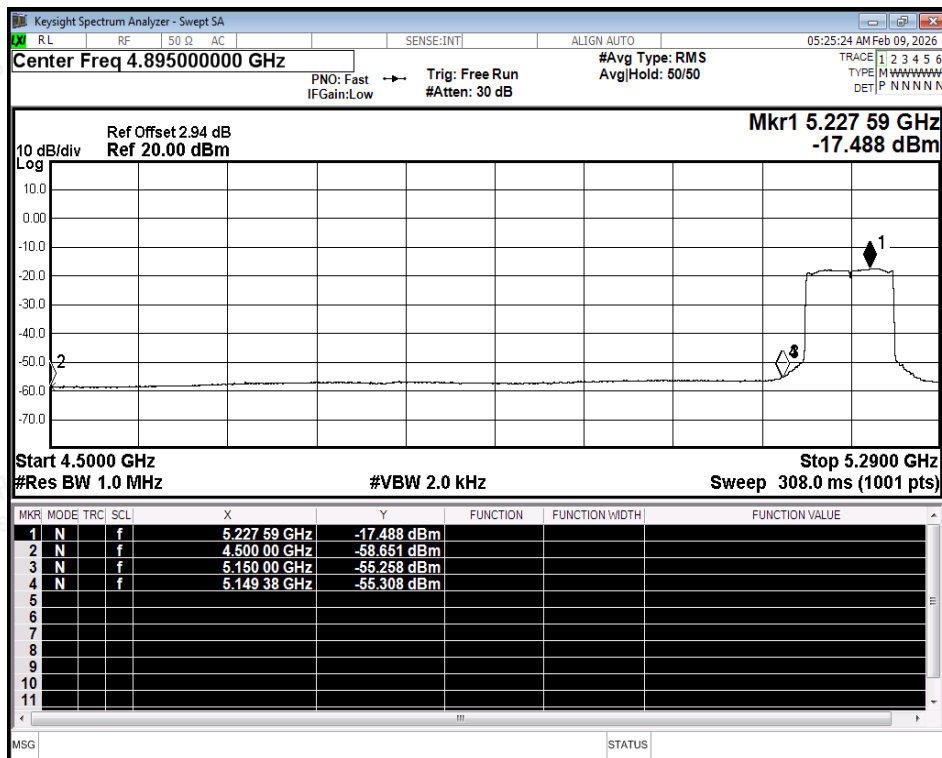

Restrict Band NVNT ac80 5210MHz Ant2 Average




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

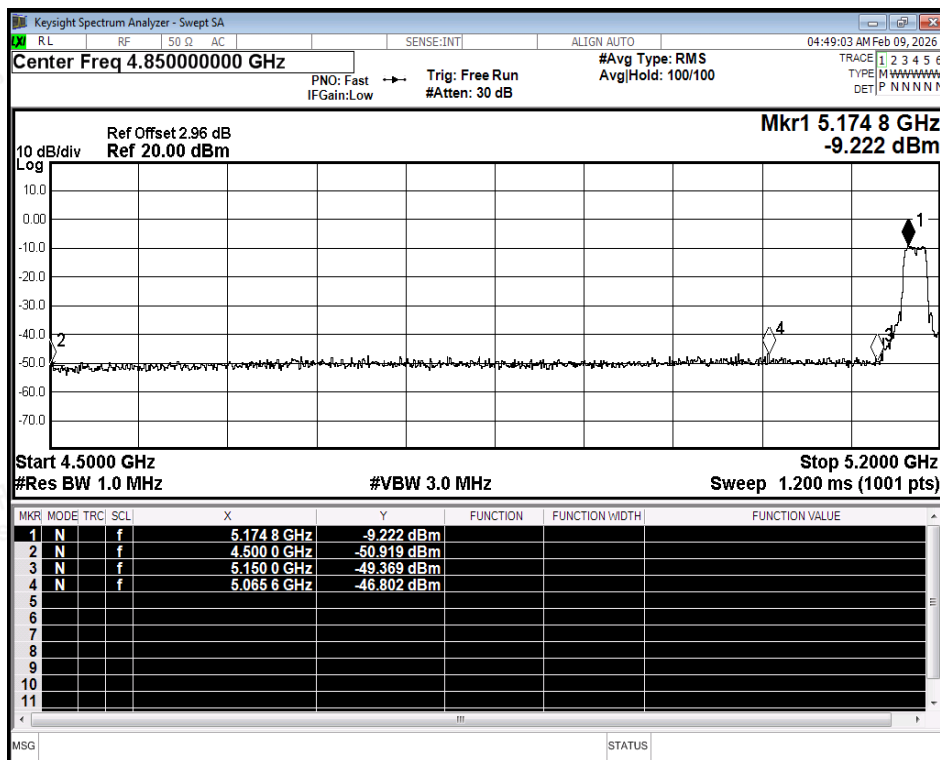

Restrict Band NVNT ax20 5180MHz Ant2 Peak

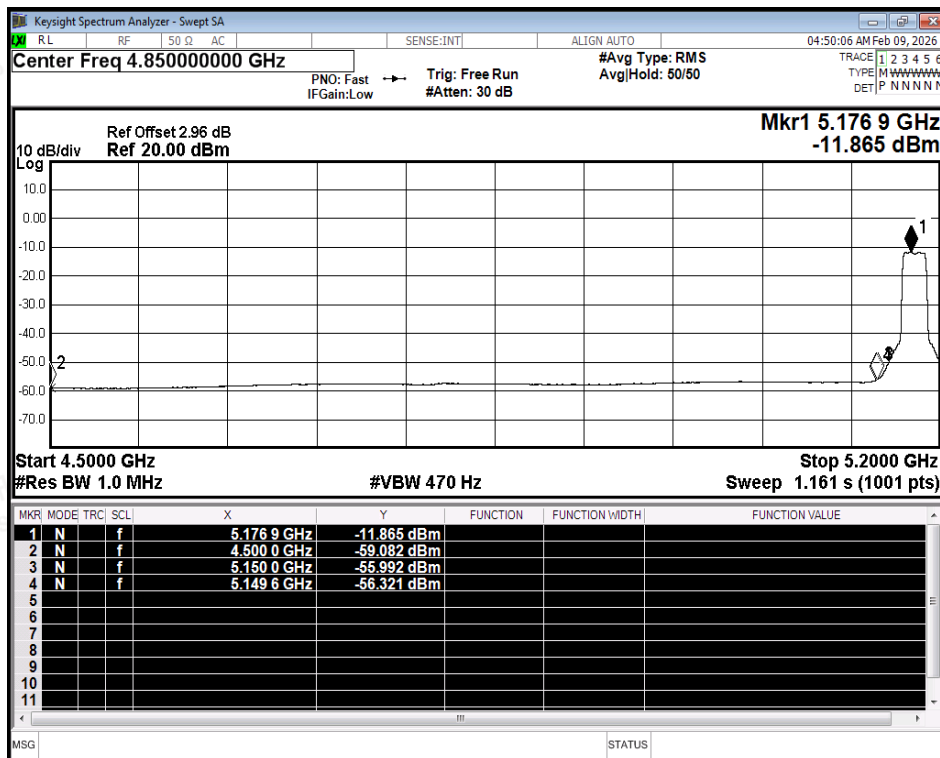

Restrict Band NVNT ax20 5180MHz Ant2 Average




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

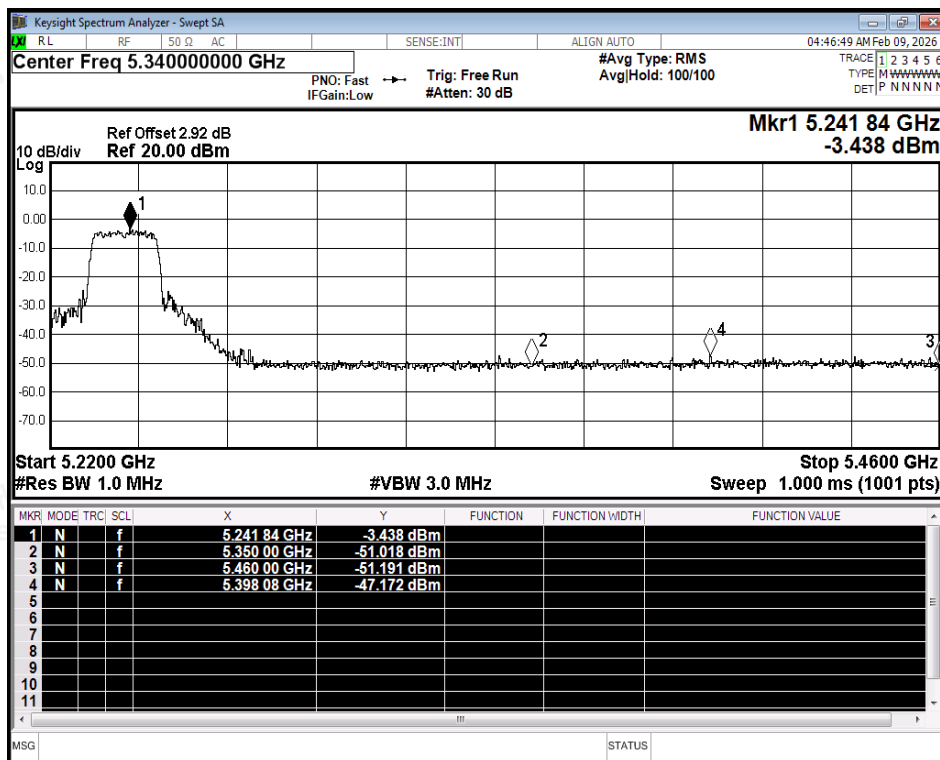

Restrict Band NVNT ax20 5240MHz Ant2 Peak

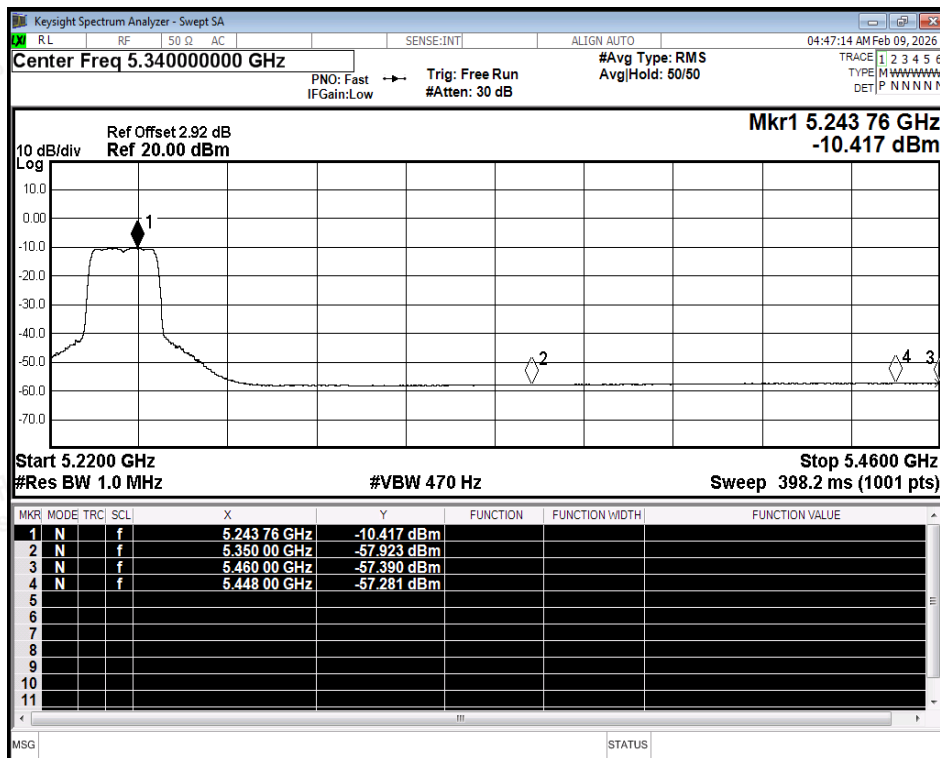

Restrict Band NVNT ax20 5240MHz Ant2 Average




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

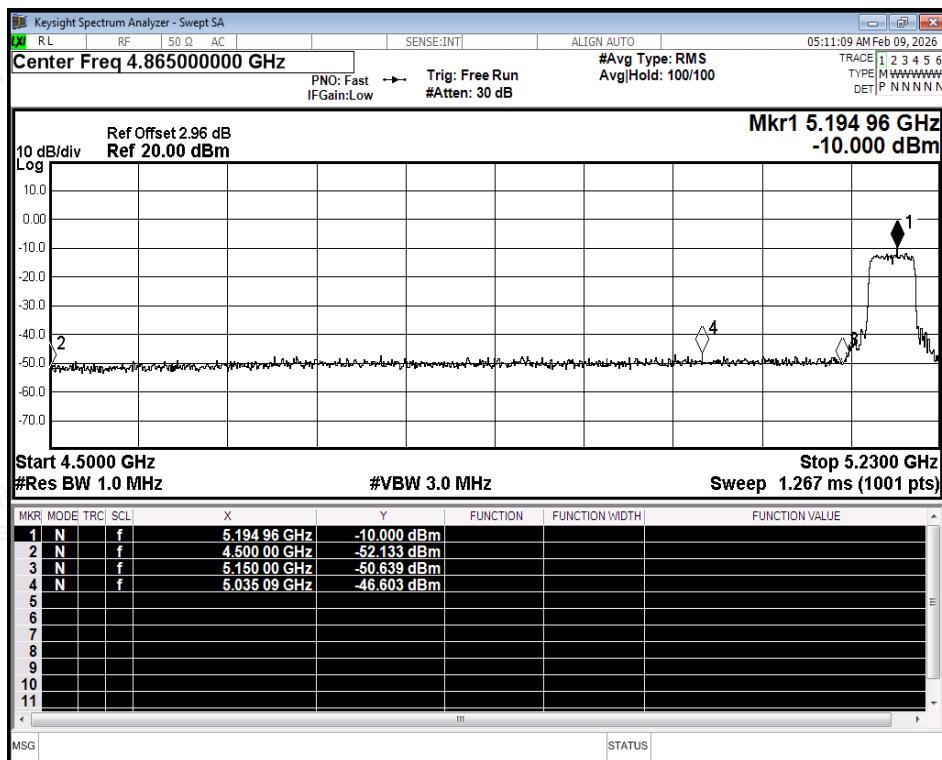

Restrict Band NVNT ax40 5190MHz Ant2 Peak

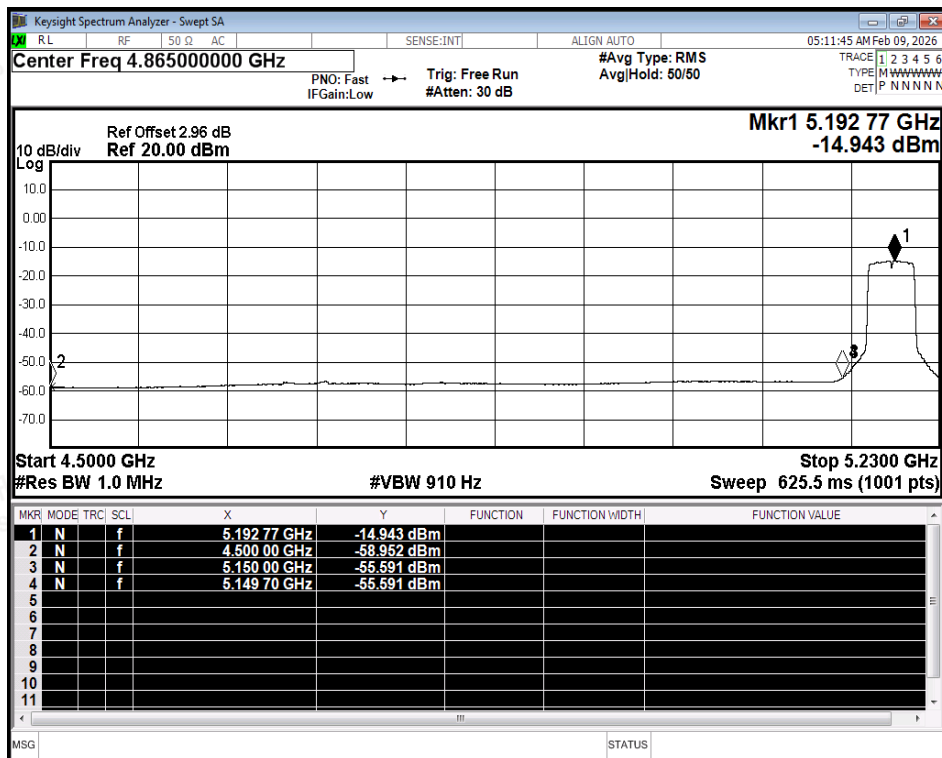

Restrict Band NVNT ax40 5190MHz Ant2 Average




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

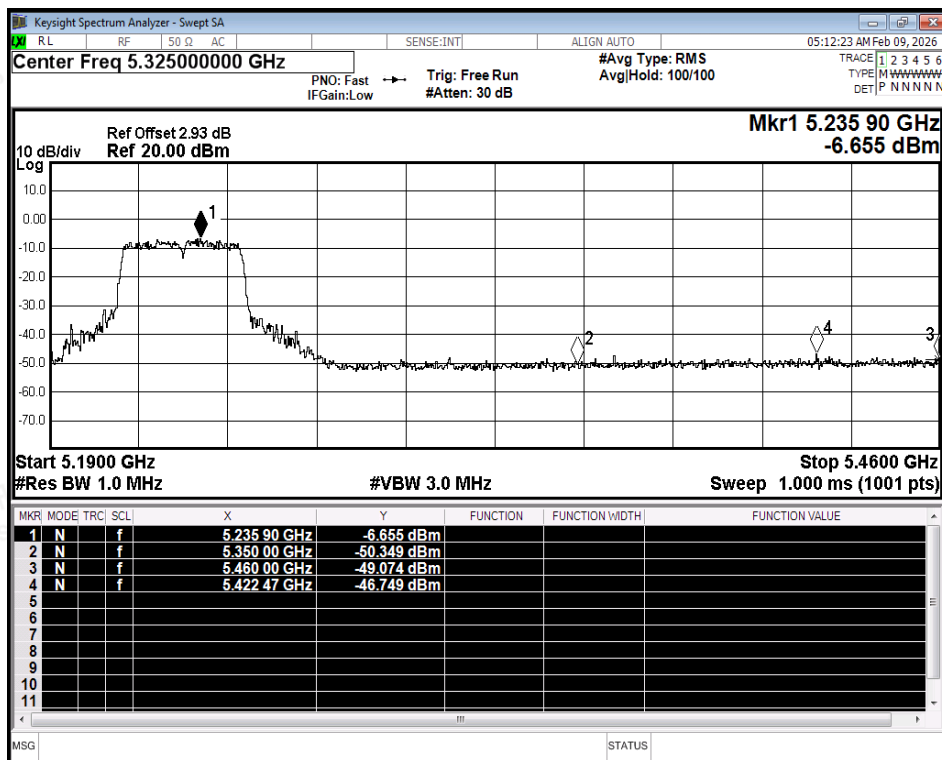

Restrict Band NVNT ax40 5230MHz Ant2 Peak

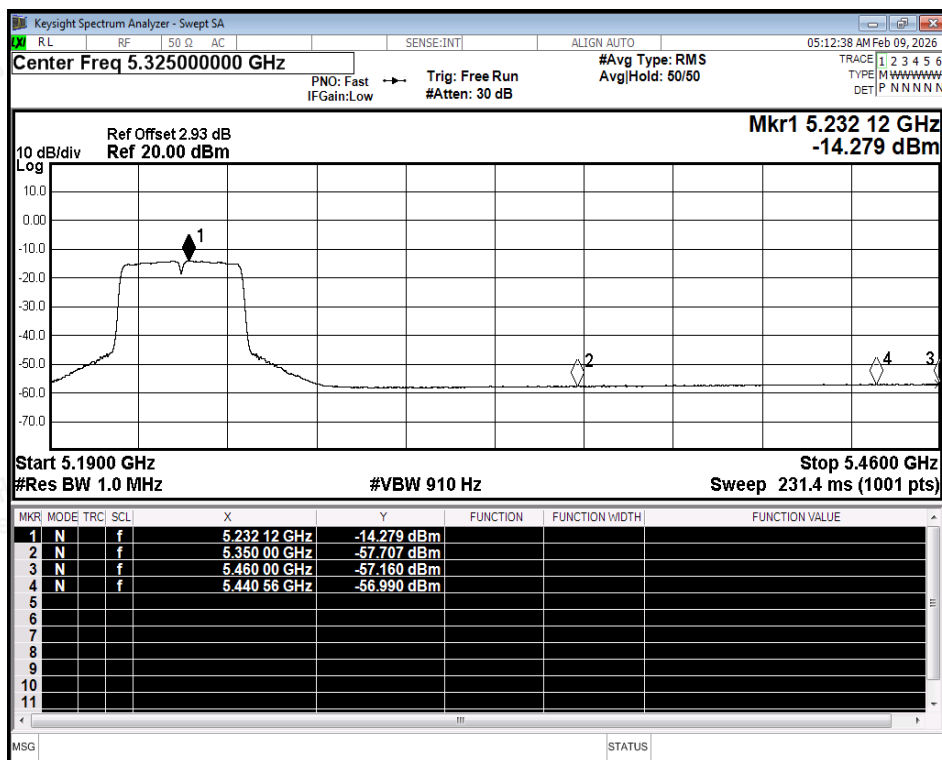

Restrict Band NVNT ax40 5230MHz Ant2 Average




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

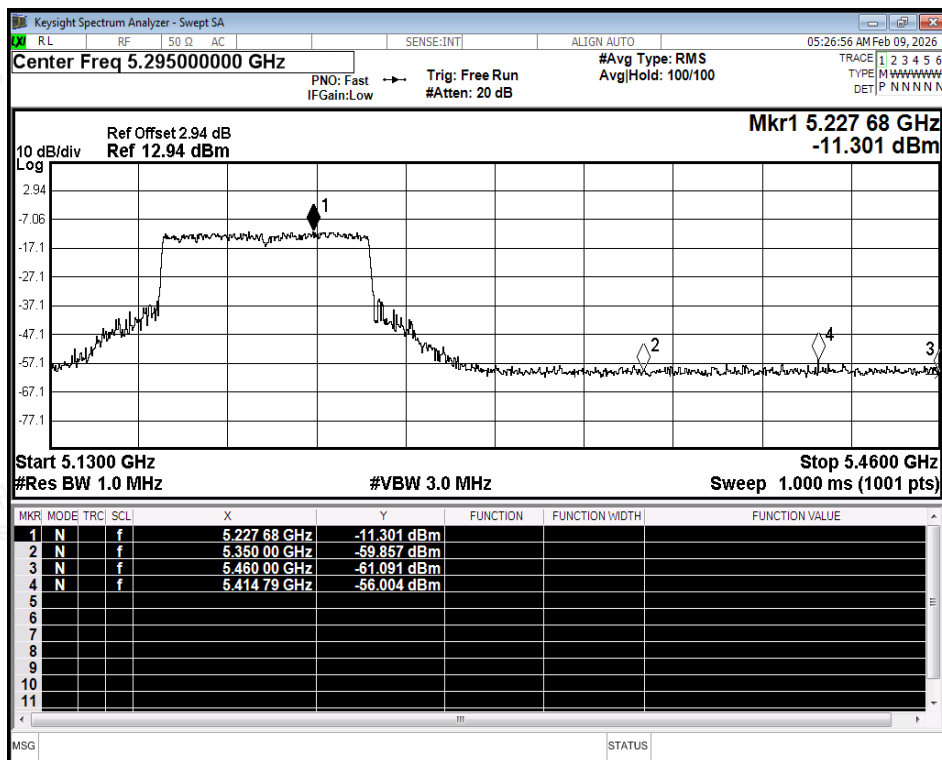

Restrict Band NVNT ax80 5210MHz Ant2 Peak

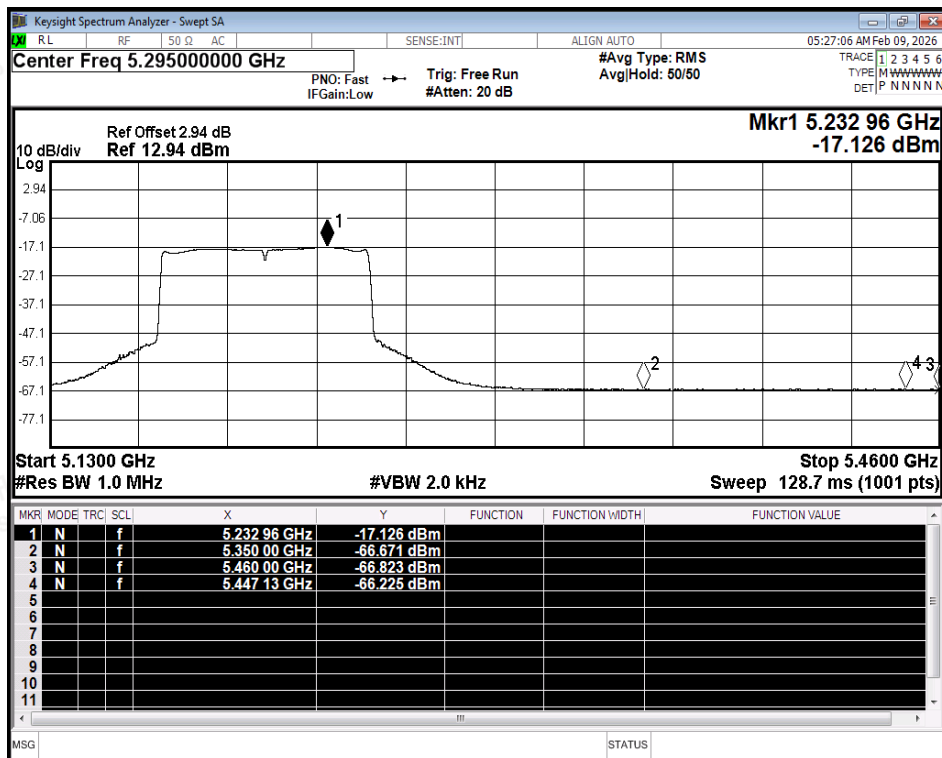

Restrict Band NVNT ax80 5210MHz Ant2 Average




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

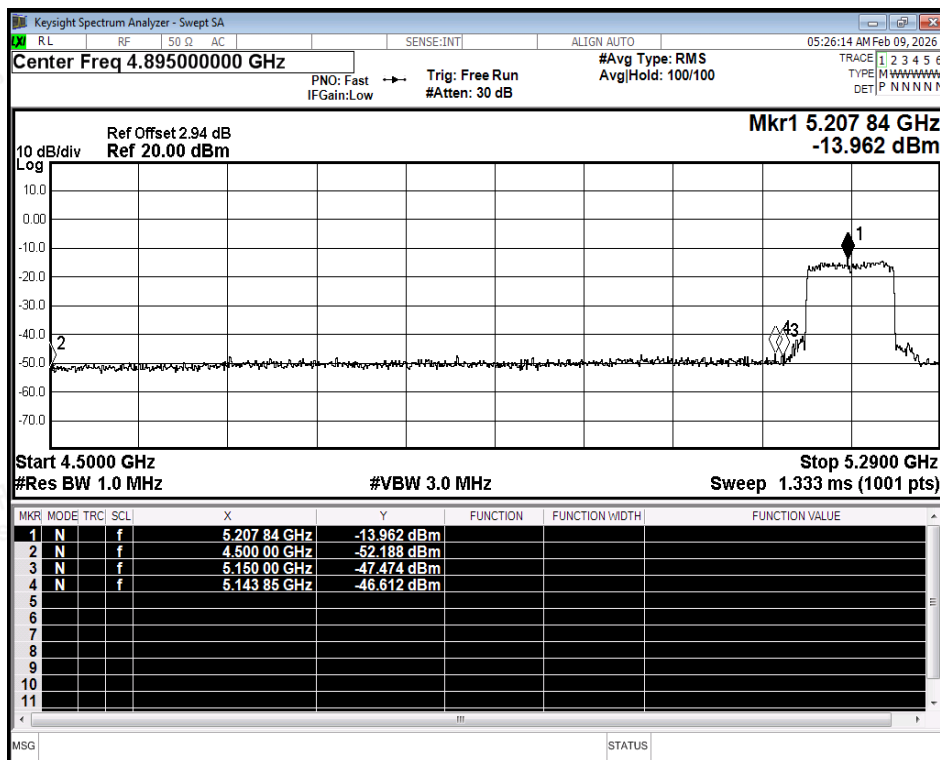

Restrict Band NVNT ax80 5210MHz Ant2 Peak

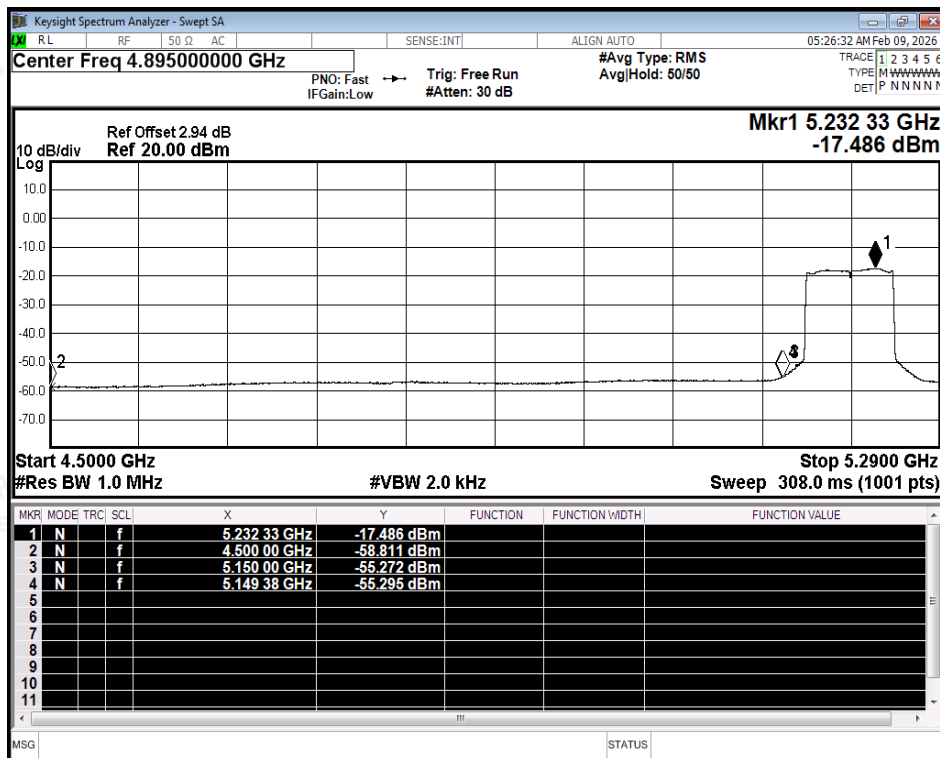

Restrict Band NVNT ax80 5210MHz Ant2 Average



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



MIMO

Condition	Mode	Frequency (MHz)	Spur Freq (MHz)	E (dBuV/m)			Detector	Limit (dBuV/m)	Verdict
				Ant1	Ant2	Ant1+ Ant2			
NVNT	n20	5180	4500	44.62	44.41	50.54	Peak	68.2	Pass
NVNT	n20	5180	4500	38.38	38.11	44.27	Average	54	Pass
NVNT	n20	5180	5106.2	50.41	50.08	56.27	Peak	68.2	Pass
NVNT	n20	5180	5149.6	41.26	40.93	47.12	Average	54	Pass
NVNT	n20	5180	5150	48.79	49.03	54.93	Peak	68.2	Pass
NVNT	n20	5180	5150	41.12	41.02	47.09	Average	54	Pass
NVNT	n20	5240	5350	46.15	45.63	51.91	Peak	68.2	Pass
NVNT	n20	5240	5350	39.29	39.4	45.37	Average	54	Pass
NVNT	n20	5240	5409.84	50.6	49.55	56.11	Peak	68.2	Pass
NVNT	n20	5240	5425.68	40.3	39.96	46.15	Average	54	Pass
NVNT	n20	5240	5460	46.58	46.58	52.60	Peak	68.2	Pass
NVNT	n20	5240	5460	39.87	39.7	45.81	Average	54	Pass
NVNT	n40	5190	4500	35.51	35.52	41.54	Peak	68.2	Pass
NVNT	n40	5190	4500	28.54	28.47	34.53	Average	54	Pass
NVNT	n40	5190	5147.51	45.04	44.08	50.59	Peak	68.2	Pass
NVNT	n40	5190	5149.7	37.48	37.81	43.67	Average	54	Pass
NVNT	n40	5190	5150	44.28	41.99	49.23	Peak	68.2	Pass
NVNT	n40	5190	5150	38.78	38.73	44.78	Average	54	Pass
NVNT	n40	5230	5350	38.2	46.51	49.33	Peak	68.2	Pass
NVNT	n40	5230	5350	30.36	39.44	42.06	Average	54	Pass
NVNT	n40	5230	5396.82	40.43	49.31	51.98	Peak	68.2	Pass
NVNT	n40	5230	5425.17	30.82	40.23	42.76	Average	54	Pass
NVNT	n40	5230	5460	36.78	46.02	48.60	Peak	68.2	Pass
NVNT	n40	5230	5460	30.29	40.03	42.48	Average	54	Pass
NVNT	ac20	5180	4500	44.54	46.11	51.38	Peak	68.2	Pass
NVNT	ac20	5180	4500	38.25	38.15	44.22	Average	54	Pass
NVNT	ac20	5180	5097.1	49.79	50.24	56.04	Peak	68.2	Pass
NVNT	ac20	5180	5149.6	40.95	40.89	46.94	Average	54	Pass
NVNT	ac20	5180	5150	47.85	47.61	53.75	Peak	68.2	Pass
NVNT	ac20	5180	5150	41.03	41.05	47.06	Average	54	Pass
NVNT	ac20	5240	5350	46.35	45.9	52.15	Peak	68.2	Pass
NVNT	ac20	5240	5350	39.64	39.29	45.49	Average	54	Pass
NVNT	ac20	5240	5437.2	49.2	49.59	55.42	Peak	68.2	Pass
NVNT	ac20	5240	5450.64	40.23	39.99	46.13	Average	54	Pass
NVNT	ac20	5240	5460	47.85	46.84	53.38	Peak	68.2	Pass
NVNT	ac20	5240	5460	39.71	39.8	45.78	Average	54	Pass
NVNT	ac40	5190	4500	35.77	44.63	47.30	Peak	68.2	Pass



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



NVNT	ac40	5190	4500	28.73	38.35	40.83	Average	54	Pass
NVNT	ac40	5190	5082.54	43.61	50.28	53.59	Peak	68.2	Pass
NVNT	ac40	5190	5149.7	37.58	41.52	45.79	Average	54	Pass
NVNT	ac40	5190	5150	46.92	47.43	53.20	Peak	68.2	Pass
NVNT	ac40	5190	5150	39.08	41.63	46.47	Average	54	Pass
NVNT	ac40	5230	5350	37.28	46.31	48.94	Peak	68.2	Pass
NVNT	ac40	5230	5350	30.42	39.5	42.12	Average	54	Pass
NVNT	ac40	5230	5369.55	40.1	49.26	51.86	Peak	68.2	Pass
NVNT	ac40	5230	5441.37	30.82	40.43	42.91	Average	54	Pass
NVNT	ac40	5230	5460	36.07	47.71	49.73	Peak	68.2	Pass
NVNT	ac40	5230	5460	30.23	39.92	42.38	Average	54	Pass
NVNT	ac80	5210	5350	48.18	46.28	53.30	Peak	68.2	Pass
NVNT	ac80	5210	5350	42.45	40.18	47.41	Average	54	Pass
NVNT	ac80	5210	5453.73	51.66	50.86	57.29	Peak	68.2	Pass
NVNT	ac80	5210	5405.22	42.45	40.98	47.77	Average	54	Pass
NVNT	ac80	5210	5460	47.48	48.92	54.25	Peak	68.2	Pass
NVNT	ac80	5210	5460	40.24	40.92	46.61	Average	54	Pass
NVNT	ac80	5210	4500	36.29	45.64	48.19	Peak	68.2	Pass
NVNT	ac80	5210	4500	28.8	38.58	41.02	Average	54	Pass
NVNT	ac80	5210	4721.2	40.21	50.03	52.46	Peak	68.2	Pass
NVNT	ac80	5210	5149.38	32.13	41.93	44.37	Average	54	Pass
NVNT	ac80	5210	5150	36.43	47.74	49.83	Peak	68.2	Pass
NVNT	ac80	5210	5150	31.2	41.98	44.19	Average	54	Pass
NVNT	ax20	5180	4500	35.48	46.32	48.51	Peak	68.2	Pass
NVNT	ax20	5180	4500	28.31	38.15	40.58	Average	54	Pass
NVNT	ax20	5180	5065.6	41.55	50.43	53.10	Peak	68.2	Pass
NVNT	ax20	5180	5149.6	36.48	40.91	45.00	Average	54	Pass
NVNT	ax20	5180	5150	42.64	47.87	51.66	Peak	68.2	Pass
NVNT	ax20	5180	5150	36.78	41.24	45.31	Average	54	Pass
NVNT	ax20	5240	5350	38.2	46.22	49.13	Peak	68.2	Pass
NVNT	ax20	5240	5350	30.41	39.31	41.97	Average	54	Pass
NVNT	ax20	5240	5398.08	40.25	50.06	52.49	Peak	68.2	Pass
NVNT	ax20	5240	5448	30.93	39.95	42.58	Average	54	Pass
NVNT	ax20	5240	5460	36.69	46.04	48.59	Peak	68.2	Pass
NVNT	ax20	5240	5460	30.11	39.84	42.29	Average	54	Pass
NVNT	ax40	5190	4500	36.35	45.1	47.80	Peak	68.2	Pass
NVNT	ax40	5190	4500	28.58	38.28	40.74	Average	54	Pass
NVNT	ax40	5190	5035.09	45.75	50.63	54.55	Peak	68.2	Pass
NVNT	ax40	5190	5149.7	37.95	41.64	46.01	Average	54	Pass
NVNT	ax40	5190	5150	47.62	47.86	53.76	Peak	68.2	Pass
NVNT	ax40	5190	5150	38.02	41.72	46.09	Average	54	Pass



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



NVNT	ax40	5230	5350	36.52	46.89	49.19	Peak	68.2	Pass
NVNT	ax40	5230	5350	30.32	39.53	42.11	Average	54	Pass
NVNT	ax40	5230	5422.47	39.73	50.49	52.70	Peak	68.2	Pass
NVNT	ax40	5230	5440.56	30.71	40.24	42.74	Average	54	Pass
NVNT	ax40	5230	5460	36.72	48.16	50.22	Peak	68.2	Pass
NVNT	ax40	5230	5460	30.19	40.07	42.49	Average	54	Pass
NVNT	ax80	5210	5350	50.64	37.38	52.35	Peak	68.2	Pass
NVNT	ax80	5210	5350	41.66	30.56	43.79	Average	54	Pass
NVNT	ax80	5210	5414.79	51.96	41.23	54.18	Peak	68.2	Pass
NVNT	ax80	5210	5447.13	41.74	31.01	43.96	Average	54	Pass
NVNT	ax80	5210	5460	45.48	36.14	48.03	Peak	68.2	Pass
NVNT	ax80	5210	5460	40.67	30.41	42.99	Average	54	Pass
NVNT	ax80	5210	4500	36.16	45.05	47.72	Peak	68.2	Pass
NVNT	ax80	5210	4500	28.58	38.42	40.85	Average	54	Pass
NVNT	ax80	5210	5143.85	40.23	50.62	52.91	Peak	68.2	Pass
NVNT	ax80	5210	5149.38	31.92	41.94	44.32	Average	54	Pass
NVNT	ax80	5210	5150	36.2	49.76	51.41	Peak	68.2	Pass
NVNT	ax80	5210	5150	31.33	41.96	44.20	Average	54	Pass







A.5 Frequency Stability

Condition	Mode	Frequency (MHz)	Antenna	Measured Frequency (MHz)	Frequency Error (Hz)	Deviation (ppm)	Limit (ppm)	Verdict
NVNT	a	5180	Ant1	5180	0	0	25	Pass
NVNT	a	5200	Ant1	5199.98	-20000	-3.85	25	Pass
NVNT	a	5240	Ant1	5239.96	-40000	-7.63	25	Pass
NVNT	n20	5180	Ant1	5180	0	0	25	Pass
NVNT	n20	5200	Ant1	5199.98	-20000	-3.85	25	Pass
NVNT	n20	5240	Ant1	5239.98	-20000	-3.82	25	Pass
NVNT	n40	5190	Ant1	5190	0	0	25	Pass
NVNT	n40	5230	Ant1	5230	0	0	25	Pass
NVNT	ac20	5180	Ant1	5179.98	-20000	-3.86	25	Pass
NVNT	ac20	5200	Ant1	5199.98	-20000	-3.85	25	Pass
NVNT	ac20	5240	Ant1	5239.98	-20000	-3.82	25	Pass
NVNT	ac40	5190	Ant1	5190	0	0	25	Pass
NVNT	ac80	5210	Ant1	5210	0	0	25	Pass
NVNT	ax20	5180	Ant1	5180	0	0	25	Pass
NVNT	ax20	5200	Ant1	5199.98	-20000	-3.85	25	Pass
NVNT	ax20	5240	Ant1	5240	0	0	25	Pass
NVNT	ax40	5190	Ant1	5190	0	0	25	Pass
NVNT	ax40	5230	Ant1	5230	0	0	25	Pass
NVNT	ax80	5210	Ant1	5210	0	0	25	Pass



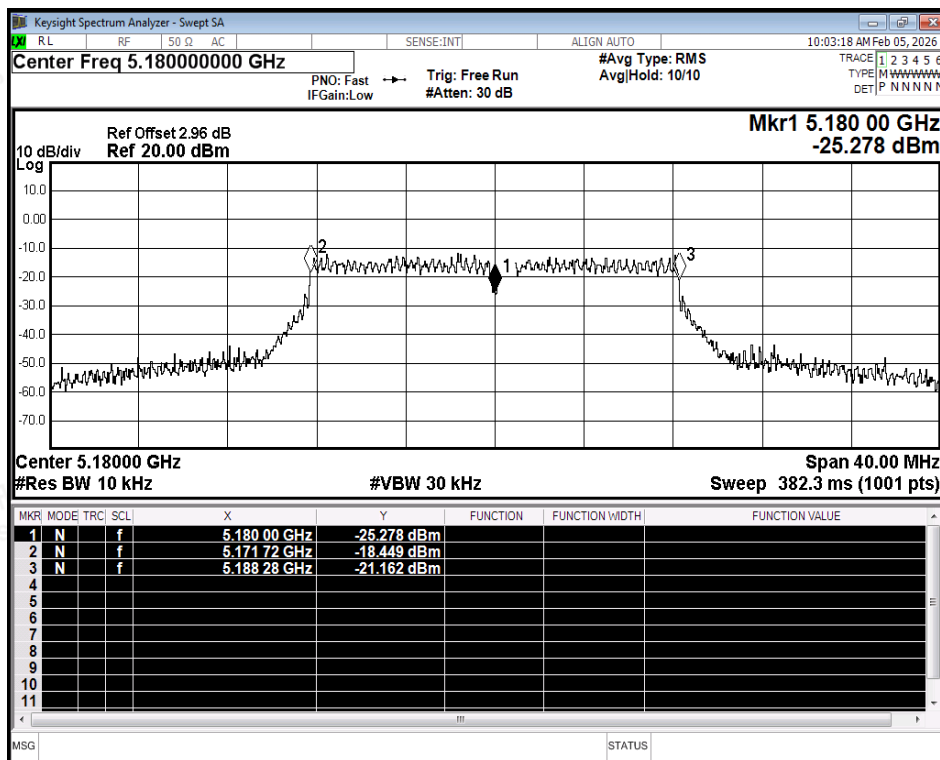

Freq. Stability NVNT a 5180MHz Ant1

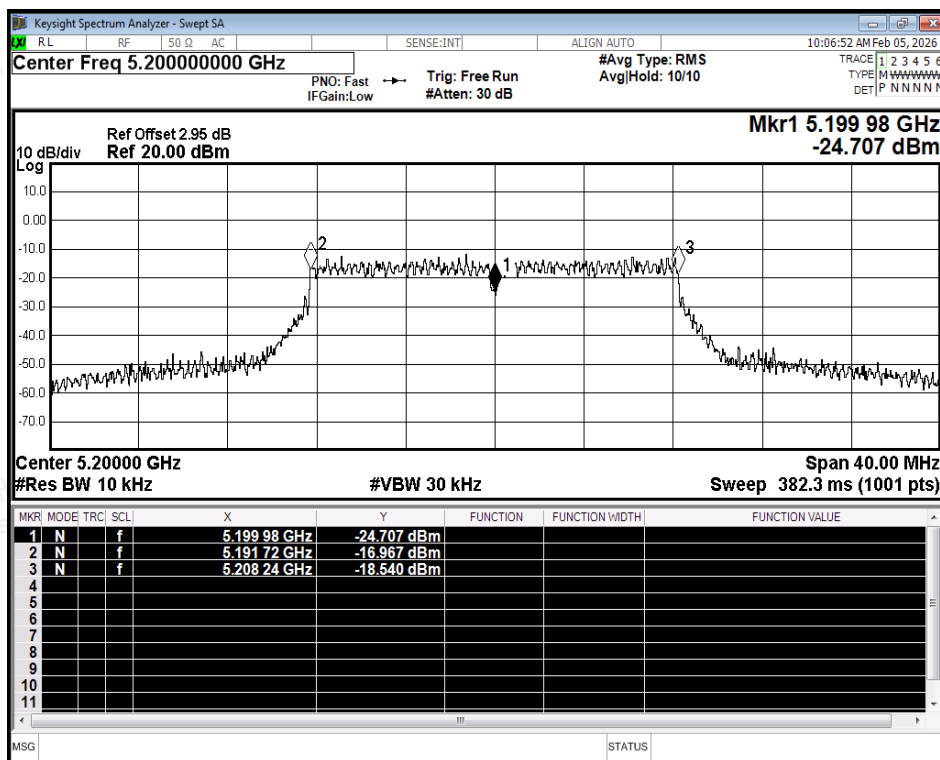

Freq. Stability NVNT a 5200MHz Ant1




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

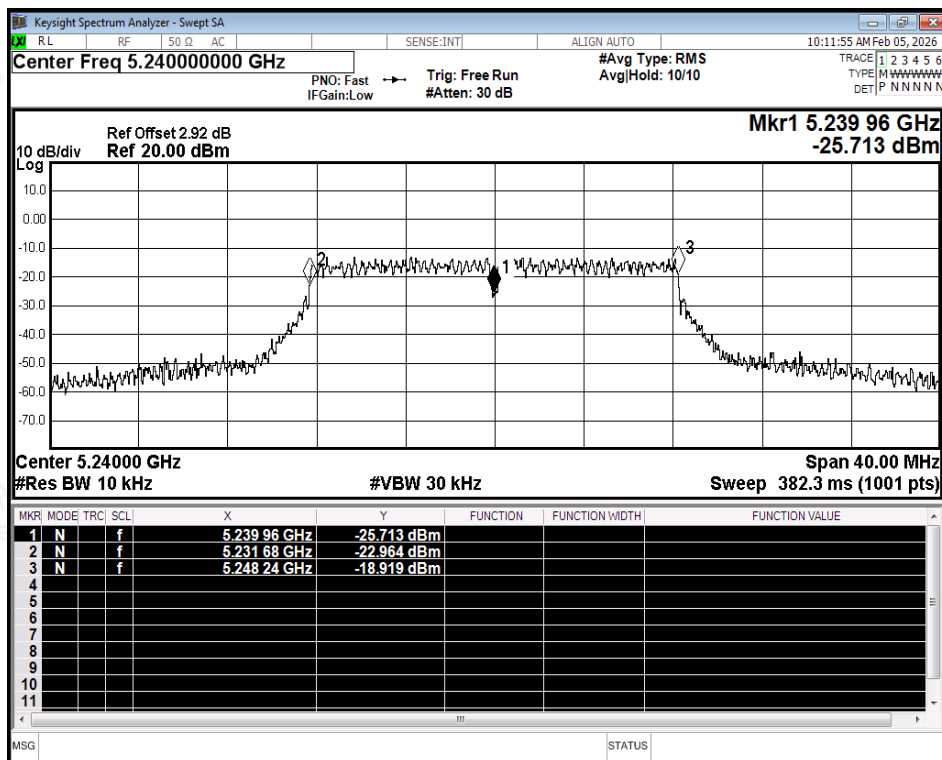

Freq. Stability NVNT a 5240MHz Ant1

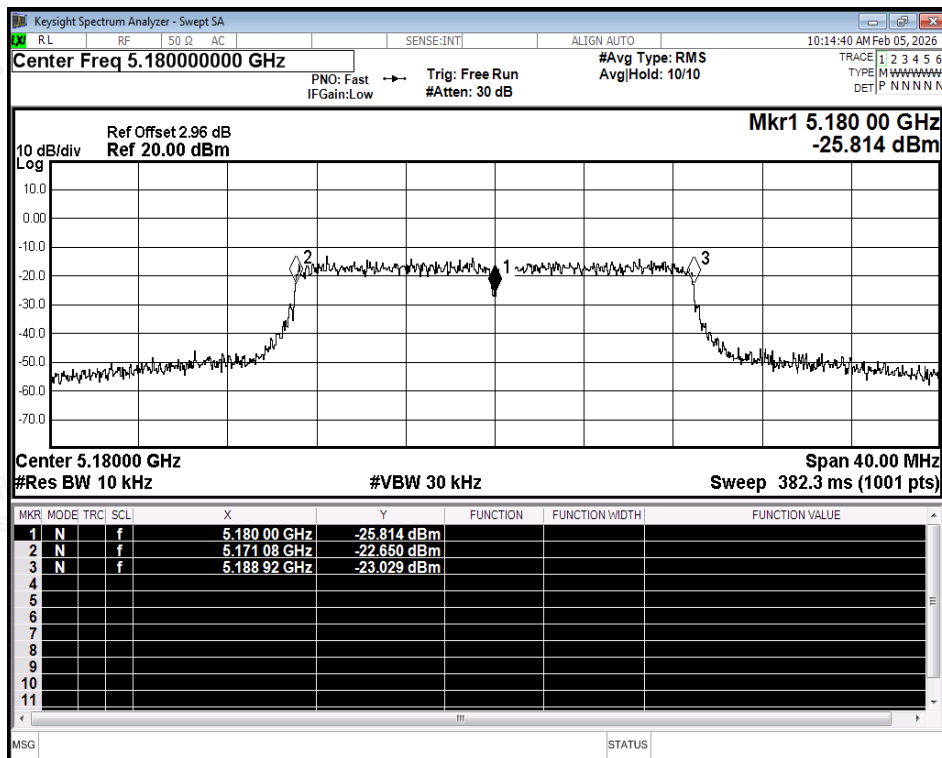

Freq. Stability NVNT n20 5180MHz Ant1




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

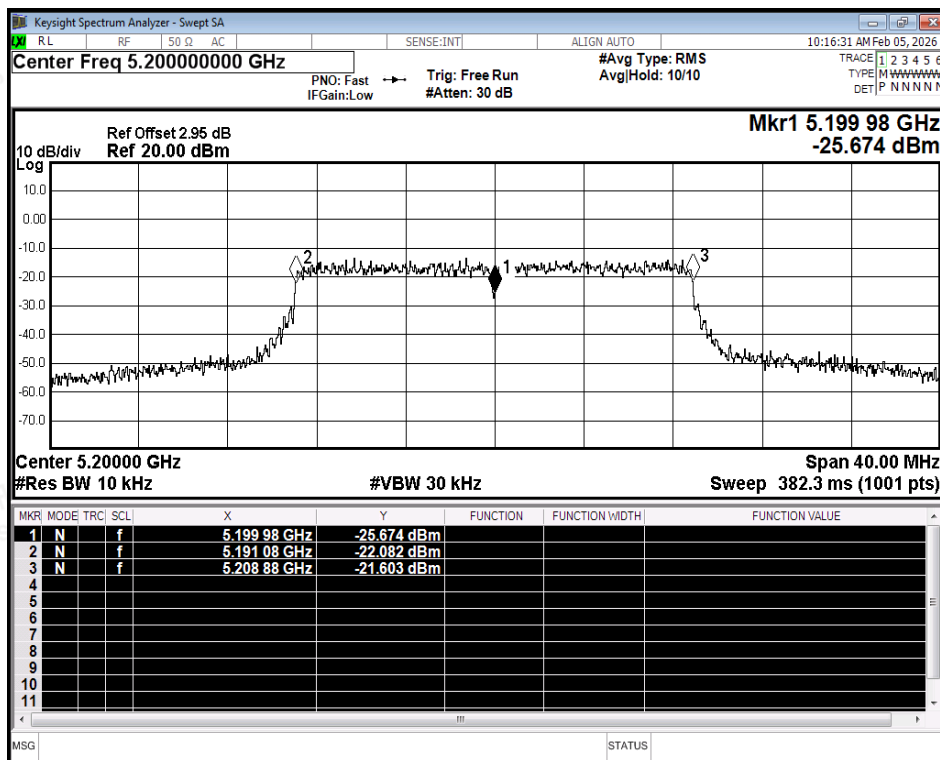

Freq. Stability NVNT n20 5200MHz Ant1

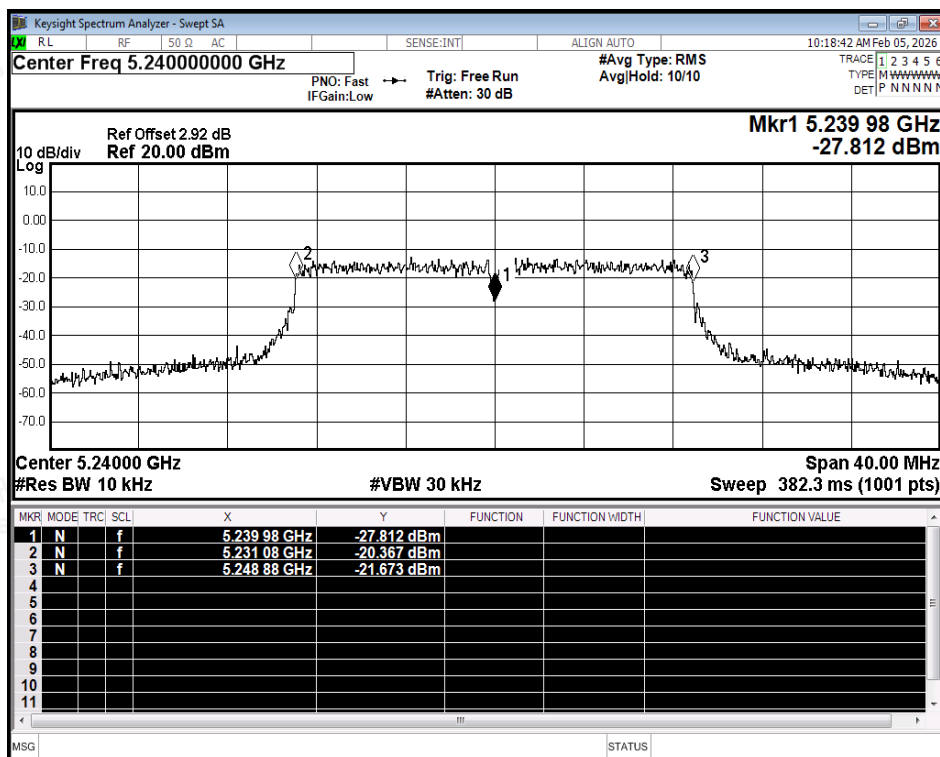

Freq. Stability NVNT n20 5240MHz Ant1




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

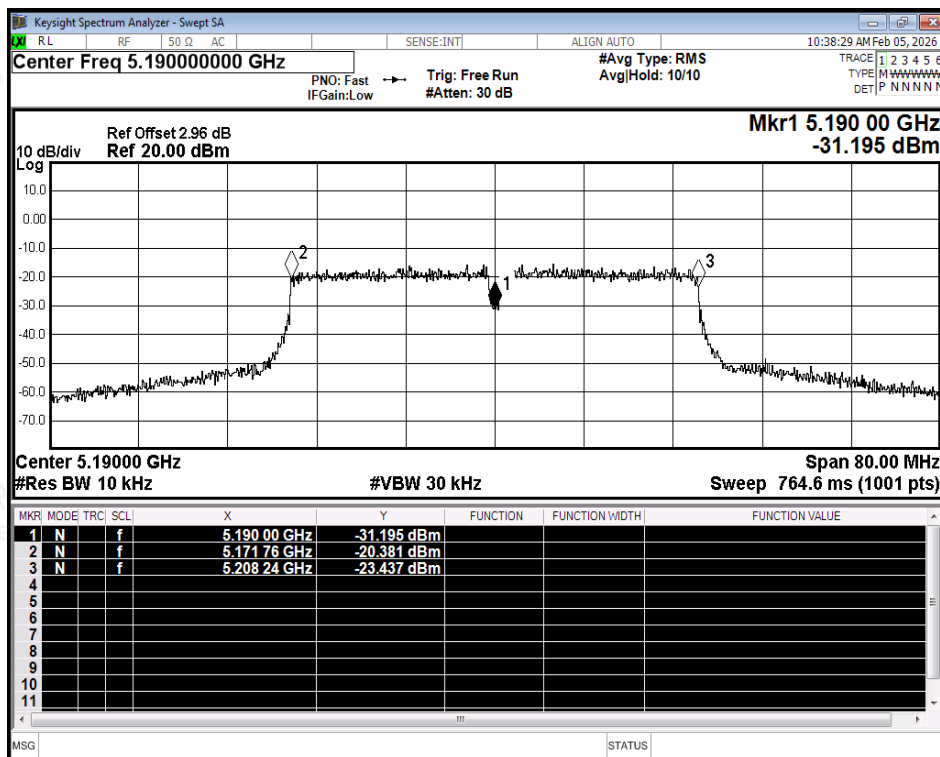

Freq. Stability NVNT n40 5190MHz Ant1

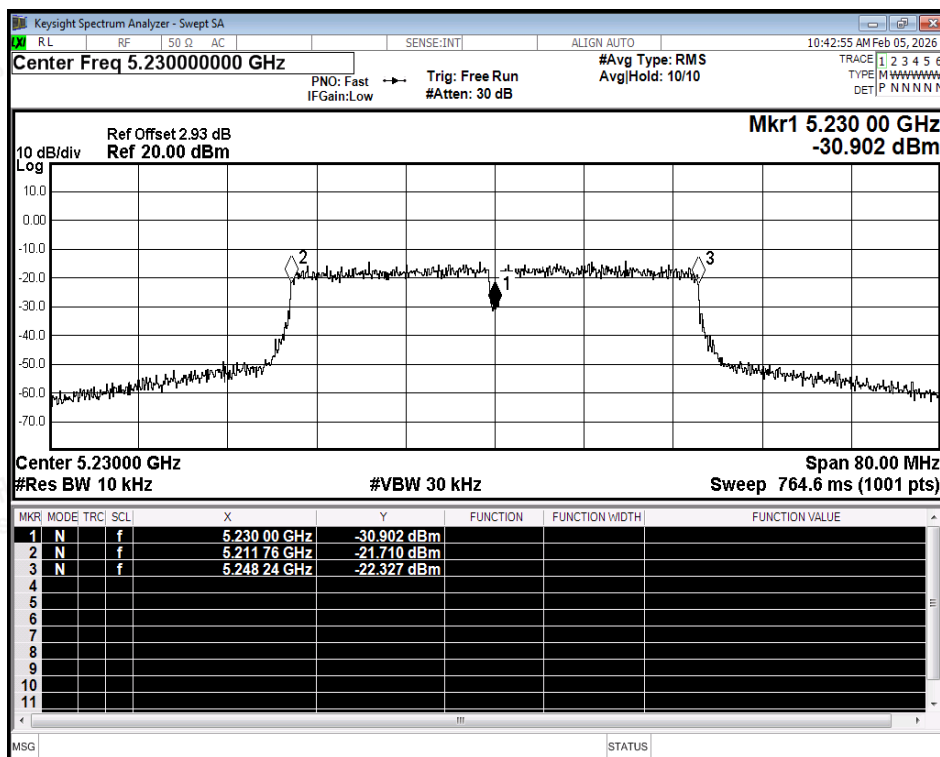

Freq. Stability NVNT n40 5230MHz Ant1




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

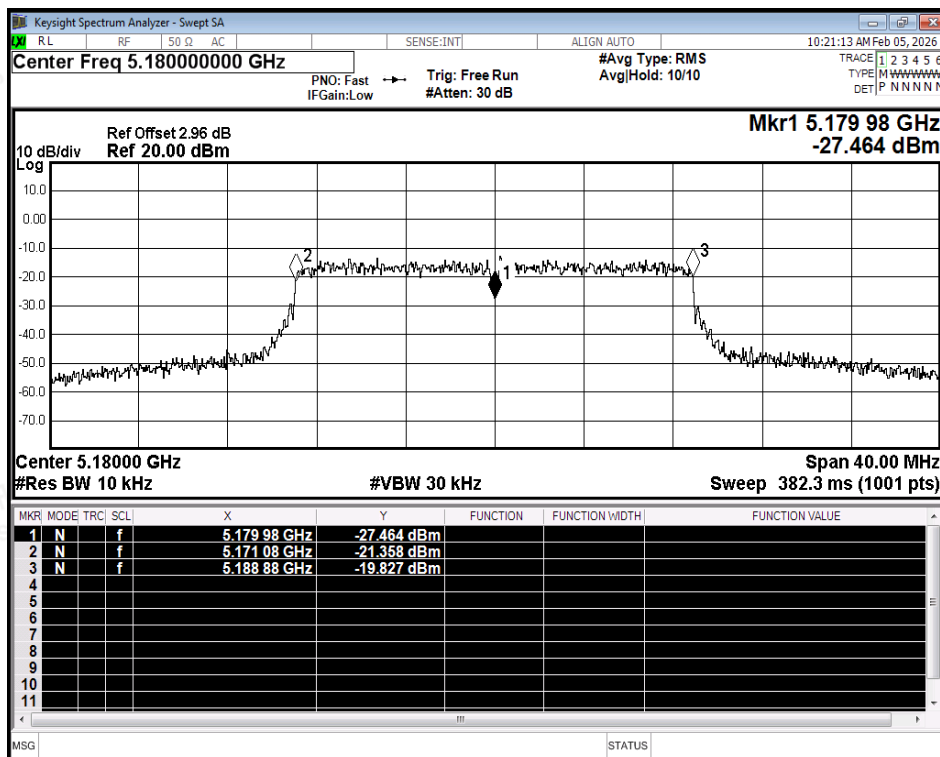

Freq. Stability NVNT ac20 5180MHz Ant1

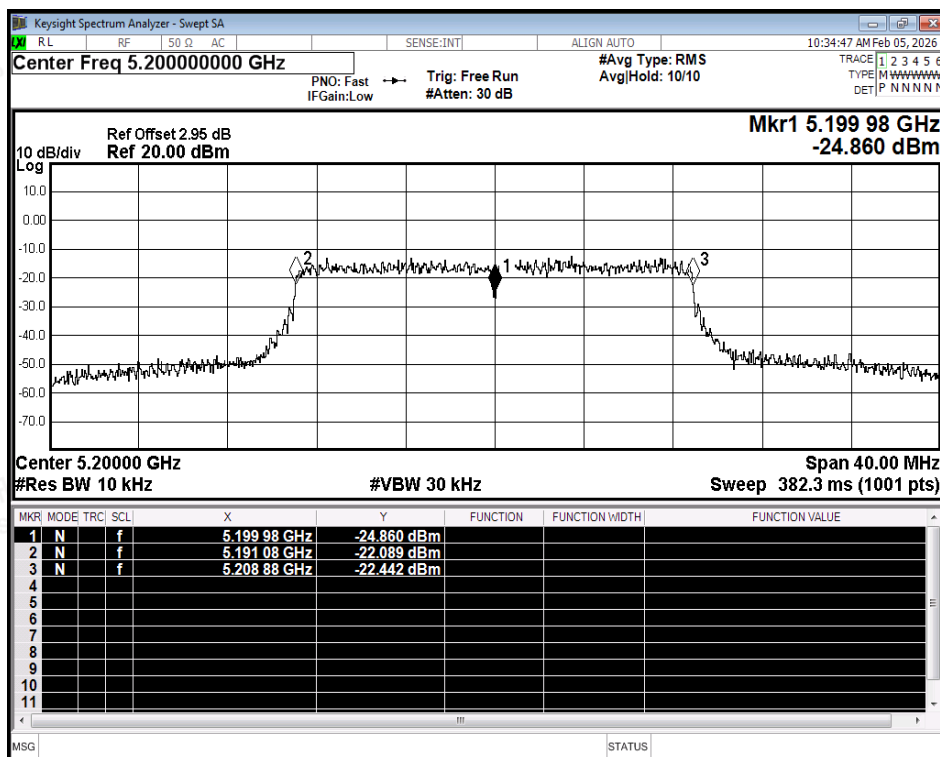

Freq. Stability NVNT ac20 5200MHz Ant1




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

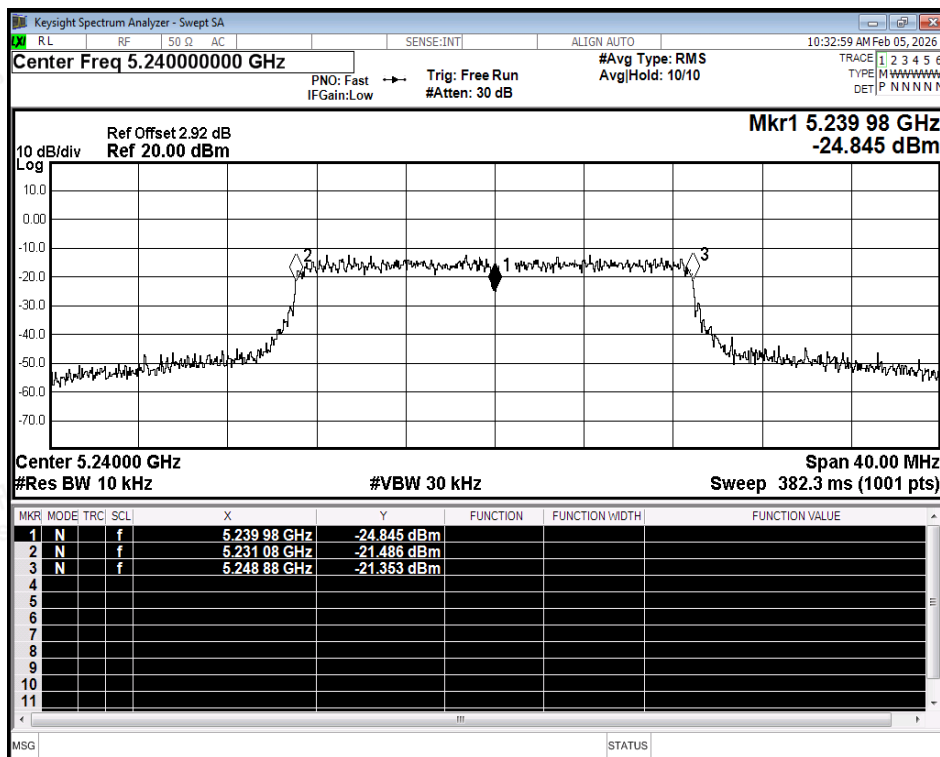

Freq. Stability NVNT ac20 5240MHz Ant1

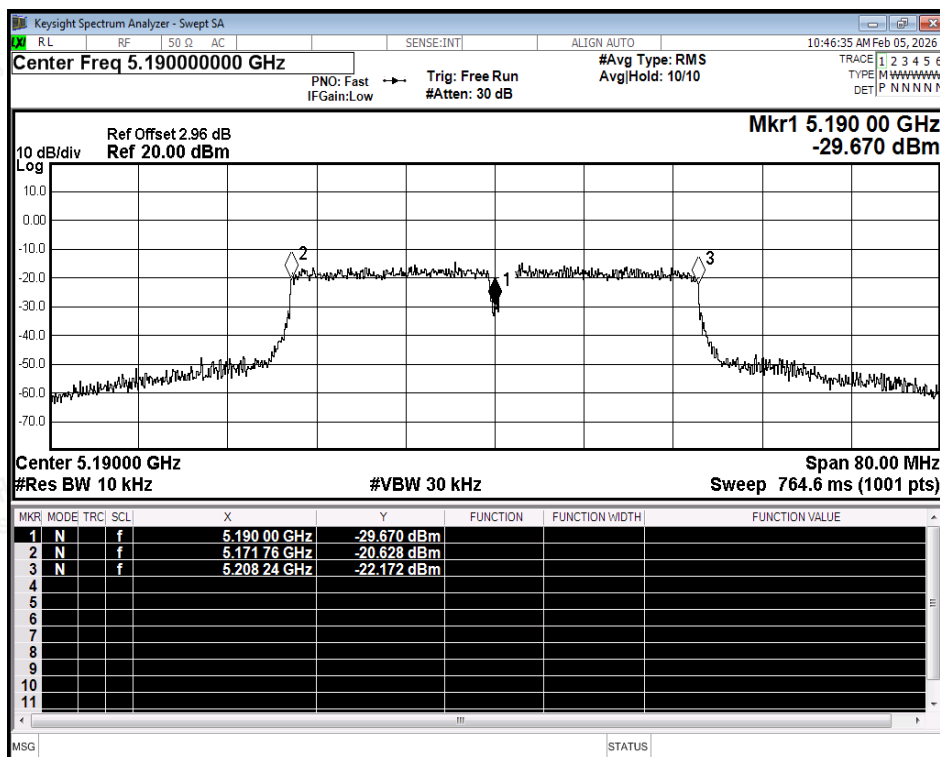

Freq. Stability NVNT ac40 5190MHz Ant1




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

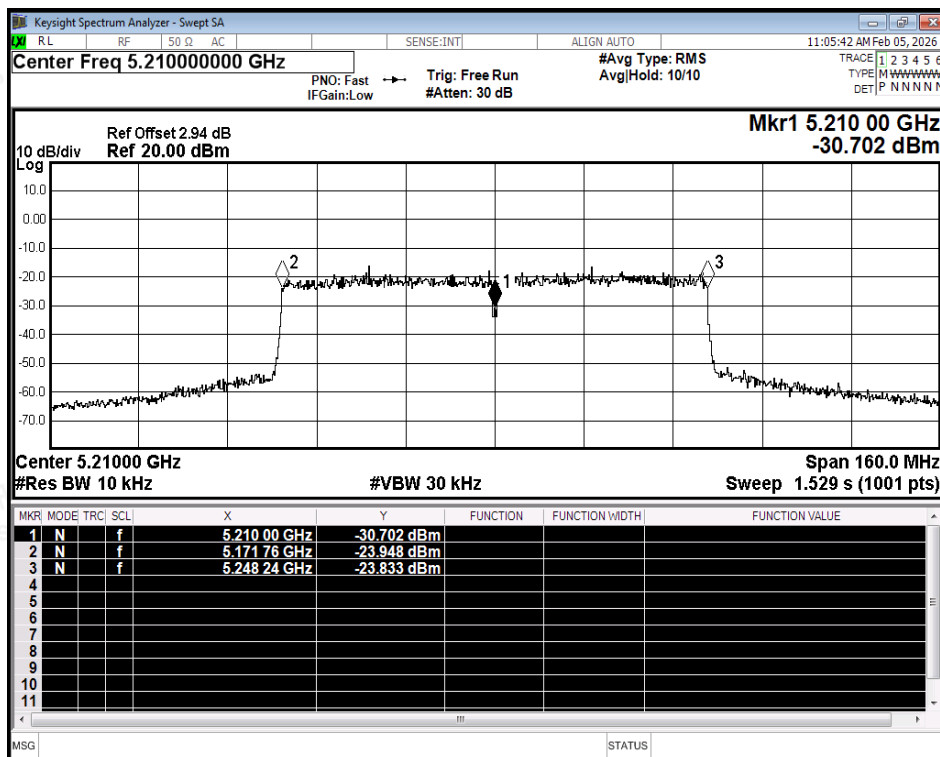

Freq. Stability NVNT ac80 5210MHz Ant1

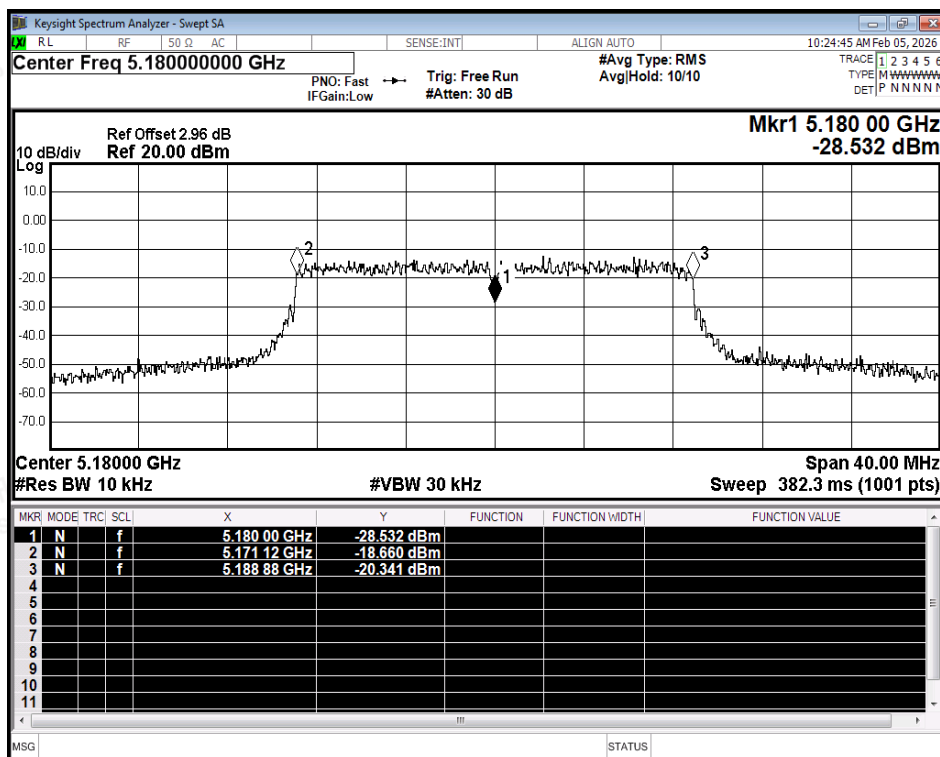

Freq. Stability NVNT ax20 5180MHz Ant1




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

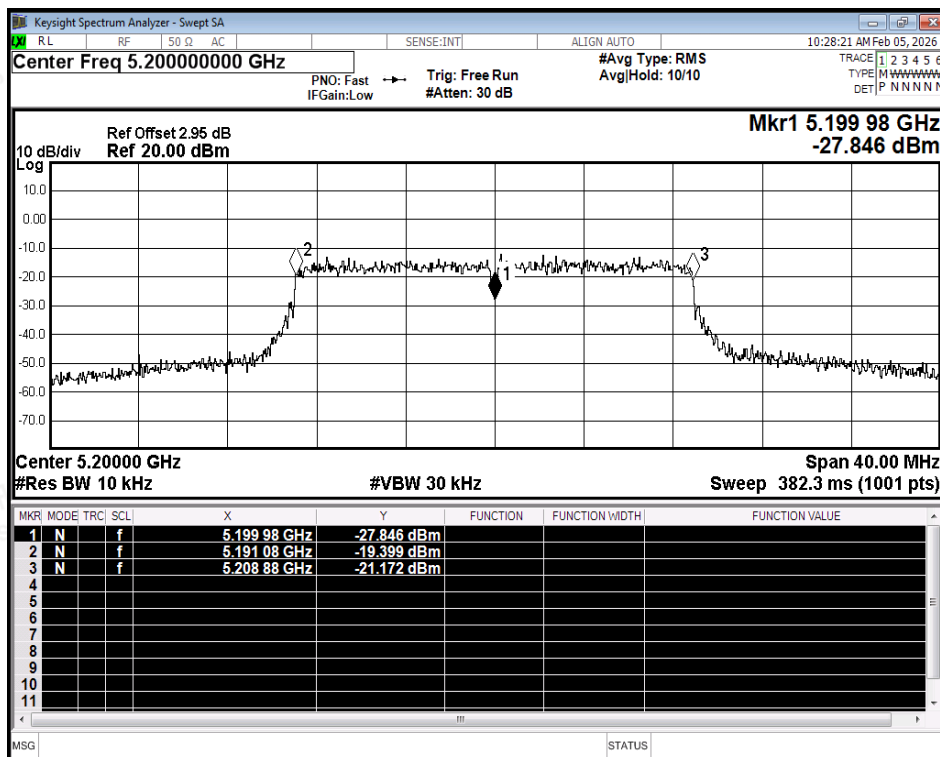

Freq. Stability NVNT ax20 5200MHz Ant1

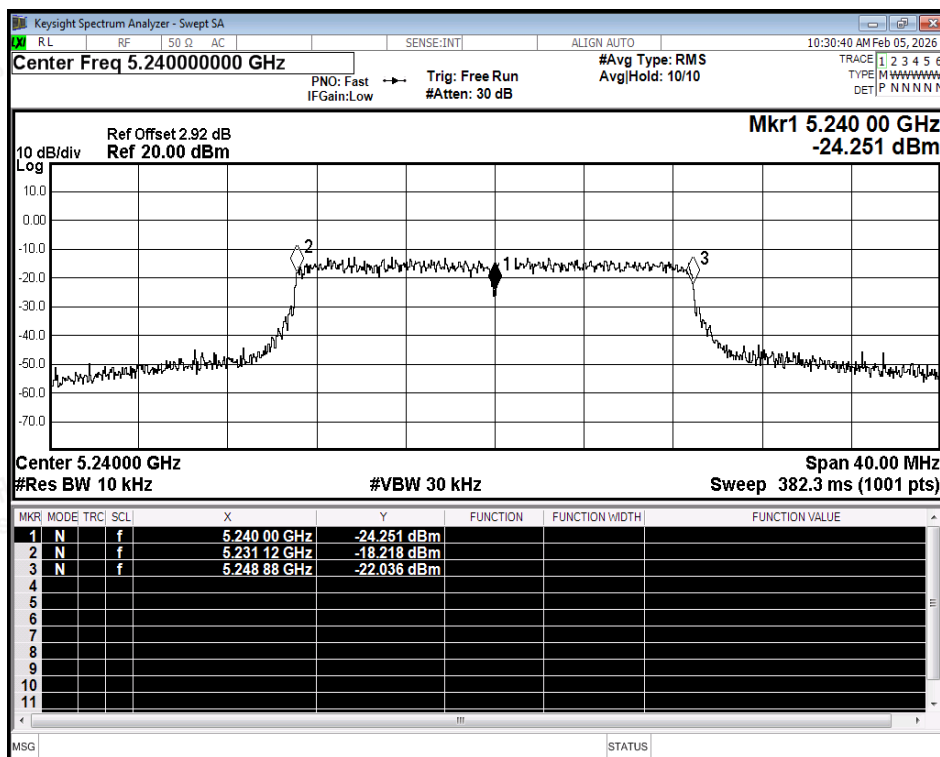

Freq. Stability NVNT ax20 5240MHz Ant1




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

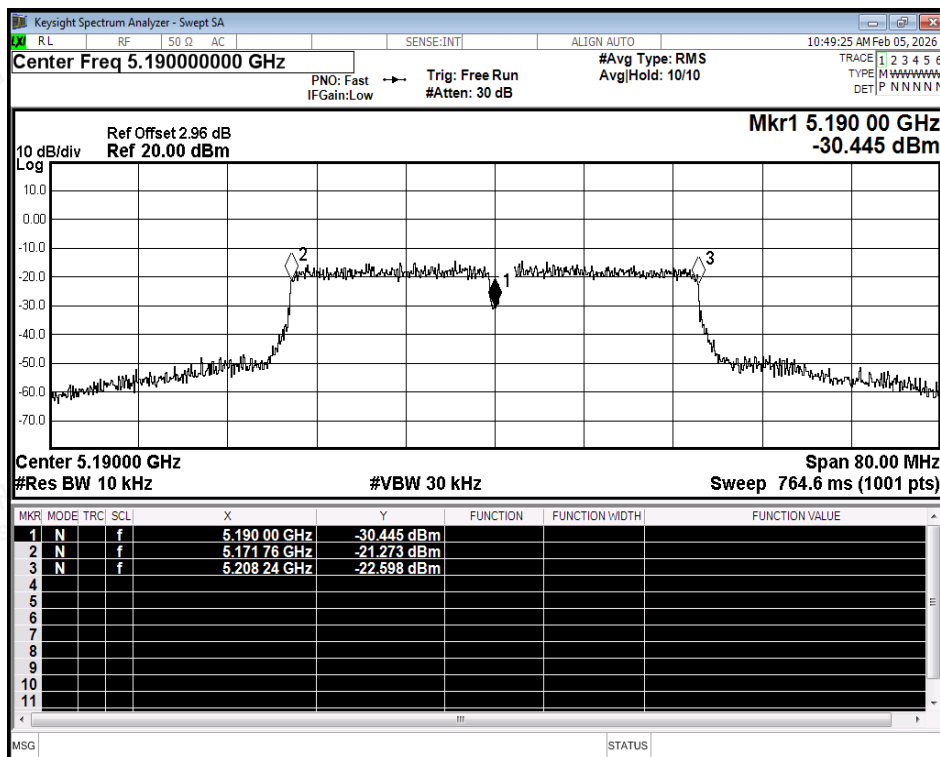

Freq. Stability NVNT ax40 5190MHz Ant1

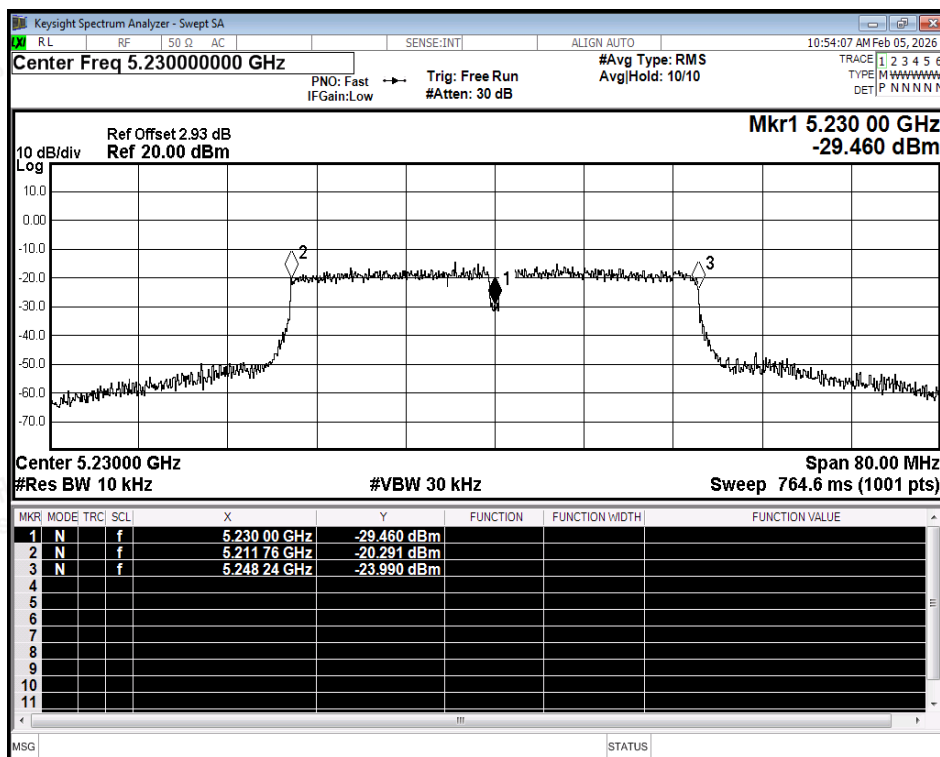

Freq. Stability NVNT ax40 5230MHz Ant1




Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

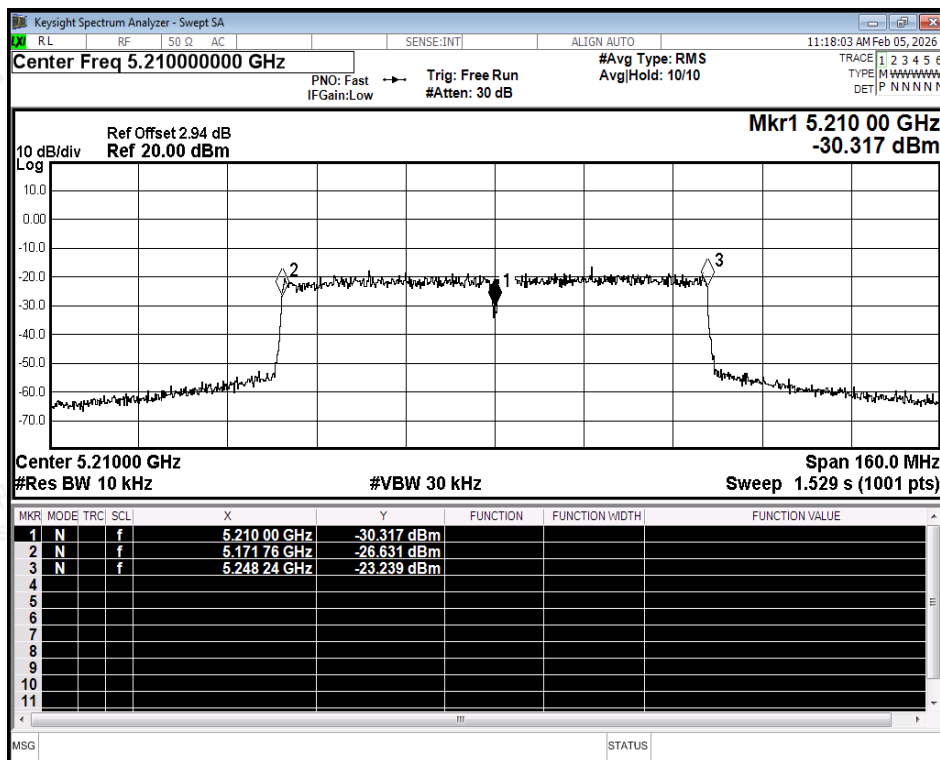

Freq. Stability NVNT ax80 5210MHz Ant1



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China


Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity




Condition	Mode	Frequency (MHz)	Antenna	Measured Frequency (MHz)	Frequency Error (Hz)	Deviation (ppm)	Limit (ppm)	Verdict
NVNT	a	5180	Ant2	5179.98	-20000	-3.86	25	Pass
NVNT	a	5200	Ant2	5200	0	0	25	Pass
NVNT	a	5240	Ant2	5239.98	-20000	-3.82	25	Pass
NVNT	n20	5180	Ant2	5179.98	-20000	-3.86	25	Pass
NVNT	n20	5200	Ant2	5200	0	0	25	Pass
NVNT	n20	5240	Ant2	5239.98	-20000	-3.82	25	Pass
NVNT	n40	5190	Ant2	5190	0	0	25	Pass
NVNT	n40	5230	Ant2	5230	0	0	25	Pass
NVNT	ac20	5180	Ant2	5179.98	-20000	-3.86	25	Pass
NVNT	ac20	5200	Ant2	5199.96	-40000	-7.69	25	Pass
NVNT	ac20	5240	Ant2	5239.98	-20000	-3.82	25	Pass
NVNT	ac40	5190	Ant2	5190	0	0	25	Pass
NVNT	ac40	5230	Ant2	5230	0	0	25	Pass
NVNT	ac80	5210	Ant2	5210	0	0	25	Pass
NVNT	ax20	5180	Ant2	5179.98	-20000	-3.86	25	Pass
NVNT	ax20	5200	Ant2	5199.98	-20000	-3.85	25	Pass
NVNT	ax20	5240	Ant2	5239.98	-20000	-3.82	25	Pass
NVNT	ax40	5190	Ant2	5190	0	0	25	Pass
NVNT	ax40	5230	Ant2	5230	0	0	25	Pass
NVNT	ax80	5210	Ant2	5210	0	0	25	Pass



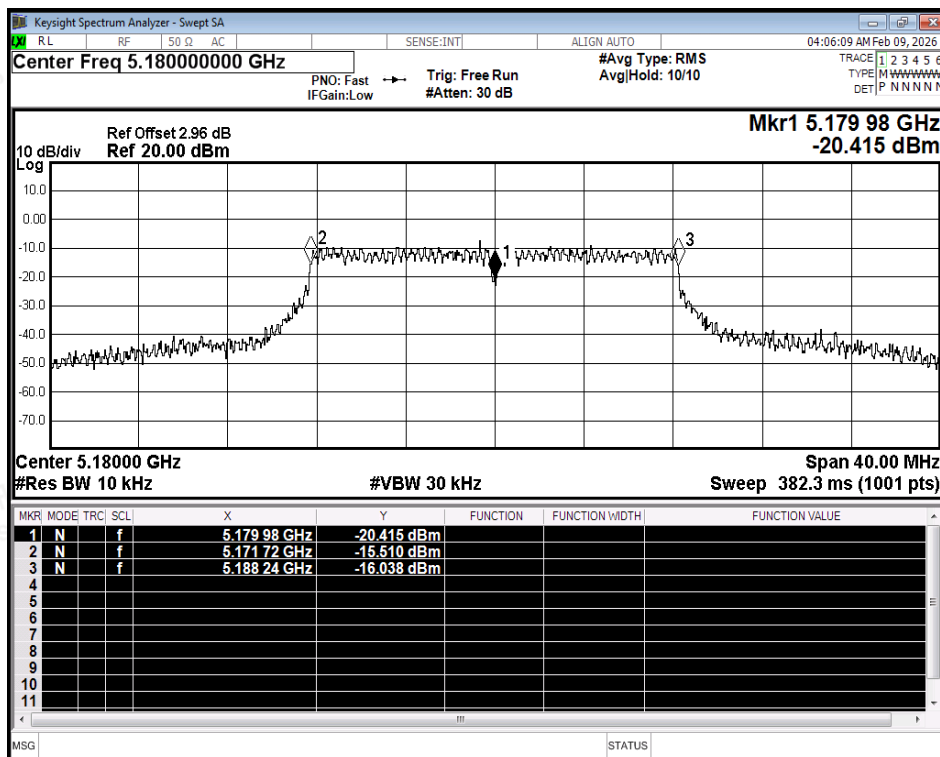

Freq. Stability NVNT a 5180MHz Ant2

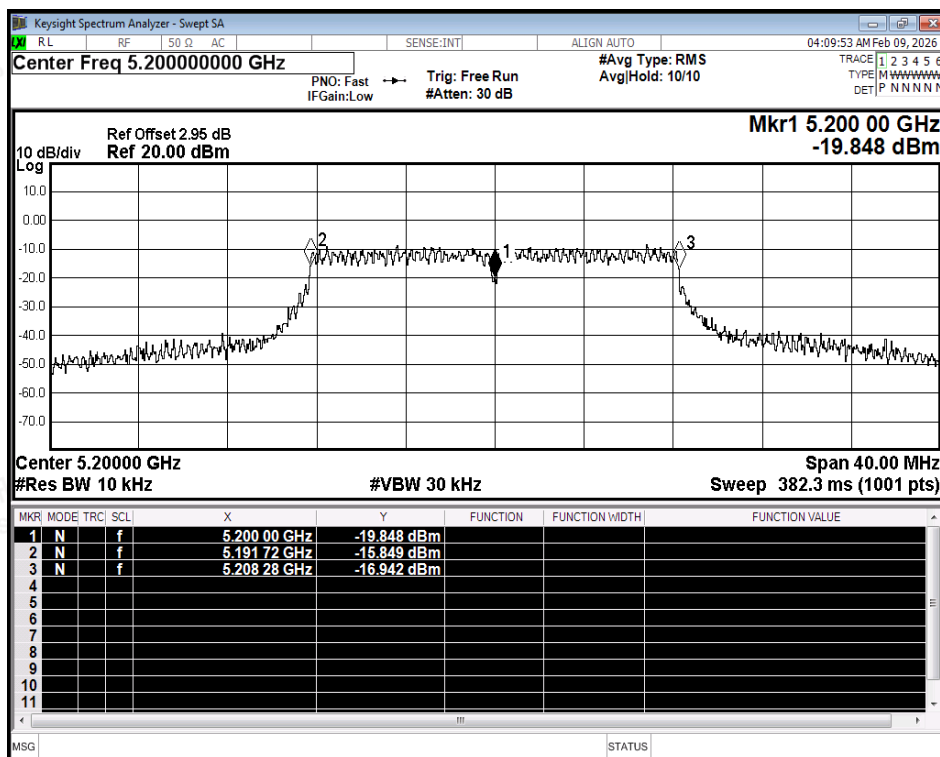

Freq. Stability NVNT a 5200MHz Ant2




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

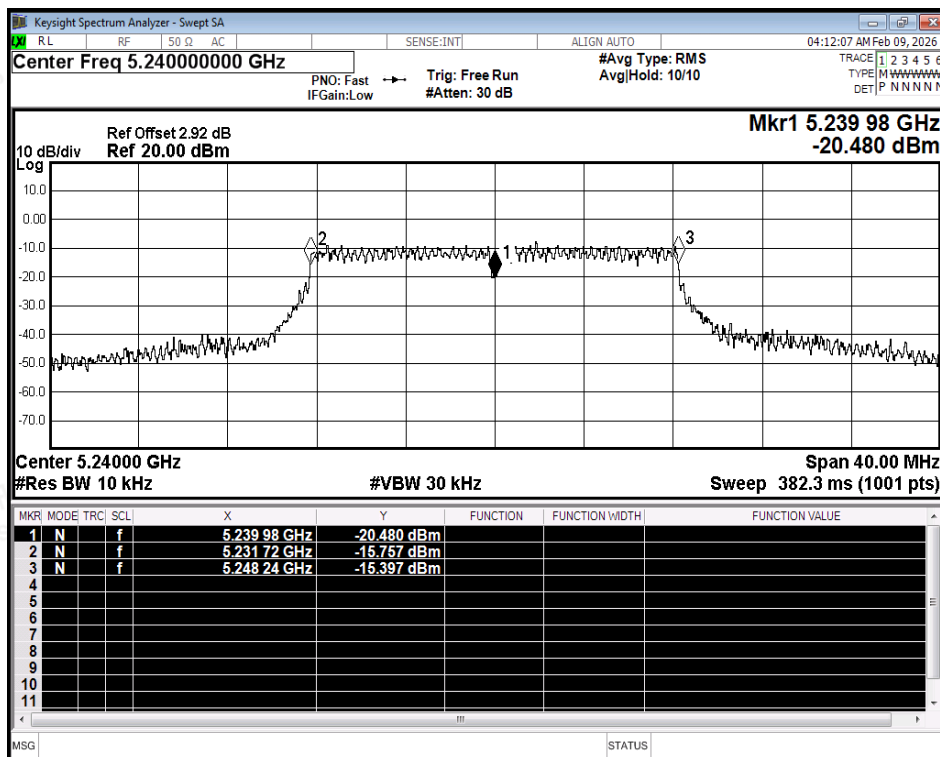

Freq. Stability NVNT a 5240MHz Ant2

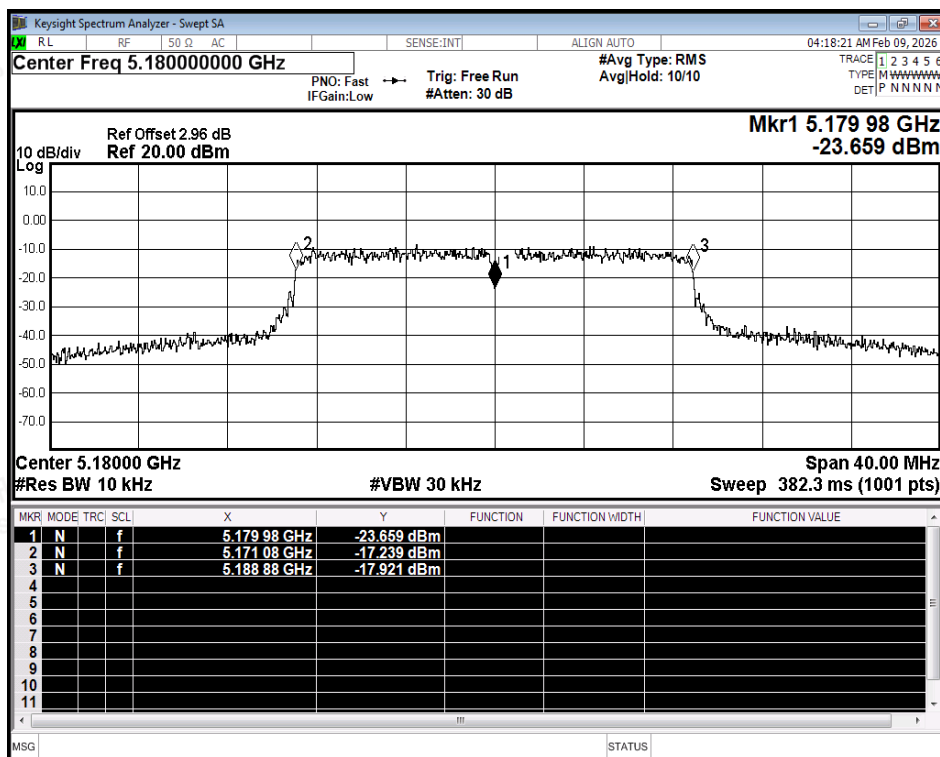

Freq. Stability NVNT n20 5180MHz Ant2




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

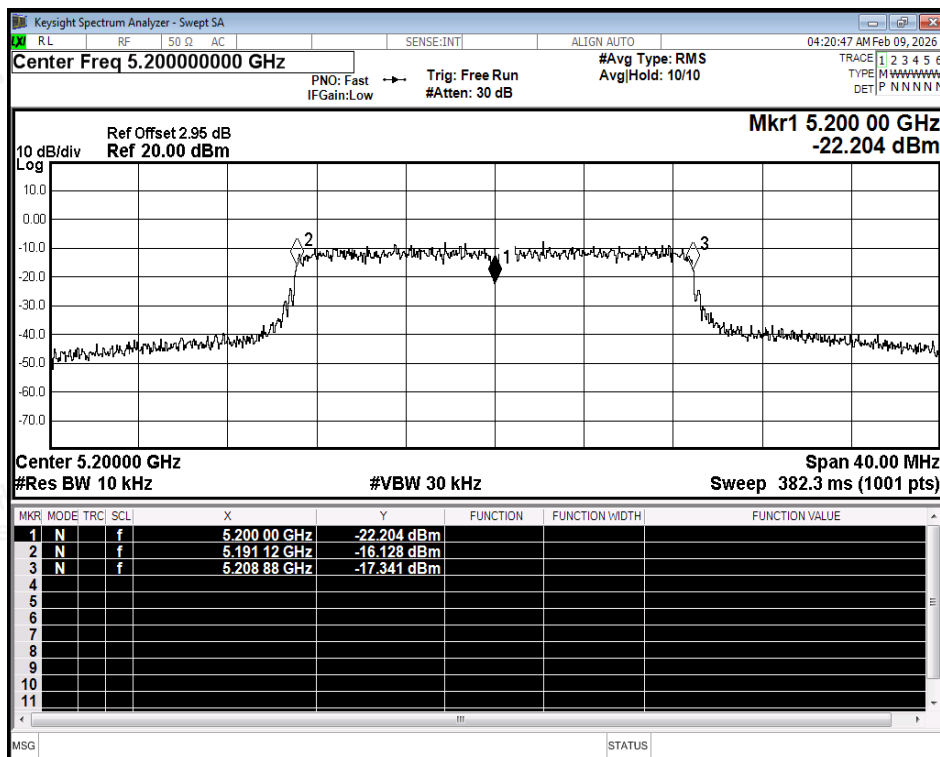

Freq. Stability NVNT n20 5200MHz Ant2

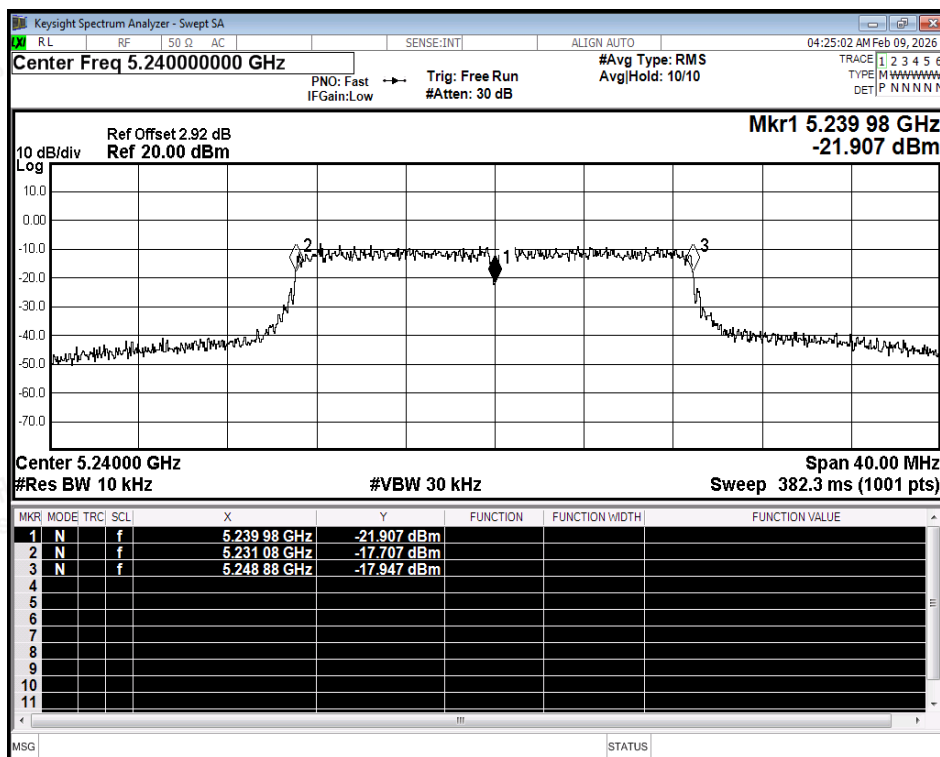

Freq. Stability NVNT n20 5240MHz Ant2




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

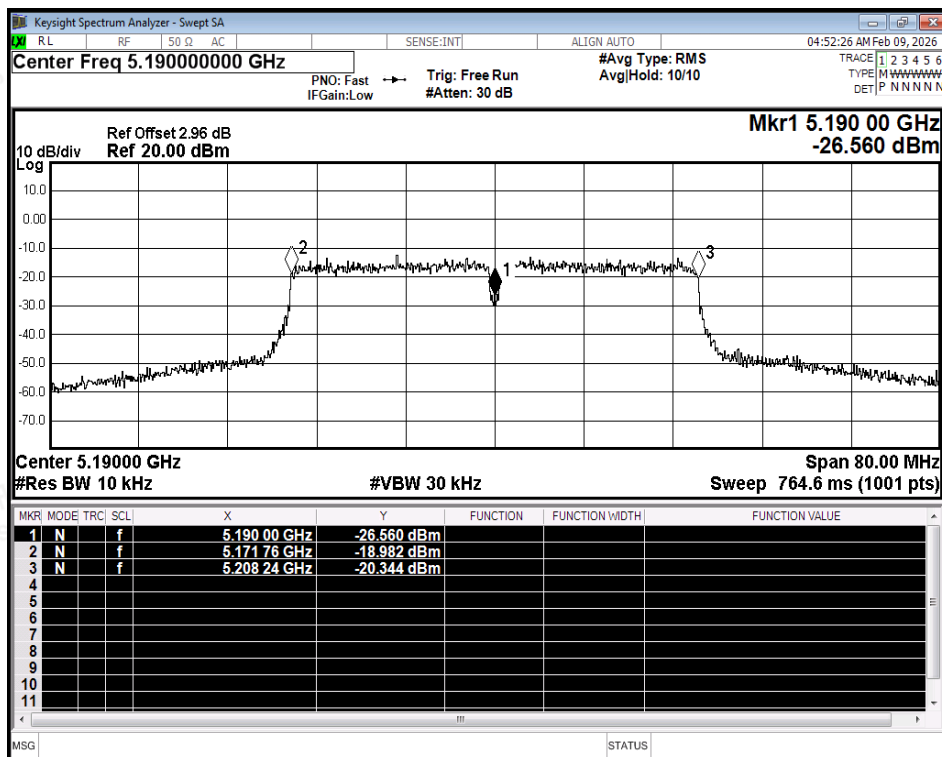

Freq. Stability NVNT n40 5190MHz Ant2

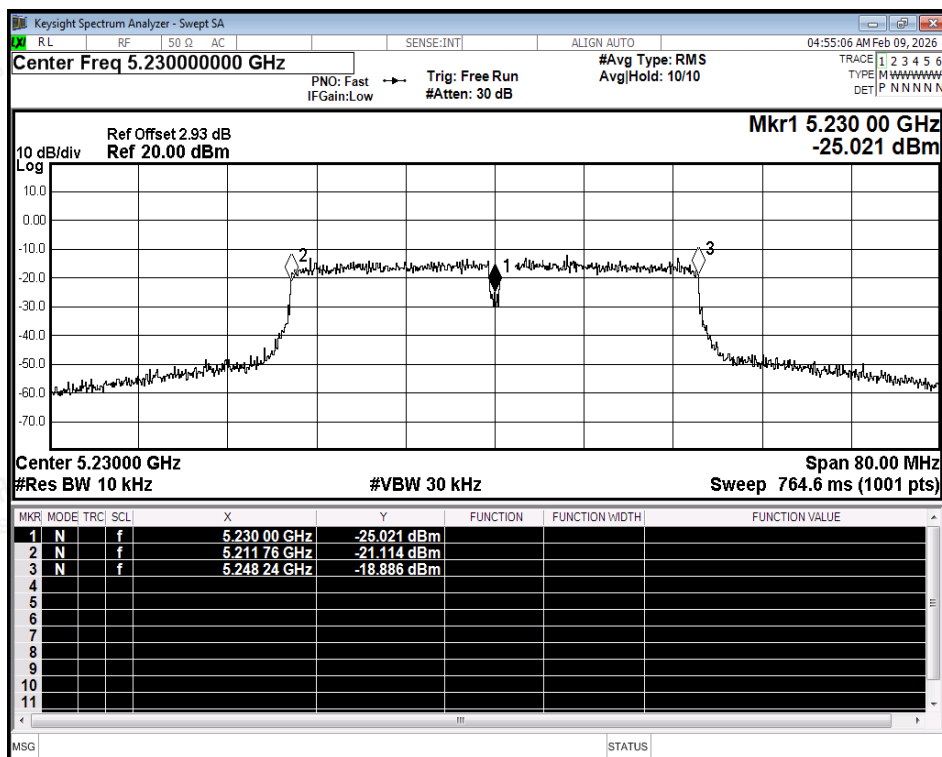

Freq. Stability NVNT n40 5230MHz Ant2




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

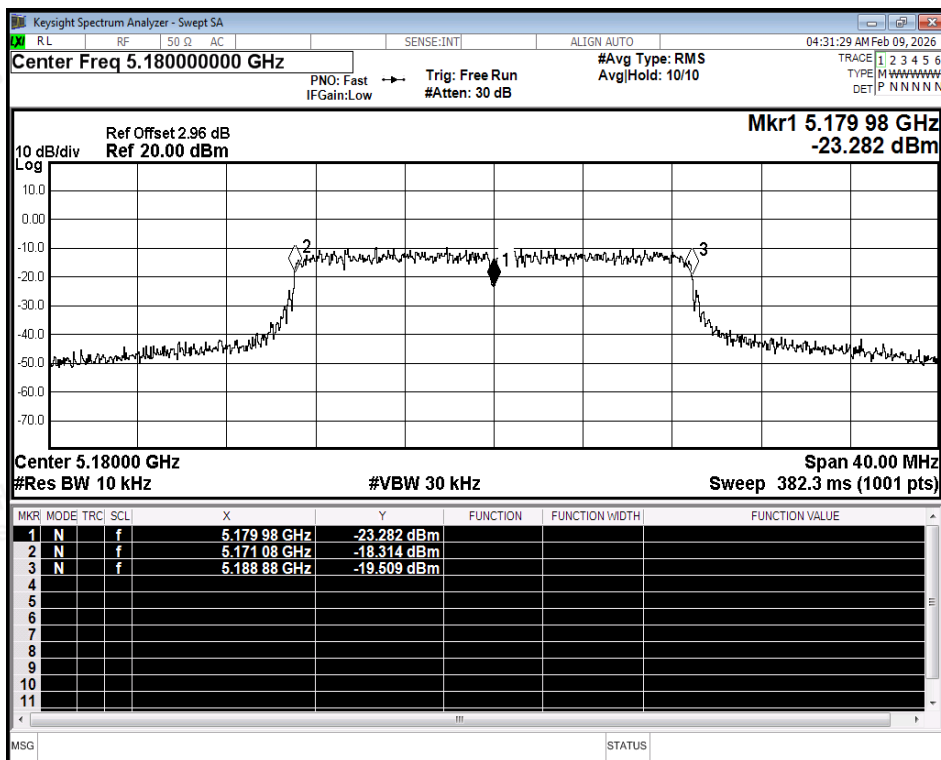

Freq. Stability NVNT ac20 5180MHz Ant2

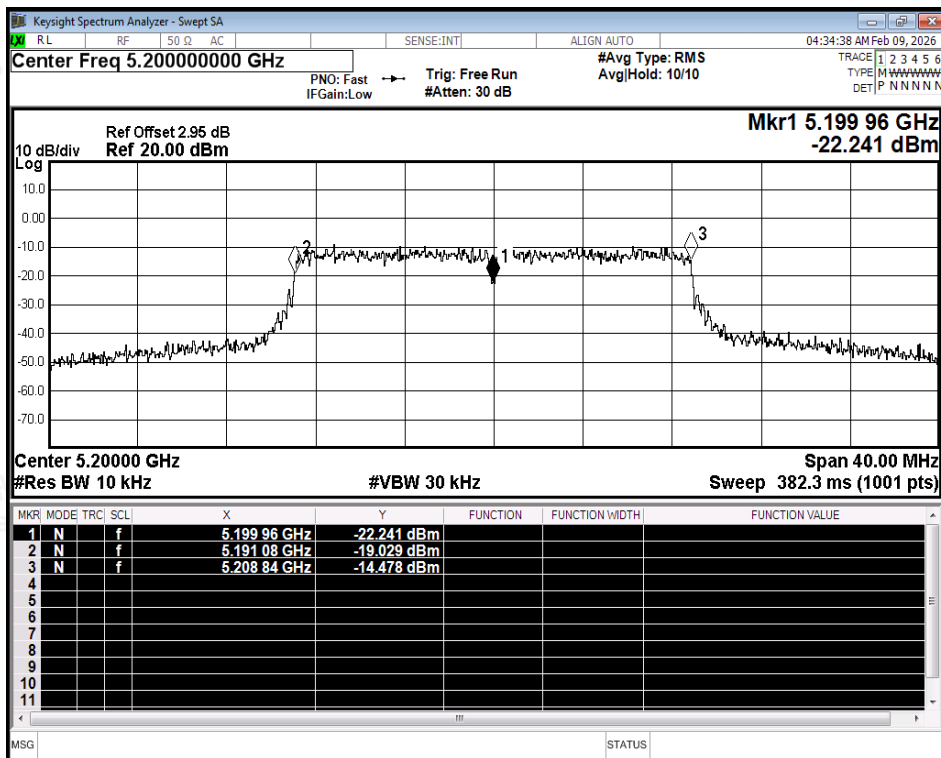

Freq. Stability NVNT ac20 5200MHz Ant2




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

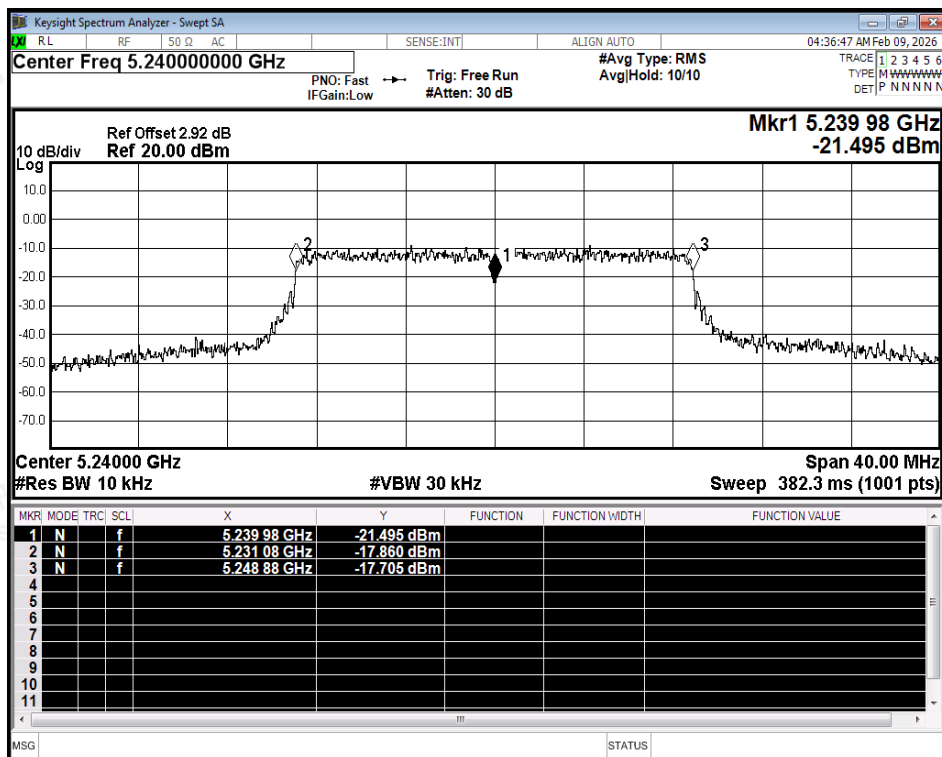

Freq. Stability NVNT ac20 5240MHz Ant2

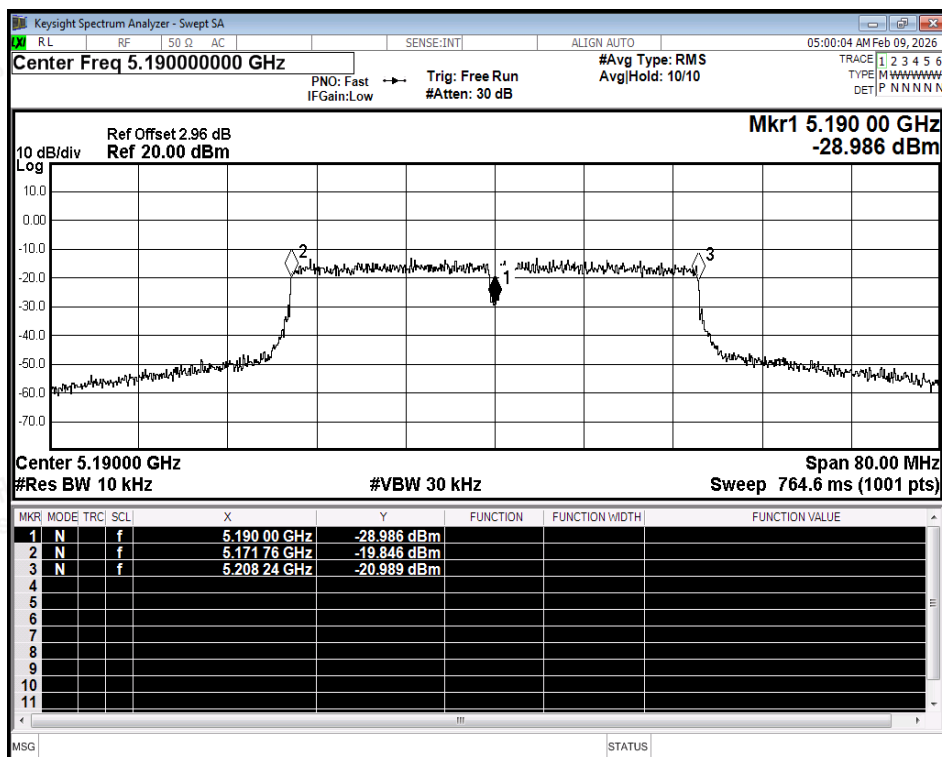

Freq. Stability NVNT ac40 5190MHz Ant2




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

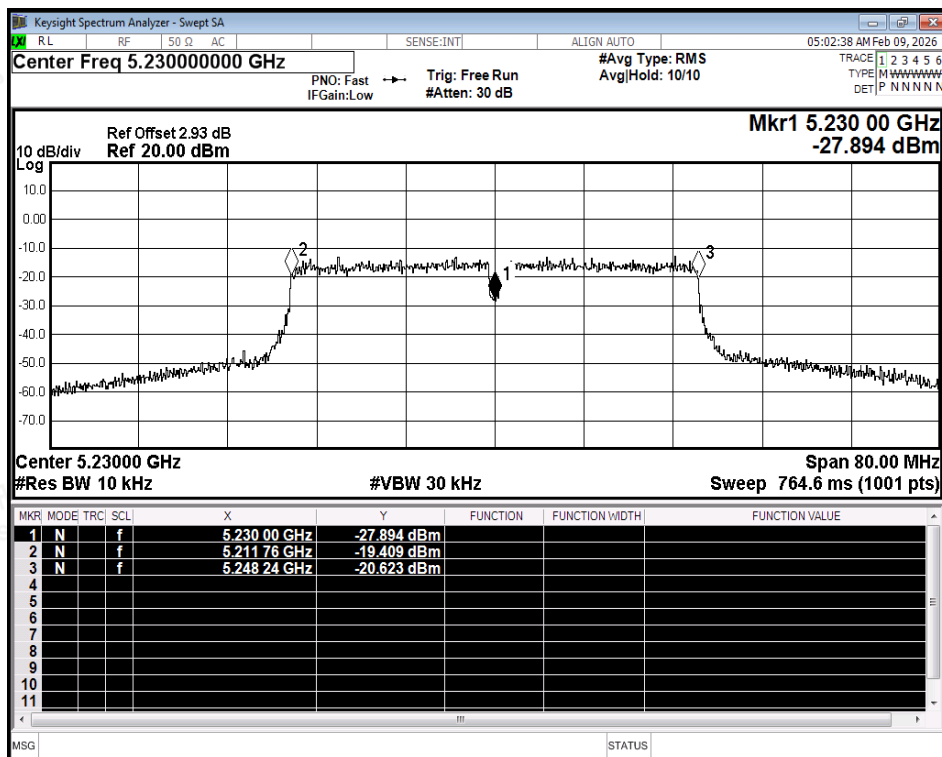

Freq. Stability NVNT ac40 5230MHz Ant2

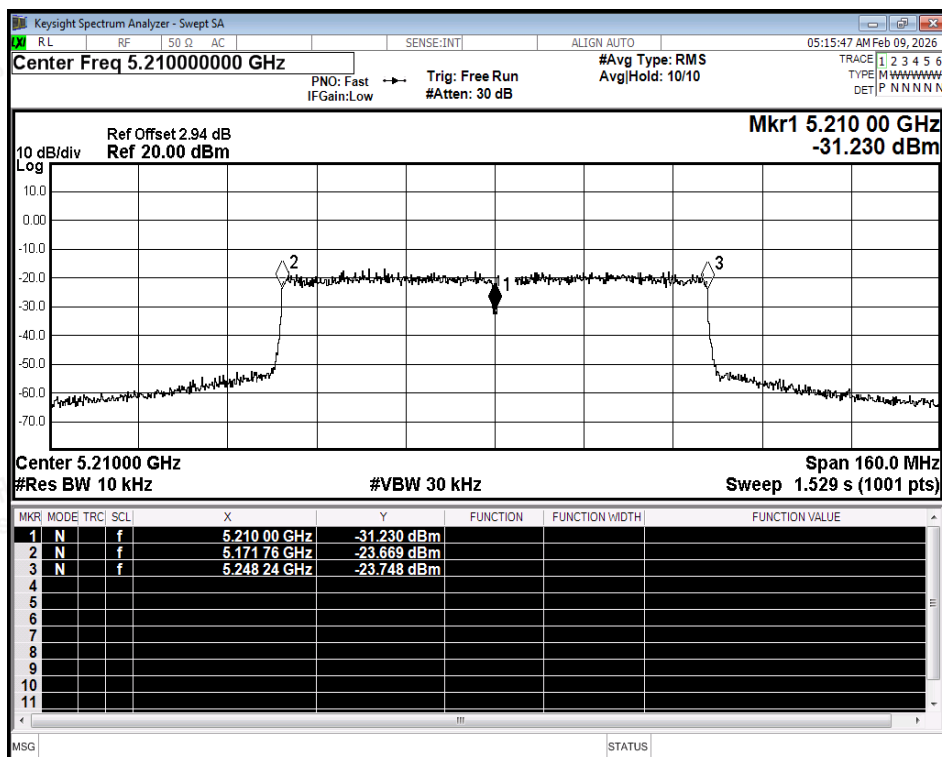

Freq. Stability NVNT ac80 5210MHz Ant2




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

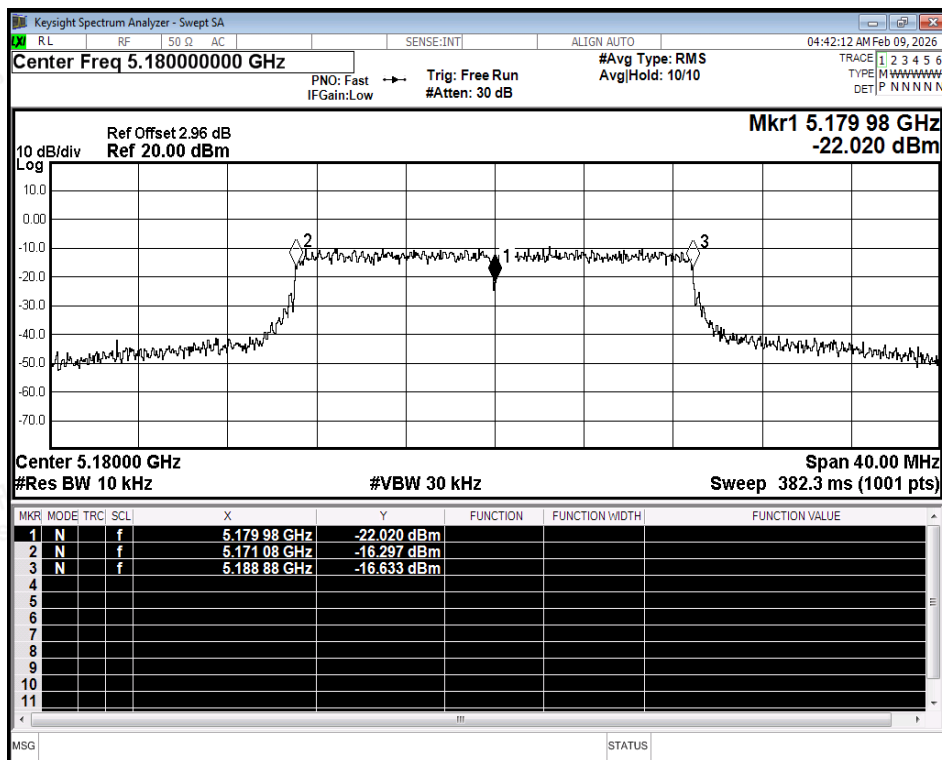

Freq. Stability NVNT ax20 5180MHz Ant2

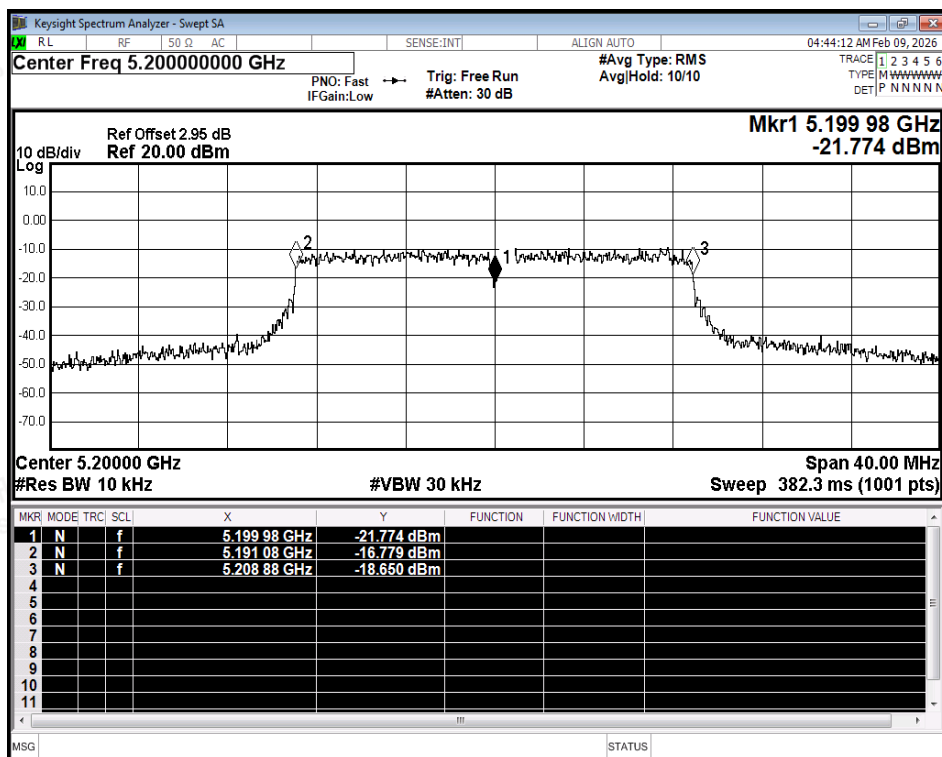

Freq. Stability NVNT ax20 5200MHz Ant2




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

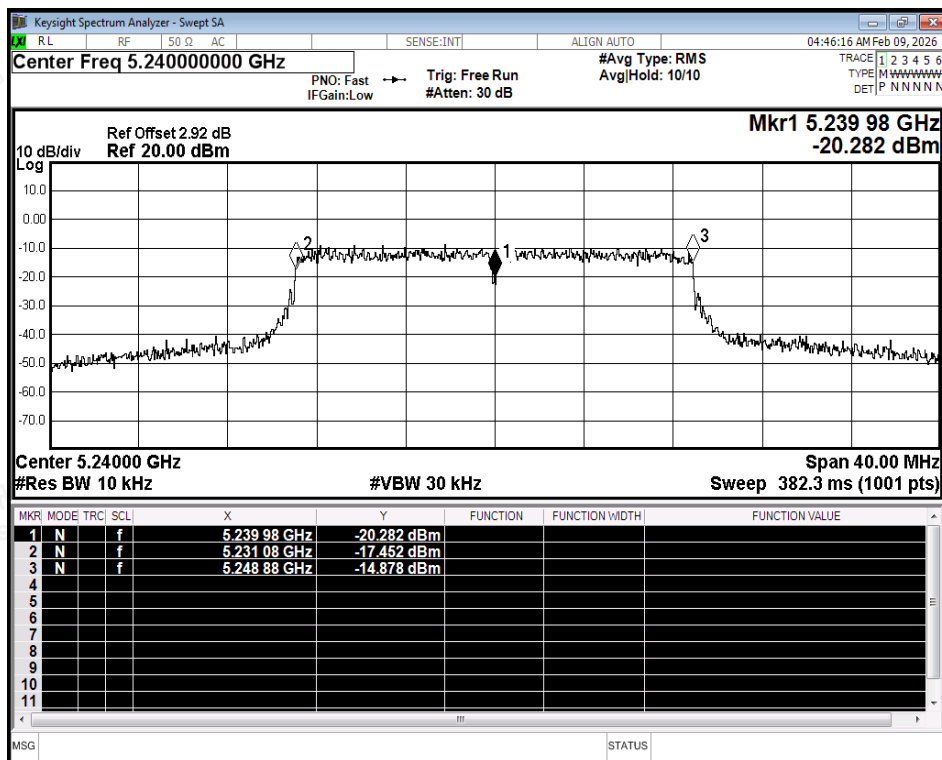

Freq. Stability NVNT ax20 5240MHz Ant2

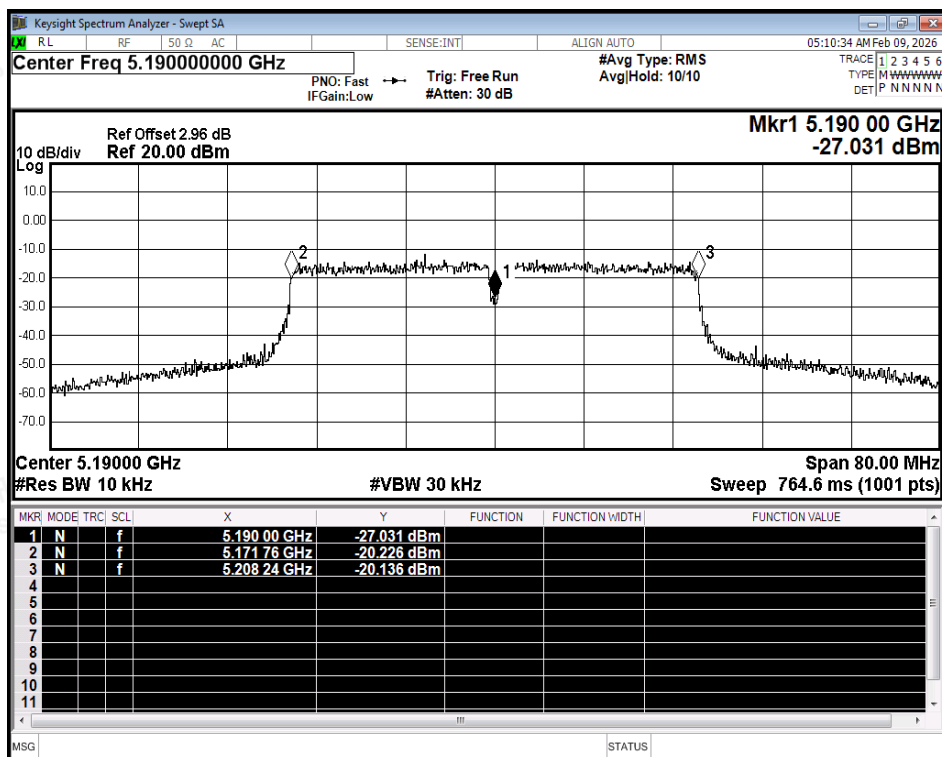

Freq. Stability NVNT ax40 5190MHz Ant2




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

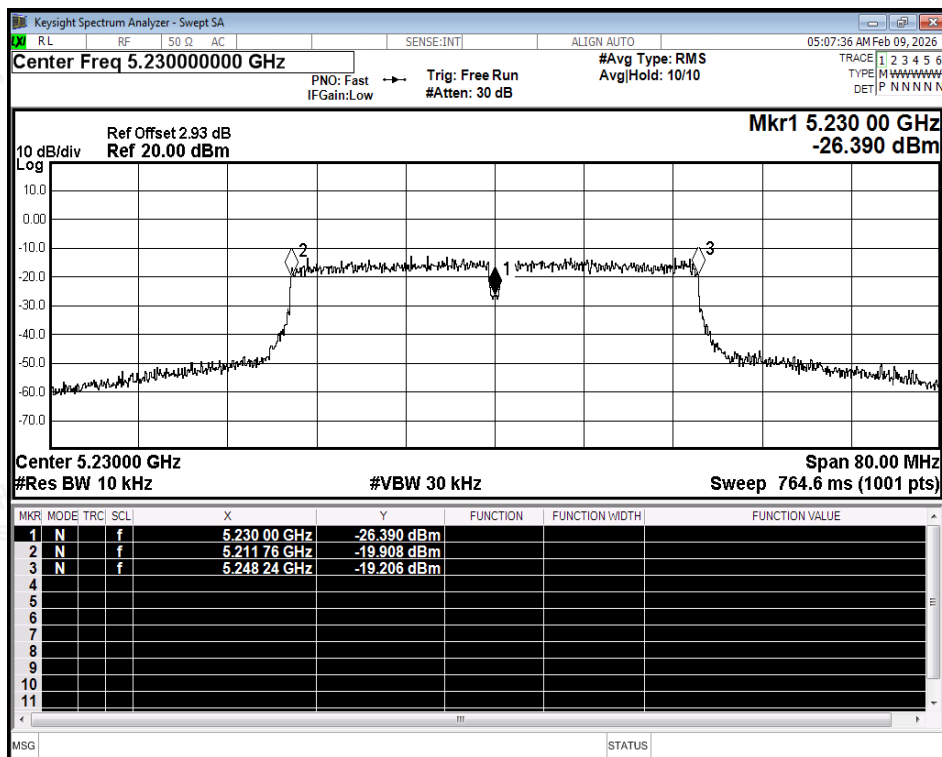

Freq. Stability NVNT ax40 5230MHz Ant2

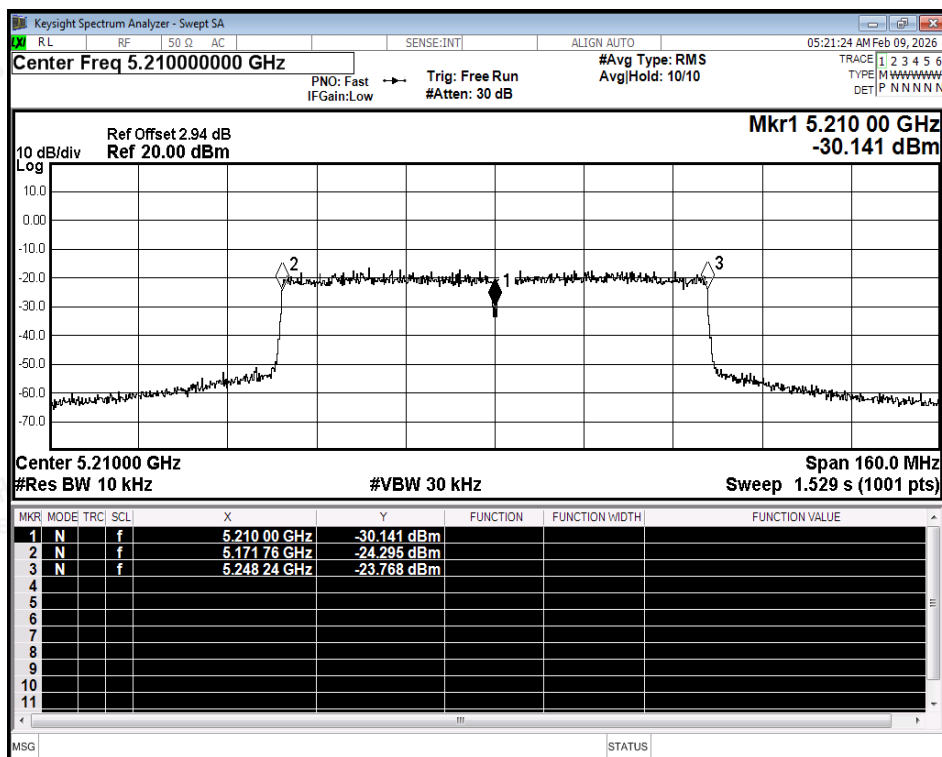

Freq. Stability NVNT ax80 5210MHz Ant2



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



A.6 Duty Cycle

Condition	Mode	Frequency (MHz)	Antenna	Duty Cycle (%)	Correction Factor (dB)	1/T (kHz)
NVNT	a	5180	Ant1	94.78	0.23	0.92
NVNT	a	5200	Ant1	94.83	0.23	0.91
NVNT	a	5240	Ant1	93.97	0.27	0.92
NVNT	n20	5180	Ant1	94	0.27	1.06
NVNT	n20	5200	Ant1	93	0.32	1.08
NVNT	n20	5240	Ant1	93	0.32	1.08
NVNT	n40	5190	Ant1	88.68	0.52	2.13
NVNT	n40	5230	Ant1	88.68	0.52	2.13
NVNT	ac20	5180	Ant1	94	0.27	1.06
NVNT	ac20	5200	Ant1	94	0.27	1.06
NVNT	ac20	5240	Ant1	94	0.27	1.06
NVNT	ac40	5190	Ant1	87.04	0.6	2.13
NVNT	ac40	5230	Ant1	88.89	0.51	2.08
NVNT	ac80	5210	Ant1	80.65	0.93	4
NVNT	ax20	5180	Ant1	94	0.27	1.06
NVNT	ax20	5200	Ant1	94	0.27	1.06
NVNT	ax20	5240	Ant1	93.07	0.31	1.06
NVNT	ax40	5190	Ant1	88.68	0.52	2.13
NVNT	ax40	5230	Ant1	87.04	0.6	2.13
NVNT	ax80	5210	Ant1	80	0.97	4.17




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

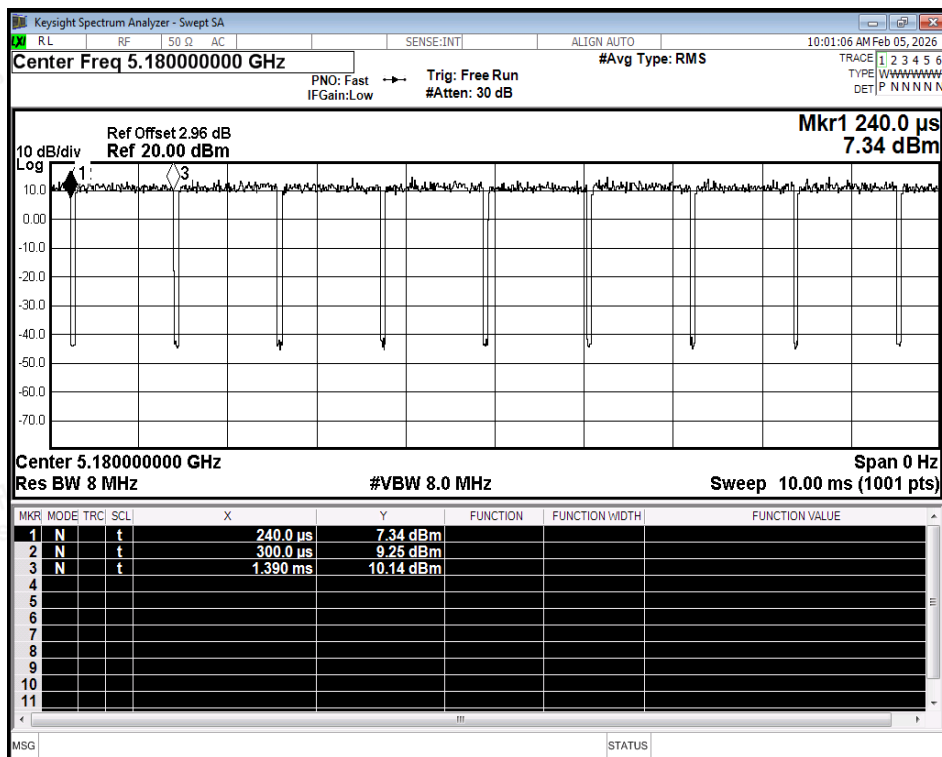

Duty Cycle NVNT a 5180MHz Ant1

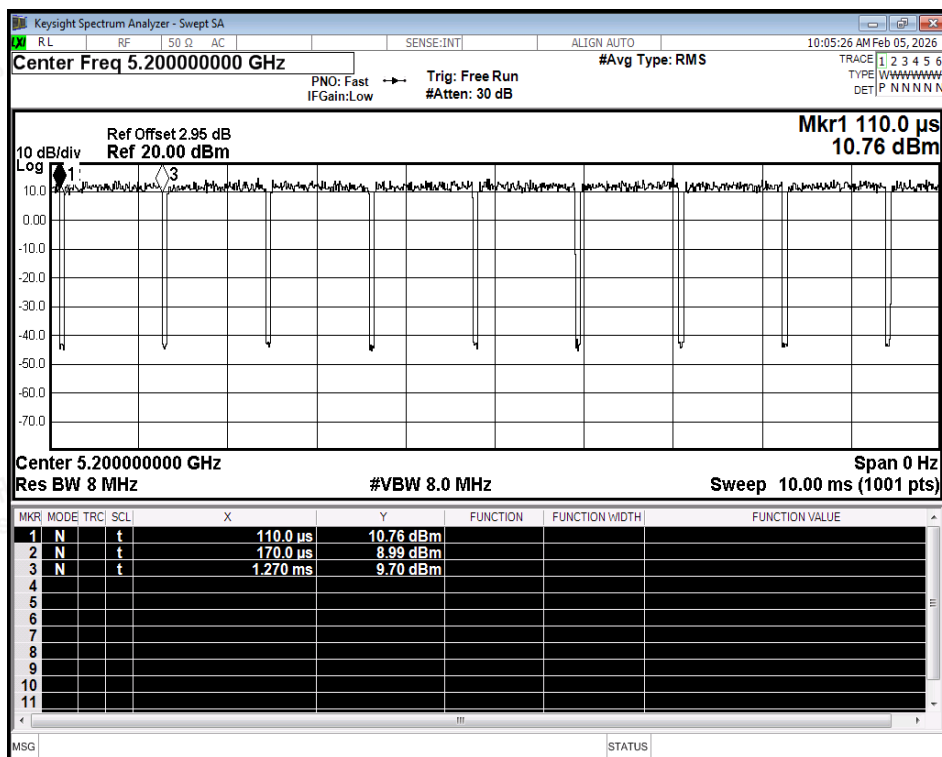

Duty Cycle NVNT a 5200MHz Ant1




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

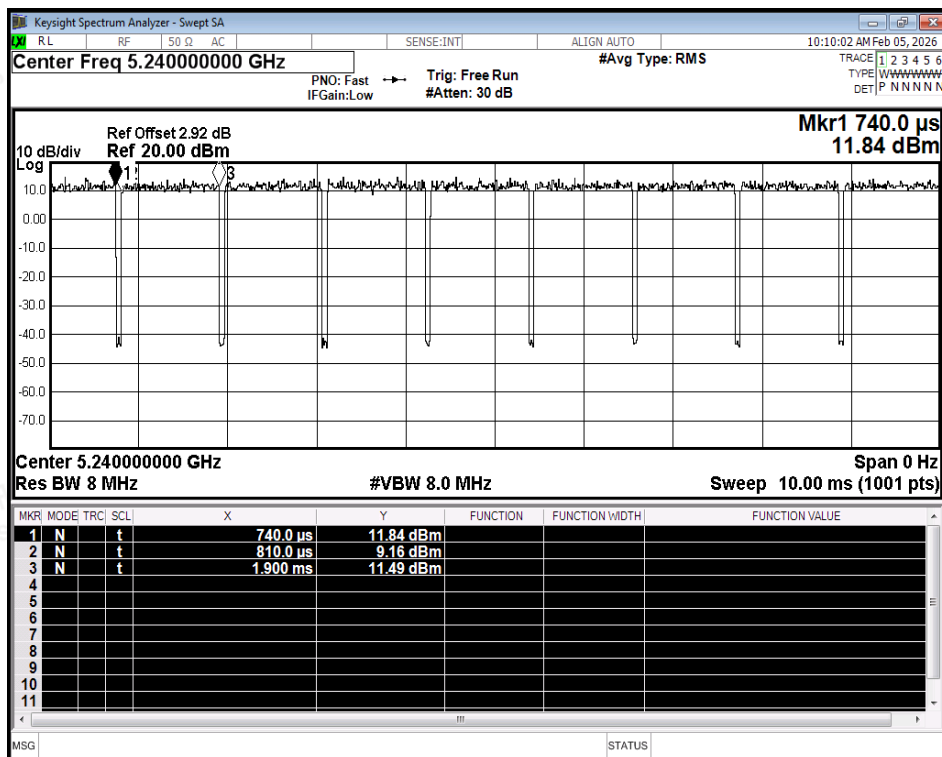

Duty Cycle NVNT a 5240MHz Ant1

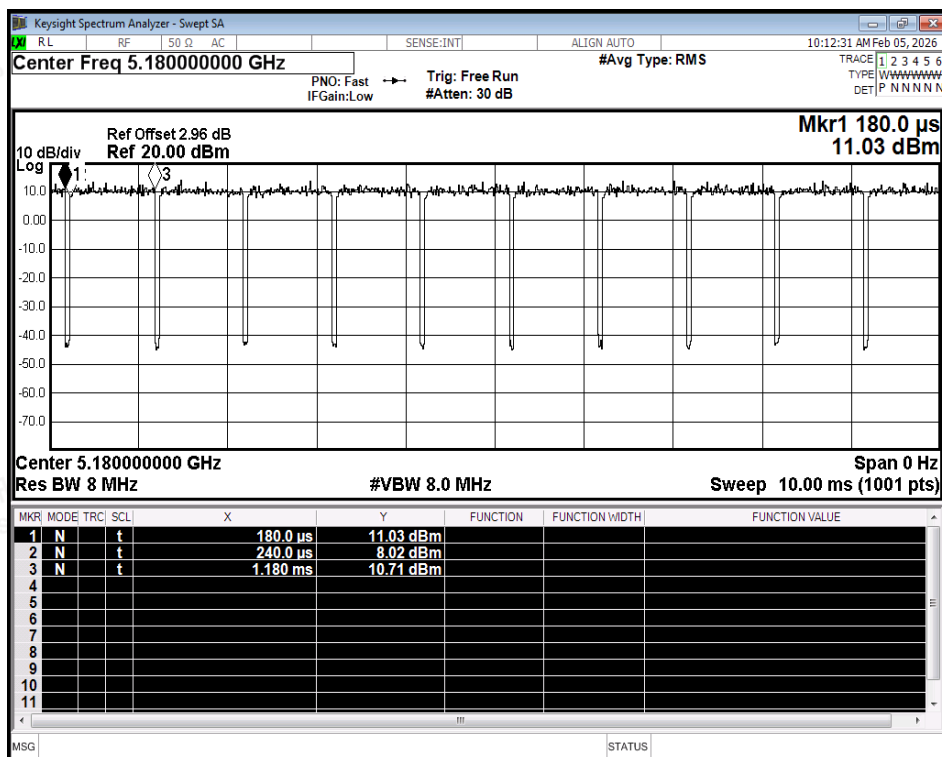

Duty Cycle NVNT n20 5180MHz Ant1




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

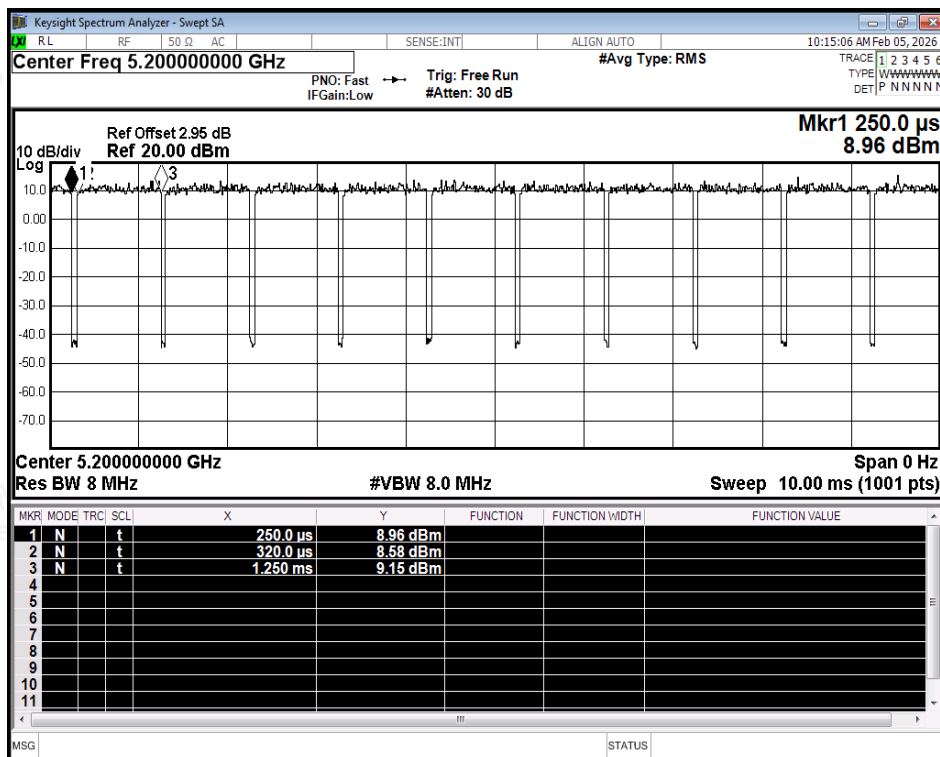

Duty Cycle NVNT n20 5200MHz Ant1

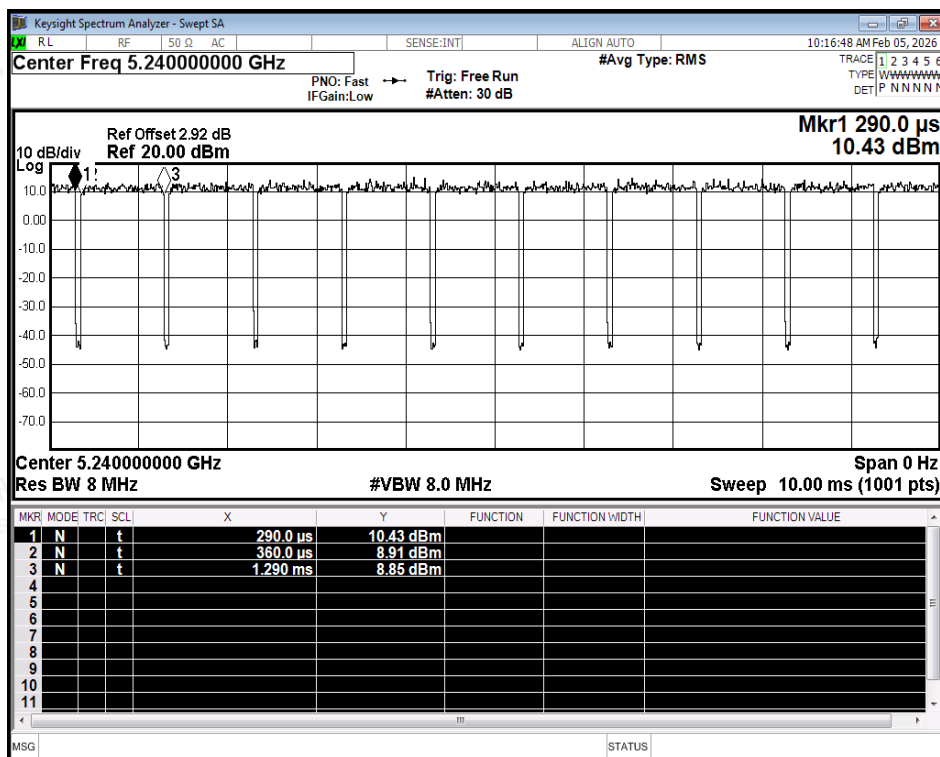

Duty Cycle NVNT n20 5240MHz Ant1




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

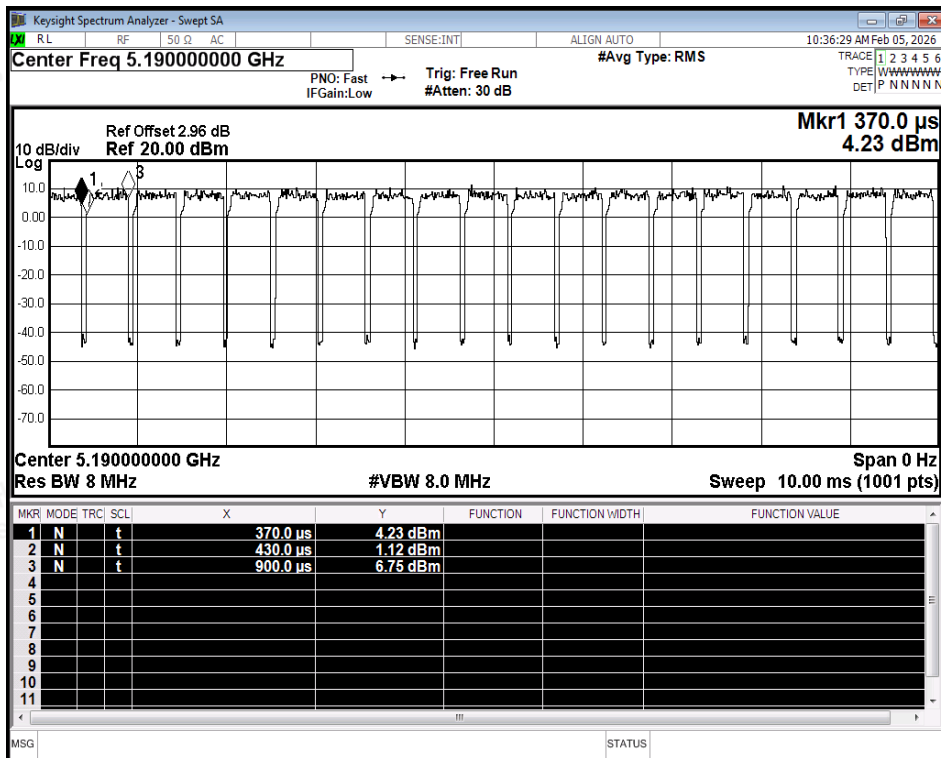

Duty Cycle NVNT n40 5190MHz Ant1

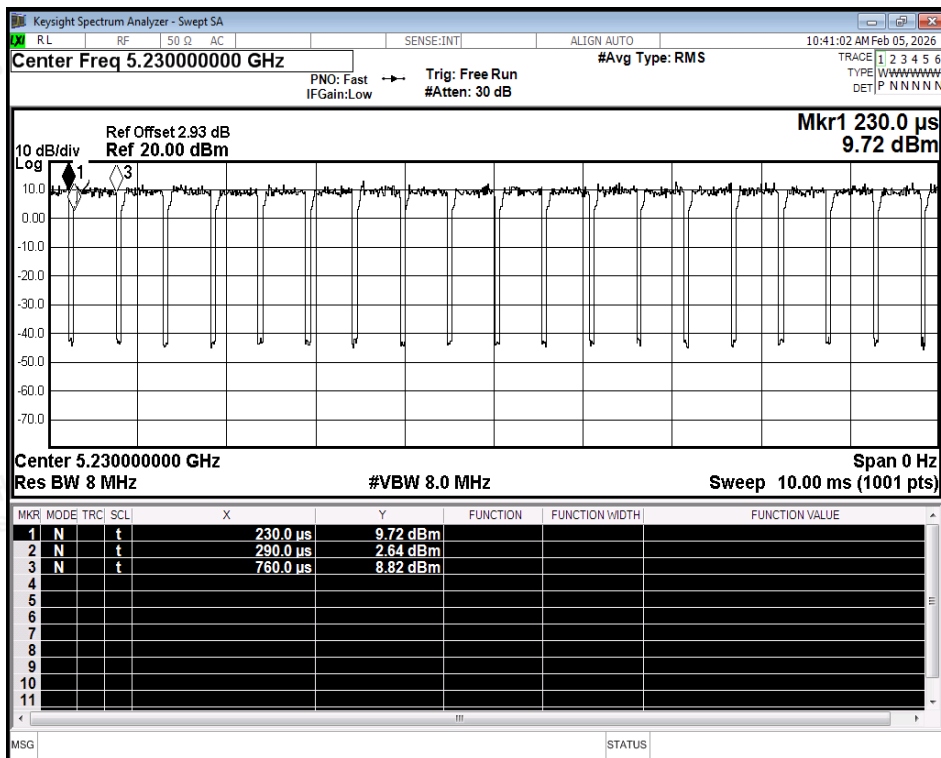

Duty Cycle NVNT n40 5230MHz Ant1




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

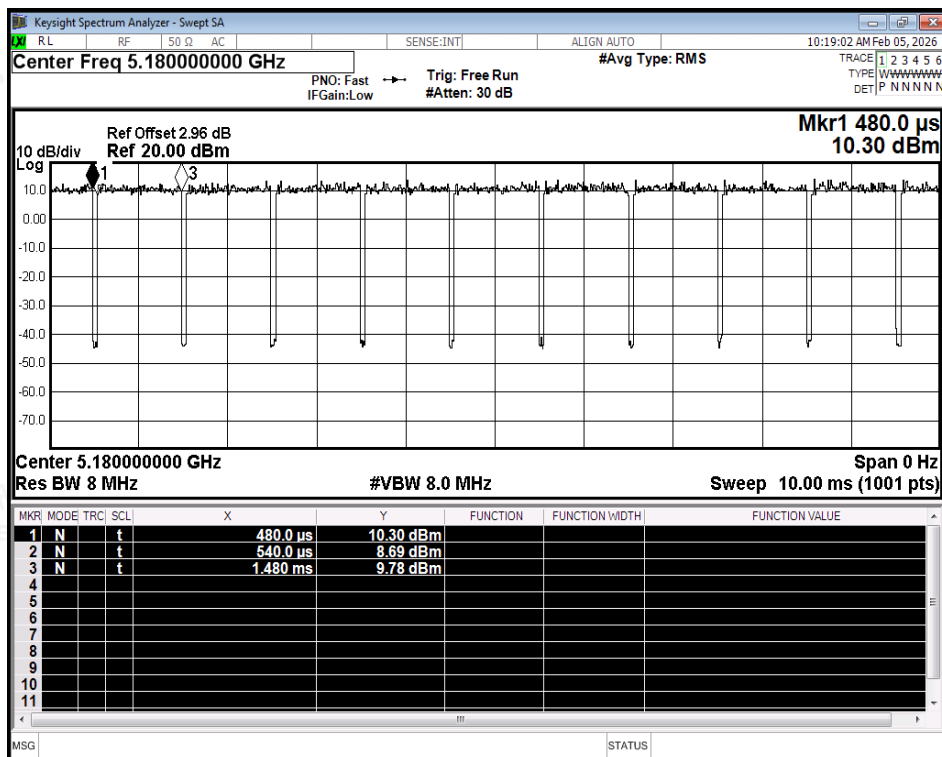

Duty Cycle NVNT ac20 5180MHz Ant1

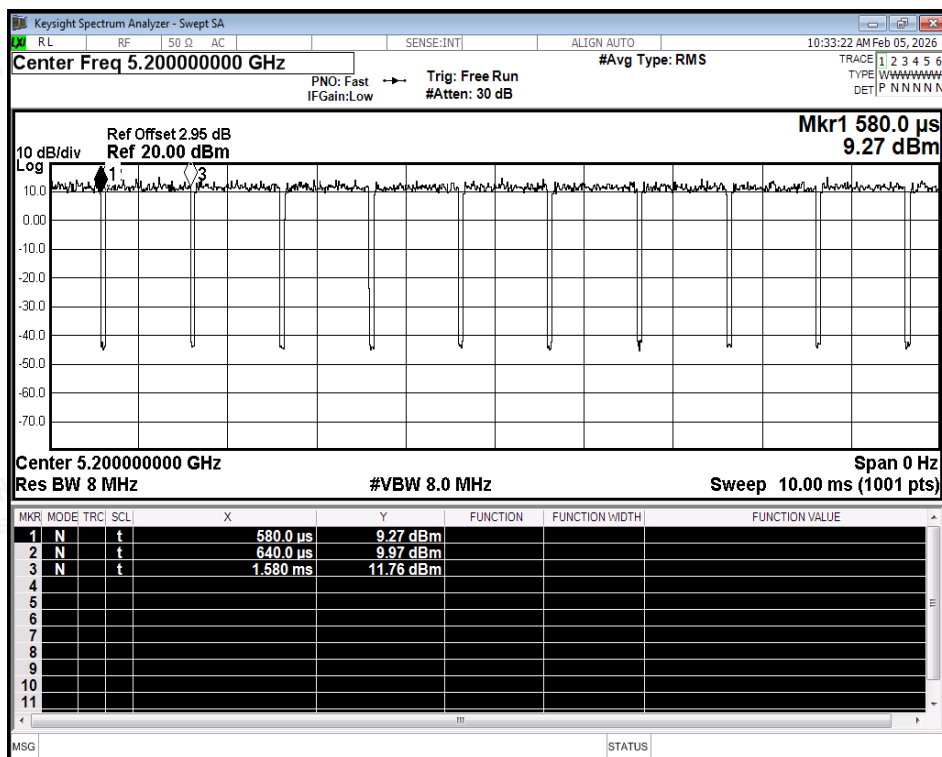

Duty Cycle NVNT ac20 5200MHz Ant1




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

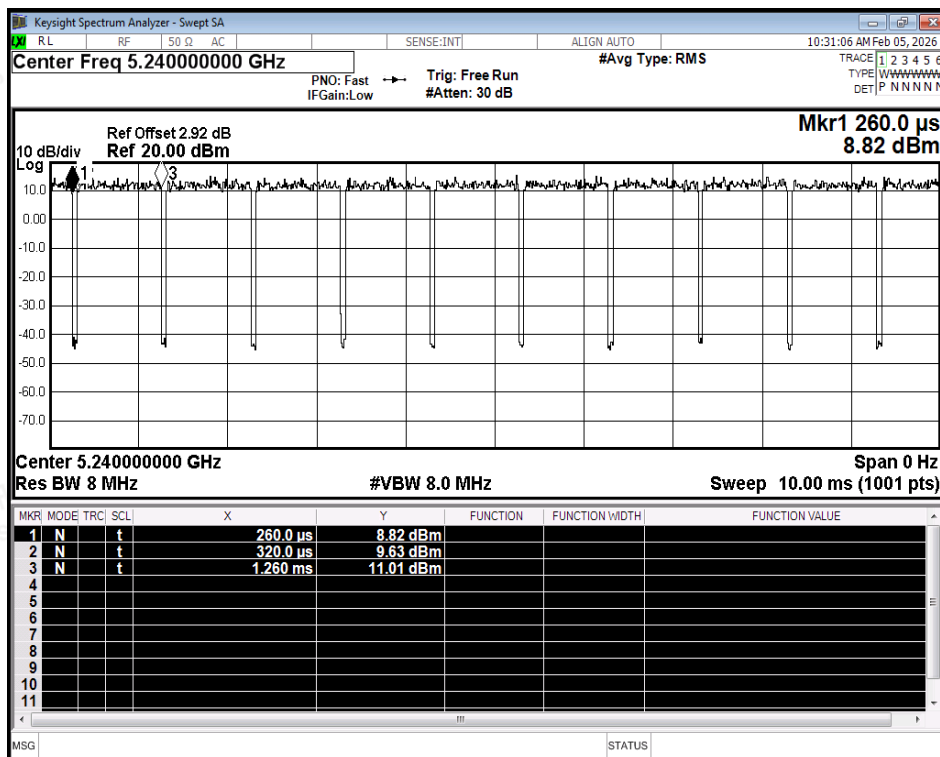

Duty Cycle NVNT ac20 5240MHz Ant1

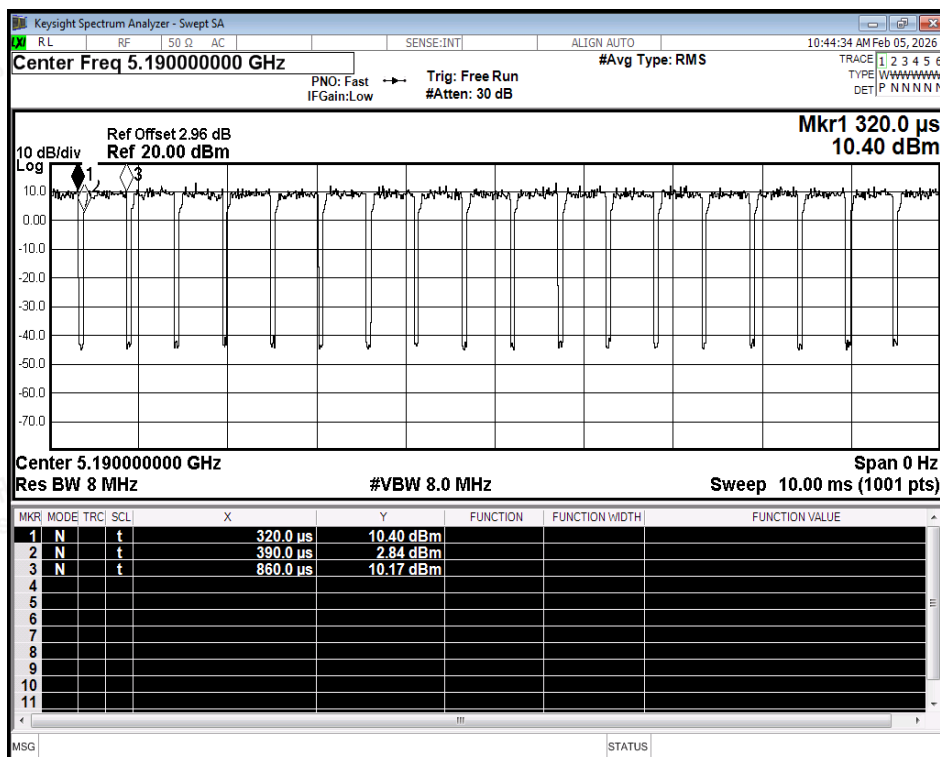

Duty Cycle NVNT ac40 5190MHz Ant1




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

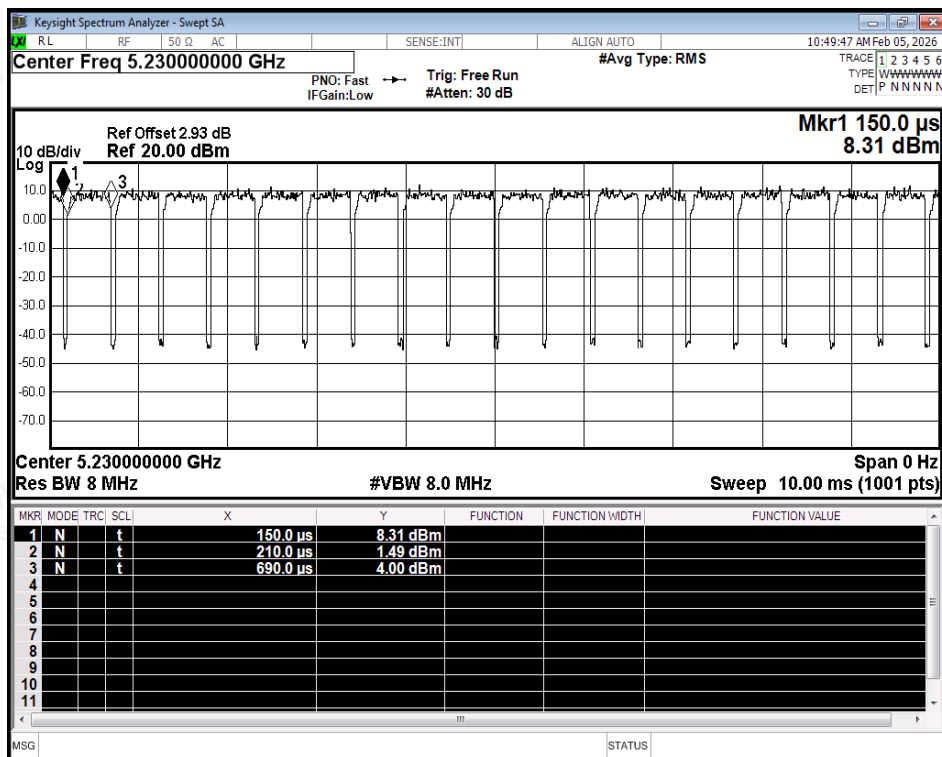


Duty Cycle NVNT ac40 5230MHz Ant1

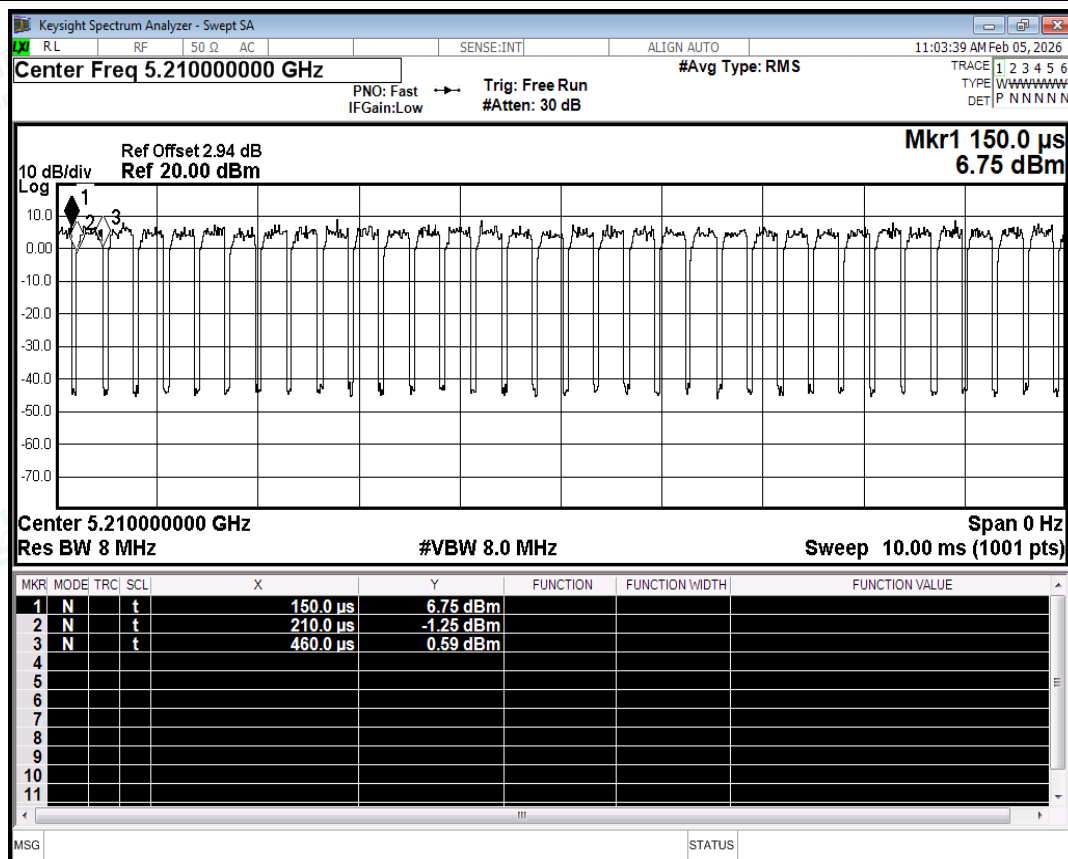




Duty Cycle NVNT ac80 5210MHz Ant1

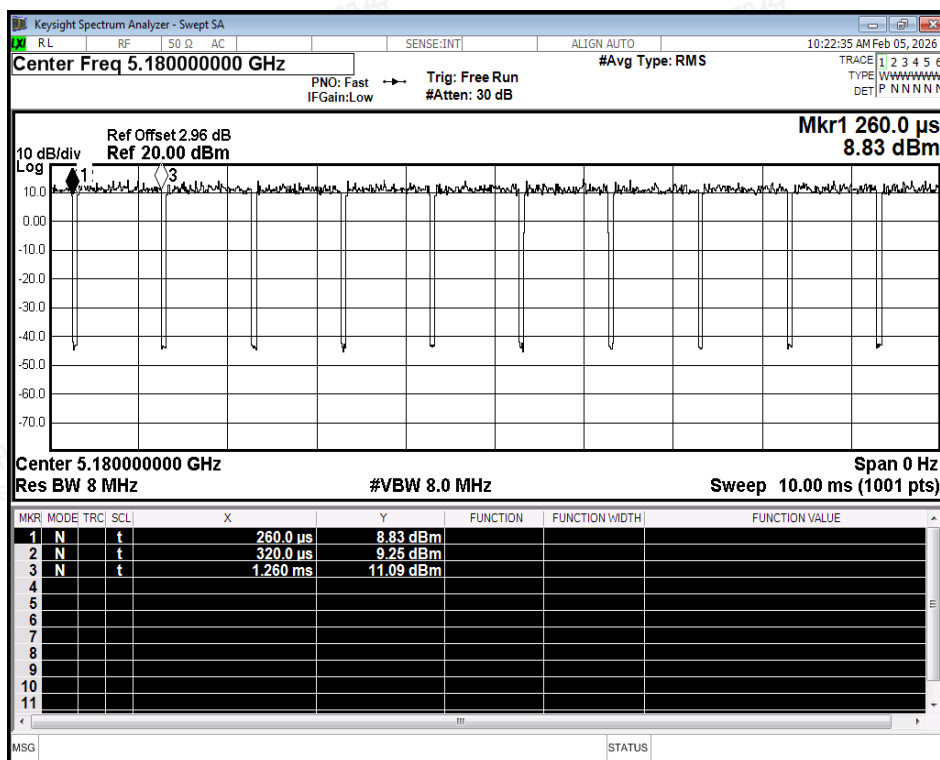

Duty Cycle NVNT ax20 5180MHz Ant1

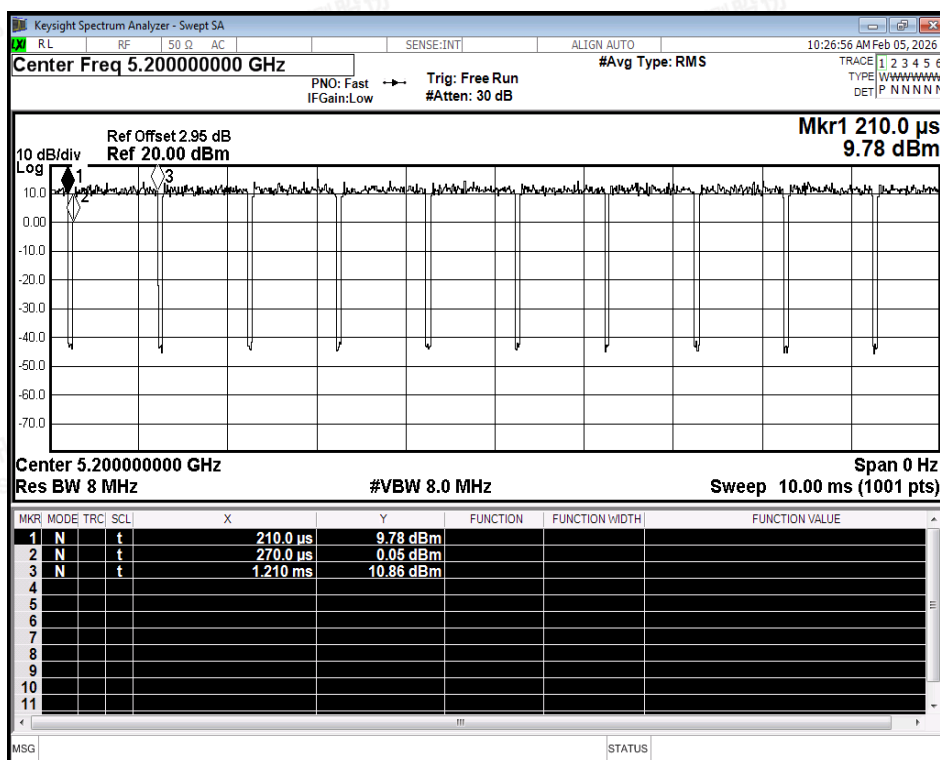

Duty Cycle NVNT ax20 5200MHz Ant1




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

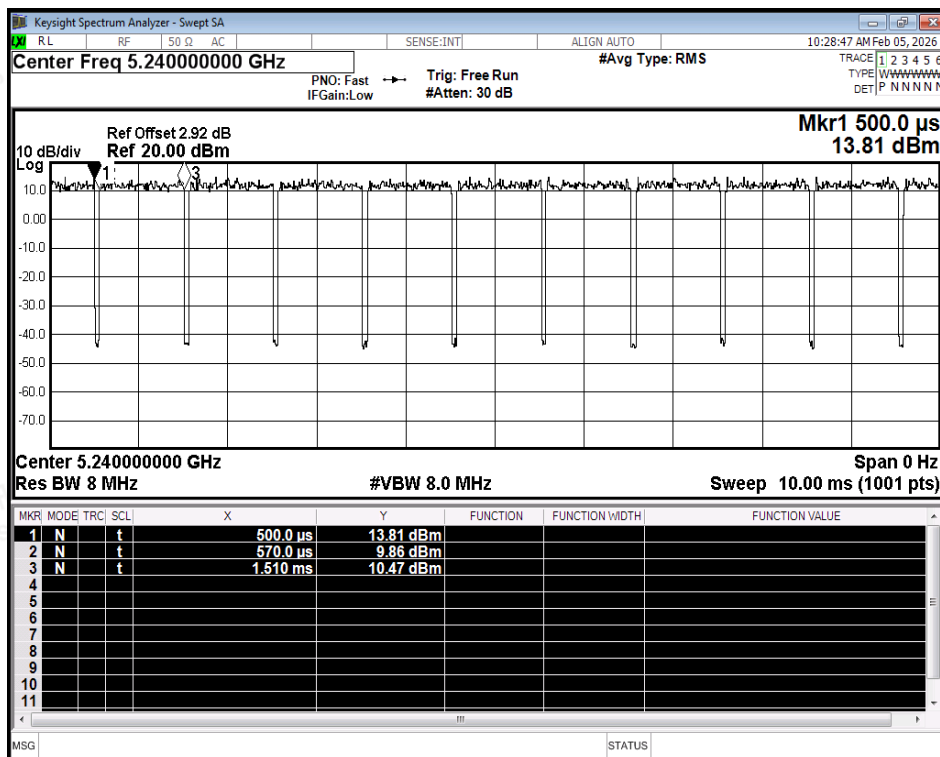

Duty Cycle NVNT ax20 5240MHz Ant1

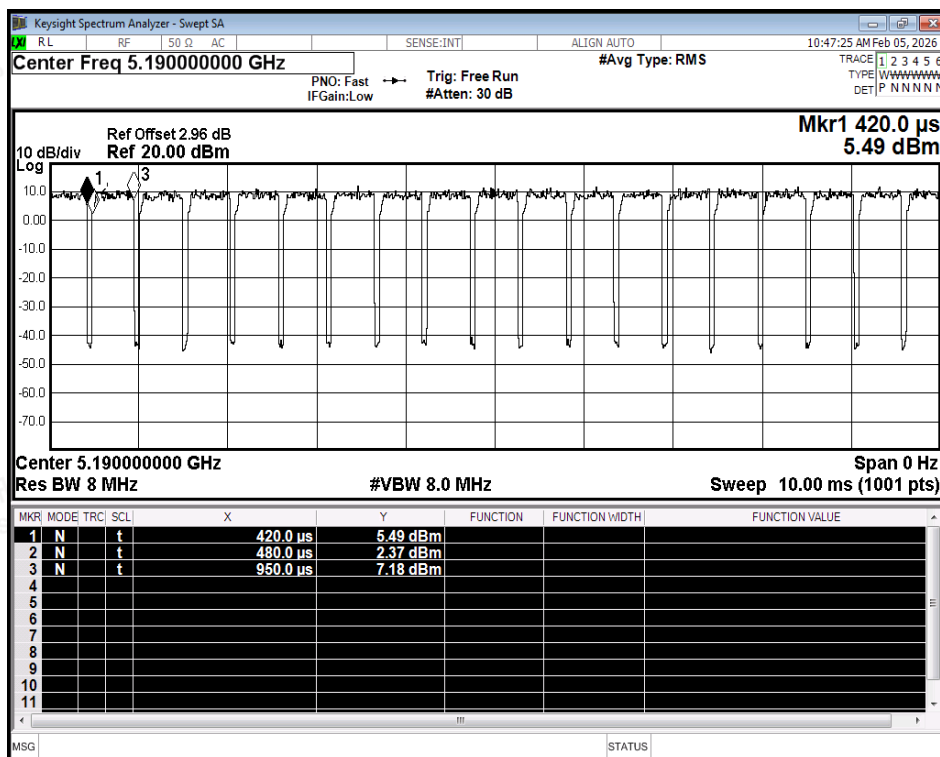

Duty Cycle NVNT ax40 5190MHz Ant1




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

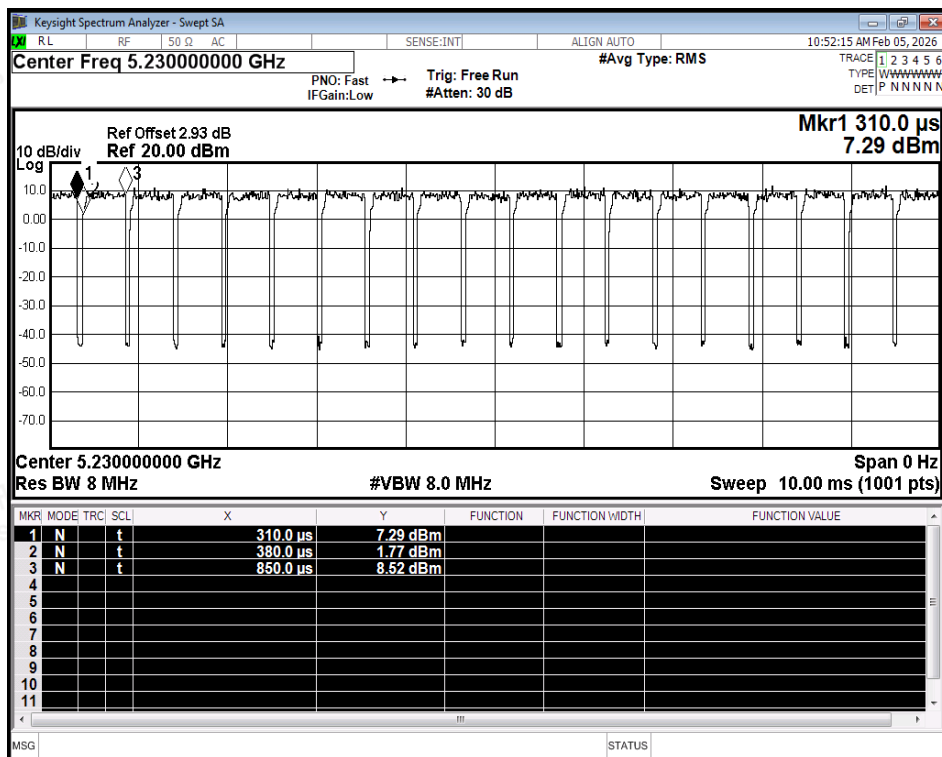

Duty Cycle NVNT ax40 5230MHz Ant1

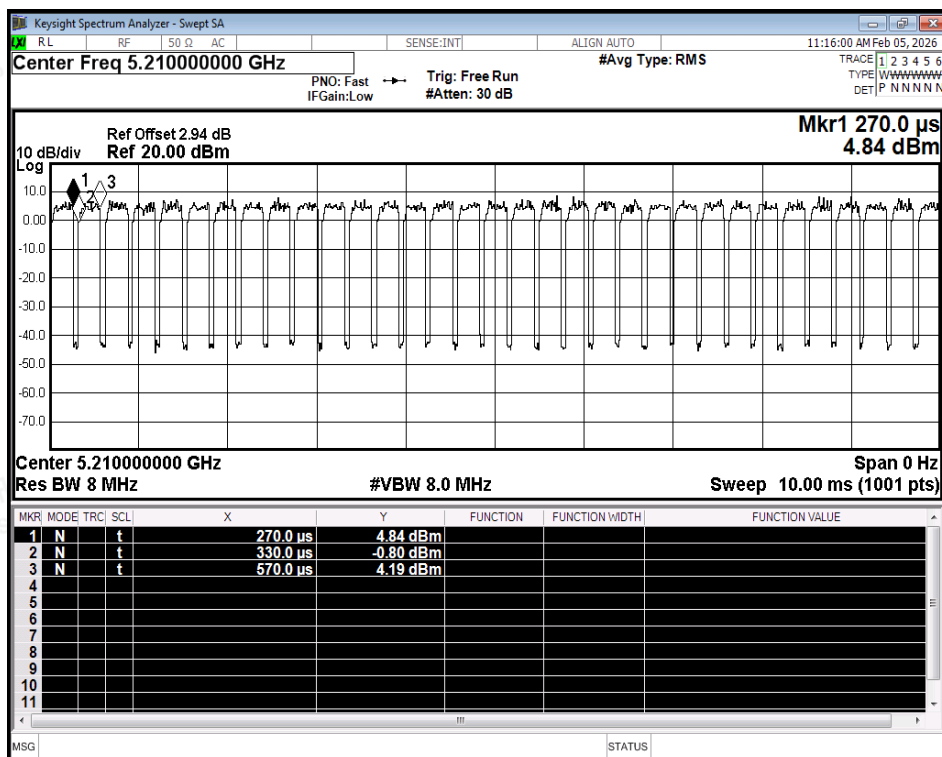

Duty Cycle NVNT ax80 5210MHz Ant1



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



Condition	Mode	Frequency (MHz)	Antenna	Duty Cycle (%)	Correction Factor (dB)	1/T (kHz)
NVNT	a	5180	Ant2	97.83	0.1	0.37
NVNT	a	5200	Ant2	97.82	0.1	0.37
NVNT	a	5240	Ant2	97.83	0.1	0.37
NVNT	n20	5180	Ant2	97.41	0.11	0.44
NVNT	n20	5200	Ant2	97	0.13	0.44
NVNT	n20	5240	Ant2	97.41	0.11	0.44
NVNT	n40	5190	Ant2	94.02	0.27	0.91
NVNT	n40	5230	Ant2	94.87	0.23	0.9
NVNT	ac20	5180	Ant2	97.42	0.11	0.44
NVNT	ac20	5200	Ant2	97	0.13	0.44
NVNT	ac20	5240	Ant2	97	0.13	0.44
NVNT	ac40	5190	Ant2	94.87	0.23	0.9
NVNT	ac40	5230	Ant2	94.87	0.23	0.9
NVNT	ac80	5210	Ant2	88.33	0.54	1.89
NVNT	ax20	5180	Ant2	97.44	0.11	0.44
NVNT	ax20	5200	Ant2	97.42	0.11	0.44
NVNT	ax20	5240	Ant2	97	0.13	0.44
NVNT	ax40	5190	Ant2	94.92	0.23	0.89
NVNT	ax40	5230	Ant2	94.87	0.23	0.9
NVNT	ax80	5210	Ant2	90	0.46	1.85




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

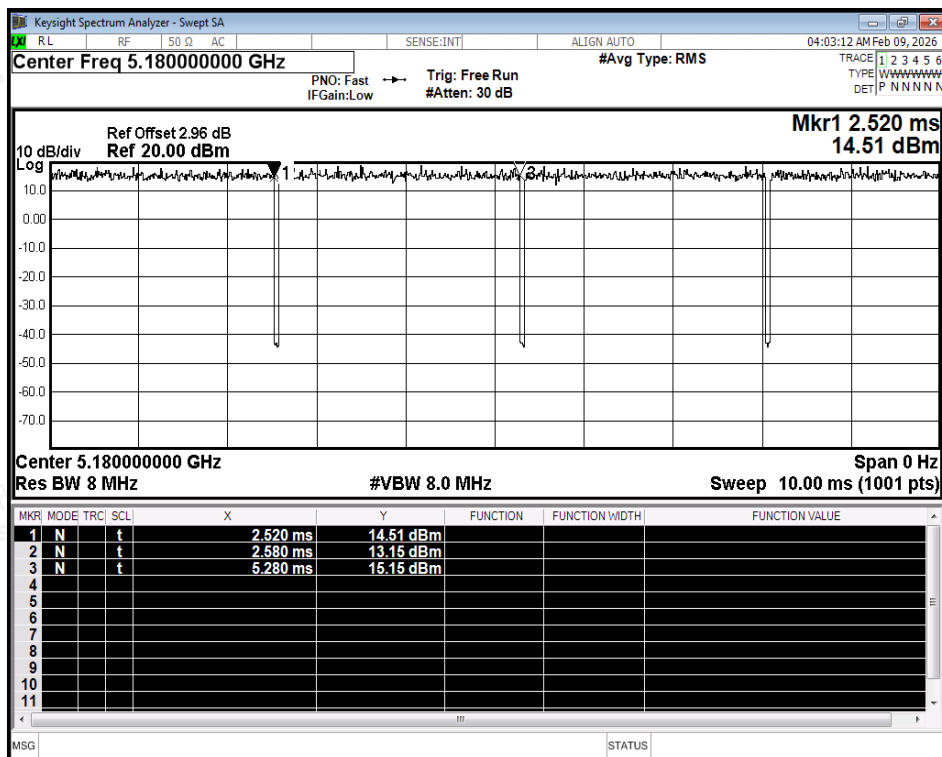

Duty Cycle NVNT a 5180MHz Ant2

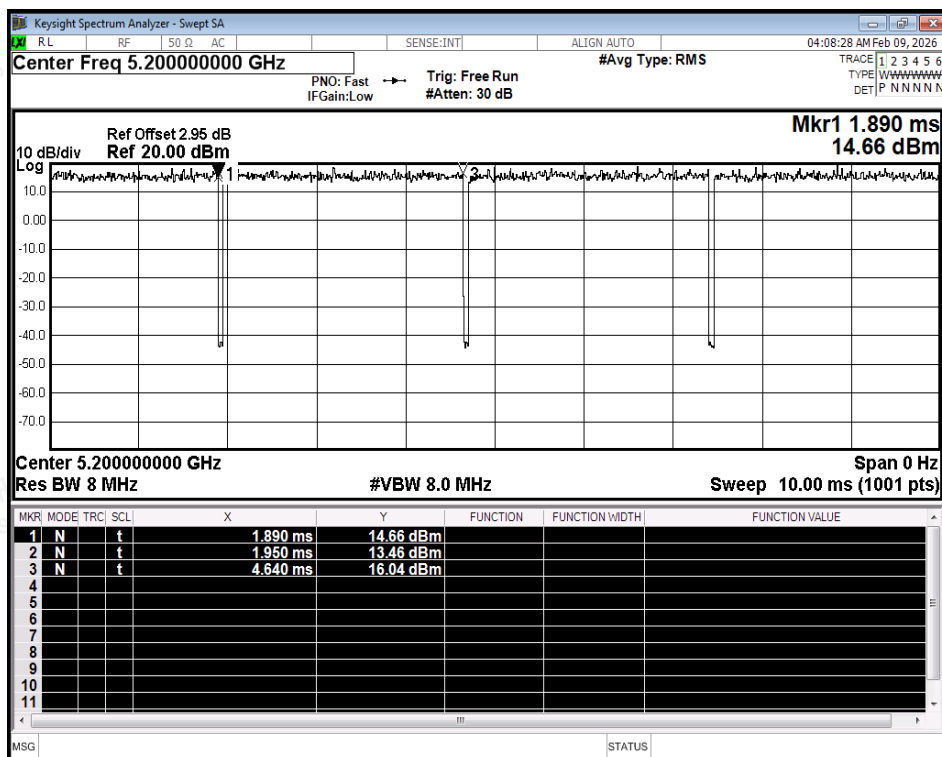

Duty Cycle NVNT a 5200MHz Ant2




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

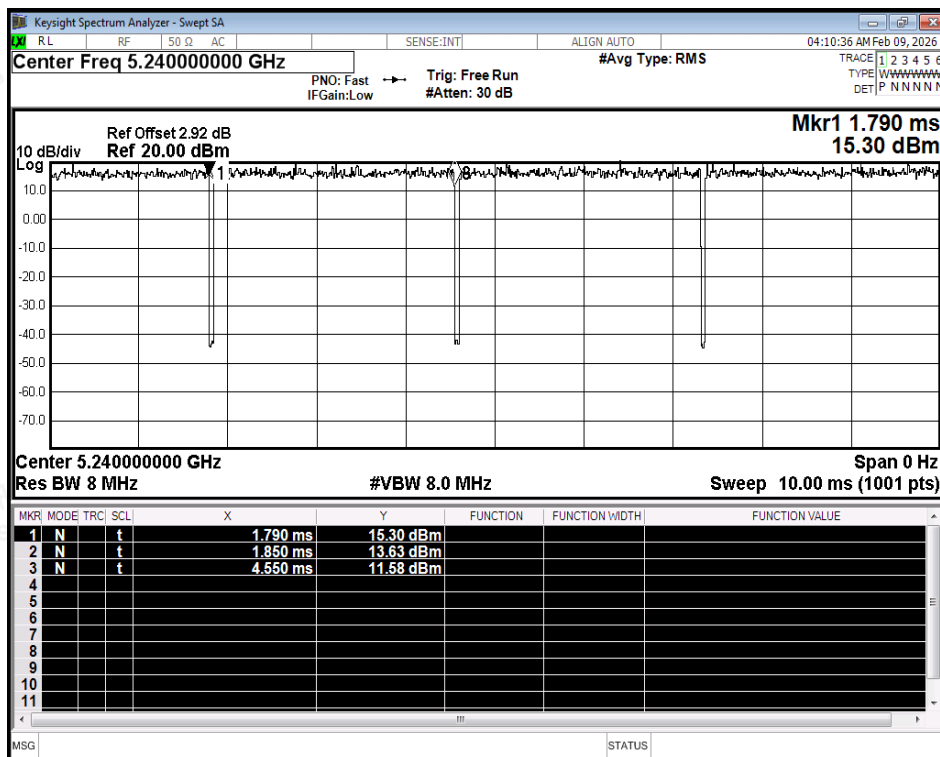

Duty Cycle NVNT a 5240MHz Ant2

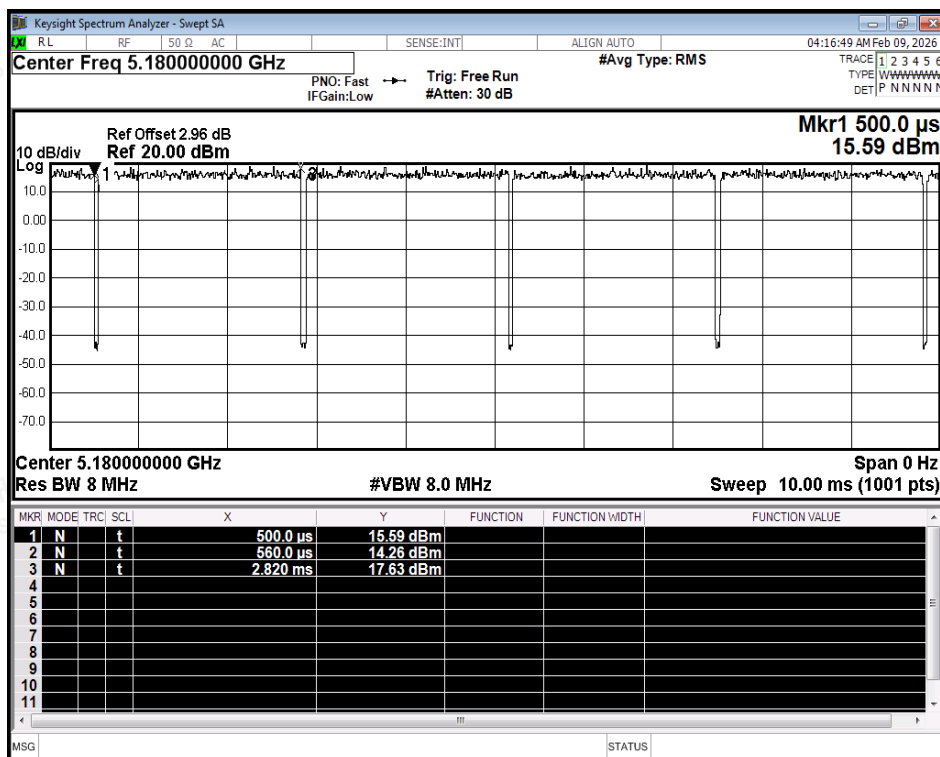

Duty Cycle NVNT n20 5180MHz Ant2




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

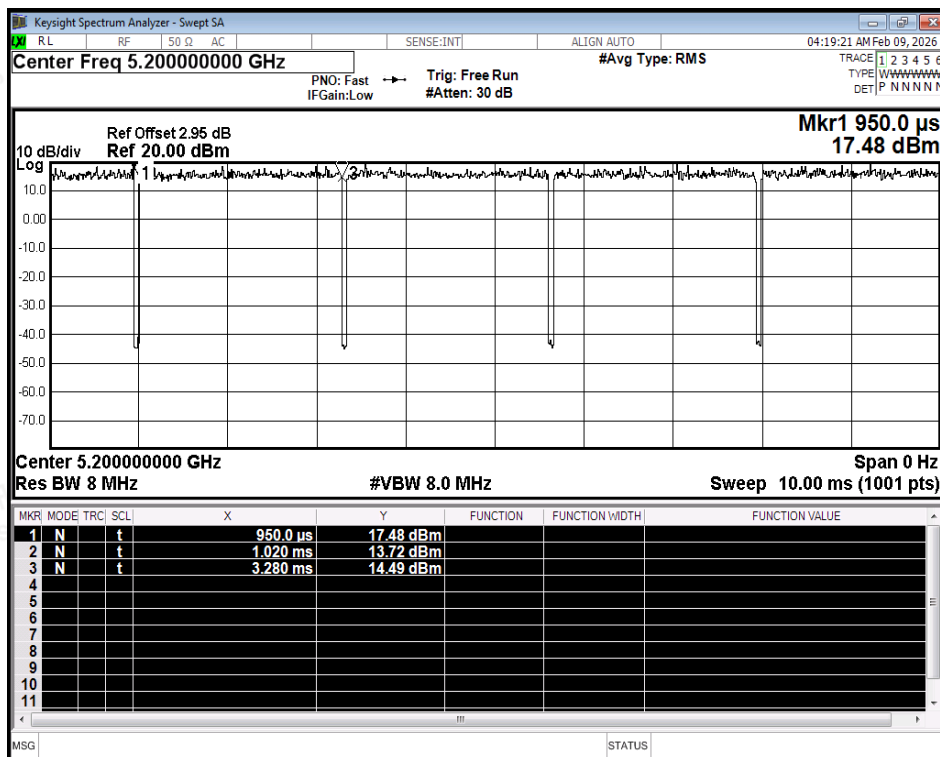

Duty Cycle NVNT n20 5200MHz Ant2

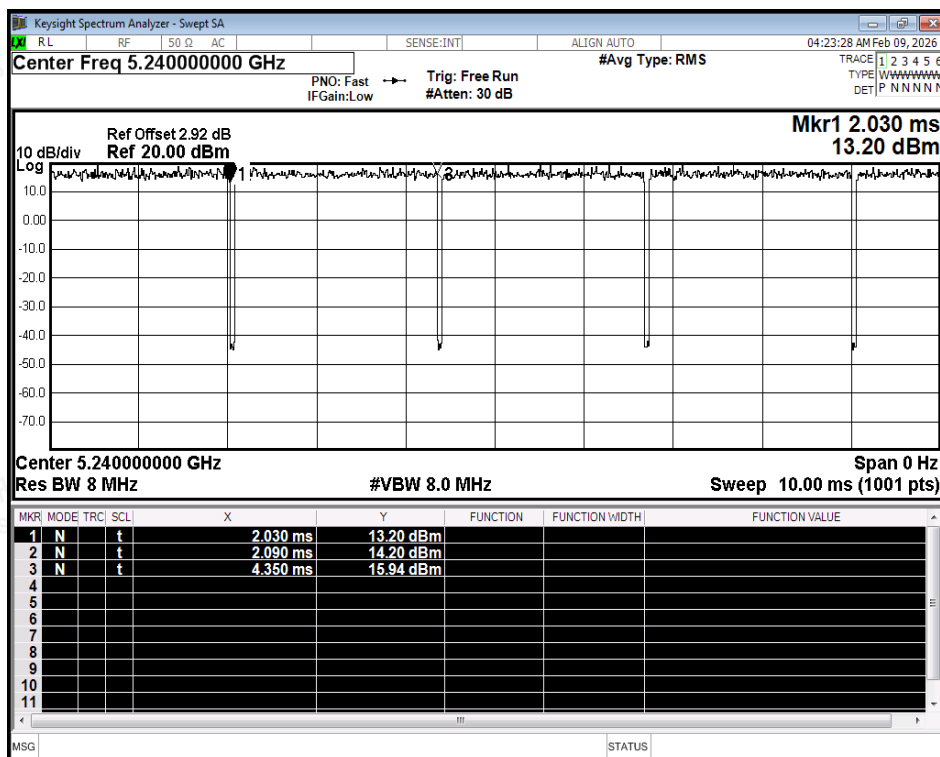

Duty Cycle NVNT n20 5240MHz Ant2




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

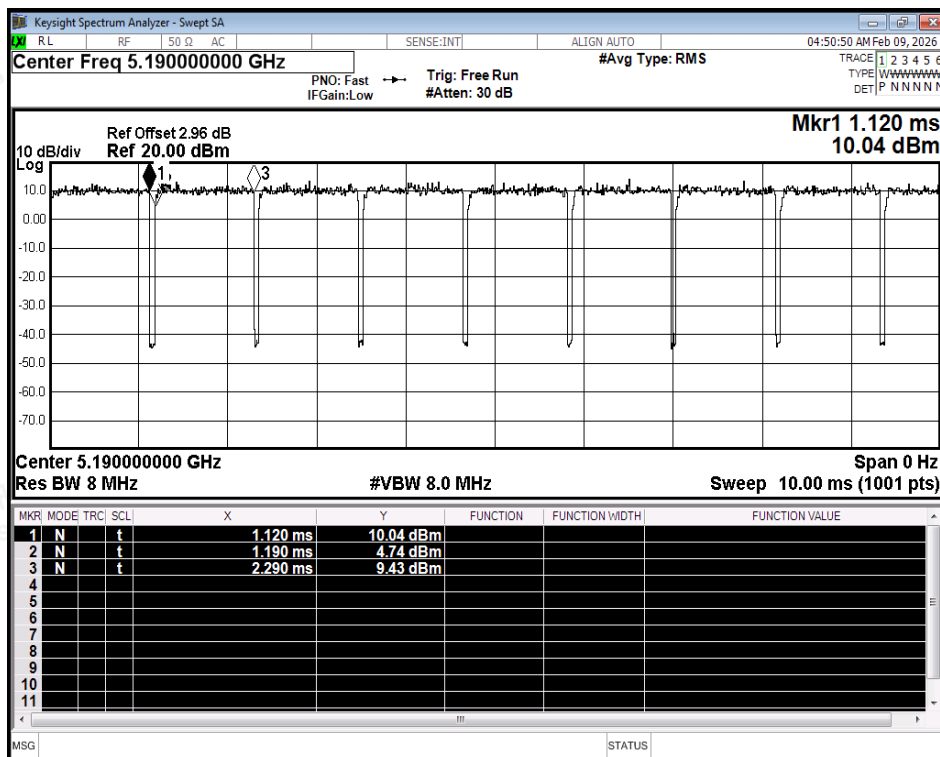

Duty Cycle NVNT n40 5190MHz Ant2

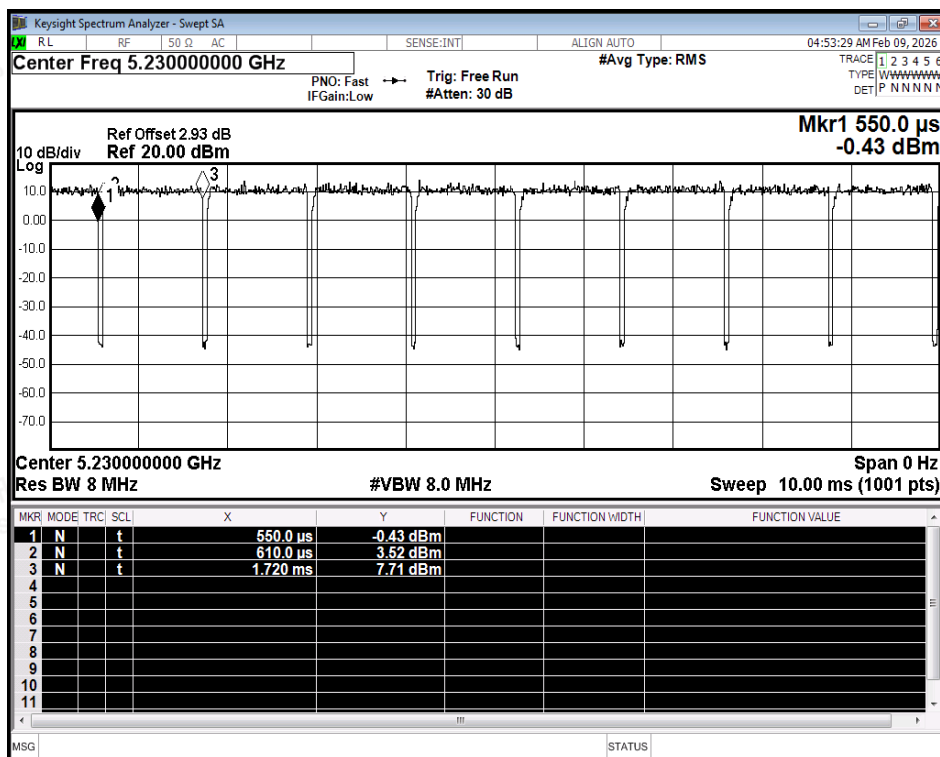

Duty Cycle NVNT n40 5230MHz Ant2




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

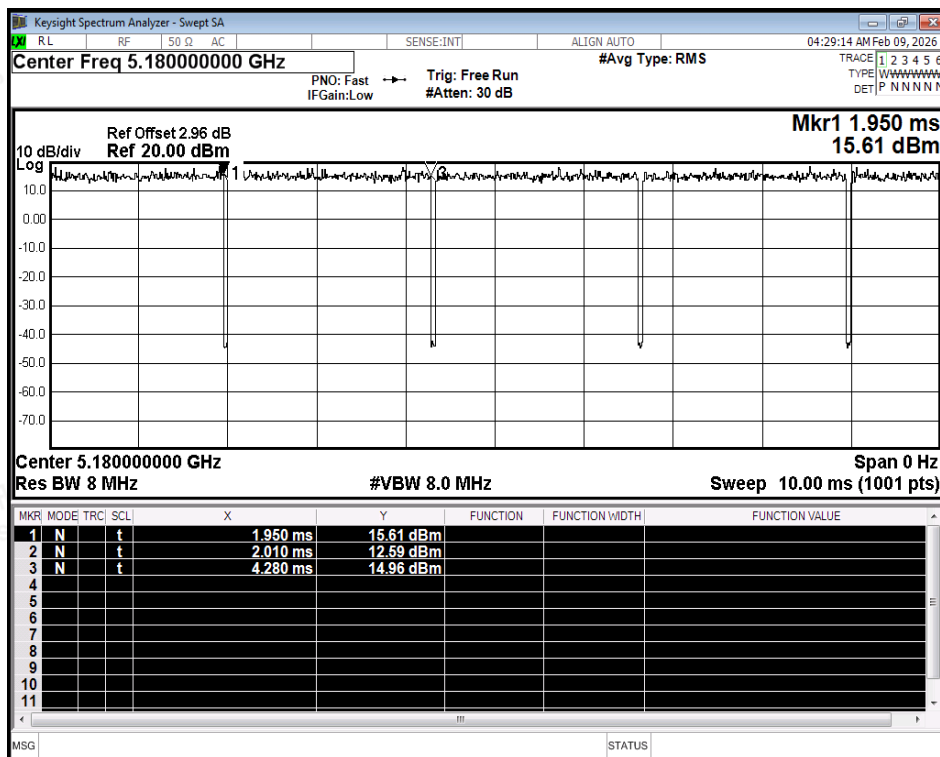

Duty Cycle NVNT ac20 5180MHz Ant2

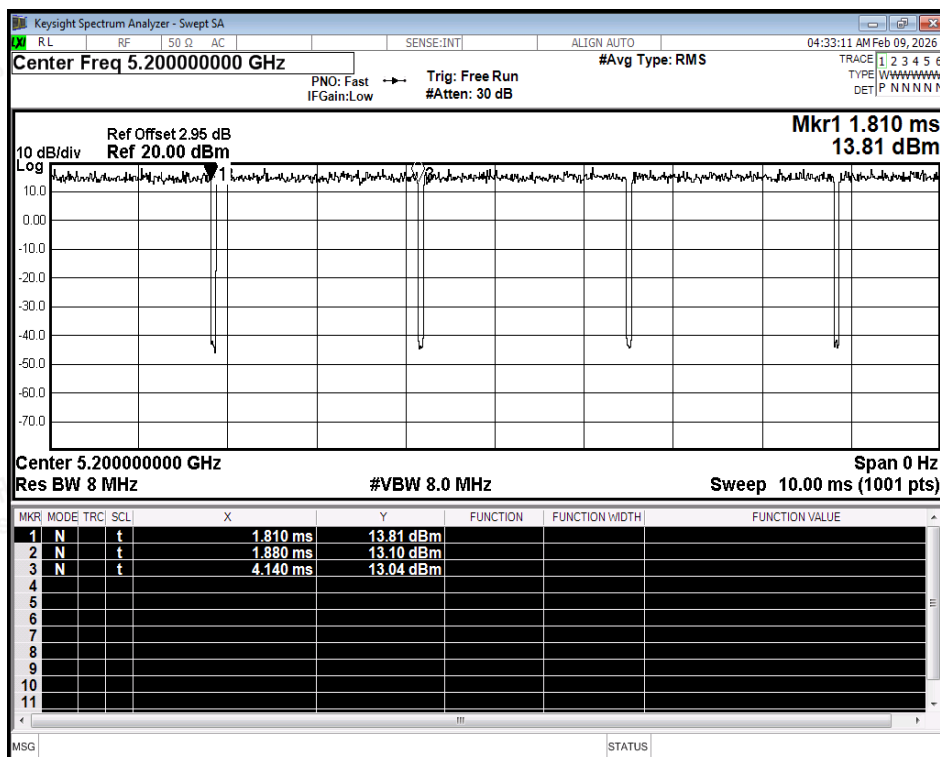

Duty Cycle NVNT ac20 5200MHz Ant2




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

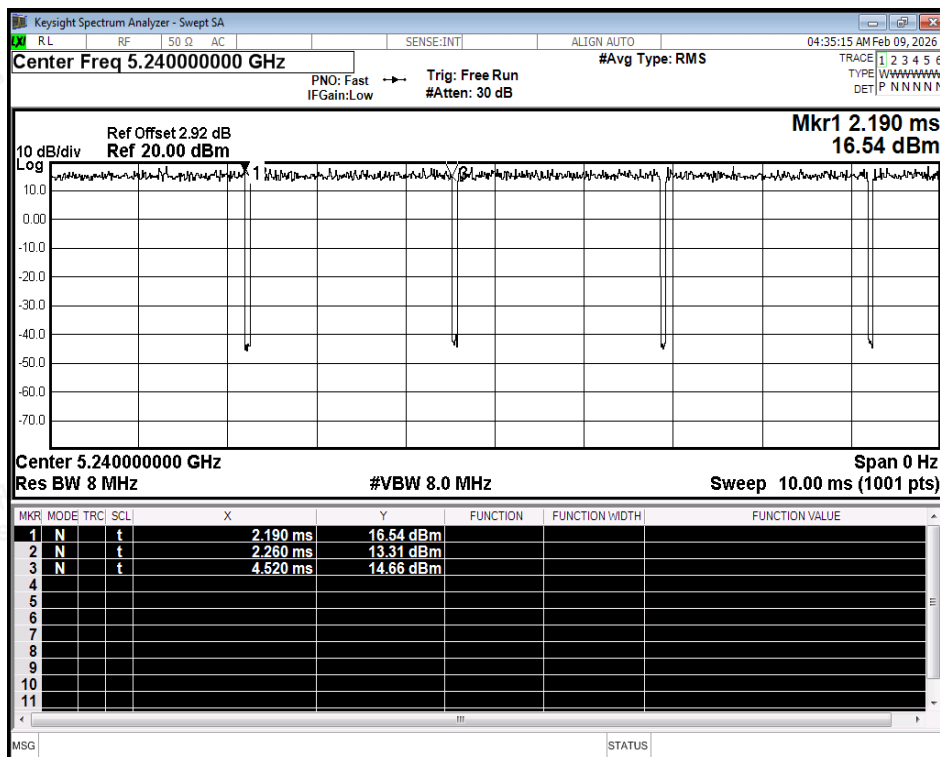

Duty Cycle NVNT ac20 5240MHz Ant2

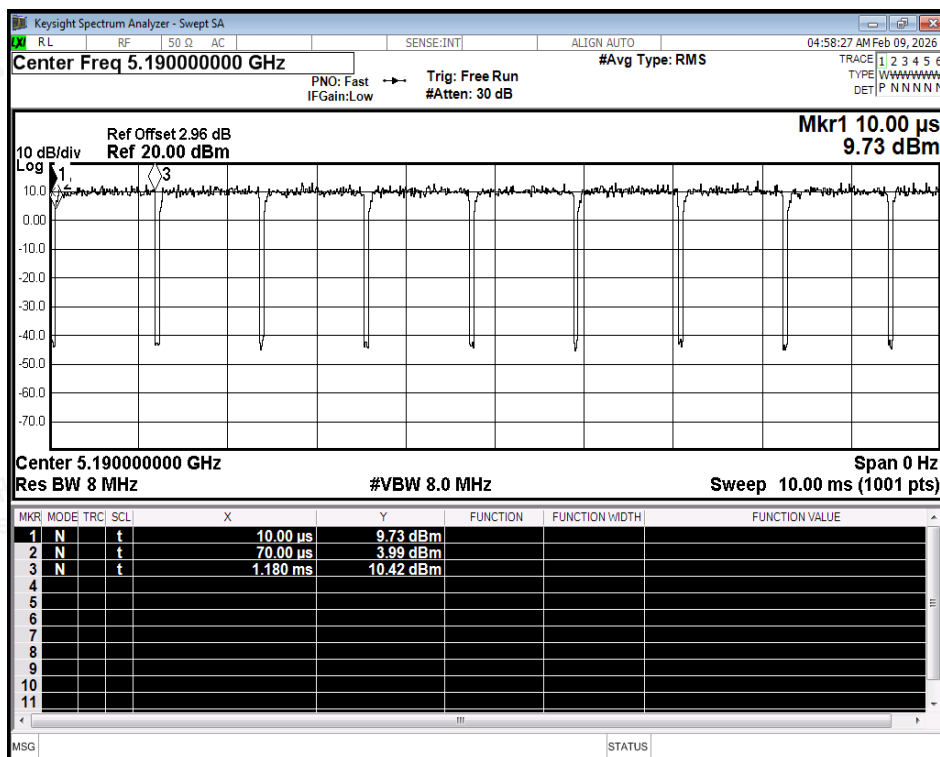

Duty Cycle NVNT ac40 5190MHz Ant2




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

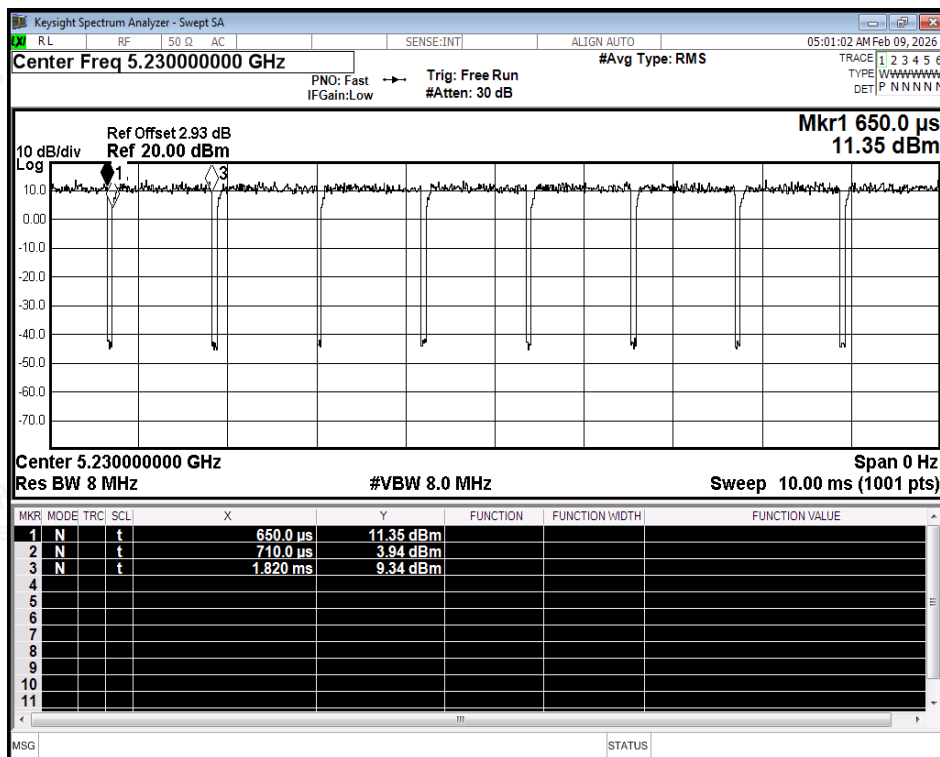

Duty Cycle NVNT ac40 5230MHz Ant2

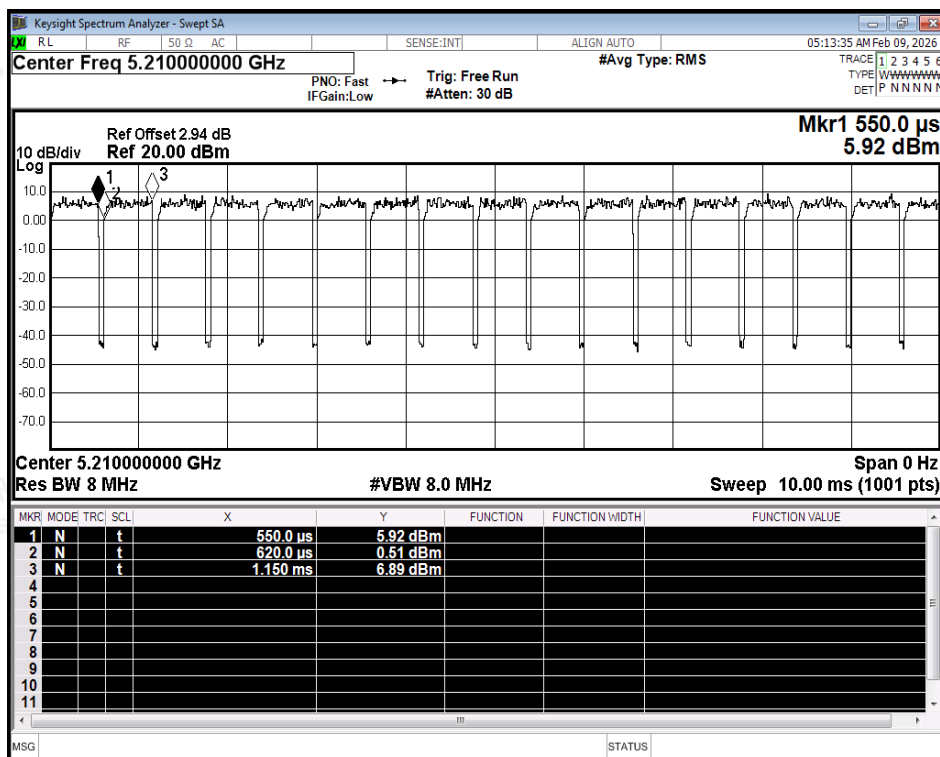

Duty Cycle NVNT ac80 5210MHz Ant2




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

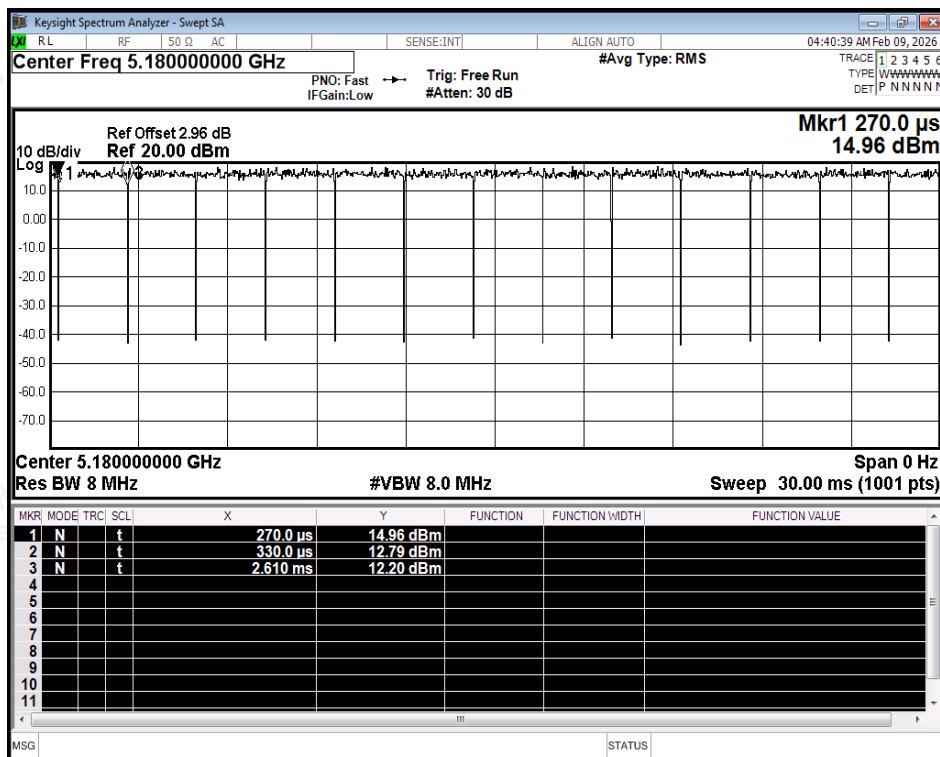

Duty Cycle NVNT ax20 5180MHz Ant2

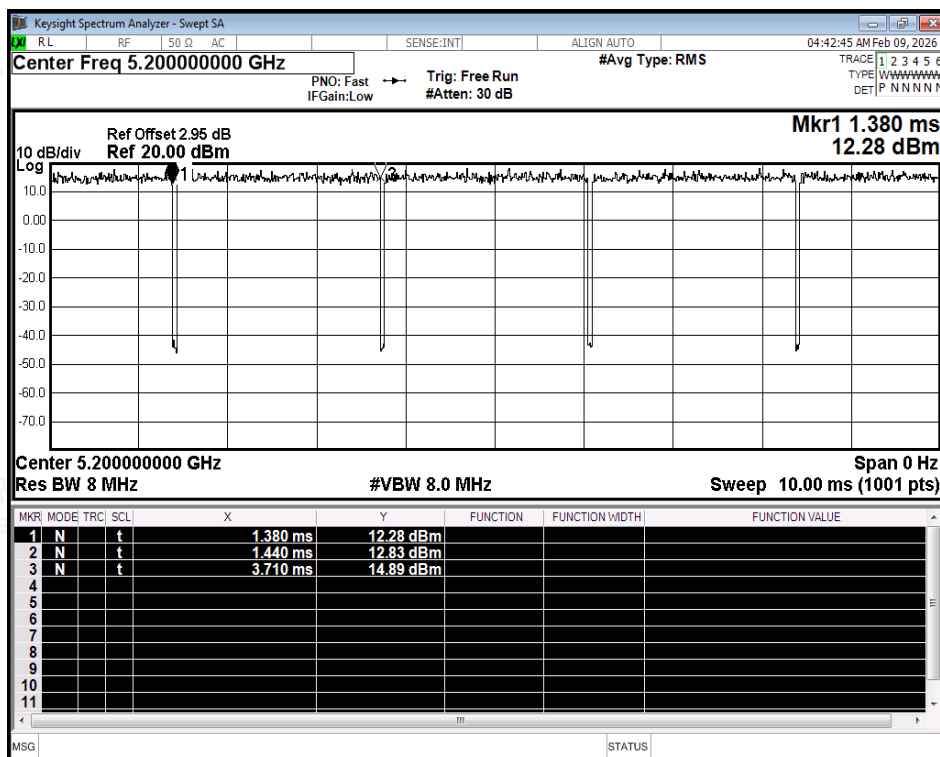

Duty Cycle NVNT ax20 5200MHz Ant2




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

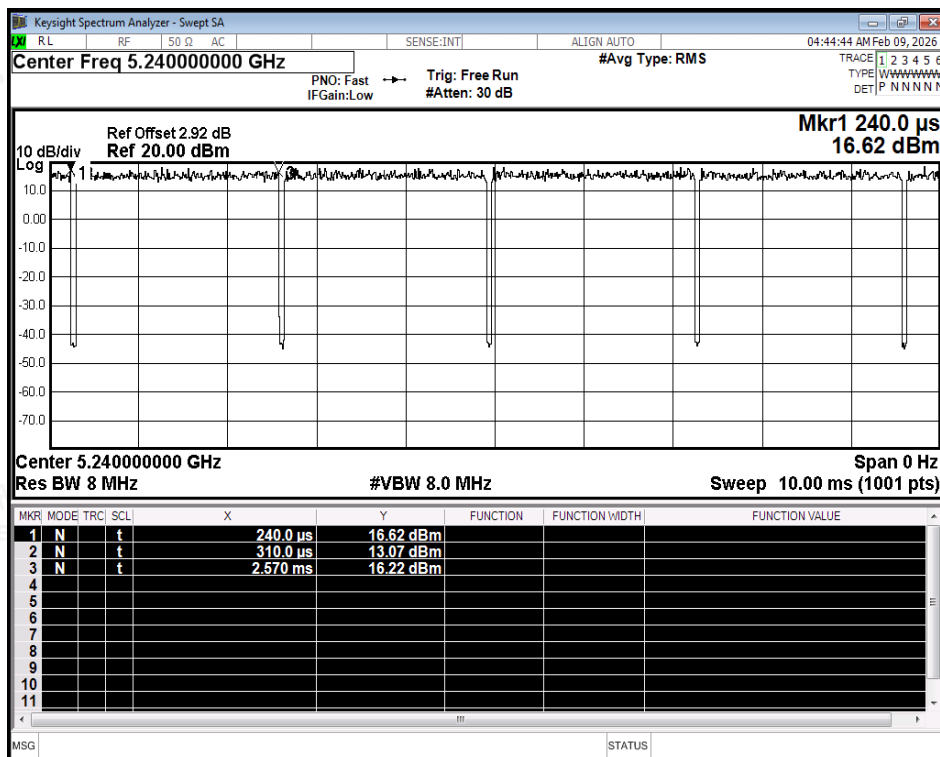

Duty Cycle NVNT ax20 5240MHz Ant2

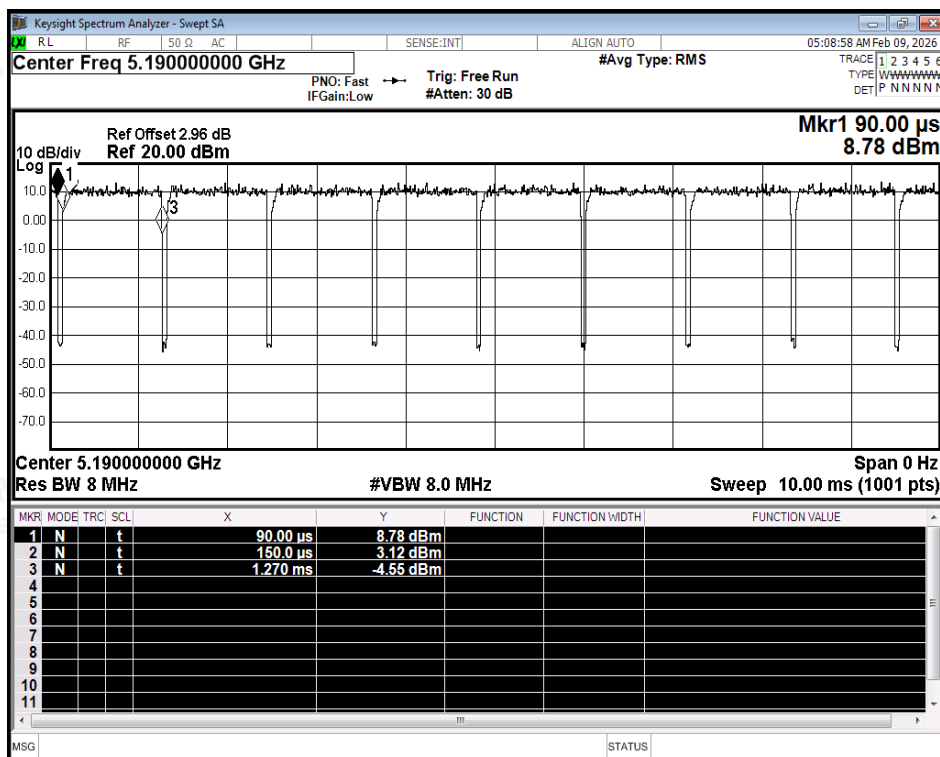

Duty Cycle NVNT ax40 5190MHz Ant2




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

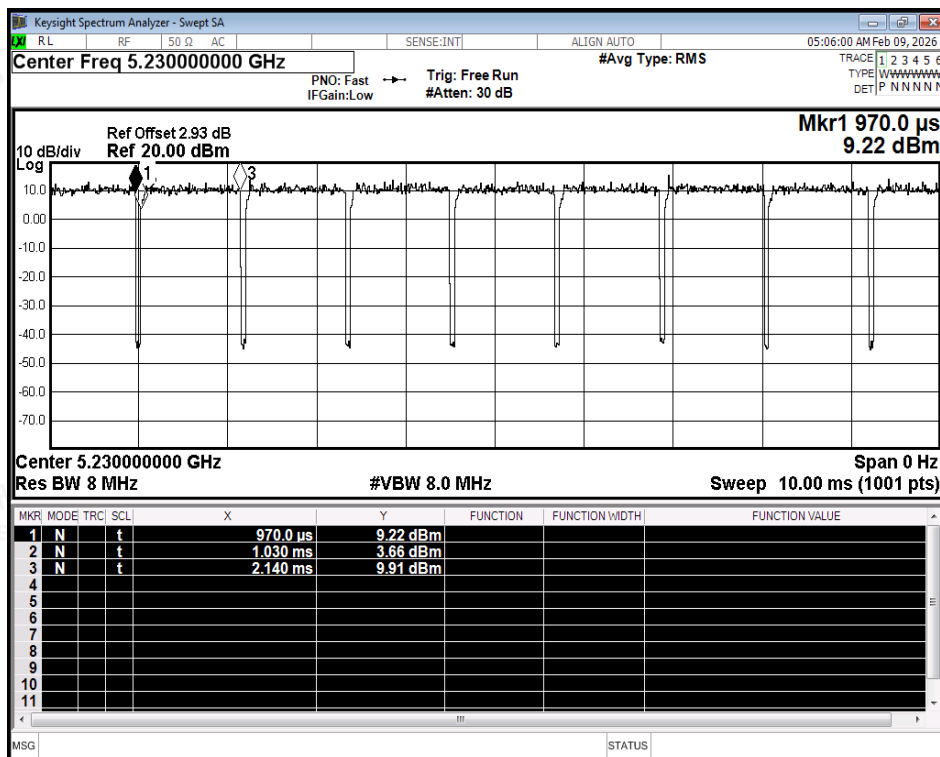

Duty Cycle NVNT ax40 5230MHz Ant2

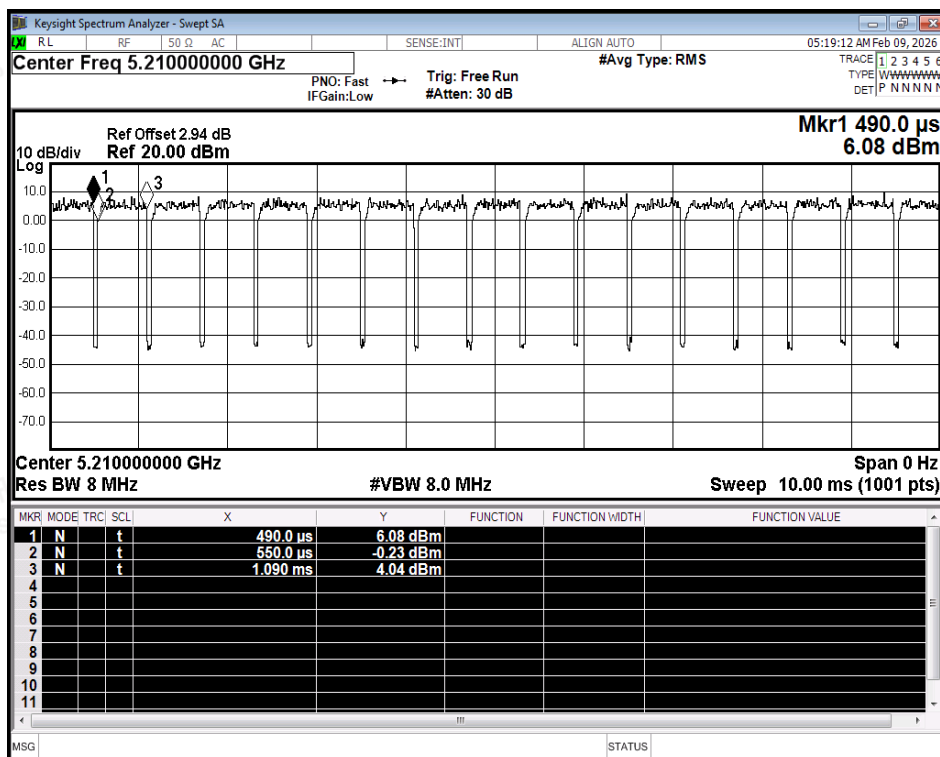

Duty Cycle NVNT ax80 5210MHz Ant2



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity