



Condition	Mode	Frequency (MHz)	Antenna	Spur Freq (MHz)	Power (dBm)	Gain (dBi)	E (dBuV/m)	Detector	Limit (dBuV/m)	Verdict
NVNT	a	5260	Ant2	4500	-52.31	2	44.92	Peak	68.2	Pass
NVNT	a	5260	Ant2	4500	-59.02	2	38.21	Average	54	Pass
NVNT	a	5260	Ant2	4773	-46.25	2	50.98	Peak	68.2	Pass
NVNT	a	5260	Ant2	4787.04	-54.15	2	43.08	Average	54	Pass
NVNT	a	5260	Ant2	5150	-50.17	2	47.06	Peak	68.2	Pass
NVNT	a	5260	Ant2	5150	-56.06	2	41.17	Average	54	Pass
NVNT	a	5320	Ant2	5350	-41.39	2	55.84	Peak	68.2	Pass
NVNT	a	5320	Ant2	5350	-49.33	2	47.9	Average	54	Pass
NVNT	a	5320	Ant2	5352	-35.71	2	61.52	Peak	68.2	Pass
NVNT	a	5320	Ant2	5350	-49.33	2	47.9	Average	54	Pass
NVNT	a	5320	Ant2	5460	-51.44	2	45.79	Peak	68.2	Pass
NVNT	a	5320	Ant2	5460	-57.43	2	39.8	Average	54	Pass
NVNT	n20	5260	Ant2	4500	-51.83	2	45.4	Peak	68.2	Pass
NVNT	n20	5260	Ant2	4500	-58.97	2	38.26	Average	54	Pass
NVNT	n20	5260	Ant2	5097.48	-46	2	51.23	Peak	68.2	Pass
NVNT	n20	5260	Ant2	4787.82	-54.33	2	42.9	Average	54	Pass
NVNT	n20	5260	Ant2	5150	-50.14	2	47.09	Peak	68.2	Pass
NVNT	n20	5260	Ant2	5150	-56.19	2	41.04	Average	54	Pass
NVNT	n20	5320	Ant2	5350	-37.15	2	60.08	Peak	68.2	Pass
NVNT	n20	5320	Ant2	5350	-47.09	2	48.14	Average	54	Pass
NVNT	n20	5320	Ant2	5352.4	-33.92	2	63.31	Peak	68.2	Pass
NVNT	n20	5320	Ant2	5350	-47.09	2	47.14	Average	54	Pass
NVNT	n20	5320	Ant2	5460	-51.86	2	45.37	Peak	68.2	Pass
NVNT	n20	5320	Ant2	5460	-57.48	2	39.75	Average	54	Pass
NVNT	n40	5270	Ant2	4500	-51.46	2	45.77	Peak	68.2	Pass
NVNT	n40	5270	Ant2	4500	-58.9	2	38.33	Average	54	Pass
NVNT	n40	5270	Ant2	4774.59	-45.04	2	52.19	Peak	68.2	Pass
NVNT	n40	5270	Ant2	4806.99	-50.76	2	46.47	Average	54	Pass
NVNT	n40	5270	Ant2	5150	-49.88	2	47.35	Peak	68.2	Pass
NVNT	n40	5270	Ant2	5150	-56.31	2	40.92	Average	54	Pass
NVNT	n40	5310	Ant2	5350	-42.01	2	55.22	Peak	68.2	Pass
NVNT	n40	5310	Ant2	5350	-52.04	2	45.19	Average	54	Pass
NVNT	n40	5310	Ant2	5350.6	-40.27	2	56.96	Peak	68.2	Pass
NVNT	n40	5310	Ant2	5350.8	-51.66	2	45.57	Average	54	Pass
NVNT	n40	5310	Ant2	5460	-50.15	2	47.08	Peak	68.2	Pass
NVNT	n40	5310	Ant2	5460	-57.31	2	39.92	Average	54	Pass
NVNT	ac20	5260	Ant2	4500	-51.91	2	45.32	Peak	68.2	Pass
NVNT	ac20	5260	Ant2	4500	-59	2	38.23	Average	54	Pass
NVNT	ac20	5260	Ant2	5132.58	-46.24	2	50.99	Peak	68.2	Pass



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



NVNT	ac20	5260	Ant2	4787.82	-54.4	2	42.83	Average	54	Pass
NVNT	ac20	5260	Ant2	5150	-48.18	2	49.05	Peak	68.2	Pass
NVNT	ac20	5260	Ant2	5150	-56.21	2	41.02	Average	54	Pass
NVNT	ac20	5320	Ant2	5350	-36.23	2	61	Peak	68.2	Pass
NVNT	ac20	5320	Ant2	5350	-46.97	2	47.26	Average	54	Pass
NVNT	ac20	5320	Ant2	5350.2	-32.78	2	61.45	Peak	68.2	Pass
NVNT	ac20	5320	Ant2	5350	-46.97	2	47.26	Average	54	Pass
NVNT	ac20	5320	Ant2	5460	-50.1	2	47.13	Peak	68.2	Pass
NVNT	ac20	5320	Ant2	5460	-57.5	2	39.73	Average	54	Pass
NVNT	ac40	5270	Ant2	4500	-51.11	2	46.12	Peak	68.2	Pass
NVNT	ac40	5270	Ant2	4500	-58.88	2	38.35	Average	54	Pass
NVNT	ac40	5270	Ant2	4807.8	-47.36	2	49.87	Peak	68.2	Pass
NVNT	ac40	5270	Ant2	4806.99	-54.12	2	43.11	Average	54	Pass
NVNT	ac40	5270	Ant2	5150	-49.6	2	47.63	Peak	68.2	Pass
NVNT	ac40	5270	Ant2	5150	-56.96	2	40.27	Average	54	Pass
NVNT	ac40	5310	Ant2	5350	-40.48	2	56.75	Peak	68.2	Pass
NVNT	ac40	5310	Ant2	5350	-51.59	2	45.64	Average	54	Pass
NVNT	ac40	5310	Ant2	5352	-38.27	2	58.96	Peak	68.2	Pass
NVNT	ac40	5310	Ant2	5350	-51.59	2	45.64	Average	54	Pass
NVNT	ac40	5310	Ant2	5460	-50.56	2	46.67	Peak	68.2	Pass
NVNT	ac40	5310	Ant2	5460	-57.3	2	39.93	Average	54	Pass
NVNT	ac80	5290	Ant2	5350	-44.87	2	52.36	Peak	68.2	Pass
NVNT	ac80	5290	Ant2	5350	-54	2	43.23	Average	54	Pass
NVNT	ac80	5290	Ant2	5350.5	-44.39	2	52.84	Peak	68.2	Pass
NVNT	ac80	5290	Ant2	5352.25	-53.36	2	43.87	Average	54	Pass
NVNT	ac80	5290	Ant2	5460	-50.71	2	46.52	Peak	68.2	Pass
NVNT	ac80	5290	Ant2	5460	-56.91	2	40.32	Average	54	Pass
NVNT	ac80	5290	Ant2	4500	-52.4	2	44.83	Peak	68.2	Pass
NVNT	ac80	5290	Ant2	4500	-58.65	2	38.58	Average	54	Pass
NVNT	ac80	5290	Ant2	4815.81	-46.79	2	50.44	Peak	68.2	Pass
NVNT	ac80	5290	Ant2	5149.89	-53.34	2	43.89	Average	54	Pass
NVNT	ac80	5290	Ant2	5150	-48.49	2	48.74	Peak	68.2	Pass
NVNT	ac80	5290	Ant2	5150	-53.52	2	43.71	Average	54	Pass
NVNT	ax20	5260	Ant2	4500	-52.75	2	44.48	Peak	68.2	Pass
NVNT	ax20	5260	Ant2	4500	-59.01	2	38.22	Average	54	Pass
NVNT	ax20	5260	Ant2	4789.38	-47.2	2	50.03	Peak	68.2	Pass
NVNT	ax20	5260	Ant2	4787.82	-54.23	2	43	Average	54	Pass
NVNT	ax20	5260	Ant2	5150	-48.89	2	48.34	Peak	68.2	Pass
NVNT	ax20	5260	Ant2	5150	-55.95	2	41.28	Average	54	Pass
NVNT	ax20	5320	Ant2	5350	-33.17	2	62.06	Peak	68.2	Pass
NVNT	ax20	5320	Ant2	5350	-46.86	2	47.37	Average	54	Pass



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China


Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity




NVNT	ax20	5320	Ant2	5350.2	-32.31	2	61.92	Peak	68.2	Pass
NVNT	ax20	5320	Ant2	5350	-46.86	2	47.37	Average	54	Pass
NVNT	ax20	5320	Ant2	5460	-49.67	2	47.56	Peak	68.2	Pass
NVNT	ax20	5320	Ant2	5460	-57.49	2	39.74	Average	54	Pass
NVNT	ax40	5270	Ant2	4500	-50.91	2	46.32	Peak	68.2	Pass
NVNT	ax40	5270	Ant2	4500	-58.77	2	38.46	Average	54	Pass
NVNT	ax40	5270	Ant2	4807.8	-46.67	2	50.56	Peak	68.2	Pass
NVNT	ax40	5270	Ant2	4806.99	-54.09	2	43.14	Average	54	Pass
NVNT	ax40	5270	Ant2	5150	-49.82	2	47.41	Peak	68.2	Pass
NVNT	ax40	5270	Ant2	5150	-56.94	2	40.29	Average	54	Pass
NVNT	ax40	5310	Ant2	5350	-41.46	2	55.77	Peak	68.2	Pass
NVNT	ax40	5310	Ant2	5350	-52.01	2	45.22	Average	54	Pass
NVNT	ax40	5310	Ant2	5350.4	-39.23	2	58	Peak	68.2	Pass
NVNT	ax40	5310	Ant2	5350.2	-51.83	2	45.4	Average	54	Pass
NVNT	ax40	5310	Ant2	5460	-51	2	46.23	Peak	68.2	Pass
NVNT	ax40	5310	Ant2	5460	-57.42	2	39.81	Average	54	Pass
NVNT	ax80	5290	Ant2	5350	-45.97	2	51.26	Peak	68.2	Pass
NVNT	ax80	5290	Ant2	5350	-53.87	2	43.36	Average	54	Pass
NVNT	ax80	5290	Ant2	5359	-43.55	2	53.68	Peak	68.2	Pass
NVNT	ax80	5290	Ant2	5350.25	-53.32	2	43.91	Average	54	Pass
NVNT	ax80	5290	Ant2	5460	-47.8	2	49.43	Peak	68.2	Pass
NVNT	ax80	5290	Ant2	5460	-57.14	2	40.09	Average	54	Pass
NVNT	ax80	5290	Ant2	4500	-51.23	2	46	Peak	68.2	Pass
NVNT	ax80	5290	Ant2	4500	-58.56	2	38.67	Average	54	Pass
NVNT	ax80	5290	Ant2	5146.41	-46.77	2	50.46	Peak	68.2	Pass
NVNT	ax80	5290	Ant2	5149.02	-53.47	2	43.76	Average	54	Pass
NVNT	ax80	5290	Ant2	5150	-46.96	2	50.27	Peak	68.2	Pass
NVNT	ax80	5290	Ant2	5150	-53.59	2	43.64	Average	54	Pass



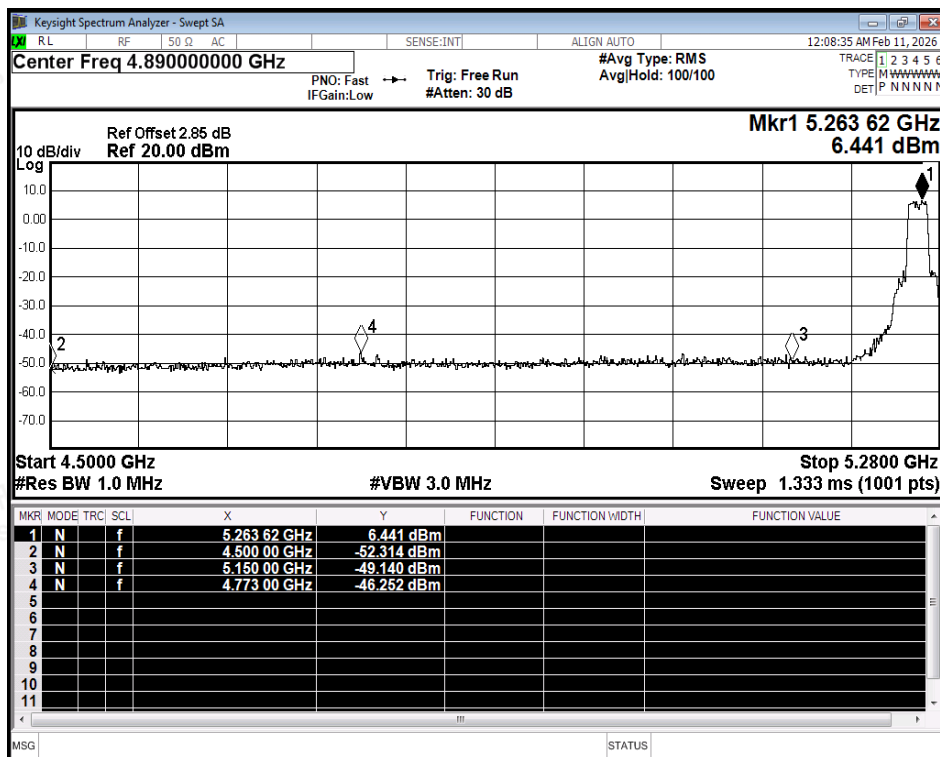

Restrict Band NVNT a 5260MHz Ant2 Peak

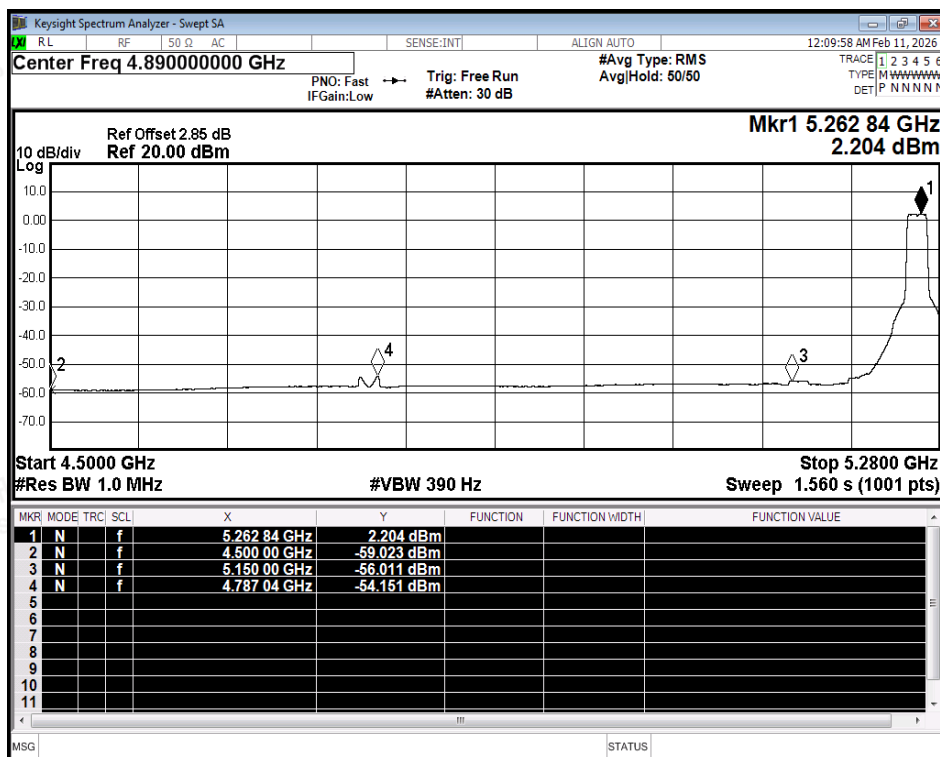

Restrict Band NVNT a 5260MHz Ant2 Average




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

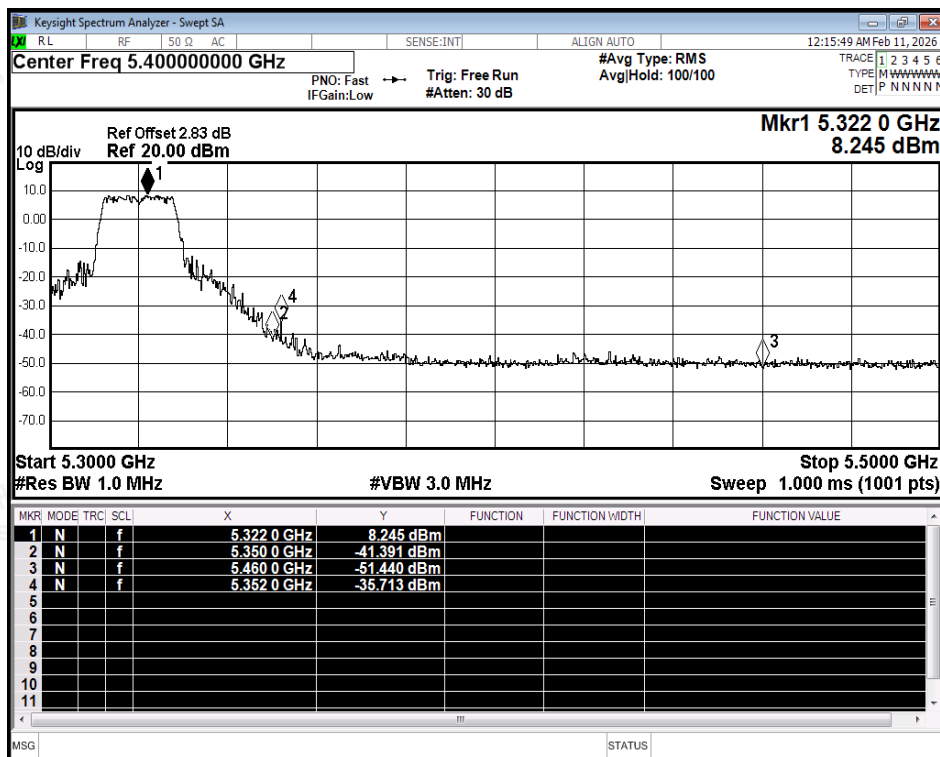

Restrict Band NVNT a 5320MHz Ant2 Peak

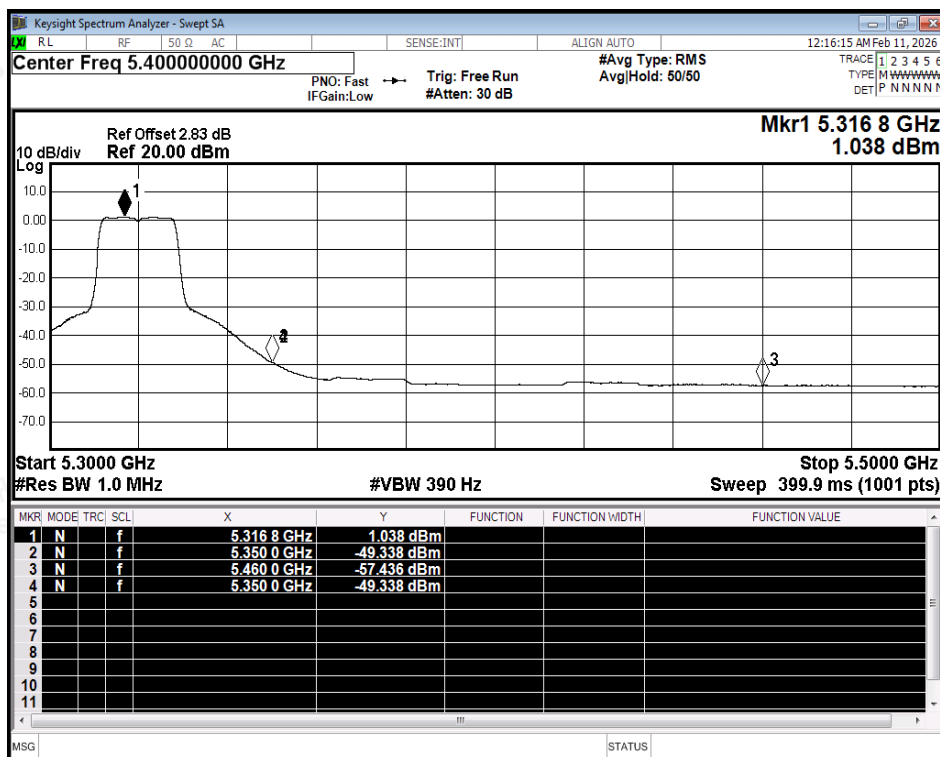

Restrict Band NVNT a 5320MHz Ant2 Average




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

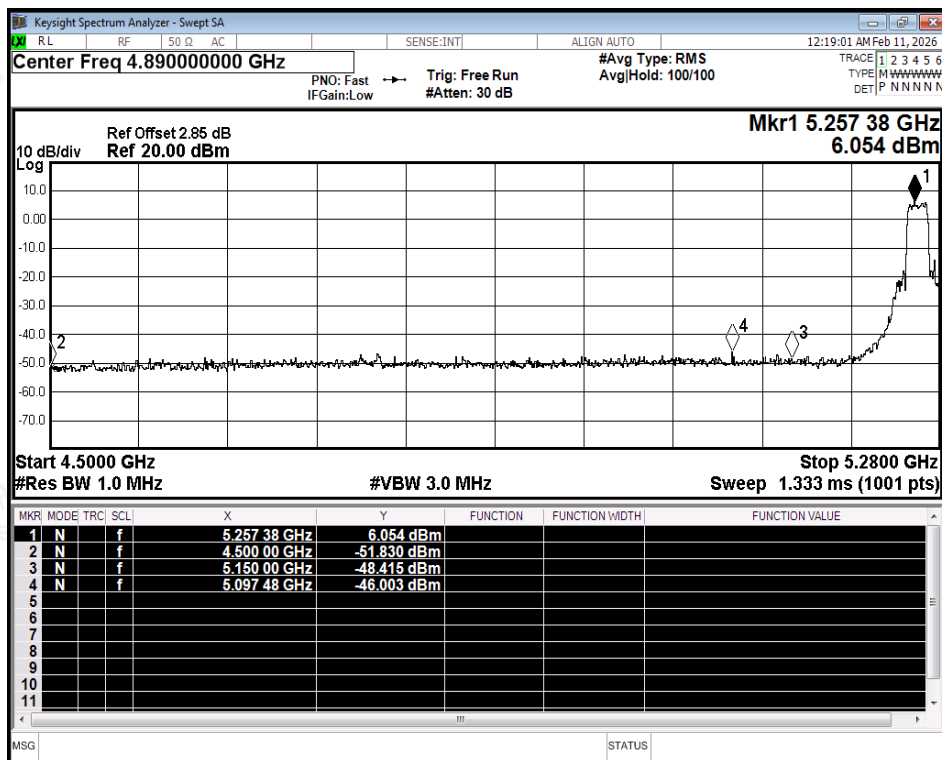

Restrict Band NVNT n20 5260MHz Ant2 Peak

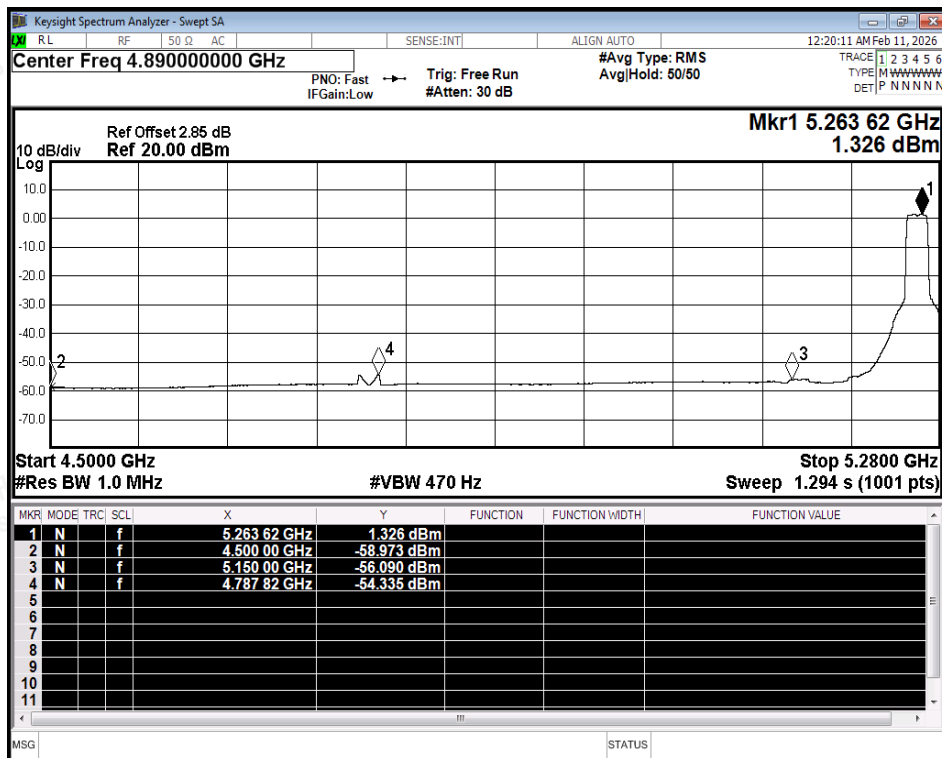

Restrict Band NVNT n20 5260MHz Ant2 Average




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

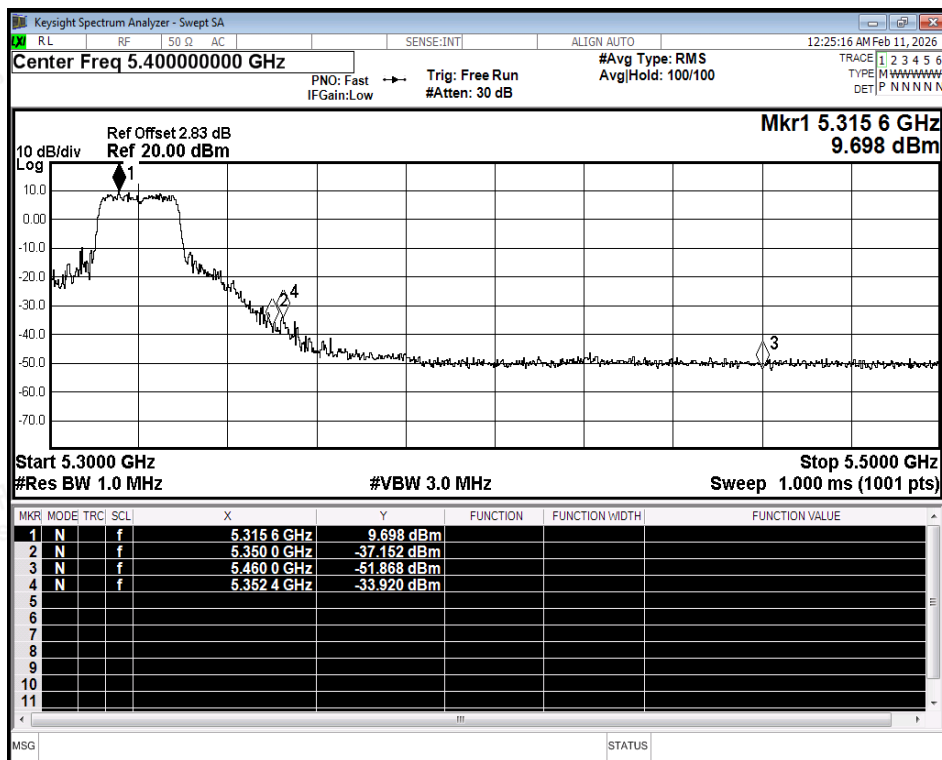

Restrict Band NVNT n20 5320MHz Ant2 Peak

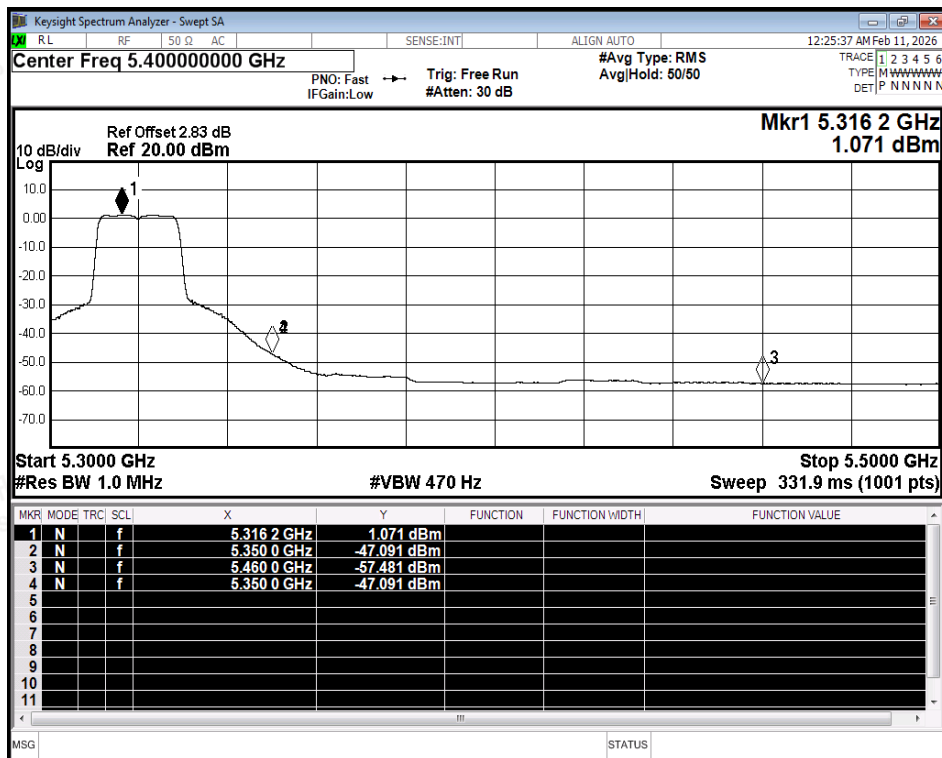

Restrict Band NVNT n20 5320MHz Ant2 Average




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

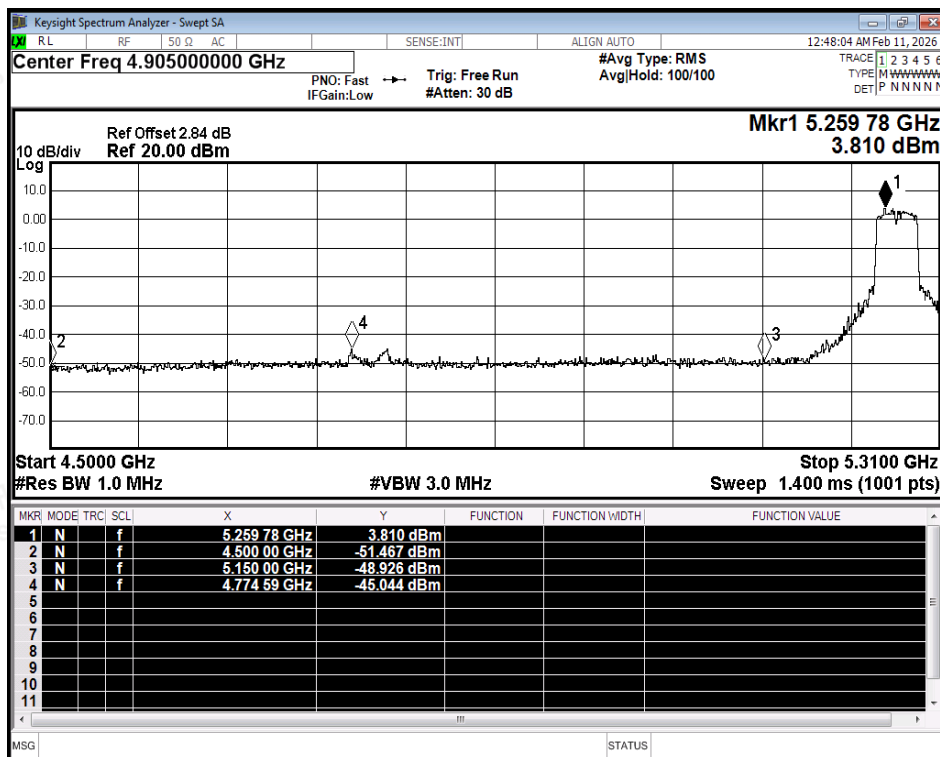

Restrict Band NVNT n40 5270MHz Ant2 Peak

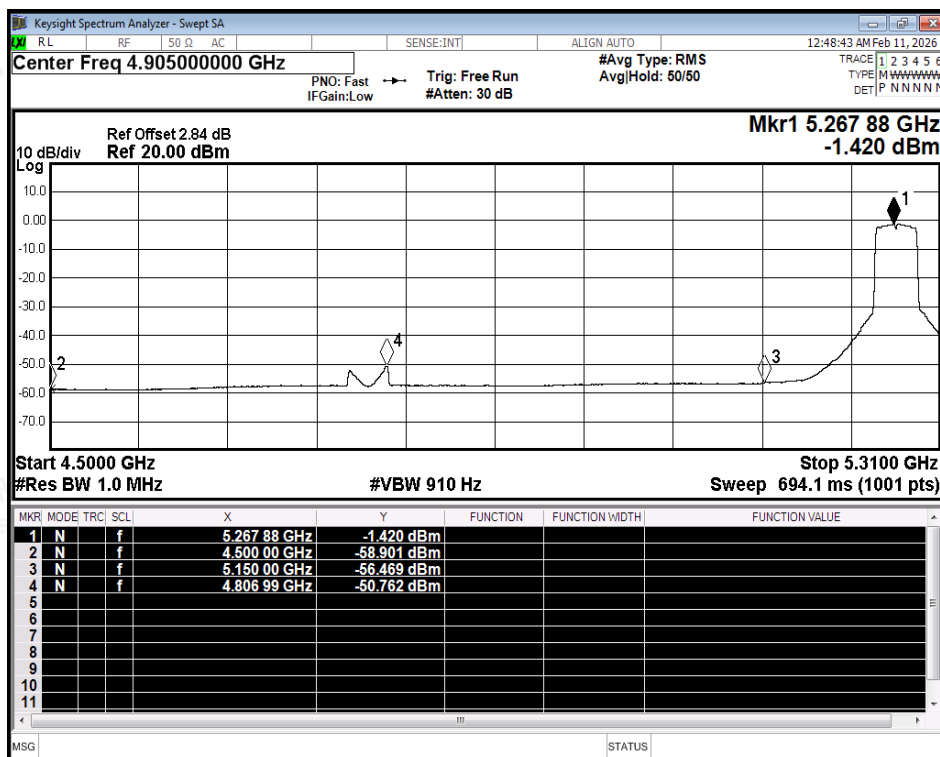

Restrict Band NVNT n40 5270MHz Ant2 Average




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

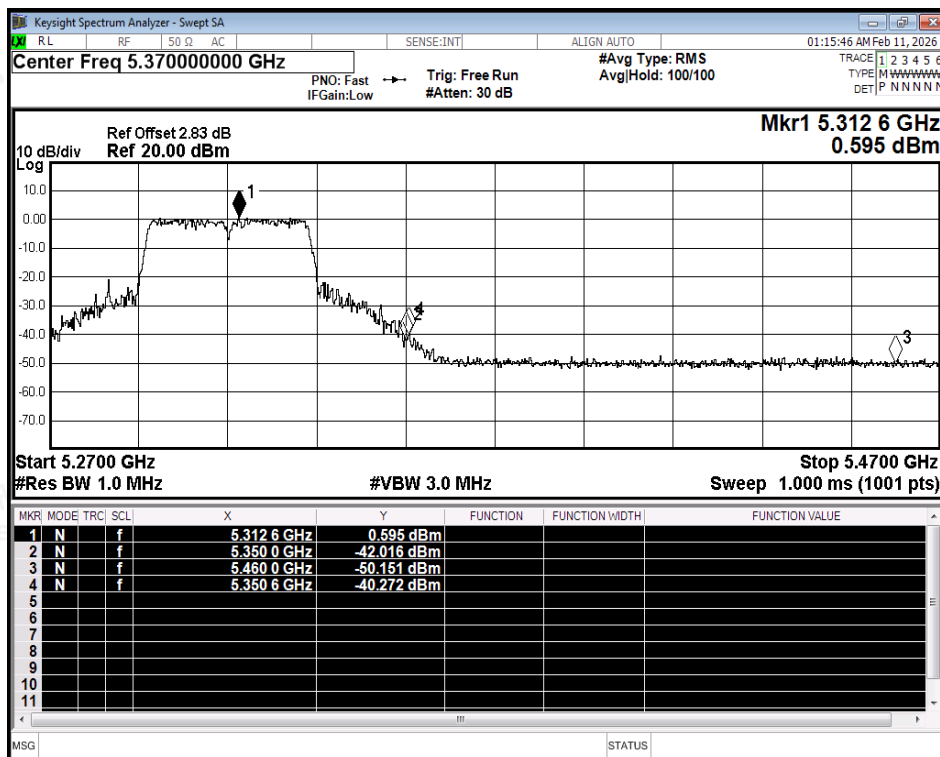

Restrict Band NVNT n40 5310MHz Ant2 Peak

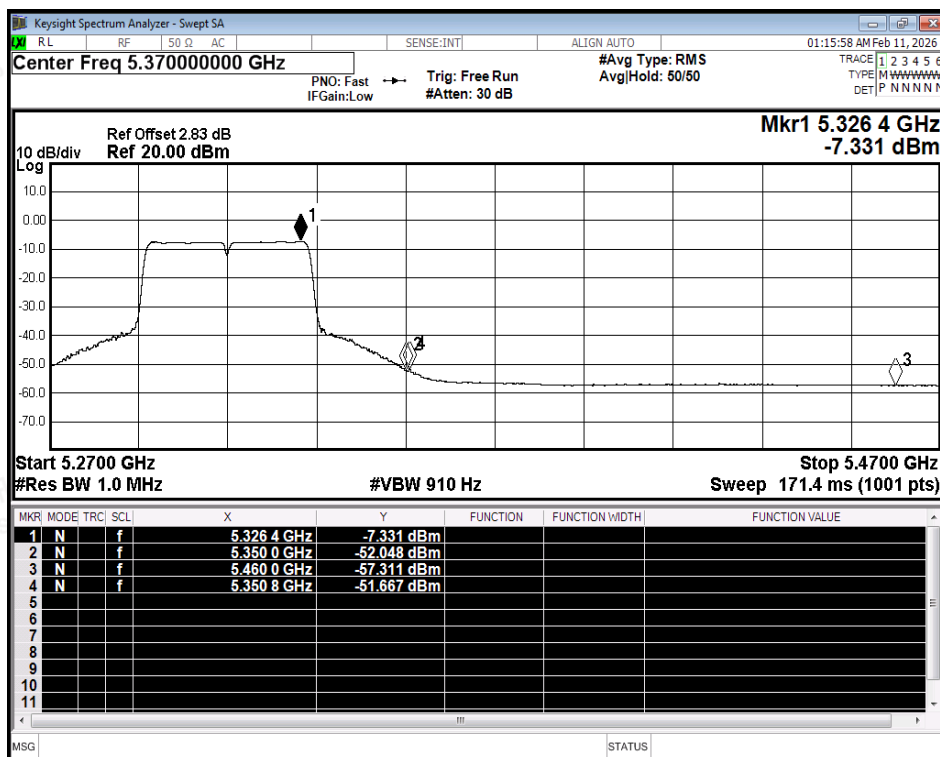

Restrict Band NVNT n40 5310MHz Ant2 Average




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

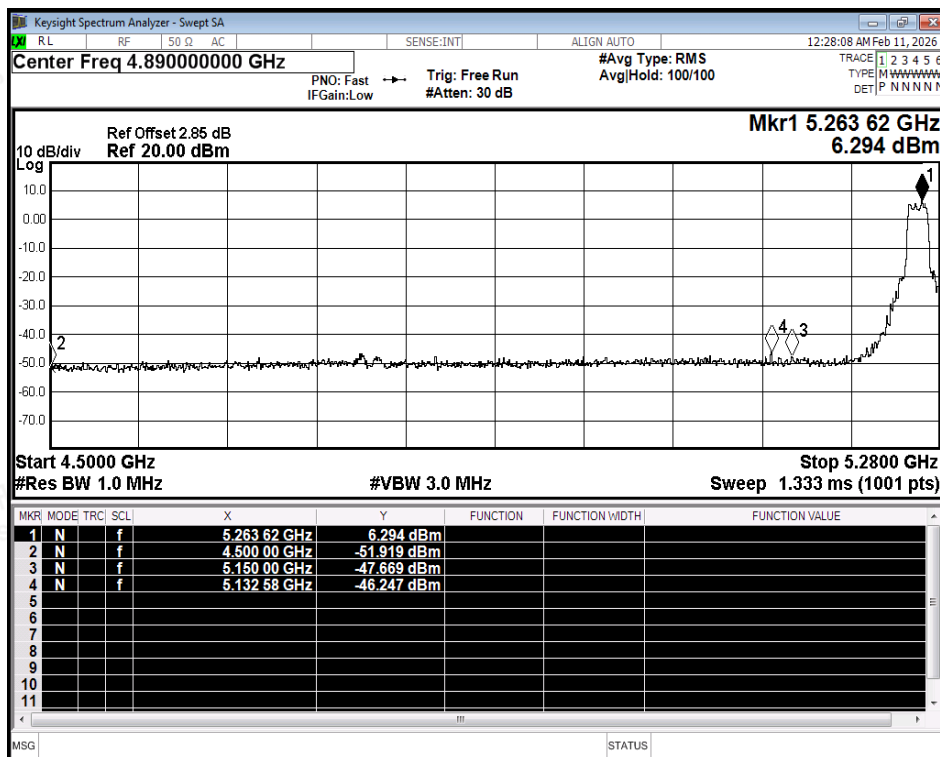

Restrict Band NVNT ac20 5260MHz Ant2 Peak

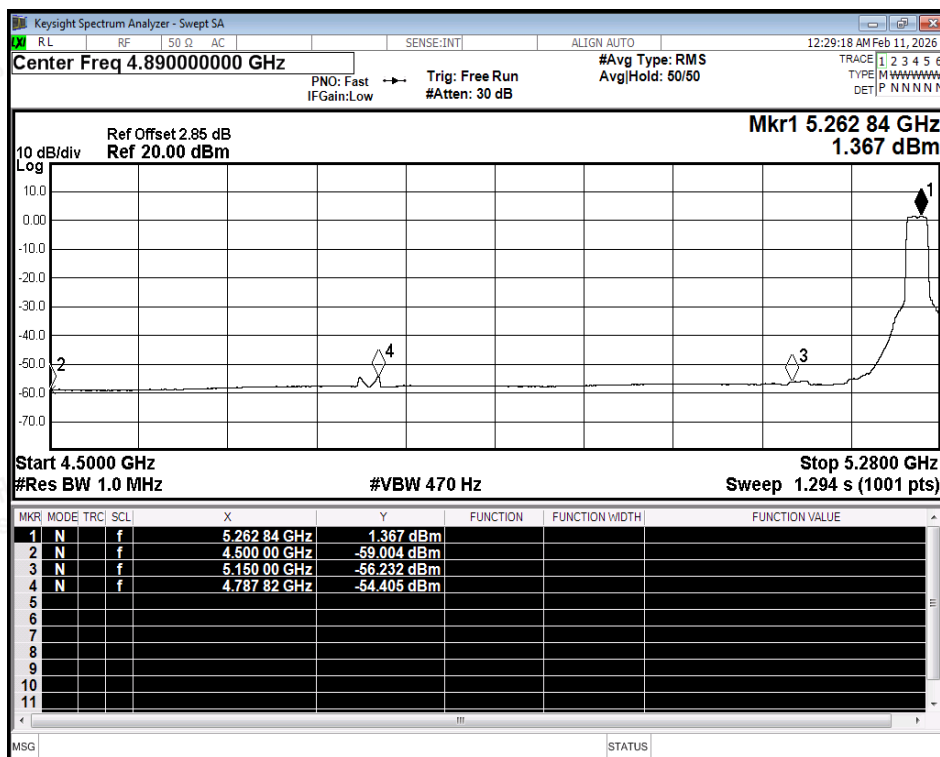

Restrict Band NVNT ac20 5260MHz Ant2 Average




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

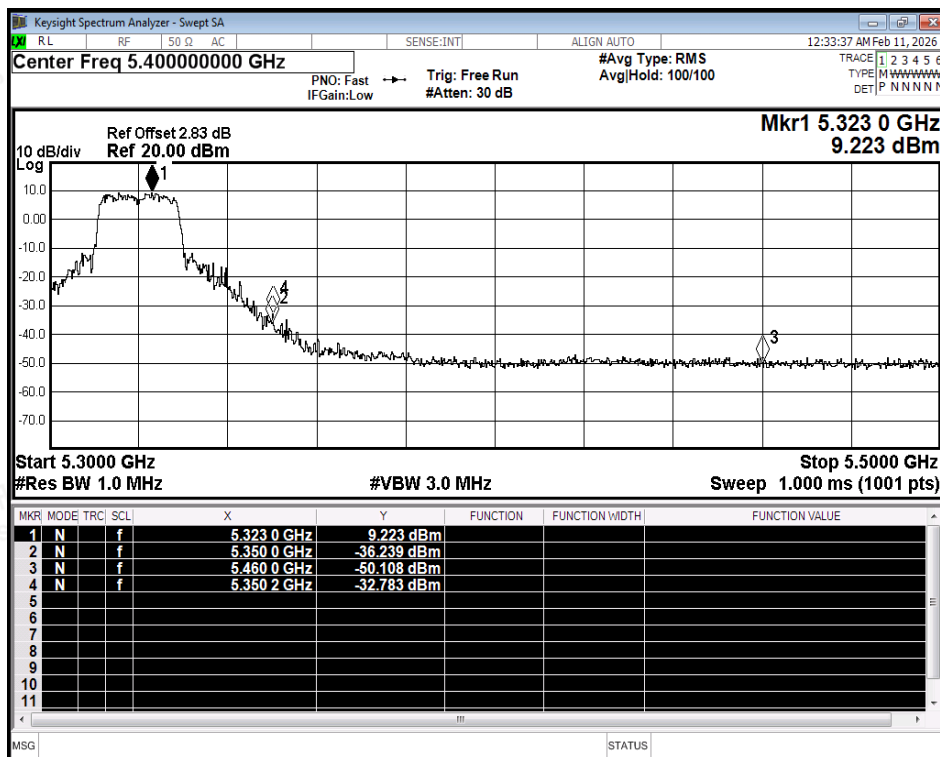

Restrict Band NVNT ac20 5320MHz Ant2 Peak

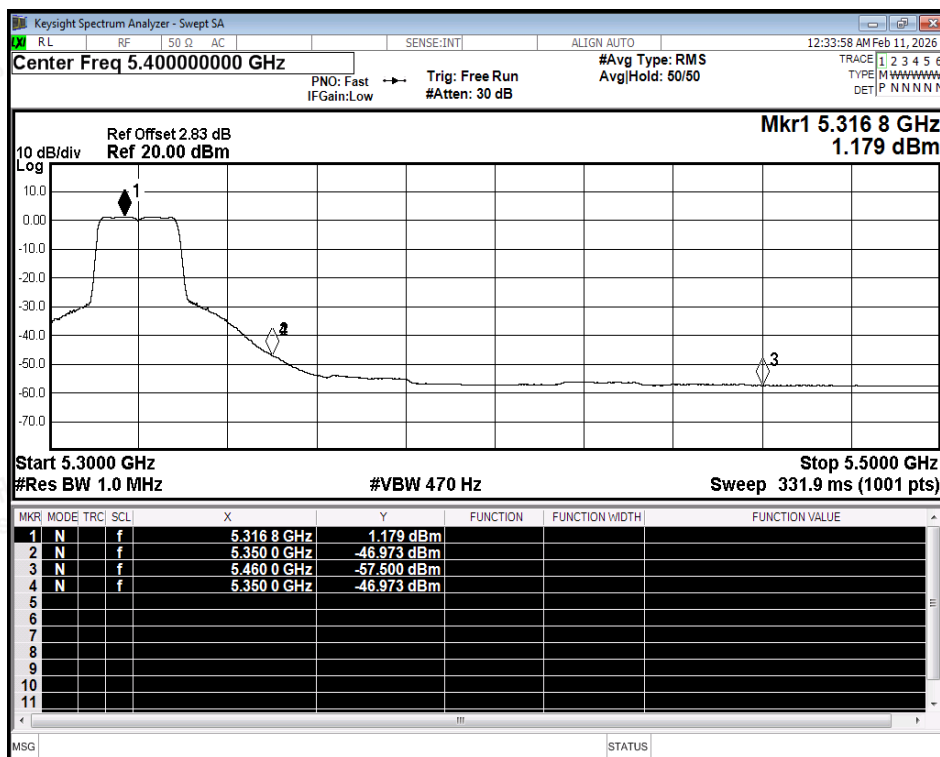

Restrict Band NVNT ac20 5320MHz Ant2 Average




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

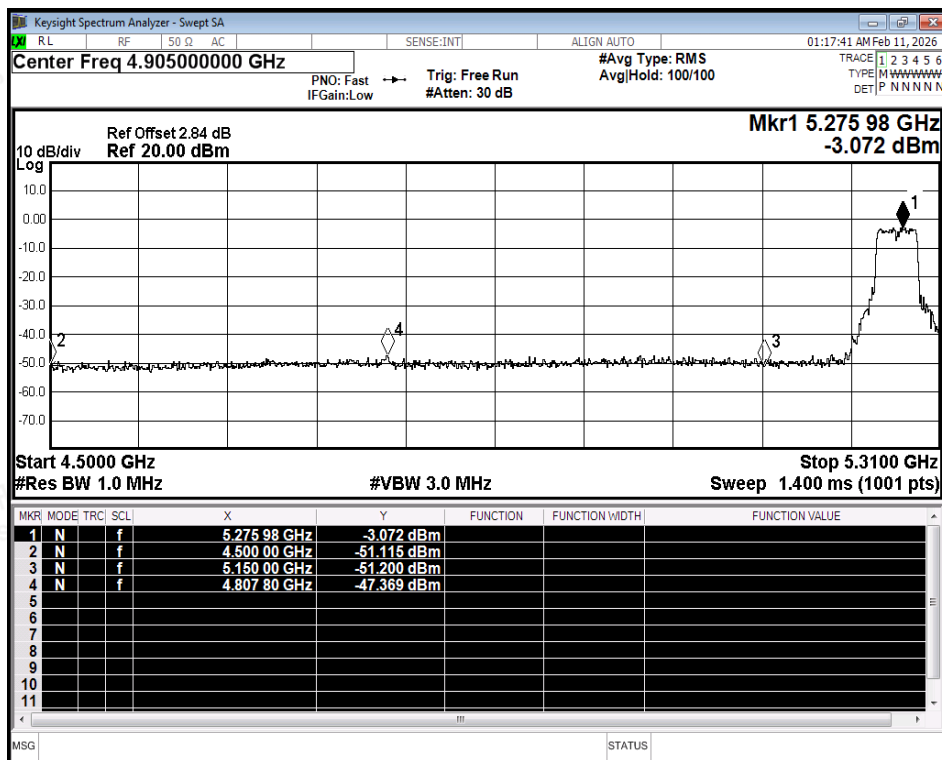

Restrict Band NVNT ac40 5270MHz Ant2 Peak

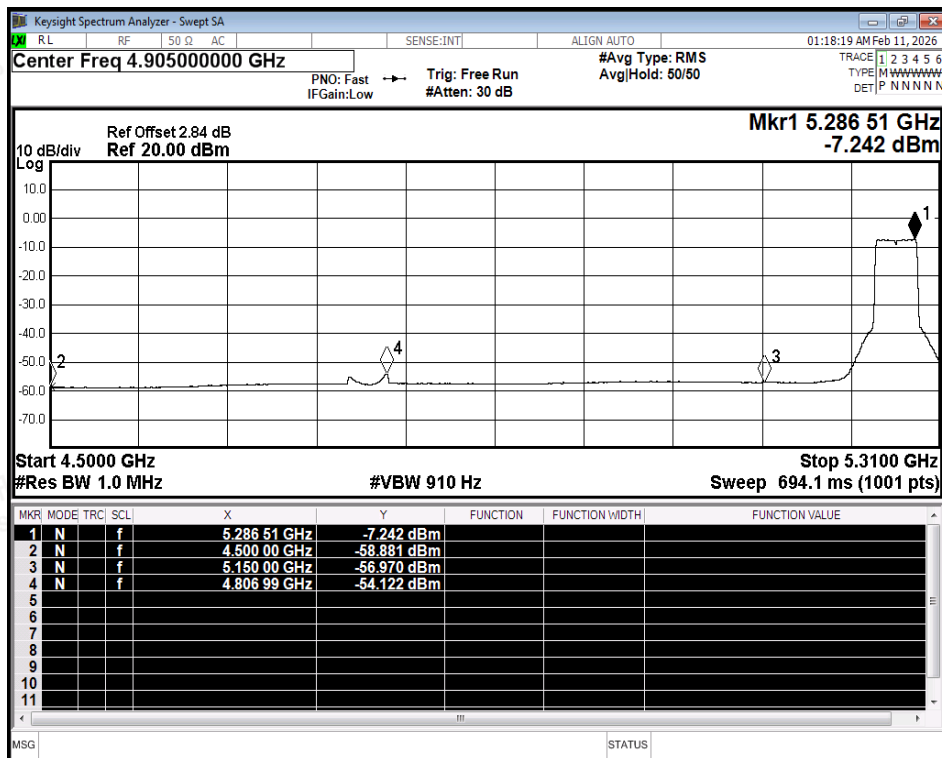

Restrict Band NVNT ac40 5270MHz Ant2 Average




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

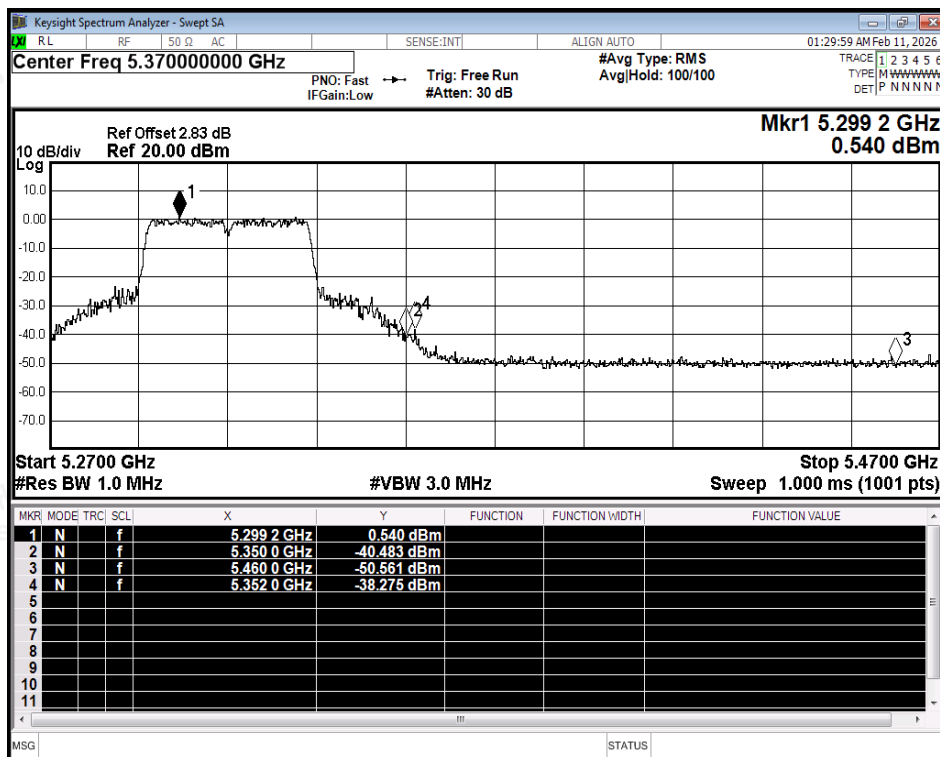

Restrict Band NVNT ac40 5310MHz Ant2 Peak

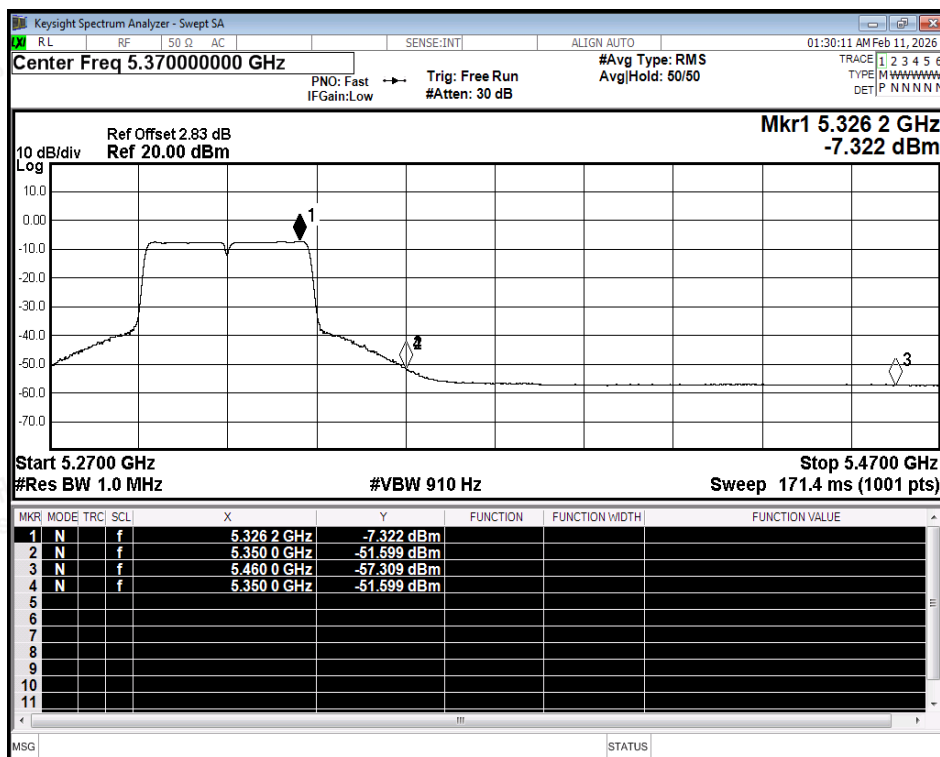

Restrict Band NVNT ac40 5310MHz Ant2 Average




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

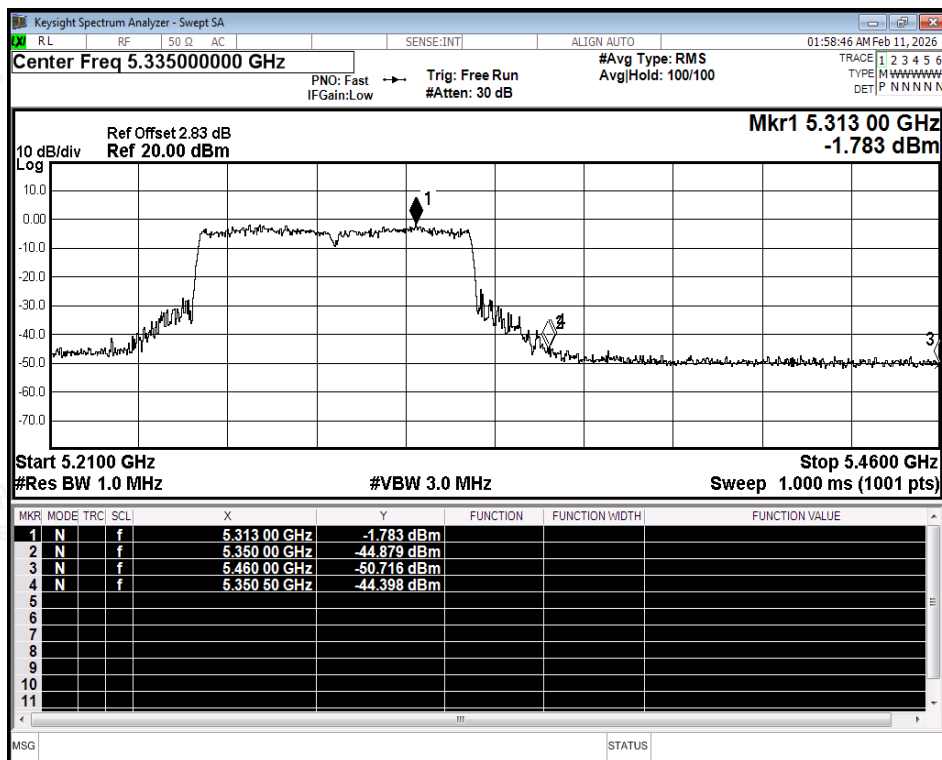

Restrict Band NVNT ac80 5290MHz Ant2 Peak

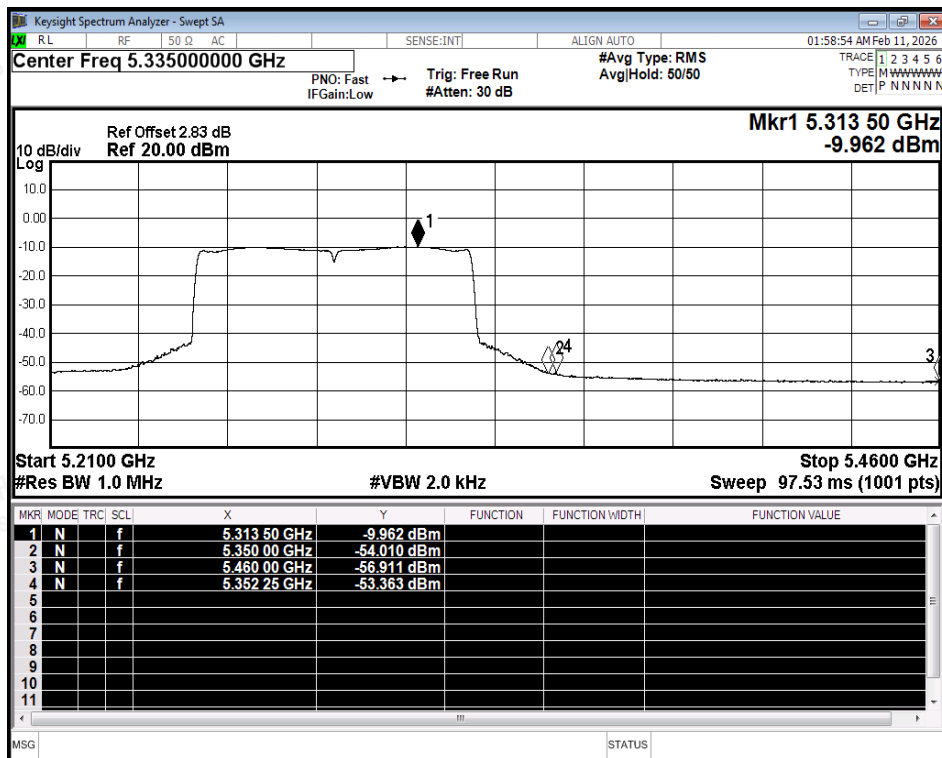

Restrict Band NVNT ac80 5290MHz Ant2 Average




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

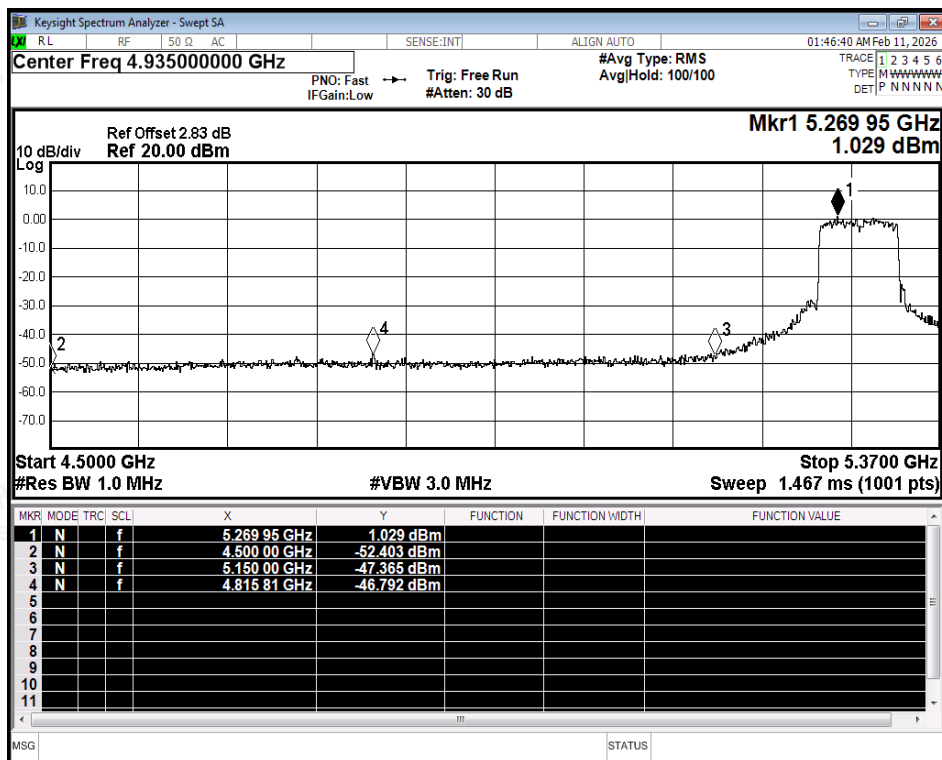

Restrict Band NVNT ac80 5290MHz Ant2 Peak

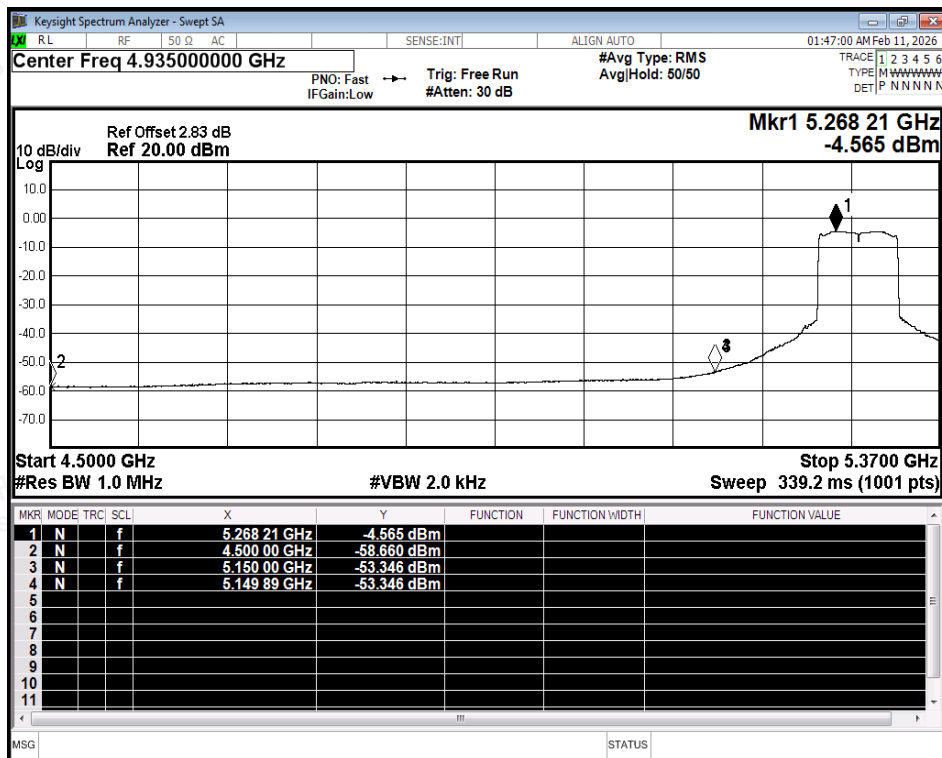

Restrict Band NVNT ac80 5290MHz Ant2 Average




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

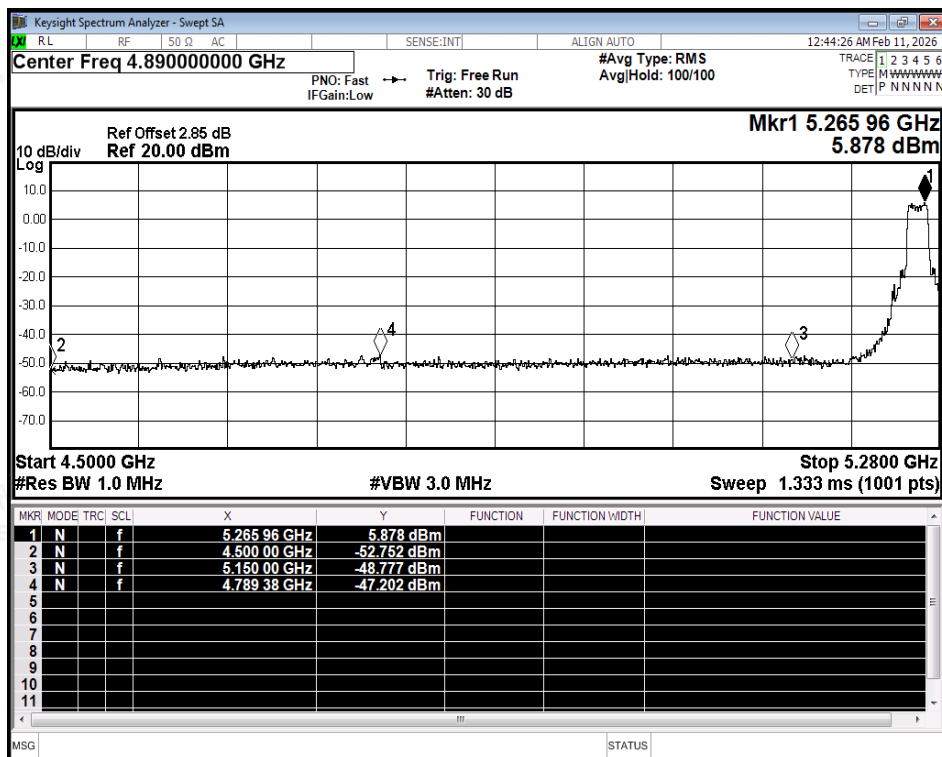

Restrict Band NVNT ax20 5260MHz Ant2 Peak

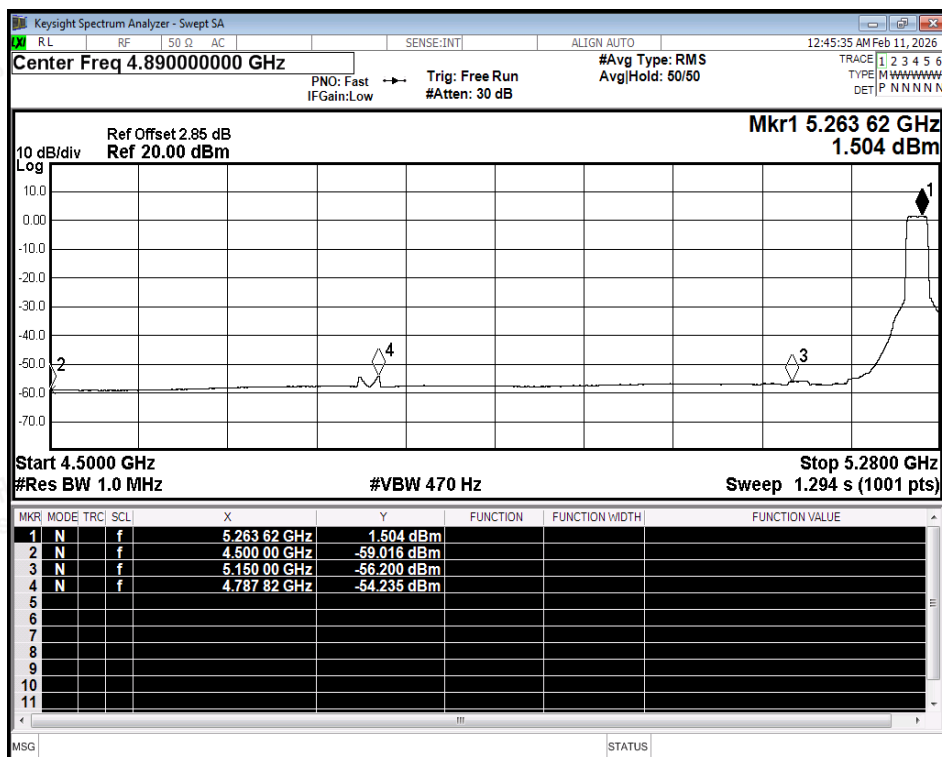

Restrict Band NVNT ax20 5260MHz Ant2 Average




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

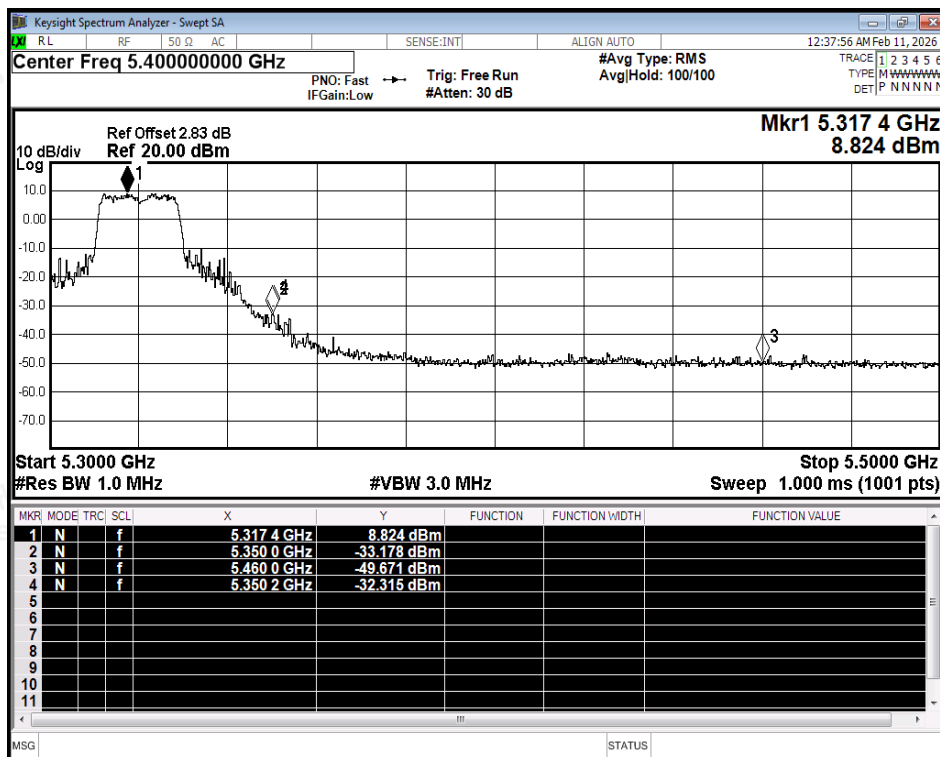

Restrict Band NVNT ax20 5320MHz Ant2 Peak

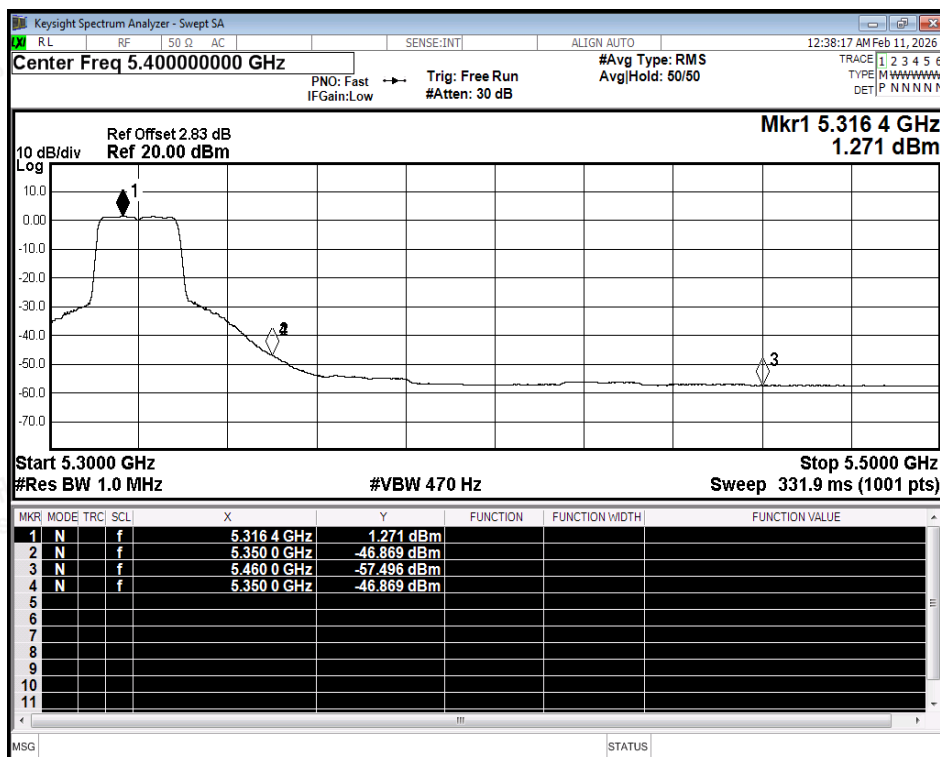

Restrict Band NVNT ax20 5320MHz Ant2 Average




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

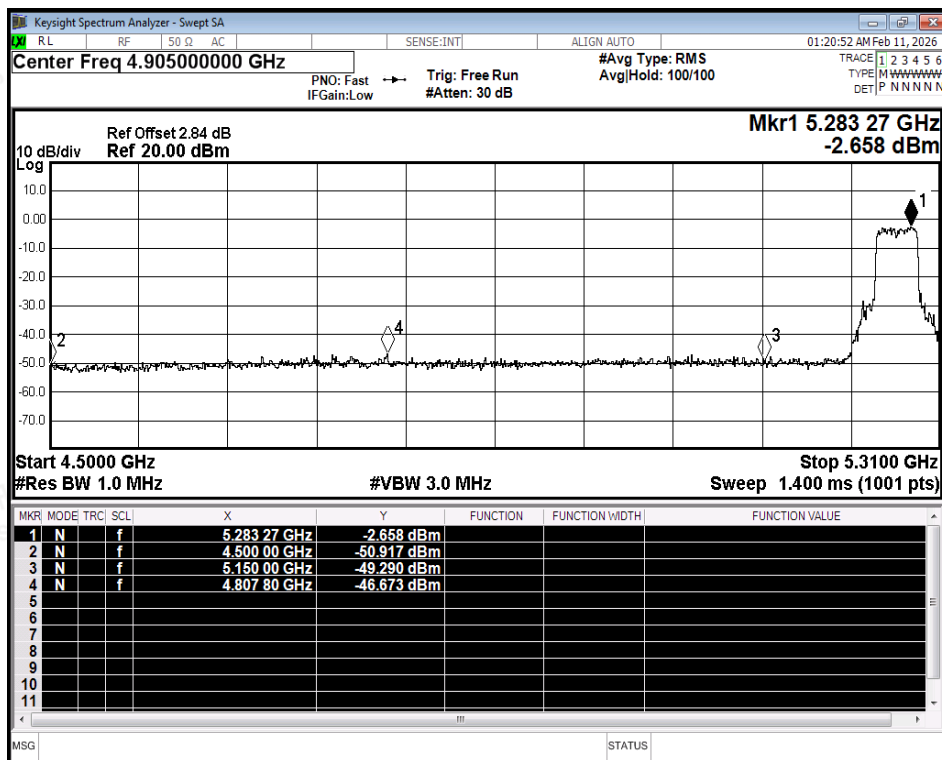

Restrict Band NVNT ax40 5270MHz Ant2 Peak

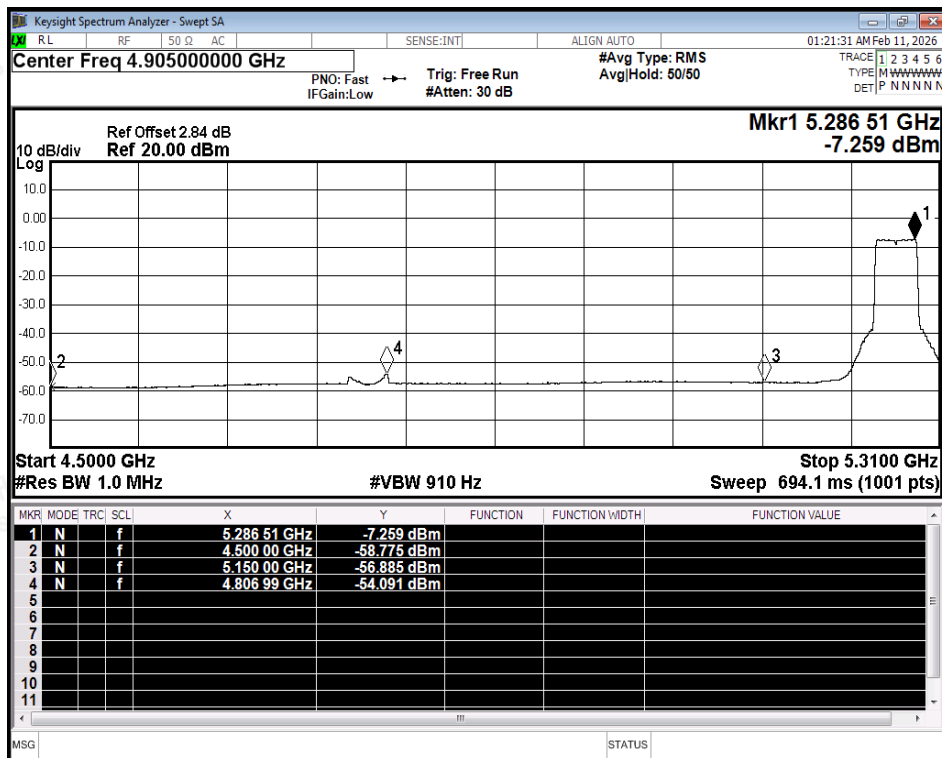

Restrict Band NVNT ax40 5270MHz Ant2 Average




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

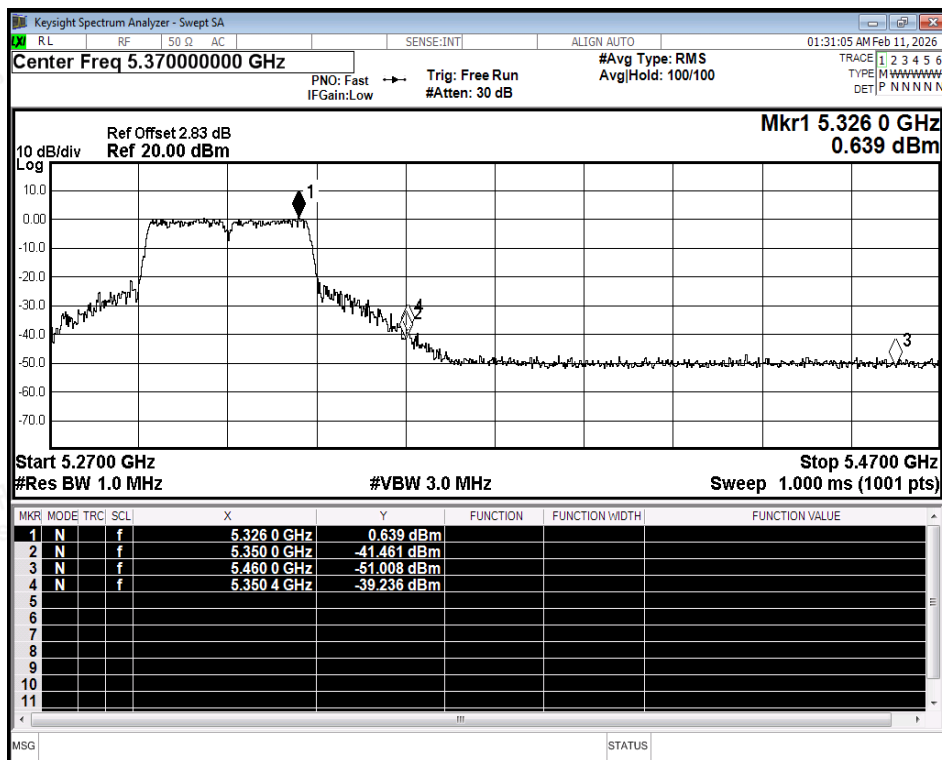

Restrict Band NVNT ax40 5310MHz Ant2 Peak

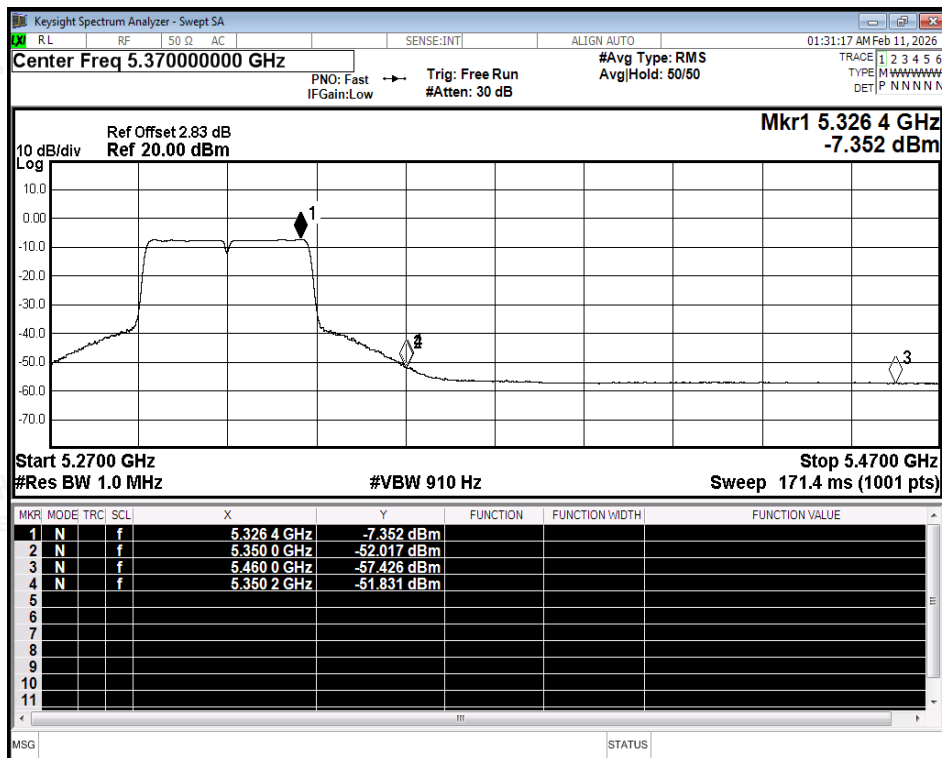

Restrict Band NVNT ax40 5310MHz Ant2 Average




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

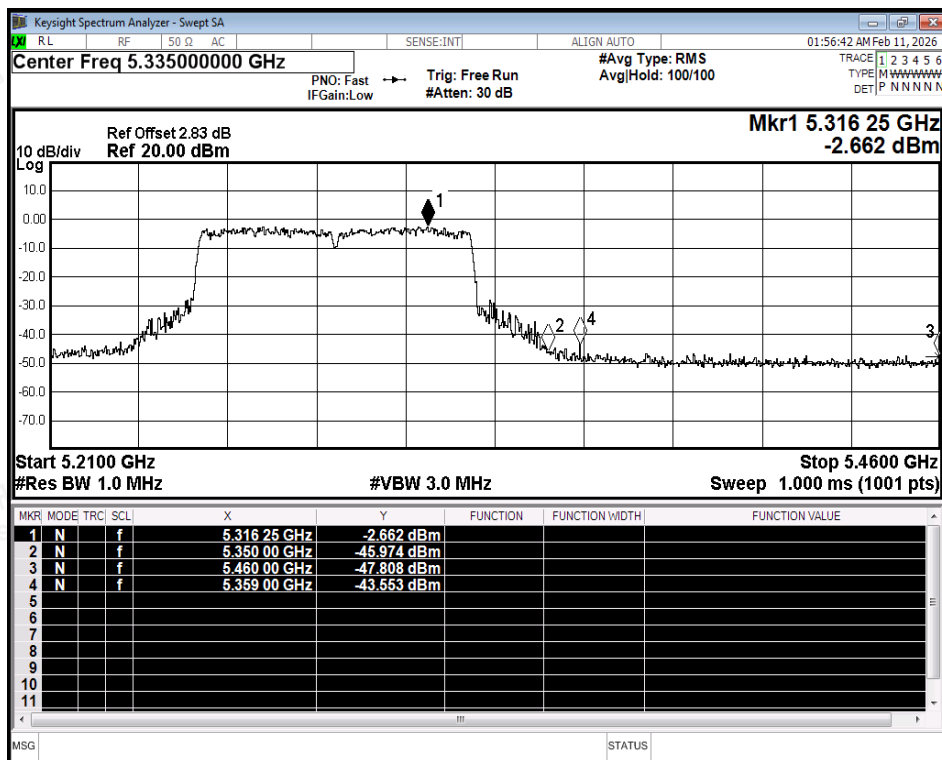

Restrict Band NVNT ax80 5290MHz Ant2 Peak

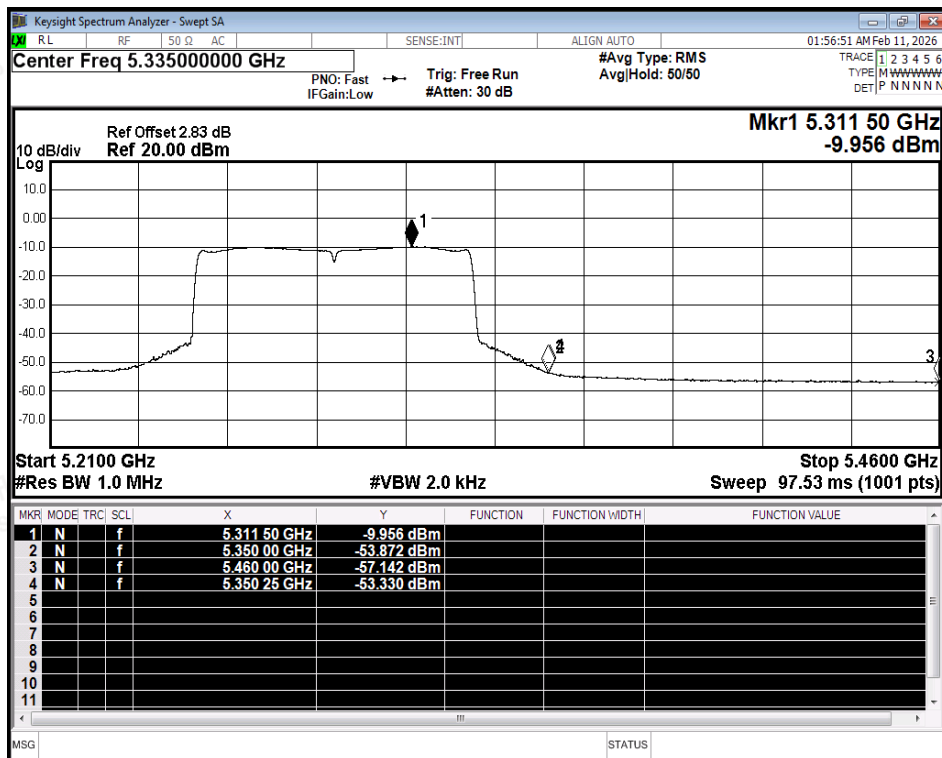

Restrict Band NVNT ax80 5290MHz Ant2 Average




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

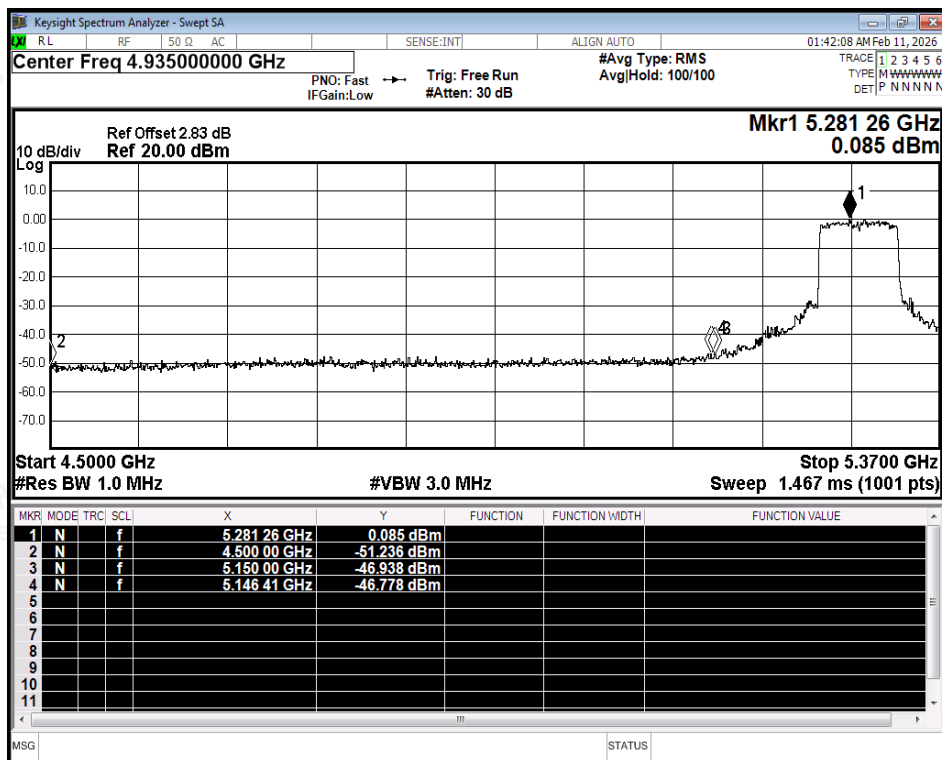

Restrict Band NVNT ax80 5290MHz Ant2 Peak

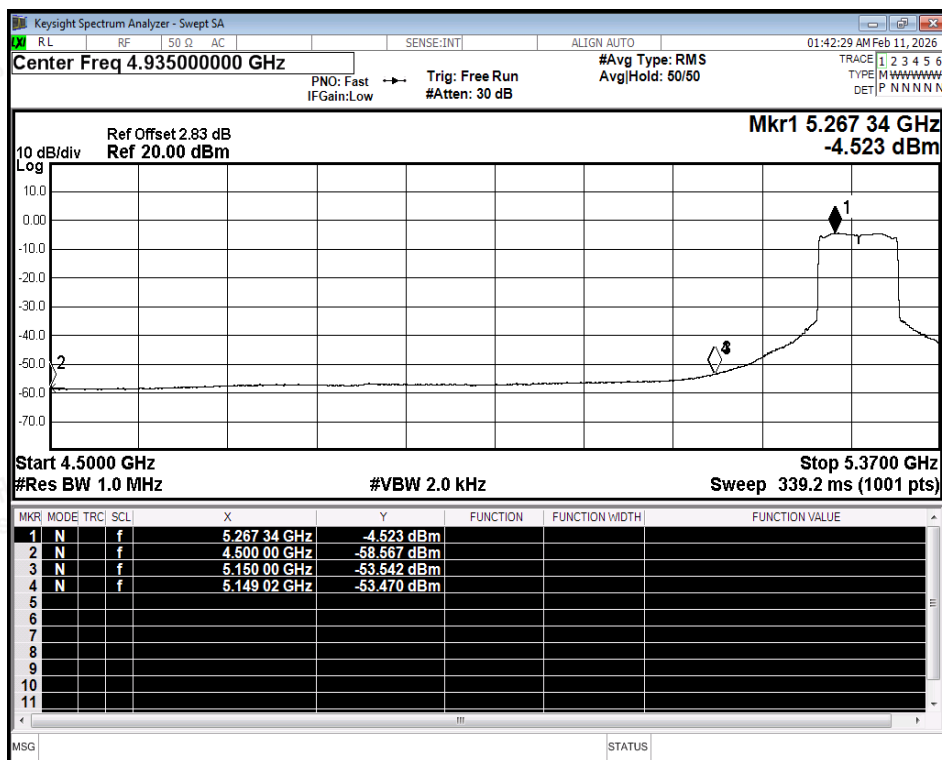

Restrict Band NVNT ax80 5290MHz Ant2 Average



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



MIMO

Condition	Mode	Frequency (MHz)	Spur Freq (MHz)	E (dBuV/m)			Detector	Limit (dBuV/m)	Verdict
				Ant1	Ant1	Ant1+ Ant2			
NVNT	n20	5260	4500	46.53	45.4	52.00	Peak	68.2	Pass
NVNT	n20	5260	4500	38.06	38.26	44.18	Average	54	Pass
NVNT	n20	5260	5097.48	49.91	51.23	56.62	Peak	68.2	Pass
NVNT	n20	5260	4787.82	43.95	42.9	49.46	Average	54	Pass
NVNT	n20	5260	5150	49.08	47.09	54.16	Peak	68.2	Pass
NVNT	n20	5260	5150	41.32	41.04	47.20	Average	54	Pass
NVNT	n20	5320	5350	63.78	60.08	68.15	Peak	68.2	Pass
NVNT	n20	5320	5350	44.84	48.14	52.67	Average	54	Pass
NVNT	n20	5320	5352.4	39.9	63.31	63.88	Peak	68.2	Pass
NVNT	n20	5320	5350	47.93	47.14	53.56	Average	54	Pass
NVNT	n20	5320	5460	64.45	45.37	65.37	Peak	68.2	Pass
NVNT	n20	5320	5460	51.93	39.75	53.84	Average	54	Pass
NVNT	n40	5270	4500	44.47	45.77	51.16	Peak	68.2	Pass
NVNT	n40	5270	4500	38.21	38.33	44.29	Average	54	Pass
NVNT	n40	5270	4774.59	50.92	52.19	57.60	Peak	68.2	Pass
NVNT	n40	5270	4806.99	45.73	46.47	52.13	Average	54	Pass
NVNT	n40	5270	5150	48.42	47.35	53.92	Peak	68.2	Pass
NVNT	n40	5270	5150	40.76	40.92	46.86	Average	54	Pass
NVNT	n40	5310	5350	63	55.22	65.97	Peak	68.2	Pass
NVNT	n40	5310	5350	49.93	45.19	53.90	Average	54	Pass
NVNT	n40	5310	5350.6	63.94	56.96	67.15	Peak	68.2	Pass
NVNT	n40	5310	5350.8	49.43	45.57	53.73	Average	54	Pass
NVNT	n40	5310	5460	47.44	47.08	53.28	Peak	68.2	Pass
NVNT	n40	5310	5460	39.93	39.92	45.95	Average	54	Pass
NVNT	ac20	5260	4500	44.57	45.32	50.97	Peak	68.2	Pass
NVNT	ac20	5260	4500	38.18	38.23	44.23	Average	54	Pass
NVNT	ac20	5260	5132.58	50.7	50.99	56.87	Peak	68.2	Pass
NVNT	ac20	5260	4787.82	42.51	42.83	48.69	Average	54	Pass
NVNT	ac20	5260	5150	47.38	49.05	54.28	Peak	68.2	Pass
NVNT	ac20	5260	5150	40.88	41.02	46.97	Average	54	Pass
NVNT	ac20	5320	5350	57.83	61	65.58	Peak	68.2	Pass
NVNT	ac20	5320	5350	47.95	47.26	53.63	Average	54	Pass
NVNT	ac20	5320	5350.2	61.92	61.45	67.71	Peak	68.2	Pass
NVNT	ac20	5320	5350	47.95	47.26	53.63	Average	54	Pass
NVNT	ac20	5320	5460	45.34	47.13	52.30	Peak	68.2	Pass
NVNT	ac20	5320	5460	39.89	39.73	45.83	Average	54	Pass
NVNT	ac40	5270	4500	46.64	46.12	52.40	Peak	68.2	Pass



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



NVNT	ac40	5270	4500	38.25	38.35	44.32	Average	54	Pass
NVNT	ac40	5270	4807.8	50.77	49.87	56.35	Peak	68.2	Pass
NVNT	ac40	5270	4806.99	45.64	43.11	50.49	Average	54	Pass
NVNT	ac40	5270	5150	48.19	47.63	53.94	Peak	68.2	Pass
NVNT	ac40	5270	5150	40.57	40.27	46.44	Average	54	Pass
NVNT	ac40	5310	5350	64.52	56.75	67.50	Peak	68.2	Pass
NVNT	ac40	5310	5350	47.93	45.64	52.88	Average	54	Pass
NVNT	ac40	5310	5352	64.52	58.96	68.20	Peak	68.2	Pass
NVNT	ac40	5310	5350	49.01	45.64	53.51	Average	54	Pass
NVNT	ac40	5310	5460	46.43	46.67	52.57	Peak	68.2	Pass
NVNT	ac40	5310	5460	40.01	39.93	45.99	Average	54	Pass
NVNT	ac80	5290	5350	49.28	52.36	56.98	Peak	68.2	Pass
NVNT	ac80	5290	5350	42.24	43.23	48.77	Average	54	Pass
NVNT	ac80	5290	5350.5	52.2	52.84	58.55	Peak	68.2	Pass
NVNT	ac80	5290	5352.25	42.38	43.87	49.18	Average	54	Pass
NVNT	ac80	5290	5460	46.41	46.52	52.49	Peak	68.2	Pass
NVNT	ac80	5290	5460	40.27	40.32	46.32	Average	54	Pass
NVNT	ac80	5290	4500	45.41	44.83	51.15	Peak	68.2	Pass
NVNT	ac80	5290	4500	38.49	38.58	44.56	Average	54	Pass
NVNT	ac80	5290	4815.81	50.38	50.44	56.43	Peak	68.2	Pass
NVNT	ac80	5290	5149.89	42.9	43.89	49.43	Average	54	Pass
NVNT	ac80	5290	5150	47.2	48.74	54.02	Peak	68.2	Pass
NVNT	ac80	5290	5150	42.87	43.71	49.32	Average	54	Pass
NVNT	ax20	5260	4500	44.71	44.48	50.62	Peak	68.2	Pass
NVNT	ax20	5260	4500	38.13	38.22	44.20	Average	54	Pass
NVNT	ax20	5260	4789.38	50.23	50.03	56.15	Peak	68.2	Pass
NVNT	ax20	5260	4787.82	43.09	43	49.07	Average	54	Pass
NVNT	ax20	5260	5150	47.16	48.34	53.79	Peak	68.2	Pass
NVNT	ax20	5260	5150	41.04	41.28	47.18	Average	54	Pass
NVNT	ax20	5320	5350	62.09	62.06	68.10	Peak	68.2	Pass
NVNT	ax20	5320	5350	47.86	47.37	53.64	Average	54	Pass
NVNT	ax20	5320	5350.2	61.96	61.92	67.96	Peak	68.2	Pass
NVNT	ax20	5320	5350	47.92	47.37	53.67	Average	54	Pass
NVNT	ax20	5320	5460	46.88	47.56	53.25	Peak	68.2	Pass
NVNT	ax20	5320	5460	39.87	39.74	45.83	Average	54	Pass
NVNT	ax40	5270	4500	45.05	46.32	51.73	Peak	68.2	Pass
NVNT	ax40	5270	4500	38.32	38.46	44.41	Average	54	Pass
NVNT	ax40	5270	4807.8	52.32	50.56	57.51	Peak	68.2	Pass
NVNT	ax40	5270	4806.99	47.09	43.14	51.36	Average	54	Pass
NVNT	ax40	5270	5150	48.26	47.41	53.87	Peak	68.2	Pass
NVNT	ax40	5270	5150	40.87	40.29	46.61	Average	54	Pass



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



NVNT	ax40	5310	5350	58.97	55.77	63.54	Peak	68.2	Pass
NVNT	ax40	5310	5350	48.36	45.22	52.95	Average	54	Pass
NVNT	ax40	5310	5350.4	61.64	58	66.03	Peak	68.2	Pass
NVNT	ax40	5310	5350.2	48.53	45.4	53.13	Average	54	Pass
NVNT	ax40	5310	5460	48.47	46.23	53.44	Peak	68.2	Pass
NVNT	ax40	5310	5460	39.97	39.81	45.91	Average	54	Pass
NVNT	ax80	5290	5350	53.79	51.26	58.64	Peak	68.2	Pass
NVNT	ax80	5290	5350	46.97	43.36	51.37	Average	54	Pass
NVNT	ax80	5290	5359	58.7	53.68	62.57	Peak	68.2	Pass
NVNT	ax80	5290	5350.25	47.3	43.91	51.79	Average	54	Pass
NVNT	ax80	5290	5460	47.81	49.43	54.68	Peak	68.2	Pass
NVNT	ax80	5290	5460	40.69	40.09	46.42	Average	54	Pass
NVNT	ax80	5290	4500	44.99	46	51.53	Peak	68.2	Pass
NVNT	ax80	5290	4500	38.76	38.67	44.74	Average	54	Pass
NVNT	ax80	5290	5146.41	50.08	50.46	56.29	Peak	68.2	Pass
NVNT	ax80	5290	5149.02	41.71	43.76	48.82	Average	54	Pass
NVNT	ax80	5290	5150	48.15	50.27	55.30	Peak	68.2	Pass
NVNT	ax80	5290	5150	41.77	43.64	48.78	Average	54	Pass



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity




B.5 Frequency Stability

Condition	Mode	Frequency (MHz)	Antenna	Measured Frequency (MHz)	Frequency Error (Hz)	Deviation (ppm)	Limit (ppm)	Verdict
NVNT	a	5260	Ant1	5259.98	-20000	-3.8	25	Pass
NVNT	a	5280	Ant1	5279.98	-20000	-3.79	25	Pass
NVNT	a	5320	Ant1	5319.98	-20000	-3.76	25	Pass
NVNT	n20	5260	Ant1	5260	0	0	25	Pass
NVNT	n20	5280	Ant1	5279.98	-20000	-3.79	25	Pass
NVNT	n20	5320	Ant1	5319.96	-40000	-7.52	25	Pass
NVNT	n40	5270	Ant1	5270	0	0	25	Pass
NVNT	n40	5310	Ant1	5309.96	-40000	-7.53	25	Pass
NVNT	ac20	5260	Ant1	5259.98	-20000	-3.8	25	Pass
NVNT	ac20	5280	Ant1	5279.98	-20000	-3.79	25	Pass
NVNT	ac20	5320	Ant1	5319.98	-20000	-3.76	25	Pass
NVNT	ac40	5270	Ant1	5270	0	0	25	Pass
NVNT	ac40	5310	Ant1	5310	0	0	25	Pass
NVNT	ac80	5290	Ant1	5290	0	0	25	Pass
NVNT	ax20	5260	Ant1	5260.02	20000	3.8	25	Pass
NVNT	ax20	5280	Ant1	5279.98	-20000	-3.79	25	Pass
NVNT	ax20	5320	Ant1	5319.98	-20000	-3.76	25	Pass
NVNT	ax40	5270	Ant1	5270	0	0	25	Pass
NVNT	ax40	5310	Ant1	5310	0	0	25	Pass
NVNT	ax80	5290	Ant1	5290	0	0	25	Pass



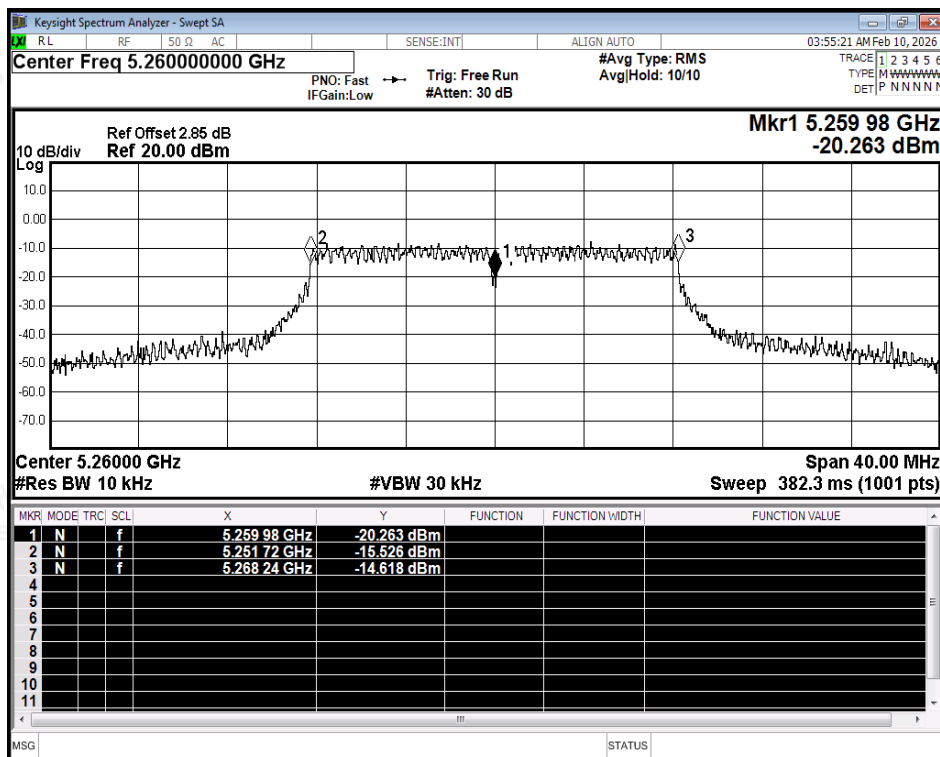

Freq. Stability NVNT a 5260MHz Ant1

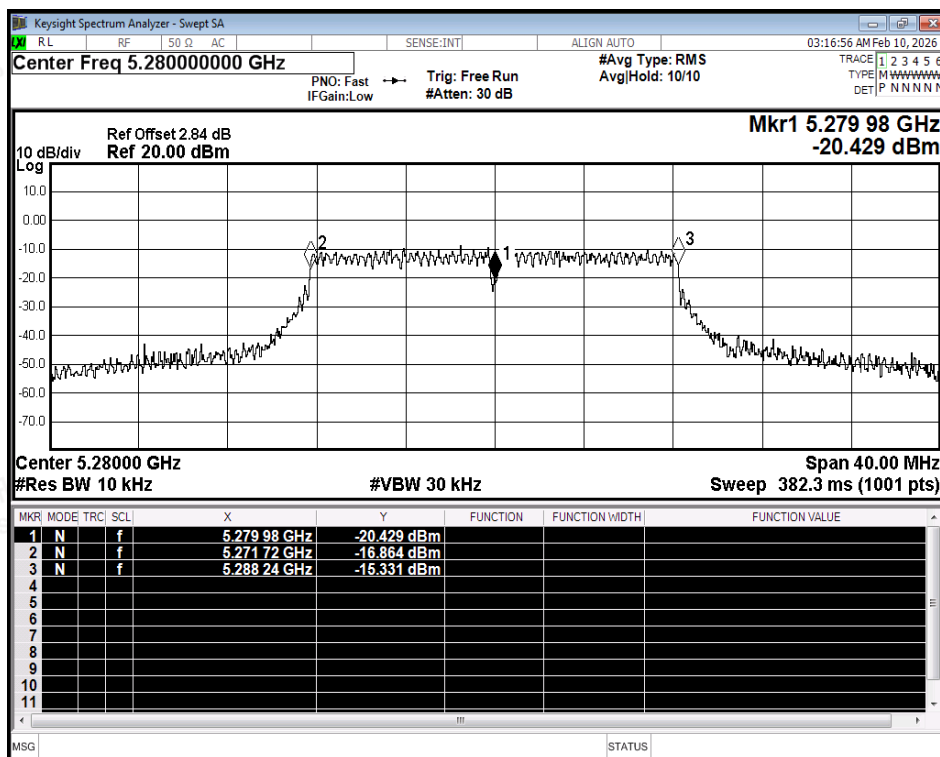

Freq. Stability NVNT a 5280MHz Ant1




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

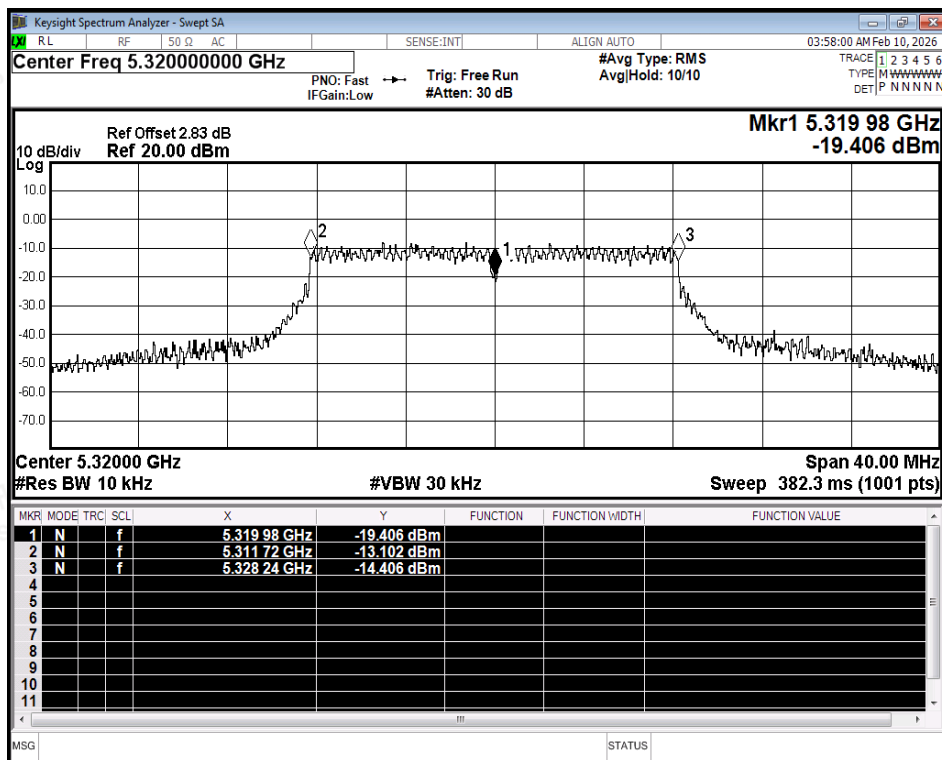

Freq. Stability NVNT a 5320MHz Ant1

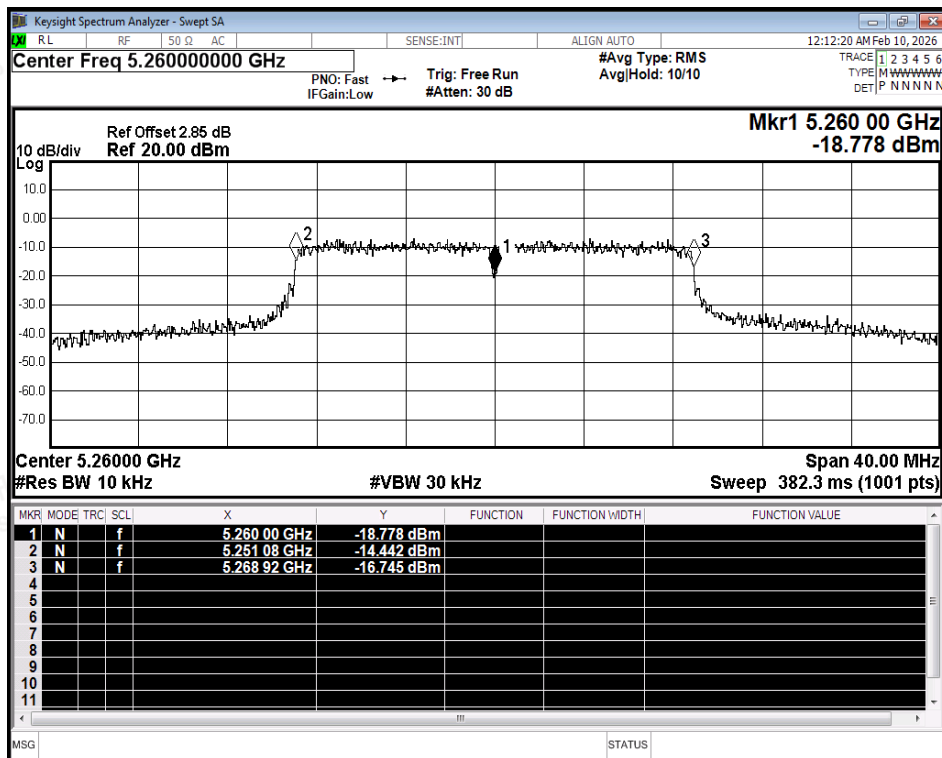

Freq. Stability NVNT n20 5260MHz Ant1




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

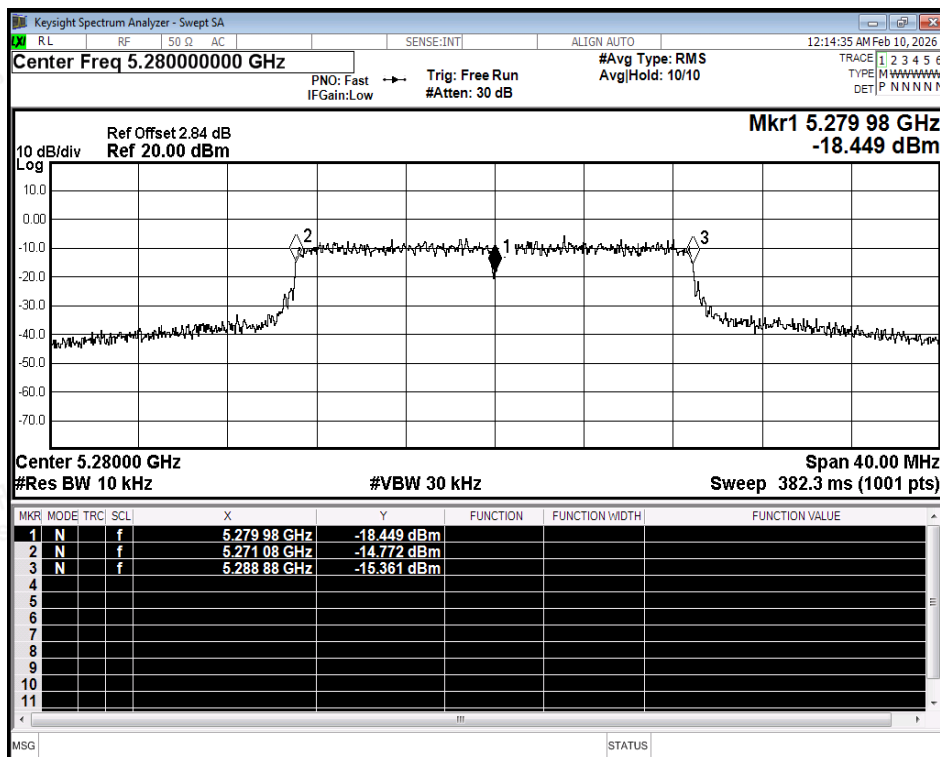

Freq. Stability NVNT n20 5280MHz Ant1

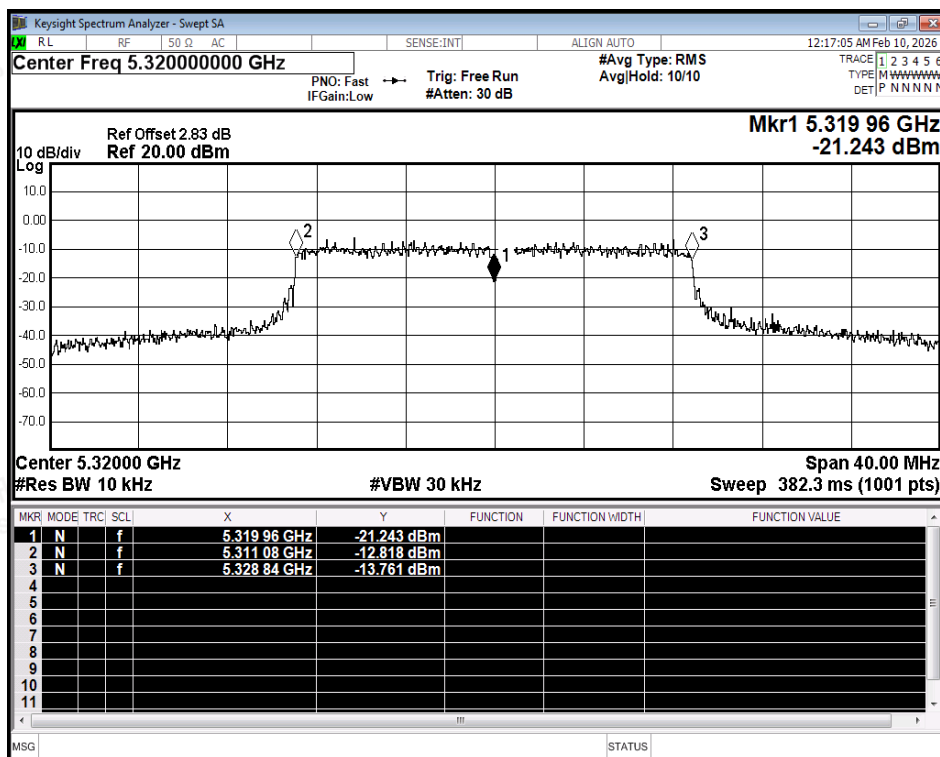

Freq. Stability NVNT n20 5320MHz Ant1




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

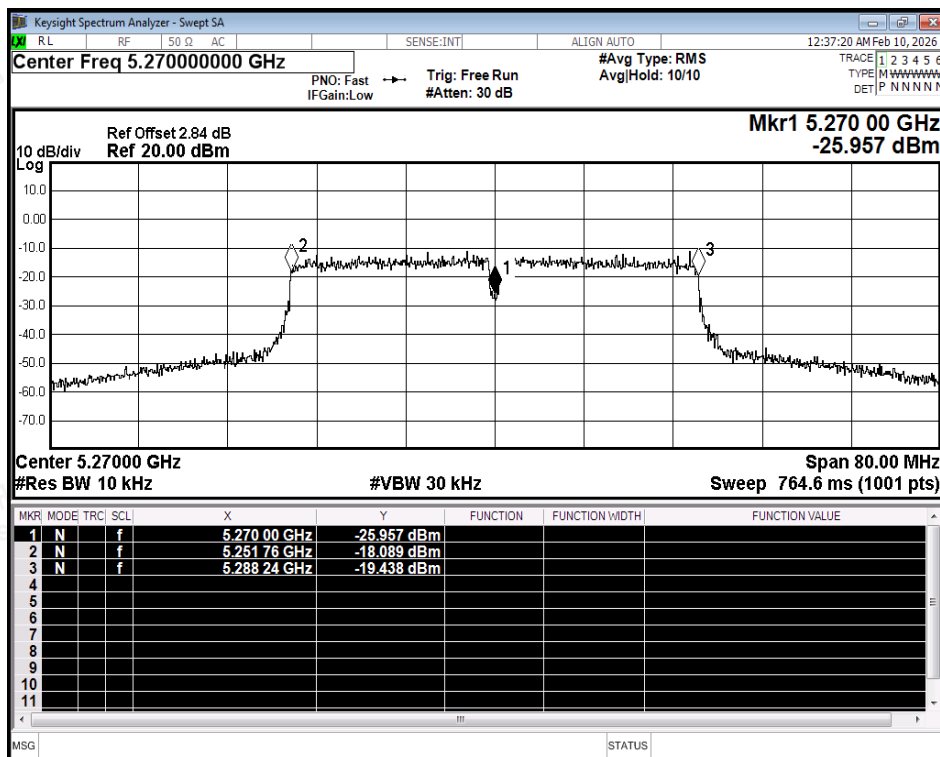

Freq. Stability NVNT n40 5270MHz Ant1

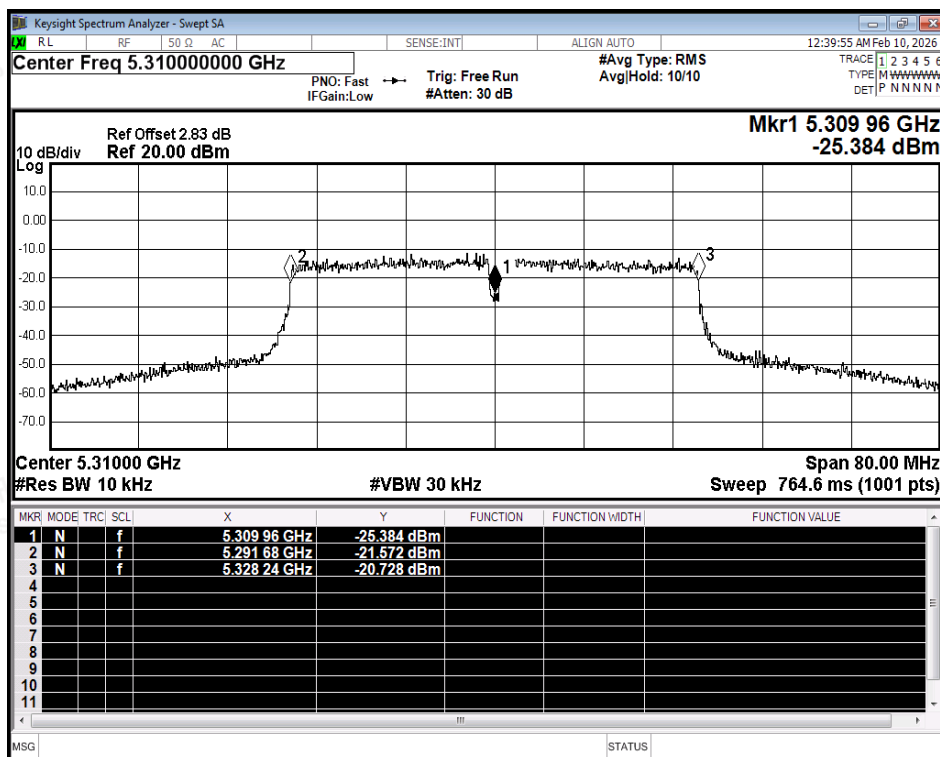

Freq. Stability NVNT n40 5310MHz Ant1




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

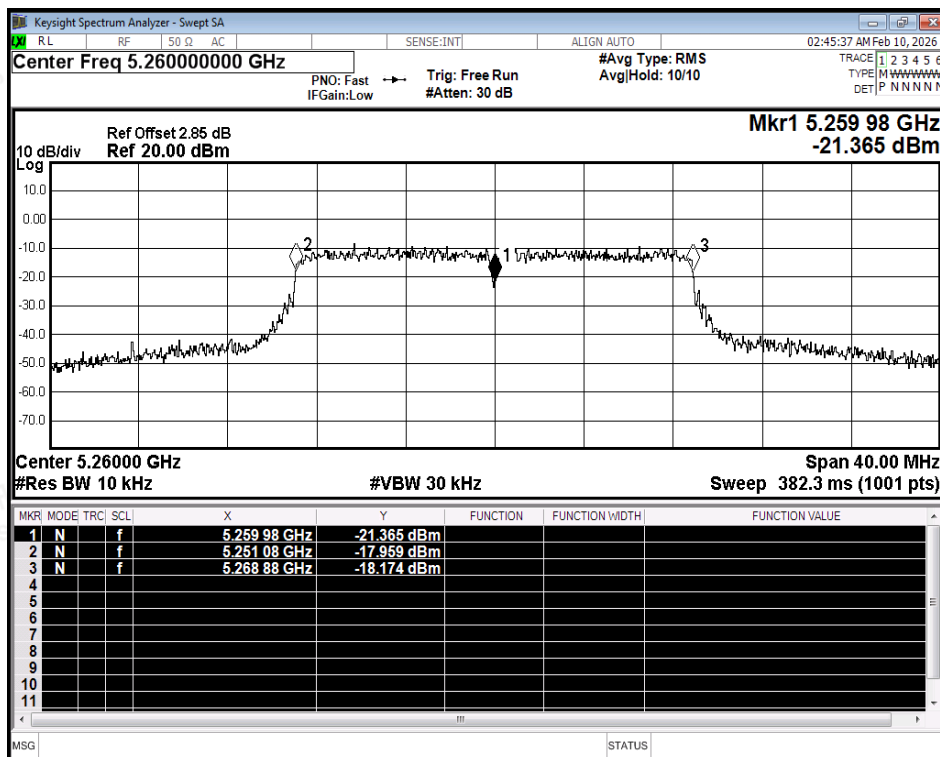

Freq. Stability NVNT ac20 5260MHz Ant1

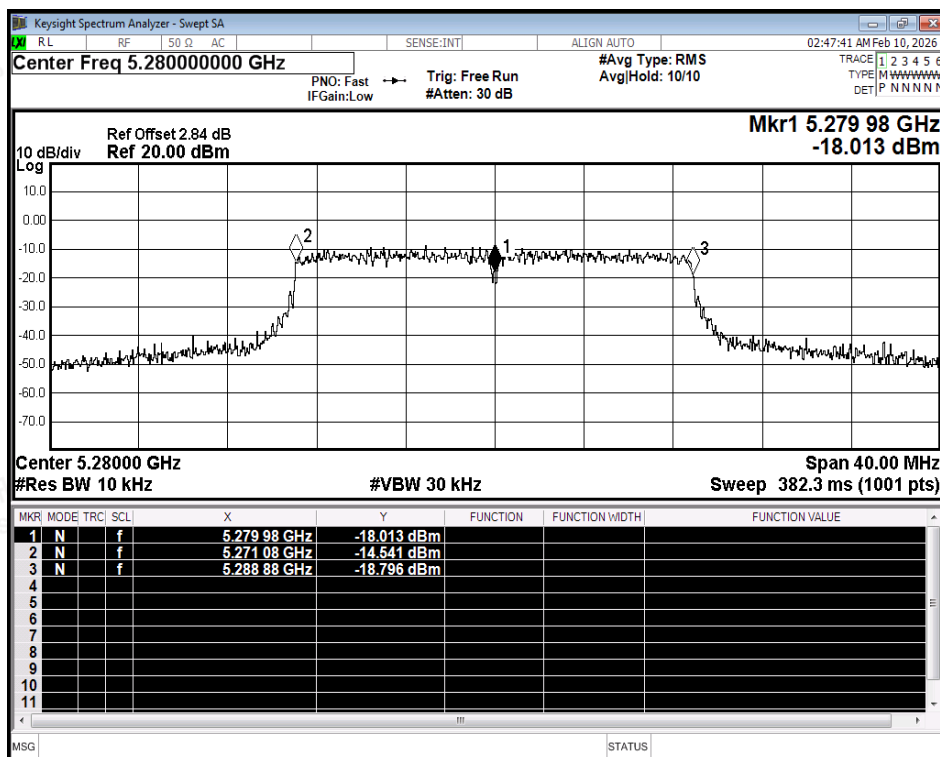

Freq. Stability NVNT ac20 5280MHz Ant1




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

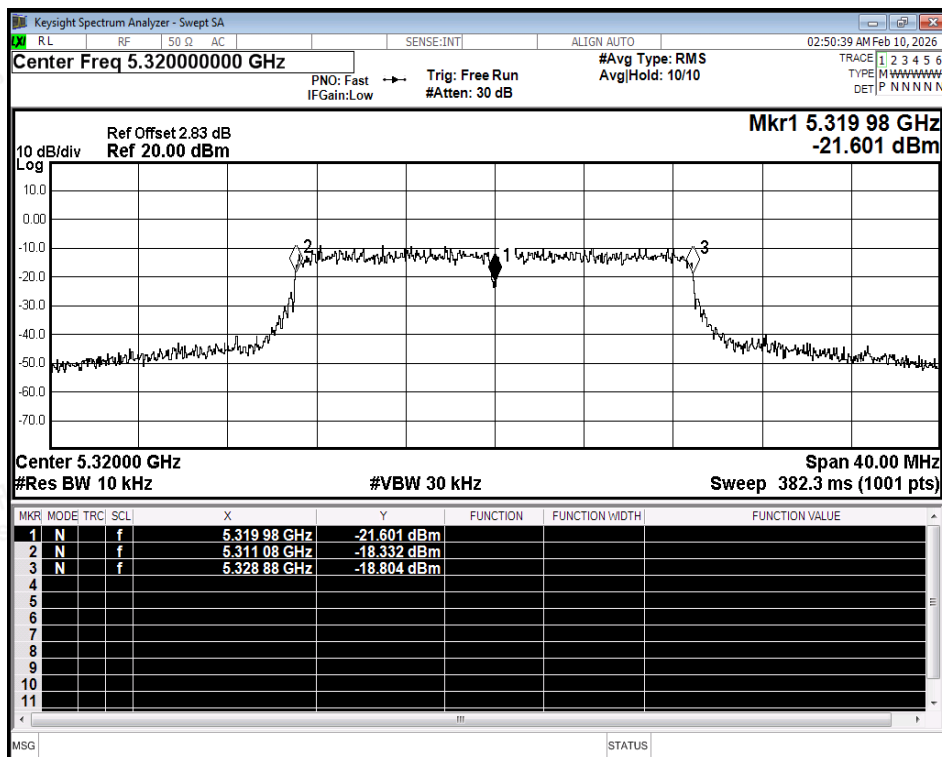

Freq. Stability NVNT ac20 5320MHz Ant1

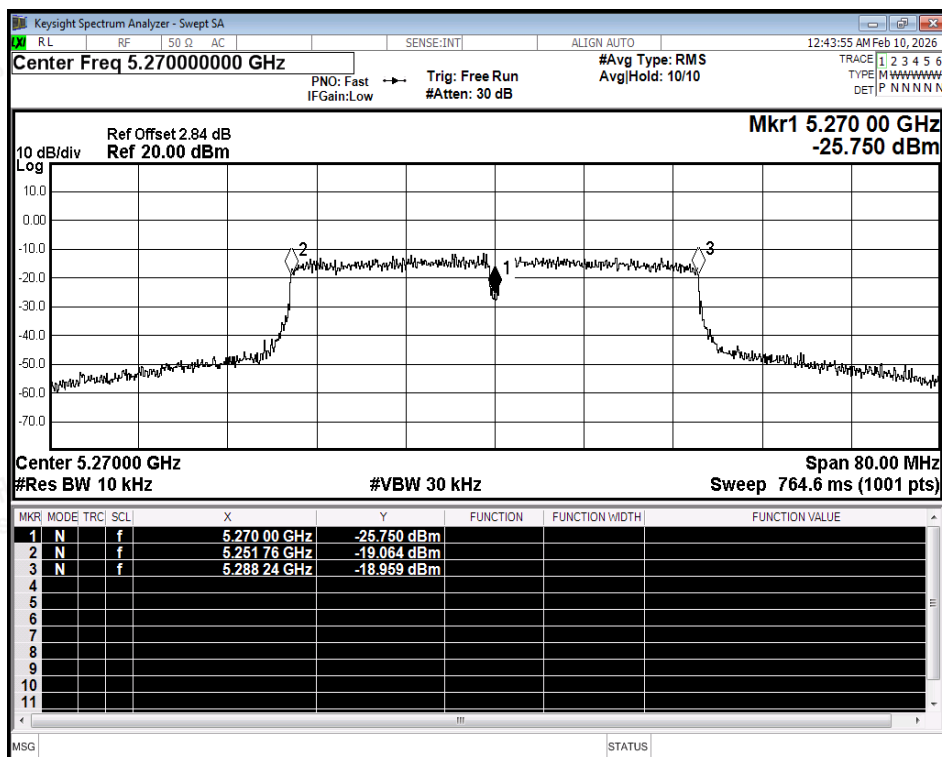

Freq. Stability NVNT ac40 5270MHz Ant1




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

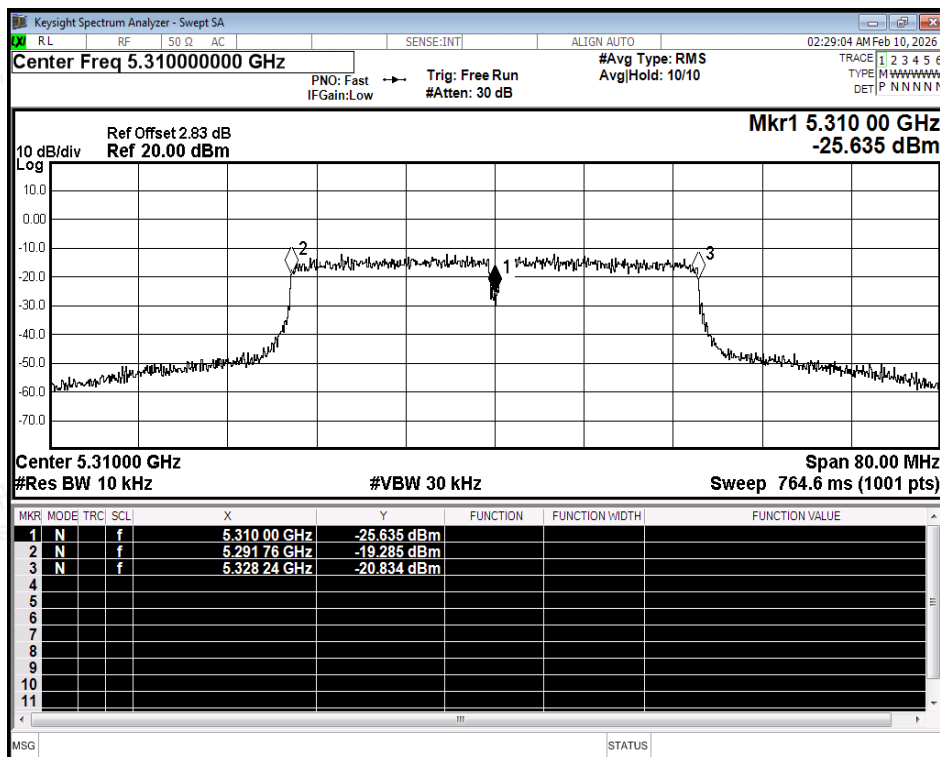

Freq. Stability NVNT ac40 5310MHz Ant1

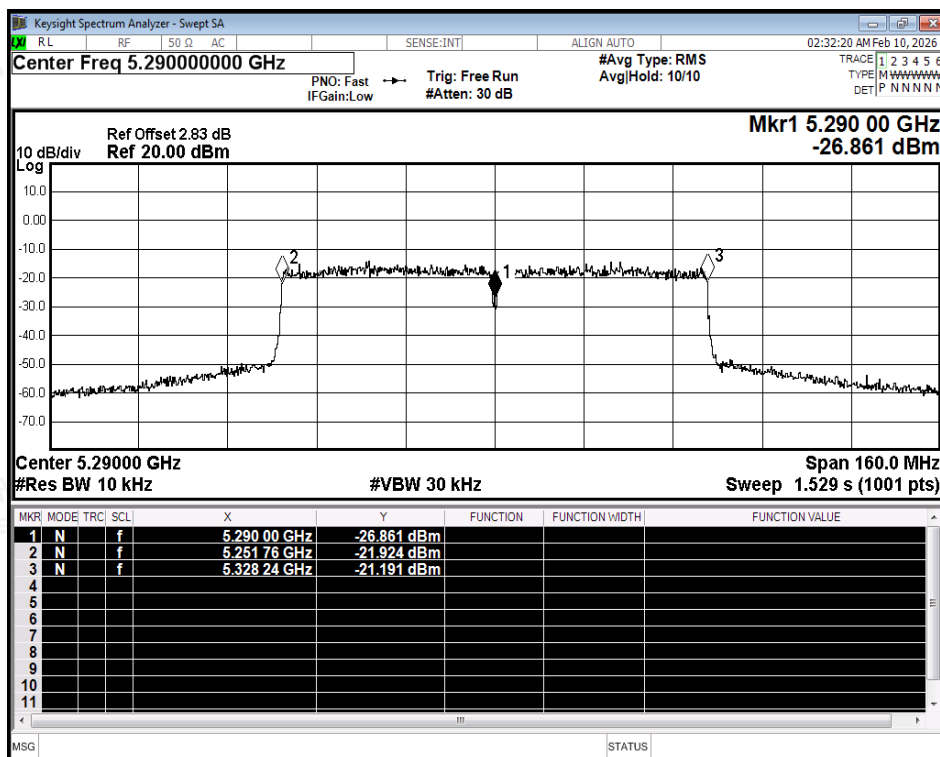

Freq. Stability NVNT ac80 5290MHz Ant1




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

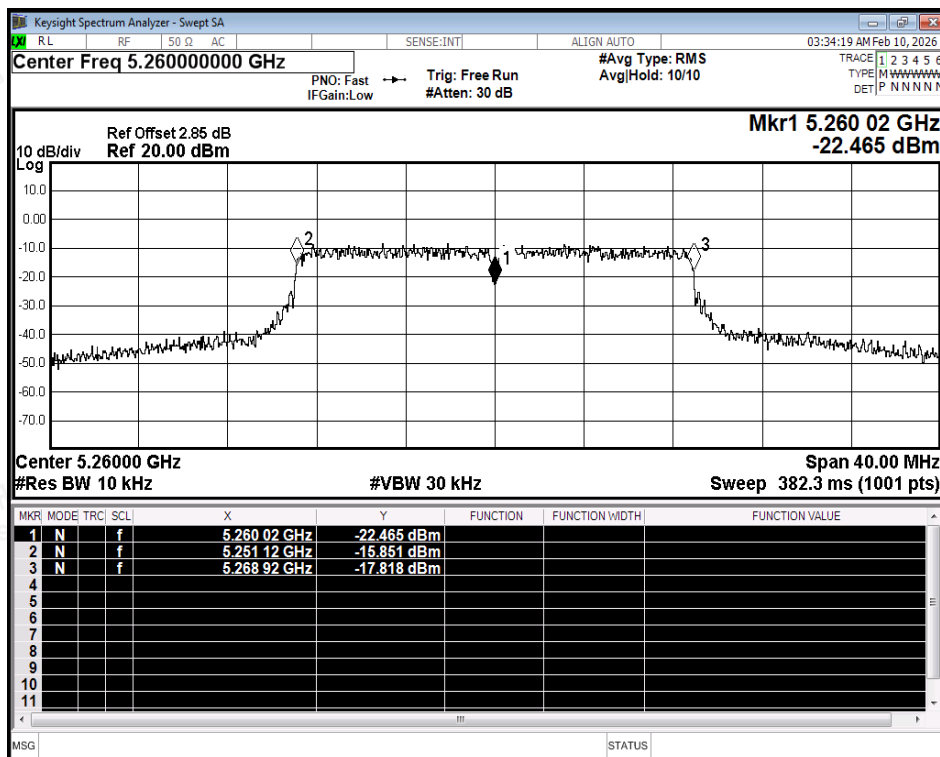

Freq. Stability NVNT ax20 5260MHz Ant1

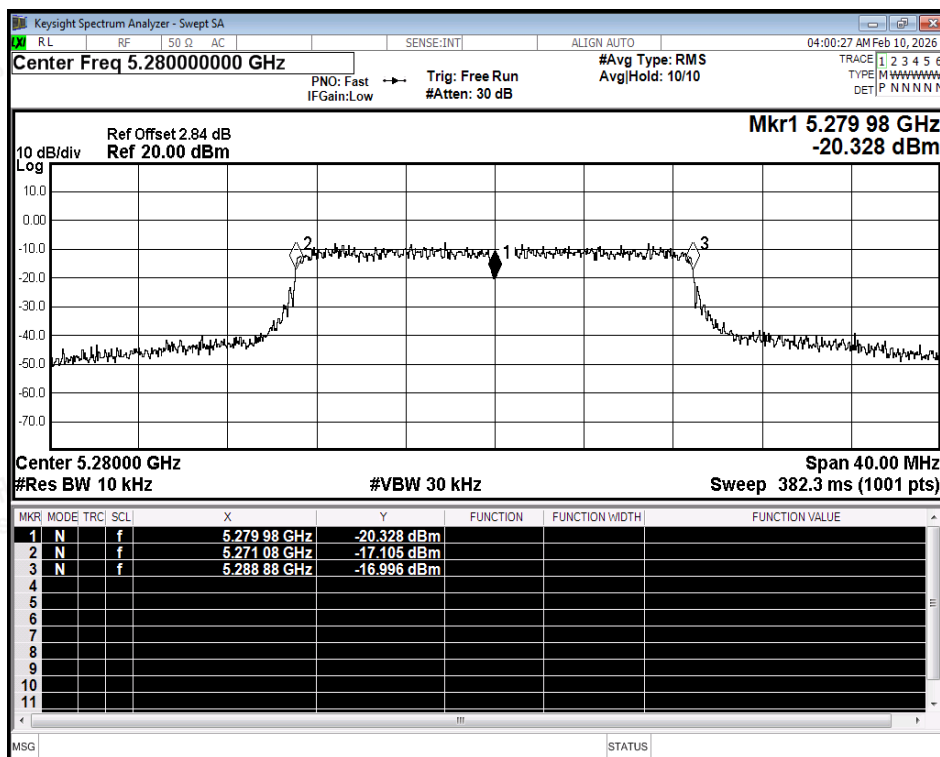

Freq. Stability NVNT ax20 5280MHz Ant1




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

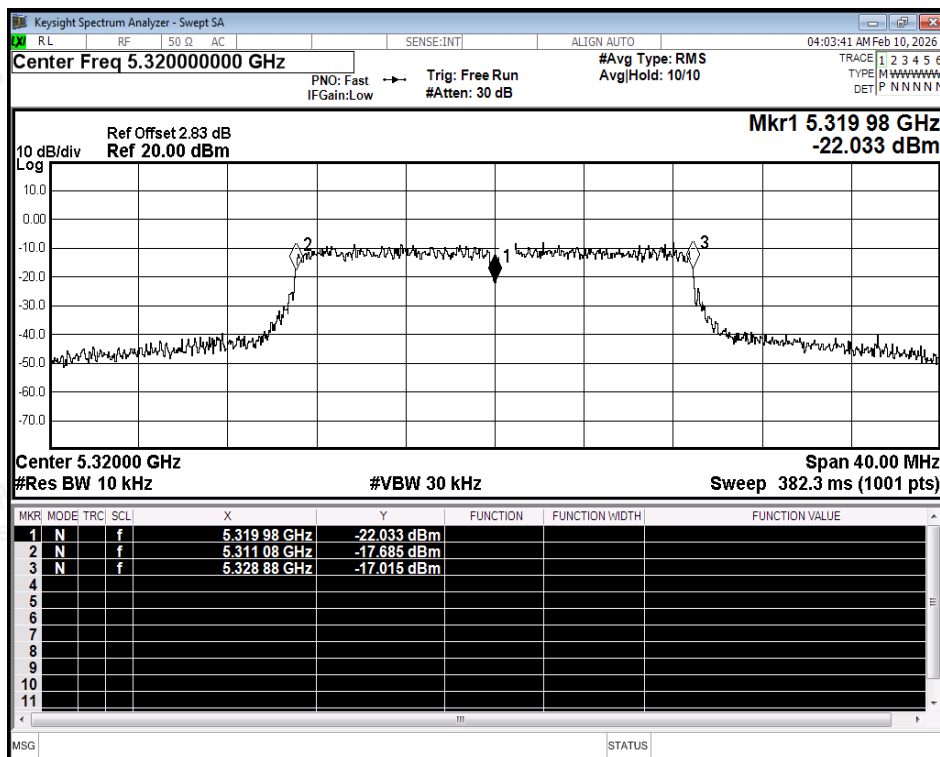

Freq. Stability NVNT ax20 5320MHz Ant1

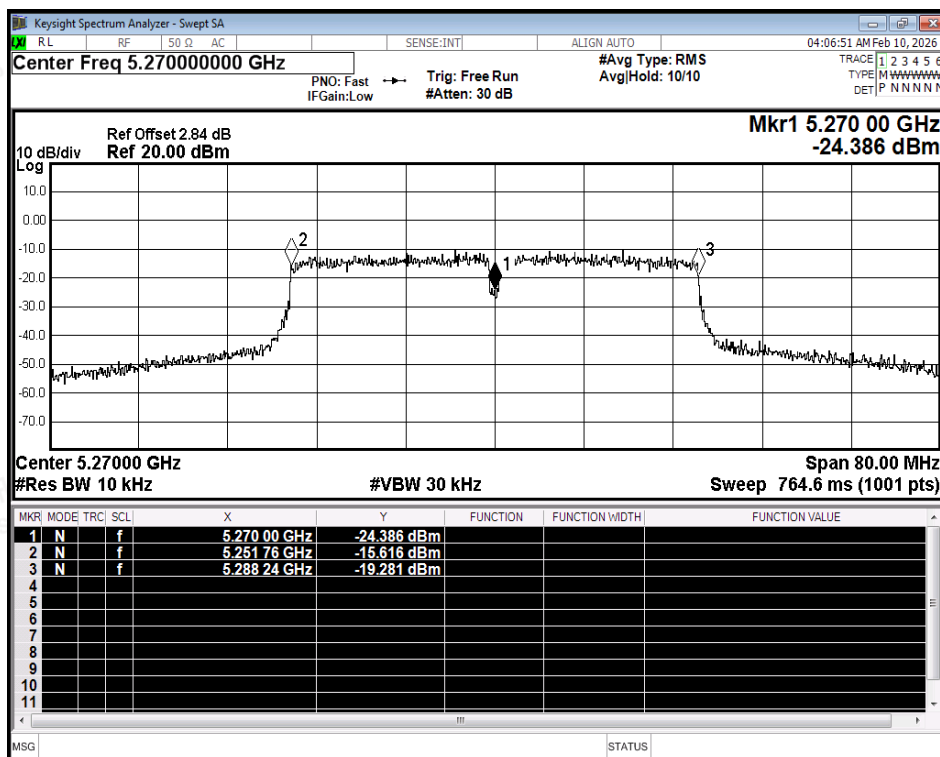

Freq. Stability NVNT ax40 5270MHz Ant1




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

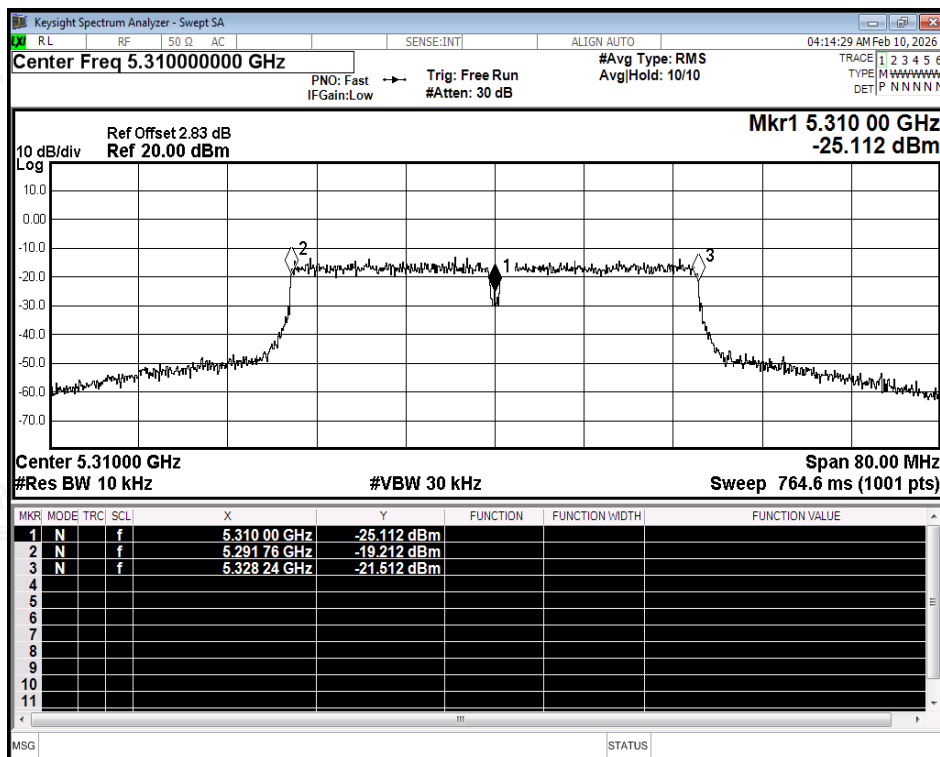

Freq. Stability NVNT ax40 5310MHz Ant1

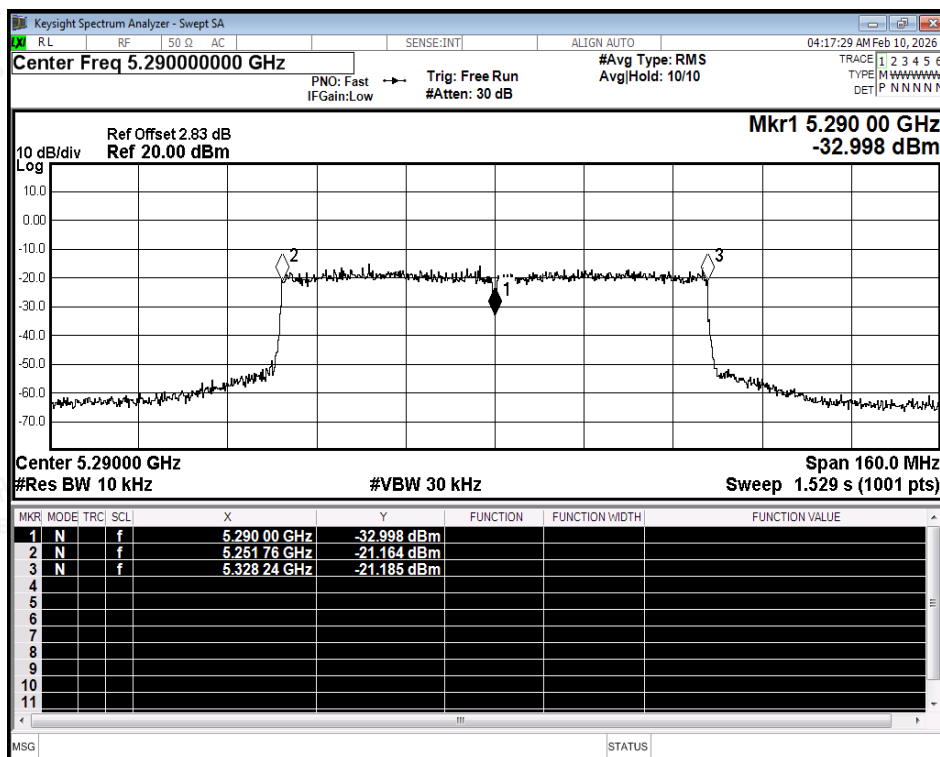

Freq. Stability NVNT ax80 5290MHz Ant1



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China


Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity




Condition	Mode	Frequency (MHz)	Antenna	Measured Frequency (MHz)	Frequency Error (Hz)	Deviation (ppm)	Limit (ppm)	Verdict
NVNT	a	5260	Ant2	5259.98	-20000	-3.8	25	Pass
NVNT	a	5280	Ant2	5279.98	-20000	-3.79	25	Pass
NVNT	a	5320	Ant2	5319.98	-20000	-3.76	25	Pass
NVNT	n20	5260	Ant2	5259.96	-40000	-7.6	25	Pass
NVNT	n20	5280	Ant2	5279.96	-40000	-7.58	25	Pass
NVNT	n20	5320	Ant2	5319.98	-20000	-3.76	25	Pass
NVNT	n40	5270	Ant2	5270	0	0	25	Pass
NVNT	n40	5310	Ant2	5310	0	0	25	Pass
NVNT	ac20	5260	Ant2	5259.98	-20000	-3.8	25	Pass
NVNT	ac20	5280	Ant2	5279.96	-40000	-7.58	25	Pass
NVNT	ac20	5320	Ant2	5319.96	-40000	-7.52	25	Pass
NVNT	ac40	5270	Ant2	5269.96	-40000	-7.59	25	Pass
NVNT	ac40	5310	Ant2	5310	0	0	25	Pass
NVNT	ac80	5290	Ant2	5290	0	0	25	Pass
NVNT	ax20	5260	Ant2	5259.98	-20000	-3.8	25	Pass
NVNT	ax20	5280	Ant2	5279.98	-20000	-3.79	25	Pass
NVNT	ax20	5320	Ant2	5319.98	-20000	-3.76	25	Pass
NVNT	ax40	5270	Ant2	5270	0	0	25	Pass
NVNT	ax40	5310	Ant2	5309.96	-40000	-7.53	25	Pass
NVNT	ax80	5290	Ant2	5290	0	0	25	Pass



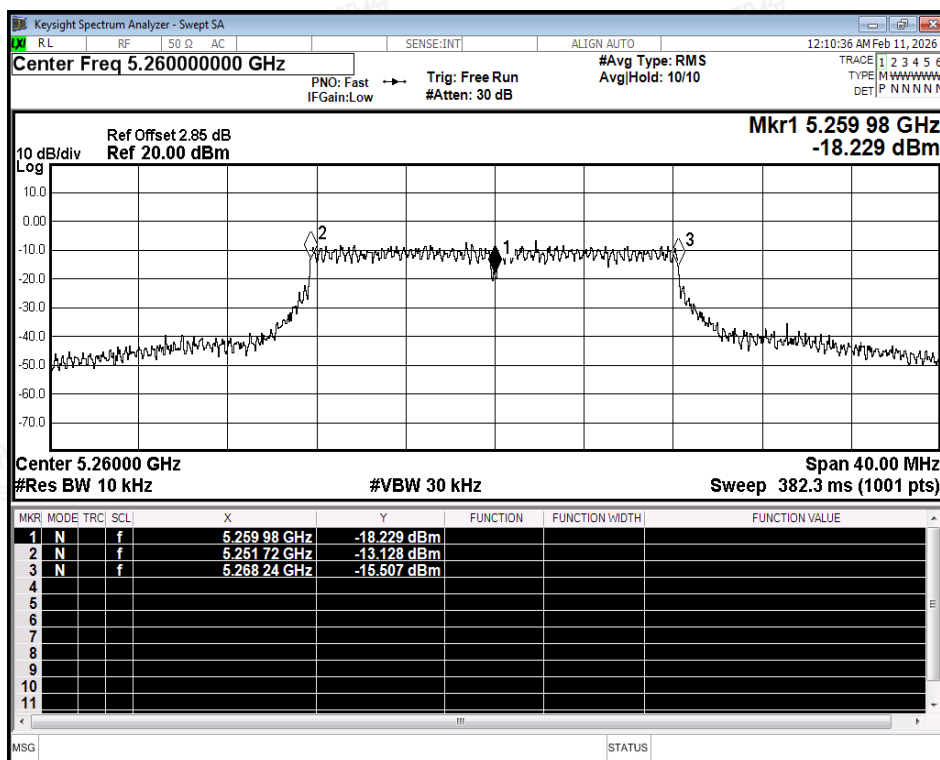

Freq. Stability NVNT a 5260MHz Ant2

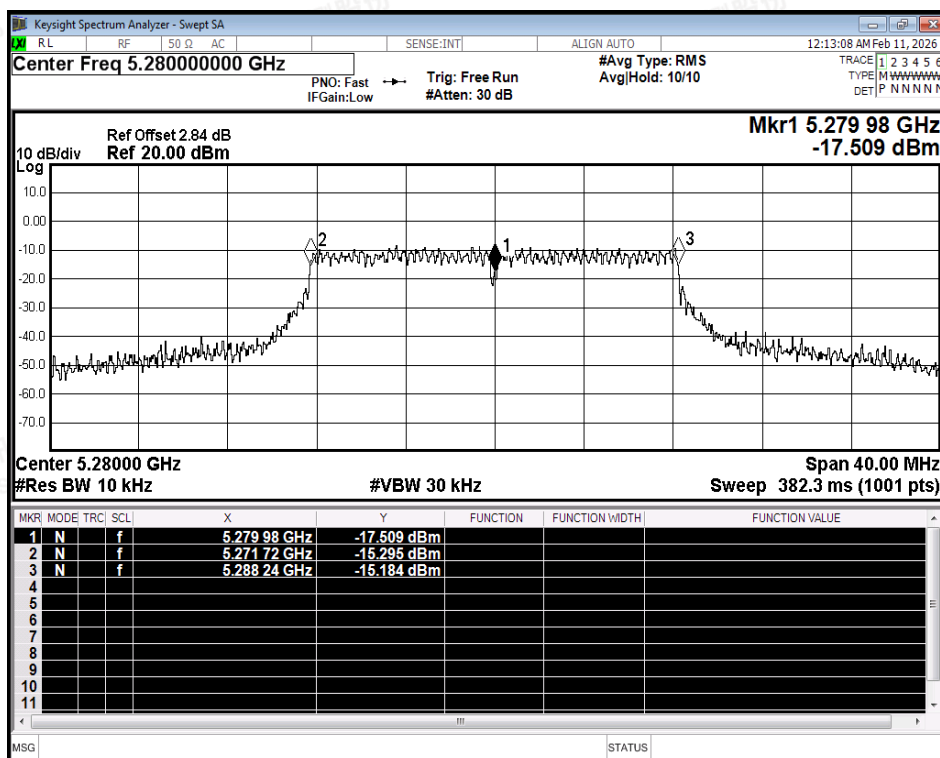

Freq. Stability NVNT a 5280MHz Ant2




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

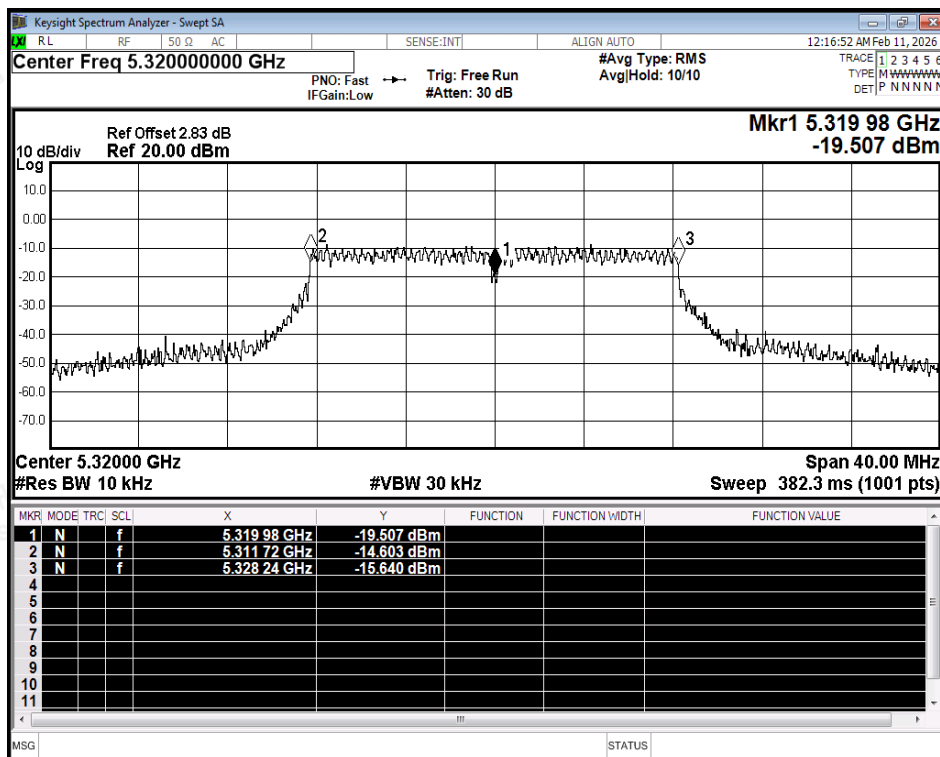

Freq. Stability NVNT a 5320MHz Ant2

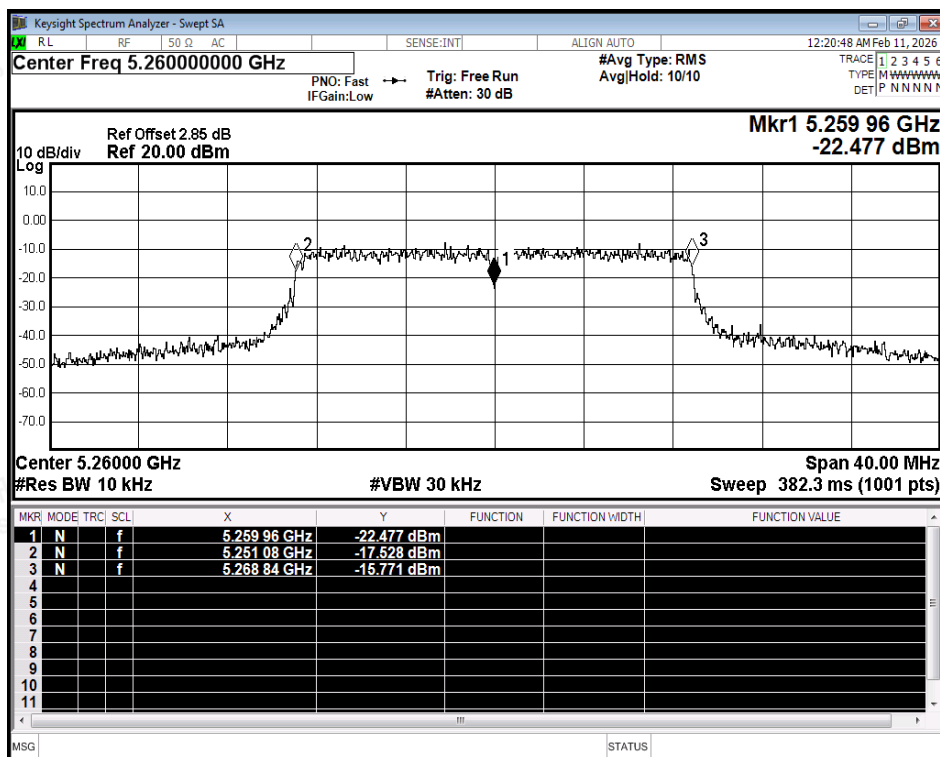

Freq. Stability NVNT n20 5260MHz Ant2




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

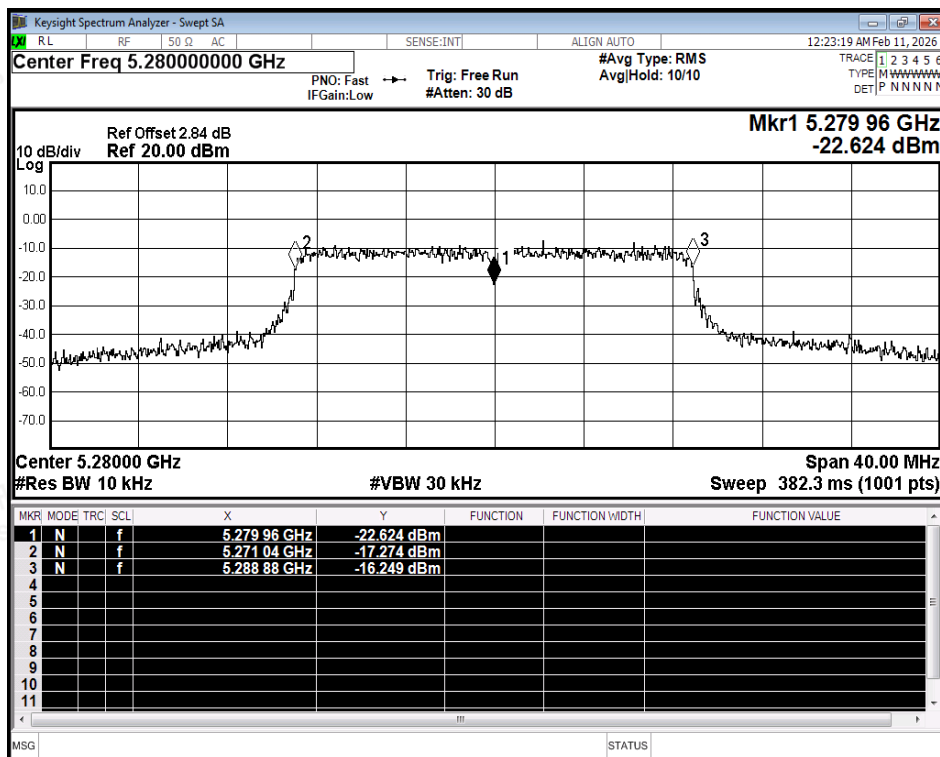

Freq. Stability NVNT n20 5280MHz Ant2

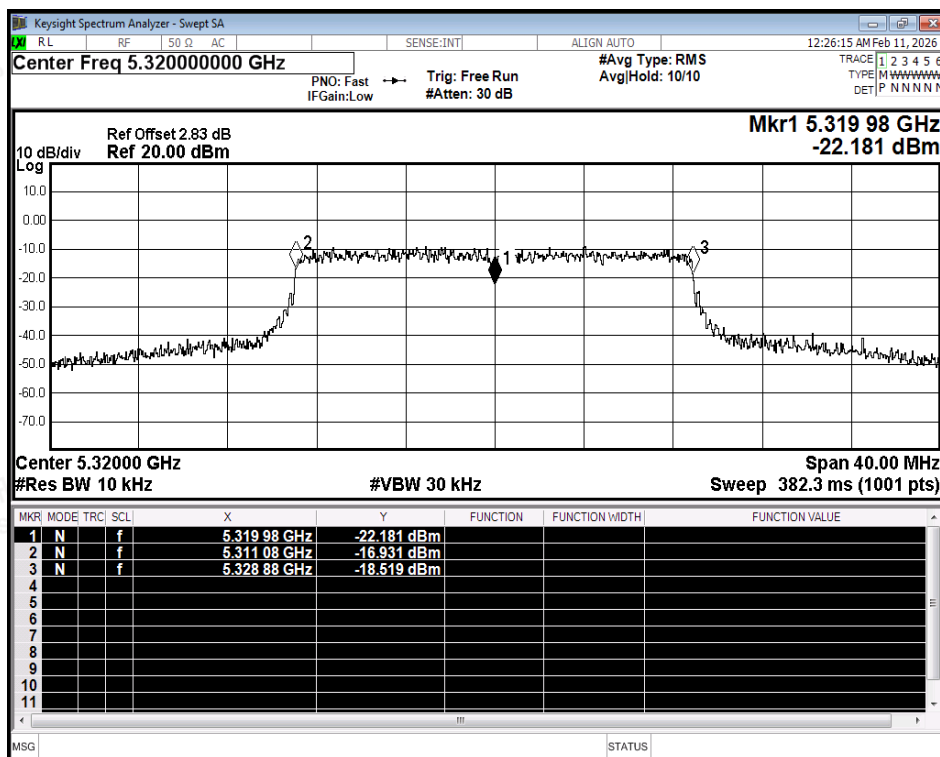

Freq. Stability NVNT n20 5320MHz Ant2




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

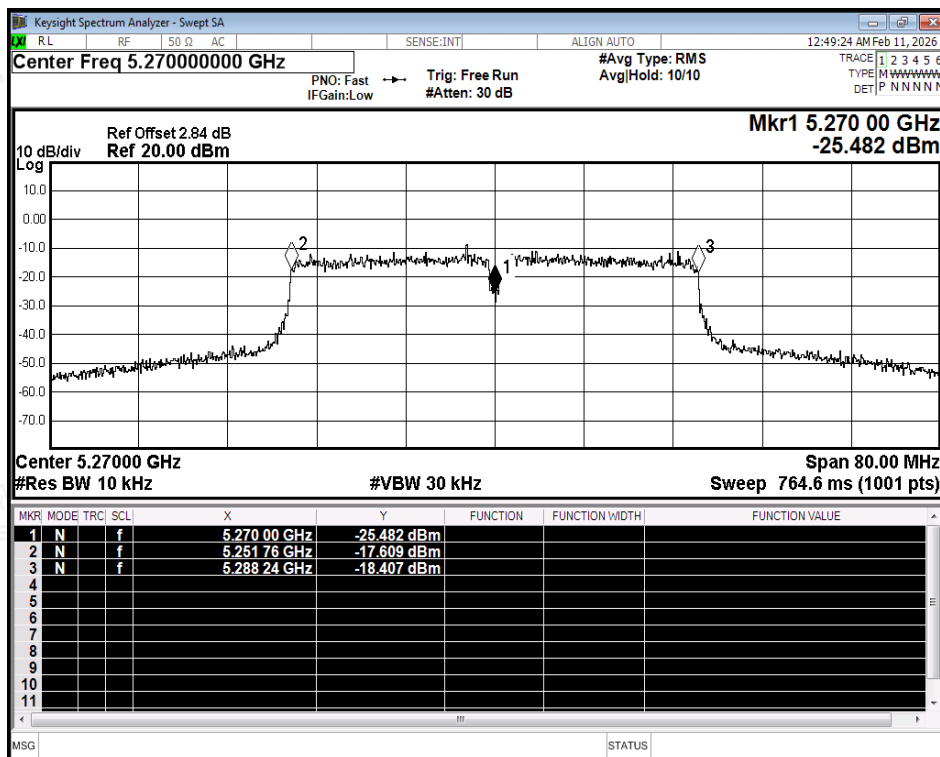

Freq. Stability NVNT n40 5270MHz Ant2

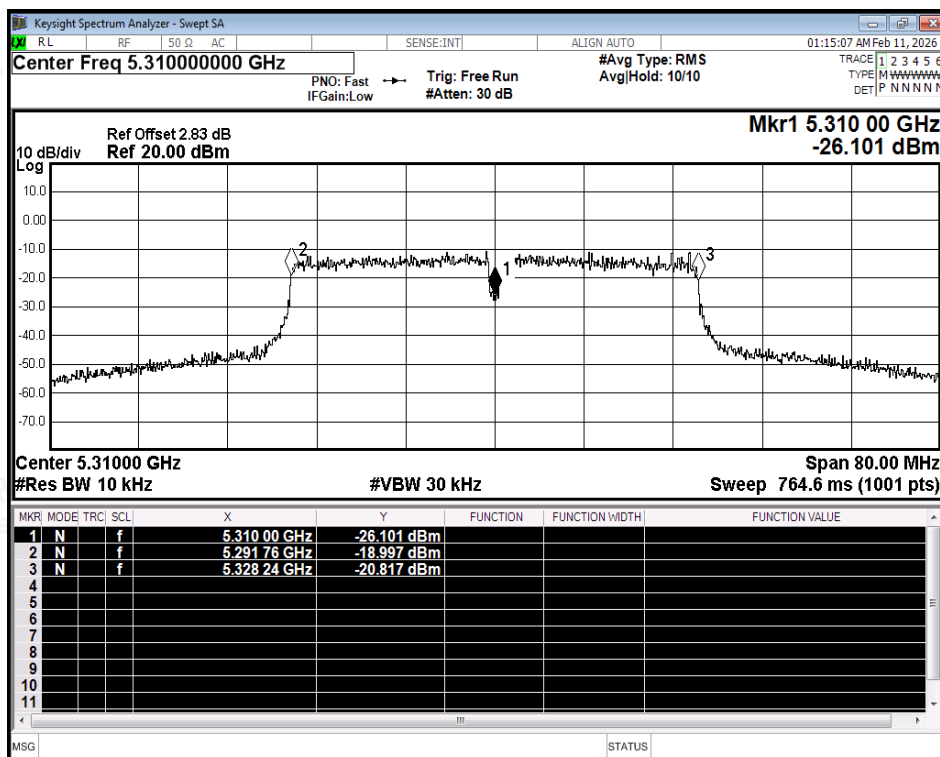

Freq. Stability NVNT n40 5310MHz Ant2




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

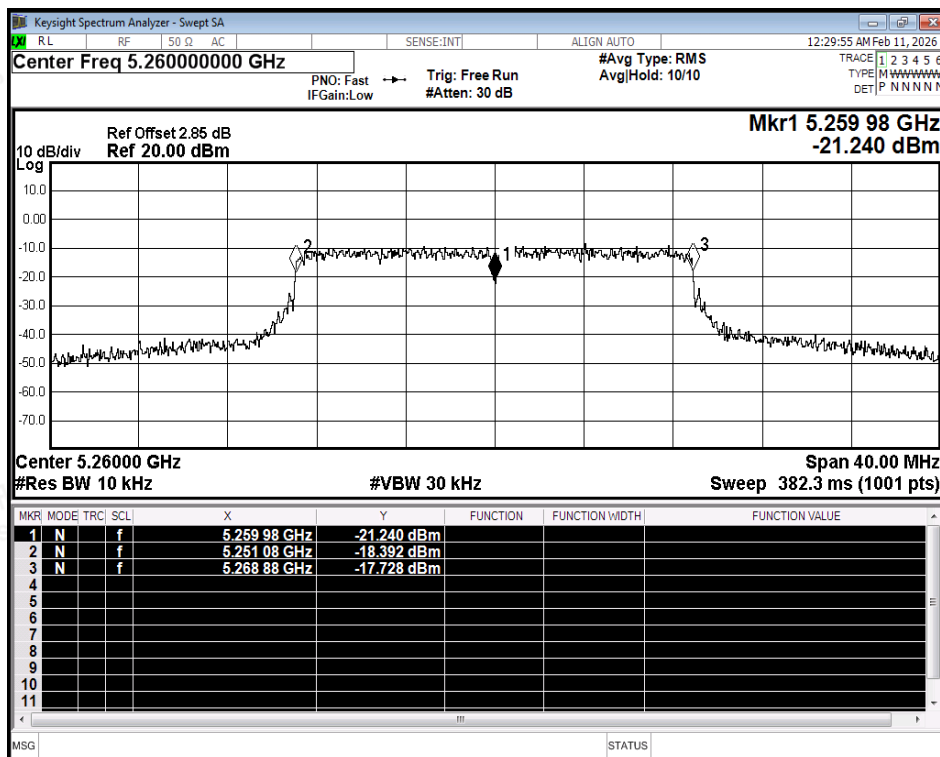

Freq. Stability NVNT ac20 5260MHz Ant2

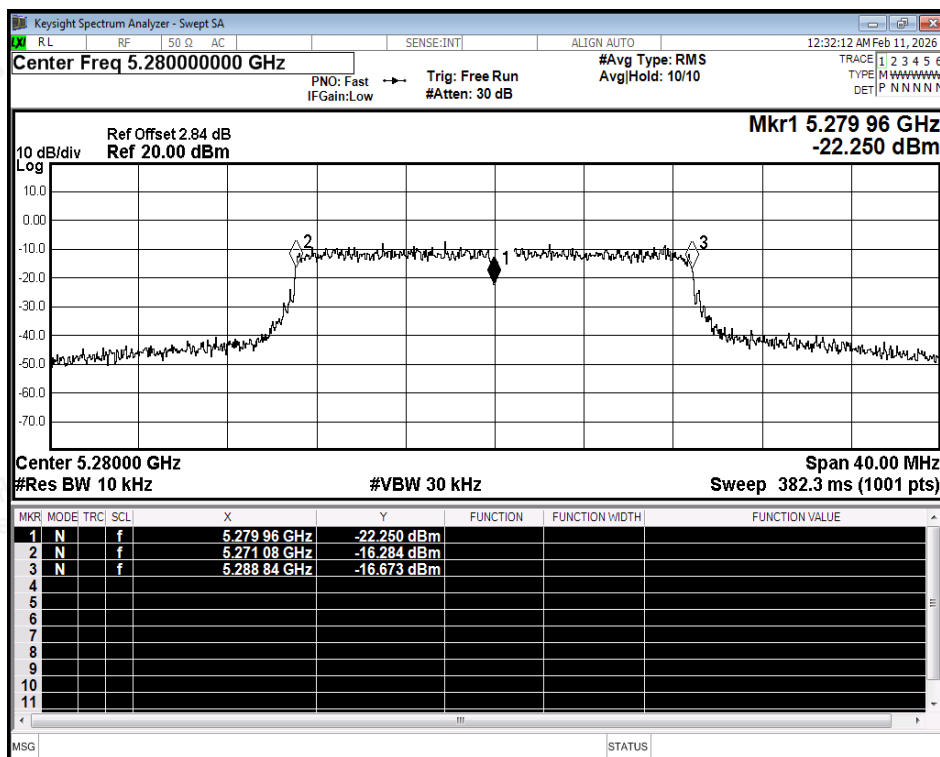

Freq. Stability NVNT ac20 5280MHz Ant2




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

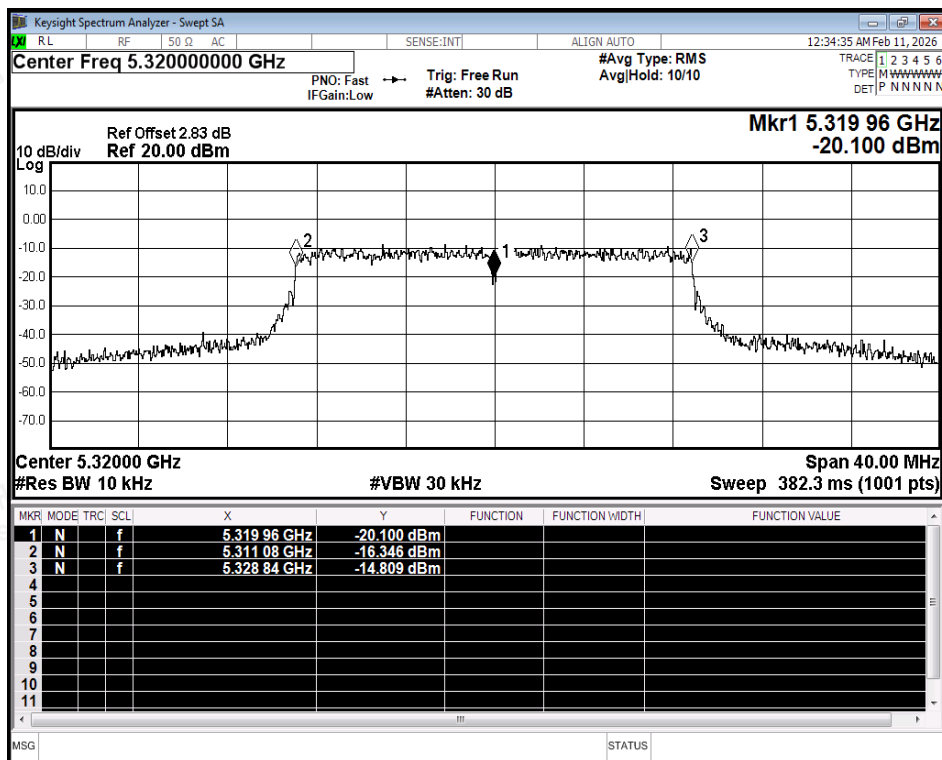

Freq. Stability NVNT ac20 5320MHz Ant2

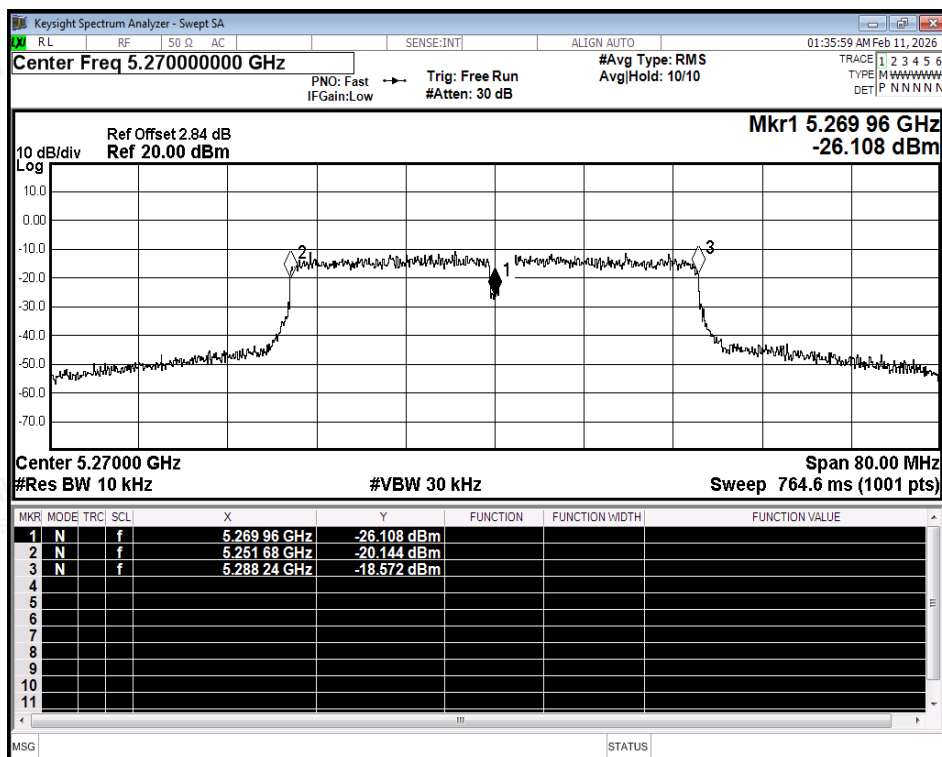

Freq. Stability NVNT ac40 5270MHz Ant2




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

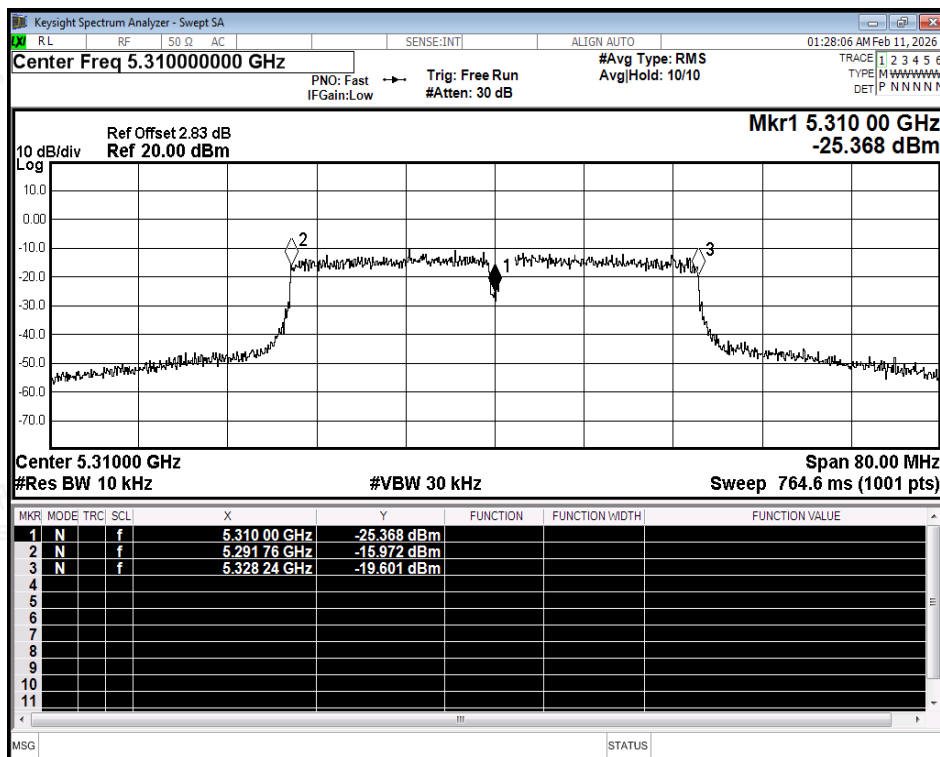

Freq. Stability NVNT ac40 5310MHz Ant2

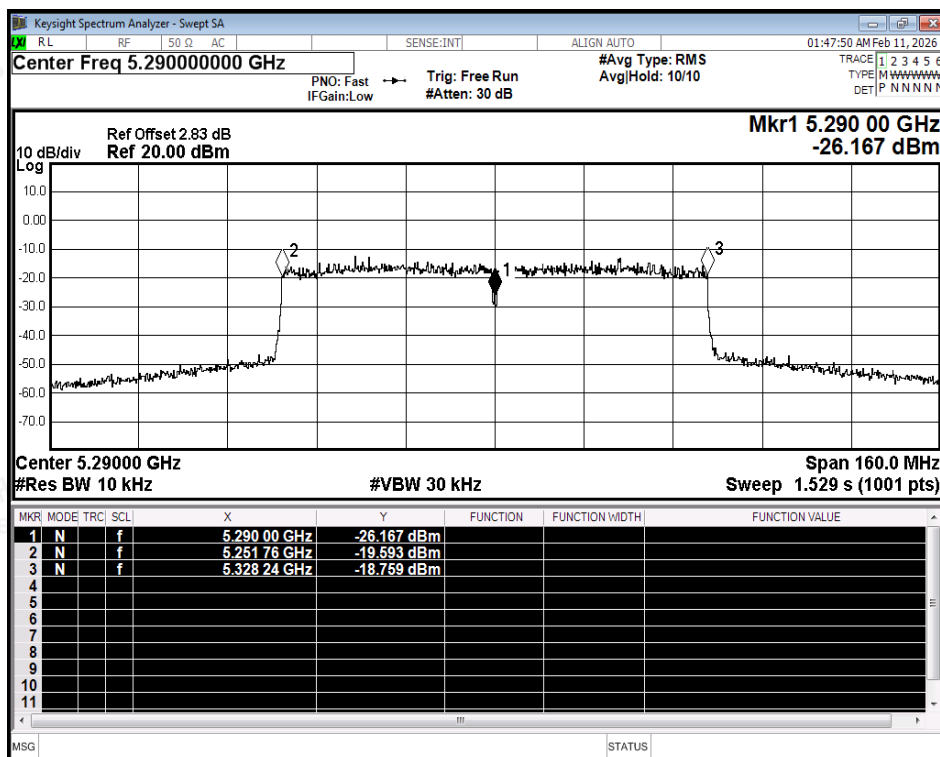

Freq. Stability NVNT ac80 5290MHz Ant2




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

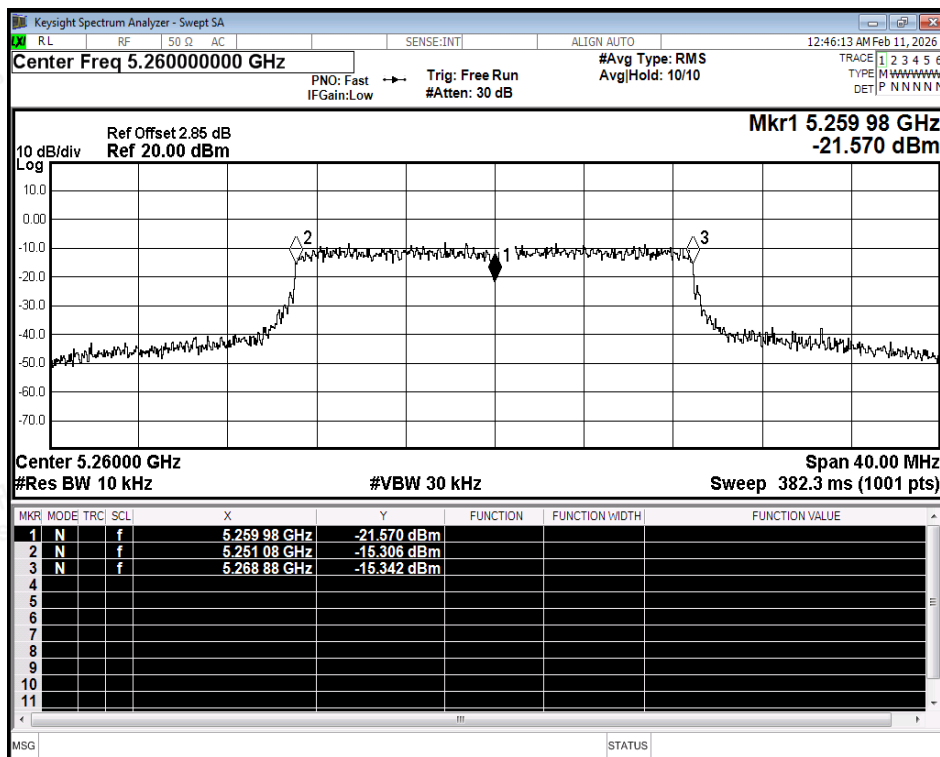

Freq. Stability NVNT ax20 5260MHz Ant2

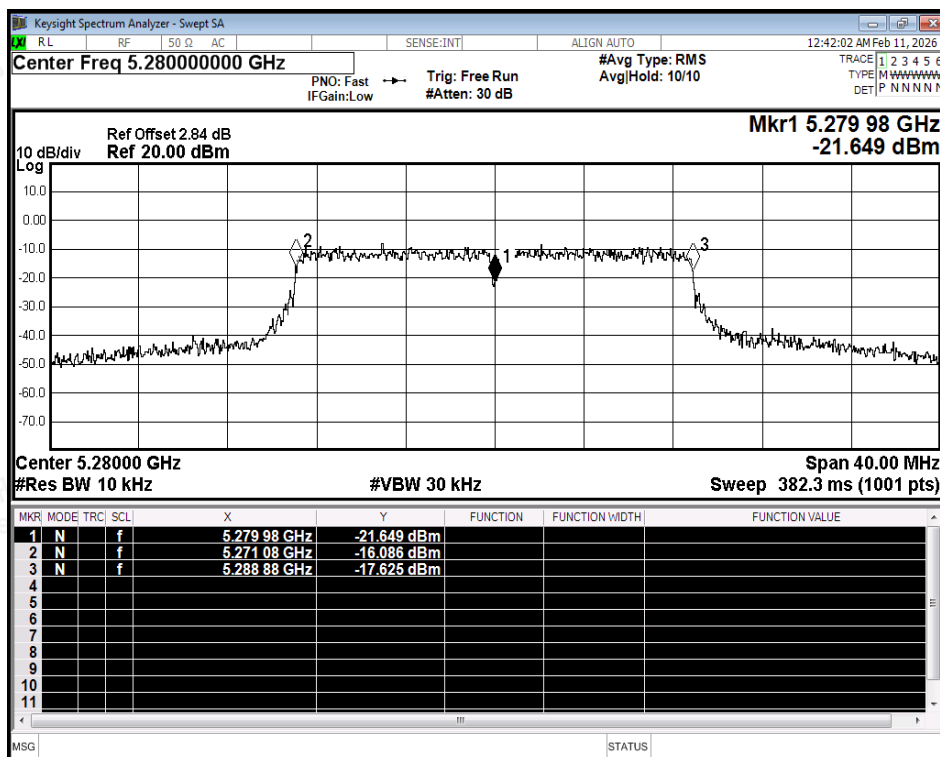

Freq. Stability NVNT ax20 5280MHz Ant2




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

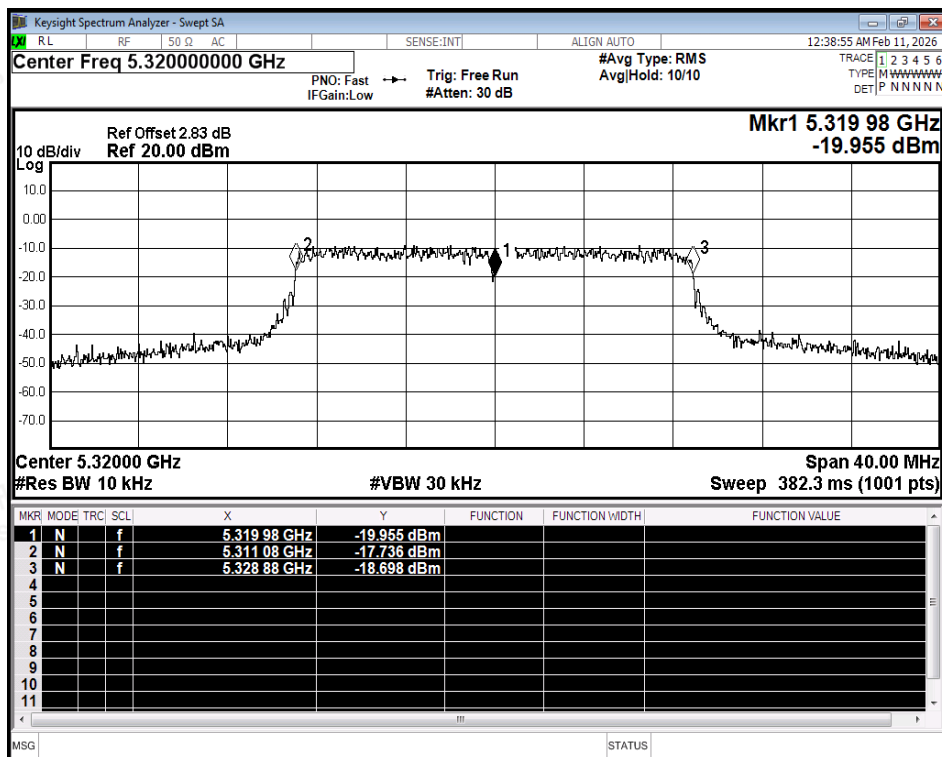

Freq. Stability NVNT ax20 5320MHz Ant2

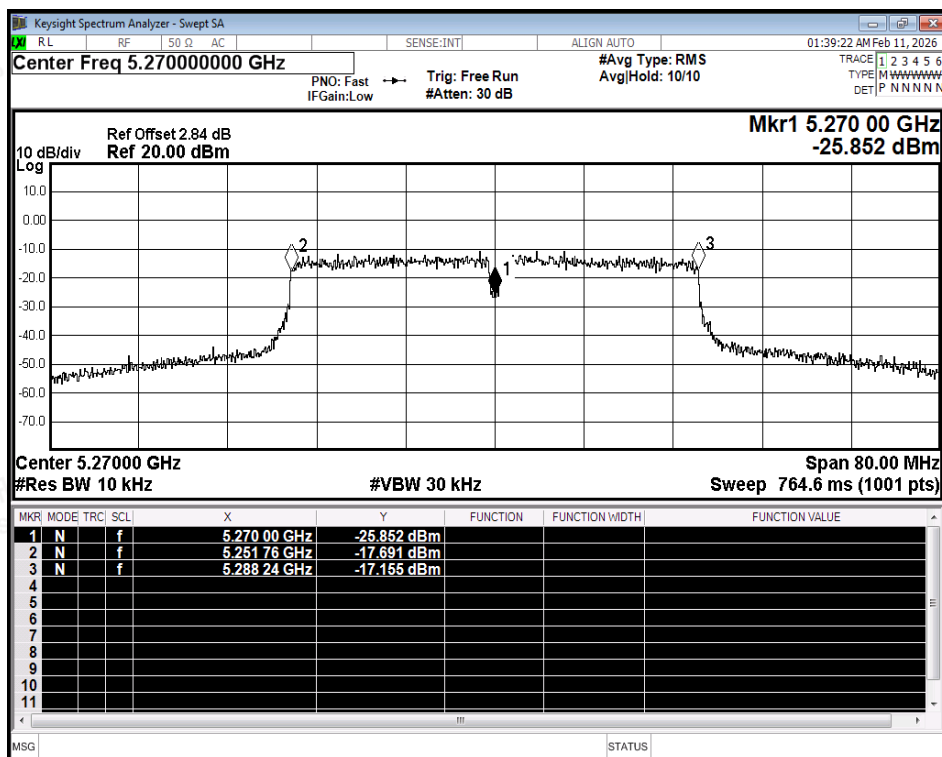

Freq. Stability NVNT ax40 5270MHz Ant2




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

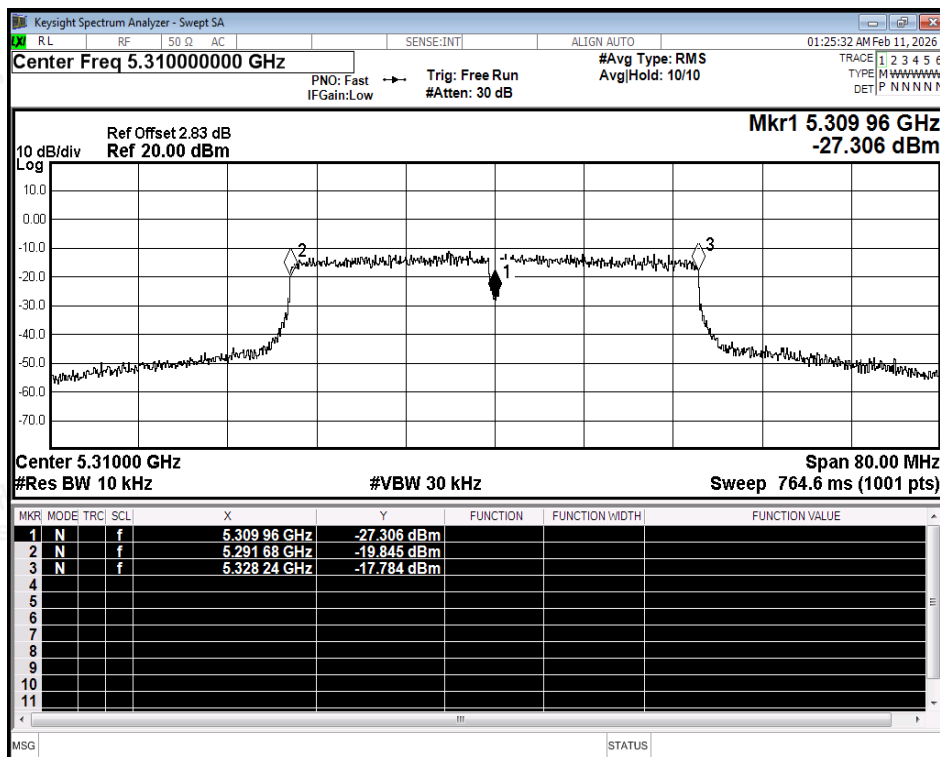

Freq. Stability NVNT ax40 5310MHz Ant2

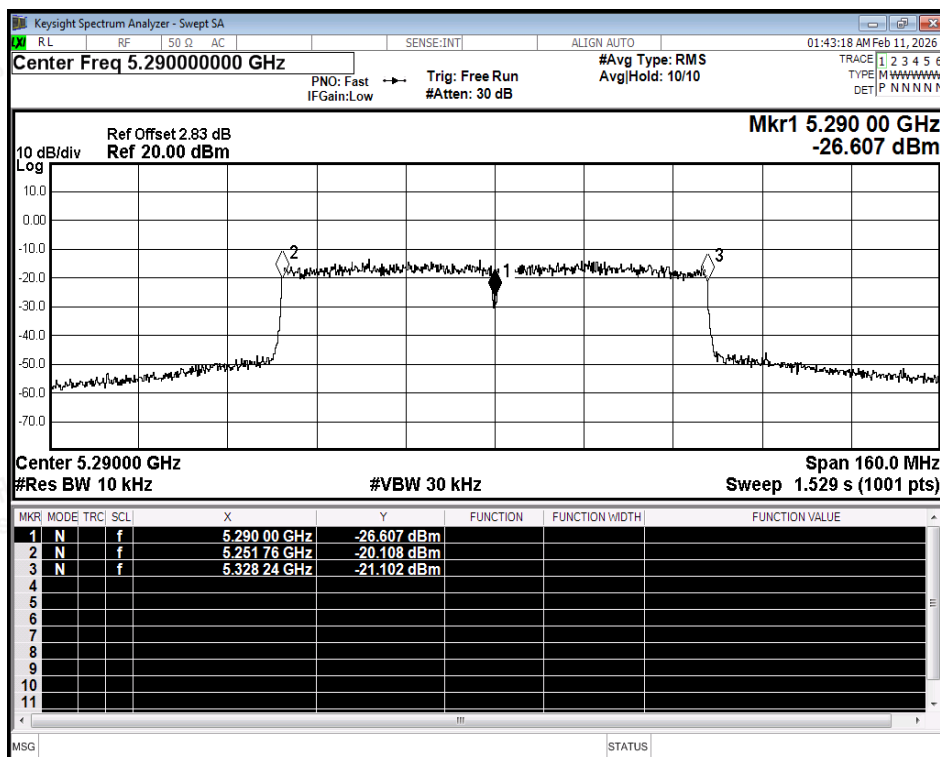

Freq. Stability NVNT ax80 5290MHz Ant2



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity




B.6 Duty Cycle

Condition	Mode	Frequency (MHz)	Antenna	Duty Cycle (%)	Correction Factor (dB)	1/T (kHz)
NVNT	a	5260	Ant1	97.83	0.1	0.37
NVNT	a	5280	Ant1	97.83	0.1	0.37
NVNT	a	5320	Ant1	97.46	0.11	0.37
NVNT	n20	5260	Ant1	97.41	0.11	0.44
NVNT	n20	5280	Ant1	97.41	0.11	0.44
NVNT	n20	5320	Ant1	97.41	0.11	0.44
NVNT	n40	5270	Ant1	94.07	0.27	0.9
NVNT	n40	5310	Ant1	94.87	0.23	0.9
NVNT	ac20	5260	Ant1	97.42	0.11	0.44
NVNT	ac20	5280	Ant1	97.42	0.11	0.44
NVNT	ac20	5320	Ant1	97	0.13	0.44
NVNT	ac40	5270	Ant1	94.87	0.23	0.9
NVNT	ac40	5310	Ant1	94.87	0.23	0.9
NVNT	ac80	5290	Ant1	88.33	0.54	1.89
NVNT	ax20	5260	Ant1	97.42	0.11	0.44
NVNT	ax20	5280	Ant1	97.01	0.13	0.44
NVNT	ax20	5320	Ant1	97.01	0.13	0.44
NVNT	ax40	5270	Ant1	94.87	0.23	0.9
NVNT	ax40	5310	Ant1	94.87	0.23	0.9
NVNT	ax80	5290	Ant1	90	0.46	1.85



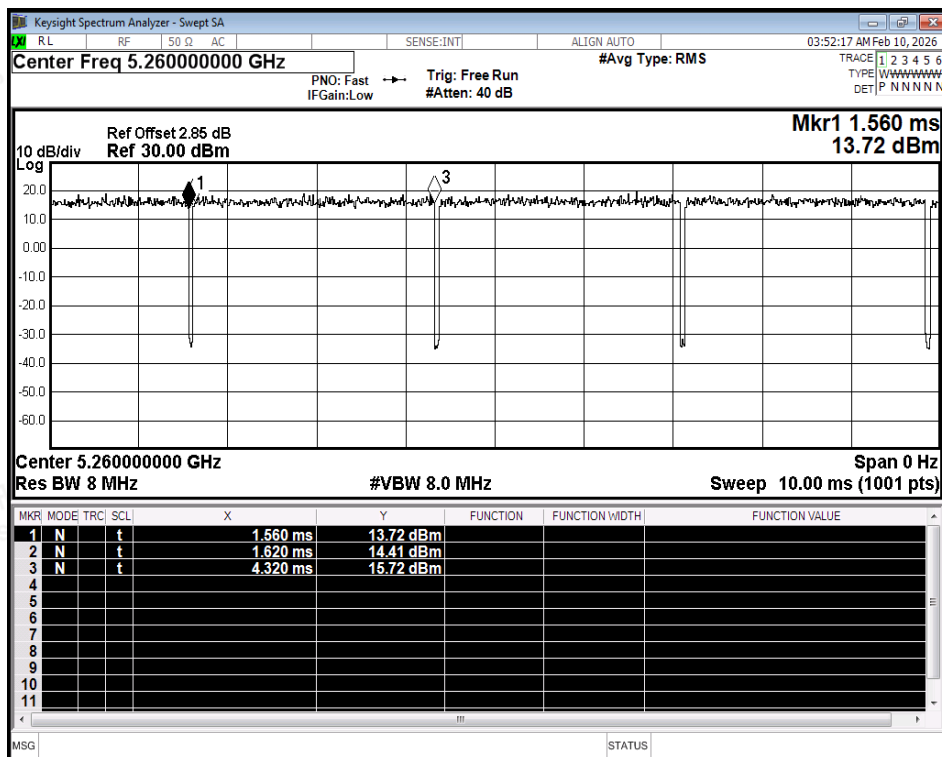

Duty Cycle NVNT a 5260MHz Ant1

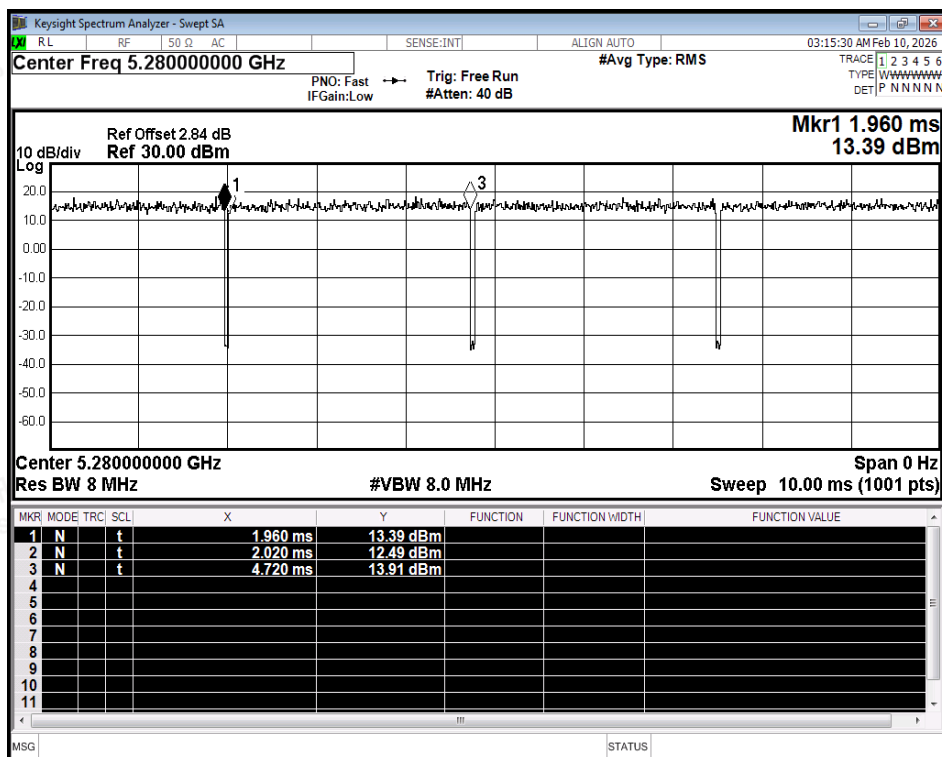

Duty Cycle NVNT a 5280MHz Ant1




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

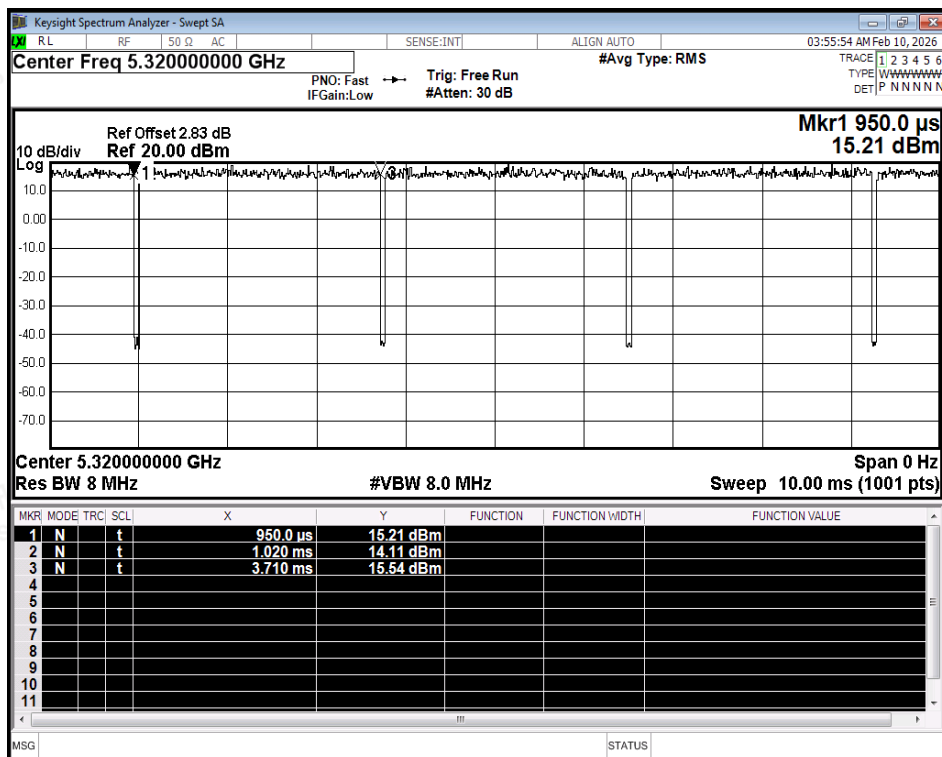

Duty Cycle NVNT a 5320MHz Ant1

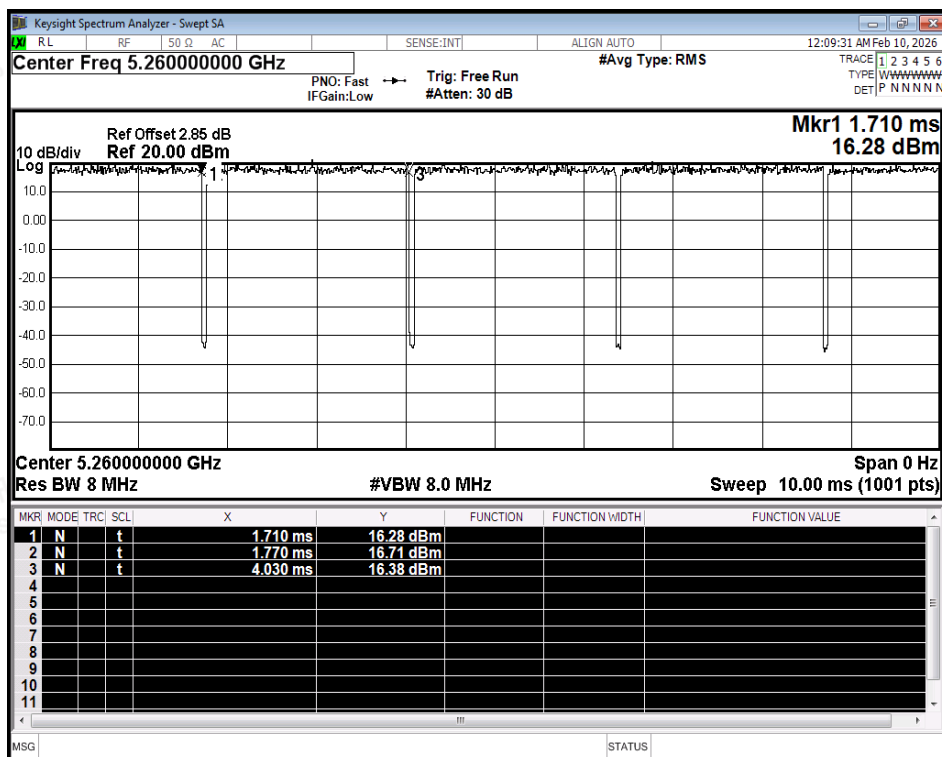

Duty Cycle NVNT n20 5260MHz Ant1




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

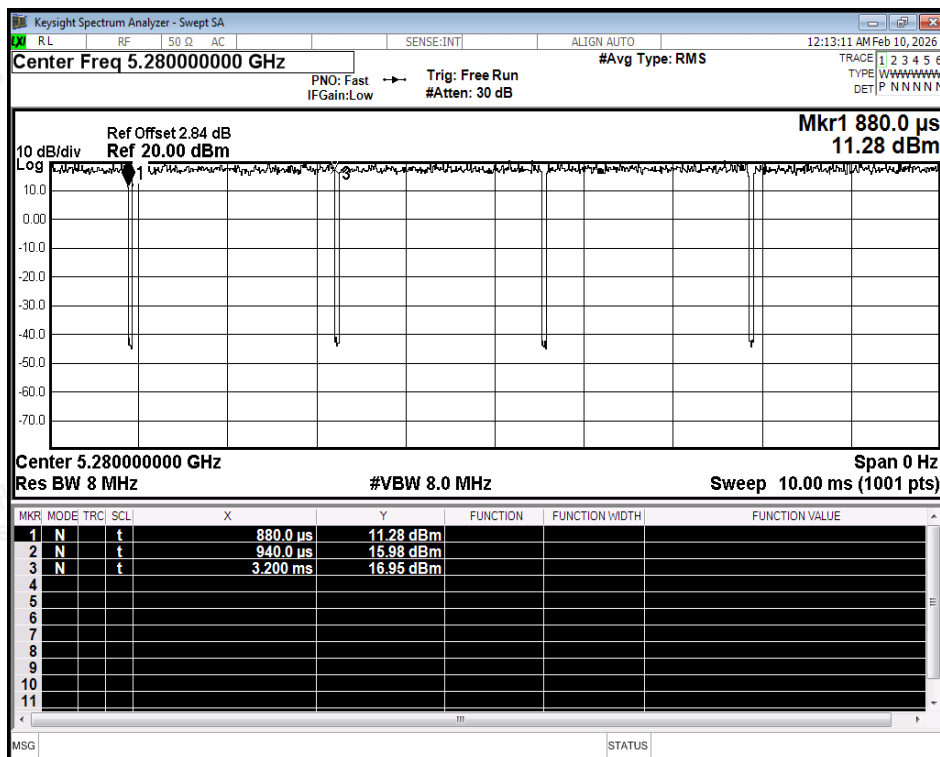

Duty Cycle NVNT n20 5280MHz Ant1

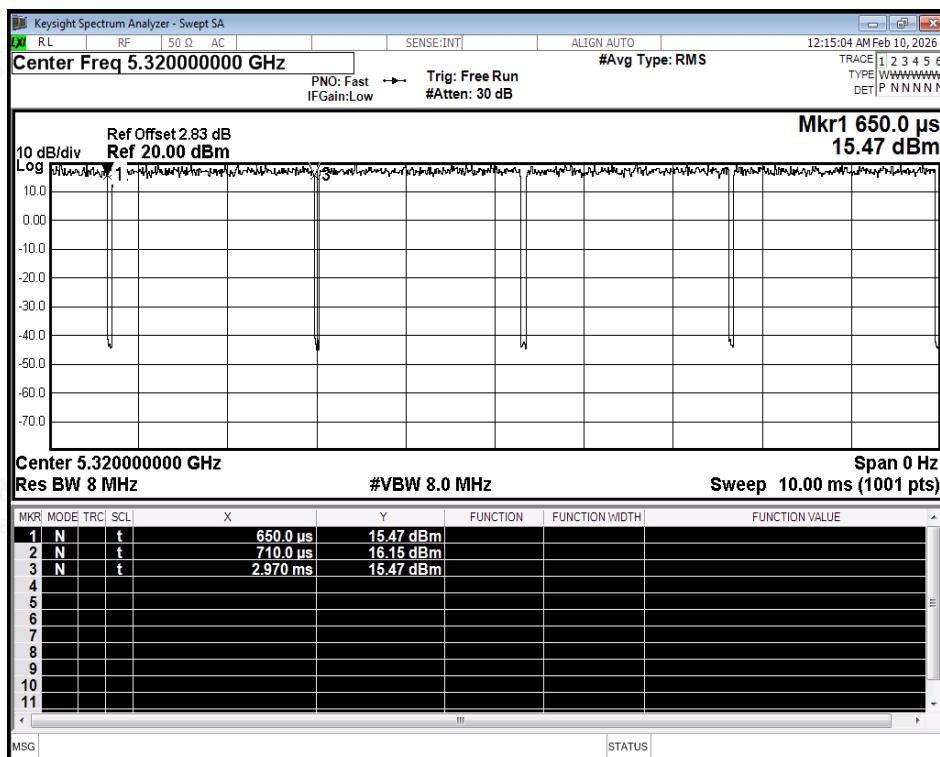

Duty Cycle NVNT n20 5320MHz Ant1




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

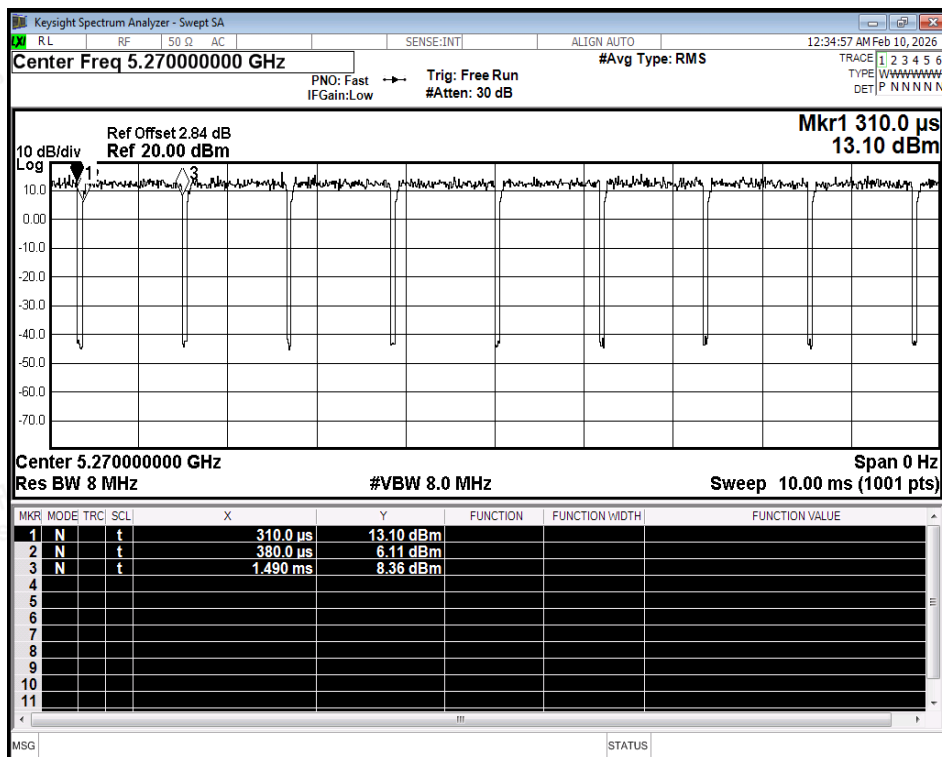

Duty Cycle NVNT n40 5270MHz Ant1

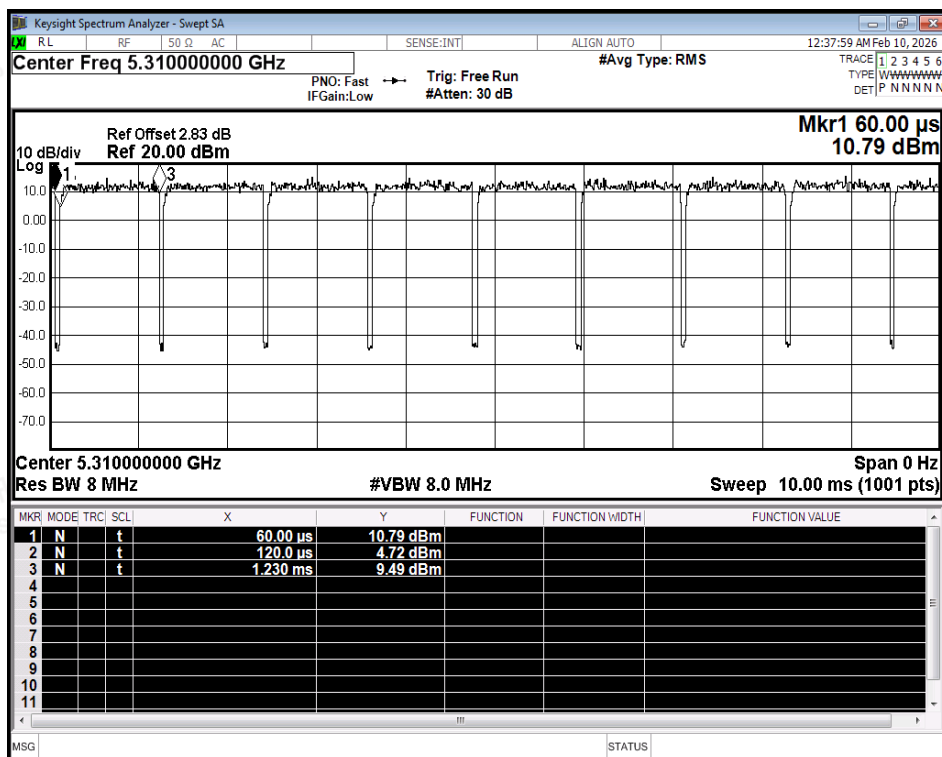

Duty Cycle NVNT n40 5310MHz Ant1




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

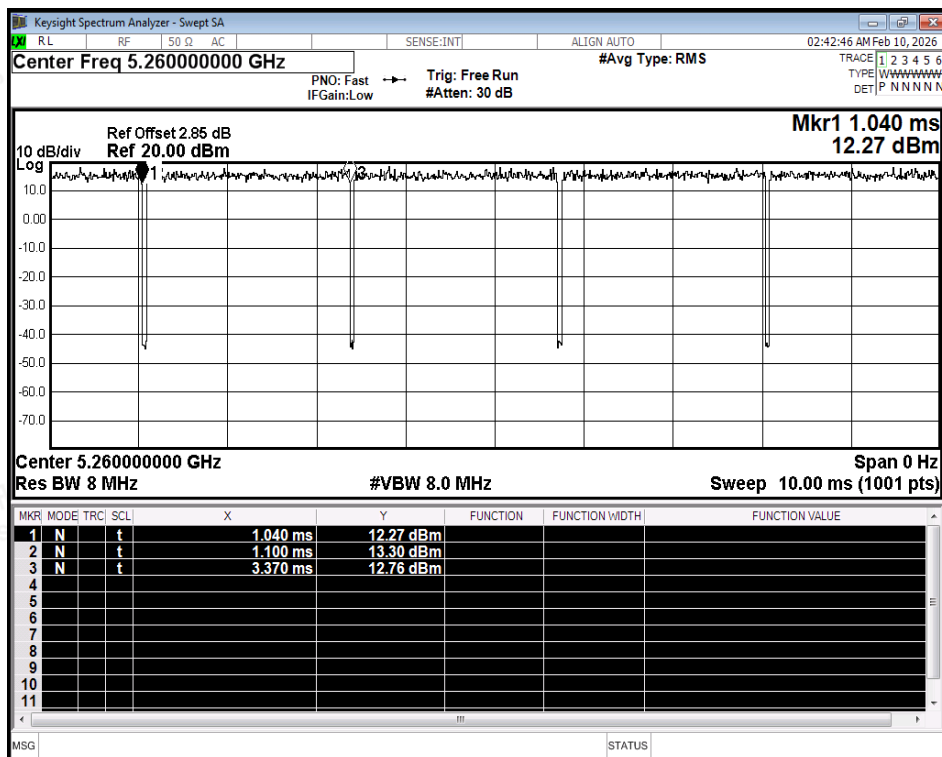

Duty Cycle NVNT ac20 5260MHz Ant1

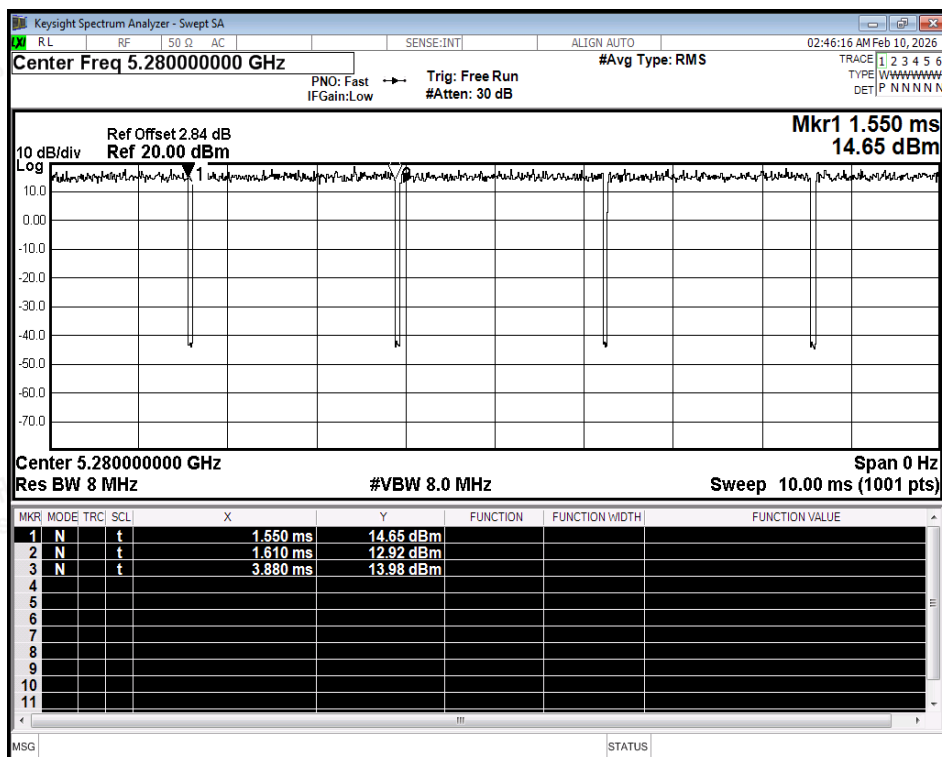

Duty Cycle NVNT ac20 5280MHz Ant1




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

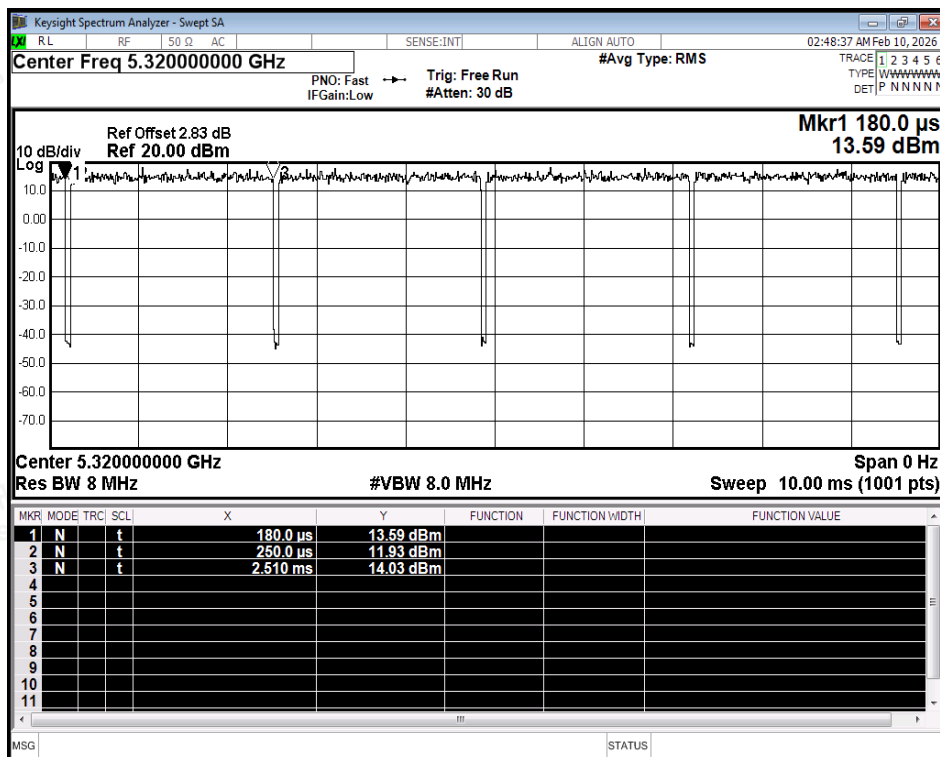

Duty Cycle NVNT ac20 5320MHz Ant1

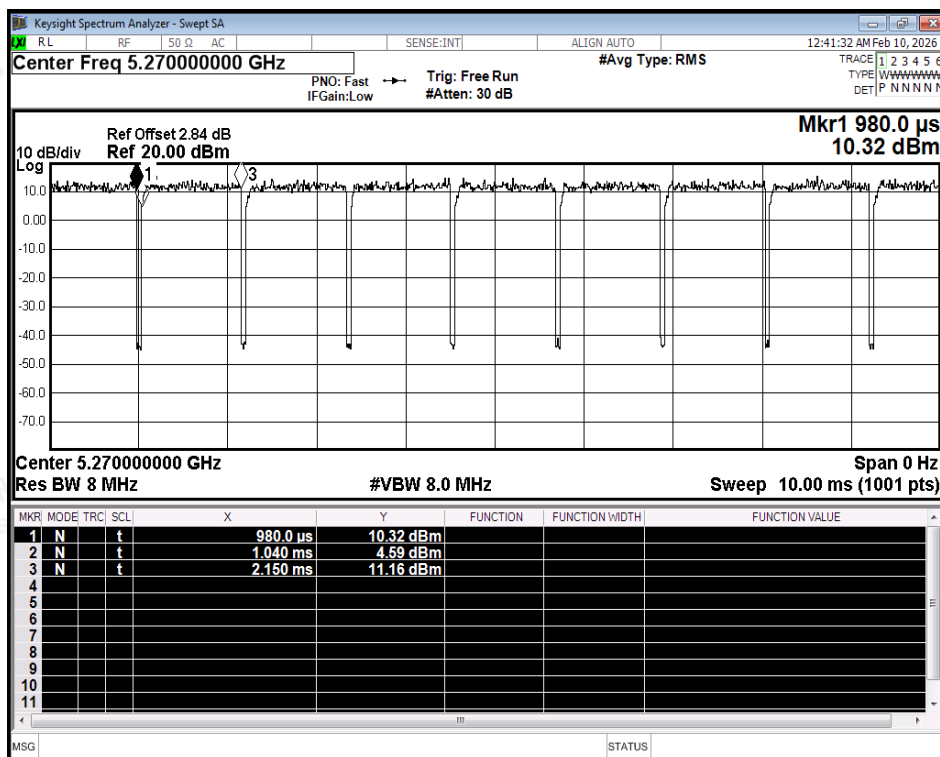

Duty Cycle NVNT ac40 5270MHz Ant1




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

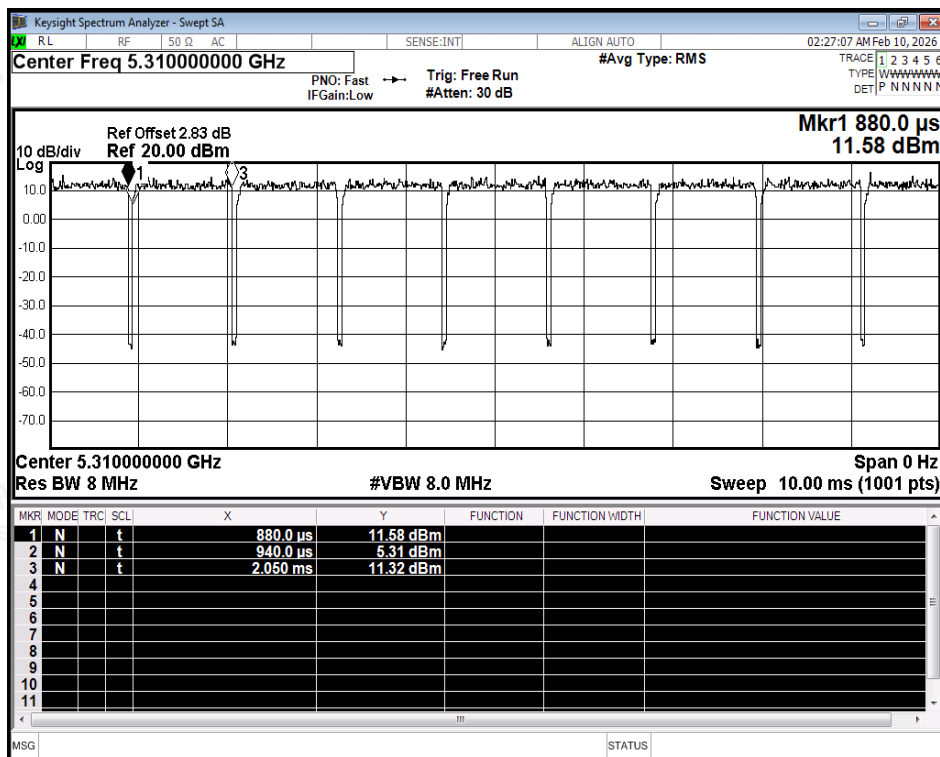

Duty Cycle NVNT ac40 5310MHz Ant1

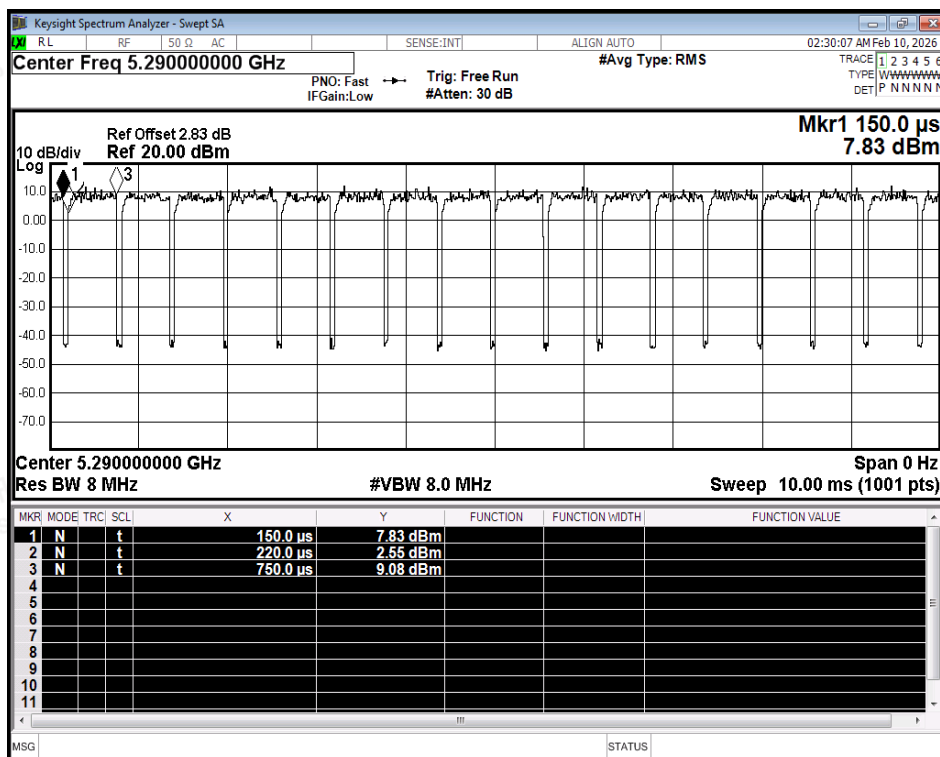

Duty Cycle NVNT ac80 5290MHz Ant1




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

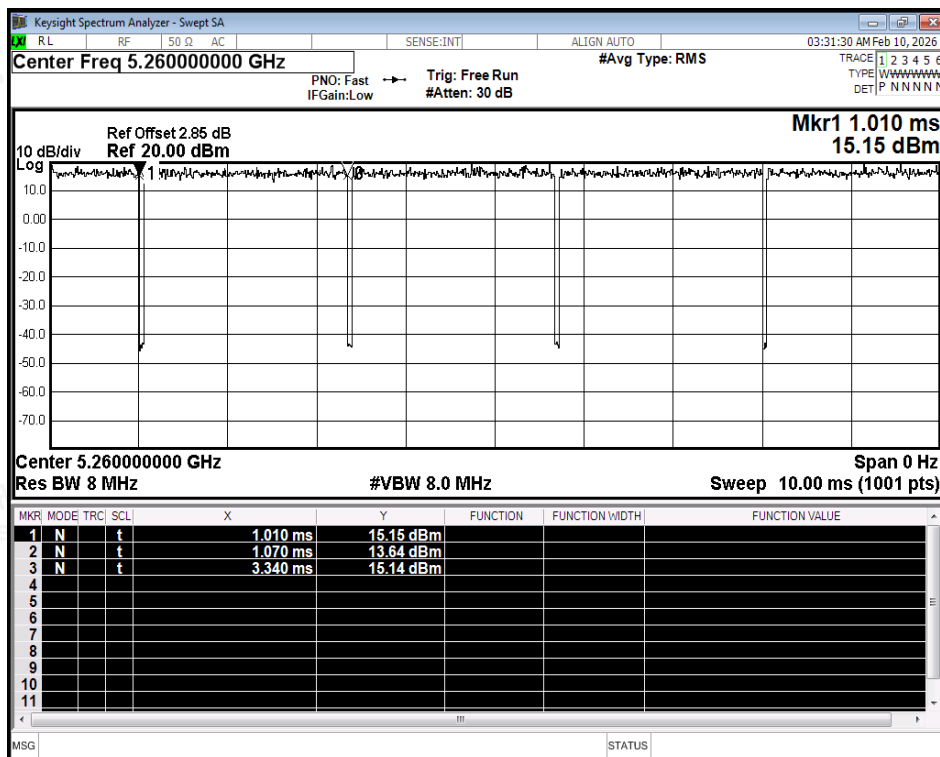

Duty Cycle NVNT ax20 5260MHz Ant1

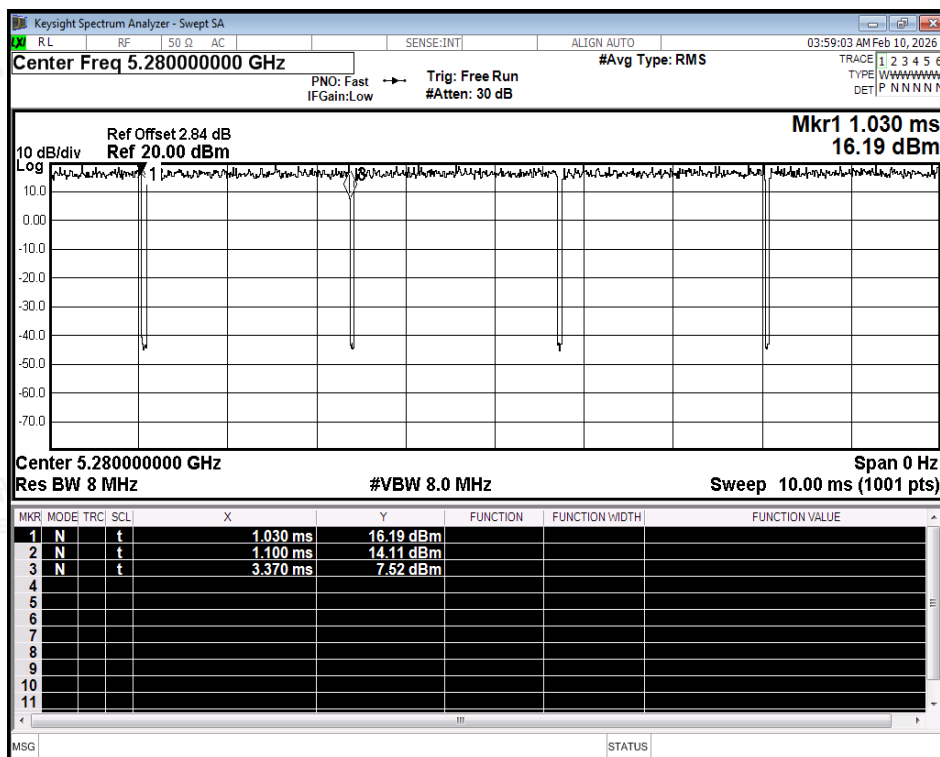

Duty Cycle NVNT ax20 5280MHz Ant1




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

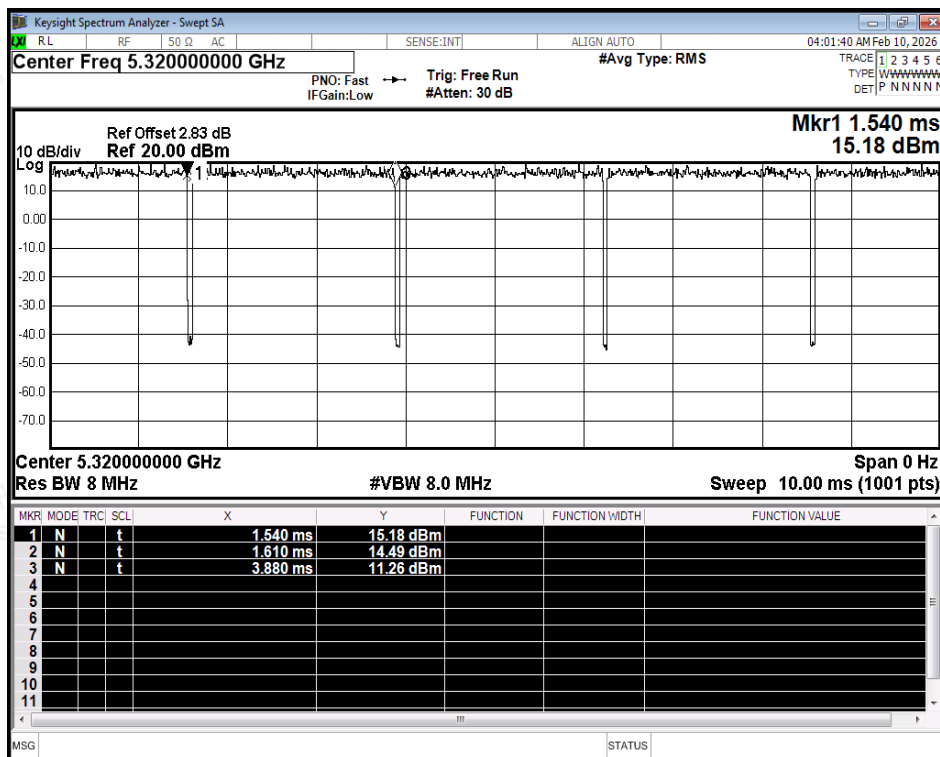

Duty Cycle NVNT ax20 5320MHz Ant1

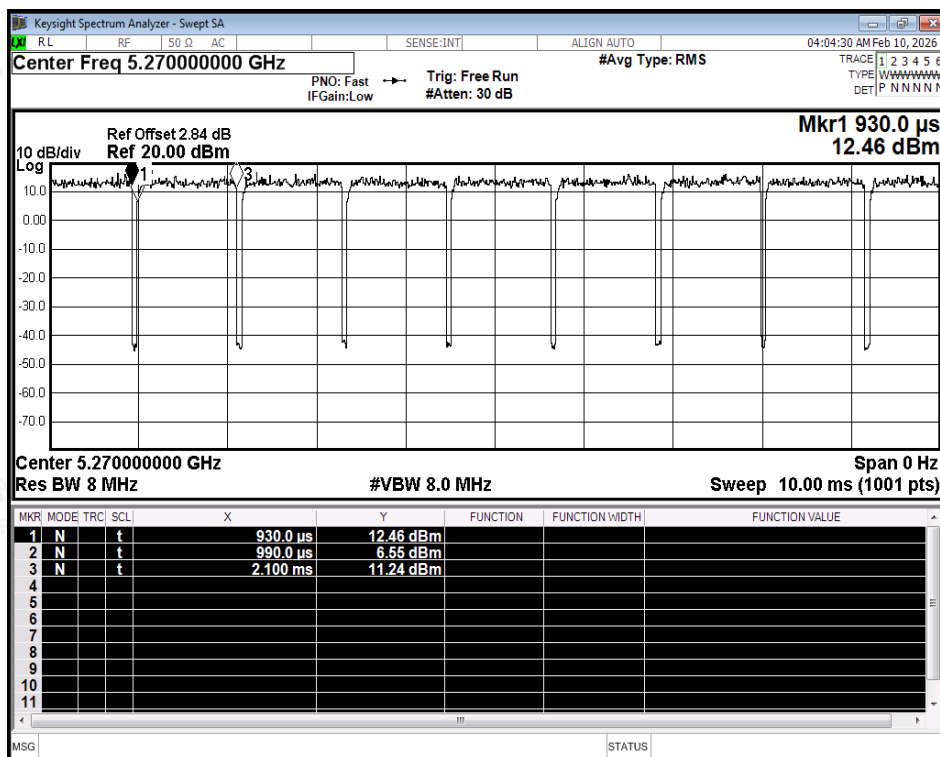

Duty Cycle NVNT ax40 5270MHz Ant1




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

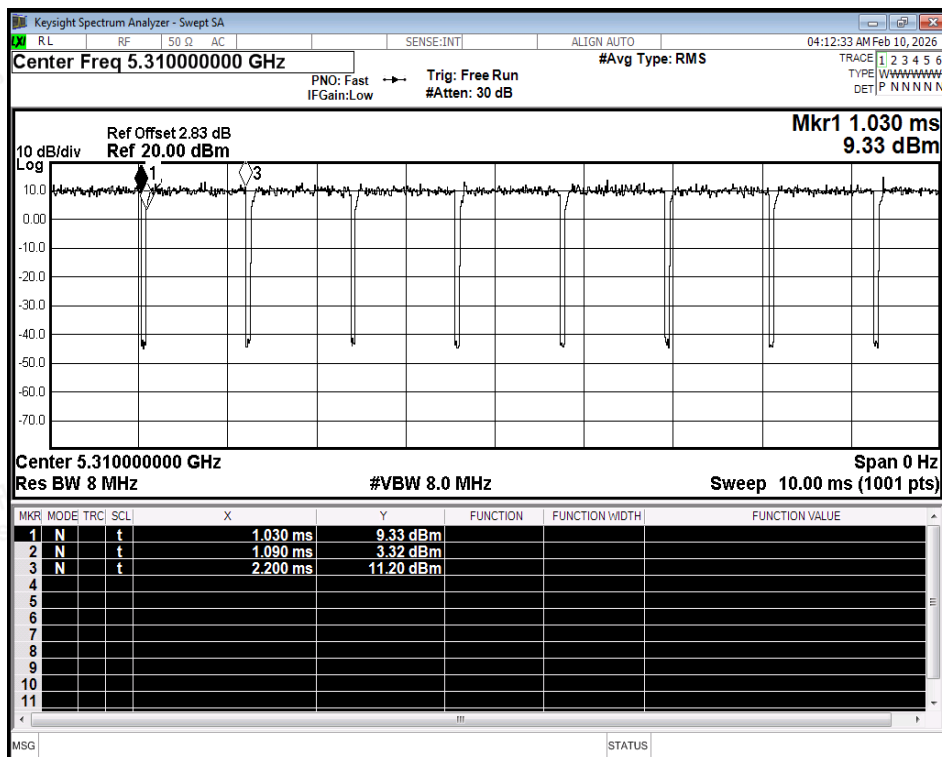

Duty Cycle NVNT ax40 5310MHz Ant1

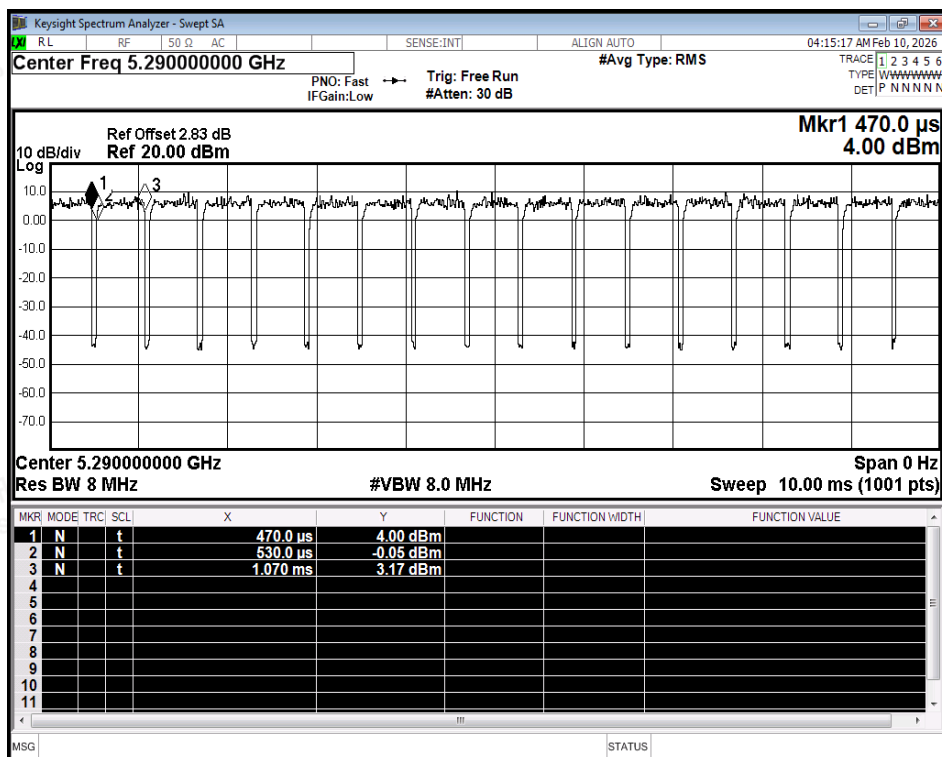

Duty Cycle NVNT ax80 5290MHz Ant1



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



Condition	Mode	Frequency (MHz)	Antenna	Duty Cycle (%)	Correction Factor (dB)	1/T (kHz)
NVNT	a	5260	Ant2	97.82	0.1	0.37
NVNT	a	5280	Ant2	97.83	0.1	0.37
NVNT	a	5320	Ant2	97.83	0.1	0.37
NVNT	n20	5260	Ant2	97.41	0.11	0.44
NVNT	n20	5280	Ant2	97.41	0.11	0.44
NVNT	n20	5320	Ant2	97	0.13	0.44
NVNT	n40	5270	Ant2	94.02	0.27	0.91
NVNT	n40	5310	Ant2	94.87	0.23	0.9
NVNT	ac20	5260	Ant2	97	0.13	0.44
NVNT	ac20	5280	Ant2	97	0.13	0.44
NVNT	ac20	5320	Ant2	97.01	0.13	0.44
NVNT	ac40	5270	Ant2	94.92	0.23	0.89
NVNT	ac40	5310	Ant2	94.87	0.23	0.9
NVNT	ac80	5290	Ant2	90	0.46	1.85
NVNT	ax20	5260	Ant2	97.42	0.11	0.44
NVNT	ax20	5280	Ant2	97.42	0.11	0.44
NVNT	ax20	5320	Ant2	97	0.13	0.44
NVNT	ax40	5270	Ant2	94.87	0.23	0.9
NVNT	ax40	5310	Ant2	94.87	0.23	0.9
NVNT	ax80	5290	Ant2	90	0.46	1.85




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

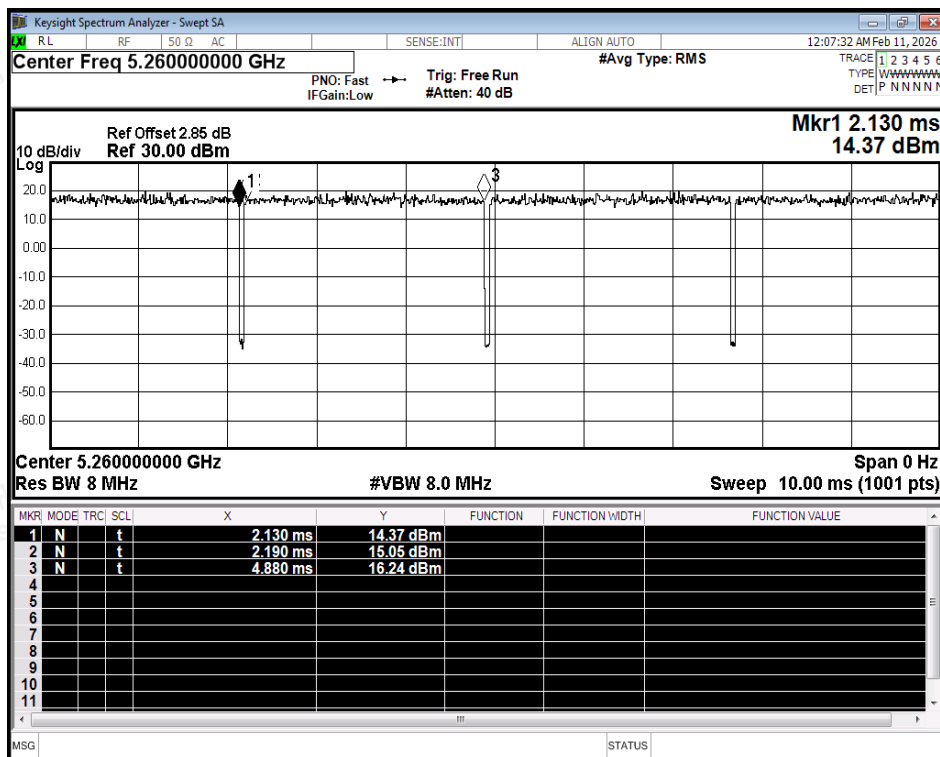

Duty Cycle NVNT a 5260MHz Ant2

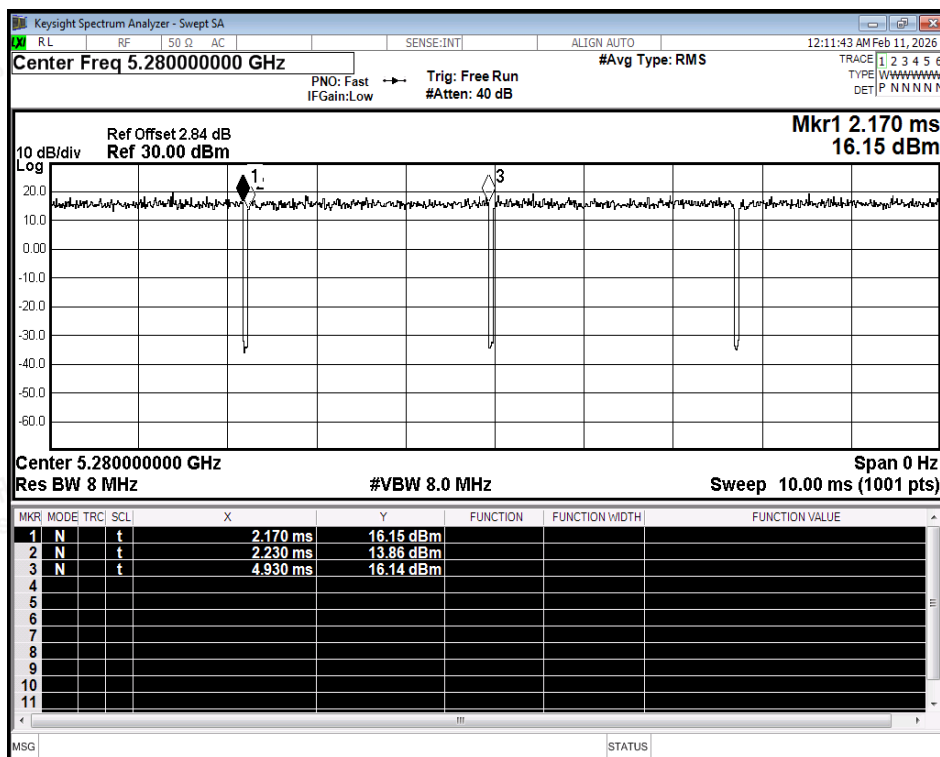

Duty Cycle NVNT a 5280MHz Ant2




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

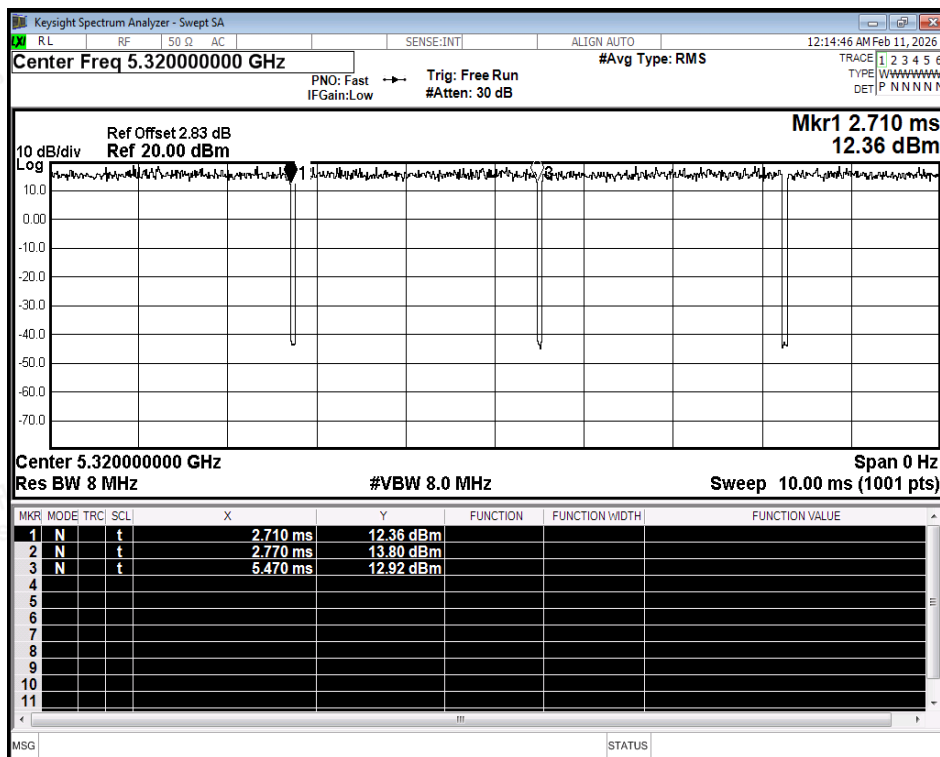

Duty Cycle NVNT a 5320MHz Ant2

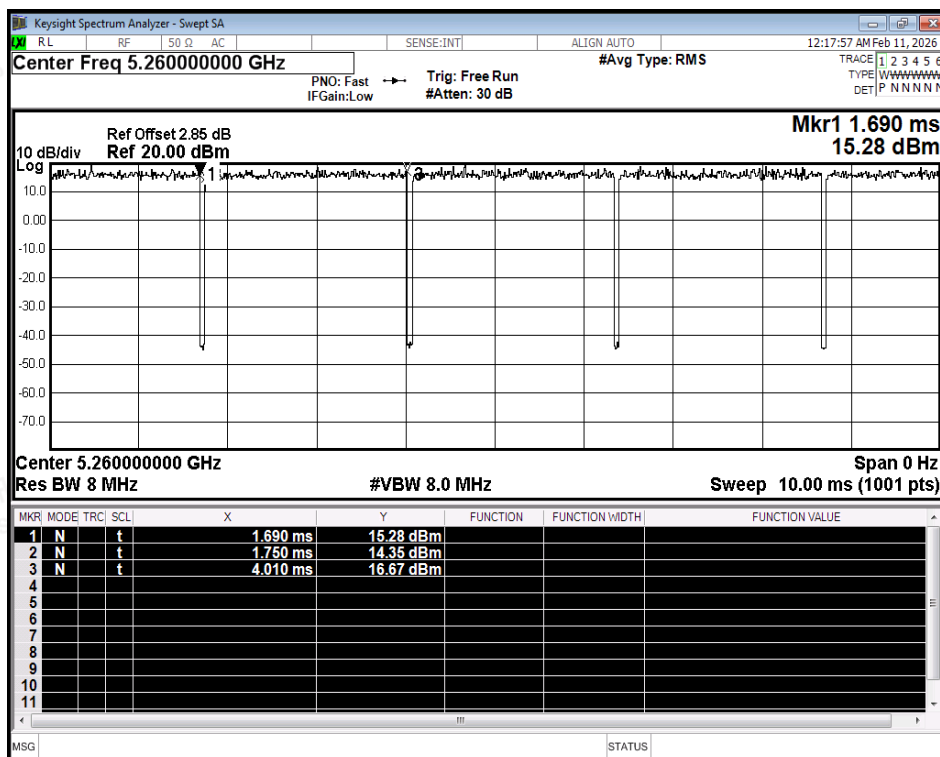

Duty Cycle NVNT n20 5260MHz Ant2




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

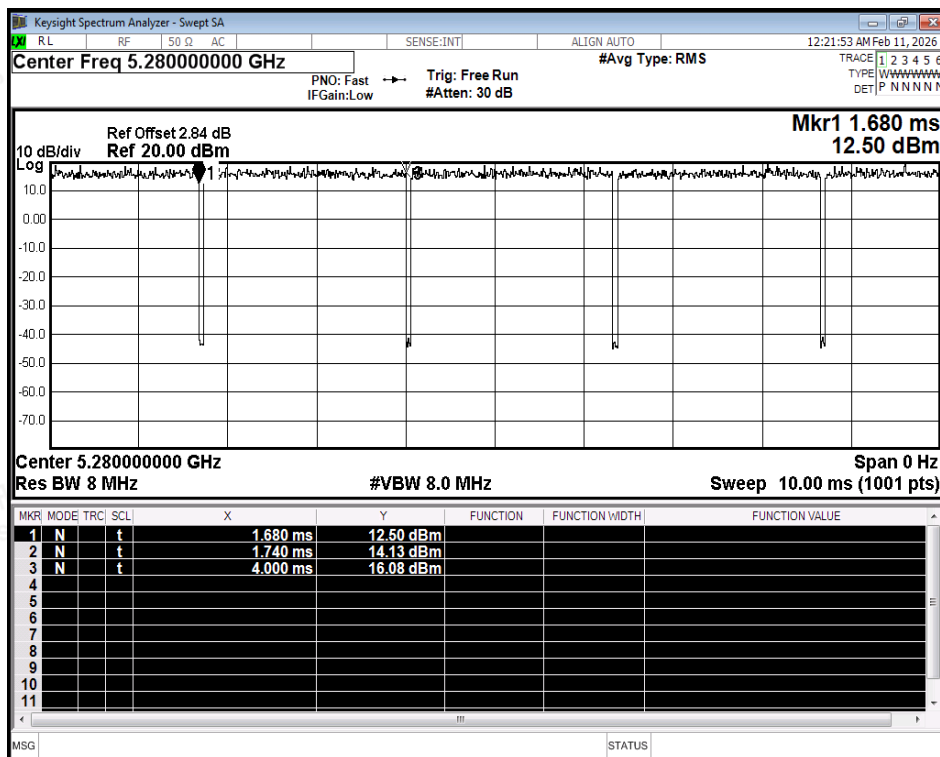

Duty Cycle NVNT n20 5280MHz Ant2

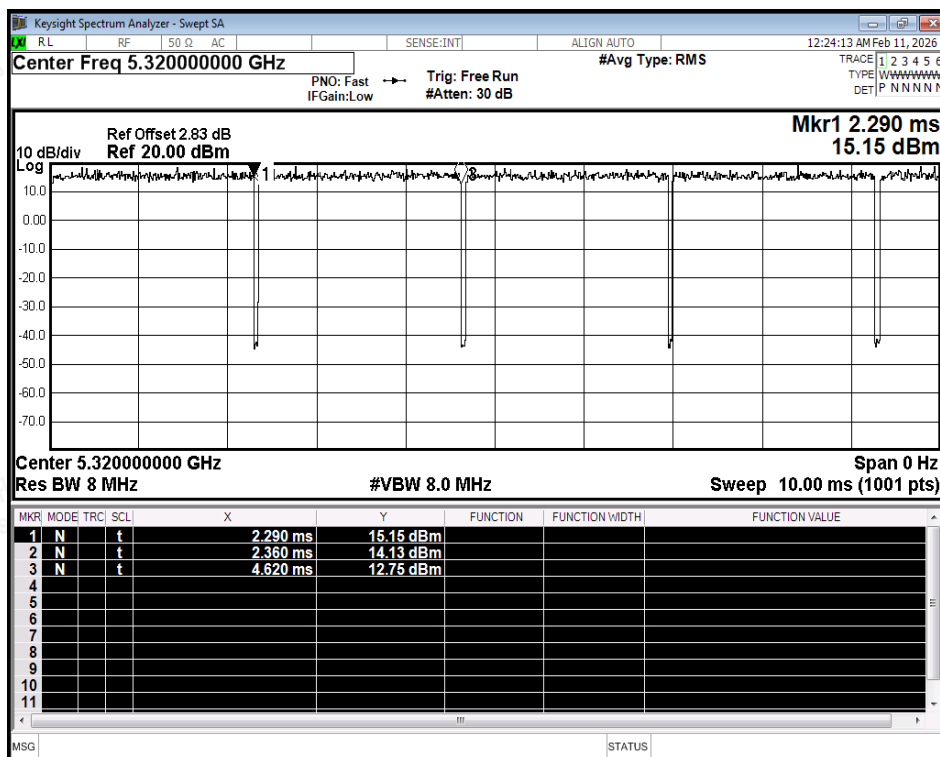

Duty Cycle NVNT n20 5320MHz Ant2




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

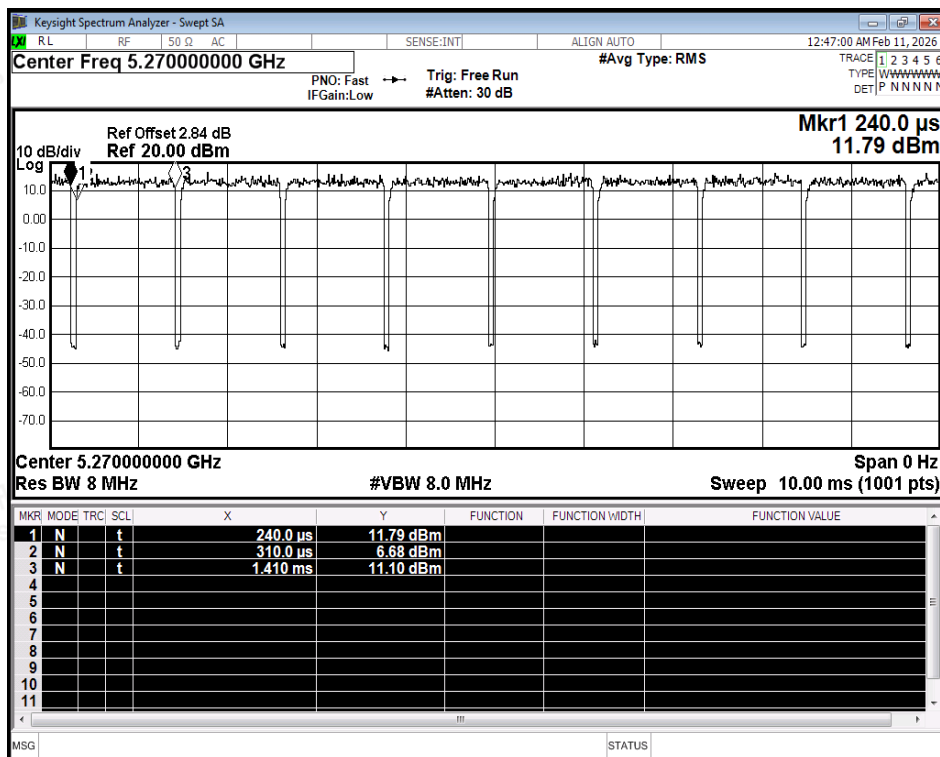

Duty Cycle NVNT n40 5270MHz Ant2

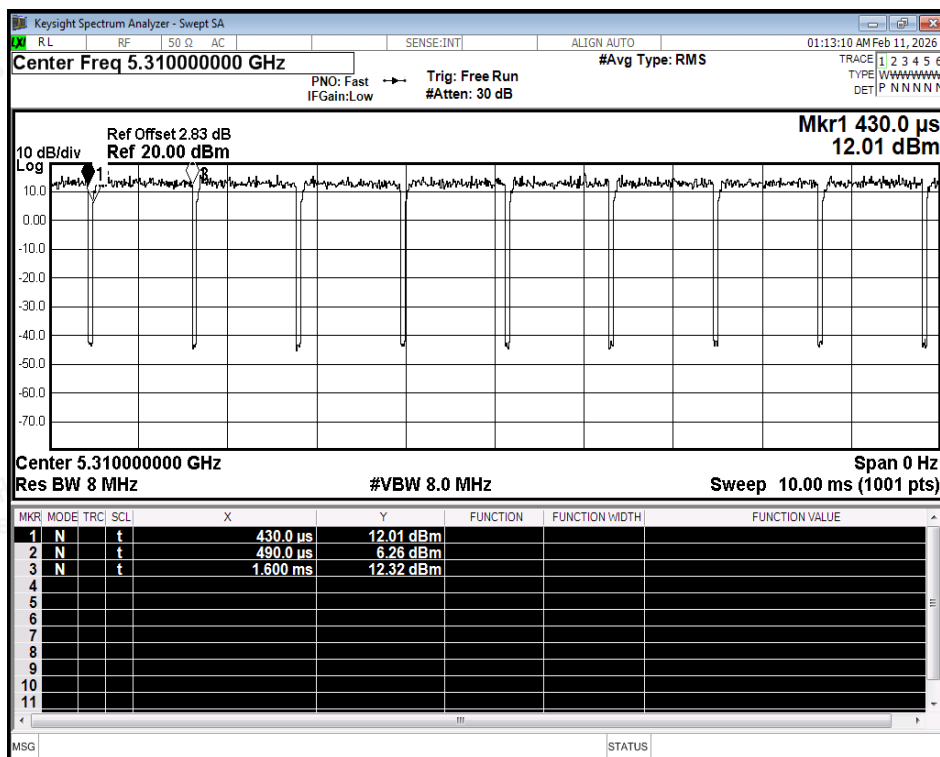

Duty Cycle NVNT n40 5310MHz Ant2




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

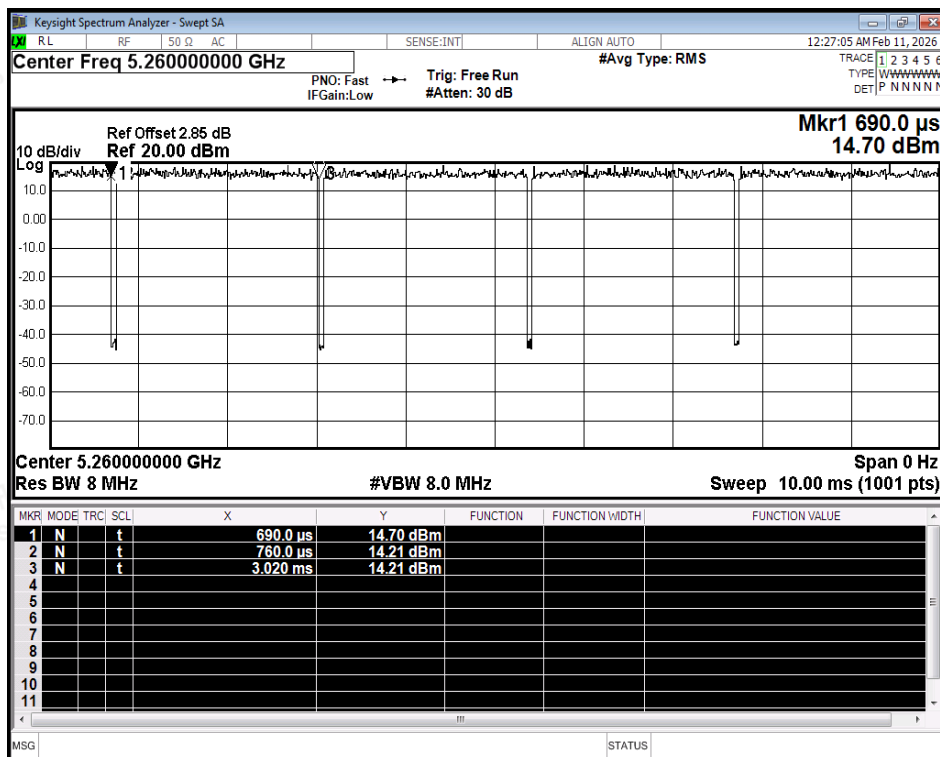

Duty Cycle NVNT ac20 5260MHz Ant2

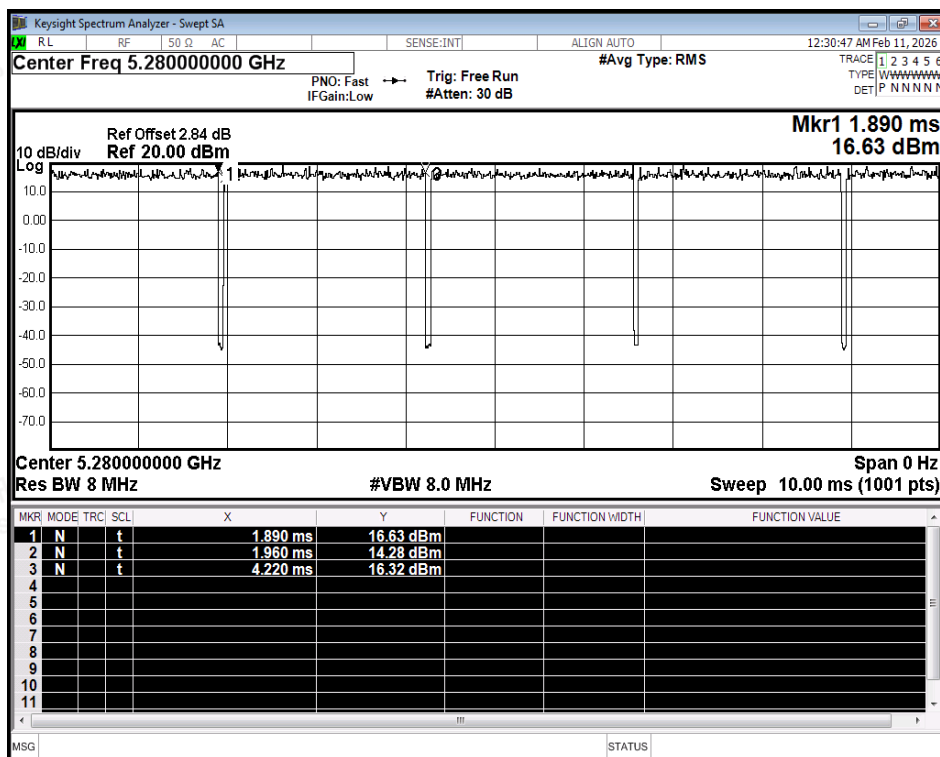

Duty Cycle NVNT ac20 5280MHz Ant2




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

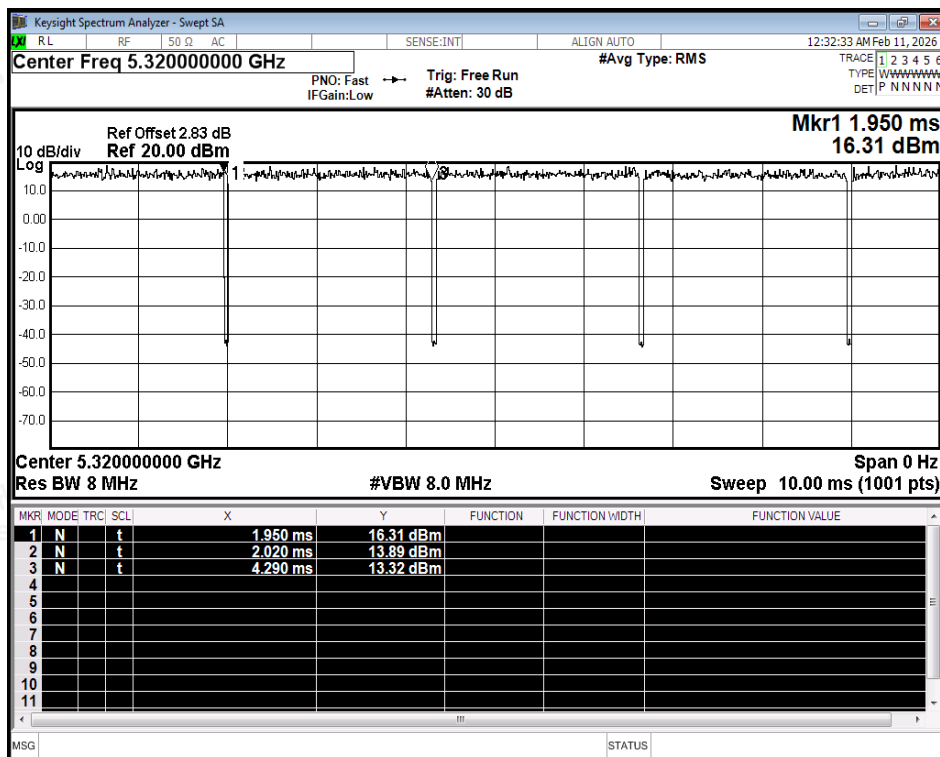

Duty Cycle NVNT ac20 5320MHz Ant2

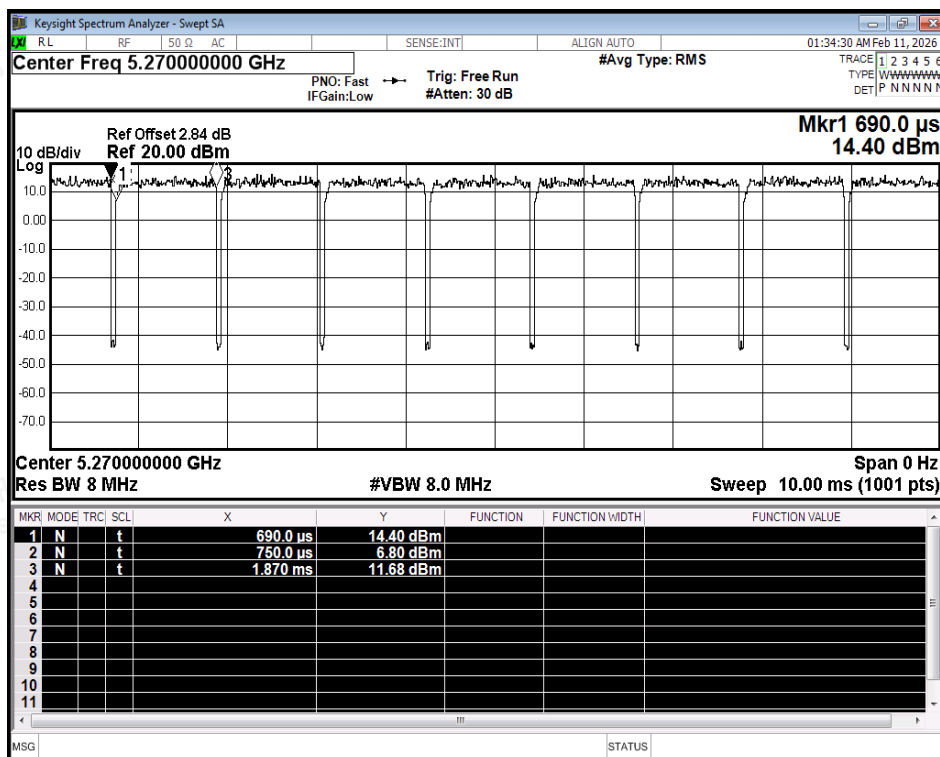

Duty Cycle NVNT ac40 5270MHz Ant2




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

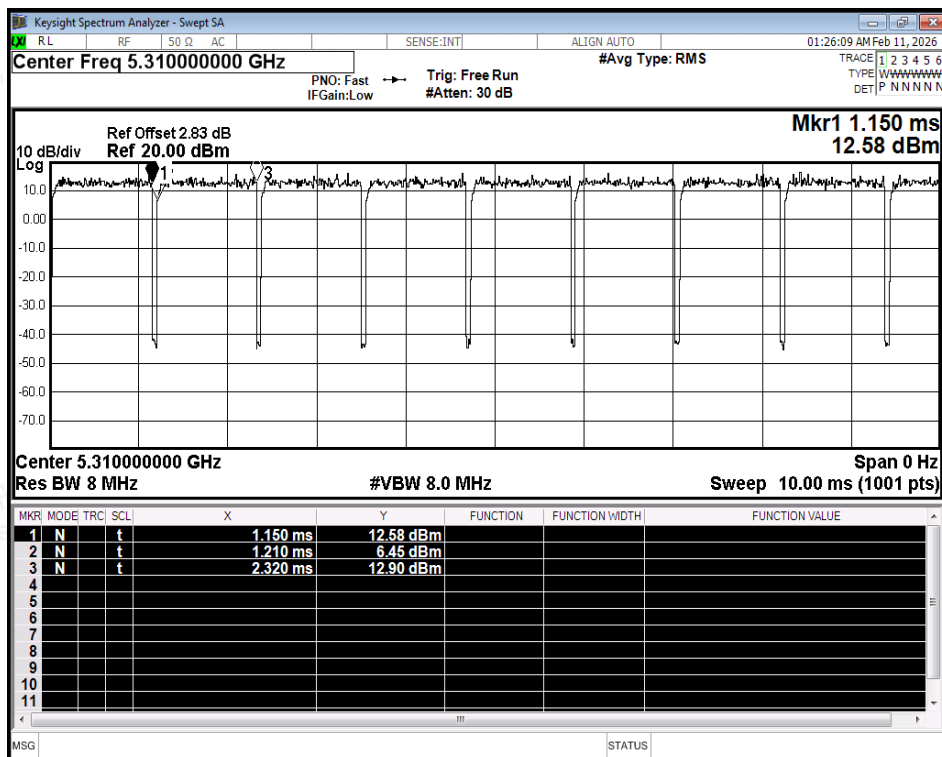

Duty Cycle NVNT ac40 5310MHz Ant2

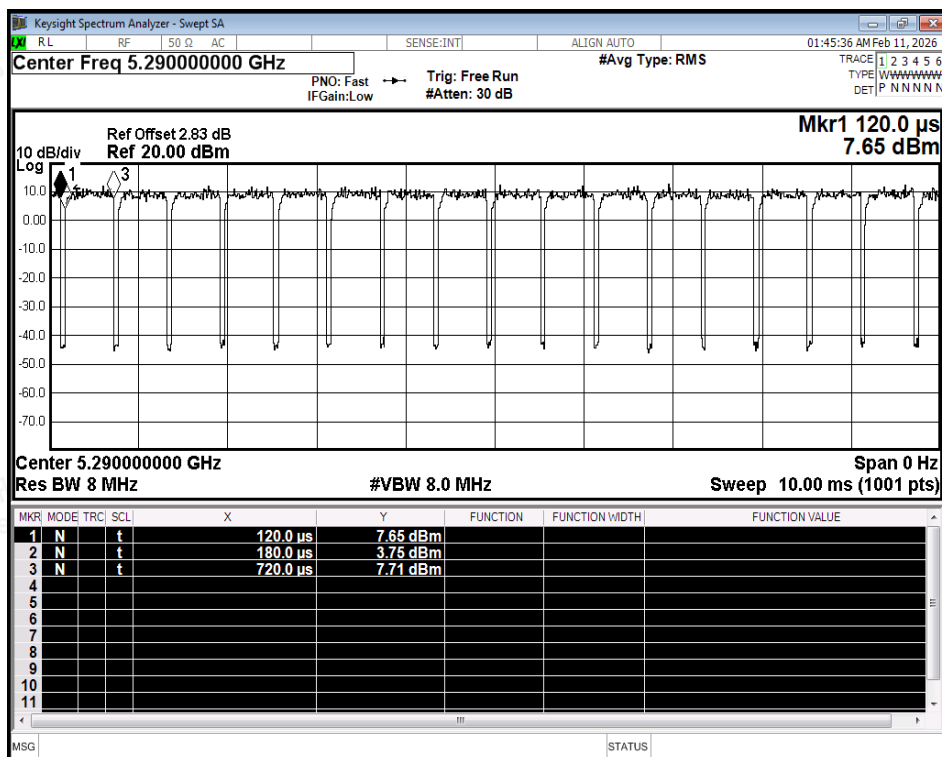

Duty Cycle NVNT ac80 5290MHz Ant2




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

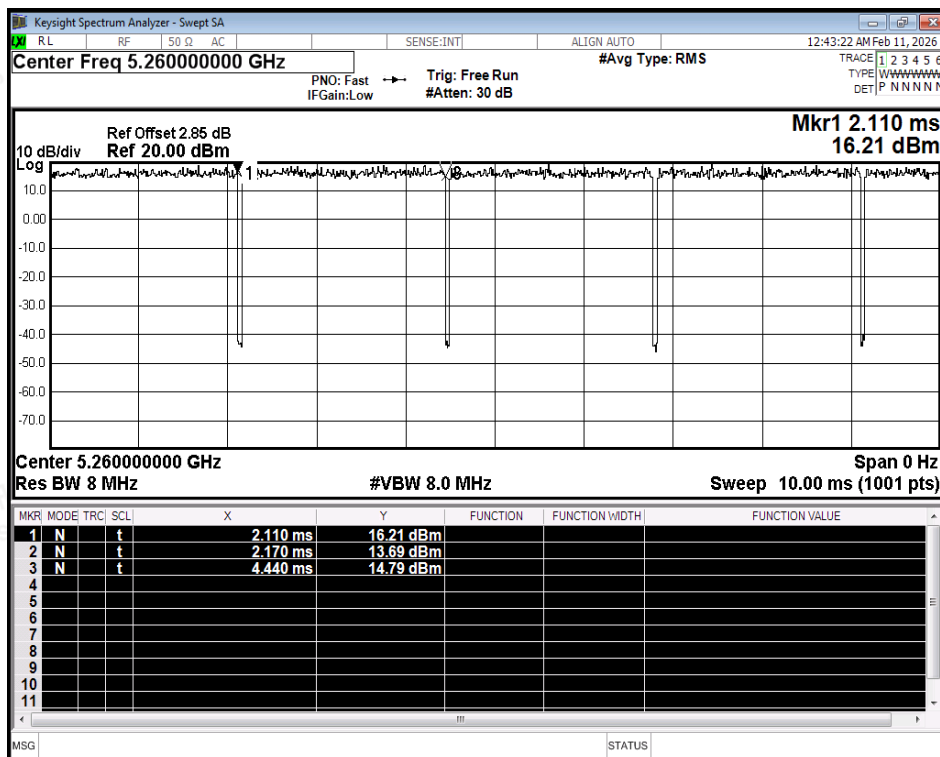

Duty Cycle NVNT ax20 5260MHz Ant2

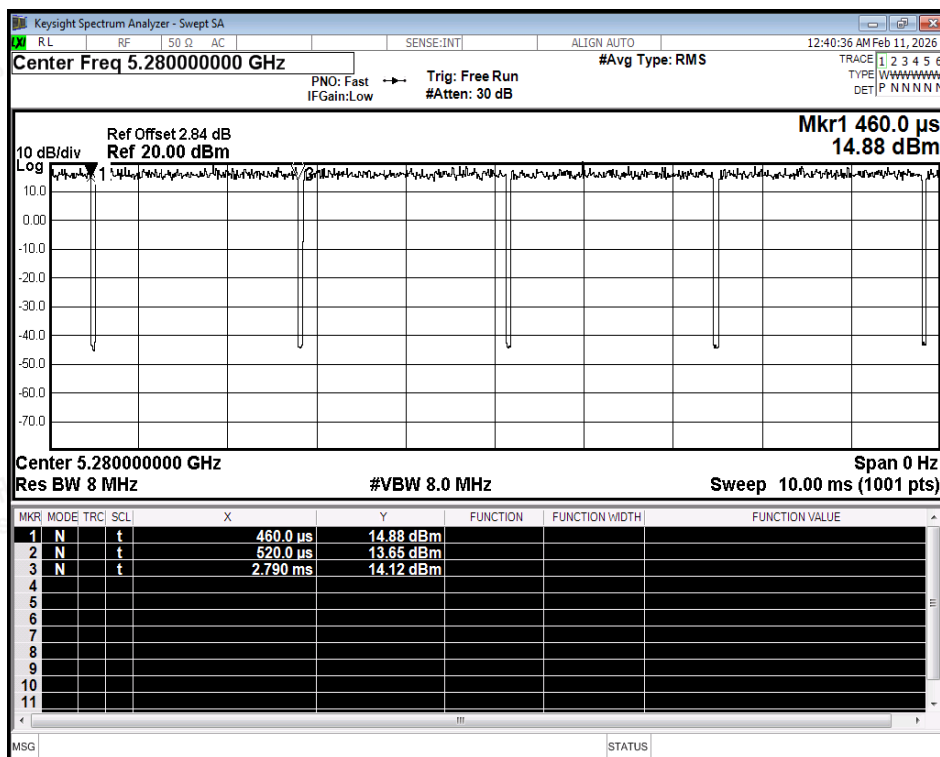

Duty Cycle NVNT ax20 5280MHz Ant2




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

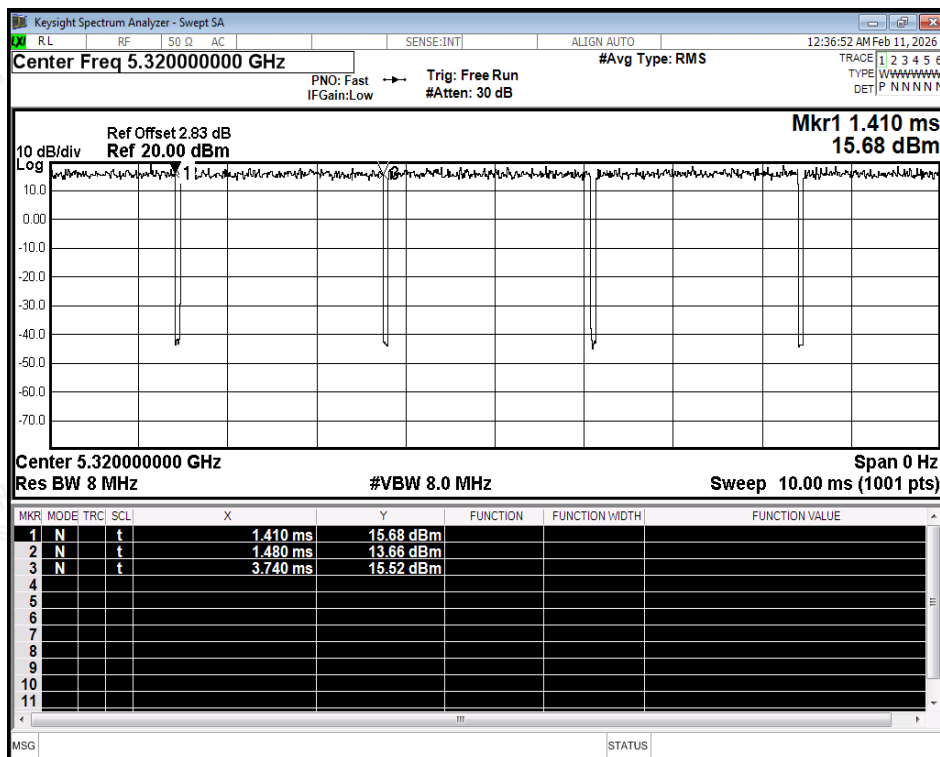

Duty Cycle NVNT ax20 5320MHz Ant2

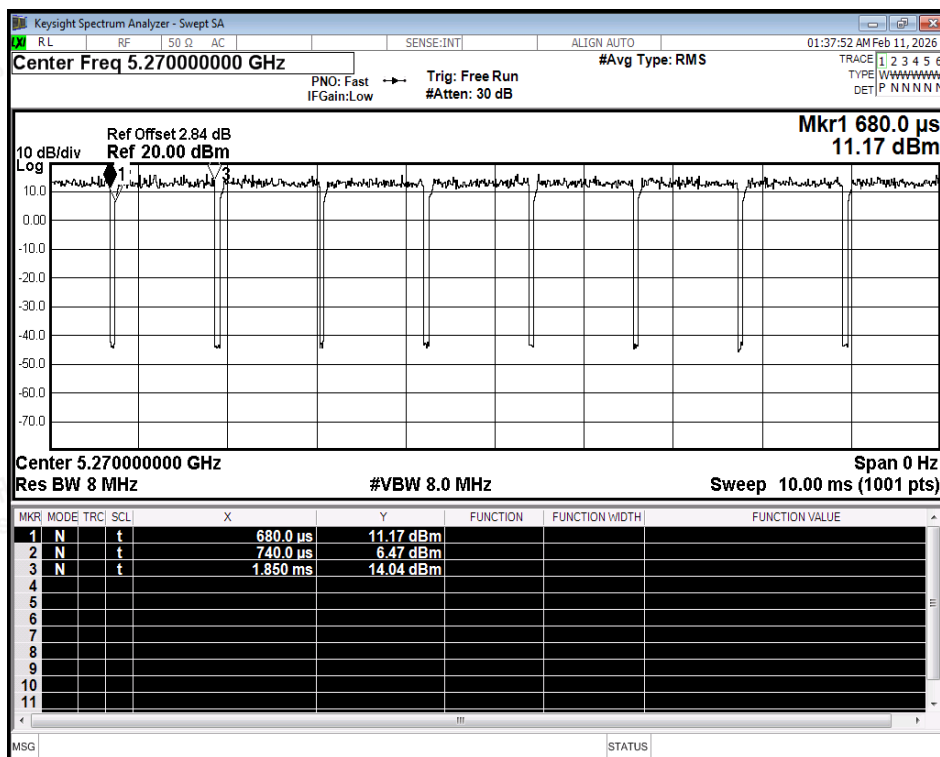

Duty Cycle NVNT ax40 5270MHz Ant2




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

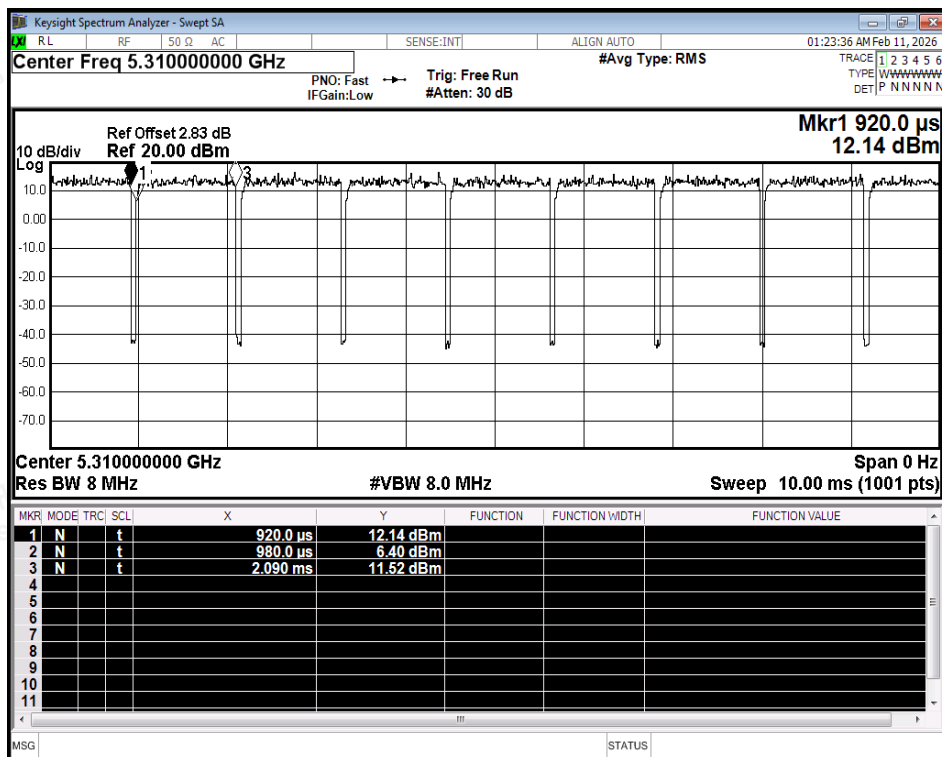

Duty Cycle NVNT ax40 5310MHz Ant2

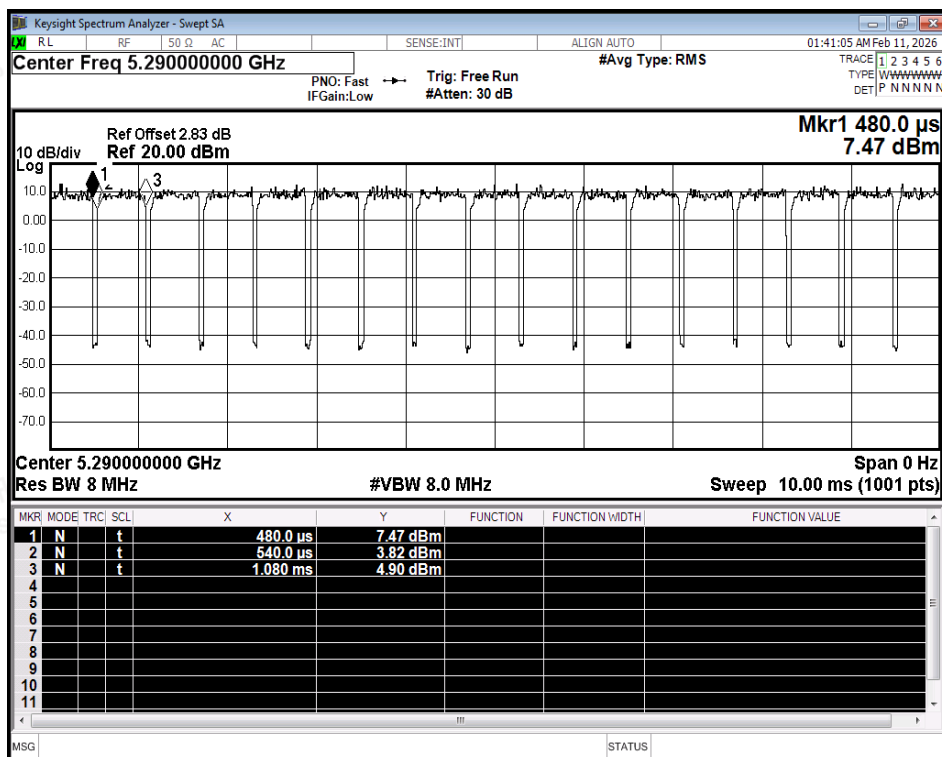

Duty Cycle NVNT ax80 5290MHz Ant2



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity