





PSD NVNT n20 5700MHz Ant2

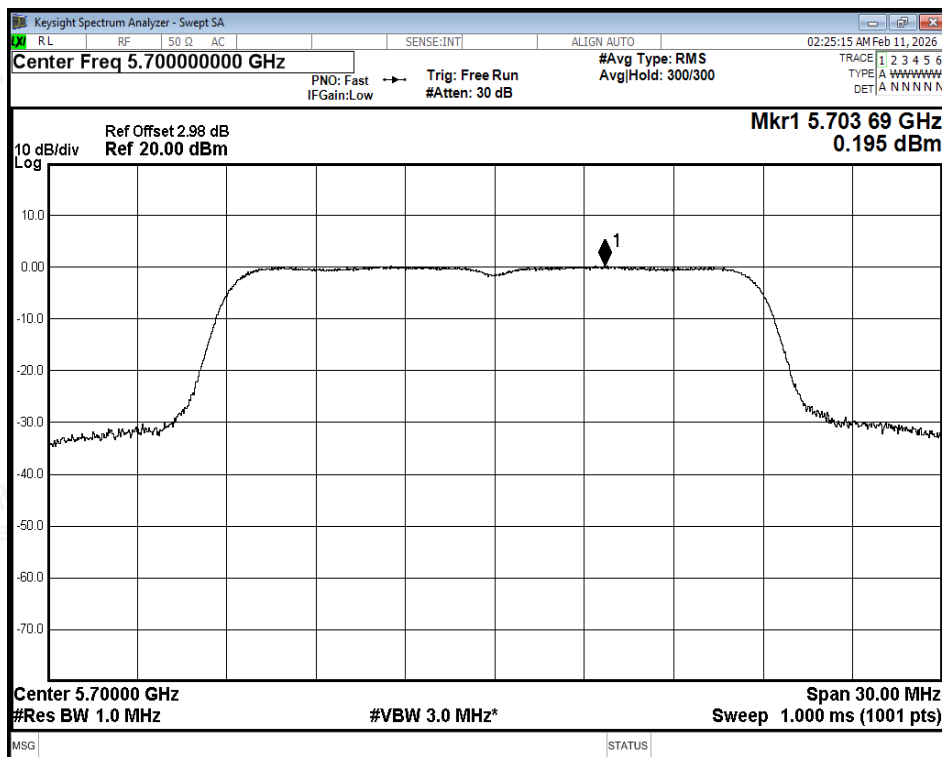

PSD NVNT n40 5510MHz Ant2

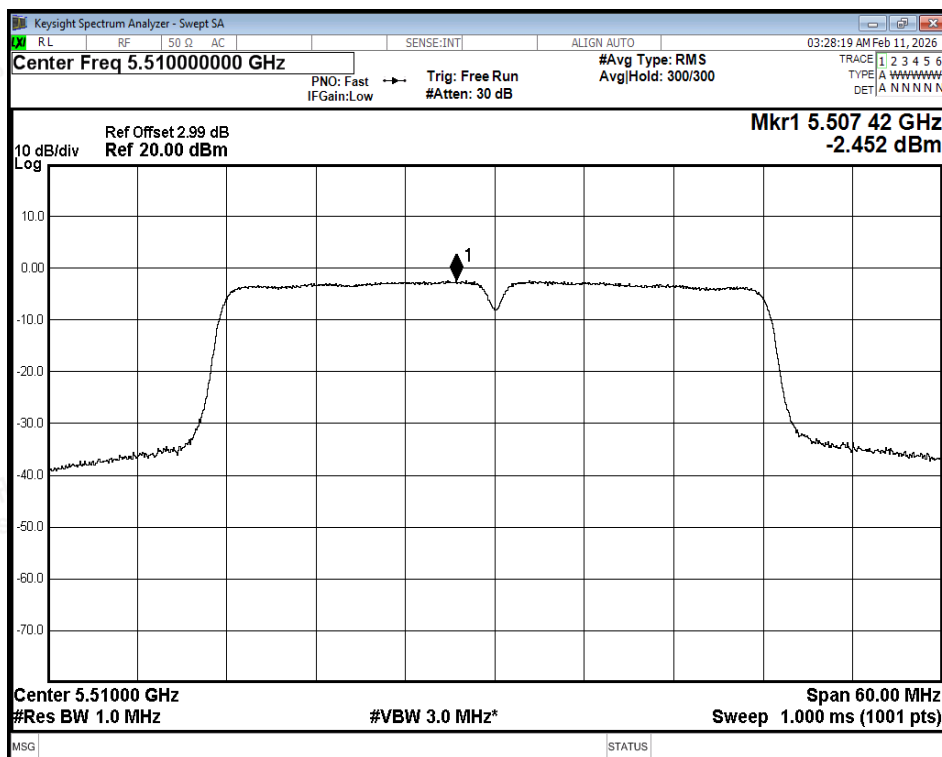


Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

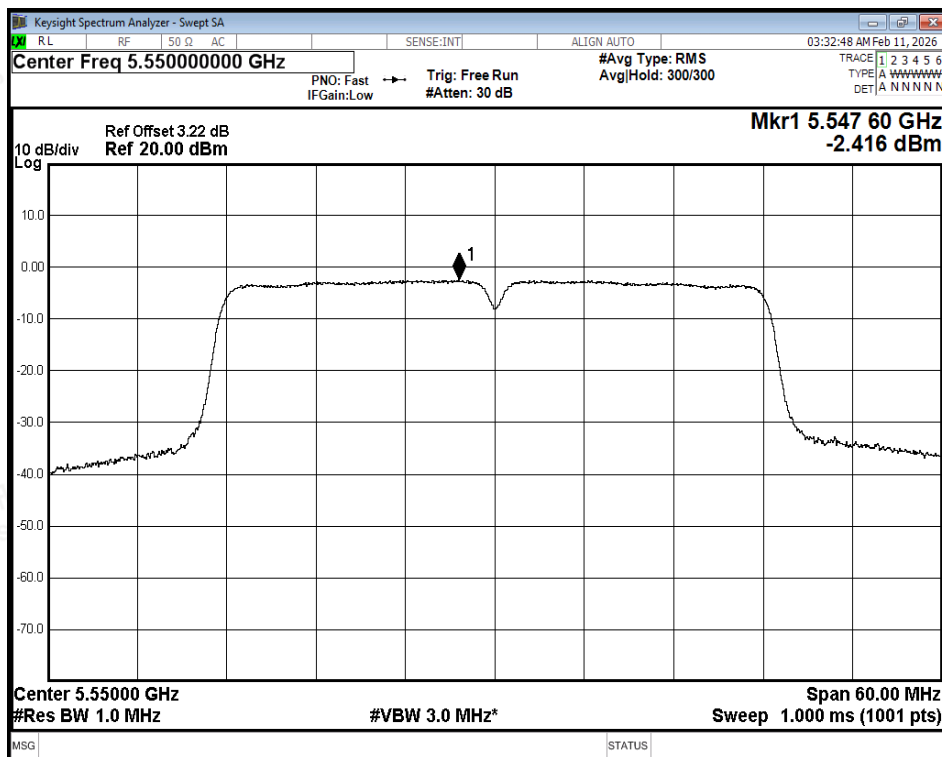

PSD NVNT n40 5550MHz Ant2

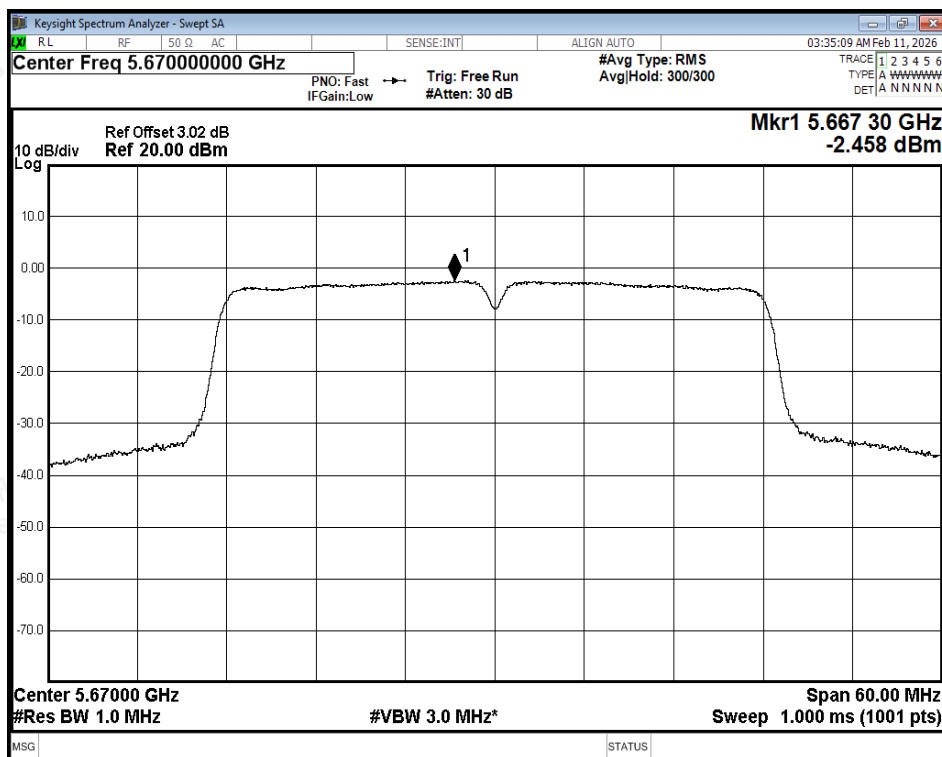

PSD NVNT n40 5670MHz Ant2




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

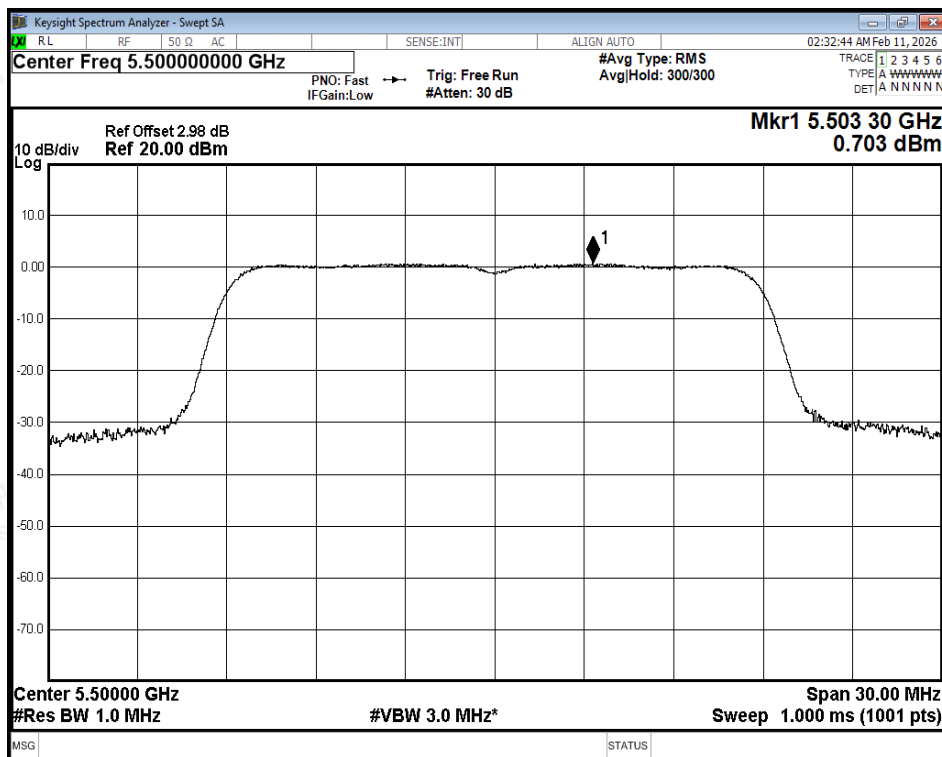

PSD NVNT ac20 5500MHz Ant2

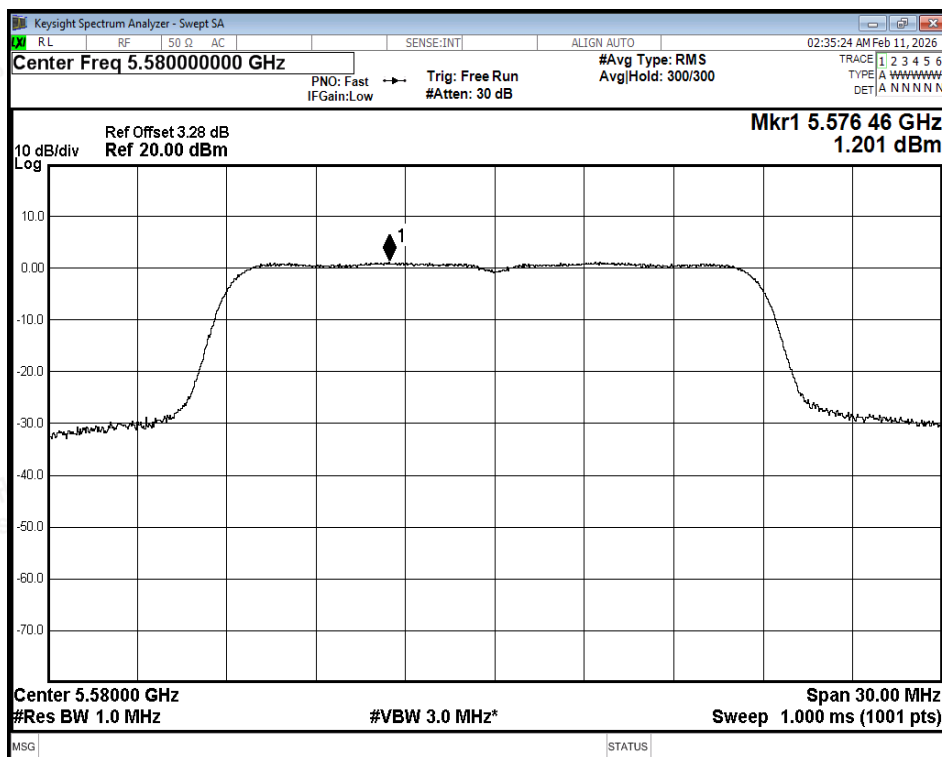

PSD NVNT ac20 5580MHz Ant2




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

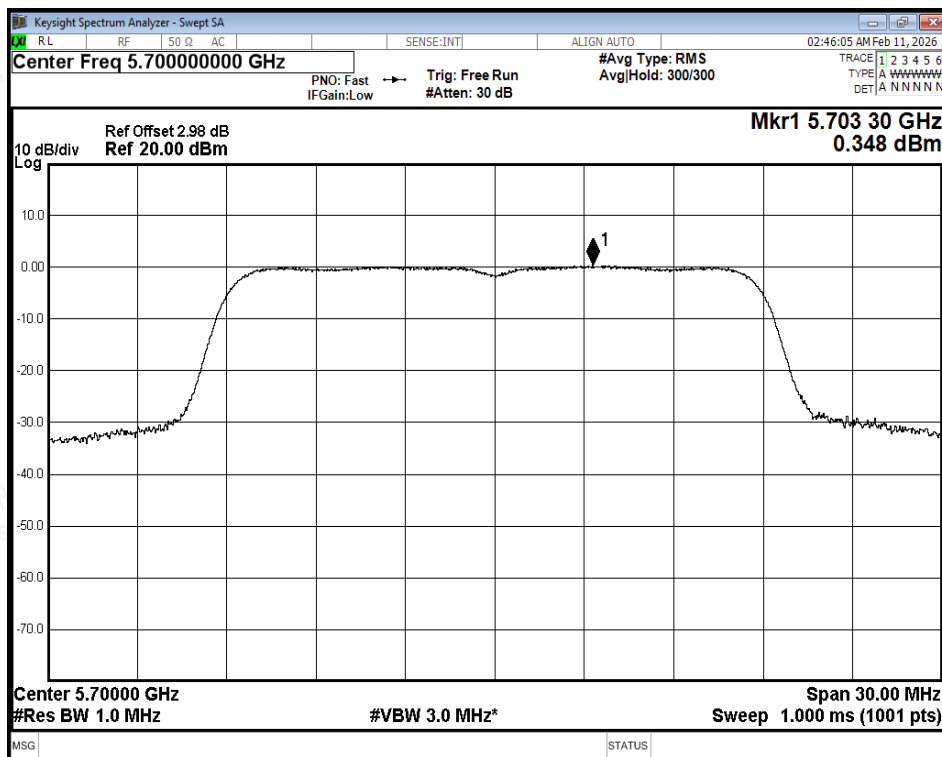

PSD NVNT ac20 5700MHz Ant2

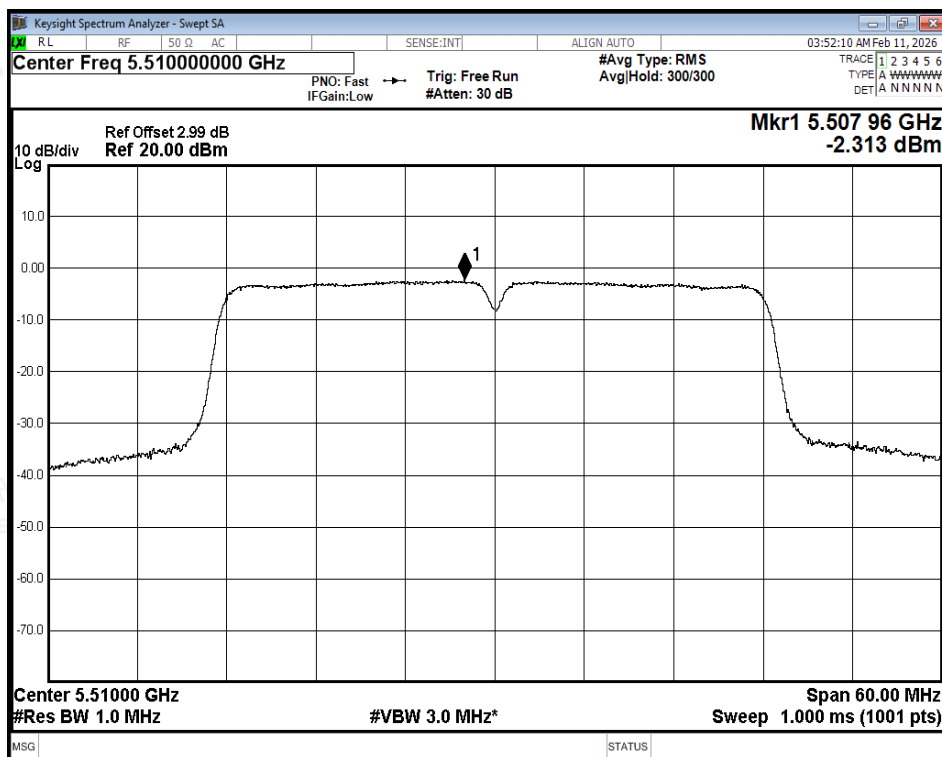

PSD NVNT ac40 5510MHz Ant2




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

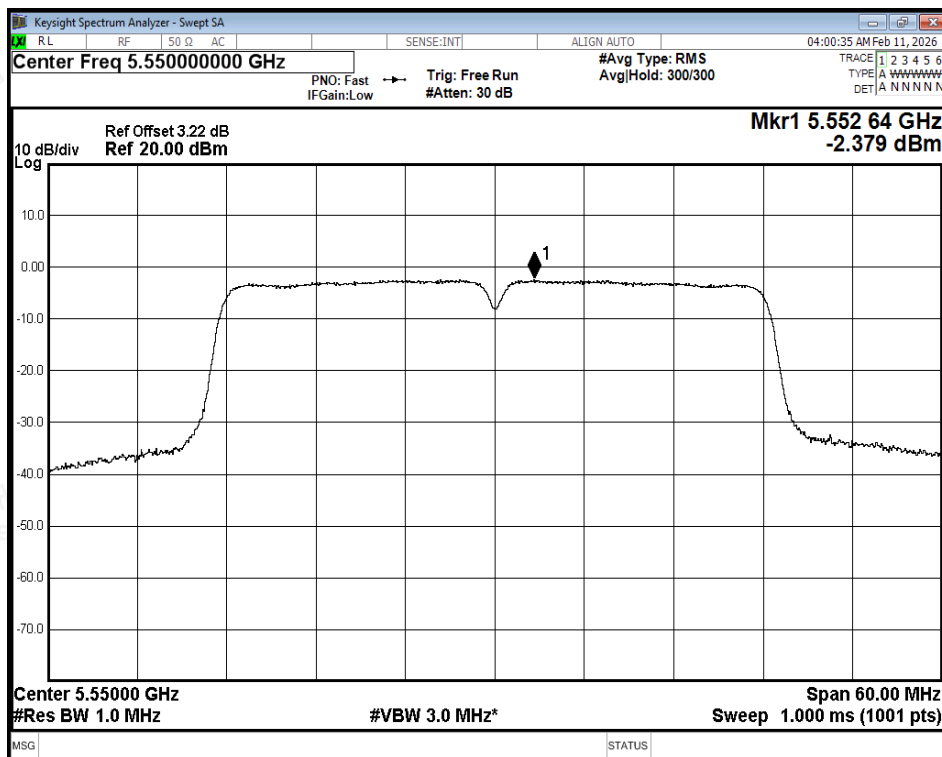


PSD NVNT ac40 5550MHz Ant2

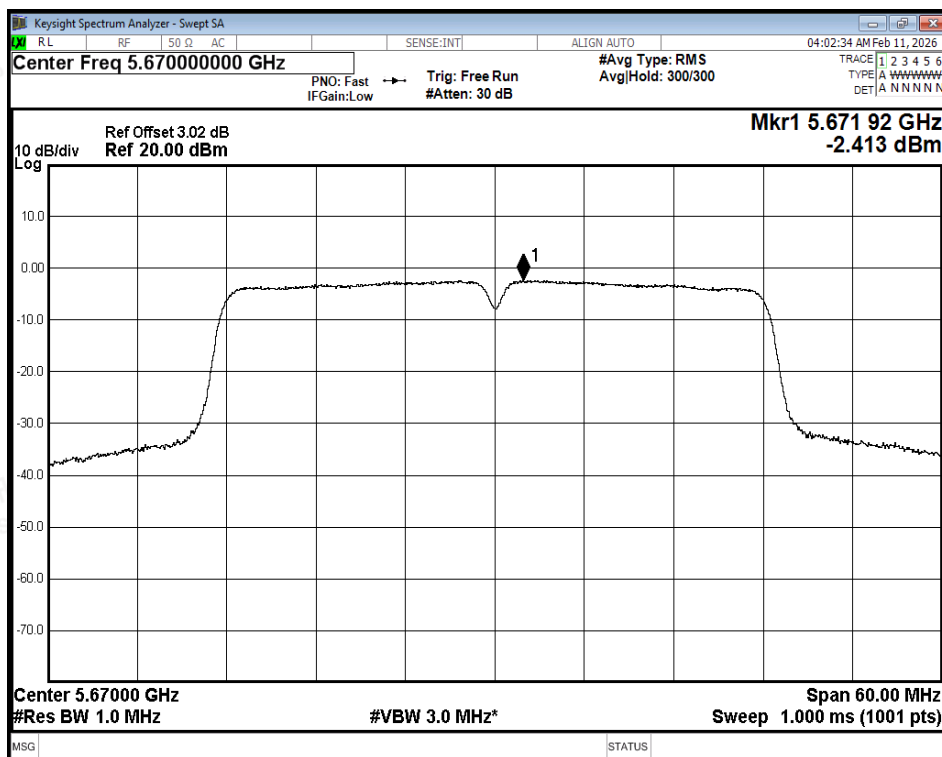


PSD NVNT ac40 5670MHz Ant2



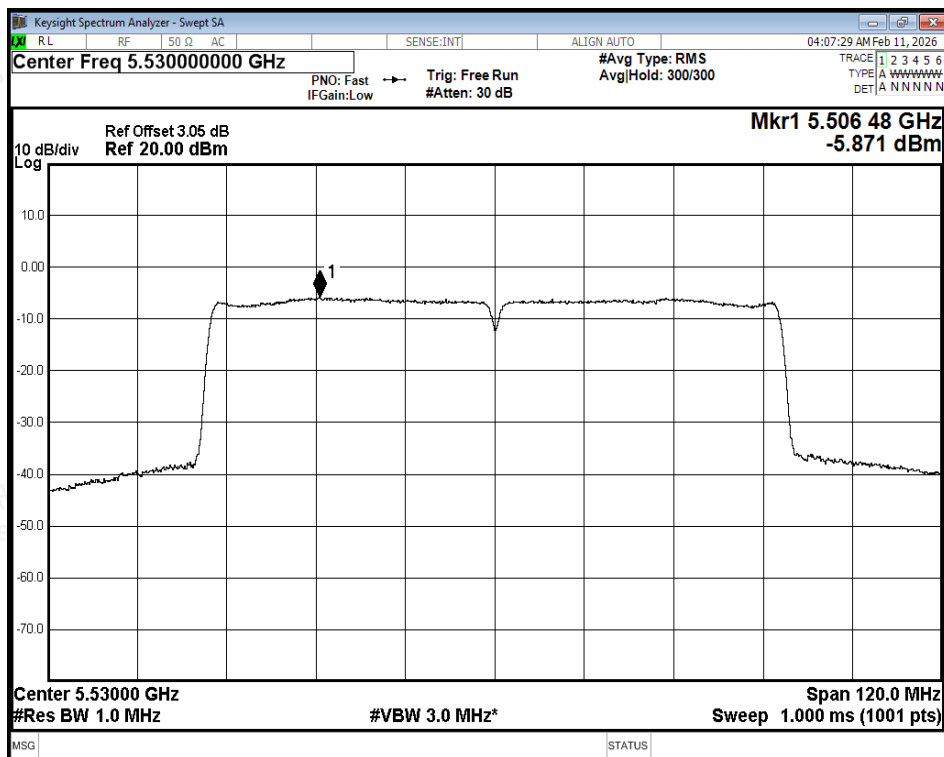

PSD NVNT ac80 5530MHz Ant2

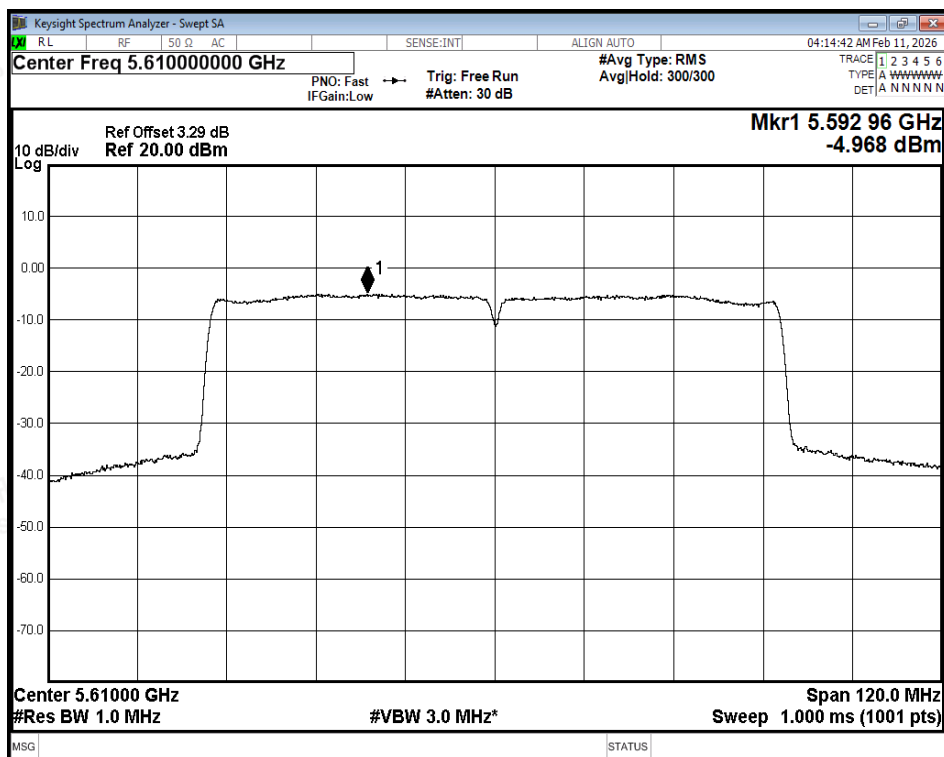

PSD NVNT ac80 5610MHz Ant2




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

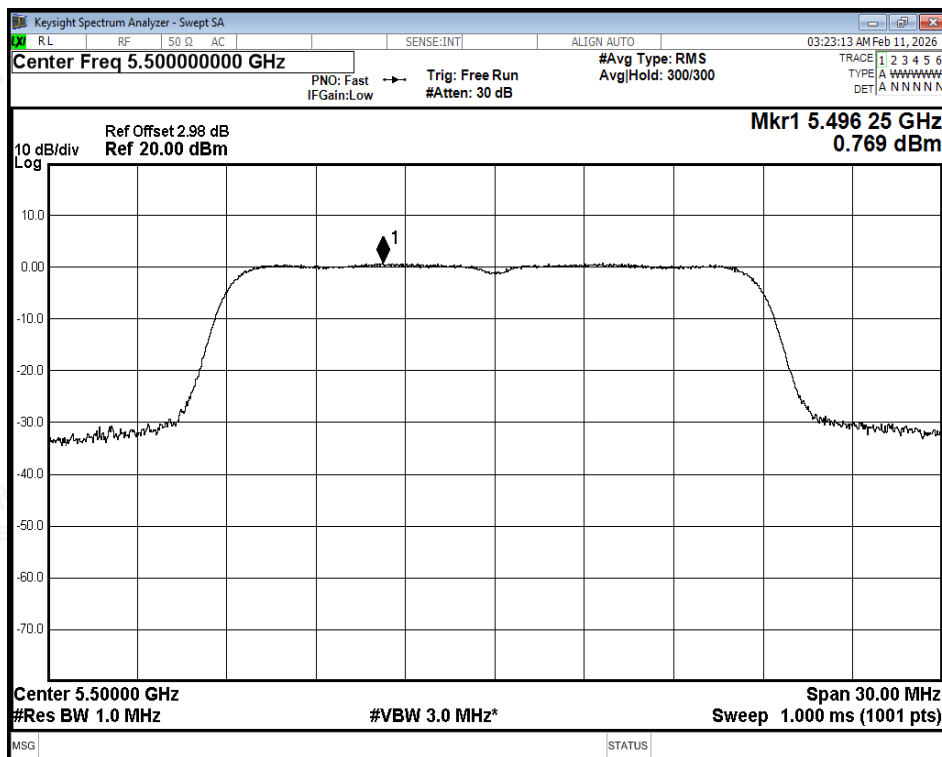

PSD NVNT ax20 5500MHz Ant2

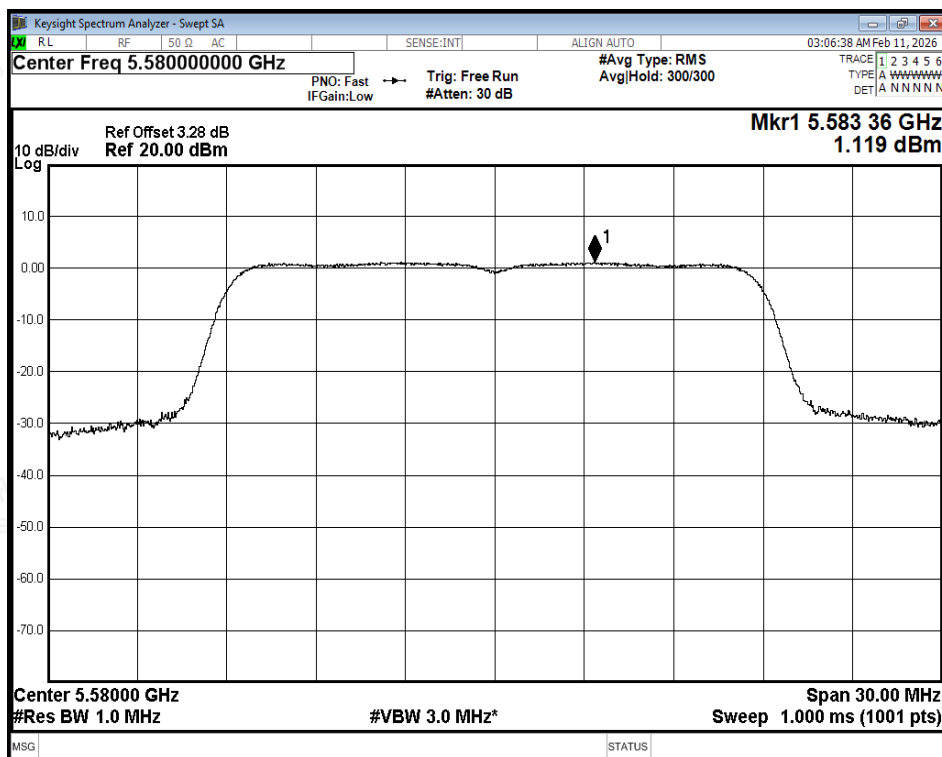

PSD NVNT ax20 5580MHz Ant2




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

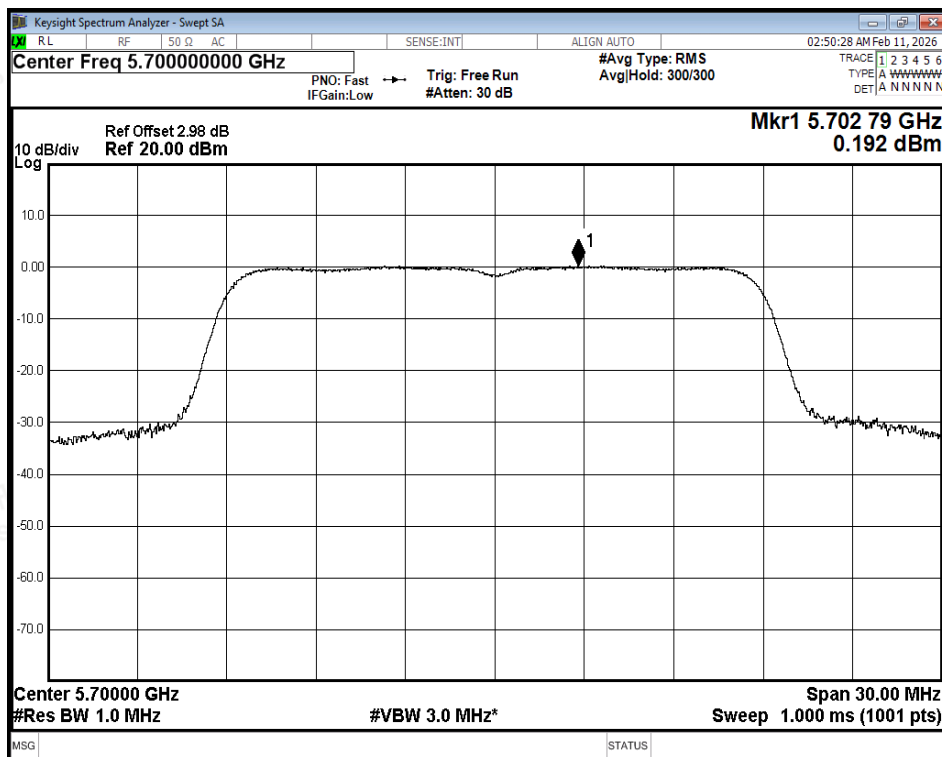


PSD NVNT ax20 5700MHz Ant2

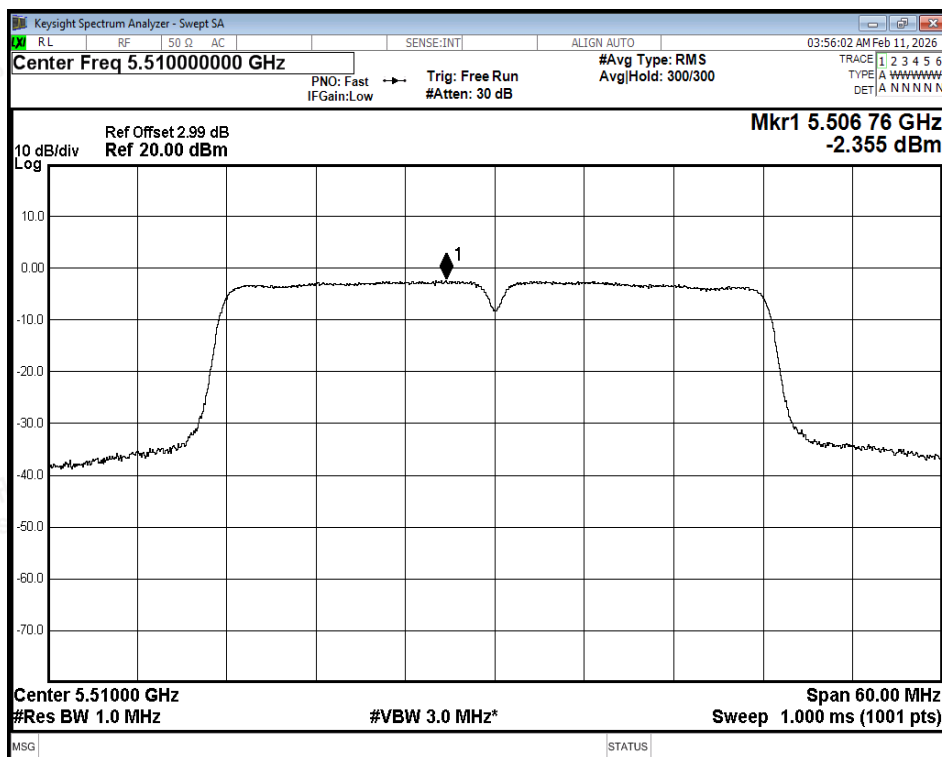


PSD NVNT ax40 5510MHz Ant2



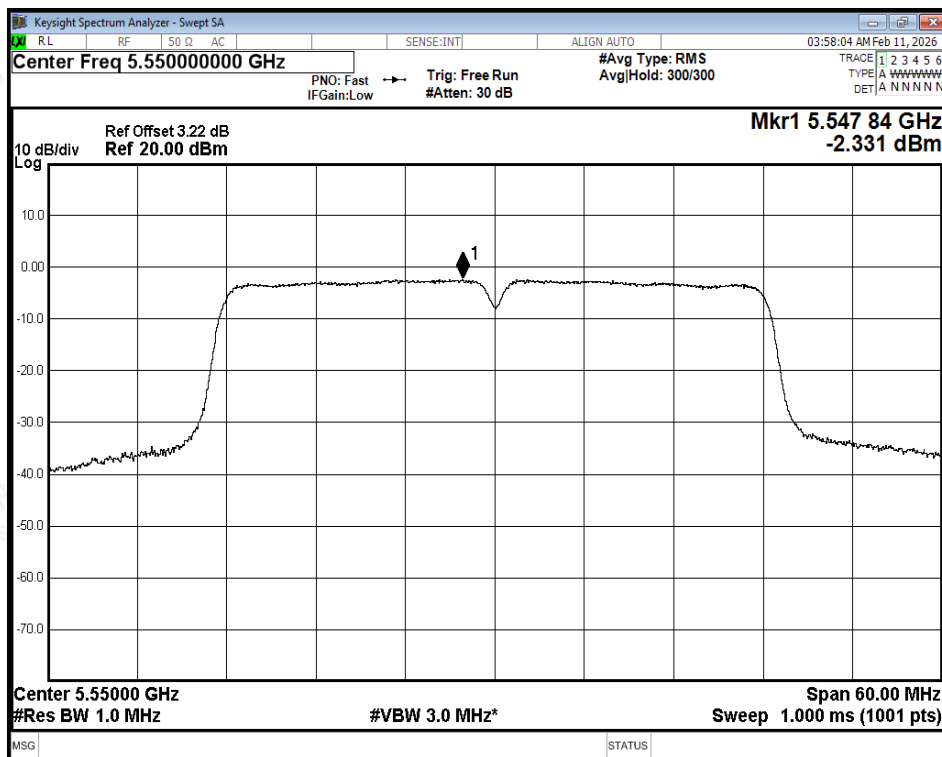


PSD NVNT ax40 5550MHz Ant2

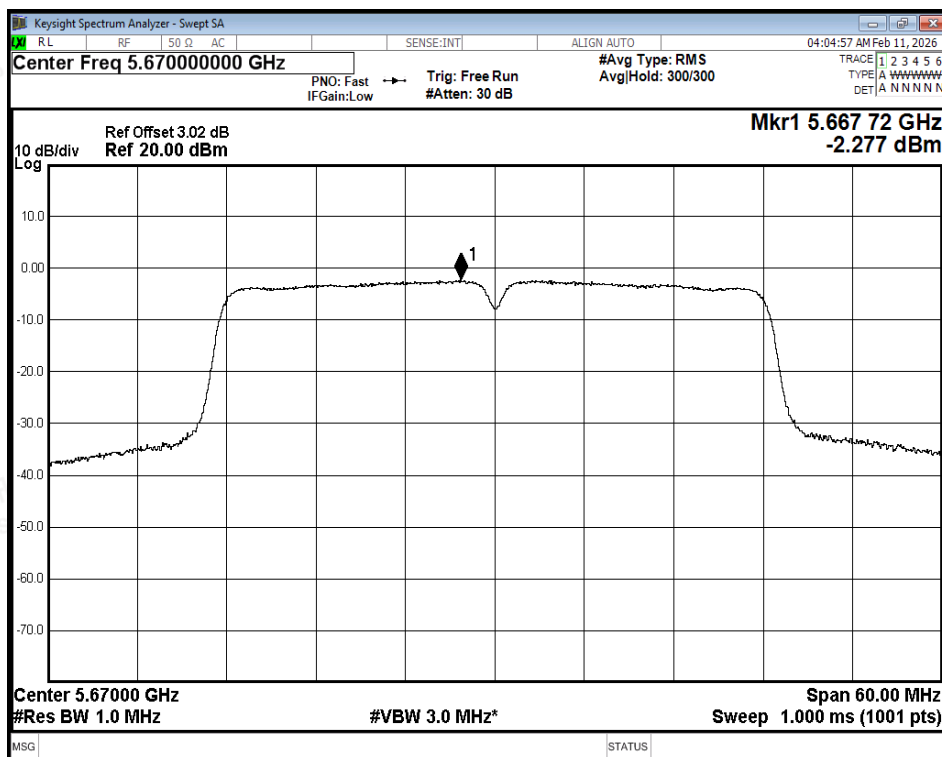


PSD NVNT ax40 5670MHz Ant2



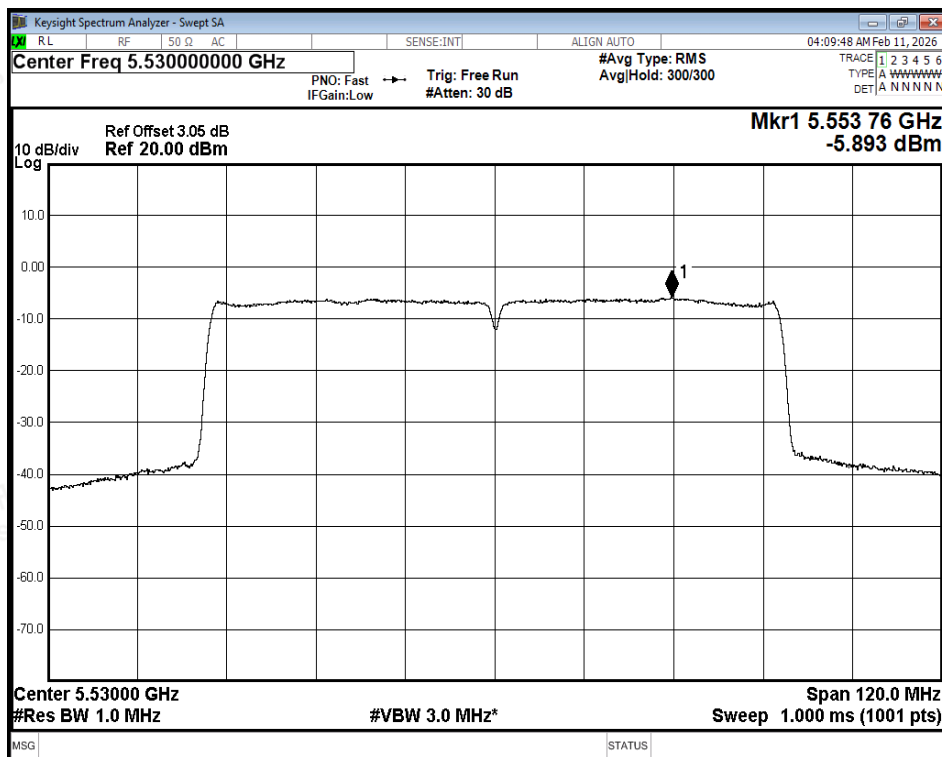

PSD NVNT ax80 5530MHz Ant2

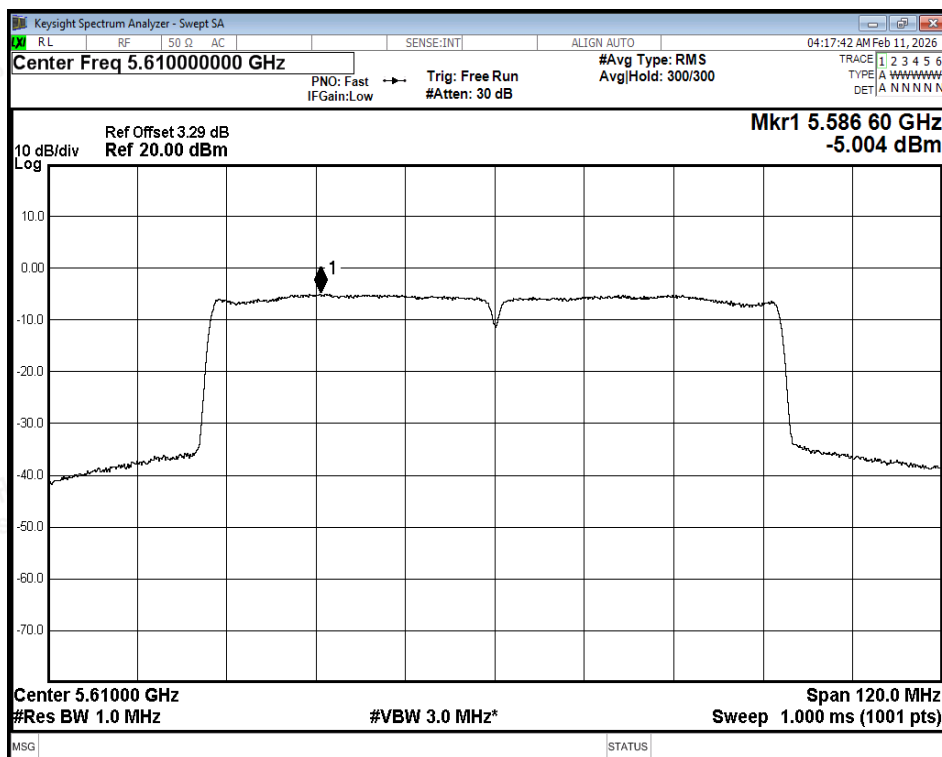

PSD NVNT ax80 5610MHz Ant2





C.4 Restrict Band

Condition	Mode	Frequency (MHz)	Antenna	Spur Freq (MHz)	Power (dBm)	Gain (dBi)	E (dBuV/m)	Detector	Limit (dBuV/m)	Verdict
NVNT	a	5500	Ant1	5460	-51.08	2	46.15	Peak	68.2	Pass
NVNT	a	5500	Ant1	5460	-57.63	2	39.6	Average	54	Pass
NVNT	a	5500	Ant1	5462.4	-48.25	2	48.98	Peak	68.2	Pass
NVNT	a	5500	Ant1	5469.8	-56.96	2	40.27	Average	54	Pass
NVNT	a	5500	Ant1	5470	-49.1	2	48.13	Peak	68.2	Pass
NVNT	a	5500	Ant1	5470	-56.98	2	40.25	Average	54	Pass
NVNT	a	5700	Ant1	5725	-40.22	2	57.01	Peak	68.2	Pass
NVNT	a	5700	Ant1	5725	-55.64	2	41.59	Average	54	Pass
NVNT	a	5700	Ant1	5725	-40.22	2	57.01	Peak	68.2	Pass
NVNT	a	5700	Ant1	5725	-55.64	2	41.59	Average	54	Pass
NVNT	a	5700	Ant1	5735	-50.28	2	46.95	Peak	68.2	Pass
NVNT	a	5700	Ant1	5735	-57.66	2	39.57	Average	54	Pass
NVNT	n20	5500	Ant1	5460	-58.03	2	39.2	Peak	68.2	Pass
NVNT	n20	5500	Ant1	5460	-65.73	2	31.5	Average	54	Pass
NVNT	n20	5500	Ant1	5468.2	-47.62	2	49.61	Peak	68.2	Pass
NVNT	n20	5500	Ant1	5469.8	-60.86	2	36.37	Average	54	Pass
NVNT	n20	5500	Ant1	5470	-48.83	2	48.4	Peak	68.2	Pass
NVNT	n20	5500	Ant1	5470	-60.97	2	36.26	Average	54	Pass
NVNT	n20	5700	Ant1	5725	-44.21	2	53.02	Peak	68.2	Pass
NVNT	n20	5700	Ant1	5725	-57.24	2	39.99	Average	54	Pass
NVNT	n20	5700	Ant1	5725.4	-43.99	2	53.24	Peak	68.2	Pass
NVNT	n20	5700	Ant1	5725	-57.24	2	39.99	Average	54	Pass
NVNT	n20	5700	Ant1	5735	-57.3	2	39.93	Peak	68.2	Pass
NVNT	n20	5700	Ant1	5735	-64.92	2	32.31	Average	54	Pass
NVNT	n40	5510	Ant1	5460	-50.7	2	46.53	Peak	68.2	Pass
NVNT	n40	5510	Ant1	5460	-57.4	2	39.83	Average	54	Pass
NVNT	n40	5510	Ant1	5468.2	-45.02	2	52.21	Peak	68.2	Pass
NVNT	n40	5510	Ant1	5470	-56.21	2	41.02	Average	54	Pass
NVNT	n40	5510	Ant1	5470	-47.52	2	49.71	Peak	68.2	Pass
NVNT	n40	5510	Ant1	5470	-56.21	2	41.02	Average	54	Pass
NVNT	n40	5670	Ant1	5725	-52.1	2	45.13	Peak	68.2	Pass
NVNT	n40	5670	Ant1	5725	-57.98	2	39.25	Average	54	Pass
NVNT	n40	5670	Ant1	5729.6	-48.89	2	48.34	Peak	68.2	Pass
NVNT	n40	5670	Ant1	5735	-57.62	2	39.61	Average	54	Pass
NVNT	n40	5670	Ant1	5735	-50.33	2	46.9	Peak	68.2	Pass
NVNT	n40	5670	Ant1	5735	-57.62	2	39.61	Average	54	Pass
NVNT	ac20	5500	Ant1	5460	-58.02	2	39.21	Peak	68.2	Pass



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



NVNT	ac20	5500	Ant1	5460	-65.64	2	31.59	Average	54	Pass
NVNT	ac20	5500	Ant1	5470	-47.63	2	49.6	Peak	68.2	Pass
NVNT	ac20	5500	Ant1	5470	-61.36	2	35.87	Average	54	Pass
NVNT	ac20	5500	Ant1	5470	-47.63	2	49.6	Peak	68.2	Pass
NVNT	ac20	5500	Ant1	5470	-61.36	2	35.87	Average	54	Pass
NVNT	ac20	5700	Ant1	5725	-44.23	2	53	Peak	68.2	Pass
NVNT	ac20	5700	Ant1	5725	-55.06	2	42.17	Average	54	Pass
NVNT	ac20	5700	Ant1	5725.4	-39.58	2	57.65	Peak	68.2	Pass
NVNT	ac20	5700	Ant1	5725	-55.06	2	42.17	Average	54	Pass
NVNT	ac20	5700	Ant1	5735	-50.89	2	46.34	Peak	68.2	Pass
NVNT	ac20	5700	Ant1	5735	-57.66	2	39.57	Average	54	Pass
NVNT	ac40	5510	Ant1	5460	-50.47	2	46.76	Peak	68.2	Pass
NVNT	ac40	5510	Ant1	5460	-57.46	2	39.77	Average	54	Pass
NVNT	ac40	5510	Ant1	5467.2	-45.52	2	51.71	Peak	68.2	Pass
NVNT	ac40	5510	Ant1	5470	-56	2	41.23	Average	54	Pass
NVNT	ac40	5510	Ant1	5470	-48.18	2	49.05	Peak	68.2	Pass
NVNT	ac40	5510	Ant1	5470	-56	2	41.23	Average	54	Pass
NVNT	ac40	5670	Ant1	5725	-51.46	2	45.77	Peak	68.2	Pass
NVNT	ac40	5670	Ant1	5725	-57.97	2	39.26	Average	54	Pass
NVNT	ac40	5670	Ant1	5728	-48.57	2	48.66	Peak	68.2	Pass
NVNT	ac40	5670	Ant1	5732.8	-57.59	2	39.64	Average	54	Pass
NVNT	ac40	5670	Ant1	5735	-50.85	2	46.38	Peak	68.2	Pass
NVNT	ac40	5670	Ant1	5735	-57.86	2	39.37	Average	54	Pass
NVNT	ac80	5530	Ant1	5460	-55.29	2	41.94	Peak	68.2	Pass
NVNT	ac80	5530	Ant1	5460	-63.04	2	34.19	Average	54	Pass
NVNT	ac80	5530	Ant1	5468.8	-48.1	2	49.13	Peak	68.2	Pass
NVNT	ac80	5530	Ant1	5469.4	-59.65	2	37.58	Average	54	Pass
NVNT	ac80	5530	Ant1	5470	-49.31	2	47.92	Peak	68.2	Pass
NVNT	ac80	5530	Ant1	5470	-60.1	2	37.13	Average	54	Pass
NVNT	ac80	5610	Ant1	5725	-59.58	2	37.65	Peak	68.2	Pass
NVNT	ac80	5610	Ant1	5725	-66.95	2	30.28	Average	54	Pass
NVNT	ac80	5610	Ant1	5735	-57.29	2	39.94	Peak	68.2	Pass
NVNT	ac80	5610	Ant1	5727.21	-66.25	2	30.98	Average	54	Pass
NVNT	ac80	5610	Ant1	5735	-57.29	2	39.94	Peak	68.2	Pass
NVNT	ac80	5610	Ant1	5735	-66.75	2	30.48	Average	54	Pass
NVNT	ax20	5500	Ant1	5460	-48.95	2	48.28	Peak	68.2	Pass
NVNT	ax20	5500	Ant1	5460	-57.78	2	39.45	Average	54	Pass
NVNT	ax20	5500	Ant1	5469.2	-47.53	2	49.7	Peak	68.2	Pass
NVNT	ax20	5500	Ant1	5469.8	-56.75	2	40.48	Average	54	Pass
NVNT	ax20	5500	Ant1	5470	-48.94	2	48.29	Peak	68.2	Pass
NVNT	ax20	5500	Ant1	5470	-56.85	2	40.38	Average	54	Pass



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China


Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity




NVNT	ax20	5700	Ant1	5725	-43.72	2	53.51	Peak	68.2	Pass
NVNT	ax20	5700	Ant1	5725	-57.08	2	40.15	Average	54	Pass
NVNT	ax20	5700	Ant1	5725.8	-43.52	2	53.71	Peak	68.2	Pass
NVNT	ax20	5700	Ant1	5725	-57.08	2	40.15	Average	54	Pass
NVNT	ax20	5700	Ant1	5735	-56.84	2	40.39	Peak	68.2	Pass
NVNT	ax20	5700	Ant1	5735	-64.72	2	32.51	Average	54	Pass
NVNT	ax40	5510	Ant1	5460	-50.78	2	46.45	Peak	68.2	Pass
NVNT	ax40	5510	Ant1	5460	-57.55	2	39.68	Average	54	Pass
NVNT	ax40	5510	Ant1	5467.6	-42.64	2	54.59	Peak	68.2	Pass
NVNT	ax40	5510	Ant1	5469.6	-56.22	2	41.01	Average	54	Pass
NVNT	ax40	5510	Ant1	5470	-45.42	2	51.81	Peak	68.2	Pass
NVNT	ax40	5510	Ant1	5470	-56.29	2	40.94	Average	54	Pass
NVNT	ax40	5670	Ant1	5725	-51.56	2	45.67	Peak	68.2	Pass
NVNT	ax40	5670	Ant1	5725	-57.89	2	39.34	Average	54	Pass
NVNT	ax40	5670	Ant1	5732.8	-48.07	2	49.16	Peak	68.2	Pass
NVNT	ax40	5670	Ant1	5730.8	-57.6	2	39.63	Average	54	Pass
NVNT	ax40	5670	Ant1	5735	-51.32	2	45.91	Peak	68.2	Pass
NVNT	ax40	5670	Ant1	5735	-57.77	2	39.46	Average	54	Pass
NVNT	ax80	5530	Ant1	5460	-53.6	2	43.63	Peak	68.2	Pass
NVNT	ax80	5530	Ant1	5460	-62.87	2	34.36	Average	54	Pass
NVNT	ax80	5530	Ant1	5467.2	-46.63	2	50.6	Peak	68.2	Pass
NVNT	ax80	5530	Ant1	5470	-59.47	2	37.76	Average	54	Pass
NVNT	ax80	5530	Ant1	5470	-49.49	2	47.74	Peak	68.2	Pass
NVNT	ax80	5530	Ant1	5470	-59.47	2	37.76	Average	54	Pass
NVNT	ax80	5610	Ant1	5725	-58.85	2	38.38	Peak	68.2	Pass
NVNT	ax80	5610	Ant1	5725	-66.64	2	30.59	Average	54	Pass
NVNT	ax80	5610	Ant1	5727.21	-57.31	2	39.92	Peak	68.2	Pass
NVNT	ax80	5610	Ant1	5731.31	-66.33	2	30.9	Average	54	Pass
NVNT	ax80	5610	Ant1	5735	-57.84	2	39.39	Peak	68.2	Pass
NVNT	ax80	5610	Ant1	5735	-66.68	2	30.55	Average	54	Pass



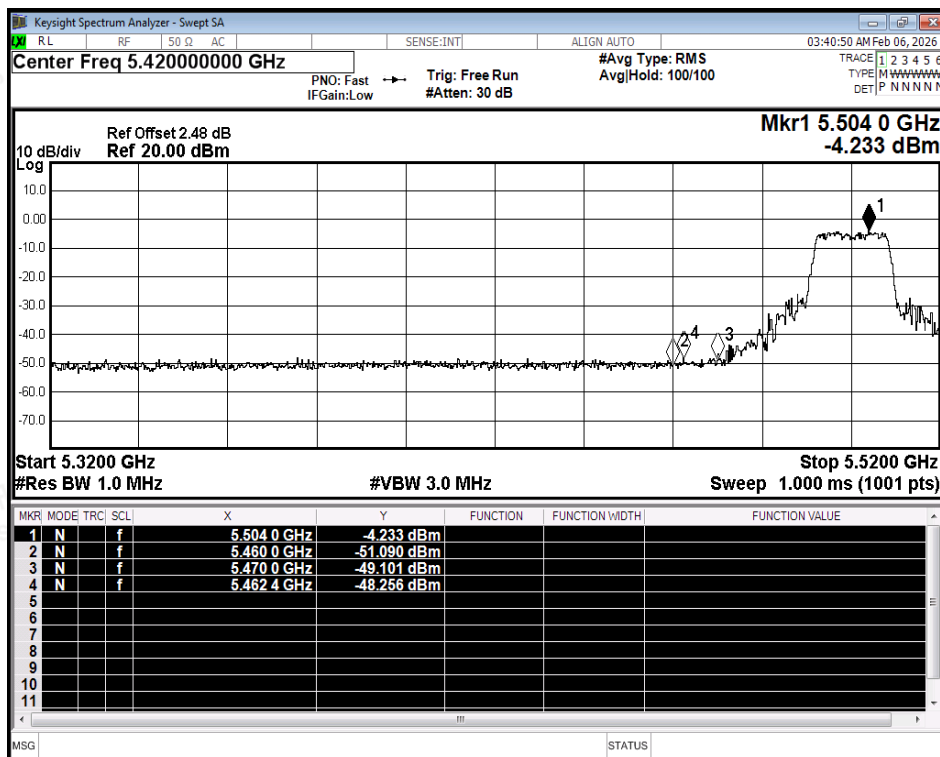

Restrict Band NVNT a 5500MHz Ant1 Peak

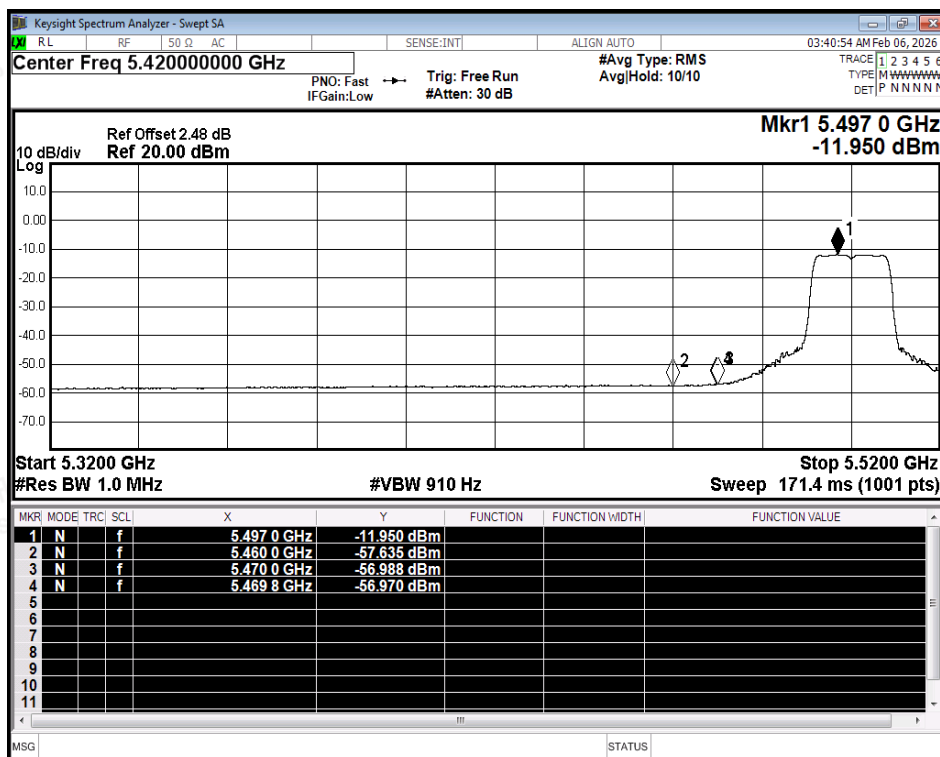

Restrict Band NVNT a 5500MHz Ant1 Average




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

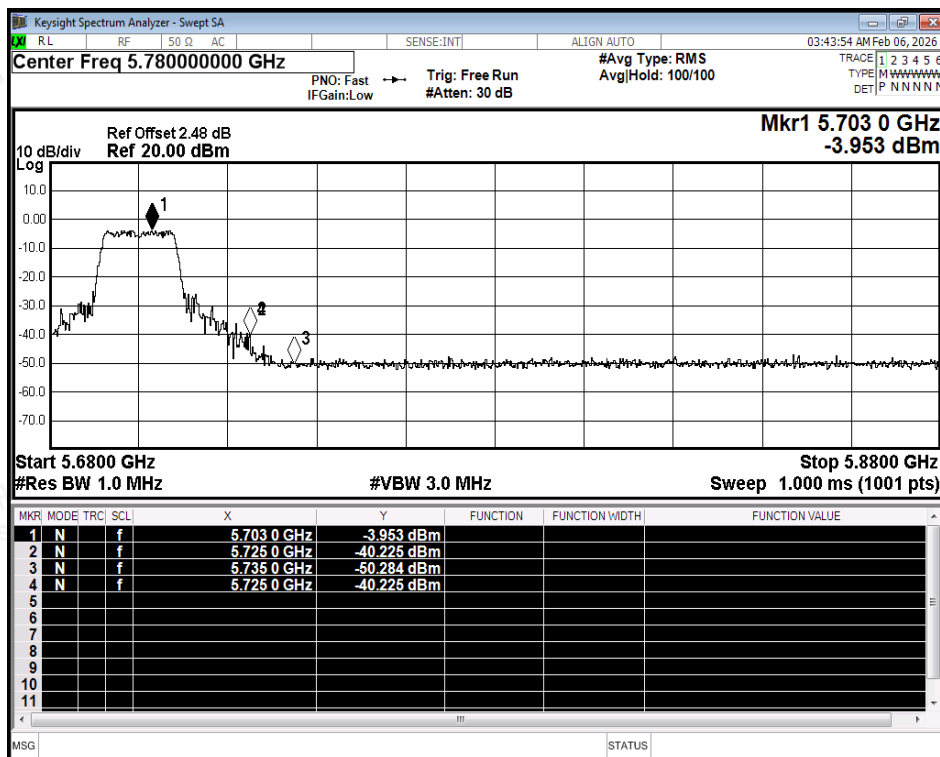

Restrict Band NVNT a 5700MHz Ant1 Peak

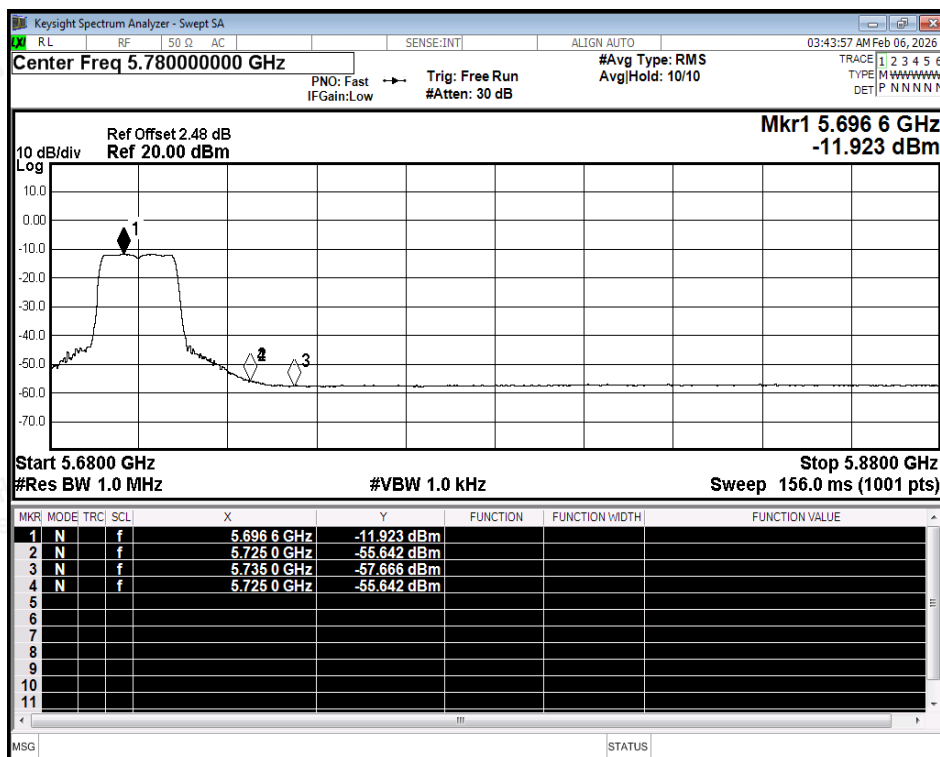

Restrict Band NVNT a 5700MHz Ant1 Average




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

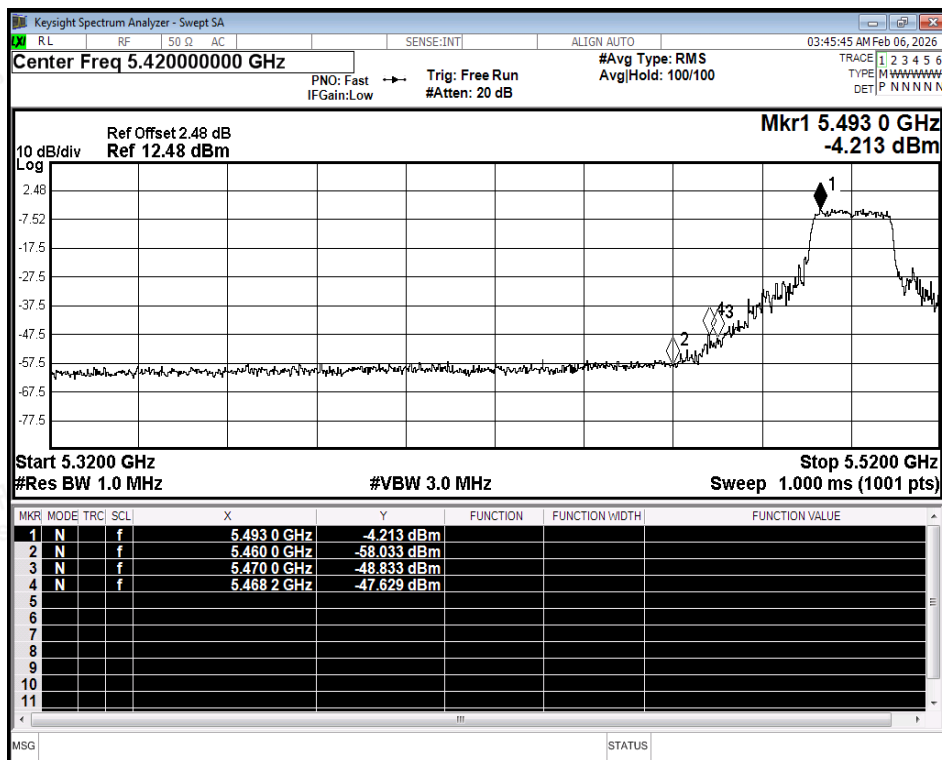

Restrict Band NVNT n20 5500MHz Ant1 Peak

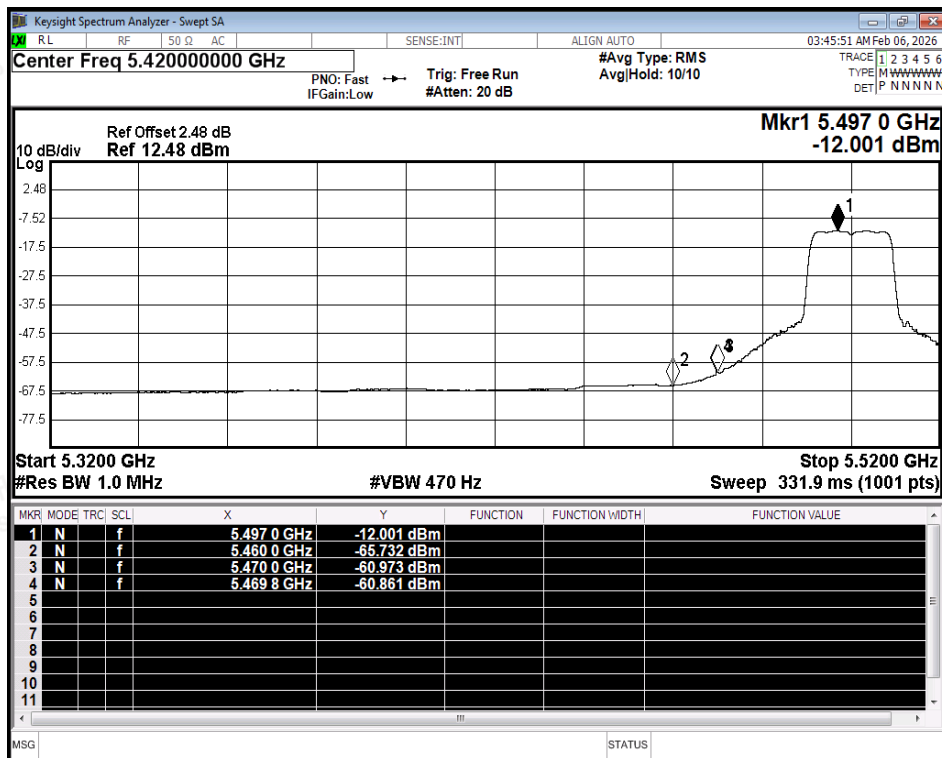

Restrict Band NVNT n20 5500MHz Ant1 Average




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

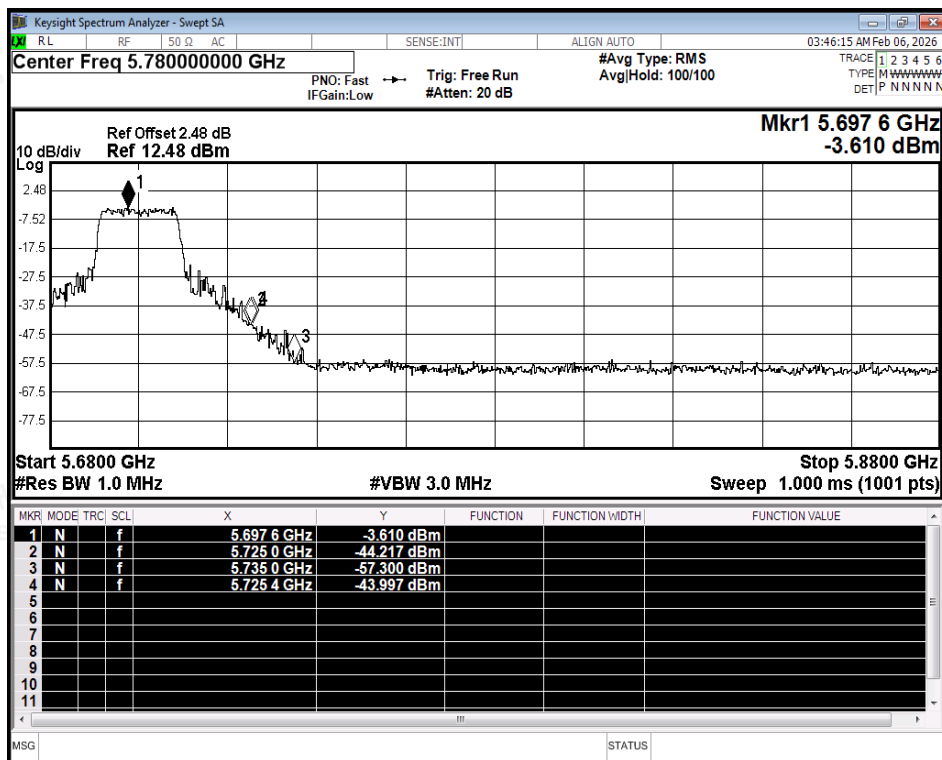

Restrict Band NVNT n20 5700MHz Ant1 Peak

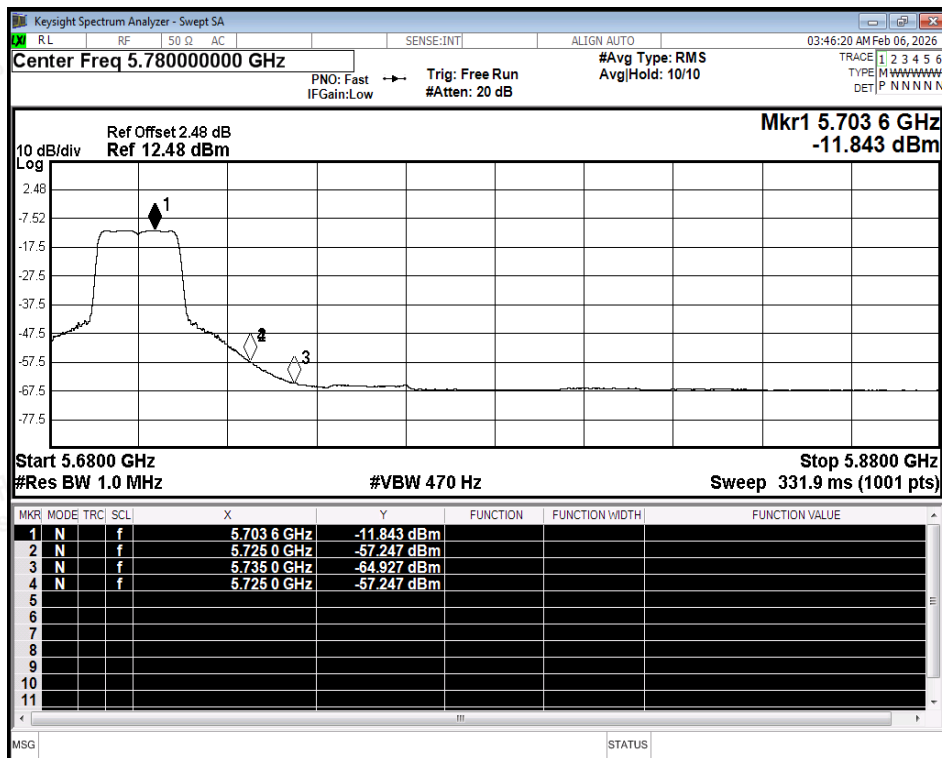

Restrict Band NVNT n20 5700MHz Ant1 Average




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

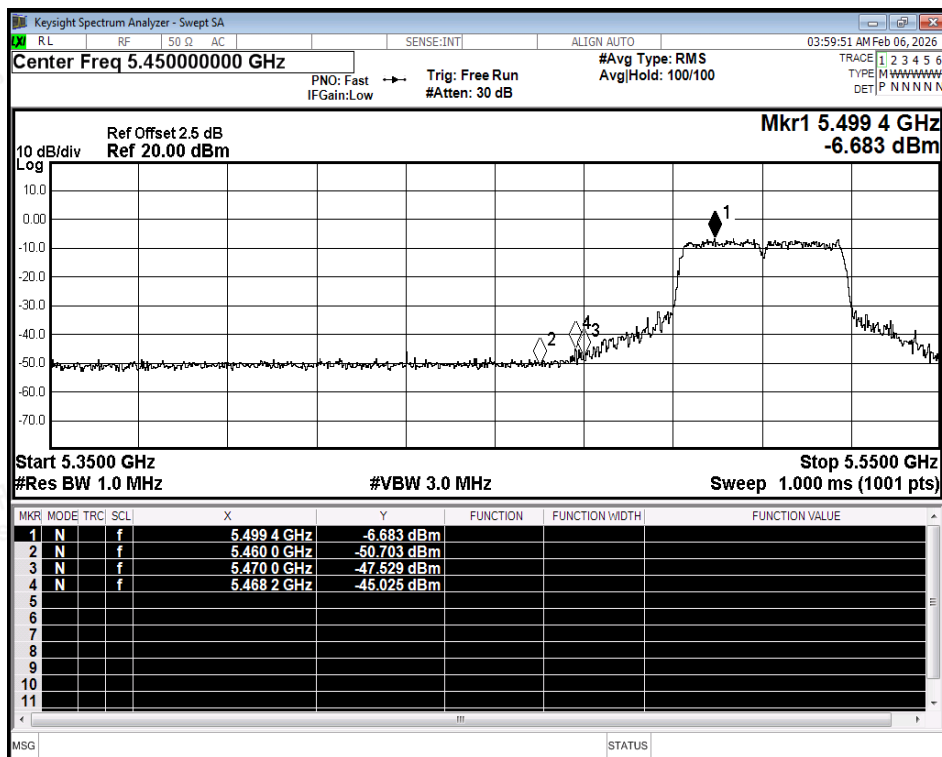

Restrict Band NVNT n40 5510MHz Ant1 Peak

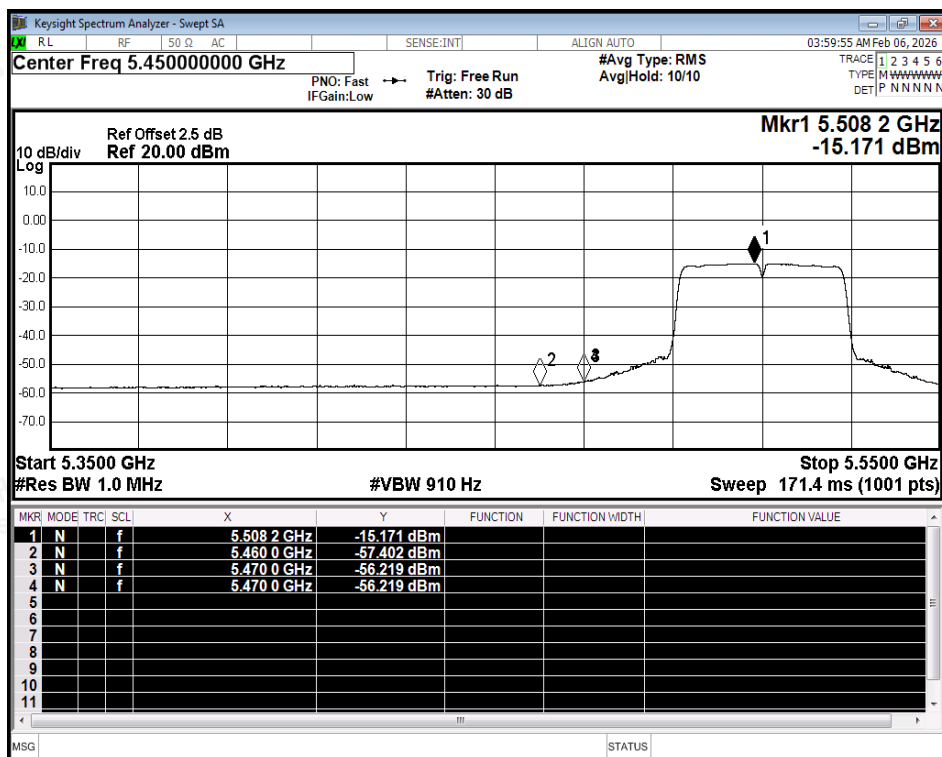

Restrict Band NVNT n40 5510MHz Ant1 Average




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

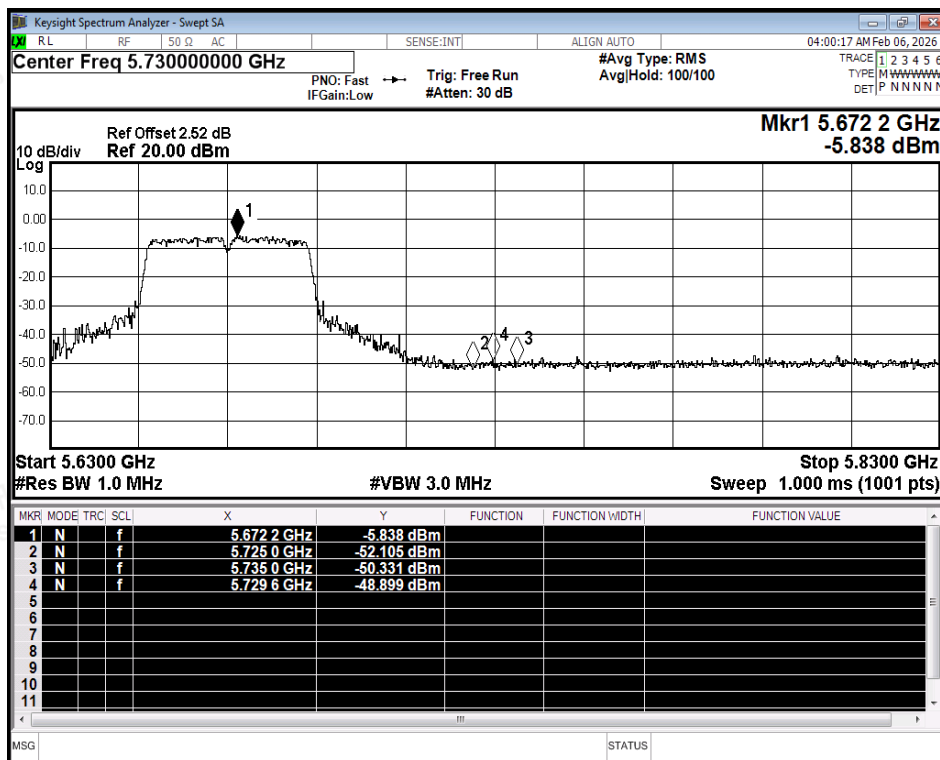

Restrict Band NVNT n40 5670MHz Ant1 Peak

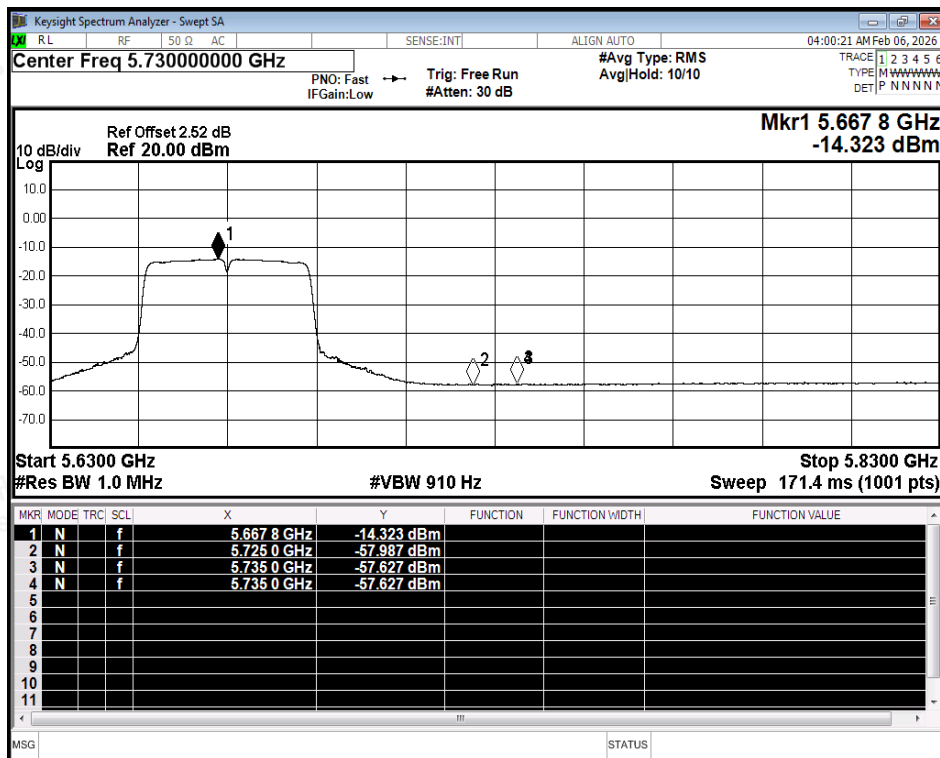

Restrict Band NVNT n40 5670MHz Ant1 Average




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

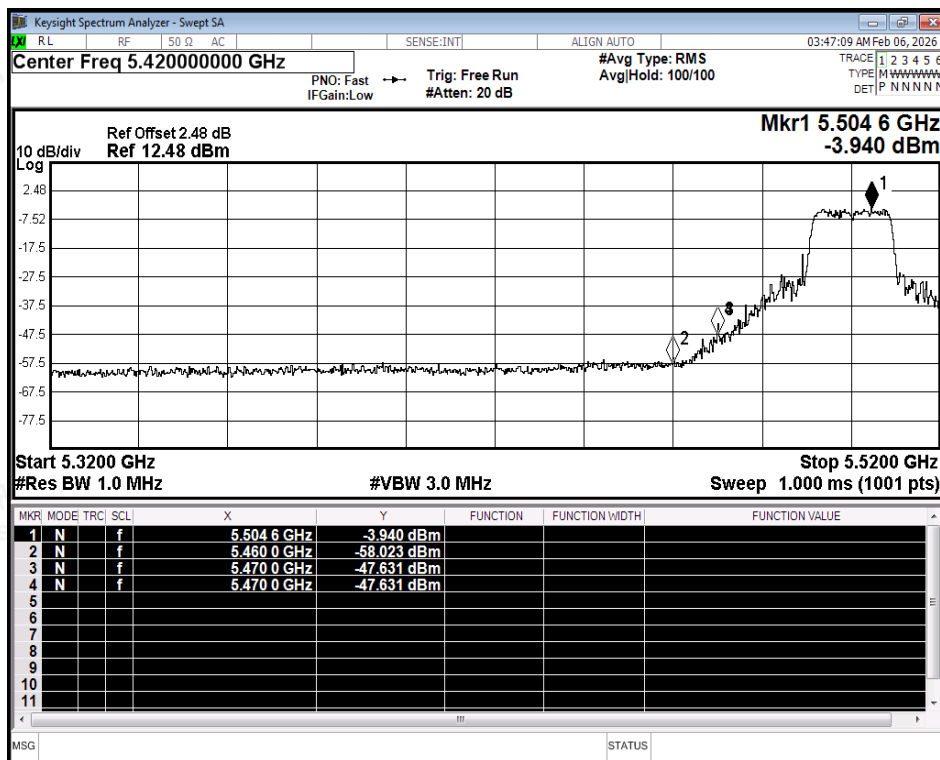

Restrict Band NVNT ac20 5500MHz Ant1 Peak

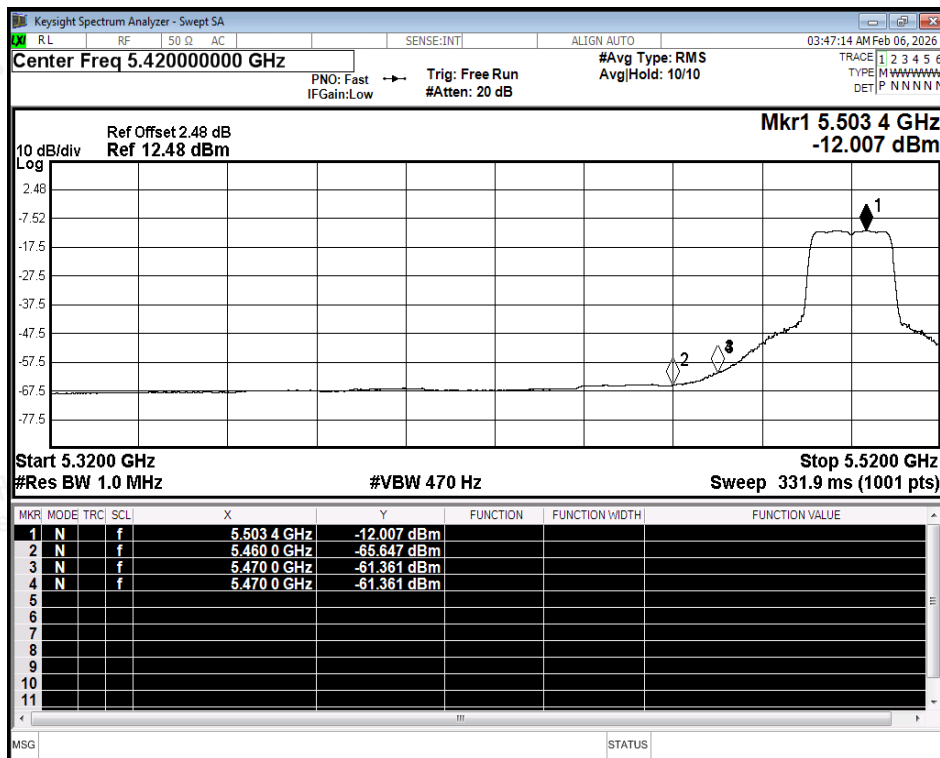

Restrict Band NVNT ac20 5500MHz Ant1 Average




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

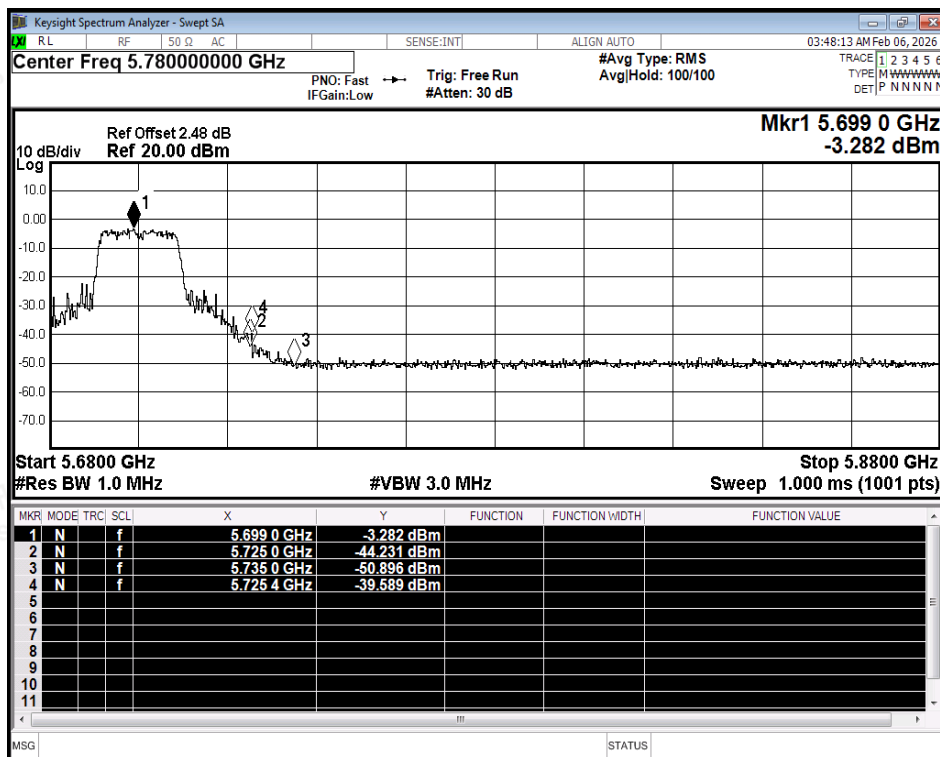

Restrict Band NVNT ac20 5700MHz Ant1 Peak

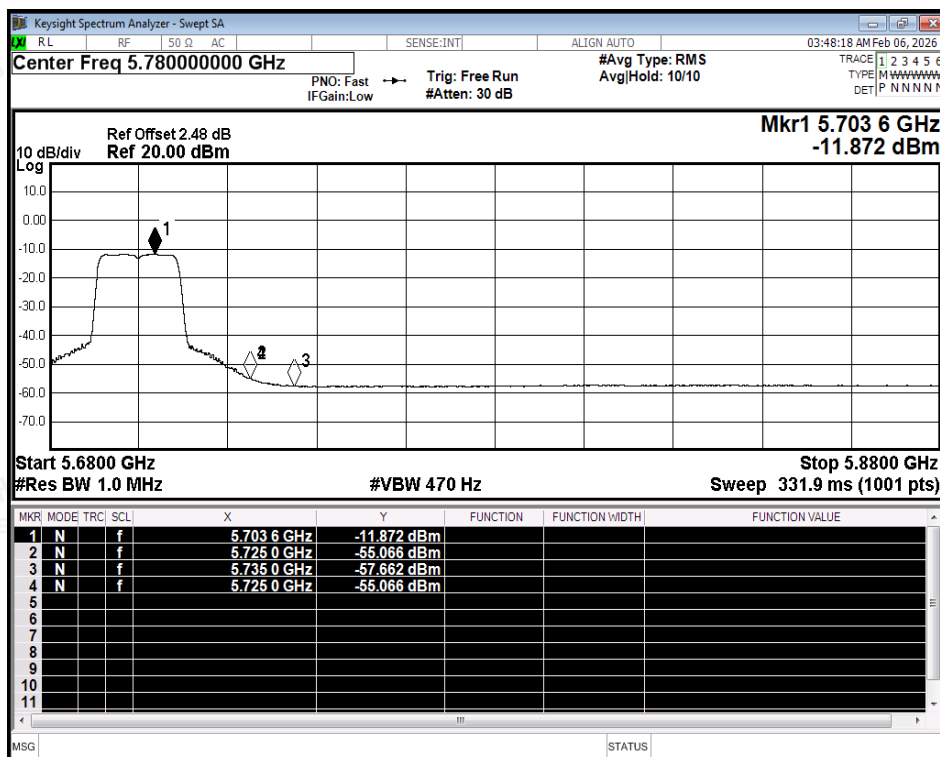

Restrict Band NVNT ac20 5700MHz Ant1 Average




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

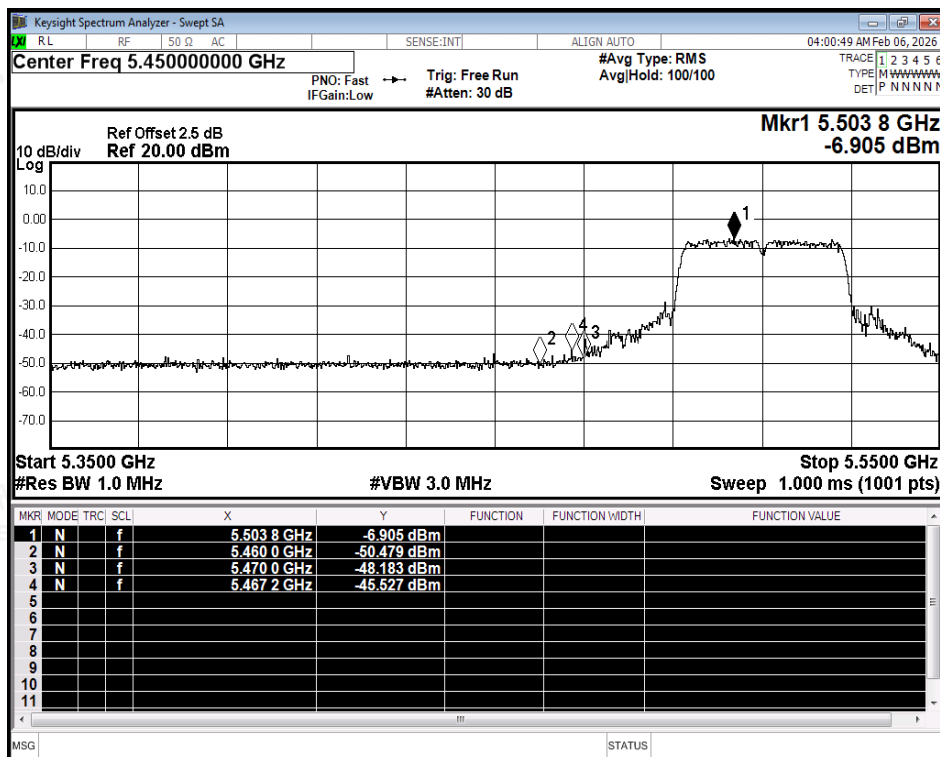

Restrict Band NVNT ac40 5510MHz Ant1 Peak

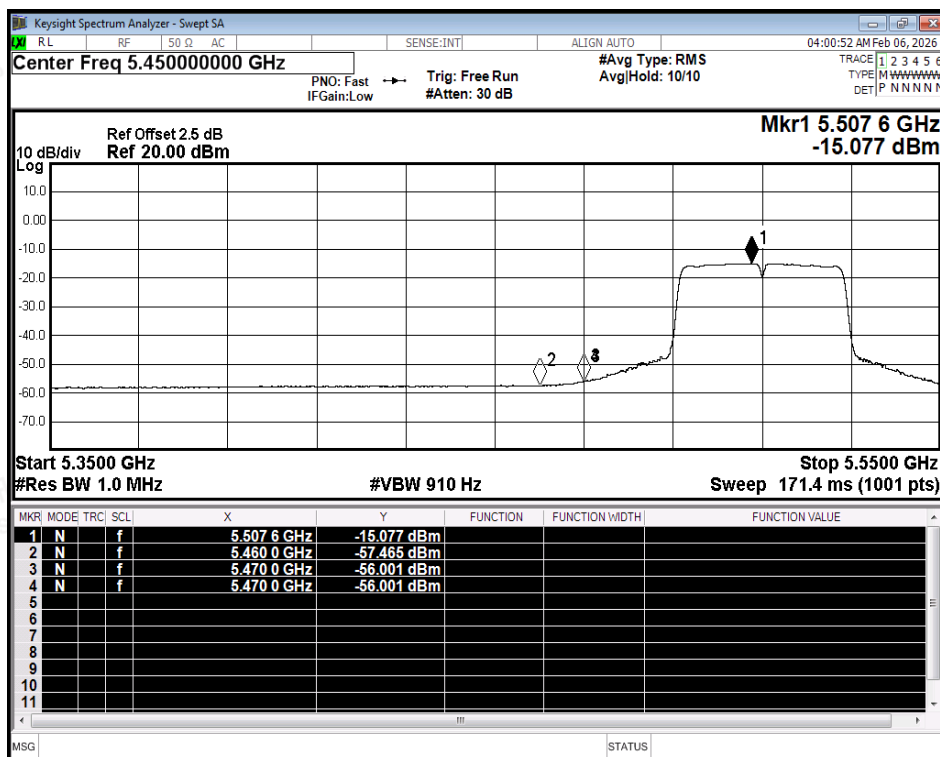

Restrict Band NVNT ac40 5510MHz Ant1 Average




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

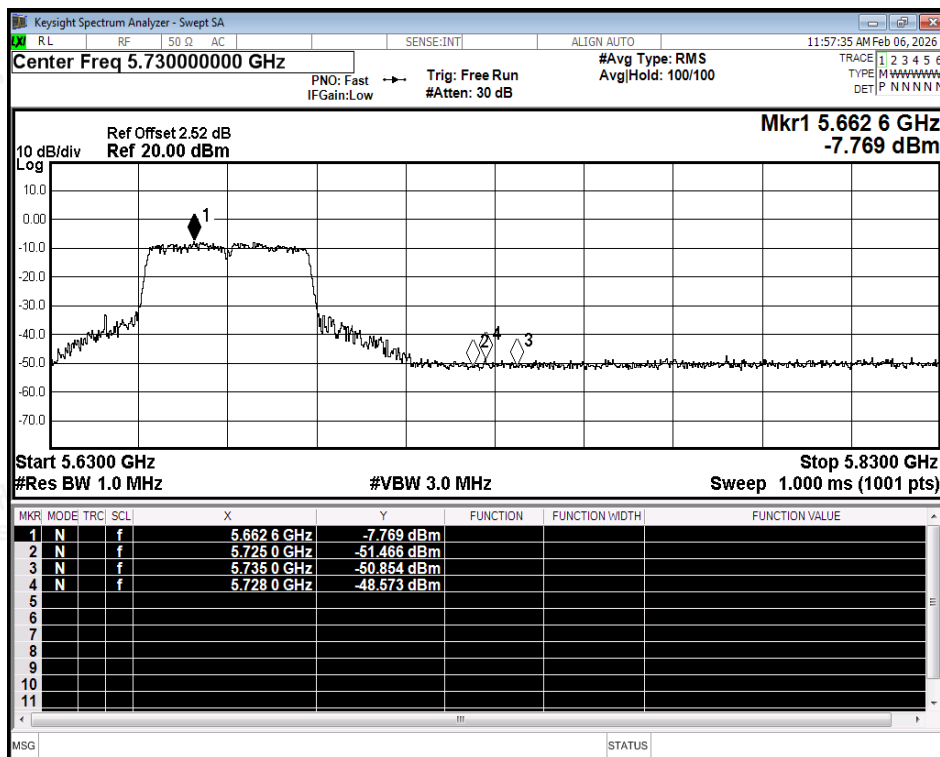

Restrict Band NVNT ac40 5670MHz Ant1 Peak

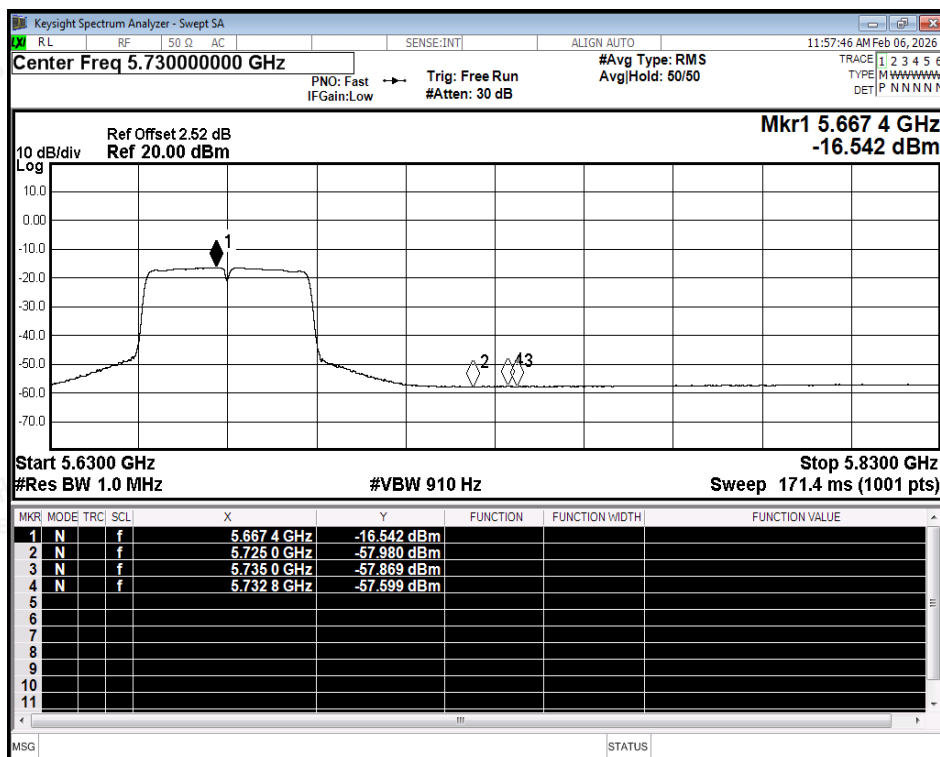

Restrict Band NVNT ac40 5670MHz Ant1 Average




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

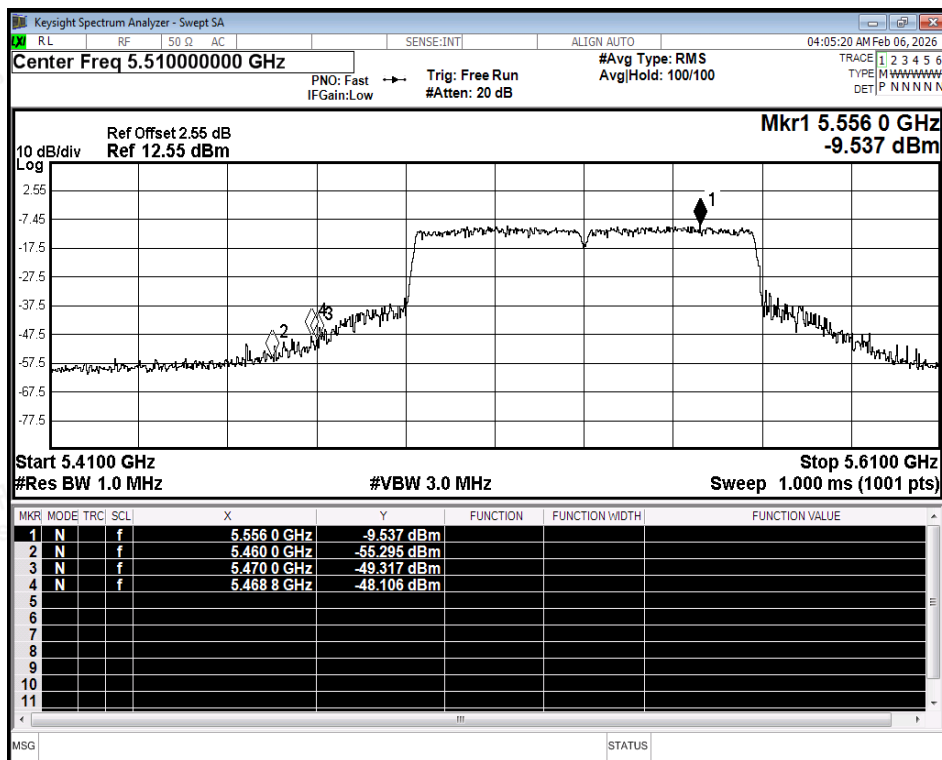

Restrict Band NVNT ac80 5530MHz Ant1 Peak

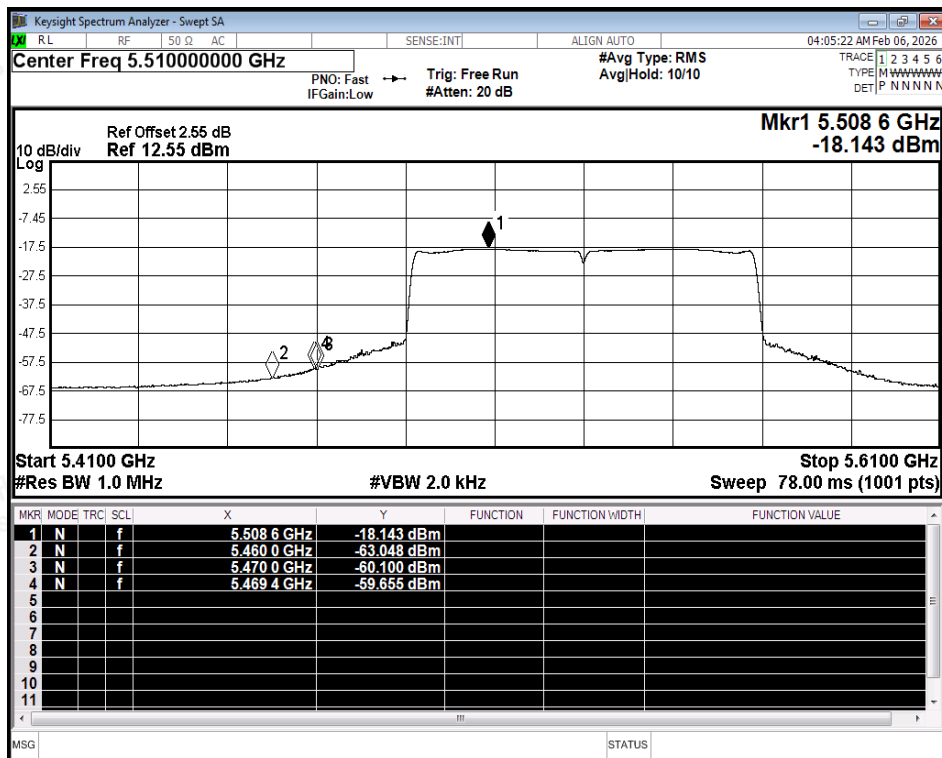

Restrict Band NVNT ac80 5530MHz Ant1 Average




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

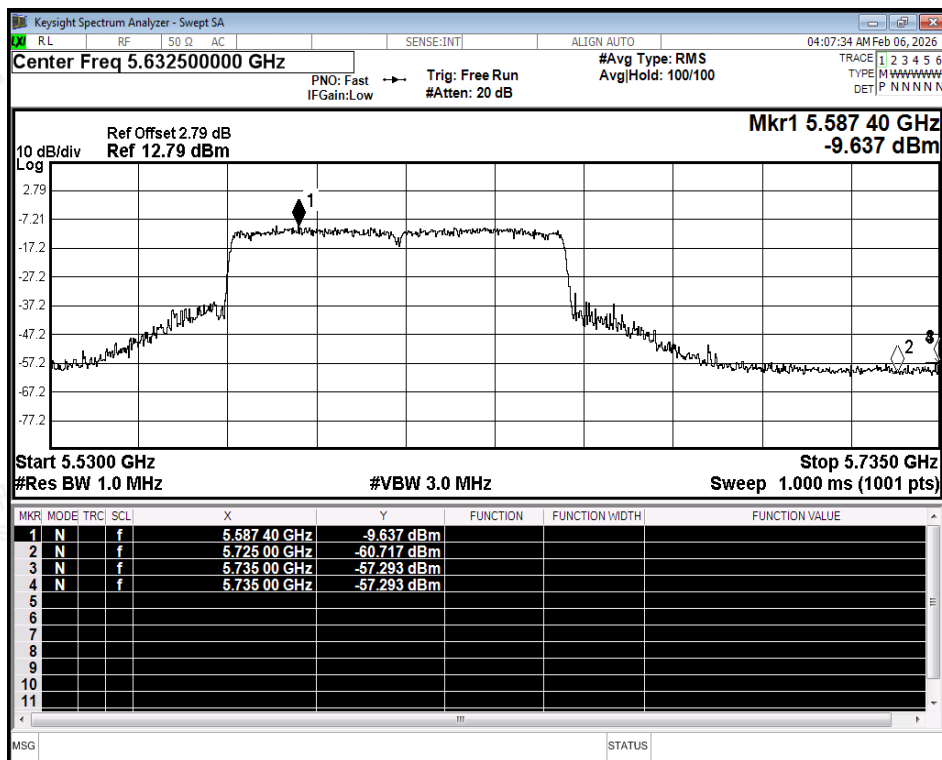

Restrict Band NVNT ac80 5610MHz Ant1 Peak

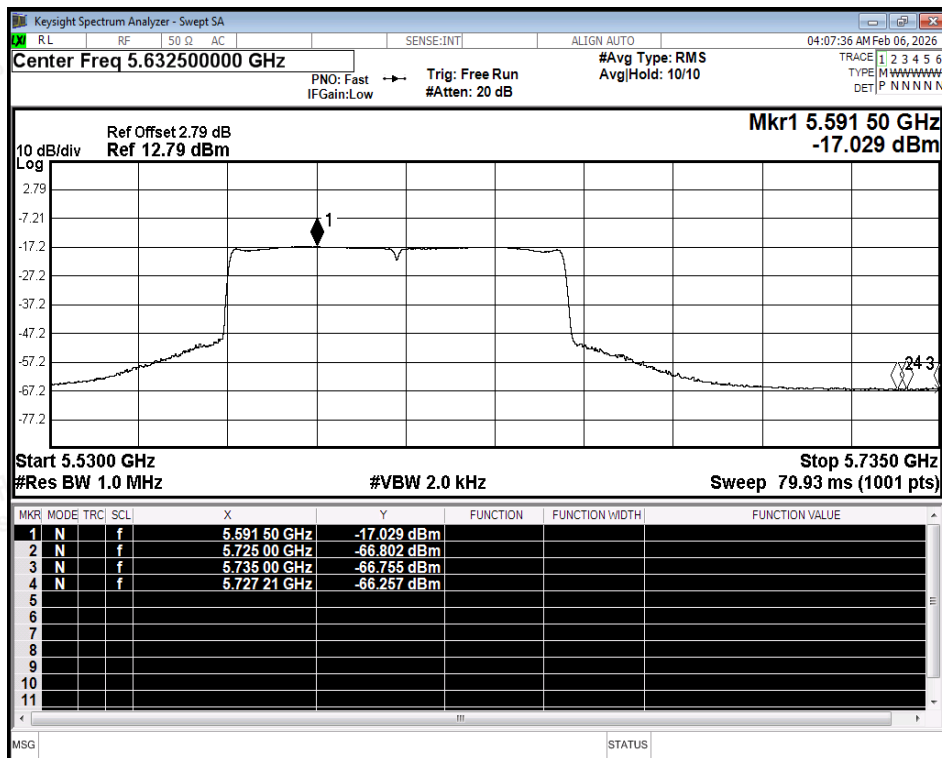

Restrict Band NVNT ac80 5610MHz Ant1 Average




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

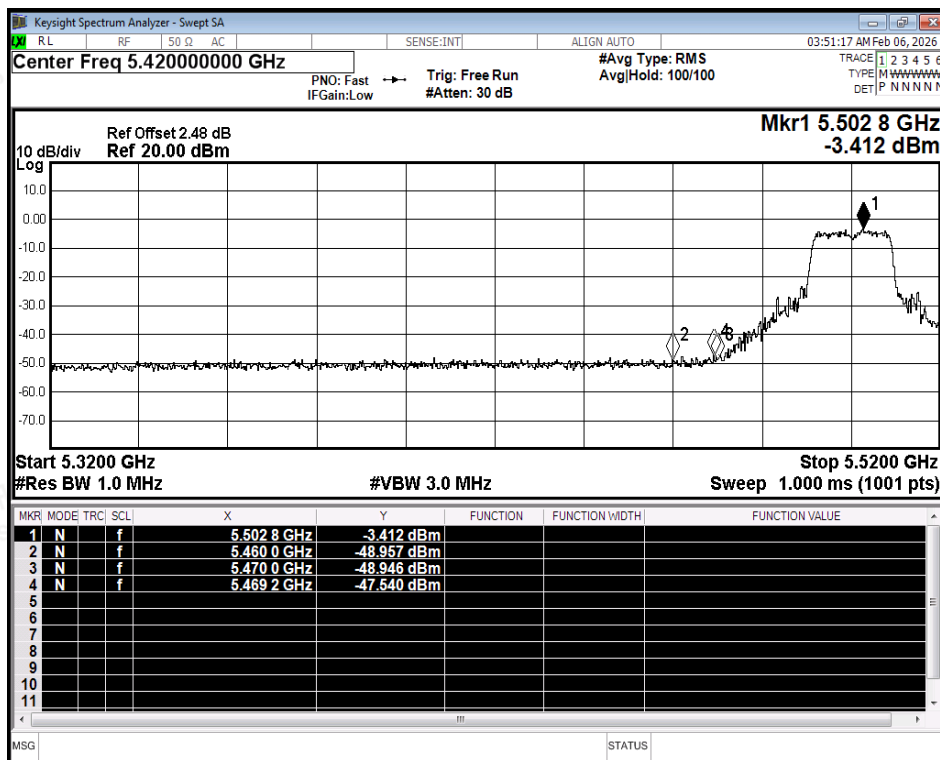

Restrict Band NVNT ax20 5500MHz Ant1 Peak

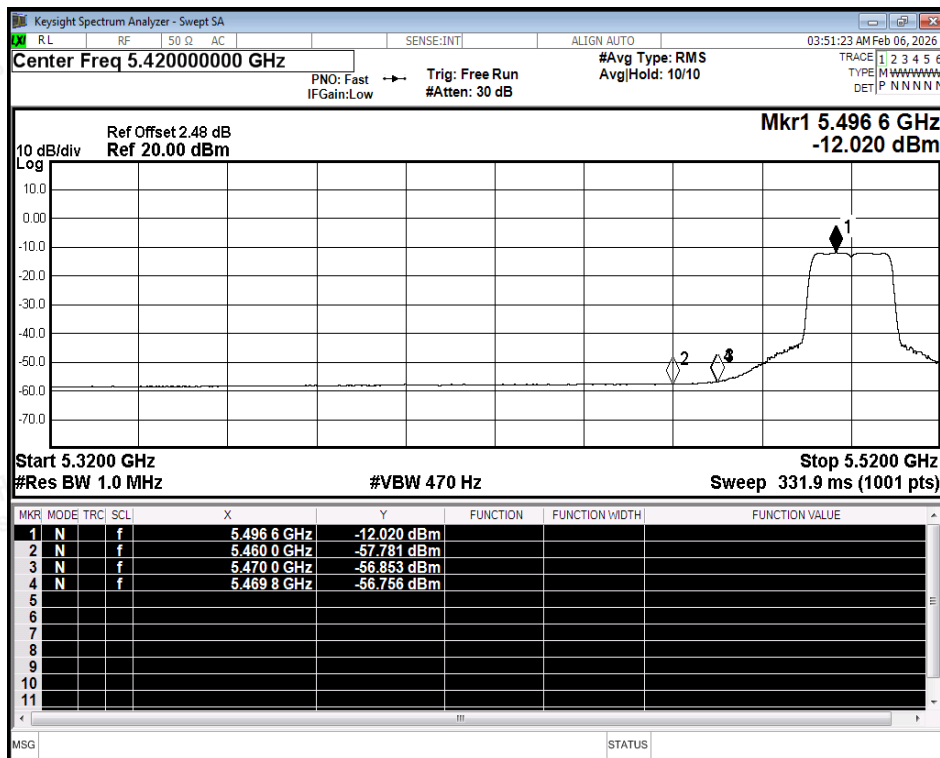

Restrict Band NVNT ax20 5500MHz Ant1 Average




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

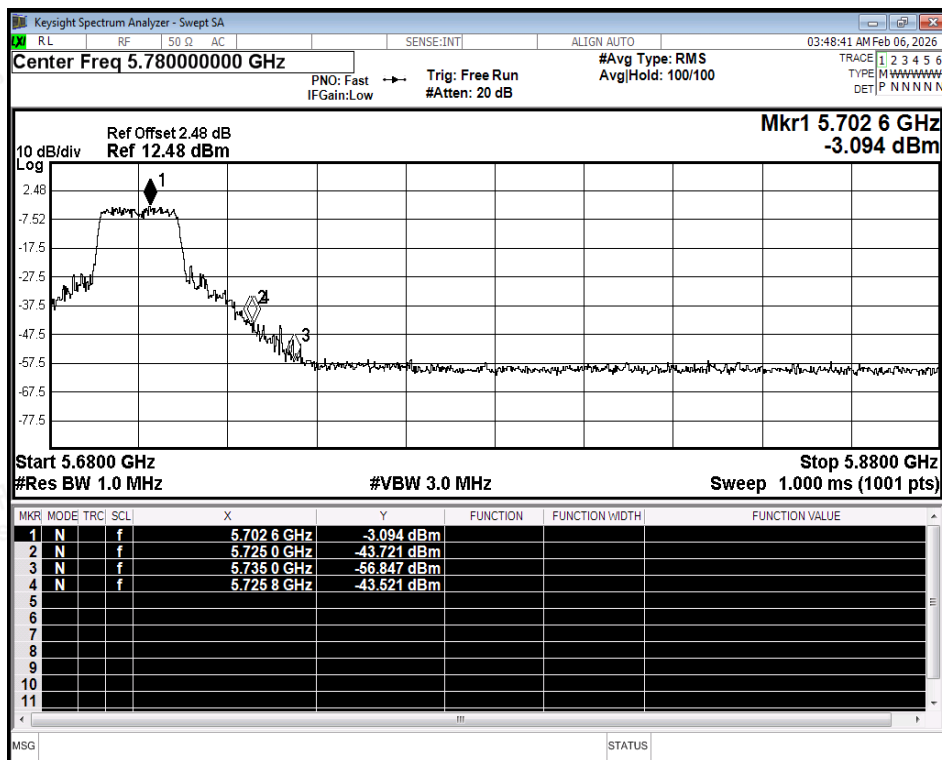

Restrict Band NVNT ax20 5700MHz Ant1 Peak

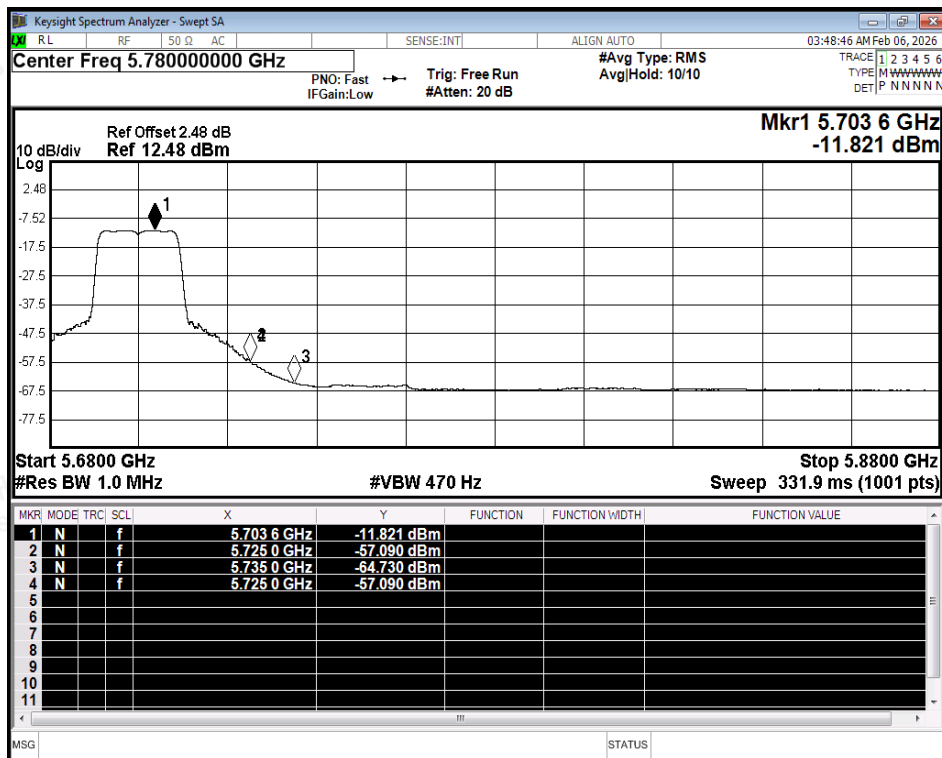

Restrict Band NVNT ax20 5700MHz Ant1 Average




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

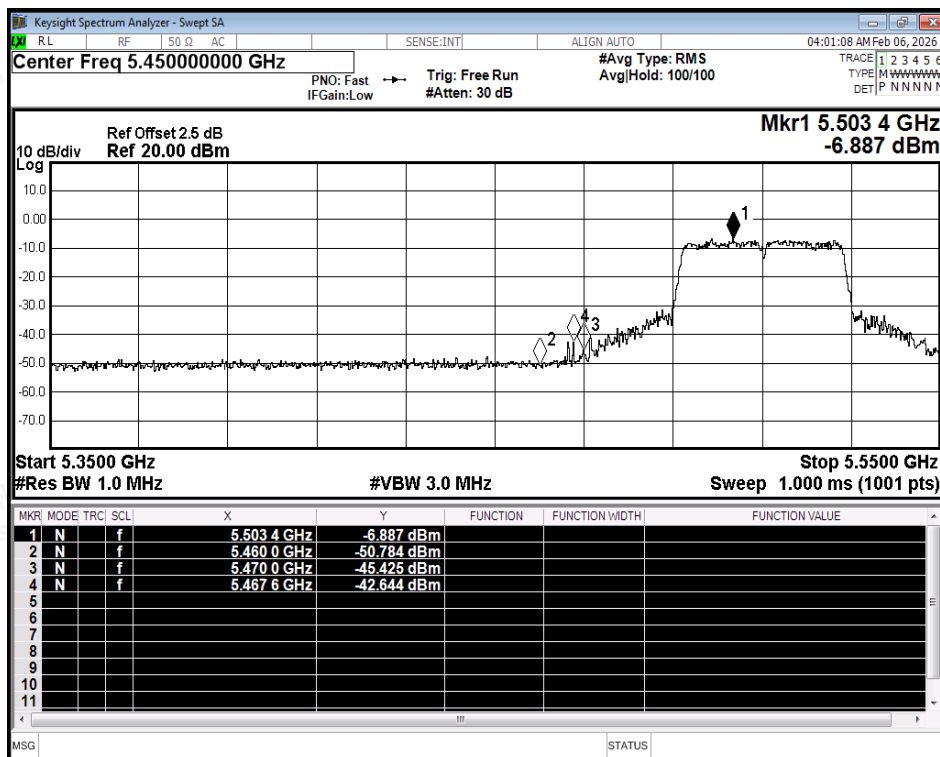

Restrict Band NVNT ax40 5510MHz Ant1 Peak

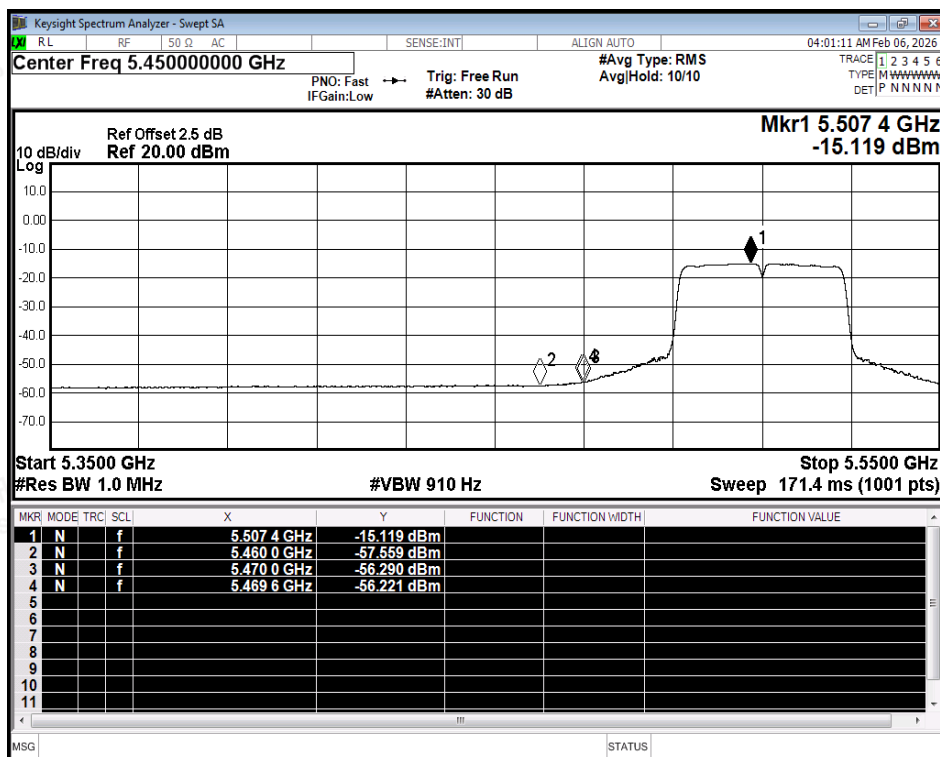

Restrict Band NVNT ax40 5510MHz Ant1 Average




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

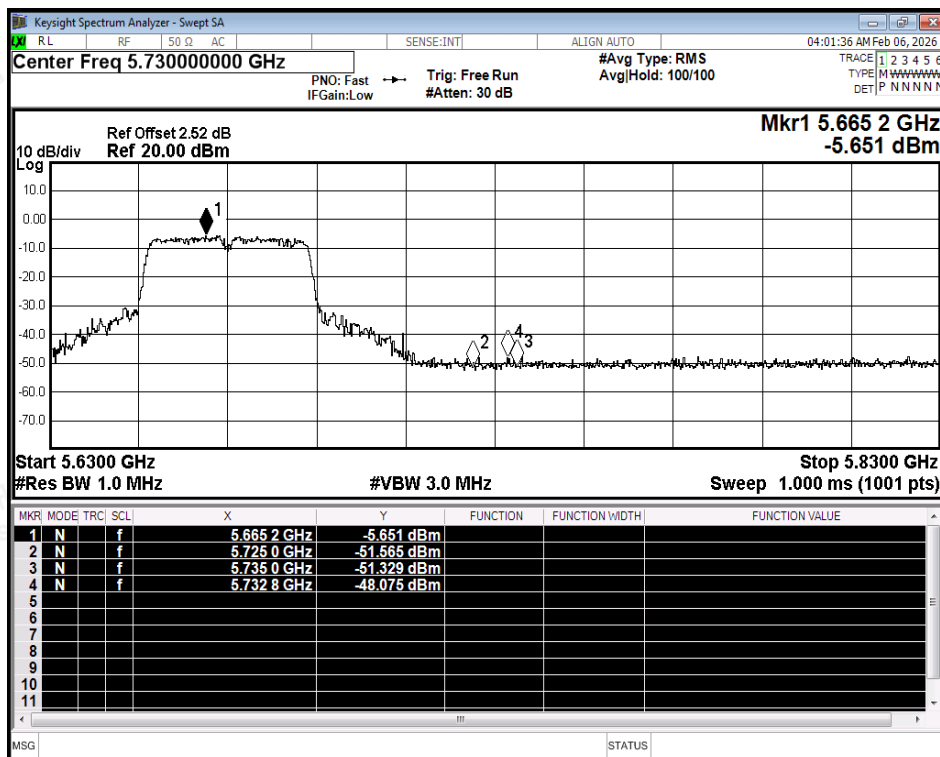

Restrict Band NVNT ax40 5670MHz Ant1 Peak

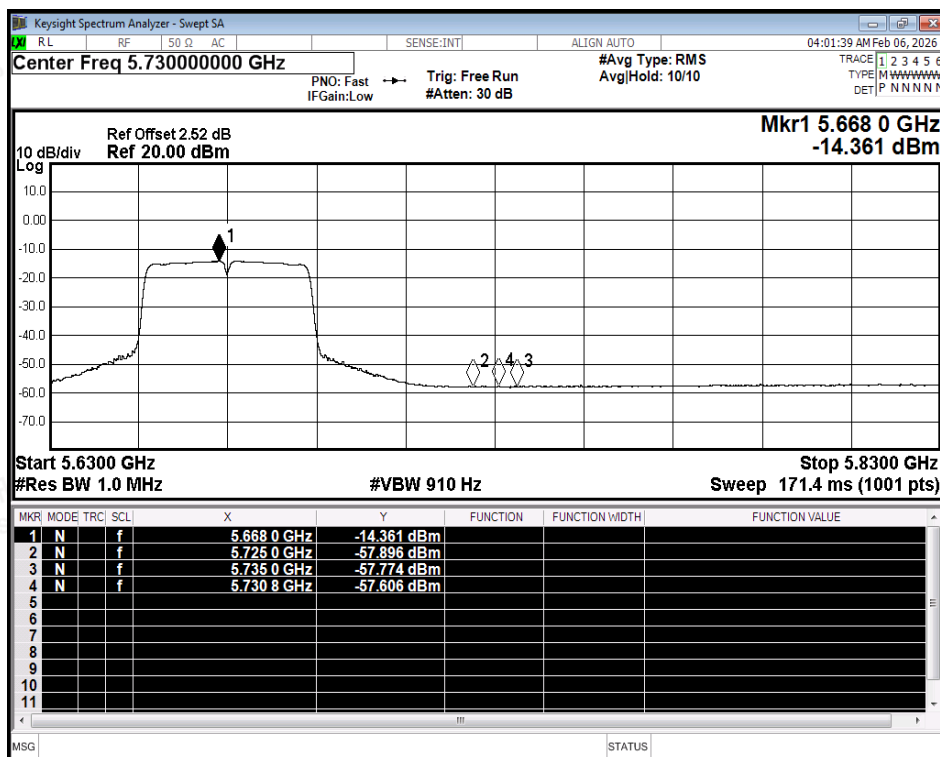

Restrict Band NVNT ax40 5670MHz Ant1 Average




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

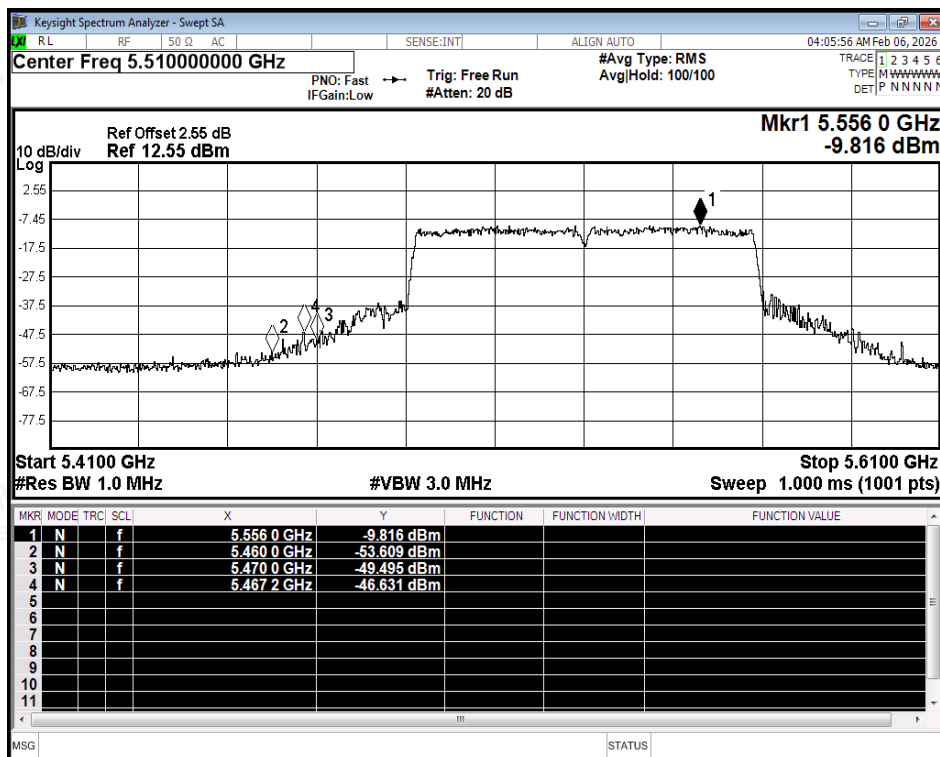

Restrict Band NVNT ax80 5530MHz Ant1 Peak

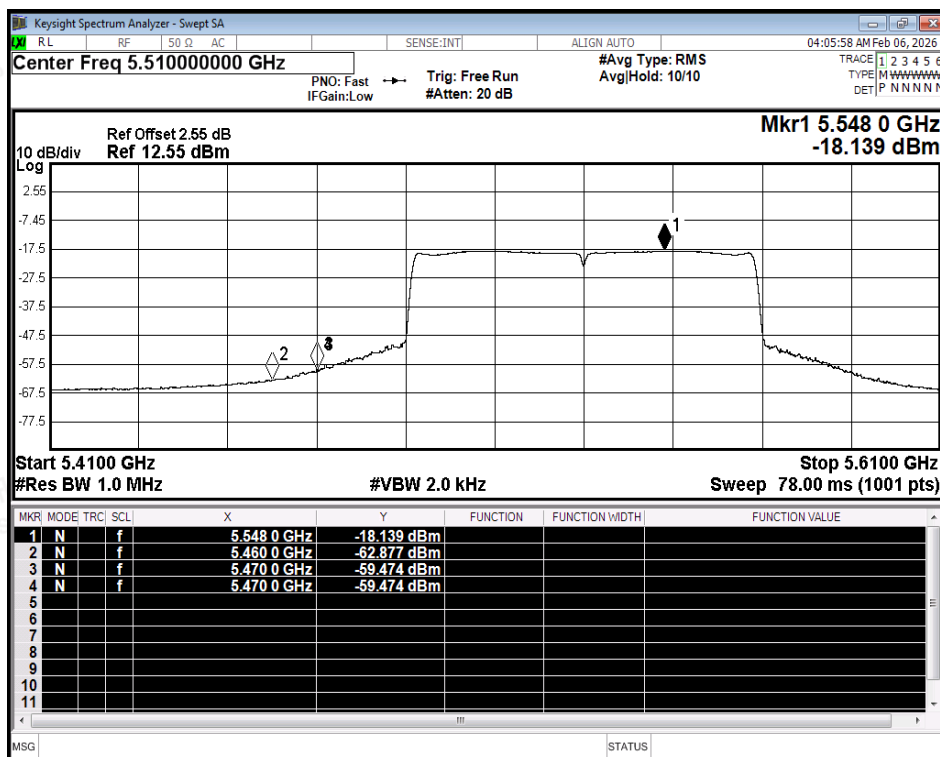

Restrict Band NVNT ax80 5530MHz Ant1 Average




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

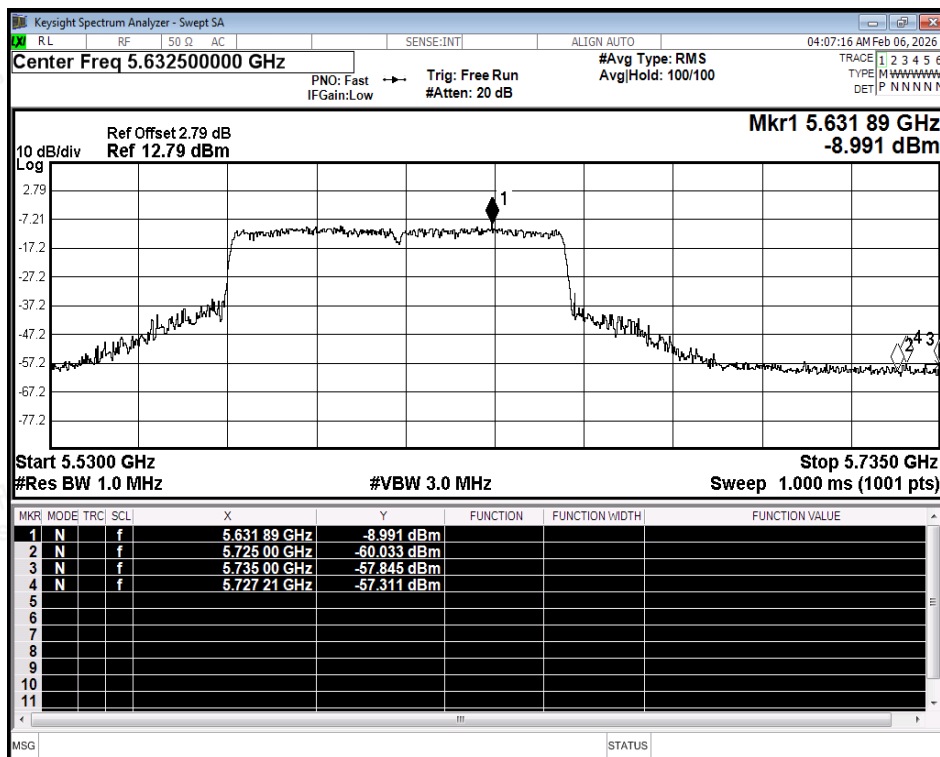

Restrict Band NVNT ax80 5610MHz Ant1 Peak

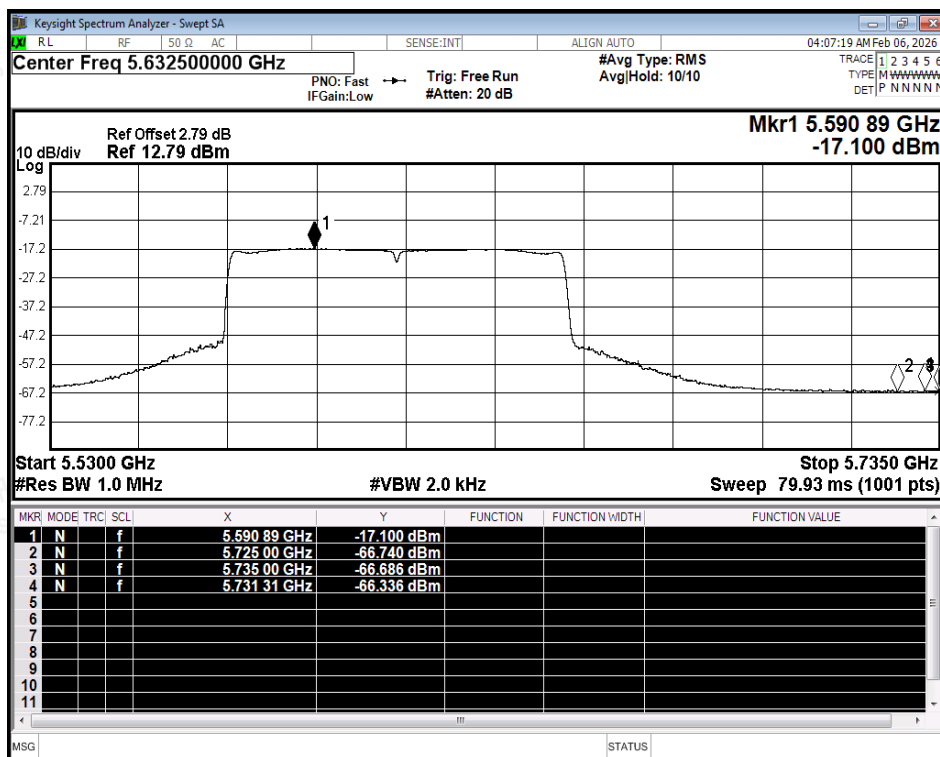

Restrict Band NVNT ax80 5610MHz Ant1 Average



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



Condition	Mode	Frequency (MHz)	Antenna	Spur Freq (MHz)	Power (dBm)	Gain (dBi)	E (dBuV/m)	Detector	Limit (dBuV/m)	Verdict
NVNT	a	5500	Ant2	5460	-41.32	2	55.91	Peak	68.2	Pass
NVNT	a	5500	Ant2	5460	-52.79	2	44.44	Average	54	Pass
NVNT	a	5500	Ant2	5468.6	-35.07	2	62.16	Peak	68.2	Pass
NVNT	a	5500	Ant2	5469.8	-46.33	2	50.9	Average	54	Pass
NVNT	a	5500	Ant2	5470	-37.37	2	59.86	Peak	68.2	Pass
NVNT	a	5500	Ant2	5470	-46.42	2	50.81	Average	54	Pass
NVNT	a	5700	Ant2	5725	-41.44	2	55.79	Peak	68.2	Pass
NVNT	a	5700	Ant2	5725	-53.26	2	43.97	Average	54	Pass
NVNT	a	5700	Ant2	5727.8	-38.57	2	58.66	Peak	68.2	Pass
NVNT	a	5700	Ant2	5725	-53.26	2	43.97	Average	54	Pass
NVNT	a	5700	Ant2	5735	-48.57	2	48.66	Peak	68.2	Pass
NVNT	a	5700	Ant2	5735	-56.77	2	40.46	Average	54	Pass
NVNT	n20	5500	Ant2	5460	-38.48	2	58.75	Peak	68.2	Pass
NVNT	n20	5500	Ant2	5460	-51.01	2	46.22	Average	54	Pass
NVNT	n20	5500	Ant2	5469.8	-33.75	2	63.48	Peak	68.2	Pass
NVNT	n20	5500	Ant2	5469.6	-44.53	2	52.7	Average	54	Pass
NVNT	n20	5500	Ant2	5470	-34.21	2	63.02	Peak	68.2	Pass
NVNT	n20	5500	Ant2	5470	-44.61	2	52.62	Average	54	Pass
NVNT	n20	5700	Ant2	5725	-41.16	2	56.07	Peak	68.2	Pass
NVNT	n20	5700	Ant2	5725	-52.51	2	44.72	Average	54	Pass
NVNT	n20	5700	Ant2	5727	-39.56	2	57.67	Peak	68.2	Pass
NVNT	n20	5700	Ant2	5725	-52.51	2	44.72	Average	54	Pass
NVNT	n20	5700	Ant2	5735	-47.74	2	49.49	Peak	68.2	Pass
NVNT	n20	5700	Ant2	5735	-56.73	2	40.5	Average	54	Pass
NVNT	n40	5510	Ant2	5460	-49.8	2	47.43	Peak	68.2	Pass
NVNT	n40	5510	Ant2	5460	-56.4	2	40.83	Average	54	Pass
NVNT	n40	5510	Ant2	5470	-37.29	2	59.94	Peak	68.2	Pass
NVNT	n40	5510	Ant2	5469	-53.02	2	44.21	Average	54	Pass
NVNT	n40	5510	Ant2	5470	-37.29	2	59.94	Peak	68.2	Pass
NVNT	n40	5510	Ant2	5470	-53.31	2	43.92	Average	54	Pass
NVNT	n40	5670	Ant2	5725	-42.66	2	54.57	Peak	68.2	Pass
NVNT	n40	5670	Ant2	5725	-51.07	2	46.16	Average	54	Pass
NVNT	n40	5670	Ant2	5727.4	-41.27	2	55.96	Peak	68.2	Pass
NVNT	n40	5670	Ant2	5725.2	-51	2	46.23	Average	54	Pass
NVNT	n40	5670	Ant2	5735	-43.63	2	53.6	Peak	68.2	Pass
NVNT	n40	5670	Ant2	5735	-53.55	2	43.68	Average	54	Pass
NVNT	ac20	5500	Ant2	5460	-37.82	2	59.41	Peak	68.2	Pass
NVNT	ac20	5500	Ant2	5460	-51.08	2	46.15	Average	54	Pass
NVNT	ac20	5500	Ant2	5468.4	-33.39	2	63.84	Peak	68.2	Pass



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



NVNT	ac20	5500	Ant2	5469.8	-44.47	2	52.76	Average	54	Pass
NVNT	ac20	5500	Ant2	5470	-35.14	2	62.09	Peak	68.2	Pass
NVNT	ac20	5500	Ant2	5470	-44.48	2	52.75	Average	54	Pass
NVNT	ac20	5700	Ant2	5725	-38.22	2	59.01	Peak	68.2	Pass
NVNT	ac20	5700	Ant2	5725	-51.37	2	45.86	Average	54	Pass
NVNT	ac20	5700	Ant2	5726.2	-36.22	2	61.01	Peak	68.2	Pass
NVNT	ac20	5700	Ant2	5725	-51.37	2	45.86	Average	54	Pass
NVNT	ac20	5700	Ant2	5735	-48.5	2	48.73	Peak	68.2	Pass
NVNT	ac20	5700	Ant2	5735	-56.57	2	40.66	Average	54	Pass
NVNT	ac40	5510	Ant2	5460	-48.82	2	48.41	Peak	68.2	Pass
NVNT	ac40	5510	Ant2	5460	-56.14	2	41.09	Average	54	Pass
NVNT	ac40	5510	Ant2	5467.4	-39.02	2	58.21	Peak	68.2	Pass
NVNT	ac40	5510	Ant2	5470	-52	2	45.23	Average	54	Pass
NVNT	ac40	5510	Ant2	5470	-43.82	2	53.41	Peak	68.2	Pass
NVNT	ac40	5510	Ant2	5470	-52	2	45.23	Average	54	Pass
NVNT	ac40	5670	Ant2	5725	-43.52	2	53.71	Peak	68.2	Pass
NVNT	ac40	5670	Ant2	5725	-51.1	2	46.13	Average	54	Pass
NVNT	ac40	5670	Ant2	5726.2	-40.29	2	56.94	Peak	68.2	Pass
NVNT	ac40	5670	Ant2	5725.6	-51.06	2	46.17	Average	54	Pass
NVNT	ac40	5670	Ant2	5735	-46.01	2	51.22	Peak	68.2	Pass
NVNT	ac40	5670	Ant2	5735	-53.45	2	43.78	Average	54	Pass
NVNT	ac80	5530	Ant2	5460	-45.72	2	51.51	Peak	68.2	Pass
NVNT	ac80	5530	Ant2	5460	-53.11	2	44.12	Average	54	Pass
NVNT	ac80	5530	Ant2	5469.4	-40.39	2	56.84	Peak	68.2	Pass
NVNT	ac80	5530	Ant2	5469.4	-51.44	2	45.79	Average	54	Pass
NVNT	ac80	5530	Ant2	5470	-44.11	2	53.12	Peak	68.2	Pass
NVNT	ac80	5530	Ant2	5470	-51.5	2	45.73	Average	54	Pass
NVNT	ac80	5610	Ant2	5725	-45.09	2	52.14	Peak	68.2	Pass
NVNT	ac80	5610	Ant2	5725	-51.43	2	45.8	Average	54	Pass
NVNT	ac80	5610	Ant2	5725.98	-42.09	2	55.14	Peak	68.2	Pass
NVNT	ac80	5610	Ant2	5725.775	-51.36	2	45.87	Average	54	Pass
NVNT	ac80	5610	Ant2	5735	-45.75	2	51.48	Peak	68.2	Pass
NVNT	ac80	5610	Ant2	5735	-52.55	2	44.68	Average	54	Pass
NVNT	ax20	5500	Ant2	5460	-40.21	2	57.02	Peak	68.2	Pass
NVNT	ax20	5500	Ant2	5460	-50.98	2	46.25	Average	54	Pass
NVNT	ax20	5500	Ant2	5469.6	-30.79	2	66.44	Peak	68.2	Pass
NVNT	ax20	5500	Ant2	5470	-44.68	2	51.55	Average	54	Pass
NVNT	ax20	5500	Ant2	5470	-34.11	2	63.12	Peak	68.2	Pass
NVNT	ax20	5500	Ant2	5470	-44.68	2	51.55	Average	54	Pass
NVNT	ax20	5700	Ant2	5725	-35.12	2	62.11	Peak	68.2	Pass
NVNT	ax20	5700	Ant2	5725	-51.33	2	45.9	Average	54	Pass



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China


Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity




NVNT	ax20	5700	Ant2	5725	-35.12	2	62.11	Peak	68.2	Pass
NVNT	ax20	5700	Ant2	5725	-51.33	2	45.9	Average	54	Pass
NVNT	ax20	5700	Ant2	5735	-48.99	2	48.24	Peak	68.2	Pass
NVNT	ax20	5700	Ant2	5735	-56.31	2	40.92	Average	54	Pass
NVNT	ax40	5510	Ant2	5460	-49.66	2	47.57	Peak	68.2	Pass
NVNT	ax40	5510	Ant2	5460	-56.32	2	40.91	Average	54	Pass
NVNT	ax40	5510	Ant2	5468.8	-36.53	2	60.7	Peak	68.2	Pass
NVNT	ax40	5510	Ant2	5469.8	-52.06	2	45.17	Average	54	Pass
NVNT	ax40	5510	Ant2	5470	-43.27	2	53.96	Peak	68.2	Pass
NVNT	ax40	5510	Ant2	5470	-52.07	2	45.16	Average	54	Pass
NVNT	ax40	5670	Ant2	5725	-42.98	2	54.25	Peak	68.2	Pass
NVNT	ax40	5670	Ant2	5725	-50.85	2	46.38	Average	54	Pass
NVNT	ax40	5670	Ant2	5725.4	-40.06	2	57.17	Peak	68.2	Pass
NVNT	ax40	5670	Ant2	5725	-50.85	2	46.38	Average	54	Pass
NVNT	ax40	5670	Ant2	5735	-45.89	2	51.34	Peak	68.2	Pass
NVNT	ax40	5670	Ant2	5735	-53.55	2	43.68	Average	54	Pass
NVNT	ax80	5530	Ant2	5460	-47.44	2	49.79	Peak	68.2	Pass
NVNT	ax80	5530	Ant2	5460	-53.16	2	44.07	Average	54	Pass
NVNT	ax80	5530	Ant2	5468.2	-39.22	2	58.01	Peak	68.2	Pass
NVNT	ax80	5530	Ant2	5470	-51.28	2	45.95	Average	54	Pass
NVNT	ax80	5530	Ant2	5470	-40.56	2	56.67	Peak	68.2	Pass
NVNT	ax80	5530	Ant2	5470	-51.28	2	45.95	Average	54	Pass
NVNT	ax80	5610	Ant2	5725	-44.74	2	52.49	Peak	68.2	Pass
NVNT	ax80	5610	Ant2	5725	-51.7	2	45.53	Average	54	Pass
NVNT	ax80	5610	Ant2	5726.8	-43.13	2	54.1	Peak	68.2	Pass
NVNT	ax80	5610	Ant2	5725.365	-51.5	2	45.73	Average	54	Pass
NVNT	ax80	5610	Ant2	5735	-45.52	2	51.71	Peak	68.2	Pass
NVNT	ax80	5610	Ant2	5735	-52.6	2	44.63	Average	54	Pass



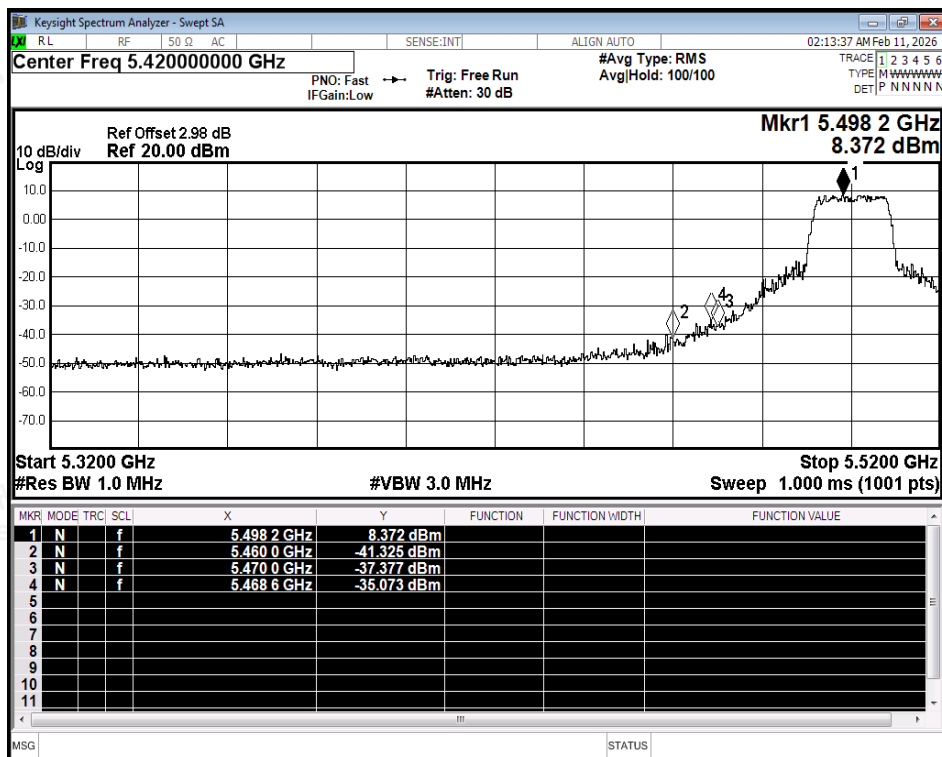

Restrict Band NVNT a 5500MHz Ant2 Peak

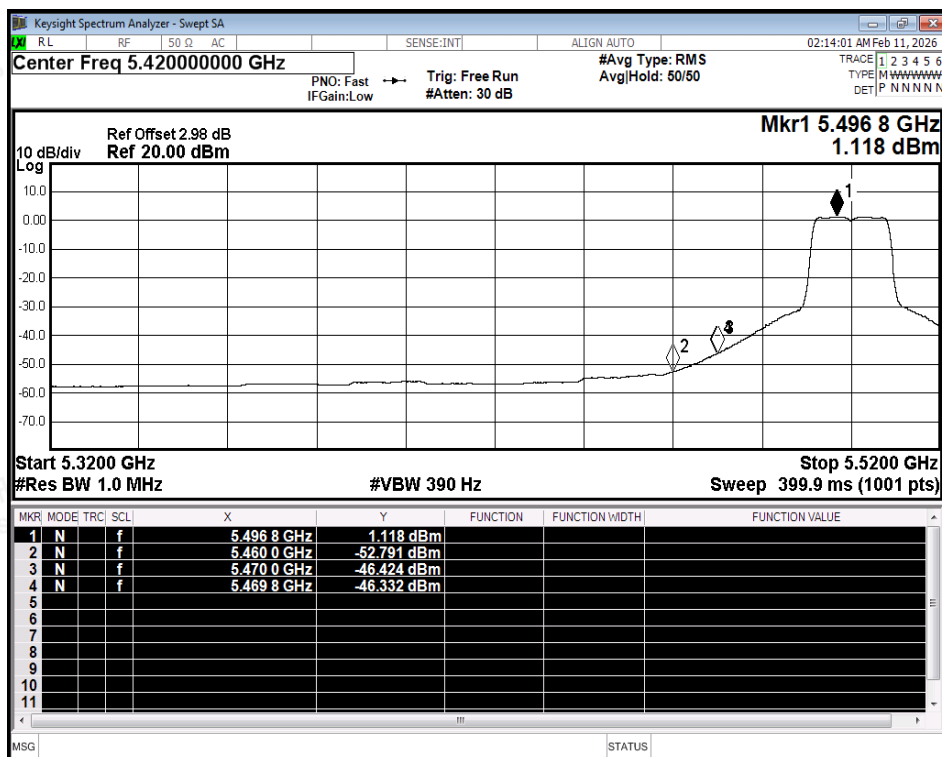

Restrict Band NVNT a 5500MHz Ant2 Average




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

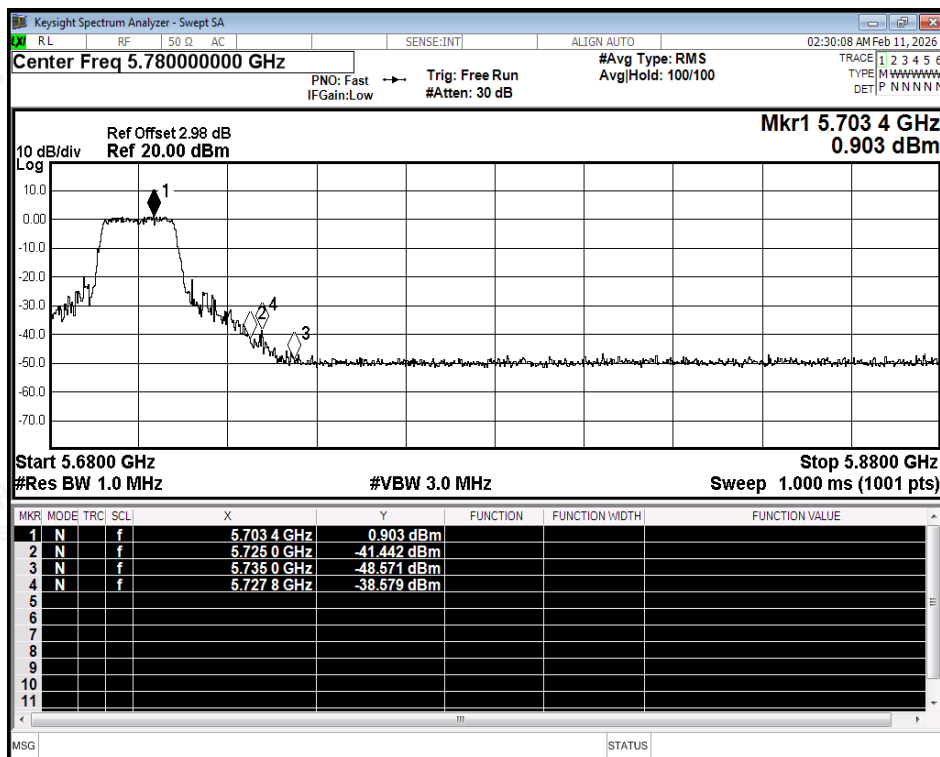

Restrict Band NVNT a 5700MHz Ant2 Peak

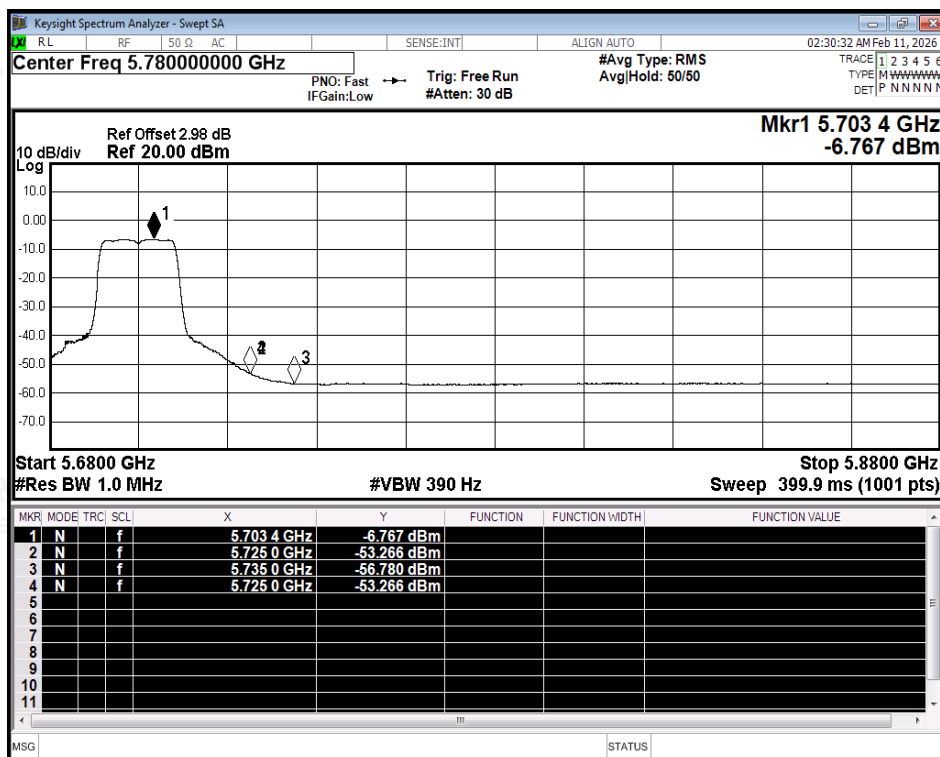

Restrict Band NVNT a 5700MHz Ant2 Average




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

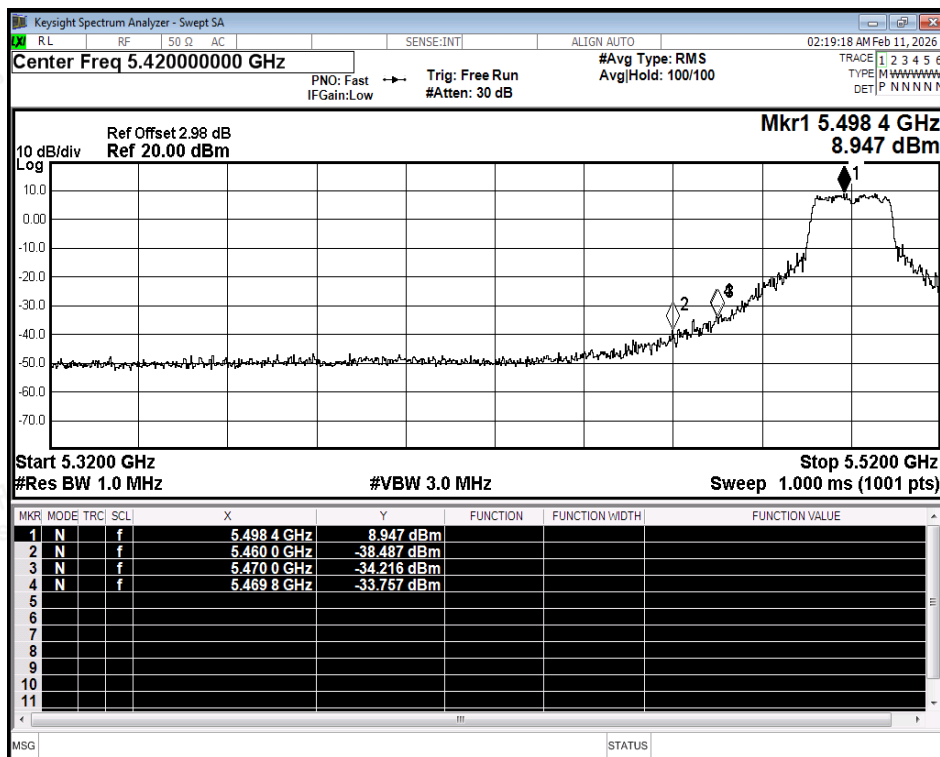


Restrict Band NVNT n20 5500MHz Ant2 Peak

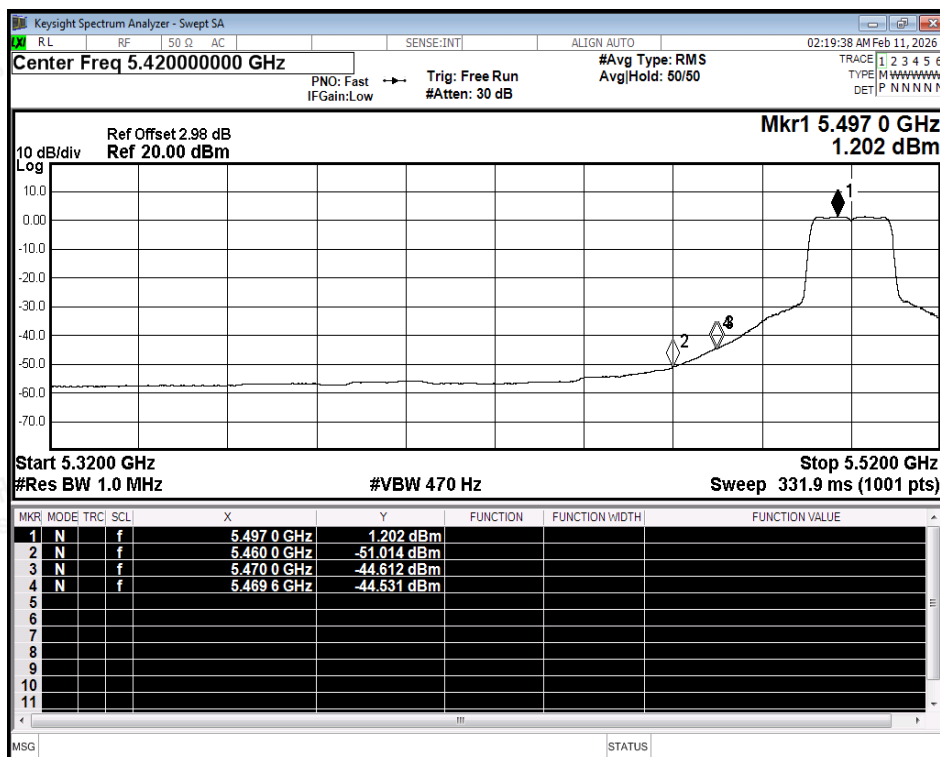


Restrict Band NVNT n20 5500MHz Ant2 Average



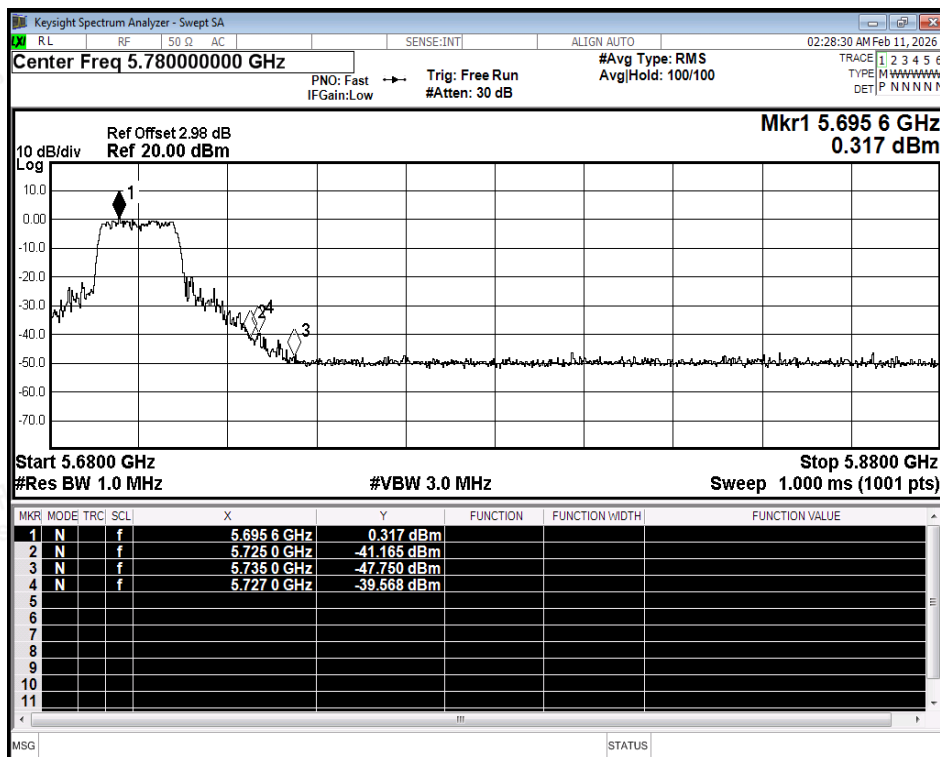

Restrict Band NVNT n20 5700MHz Ant2 Peak

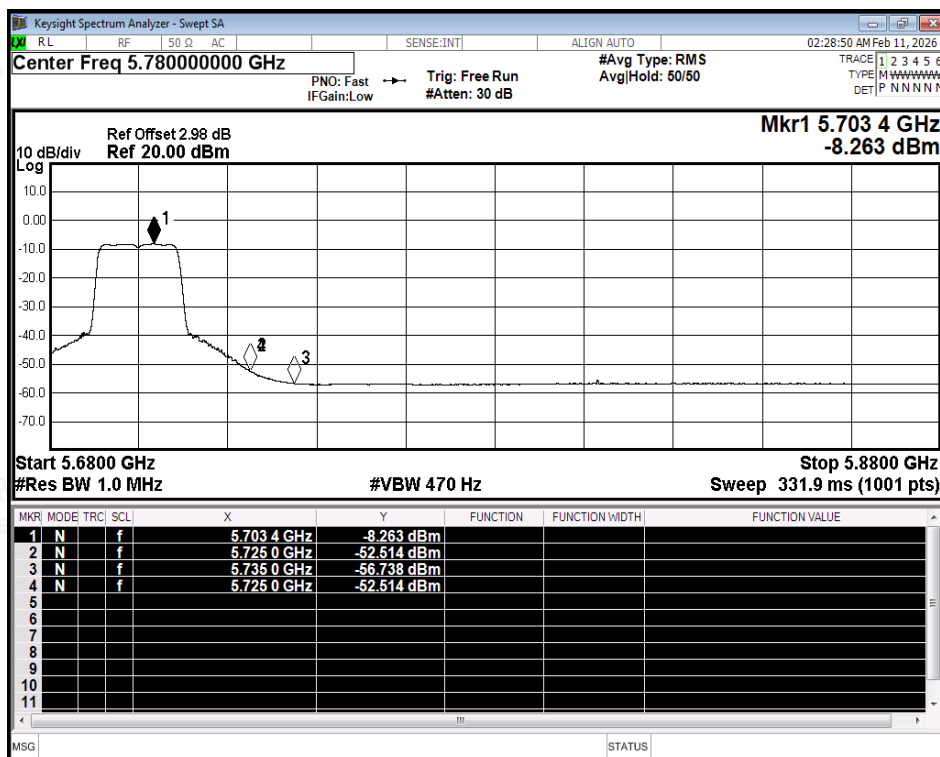

Restrict Band NVNT n20 5700MHz Ant2 Average




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

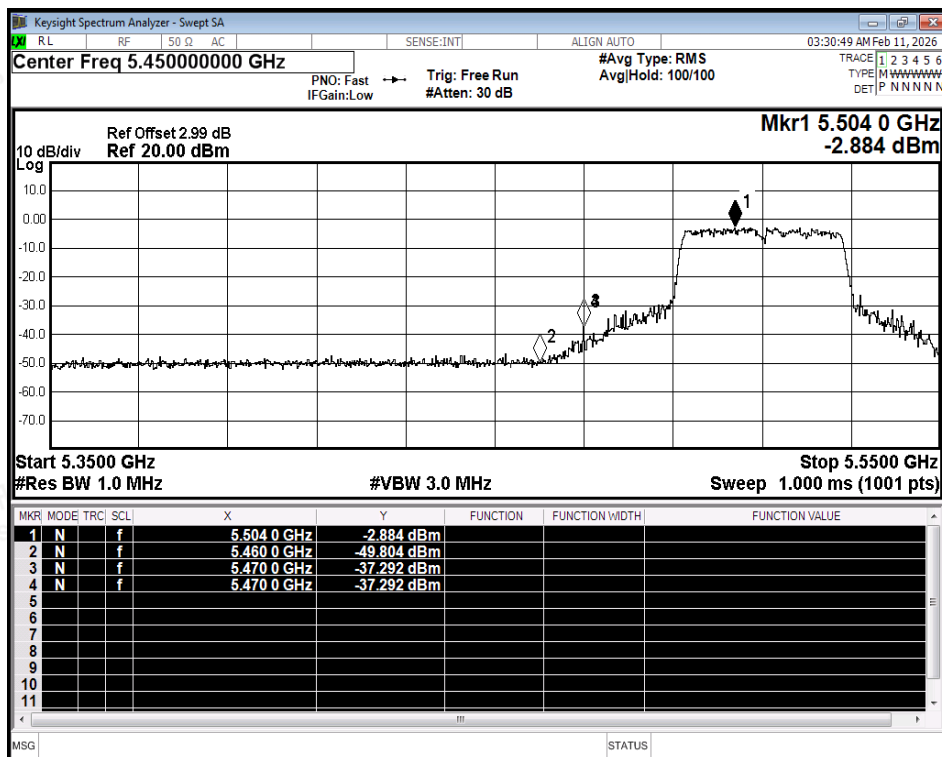

Restrict Band NVNT n40 5510MHz Ant2 Peak

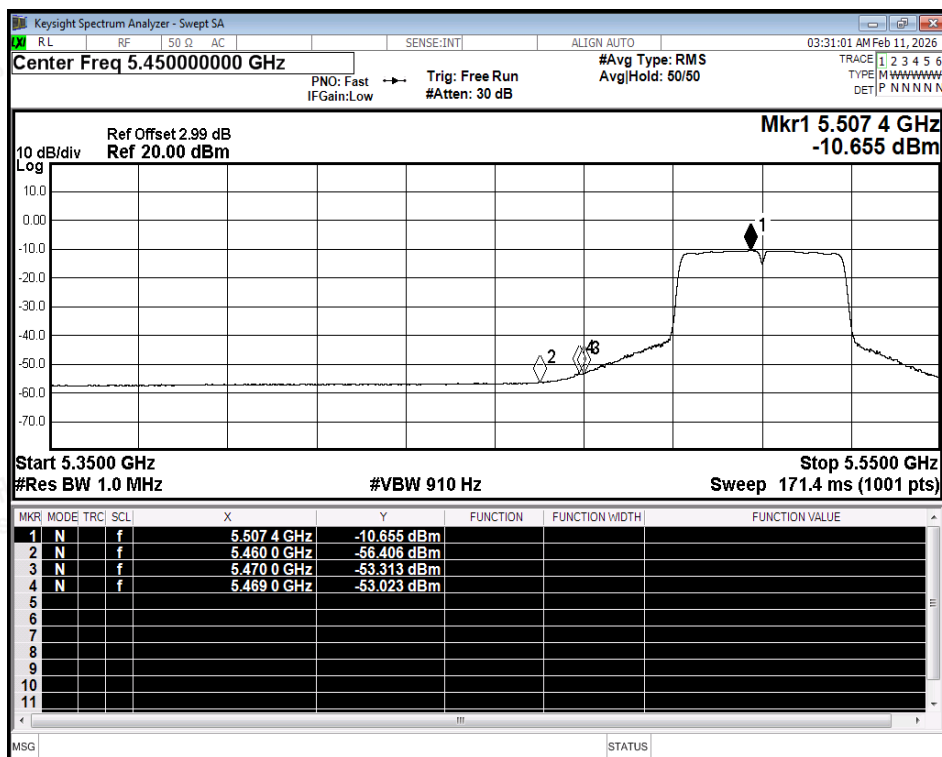

Restrict Band NVNT n40 5510MHz Ant2 Average




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

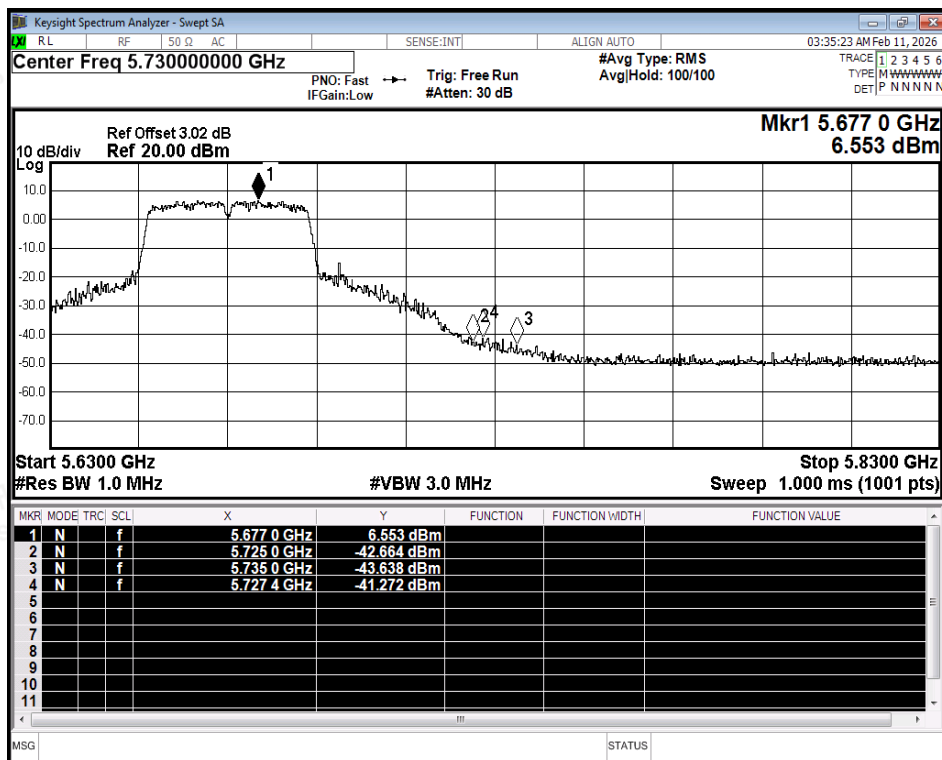

Restrict Band NVNT n40 5670MHz Ant2 Peak

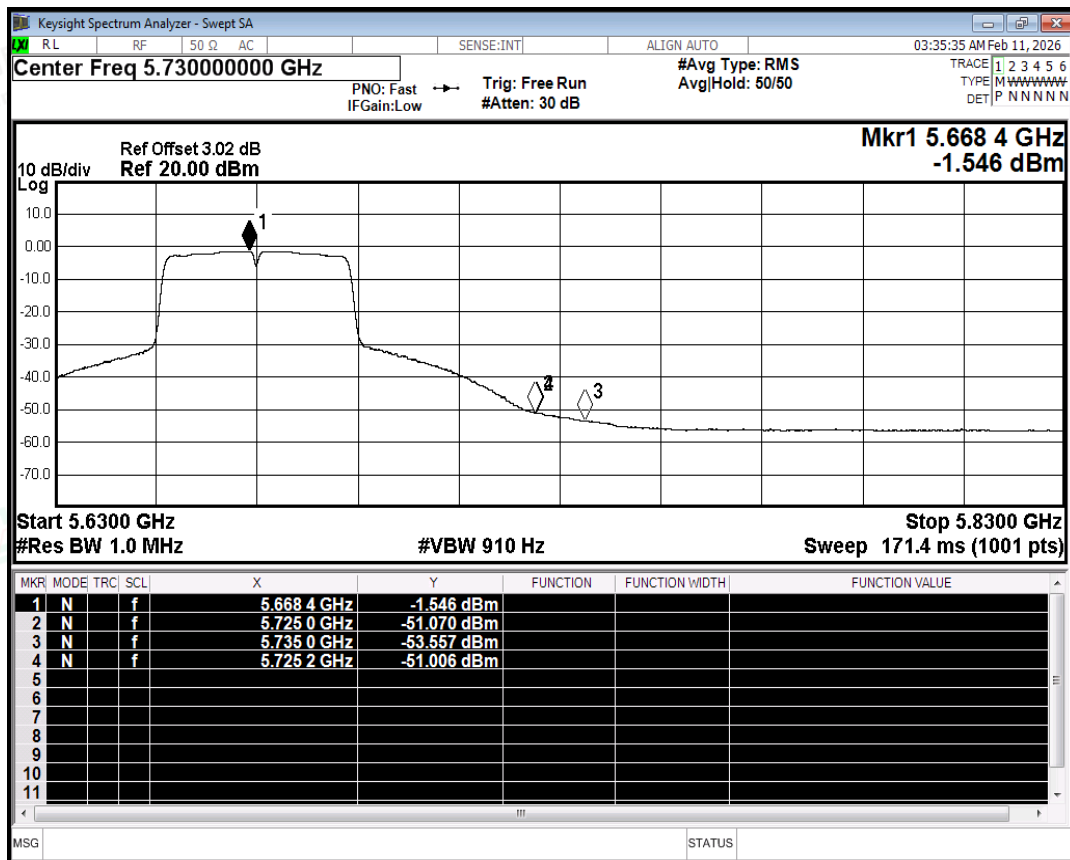

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT n40 5670MHz Ant2 Average

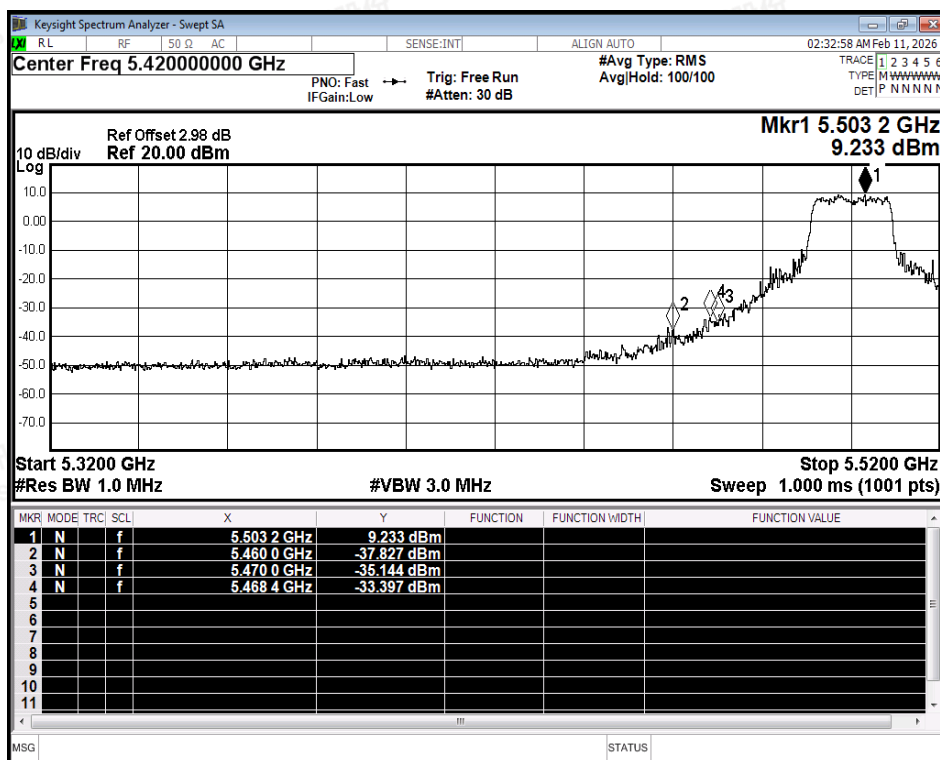

Restrict Band NVNT ac20 5500MHz Ant2 Peak

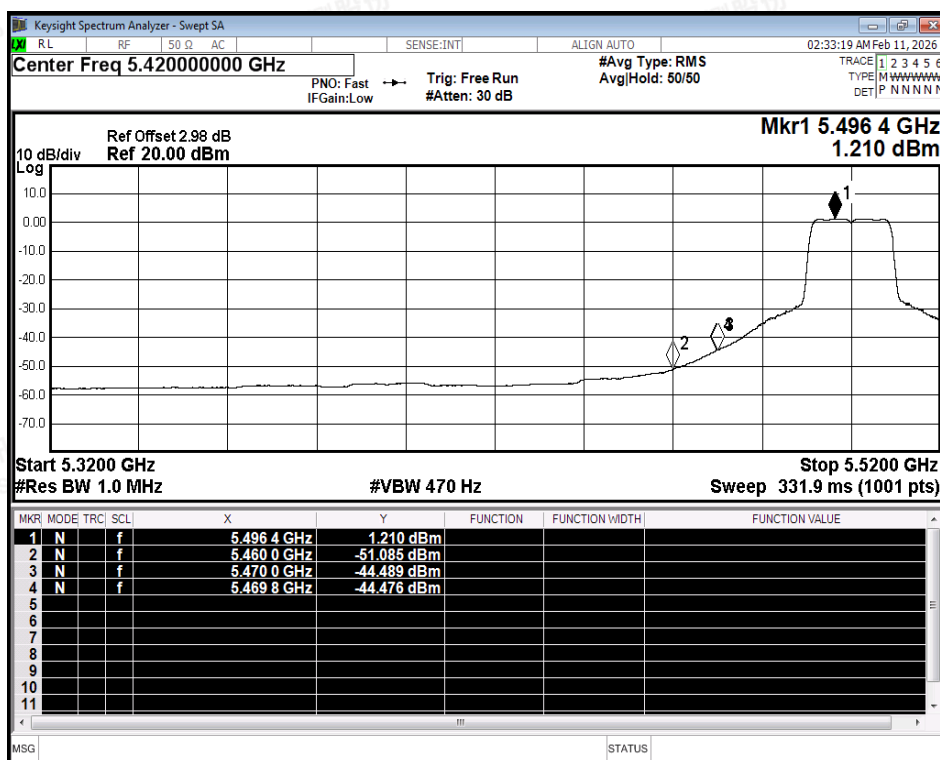

Restrict Band NVNT ac20 5500MHz Ant2 Average




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

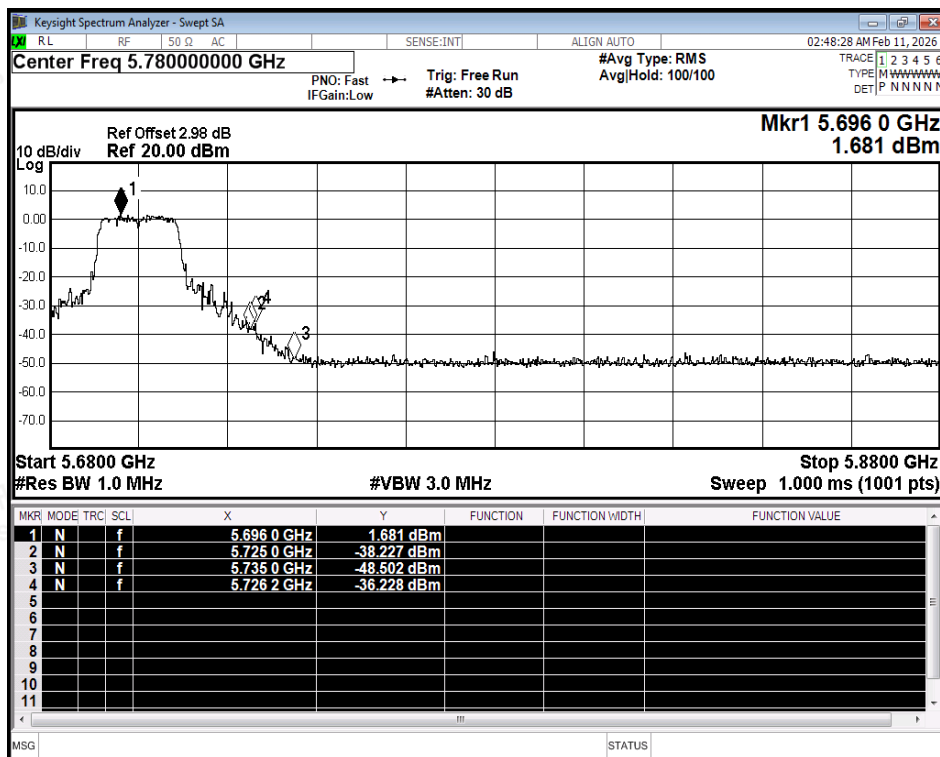

Restrict Band NVNT ac20 5700MHz Ant2 Peak

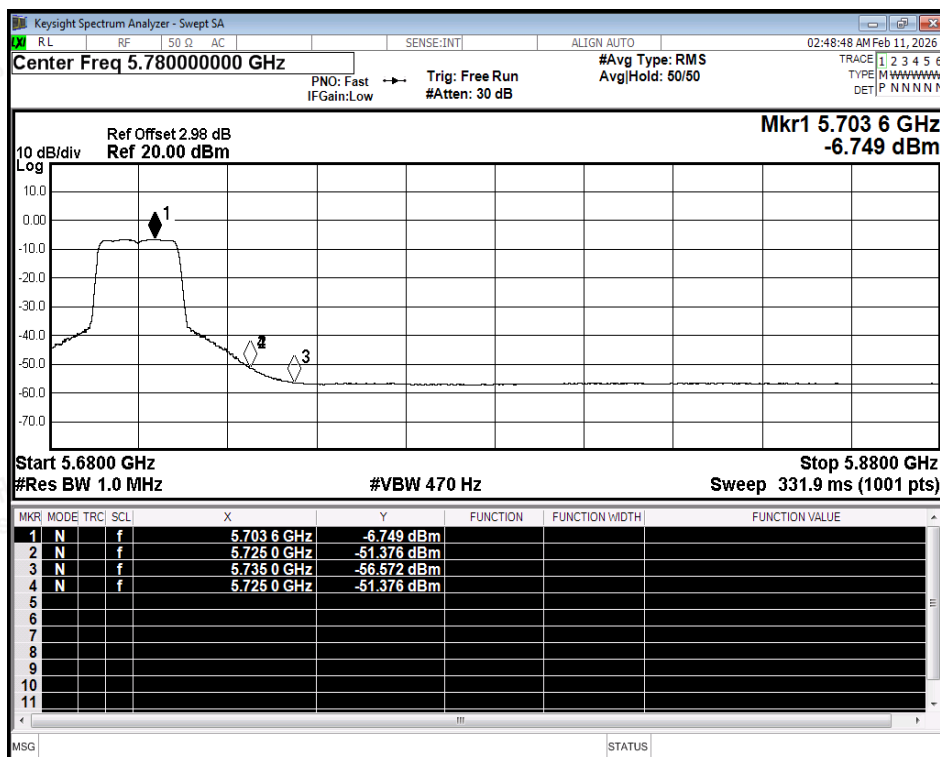

Restrict Band NVNT ac20 5700MHz Ant2 Average




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

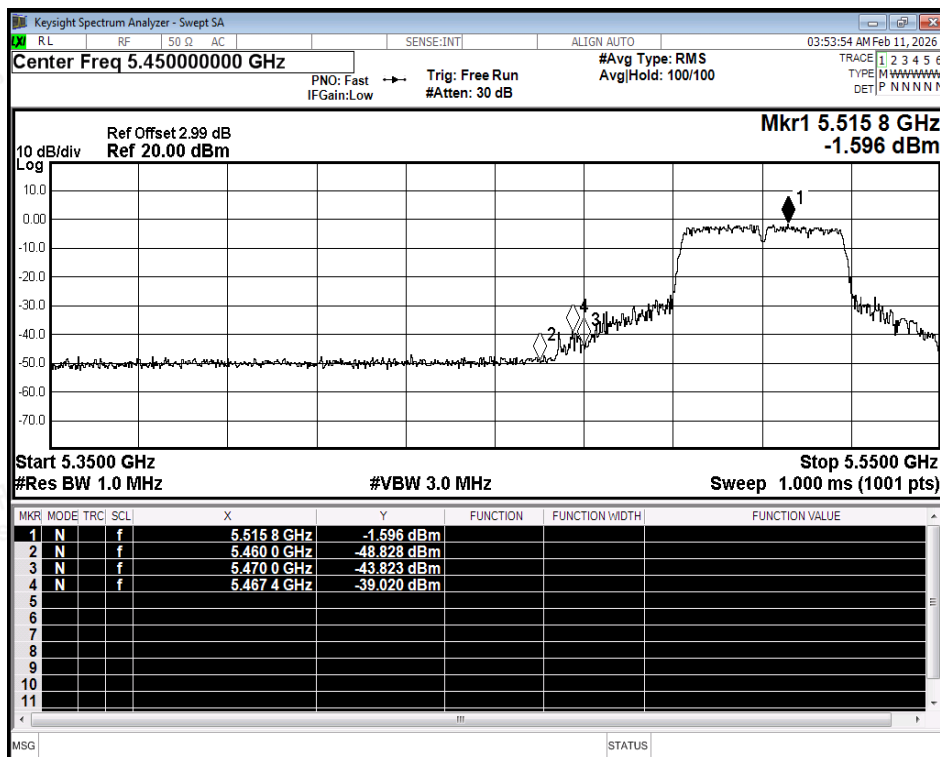

Restrict Band NVNT ac40 5510MHz Ant2 Peak

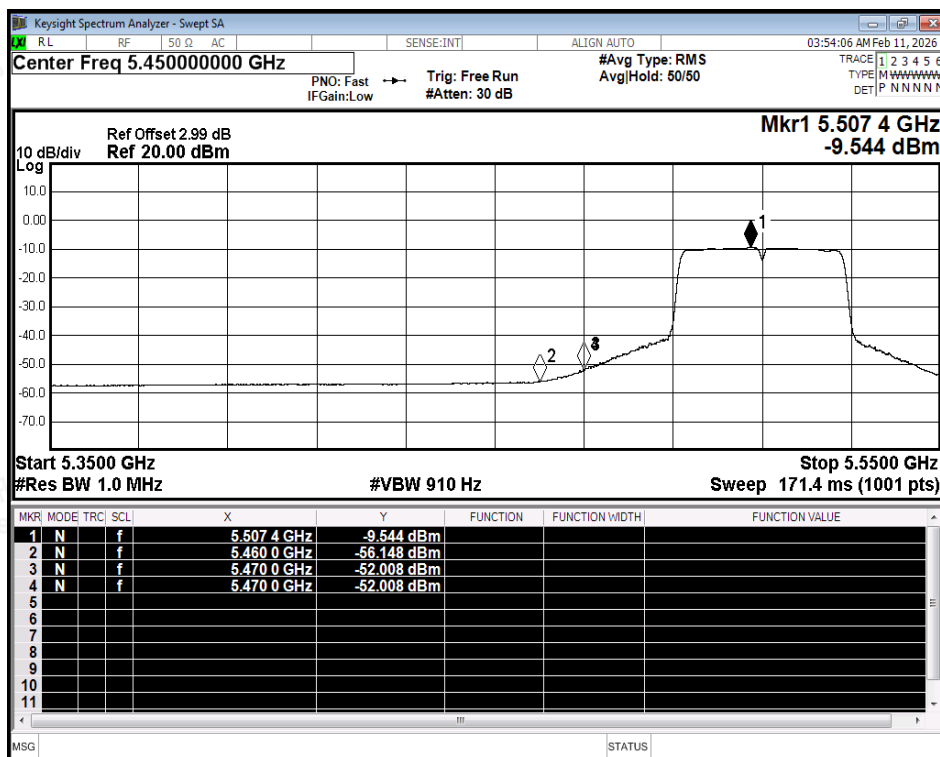

Restrict Band NVNT ac40 5510MHz Ant2 Average




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

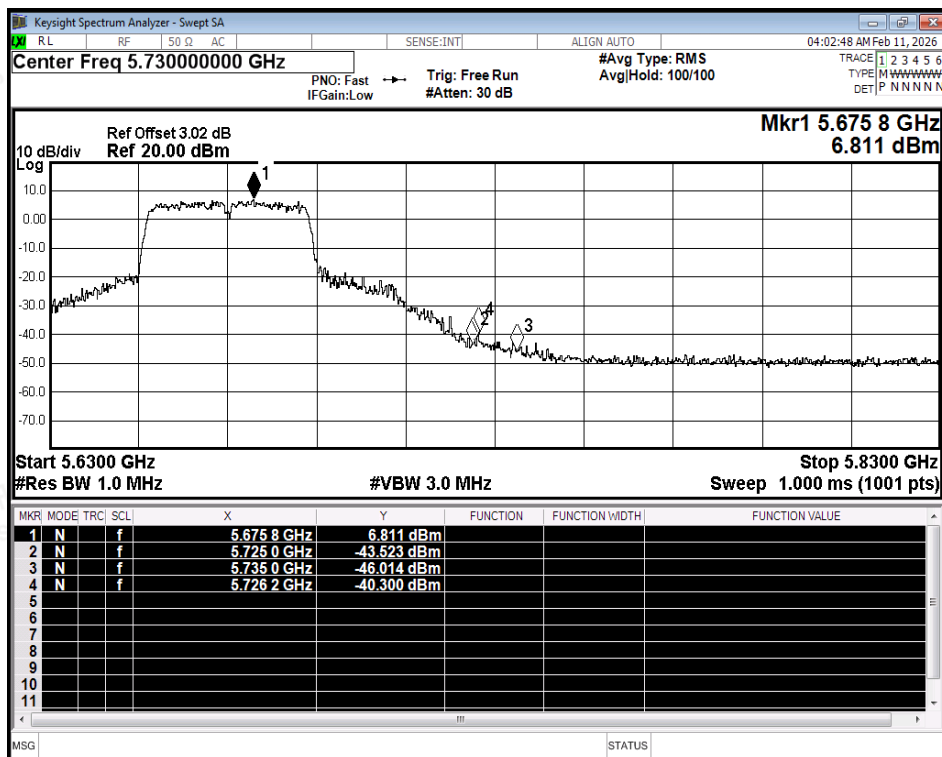

Restrict Band NVNT ac40 5670MHz Ant2 Peak

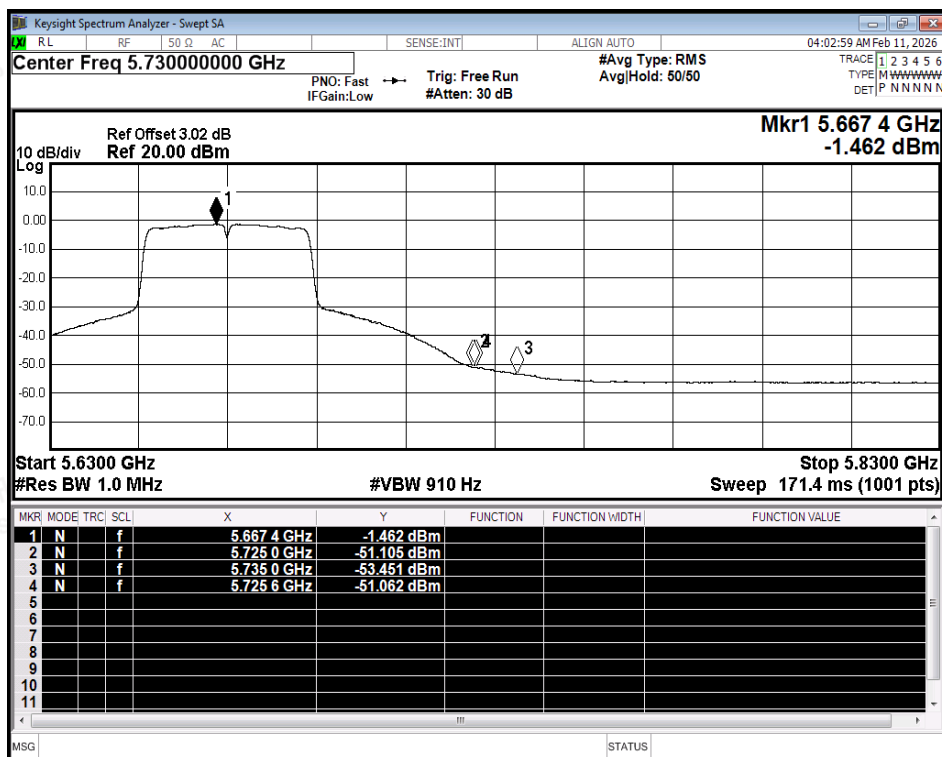

Restrict Band NVNT ac40 5670MHz Ant2 Average




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

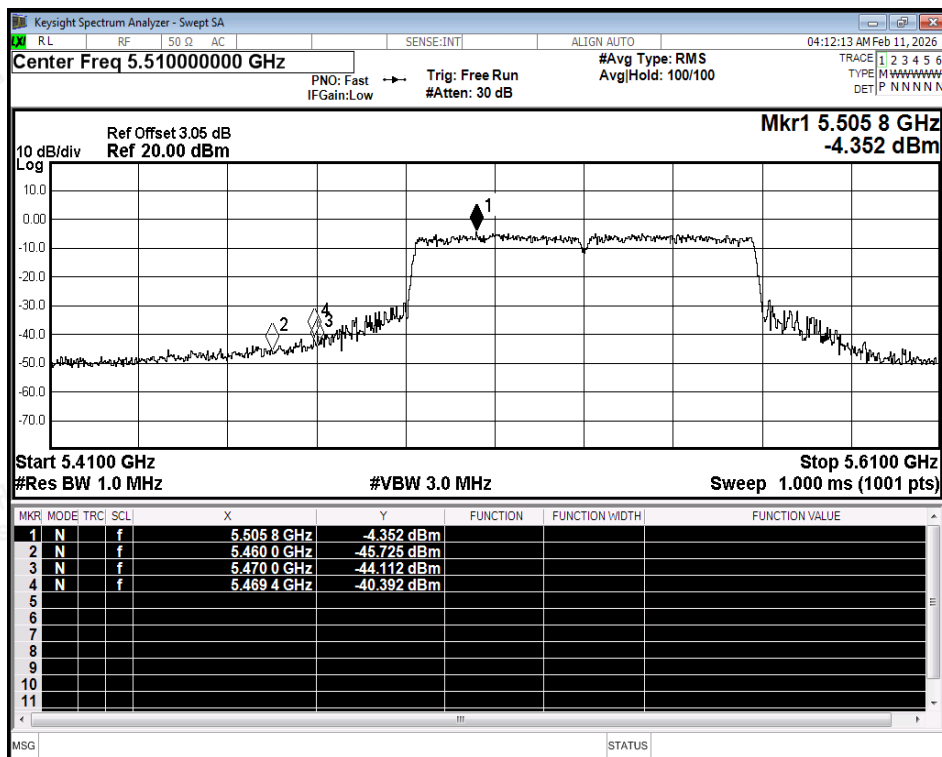

Restrict Band NVNT ac80 5530MHz Ant2 Peak

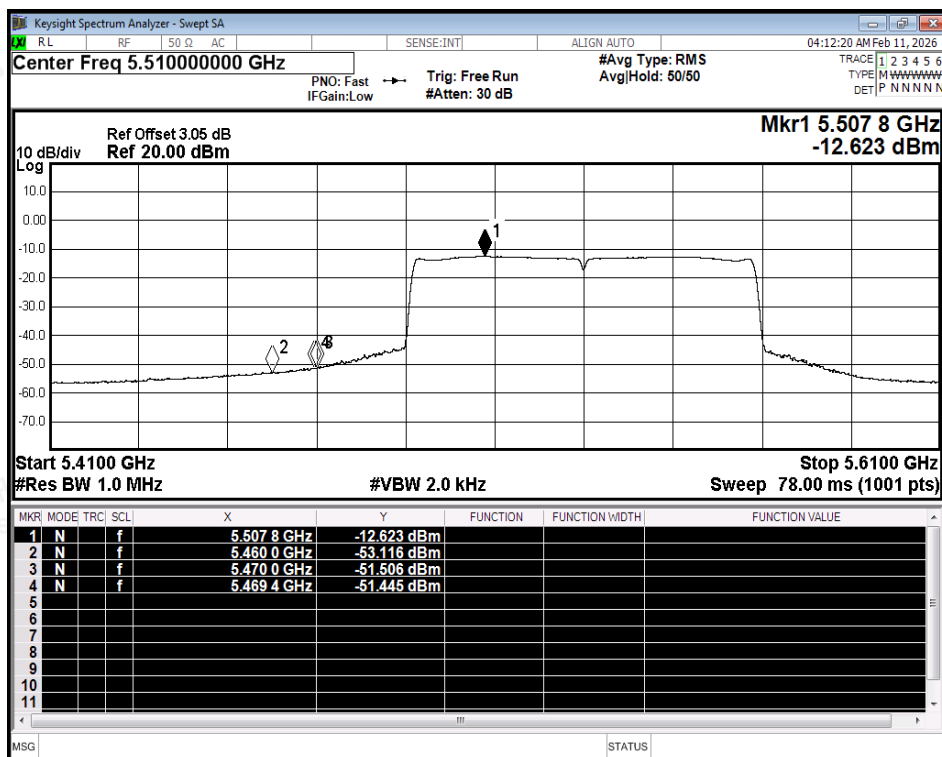

Restrict Band NVNT ac80 5530MHz Ant2 Average




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

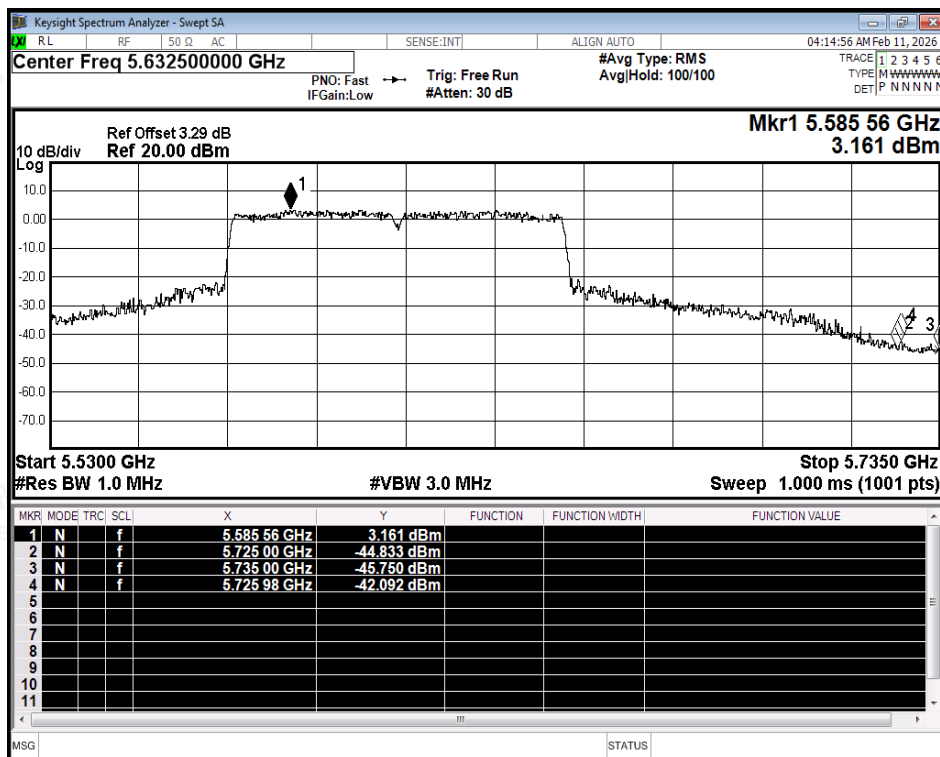

Restrict Band NVNT ac80 5610MHz Ant2 Peak

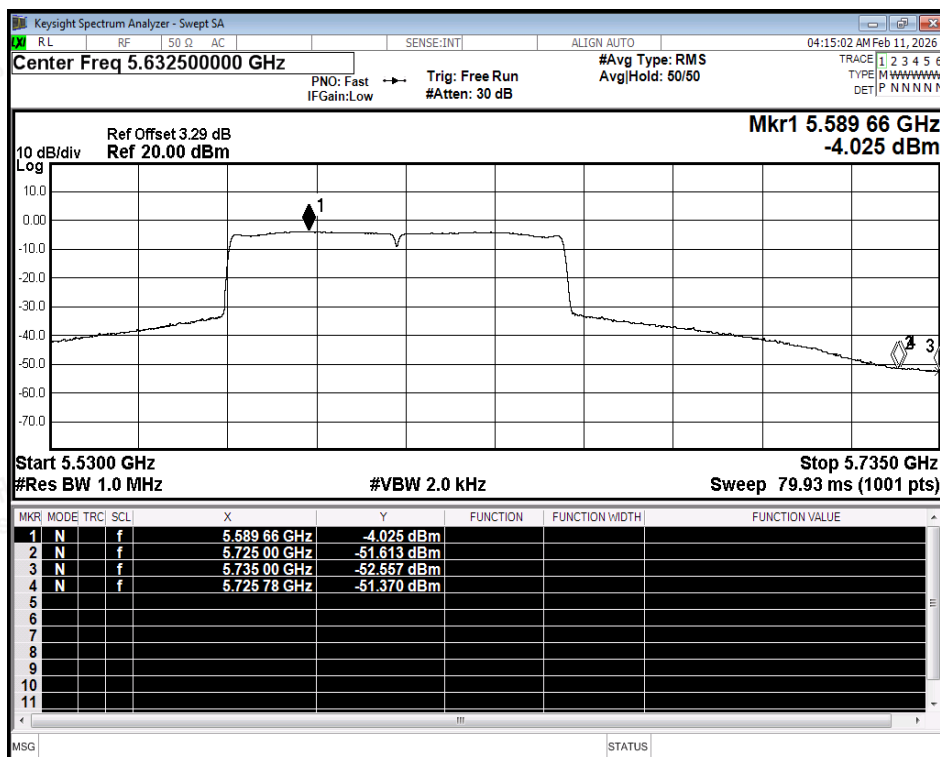

Restrict Band NVNT ac80 5610MHz Ant2 Average




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

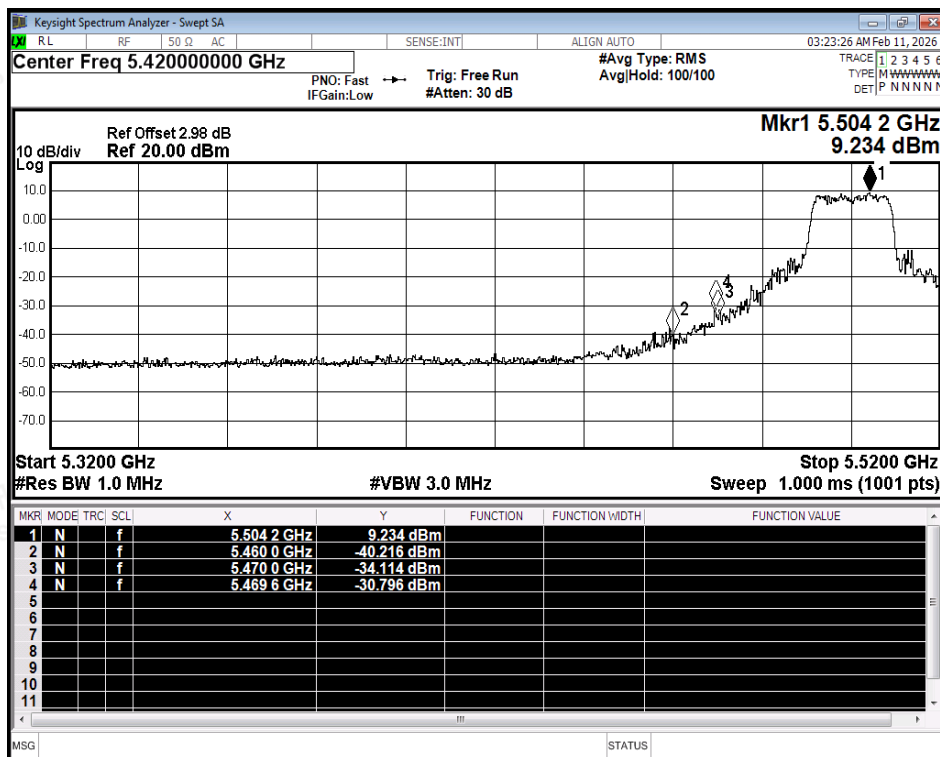

Restrict Band NVNT ax20 5500MHz Ant2 Peak

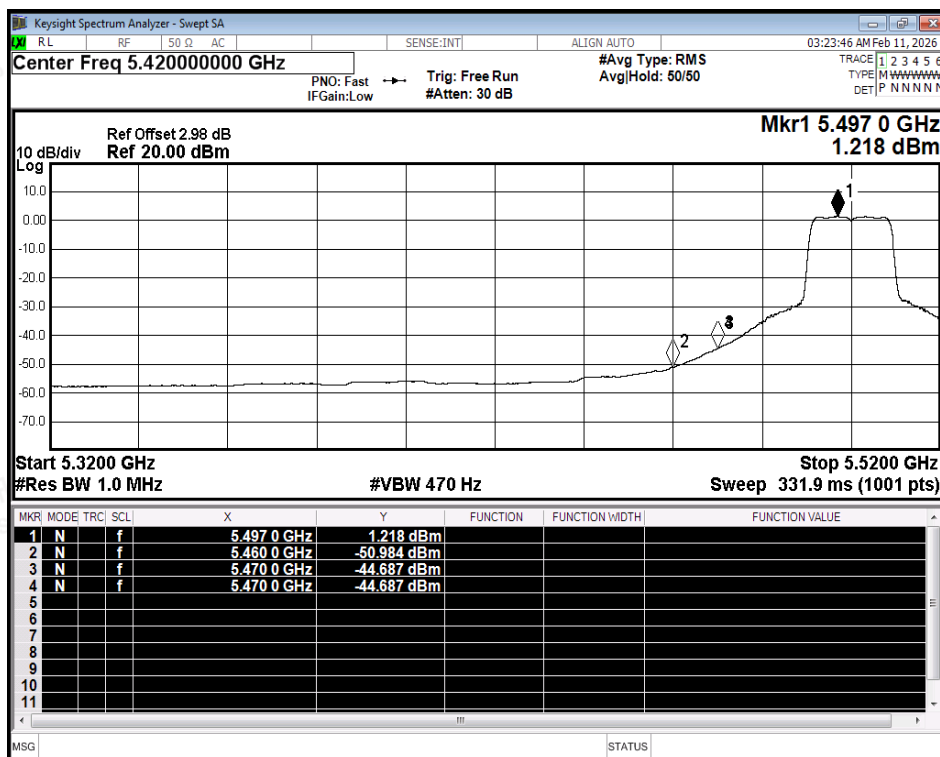

Restrict Band NVNT ax20 5500MHz Ant2 Average




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

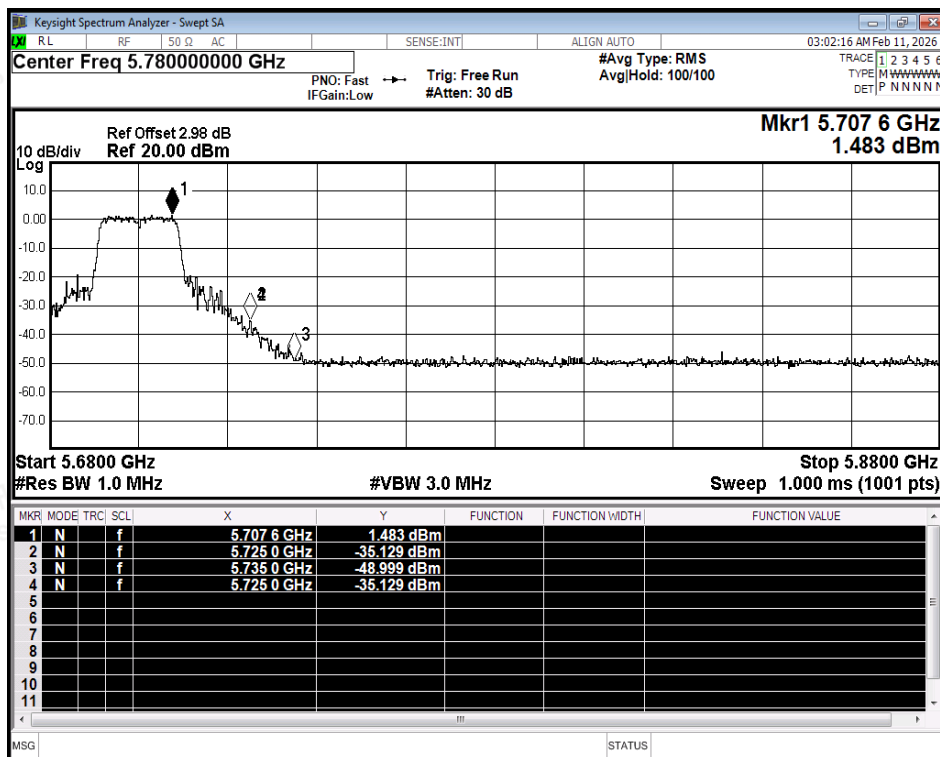

Restrict Band NVNT ax20 5700MHz Ant2 Peak

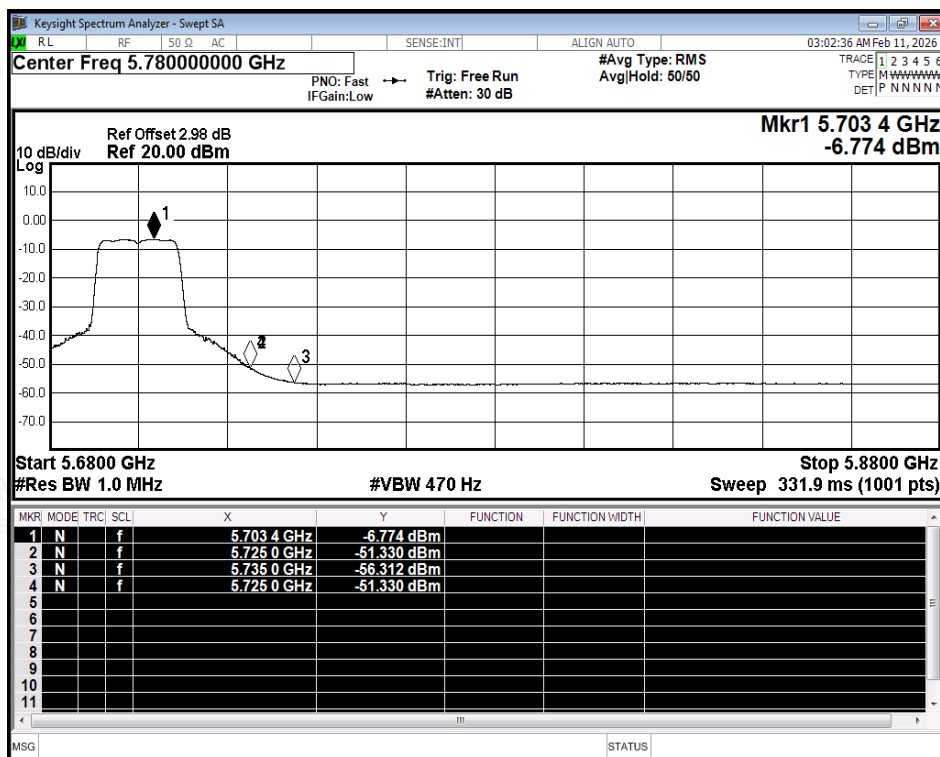

Restrict Band NVNT ax20 5700MHz Ant2 Average




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

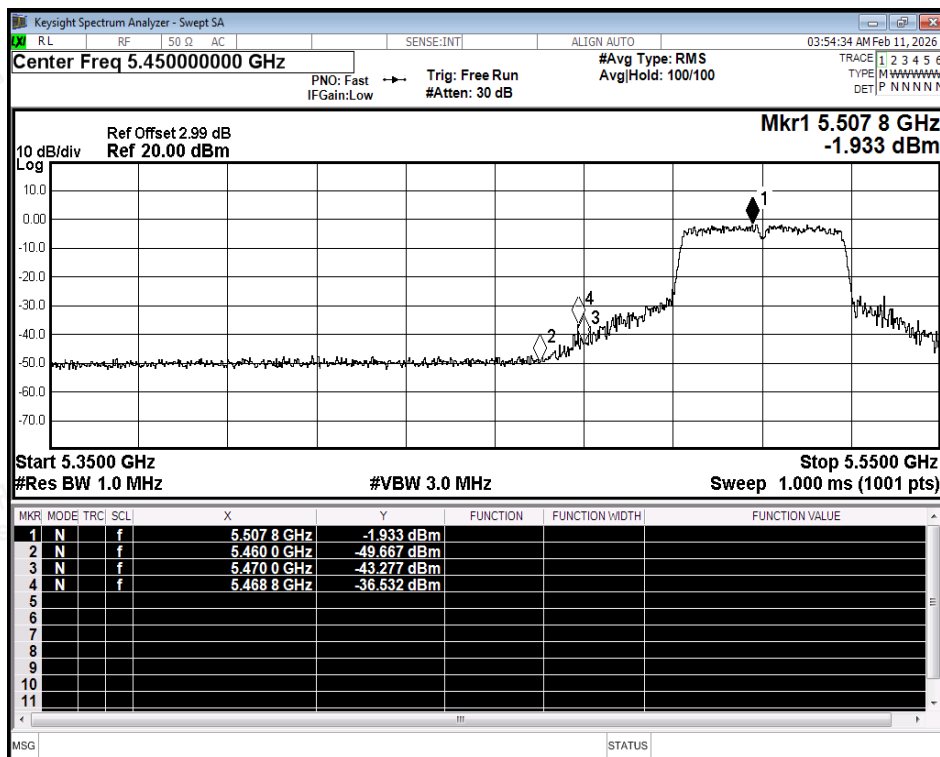

Restrict Band NVNT ax40 5510MHz Ant2 Peak

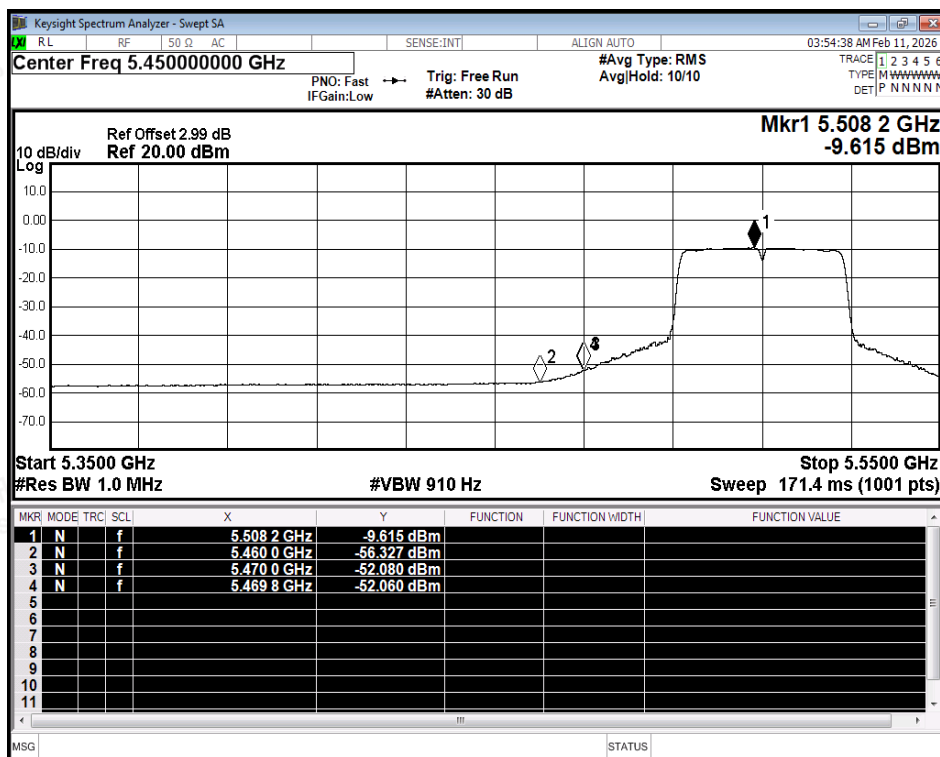

Restrict Band NVNT ax40 5510MHz Ant2 Average




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

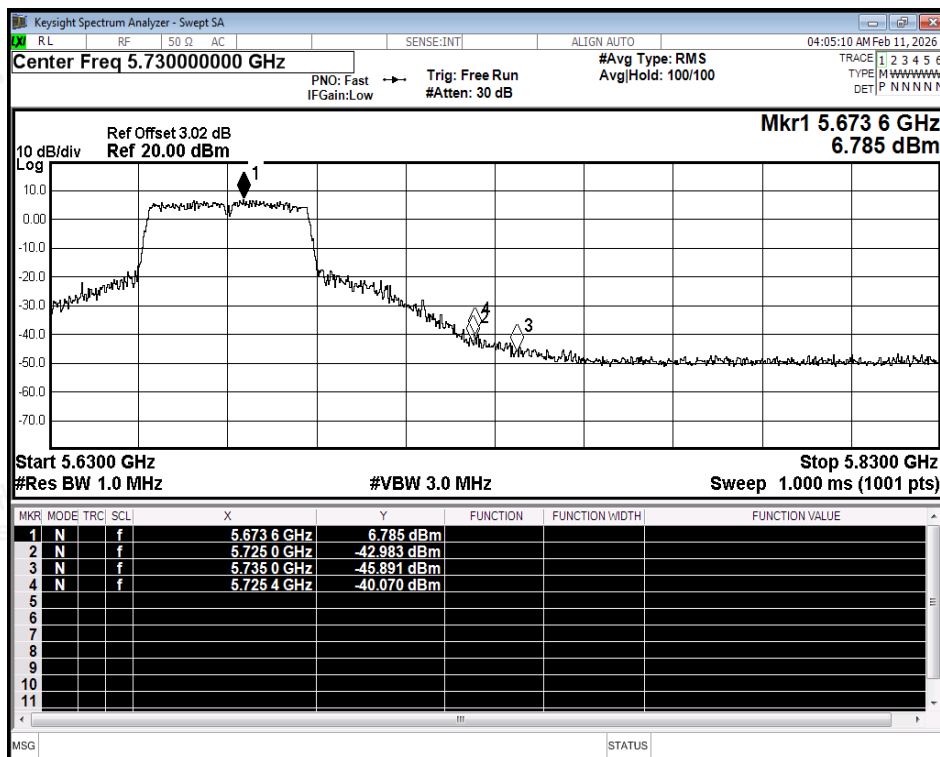

Restrict Band NVNT ax40 5670MHz Ant2 Peak

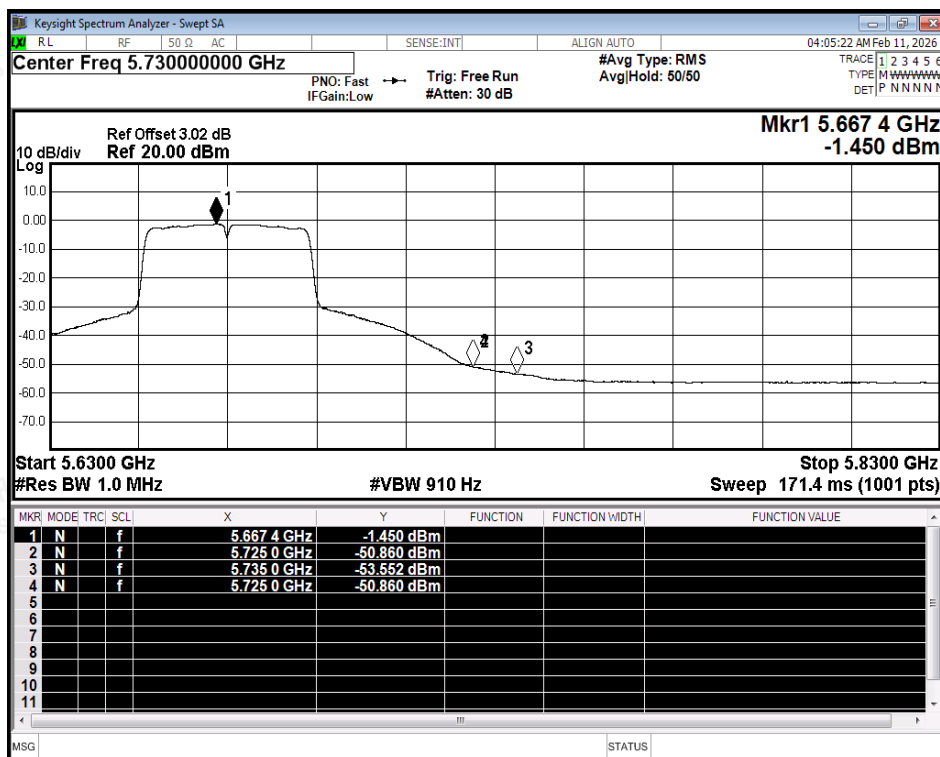

Restrict Band NVNT ax40 5670MHz Ant2 Average



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity