



Condition	Mode	Frequency (MHz)	Antenna	Spur Freq (MHz)	Power (dBm)	Gain (dBi)	E (dBuV/m)	Detector	Limit (dBuV/m)	Verdict
NVNT	a	5180	Ant2	4500	-61.22	2	36.01	Peak	68.2	Pass
NVNT	a	5180	Ant2	4500	-68.91	2	28.32	Average	54	Pass
NVNT	a	5180	Ant2	5148.9	-52.59	2	44.64	Peak	68.2	Pass
NVNT	a	5180	Ant2	5149.6	-60.05	2	37.18	Average	54	Pass
NVNT	a	5180	Ant2	5150	-52.76	2	44.47	Peak	68.2	Pass
NVNT	a	5180	Ant2	5150	-59.68	2	37.55	Average	54	Pass
NVNT	a	5240	Ant2	5350	-59.47	2	37.76	Peak	68.2	Pass
NVNT	a	5240	Ant2	5350	-66.68	2	30.55	Average	54	Pass
NVNT	a	5240	Ant2	5360.88	-56.87	2	40.36	Peak	68.2	Pass
NVNT	a	5240	Ant2	5350.08	-66.68	2	30.55	Average	54	Pass
NVNT	a	5240	Ant2	5460	-60.25	2	36.98	Peak	68.2	Pass
NVNT	a	5240	Ant2	5460	-67.23	2	30	Average	54	Pass
NVNT	n20	5180	Ant2	4500	-61.62	2	35.61	Peak	68.2	Pass
NVNT	n20	5180	Ant2	4500	-68.78	2	28.45	Average	54	Pass
NVNT	n20	5180	Ant2	5148.2	-50.5	2	46.73	Peak	68.2	Pass
NVNT	n20	5180	Ant2	4660.3	-53.12	2	44.11	Average	54	Pass
NVNT	n20	5180	Ant2	5150	-50.54	2	46.69	Peak	68.2	Pass
NVNT	n20	5180	Ant2	5150	-57.46	2	39.77	Average	54	Pass
NVNT	n20	5240	Ant2	5350	-60.83	2	36.4	Peak	68.2	Pass
NVNT	n20	5240	Ant2	5350	-66.76	2	30.47	Average	54	Pass
NVNT	n20	5240	Ant2	5423.28	-56.85	2	40.38	Peak	68.2	Pass
NVNT	n20	5240	Ant2	5351.04	-66.63	2	30.6	Average	54	Pass
NVNT	n20	5240	Ant2	5460	-59.84	2	37.39	Peak	68.2	Pass
NVNT	n20	5240	Ant2	5460	-67.16	2	30.07	Average	54	Pass
NVNT	n40	5190	Ant2	4500	-63.24	2	33.99	Peak	68.2	Pass
NVNT	n40	5190	Ant2	4500	-68.65	2	28.58	Average	54	Pass
NVNT	n40	5190	Ant2	5148.24	-51.15	2	46.08	Peak	68.2	Pass
NVNT	n40	5190	Ant2	5149.7	-57.61	2	39.62	Average	54	Pass
NVNT	n40	5190	Ant2	5150	-50.23	2	47	Peak	68.2	Pass
NVNT	n40	5190	Ant2	5150	-57.15	2	40.08	Average	54	Pass
NVNT	n40	5230	Ant2	5350	-59.61	2	37.62	Peak	68.2	Pass
NVNT	n40	5230	Ant2	5350	-67.03	2	30.2	Average	54	Pass
NVNT	n40	5230	Ant2	5435.43	-56.92	2	40.31	Peak	68.2	Pass
NVNT	n40	5230	Ant2	5451.36	-66.71	2	30.52	Average	54	Pass
NVNT	n40	5230	Ant2	5460	-60.72	2	36.51	Peak	68.2	Pass
NVNT	n40	5230	Ant2	5460	-67.03	2	30.2	Average	54	Pass
NVNT	ac20	5180	Ant2	4500	-62.74	2	34.49	Peak	68.2	Pass
NVNT	ac20	5180	Ant2	4500	-68.79	2	28.44	Average	54	Pass



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



NVNT	ac20	5180	Ant2	5149.6	-50.33	2	46.9	Peak	68.2	Pass
NVNT	ac20	5180	Ant2	5148.9	-58.09	2	39.14	Average	54	Pass
NVNT	ac20	5180	Ant2	5150	-51.38	2	45.85	Peak	68.2	Pass
NVNT	ac20	5180	Ant2	5150	-57.08	2	40.15	Average	54	Pass
NVNT	ac20	5240	Ant2	5350	-60.92	2	36.31	Peak	68.2	Pass
NVNT	ac20	5240	Ant2	5350	-66.73	2	30.5	Average	54	Pass
NVNT	ac20	5240	Ant2	5366.16	-56.58	2	40.65	Peak	68.2	Pass
NVNT	ac20	5240	Ant2	5351.52	-66.57	2	30.66	Average	54	Pass
NVNT	ac20	5240	Ant2	5460	-59.74	2	37.49	Peak	68.2	Pass
NVNT	ac20	5240	Ant2	5460	-67.17	2	30.06	Average	54	Pass
NVNT	ac40	5190	Ant2	4500	-50.34	2	46.89	Peak	68.2	Pass
NVNT	ac40	5190	Ant2	4500	-58.7	2	38.53	Average	54	Pass
NVNT	ac40	5190	Ant2	4736.52	-46.72	2	50.51	Peak	68.2	Pass
NVNT	ac40	5190	Ant2	5149.7	-54.04	2	43.19	Average	54	Pass
NVNT	ac40	5190	Ant2	5150	-40.22	2	57.01	Peak	68.2	Pass
NVNT	ac40	5190	Ant2	5150	-53.93	2	43.3	Average	54	Pass
NVNT	ac40	5230	Ant2	5350	-58.15	2	39.08	Peak	68.2	Pass
NVNT	ac40	5230	Ant2	5350	-67.05	2	30.18	Average	54	Pass
NVNT	ac40	5230	Ant2	5378.73	-56.41	2	40.82	Peak	68.2	Pass
NVNT	ac40	5230	Ant2	5415.18	-66.72	2	30.51	Average	54	Pass
NVNT	ac40	5230	Ant2	5460	-58.8	2	38.43	Peak	68.2	Pass
NVNT	ac40	5230	Ant2	5460	-66.91	2	30.32	Average	54	Pass
NVNT	ac80	5210	Ant2	5350	-50.97	2	46.26	Peak	68.2	Pass
NVNT	ac80	5210	Ant2	5350	-57.27	2	39.96	Average	54	Pass
NVNT	ac80	5210	Ant2	5382.12	-47.53	2	49.7	Peak	68.2	Pass
NVNT	ac80	5210	Ant2	5454.72	-56.38	2	40.85	Average	54	Pass
NVNT	ac80	5210	Ant2	5460	-49.59	2	47.64	Peak	68.2	Pass
NVNT	ac80	5210	Ant2	5460	-56.93	2	40.3	Average	54	Pass
NVNT	ac80	5210	Ant2	4500	-50.71	2	46.52	Peak	68.2	Pass
NVNT	ac80	5210	Ant2	4500	-58.4	2	38.83	Average	54	Pass
NVNT	ac80	5210	Ant2	5139.11	-42.77	2	54.46	Peak	68.2	Pass
NVNT	ac80	5210	Ant2	5145.43	-48.7	2	48.53	Average	54	Pass
NVNT	ac80	5210	Ant2	5150	-43.83	2	53.4	Peak	68.2	Pass
NVNT	ac80	5210	Ant2	5150	-48.93	2	48.3	Average	54	Pass
NVNT	ax20	5180	Ant2	4500	-52.01	2	45.22	Peak	68.2	Pass
NVNT	ax20	5180	Ant2	4500	-58.84	2	38.39	Average	54	Pass
NVNT	ax20	5180	Ant2	5060.7	-46.79	2	50.44	Peak	68.2	Pass
NVNT	ax20	5180	Ant2	5149.6	-54.85	2	42.38	Average	54	Pass
NVNT	ax20	5180	Ant2	5150	-49.61	2	47.62	Peak	68.2	Pass
NVNT	ax20	5180	Ant2	5150	-54.72	2	42.51	Average	54	Pass
NVNT	ax20	5240	Ant2	5350	-51.01	2	46.22	Peak	68.2	Pass



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China


Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity




NVNT	ax20	5240	Ant2	5350	-57.46	2	39.77	Average	54	Pass
NVNT	ax20	5240	Ant2	5445.6	-47.43	2	49.8	Peak	68.2	Pass
NVNT	ax20	5240	Ant2	5352.72	-56.91	2	40.32	Average	54	Pass
NVNT	ax20	5240	Ant2	5460	-47.63	2	49.6	Peak	68.2	Pass
NVNT	ax20	5240	Ant2	5460	-57.28	2	39.95	Average	54	Pass
NVNT	ax40	5190	Ant2	4500	-51.09	2	46.14	Peak	68.2	Pass
NVNT	ax40	5190	Ant2	4500	-58.88	2	38.35	Average	54	Pass
NVNT	ax40	5190	Ant2	5149.7	-45.83	2	51.4	Peak	68.2	Pass
NVNT	ax40	5190	Ant2	5149.7	-54.35	2	42.88	Average	54	Pass
NVNT	ax40	5190	Ant2	5150	-45.05	2	52.18	Peak	68.2	Pass
NVNT	ax40	5190	Ant2	5150	-53.89	2	43.34	Average	54	Pass
NVNT	ax40	5230	Ant2	5350	-60.6	2	36.63	Peak	68.2	Pass
NVNT	ax40	5230	Ant2	5350	-66.87	2	30.36	Average	54	Pass
NVNT	ax40	5230	Ant2	5423.82	-57.6	2	39.63	Peak	68.2	Pass
NVNT	ax40	5230	Ant2	5444.61	-66.73	2	30.5	Average	54	Pass
NVNT	ax40	5230	Ant2	5460	-60.77	2	36.46	Peak	68.2	Pass
NVNT	ax40	5230	Ant2	5460	-66.95	2	30.28	Average	54	Pass
NVNT	ax80	5210	Ant2	5350	-60.25	2	36.98	Peak	68.2	Pass
NVNT	ax80	5210	Ant2	5350	-66.5	2	30.73	Average	54	Pass
NVNT	ax80	5210	Ant2	5382.12	-57.07	2	40.16	Peak	68.2	Pass
NVNT	ax80	5210	Ant2	5393.01	-65.99	2	31.24	Average	54	Pass
NVNT	ax80	5210	Ant2	5460	-60.11	2	37.12	Peak	68.2	Pass
NVNT	ax80	5210	Ant2	5460	-66.28	2	30.95	Average	54	Pass
NVNT	ax80	5210	Ant2	4500	-53.21	2	44.02	Peak	68.2	Pass
NVNT	ax80	5210	Ant2	4500	-58.36	2	38.87	Average	54	Pass
NVNT	ax80	5210	Ant2	5025.35	-46.86	2	50.37	Peak	68.2	Pass
NVNT	ax80	5210	Ant2	5149.38	-54	2	43.23	Average	54	Pass
NVNT	ax80	5210	Ant2	5150	-48.73	2	48.5	Peak	68.2	Pass
NVNT	ax80	5210	Ant2	5150	-53.7	2	43.53	Average	54	Pass



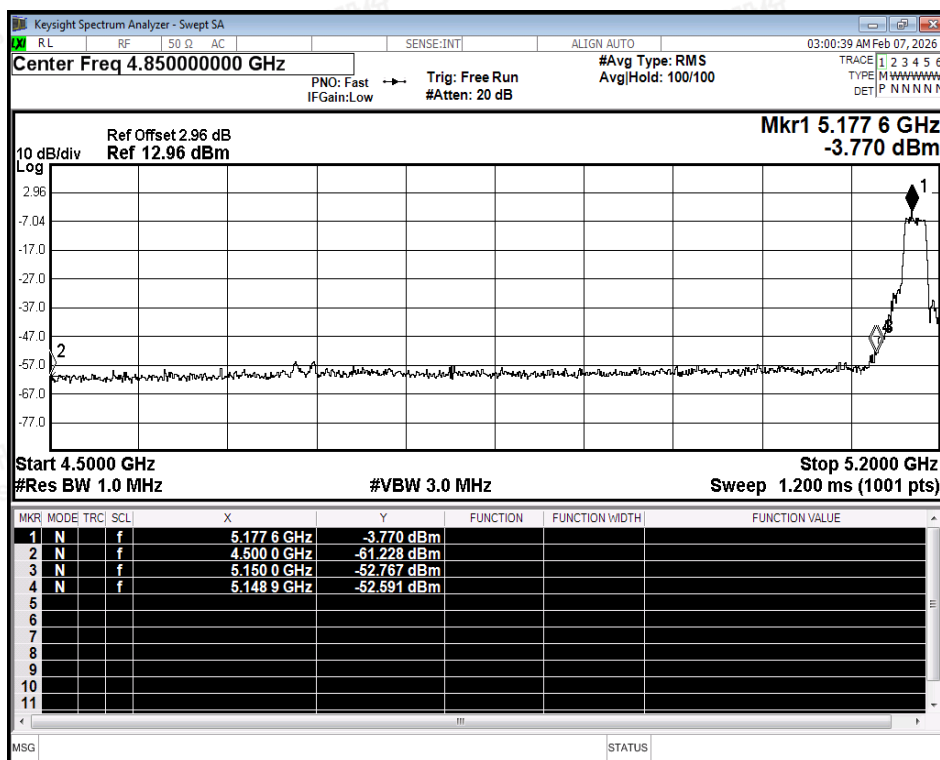

Restrict Band NVNT a 5180MHz Ant2 Peak

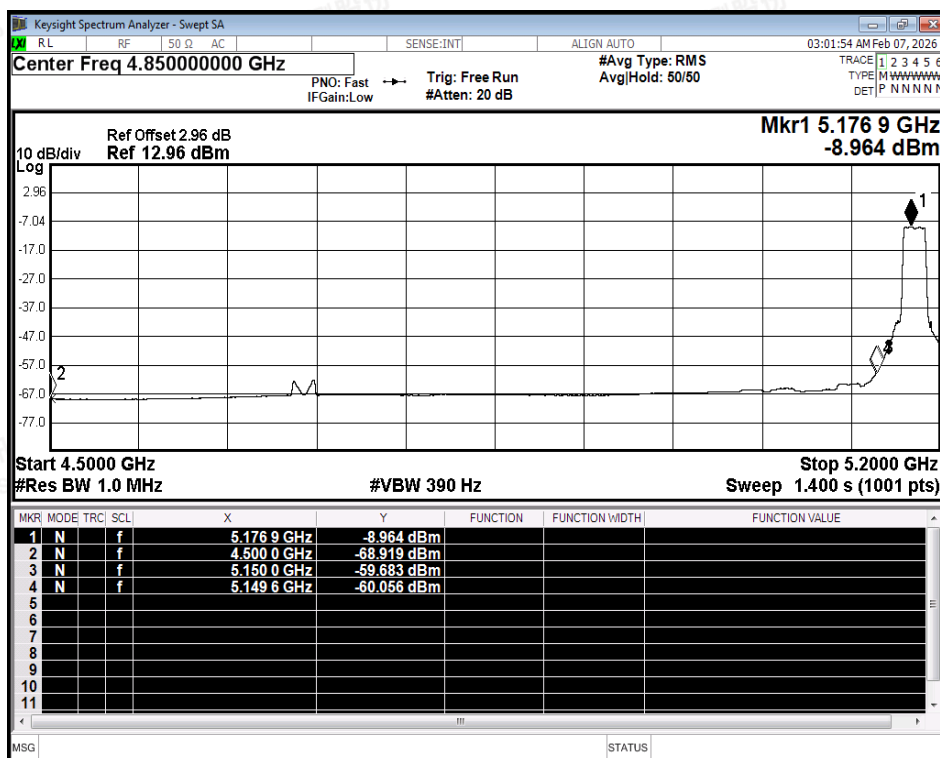

Restrict Band NVNT a 5180MHz Ant2 Average




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

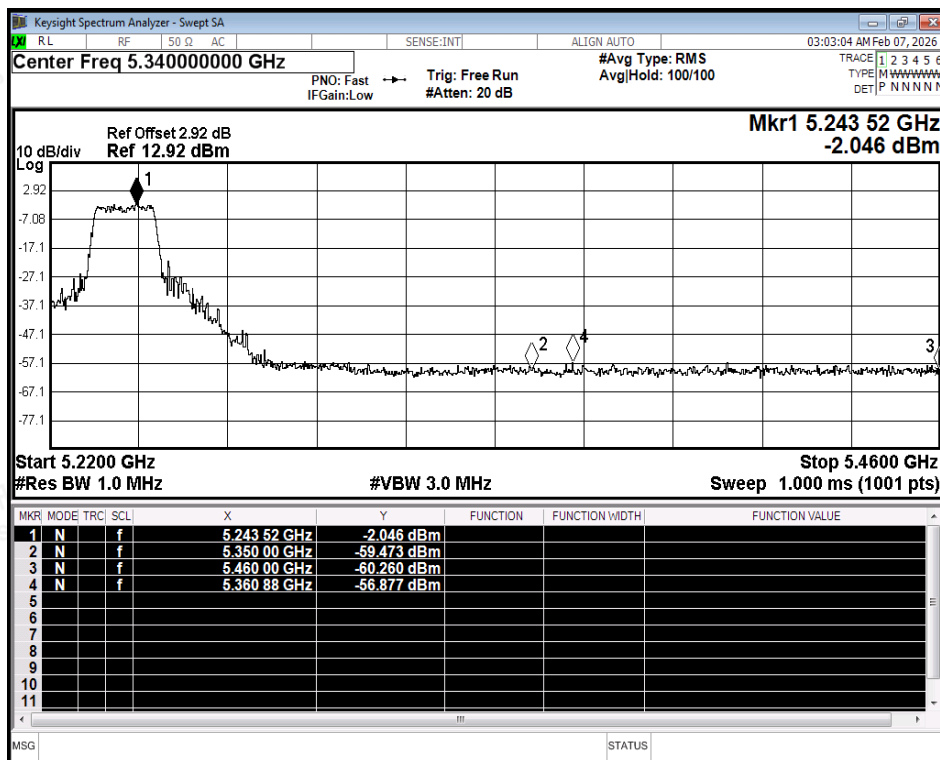

Restrict Band NVNT a 5240MHz Ant2 Peak

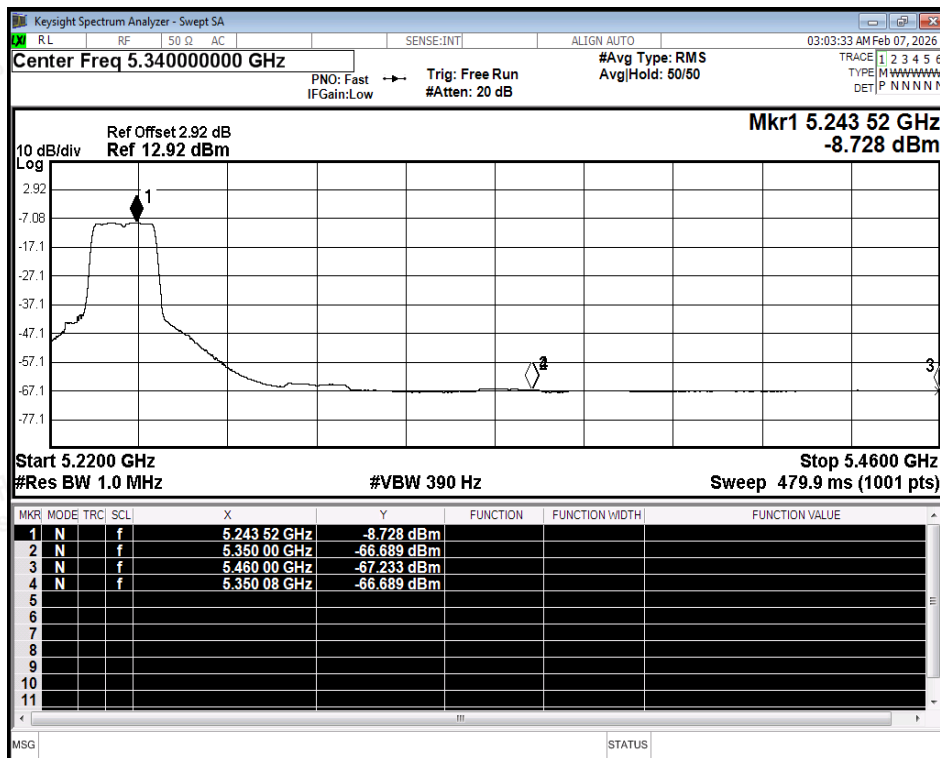

Restrict Band NVNT a 5240MHz Ant2 Average




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

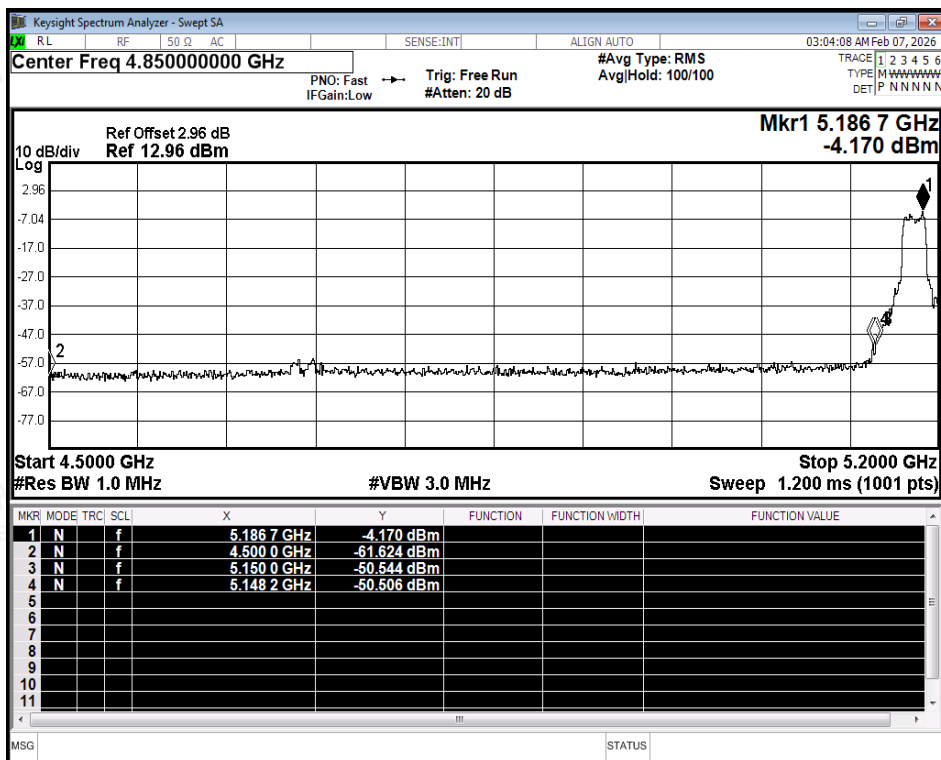

Restrict Band NVNT n20 5180MHz Ant2 Peak

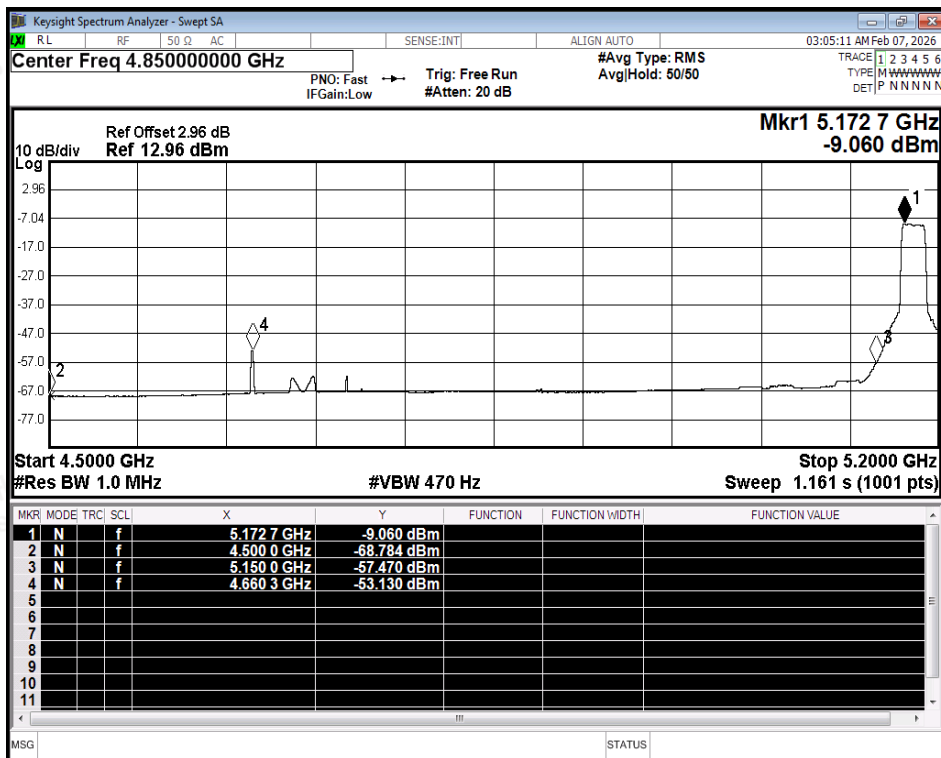

Restrict Band NVNT n20 5180MHz Ant2 Average




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

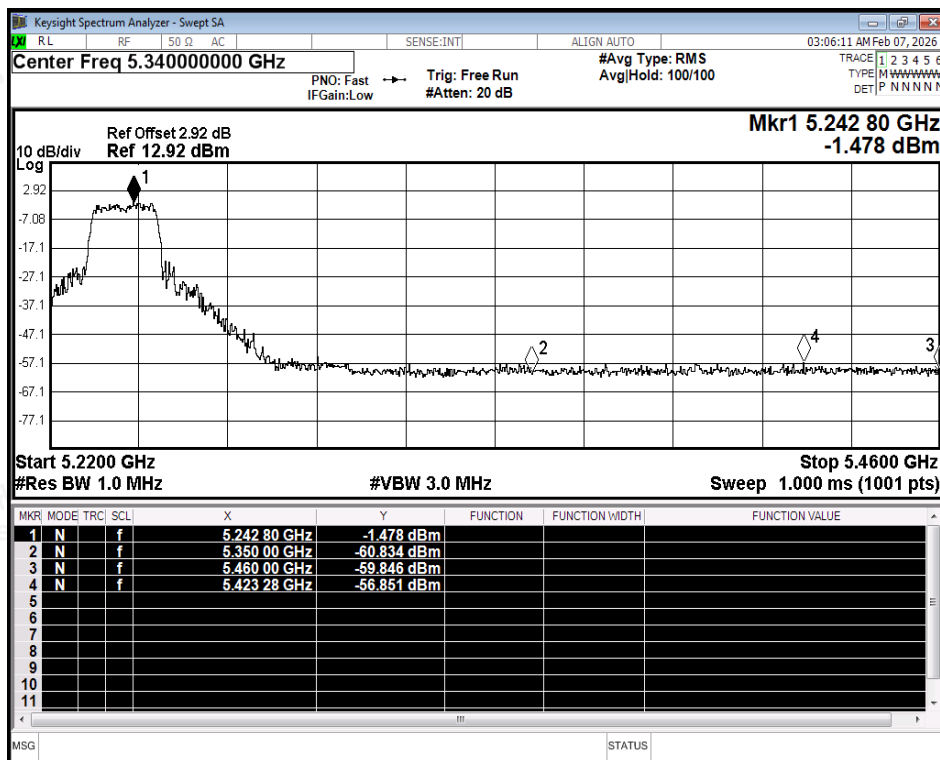

Restrict Band NVNT n20 5240MHz Ant2 Peak

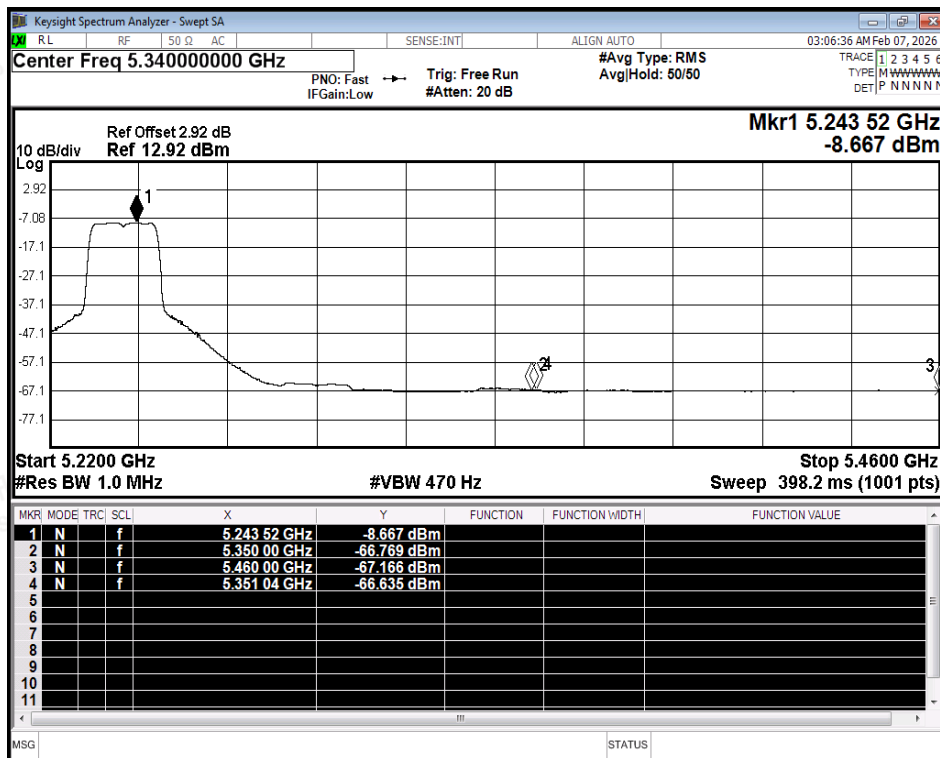

Restrict Band NVNT n20 5240MHz Ant2 Average




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

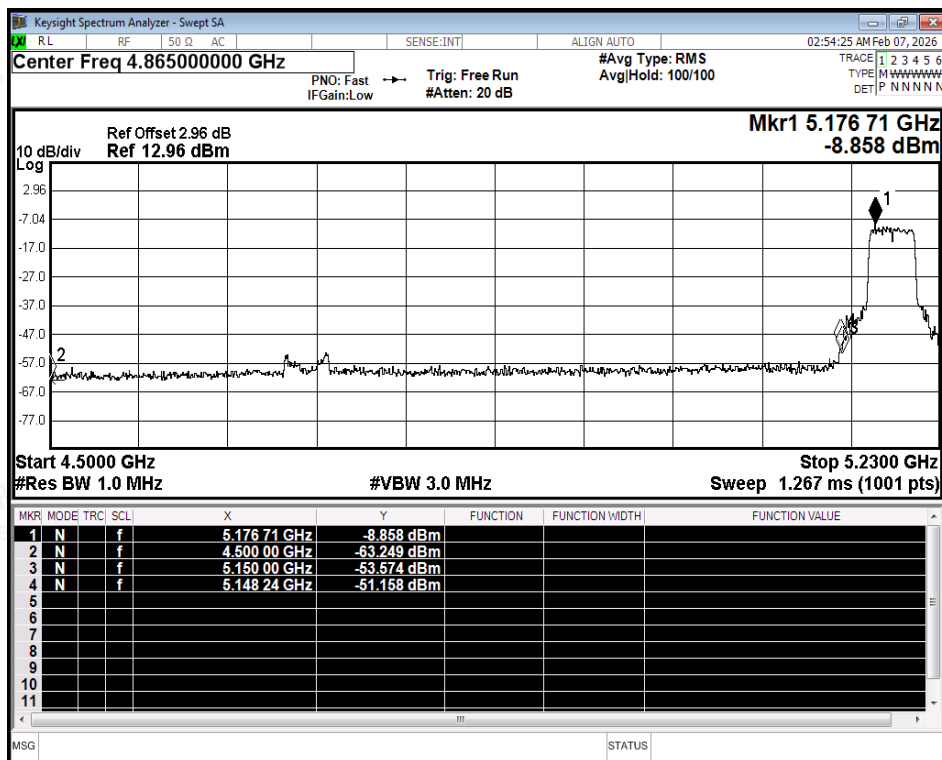

Restrict Band NVNT n40 5190MHz Ant2 Peak

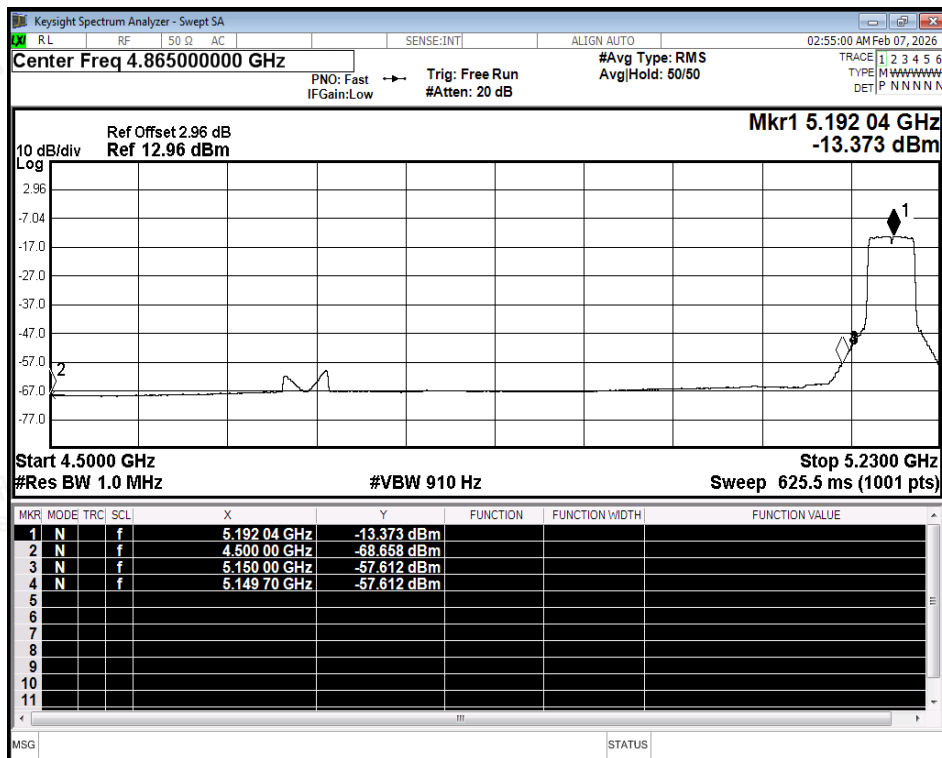

Restrict Band NVNT n40 5190MHz Ant2 Average




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

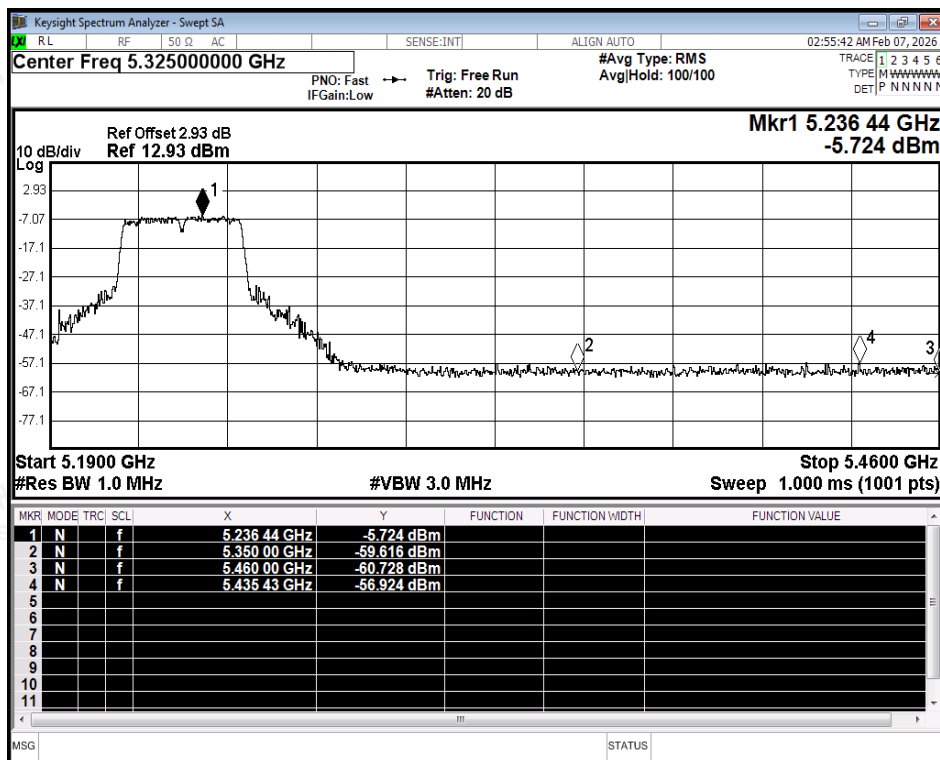

Restrict Band NVNT n40 5230MHz Ant2 Peak

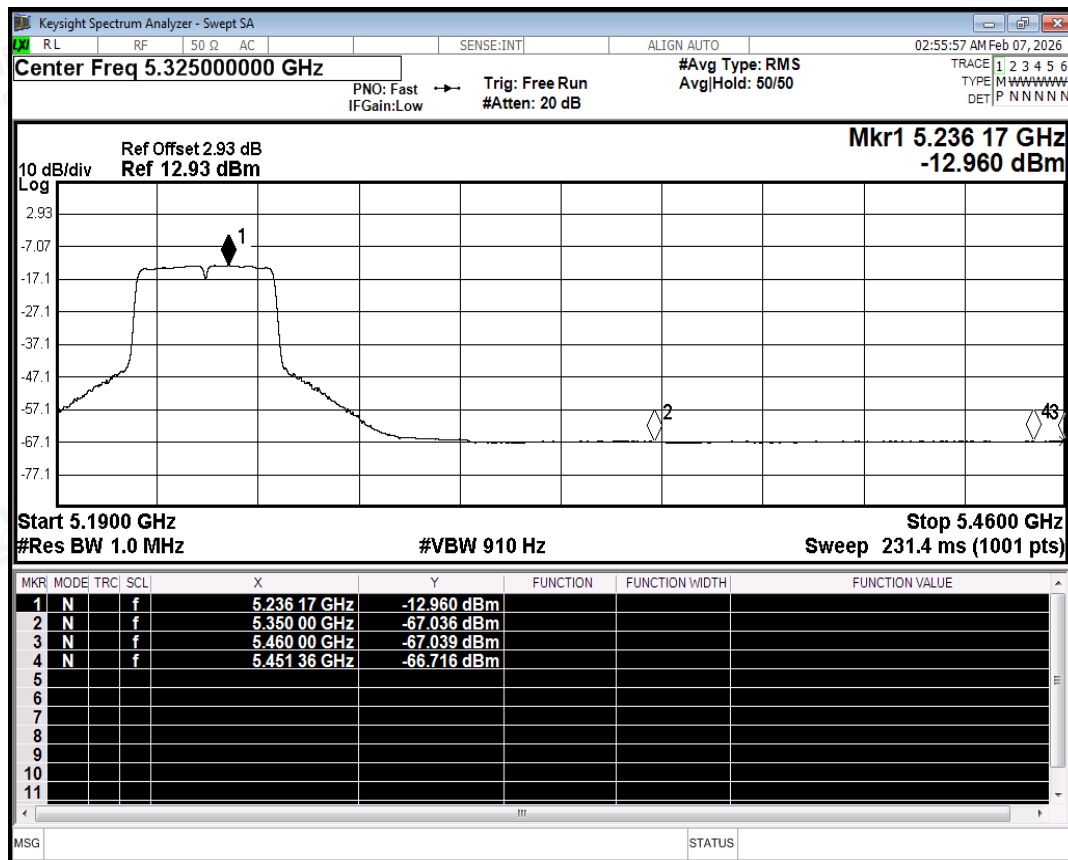

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT n40 5230MHz Ant2 Average

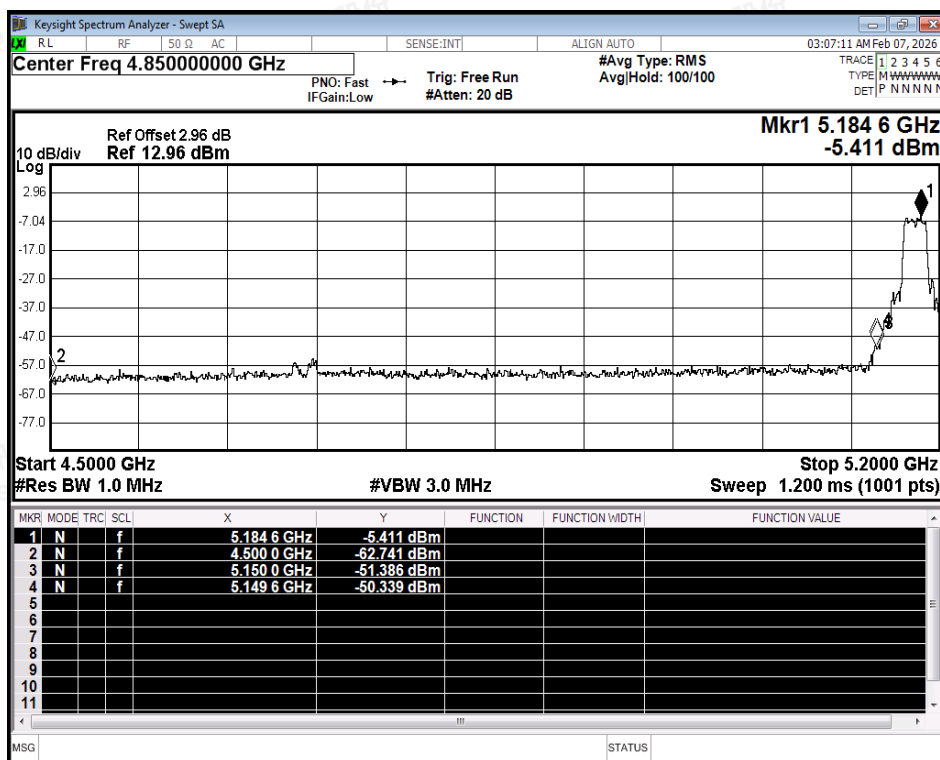

Restrict Band NVNT ac20 5180MHz Ant2 Peak

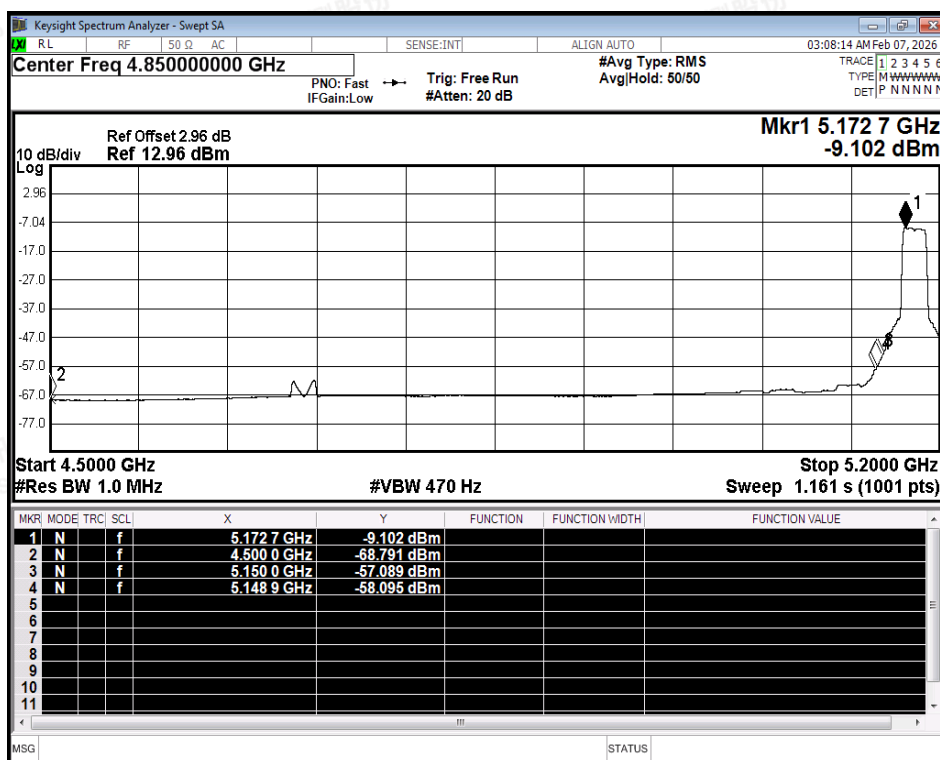

Restrict Band NVNT ac20 5180MHz Ant2 Average




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

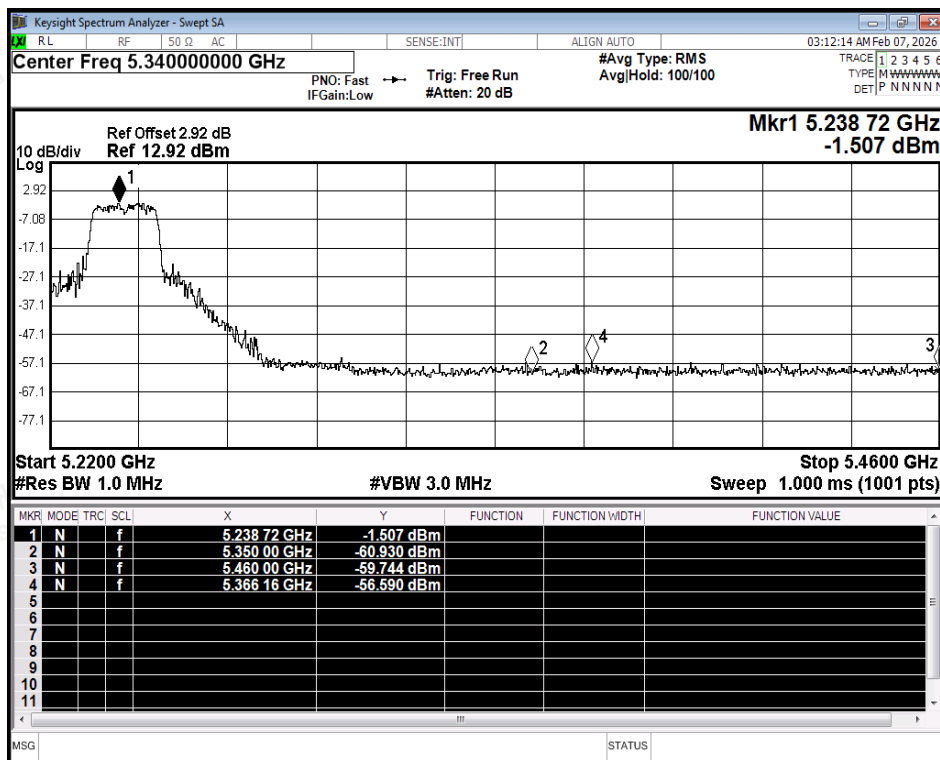

Restrict Band NVNT ac20 5240MHz Ant2 Peak

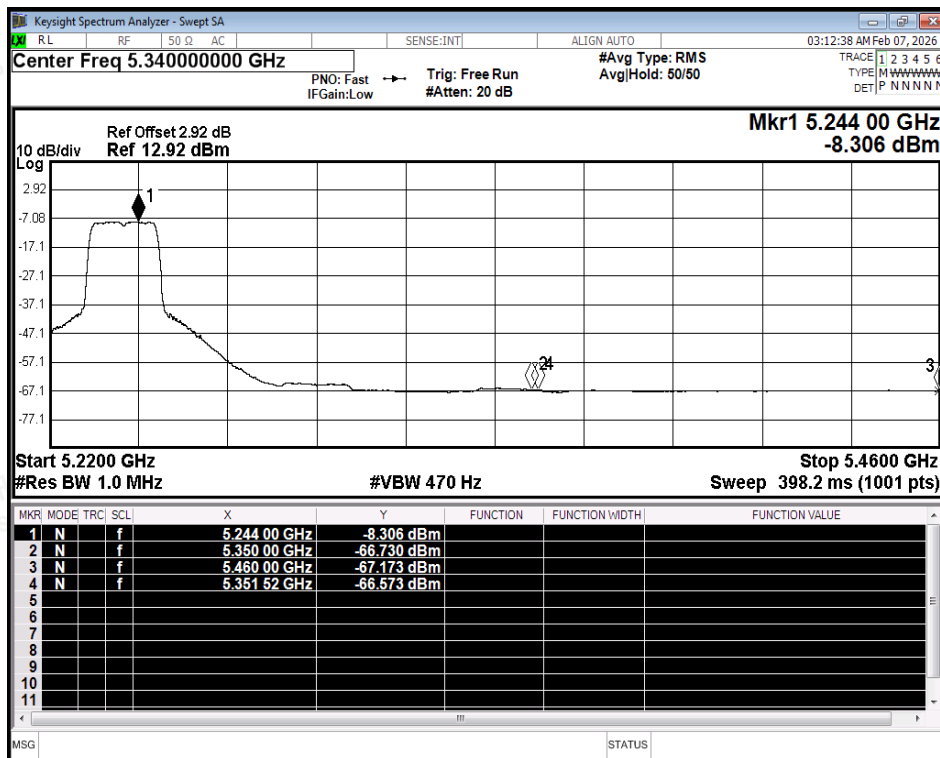

Restrict Band NVNT ac20 5240MHz Ant2 Average




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

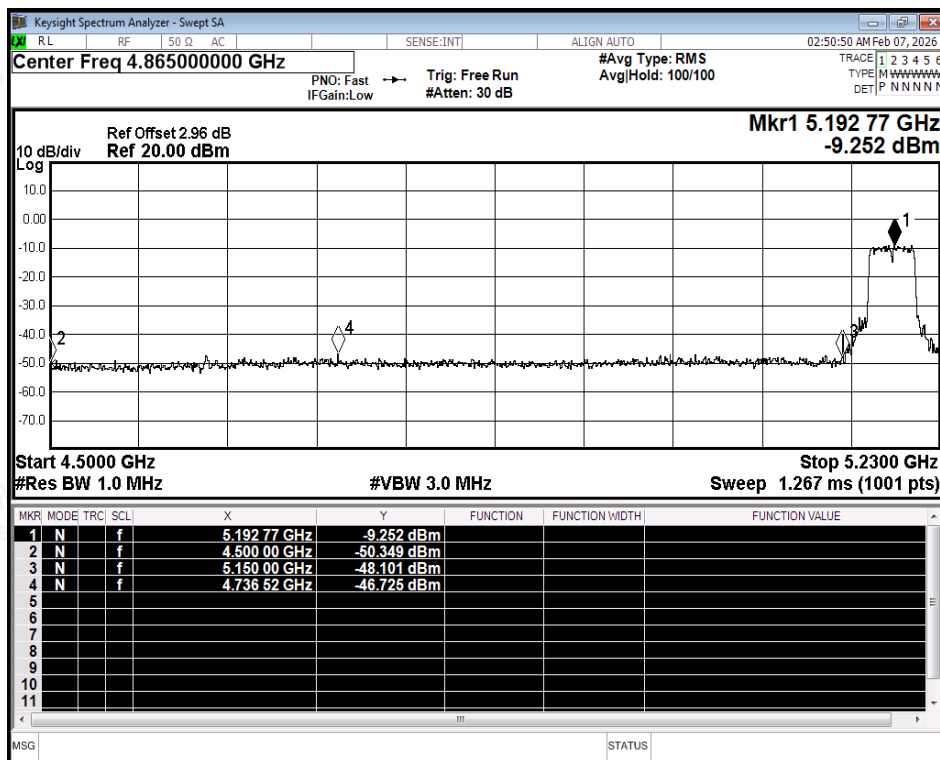

Restrict Band NVNT ac40 5190MHz Ant2 Peak

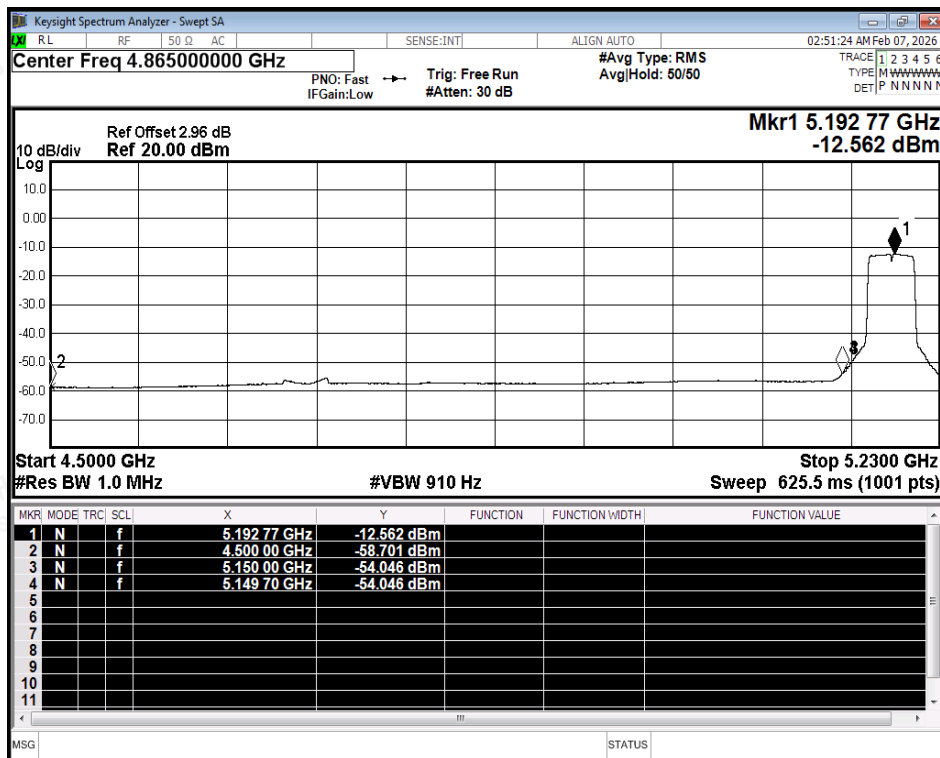

Restrict Band NVNT ac40 5190MHz Ant2 Average




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

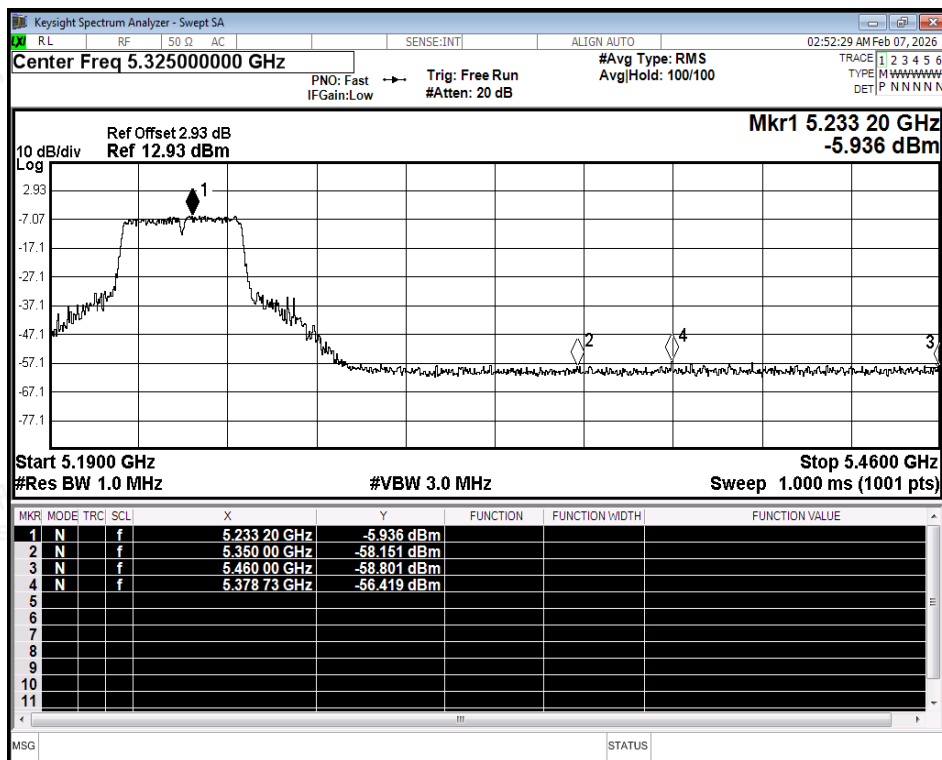

Restrict Band NVNT ac40 5230MHz Ant2 Peak

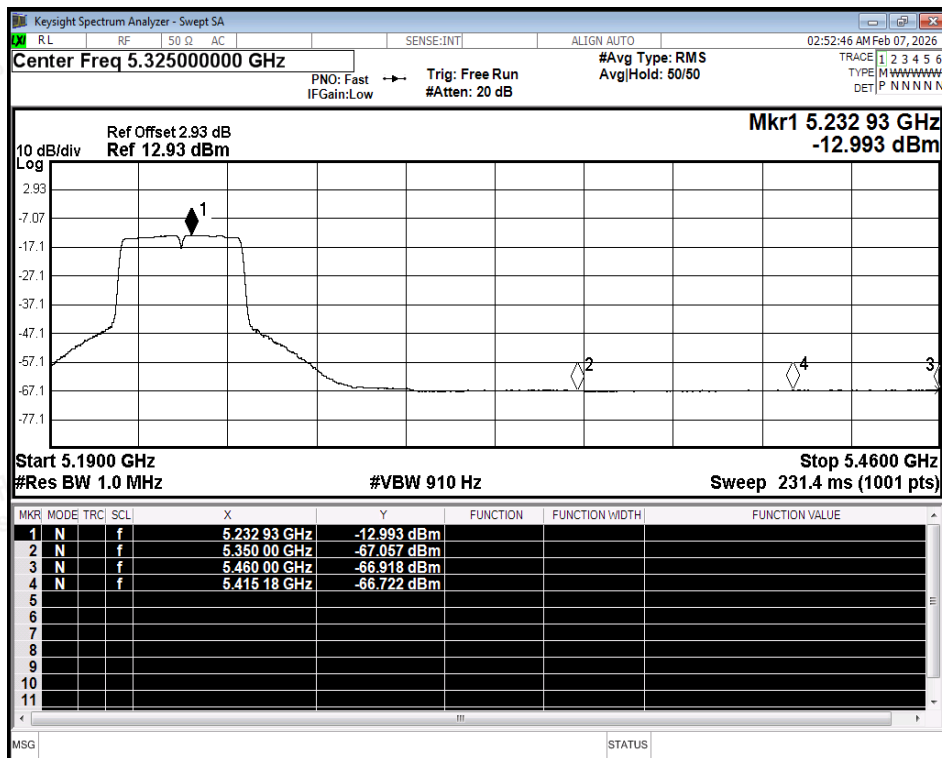

Restrict Band NVNT ac40 5230MHz Ant2 Average




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

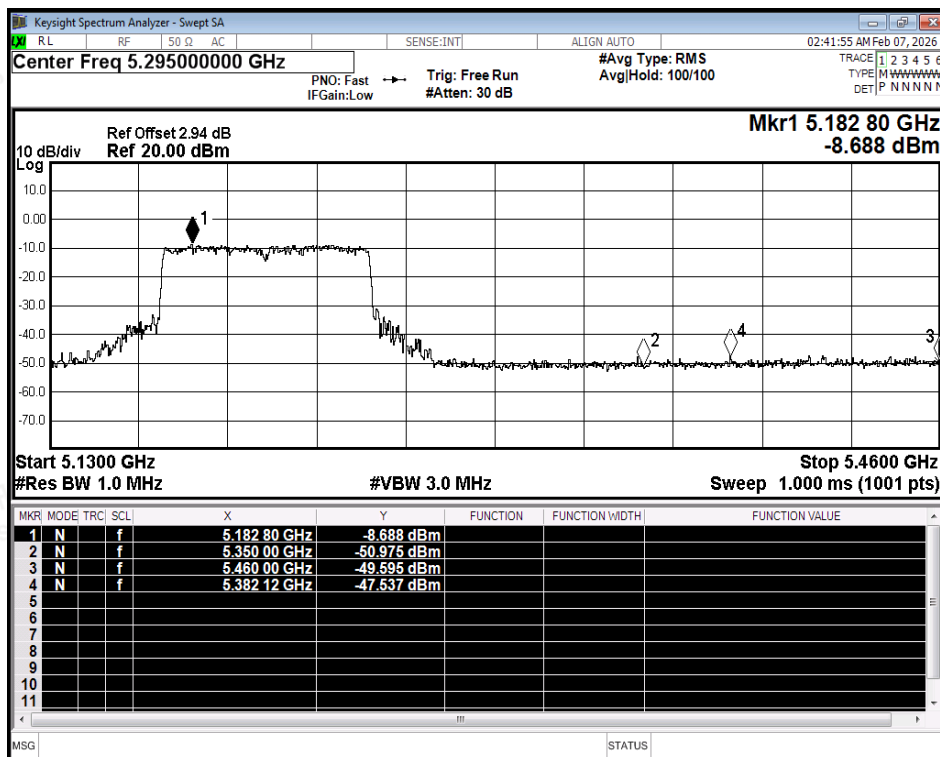

Restrict Band NVNT ac80 5210MHz Ant2 Peak

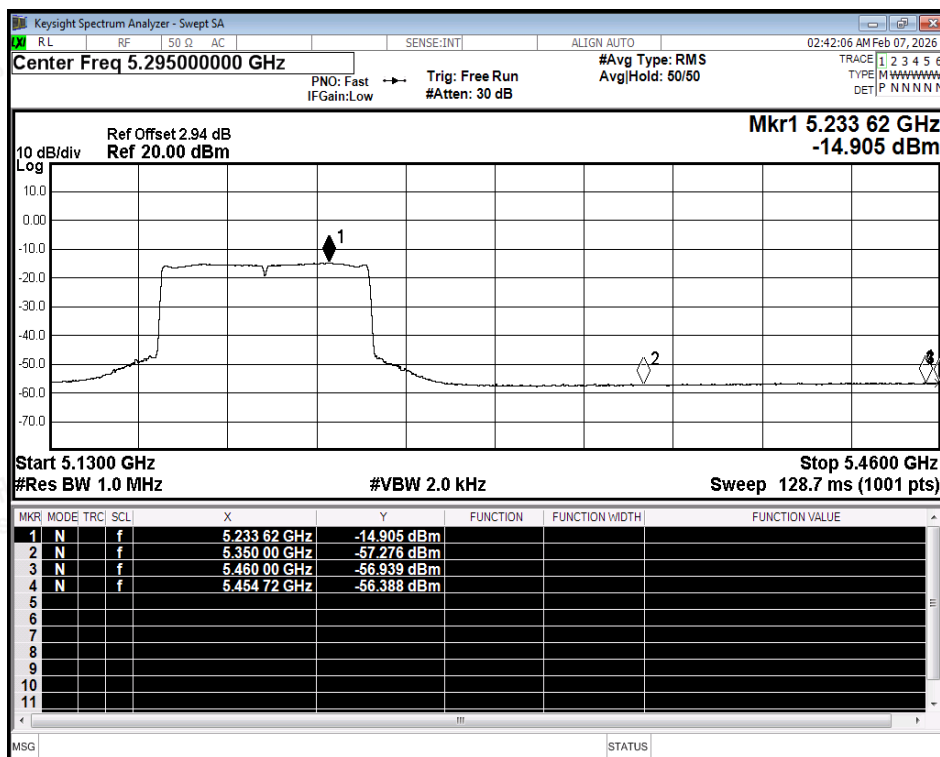

Restrict Band NVNT ac80 5210MHz Ant2 Average




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

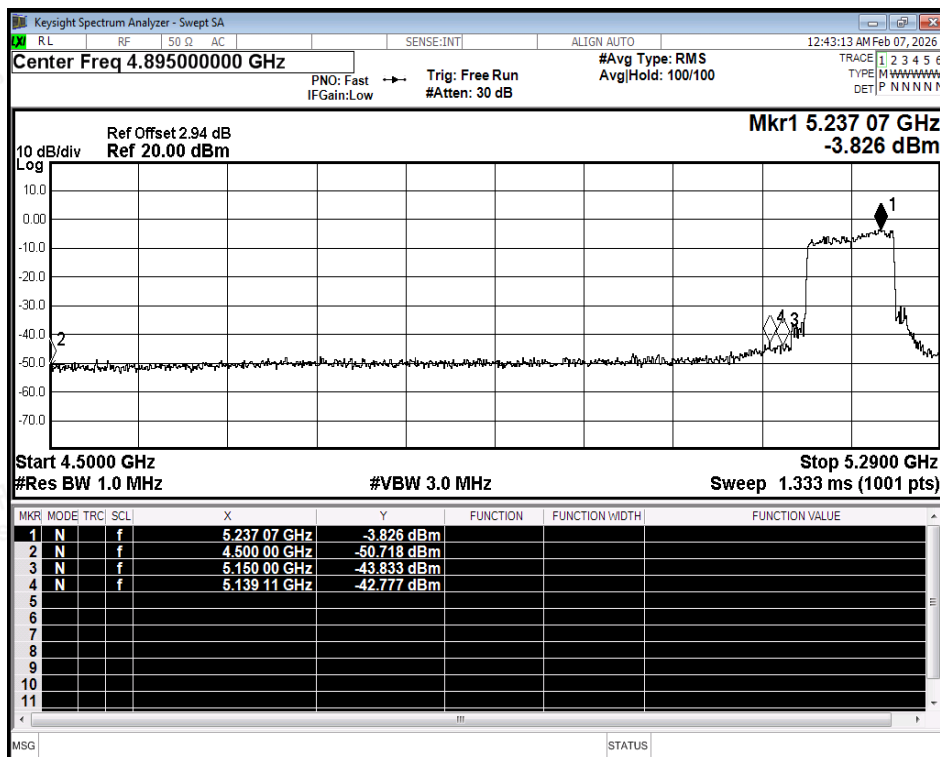

Restrict Band NVNT ac80 5210MHz Ant2 Peak

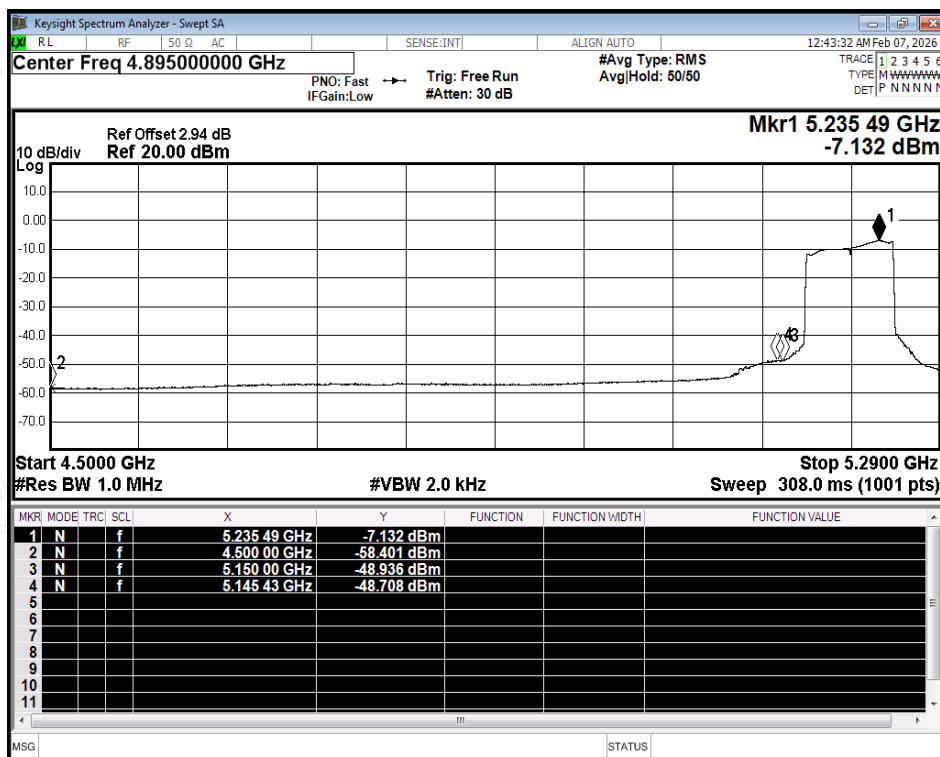

Restrict Band NVNT ac80 5210MHz Ant2 Average




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

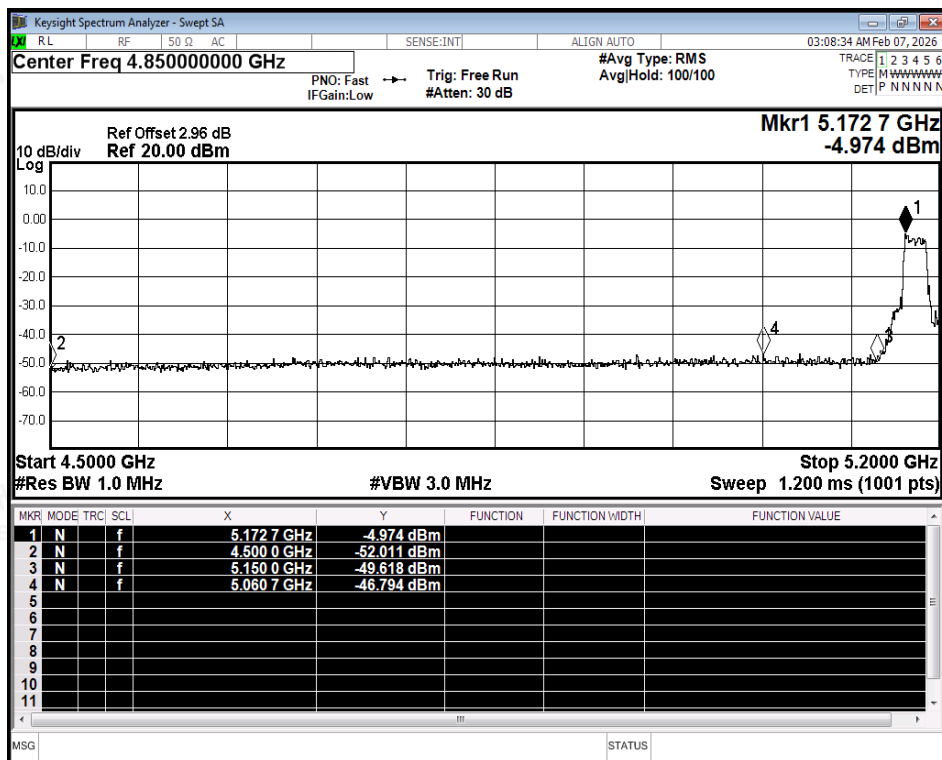

Restrict Band NVNT ax20 5180MHz Ant2 Peak

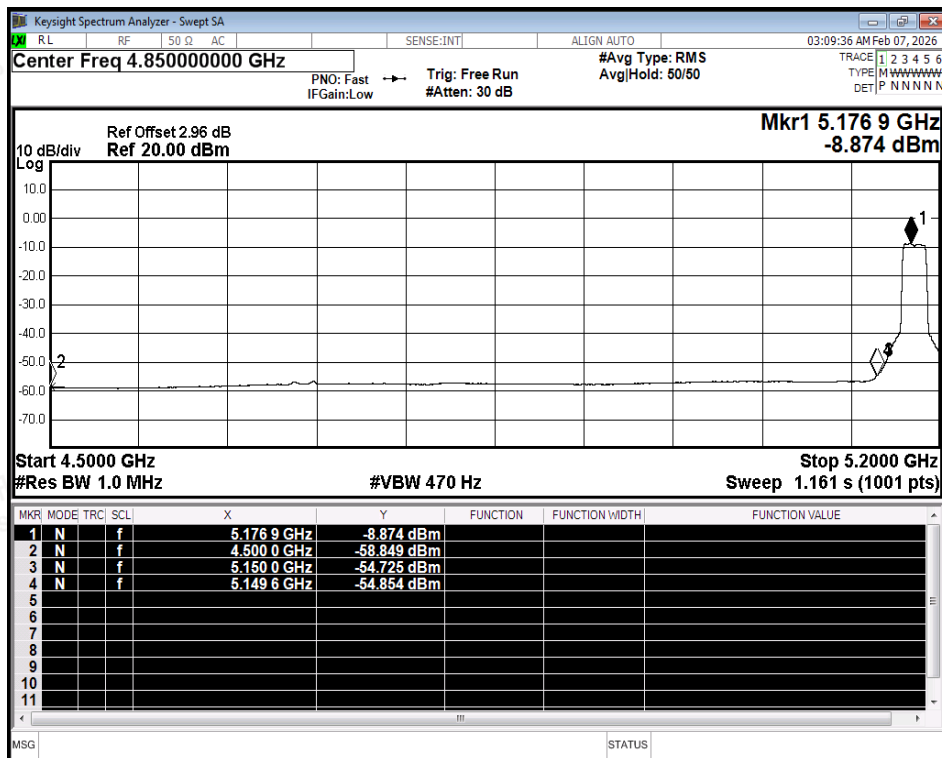

Restrict Band NVNT ax20 5180MHz Ant2 Average




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

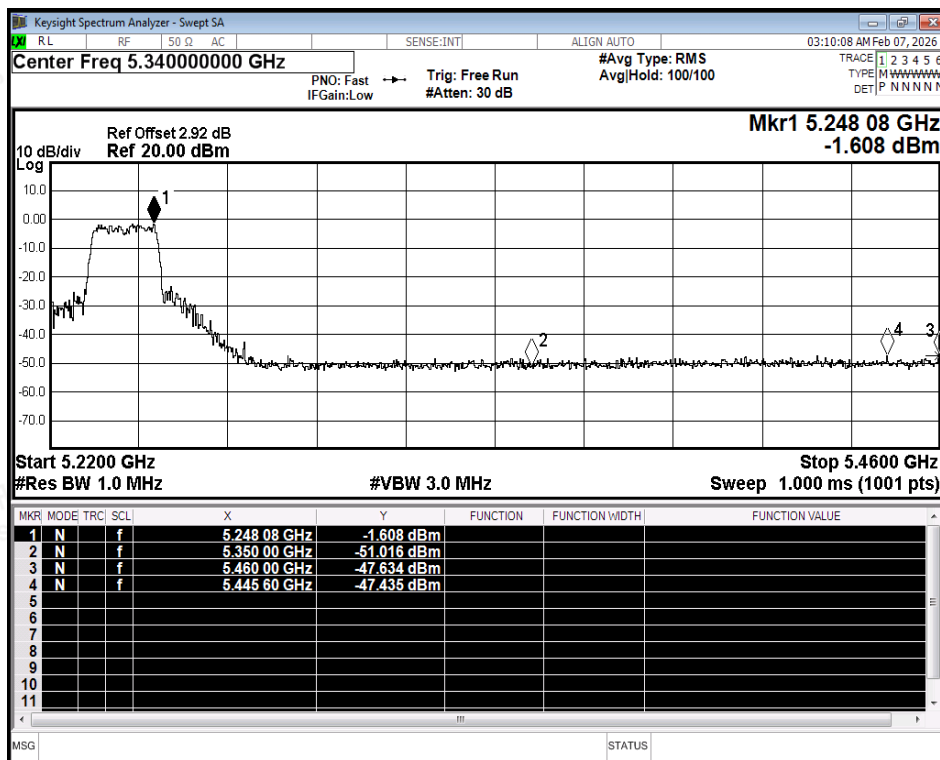

Restrict Band NVNT ax20 5240MHz Ant2 Peak

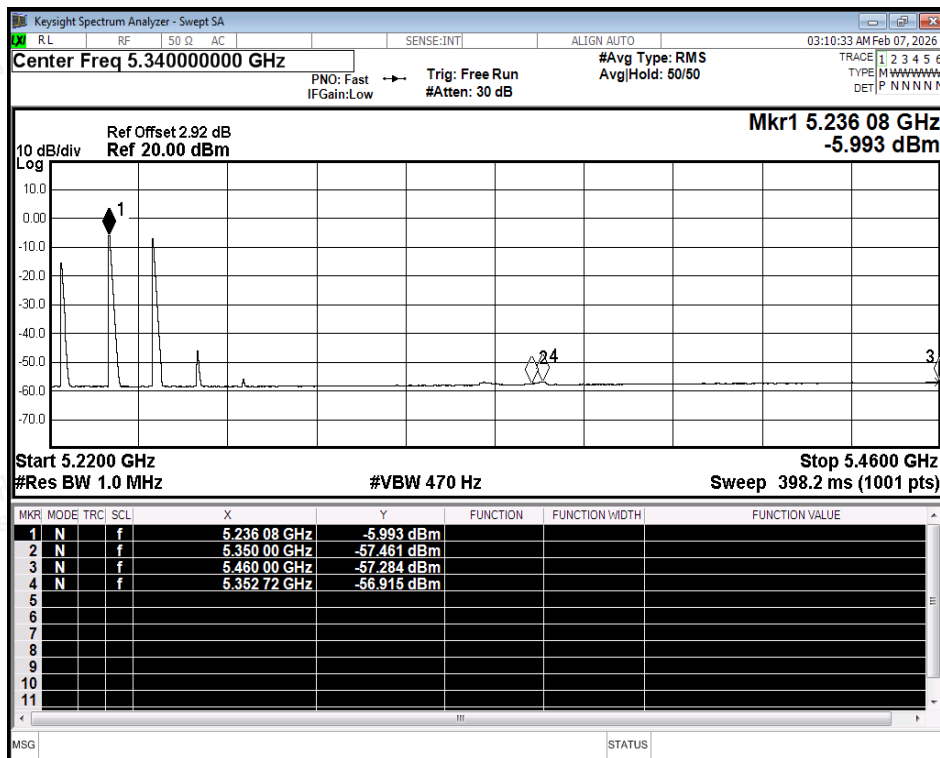

Restrict Band NVNT ax20 5240MHz Ant2 Average




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

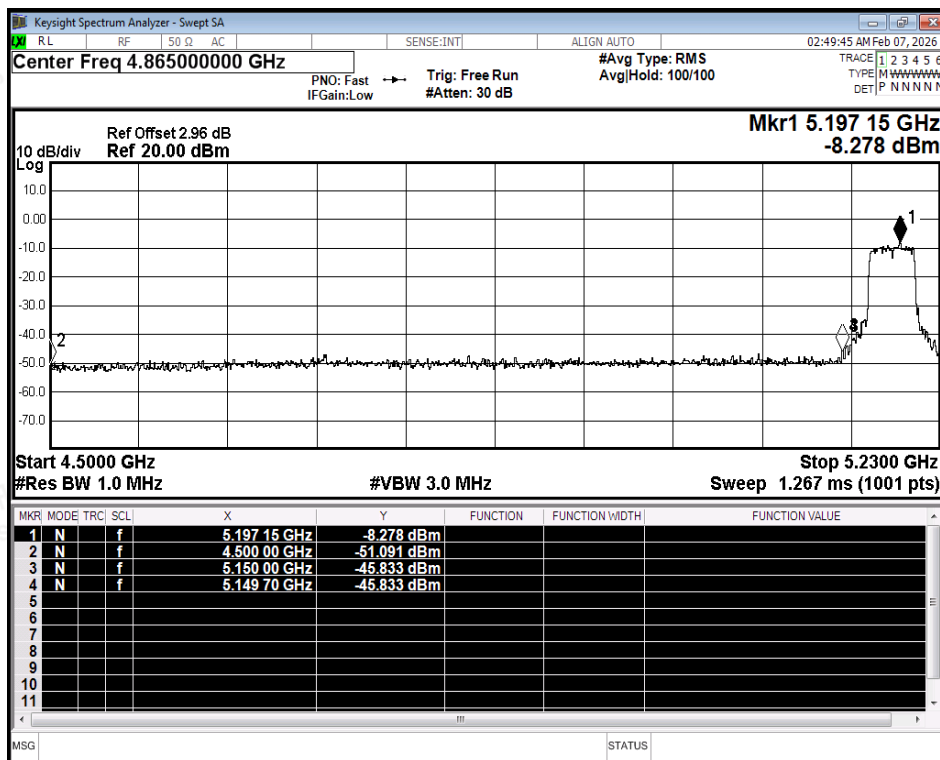

Restrict Band NVNT ax40 5190MHz Ant2 Peak

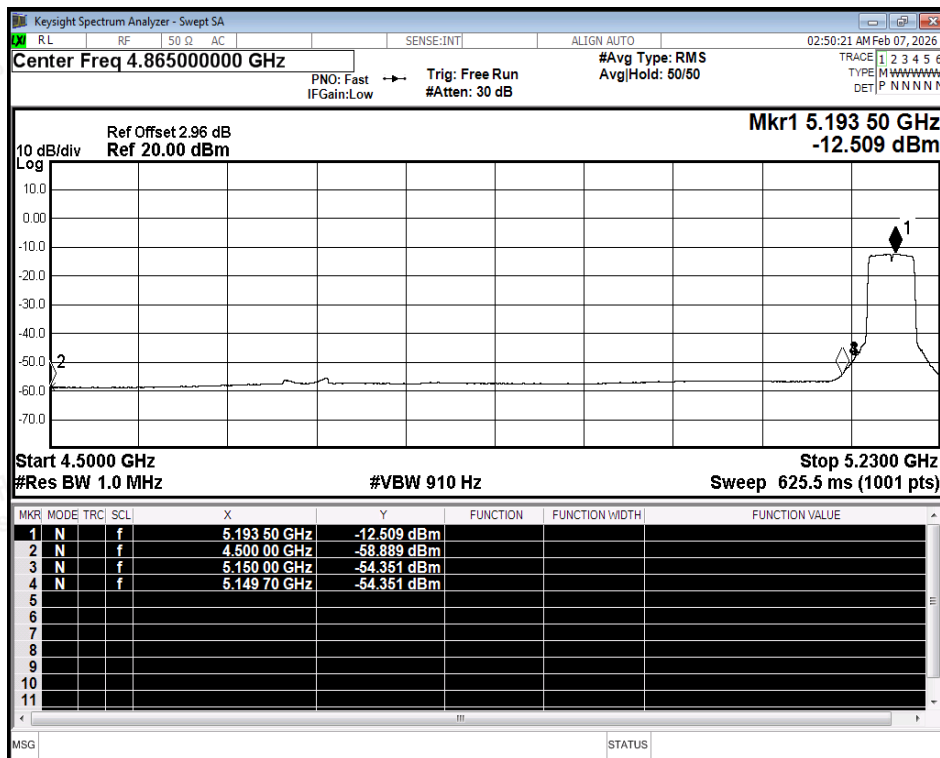

Restrict Band NVNT ax40 5190MHz Ant2 Average




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

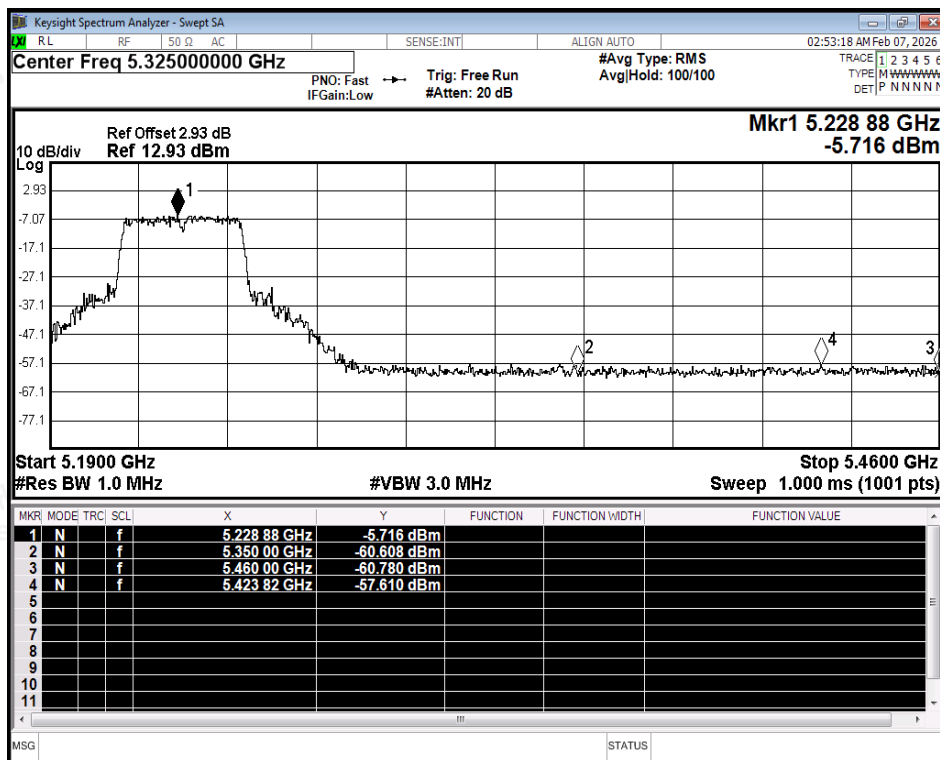

Restrict Band NVNT ax40 5230MHz Ant2 Peak

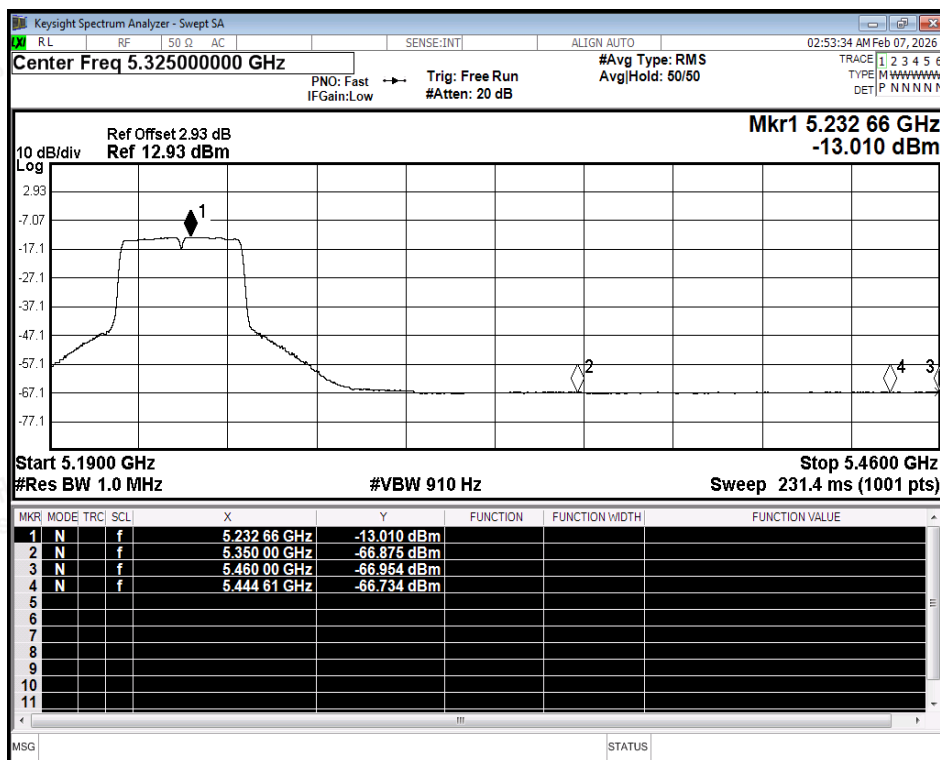

Restrict Band NVNT ax40 5230MHz Ant2 Average




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

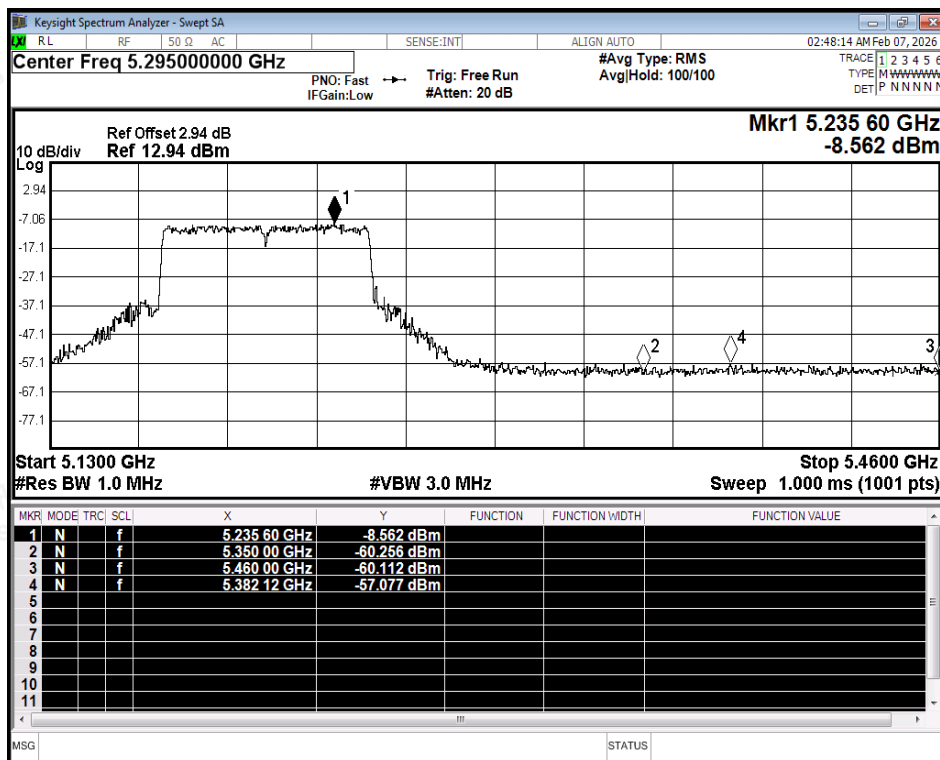

Restrict Band NVNT ax80 5210MHz Ant2 Peak

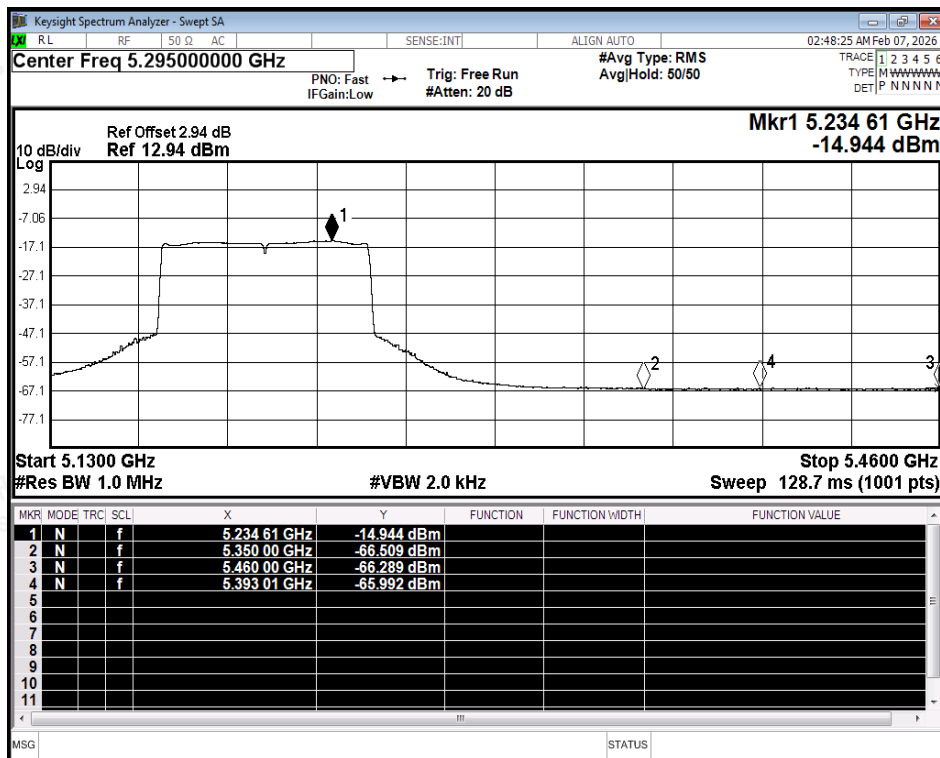

Restrict Band NVNT ax80 5210MHz Ant2 Average




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

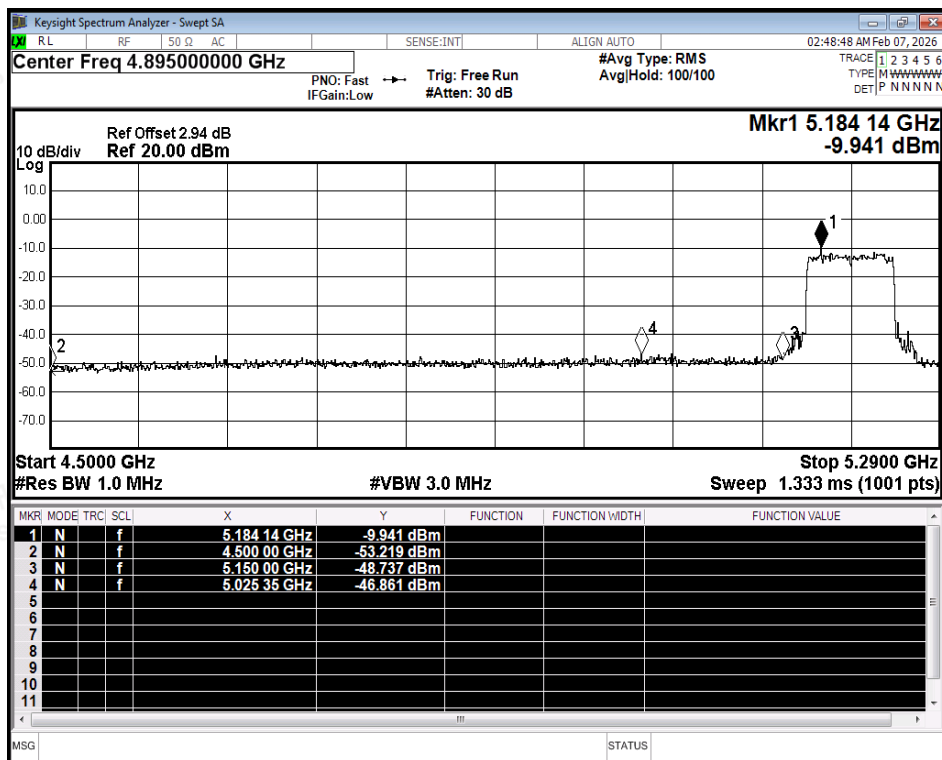

Restrict Band NVNT ax80 5210MHz Ant2 Peak

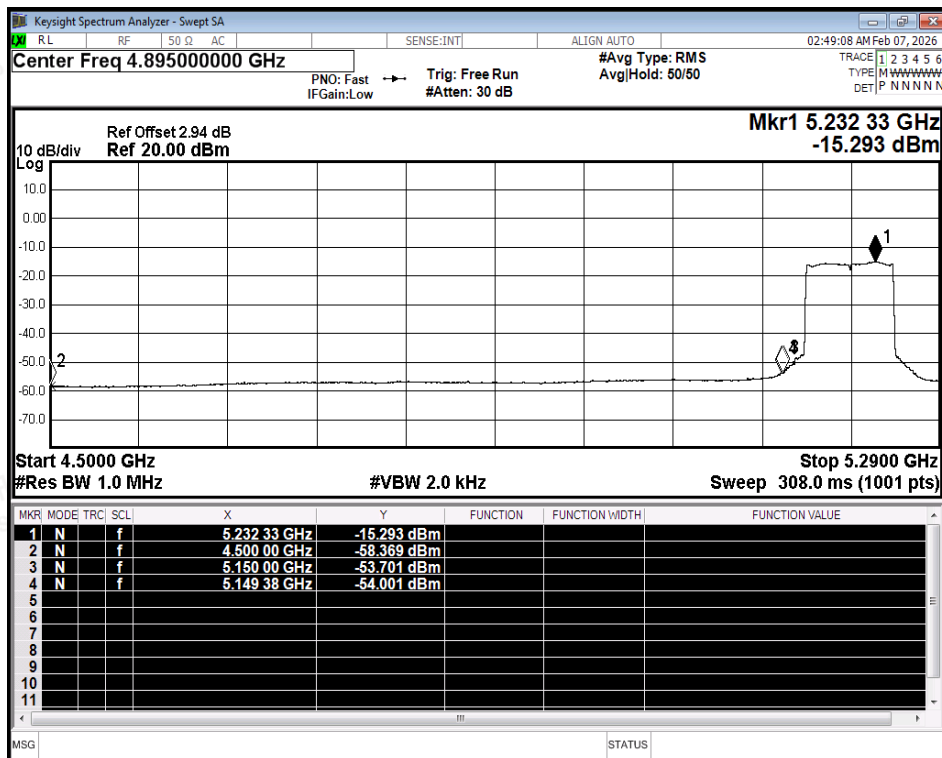

Restrict Band NVNT ax80 5210MHz Ant2 Average



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



MIMO

Condition	Mode	Frequency (MHz)	Spur Freq (MHz)	E (dBuV/m)			Detector	Limit (dBuV/m)	Verdict
				Ant1	Ant2	Ant1+ Ant2			
NVNT	n20	5180	4500	45	35.61	47.54	Peak	68.2	Pass
NVNT	n20	5180	4500	38.54	28.45	40.91	Average	54	Pass
NVNT	n20	5180	5148.2	53.16	46.73	56.55	Peak	68.2	Pass
NVNT	n20	5180	4660.3	46.25	44.11	51.27	Average	54	Pass
NVNT	n20	5180	5150	49.11	46.69	54.00	Peak	68.2	Pass
NVNT	n20	5180	5150	47.8	39.77	50.70	Average	54	Pass
NVNT	n20	5240	5350	47.68	36.4	49.78	Peak	68.2	Pass
NVNT	n20	5240	5350	39.89	30.47	42.42	Average	54	Pass
NVNT	n20	5240	5423.28	49.65	40.38	52.22	Peak	68.2	Pass
NVNT	n20	5240	5351.04	40.36	30.6	42.80	Average	54	Pass
NVNT	n20	5240	5460	45.97	37.39	48.72	Peak	68.2	Pass
NVNT	n20	5240	5460	40.06	30.07	42.45	Average	54	Pass
NVNT	n40	5190	4500	36.25	33.99	41.21	Peak	68.2	Pass
NVNT	n40	5190	4500	28.68	28.58	34.65	Average	54	Pass
NVNT	n40	5190	5148.24	53.22	46.08	56.38	Peak	68.2	Pass
NVNT	n40	5190	5149.7	47.32	39.62	50.32	Average	54	Pass
NVNT	n40	5190	5150	52.85	47	56.43	Peak	68.2	Pass
NVNT	n40	5190	5150	47.02	40.08	50.25	Average	54	Pass
NVNT	n40	5230	5350	47.33	37.62	49.79	Peak	68.2	Pass
NVNT	n40	5230	5350	40.2	30.2	42.59	Average	54	Pass
NVNT	n40	5230	5435.43	49.6	40.31	52.16	Peak	68.2	Pass
NVNT	n40	5230	5451.36	40.9	30.52	43.20	Average	54	Pass
NVNT	n40	5230	5460	47.9	36.51	49.97	Peak	68.2	Pass
NVNT	n40	5230	5460	40.27	30.2	42.64	Average	54	Pass
NVNT	ac20	5180	4500	44.47	34.49	46.86	Peak	68.2	Pass
NVNT	ac20	5180	4500	38.51	28.44	40.88	Average	54	Pass
NVNT	ac20	5180	5149.6	50.53	46.9	54.92	Peak	68.2	Pass
NVNT	ac20	5180	5148.9	46.93	39.14	49.90	Average	54	Pass
NVNT	ac20	5180	5150	52.44	45.85	55.78	Peak	68.2	Pass
NVNT	ac20	5180	5150	47.35	40.15	50.50	Average	54	Pass
NVNT	ac20	5240	5350	46.59	36.31	48.91	Peak	68.2	Pass
NVNT	ac20	5240	5350	39.89	30.5	42.43	Average	54	Pass
NVNT	ac20	5240	5366.16	49.55	40.65	52.21	Peak	68.2	Pass
NVNT	ac20	5240	5351.52	40.38	30.66	42.83	Average	54	Pass
NVNT	ac20	5240	5460	47.73	37.49	50.06	Peak	68.2	Pass
NVNT	ac20	5240	5460	40.09	30.06	42.47	Average	54	Pass
NVNT	ac40	5190	4500	45.84	46.89	52.40	Peak	68.2	Pass



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



NVNT	ac40	5190	4500	38.73	38.53	44.65	Average	54	Pass
NVNT	ac40	5190	4736.52	52.7	50.51	57.69	Peak	68.2	Pass
NVNT	ac40	5190	5149.7	48.88	43.19	52.51	Average	54	Pass
NVNT	ac40	5190	5150	53.56	57.01	61.48	Peak	68.2	Pass
NVNT	ac40	5190	5150	48.98	43.3	52.62	Average	54	Pass
NVNT	ac40	5230	5350	46.81	39.08	49.80	Peak	68.2	Pass
NVNT	ac40	5230	5350	40.19	30.18	42.57	Average	54	Pass
NVNT	ac40	5230	5378.73	49.65	40.82	52.33	Peak	68.2	Pass
NVNT	ac40	5230	5415.18	40.76	30.51	43.09	Average	54	Pass
NVNT	ac40	5230	5460	46.15	38.43	49.14	Peak	68.2	Pass
NVNT	ac40	5230	5460	40.38	30.32	42.75	Average	54	Pass
NVNT	ac80	5210	5350	47.7	46.26	53.03	Peak	68.2	Pass
NVNT	ac80	5210	5350	40.88	39.96	46.45	Average	54	Pass
NVNT	ac80	5210	5382.12	49.98	49.7	55.86	Peak	68.2	Pass
NVNT	ac80	5210	5454.72	41.52	40.85	47.21	Average	54	Pass
NVNT	ac80	5210	5460	47.63	47.64	53.66	Peak	68.2	Pass
NVNT	ac80	5210	5460	41.15	40.3	46.76	Average	54	Pass
NVNT	ac80	5210	4500	44.83	46.52	51.74	Peak	68.2	Pass
NVNT	ac80	5210	4500	39.12	38.83	45.00	Average	54	Pass
NVNT	ac80	5210	5139.11	53.04	54.46	59.80	Peak	68.2	Pass
NVNT	ac80	5210	5145.43	48.56	48.53	53.57	Average	54	Pass
NVNT	ac80	5210	5150	55.7	53.4	60.65	Peak	68.2	Pass
NVNT	ac80	5210	5150	48.3	48.3	53.32	Average	54	Pass
NVNT	ax20	5180	4500	45.7	45.22	51.48	Peak	68.2	Pass
NVNT	ax20	5180	4500	38.59	38.39	44.51	Average	54	Pass
NVNT	ax20	5180	5060.7	52.48	50.44	57.54	Peak	68.2	Pass
NVNT	ax20	5180	5149.6	47.11	42.38	51.08	Average	54	Pass
NVNT	ax20	5180	5150	53.39	47.62	57.00	Peak	68.2	Pass
NVNT	ax20	5180	5150	47.23	42.51	51.21	Average	54	Pass
NVNT	ax20	5240	5350	48.75	46.22	53.60	Peak	68.2	Pass
NVNT	ax20	5240	5350	40.24	39.77	46.03	Average	54	Pass
NVNT	ax20	5240	5445.6	49.63	49.8	55.74	Peak	68.2	Pass
NVNT	ax20	5240	5352.72	40.47	40.32	46.42	Average	54	Pass
NVNT	ax20	5240	5460	46.37	49.6	54.15	Peak	68.2	Pass
NVNT	ax20	5240	5460	40.06	39.95	46.03	Average	54	Pass
NVNT	ax40	5190	4500	46.82	46.14	52.51	Peak	68.2	Pass
NVNT	ax40	5190	4500	38.62	38.35	44.51	Average	54	Pass
NVNT	ax40	5190	5149.7	53.76	51.4	58.68	Peak	68.2	Pass
NVNT	ax40	5190	5149.7	48.95	42.88	52.46	Average	54	Pass
NVNT	ax40	5190	5150	52.77	52.18	58.50	Peak	68.2	Pass
NVNT	ax40	5190	5150	48.94	43.34	52.60	Average	54	Pass



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



NVNT	ax40	5230	5350	46.37	36.63	48.82	Peak	68.2	Pass
NVNT	ax40	5230	5350	40.08	30.36	42.53	Average	54	Pass
NVNT	ax40	5230	5423.82	49.57	39.63	51.97	Peak	68.2	Pass
NVNT	ax40	5230	5444.61	40.74	30.5	43.07	Average	54	Pass
NVNT	ax40	5230	5460	46	36.46	48.50	Peak	68.2	Pass
NVNT	ax40	5230	5460	40.24	30.28	42.64	Average	54	Pass
NVNT	ax80	5210	5350	47.47	36.98	49.74	Peak	68.2	Pass
NVNT	ax80	5210	5350	40.74	30.73	43.12	Average	54	Pass
NVNT	ax80	5210	5382.12	50.35	40.16	52.69	Peak	68.2	Pass
NVNT	ax80	5210	5393.01	41.37	31.24	43.73	Average	54	Pass
NVNT	ax80	5210	5460	46.93	37.12	49.36	Peak	68.2	Pass
NVNT	ax80	5210	5460	40.66	30.95	43.12	Average	54	Pass
NVNT	ax80	5210	4500	45.01	44.02	50.55	Peak	68.2	Pass
NVNT	ax80	5210	4500	39.01	38.87	44.96	Average	54	Pass
NVNT	ax80	5210	5025.35	54	50.37	58.39	Peak	68.2	Pass
NVNT	ax80	5210	5149.38	49.11	43.23	52.68	Average	54	Pass
NVNT	ax80	5210	5150	54.02	48.5	57.71	Peak	68.2	Pass
NVNT	ax80	5210	5150	48.49	43.53	52.38	Average	54	Pass



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity




A.5 Frequency Stability

Condition	Mode	Frequency (MHz)	Antenna	Measured Frequency (MHz)	Frequency Error (Hz)	Deviation (ppm)	Limit (ppm)	Verdict
NVNT	a	5180	Ant1	5180	0	0	25	Pass
NVNT	a	5200	Ant1	5199.98	-20000	-3.85	25	Pass
NVNT	a	5240	Ant1	5239.96	-40000	-7.63	25	Pass
NVNT	n20	5180	Ant1	5180	0	0	25	Pass
NVNT	n20	5200	Ant1	5199.98	-20000	-3.85	25	Pass
NVNT	n20	5240	Ant1	5239.98	-20000	-3.82	25	Pass
NVNT	n40	5190	Ant1	5190	0	0	25	Pass
NVNT	n40	5230	Ant1	5230	0	0	25	Pass
NVNT	ac20	5180	Ant1	5179.98	-20000	-3.86	25	Pass
NVNT	ac20	5200	Ant1	5199.98	-20000	-3.85	25	Pass
NVNT	ac20	5240	Ant1	5239.98	-20000	-3.82	25	Pass
NVNT	ac40	5190	Ant1	5190	0	0	25	Pass
NVNT	ac80	5210	Ant1	5210	0	0	25	Pass
NVNT	ax20	5180	Ant1	5180	0	0	25	Pass
NVNT	ax20	5200	Ant1	5199.98	-20000	-3.85	25	Pass
NVNT	ax20	5240	Ant1	5240	0	0	25	Pass
NVNT	ax40	5190	Ant1	5190	0	0	25	Pass
NVNT	ax40	5230	Ant1	5230	0	0	25	Pass
NVNT	ax80	5210	Ant1	5210	0	0	25	Pass



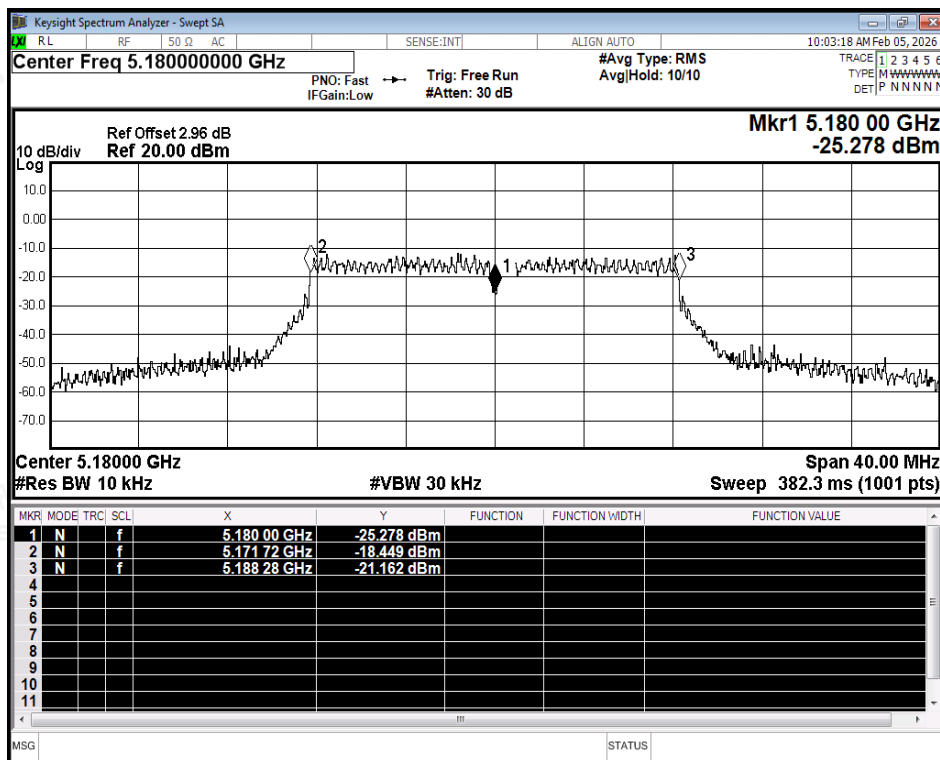

Freq. Stability NVNT a 5180MHz Ant1

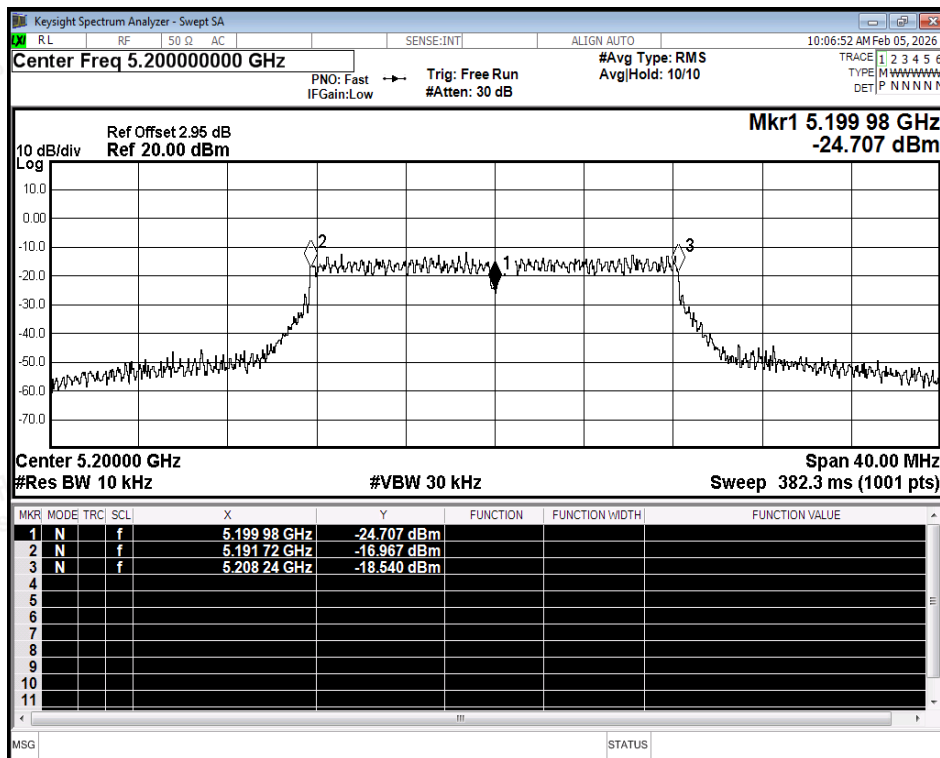

Freq. Stability NVNT a 5200MHz Ant1




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

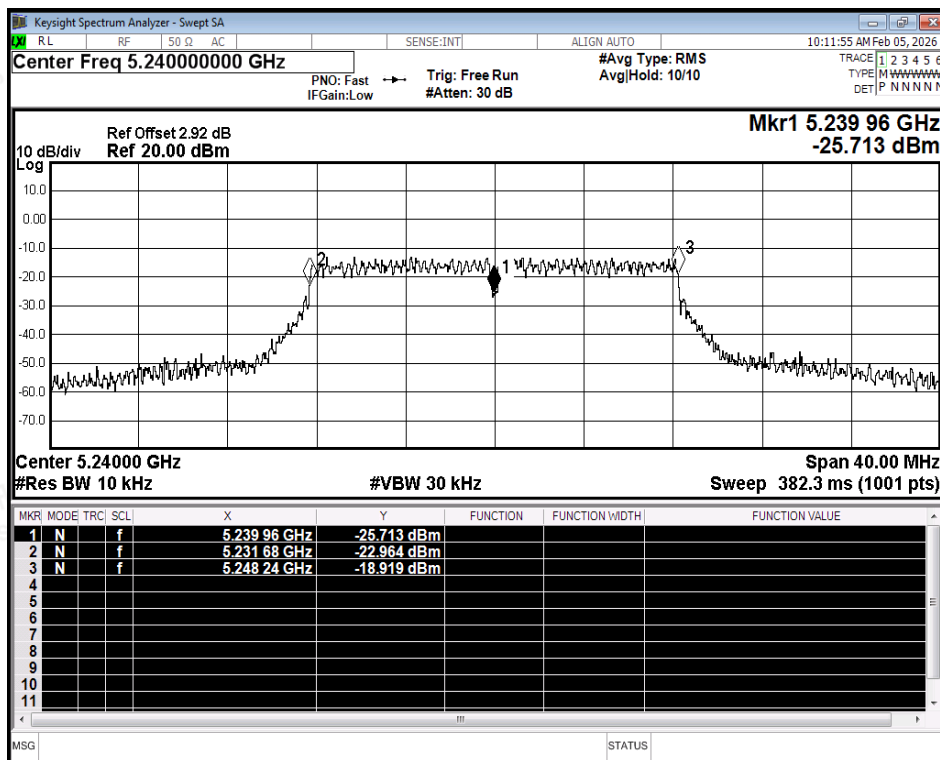

Freq. Stability NVNT a 5240MHz Ant1

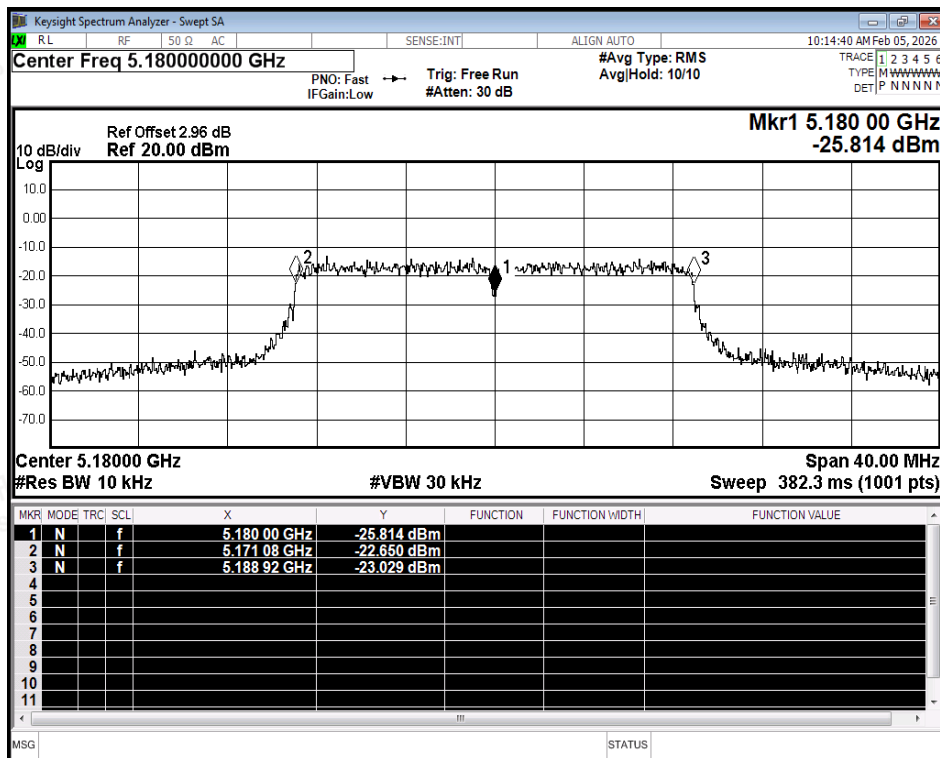

Freq. Stability NVNT n20 5180MHz Ant1




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

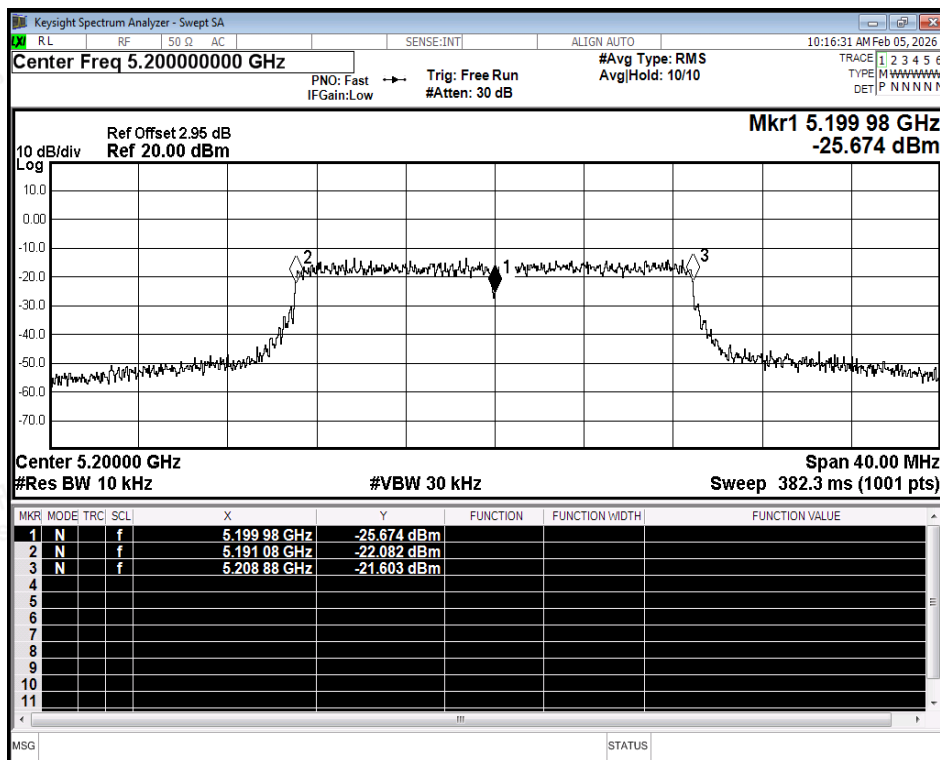

Freq. Stability NVNT n20 5200MHz Ant1

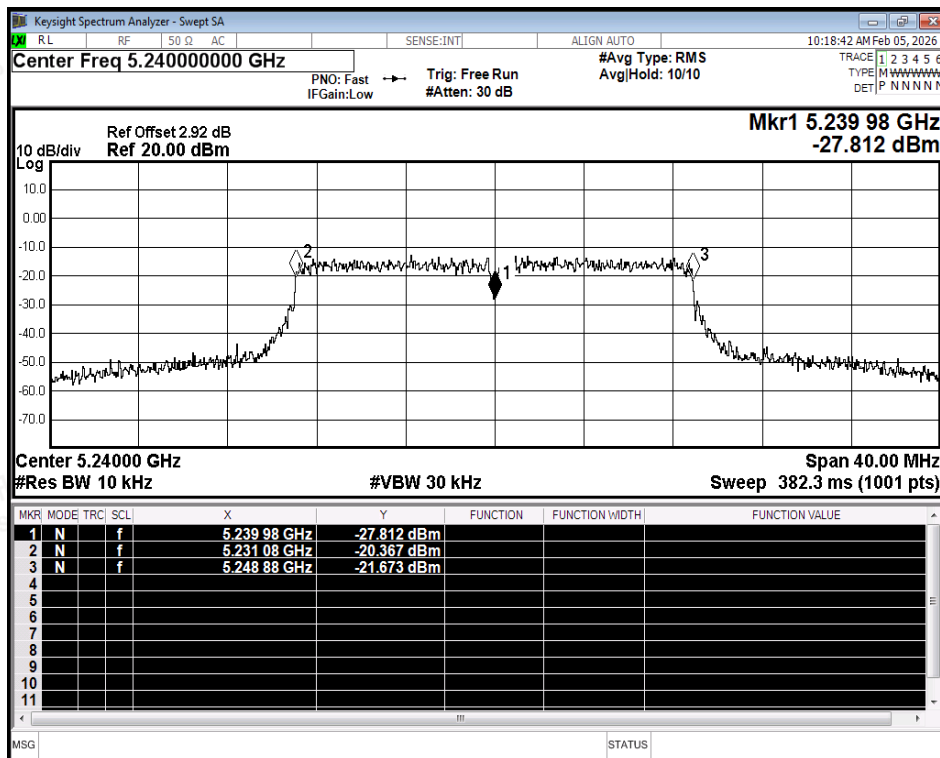

Freq. Stability NVNT n20 5240MHz Ant1




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

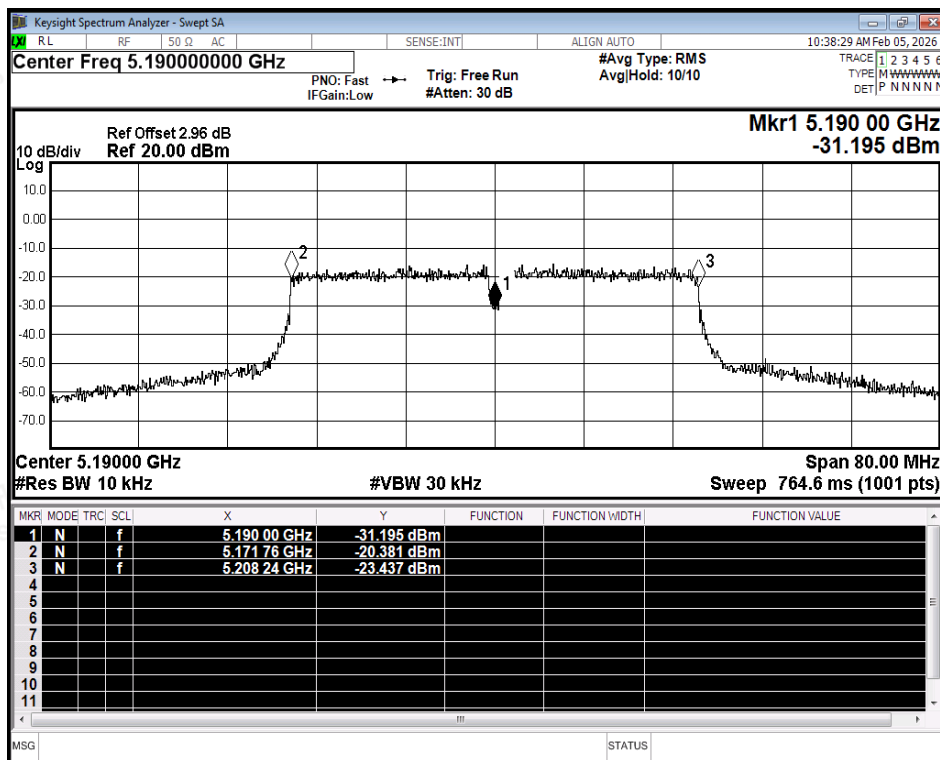

Freq. Stability NVNT n40 5190MHz Ant1

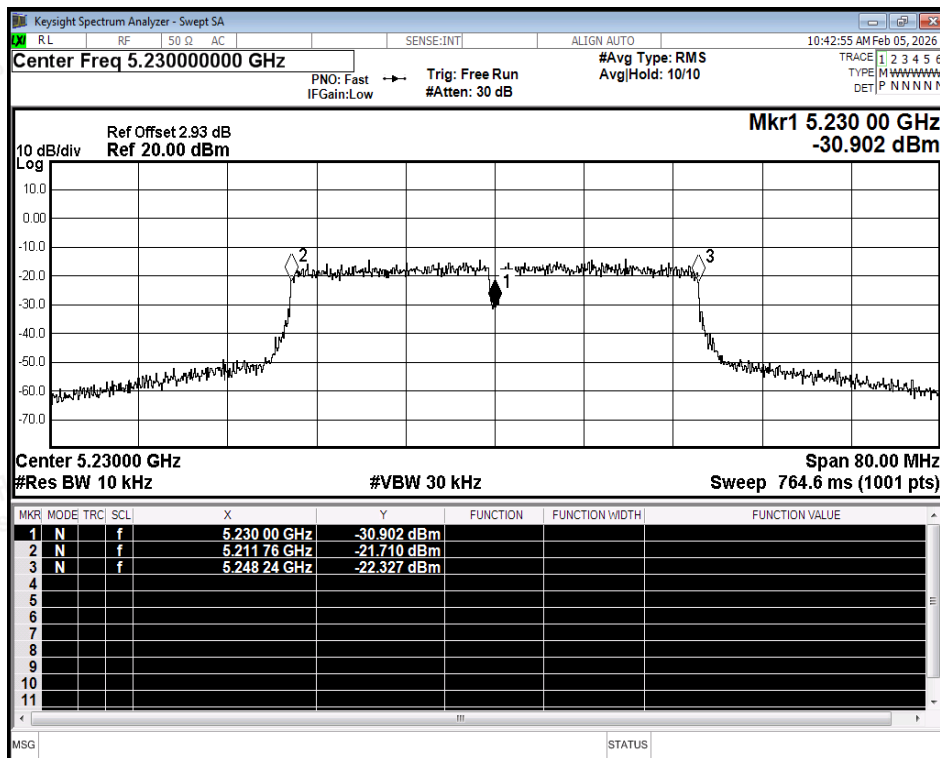

Freq. Stability NVNT n40 5230MHz Ant1




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

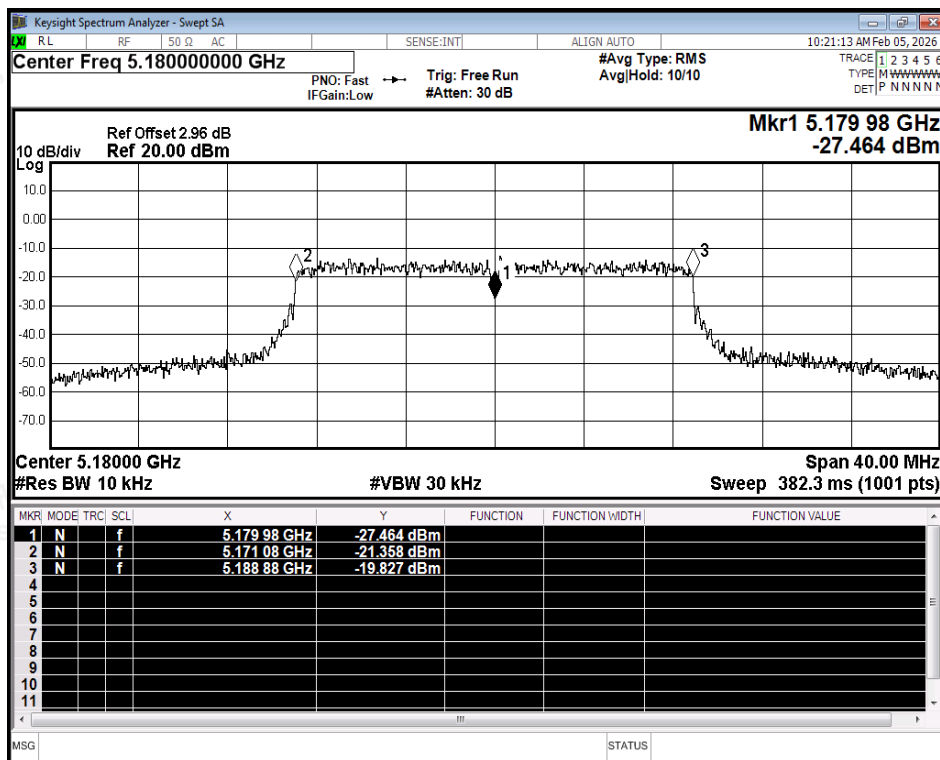

Freq. Stability NVNT ac20 5180MHz Ant1

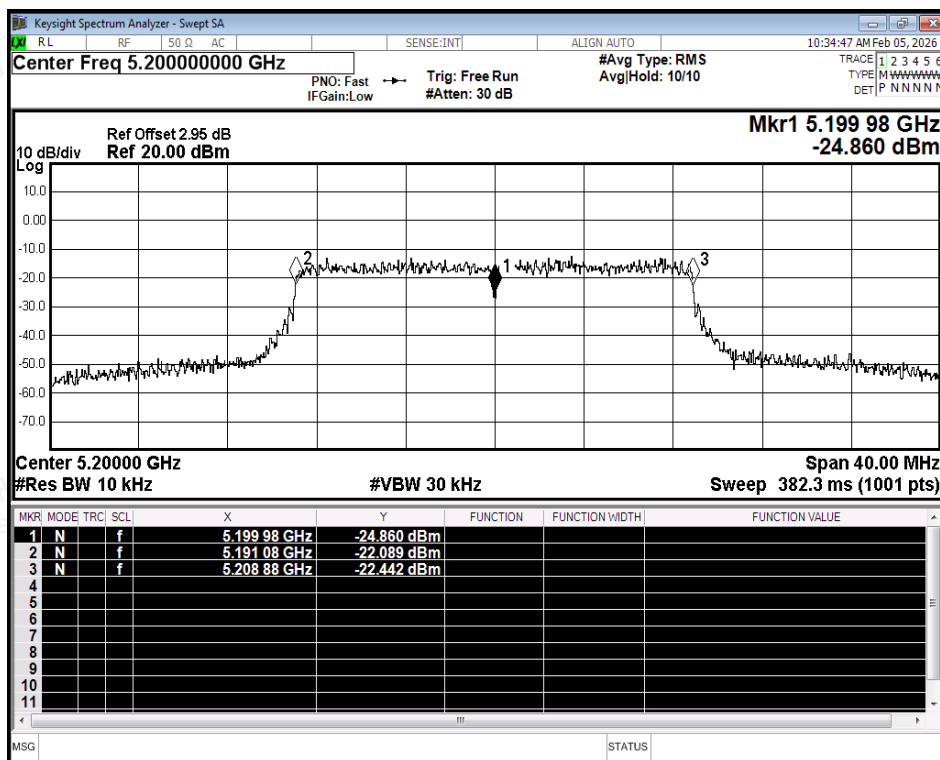

Freq. Stability NVNT ac20 5200MHz Ant1




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

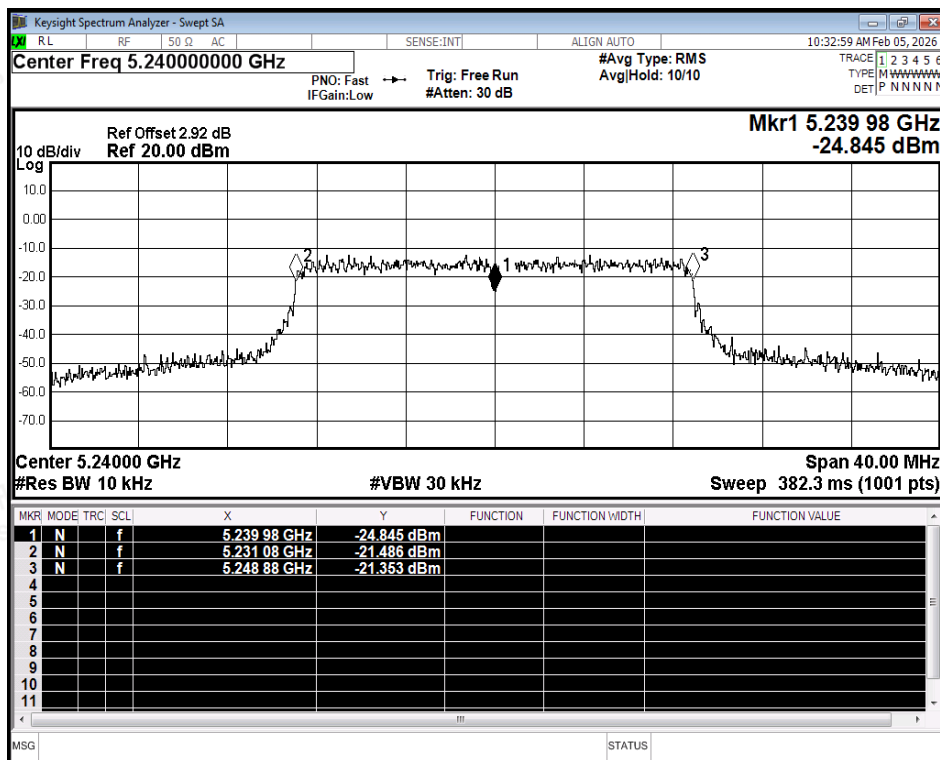

Freq. Stability NVNT ac20 5240MHz Ant1

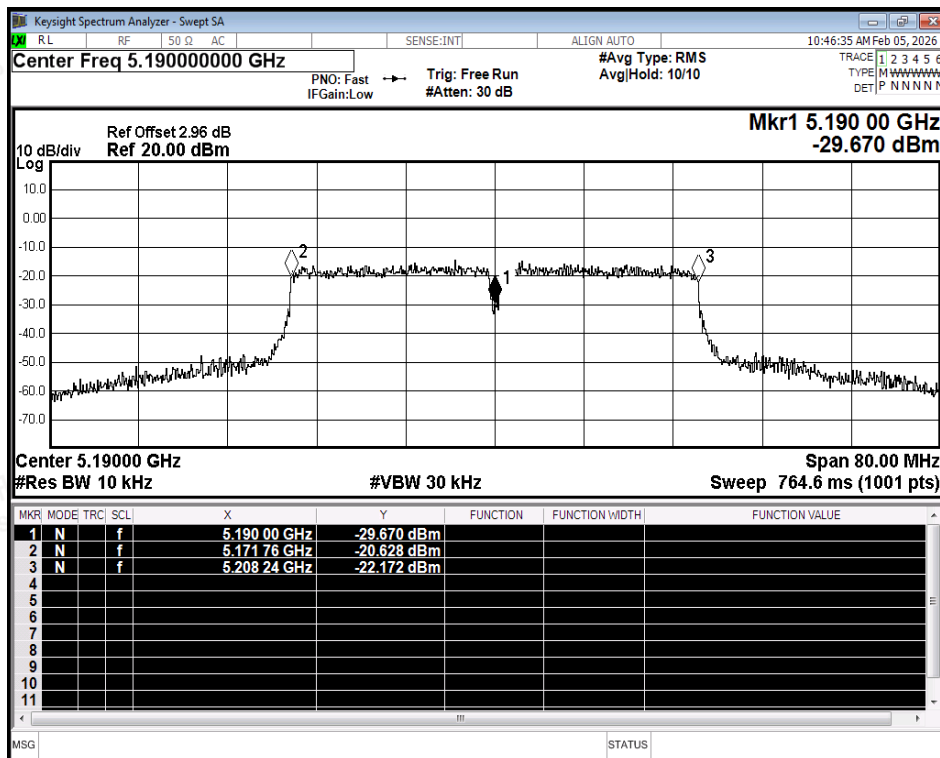

Freq. Stability NVNT ac40 5190MHz Ant1




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

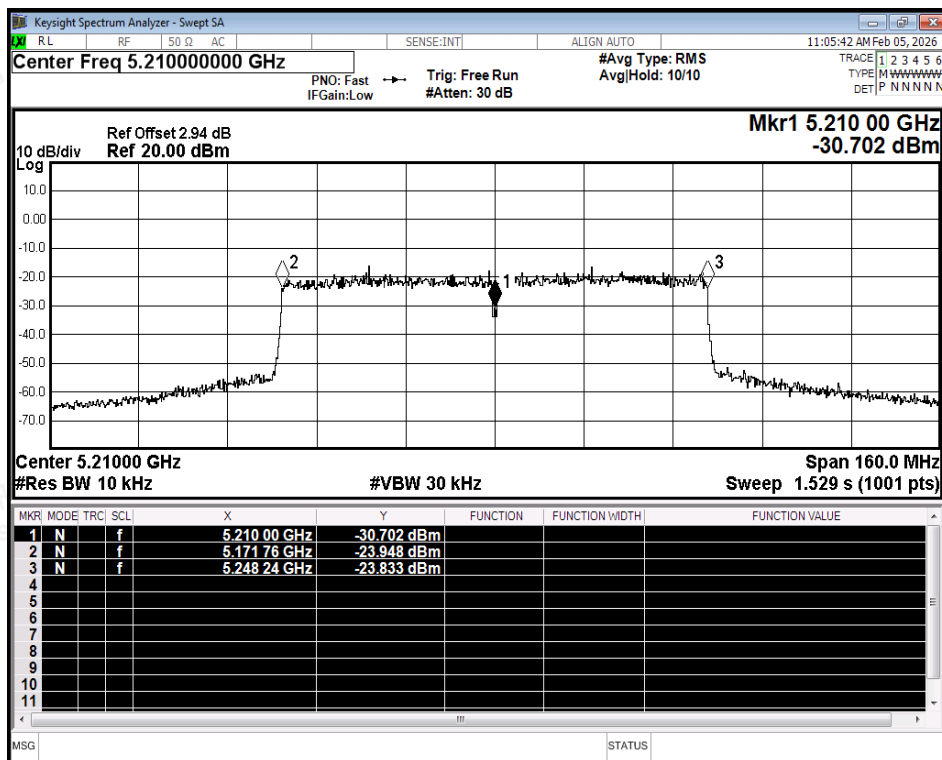


Freq. Stability NVNT ac80 5210MHz Ant1

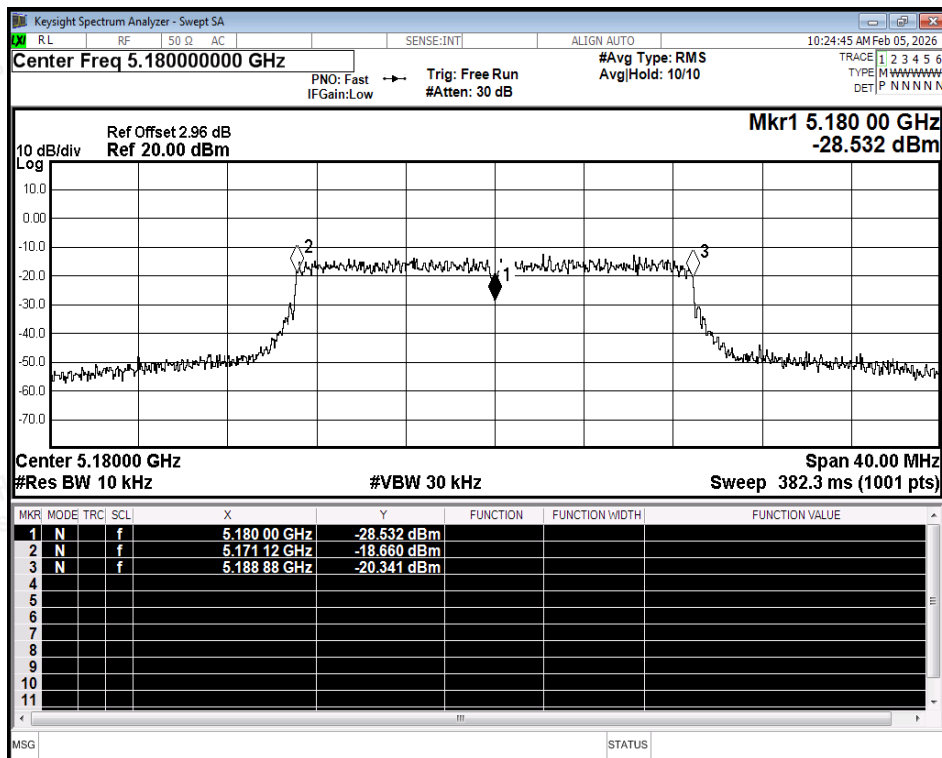


Freq. Stability NVNT ax20 5180MHz Ant1



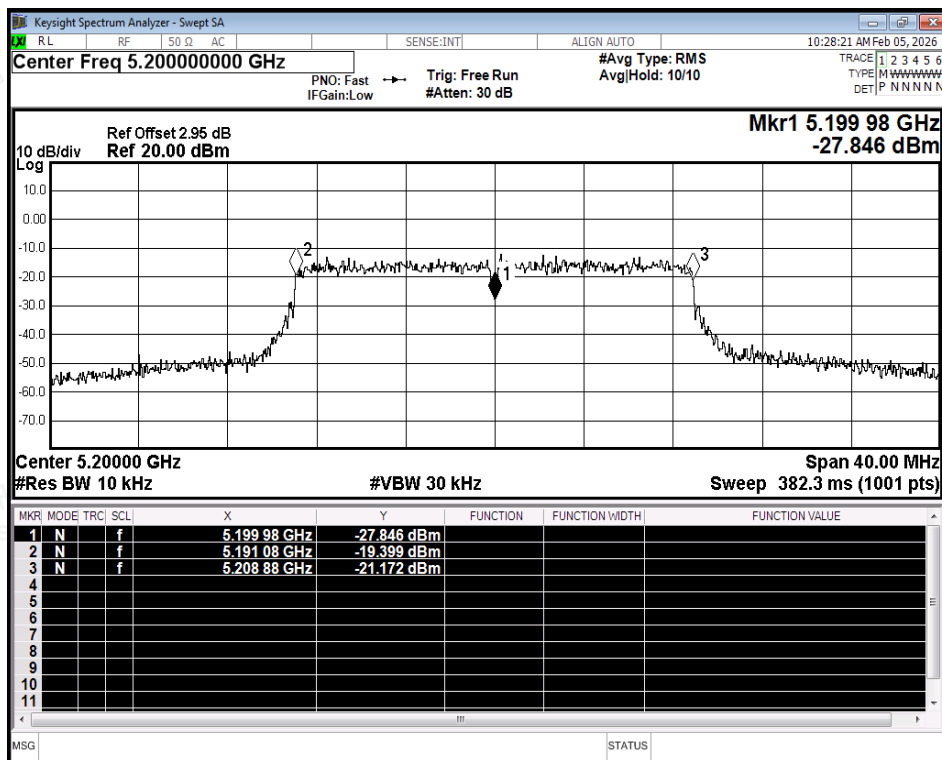

Freq. Stability NVNT ax20 5200MHz Ant1

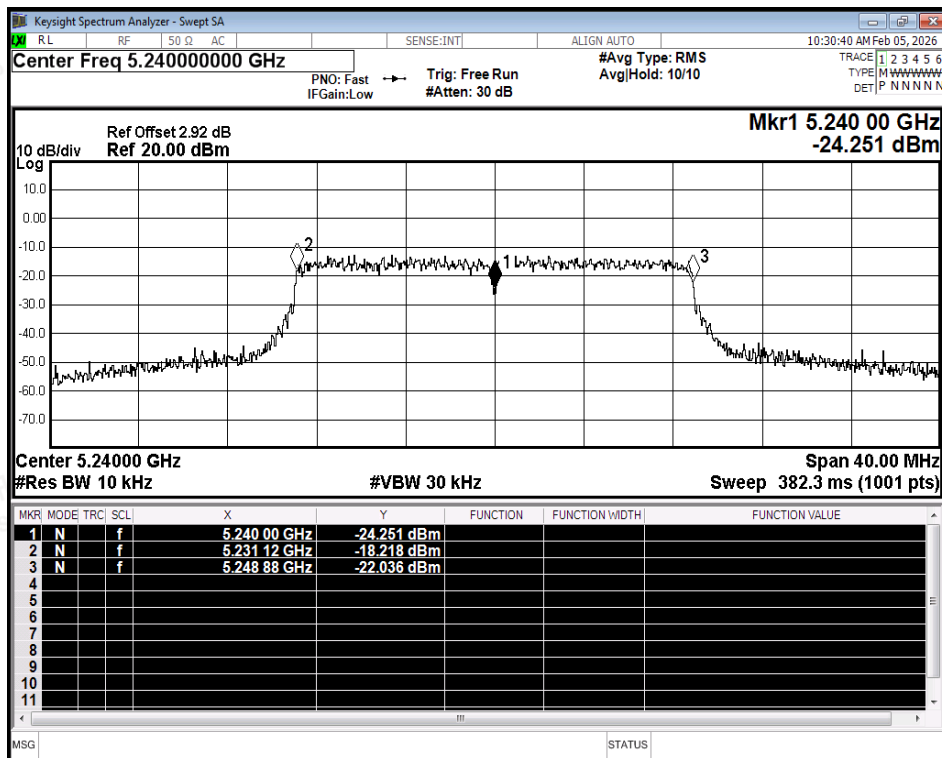

Freq. Stability NVNT ax20 5240MHz Ant1




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

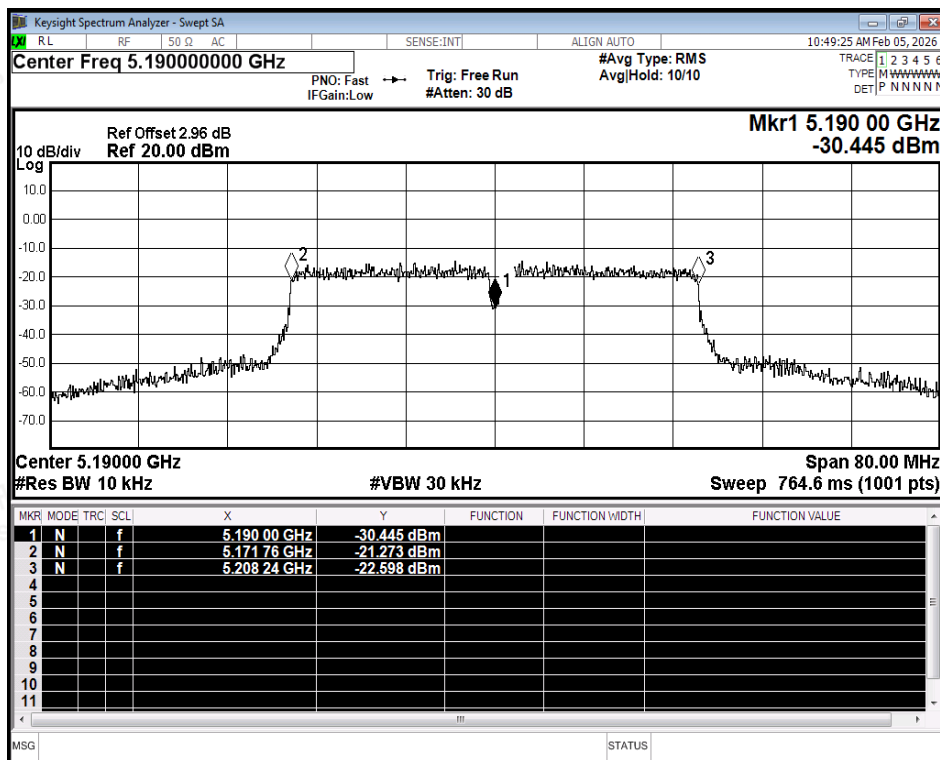

Freq. Stability NVNT ax40 5190MHz Ant1

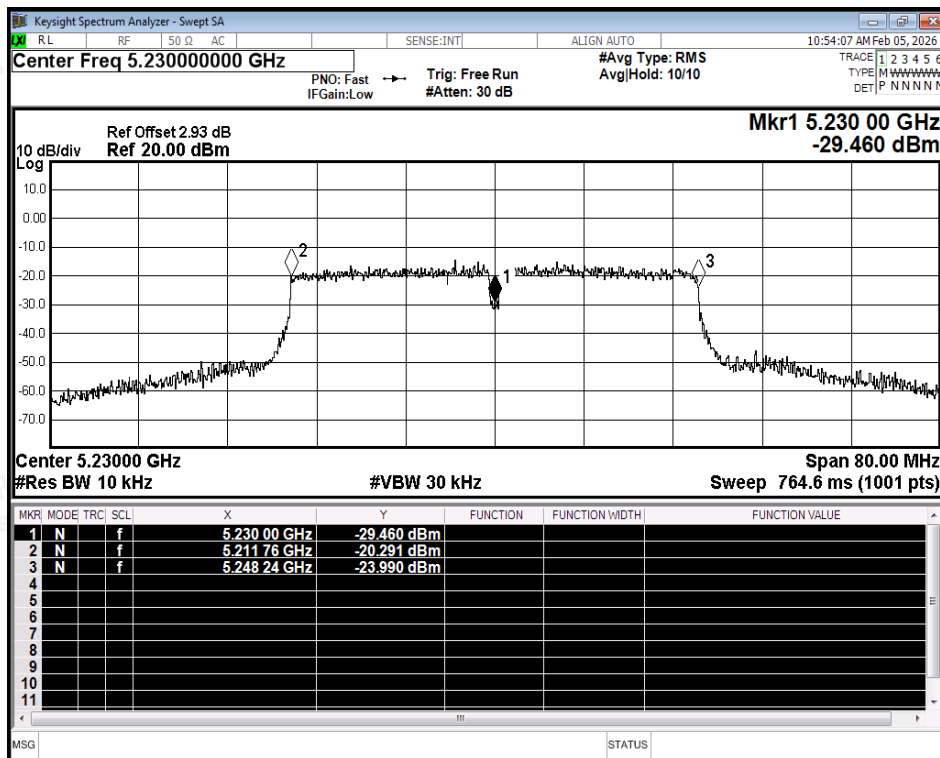

Freq. Stability NVNT ax40 5230MHz Ant1




Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

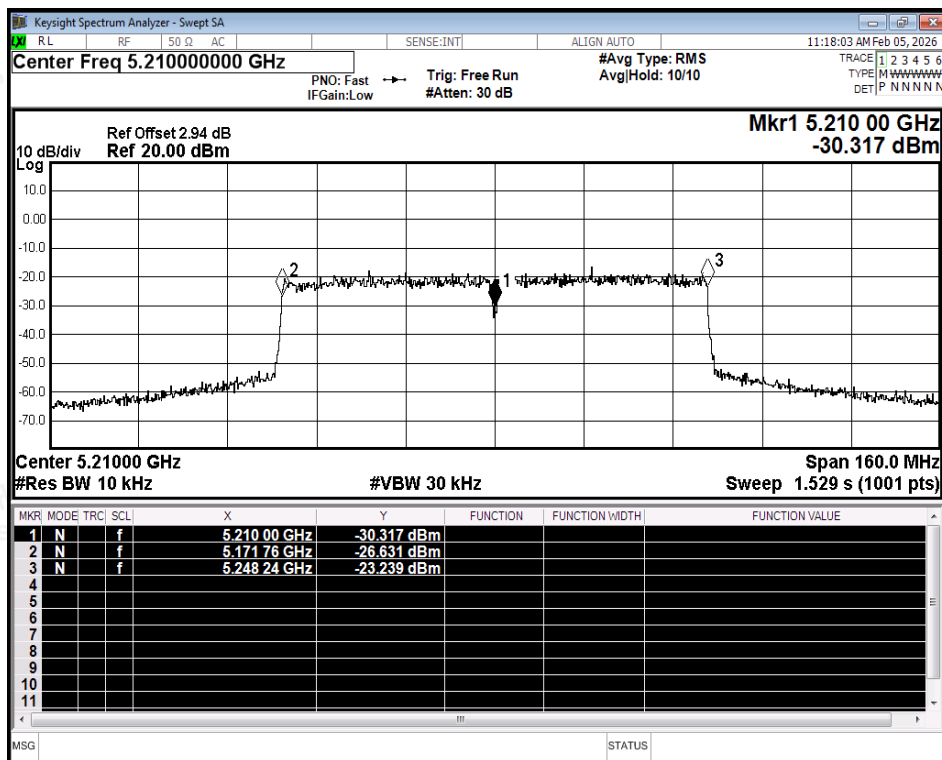

Freq. Stability NVNT ax80 5210MHz Ant1



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China


Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity




Condition	Mode	Frequency (MHz)	Antenna	Measured Frequency (MHz)	Frequency Error (Hz)	Deviation (ppm)	Limit (ppm)	Verdict
NVNT	a	5180	Ant2	5180	0	0	25	Pass
NVNT	a	5200	Ant2	5200	0	0	25	Pass
NVNT	a	5240	Ant2	5240	0	0	25	Pass
NVNT	n20	5180	Ant2	5180	0	0	25	Pass
NVNT	n20	5200	Ant2	5200	0	0	25	Pass
NVNT	n20	5240	Ant2	5239.98	-20000	-3.82	25	Pass
NVNT	n40	5190	Ant2	5190	0	0	25	Pass
NVNT	n40	5230	Ant2	5230	0	0	25	Pass
NVNT	ac20	5180	Ant2	5179.98	-20000	-3.86	25	Pass
NVNT	ac20	5200	Ant2	5200	0	0	25	Pass
NVNT	ac20	5240	Ant2	5239.98	-20000	-3.82	25	Pass
NVNT	ac40	5190	Ant2	5190	0	0	25	Pass
NVNT	ac40	5230	Ant2	5230	0	0	25	Pass
NVNT	ac80	5210	Ant2	5210	0	0	25	Pass
NVNT	ax20	5180	Ant2	5180	0	0	25	Pass
NVNT	ax20	5200	Ant2	5199.98	-20000	-3.85	25	Pass
NVNT	ax20	5240	Ant2	5239.98	-20000	-3.82	25	Pass
NVNT	ax40	5190	Ant2	5190	0	0	25	Pass
NVNT	ax40	5230	Ant2	5230	0	0	25	Pass
NVNT	ax80	5210	Ant2	5210	0	0	25	Pass



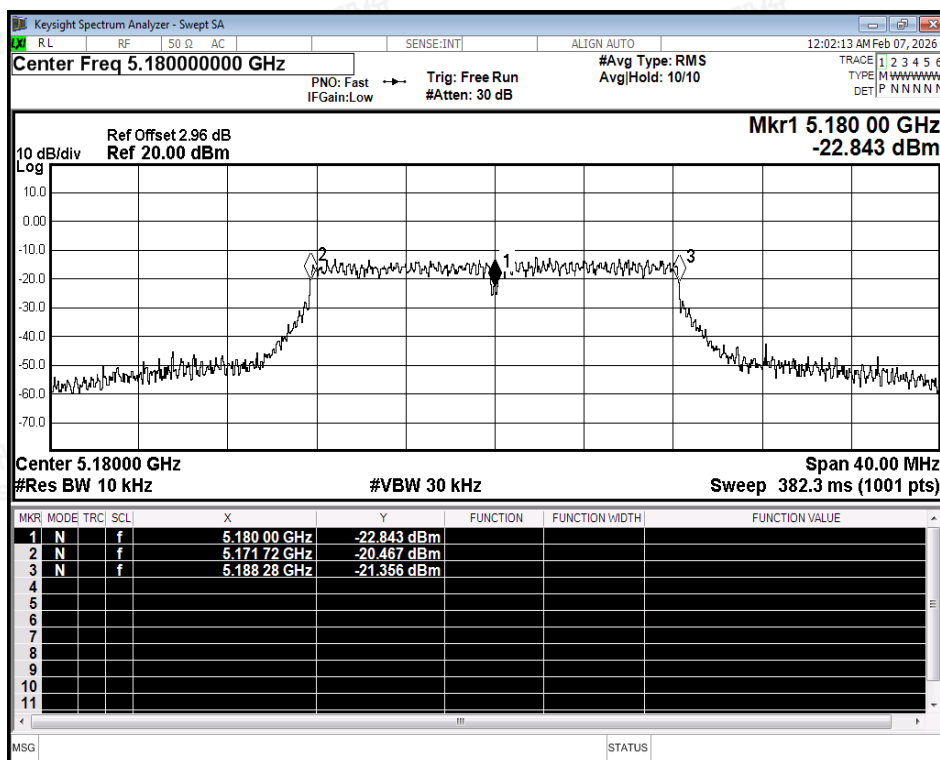

Freq. Stability NVNT a 5180MHz Ant2

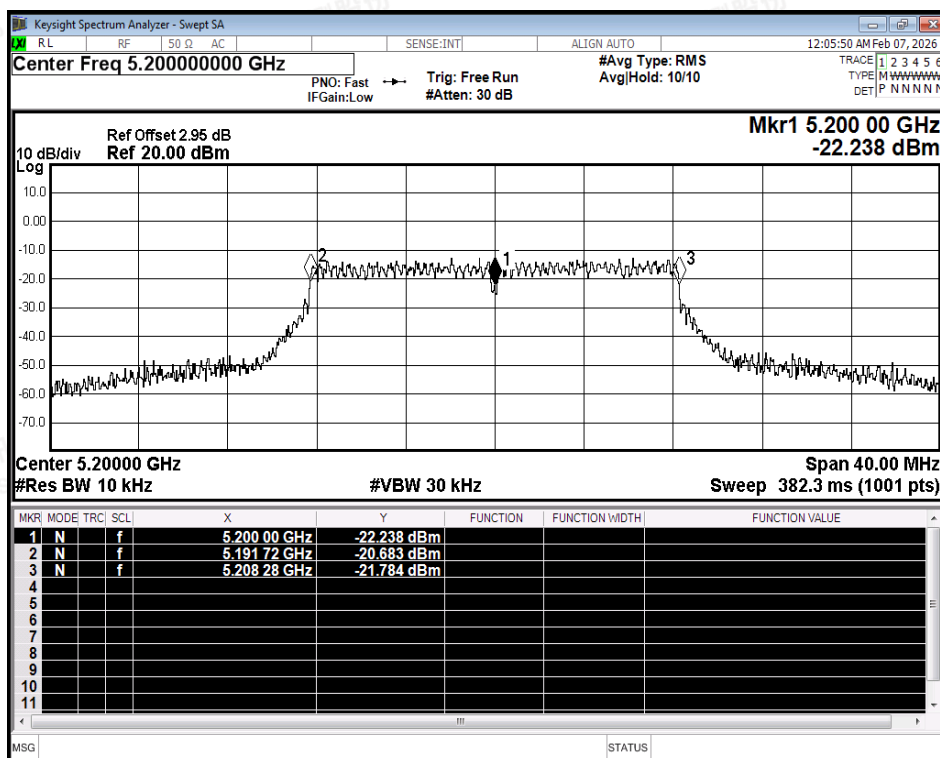

Freq. Stability NVNT a 5200MHz Ant2




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

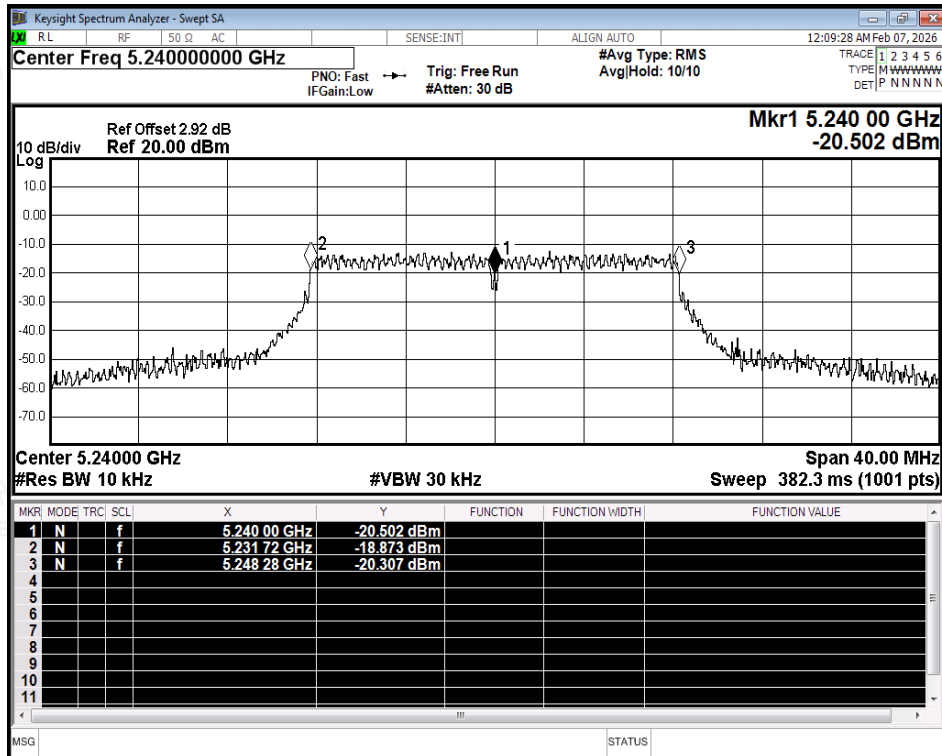

Freq. Stability NVNT a 5240MHz Ant2

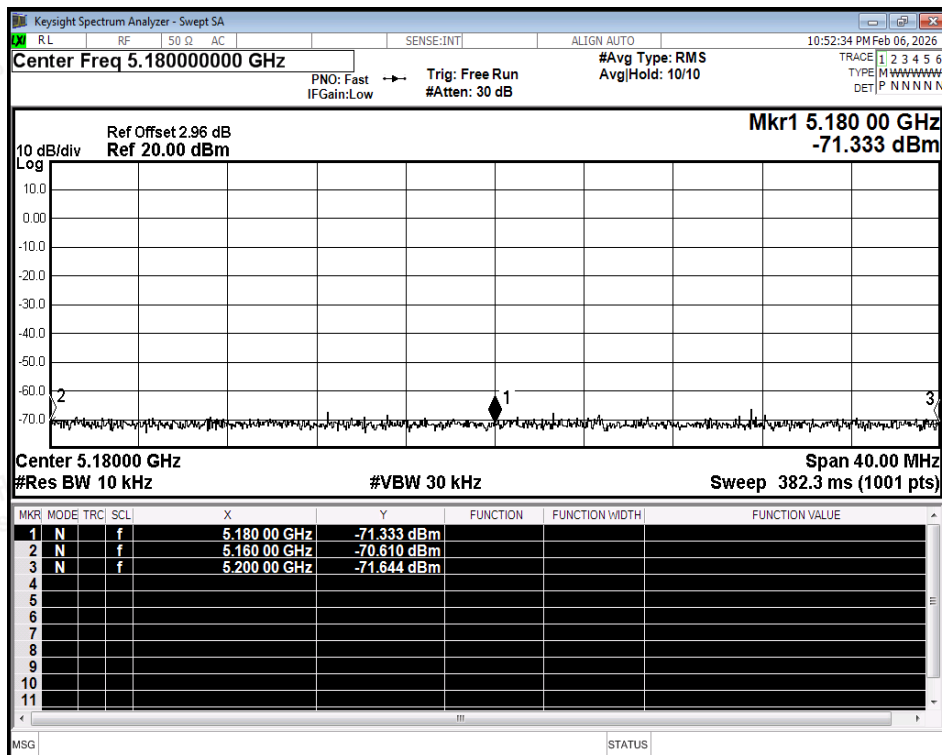

Freq. Stability NVNT n20 5180MHz Ant2




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

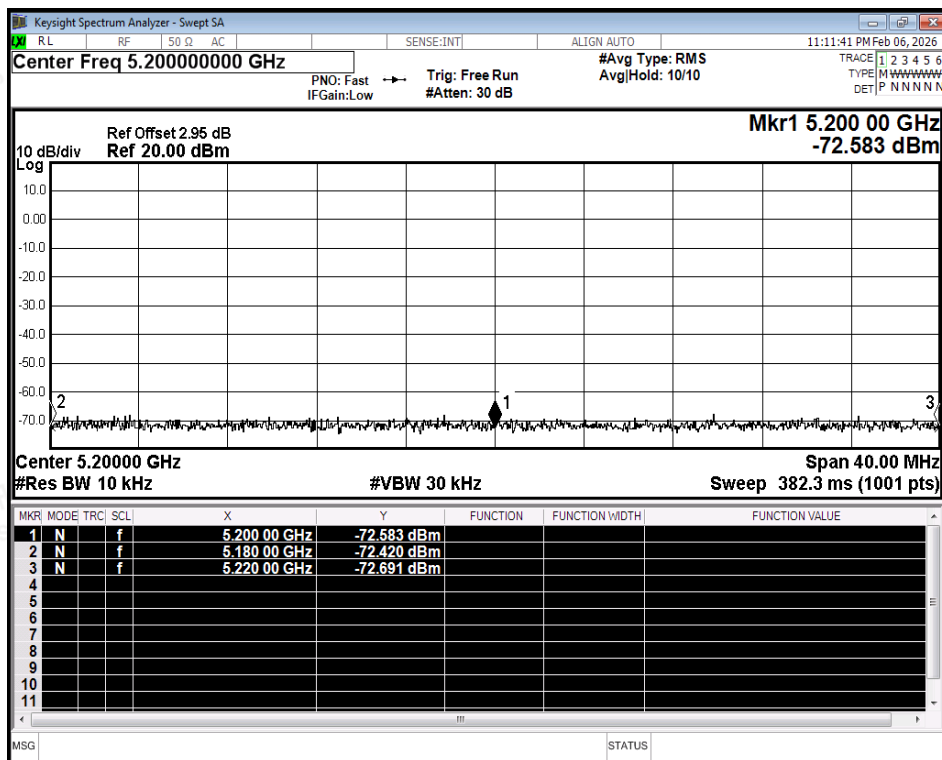

Freq. Stability NVNT n20 5200MHz Ant2

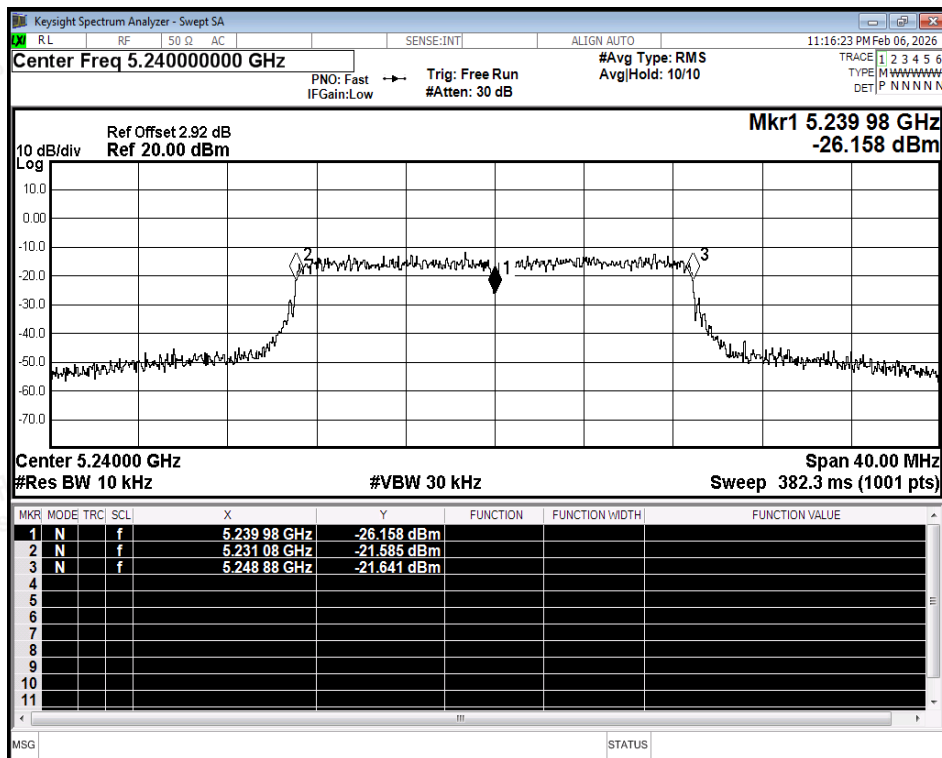

Freq. Stability NVNT n20 5240MHz Ant2




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

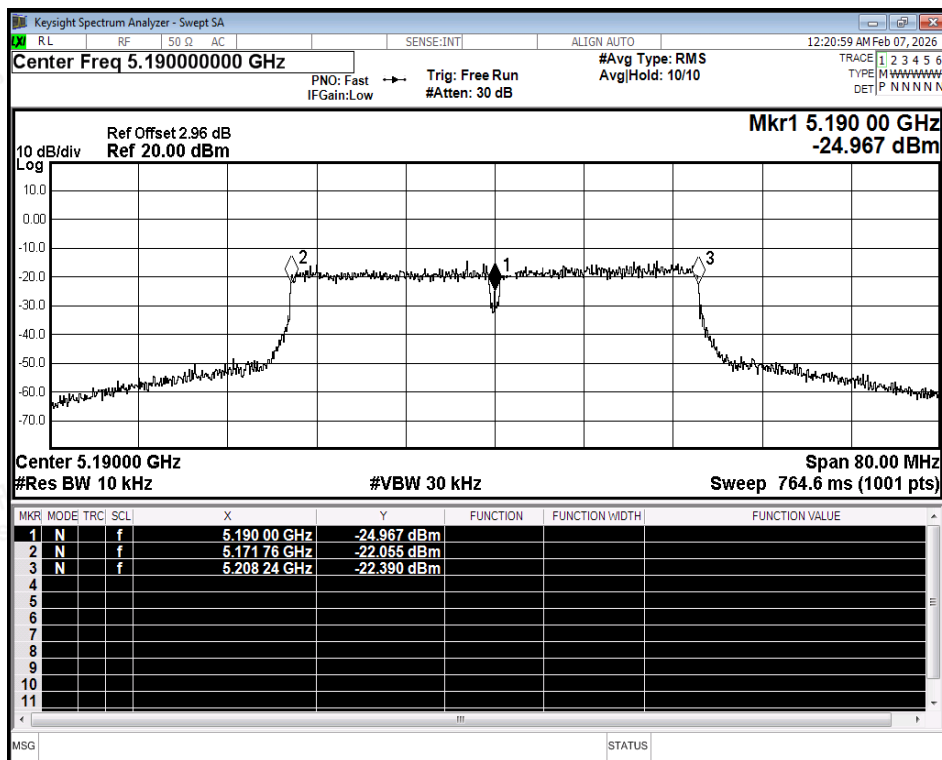

Freq. Stability NVNT n40 5190MHz Ant2

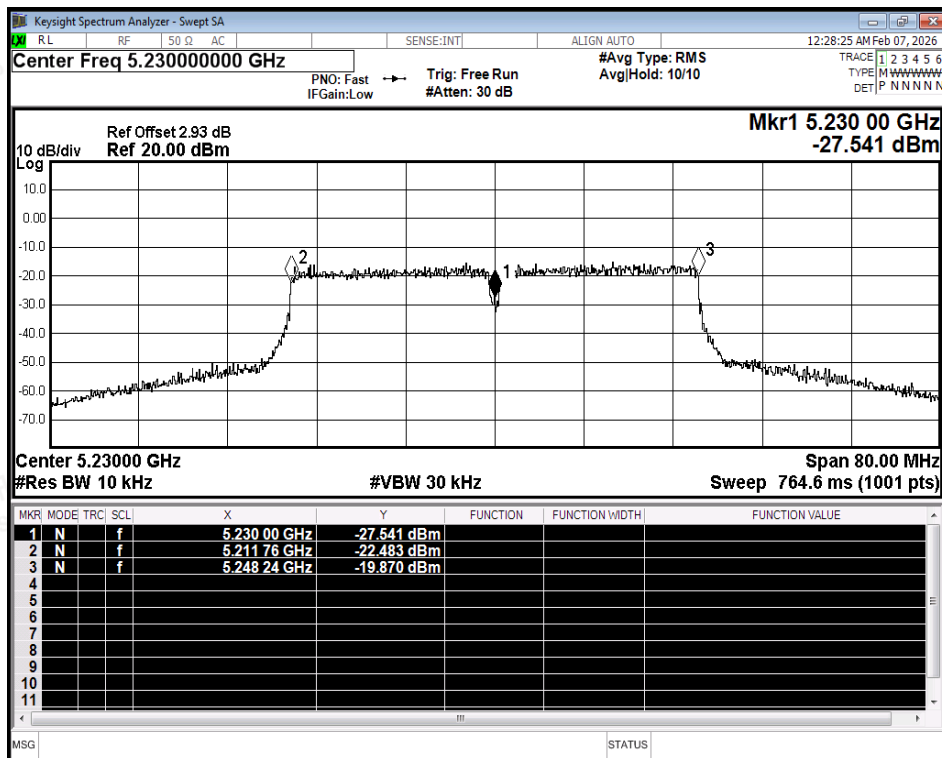

Freq. Stability NVNT n40 5230MHz Ant2




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

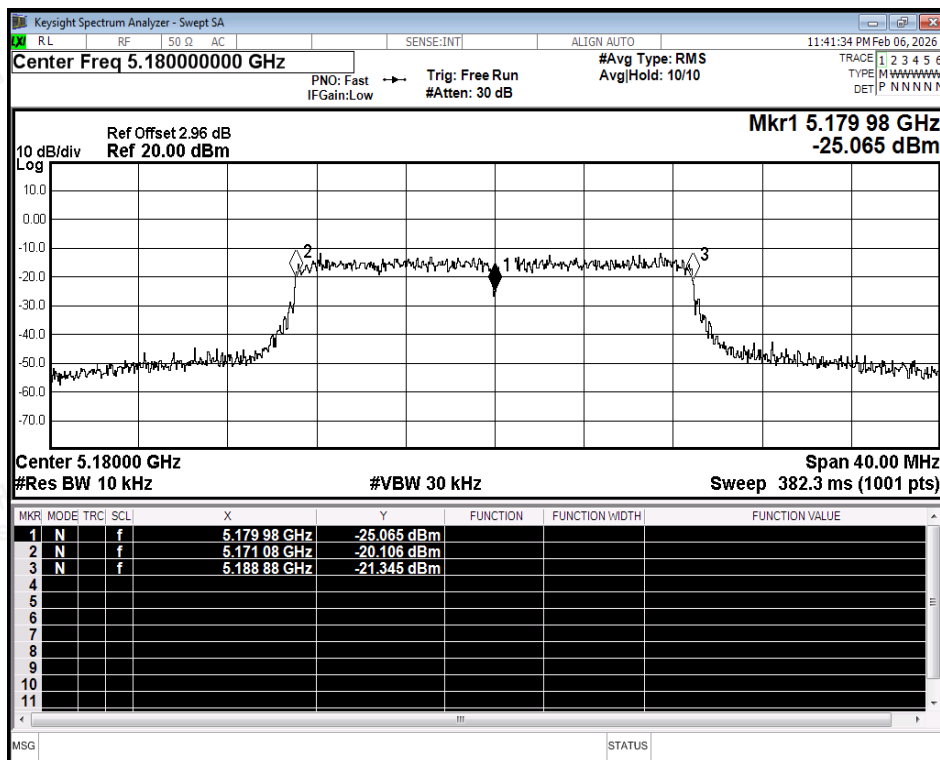

Freq. Stability NVNT ac20 5180MHz Ant2

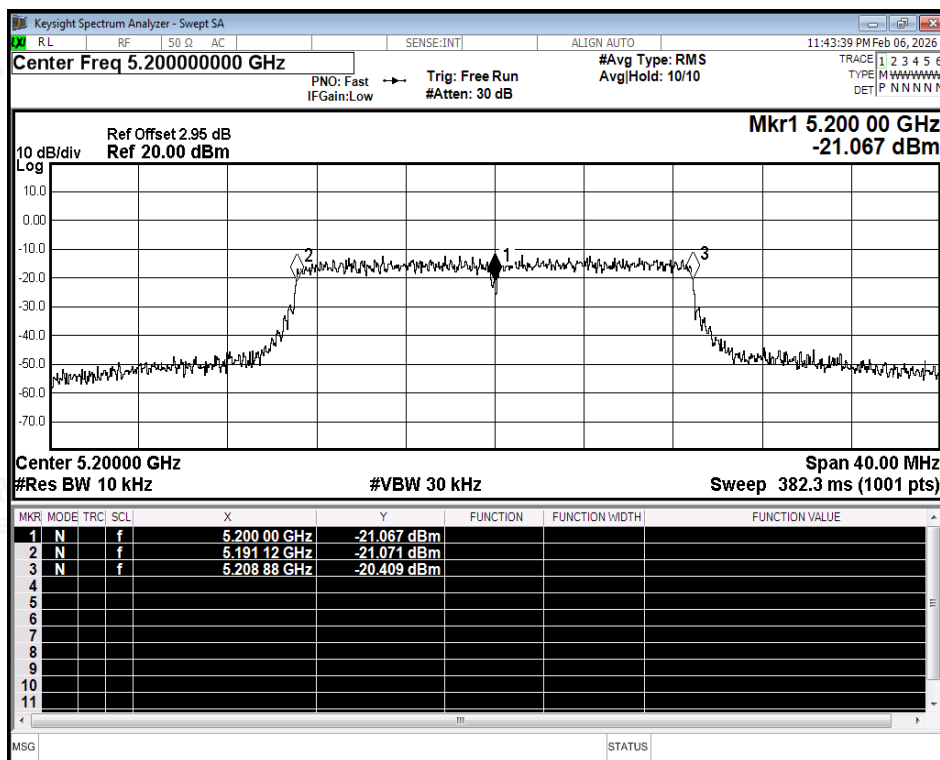

Freq. Stability NVNT ac20 5200MHz Ant2




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

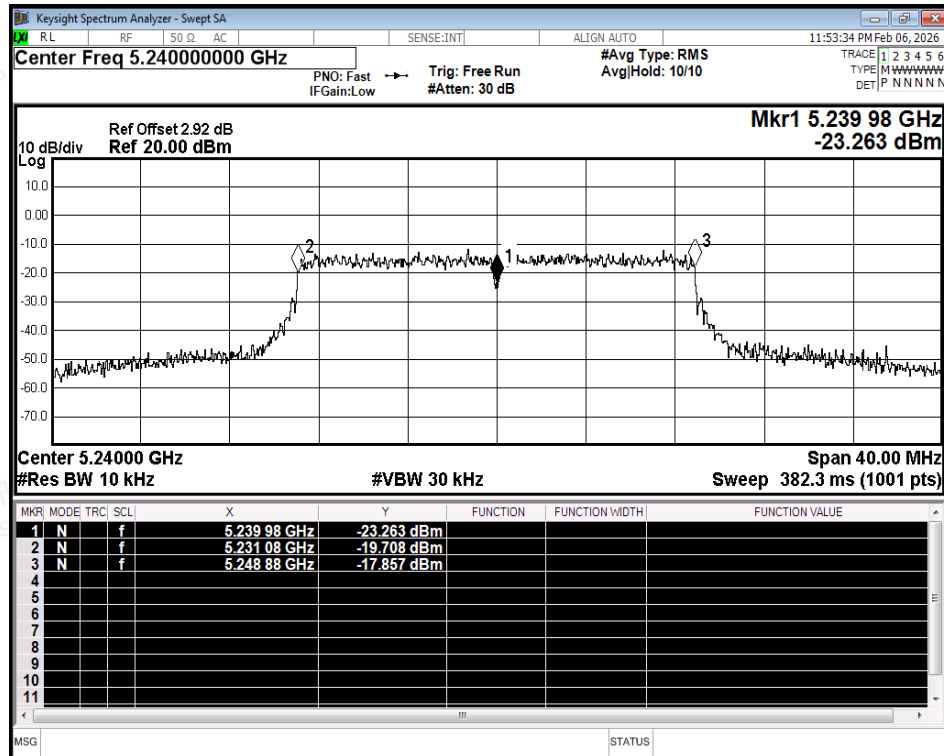

Freq. Stability NVNT ac20 5240MHz Ant2

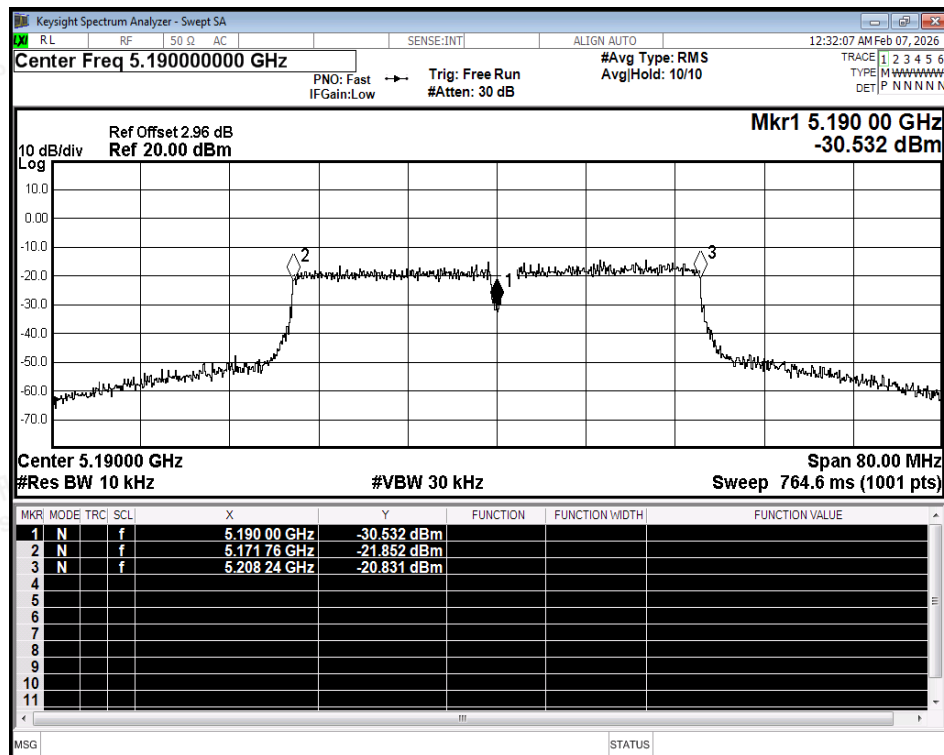

Freq. Stability NVNT ac40 5190MHz Ant2




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

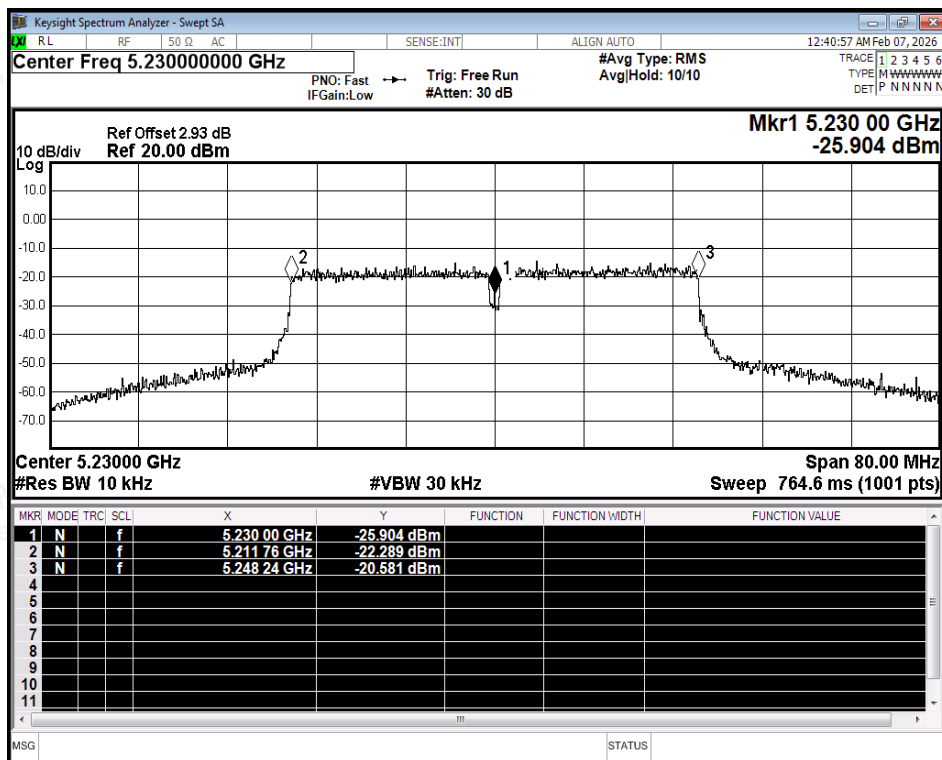


Freq. Stability NVNT ac40 5230MHz Ant2

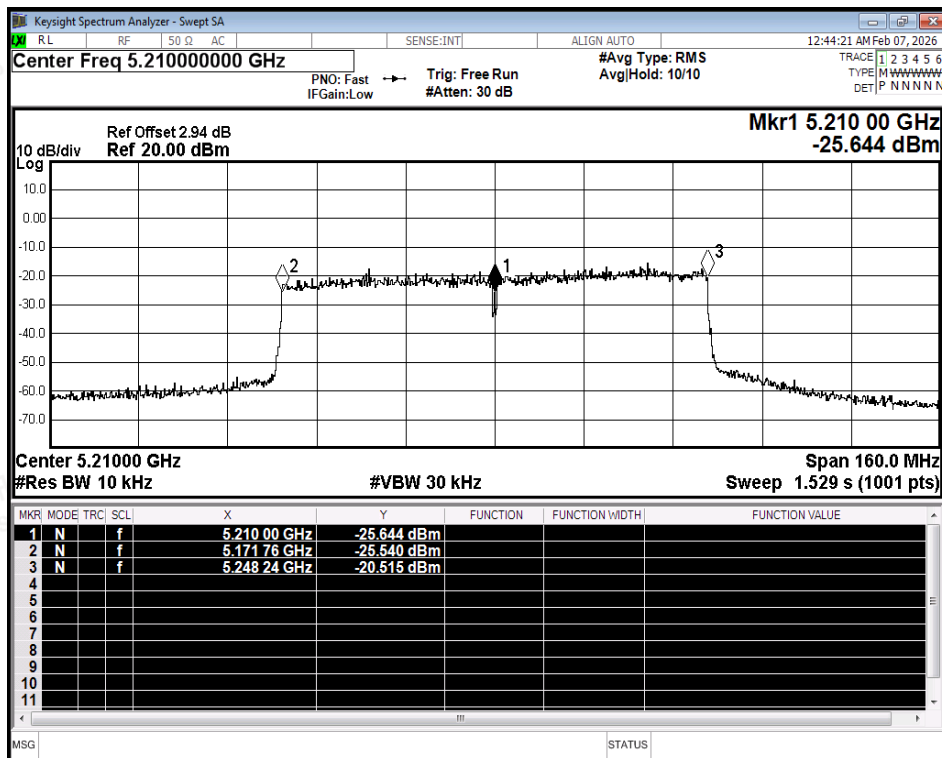


Freq. Stability NVNT ac80 5210MHz Ant2



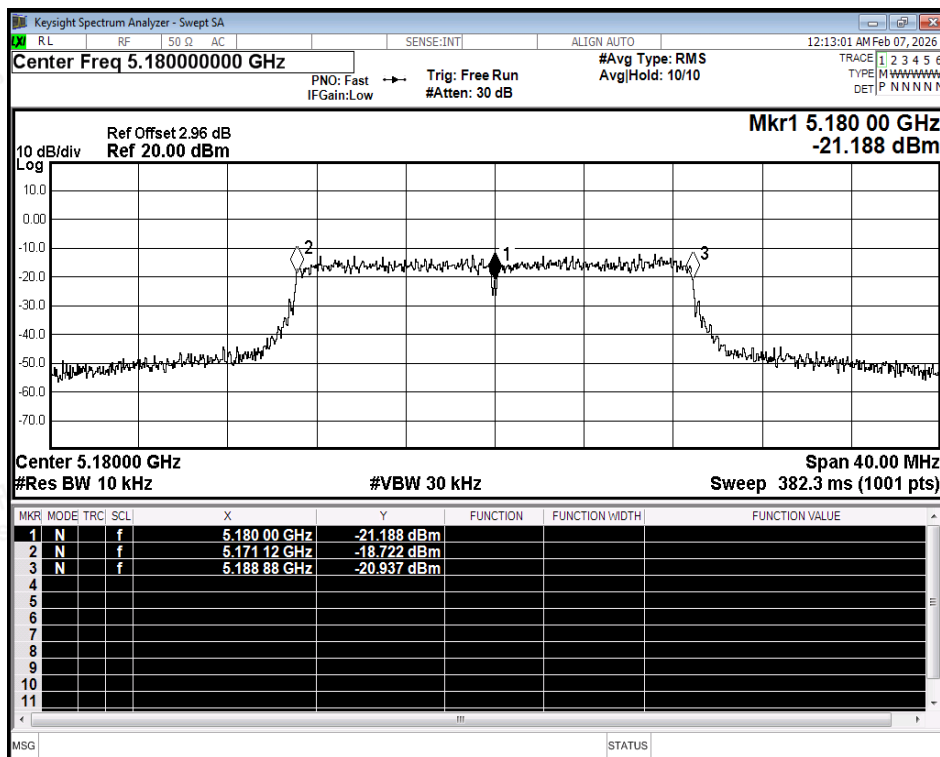

Freq. Stability NVNT ax20 5180MHz Ant2

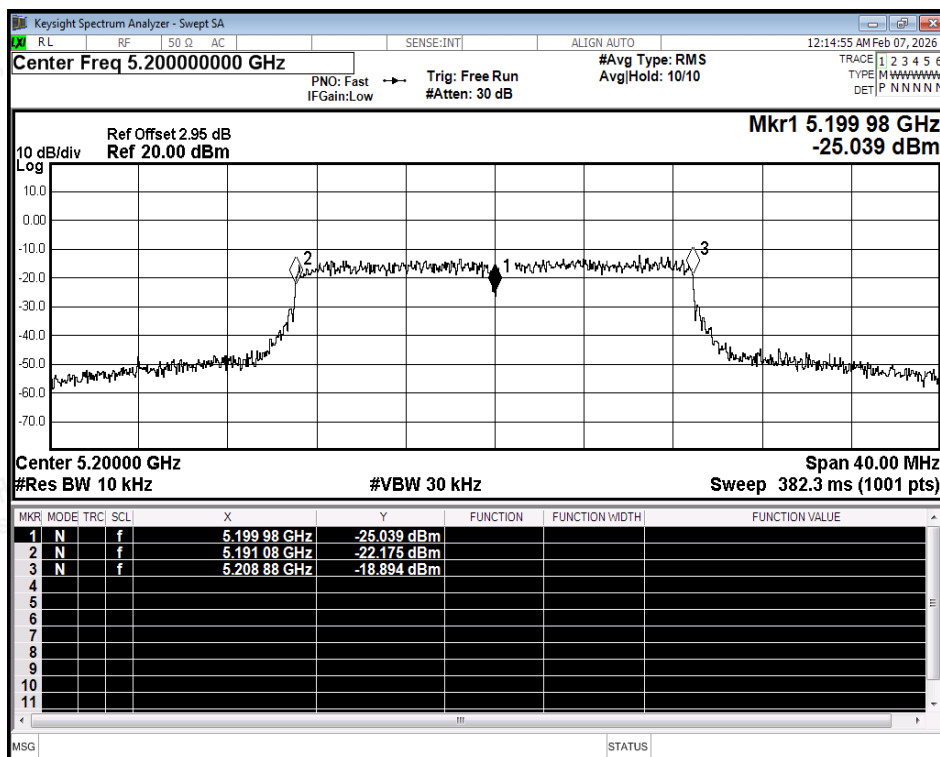

Freq. Stability NVNT ax20 5200MHz Ant2




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

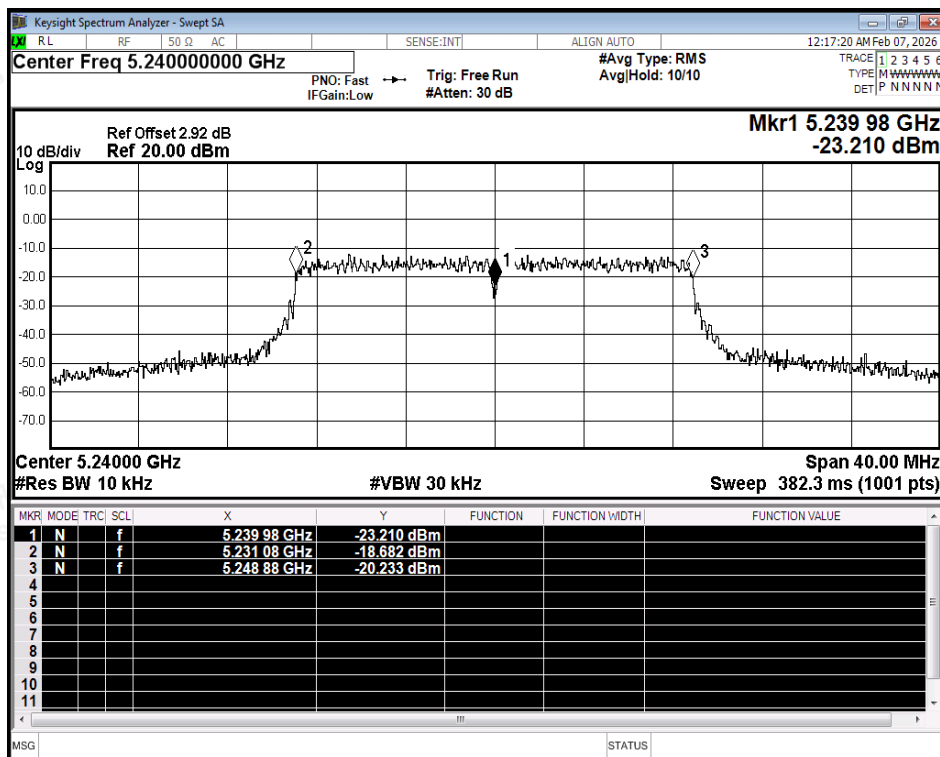

Freq. Stability NVNT ax20 5240MHz Ant2

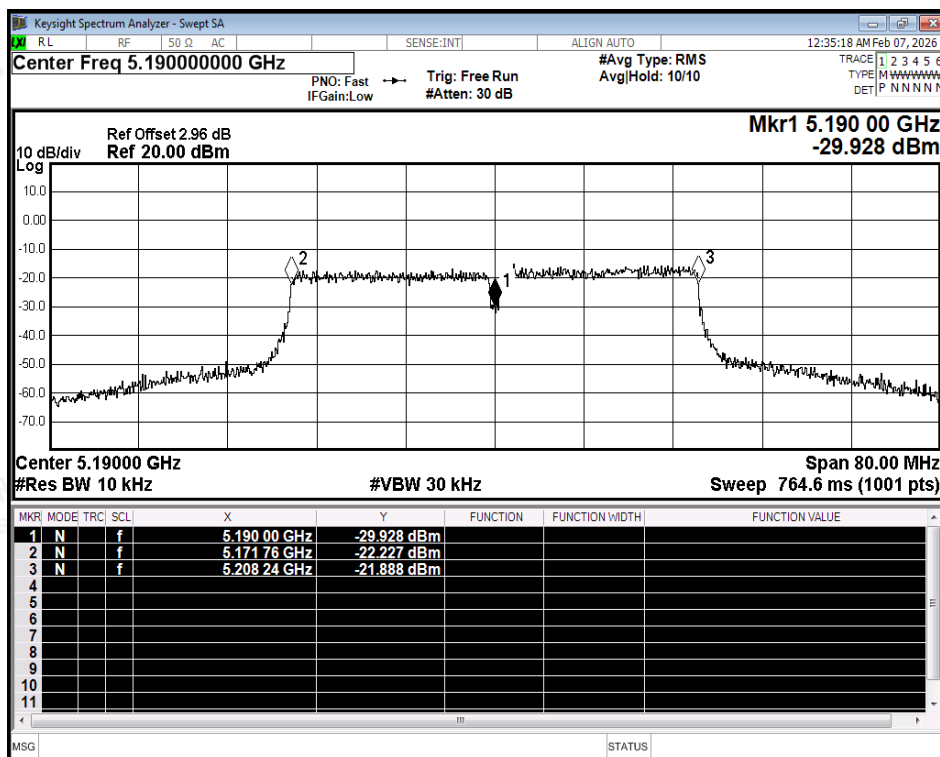

Freq. Stability NVNT ax40 5190MHz Ant2




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

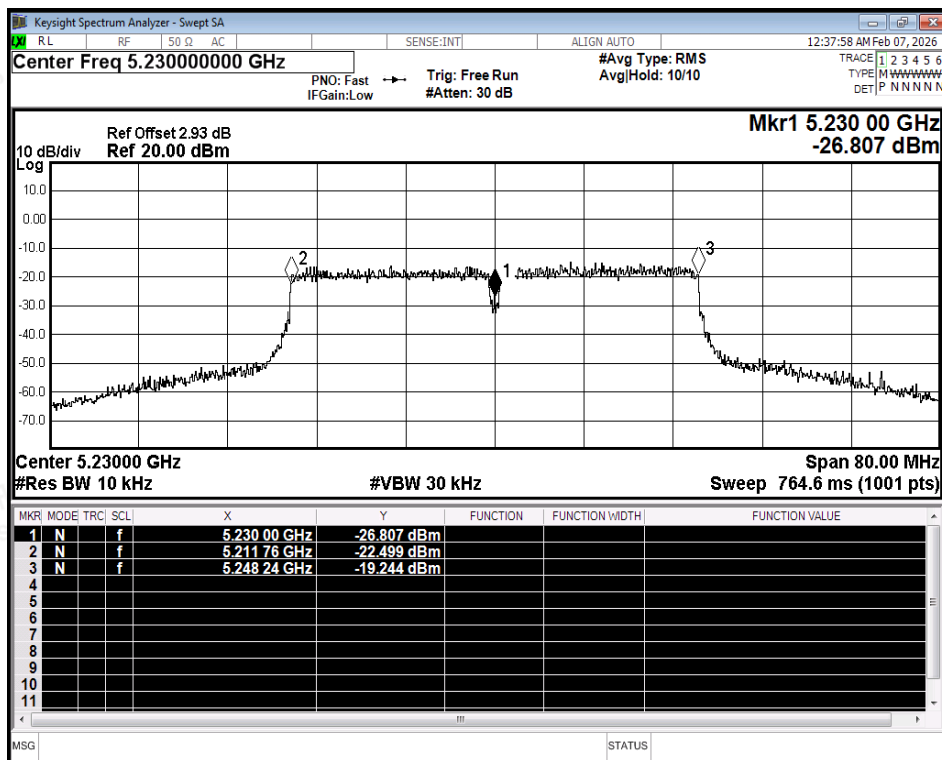

Freq. Stability NVNT ax40 5230MHz Ant2

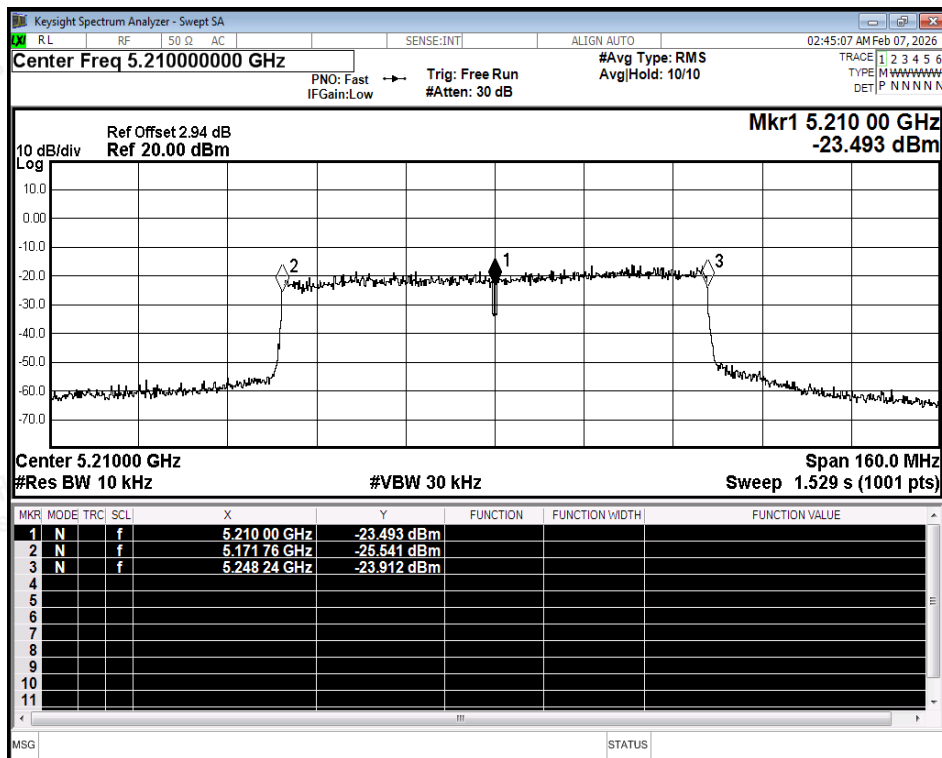

Freq. Stability NVNT ax80 5210MHz Ant2



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity




A.6 Duty Cycle

Condition	Mode	Frequency (MHz)	Antenna	Duty Cycle (%)	Correction Factor (dB)	1/T (kHz)
NVNT	a	5180	Ant1	94.78	0.23	0.92
NVNT	a	5200	Ant1	94.83	0.23	0.91
NVNT	a	5240	Ant1	93.97	0.27	0.92
NVNT	n20	5180	Ant1	94	0.27	1.06
NVNT	n20	5200	Ant1	93	0.32	1.08
NVNT	n20	5240	Ant1	93	0.32	1.08
NVNT	n40	5190	Ant1	88.68	0.52	2.13
NVNT	n40	5230	Ant1	88.68	0.52	2.13
NVNT	ac20	5180	Ant1	94	0.27	1.06
NVNT	ac20	5200	Ant1	94	0.27	1.06
NVNT	ac20	5240	Ant1	94	0.27	1.06
NVNT	ac40	5190	Ant1	87.04	0.6	2.13
NVNT	ac40	5230	Ant1	88.89	0.51	2.08
NVNT	ac80	5210	Ant1	80.65	0.93	4
NVNT	ax20	5180	Ant1	94	0.27	1.06
NVNT	ax20	5200	Ant1	94	0.27	1.06
NVNT	ax20	5240	Ant1	93.07	0.31	1.06
NVNT	ax40	5190	Ant1	88.68	0.52	2.13
NVNT	ax40	5230	Ant1	87.04	0.6	2.13
NVNT	ax80	5210	Ant1	80	0.97	4.17



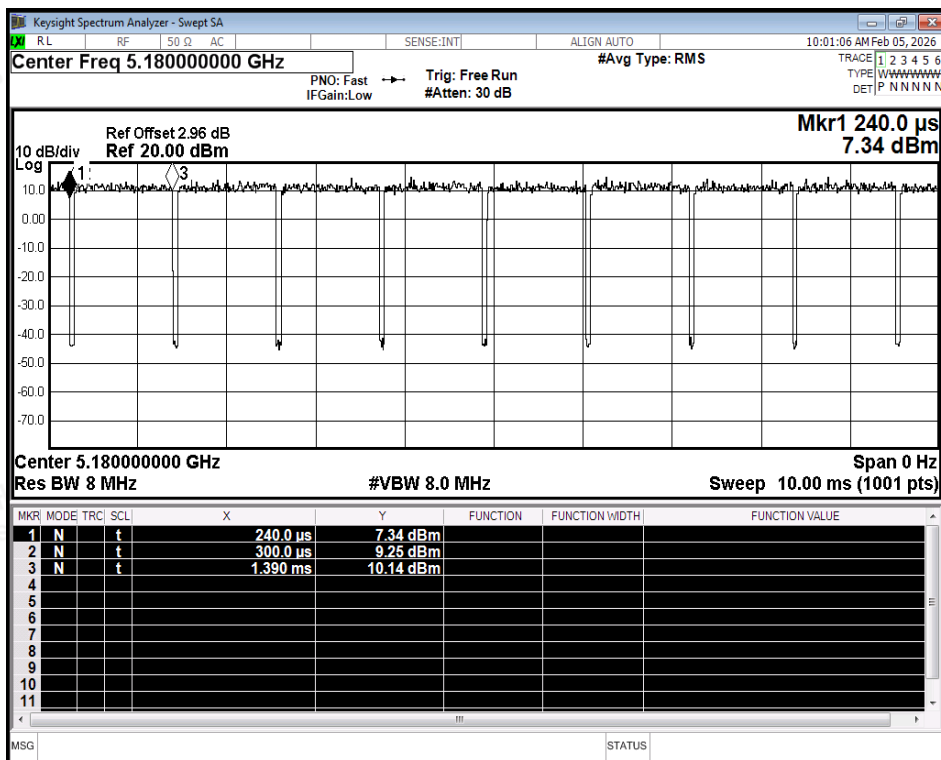

Duty Cycle NVNT a 5180MHz Ant1

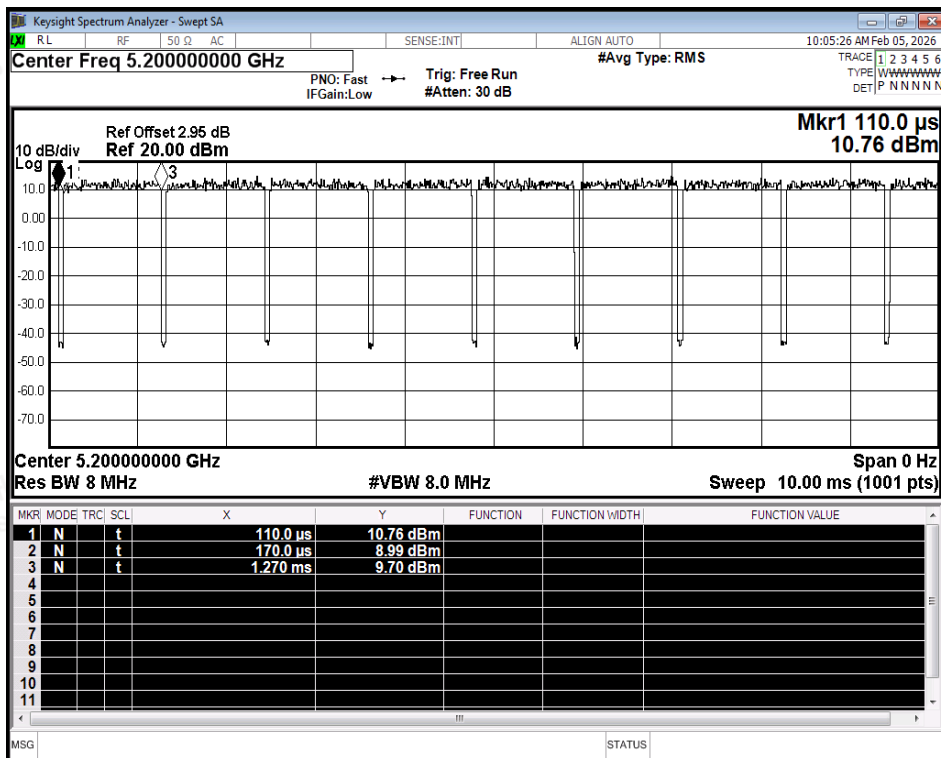

Duty Cycle NVNT a 5200MHz Ant1




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

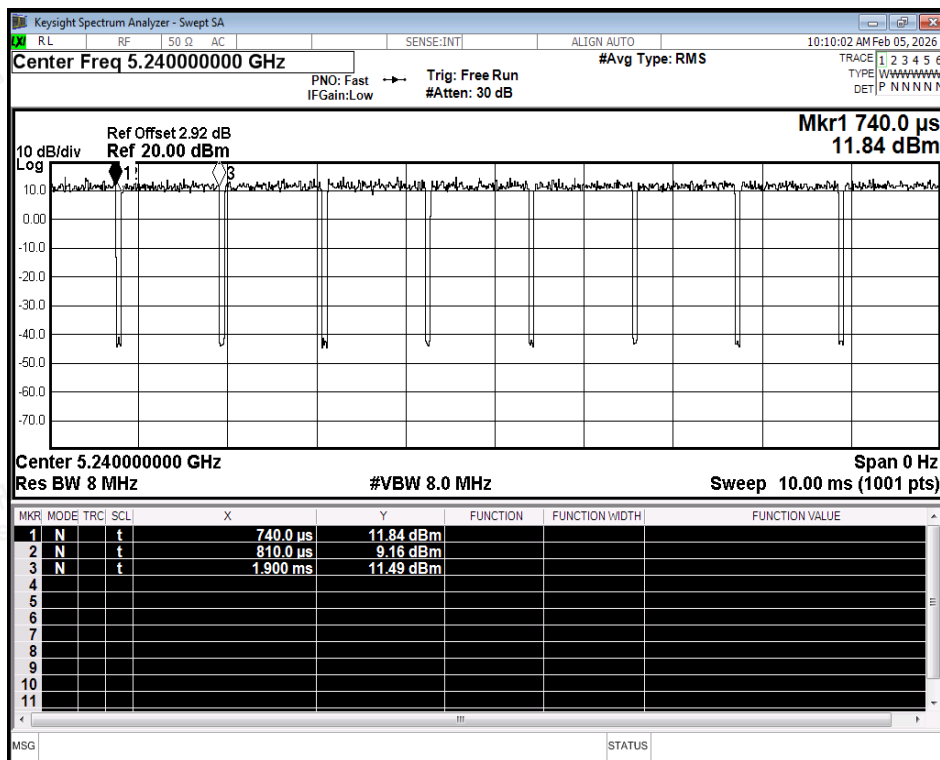

Duty Cycle NVNT a 5240MHz Ant1

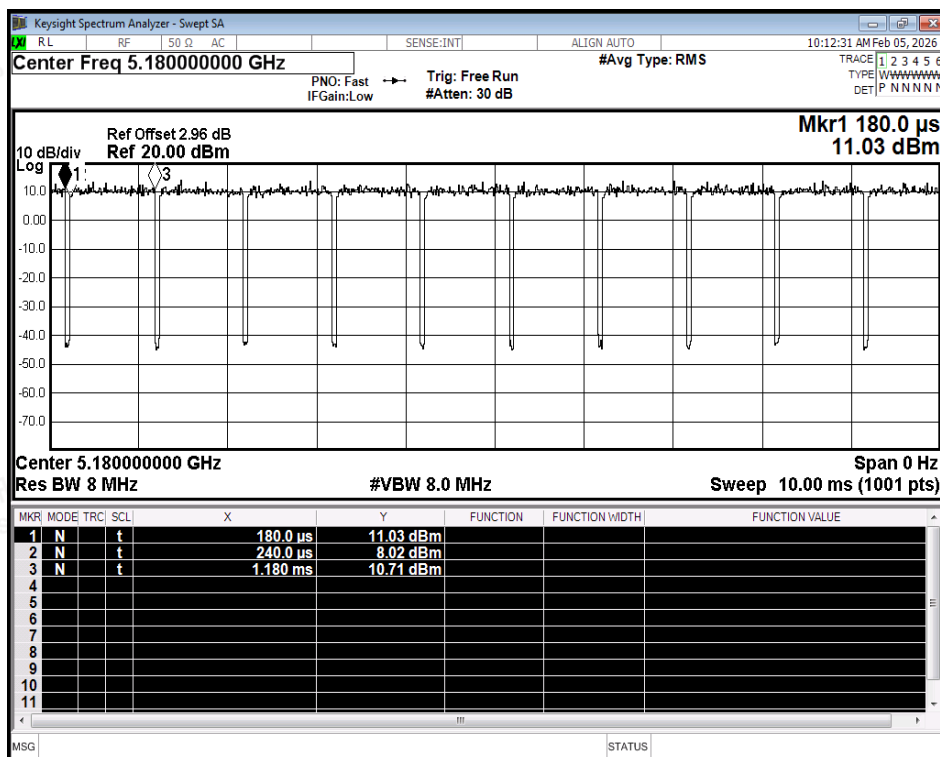

Duty Cycle NVNT n20 5180MHz Ant1




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

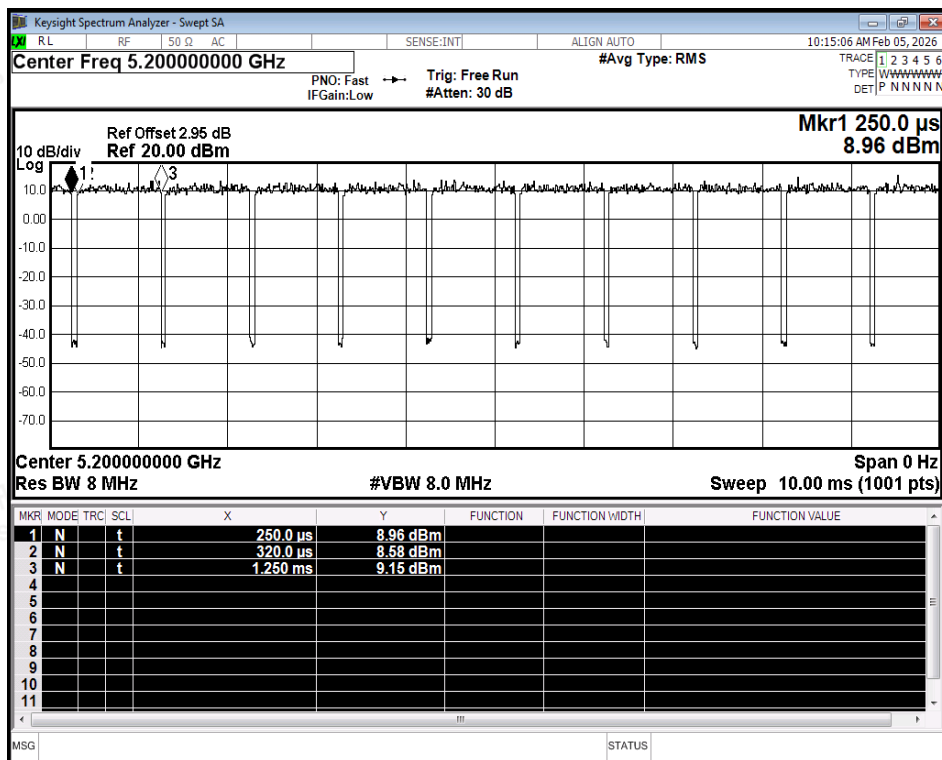

Duty Cycle NVNT n20 5200MHz Ant1

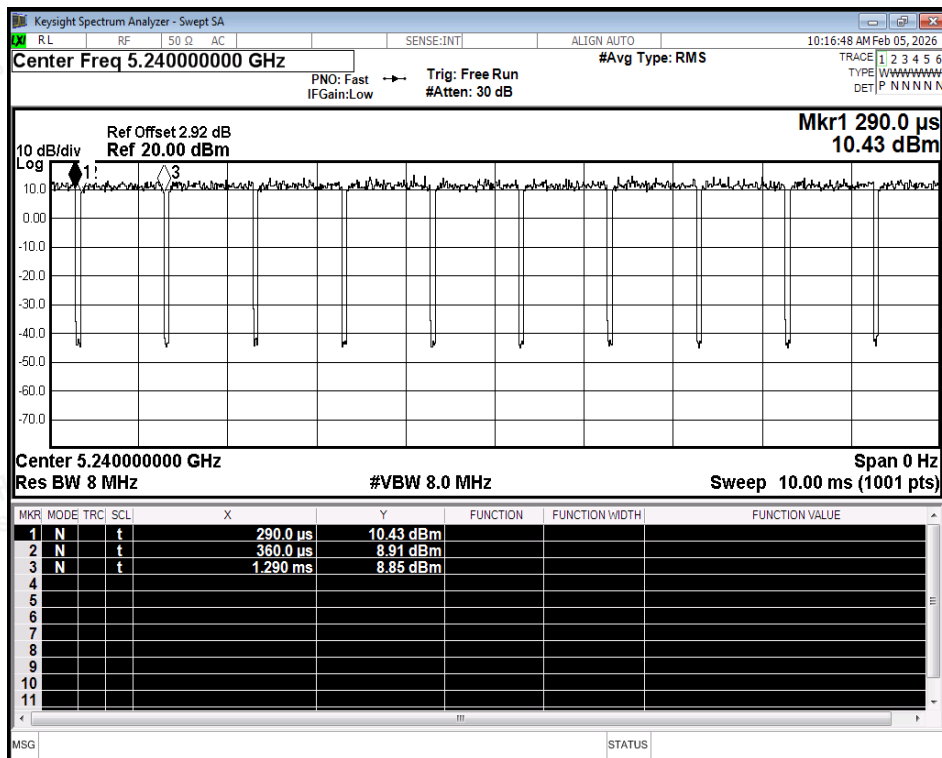

Duty Cycle NVNT n20 5240MHz Ant1




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

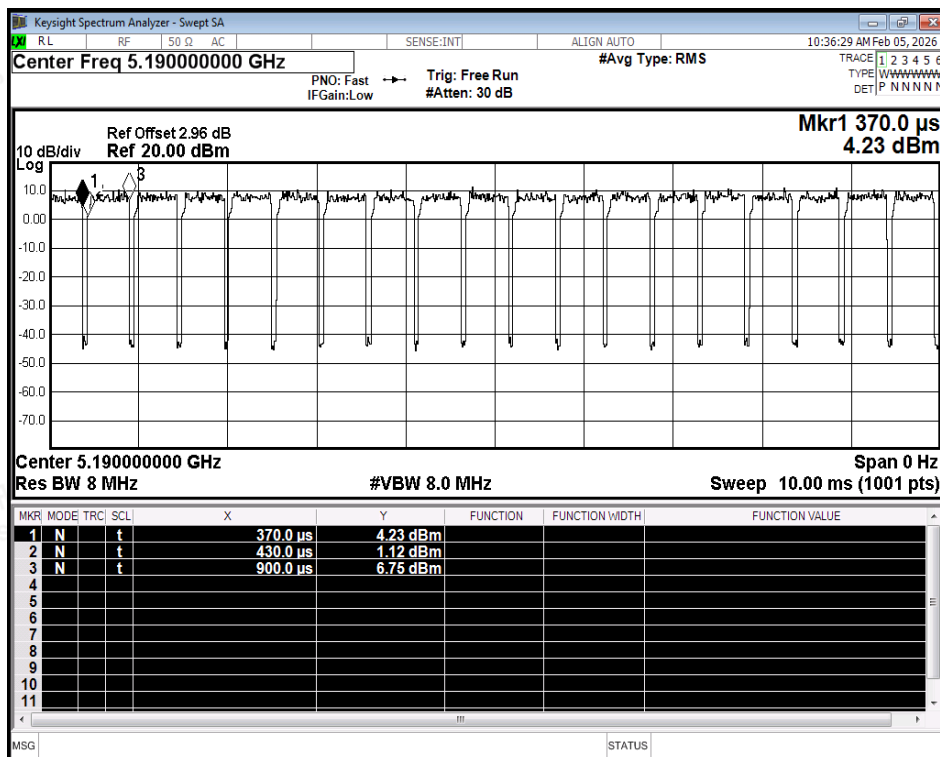


Duty Cycle NVNT n40 5190MHz Ant1

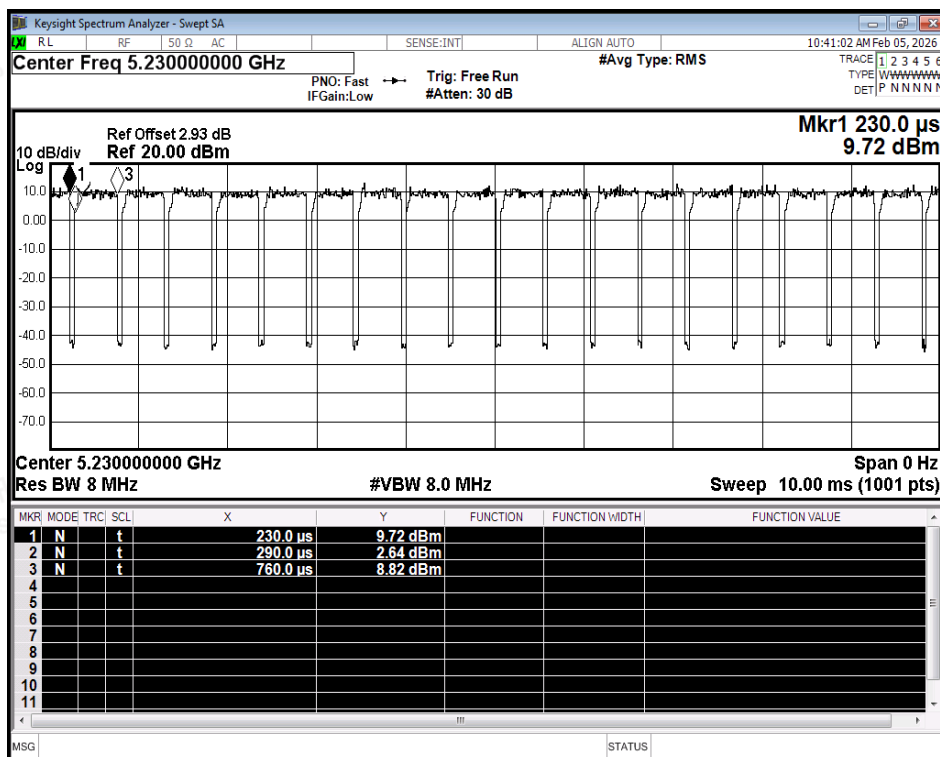


Duty Cycle NVNT n40 5230MHz Ant1



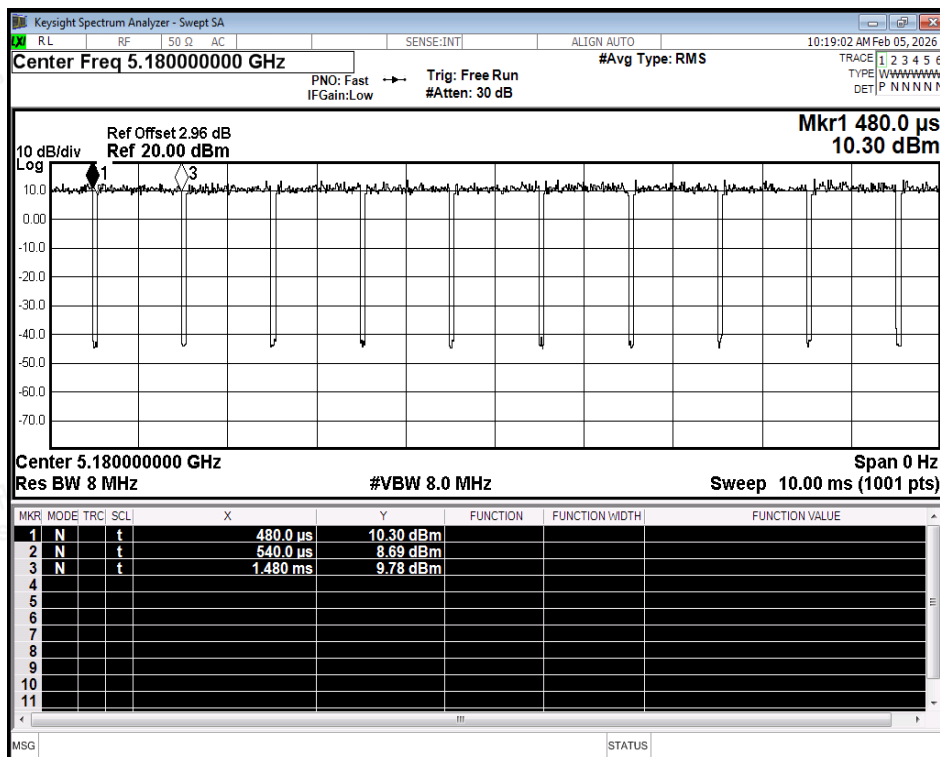

Duty Cycle NVNT ac20 5180MHz Ant1

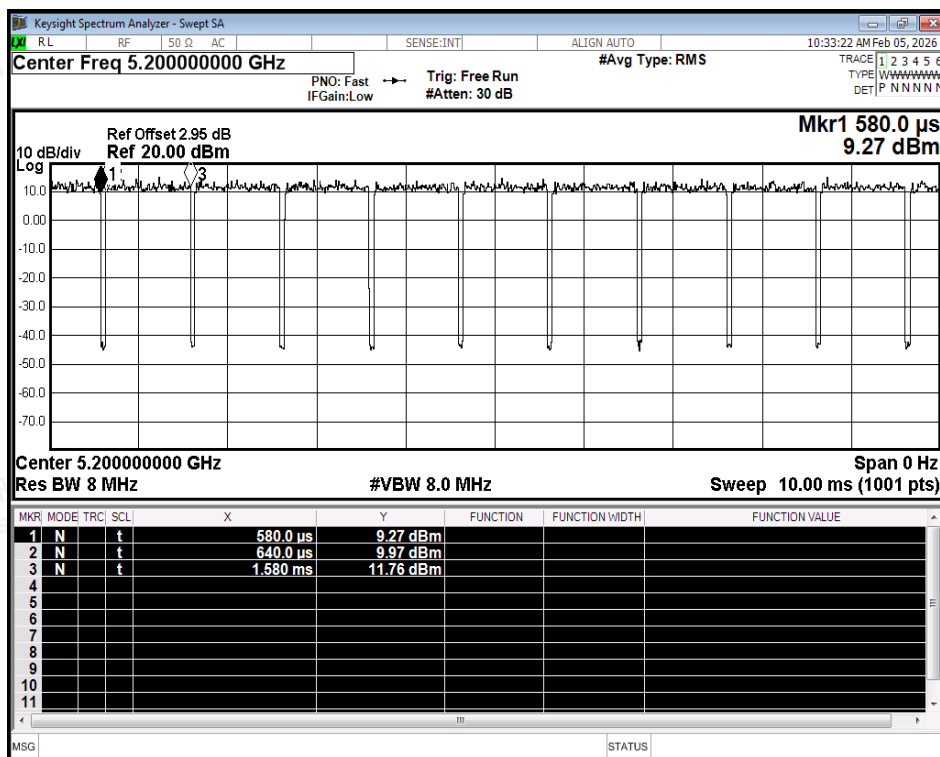

Duty Cycle NVNT ac20 5200MHz Ant1




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

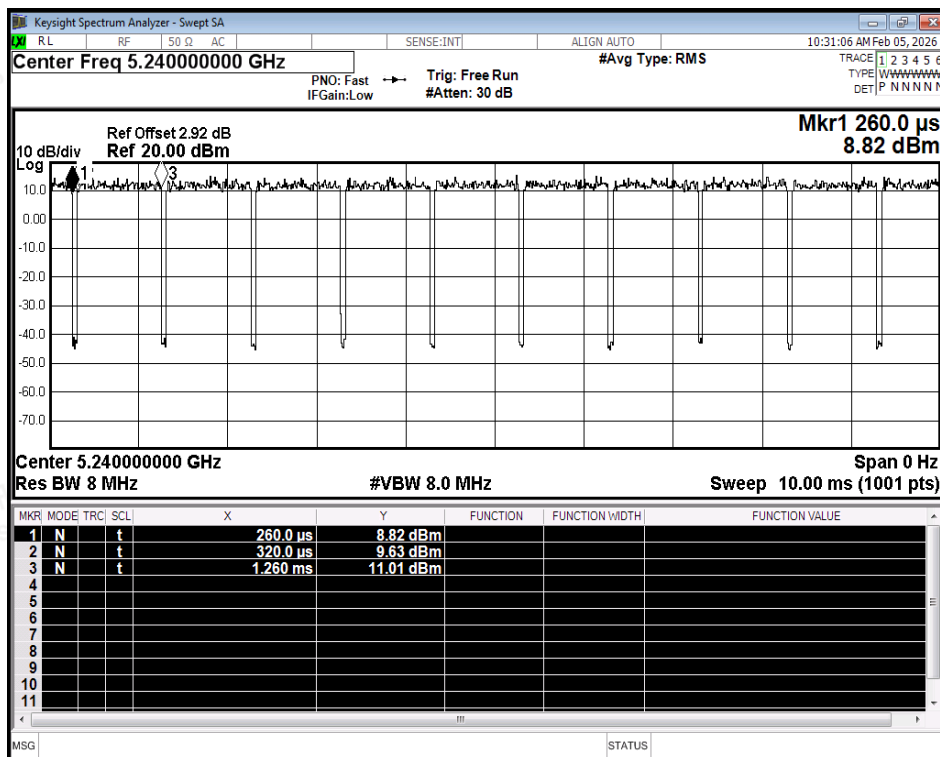

Duty Cycle NVNT ac20 5240MHz Ant1

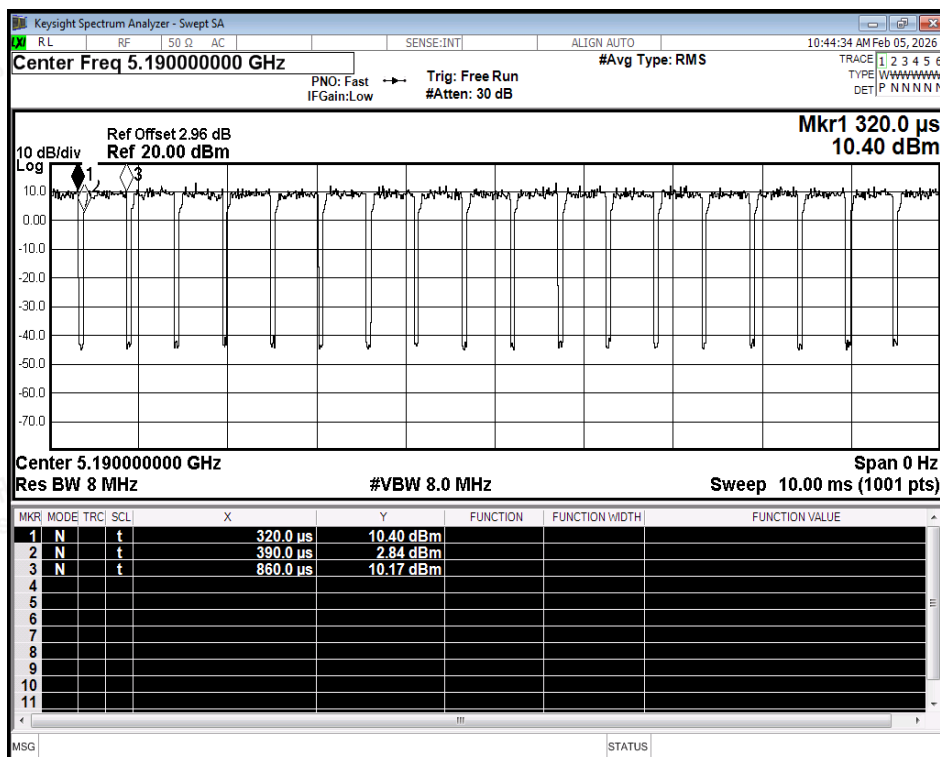

Duty Cycle NVNT ac40 5190MHz Ant1




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

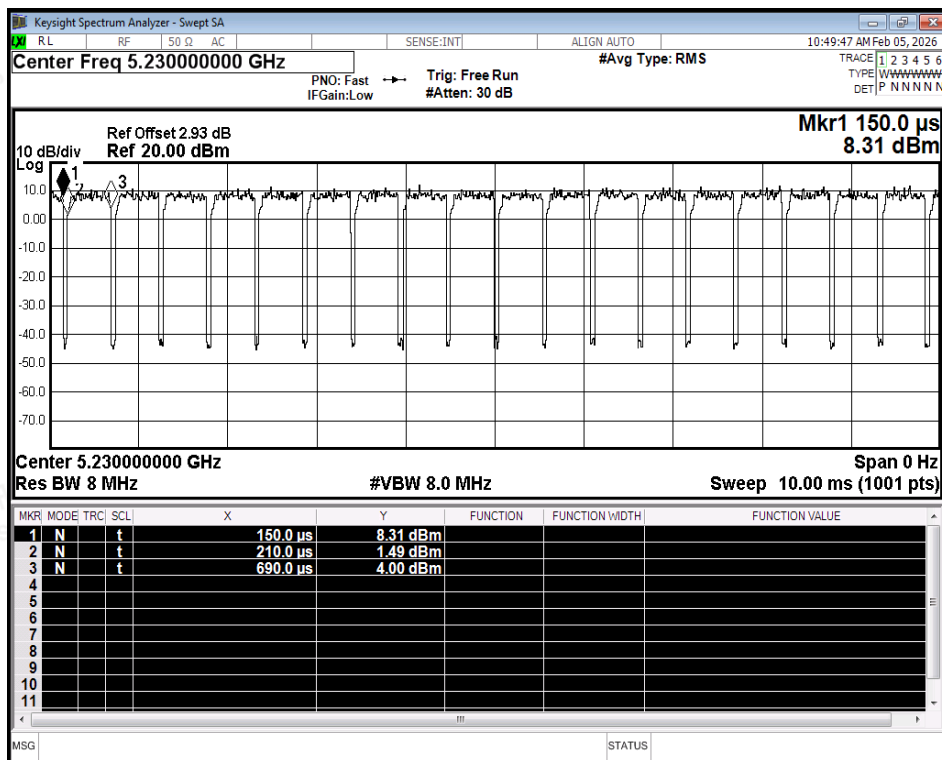

Duty Cycle NVNT ac40 5230MHz Ant1

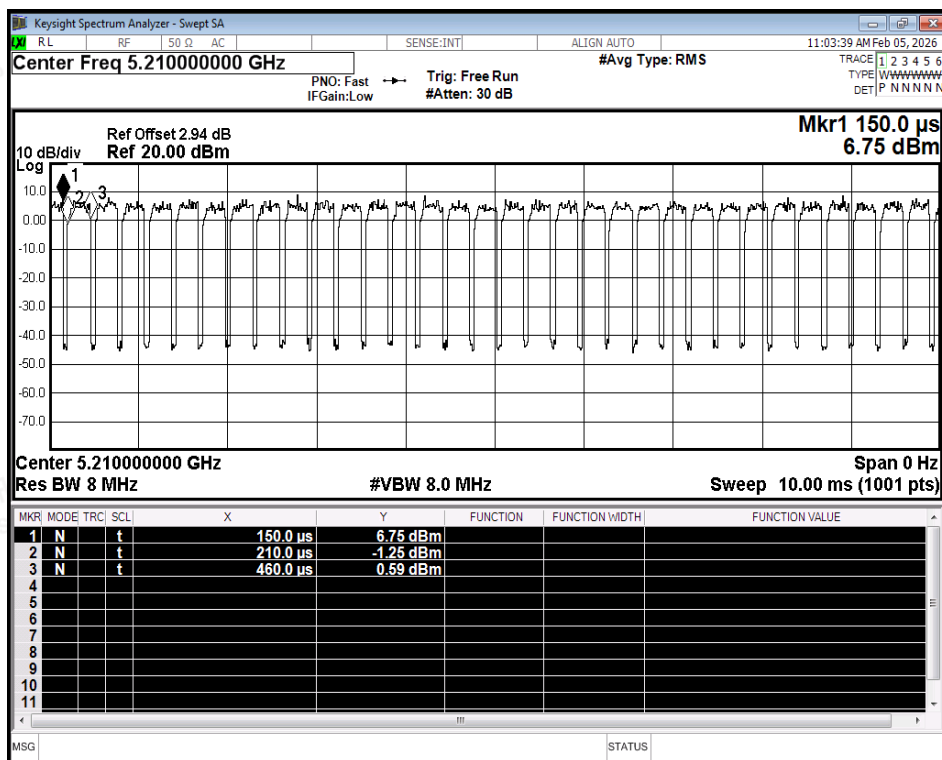

Duty Cycle NVNT ac80 5210MHz Ant1




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

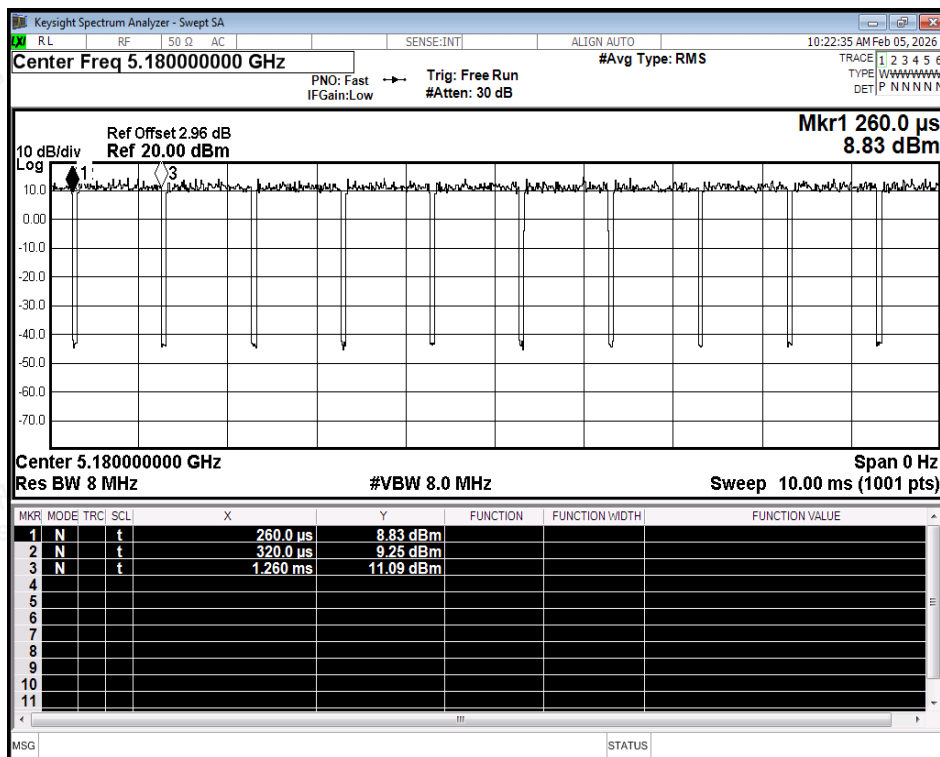

Duty Cycle NVNT ax20 5180MHz Ant1

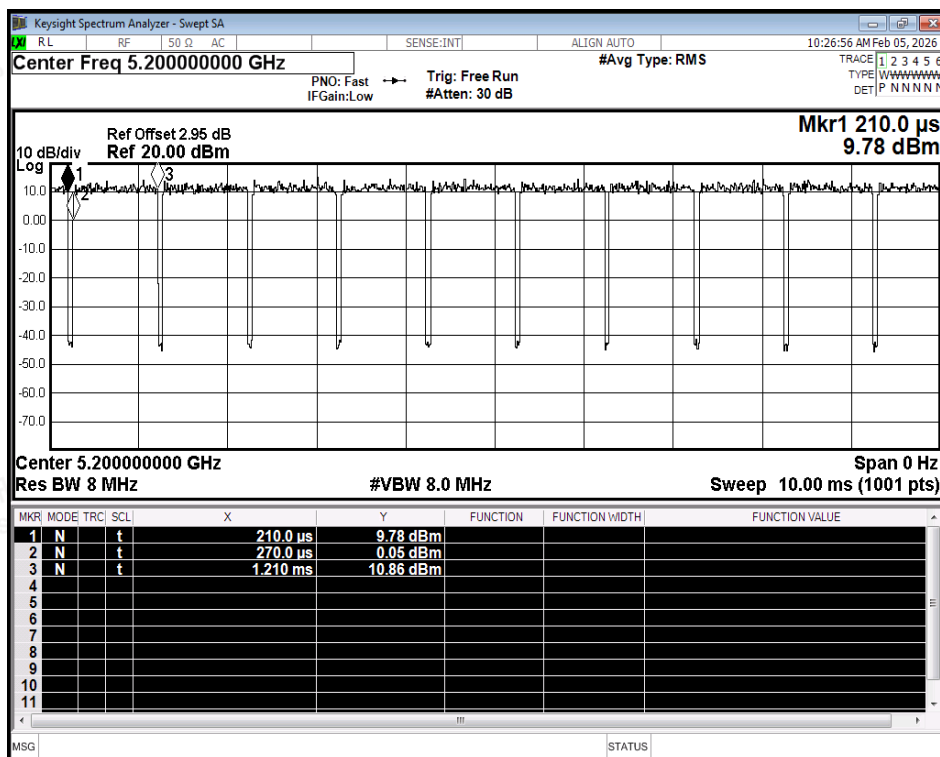

Duty Cycle NVNT ax20 5200MHz Ant1




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

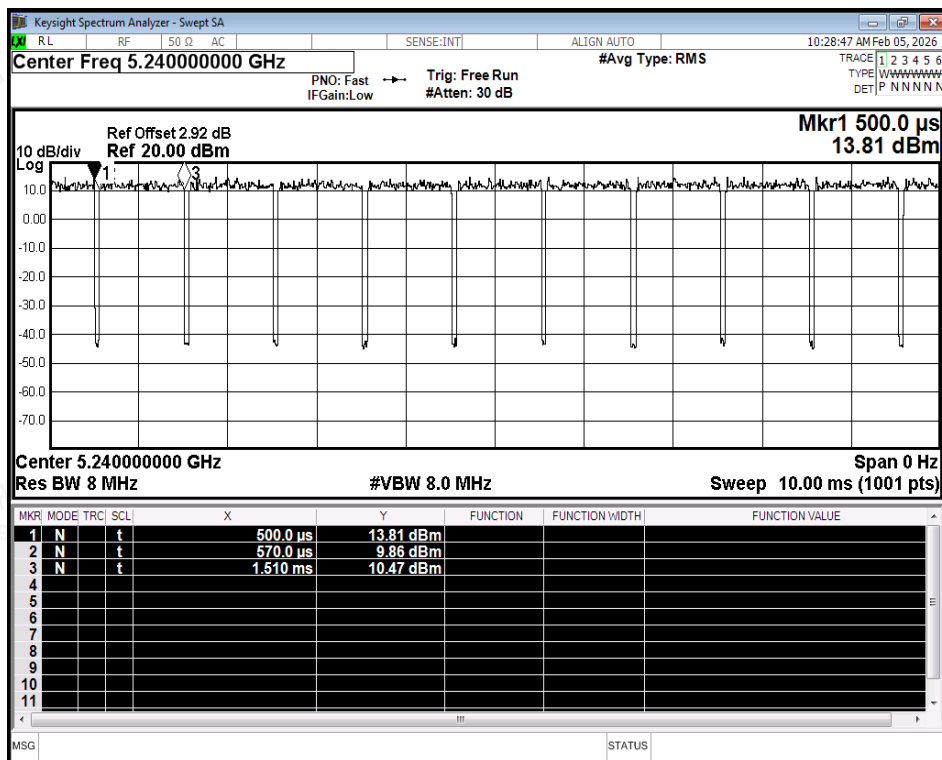

Duty Cycle NVNT ax20 5240MHz Ant1

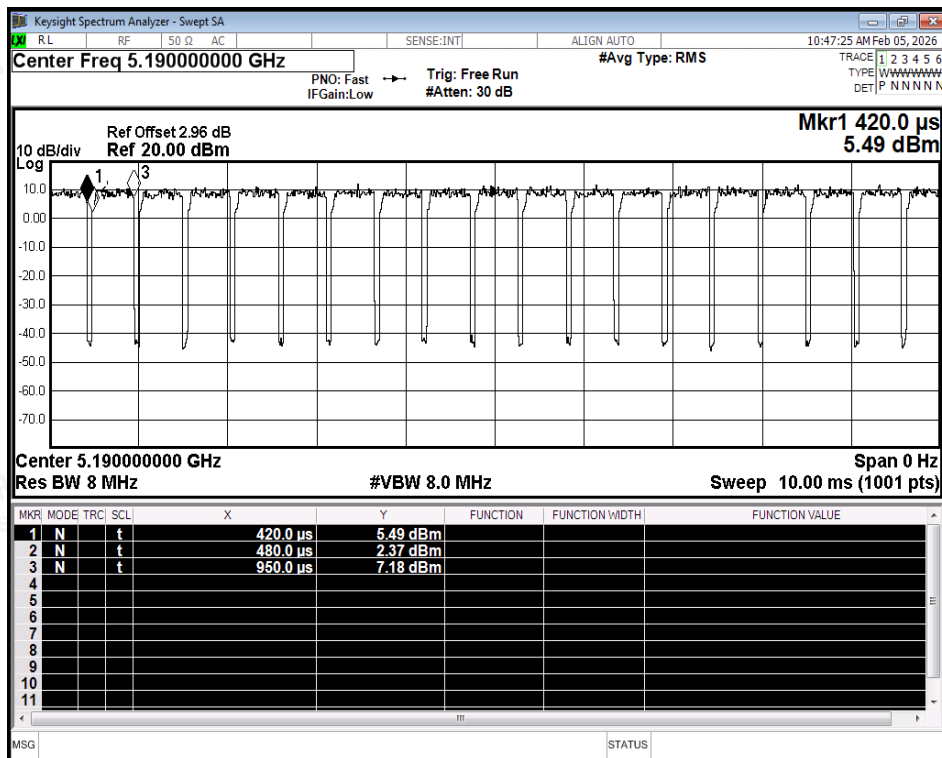

Duty Cycle NVNT ax40 5190MHz Ant1




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

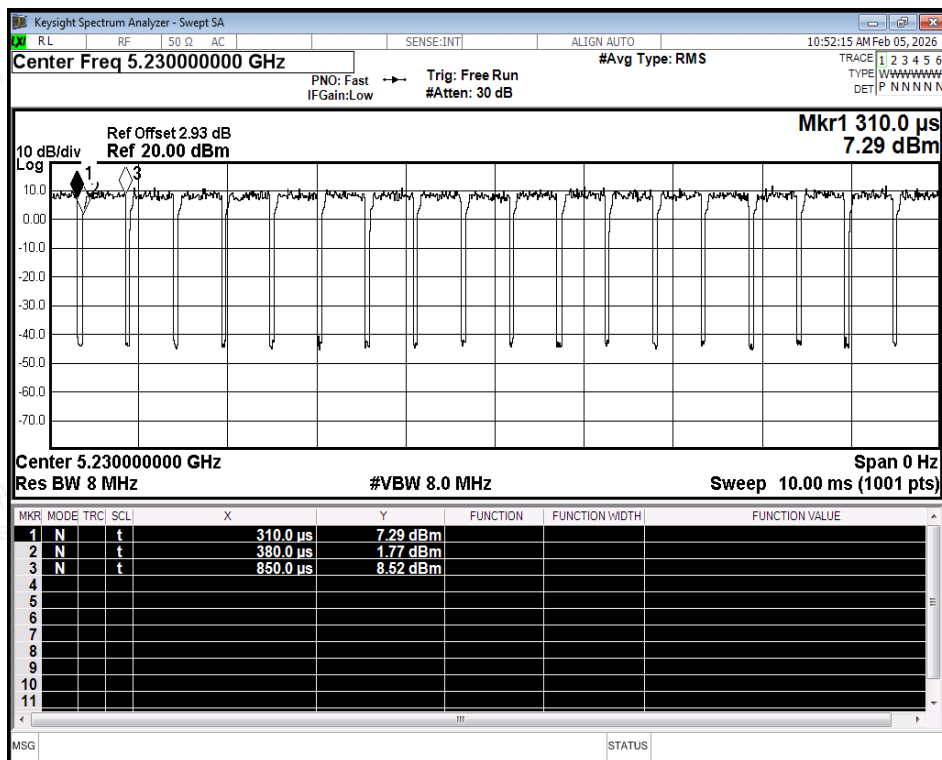

Duty Cycle NVNT ax40 5230MHz Ant1

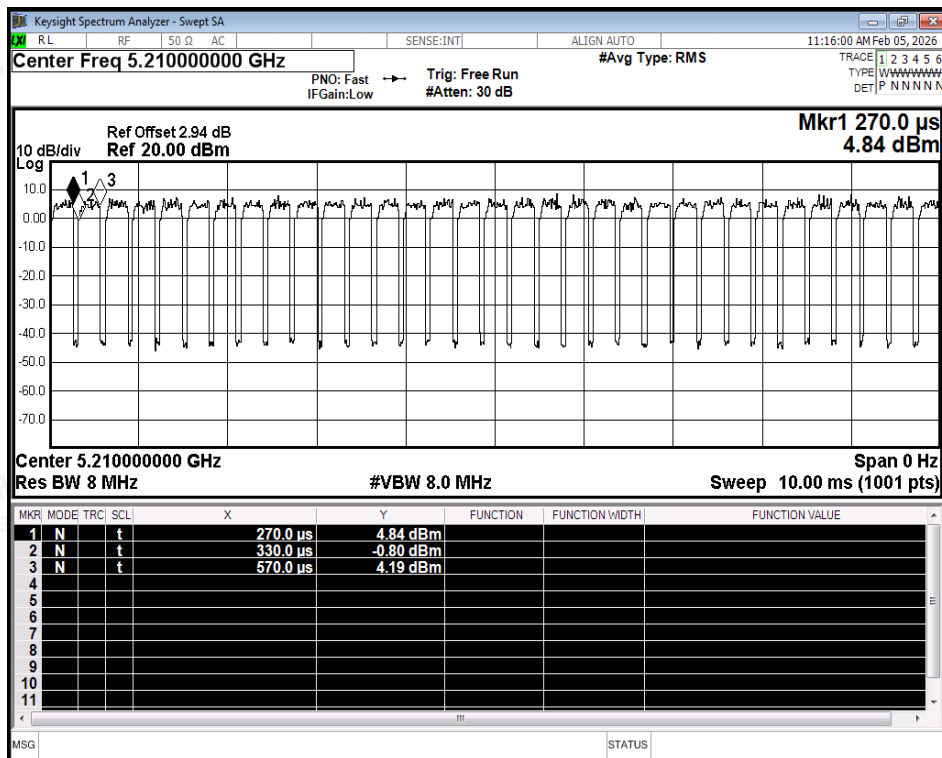

Duty Cycle NVNT ax80 5210MHz Ant1



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China


Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity




Condition	Mode	Frequency (MHz)	Antenna	Duty Cycle (%)	Correction Factor (dB)	1/T (kHz)
NVNT	a	5180	Ant2	97.47	0.11	0.37
NVNT	a	5200	Ant2	97.47	0.11	0.37
NVNT	a	5240	Ant2	97.47	0.11	0.37
NVNT	n20	5180	Ant2	96.17	0.17	0.44
NVNT	n20	5200	Ant2	97	0.13	0.44
NVNT	n20	5240	Ant2	96.58	0.15	0.44
NVNT	n40	5190	Ant2	93.22	0.3	0.91
NVNT	n40	5230	Ant2	94.07	0.27	0.9
NVNT	ac20	5180	Ant2	97.01	0.13	0.44
NVNT	ac20	5200	Ant2	97.01	0.13	0.44
NVNT	ac20	5240	Ant2	97.01	0.13	0.44
NVNT	ac40	5190	Ant2	94.07	0.27	0.9
NVNT	ac40	5230	Ant2	94.07	0.27	0.9
NVNT	ac80	5210	Ant2	88.52	0.53	1.85
NVNT	ax20	5180	Ant2	97.44	0.11	0.44
NVNT	ax20	5200	Ant2	97.01	0.13	0.44
NVNT	ax20	5240	Ant2	97.01	0.13	0.44
NVNT	ax40	5190	Ant2	94.07	0.27	0.9
NVNT	ax40	5230	Ant2	94.12	0.26	0.89
NVNT	ax80	5210	Ant2	88.52	0.53	1.85



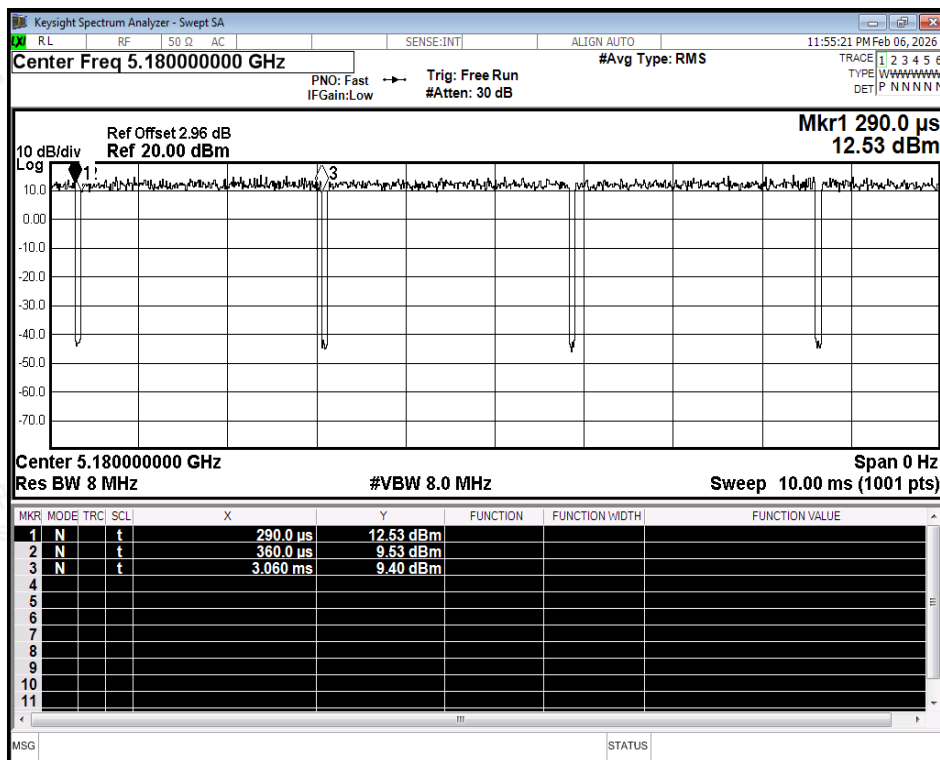

Duty Cycle NVNT a 5180MHz Ant2

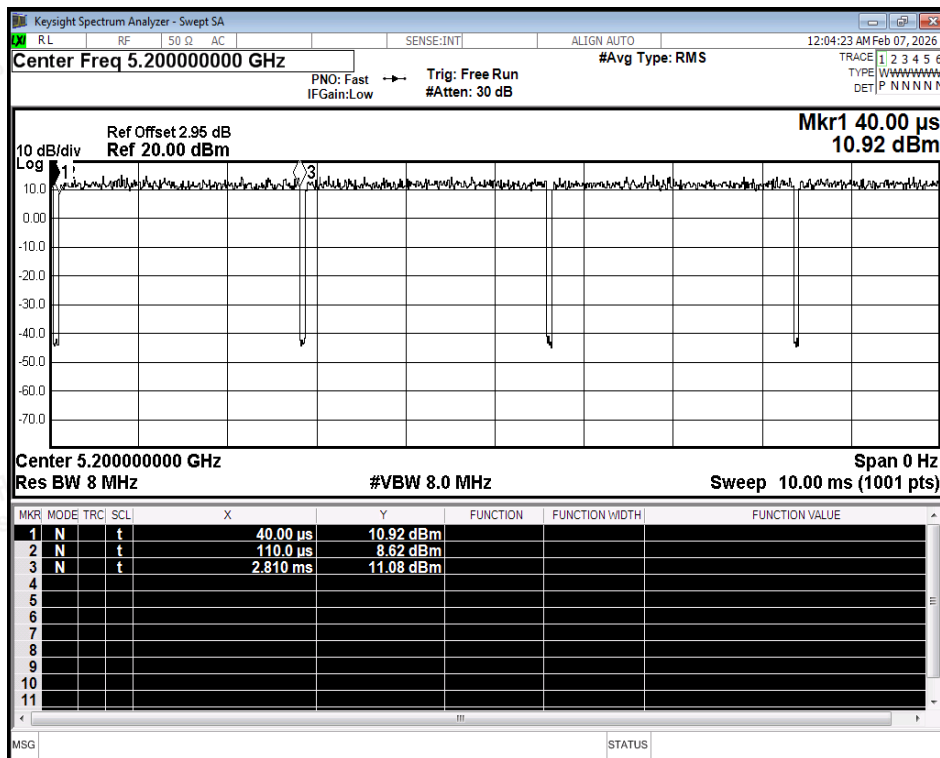

Duty Cycle NVNT a 5200MHz Ant2




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

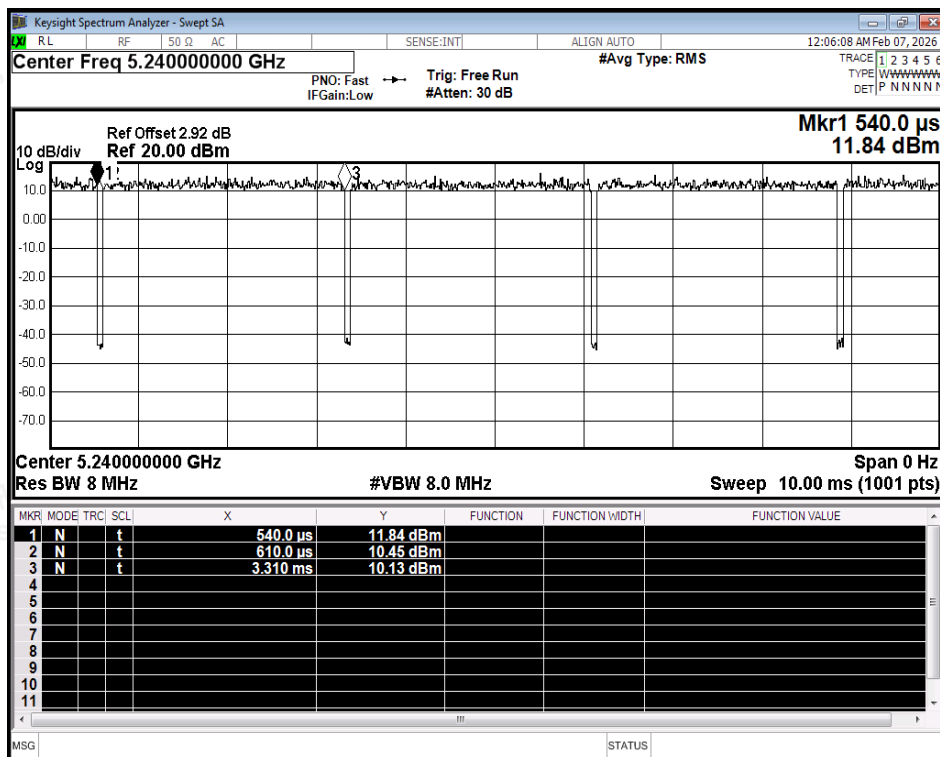

Duty Cycle NVNT a 5240MHz Ant2

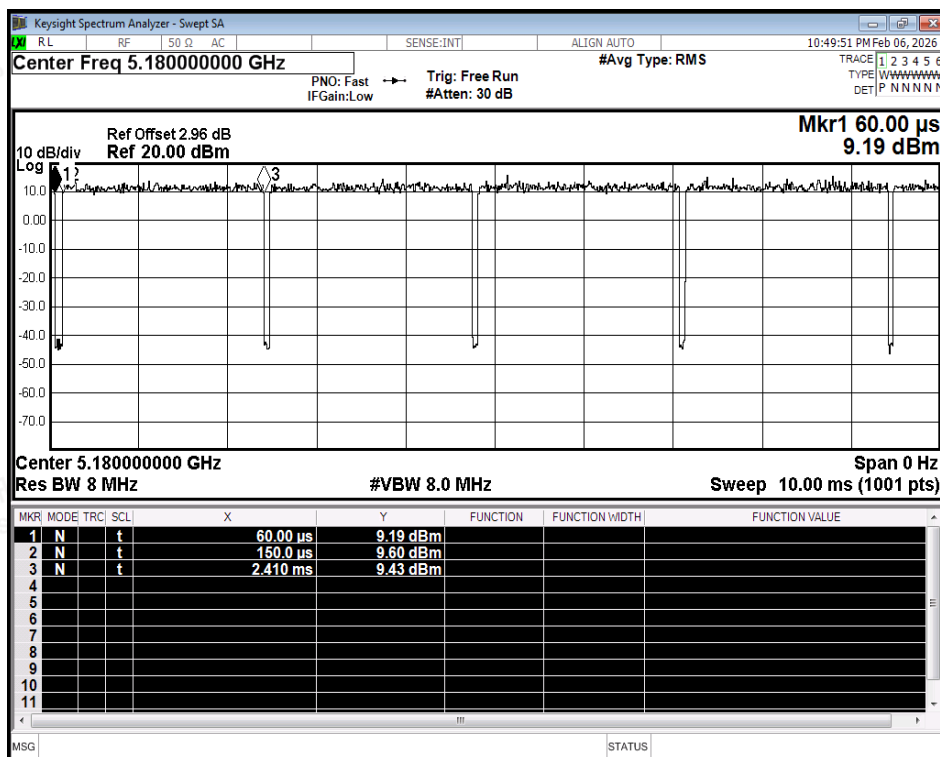

Duty Cycle NVNT n20 5180MHz Ant2




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

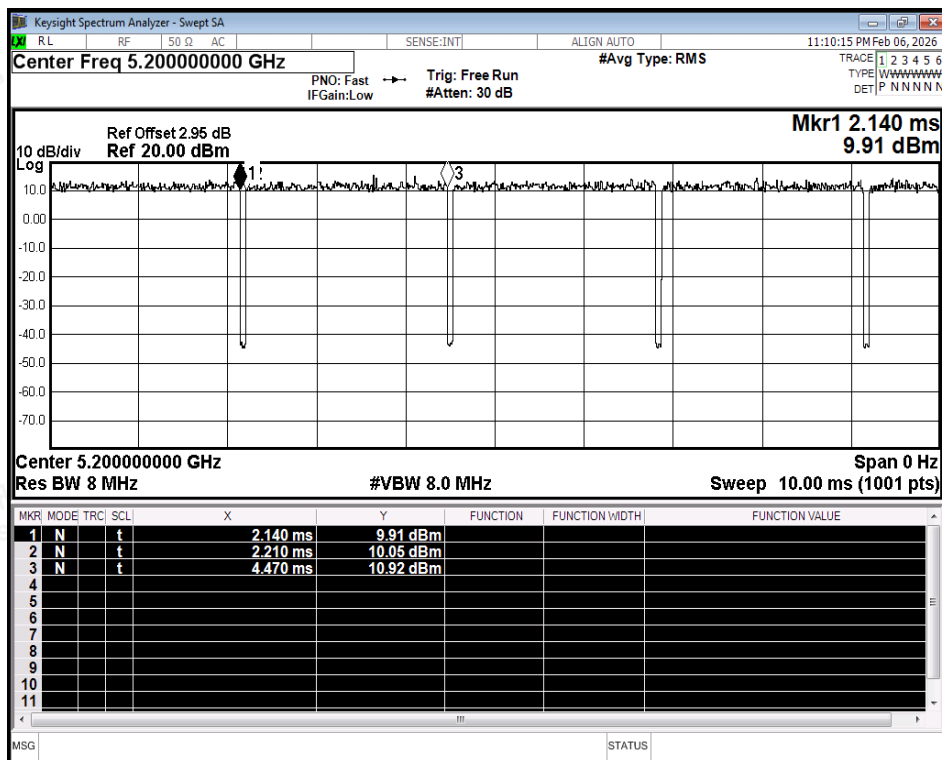


Duty Cycle NVNT n20 5200MHz Ant2

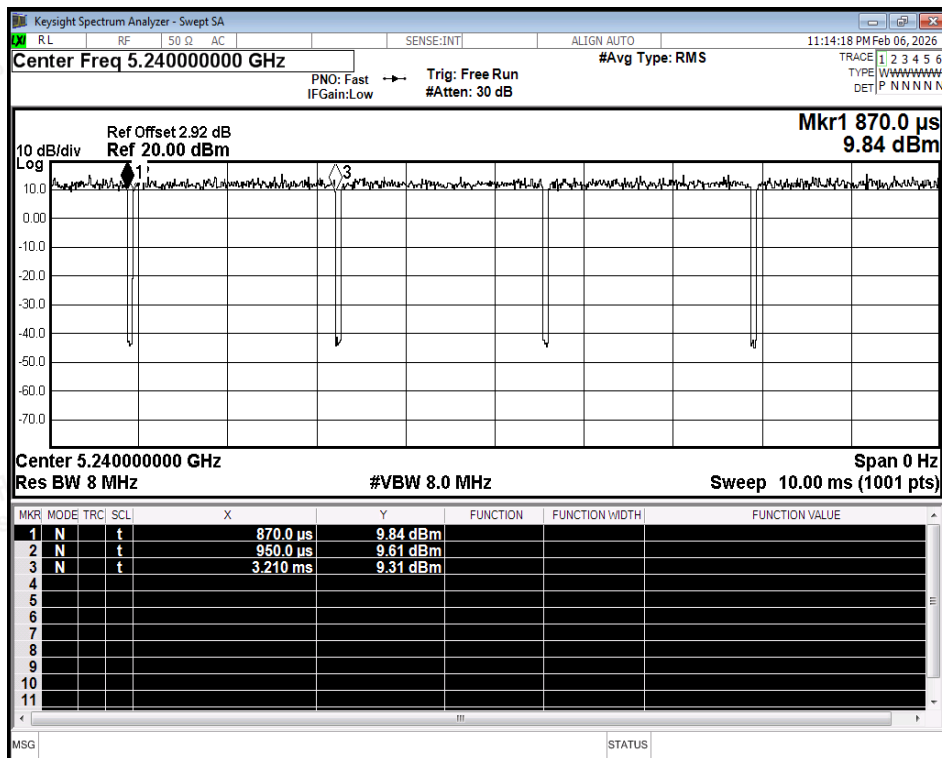


Duty Cycle NVNT n20 5240MHz Ant2



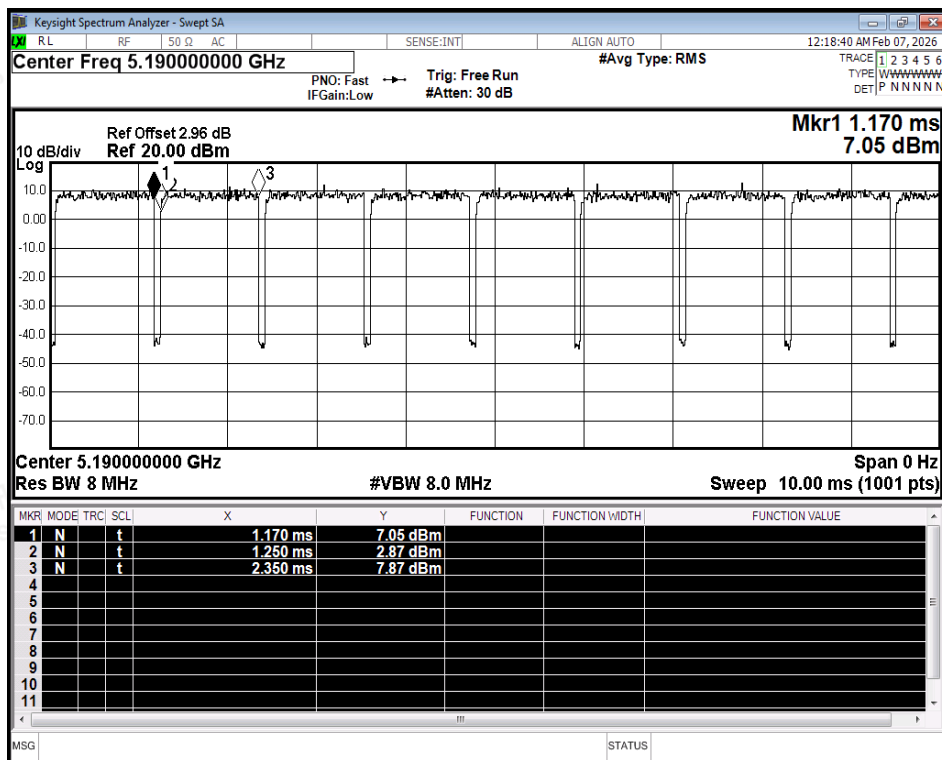

Duty Cycle NVNT n40 5190MHz Ant2

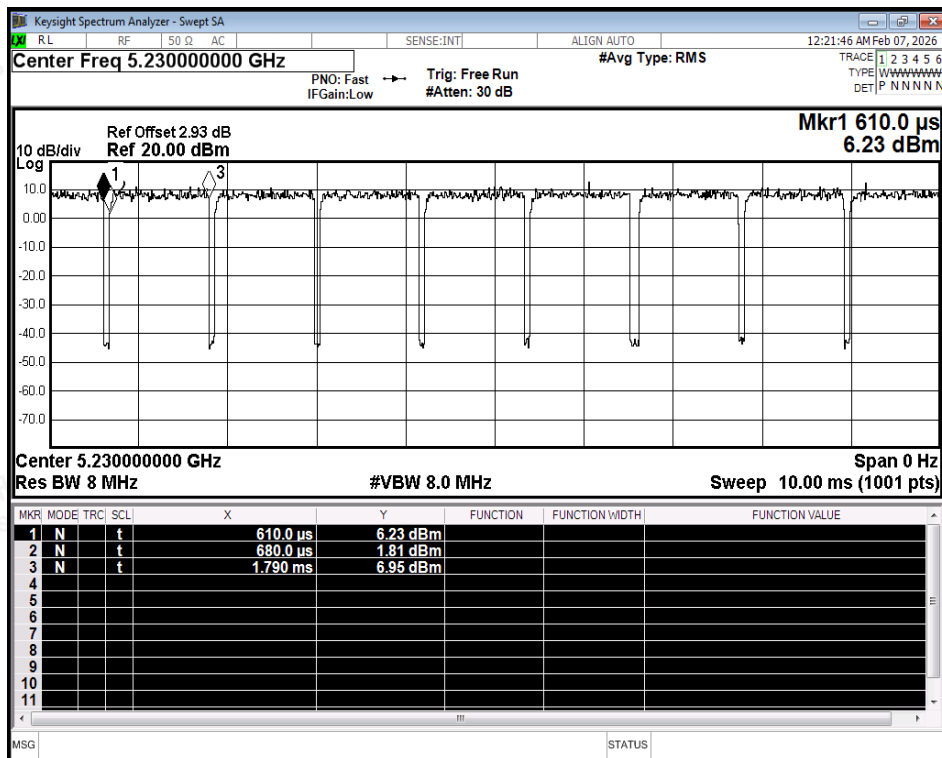

Duty Cycle NVNT n40 5230MHz Ant2




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

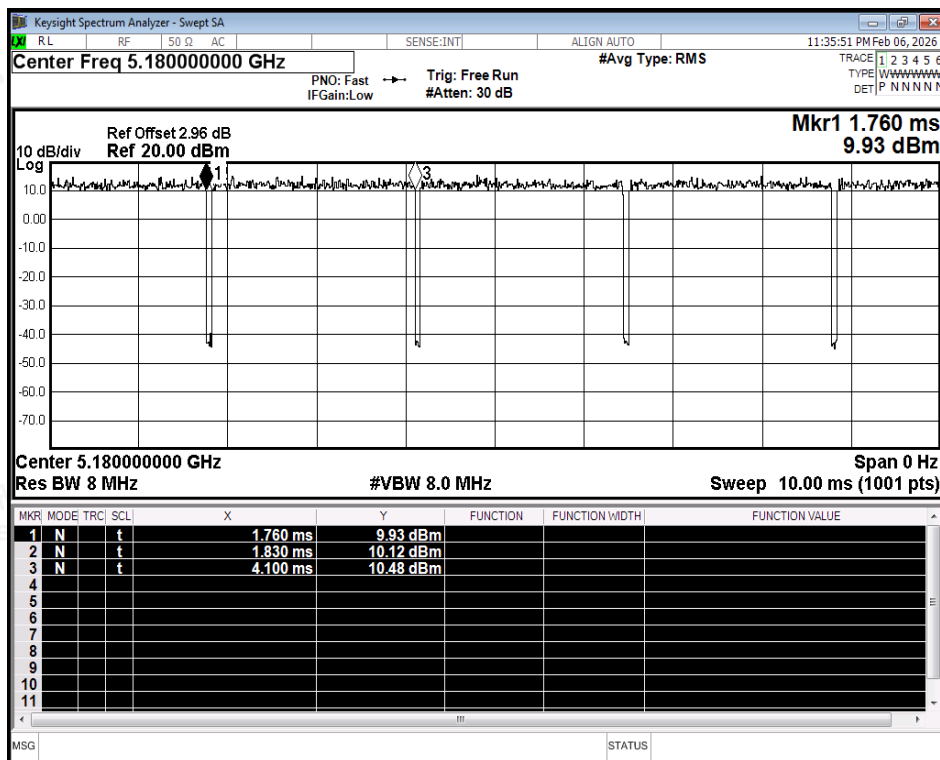

Duty Cycle NVNT ac20 5180MHz Ant2

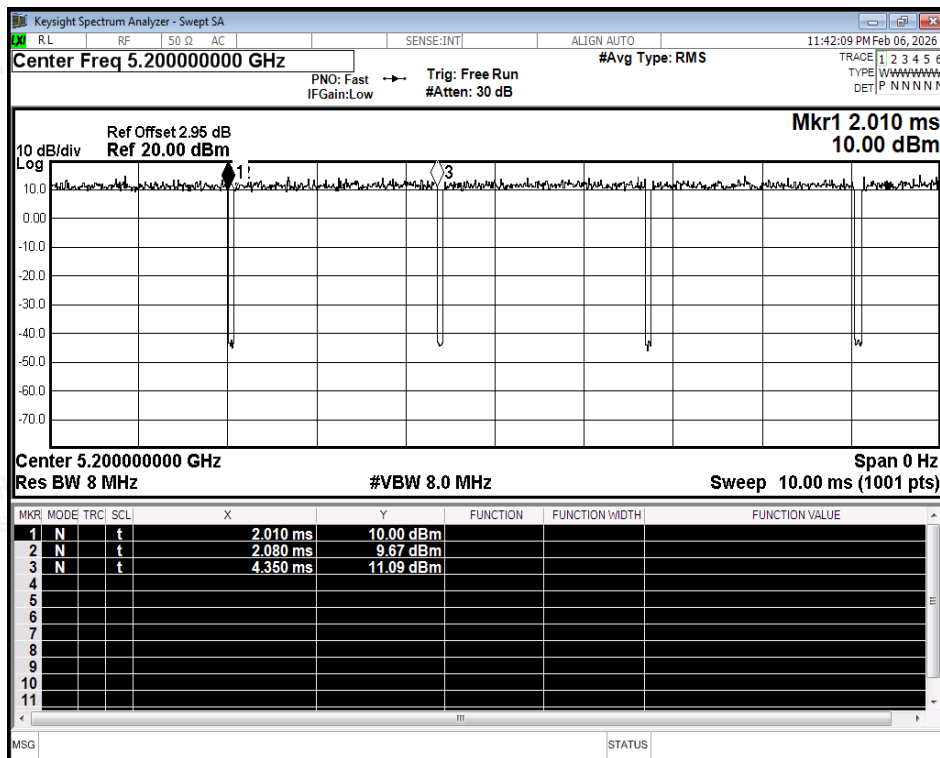

Duty Cycle NVNT ac20 5200MHz Ant2




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

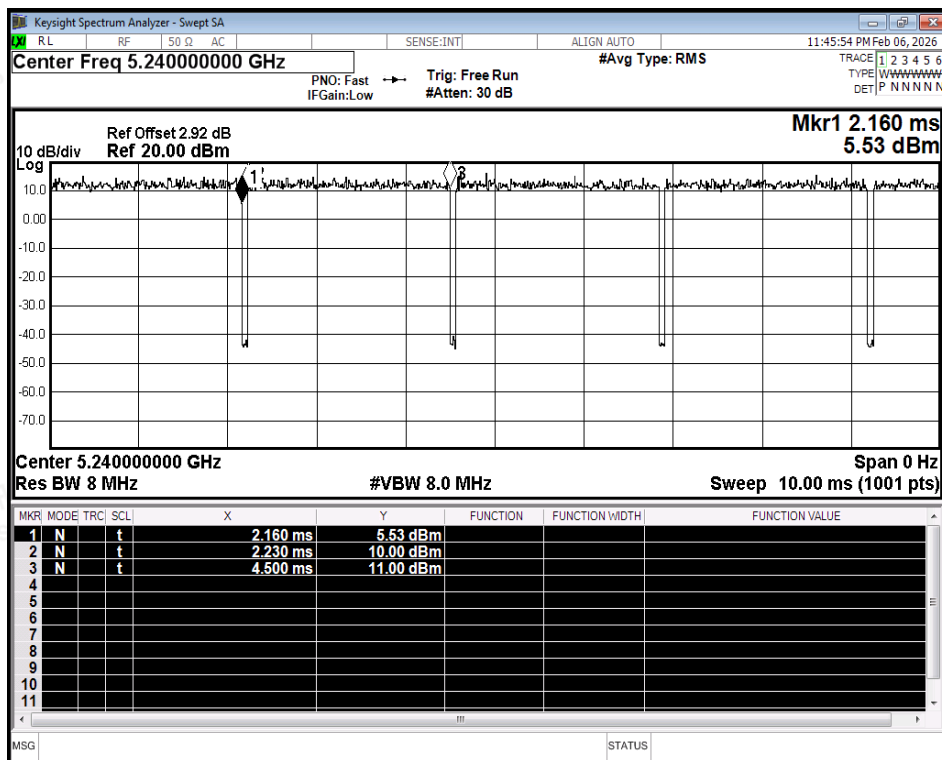

Duty Cycle NVNT ac20 5240MHz Ant2

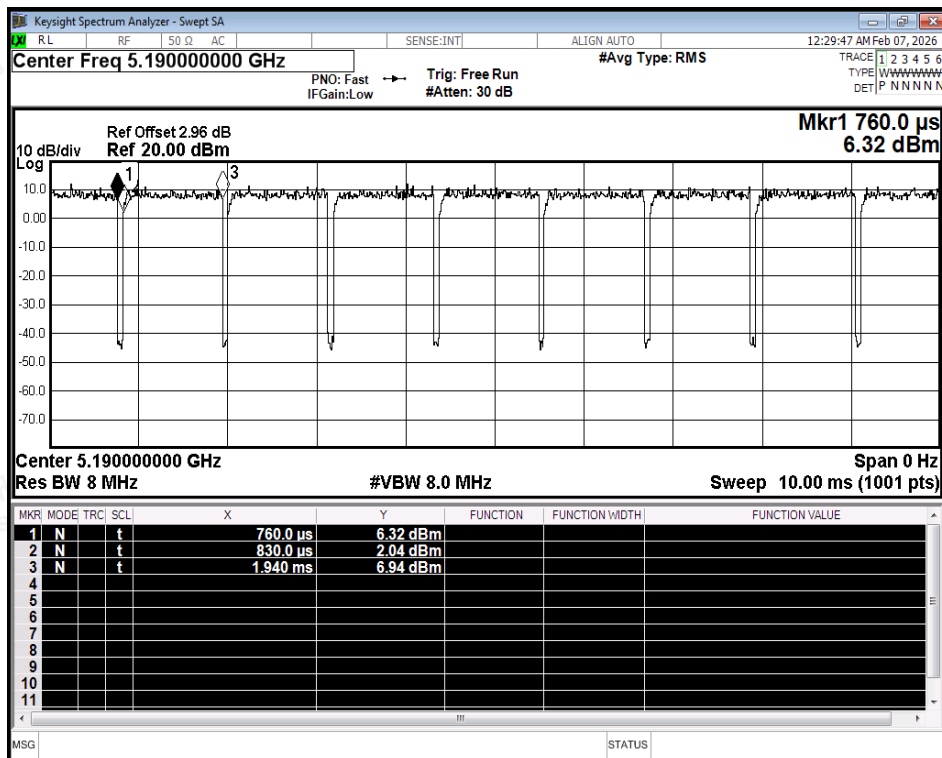

Duty Cycle NVNT ac40 5190MHz Ant2




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

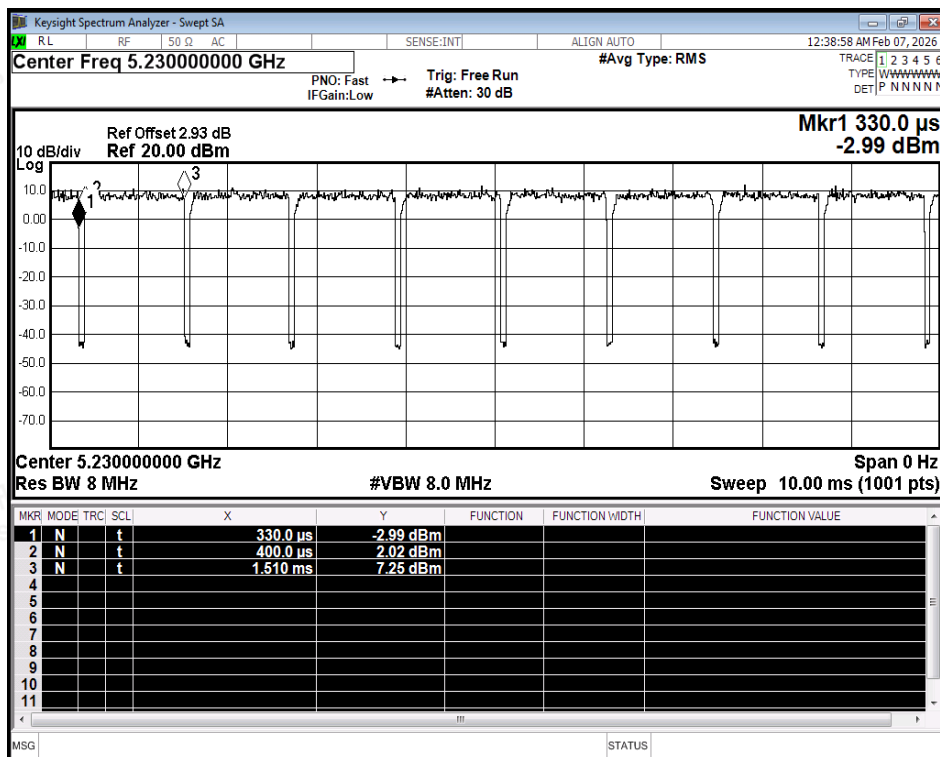

Duty Cycle NVNT ac40 5230MHz Ant2

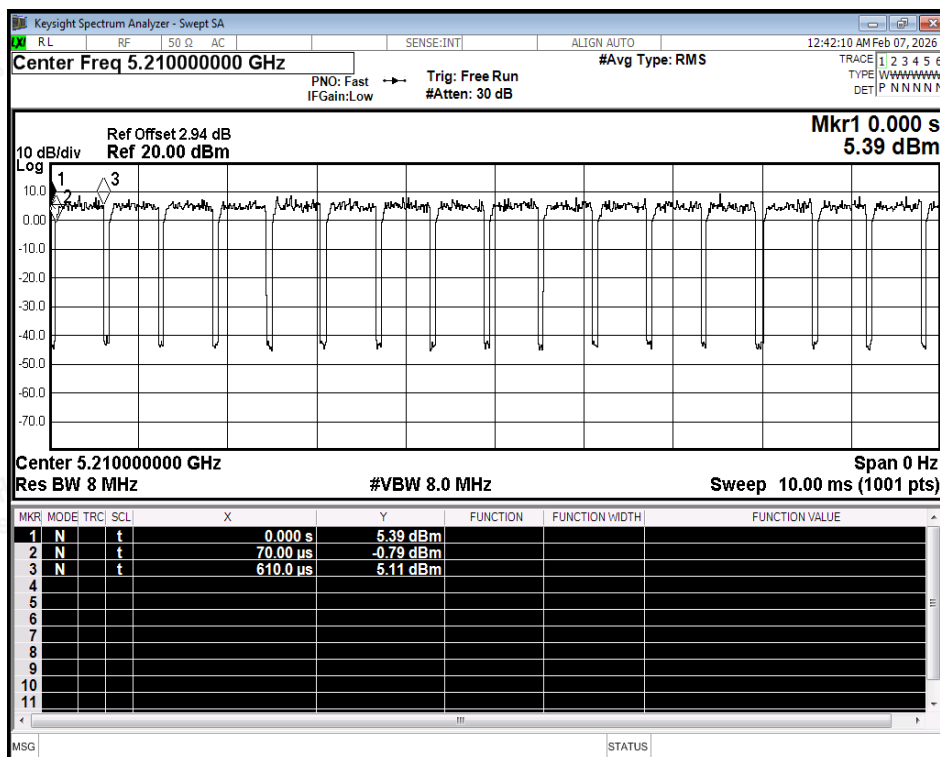

Duty Cycle NVNT ac80 5210MHz Ant2




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

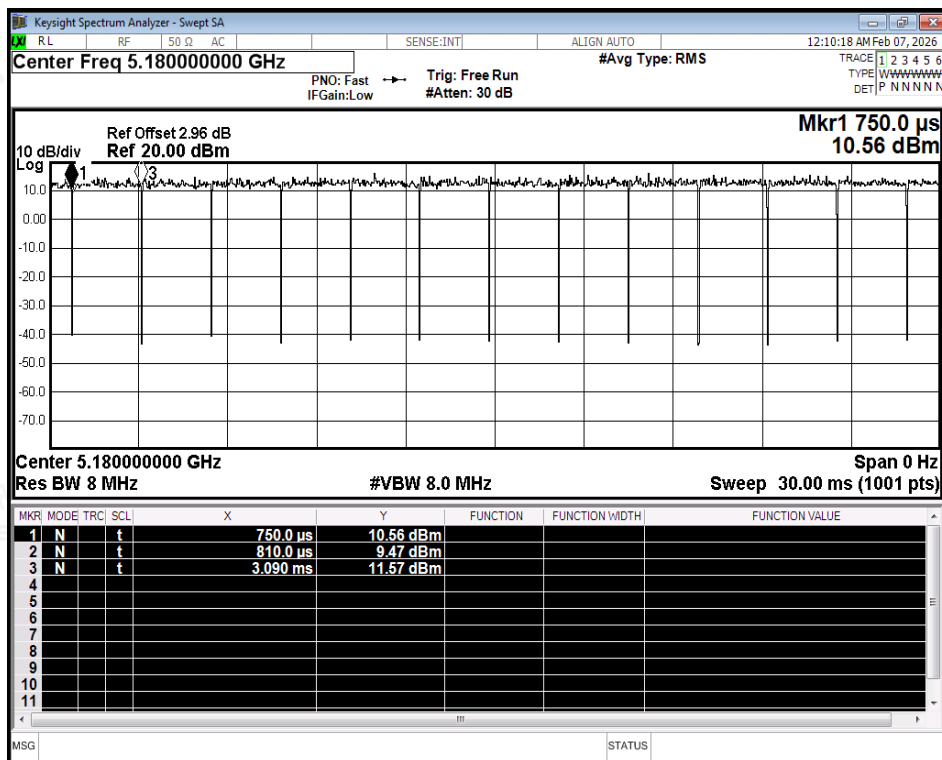

Duty Cycle NVNT ax20 5180MHz Ant2

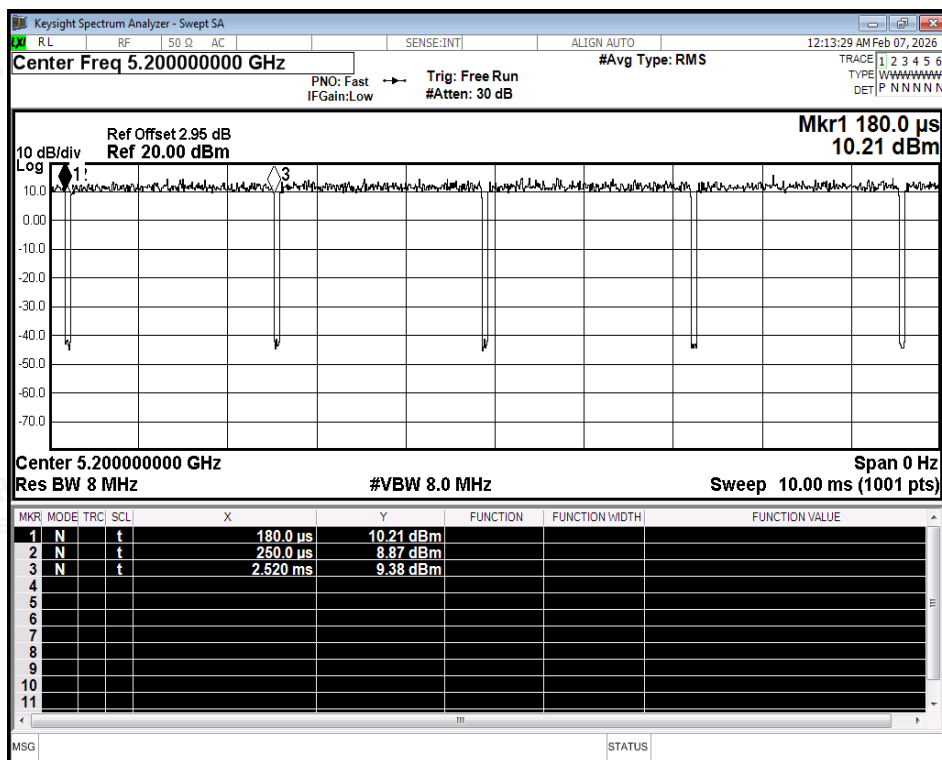

Duty Cycle NVNT ax20 5200MHz Ant2




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

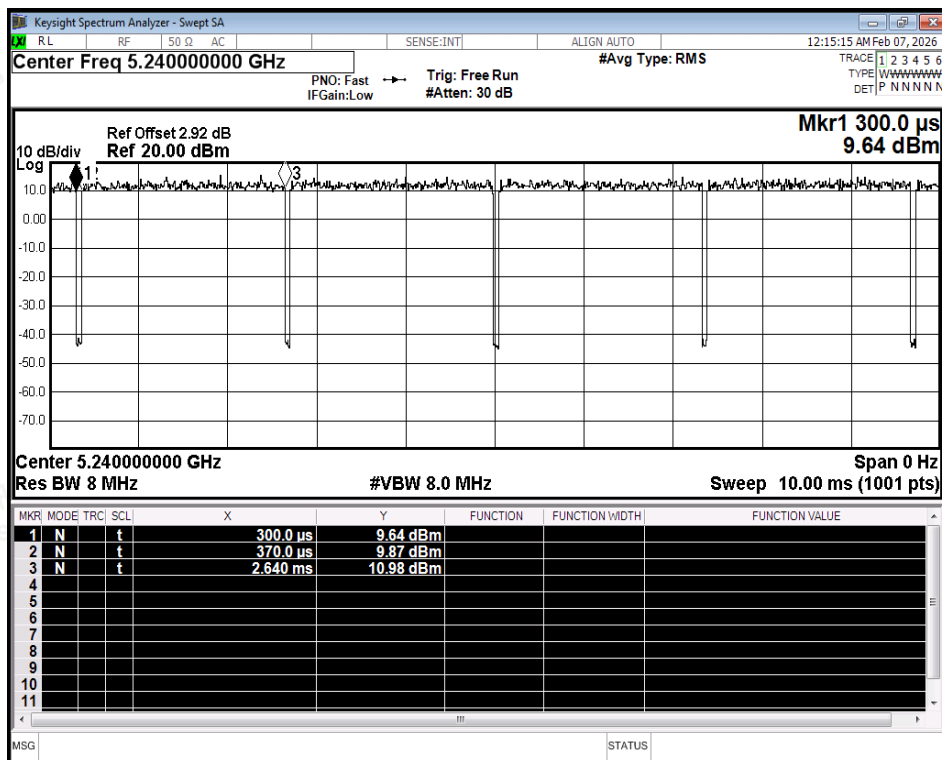

Duty Cycle NVNT ax20 5240MHz Ant2

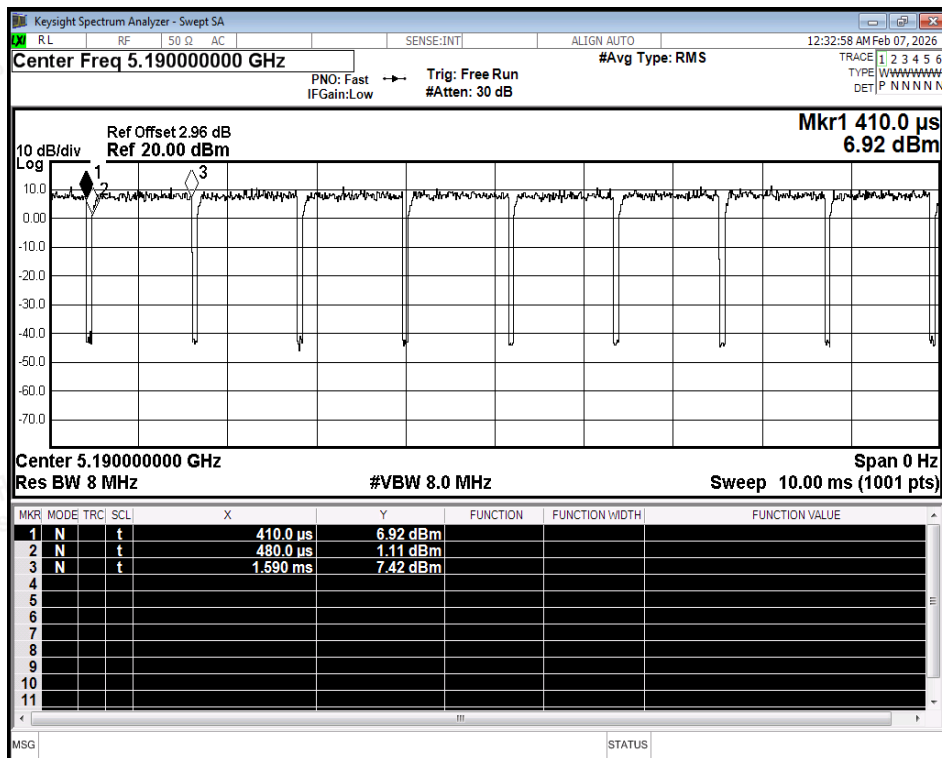

Duty Cycle NVNT ax40 5190MHz Ant2




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

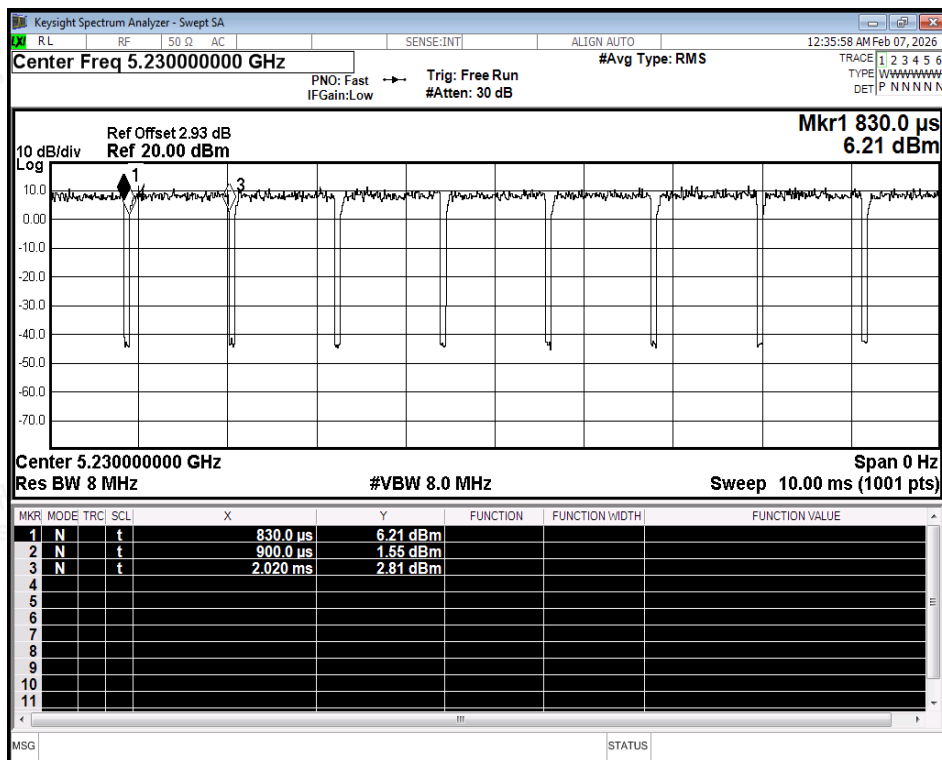

Duty Cycle NVNT ax40 5230MHz Ant2

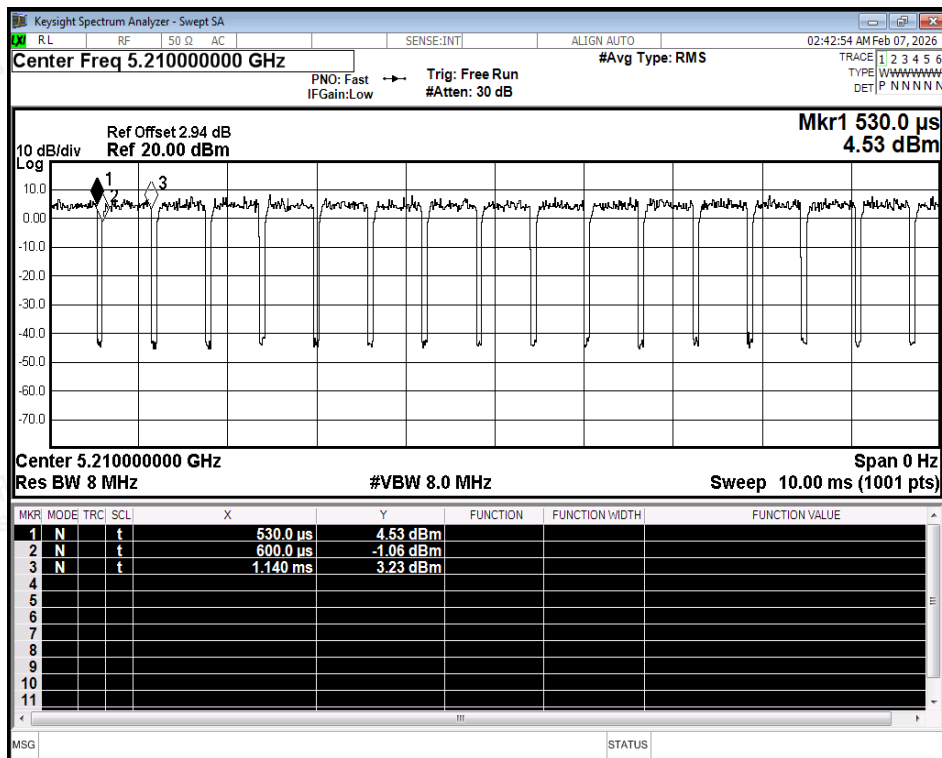

Duty Cycle NVNT ax80 5210MHz Ant2

