



## Appendix C

### RF Test Data for 5.5GWIFI (Conducted Measurement)

**Product Name: Wireless zoom transmitter**

**Test Model: WVTM**

#### Environmental Conditions

|                    |           |
|--------------------|-----------|
| Temperature:       | 23.7°C    |
| Relative Humidity: | 54.2%     |
| ATM Pressure:      | 100.0 kPa |
| Test Engineer:     | Jerry Chu |
| Supervised by:     | Can Kun   |



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: [webmaster@lcs-cert.com](mailto:webmaster@lcs-cert.com) | Web: [www.lcs-cert.com](http://www.lcs-cert.com)

Scan code to check authenticity



## C.1 -26dB Bandwidth

| Condition | Mode | Frequency (MHz) | Antenna | -26 dB Bandwidth (MHz) |
|-----------|------|-----------------|---------|------------------------|
| NVNT      | a    | 5500            | Ant1    | 29.15                  |
| NVNT      | a    | 5580            | Ant1    | 27.23                  |
| NVNT      | a    | 5700            | Ant1    | 27.79                  |
| NVNT      | n20  | 5500            | Ant1    | 29.29                  |
| NVNT      | n20  | 5580            | Ant1    | 29.39                  |
| NVNT      | n20  | 5700            | Ant1    | 29.3                   |
| NVNT      | n40  | 5510            | Ant1    | 48.23                  |
| NVNT      | n40  | 5550            | Ant1    | 47.41                  |
| NVNT      | n40  | 5670            | Ant1    | 51.24                  |
| NVNT      | ac20 | 5500            | Ant1    | 29.9                   |
| NVNT      | ac20 | 5580            | Ant1    | 29.15                  |
| NVNT      | ac20 | 5700            | Ant1    | 28.49                  |
| NVNT      | ac40 | 5510            | Ant1    | 48.8                   |
| NVNT      | ac40 | 5550            | Ant1    | 52.42                  |
| NVNT      | ac40 | 5670            | Ant1    | 46.24                  |
| NVNT      | ac80 | 5530            | Ant1    | 96.27                  |
| NVNT      | ac80 | 5610            | Ant1    | 92.66                  |
| NVNT      | ax20 | 5500            | Ant1    | 29.49                  |
| NVNT      | ax20 | 5580            | Ant1    | 29.29                  |
| NVNT      | ax20 | 5700            | Ant1    | 28.81                  |
| NVNT      | ax40 | 5510            | Ant1    | 46.6                   |
| NVNT      | ax40 | 5550            | Ant1    | 49.67                  |
| NVNT      | ax40 | 5670            | Ant1    | 49.12                  |
| NVNT      | ax80 | 5530            | Ant1    | 89.42                  |
| NVNT      | ax80 | 5610            | Ant1    | 90.24                  |




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: [webmaster@lcs-cert.com](mailto:webmaster@lcs-cert.com) | Web: [www.lcs-cert.com](http://www.lcs-cert.com)

Scan code to check authenticity

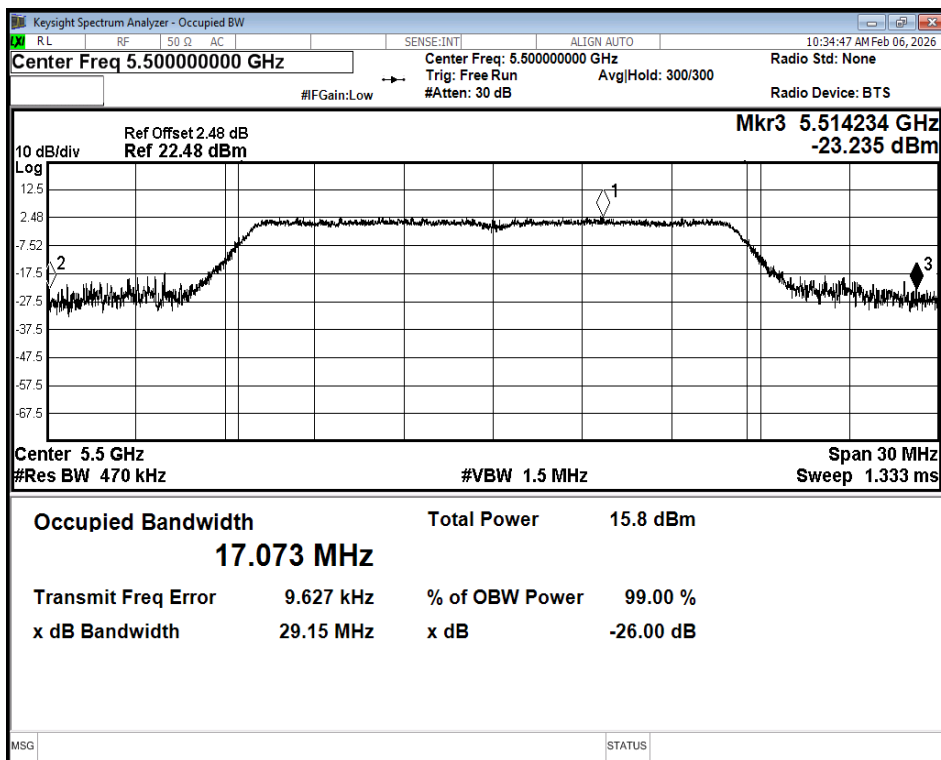

-26dB Bandwidth NVNT a 5500MHz Ant1

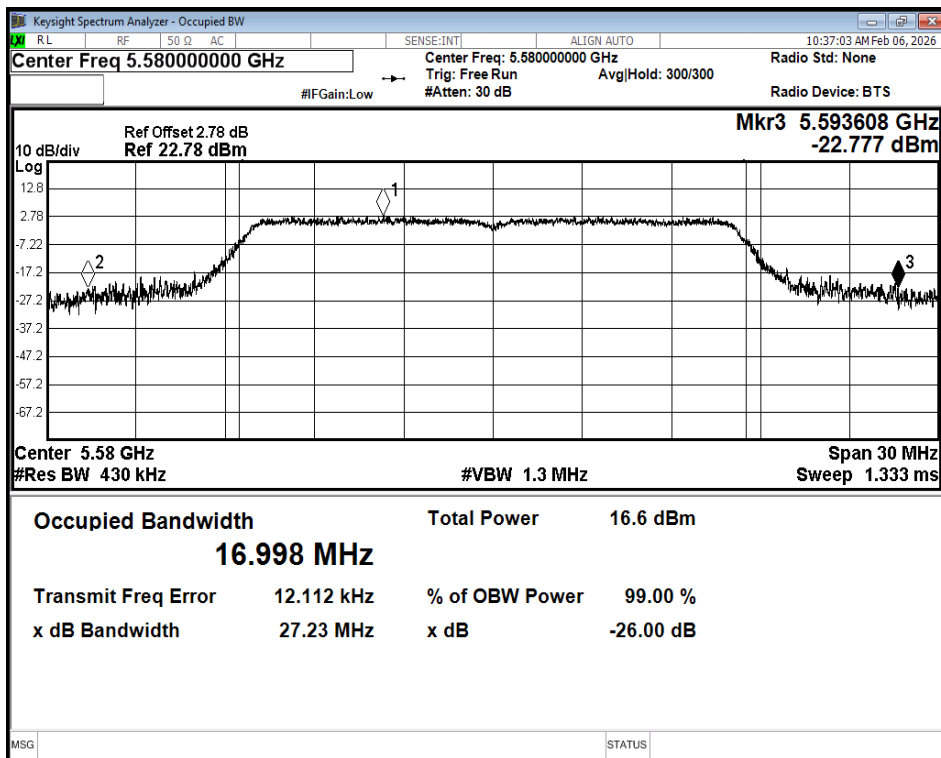

-26dB Bandwidth NVNT a 5580MHz Ant1




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

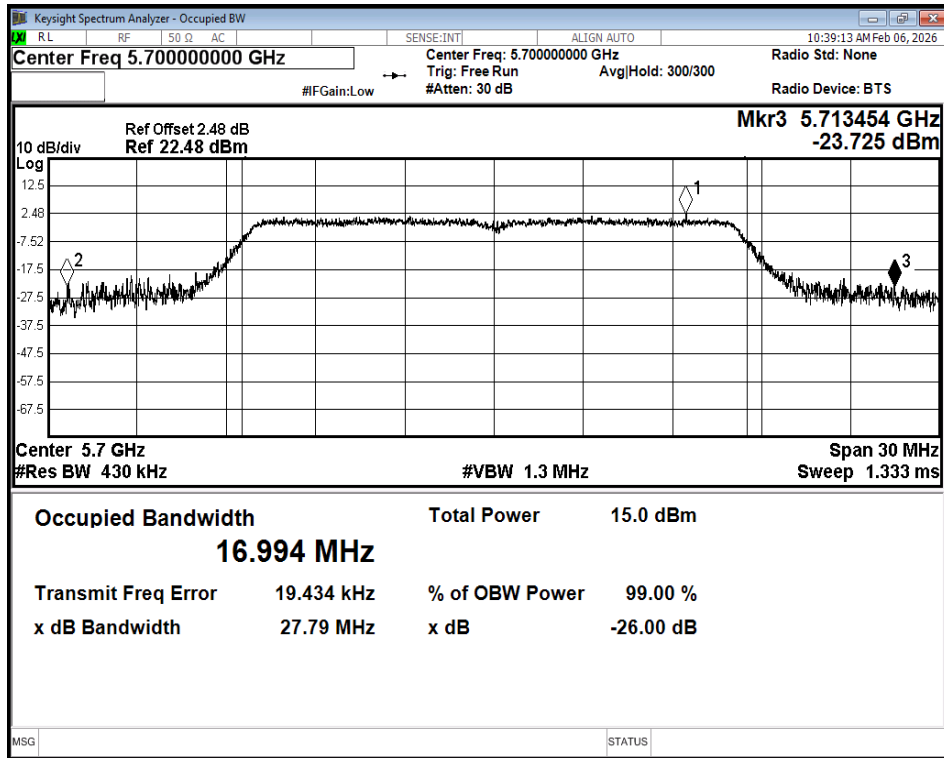

-26dB Bandwidth NVNT a 5700MHz Ant1

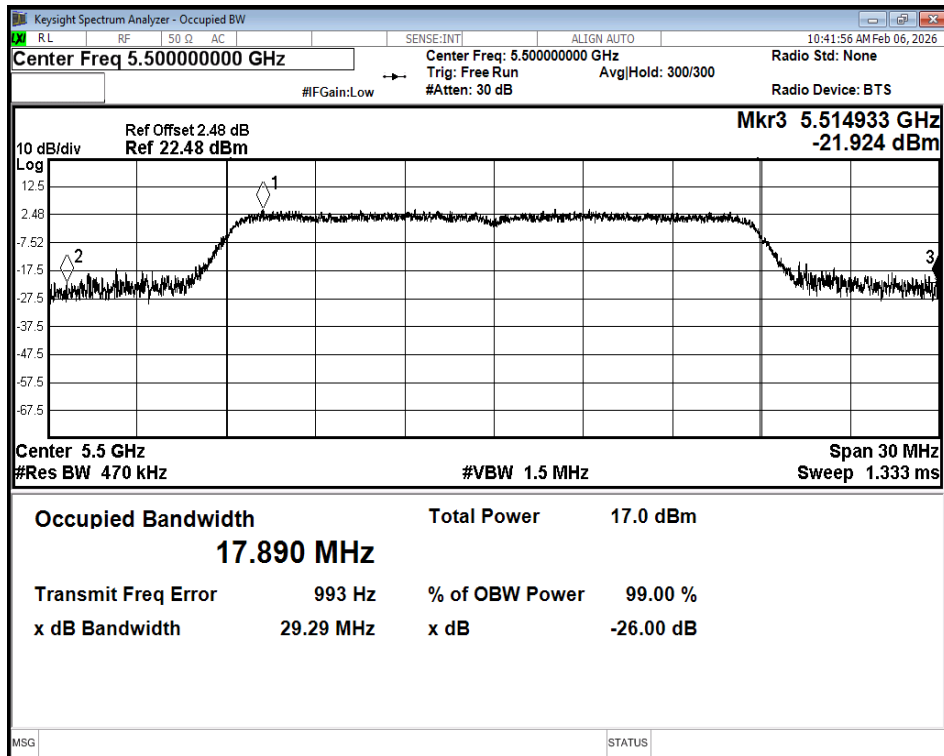

-26dB Bandwidth NVNT n20 5500MHz Ant1




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A &amp; 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

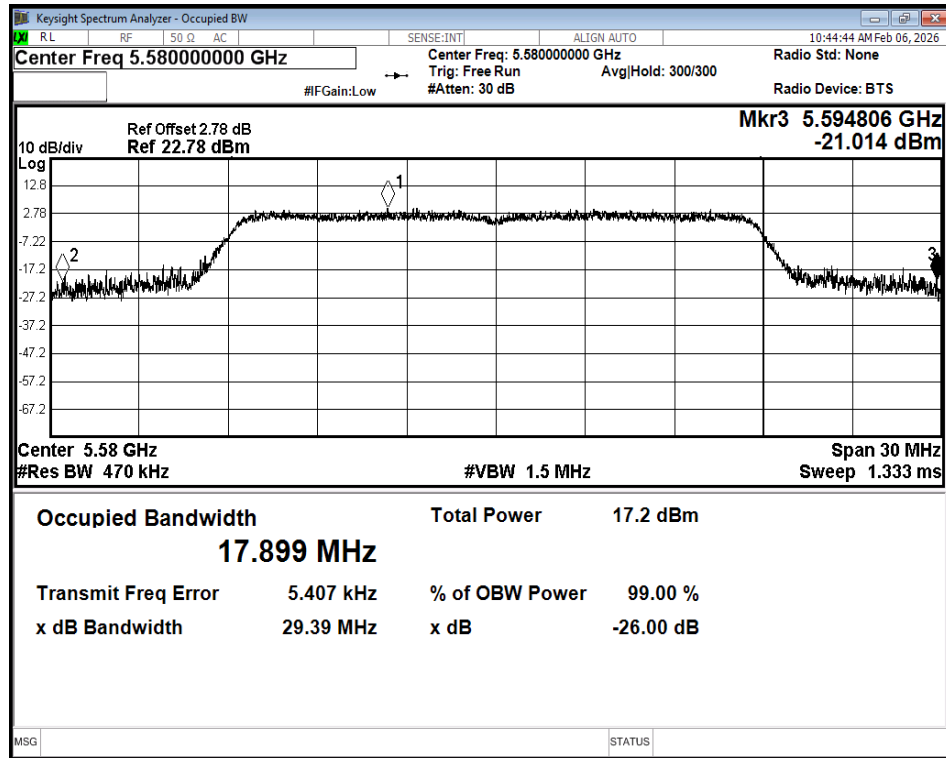

-26dB Bandwidth NVNT n20 5580MHz Ant1

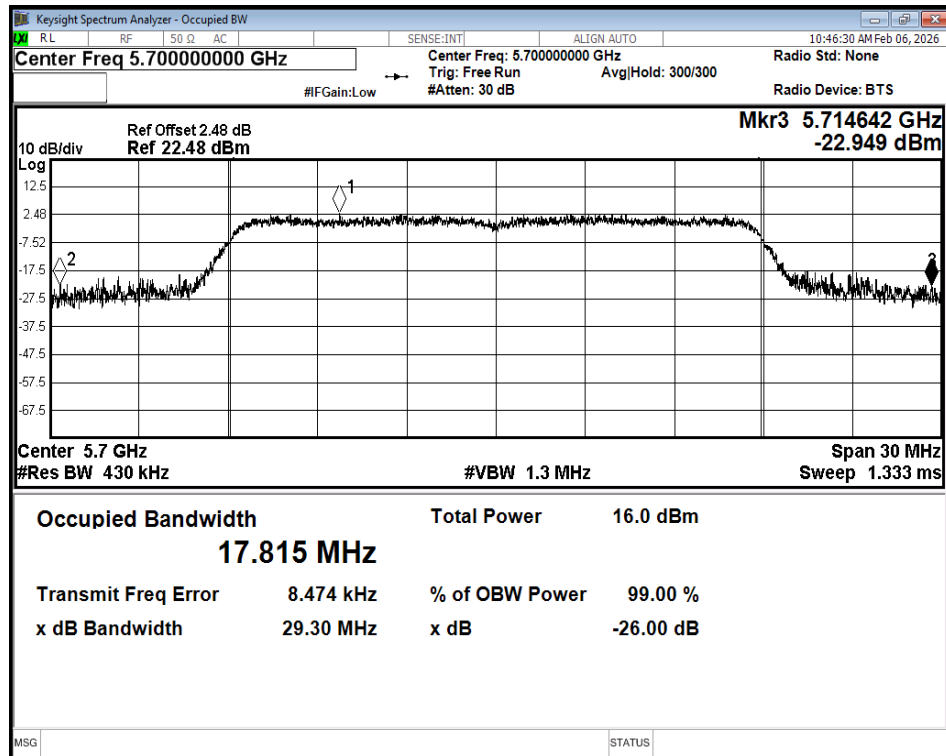

-26dB Bandwidth NVNT n20 5700MHz Ant1




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: [webmaster@lcs-cert.com](mailto:webmaster@lcs-cert.com) | Web: [www.lcs-cert.com](http://www.lcs-cert.com)

Scan code to check authenticity

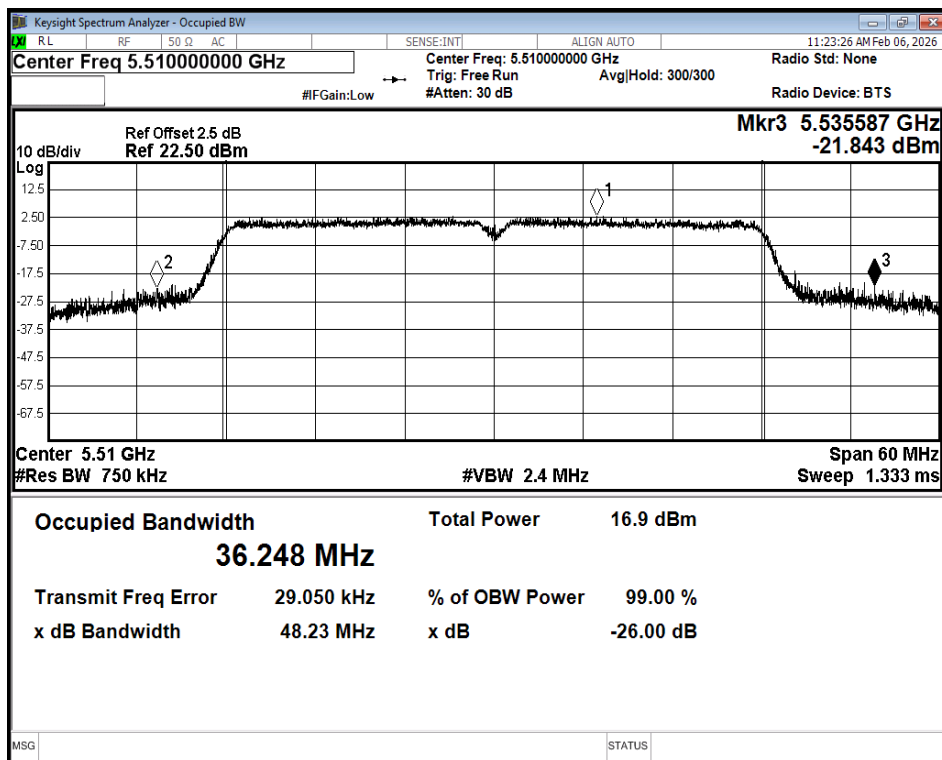

-26dB Bandwidth NVNT n40 5510MHz Ant1

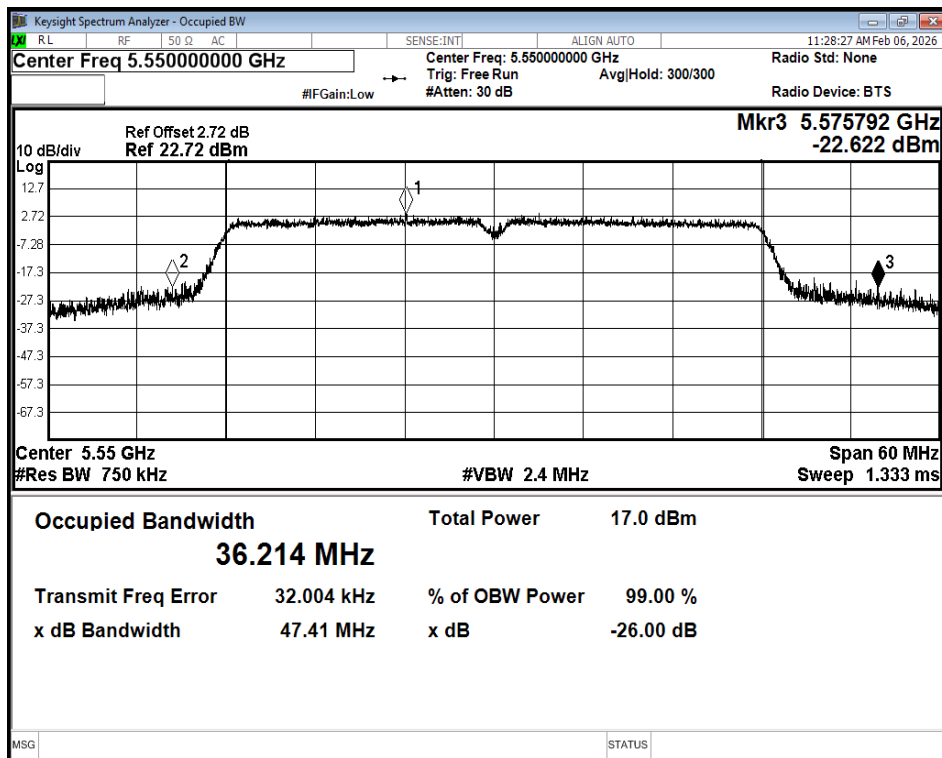

-26dB Bandwidth NVNT n40 5550MHz Ant1




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A &amp; 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

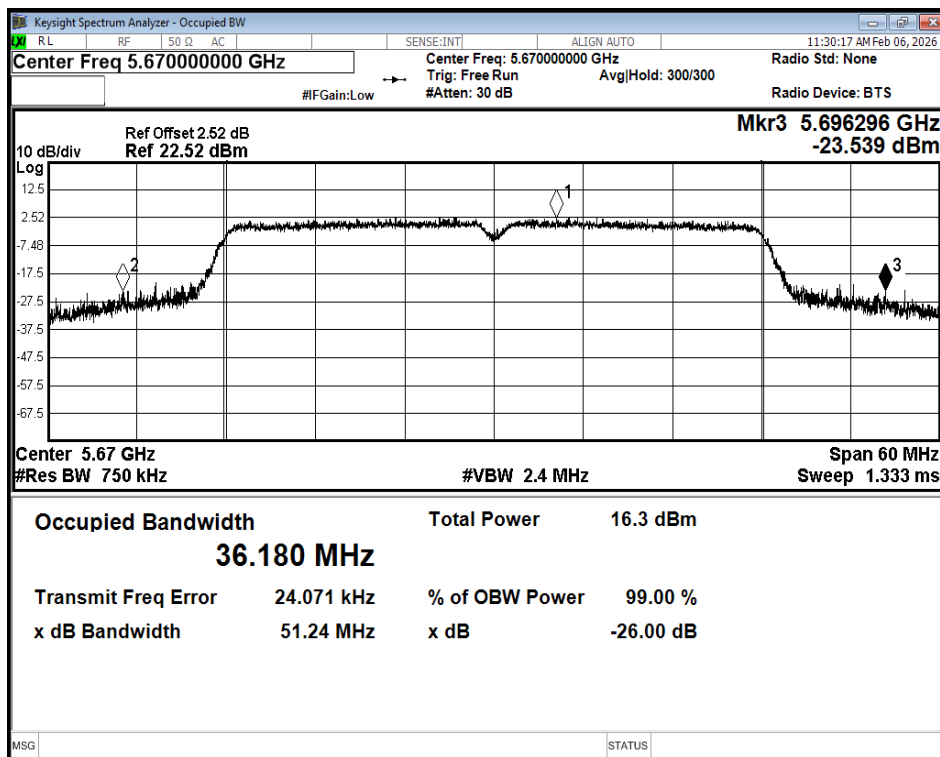

-26dB Bandwidth NVNT n40 5670MHz Ant1

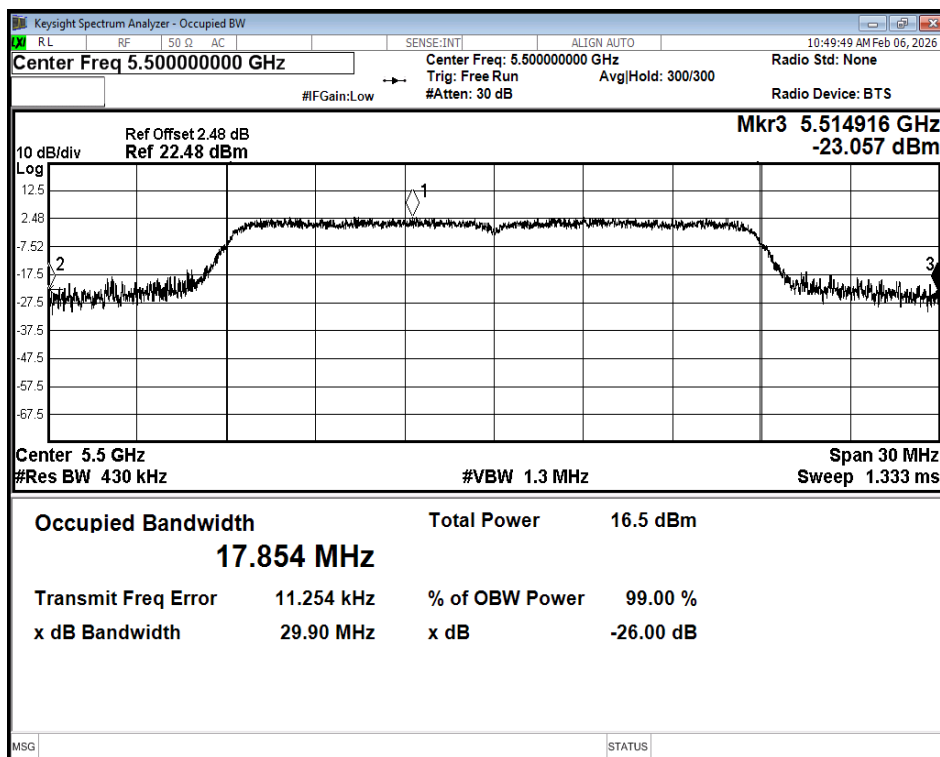

-26dB Bandwidth NVNT ac20 5500MHz Ant1




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A &amp; 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

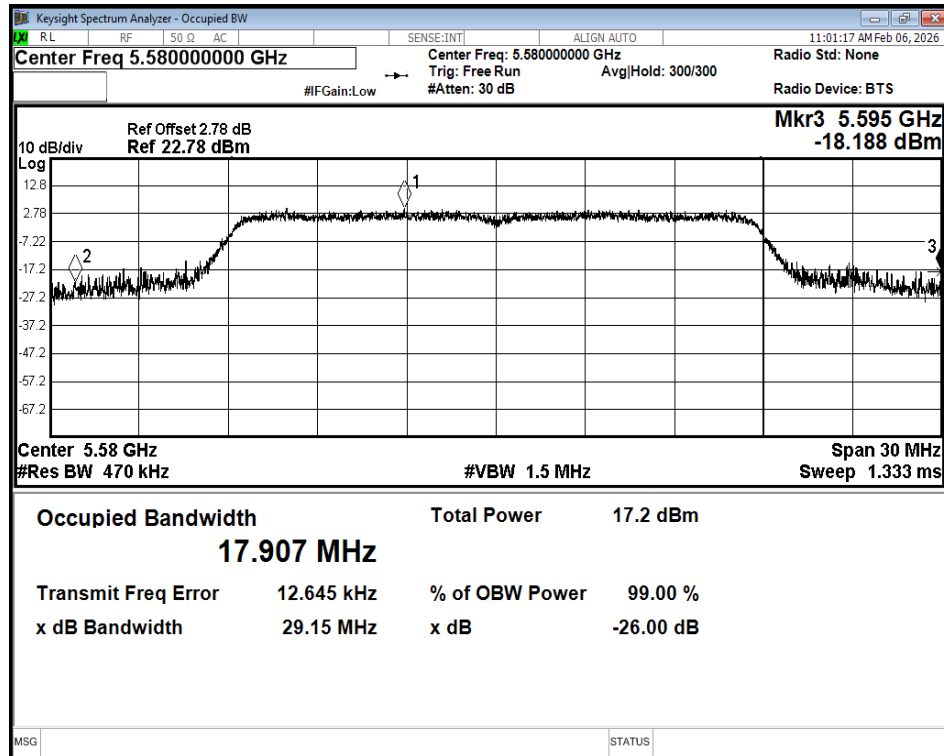

-26dB Bandwidth NVNT ac20 5580MHz Ant1

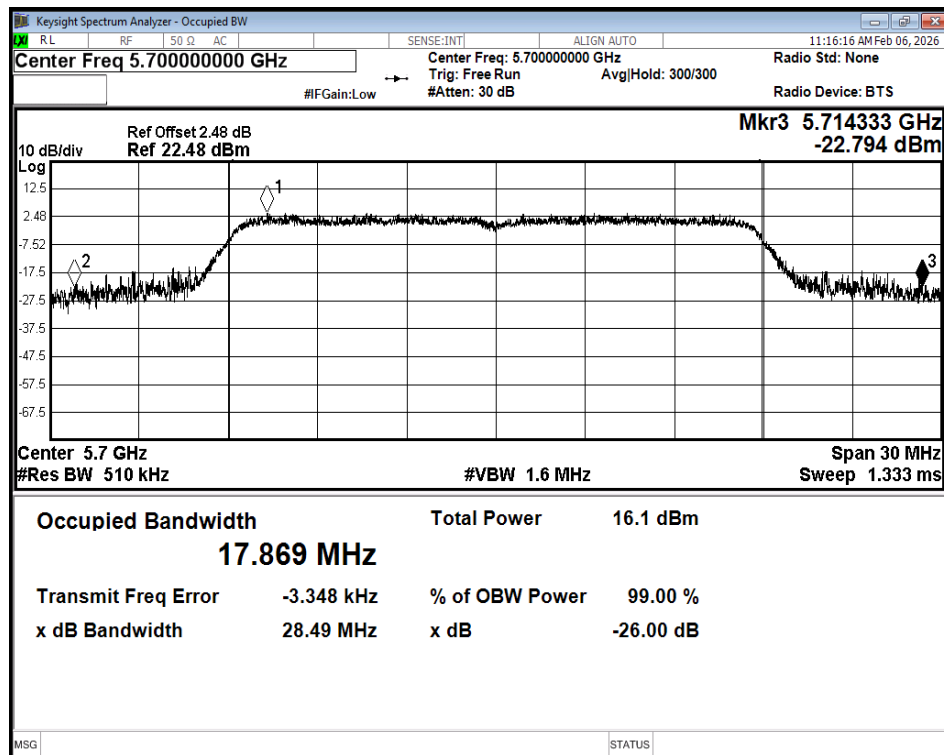

-26dB Bandwidth NVNT ac20 5700MHz Ant1




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A &amp; 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

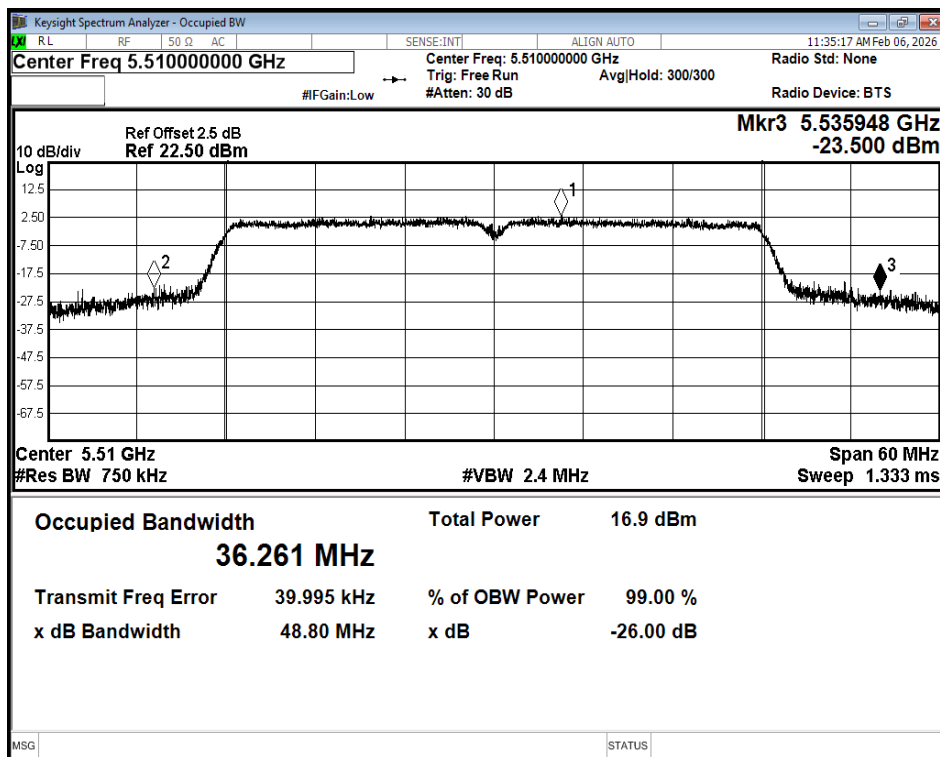

-26dB Bandwidth NVNT ac40 5510MHz Ant1

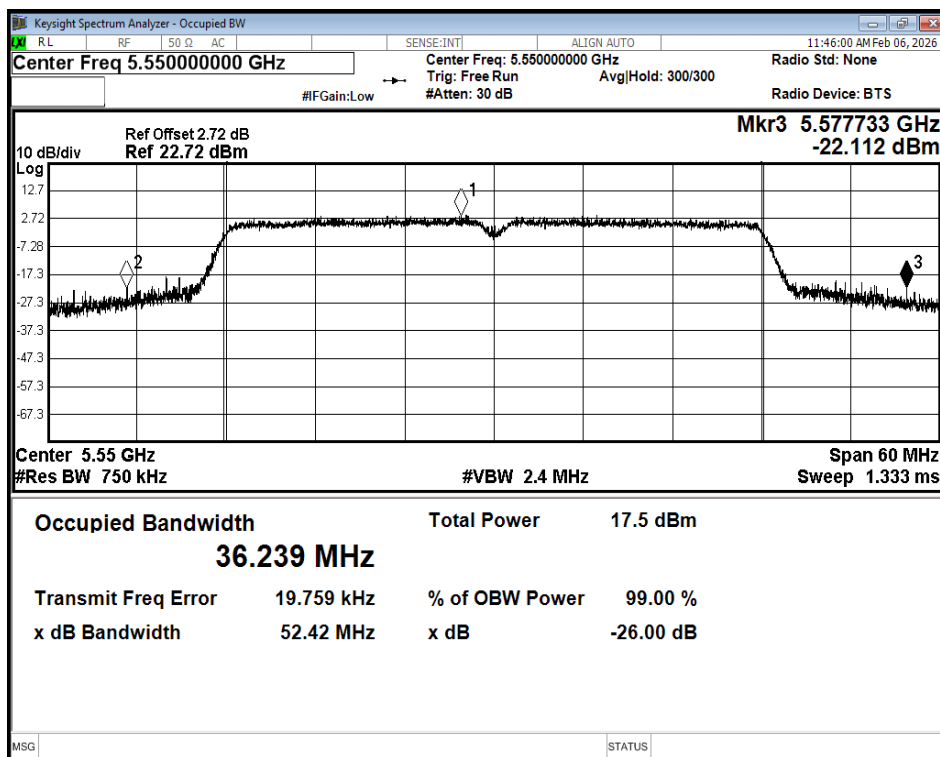

-26dB Bandwidth NVNT ac40 5550MHz Ant1




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: [webmaster@lcs-cert.com](mailto:webmaster@lcs-cert.com) | Web: [www.lcs-cert.com](http://www.lcs-cert.com)

Scan code to check authenticity

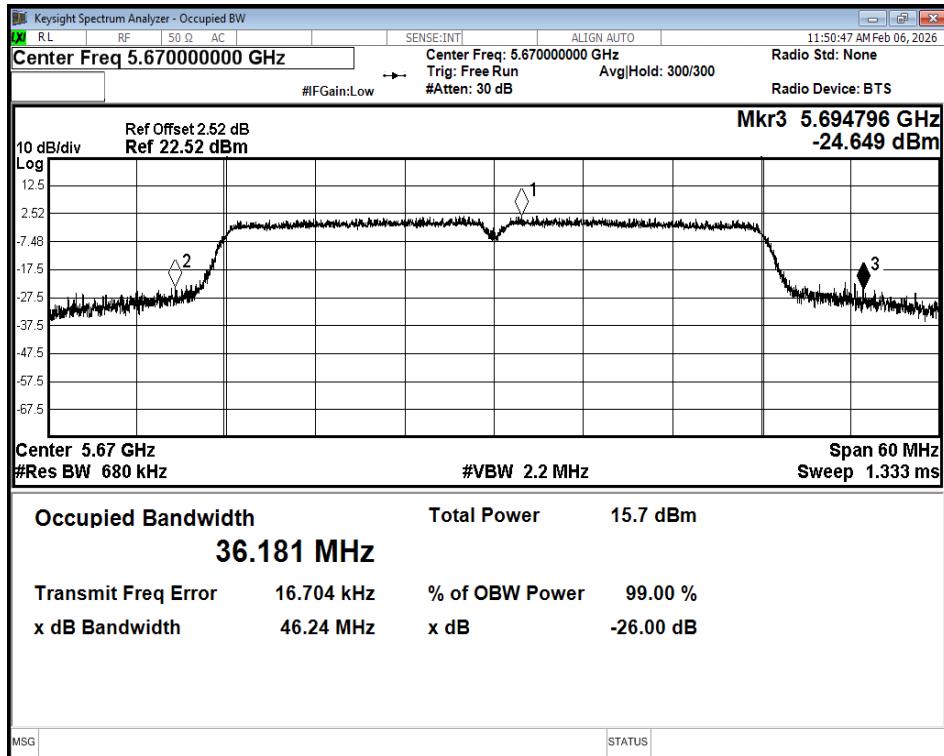

-26dB Bandwidth NVNT ac40 5670MHz Ant1

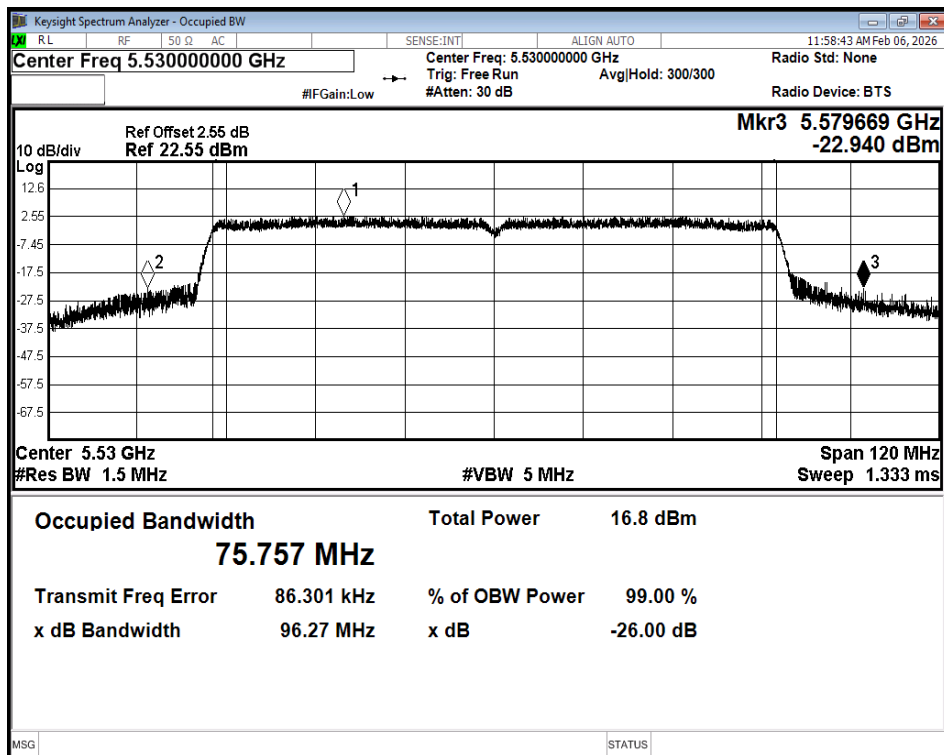

-26dB Bandwidth NVNT ac80 5530MHz Ant1




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A &amp; 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

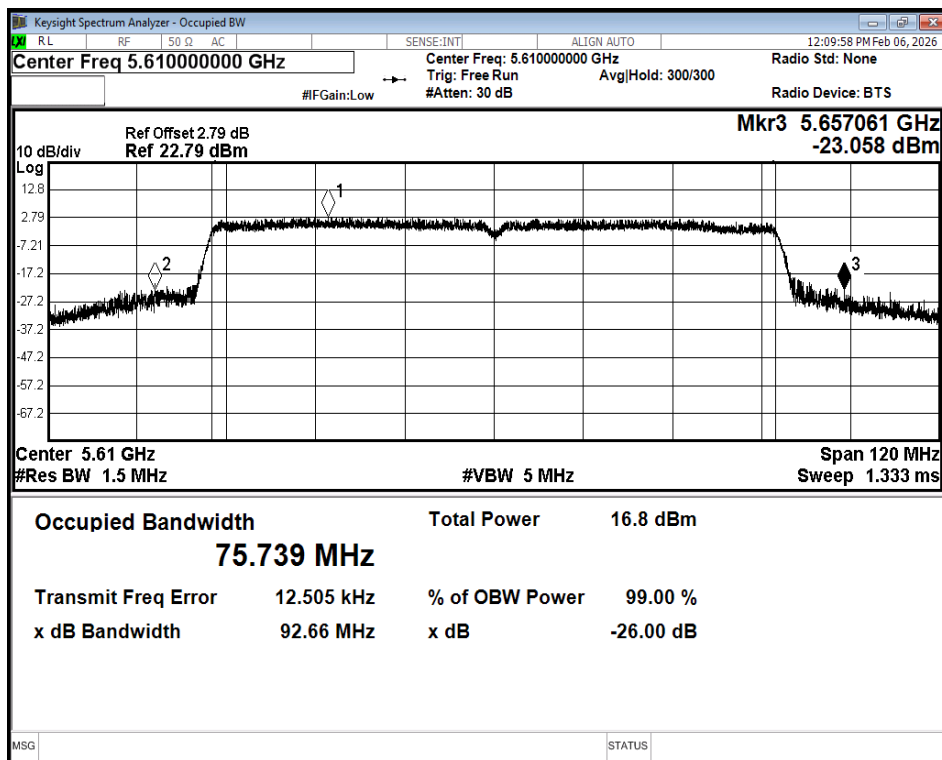

-26dB Bandwidth NVNT ac80 5610MHz Ant1

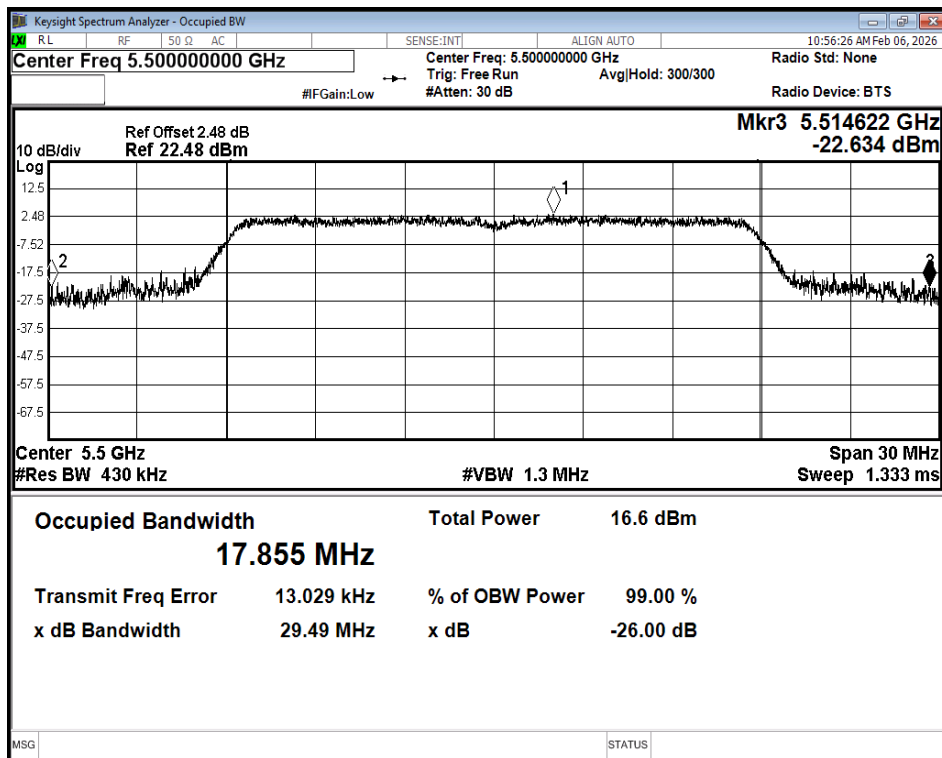

-26dB Bandwidth NVNT ax20 5500MHz Ant1




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A &amp; 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

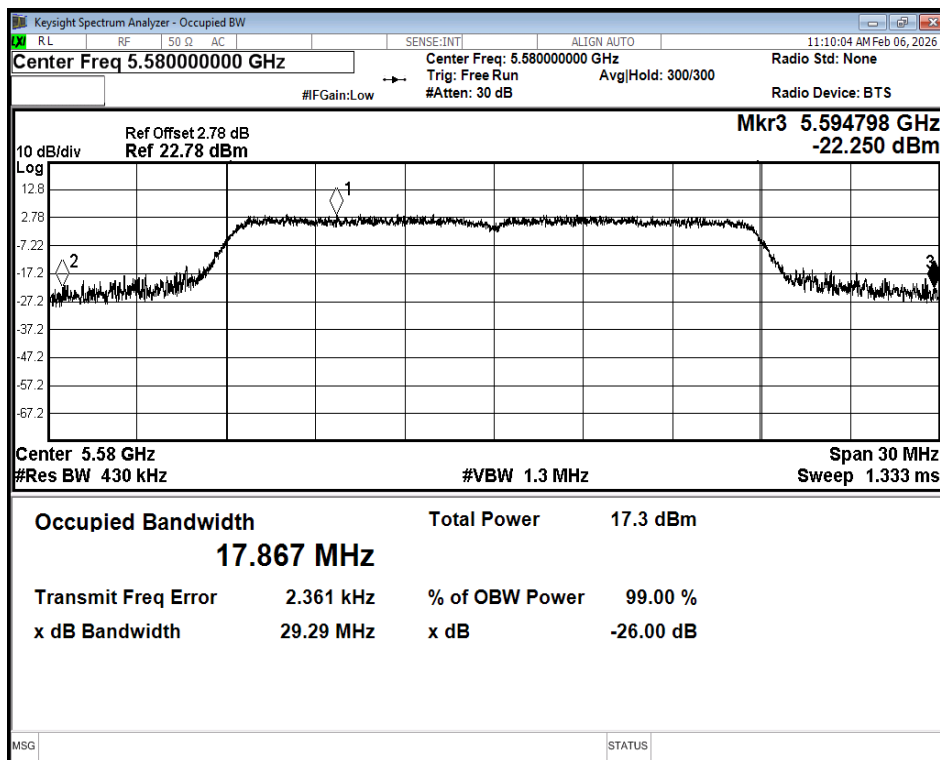

-26dB Bandwidth NVNT ax20 5580MHz Ant1

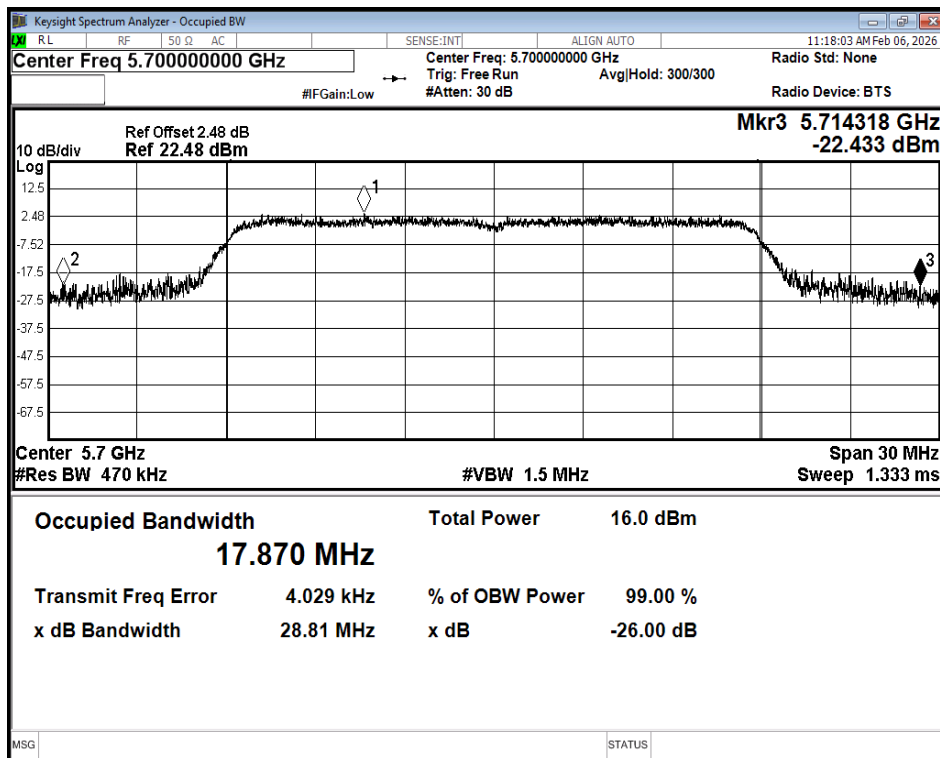

-26dB Bandwidth NVNT ax20 5700MHz Ant1




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A &amp; 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

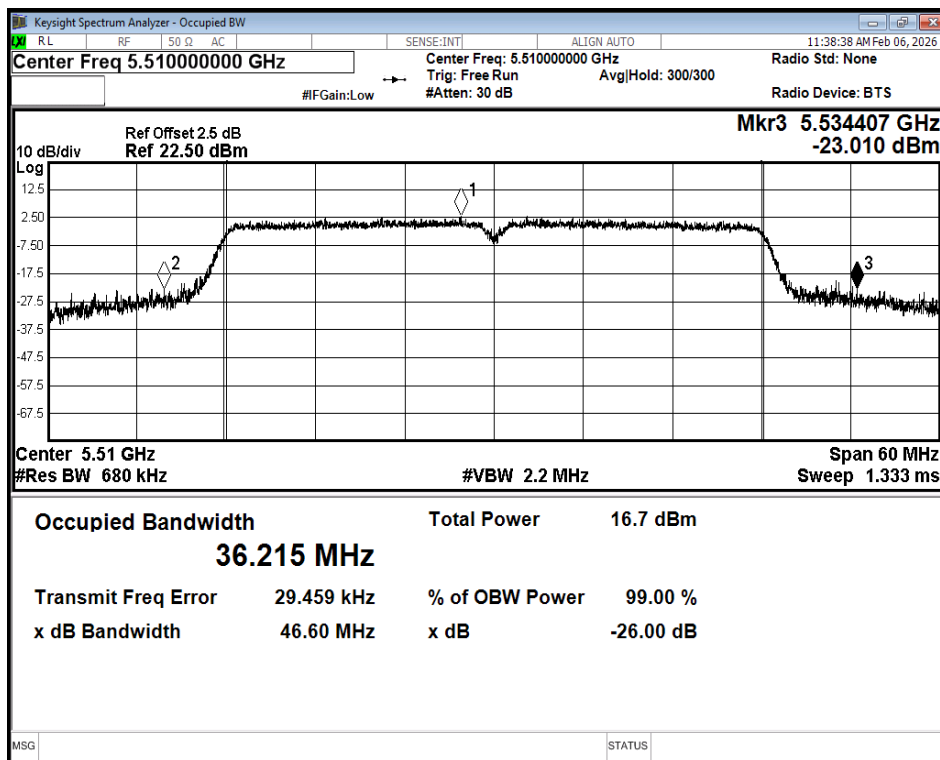

-26dB Bandwidth NVNT ax40 5510MHz Ant1

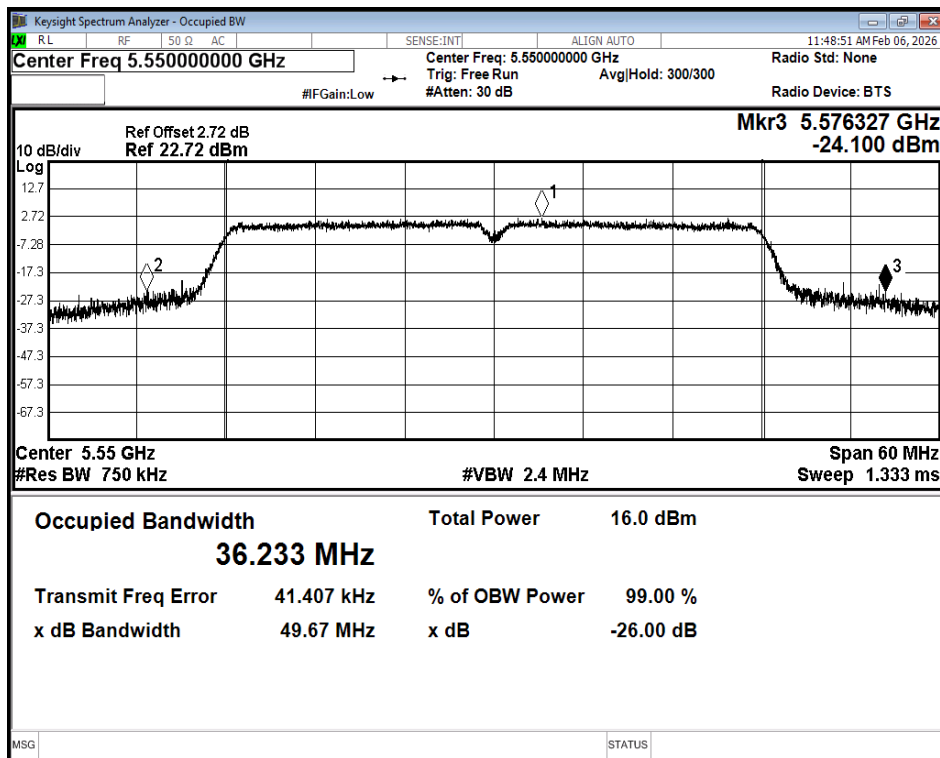

-26dB Bandwidth NVNT ax40 5550MHz Ant1




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: [webmaster@lcs-cert.com](mailto:webmaster@lcs-cert.com) | Web: [www.lcs-cert.com](http://www.lcs-cert.com)

Scan code to check authenticity

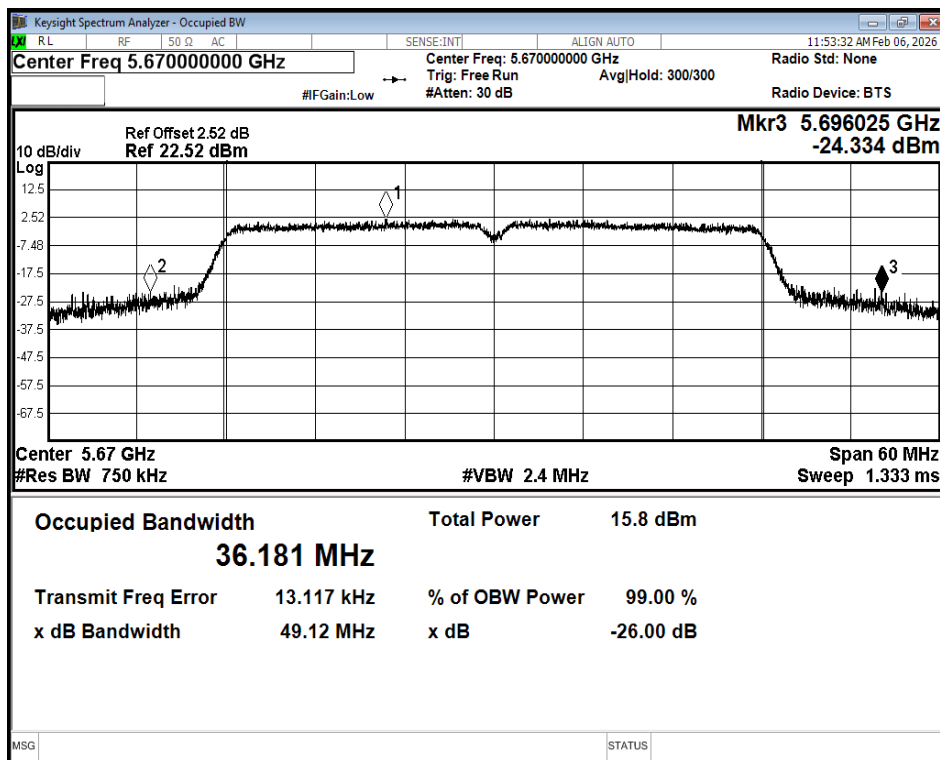

-26dB Bandwidth NVNT ax40 5670MHz Ant1

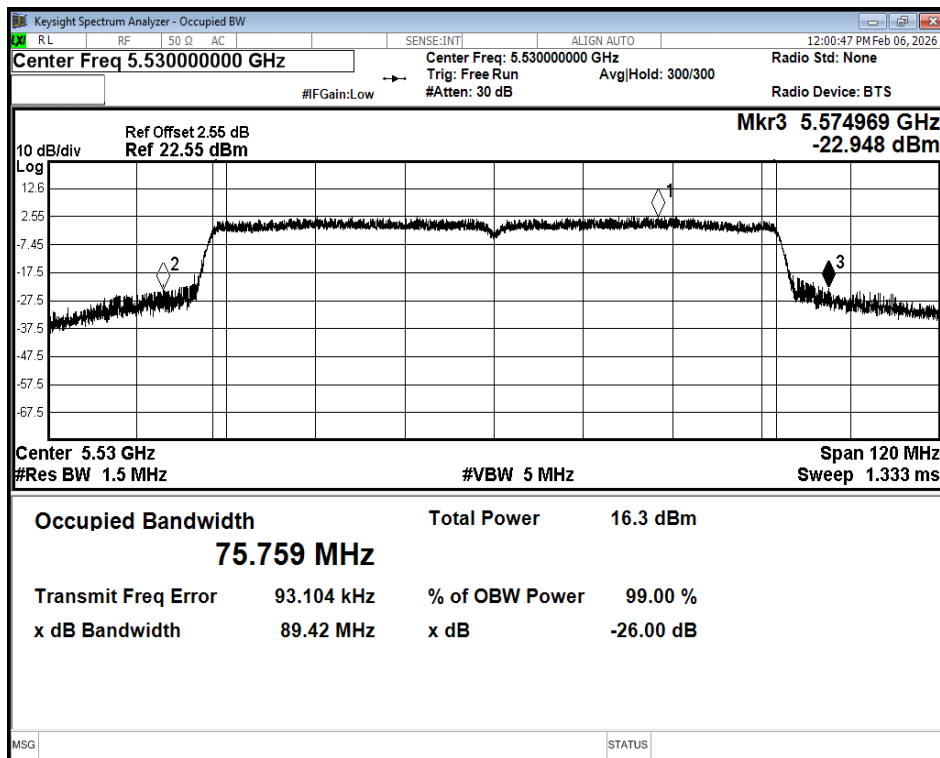

-26dB Bandwidth NVNT ax80 5530MHz Ant1




Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A &amp; 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

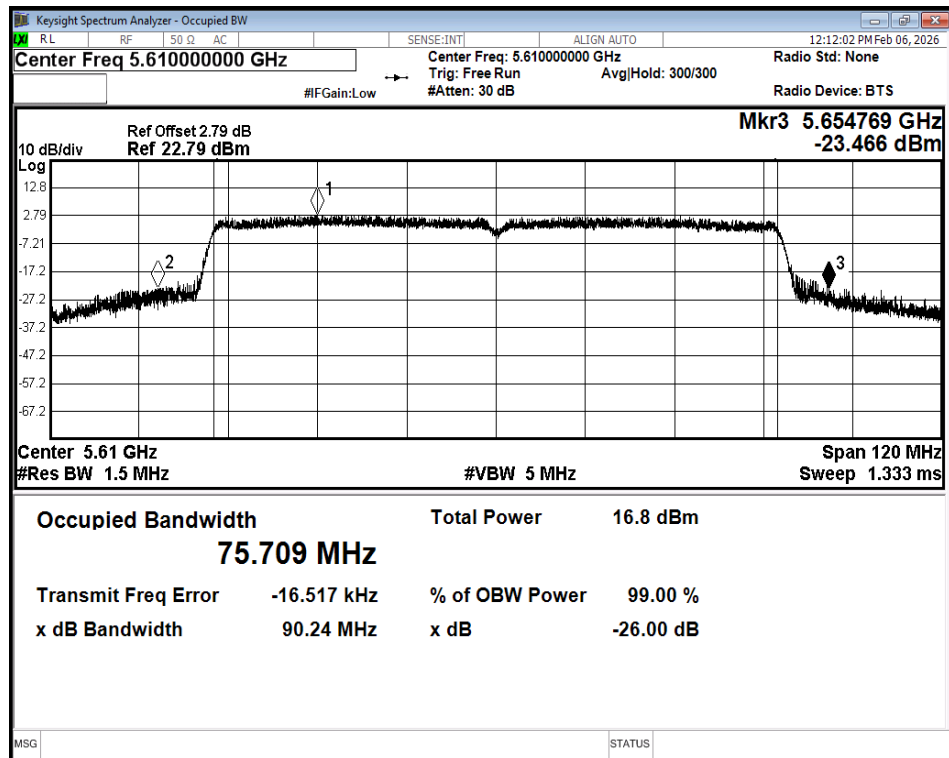

-26dB Bandwidth NVNT ax80 5610MHz Ant1



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: [webmaster@lcs-cert.com](mailto:webmaster@lcs-cert.com) | Web: [www.lcs-cert.com](http://www.lcs-cert.com)

Scan code to check authenticity



| Condition | Mode | Frequency (MHz) | Antenna | -26 dB Bandwidth (MHz) |
|-----------|------|-----------------|---------|------------------------|
| NVNT      | a    | 5500            | Ant2    | 28.46                  |
| NVNT      | a    | 5580            | Ant2    | 28.31                  |
| NVNT      | a    | 5700            | Ant2    | 27.42                  |
| NVNT      | n20  | 5500            | Ant2    | 29.8                   |
| NVNT      | n20  | 5580            | Ant2    | 29.48                  |
| NVNT      | n20  | 5700            | Ant2    | 29.14                  |
| NVNT      | n40  | 5510            | Ant2    | 56.47                  |
| NVNT      | n40  | 5550            | Ant2    | 50.53                  |
| NVNT      | n40  | 5670            | Ant2    | 53.53                  |
| NVNT      | ac20 | 5500            | Ant2    | 29.05                  |
| NVNT      | ac20 | 5580            | Ant2    | 29.69                  |
| NVNT      | ac20 | 5700            | Ant2    | 29.26                  |
| NVNT      | ac40 | 5510            | Ant2    | 56.41                  |
| NVNT      | ac40 | 5550            | Ant2    | 57.15                  |
| NVNT      | ac40 | 5670            | Ant2    | 54.56                  |
| NVNT      | ac80 | 5530            | Ant2    | 86.09                  |
| NVNT      | ac80 | 5610            | Ant2    | 85.14                  |
| NVNT      | ax20 | 5500            | Ant2    | 29.79                  |
| NVNT      | ax20 | 5580            | Ant2    | 29.86                  |
| NVNT      | ax20 | 5700            | Ant2    | 28.53                  |
| NVNT      | ax40 | 5510            | Ant2    | 55.64                  |
| NVNT      | ax40 | 5550            | Ant2    | 54.84                  |
| NVNT      | ax40 | 5670            | Ant2    | 51.15                  |
| NVNT      | ax80 | 5530            | Ant2    | 86.18                  |
| NVNT      | ax80 | 5610            | Ant2    | 84.65                  |




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: [webmaster@lcs-cert.com](mailto:webmaster@lcs-cert.com) | Web: [www.lcs-cert.com](http://www.lcs-cert.com)

Scan code to check authenticity

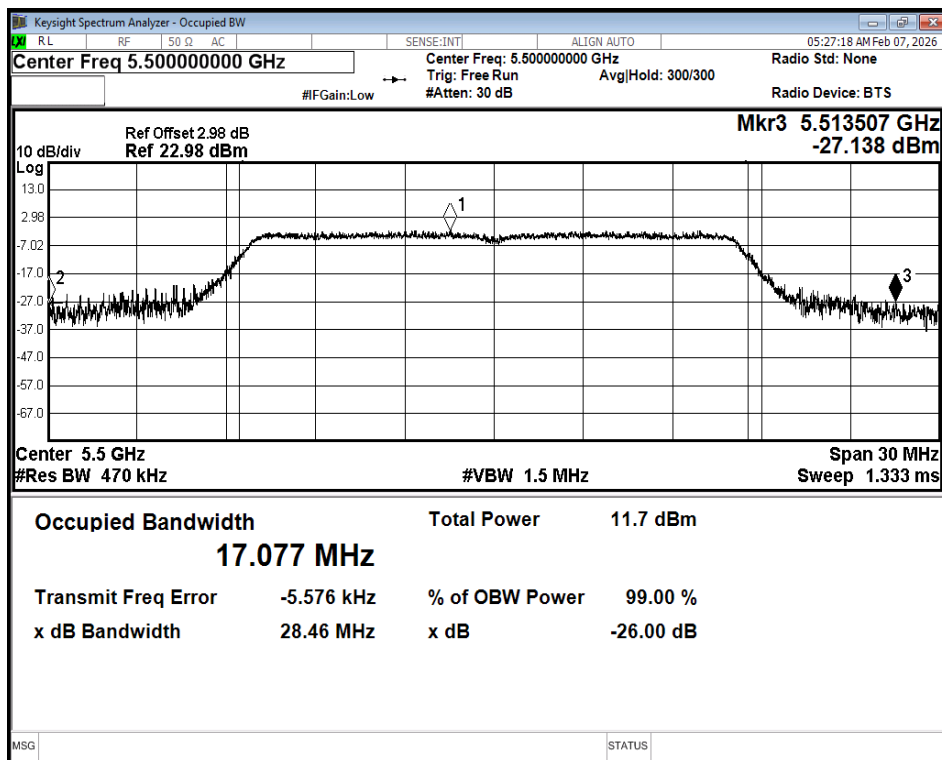

-26dB Bandwidth NVNT a 5500MHz Ant2

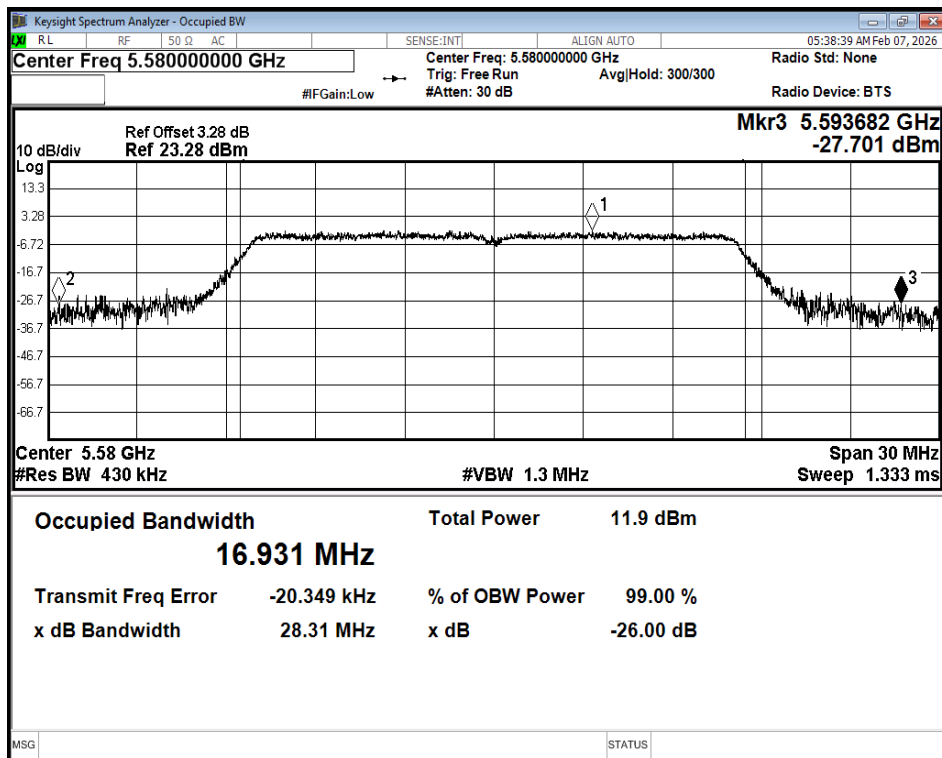

-26dB Bandwidth NVNT a 5580MHz Ant2




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A &amp; 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

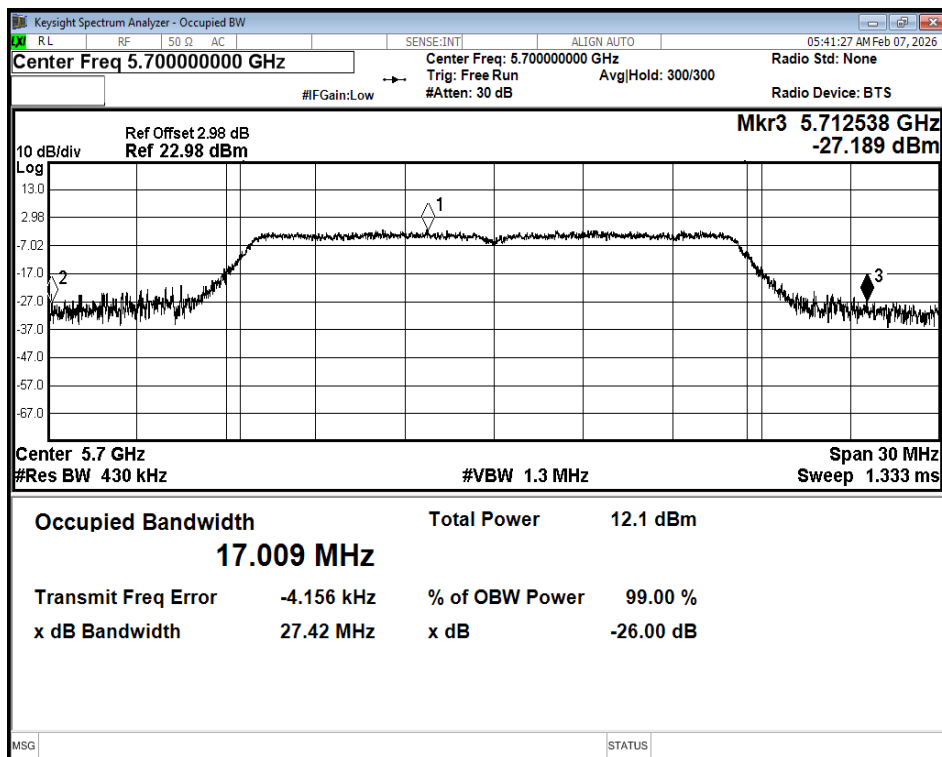

-26dB Bandwidth NVNT a 5700MHz Ant2

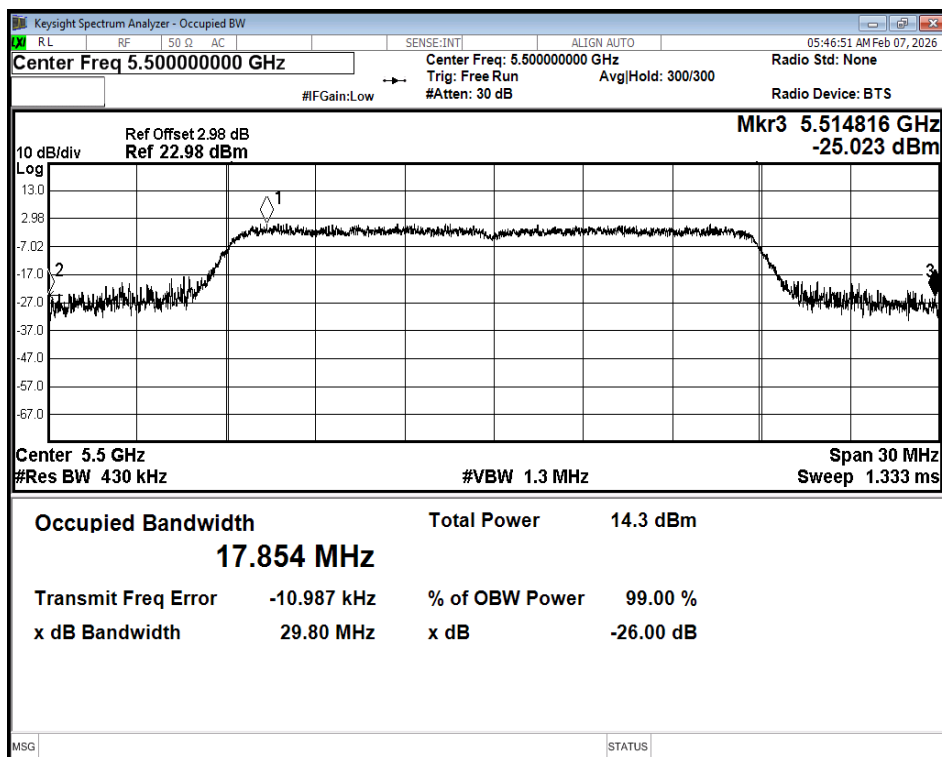

-26dB Bandwidth NVNT n20 5500MHz Ant2




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A &amp; 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

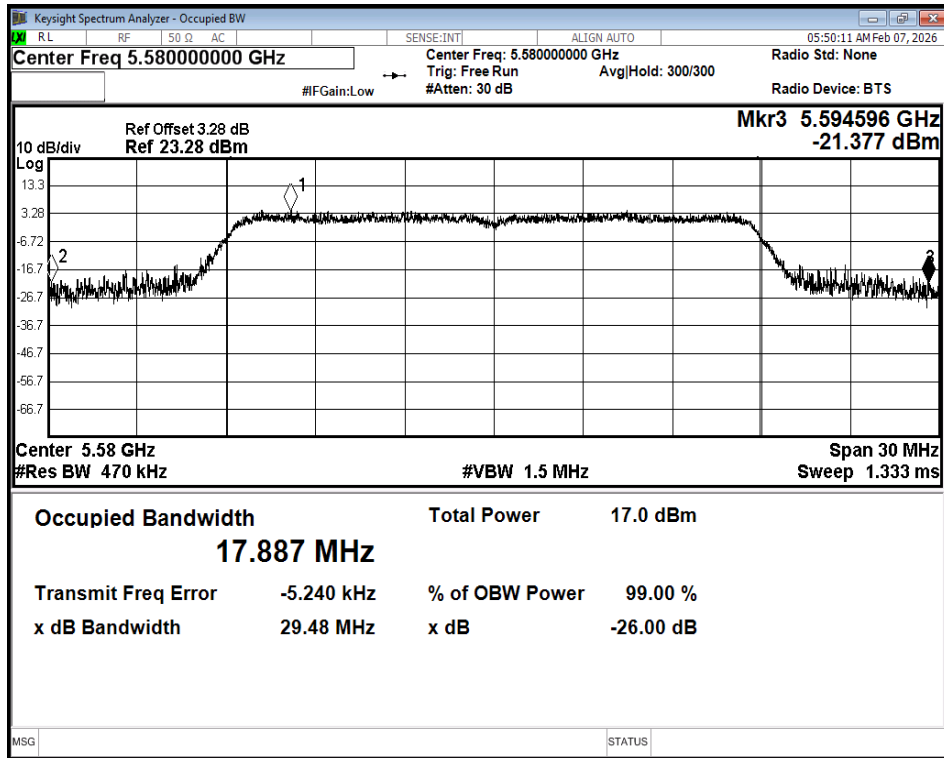

-26dB Bandwidth NVNT n20 5580MHz Ant2

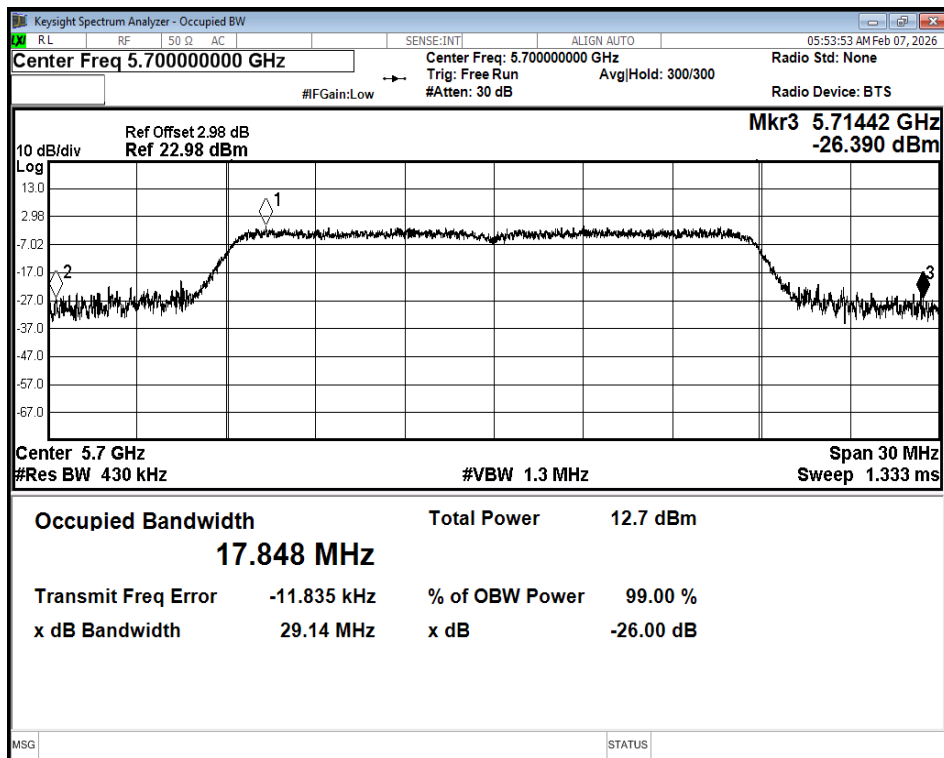

-26dB Bandwidth NVNT n20 5700MHz Ant2




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: [webmaster@lcs-cert.com](mailto:webmaster@lcs-cert.com) | Web: [www.lcs-cert.com](http://www.lcs-cert.com)

Scan code to check authenticity

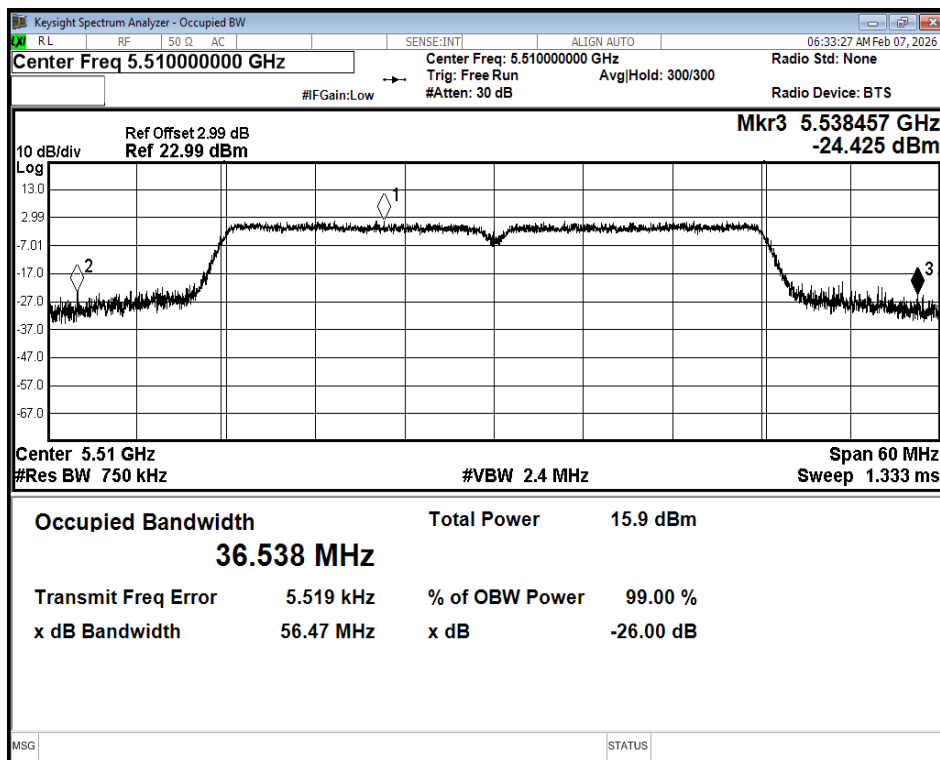

-26dB Bandwidth NVNT n40 5510MHz Ant2

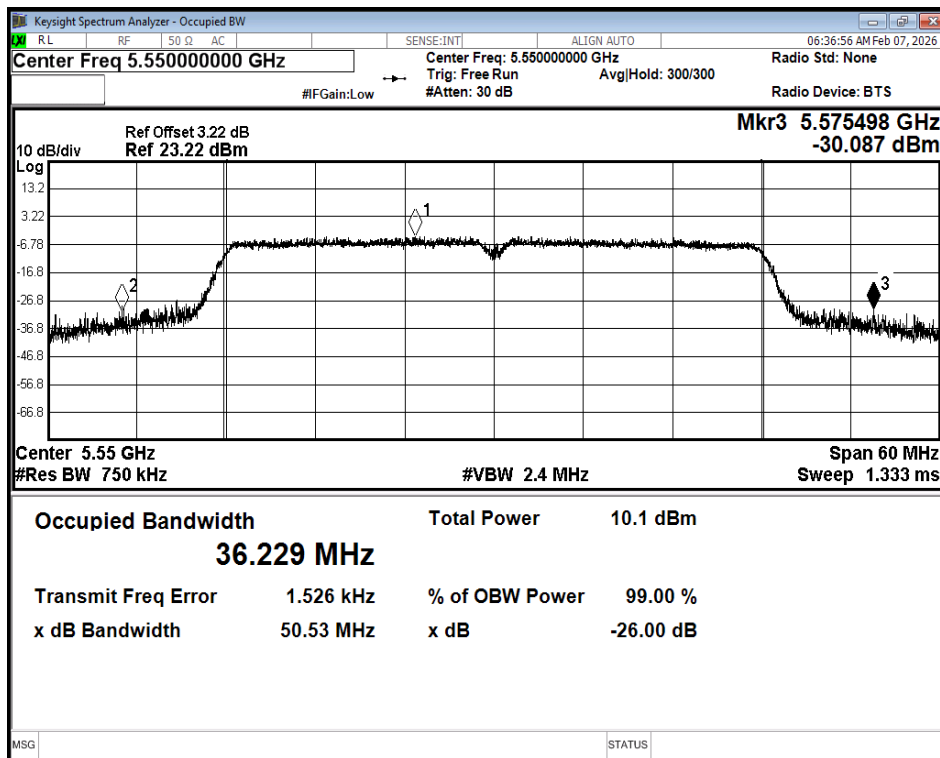

-26dB Bandwidth NVNT n40 5550MHz Ant2




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A &amp; 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: [webmaster@lcs-cert.com](mailto:webmaster@lcs-cert.com) | Web: [www.lcs-cert.com](http://www.lcs-cert.com)

Scan code to check authenticity

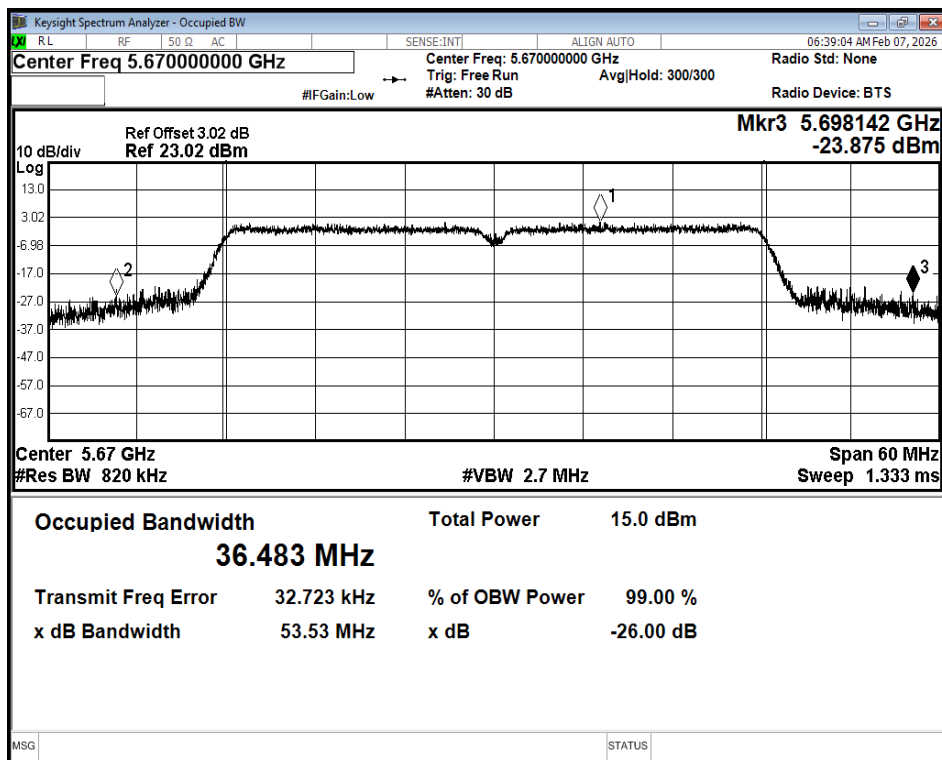

-26dB Bandwidth NVNT n40 5670MHz Ant2

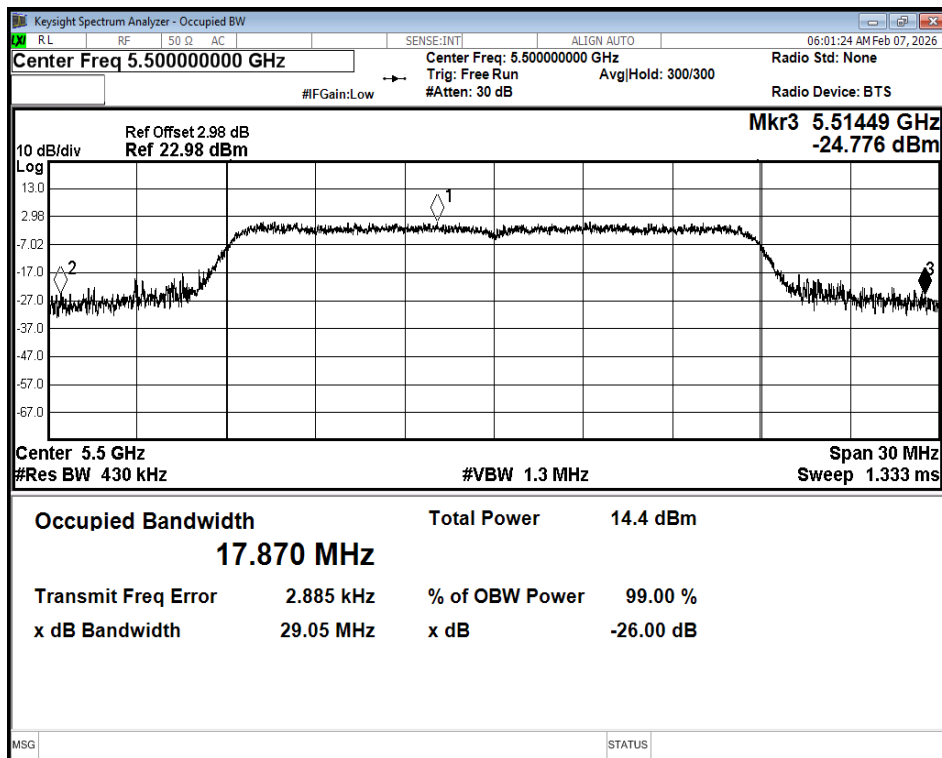

-26dB Bandwidth NVNT ac20 5500MHz Ant2




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

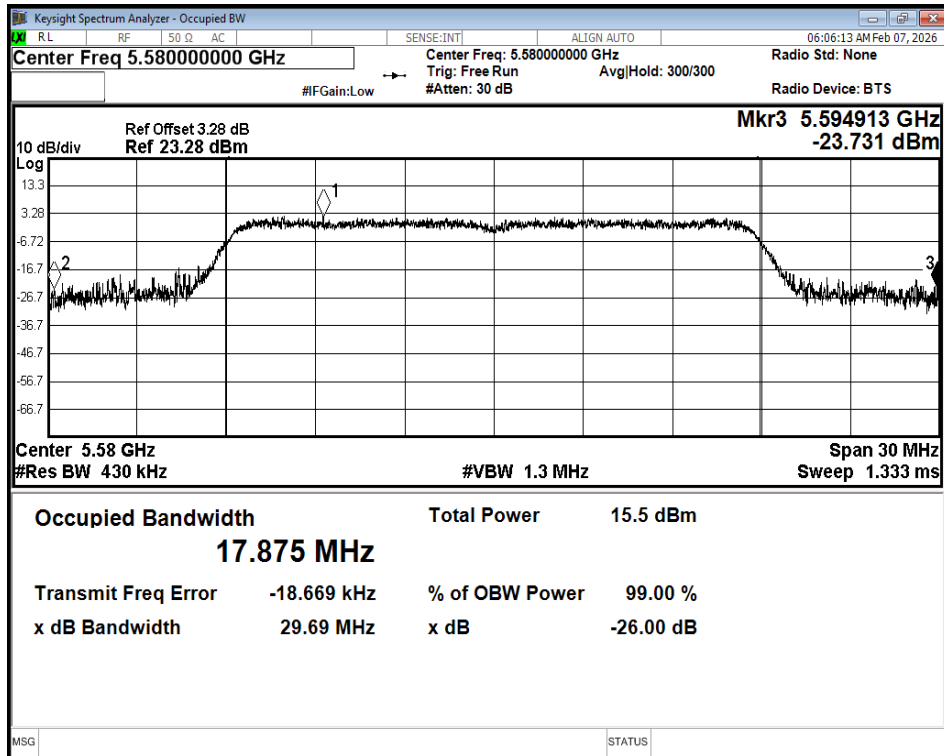

-26dB Bandwidth NVNT ac20 5580MHz Ant2

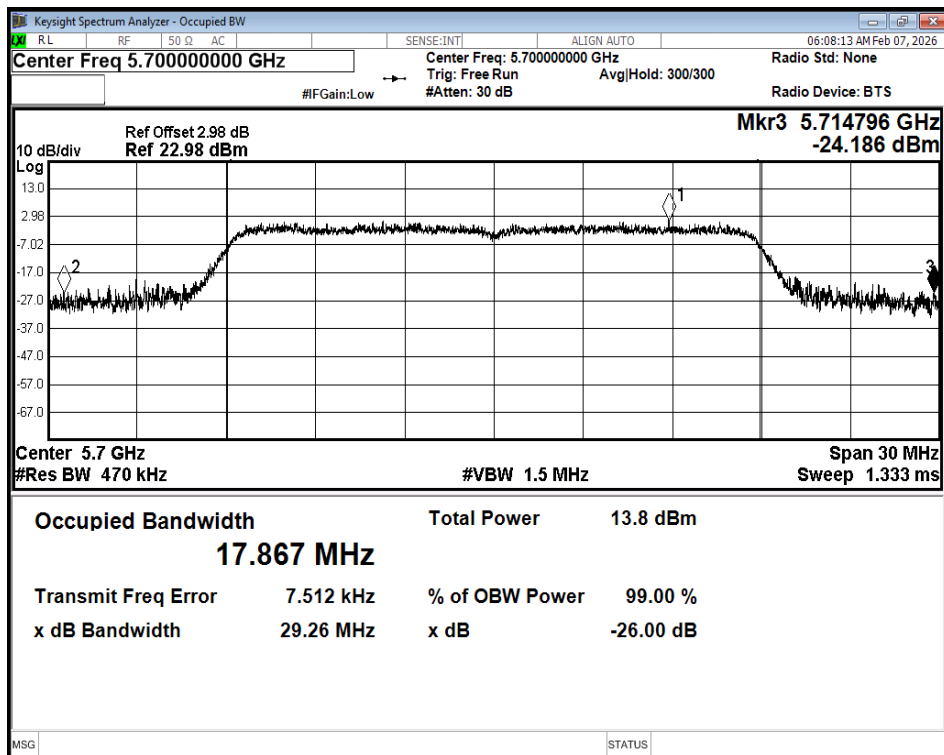

-26dB Bandwidth NVNT ac20 5700MHz Ant2




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: [webmaster@lcs-cert.com](mailto:webmaster@lcs-cert.com) | Web: [www.lcs-cert.com](http://www.lcs-cert.com)

Scan code to check authenticity

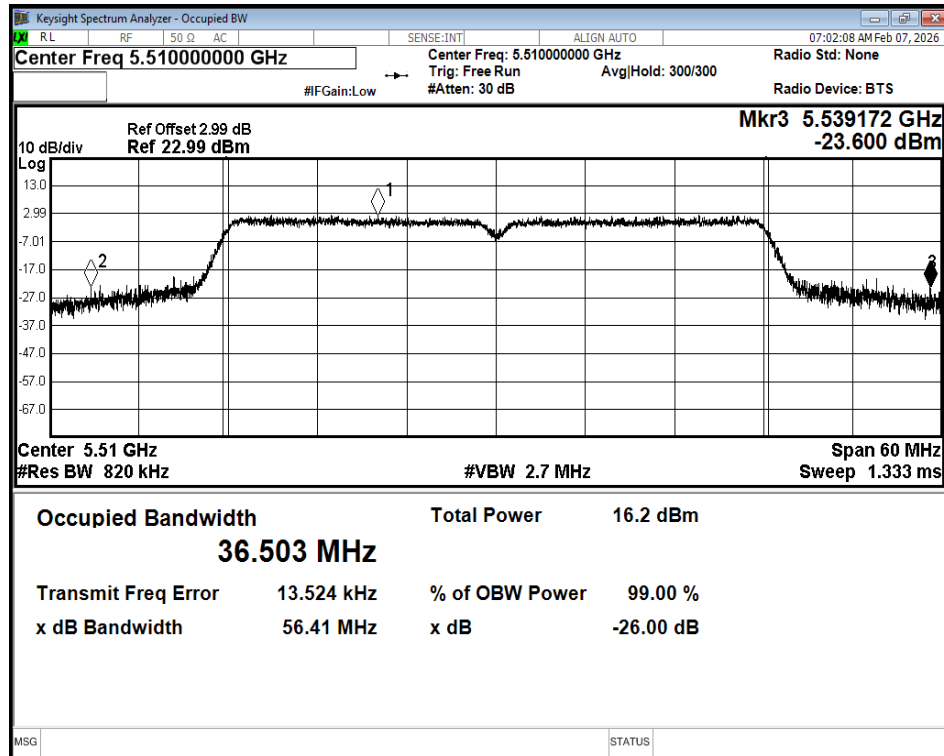

-26dB Bandwidth NVNT ac40 5510MHz Ant2

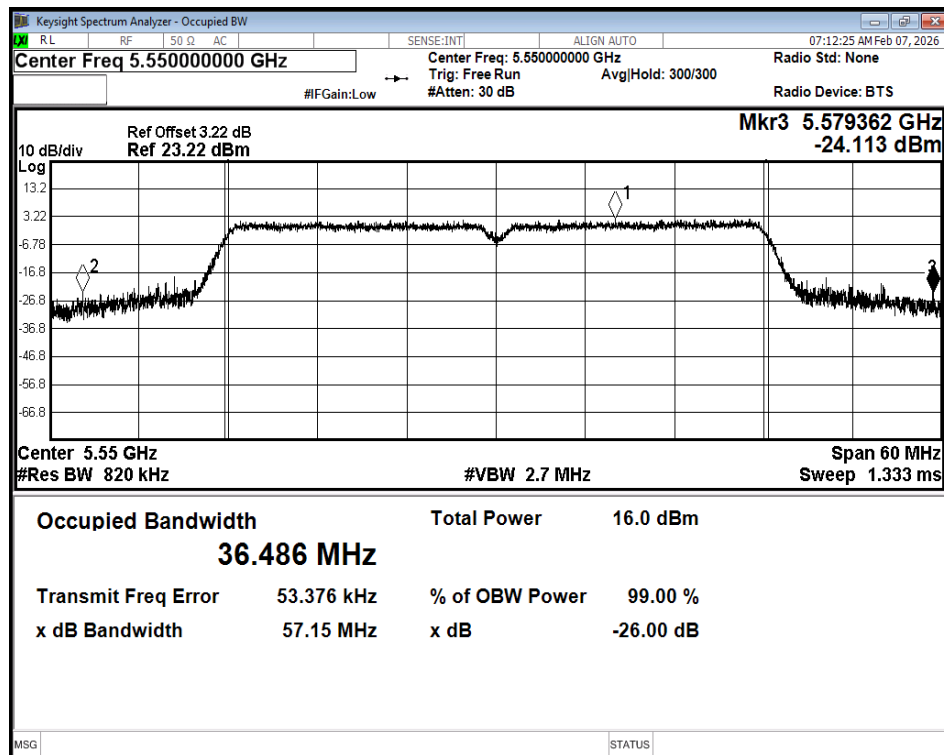

-26dB Bandwidth NVNT ac40 5550MHz Ant2




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A &amp; 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

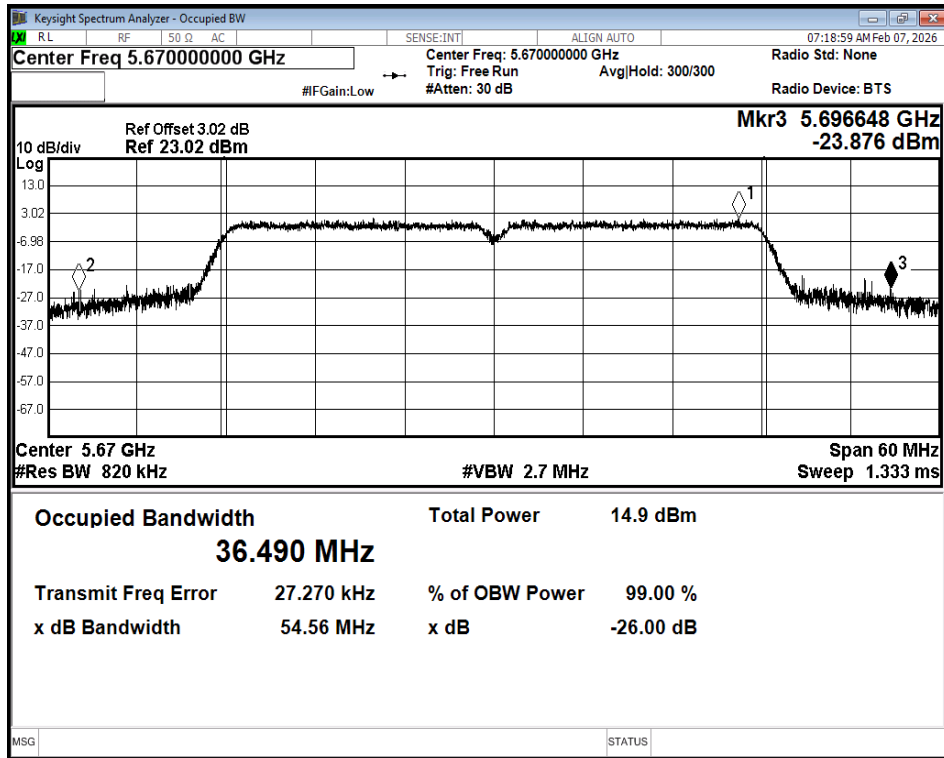

-26dB Bandwidth NVNT ac40 5670MHz Ant2

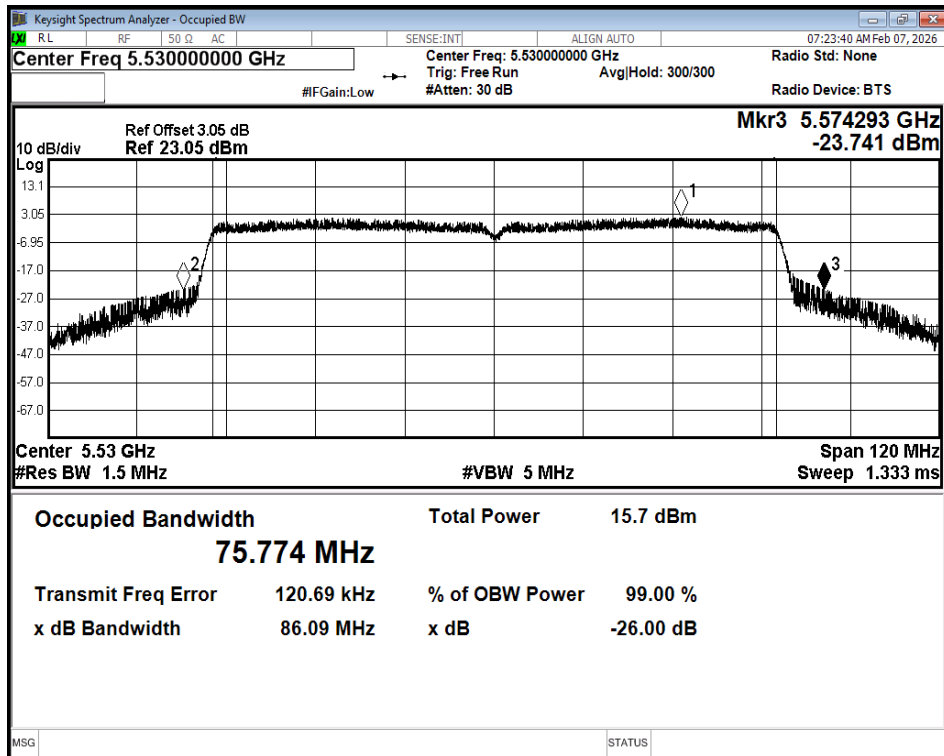

-26dB Bandwidth NVNT ac80 5530MHz Ant2




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A &amp; 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

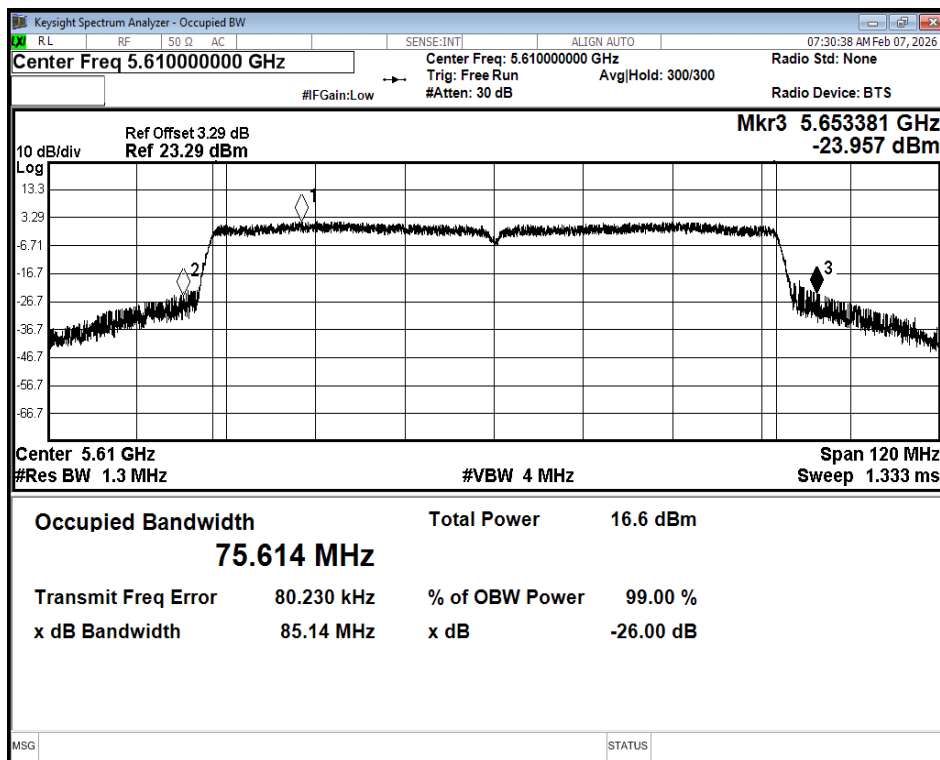

-26dB Bandwidth NVNT ac80 5610MHz Ant2

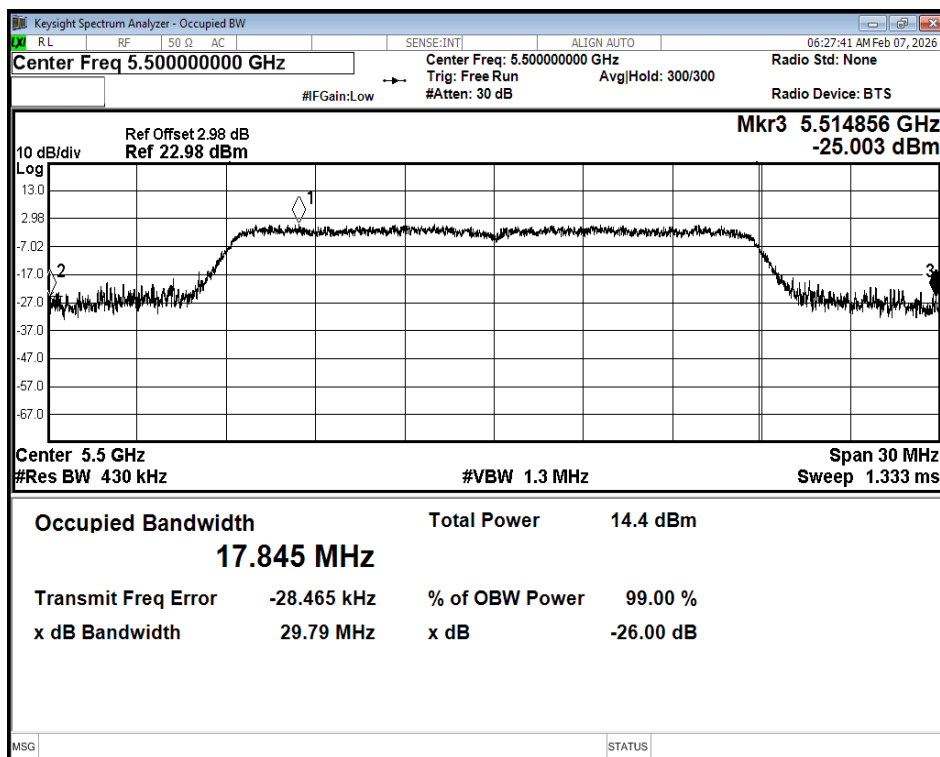

-26dB Bandwidth NVNT ax20 5500MHz Ant2




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A &amp; 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

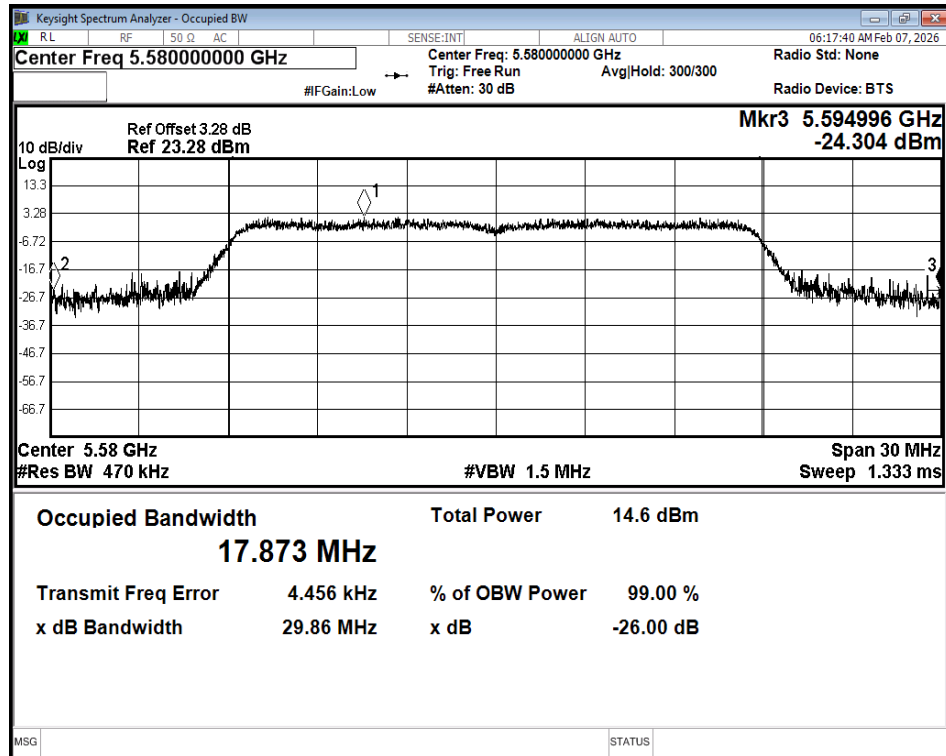

-26dB Bandwidth NVNT ax20 5580MHz Ant2

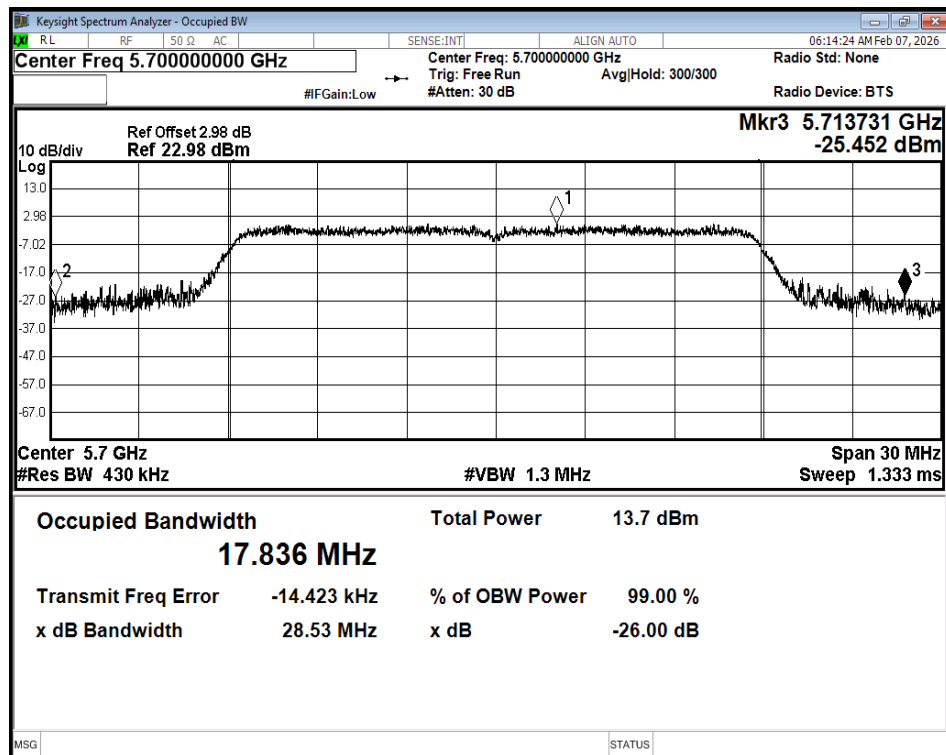

-26dB Bandwidth NVNT ax20 5700MHz Ant2




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A &amp; 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

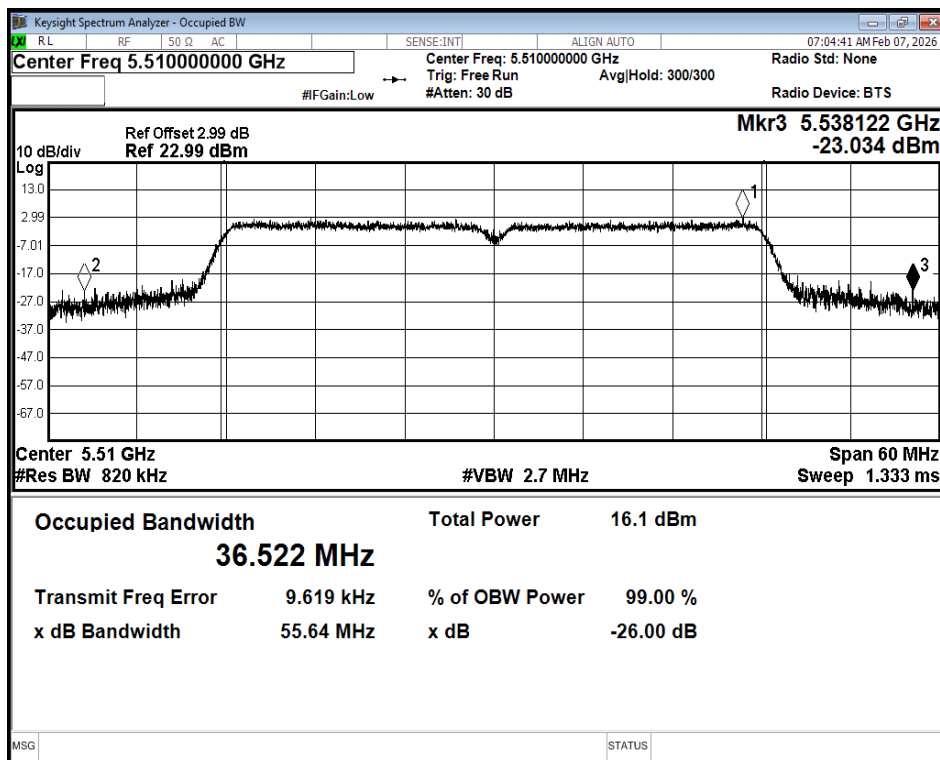

-26dB Bandwidth NVNT ax40 5510MHz Ant2

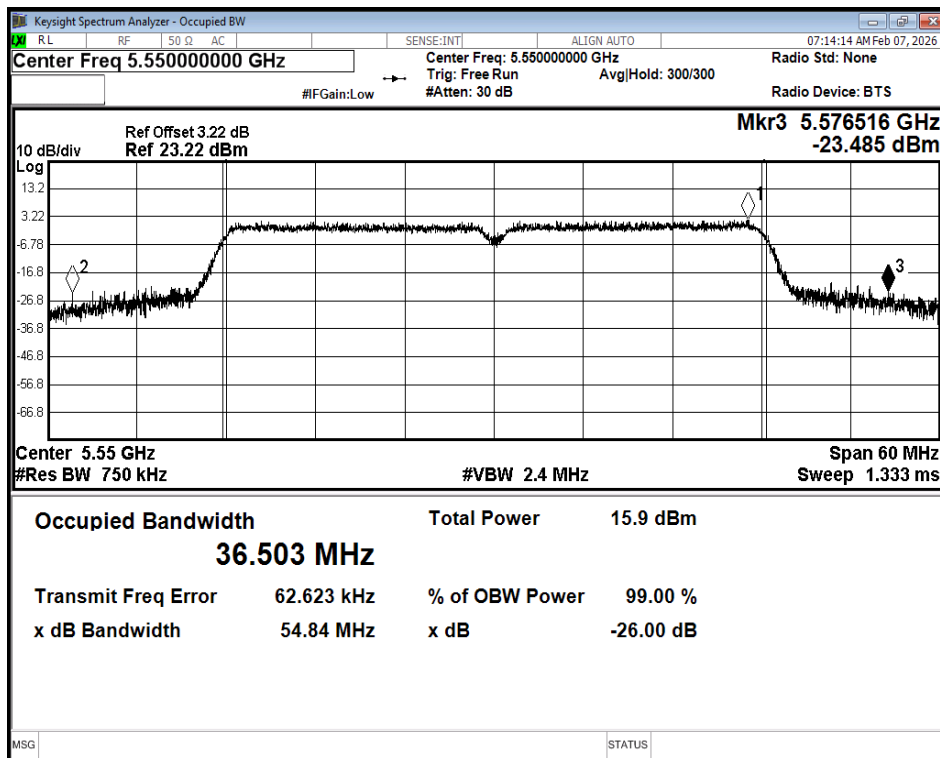

-26dB Bandwidth NVNT ax40 5550MHz Ant2




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A &amp; 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

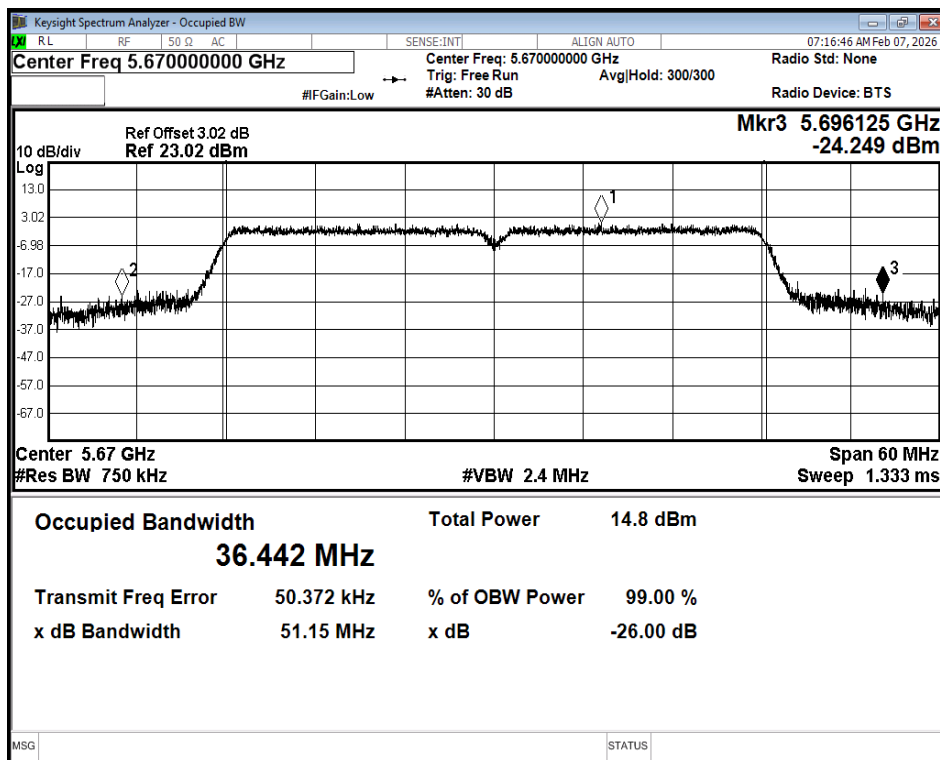

-26dB Bandwidth NVNT ax40 5670MHz Ant2

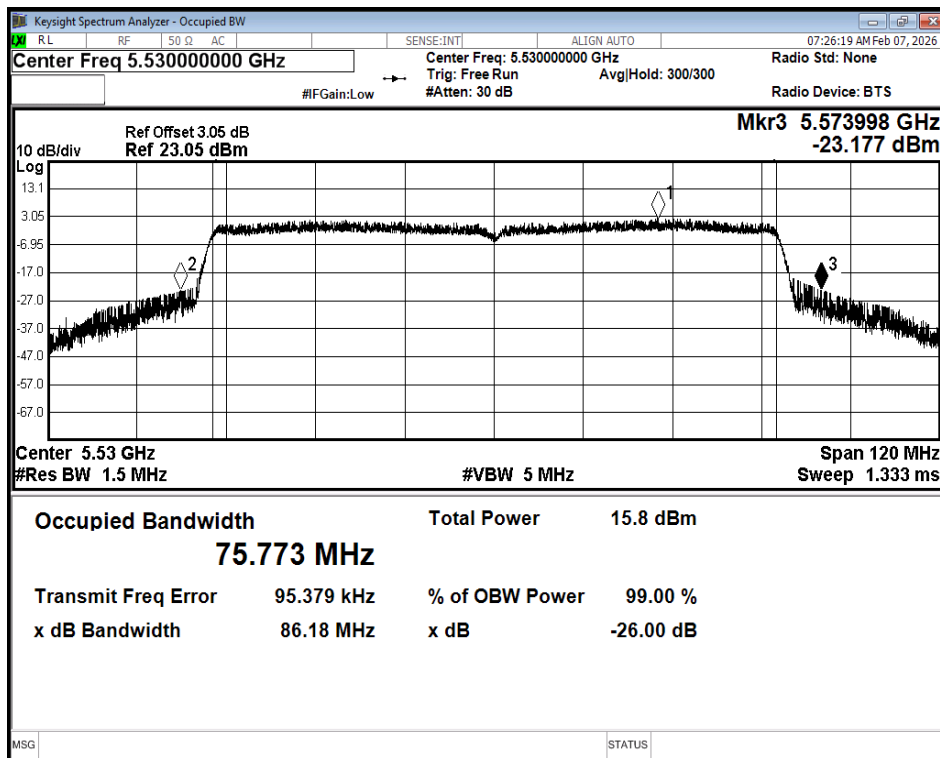

-26dB Bandwidth NVNT ax80 5530MHz Ant2




Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A &amp; 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

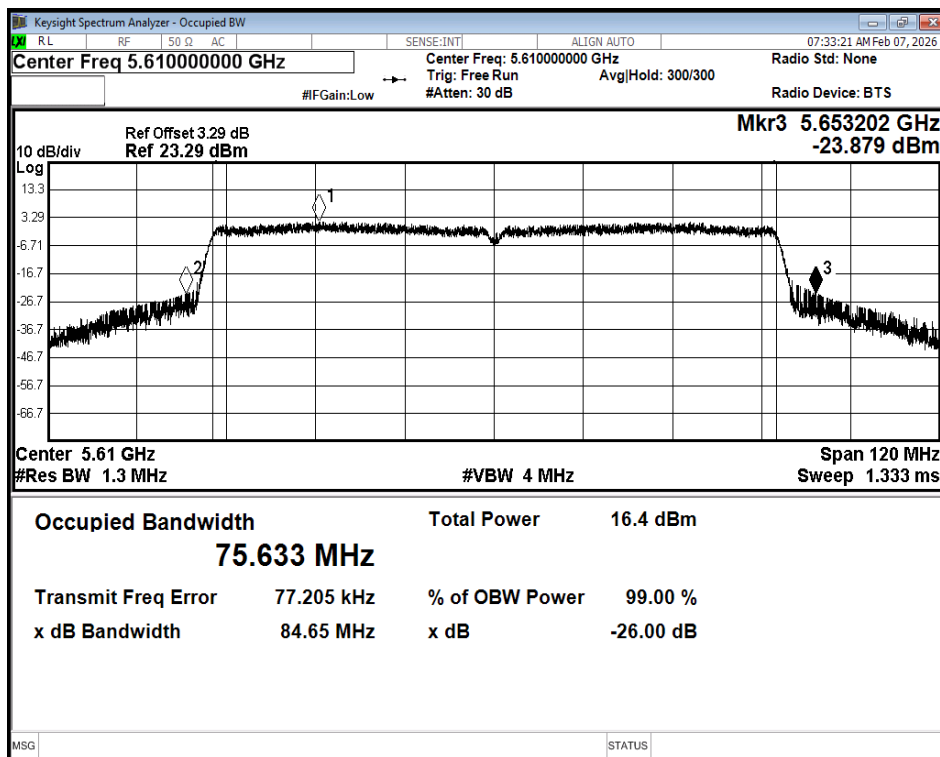

-26dB Bandwidth NVNT ax80 5610MHz Ant2



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: [webmaster@lcs-cert.com](mailto:webmaster@lcs-cert.com) | Web: [www.lcs-cert.com](http://www.lcs-cert.com)

Scan code to check authenticity



## C.2 Maximum Conducted Output Power

| Condition | Mode | Frequency (MHz) | Antenna | Conducted Power (dBm) | Duty Factor (dB) | Total Conducted Power (dBm) | Limit Conducted (dBm) | Verdict |
|-----------|------|-----------------|---------|-----------------------|------------------|-----------------------------|-----------------------|---------|
| NVNT      | a    | 5500            | Ant1    | 9.42                  | 0.23             | 9.65                        | 24                    | Pass    |
| NVNT      | a    | 5580            | Ant1    | 10.16                 | 0.23             | 10.39                       | 24                    | Pass    |
| NVNT      | a    | 5700            | Ant1    | 8.66                  | 0.27             | 8.93                        | 24                    | Pass    |
| NVNT      | n20  | 5500            | Ant1    | 10.31                 | 0.11             | 10.42                       | 24                    | Pass    |
| NVNT      | n20  | 5580            | Ant1    | 10.59                 | 0.11             | 10.7                        | 24                    | Pass    |
| NVNT      | n20  | 5700            | Ant1    | 9.33                  | 0.11             | 9.44                        | 24                    | Pass    |
| NVNT      | n40  | 5510            | Ant1    | 9.83                  | 0.23             | 10.06                       | 24                    | Pass    |
| NVNT      | n40  | 5550            | Ant1    | 10.03                 | 0.23             | 10.26                       | 24                    | Pass    |
| NVNT      | n40  | 5670            | Ant1    | 9.16                  | 0.23             | 9.39                        | 24                    | Pass    |
| NVNT      | ac20 | 5500            | Ant1    | 9.85                  | 0.13             | 9.98                        | 24                    | Pass    |
| NVNT      | ac20 | 5580            | Ant1    | 10.54                 | 0.13             | 10.67                       | 24                    | Pass    |
| NVNT      | ac20 | 5700            | Ant1    | 9.21                  | 0.11             | 9.32                        | 24                    | Pass    |
| NVNT      | ac40 | 5510            | Ant1    | 9.84                  | 0.27             | 10.11                       | 24                    | Pass    |
| NVNT      | ac40 | 5550            | Ant1    | 10.31                 | 0.23             | 10.54                       | 24                    | Pass    |
| NVNT      | ac40 | 5670            | Ant1    | 8.61                  | 0.23             | 8.84                        | 24                    | Pass    |
| NVNT      | ac80 | 5530            | Ant1    | 9.17                  | 0.54             | 9.71                        | 24                    | Pass    |
| NVNT      | ac80 | 5610            | Ant1    | 9.25                  | 0.46             | 9.71                        | 24                    | Pass    |
| NVNT      | ax20 | 5500            | Ant1    | 10.05                 | 0.11             | 10.16                       | 24                    | Pass    |
| NVNT      | ax20 | 5580            | Ant1    | 10.64                 | 0.11             | 10.75                       | 24                    | Pass    |
| NVNT      | ax20 | 5700            | Ant1    | 9.26                  | 0.11             | 9.37                        | 24                    | Pass    |
| NVNT      | ax40 | 5510            | Ant1    | 9.81                  | 0.23             | 10.04                       | 24                    | Pass    |
| NVNT      | ax40 | 5550            | Ant1    | 9.28                  | 0.23             | 9.51                        | 24                    | Pass    |
| NVNT      | ax40 | 5670            | Ant1    | 8.63                  | 0.27             | 8.9                         | 24                    | Pass    |
| NVNT      | ax80 | 5530            | Ant1    | 8.59                  | 0.46             | 9.05                        | 24                    | Pass    |
| NVNT      | ax80 | 5610            | Ant1    | 9.24                  | 0.46             | 9.7                         | 24                    | Pass    |



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: [webmaster@lcs-cert.com](mailto:webmaster@lcs-cert.com) | Web: [www.lcs-cert.com](http://www.lcs-cert.com)

Scan code to check authenticity



| Condition | Mode | Frequency (MHz) | Antenna | Conducted Power (dBm) | Duty Factor (dB) | Total Conducted Power (dBm) | Limit Conducted (dBm) | Verdict |
|-----------|------|-----------------|---------|-----------------------|------------------|-----------------------------|-----------------------|---------|
| NVNT      | a    | 5500            | Ant2    | 8.13                  | 0.1              | 8.23                        | 24                    | Pass    |
| NVNT      | a    | 5580            | Ant2    | 7.63                  | 0.1              | 7.73                        | 24                    | Pass    |
| NVNT      | a    | 5700            | Ant2    | 8.94                  | 0.1              | 9.04                        | 24                    | Pass    |
| NVNT      | n20  | 5500            | Ant2    | 7.73                  | 0                | 7.73                        | 24                    | Pass    |
| NVNT      | n20  | 5580            | Ant2    | 7.8                   | 0.11             | 7.91                        | 24                    | Pass    |
| NVNT      | n20  | 5700            | Ant2    | 6.11                  | 0.13             | 6.24                        | 24                    | Pass    |
| NVNT      | n40  | 5510            | Ant2    | 8.74                  | 0.23             | 8.97                        | 24                    | Pass    |
| NVNT      | n40  | 5550            | Ant2    | 3.14                  | 0.23             | 3.37                        | 24                    | Pass    |
| NVNT      | n40  | 5670            | Ant2    | 7.73                  | 0.27             | 8                           | 24                    | Pass    |
| NVNT      | ac20 | 5500            | Ant2    | 7.84                  | 0                | 7.84                        | 24                    | Pass    |
| NVNT      | ac20 | 5580            | Ant2    | 8.89                  | 0.11             | 9                           | 24                    | Pass    |
| NVNT      | ac20 | 5700            | Ant2    | 7.14                  | 0.11             | 7.25                        | 24                    | Pass    |
| NVNT      | ac40 | 5510            | Ant2    | 8.96                  | 0.27             | 9.23                        | 24                    | Pass    |
| NVNT      | ac40 | 5550            | Ant2    | 8.84                  | 0.23             | 9.07                        | 24                    | Pass    |
| NVNT      | ac40 | 5670            | Ant2    | 7.75                  | 0.27             | 8.02                        | 24                    | Pass    |
| NVNT      | ac80 | 5530            | Ant2    | 7.98                  | 0.54             | 8.52                        | 24                    | Pass    |
| NVNT      | ac80 | 5610            | Ant2    | 8.99                  | 0.46             | 9.45                        | 24                    | Pass    |
| NVNT      | ax20 | 5500            | Ant2    | 7.75                  | 0.11             | 7.86                        | 24                    | Pass    |
| NVNT      | ax20 | 5580            | Ant2    | 7.91                  | 0.11             | 8.02                        | 24                    | Pass    |
| NVNT      | ax20 | 5700            | Ant2    | 7.09                  | 0.11             | 7.2                         | 24                    | Pass    |
| NVNT      | ax40 | 5510            | Ant2    | 8.84                  | 0.27             | 9.11                        | 24                    | Pass    |
| NVNT      | ax40 | 5550            | Ant2    | 8.81                  | 0.23             | 9.04                        | 24                    | Pass    |
| NVNT      | ax40 | 5670            | Ant2    | 7.76                  | 0.23             | 7.99                        | 24                    | Pass    |
| NVNT      | ax80 | 5530            | Ant2    | 7.95                  | 0.47             | 8.42                        | 24                    | Pass    |
| NVNT      | ax80 | 5610            | Ant2    | 8.98                  | 0.54             | 9.52                        | 24                    | Pass    |



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: [webmaster@lcs-cert.com](mailto:webmaster@lcs-cert.com) | Web: [www.lcs-cert.com](http://www.lcs-cert.com)

Scan code to check authenticity



## MIMO

| Condition | Mode | Frequency (MHz) | Antenna |      | Total Power (dBm) | Limit (dBm) | Verdict |
|-----------|------|-----------------|---------|------|-------------------|-------------|---------|
|           |      |                 | Ant1    | Ant2 |                   |             |         |
| NVNT      | n20  | 5500            | 10.42   | 7.73 | 12.29             | 24          | Pass    |
| NVNT      | n20  | 5580            | 10.7    | 7.91 | 12.54             | 24          | Pass    |
| NVNT      | n20  | 5700            | 9.44    | 6.24 | 11.14             | 24          | Pass    |
| NVNT      | n40  | 5510            | 10.06   | 8.97 | 12.56             | 24          | Pass    |
| NVNT      | n40  | 5550            | 10.26   | 3.37 | 11.07             | 24          | Pass    |
| NVNT      | n40  | 5670            | 9.39    | 8    | 11.76             | 24          | Pass    |
| NVNT      | ac20 | 5500            | 9.98    | 7.84 | 12.05             | 24          | Pass    |
| NVNT      | ac20 | 5580            | 10.67   | 9    | 12.93             | 24          | Pass    |
| NVNT      | ac20 | 5700            | 9.32    | 7.25 | 11.42             | 24          | Pass    |
| NVNT      | ac40 | 5510            | 10.11   | 9.23 | 12.70             | 24          | Pass    |
| NVNT      | ac40 | 5550            | 10.54   | 9.07 | 12.88             | 24          | Pass    |
| NVNT      | ac40 | 5670            | 8.84    | 8.02 | 11.46             | 24          | Pass    |
| NVNT      | ac80 | 5530            | 9.71    | 8.52 | 12.17             | 24          | Pass    |
| NVNT      | ac80 | 5610            | 9.71    | 9.45 | 12.59             | 24          | Pass    |
| NVNT      | ax20 | 5500            | 10.16   | 7.86 | 12.17             | 24          | Pass    |
| NVNT      | ax20 | 5580            | 10.75   | 8.02 | 12.61             | 24          | Pass    |
| NVNT      | ax20 | 5700            | 9.37    | 7.2  | 11.43             | 24          | Pass    |
| NVNT      | ax40 | 5510            | 10.04   | 9.11 | 12.61             | 24          | Pass    |
| NVNT      | ax40 | 5550            | 9.51    | 9.04 | 12.29             | 24          | Pass    |
| NVNT      | ax40 | 5670            | 8.9     | 7.99 | 11.48             | 24          | Pass    |
| NVNT      | ax80 | 5530            | 9.05    | 8.42 | 11.76             | 24          | Pass    |
| NVNT      | ax80 | 5610            | 9.7     | 9.52 | 12.62             | 24          | Pass    |



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: [webmaster@lcs-cert.com](mailto:webmaster@lcs-cert.com) | Web: [www.lcs-cert.com](http://www.lcs-cert.com)

Scan code to check authenticity



### C.3 Maximum Power Spectral Density Level

| Condition | Mode | Frequency (MHz) | Antenna | Conducted PSD (dBm/MHz) | Duty Factor (dB) | Total Conducted PSD (dBm/MHz) | Limit Conducted (dBm/MHz) | Verdict |
|-----------|------|-----------------|---------|-------------------------|------------------|-------------------------------|---------------------------|---------|
| NVNT      | a    | 5500            | Ant1    | -1.36                   | 0.23             | -1.13                         | 11                        | Pass    |
| NVNT      | a    | 5580            | Ant1    | -0.94                   | 0.23             | -0.71                         | 11                        | Pass    |
| NVNT      | a    | 5700            | Ant1    | -2.6                    | 0.27             | -2.33                         | 11                        | Pass    |
| NVNT      | n20  | 5500            | Ant1    | -1.14                   | 0.11             | -1.03                         | 11                        | Pass    |
| NVNT      | n20  | 5580            | Ant1    | -0.92                   | 0.11             | -0.81                         | 11                        | Pass    |
| NVNT      | n20  | 5700            | Ant1    | -2.27                   | 0.11             | -2.16                         | 11                        | Pass    |
| NVNT      | n40  | 5510            | Ant1    | -4.7                    | 0.23             | -4.47                         | 11                        | Pass    |
| NVNT      | n40  | 5550            | Ant1    | -4.51                   | 0.23             | -4.28                         | 11                        | Pass    |
| NVNT      | n40  | 5670            | Ant1    | -5.21                   | 0.23             | -4.98                         | 11                        | Pass    |
| NVNT      | ac20 | 5500            | Ant1    | -1.72                   | 0.13             | -1.59                         | 11                        | Pass    |
| NVNT      | ac20 | 5580            | Ant1    | -1.05                   | 0.13             | -0.92                         | 11                        | Pass    |
| NVNT      | ac20 | 5700            | Ant1    | -2.33                   | 0.11             | -2.22                         | 11                        | Pass    |
| NVNT      | ac40 | 5510            | Ant1    | -4.75                   | 0.27             | -4.48                         | 11                        | Pass    |
| NVNT      | ac40 | 5550            | Ant1    | -4.24                   | 0.23             | -4.01                         | 11                        | Pass    |
| NVNT      | ac40 | 5670            | Ant1    | -5.72                   | 0.23             | -5.49                         | 11                        | Pass    |
| NVNT      | ac80 | 5530            | Ant1    | -8.57                   | 0.54             | -8.03                         | 11                        | Pass    |
| NVNT      | ac80 | 5610            | Ant1    | -8.28                   | 0.46             | -7.82                         | 11                        | Pass    |
| NVNT      | ax20 | 5500            | Ant1    | -1.43                   | 0.11             | -1.32                         | 11                        | Pass    |
| NVNT      | ax20 | 5580            | Ant1    | -0.86                   | 0.11             | -0.75                         | 11                        | Pass    |
| NVNT      | ax20 | 5700            | Ant1    | -2.2                    | 0.11             | -2.09                         | 11                        | Pass    |
| NVNT      | ax40 | 5510            | Ant1    | -4.6                    | 0.23             | -4.37                         | 11                        | Pass    |
| NVNT      | ax40 | 5550            | Ant1    | -5                      | 0.23             | -4.77                         | 11                        | Pass    |
| NVNT      | ax40 | 5670            | Ant1    | -5.79                   | 0.27             | -5.52                         | 11                        | Pass    |
| NVNT      | ax80 | 5530            | Ant1    | -9.19                   | 0.46             | -8.73                         | 11                        | Pass    |
| NVNT      | ax80 | 5610            | Ant1    | -8.27                   | 0.46             | -7.81                         | 11                        | Pass    |



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: [webmaster@lcs-cert.com](mailto:webmaster@lcs-cert.com) | Web: [www.lcs-cert.com](http://www.lcs-cert.com)

Scan code to check authenticity



| Condition | Mode | Frequency (MHz) | Antenna | Conducted PSD (dBm/MHz) | Duty Factor (dB) | Total Conducted PSD (dBm/MHz) | Limit Conducted (dBm/MHz) | Verdict |
|-----------|------|-----------------|---------|-------------------------|------------------|-------------------------------|---------------------------|---------|
| NVNT      | a    | 5500            | Ant2    | -5.84                   | 0.1              | -5.74                         | 11                        | Pass    |
| NVNT      | a    | 5580            | Ant2    | -5.72                   | 0.1              | -5.62                         | 11                        | Pass    |
| NVNT      | a    | 5700            | Ant2    | -5.47                   | 0.1              | -5.37                         | 11                        | Pass    |
| NVNT      | n20  | 5500            | Ant2    | -3.73                   | 0.11             | -3.62                         | 11                        | Pass    |
| NVNT      | n20  | 5580            | Ant2    | -1.18                   | 0.11             | -1.07                         | 11                        | Pass    |
| NVNT      | n20  | 5700            | Ant2    | -5.49                   | 0.13             | -5.36                         | 11                        | Pass    |
| NVNT      | n40  | 5510            | Ant2    | -5.66                   | 0.23             | -5.43                         | 11                        | Pass    |
| NVNT      | n40  | 5550            | Ant2    | -11.38                  | 0.23             | -11.15                        | 11                        | Pass    |
| NVNT      | n40  | 5670            | Ant2    | -6.92                   | 0.27             | -6.65                         | 11                        | Pass    |
| NVNT      | ac20 | 5500            | Ant2    | -3.7                    | 0.11             | -3.59                         | 11                        | Pass    |
| NVNT      | ac20 | 5580            | Ant2    | -2.68                   | 0.11             | -2.57                         | 11                        | Pass    |
| NVNT      | ac20 | 5700            | Ant2    | -4.35                   | 0.11             | -4.24                         | 11                        | Pass    |
| NVNT      | ac40 | 5510            | Ant2    | -5.53                   | 0.27             | -5.26                         | 11                        | Pass    |
| NVNT      | ac40 | 5550            | Ant2    | -5.49                   | 0.23             | -5.26                         | 11                        | Pass    |
| NVNT      | ac40 | 5670            | Ant2    | -7.08                   | 0.27             | -6.81                         | 11                        | Pass    |
| NVNT      | ac80 | 5530            | Ant2    | -9.33                   | 0.54             | -8.79                         | 11                        | Pass    |
| NVNT      | ac80 | 5610            | Ant2    | -8.42                   | 0.46             | -7.96                         | 11                        | Pass    |
| NVNT      | ax20 | 5500            | Ant2    | -3.61                   | 0.11             | -3.5                          | 11                        | Pass    |
| NVNT      | ax20 | 5580            | Ant2    | -3.66                   | 0.11             | -3.55                         | 11                        | Pass    |
| NVNT      | ax20 | 5700            | Ant2    | -4.33                   | 0.11             | -4.22                         | 11                        | Pass    |
| NVNT      | ax40 | 5510            | Ant2    | -5.64                   | 0.27             | -5.37                         | 11                        | Pass    |
| NVNT      | ax40 | 5550            | Ant2    | -5.43                   | 0.23             | -5.2                          | 11                        | Pass    |
| NVNT      | ax40 | 5670            | Ant2    | -6.9                    | 0.23             | -6.67                         | 11                        | Pass    |
| NVNT      | ax80 | 5530            | Ant2    | -9.4                    | 0.47             | -8.93                         | 11                        | Pass    |
| NVNT      | ax80 | 5610            | Ant2    | -8.57                   | 0.54             | -8.04                         | 11                        | Pass    |



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A &amp; 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: [webmaster@lcs-cert.com](mailto:webmaster@lcs-cert.com) | Web: [www.lcs-cert.com](http://www.lcs-cert.com)

Scan code to check authenticity



## MIMO

| Condition | Mode | Frequency (MHz) | Conducted PSD (dBm/MHz) |        | Total PSD (dBm/MHz) | Limit (dBm/MHz) | Verdict |
|-----------|------|-----------------|-------------------------|--------|---------------------|-----------------|---------|
|           |      |                 | Duty Factor (dB)        |        |                     |                 |         |
|           |      |                 | Ant1                    | Ant2   |                     |                 |         |
| NVNT      | n20  | 5500            | -1.03                   | -3.62  | 0.88                | 11              | Pass    |
| NVNT      | n20  | 5580            | -0.81                   | -1.07  | 2.07                | 11              | Pass    |
| NVNT      | n20  | 5700            | -2.16                   | -5.36  | -0.46               | 11              | Pass    |
| NVNT      | n40  | 5510            | -4.47                   | -5.43  | -1.91               | 11              | Pass    |
| NVNT      | n40  | 5550            | -4.28                   | -11.15 | -3.47               | 11              | Pass    |
| NVNT      | n40  | 5670            | -4.98                   | -6.65  | -2.72               | 11              | Pass    |
| NVNT      | ac20 | 5500            | -1.59                   | -3.59  | 0.53                | 11              | Pass    |
| NVNT      | ac20 | 5580            | -0.92                   | -2.57  | 1.34                | 11              | Pass    |
| NVNT      | ac20 | 5700            | -2.22                   | -4.24  | -0.10               | 11              | Pass    |
| NVNT      | ac40 | 5510            | -4.48                   | -5.26  | -1.84               | 11              | Pass    |
| NVNT      | ac40 | 5550            | -4.01                   | -5.26  | -1.58               | 11              | Pass    |
| NVNT      | ac40 | 5670            | -5.49                   | -6.81  | -3.09               | 11              | Pass    |
| NVNT      | ac80 | 5530            | -8.03                   | -8.79  | -5.38               | 11              | Pass    |
| NVNT      | ac80 | 5610            | -7.82                   | -7.96  | -4.88               | 11              | Pass    |
| NVNT      | ax20 | 5500            | -1.32                   | -3.5   | 0.74                | 11              | Pass    |
| NVNT      | ax20 | 5580            | -0.75                   | -3.55  | 1.08                | 11              | Pass    |
| NVNT      | ax20 | 5700            | -2.09                   | -4.22  | -0.02               | 11              | Pass    |
| NVNT      | ax40 | 5510            | -4.37                   | -5.37  | -1.83               | 11              | Pass    |
| NVNT      | ax40 | 5550            | -4.77                   | -5.2   | -1.97               | 11              | Pass    |
| NVNT      | ax40 | 5670            | -5.52                   | -6.67  | -3.05               | 11              | Pass    |
| NVNT      | ax80 | 5530            | -8.73                   | -8.93  | -5.82               | 11              | Pass    |
| NVNT      | ax80 | 5610            | -7.81                   | -8.04  | -4.91               | 11              | Pass    |




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A &amp; 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: [webmaster@lcs-cert.com](mailto:webmaster@lcs-cert.com) | Web: [www.lcs-cert.com](http://www.lcs-cert.com)

Scan code to check authenticity

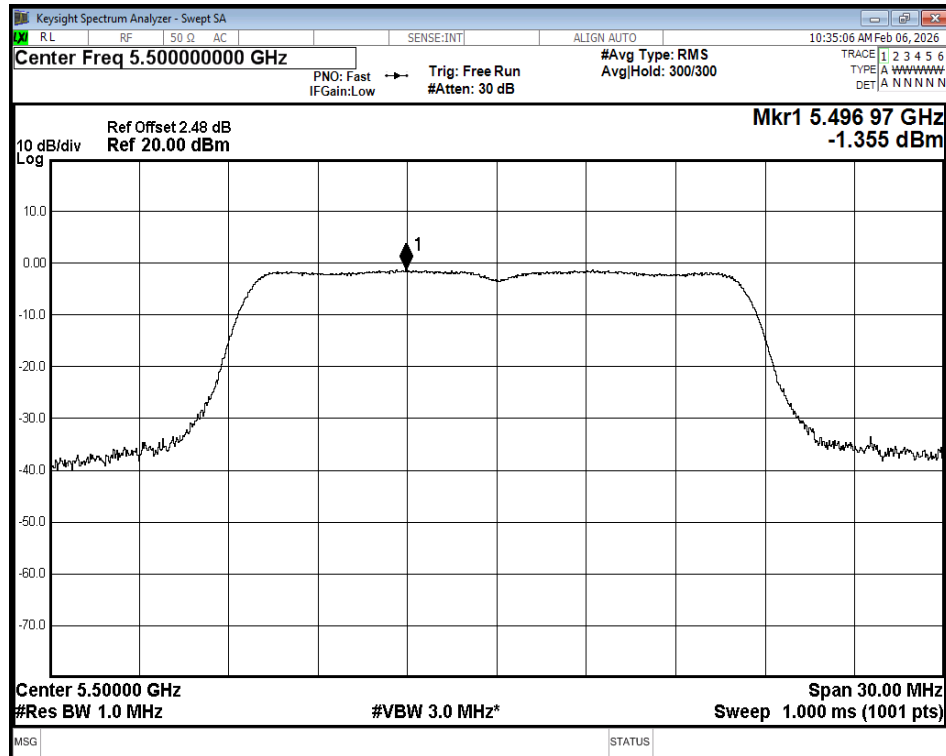

PSD NVNT a 5500MHz Ant1

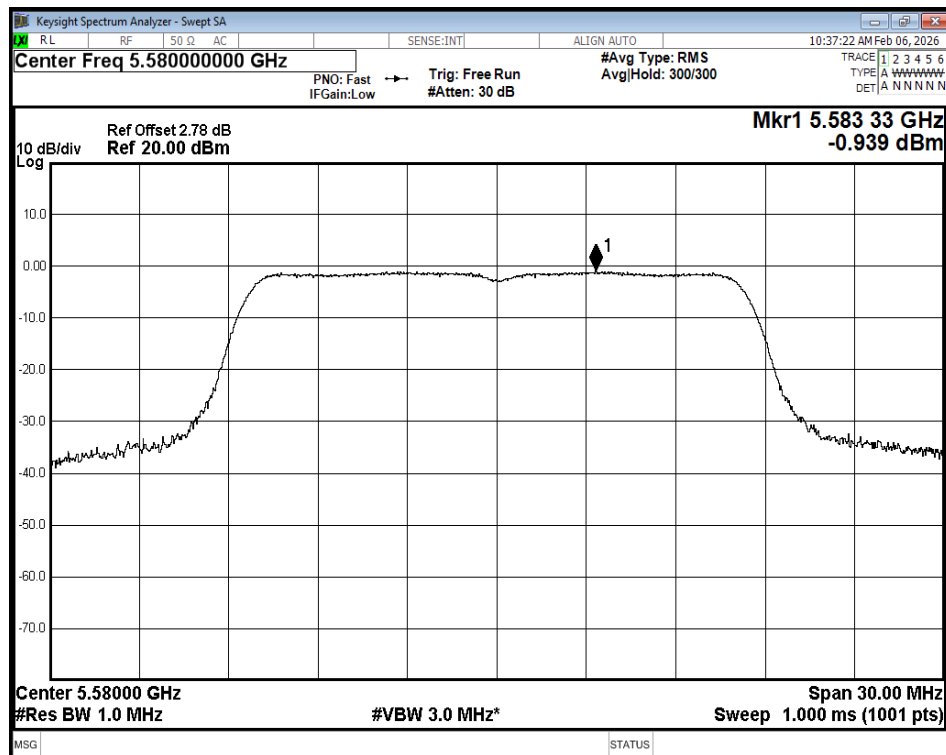

PSD NVNT a 5580MHz Ant1




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A &amp; 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

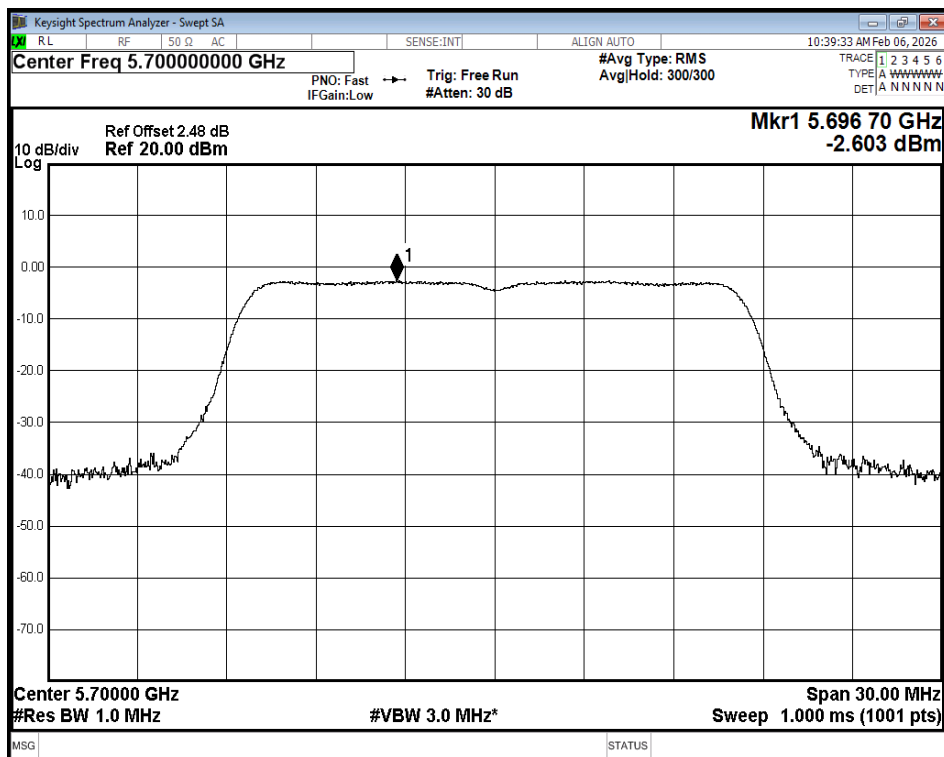

PSD NVNT a 5700MHz Ant1

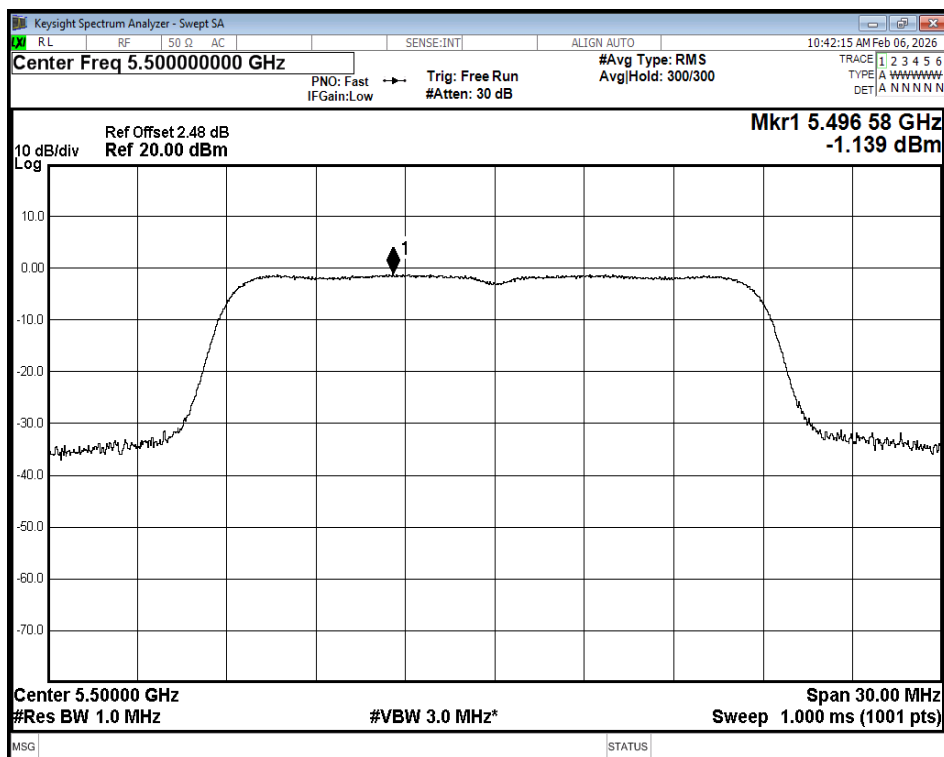

PSD NVNT n20 5500MHz Ant1




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A &amp; 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: [webmaster@lcs-cert.com](mailto:webmaster@lcs-cert.com) | Web: [www.lcs-cert.com](http://www.lcs-cert.com)

Scan code to check authenticity

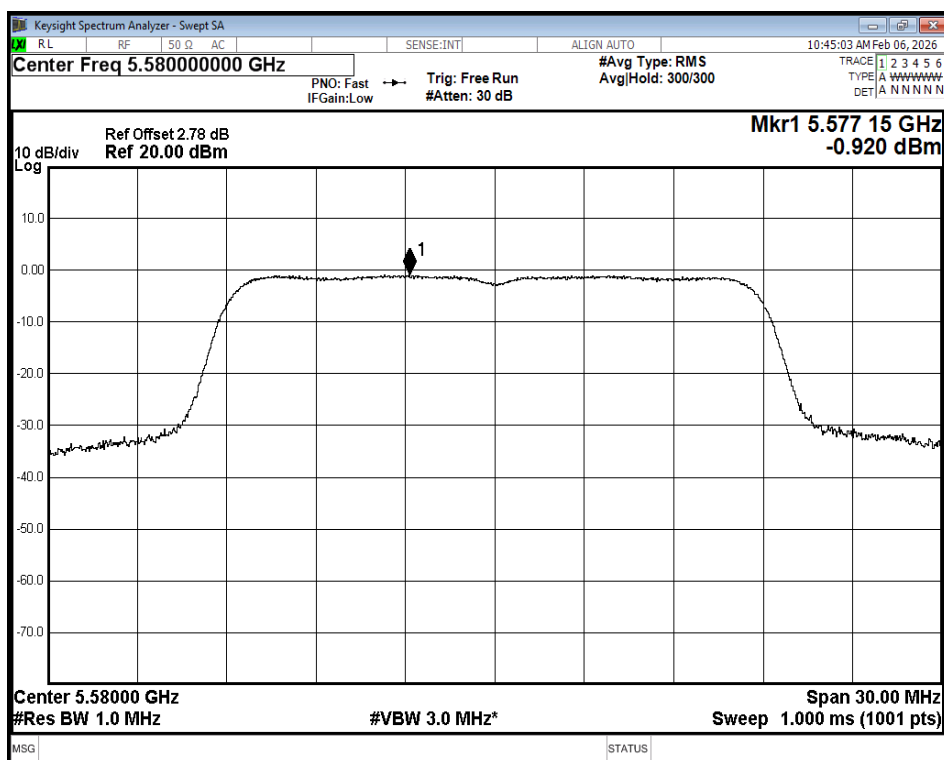

PSD NVNT n20 5580MHz Ant1

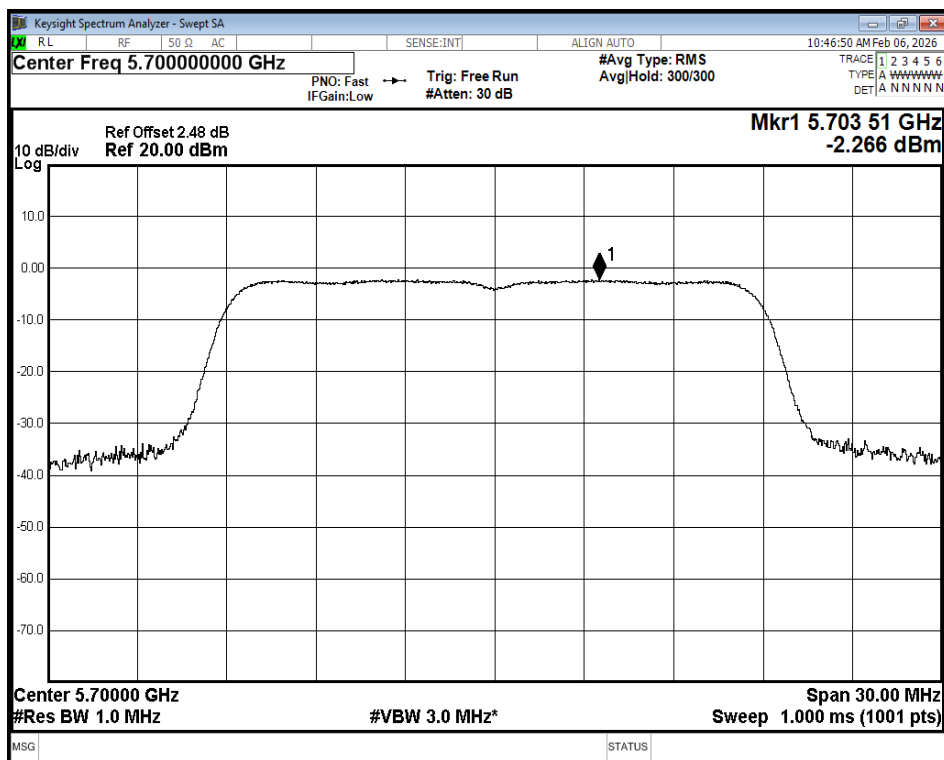

PSD NVNT n20 5700MHz Ant1




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A &amp; 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

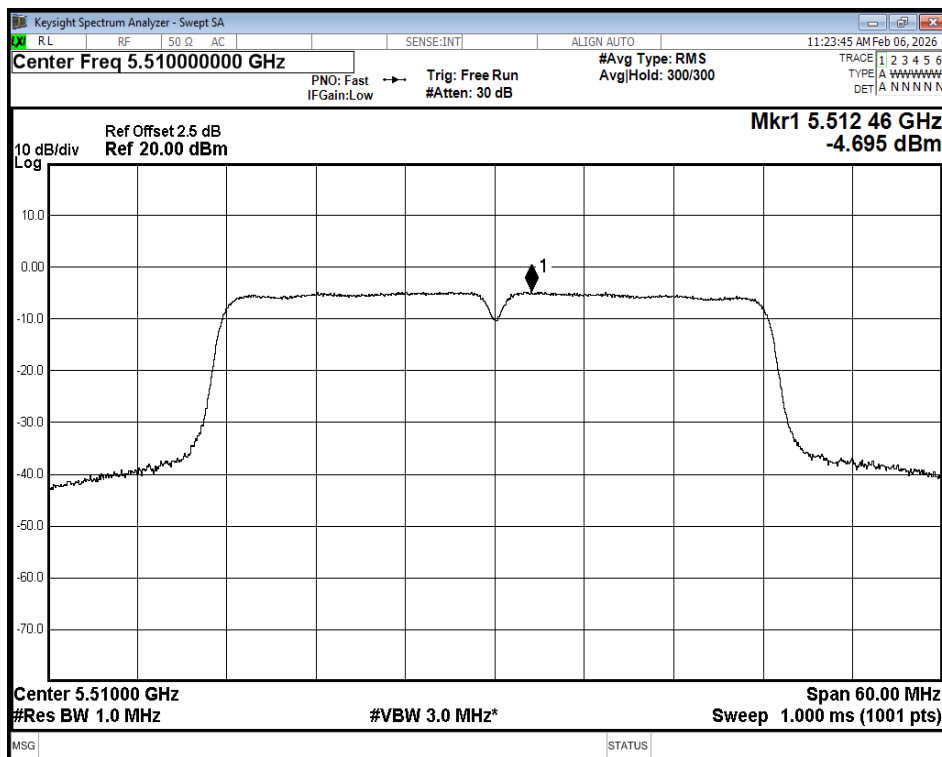

PSD NVNT n40 5510MHz Ant1

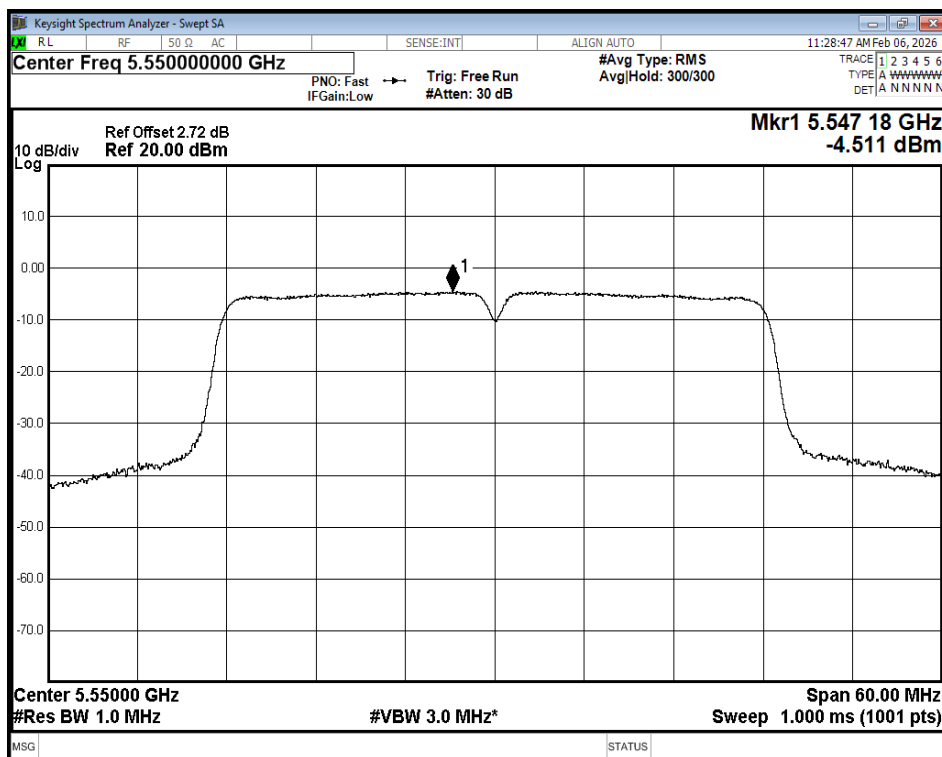

PSD NVNT n40 5550MHz Ant1




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A &amp; 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: [webmaster@lcs-cert.com](mailto:webmaster@lcs-cert.com) | Web: [www.lcs-cert.com](http://www.lcs-cert.com)

Scan code to check authenticity

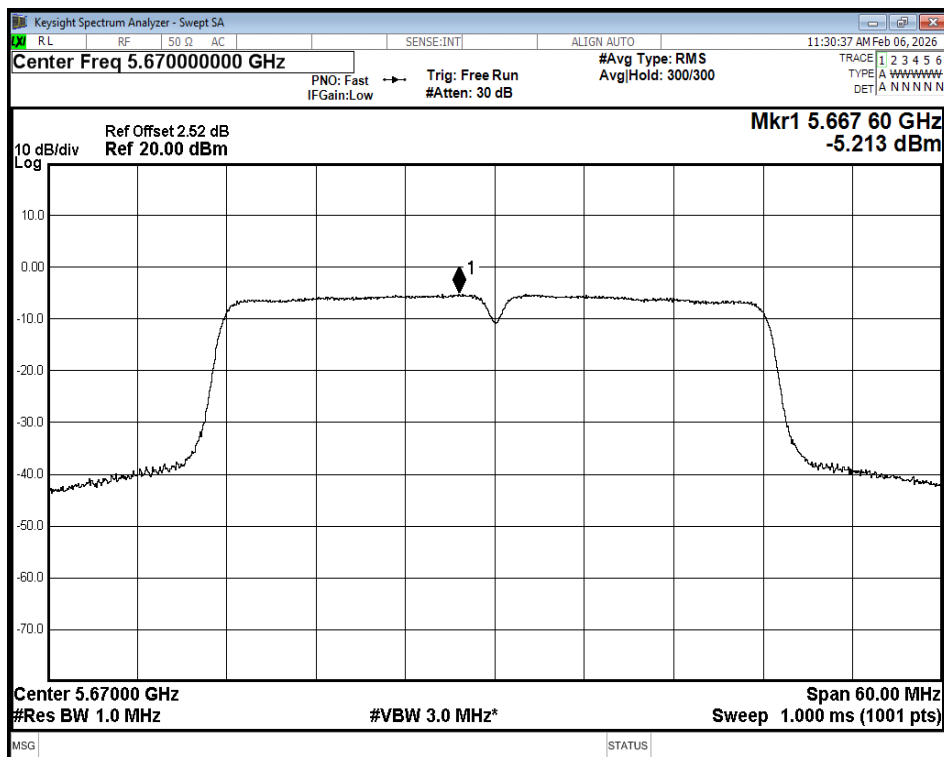

PSD NVNT n40 5670MHz Ant1

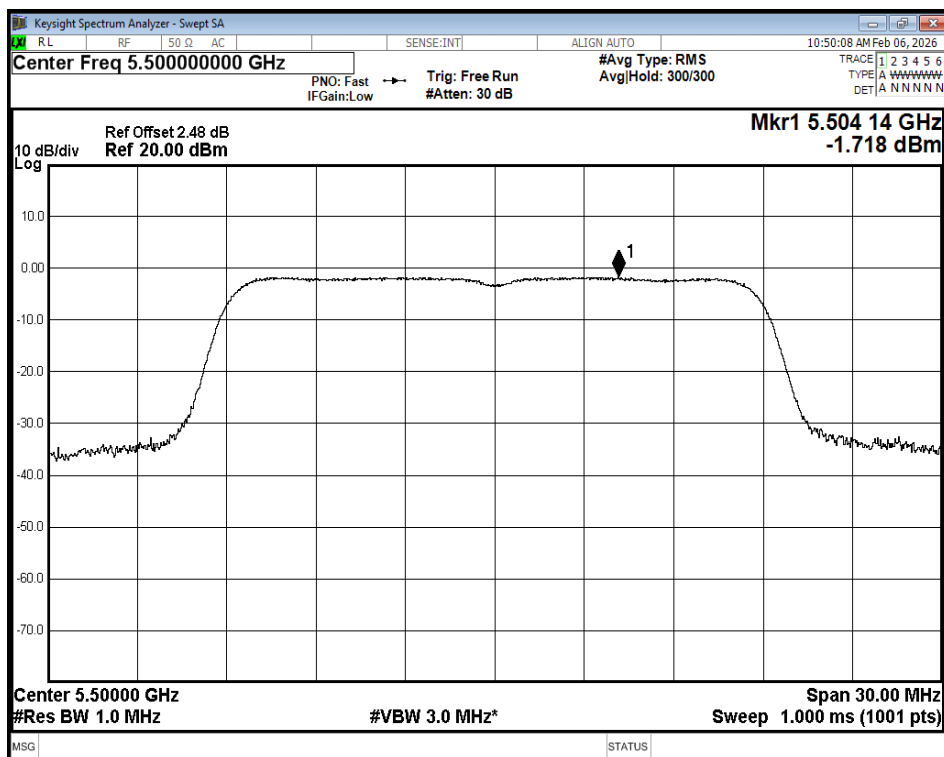

PSD NVNT ac20 5500MHz Ant1




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A &amp; 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

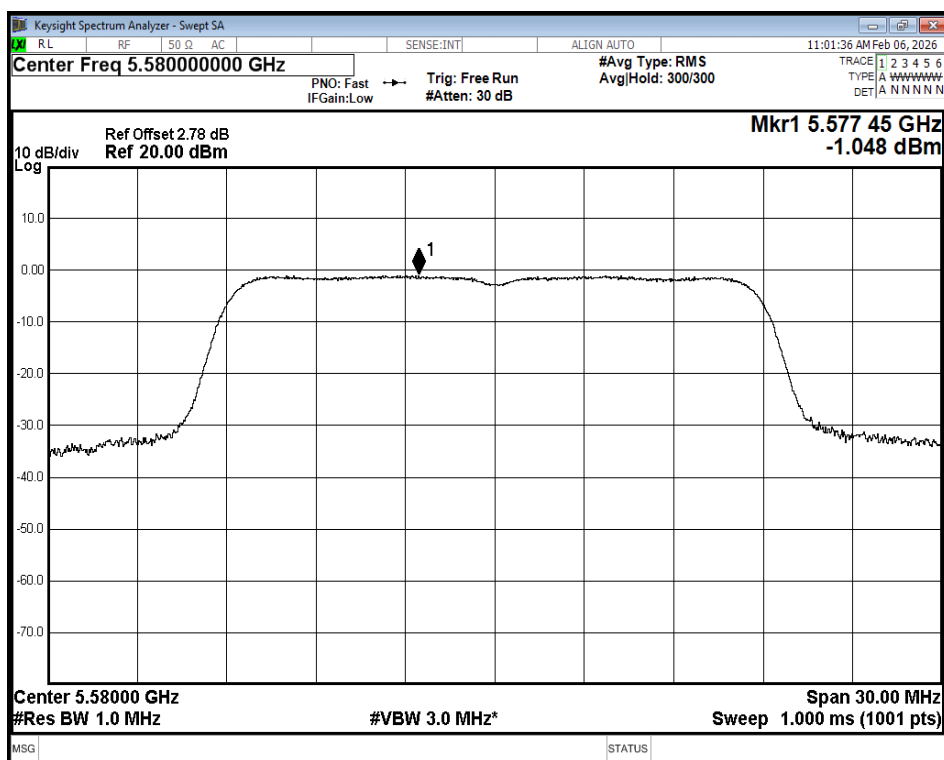

PSD NVNT ac20 5580MHz Ant1

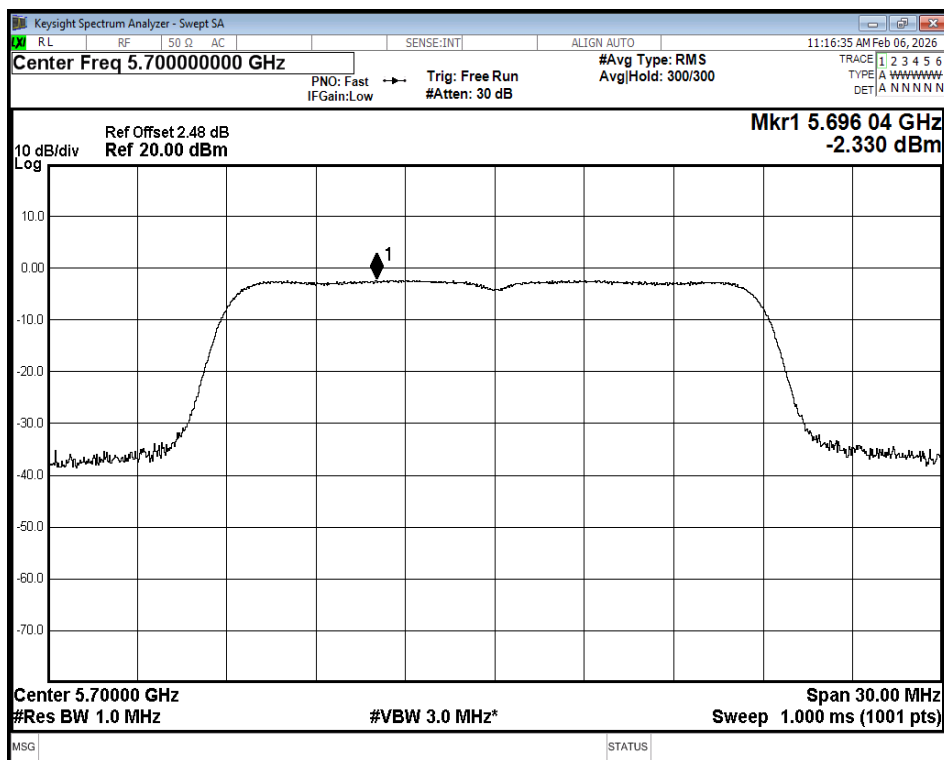

PSD NVNT ac20 5700MHz Ant1




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A &amp; 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: [webmaster@lcs-cert.com](mailto:webmaster@lcs-cert.com) | Web: [www.lcs-cert.com](http://www.lcs-cert.com)

Scan code to check authenticity

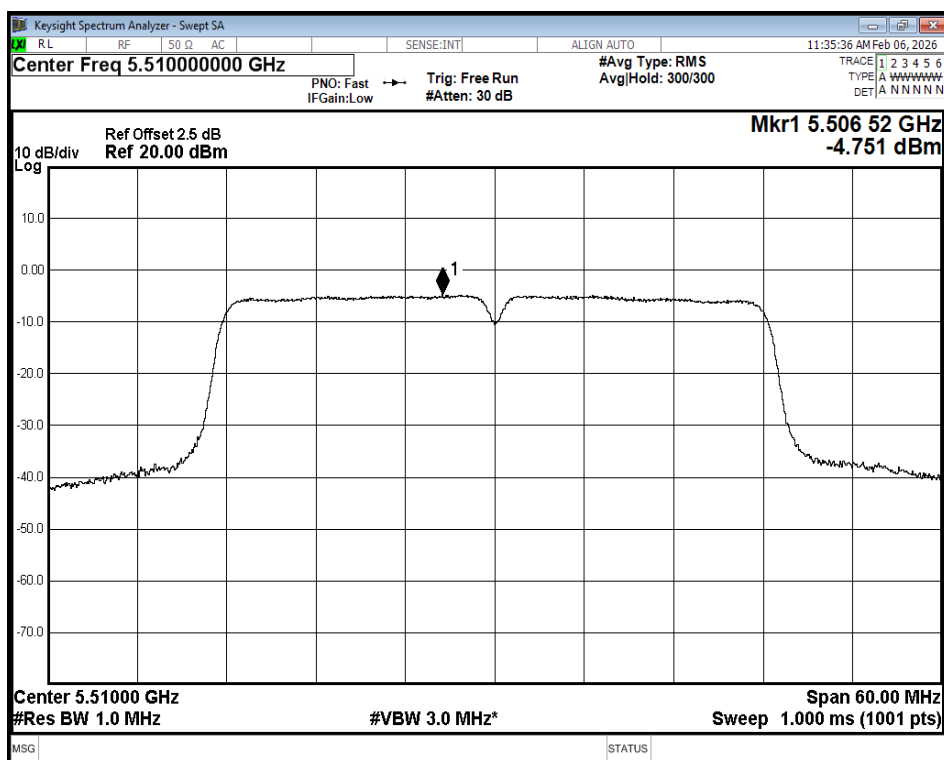

PSD NVNT ac40 5510MHz Ant1

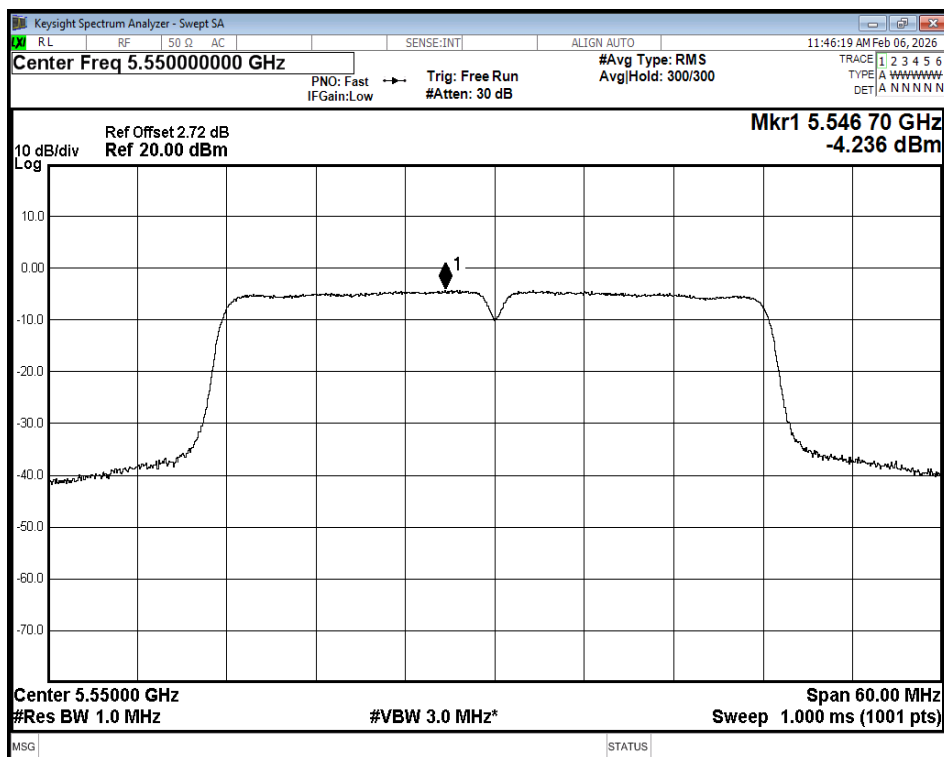

PSD NVNT ac40 5550MHz Ant1




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A &amp; 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: [webmaster@lcs-cert.com](mailto:webmaster@lcs-cert.com) | Web: [www.lcs-cert.com](http://www.lcs-cert.com)

Scan code to check authenticity

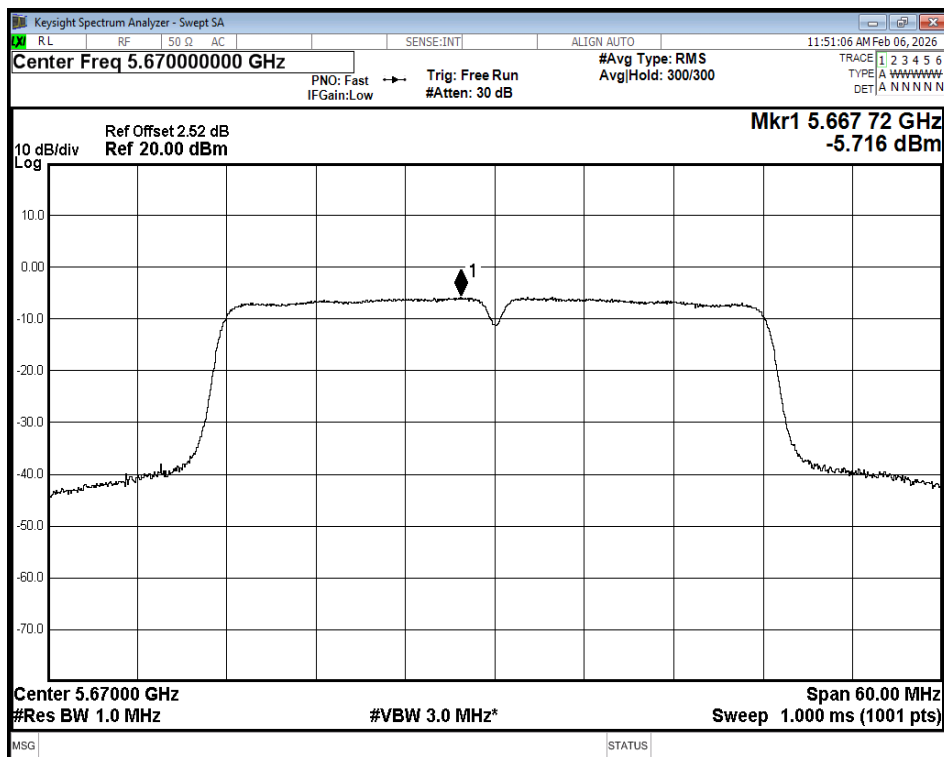

PSD NVNT ac40 5670MHz Ant1

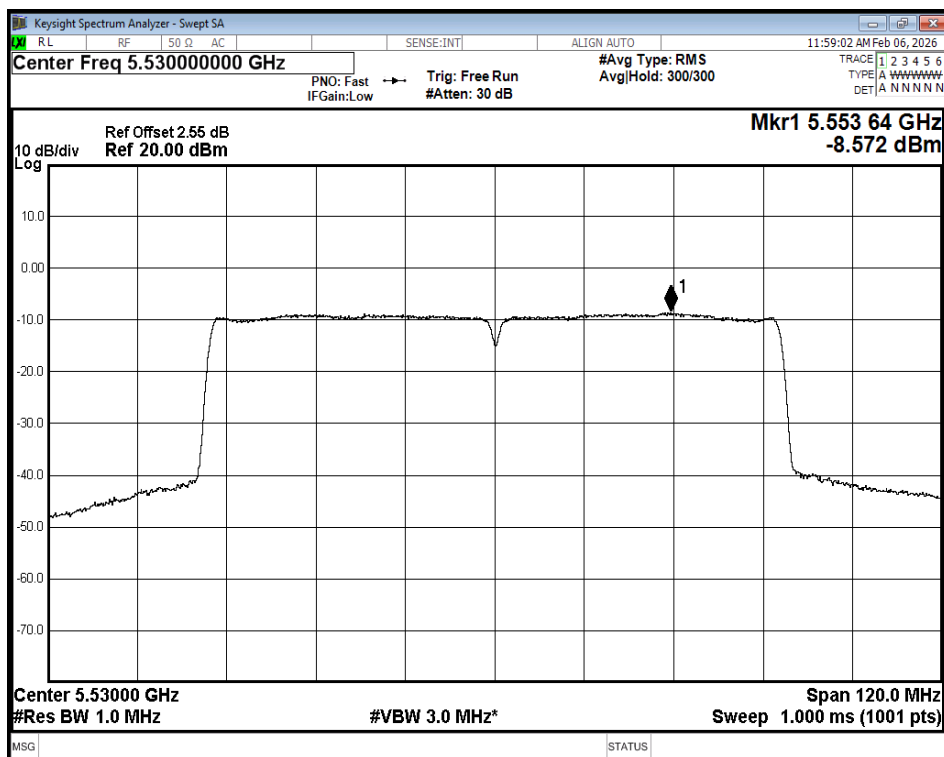

PSD NVNT ac80 5530MHz Ant1




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A &amp; 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

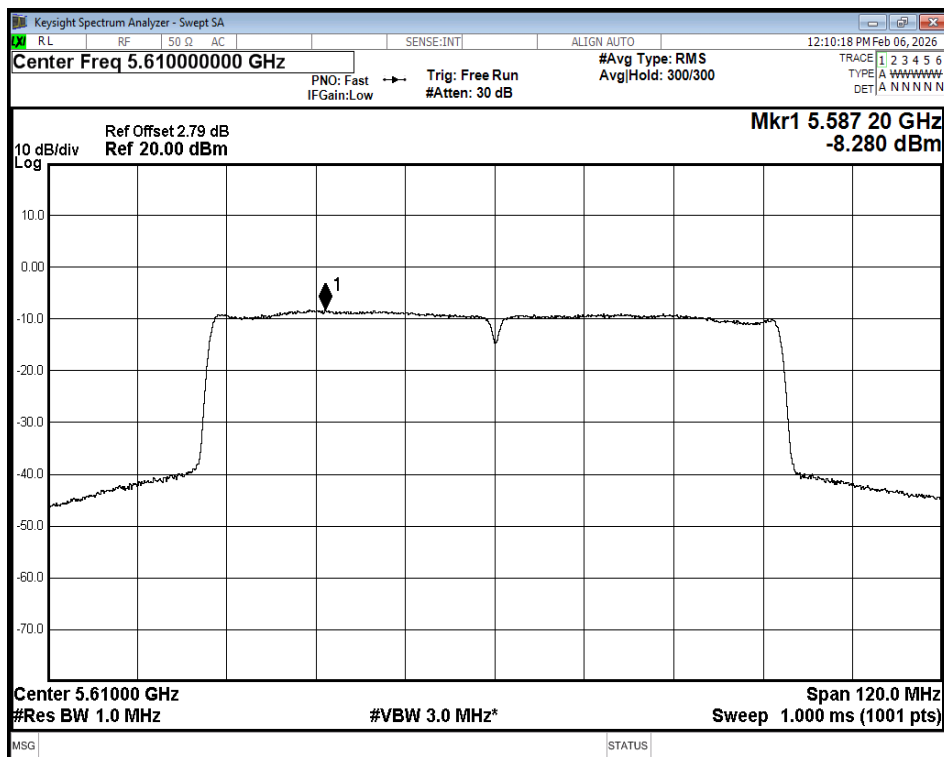

PSD NVNT ac80 5610MHz Ant1

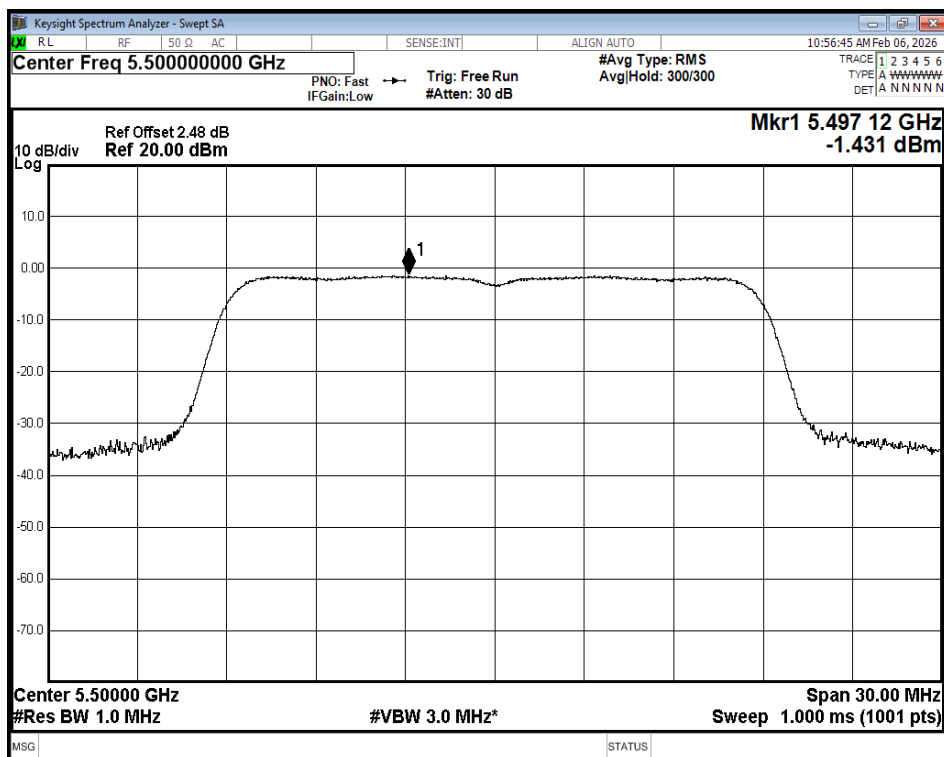

PSD NVNT ax20 5500MHz Ant1




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A &amp; 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: [webmaster@lcs-cert.com](mailto:webmaster@lcs-cert.com) | Web: [www.lcs-cert.com](http://www.lcs-cert.com)

Scan code to check authenticity

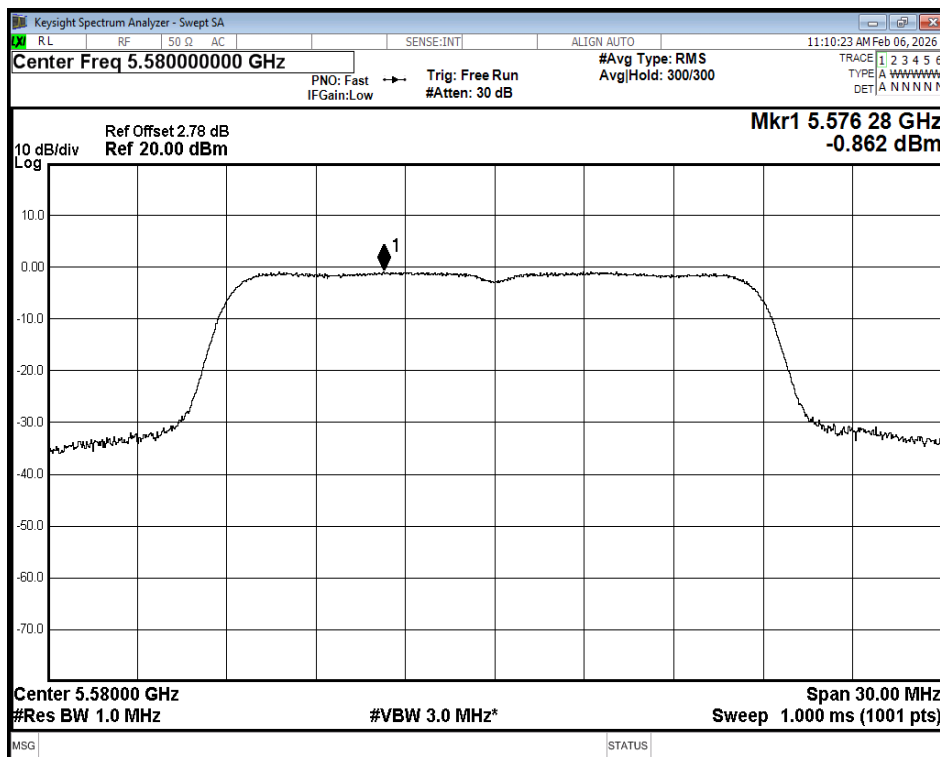

PSD NVNT ax20 5580MHz Ant1

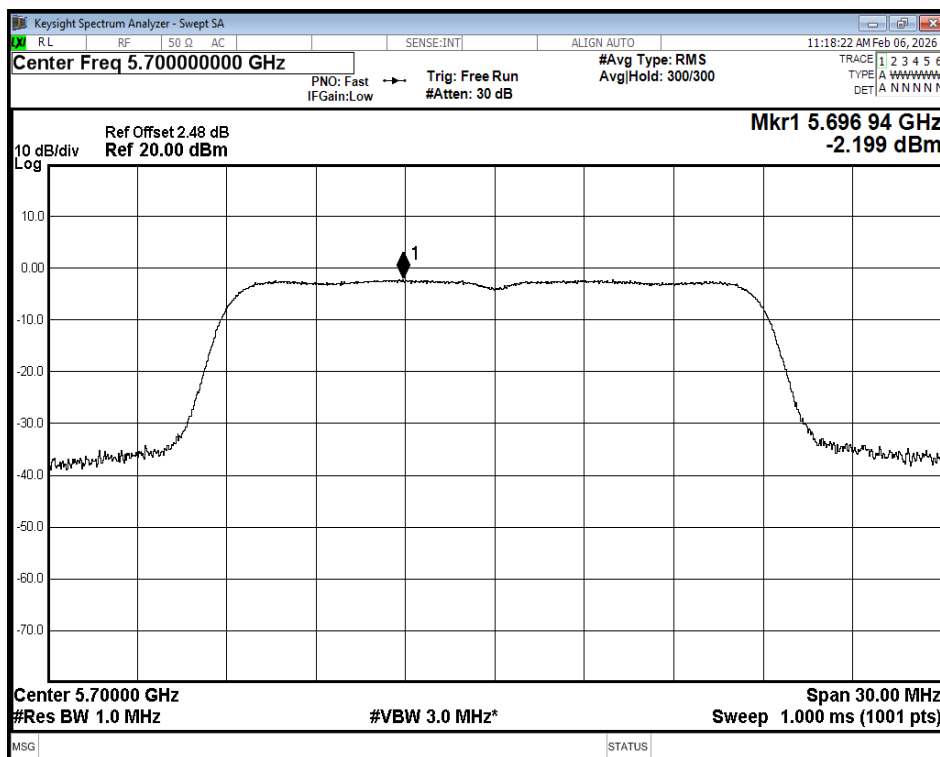

PSD NVNT ax20 5700MHz Ant1




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A &amp; 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

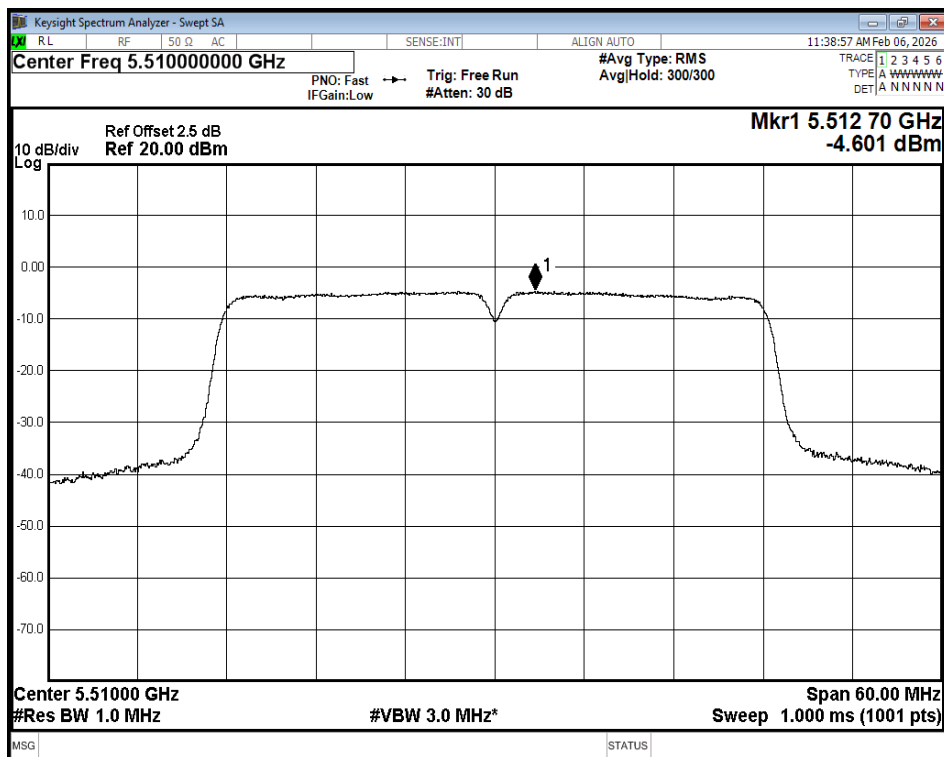

PSD NVNT ax40 5510MHz Ant1

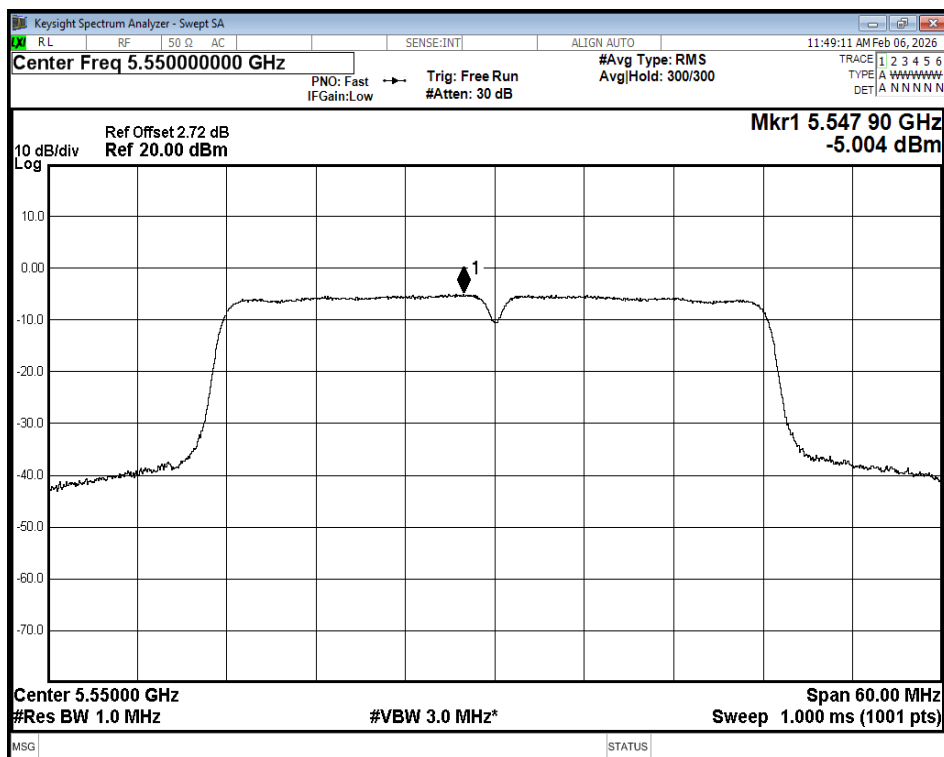

PSD NVNT ax40 5550MHz Ant1




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A &amp; 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: [webmaster@lcs-cert.com](mailto:webmaster@lcs-cert.com) | Web: [www.lcs-cert.com](http://www.lcs-cert.com)

Scan code to check authenticity

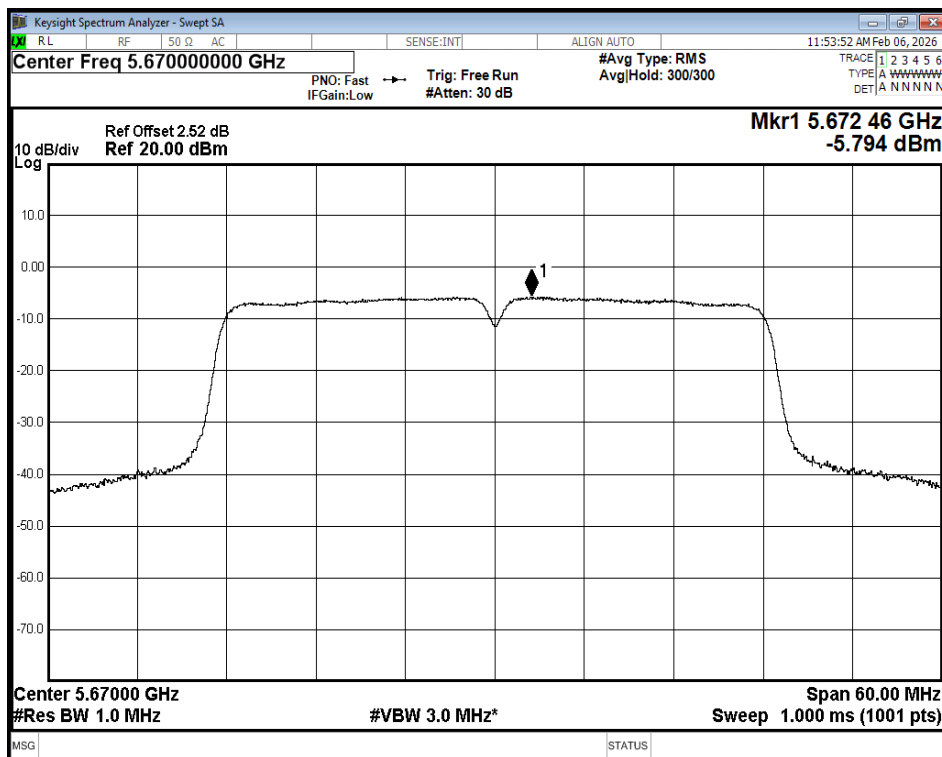

PSD NVNT ax40 5670MHz Ant1

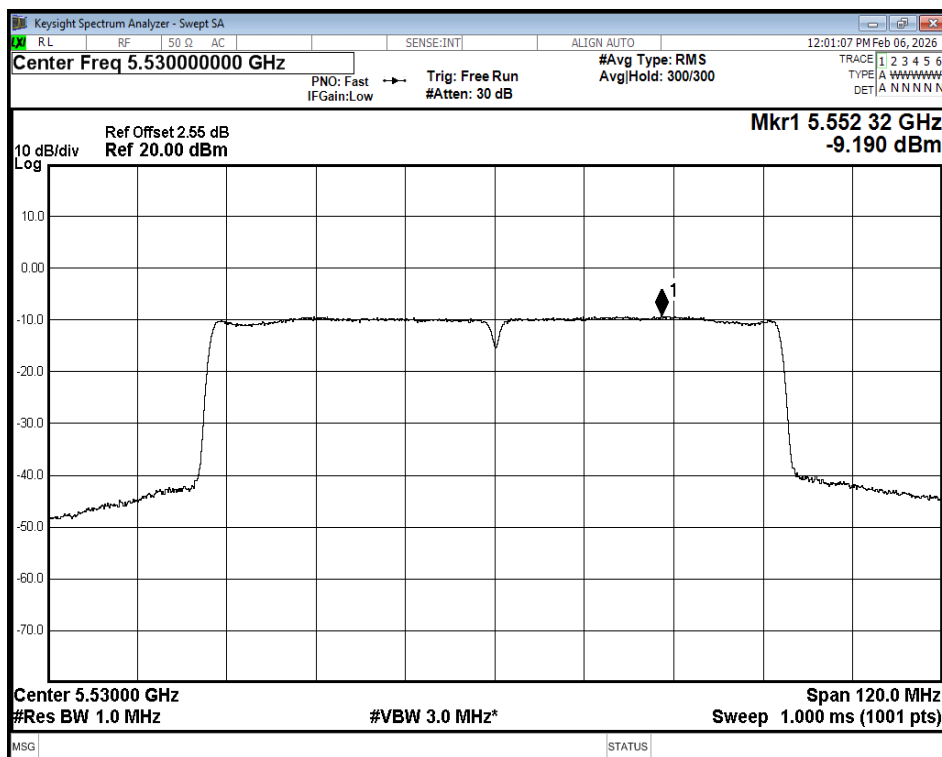

PSD NVNT ax80 5530MHz Ant1




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A &amp; 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

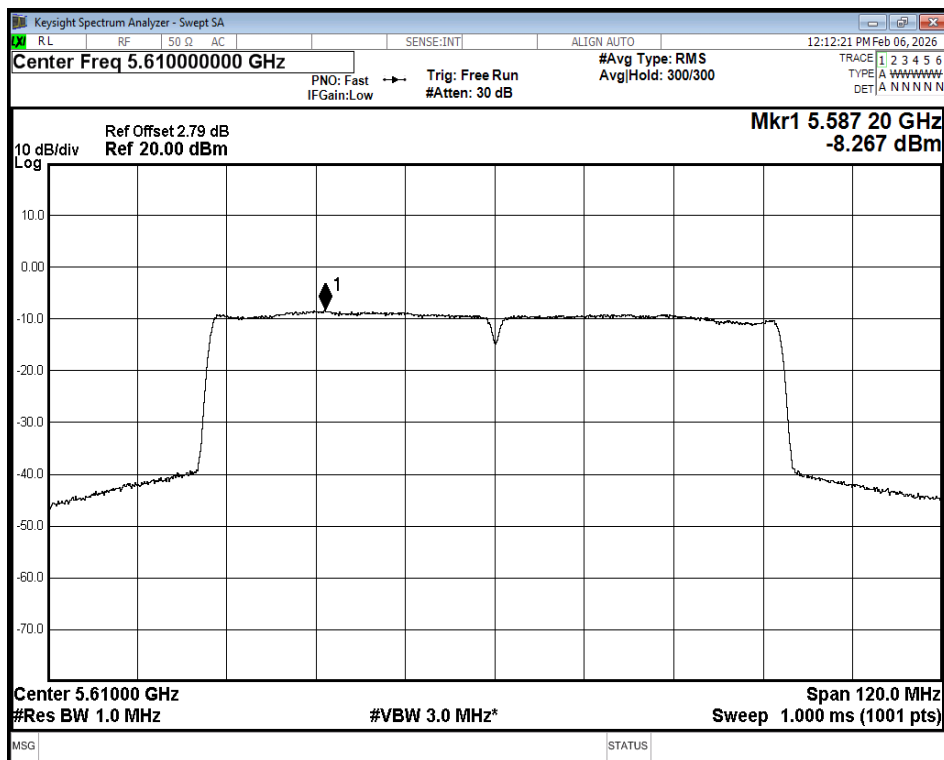

PSD NVNT ax80 5610MHz Ant1

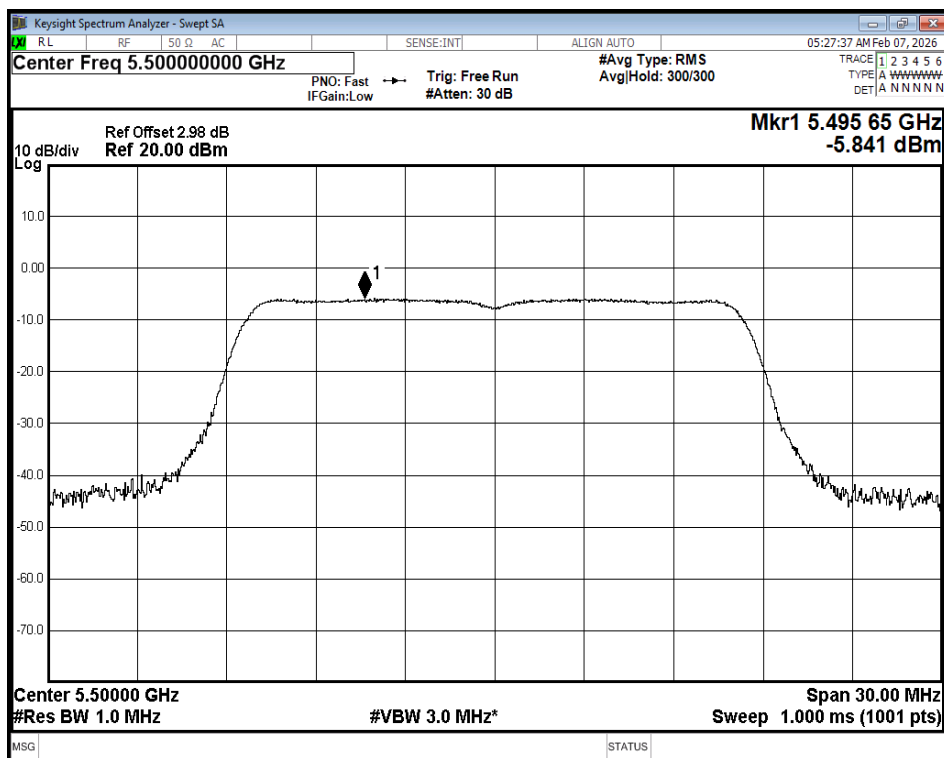

PSD NVNT a 5500MHz Ant2




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A &amp; 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

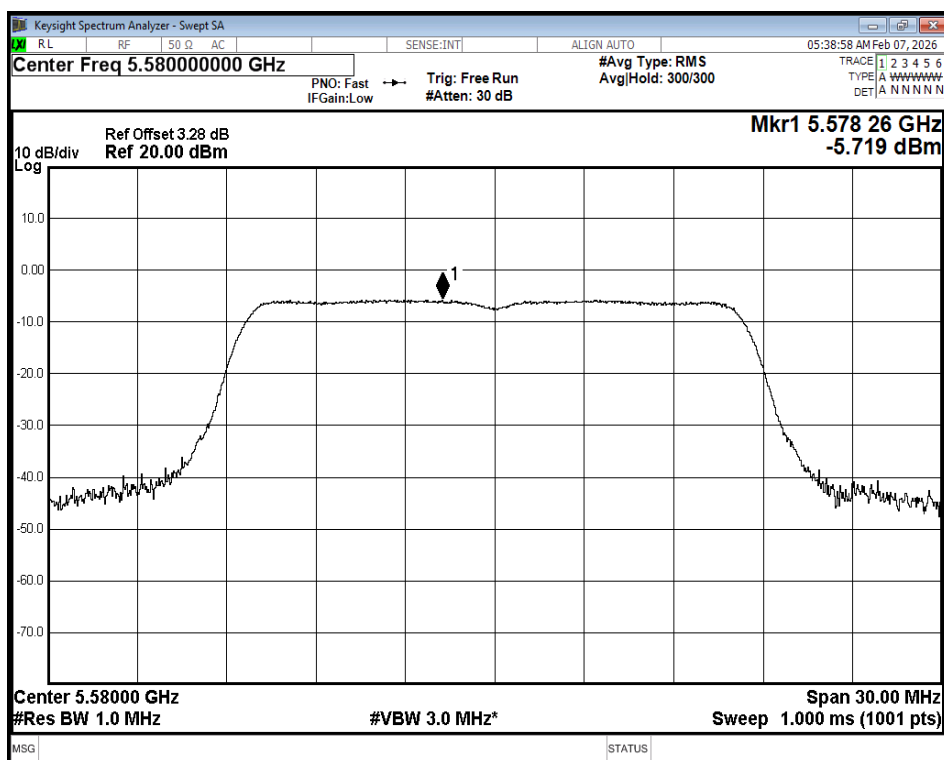

PSD NVNT a 5580MHz Ant2

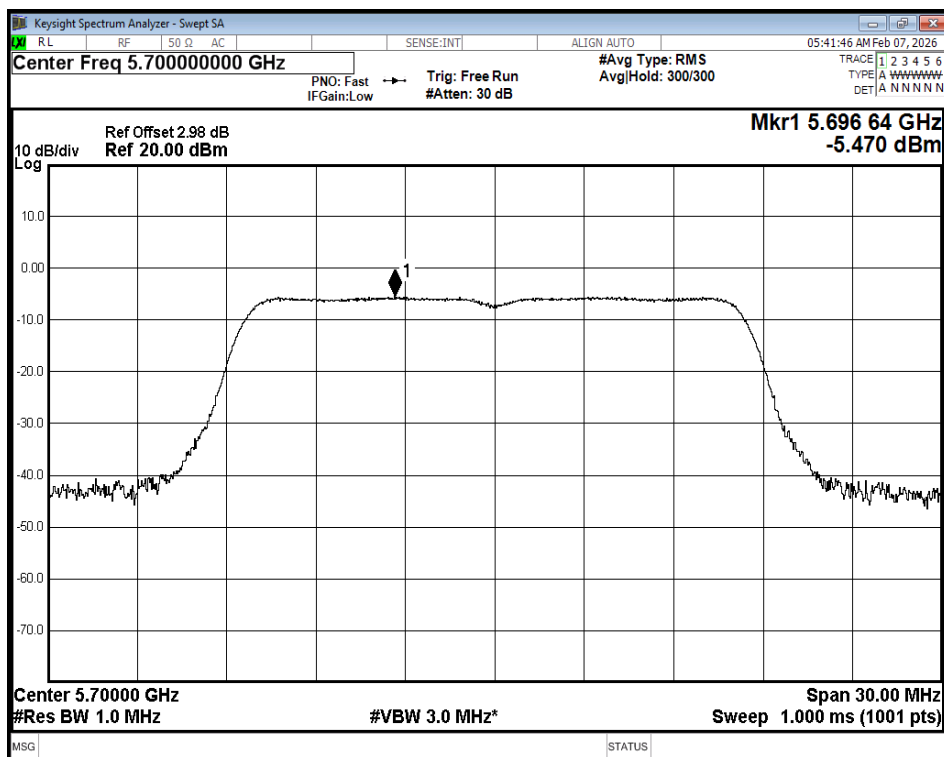

PSD NVNT a 5700MHz Ant2




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A &amp; 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

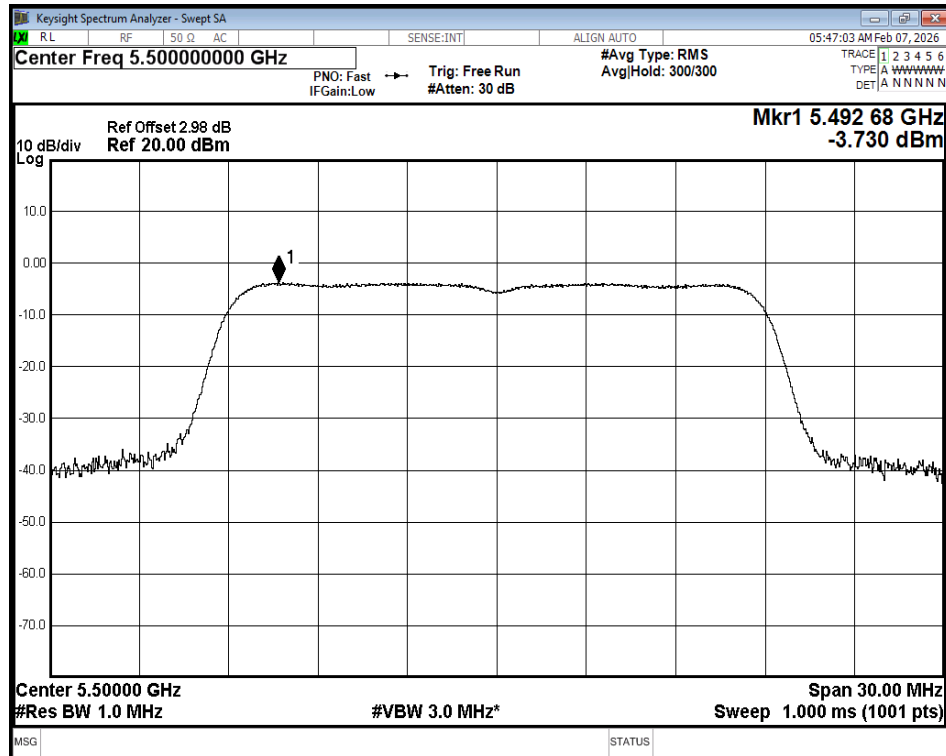

PSD NVNT n20 5500MHz Ant2

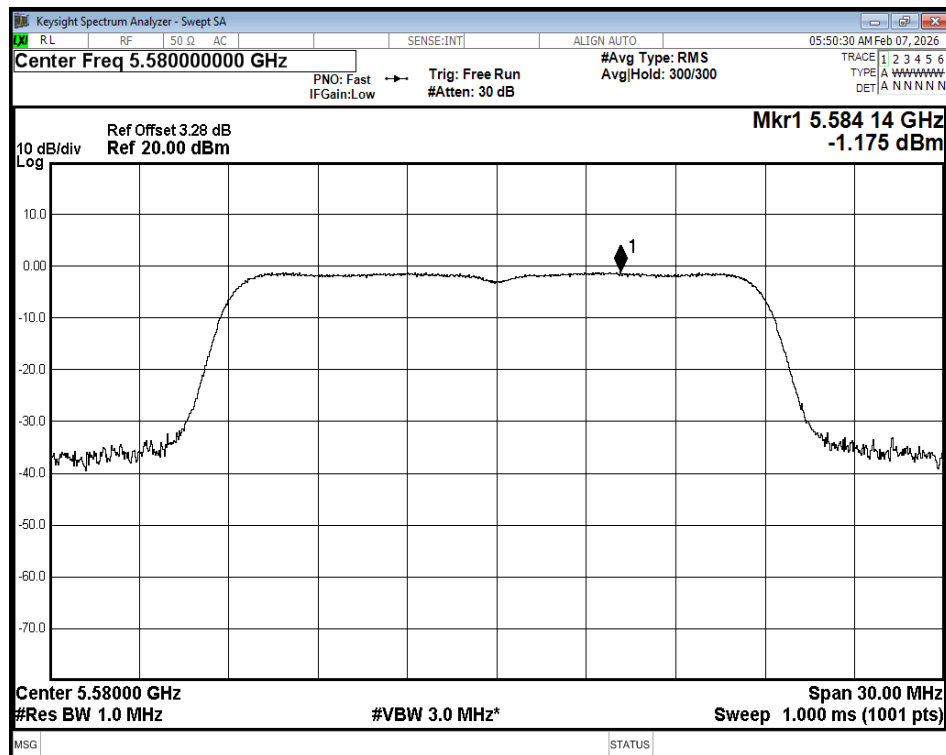

PSD NVNT n20 5580MHz Ant2




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A &amp; 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: [webmaster@lcs-cert.com](mailto:webmaster@lcs-cert.com) | Web: [www.lcs-cert.com](http://www.lcs-cert.com)

Scan code to check authenticity

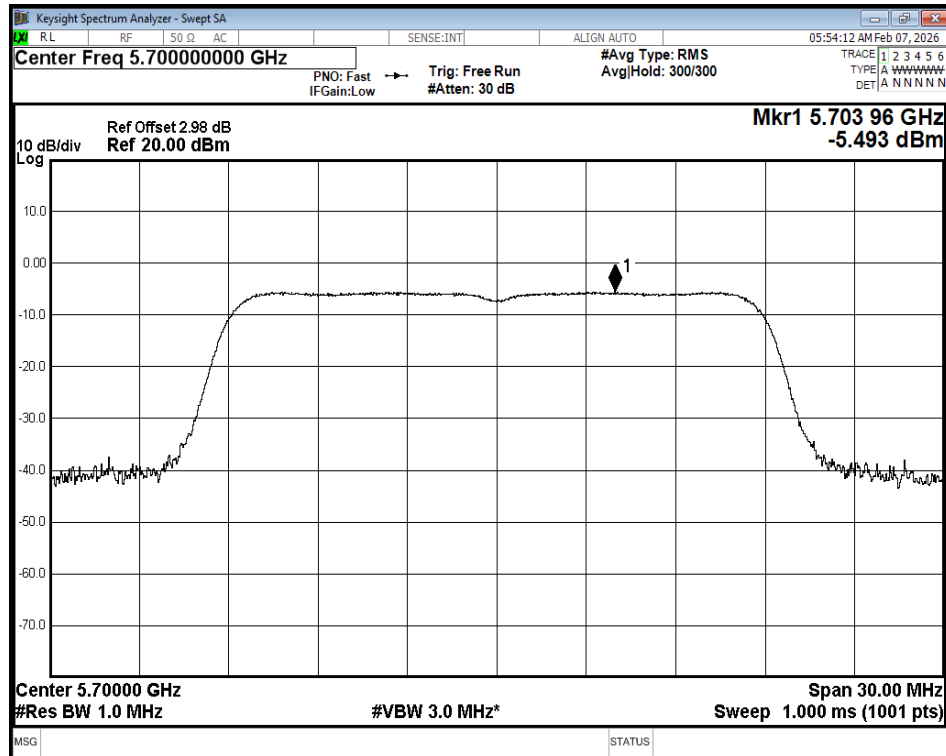

PSD NVNT n20 5700MHz Ant2

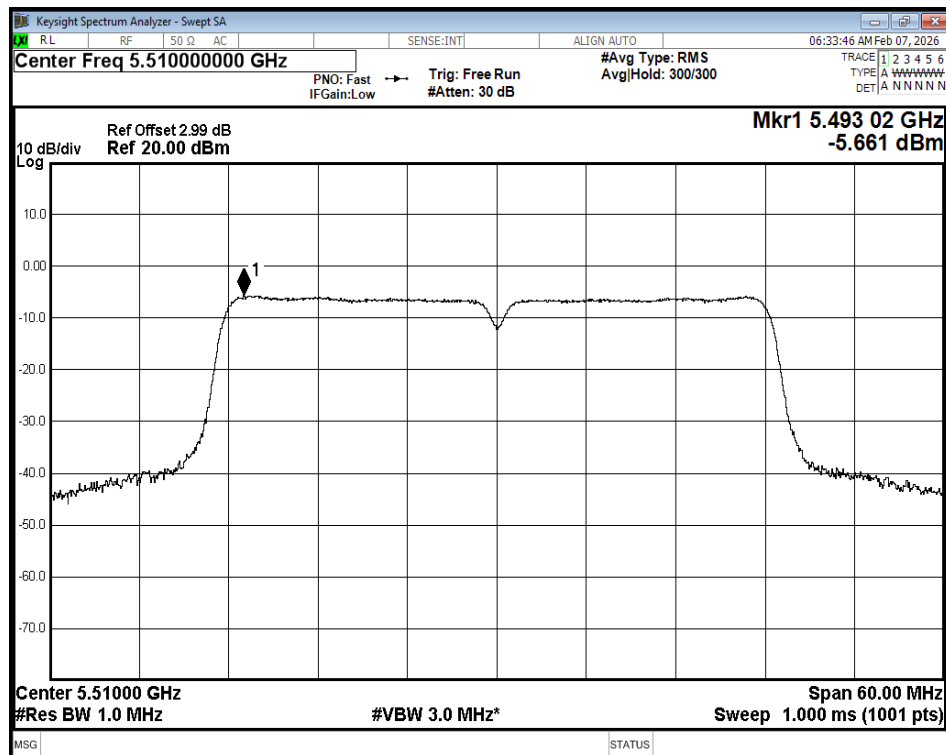

PSD NVNT n40 5510MHz Ant2




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A &amp; 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: [webmaster@lcs-cert.com](mailto:webmaster@lcs-cert.com) | Web: [www.lcs-cert.com](http://www.lcs-cert.com)

Scan code to check authenticity

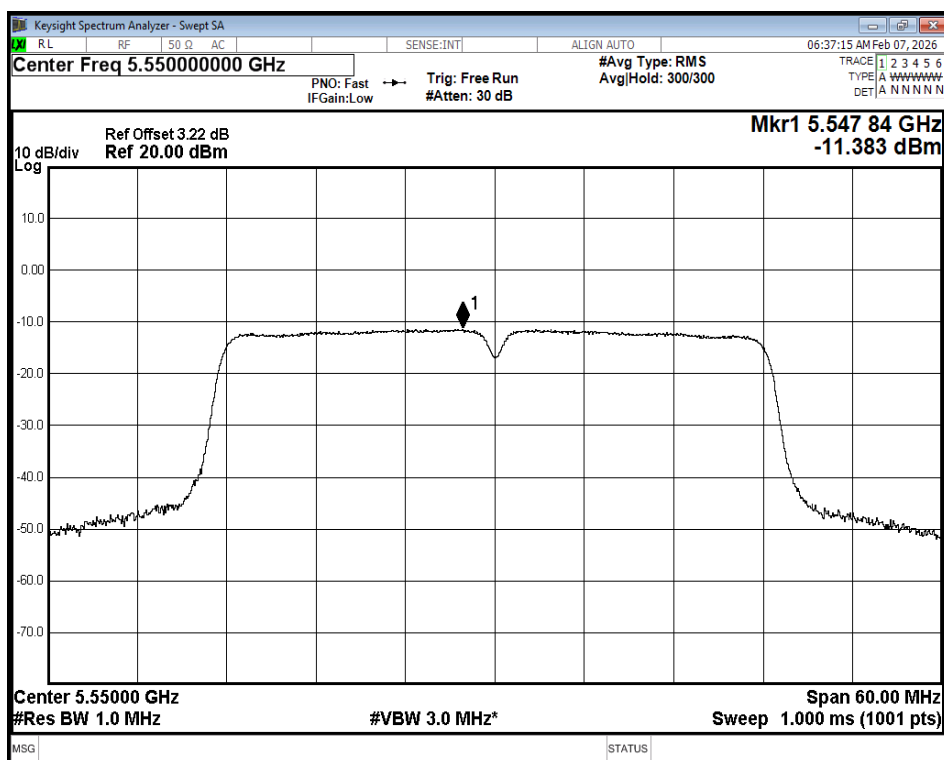

PSD NVNT n40 5550MHz Ant2

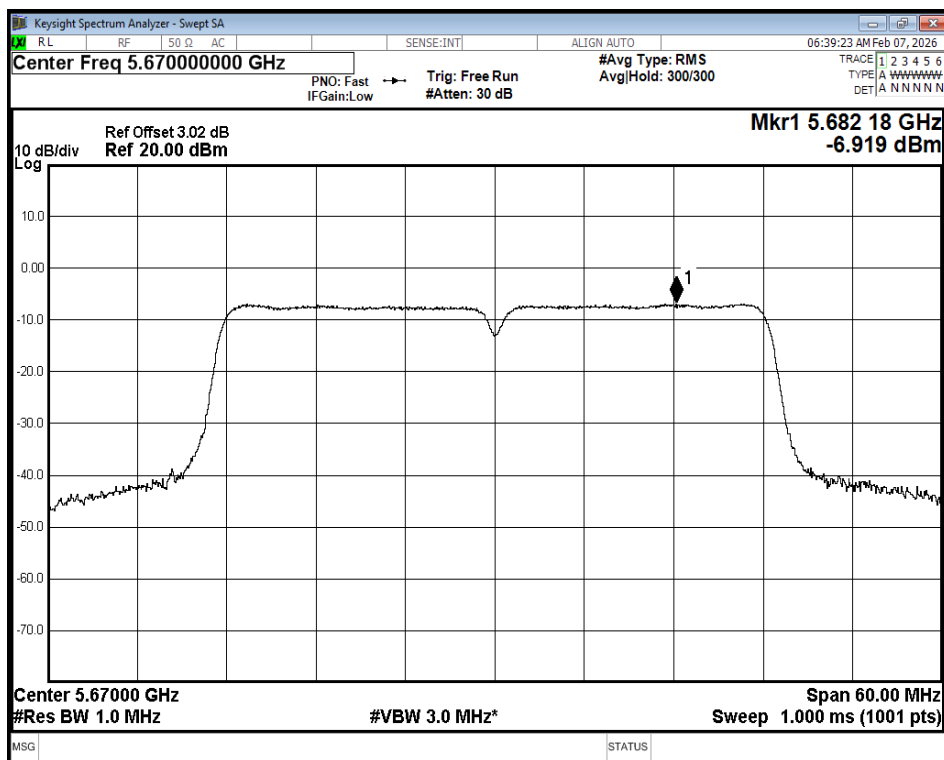

PSD NVNT n40 5670MHz Ant2




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A &amp; 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

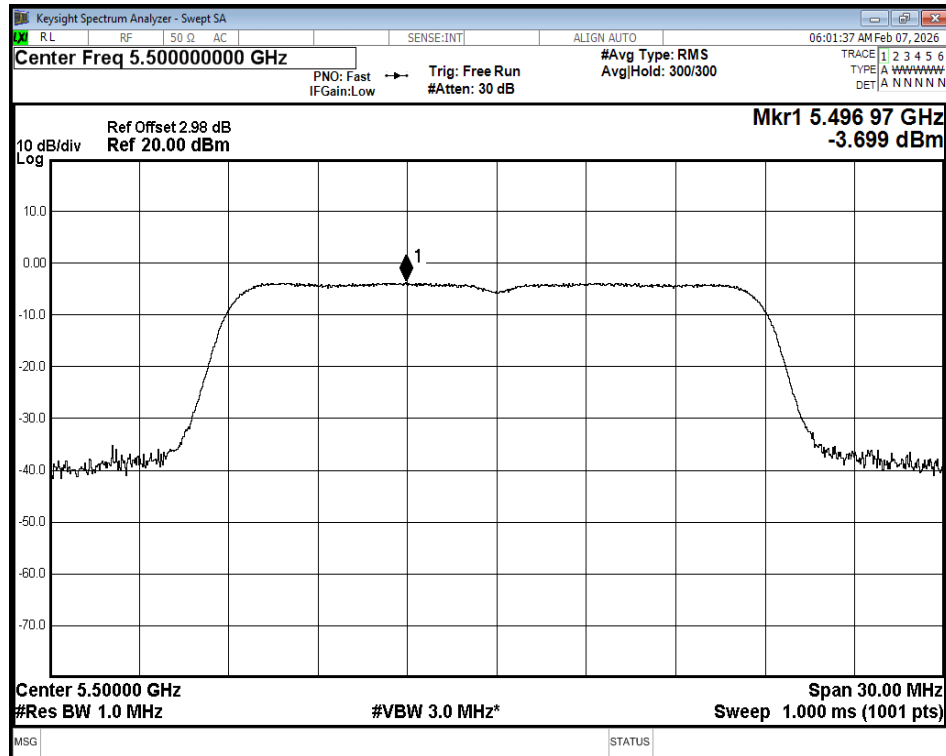

PSD NVNT ac20 5500MHz Ant2

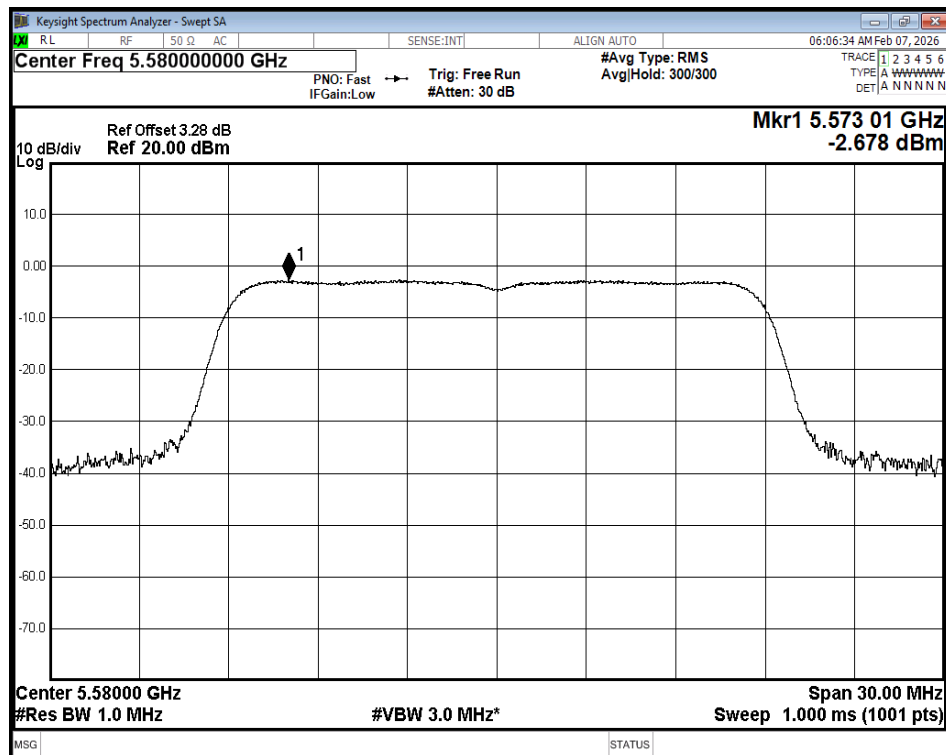

PSD NVNT ac20 5580MHz Ant2




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A &amp; 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: [webmaster@lcs-cert.com](mailto:webmaster@lcs-cert.com) | Web: [www.lcs-cert.com](http://www.lcs-cert.com)

Scan code to check authenticity

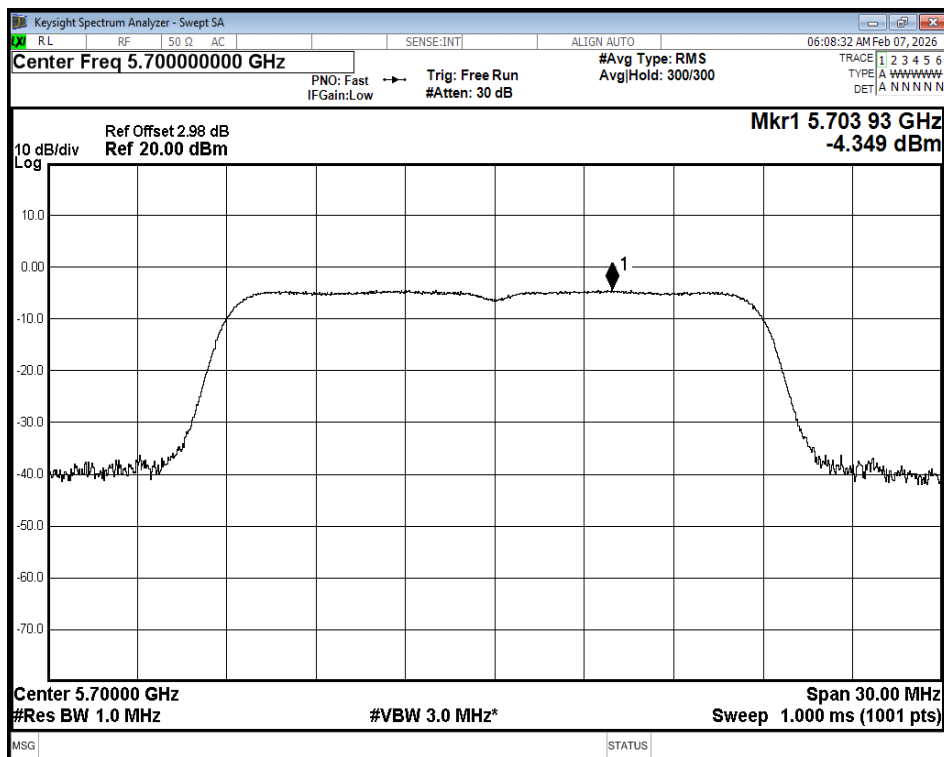

PSD NVNT ac20 5700MHz Ant2

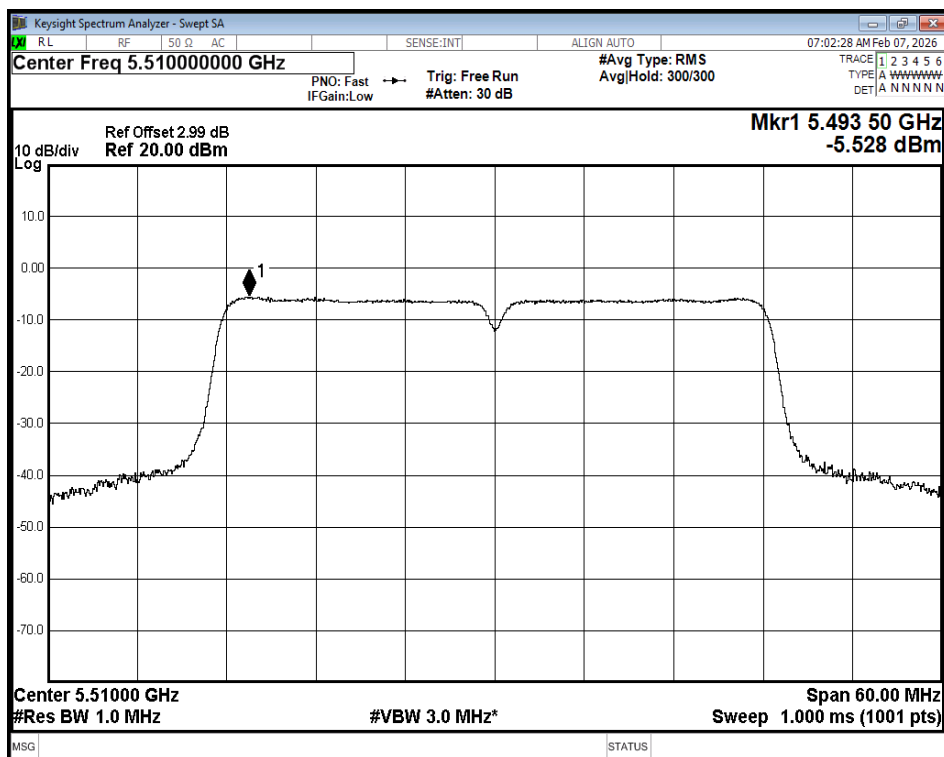

PSD NVNT ac40 5510MHz Ant2




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A &amp; 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

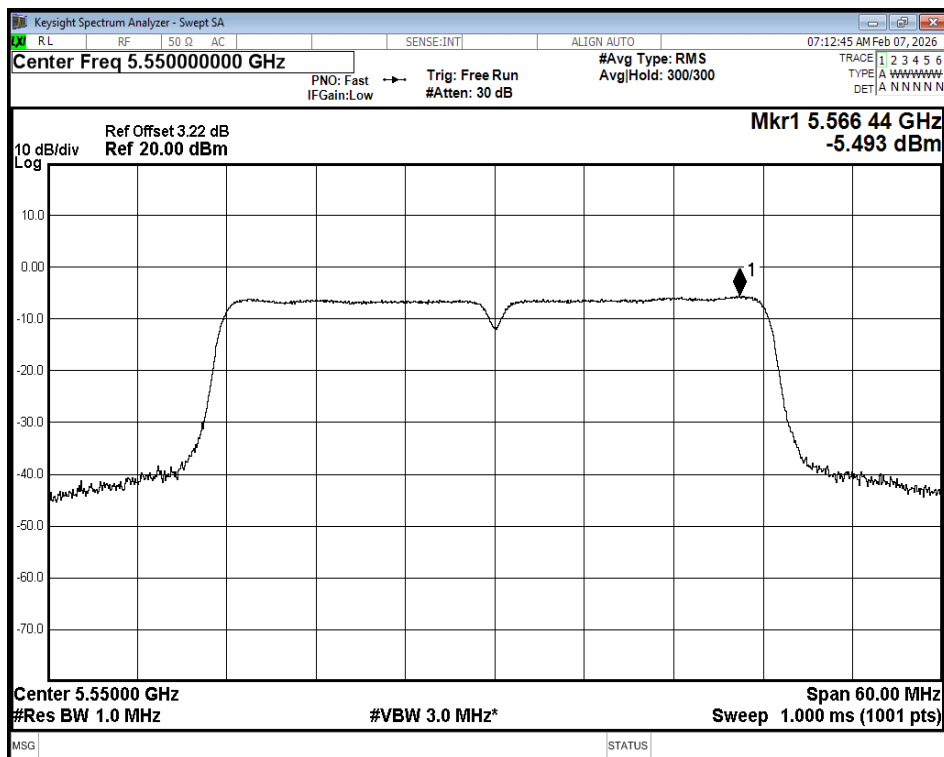

PSD NVNT ac40 5550MHz Ant2

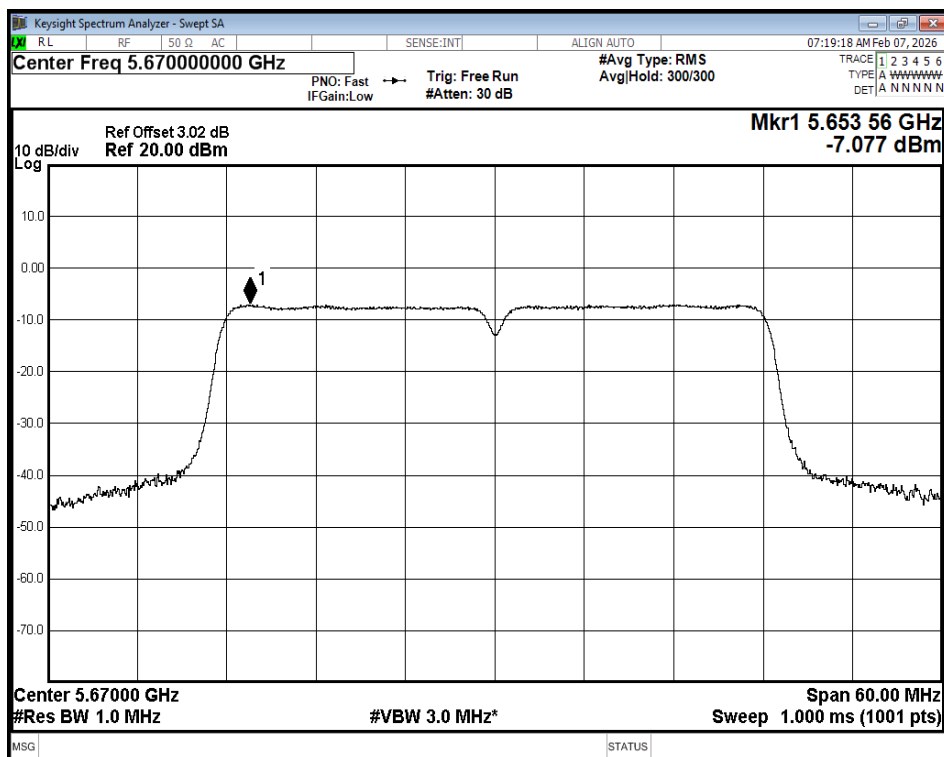

PSD NVNT ac40 5670MHz Ant2




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A &amp; 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: [webmaster@lcs-cert.com](mailto:webmaster@lcs-cert.com) | Web: [www.lcs-cert.com](http://www.lcs-cert.com)

Scan code to check authenticity

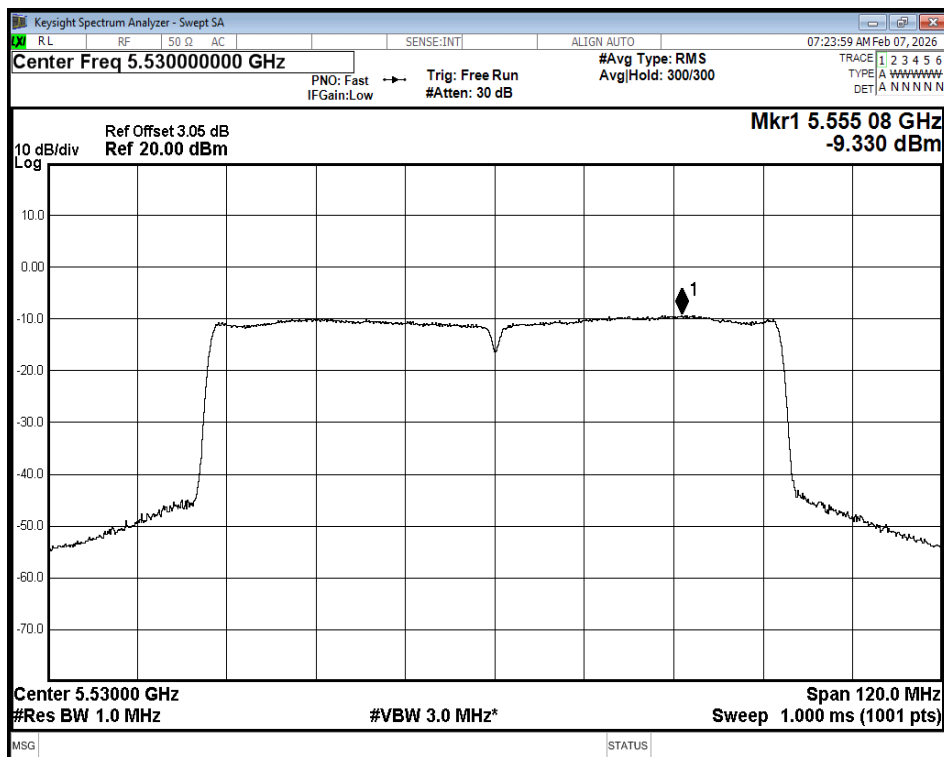

PSD NVNT ac80 5530MHz Ant2

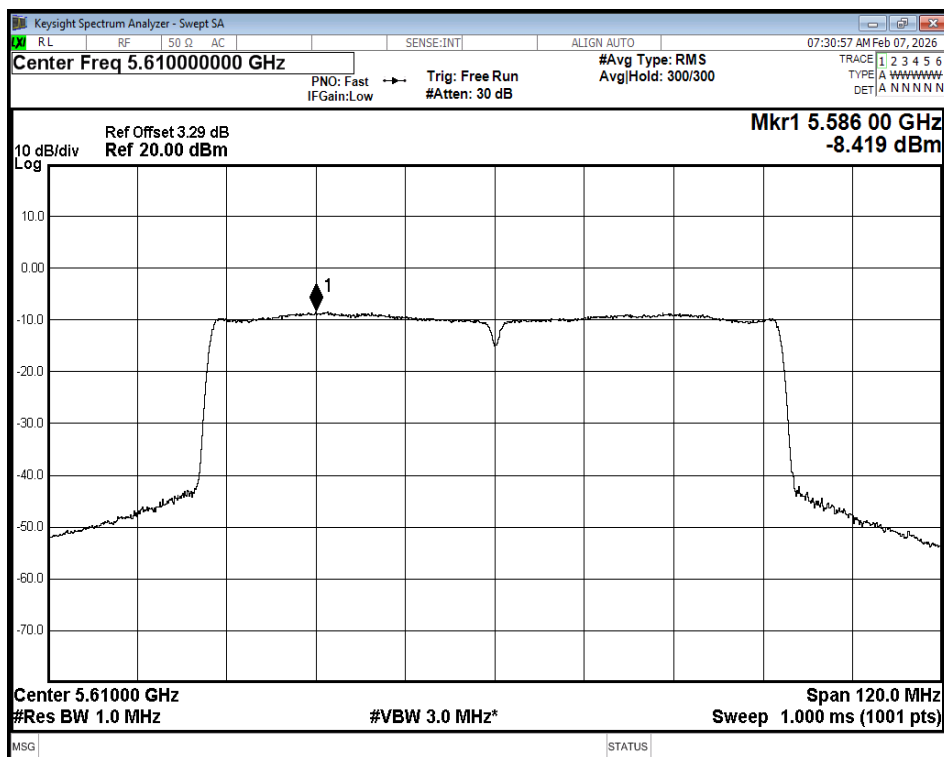

PSD NVNT ac80 5610MHz Ant2




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A &amp; 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

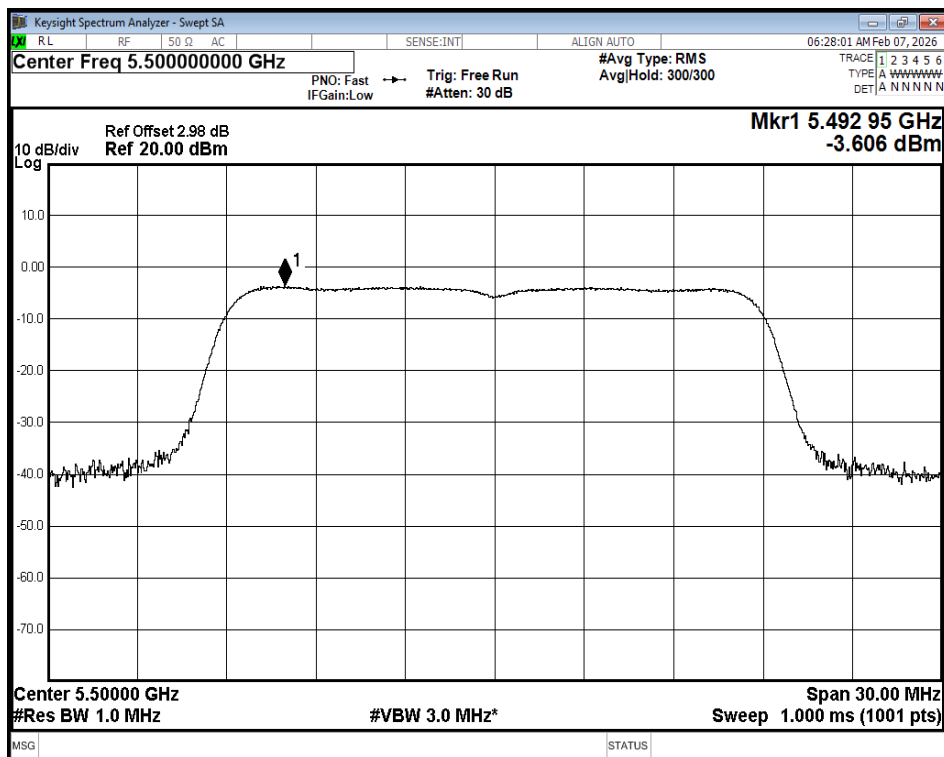

PSD NVNT ax20 5500MHz Ant2

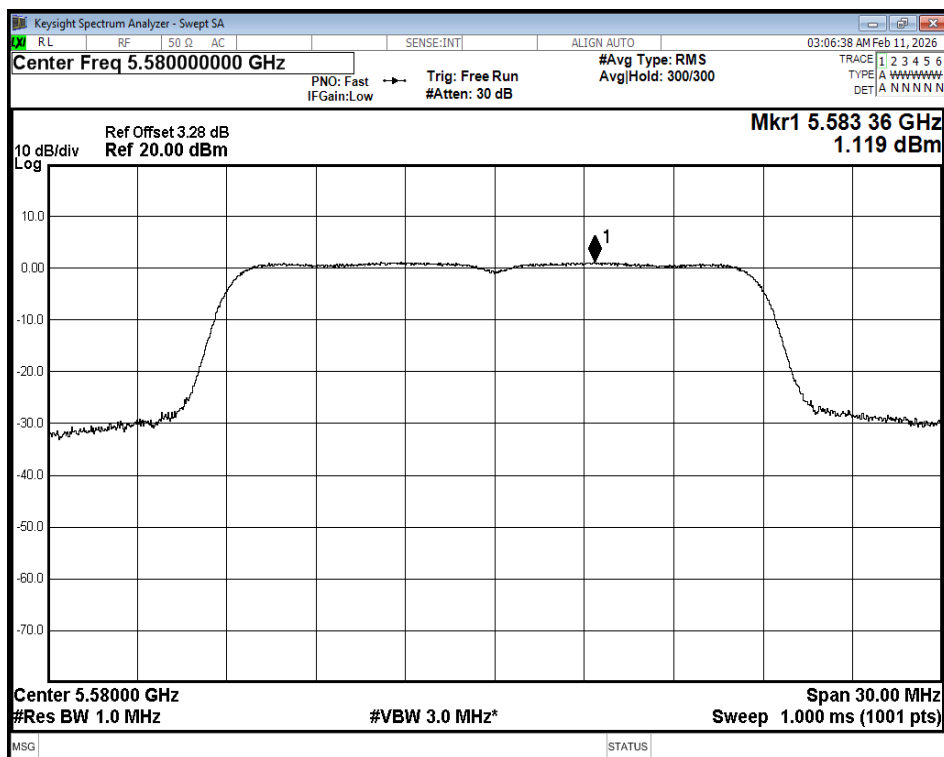

PSD NVNT ax20 5580MHz Ant2




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A &amp; 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: [webmaster@lcs-cert.com](mailto:webmaster@lcs-cert.com) | Web: [www.lcs-cert.com](http://www.lcs-cert.com)

Scan code to check authenticity

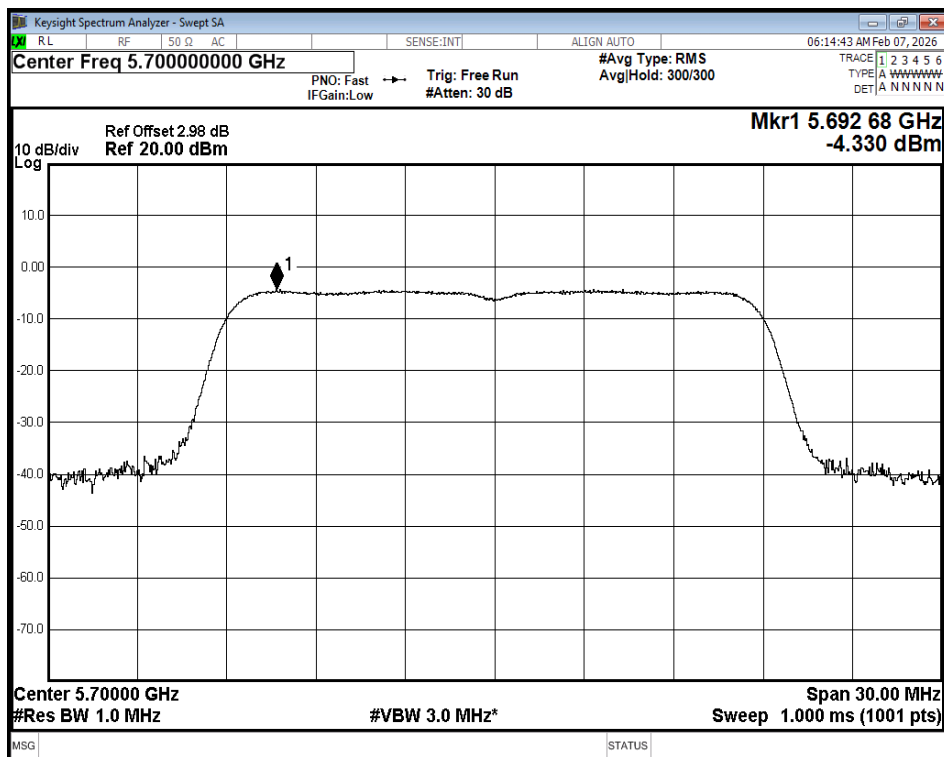

PSD NVNT ax20 5700MHz Ant2

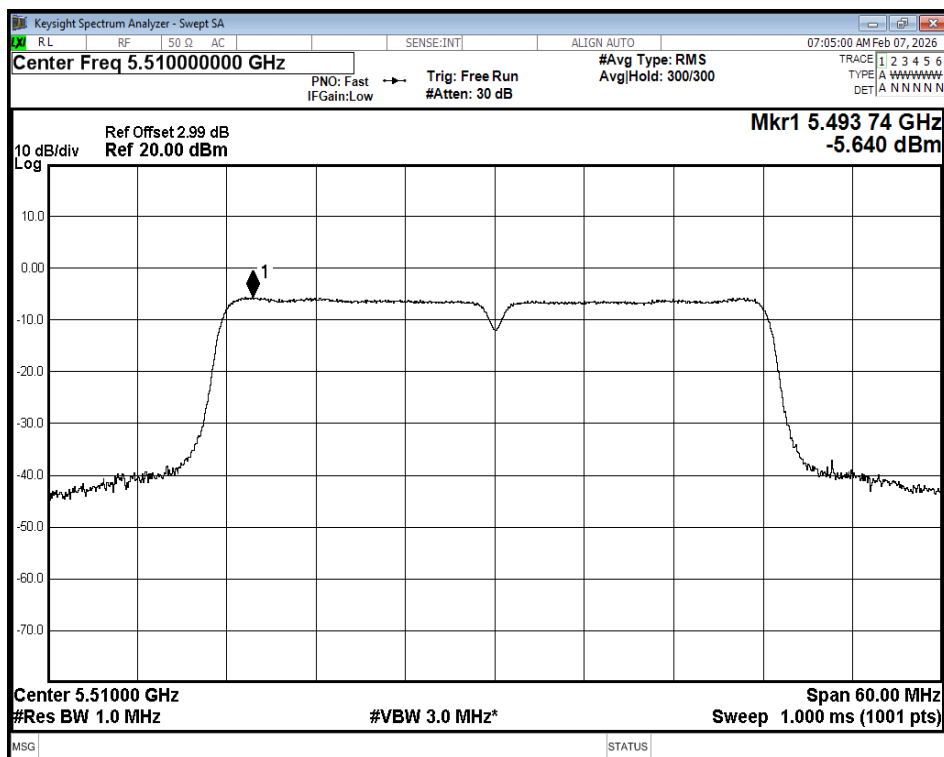

PSD NVNT ax40 5510MHz Ant2




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A &amp; 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

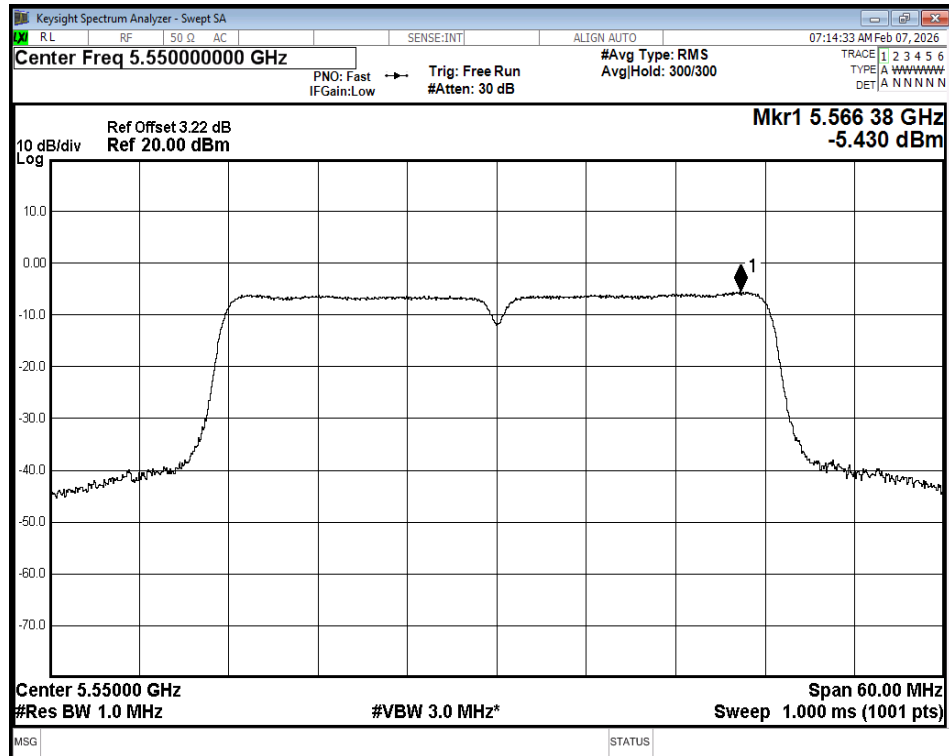

PSD NVNT ax40 5550MHz Ant2

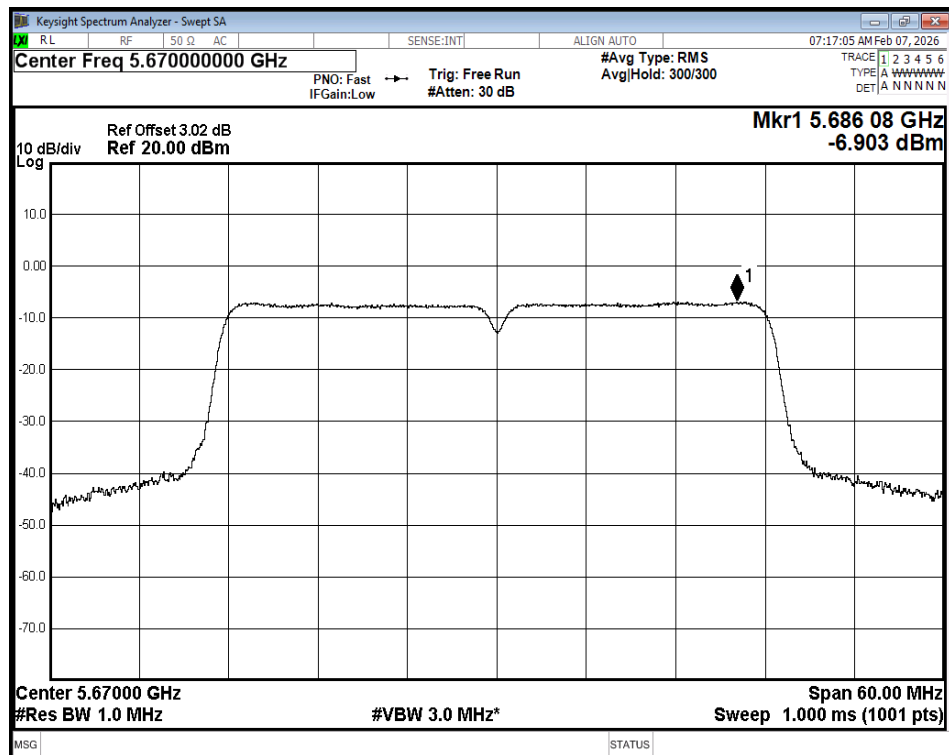

PSD NVNT ax40 5670MHz Ant2




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A &amp; 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: [webmaster@lcs-cert.com](mailto:webmaster@lcs-cert.com) | Web: [www.lcs-cert.com](http://www.lcs-cert.com)

Scan code to check authenticity

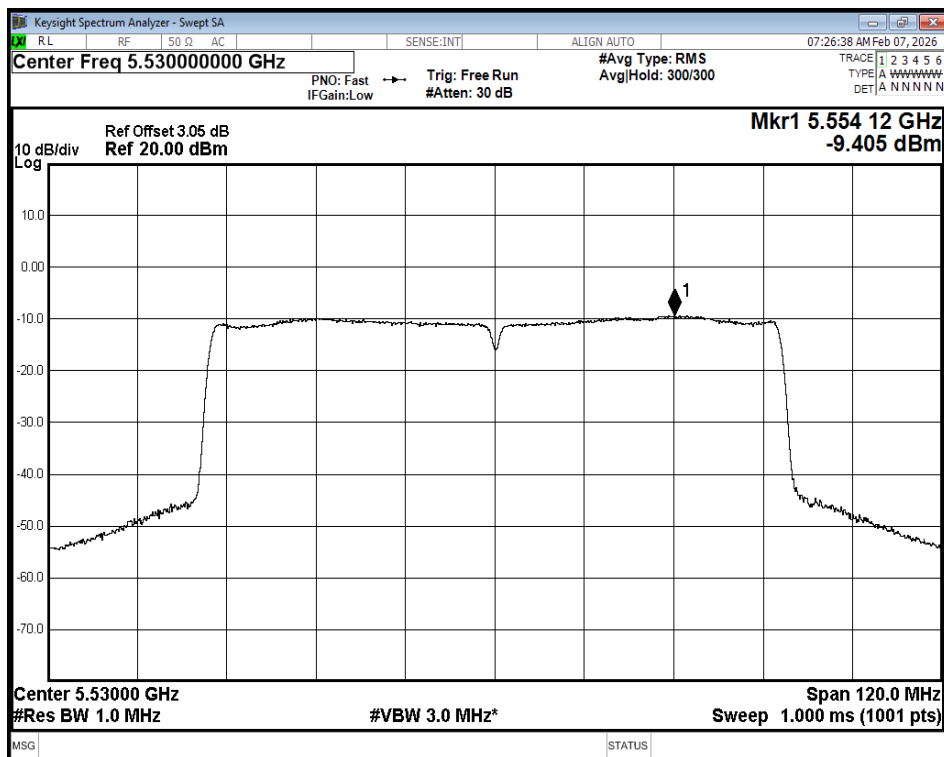

PSD NVNT ax80 5530MHz Ant2

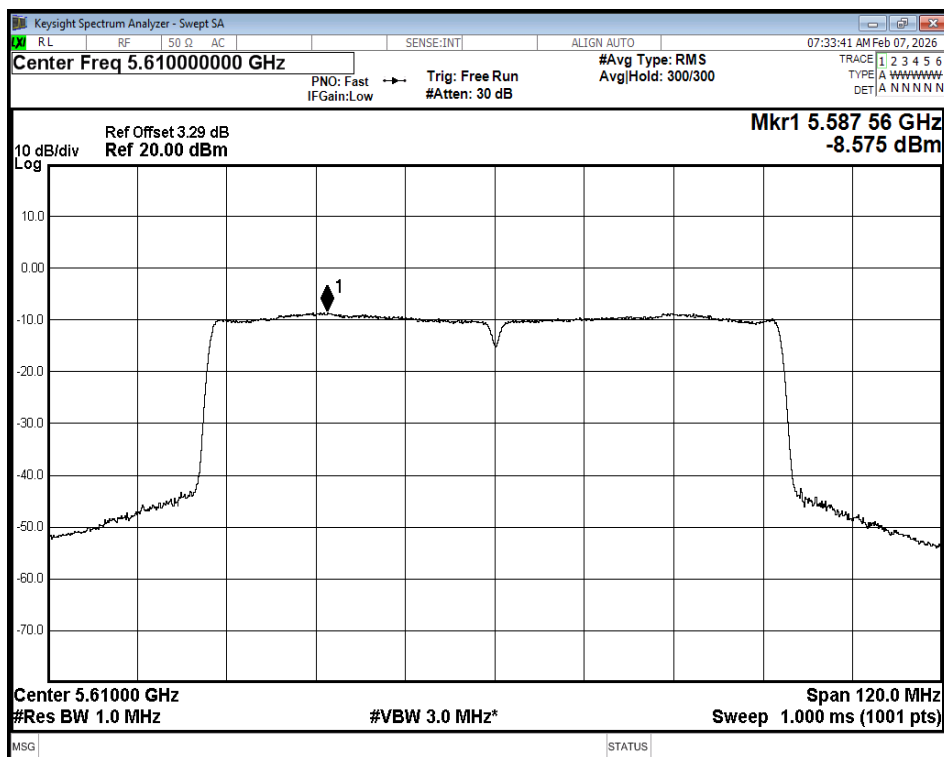

PSD NVNT ax80 5610MHz Ant2



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A &amp; 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: [webmaster@lcs-cert.com](mailto:webmaster@lcs-cert.com) | Web: [www.lcs-cert.com](http://www.lcs-cert.com)

Scan code to check authenticity



## C.4 Restrict Band

| Condition | Mode | Frequency<br>(MHz) | Antenna | Spur Freq<br>(MHz) | Power<br>(dBm) | Gain<br>(dBi) | E<br>(dBuV/m) | Detector | Limit<br>(dBuV/m) | Verdict |
|-----------|------|--------------------|---------|--------------------|----------------|---------------|---------------|----------|-------------------|---------|
| NVNT      | a    | 5500               | Ant1    | 5460               | -45.27         | 2             | 51.96         | Peak     | 68.2              | Pass    |
| NVNT      | a    | 5500               | Ant1    | 5460               | -54.34         | 2             | 42.89         | Average  | 54                | Pass    |
| NVNT      | a    | 5500               | Ant1    | 5469.2             | -34.01         | 2             | 63.22         | Peak     | 68.2              | Pass    |
| NVNT      | a    | 5500               | Ant1    | 5470               | -48.39         | 2             | 48.84         | Average  | 54                | Pass    |
| NVNT      | a    | 5500               | Ant1    | 5470               | -35.53         | 2             | 61.7          | Peak     | 68.2              | Pass    |
| NVNT      | a    | 5500               | Ant1    | 5470               | -48.39         | 2             | 48.84         | Average  | 54                | Pass    |
| NVNT      | a    | 5700               | Ant1    | 5725               | -48.31         | 2             | 48.92         | Peak     | 68.2              | Pass    |
| NVNT      | a    | 5700               | Ant1    | 5725               | -55.94         | 2             | 41.29         | Average  | 54                | Pass    |
| NVNT      | a    | 5700               | Ant1    | 5726.6             | -44.19         | 2             | 53.04         | Peak     | 68.2              | Pass    |
| NVNT      | a    | 5700               | Ant1    | 5725               | -55.94         | 2             | 41.29         | Average  | 54                | Pass    |
| NVNT      | a    | 5700               | Ant1    | 5735               | -51.13         | 2             | 46.1          | Peak     | 68.2              | Pass    |
| NVNT      | a    | 5700               | Ant1    | 5735               | -57.46         | 2             | 39.77         | Average  | 54                | Pass    |
| NVNT      | n20  | 5500               | Ant1    | 5460               | -51.48         | 2             | 45.75         | Peak     | 68.2              | Pass    |
| NVNT      | n20  | 5500               | Ant1    | 5460               | -57.64         | 2             | 39.59         | Average  | 54                | Pass    |
| NVNT      | n20  | 5500               | Ant1    | 5467.6             | -46.02         | 2             | 51.21         | Peak     | 68.2              | Pass    |
| NVNT      | n20  | 5500               | Ant1    | 5469.4             | -56.66         | 2             | 40.57         | Average  | 54                | Pass    |
| NVNT      | n20  | 5500               | Ant1    | 5470               | -46.6          | 2             | 50.63         | Peak     | 68.2              | Pass    |
| NVNT      | n20  | 5500               | Ant1    | 5470               | -56.69         | 2             | 40.54         | Average  | 54                | Pass    |
| NVNT      | n20  | 5700               | Ant1    | 5725               | -40.92         | 2             | 56.31         | Peak     | 68.2              | Pass    |
| NVNT      | n20  | 5700               | Ant1    | 5725               | -55.19         | 2             | 42.04         | Average  | 54                | Pass    |
| NVNT      | n20  | 5700               | Ant1    | 5725               | -40.92         | 2             | 56.31         | Peak     | 68.2              | Pass    |
| NVNT      | n20  | 5700               | Ant1    | 5725               | -55.19         | 2             | 42.04         | Average  | 54                | Pass    |
| NVNT      | n20  | 5700               | Ant1    | 5735               | -49.63         | 2             | 47.6          | Peak     | 68.2              | Pass    |
| NVNT      | n20  | 5700               | Ant1    | 5735               | -57.65         | 2             | 39.58         | Average  | 54                | Pass    |
| NVNT      | n40  | 5510               | Ant1    | 5460               | -50.86         | 2             | 46.37         | Peak     | 68.2              | Pass    |
| NVNT      | n40  | 5510               | Ant1    | 5460               | -57.61         | 2             | 39.62         | Average  | 54                | Pass    |
| NVNT      | n40  | 5510               | Ant1    | 5466.6             | -46.33         | 2             | 50.9          | Peak     | 68.2              | Pass    |
| NVNT      | n40  | 5510               | Ant1    | 5470               | -56.04         | 2             | 41.19         | Average  | 54                | Pass    |
| NVNT      | n40  | 5510               | Ant1    | 5470               | -47.1          | 2             | 50.13         | Peak     | 68.2              | Pass    |
| NVNT      | n40  | 5510               | Ant1    | 5470               | -56.04         | 2             | 41.19         | Average  | 54                | Pass    |
| NVNT      | n40  | 5670               | Ant1    | 5725               | -50.38         | 2             | 46.85         | Peak     | 68.2              | Pass    |
| NVNT      | n40  | 5670               | Ant1    | 5725               | -57.97         | 2             | 39.26         | Average  | 54                | Pass    |
| NVNT      | n40  | 5670               | Ant1    | 5730               | -48.88         | 2             | 48.35         | Peak     | 68.2              | Pass    |
| NVNT      | n40  | 5670               | Ant1    | 5731.4             | -57.68         | 2             | 39.55         | Average  | 54                | Pass    |
| NVNT      | n40  | 5670               | Ant1    | 5735               | -51.2          | 2             | 46.03         | Peak     | 68.2              | Pass    |
| NVNT      | n40  | 5670               | Ant1    | 5735               | -57.77         | 2             | 39.46         | Average  | 54                | Pass    |
| NVNT      | ac20 | 5500               | Ant1    | 5460               | -50.48         | 2             | 46.75         | Peak     | 68.2              | Pass    |



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: [webmaster@lcs-cert.com](mailto:webmaster@lcs-cert.com) | Web: [www.lcs-cert.com](http://www.lcs-cert.com)

Scan code to check authenticity



|      |      |      |      |          |        |   |       |         |      |      |
|------|------|------|------|----------|--------|---|-------|---------|------|------|
| NVNT | ac20 | 5500 | Ant1 | 5460     | -57.65 | 2 | 39.58 | Average | 54   | Pass |
| NVNT | ac20 | 5500 | Ant1 | 5468     | -46.16 | 2 | 51.07 | Peak    | 68.2 | Pass |
| NVNT | ac20 | 5500 | Ant1 | 5470     | -56.48 | 2 | 40.75 | Average | 54   | Pass |
| NVNT | ac20 | 5500 | Ant1 | 5470     | -47.33 | 2 | 49.9  | Peak    | 68.2 | Pass |
| NVNT | ac20 | 5500 | Ant1 | 5470     | -56.48 | 2 | 40.75 | Average | 54   | Pass |
| NVNT | ac20 | 5700 | Ant1 | 5725     | -40.12 | 2 | 57.11 | Peak    | 68.2 | Pass |
| NVNT | ac20 | 5700 | Ant1 | 5725     | -55.25 | 2 | 41.98 | Average | 54   | Pass |
| NVNT | ac20 | 5700 | Ant1 | 5725     | -40.12 | 2 | 57.11 | Peak    | 68.2 | Pass |
| NVNT | ac20 | 5700 | Ant1 | 5725     | -55.25 | 2 | 41.98 | Average | 54   | Pass |
| NVNT | ac20 | 5700 | Ant1 | 5735     | -51.13 | 2 | 46.1  | Peak    | 68.2 | Pass |
| NVNT | ac20 | 5700 | Ant1 | 5735     | -57.76 | 2 | 39.47 | Average | 54   | Pass |
| NVNT | ac40 | 5510 | Ant1 | 5460     | -50.42 | 2 | 46.81 | Peak    | 68.2 | Pass |
| NVNT | ac40 | 5510 | Ant1 | 5460     | -57.35 | 2 | 39.88 | Average | 54   | Pass |
| NVNT | ac40 | 5510 | Ant1 | 5469.8   | -47.94 | 2 | 49.29 | Peak    | 68.2 | Pass |
| NVNT | ac40 | 5510 | Ant1 | 5469.6   | -55.82 | 2 | 41.41 | Average | 54   | Pass |
| NVNT | ac40 | 5510 | Ant1 | 5470     | -49.9  | 2 | 47.33 | Peak    | 68.2 | Pass |
| NVNT | ac40 | 5510 | Ant1 | 5470     | -55.82 | 2 | 41.41 | Average | 54   | Pass |
| NVNT | ac40 | 5670 | Ant1 | 5725     | -51.46 | 2 | 45.77 | Peak    | 68.2 | Pass |
| NVNT | ac40 | 5670 | Ant1 | 5725     | -57.97 | 2 | 39.26 | Average | 54   | Pass |
| NVNT | ac40 | 5670 | Ant1 | 5728     | -48.57 | 2 | 48.66 | Peak    | 68.2 | Pass |
| NVNT | ac40 | 5670 | Ant1 | 5732.8   | -57.59 | 2 | 39.64 | Average | 54   | Pass |
| NVNT | ac40 | 5670 | Ant1 | 5735     | -50.85 | 2 | 46.38 | Peak    | 68.2 | Pass |
| NVNT | ac40 | 5670 | Ant1 | 5735     | -57.86 | 2 | 39.37 | Average | 54   | Pass |
| NVNT | ac80 | 5530 | Ant1 | 5460     | -49.47 | 2 | 47.76 | Peak    | 68.2 | Pass |
| NVNT | ac80 | 5530 | Ant1 | 5460     | -56.82 | 2 | 40.41 | Average | 54   | Pass |
| NVNT | ac80 | 5530 | Ant1 | 5467.2   | -47.22 | 2 | 50.01 | Peak    | 68.2 | Pass |
| NVNT | ac80 | 5530 | Ant1 | 5469.6   | -56.24 | 2 | 40.99 | Average | 54   | Pass |
| NVNT | ac80 | 5530 | Ant1 | 5470     | -48.24 | 2 | 48.99 | Peak    | 68.2 | Pass |
| NVNT | ac80 | 5530 | Ant1 | 5470     | -56.55 | 2 | 40.68 | Average | 54   | Pass |
| NVNT | ac80 | 5610 | Ant1 | 5725     | -49.99 | 2 | 47.24 | Peak    | 68.2 | Pass |
| NVNT | ac80 | 5610 | Ant1 | 5725     | -57.44 | 2 | 39.79 | Average | 54   | Pass |
| NVNT | ac80 | 5610 | Ant1 | 5727.415 | -48.66 | 2 | 48.57 | Peak    | 68.2 | Pass |
| NVNT | ac80 | 5610 | Ant1 | 5732.335 | -57.05 | 2 | 40.18 | Average | 54   | Pass |
| NVNT | ac80 | 5610 | Ant1 | 5735     | -51.6  | 2 | 45.63 | Peak    | 68.2 | Pass |
| NVNT | ac80 | 5610 | Ant1 | 5735     | -57.32 | 2 | 39.91 | Average | 54   | Pass |
| NVNT | ax20 | 5500 | Ant1 | 5460     | -49.79 | 2 | 47.44 | Peak    | 68.2 | Pass |
| NVNT | ax20 | 5500 | Ant1 | 5460     | -57.58 | 2 | 39.65 | Average | 54   | Pass |
| NVNT | ax20 | 5500 | Ant1 | 5465.8   | -45.57 | 2 | 51.66 | Peak    | 68.2 | Pass |
| NVNT | ax20 | 5500 | Ant1 | 5469.6   | -56.62 | 2 | 40.61 | Average | 54   | Pass |
| NVNT | ax20 | 5500 | Ant1 | 5470     | -49.02 | 2 | 48.21 | Peak    | 68.2 | Pass |
| NVNT | ax20 | 5500 | Ant1 | 5470     | -56.73 | 2 | 40.5  | Average | 54   | Pass |



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A &amp; 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: [webmaster@lcs-cert.com](mailto:webmaster@lcs-cert.com) | Web: [www.lcs-cert.com](http://www.lcs-cert.com)

Scan code to check authenticity



|      |      |      |      |          |        |   |       |         |      |      |
|------|------|------|------|----------|--------|---|-------|---------|------|------|
| NVNT | ax20 | 5700 | Ant1 | 5725     | -44.44 | 2 | 52.79 | Peak    | 68.2 | Pass |
| NVNT | ax20 | 5700 | Ant1 | 5725     | -55.19 | 2 | 42.04 | Average | 54   | Pass |
| NVNT | ax20 | 5700 | Ant1 | 5726.4   | -42.78 | 2 | 54.45 | Peak    | 68.2 | Pass |
| NVNT | ax20 | 5700 | Ant1 | 5725     | -55.19 | 2 | 42.04 | Average | 54   | Pass |
| NVNT | ax20 | 5700 | Ant1 | 5735     | -49.78 | 2 | 47.45 | Peak    | 68.2 | Pass |
| NVNT | ax20 | 5700 | Ant1 | 5735     | -57.68 | 2 | 39.55 | Average | 54   | Pass |
| NVNT | ax40 | 5510 | Ant1 | 5460     | -50.36 | 2 | 46.87 | Peak    | 68.2 | Pass |
| NVNT | ax40 | 5510 | Ant1 | 5460     | -57.53 | 2 | 39.7  | Average | 54   | Pass |
| NVNT | ax40 | 5510 | Ant1 | 5465.6   | -47.45 | 2 | 49.78 | Peak    | 68.2 | Pass |
| NVNT | ax40 | 5510 | Ant1 | 5470     | -55.84 | 2 | 41.39 | Average | 54   | Pass |
| NVNT | ax40 | 5510 | Ant1 | 5470     | -47.84 | 2 | 49.39 | Peak    | 68.2 | Pass |
| NVNT | ax40 | 5510 | Ant1 | 5470     | -55.84 | 2 | 41.39 | Average | 54   | Pass |
| NVNT | ax40 | 5670 | Ant1 | 5725     | -50.31 | 2 | 46.92 | Peak    | 68.2 | Pass |
| NVNT | ax40 | 5670 | Ant1 | 5725     | -57.83 | 2 | 39.4  | Average | 54   | Pass |
| NVNT | ax40 | 5670 | Ant1 | 5733.2   | -49.5  | 2 | 47.73 | Peak    | 68.2 | Pass |
| NVNT | ax40 | 5670 | Ant1 | 5732.8   | -57.59 | 2 | 39.64 | Average | 54   | Pass |
| NVNT | ax40 | 5670 | Ant1 | 5735     | -51.77 | 2 | 45.46 | Peak    | 68.2 | Pass |
| NVNT | ax40 | 5670 | Ant1 | 5735     | -57.73 | 2 | 39.5  | Average | 54   | Pass |
| NVNT | ax80 | 5530 | Ant1 | 5460     | -49.7  | 2 | 47.53 | Peak    | 68.2 | Pass |
| NVNT | ax80 | 5530 | Ant1 | 5460     | -57.09 | 2 | 40.14 | Average | 54   | Pass |
| NVNT | ax80 | 5530 | Ant1 | 5465.2   | -47.13 | 2 | 50.1  | Peak    | 68.2 | Pass |
| NVNT | ax80 | 5530 | Ant1 | 5466.8   | -56.15 | 2 | 41.08 | Average | 54   | Pass |
| NVNT | ax80 | 5530 | Ant1 | 5470     | -49.78 | 2 | 47.45 | Peak    | 68.2 | Pass |
| NVNT | ax80 | 5530 | Ant1 | 5470     | -56.47 | 2 | 40.76 | Average | 54   | Pass |
| NVNT | ax80 | 5610 | Ant1 | 5725     | -50.03 | 2 | 47.2  | Peak    | 68.2 | Pass |
| NVNT | ax80 | 5610 | Ant1 | 5725     | -57.33 | 2 | 39.9  | Average | 54   | Pass |
| NVNT | ax80 | 5610 | Ant1 | 5725.775 | -48.74 | 2 | 48.49 | Peak    | 68.2 | Pass |
| NVNT | ax80 | 5610 | Ant1 | 5727.21  | -57    | 2 | 40.23 | Average | 54   | Pass |
| NVNT | ax80 | 5610 | Ant1 | 5735     | -51.18 | 2 | 46.05 | Peak    | 68.2 | Pass |
| NVNT | ax80 | 5610 | Ant1 | 5735     | -57.28 | 2 | 39.95 | Average | 54   | Pass |




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A &amp; 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: [webmaster@lcs-cert.com](mailto:webmaster@lcs-cert.com) | Web: [www.lcs-cert.com](http://www.lcs-cert.com)

Scan code to check authenticity

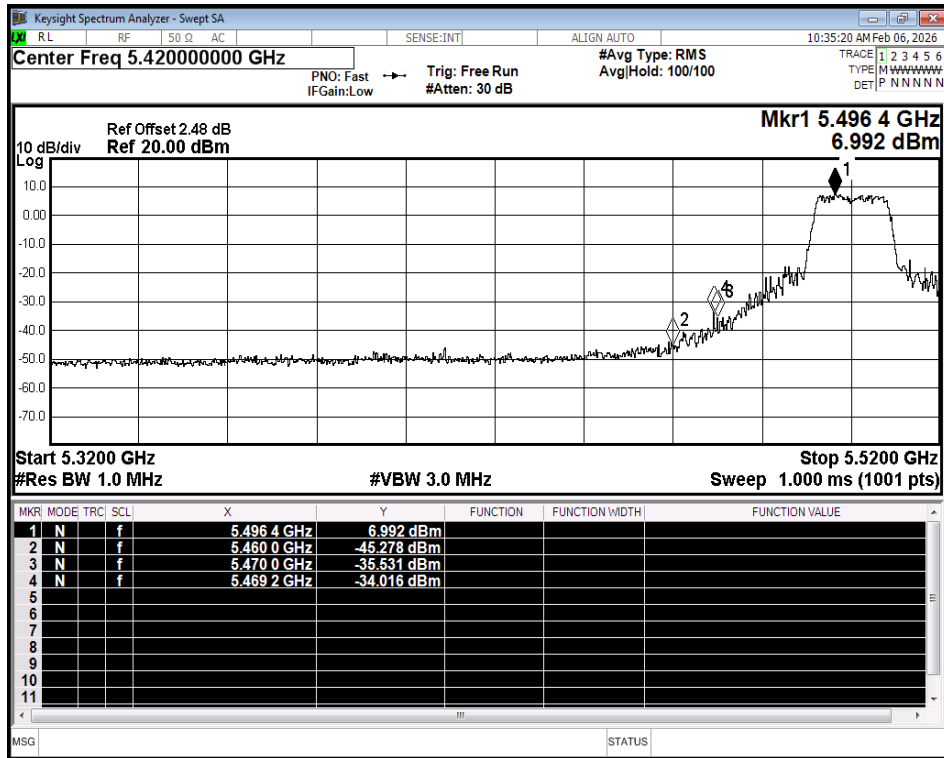

Restrict Band NVNT a 5500MHz Ant1 Peak

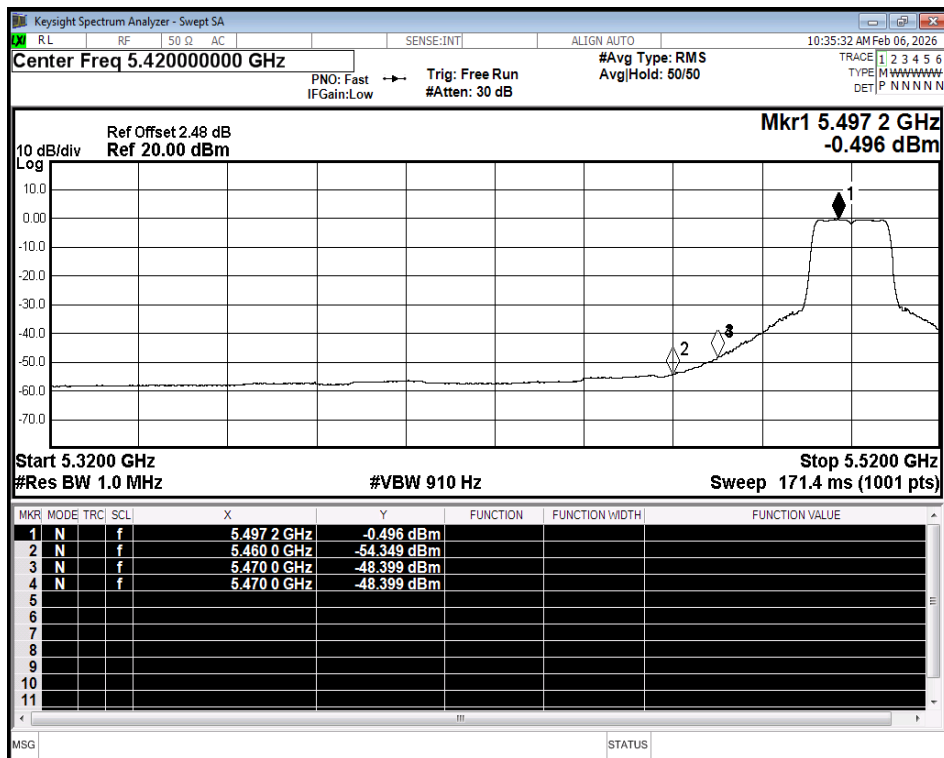

Restrict Band NVNT a 5500MHz Ant1 Average




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A &amp; 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

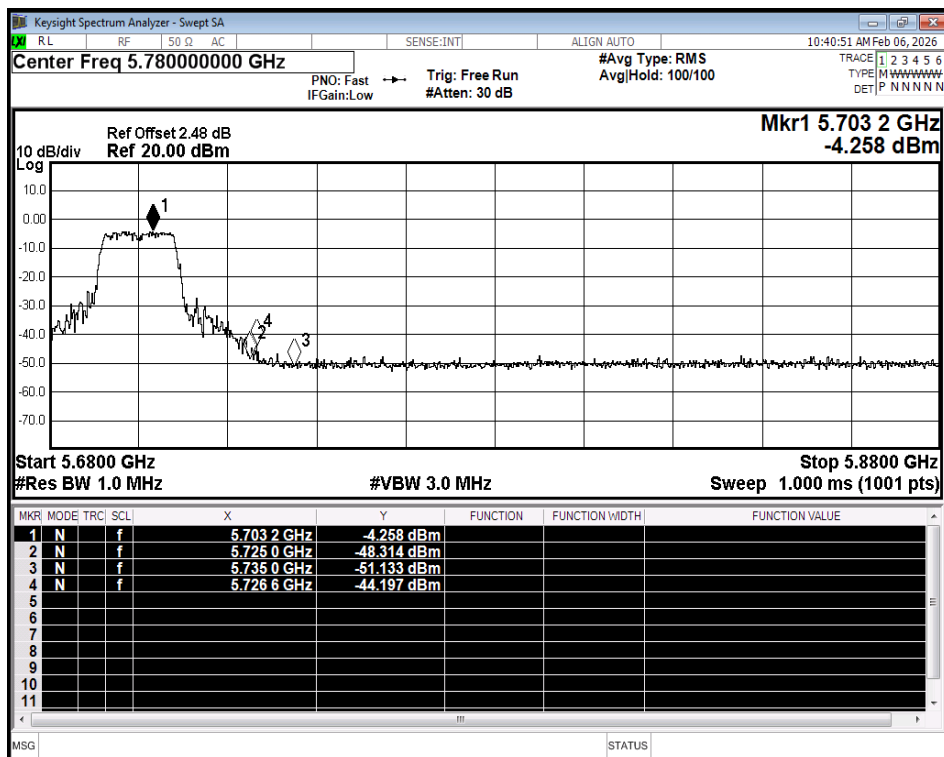

Restrict Band NVNT a 5700MHz Ant1 Peak

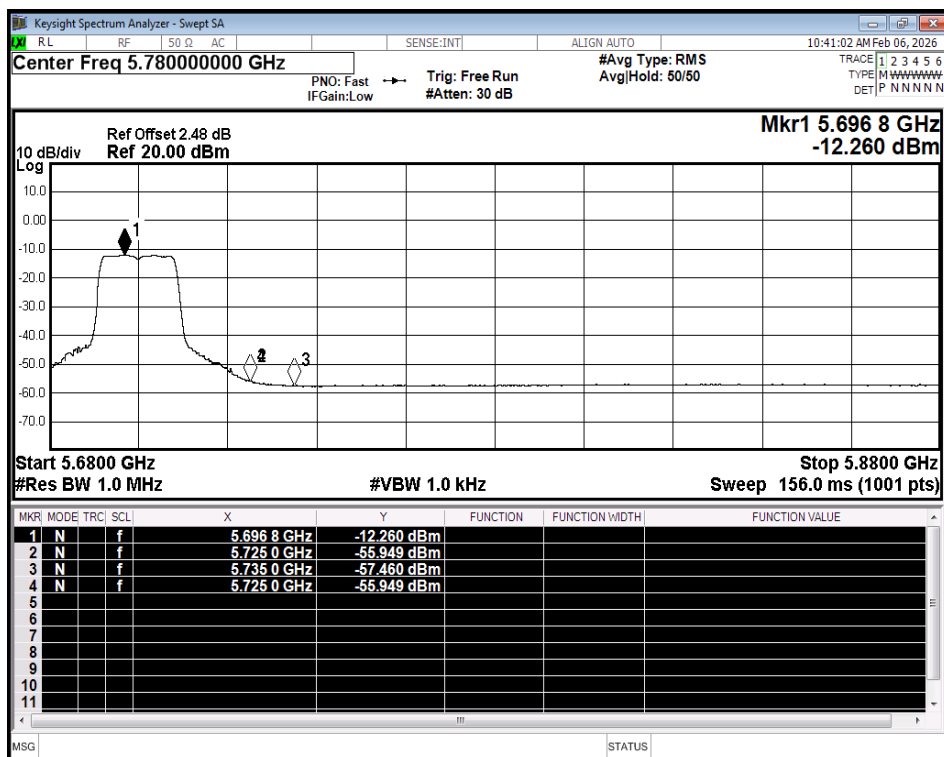

Restrict Band NVNT a 5700MHz Ant1 Average




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A &amp; 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

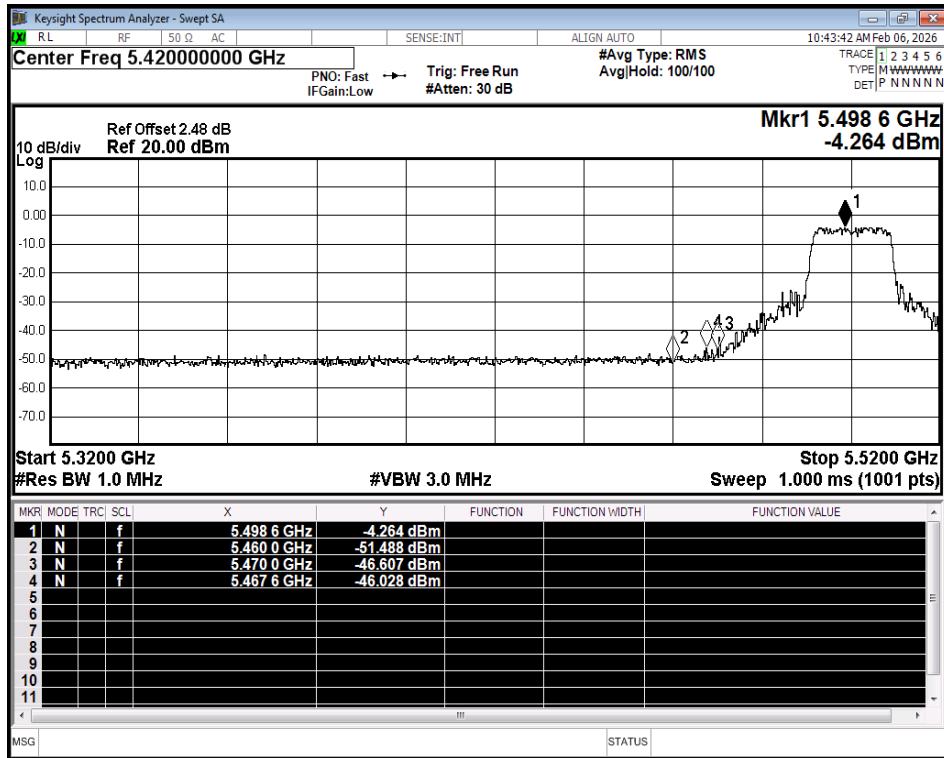

Restrict Band NVNT n20 5500MHz Ant1 Peak

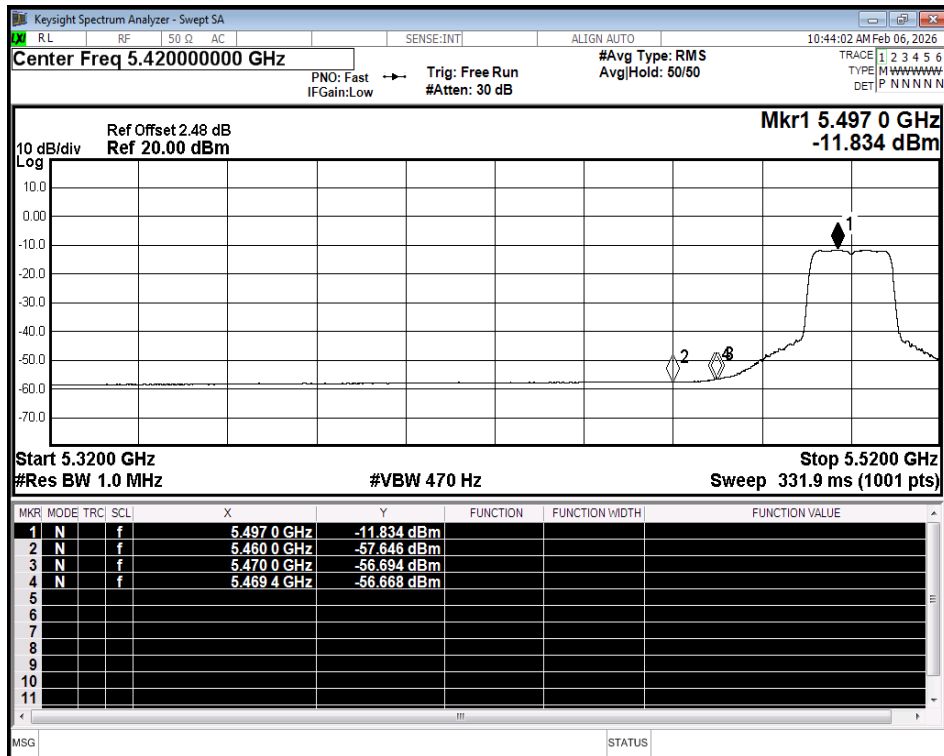

Restrict Band NVNT n20 5500MHz Ant1 Average




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A &amp; 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

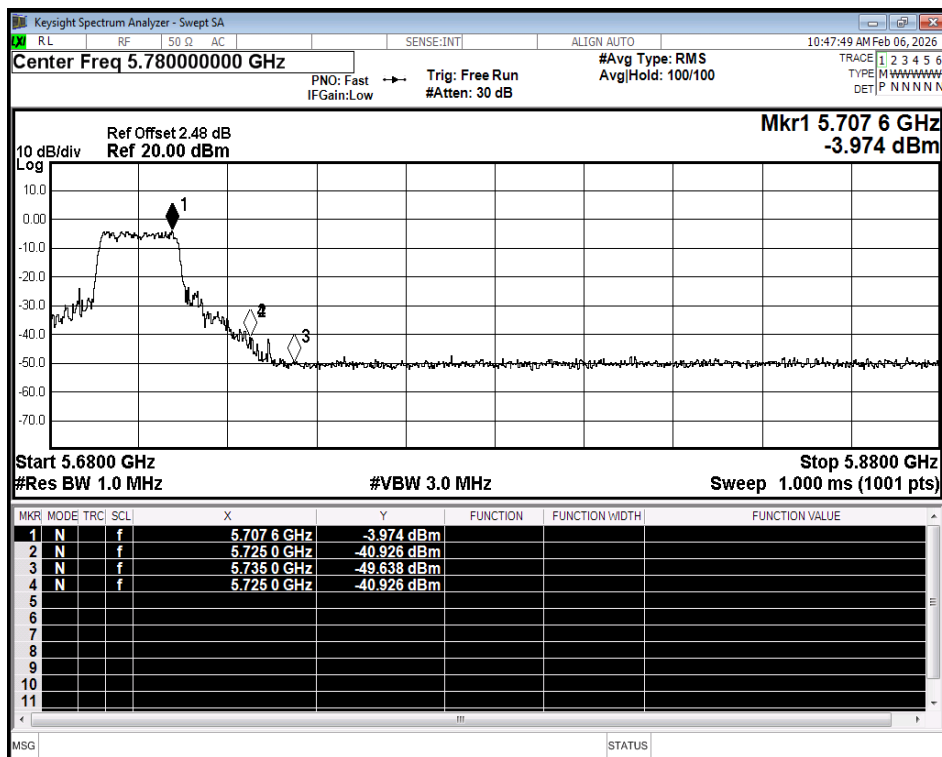

Restrict Band NVNT n20 5700MHz Ant1 Peak

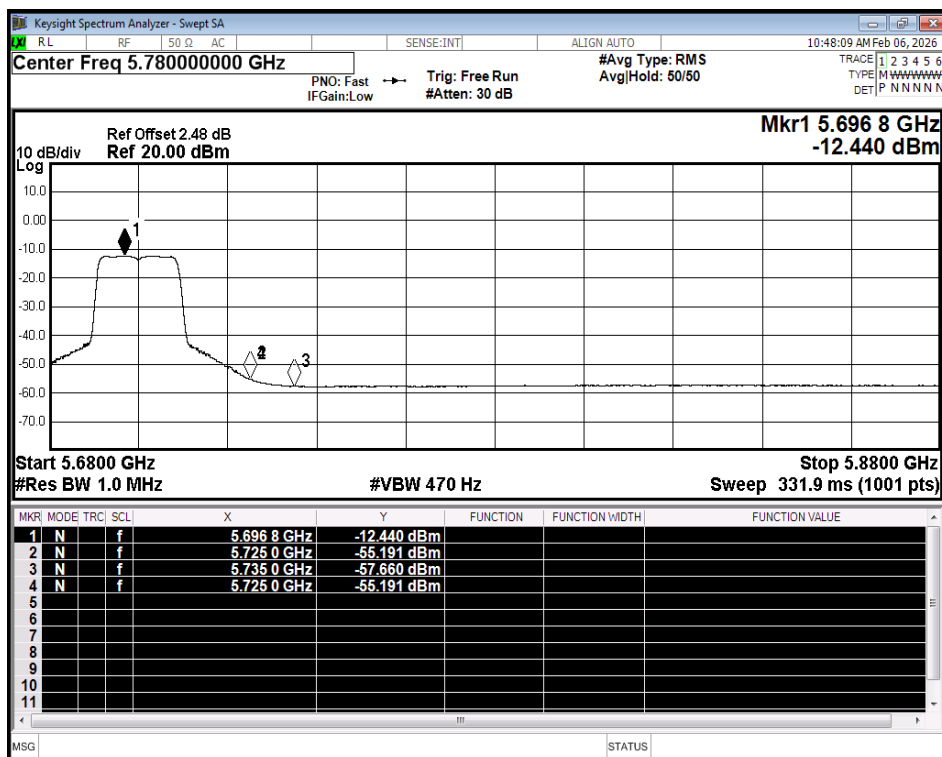

Restrict Band NVNT n20 5700MHz Ant1 Average




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A &amp; 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

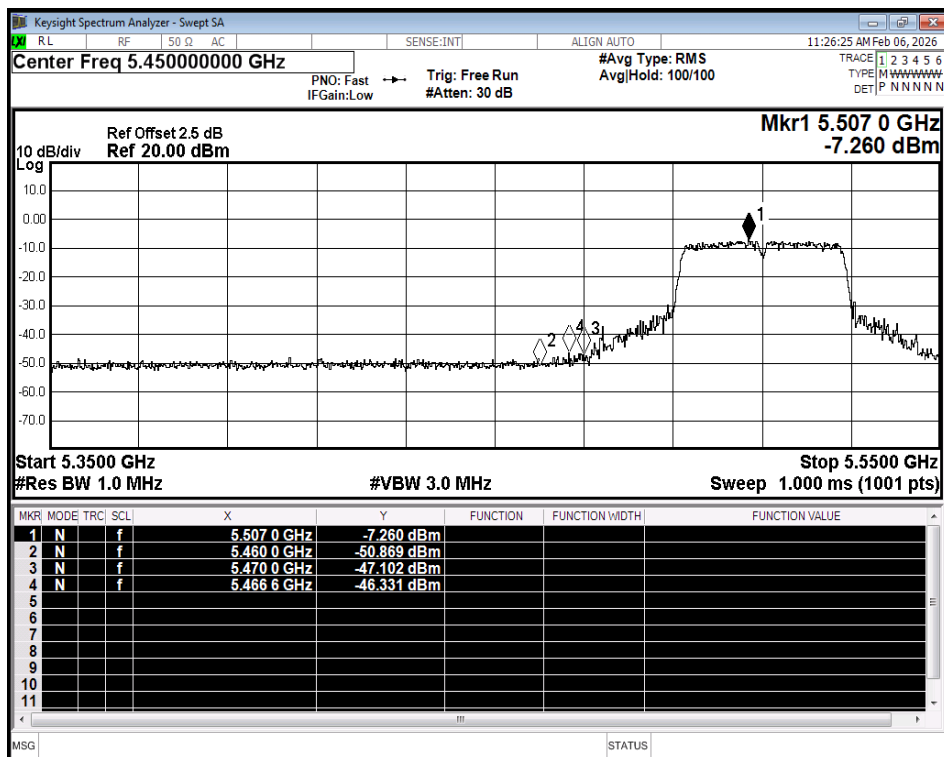

Restrict Band NVNT n40 5510MHz Ant1 Peak

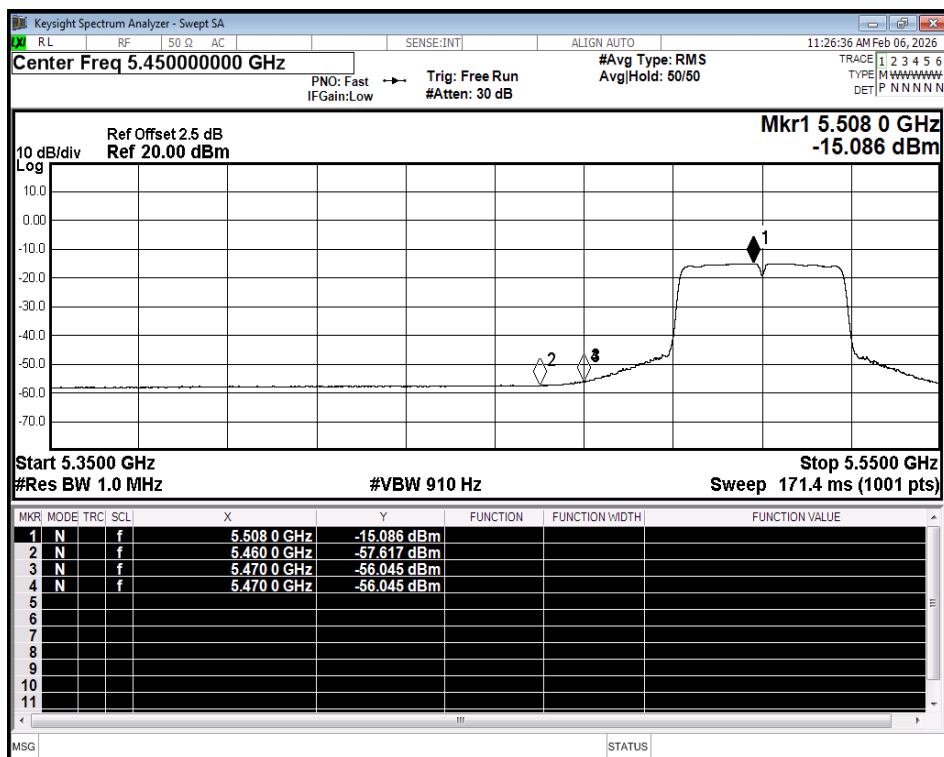

Restrict Band NVNT n40 5510MHz Ant1 Average




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A &amp; 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

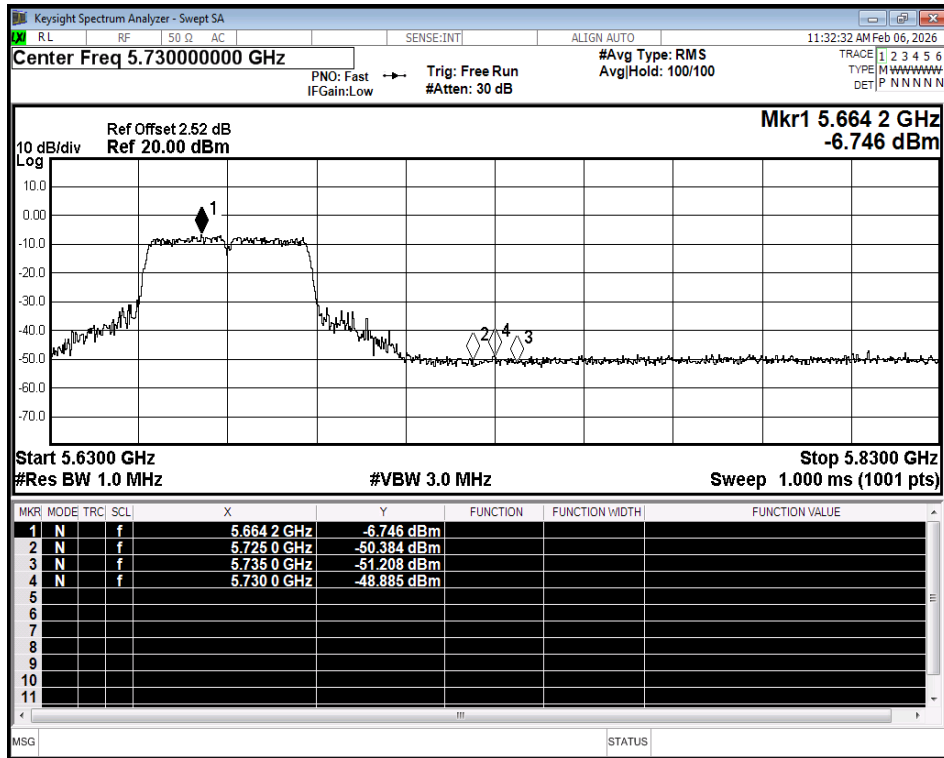

Restrict Band NVNT n40 5670MHz Ant1 Peak

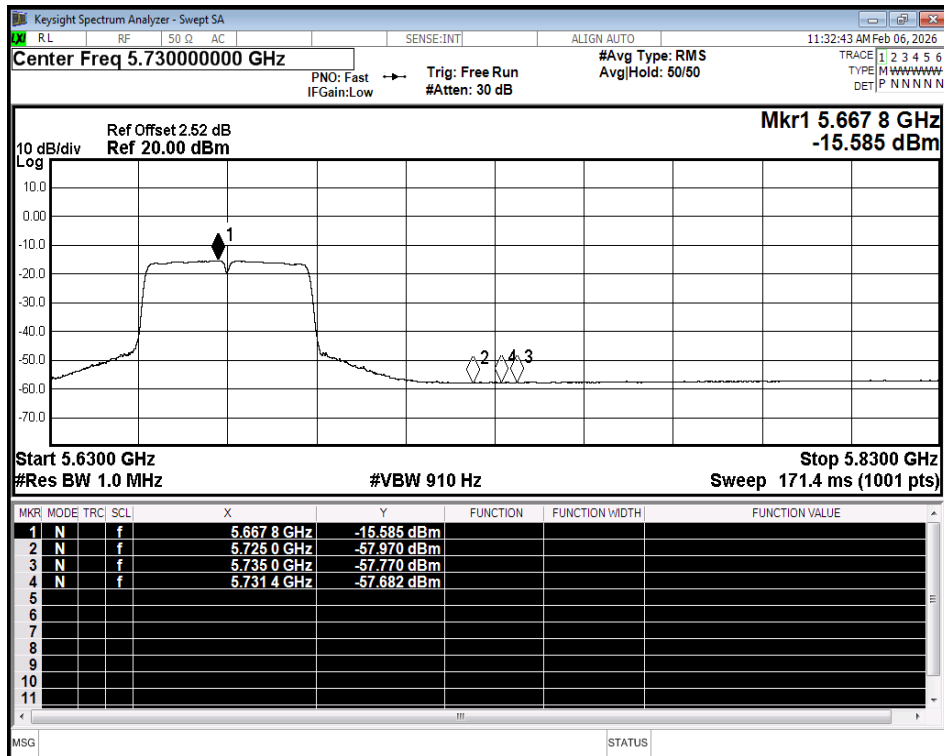

Restrict Band NVNT n40 5670MHz Ant1 Average




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A &amp; 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

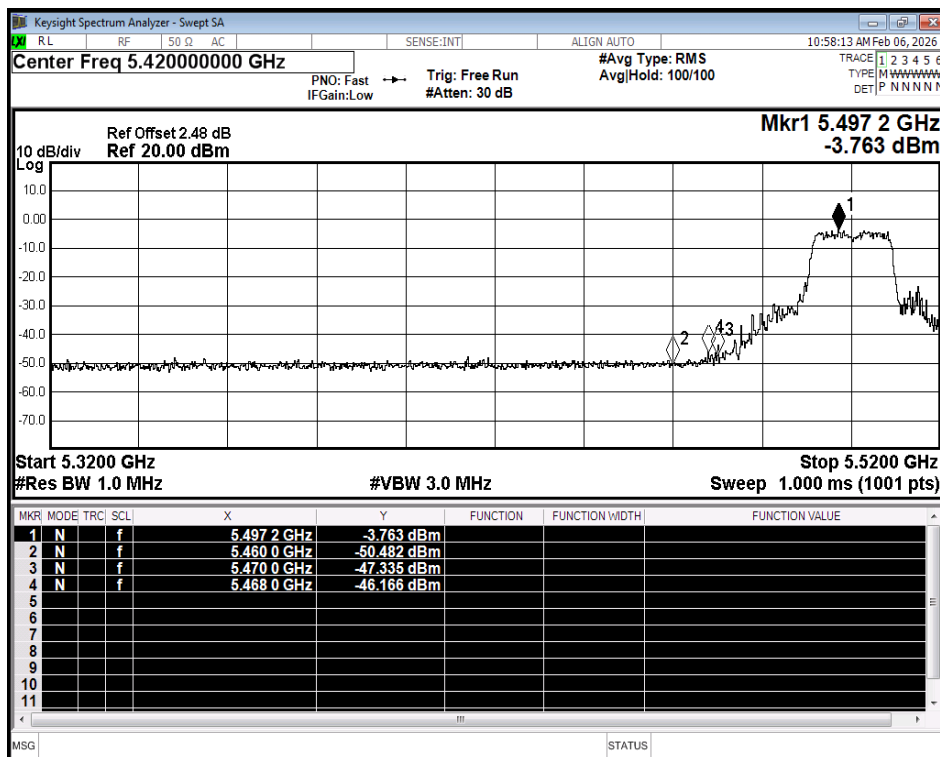

Restrict Band NVNT ac20 5500MHz Ant1 Peak

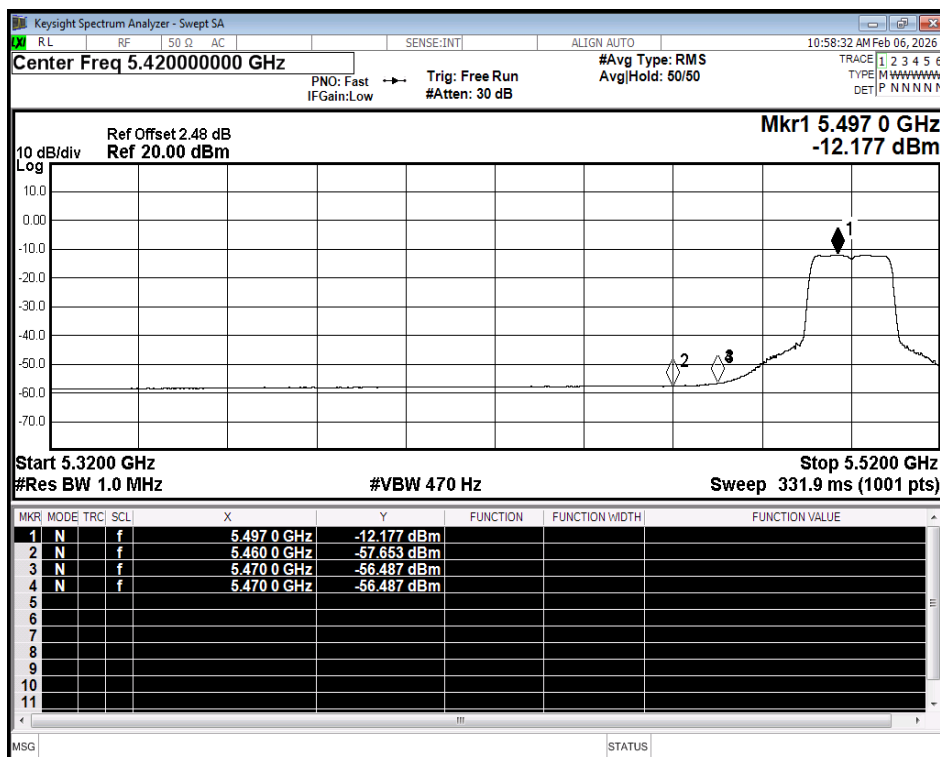

Restrict Band NVNT ac20 5500MHz Ant1 Average




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A &amp; 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

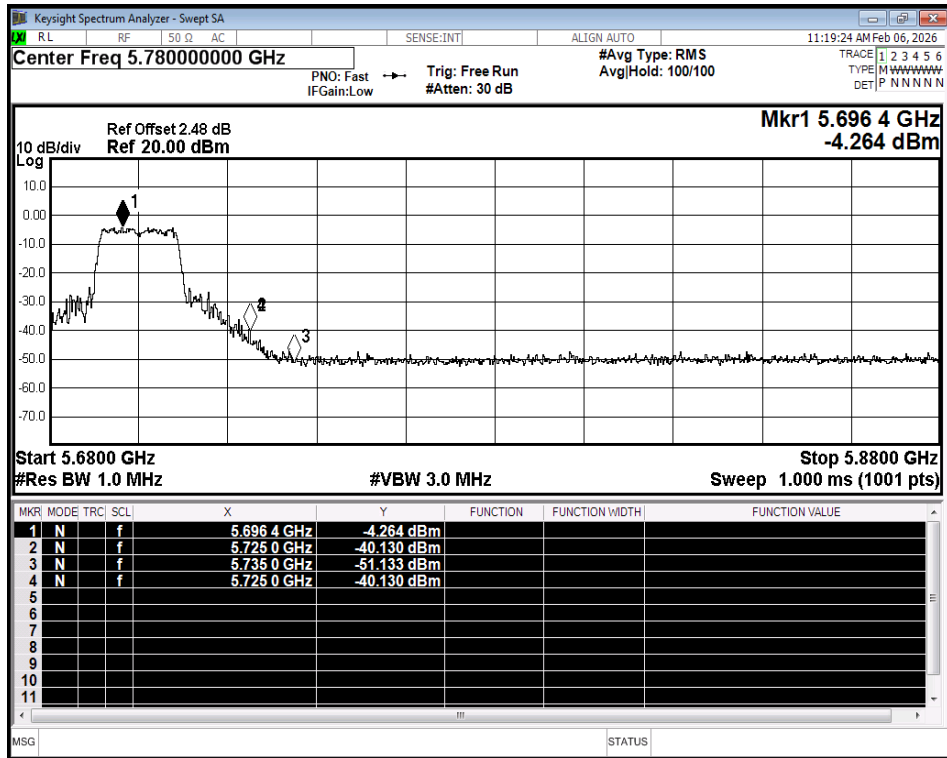

Restrict Band NVNT ac20 5700MHz Ant1 Peak

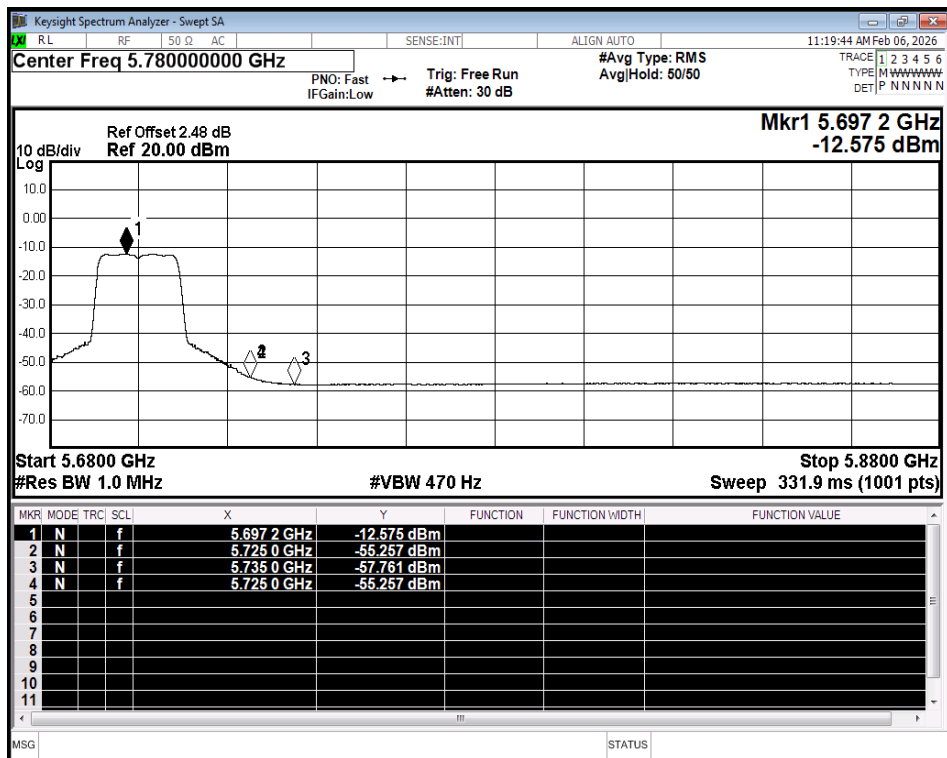

Restrict Band NVNT ac20 5700MHz Ant1 Average




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A &amp; 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

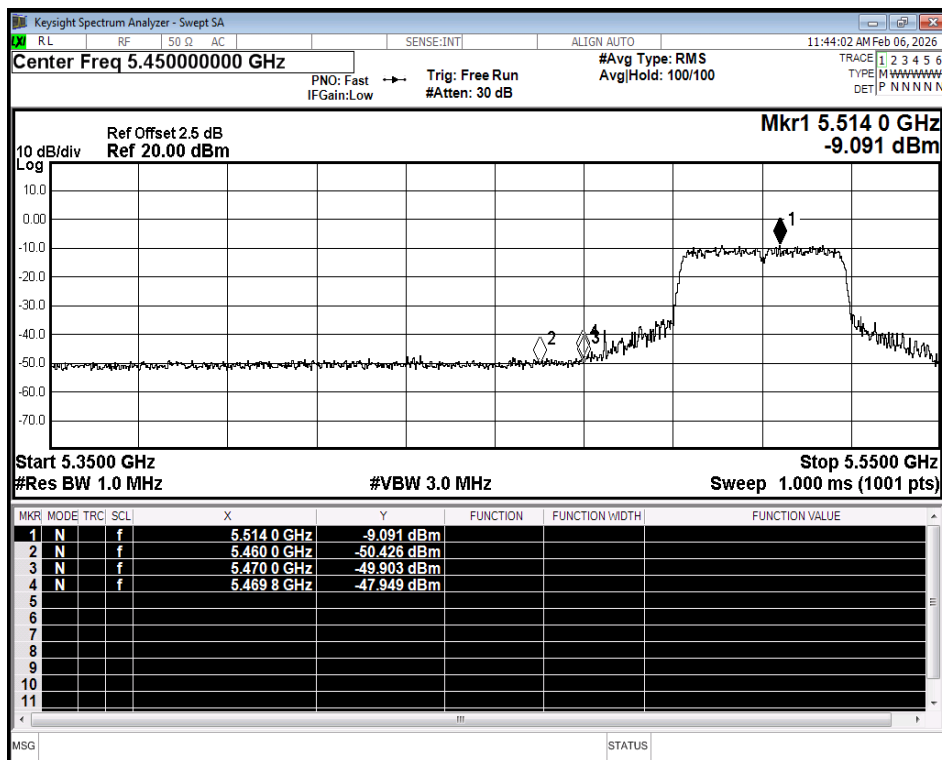

Restrict Band NVNT ac40 5510MHz Ant1 Peak

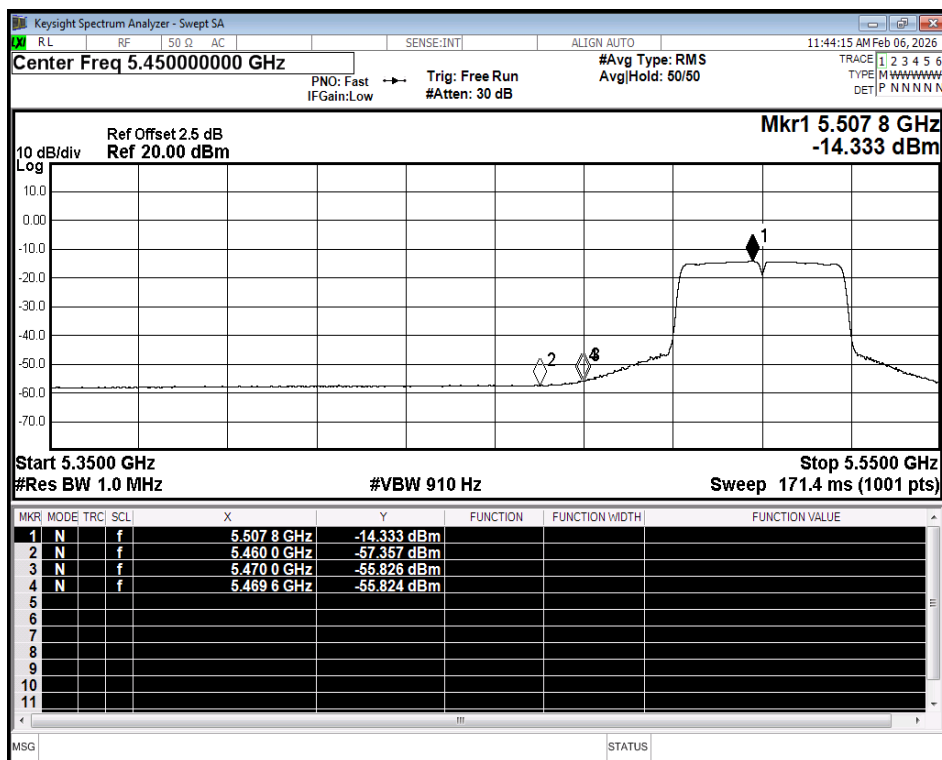

Restrict Band NVNT ac40 5510MHz Ant1 Average




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A &amp; 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

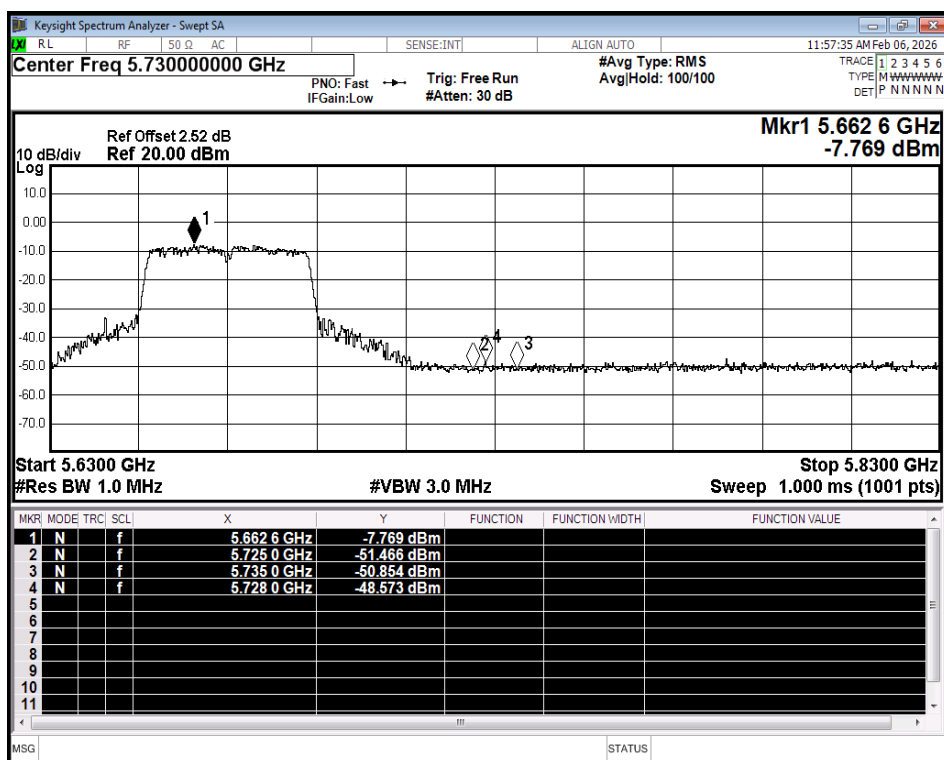

Restrict Band NVNT ac40 5670MHz Ant1 Peak

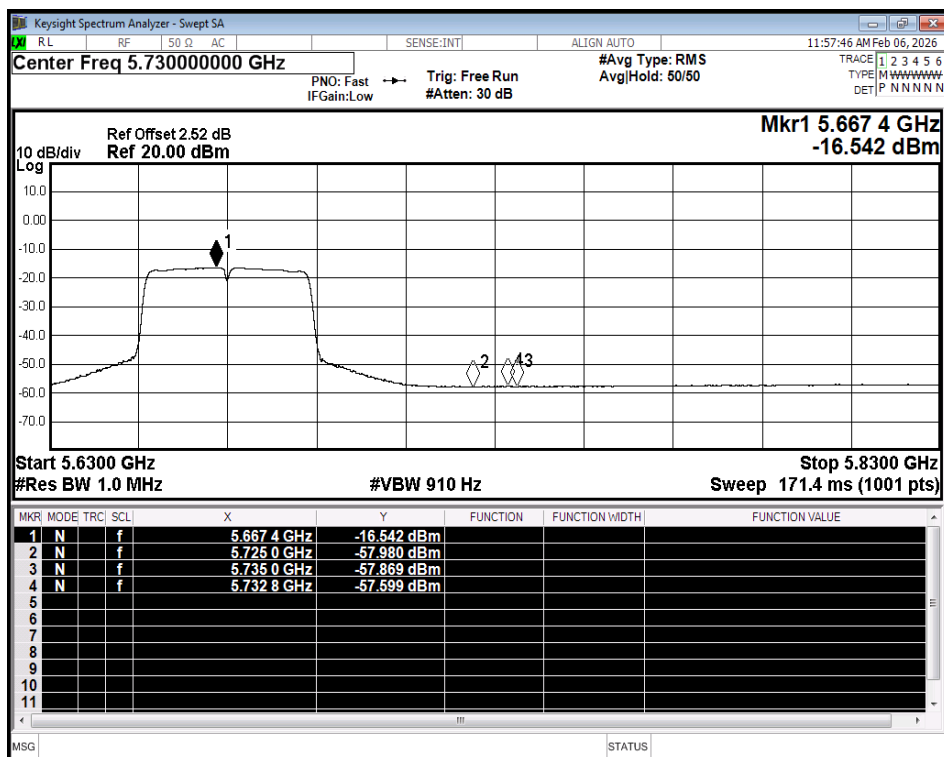

Restrict Band NVNT ac40 5670MHz Ant1 Average




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A &amp; 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

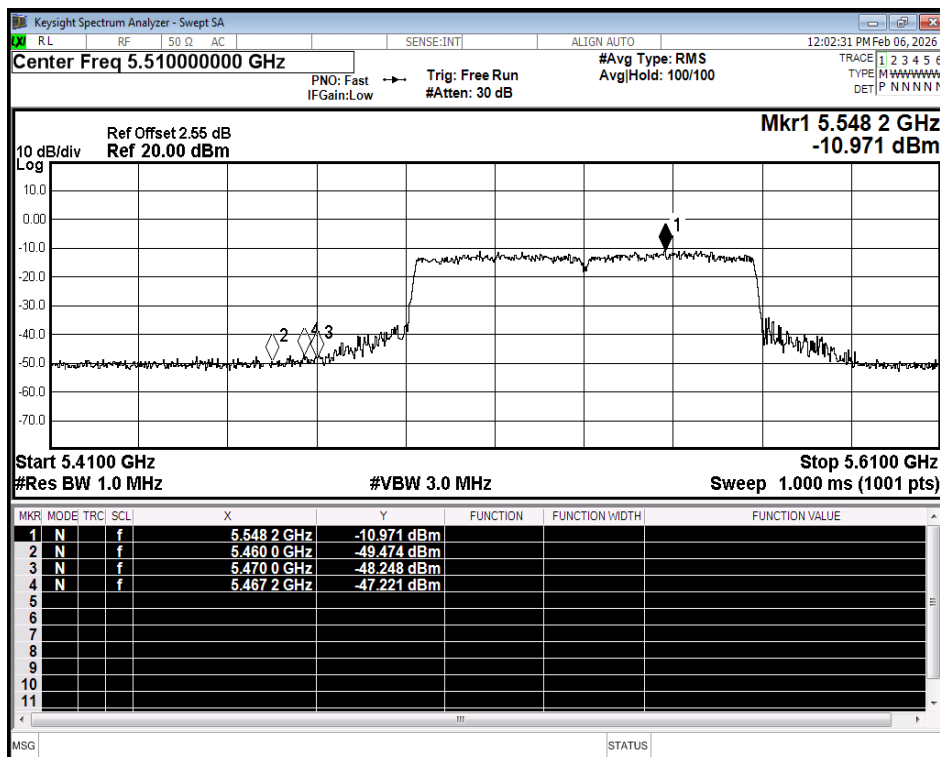

Restrict Band NVNT ac80 5530MHz Ant1 Peak

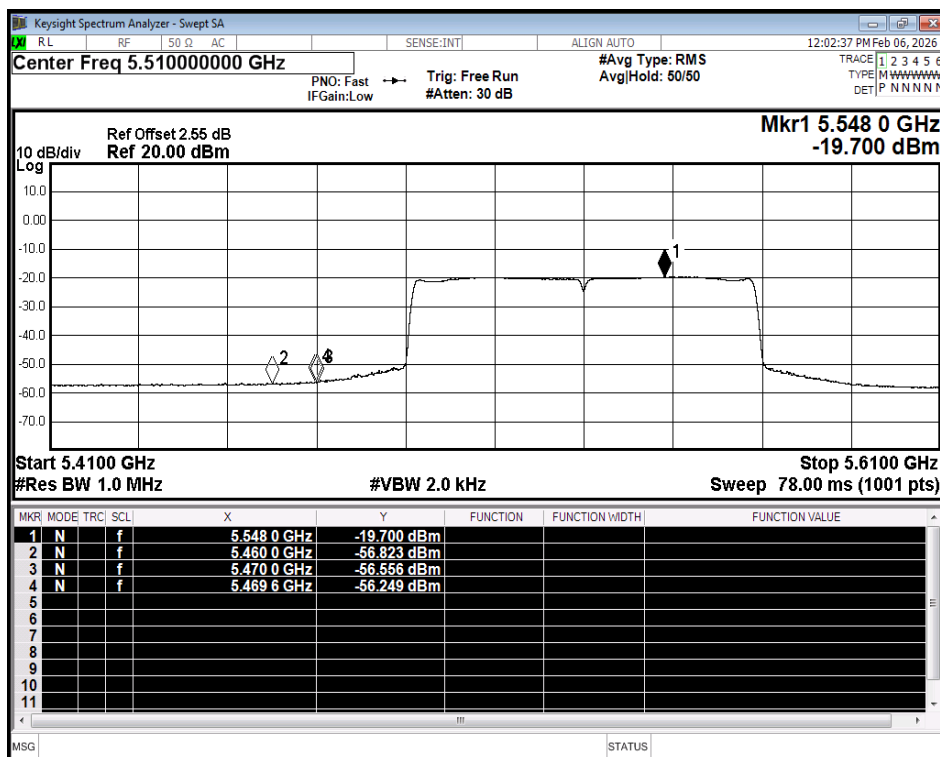

Restrict Band NVNT ac80 5530MHz Ant1 Average




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A &amp; 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

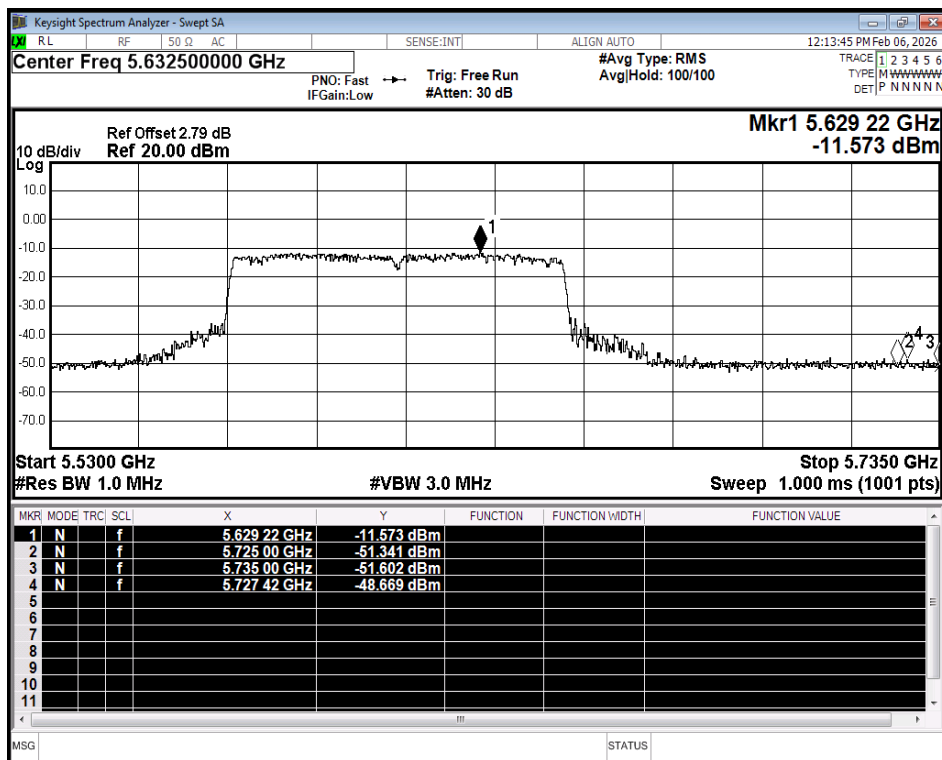

Restrict Band NVNT ac80 5610MHz Ant1 Peak

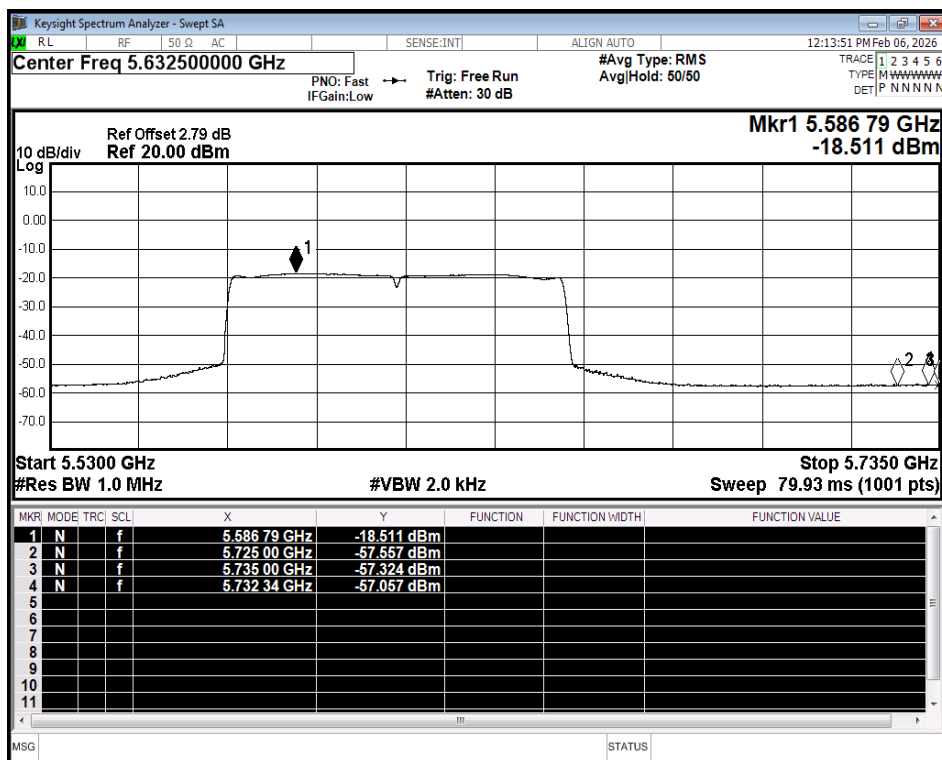

Restrict Band NVNT ac80 5610MHz Ant1 Average




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A &amp; 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

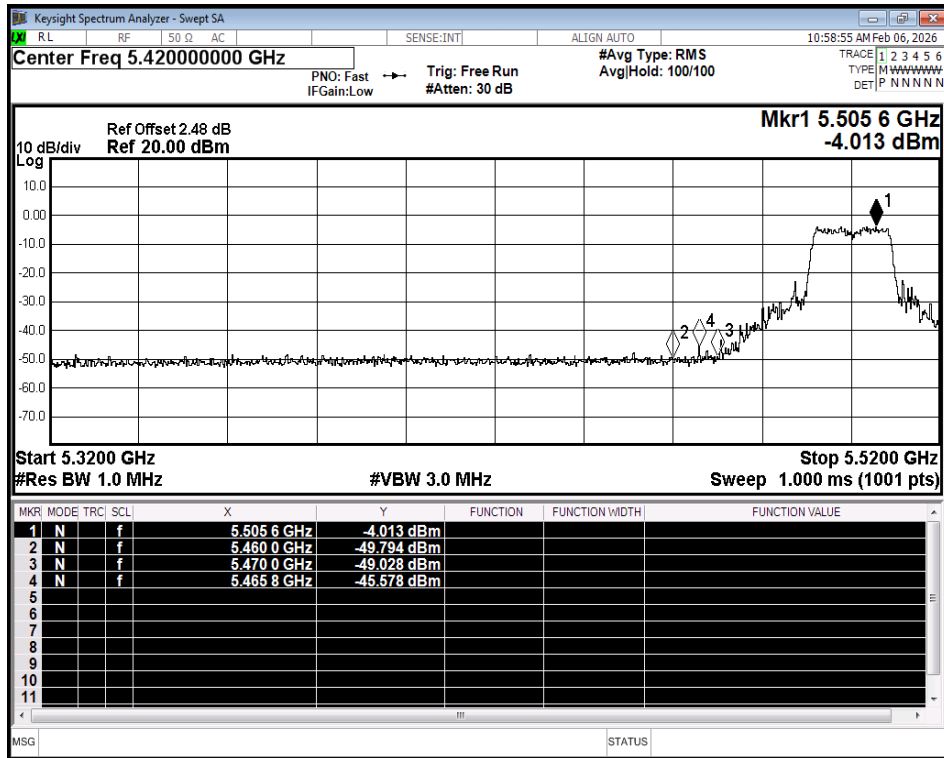

Restrict Band NVNT ax20 5500MHz Ant1 Peak

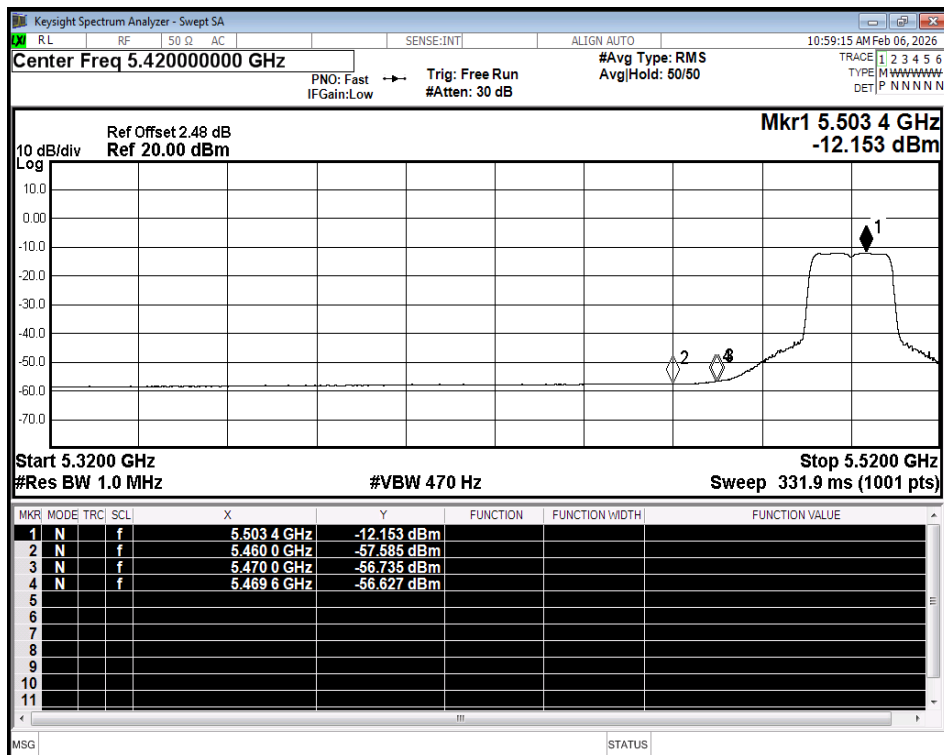

Restrict Band NVNT ax20 5500MHz Ant1 Average




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A &amp; 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

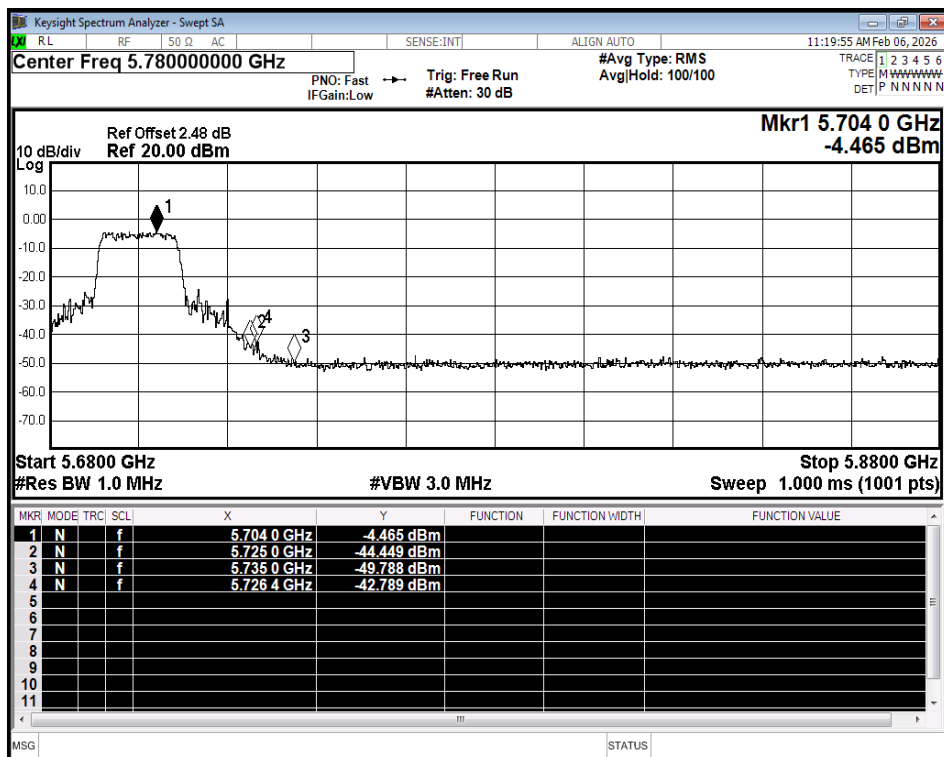

Restrict Band NVNT ax20 5700MHz Ant1 Peak

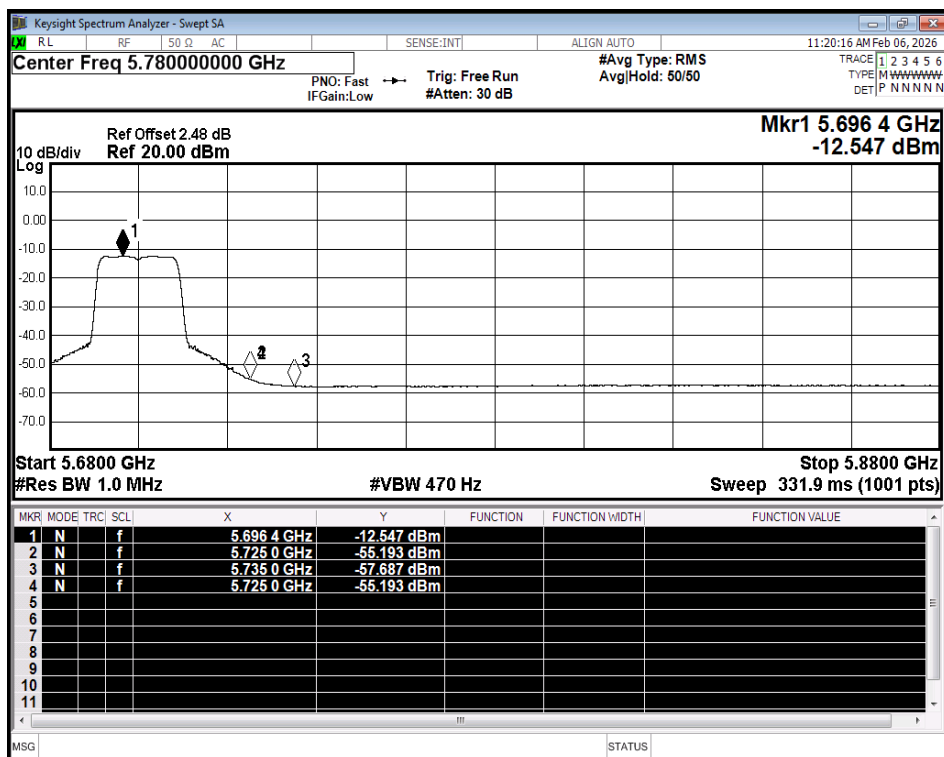

Restrict Band NVNT ax20 5700MHz Ant1 Average




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A &amp; 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

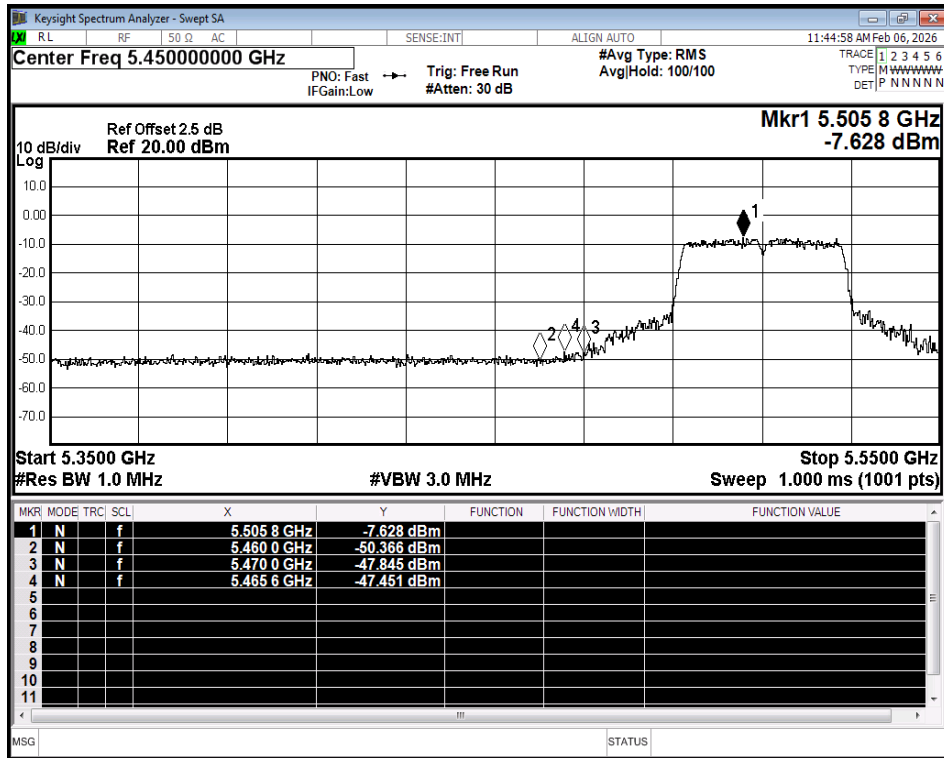

Restrict Band NVNT ax40 5510MHz Ant1 Peak

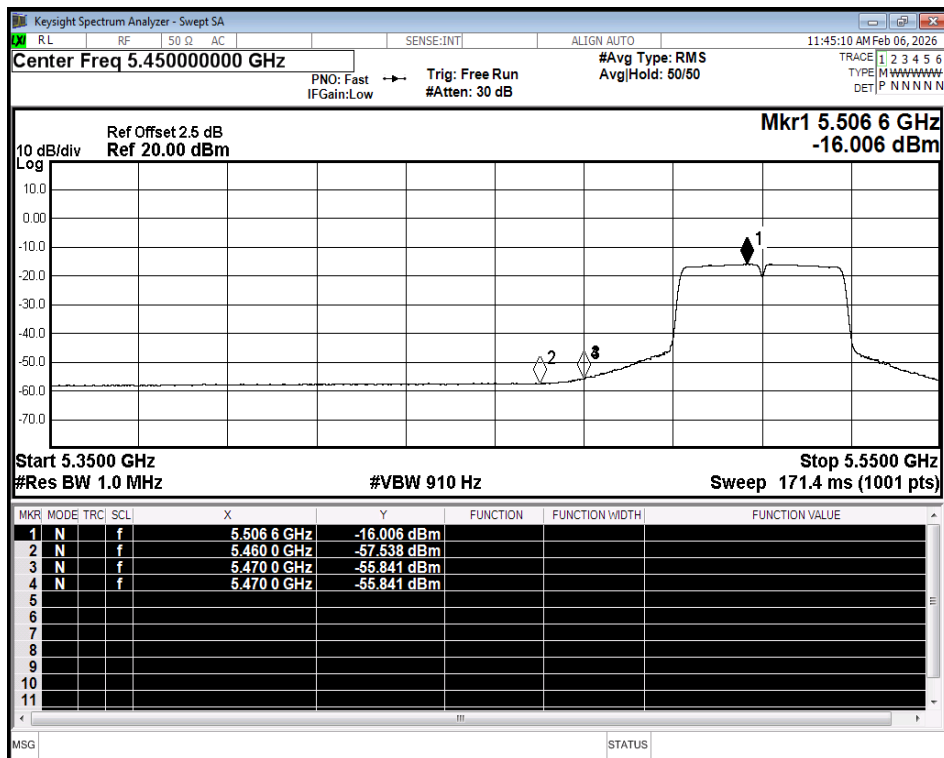

Restrict Band NVNT ax40 5510MHz Ant1 Average




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A &amp; 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

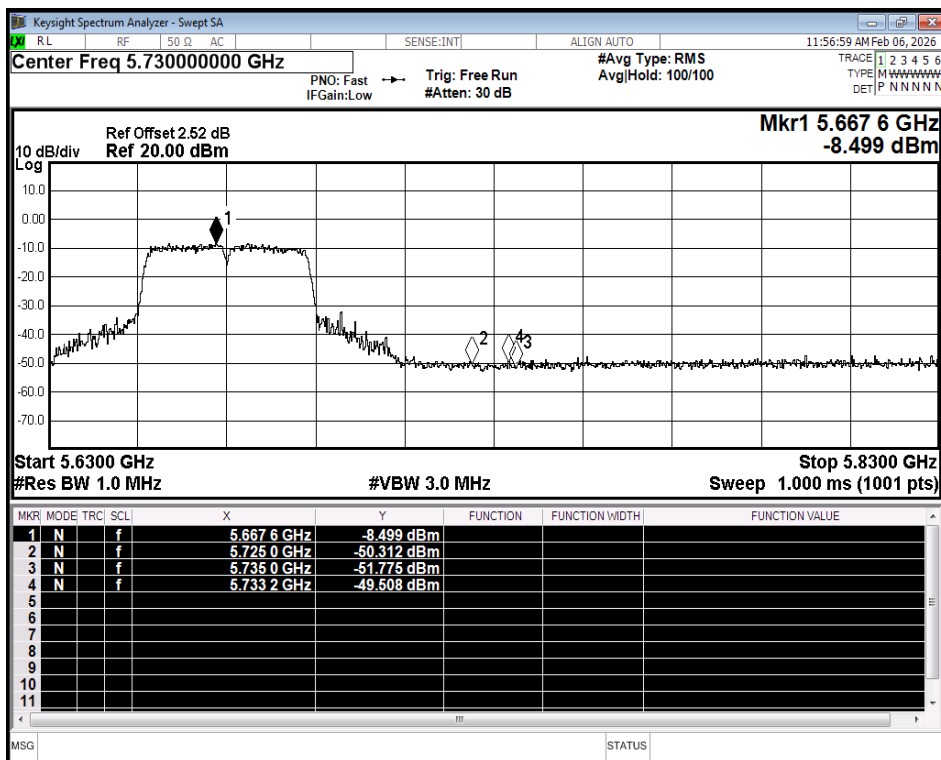

Restrict Band NVNT ax40 5670MHz Ant1 Peak

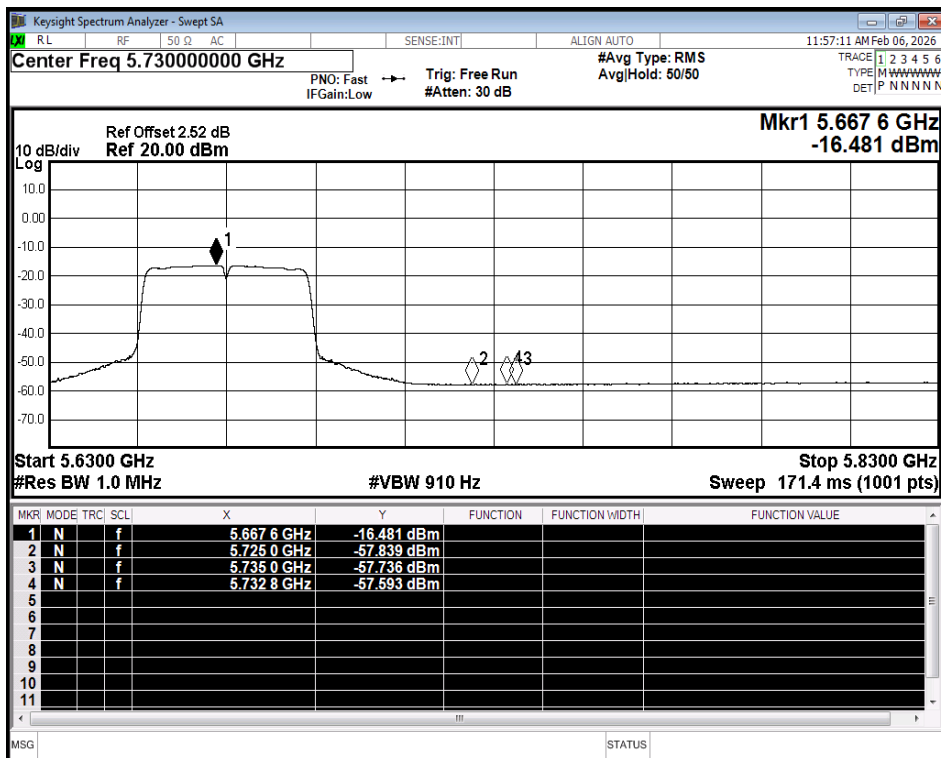

Restrict Band NVNT ax40 5670MHz Ant1 Average




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A &amp; 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

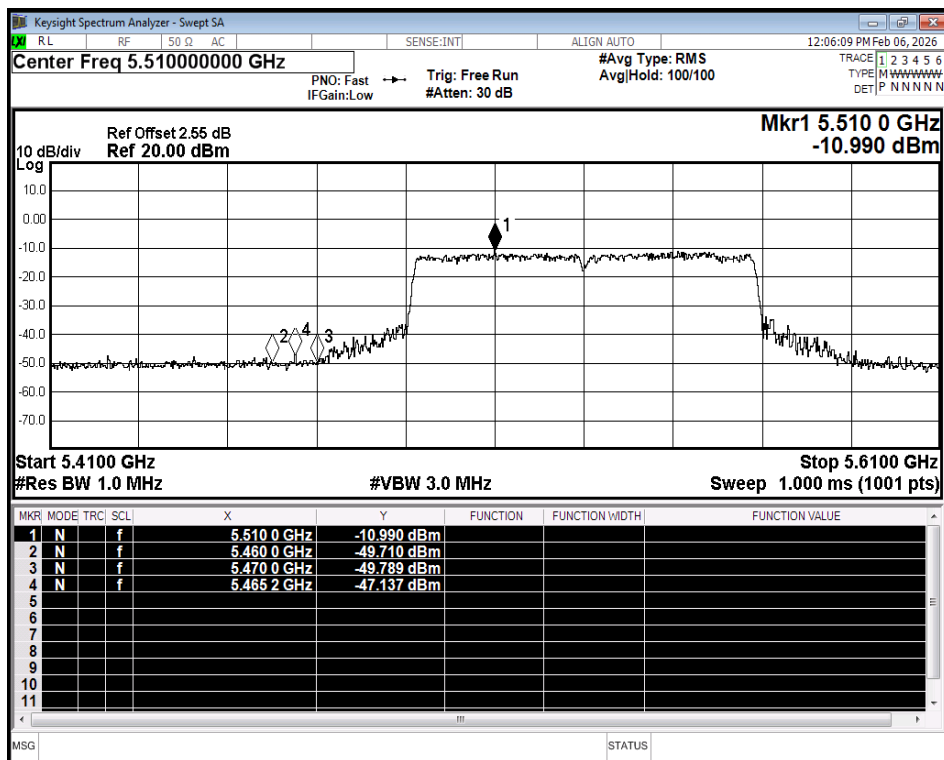

Restrict Band NVNT ax80 5530MHz Ant1 Peak

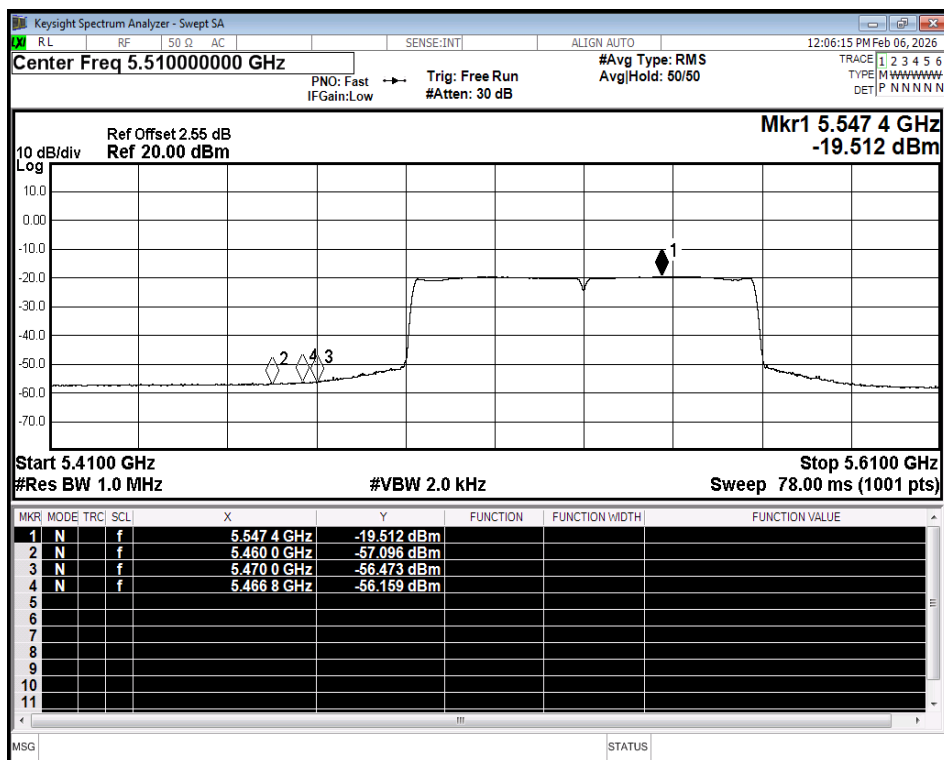

Restrict Band NVNT ax80 5530MHz Ant1 Average




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A &amp; 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

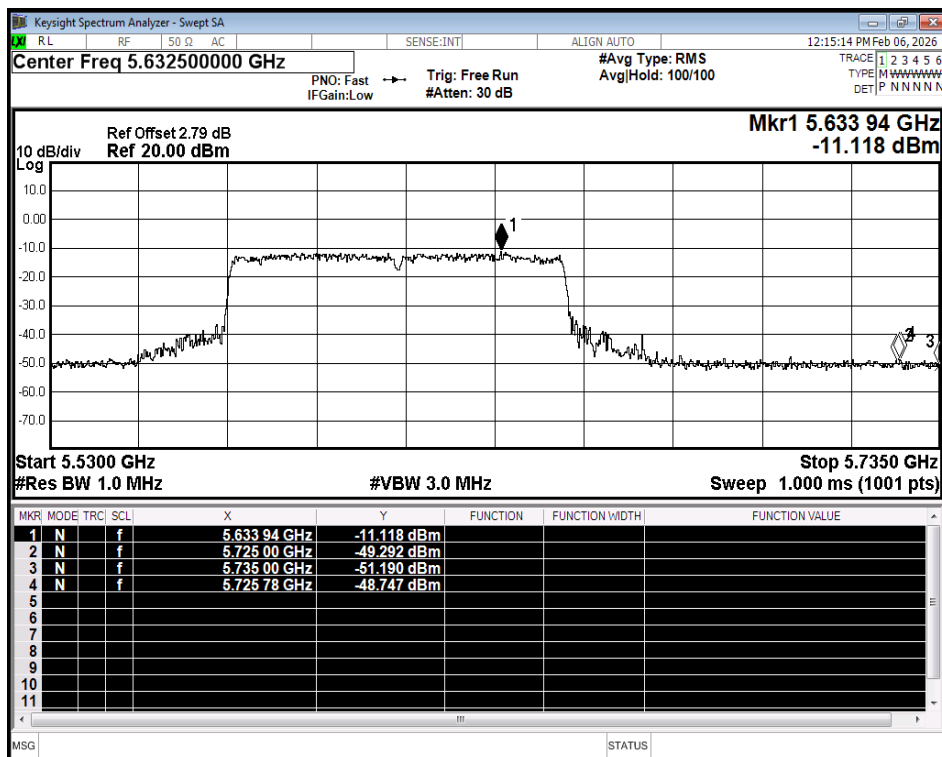

Restrict Band NVNT ax80 5610MHz Ant1 Peak

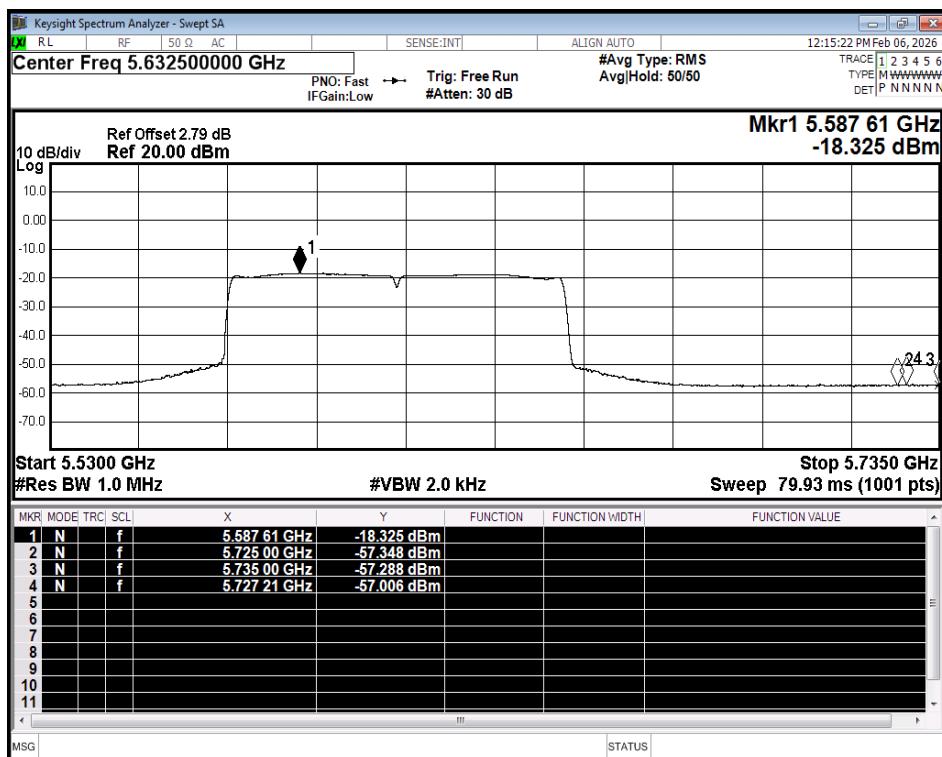

Restrict Band NVNT ax80 5610MHz Ant1 Average



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A &amp; 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



| Condition | Mode | Frequency<br>(MHz) | Antenna | Spur Freq<br>(MHz) | Power<br>(dBm) | Gain<br>(dBi) | E<br>(dBuV/m) | Detector | Limit<br>(dBuV/m) | Verdict |
|-----------|------|--------------------|---------|--------------------|----------------|---------------|---------------|----------|-------------------|---------|
| NVNT      | a    | 5500               | Ant2    | 5460               | -48.32         | 2             | 48.91         | Peak     | 68.2              | Pass    |
| NVNT      | a    | 5500               | Ant2    | 5460               | -56.81         | 2             | 40.42         | Average  | 54                | Pass    |
| NVNT      | a    | 5500               | Ant2    | 5468.2             | -42.68         | 2             | 54.55         | Peak     | 68.2              | Pass    |
| NVNT      | a    | 5500               | Ant2    | 5469.6             | -55.77         | 2             | 41.46         | Average  | 54                | Pass    |
| NVNT      | a    | 5500               | Ant2    | 5470               | -44.53         | 2             | 52.7          | Peak     | 68.2              | Pass    |
| NVNT      | a    | 5500               | Ant2    | 5470               | -56.04         | 2             | 41.19         | Average  | 54                | Pass    |
| NVNT      | a    | 5700               | Ant2    | 5725               | -46.35         | 2             | 50.88         | Peak     | 68.2              | Pass    |
| NVNT      | a    | 5700               | Ant2    | 5725               | -54.74         | 2             | 42.49         | Average  | 54                | Pass    |
| NVNT      | a    | 5700               | Ant2    | 5725.2             | -39.75         | 2             | 57.48         | Peak     | 68.2              | Pass    |
| NVNT      | a    | 5700               | Ant2    | 5725               | -54.74         | 2             | 42.49         | Average  | 54                | Pass    |
| NVNT      | a    | 5700               | Ant2    | 5735               | -48.64         | 2             | 48.59         | Peak     | 68.2              | Pass    |
| NVNT      | a    | 5700               | Ant2    | 5735               | -57.04         | 2             | 40.19         | Average  | 54                | Pass    |
| NVNT      | n20  | 5500               | Ant2    | 5460               | -57.51         | 2             | 39.72         | Peak     | 68.2              | Pass    |
| NVNT      | n20  | 5500               | Ant2    | 5460               | -63.95         | 2             | 33.28         | Average  | 54                | Pass    |
| NVNT      | n20  | 5500               | Ant2    | 5469.8             | -44.3          | 2             | 52.93         | Peak     | 68.2              | Pass    |
| NVNT      | n20  | 5500               | Ant2    | 5470               | -57.33         | 2             | 39.9          | Average  | 54                | Pass    |
| NVNT      | n20  | 5500               | Ant2    | 5470               | -47.1          | 2             | 50.13         | Peak     | 68.2              | Pass    |
| NVNT      | n20  | 5500               | Ant2    | 5470               | -57.33         | 2             | 39.9          | Average  | 54                | Pass    |
| NVNT      | n20  | 5700               | Ant2    | 5725               | -41.36         | 2             | 55.87         | Peak     | 68.2              | Pass    |
| NVNT      | n20  | 5700               | Ant2    | 5725               | -54.61         | 2             | 42.62         | Average  | 54                | Pass    |
| NVNT      | n20  | 5700               | Ant2    | 5725.4             | -40.57         | 2             | 56.66         | Peak     | 68.2              | Pass    |
| NVNT      | n20  | 5700               | Ant2    | 5725               | -54.61         | 2             | 42.62         | Average  | 54                | Pass    |
| NVNT      | n20  | 5700               | Ant2    | 5735               | -53.07         | 2             | 44.16         | Peak     | 68.2              | Pass    |
| NVNT      | n20  | 5700               | Ant2    | 5735               | -63.19         | 2             | 34.04         | Average  | 54                | Pass    |
| NVNT      | n40  | 5510               | Ant2    | 5460               | -54.8          | 2             | 42.43         | Peak     | 68.2              | Pass    |
| NVNT      | n40  | 5510               | Ant2    | 5460               | -63.34         | 2             | 33.89         | Average  | 54                | Pass    |
| NVNT      | n40  | 5510               | Ant2    | 5467.8             | -42.51         | 2             | 54.72         | Peak     | 68.2              | Pass    |
| NVNT      | n40  | 5510               | Ant2    | 5470               | -55.9          | 2             | 41.33         | Average  | 54                | Pass    |
| NVNT      | n40  | 5510               | Ant2    | 5470               | -45.79         | 2             | 51.44         | Peak     | 68.2              | Pass    |
| NVNT      | n40  | 5510               | Ant2    | 5470               | -55.9          | 2             | 41.33         | Average  | 54                | Pass    |
| NVNT      | n40  | 5670               | Ant2    | 5725               | -57.58         | 2             | 39.65         | Peak     | 68.2              | Pass    |
| NVNT      | n40  | 5670               | Ant2    | 5725               | -65.23         | 2             | 32            | Average  | 54                | Pass    |
| NVNT      | n40  | 5670               | Ant2    | 5726.6             | -56.56         | 2             | 40.67         | Peak     | 68.2              | Pass    |
| NVNT      | n40  | 5670               | Ant2    | 5725.4             | -64.75         | 2             | 32.48         | Average  | 54                | Pass    |
| NVNT      | n40  | 5670               | Ant2    | 5735               | -57.61         | 2             | 39.62         | Peak     | 68.2              | Pass    |
| NVNT      | n40  | 5670               | Ant2    | 5735               | -65.56         | 2             | 31.67         | Average  | 54                | Pass    |
| NVNT      | ac20 | 5500               | Ant2    | 5460               | -57.81         | 2             | 39.42         | Peak     | 68.2              | Pass    |
| NVNT      | ac20 | 5500               | Ant2    | 5460               | -64.01         | 2             | 33.22         | Average  | 54                | Pass    |



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A &amp; 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: [webmaster@lcs-cert.com](mailto:webmaster@lcs-cert.com) | Web: [www.lcs-cert.com](http://www.lcs-cert.com)

Scan code to check authenticity



|      |      |      |      |         |        |   |       |         |      |      |
|------|------|------|------|---------|--------|---|-------|---------|------|------|
| NVNT | ac20 | 5500 | Ant2 | 5468.6  | -45.12 | 2 | 52.11 | Peak    | 68.2 | Pass |
| NVNT | ac20 | 5500 | Ant2 | 5470    | -57.38 | 2 | 39.85 | Average | 54   | Pass |
| NVNT | ac20 | 5500 | Ant2 | 5470    | -48.12 | 2 | 49.11 | Peak    | 68.2 | Pass |
| NVNT | ac20 | 5500 | Ant2 | 5470    | -57.38 | 2 | 39.85 | Average | 54   | Pass |
| NVNT | ac20 | 5700 | Ant2 | 5725    | -43.46 | 2 | 53.77 | Peak    | 68.2 | Pass |
| NVNT | ac20 | 5700 | Ant2 | 5725    | -55.58 | 2 | 41.65 | Average | 54   | Pass |
| NVNT | ac20 | 5700 | Ant2 | 5726    | -40.54 | 2 | 56.69 | Peak    | 68.2 | Pass |
| NVNT | ac20 | 5700 | Ant2 | 5725.2  | -55.49 | 2 | 41.74 | Average | 54   | Pass |
| NVNT | ac20 | 5700 | Ant2 | 5735    | -53.24 | 2 | 43.99 | Peak    | 68.2 | Pass |
| NVNT | ac20 | 5700 | Ant2 | 5735    | -63.12 | 2 | 34.11 | Average | 54   | Pass |
| NVNT | ac40 | 5510 | Ant2 | 5460    | -58.26 | 2 | 38.97 | Peak    | 68.2 | Pass |
| NVNT | ac40 | 5510 | Ant2 | 5460    | -63.23 | 2 | 34    | Average | 54   | Pass |
| NVNT | ac40 | 5510 | Ant2 | 5468.6  | -39.91 | 2 | 57.32 | Peak    | 68.2 | Pass |
| NVNT | ac40 | 5510 | Ant2 | 5469.6  | -55.97 | 2 | 41.26 | Average | 54   | Pass |
| NVNT | ac40 | 5510 | Ant2 | 5470    | -45.6  | 2 | 51.63 | Peak    | 68.2 | Pass |
| NVNT | ac40 | 5510 | Ant2 | 5470    | -56.09 | 2 | 41.14 | Average | 54   | Pass |
| NVNT | ac40 | 5670 | Ant2 | 5725    | -57.65 | 2 | 39.58 | Peak    | 68.2 | Pass |
| NVNT | ac40 | 5670 | Ant2 | 5725    | -65.1  | 2 | 32.13 | Average | 54   | Pass |
| NVNT | ac40 | 5670 | Ant2 | 5725.2  | -55.81 | 2 | 41.42 | Peak    | 68.2 | Pass |
| NVNT | ac40 | 5670 | Ant2 | 5725    | -65.1  | 2 | 32.13 | Average | 54   | Pass |
| NVNT | ac40 | 5670 | Ant2 | 5735    | -57.89 | 2 | 39.34 | Peak    | 68.2 | Pass |
| NVNT | ac40 | 5670 | Ant2 | 5735    | -65.46 | 2 | 31.77 | Average | 54   | Pass |
| NVNT | ac80 | 5530 | Ant2 | 5460    | -51.96 | 2 | 45.27 | Peak    | 68.2 | Pass |
| NVNT | ac80 | 5530 | Ant2 | 5460    | -59.95 | 2 | 37.28 | Average | 54   | Pass |
| NVNT | ac80 | 5530 | Ant2 | 5467.4  | -43.42 | 2 | 53.81 | Peak    | 68.2 | Pass |
| NVNT | ac80 | 5530 | Ant2 | 5469.8  | -55.96 | 2 | 41.27 | Average | 54   | Pass |
| NVNT | ac80 | 5530 | Ant2 | 5470    | -44.38 | 2 | 52.85 | Peak    | 68.2 | Pass |
| NVNT | ac80 | 5530 | Ant2 | 5470    | -56.07 | 2 | 41.16 | Average | 54   | Pass |
| NVNT | ac80 | 5610 | Ant2 | 5725    | -58.47 | 2 | 38.76 | Peak    | 68.2 | Pass |
| NVNT | ac80 | 5610 | Ant2 | 5725    | -65.54 | 2 | 31.69 | Average | 54   | Pass |
| NVNT | ac80 | 5610 | Ant2 | 5730.9  | -57.07 | 2 | 40.16 | Peak    | 68.2 | Pass |
| NVNT | ac80 | 5610 | Ant2 | 5733.36 | -65.36 | 2 | 31.87 | Average | 54   | Pass |
| NVNT | ac80 | 5610 | Ant2 | 5735    | -59.03 | 2 | 38.2  | Peak    | 68.2 | Pass |
| NVNT | ac80 | 5610 | Ant2 | 5735    | -65.36 | 2 | 31.87 | Average | 54   | Pass |
| NVNT | ax20 | 5500 | Ant2 | 5460    | -54.99 | 2 | 42.24 | Peak    | 68.2 | Pass |
| NVNT | ax20 | 5500 | Ant2 | 5460    | -64.04 | 2 | 33.19 | Average | 54   | Pass |
| NVNT | ax20 | 5500 | Ant2 | 5469.4  | -41.35 | 2 | 55.88 | Peak    | 68.2 | Pass |
| NVNT | ax20 | 5500 | Ant2 | 5469.8  | -57.64 | 2 | 39.59 | Average | 54   | Pass |
| NVNT | ax20 | 5500 | Ant2 | 5470    | -45.19 | 2 | 52.04 | Peak    | 68.2 | Pass |
| NVNT | ax20 | 5500 | Ant2 | 5470    | -57.82 | 2 | 39.41 | Average | 54   | Pass |
| NVNT | ax20 | 5700 | Ant2 | 5725    | -43.11 | 2 | 54.12 | Peak    | 68.2 | Pass |



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A &amp; 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



|      |      |      |      |          |        |   |       |         |      |      |
|------|------|------|------|----------|--------|---|-------|---------|------|------|
| NVNT | ax20 | 5700 | Ant2 | 5725     | -53.28 | 2 | 43.95 | Average | 54   | Pass |
| NVNT | ax20 | 5700 | Ant2 | 5727.2   | -41.62 | 2 | 55.61 | Peak    | 68.2 | Pass |
| NVNT | ax20 | 5700 | Ant2 | 5725     | -53.28 | 2 | 43.95 | Average | 54   | Pass |
| NVNT | ax20 | 5700 | Ant2 | 5735     | -48.77 | 2 | 48.46 | Peak    | 68.2 | Pass |
| NVNT | ax20 | 5700 | Ant2 | 5735     | -56.86 | 2 | 40.37 | Average | 54   | Pass |
| NVNT | ax40 | 5510 | Ant2 | 5460     | -53.43 | 2 | 43.8  | Peak    | 68.2 | Pass |
| NVNT | ax40 | 5510 | Ant2 | 5460     | -63.23 | 2 | 34    | Average | 54   | Pass |
| NVNT | ax40 | 5510 | Ant2 | 5469.8   | -43.26 | 2 | 53.97 | Peak    | 68.2 | Pass |
| NVNT | ax40 | 5510 | Ant2 | 5469.4   | -55.77 | 2 | 41.46 | Average | 54   | Pass |
| NVNT | ax40 | 5510 | Ant2 | 5470     | -44.86 | 2 | 52.37 | Peak    | 68.2 | Pass |
| NVNT | ax40 | 5510 | Ant2 | 5470     | -56.11 | 2 | 41.12 | Average | 54   | Pass |
| NVNT | ax40 | 5670 | Ant2 | 5725     | -57.47 | 2 | 39.76 | Peak    | 68.2 | Pass |
| NVNT | ax40 | 5670 | Ant2 | 5725     | -65.18 | 2 | 32.05 | Average | 54   | Pass |
| NVNT | ax40 | 5670 | Ant2 | 5727     | -55.85 | 2 | 41.38 | Peak    | 68.2 | Pass |
| NVNT | ax40 | 5670 | Ant2 | 5725.2   | -64.9  | 2 | 32.33 | Average | 54   | Pass |
| NVNT | ax40 | 5670 | Ant2 | 5735     | -58.31 | 2 | 38.92 | Peak    | 68.2 | Pass |
| NVNT | ax40 | 5670 | Ant2 | 5735     | -65.47 | 2 | 31.76 | Average | 54   | Pass |
| NVNT | ax80 | 5530 | Ant2 | 5460     | -53.51 | 2 | 43.72 | Peak    | 68.2 | Pass |
| NVNT | ax80 | 5530 | Ant2 | 5460     | -60.22 | 2 | 37.01 | Average | 54   | Pass |
| NVNT | ax80 | 5530 | Ant2 | 5469.2   | -43.31 | 2 | 53.92 | Peak    | 68.2 | Pass |
| NVNT | ax80 | 5530 | Ant2 | 5469.8   | -55.11 | 2 | 42.12 | Average | 54   | Pass |
| NVNT | ax80 | 5530 | Ant2 | 5470     | -47.78 | 2 | 49.45 | Peak    | 68.2 | Pass |
| NVNT | ax80 | 5530 | Ant2 | 5470     | -55.66 | 2 | 41.57 | Average | 54   | Pass |
| NVNT | ax80 | 5610 | Ant2 | 5725     | -46.77 | 2 | 50.46 | Peak    | 68.2 | Pass |
| NVNT | ax80 | 5610 | Ant2 | 5725     | -56.72 | 2 | 40.51 | Average | 54   | Pass |
| NVNT | ax80 | 5610 | Ant2 | 5725.16  | -46.77 | 2 | 50.46 | Peak    | 68.2 | Pass |
| NVNT | ax80 | 5610 | Ant2 | 5734.795 | -56.07 | 2 | 41.16 | Average | 54   | Pass |
| NVNT | ax80 | 5610 | Ant2 | 5735     | -49.15 | 2 | 48.08 | Peak    | 68.2 | Pass |
| NVNT | ax80 | 5610 | Ant2 | 5735     | -56.17 | 2 | 41.06 | Average | 54   | Pass |




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A &amp; 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: [webmaster@lcs-cert.com](mailto:webmaster@lcs-cert.com) | Web: [www.lcs-cert.com](http://www.lcs-cert.com)

Scan code to check authenticity

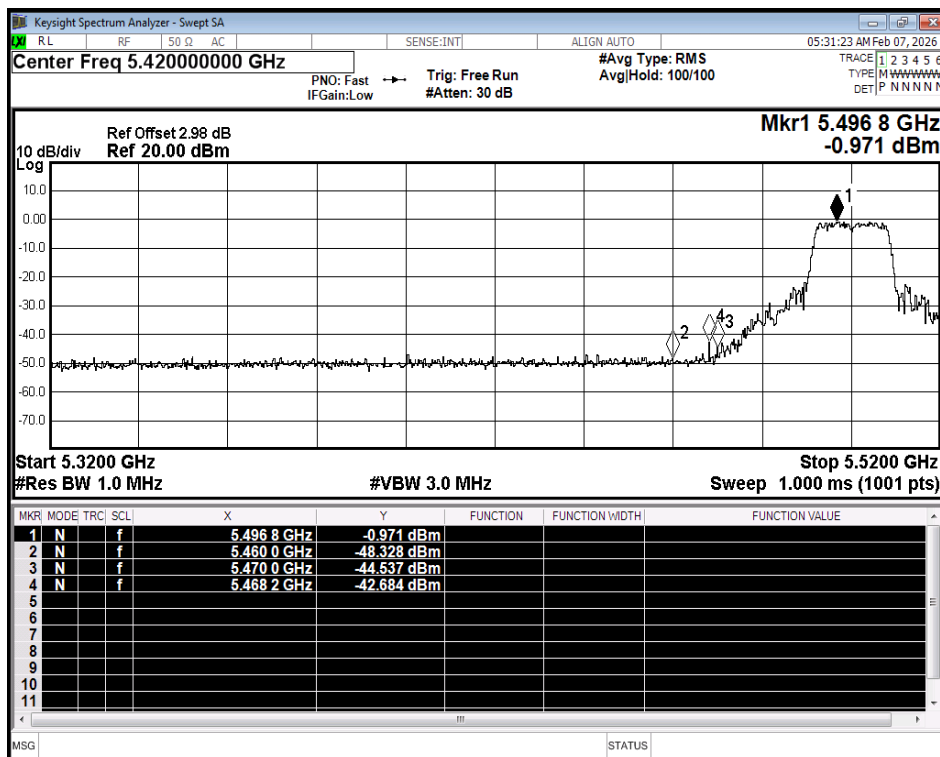

Restrict Band NVNT a 5500MHz Ant2 Peak

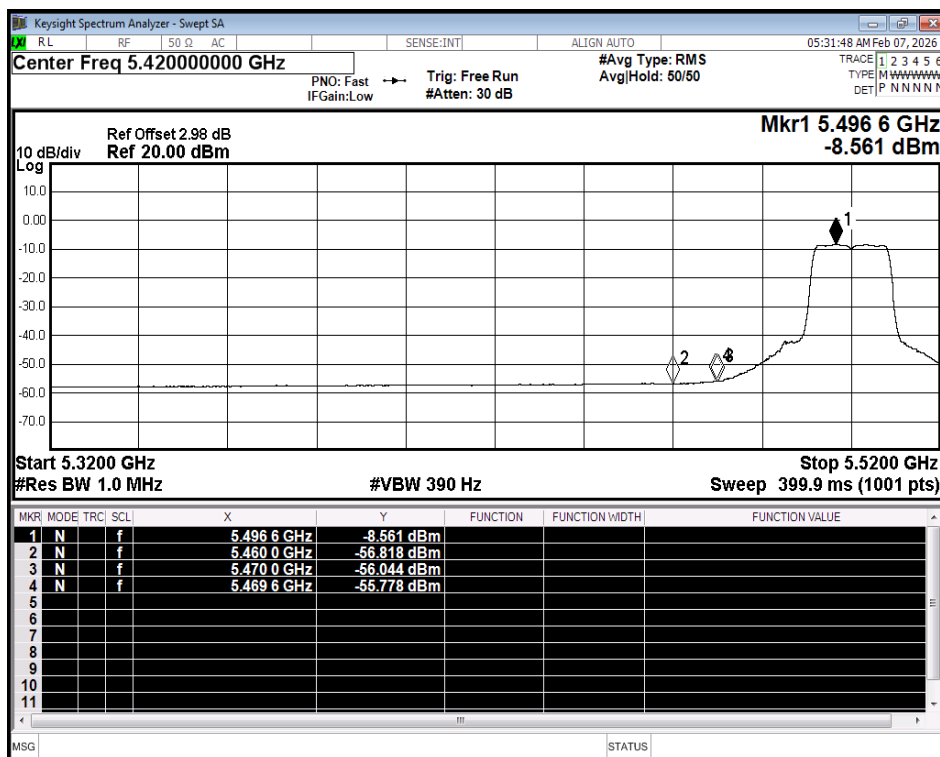

Restrict Band NVNT a 5500MHz Ant2 Average




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A &amp; 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

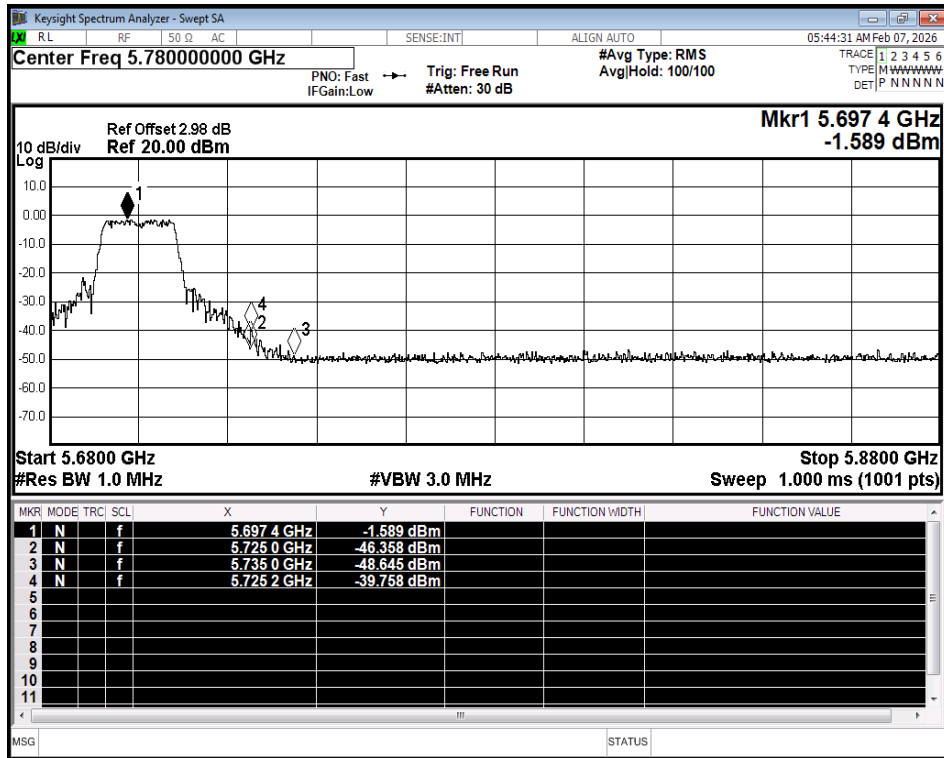

Restrict Band NVNT a 5700MHz Ant2 Peak

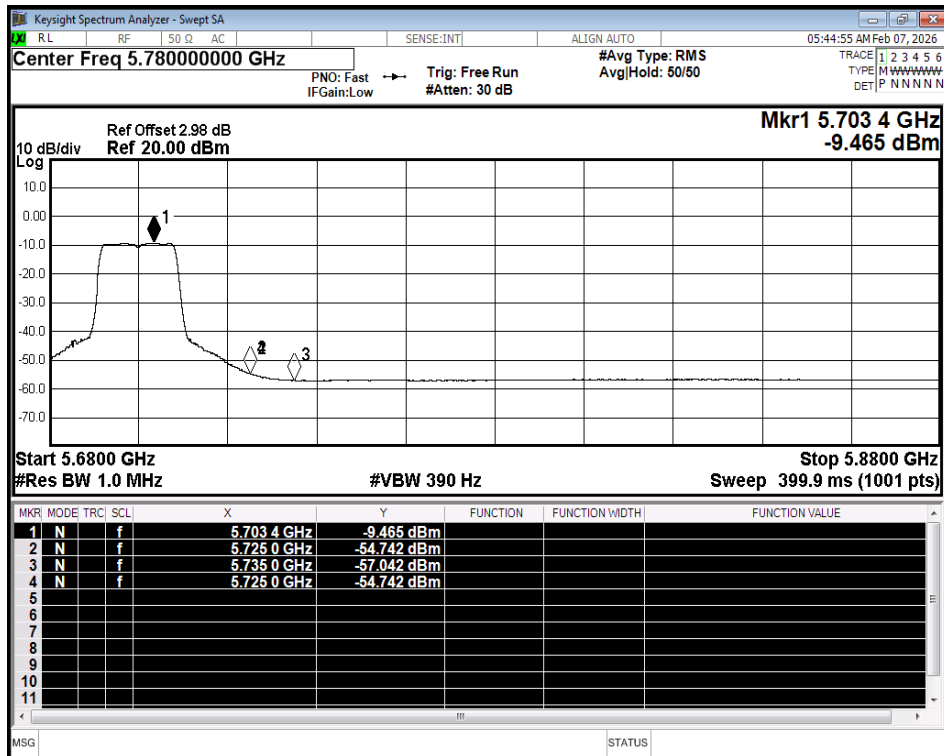

Restrict Band NVNT a 5700MHz Ant2 Average




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A &amp; 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

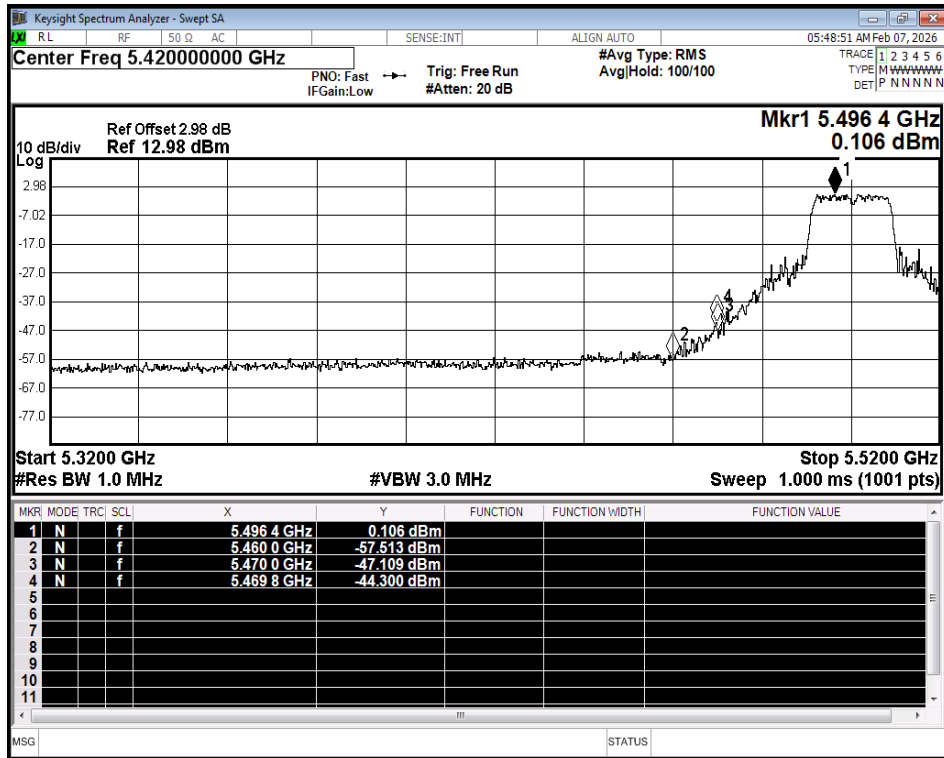

Restrict Band NVNT n20 5500MHz Ant2 Peak

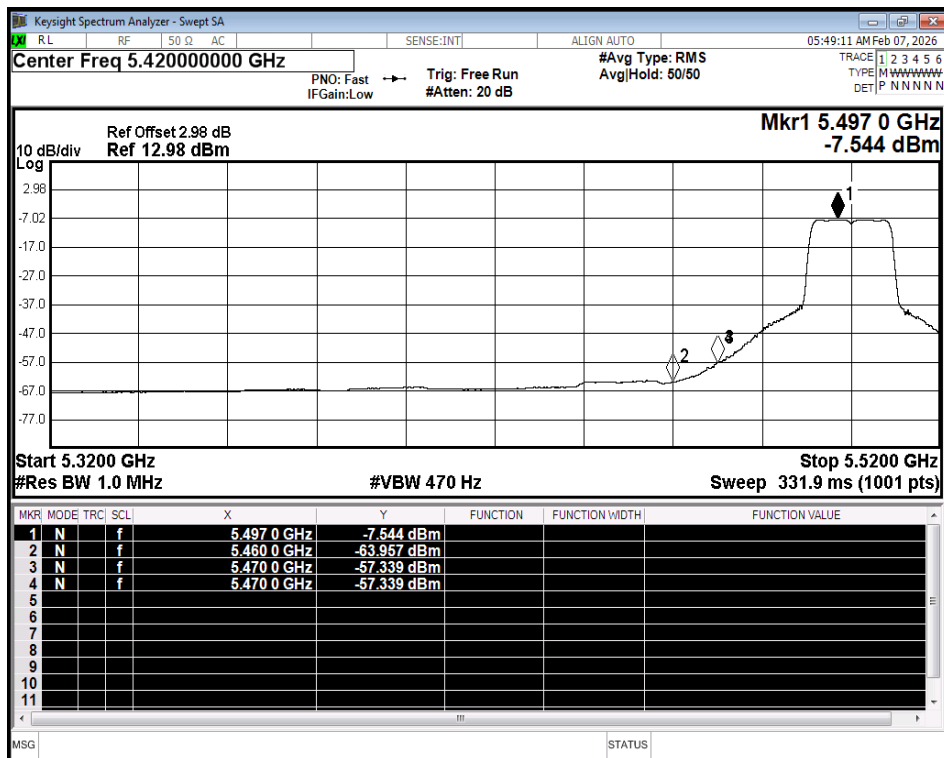

Restrict Band NVNT n20 5500MHz Ant2 Average



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A &amp; 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity