




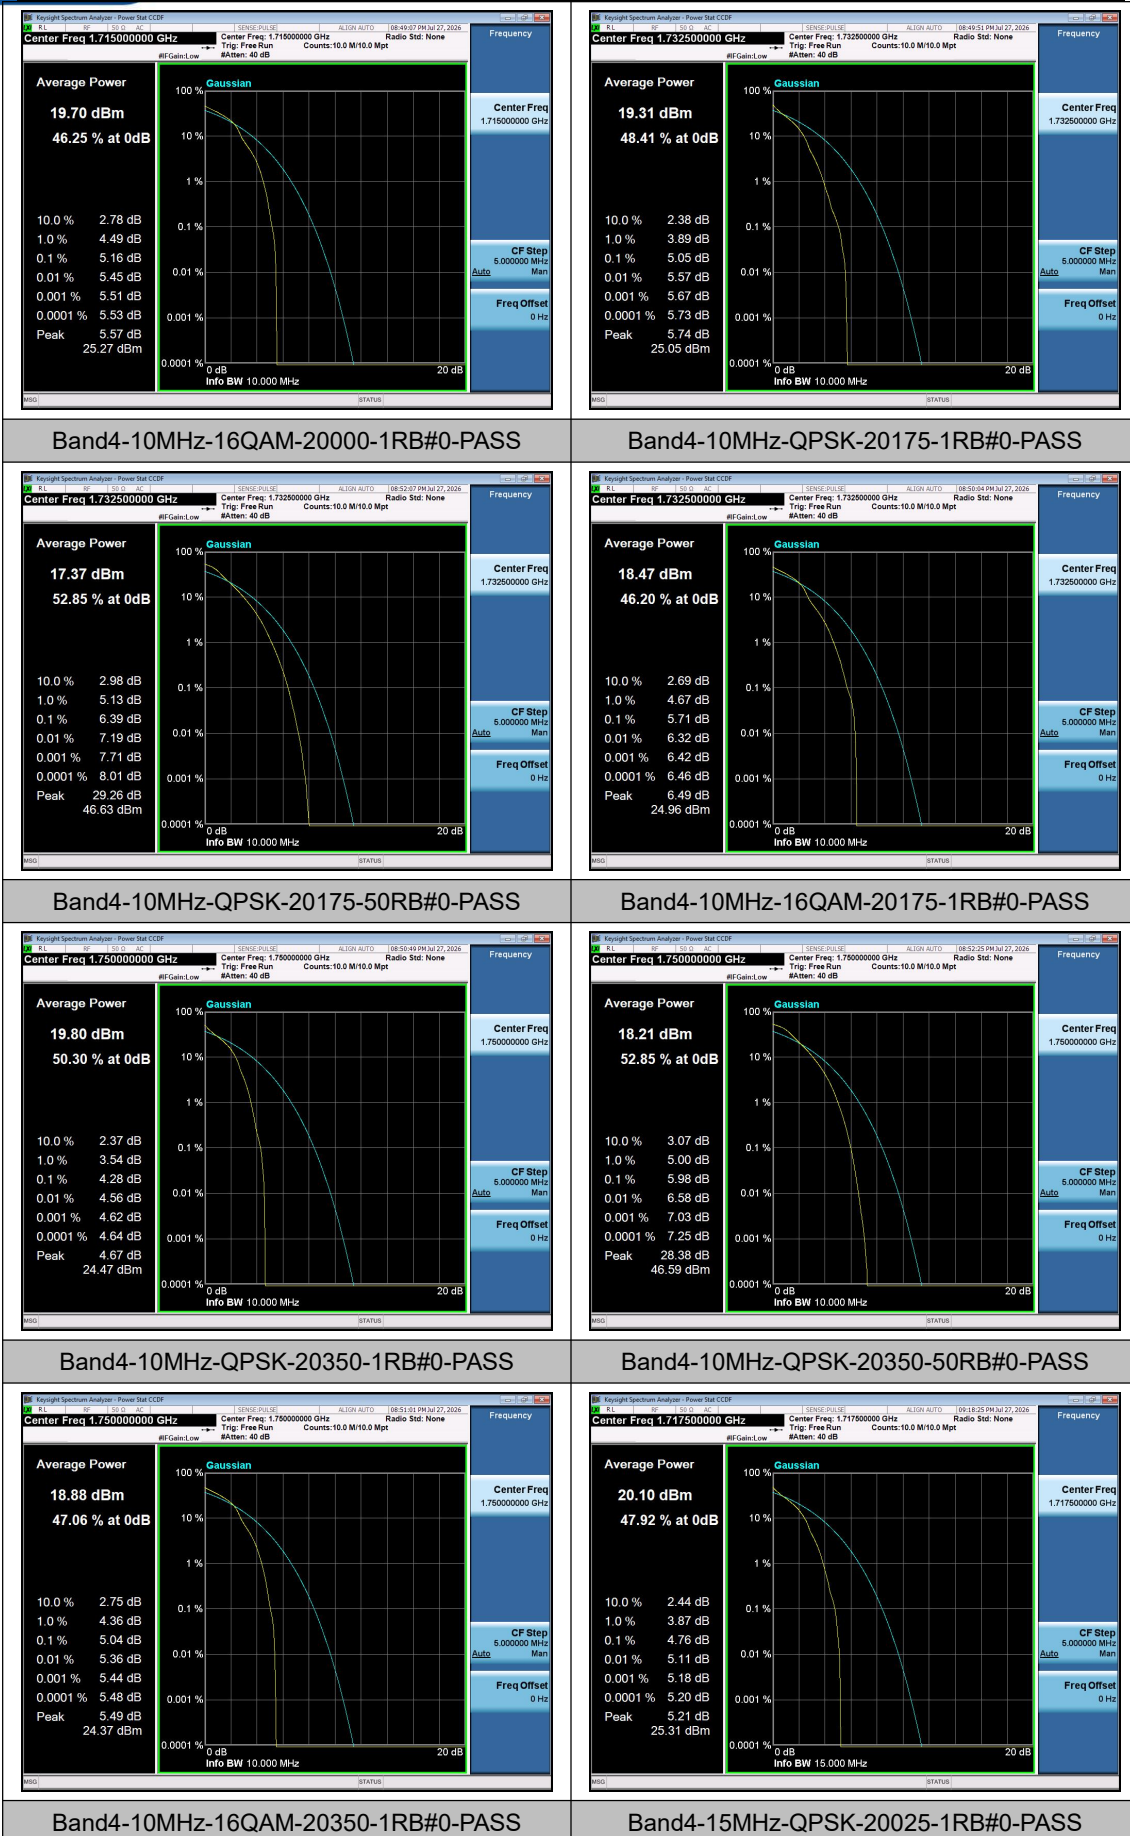

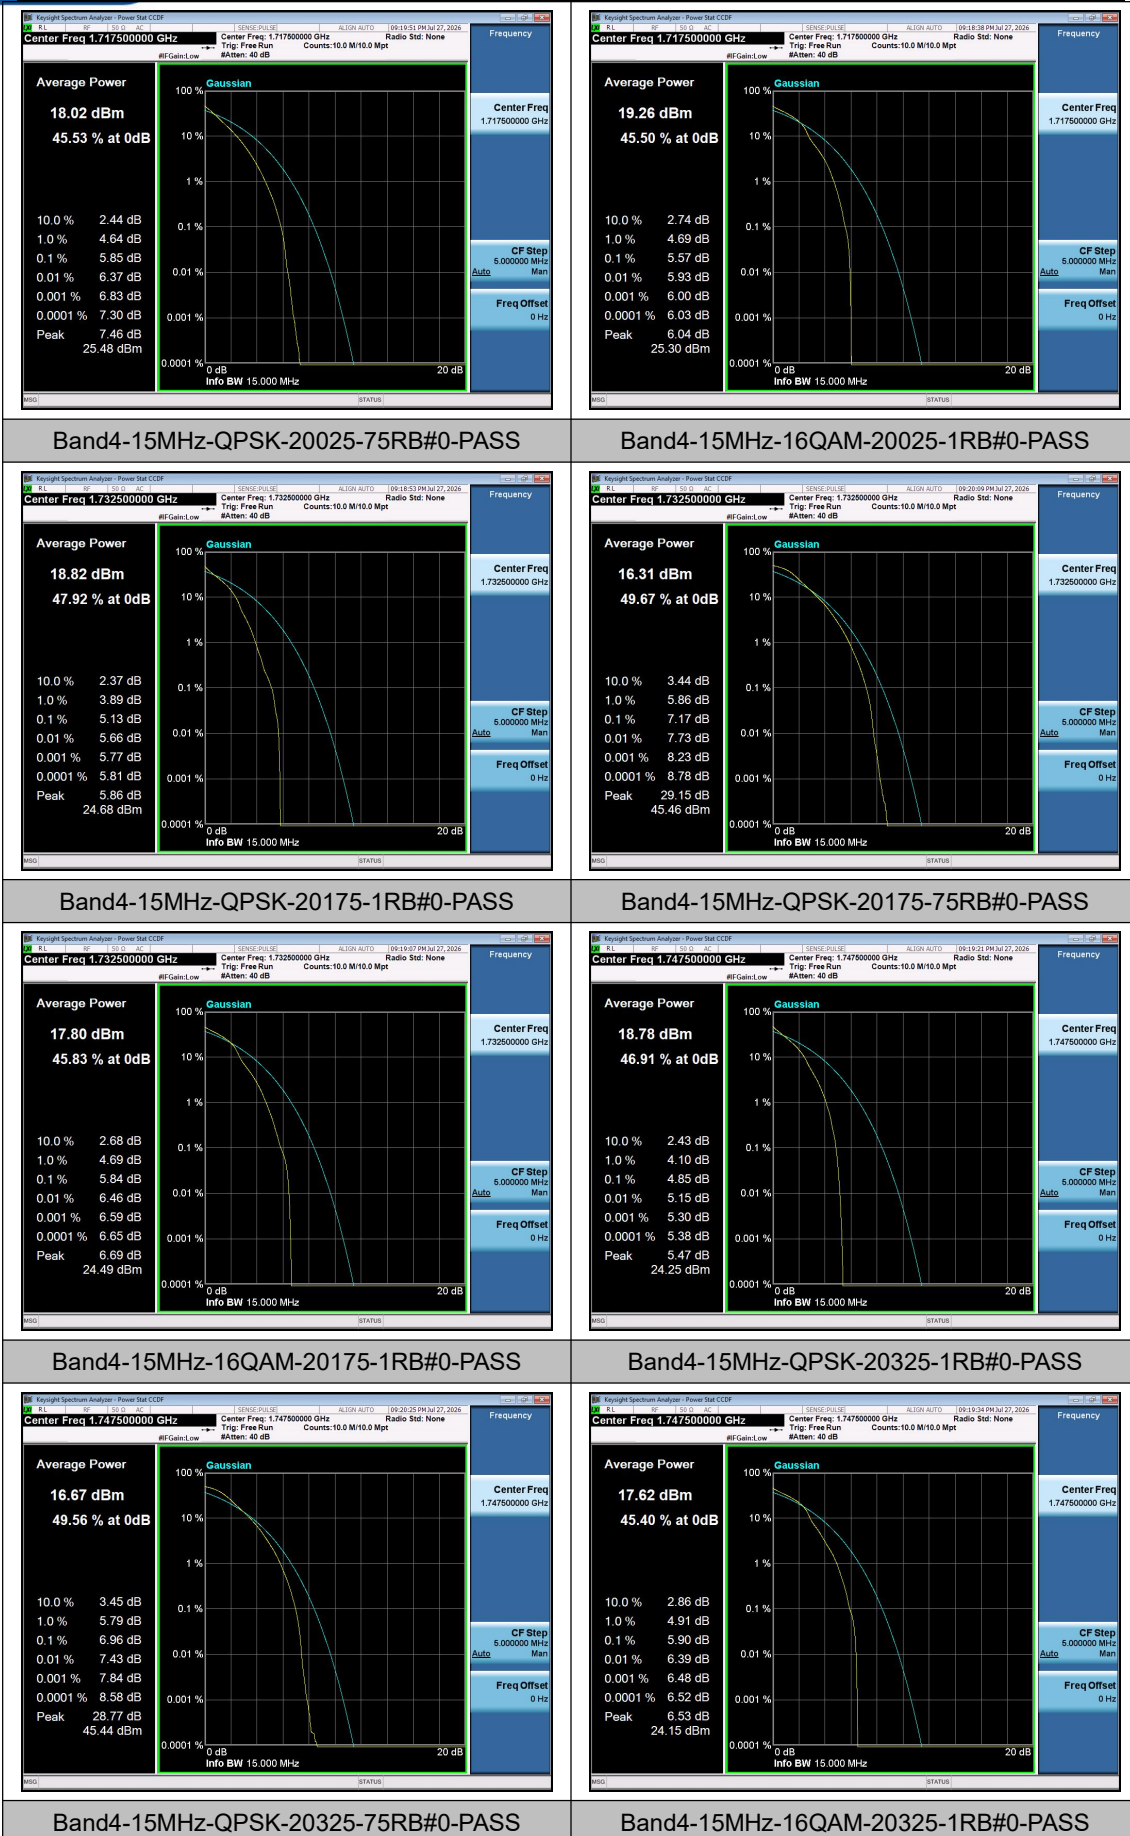

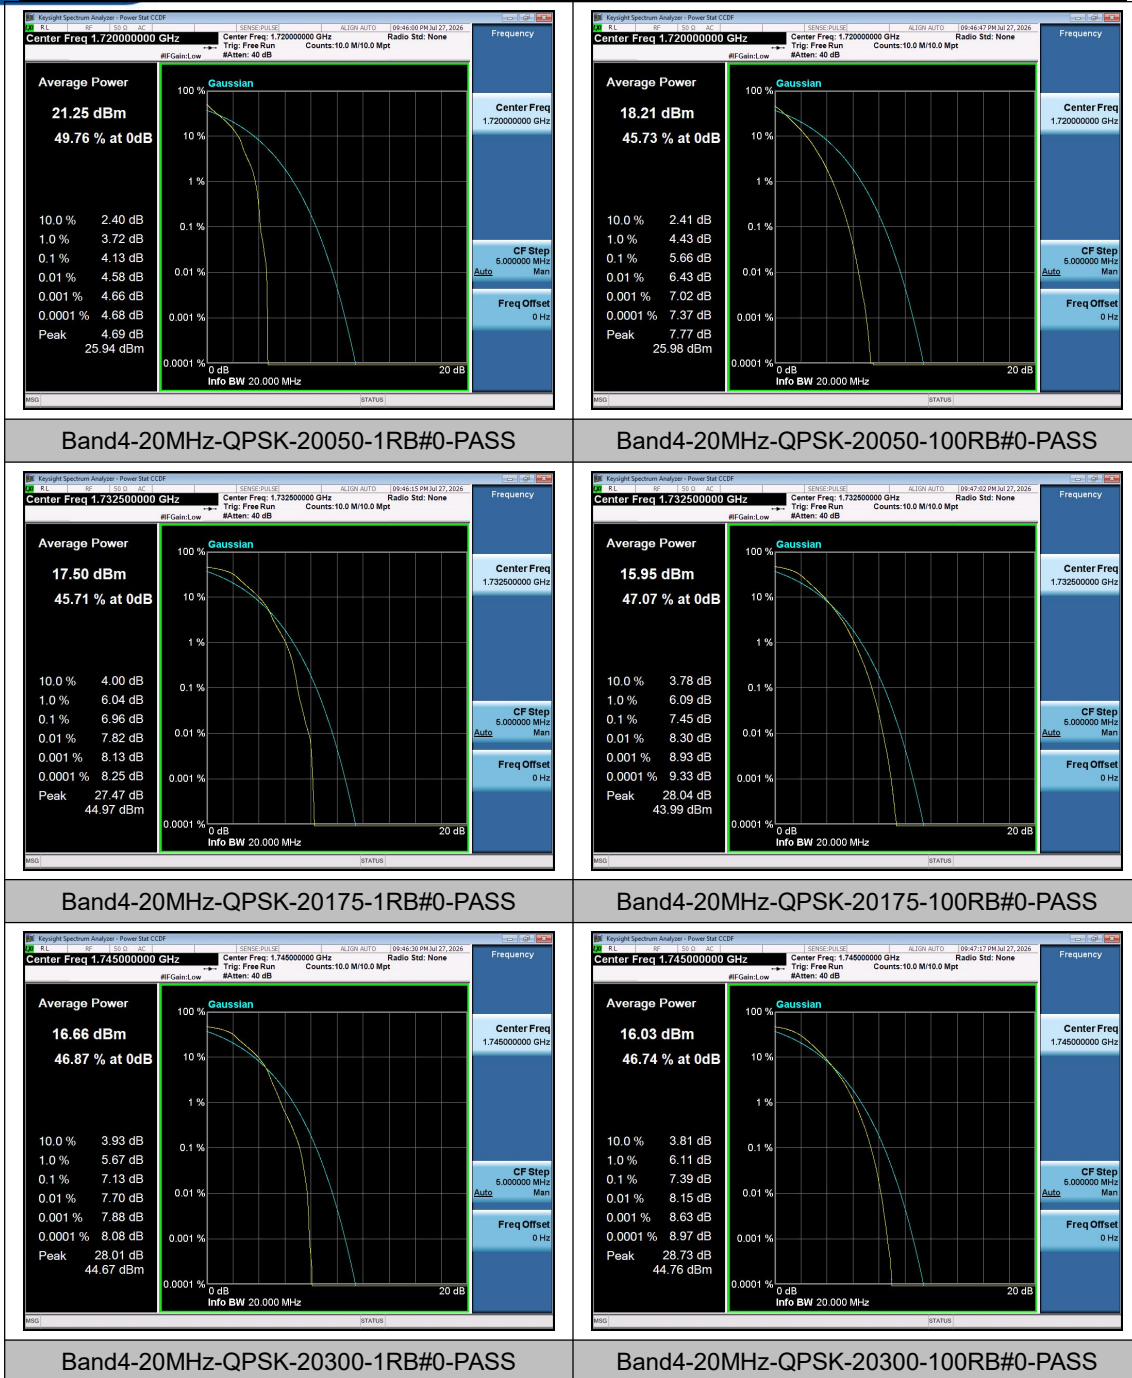



Appendix C: 26dB Bandwidth and Occupied Bandwidth

Test Result

Band	Bandwidth	Modulation	Channel	RB Configuration	Occupied Bandwidth (MHz)	26dB Bandwidth (MHz)	Verdict
Band4	1.4MHz	QPSK	19957	6RB#0	1.0954	1.280	PASS
Band4	1.4MHz	16QAM	19957	6RB#0	1.0910	1.291	PASS
Band4	1.4MHz	QPSK	20175	6RB#0	1.0920	1.294	PASS
Band4	1.4MHz	16QAM	20175	6RB#0	1.0896	1.285	PASS
Band4	1.4MHz	QPSK	20393	6RB#0	1.0964	1.302	PASS
Band4	1.4MHz	16QAM	20393	6RB#0	1.0959	1.313	PASS
Band4	3MHz	QPSK	19965	15RB#0	2.6963	2.957	PASS
Band4	3MHz	16QAM	19965	15RB#0	2.6932	2.944	PASS
Band4	3MHz	QPSK	20175	15RB#0	2.6988	2.972	PASS
Band4	3MHz	16QAM	20175	15RB#0	2.7062	2.975	PASS
Band4	3MHz	QPSK	20385	15RB#0	2.6975	2.951	PASS
Band4	3MHz	16QAM	20385	15RB#0	2.6884	2.956	PASS
Band4	5MHz	QPSK	19975	25RB#0	4.4872	4.960	PASS
Band4	5MHz	16QAM	19975	25RB#0	4.4973	4.984	PASS
Band4	5MHz	QPSK	20175	25RB#0	4.5027	5.045	PASS
Band4	5MHz	16QAM	20175	25RB#0	4.5021	5.023	PASS
Band4	5MHz	QPSK	20375	25RB#0	4.4978	4.997	PASS
Band4	5MHz	16QAM	20375	25RB#0	4.5013	4.999	PASS
Band4	10MHz	QPSK	20000	50RB#0	8.9866	10.07	PASS
Band4	10MHz	16QAM	20000	27RB#0	5.0028	6.195	PASS
Band4	10MHz	QPSK	20350	50RB#0	8.9996	10.11	PASS
Band4	10MHz	16QAM	20350	27RB#0	5.0074	6.168	PASS
Band4	15MHz	QPSK	20025	75RB#0	13.476	15.21	PASS
Band4	15MHz	16QAM	20025	27RB#0	5.1872	6.610	PASS
Band4	15MHz	QPSK	20175	75RB#0	13.521	15.35	PASS
Band4	15MHz	16QAM	20175	27RB#0	5.2309	6.778	PASS
Band4	15MHz	QPSK	20325	75RB#0	13.502	15.35	PASS
Band4	15MHz	16QAM	20325	27RB#0	5.1713	6.855	PASS
Band4	20MHz	QPSK	20050	100RB#0	17.957	20.00	PASS
Band4	20MHz	16QAM	20050	27RB#0	5.3090	6.865	PASS
Band4	20MHz	QPSK	20175	100RB#0	17.995	20.04	PASS
Band4	20MHz	16QAM	20175	27RB#0	5.3713	7.054	PASS
Band4	20MHz	QPSK	20300	100RB#0	17.947	20.05	PASS
Band4	20MHz	16QAM	20300	27RB#0	5.4444	7.376	PASS

Test Graphs

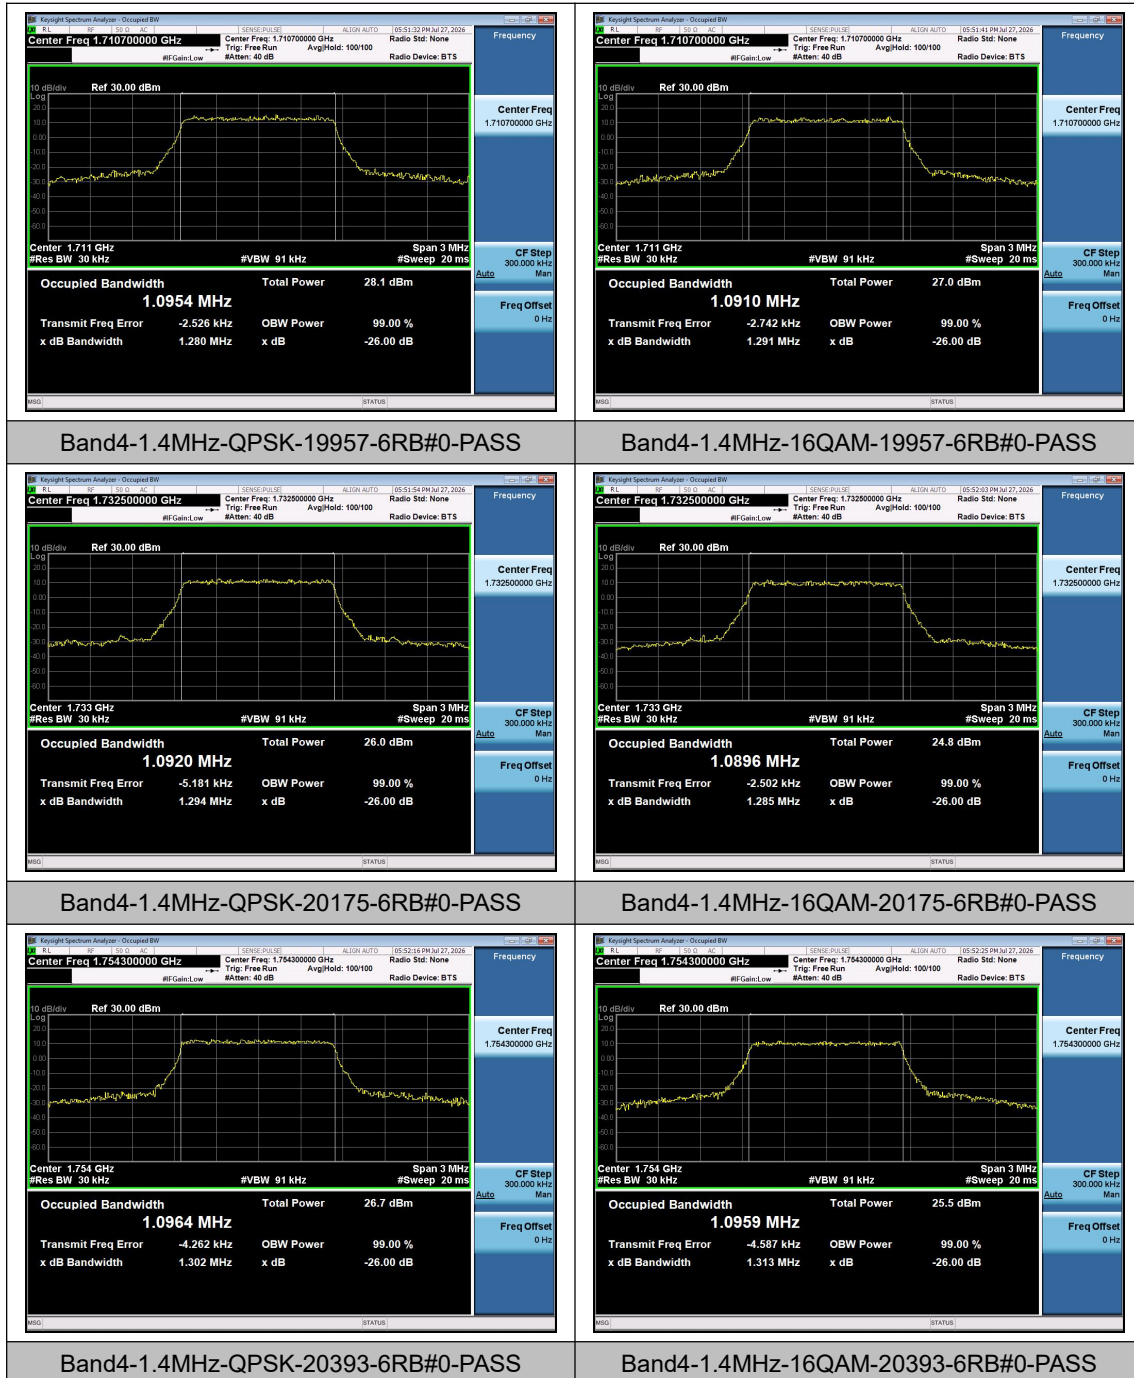

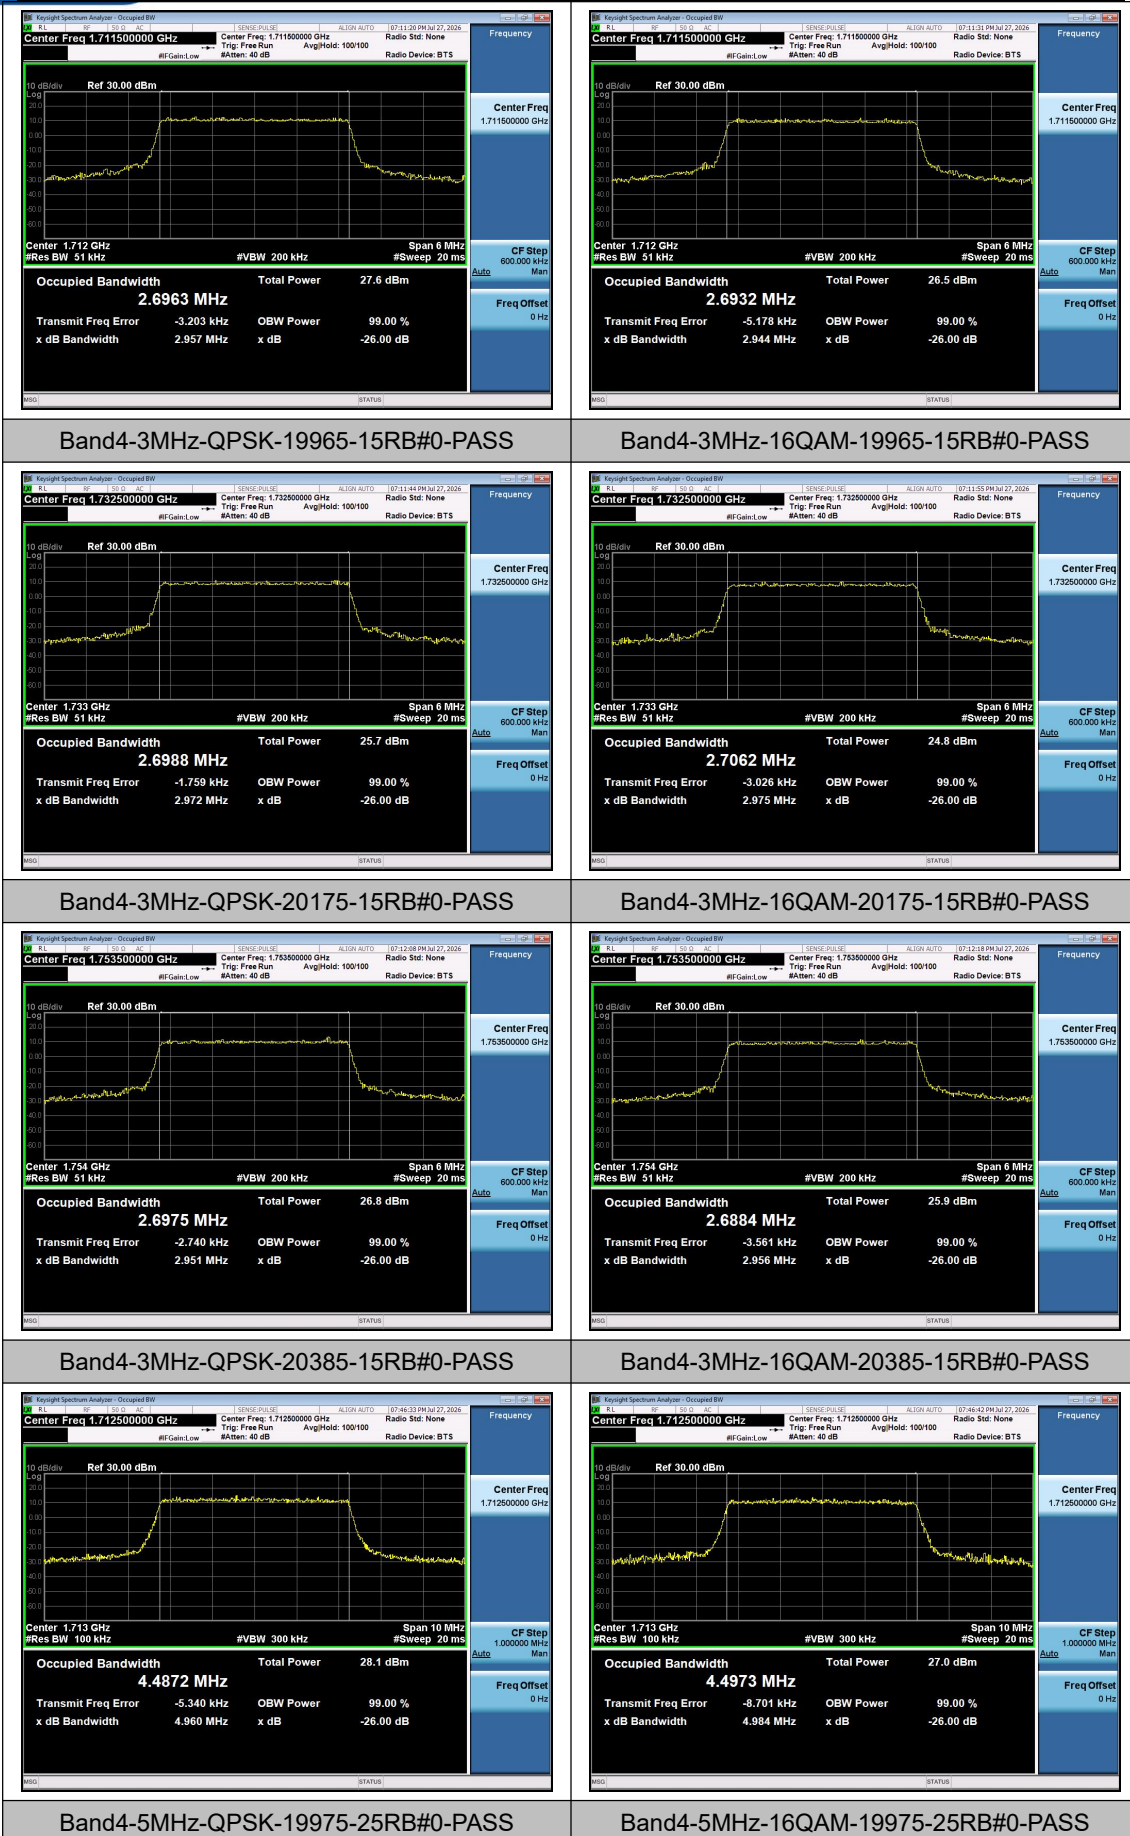

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

