



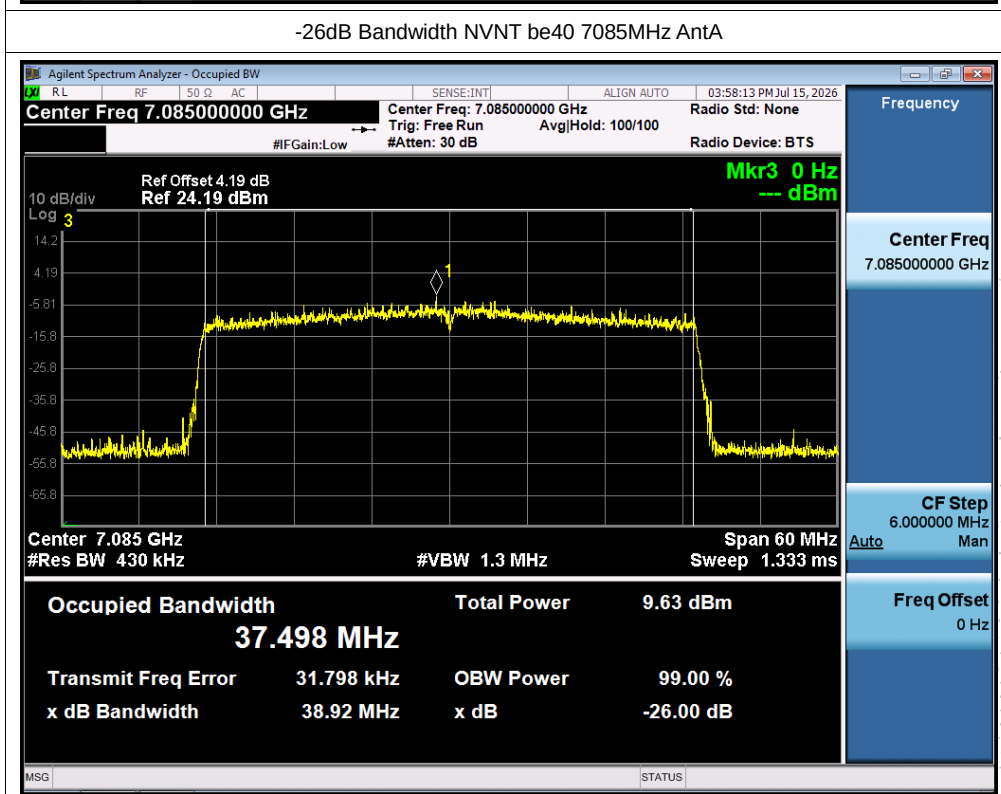
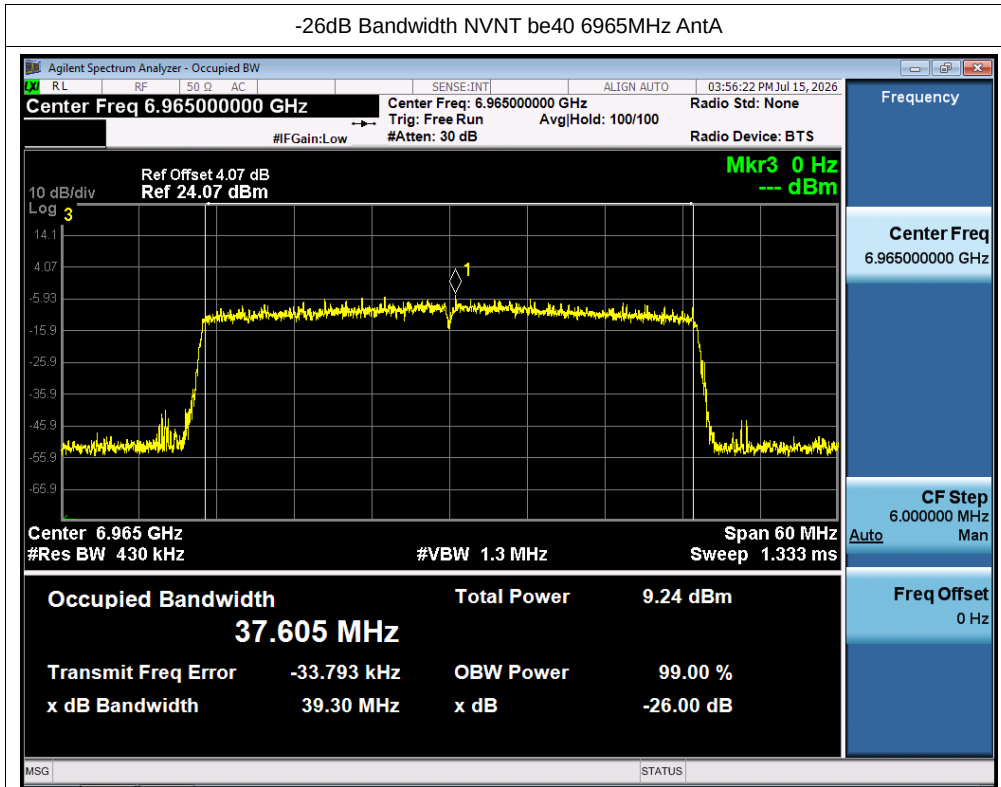


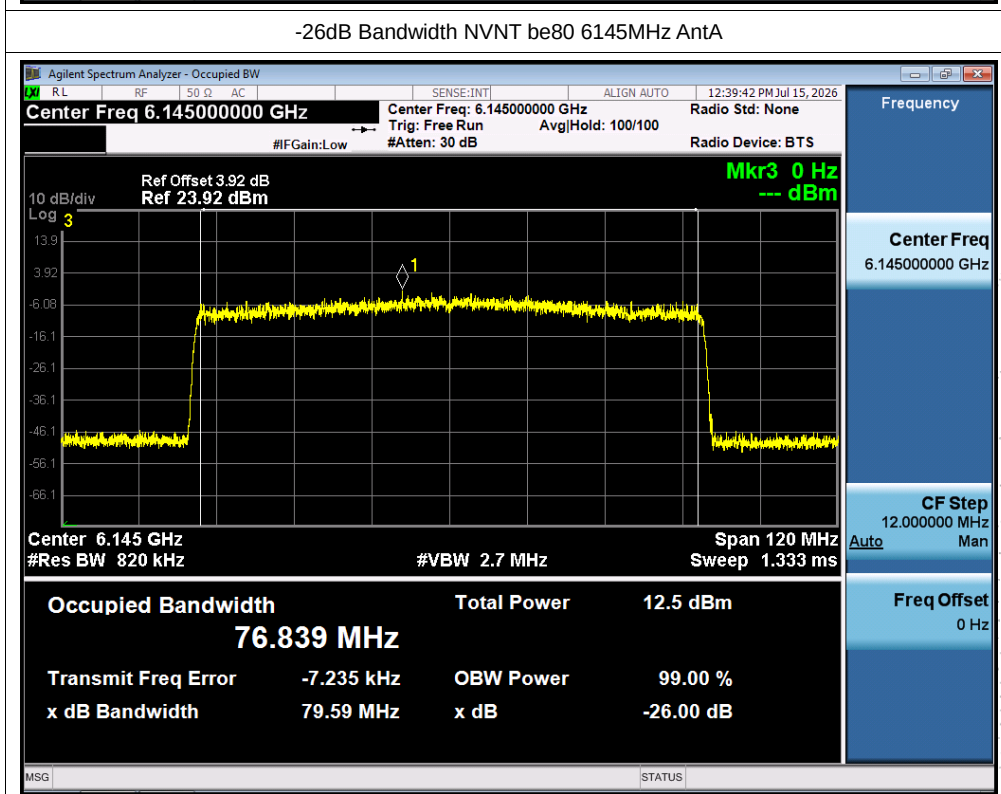


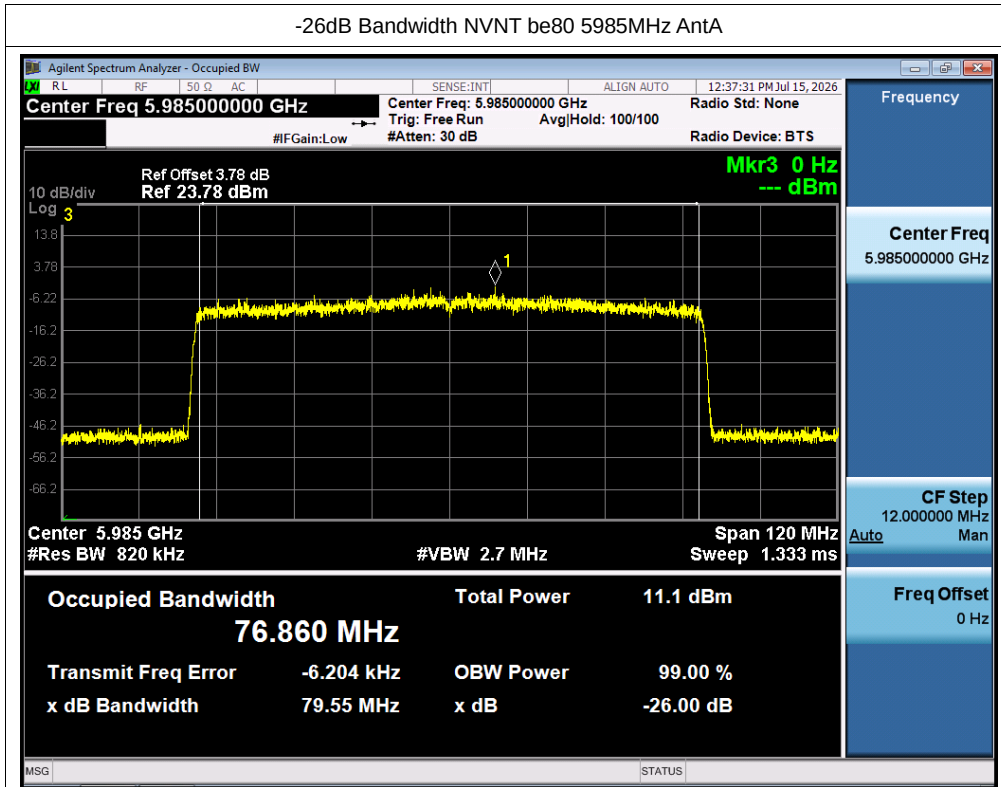

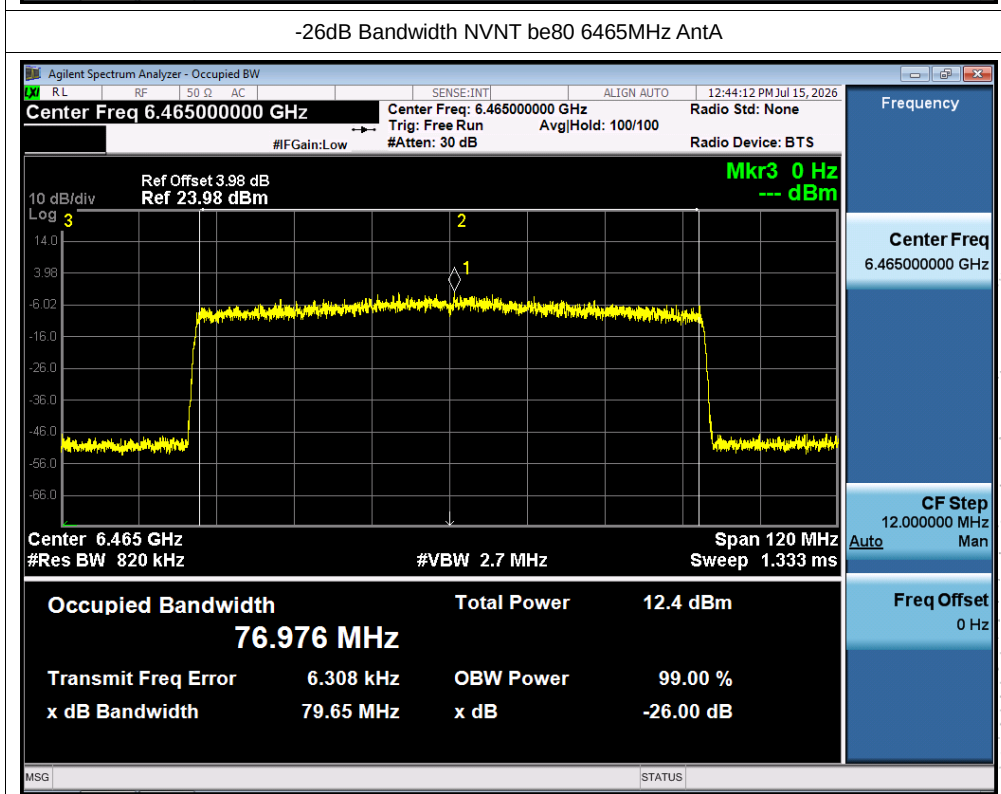



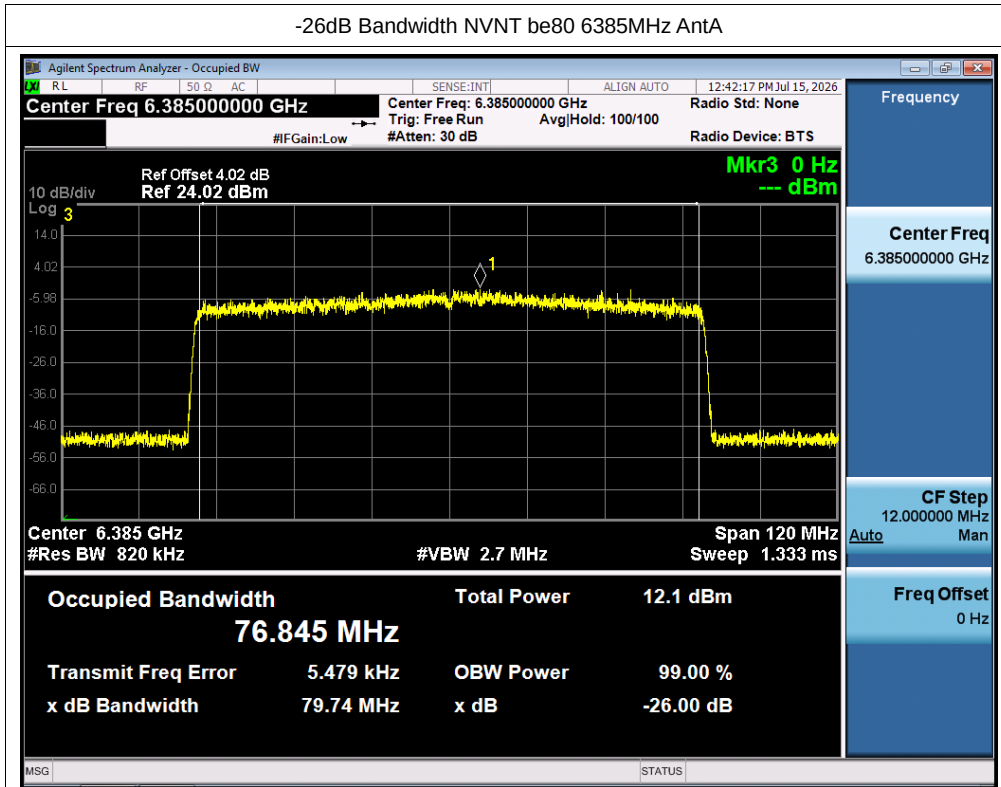




-26dB Bandwidth NVNT be80 6545MHz AntA


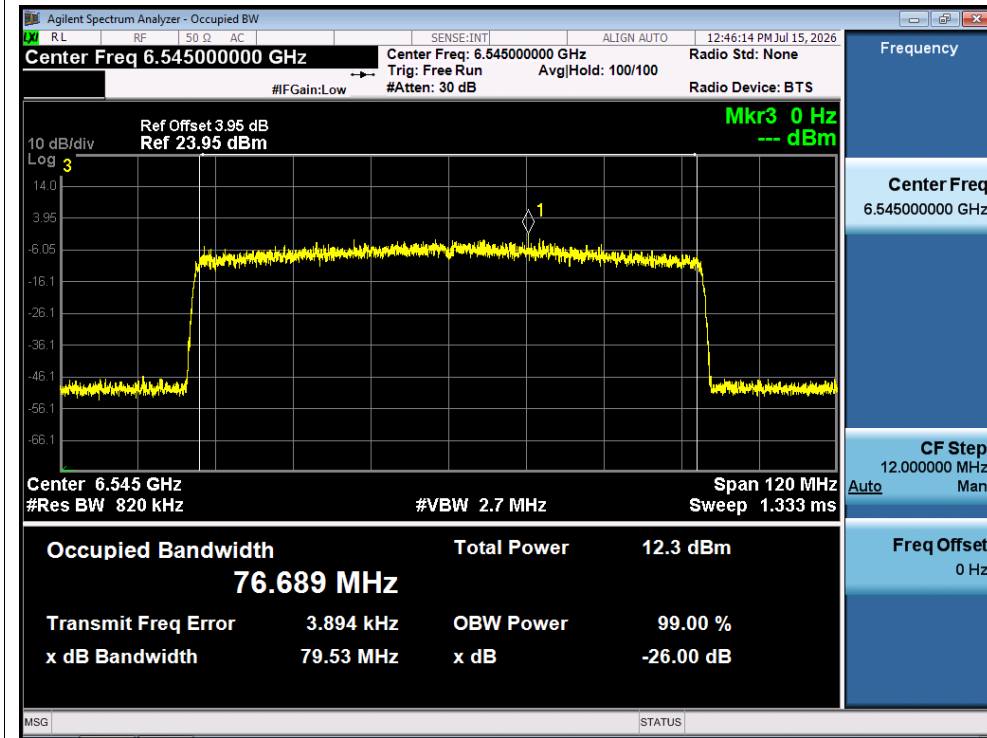


-26dB Bandwidth NVNT be80 6625MHz AntA

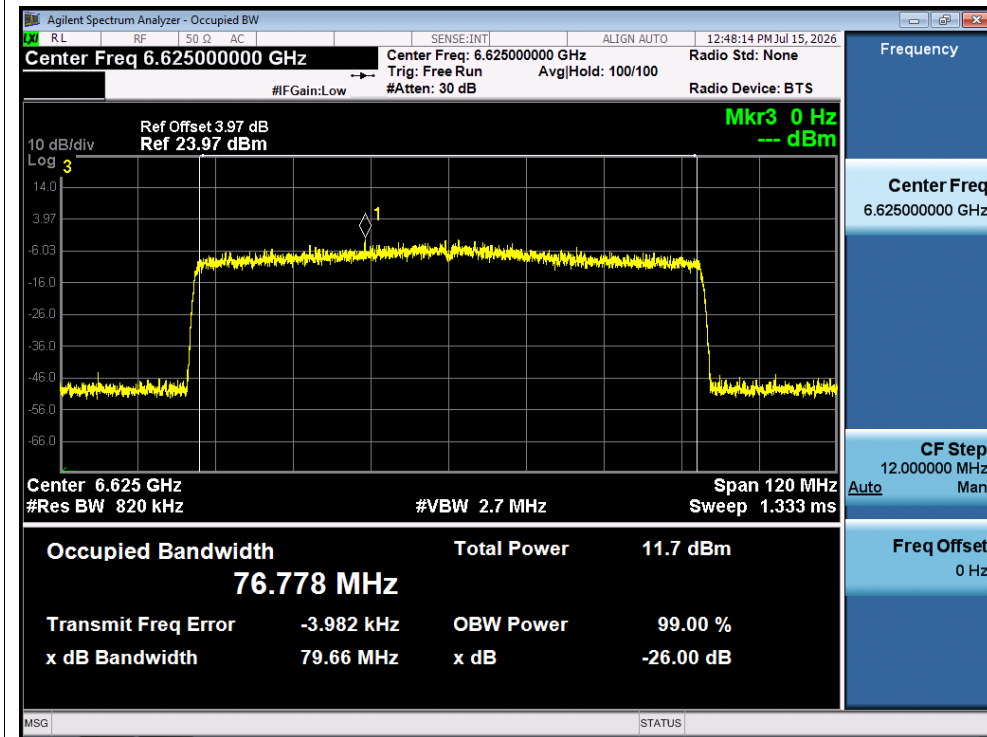

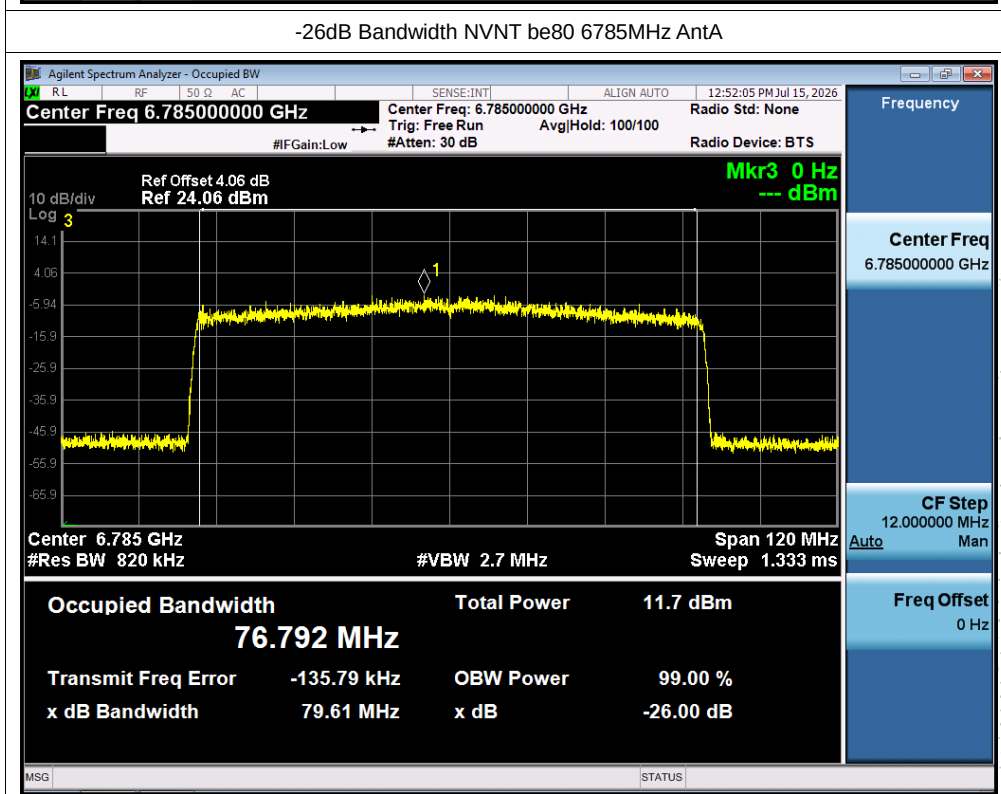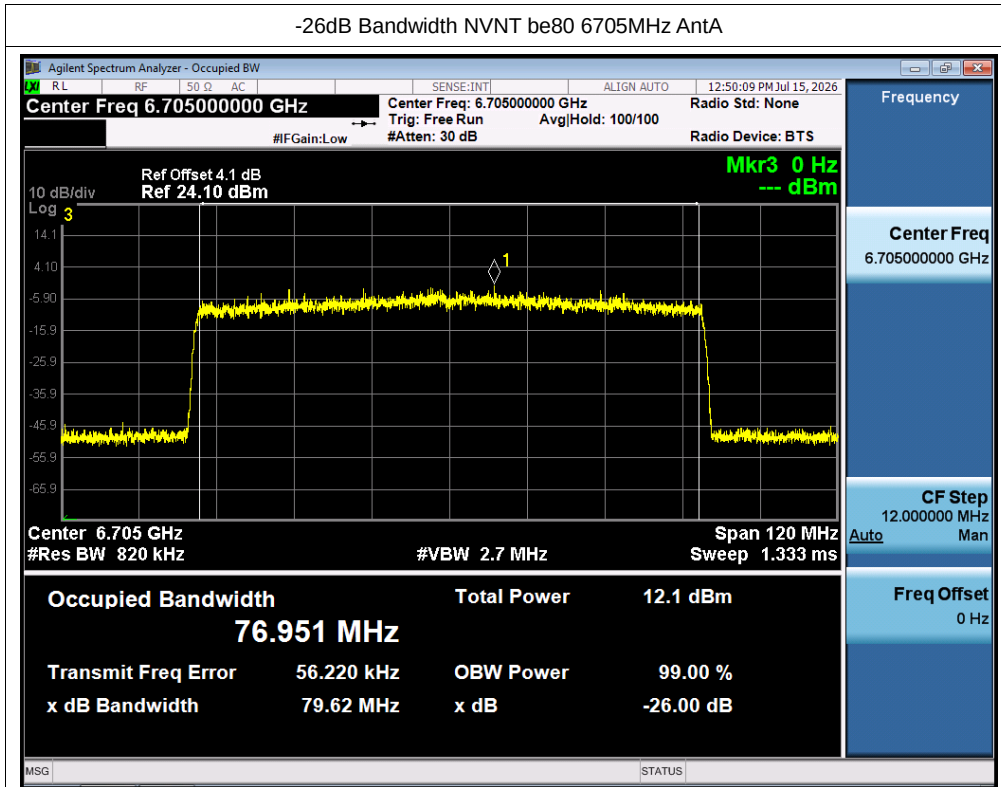


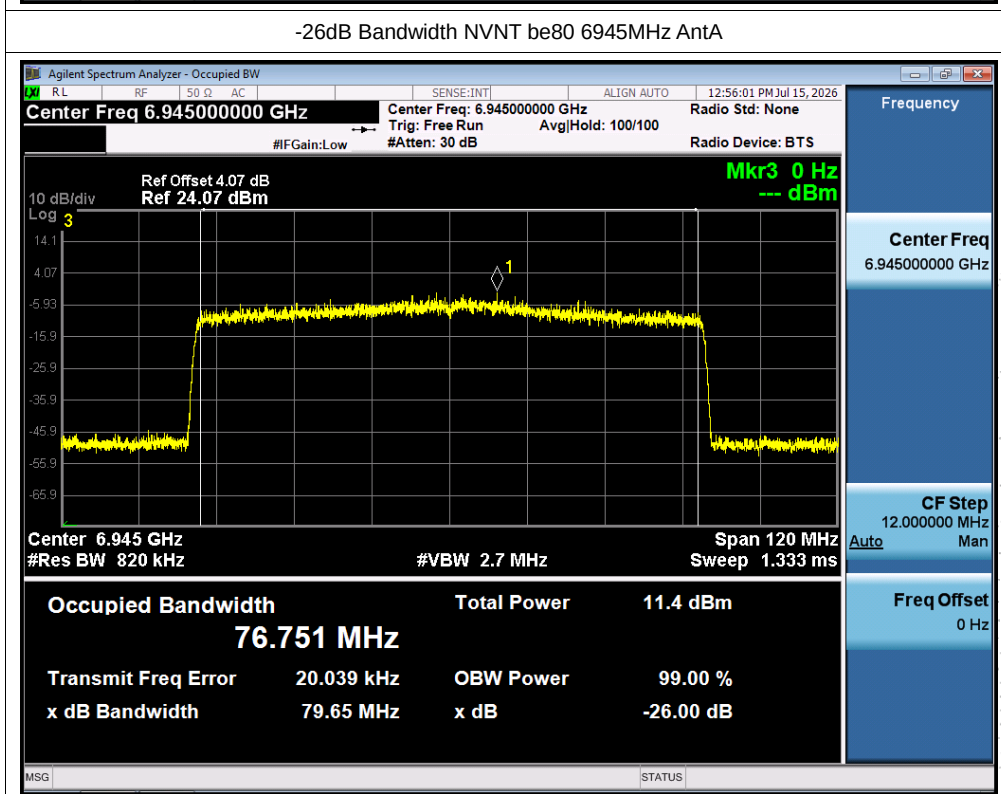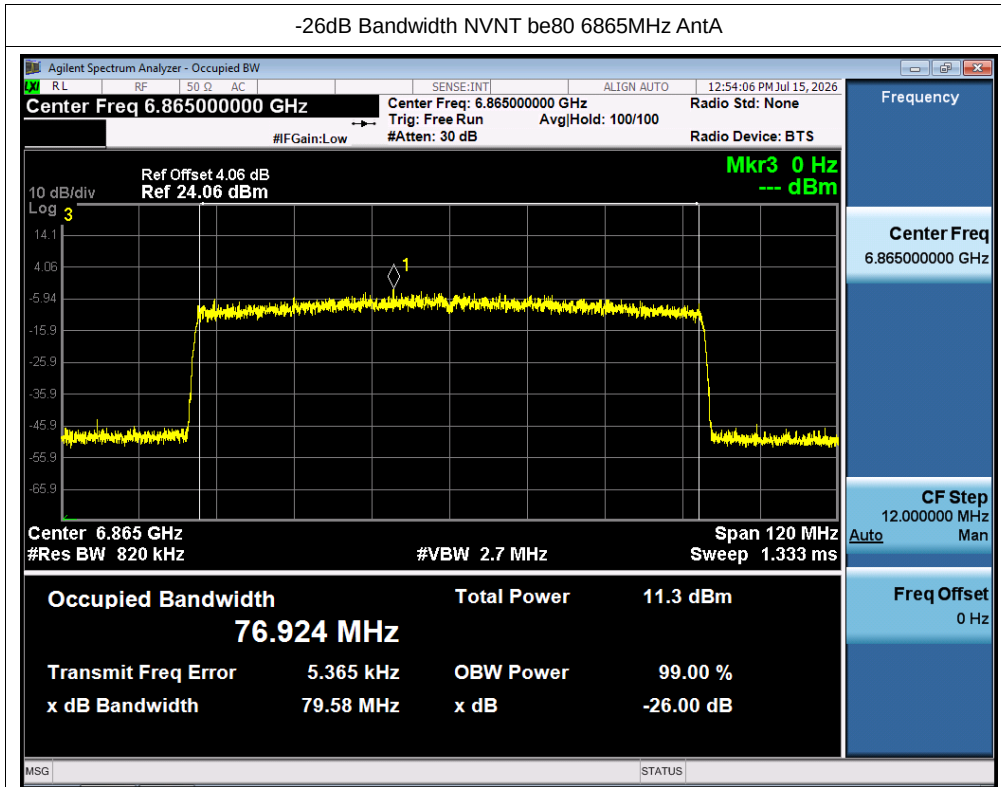

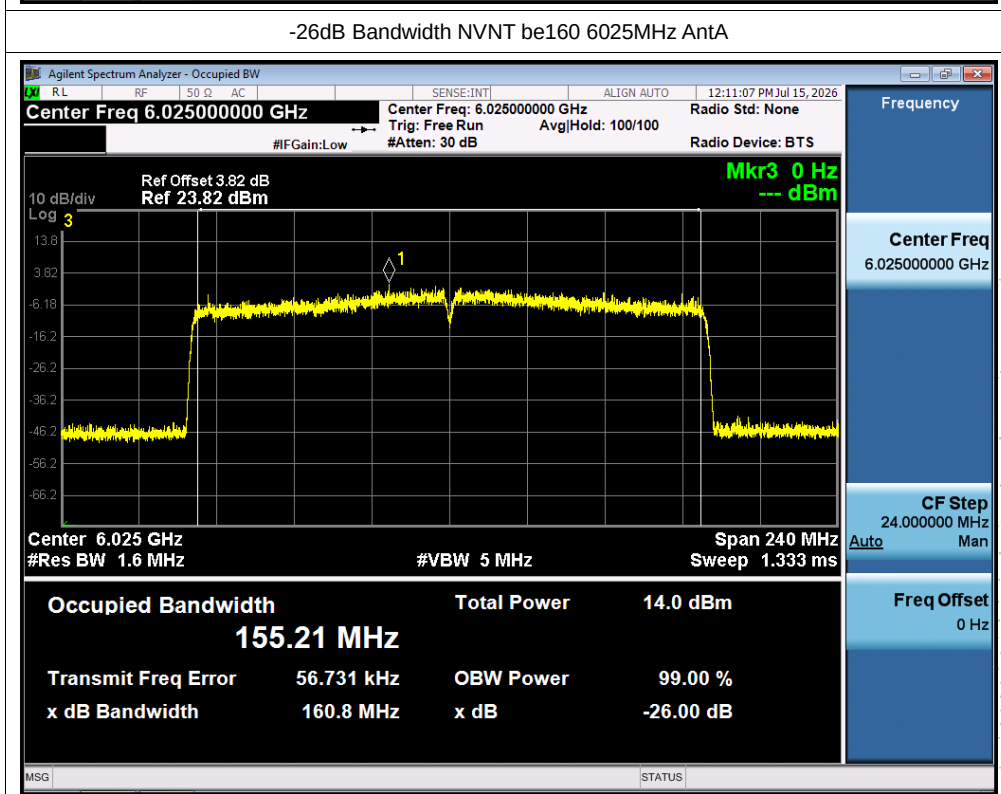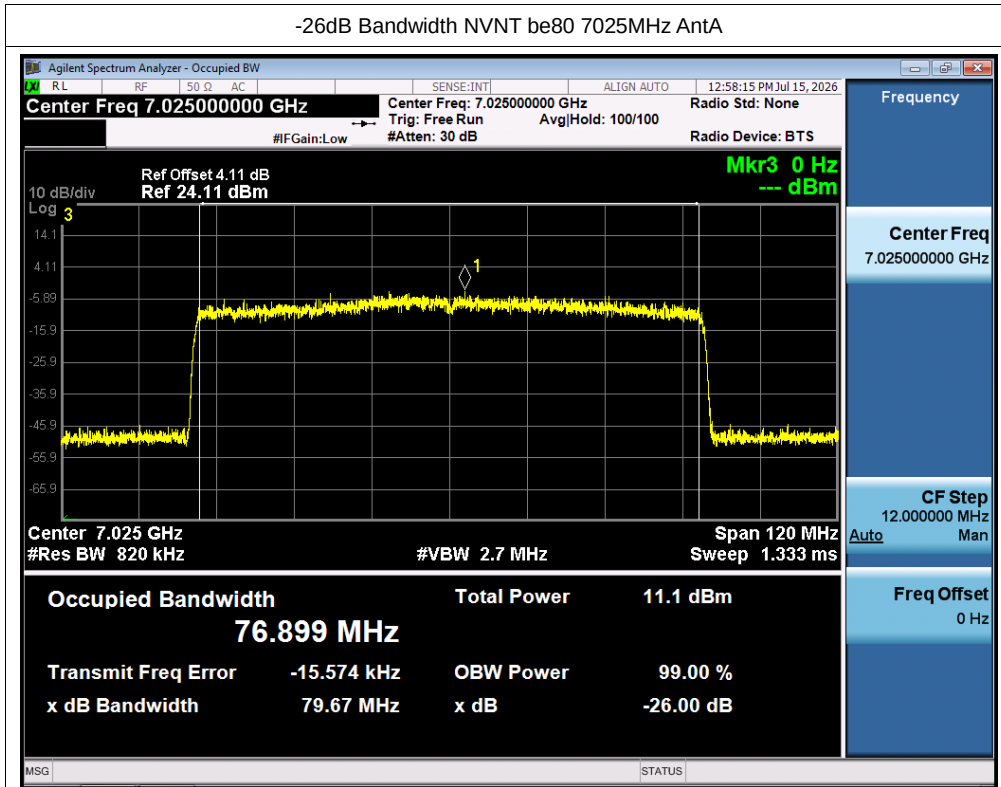




-26dB Bandwidth NVNT be160 6185MHz AntA

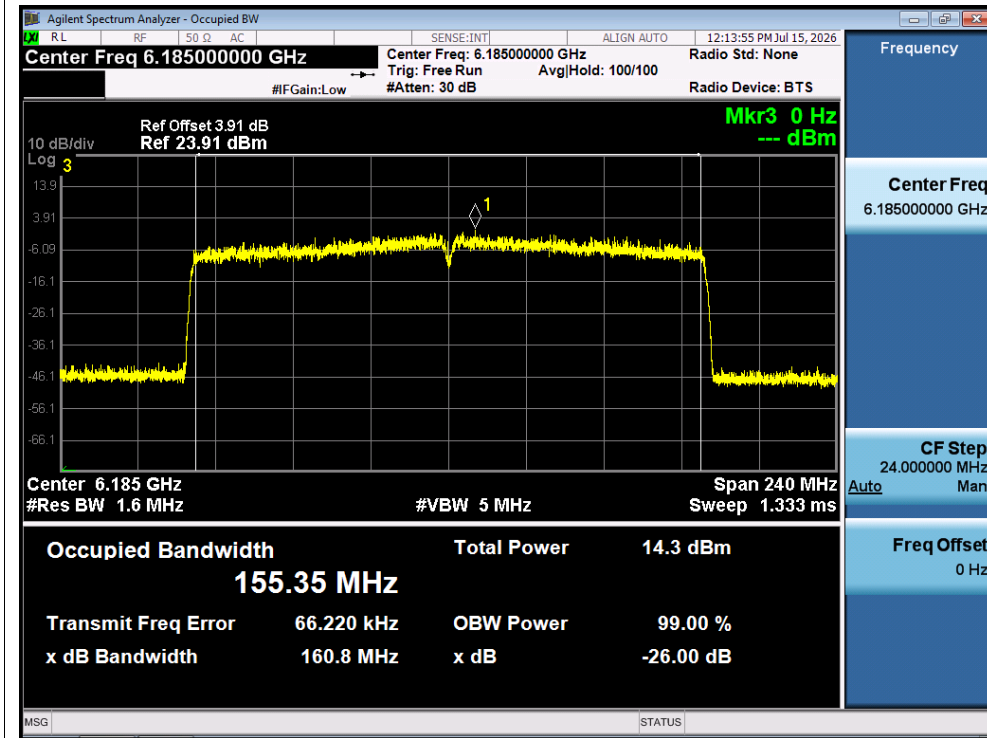


-26dB Bandwidth NVNT be160 6345MHz AntA

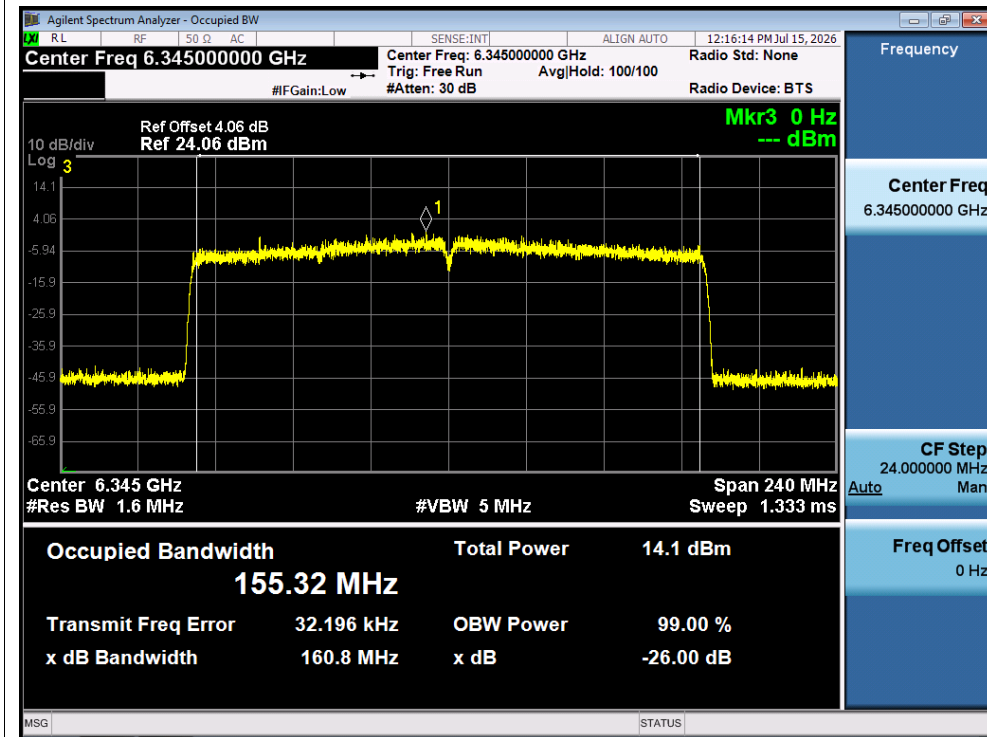




-26dB Bandwidth NVNT be160 6505MHz AntA

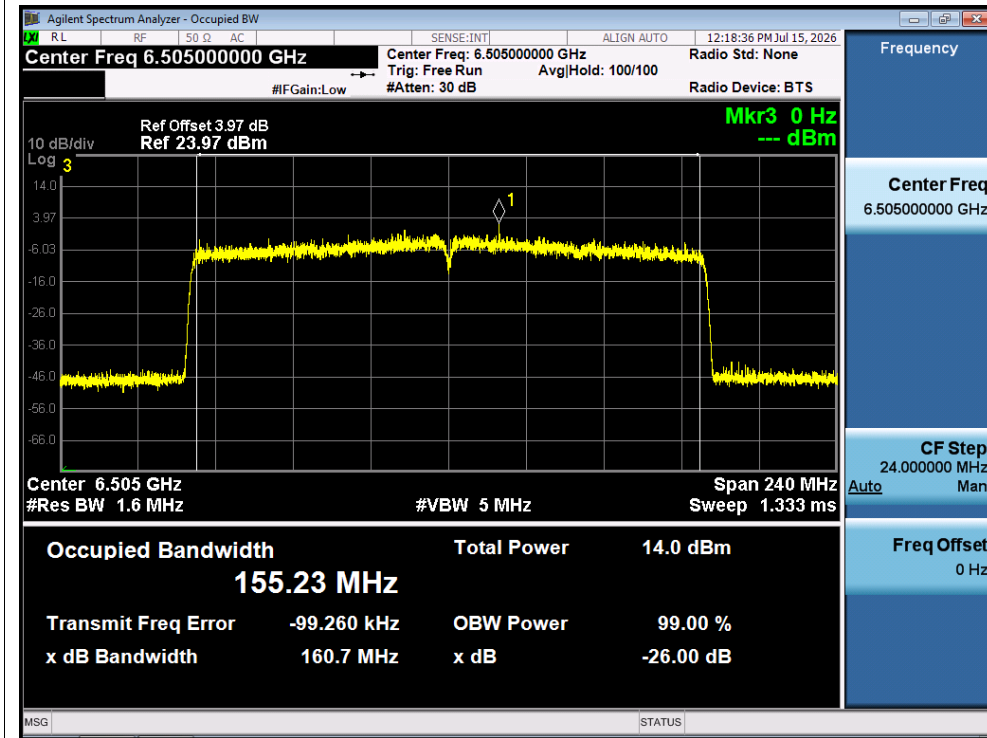


-26dB Bandwidth NVNT be160 6665MHz AntA

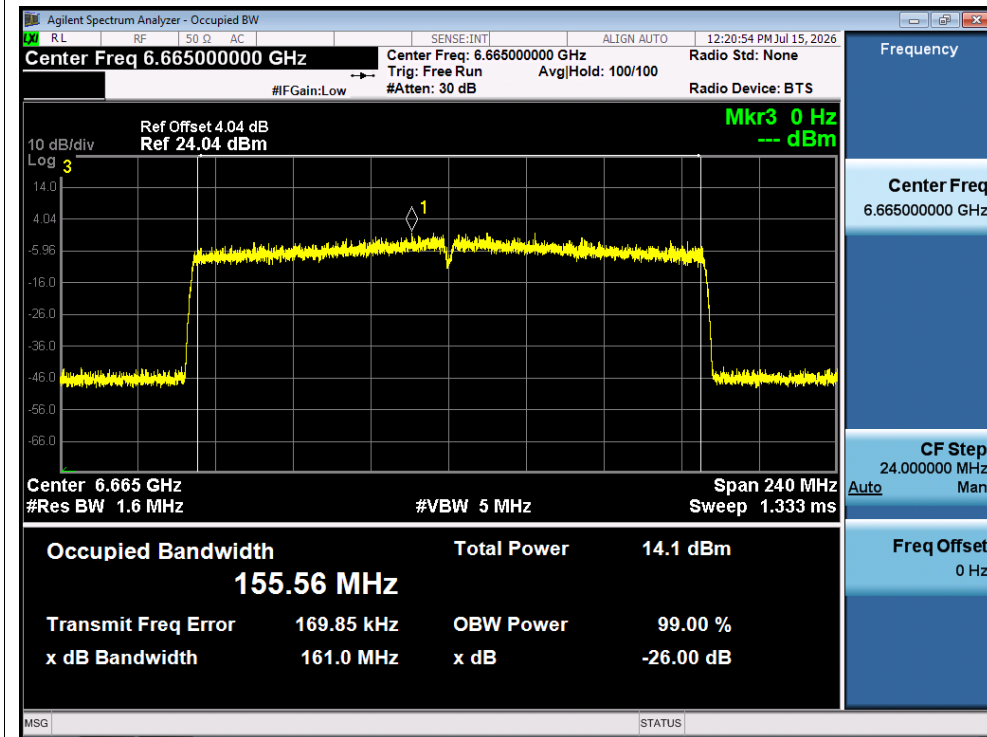




-26dB Bandwidth NVNT be160 6825MHz AntA

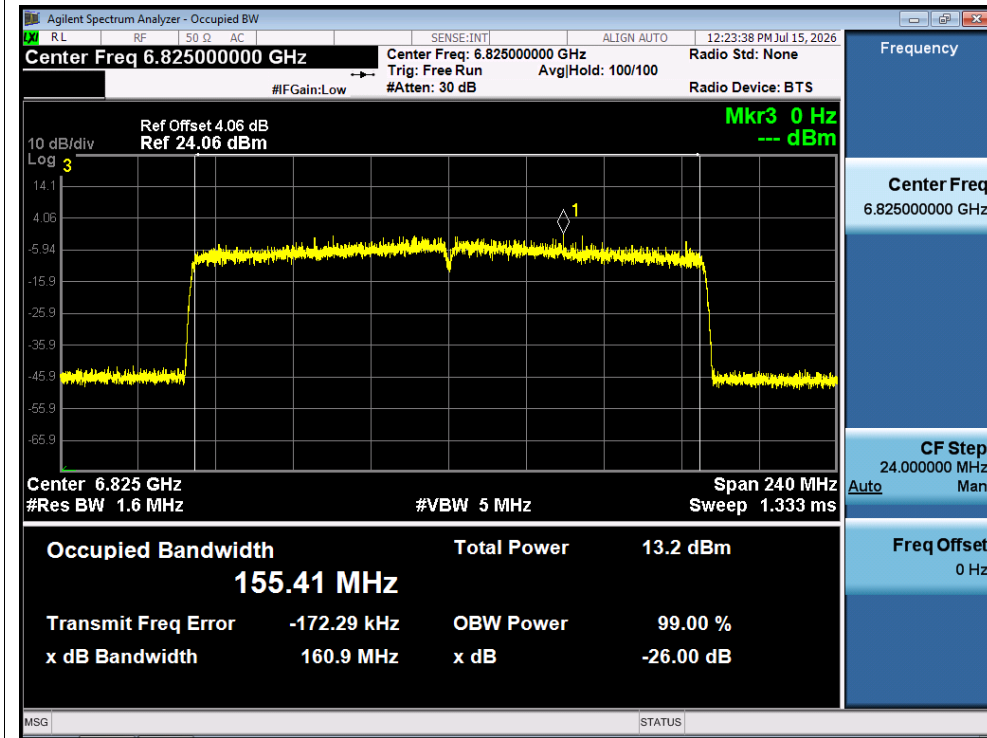

-26dB Bandwidth NVNT be160 6985MHz AntA

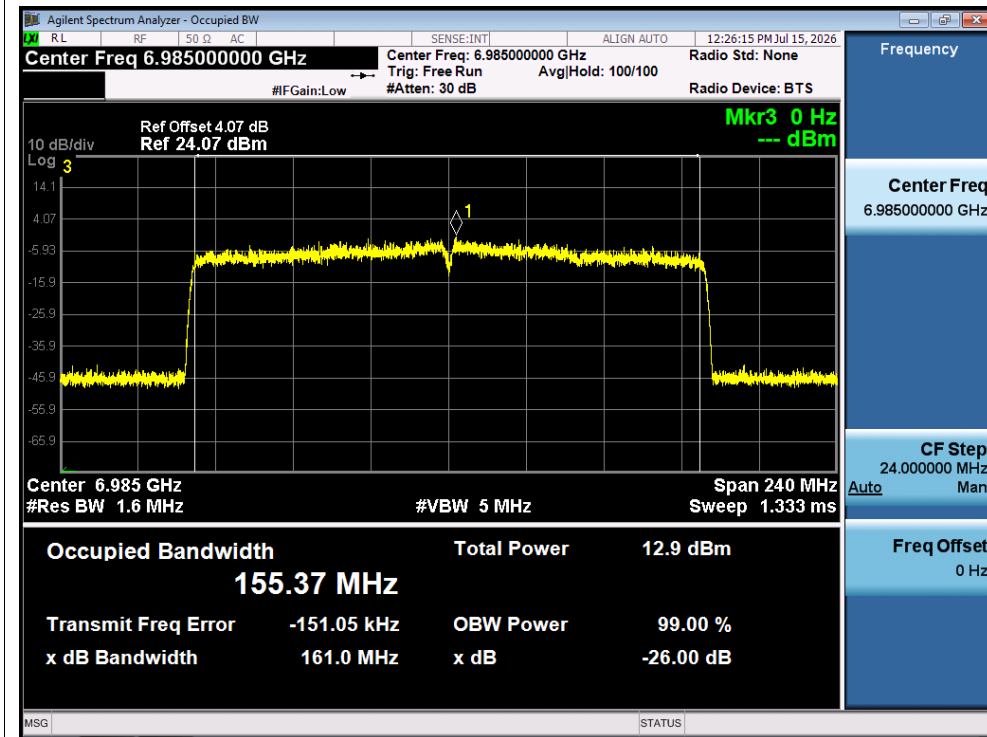

Appendix E. Maximum Power Spectral Density Level

Condition	Mode	Frequency (MHz)	Antenna	Conducted PSD (dBm)	Gain (dBi)	eirp PSD (dBm)	Limit (dBm)	Verdict
NVNT	ax20	5955	AntA	-10.12	1.28	-8.84	-1	Pass
NVNT	ax20	6175	AntA	-9.72	1.28	-8.44	-1	Pass
NVNT	ax20	6415	AntA	-9.49	1.28	-8.21	-1	Pass
NVNT	ax20	6435	AntA	-10.15	1.28	-8.87	-1	Pass
NVNT	ax20	6475	AntA	-9.77	1.28	-8.49	-1	Pass
NVNT	ax20	6515	AntA	-10.21	1.28	-8.93	-1	Pass
NVNT	ax20	6535	AntA	-10.08	1.28	-8.8	-1	Pass
NVNT	ax20	6695	AntA	-10.28	1.28	-9	-1	Pass
NVNT	ax20	6855	AntA	-9.61	1.28	-8.33	-1	Pass
NVNT	ax20	6875	AntA	-10.67	1.28	-9.39	-1	Pass
NVNT	ax20	6895	AntA	-11.09	1.28	-9.81	-1	Pass
NVNT	ax20	6995	AntA	-10.29	1.28	-9.01	-1	Pass
NVNT	ax20	7115	AntA	-10.05	1.28	-8.77	-1	Pass
NVNT	ax40	5965	AntA	-11.89	1.28	-10.61	-1	Pass
NVNT	ax40	6165	AntA	-11.1	1.28	-9.82	-1	Pass
NVNT	ax40	6405	AntA	-11.66	1.28	-10.38	-1	Pass
NVNT	ax40	6445	AntA	-10.91	1.28	-9.63	-1	Pass
NVNT	ax40	6485	AntA	-11.28	1.28	-10	-1	Pass
NVNT	ax40	6525	AntA	-11.24	1.28	-9.96	-1	Pass
NVNT	ax40	6565	AntA	-11.33	1.28	-10.05	-1	Pass
NVNT	ax40	6685	AntA	-11.85	1.28	-10.57	-1	Pass
NVNT	ax40	6845	AntA	-11.4	1.28	-10.12	-1	Pass
NVNT	ax40	6885	AntA	-12.23	1.28	-10.95	-1	Pass
NVNT	ax40	6925	AntA	-11.08	1.28	-9.8	-1	Pass
NVNT	ax40	6965	AntA	-13.3	1.28	-12.02	-1	Pass
NVNT	ax40	7085	AntA	-11.39	1.28	-10.11	-1	Pass
NVNT	ax80	5985	AntA	-13.89	1.28	-12.61	-1	Pass
NVNT	ax80	6145	AntA	-13.62	1.28	-12.34	-1	Pass
NVNT	ax80	6385	AntA	-13.41	1.28	-12.13	-1	Pass
NVNT	ax80	6465	AntA	-12.9	1.28	-11.62	-1	Pass
NVNT	ax80	6545	AntA	-12.48	1.28	-11.2	-1	Pass
NVNT	ax80	6625	AntA	-14.33	1.28	-13.05	-1	Pass
NVNT	ax80	6705	AntA	-13.7	1.28	-12.42	-1	Pass
NVNT	ax80	6785	AntA	-13.68	1.28	-12.4	-1	Pass
NVNT	ax80	6865	AntA	-13.52	1.28	-12.24	-1	Pass
NVNT	ax80	6945	AntA	-13.06	1.28	-11.78	-1	Pass
NVNT	ax80	7025	AntA	-14.21	1.28	-12.93	-1	Pass



NVNT	ax160	6025	AntA	-17.22	1.28	-15.94	-1	Pass
NVNT	ax160	6185	AntA	-16.95	1.28	-15.67	-1	Pass
NVNT	ax160	6345	AntA	-17.52	1.28	-16.24	-1	Pass
NVNT	ax160	6505	AntA	-16.96	1.28	-15.68	-1	Pass
NVNT	ax160	6665	AntA	-17.57	1.28	-16.29	-1	Pass
NVNT	ax160	6825	AntA	-17.35	1.28	-16.07	-1	Pass
NVNT	ax160	6985	AntA	-18.65	1.28	-17.37	-1	Pass
NVNT	be20	5955	AntA	-11.41	1.28	-10.13	-1	Pass
NVNT	be20	6175	AntA	-10.05	1.28	-8.77	-1	Pass
NVNT	be20	6415	AntA	-10.85	1.28	-9.57	-1	Pass
NVNT	be20	6435	AntA	-10.3	1.28	-9.02	-1	Pass
NVNT	be20	6475	AntA	-9.68	1.28	-8.4	-1	Pass
NVNT	be20	6515	AntA	-10.26	1.28	-8.98	-1	Pass
NVNT	be20	6535	AntA	-10.35	1.28	-9.07	-1	Pass
NVNT	be20	6695	AntA	-10.31	1.28	-9.03	-1	Pass
NVNT	be20	6855	AntA	-10.82	1.28	-9.54	-1	Pass
NVNT	be20	6875	AntA	-11.44	1.28	-10.16	-1	Pass
NVNT	be20	6895	AntA	-11.94	1.28	-10.66	-1	Pass
NVNT	be20	6995	AntA	-11.77	1.28	-10.49	-1	Pass
NVNT	be20	7115	AntA	-10.54	1.28	-9.26	-1	Pass
NVNT	be40	5965	AntA	-12.28	1.28	-11	-1	Pass
NVNT	be40	6165	AntA	-10.55	1.28	-9.27	-1	Pass
NVNT	be40	6405	AntA	-11.4	1.28	-10.12	-1	Pass
NVNT	be40	6445	AntA	-11.49	1.28	-10.21	-1	Pass
NVNT	be40	6485	AntA	-11.74	1.28	-10.46	-1	Pass
NVNT	be40	6525	AntA	-10.5	1.28	-9.22	-1	Pass
NVNT	be40	6565	AntA	-10.82	1.28	-9.54	-1	Pass
NVNT	be40	6685	AntA	-11.26	1.28	-9.98	-1	Pass
NVNT	be40	6845	AntA	-11.4	1.28	-10.12	-1	Pass
NVNT	be40	6885	AntA	-12.05	1.28	-10.77	-1	Pass
NVNT	be40	6925	AntA	-12.57	1.28	-11.29	-1	Pass
NVNT	be40	6965	AntA	-12.36	1.28	-11.08	-1	Pass
NVNT	be40	7085	AntA	-11.82	1.28	-10.54	-1	Pass
NVNT	be80	5985	AntA	-13.52	1.28	-12.24	-1	Pass
NVNT	be80	6145	AntA	-12.67	1.28	-11.39	-1	Pass
NVNT	be80	6385	AntA	-13.36	1.28	-12.08	-1	Pass
NVNT	be80	6465	AntA	-12.51	1.28	-11.23	-1	Pass
NVNT	be80	6545	AntA	-12.69	1.28	-11.41	-1	Pass
NVNT	be80	6625	AntA	-13.28	1.28	-12	-1	Pass
NVNT	be80	6705	AntA	-13.53	1.28	-12.25	-1	Pass
NVNT	be80	6785	AntA	-13.58	1.28	-12.3	-1	Pass
NVNT	be80	6865	AntA	-14	1.28	-12.72	-1	Pass

NVNT	be80	6945	AntA	-13.21	1.28	-11.93	-1	Pass
NVNT	be80	7025	AntA	-12.96	1.28	-11.68	-1	Pass
NVNT	be160	6025	AntA	-14.48	1.28	-13.2	-1	Pass
NVNT	be160	6185	AntA	-13.23	1.28	-11.95	-1	Pass
NVNT	be160	6345	AntA	-14.45	1.28	-13.17	-1	Pass
NVNT	be160	6505	AntA	-13.71	1.28	-12.43	-1	Pass
NVNT	be160	6665	AntA	-13.86	1.28	-12.58	-1	Pass
NVNT	be160	6825	AntA	-15.26	1.28	-13.98	-1	Pass
NVNT	be160	6985	AntA	-15.02	1.28	-13.74	-1	Pass


The test results have been incorporated into Factor.


Condition	Mode	Frequency (MHz)	eirp PSD (dBm) ANT A	eirp PSD (dBm) ANT B	Total eirp PSD (dBm)	Limit (dBm)	Verdict
NVNT	ax20	5955	-8.84	-9.34	-6.07	-1	Pass
NVNT	ax20	6175	-8.44	-8.85	-5.63	-1	Pass
NVNT	ax20	6415	-8.21	-9.11	-5.63	-1	Pass
NVNT	ax20	6435	-8.87	-8.4	-5.62	-1	Pass
NVNT	ax20	6475	-8.49	-9.19	-5.82	-1	Pass
NVNT	ax20	6515	-8.93	-7.99	-5.42	-1	Pass
NVNT	ax20	6535	-8.8	-8.22	-5.49	-1	Pass
NVNT	ax20	6695	-9	-7.82	-5.36	-1	Pass
NVNT	ax20	6855	-8.33	-7.9	-5.10	-1	Pass
NVNT	ax20	6875	-9.39	-8.46	-5.89	-1	Pass
NVNT	ax20	6895	-9.81	-8.66	-6.19	-1	Pass
NVNT	ax20	6995	-9.01	-7.75	-5.32	-1	Pass
NVNT	ax20	7115	-8.77	-8.77	-5.76	-1	Pass
NVNT	ax40	5965	-10.61	-11.2	-7.88	-1	Pass
NVNT	ax40	6165	-9.82	-9.03	-6.40	-1	Pass
NVNT	ax40	6405	-10.38	-9.22	-6.75	-1	Pass
NVNT	ax40	6445	-9.63	-9.22	-6.41	-1	Pass
NVNT	ax40	6485	-10	-10.27	-7.12	-1	Pass
NVNT	ax40	6525	-9.96	-8.55	-6.19	-1	Pass
NVNT	ax40	6565	-10.05	-9.74	-6.88	-1	Pass
NVNT	ax40	6685	-10.57	-7.94	-6.05	-1	Pass
NVNT	ax40	6845	-10.12	-9.58	-6.83	-1	Pass
NVNT	ax40	6885	-10.95	-8.95	-6.83	-1	Pass
NVNT	ax40	6925	-9.8	-8.38	-6.02	-1	Pass
NVNT	ax40	6965	-12.02	-9.71	-7.70	-1	Pass
NVNT	ax40	7085	-10.11	-11.29	-7.65	-1	Pass
NVNT	ax80	5985	-12.61	-9.73	-7.93	-1	Pass
NVNT	ax80	6145	-12.34	-10.38	-8.24	-1	Pass







NVNT	ax80	6385	-12.13	-10.97	-8.50	-1	Pass
NVNT	ax80	6465	-11.62	-10.77	-8.16	-1	Pass
NVNT	ax80	6545	-11.2	-10.73	-7.95	-1	Pass
NVNT	ax80	6625	-13.05	-10.35	-8.48	-1	Pass
NVNT	ax80	6705	-12.42	-11.44	-8.89	-1	Pass
NVNT	ax80	6785	-12.4	-12.3	-9.34	-1	Pass
NVNT	ax80	6865	-12.24	-11.56	-8.88	-1	Pass
NVNT	ax80	6945	-11.78	-10.91	-8.31	-1	Pass
NVNT	ax80	7025	-12.93	-12.1	-9.48	-1	Pass
NVNT	ax160	6025	-15.94	-12.85	-11.12	-1	Pass
NVNT	ax160	6185	-15.67	-13.36	-11.35	-1	Pass
NVNT	ax160	6345	-16.24	-11.78	-10.45	-1	Pass
NVNT	ax160	6505	-15.68	-13.45	-11.41	-1	Pass
NVNT	ax160	6665	-16.29	-13.18	-11.45	-1	Pass
NVNT	ax160	6825	-16.07	-12.73	-11.08	-1	Pass
NVNT	ax160	6985	-17.37	-10.5	-9.69	-1	Pass
NVNT	be20	5955	-10.13	-8.63	-6.31	-1	Pass
NVNT	be20	6175	-8.77	-9.14	-5.94	-1	Pass
NVNT	be20	6415	-9.57	-8.22	-5.83	-1	Pass
NVNT	be20	6435	-9.02	-8.95	-5.97	-1	Pass
NVNT	be20	6475	-8.4	-9.12	-5.73	-1	Pass
NVNT	be20	6515	-8.98	-8.3	-5.62	-1	Pass
NVNT	be20	6535	-9.07	-8.93	-5.99	-1	Pass
NVNT	be20	6695	-9.03	-9.92	-6.44	-1	Pass
NVNT	be20	6855	-9.54	-9.53	-6.52	-1	Pass
NVNT	be20	6875	-10.16	-10.15	-7.14	-1	Pass
NVNT	be20	6895	-10.66	-10.48	-7.56	-1	Pass
NVNT	be20	6995	-10.49	-10.03	-7.24	-1	Pass
NVNT	be20	7115	-9.26	-10.26	-6.72	-1	Pass
NVNT	be40	5965	-11	-8.93	-6.83	-1	Pass
NVNT	be40	6165	-9.27	-8.99	-6.12	-1	Pass
NVNT	be40	6405	-10.12	-8.74	-6.37	-1	Pass
NVNT	be40	6445	-10.21	-8.95	-6.52	-1	Pass
NVNT	be40	6485	-10.46	-8.69	-6.48	-1	Pass
NVNT	be40	6525	-9.22	-8.48	-5.82	-1	Pass
NVNT	be40	6565	-9.54	-8.87	-6.18	-1	Pass
NVNT	be40	6685	-9.98	-9.17	-6.55	-1	Pass
NVNT	be40	6845	-10.12	-9.11	-6.58	-1	Pass
NVNT	be40	6885	-10.77	-9.49	-7.07	-1	Pass
NVNT	be40	6925	-11.29	-9.63	-7.37	-1	Pass
NVNT	be40	6965	-11.08	-9.51	-7.21	-1	Pass
NVNT	be40	7085	-10.54	-9.99	-7.25	-1	Pass



NVNT	be80	5985	-12.24	-9.22	-7.46	-1	Pass
NVNT	be80	6145	-11.39	-10.09	-7.68	-1	Pass
NVNT	be80	6385	-12.08	-11	-8.50	-1	Pass
NVNT	be80	6465	-11.23	-10.24	-7.70	-1	Pass
NVNT	be80	6545	-11.41	-11.91	-8.64	-1	Pass
NVNT	be80	6625	-12	-10.15	-7.97	-1	Pass
NVNT	be80	6705	-12.25	-13.19	-9.68	-1	Pass
NVNT	be80	6785	-12.3	-12.48	-9.38	-1	Pass
NVNT	be80	6865	-12.72	-12.72	-9.71	-1	Pass
NVNT	be80	6945	-11.93	-11.63	-8.77	-1	Pass
NVNT	be80	7025	-11.68	-12.87	-9.22	-1	Pass
NVNT	be160	6025	-13.2	-11.41	-9.20	-1	Pass
NVNT	be160	6185	-11.95	-13.24	-9.54	-1	Pass
NVNT	be160	6345	-13.17	-11.43	-9.20	-1	Pass
NVNT	be160	6505	-12.43	-11.97	-9.18	-1	Pass
NVNT	be160	6665	-12.58	-13.01	-9.78	-1	Pass
NVNT	be160	6825	-13.98	-13.08	-10.50	-1	Pass
NVNT	be160	6985	-13.74	-13.06	-10.38	-1	Pass


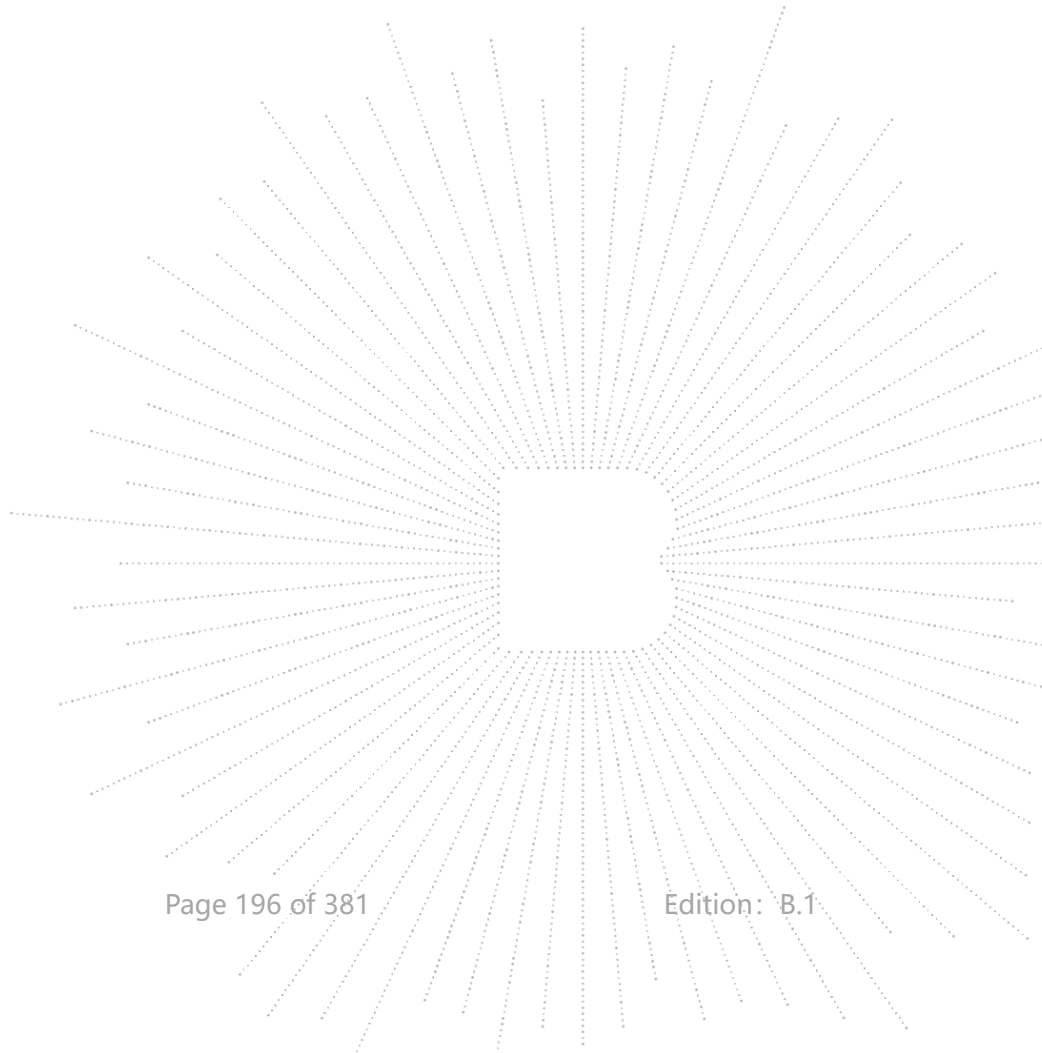



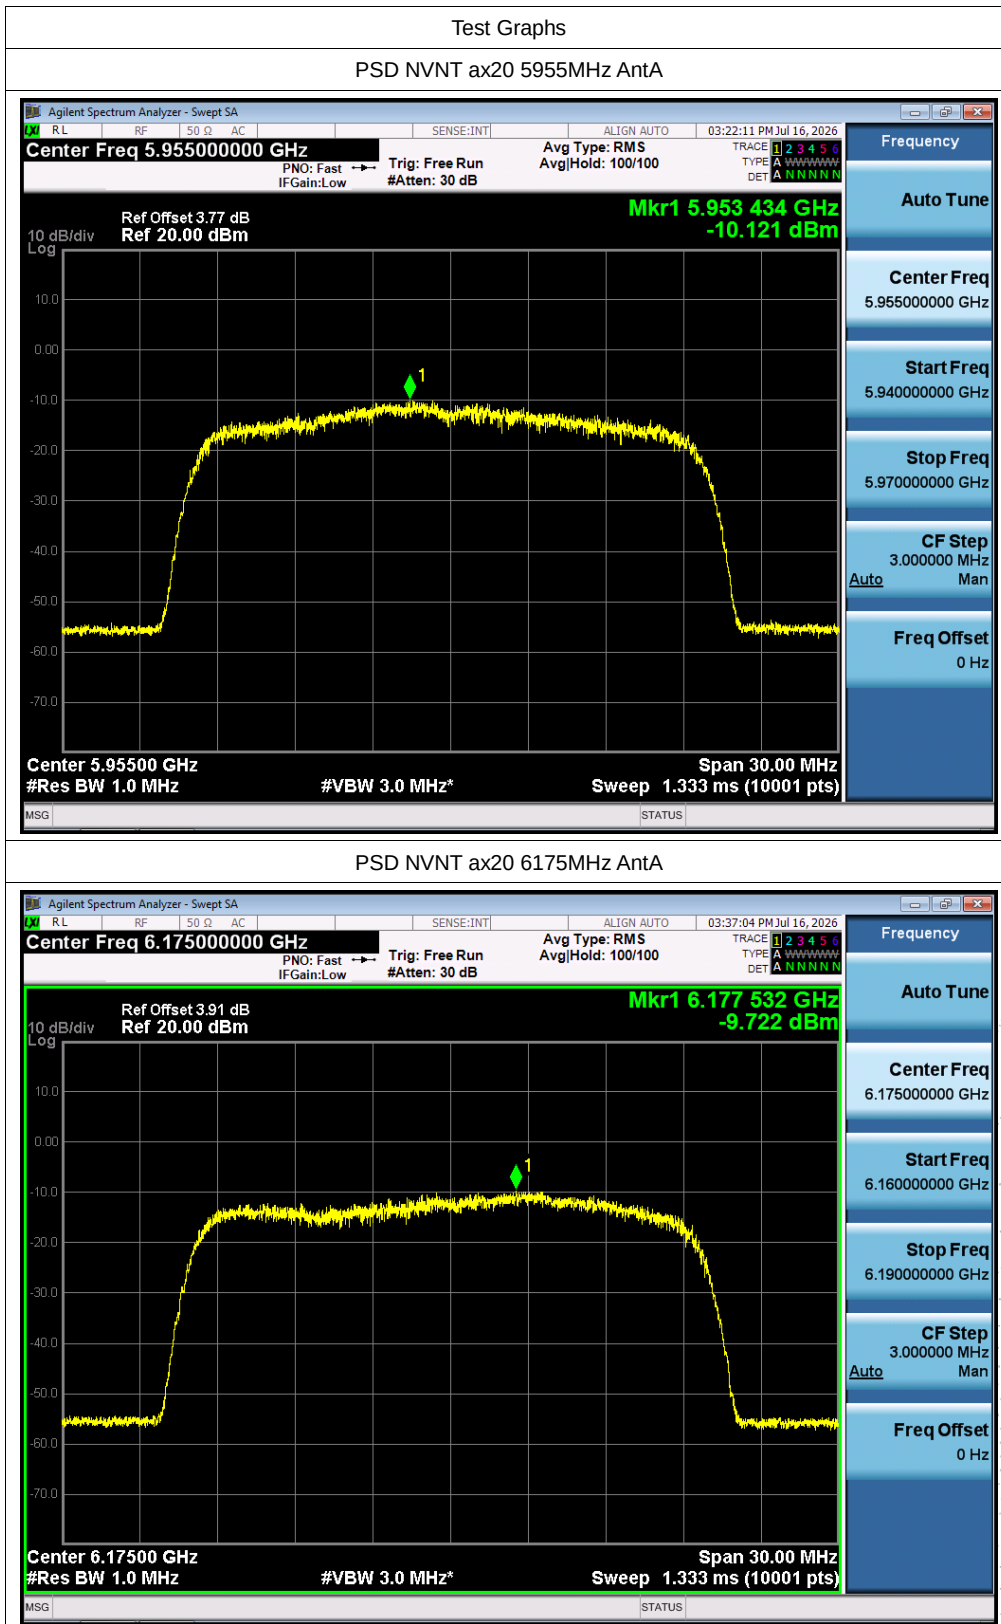


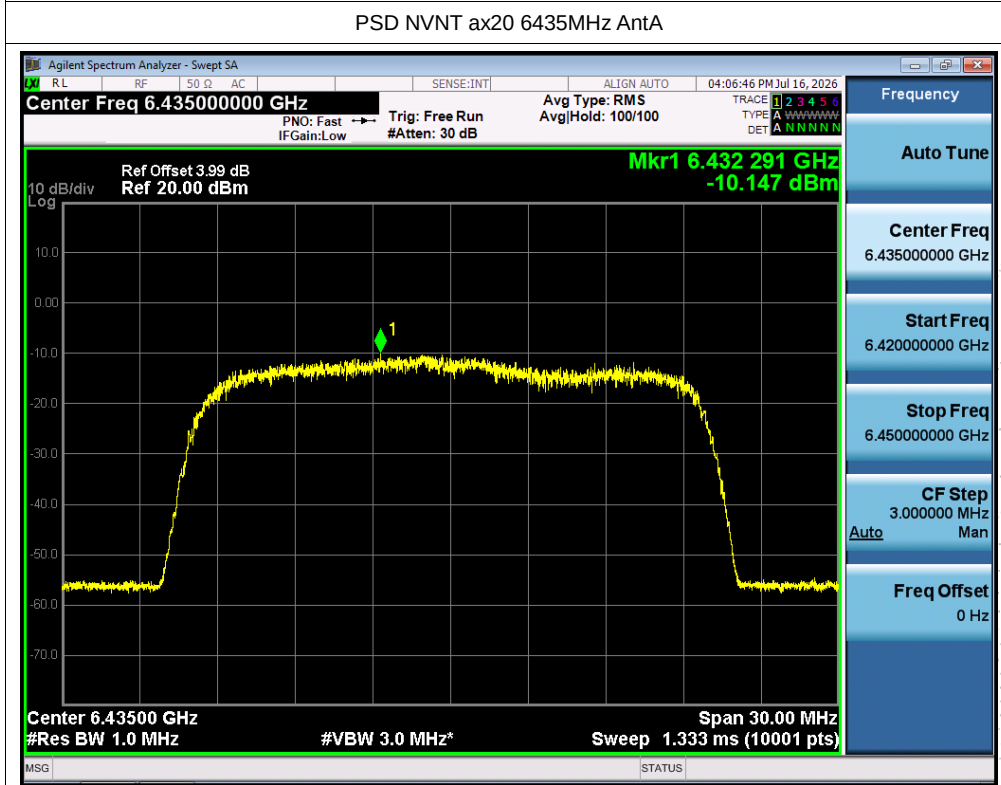
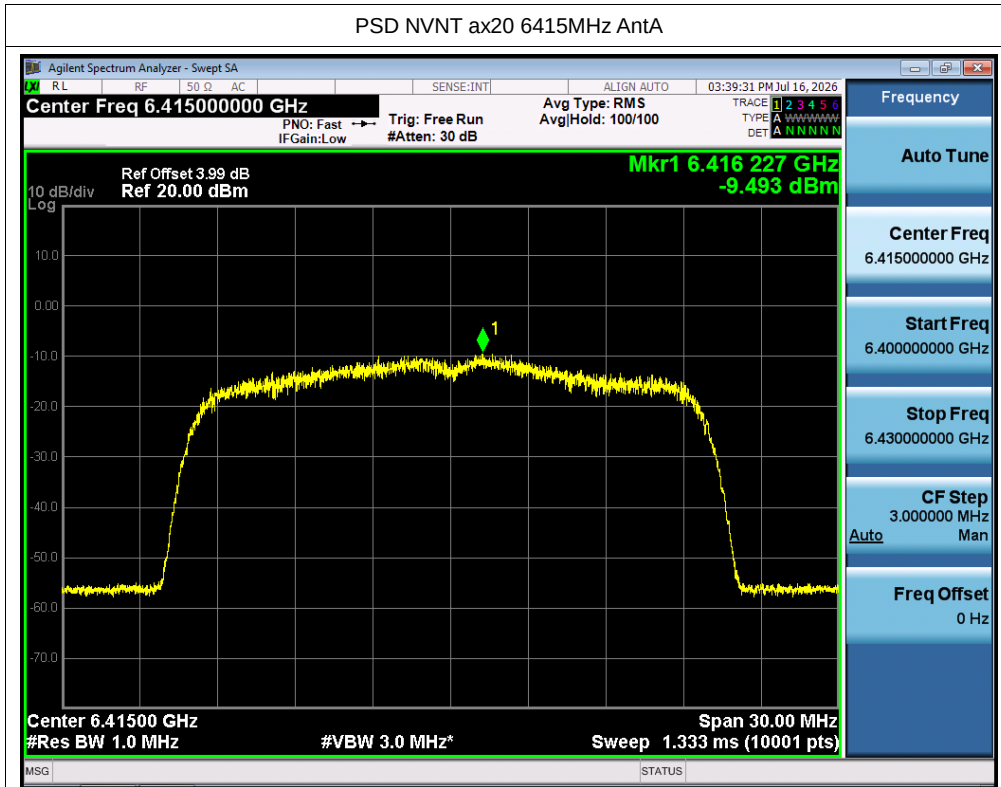


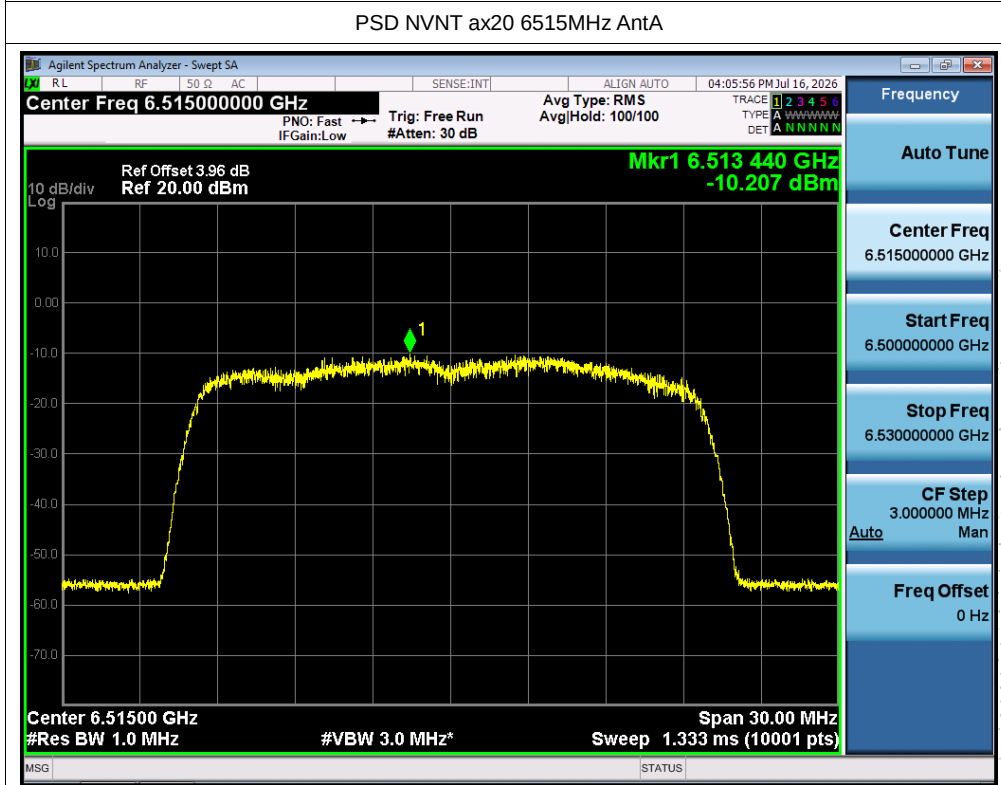
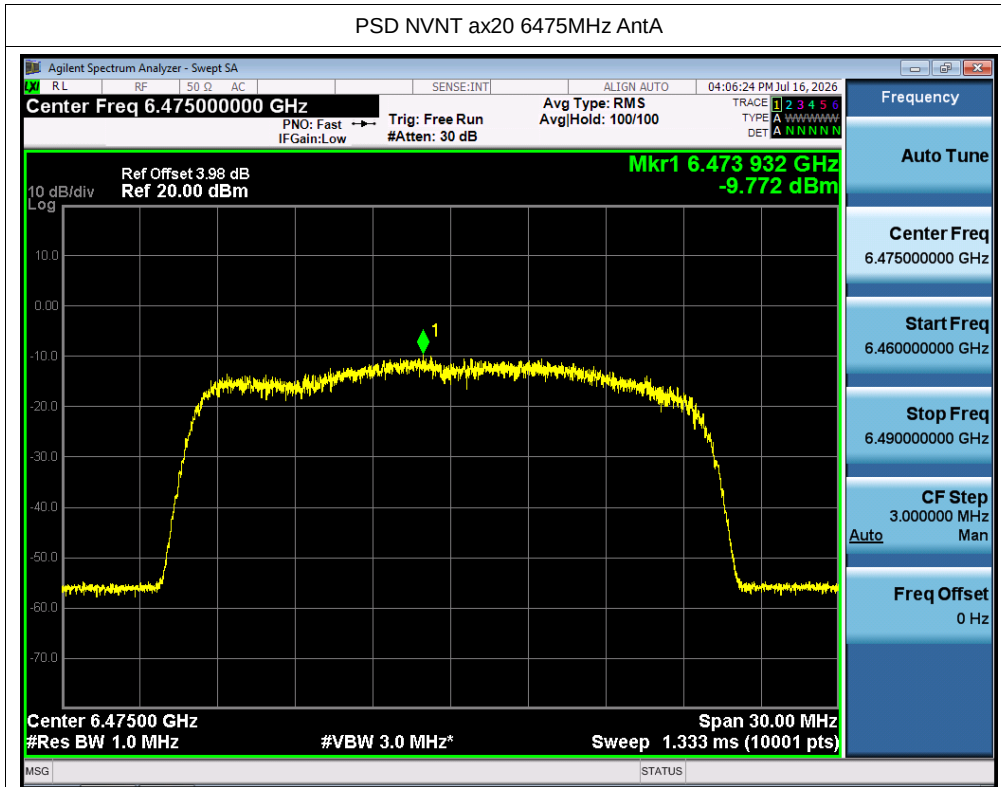


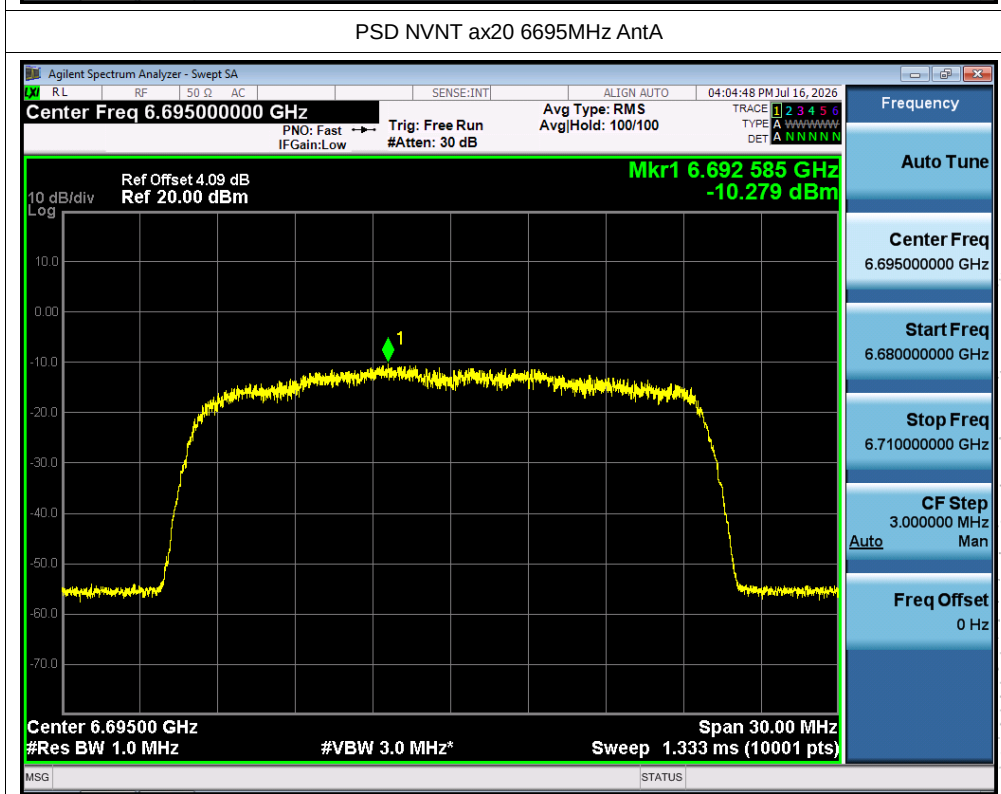
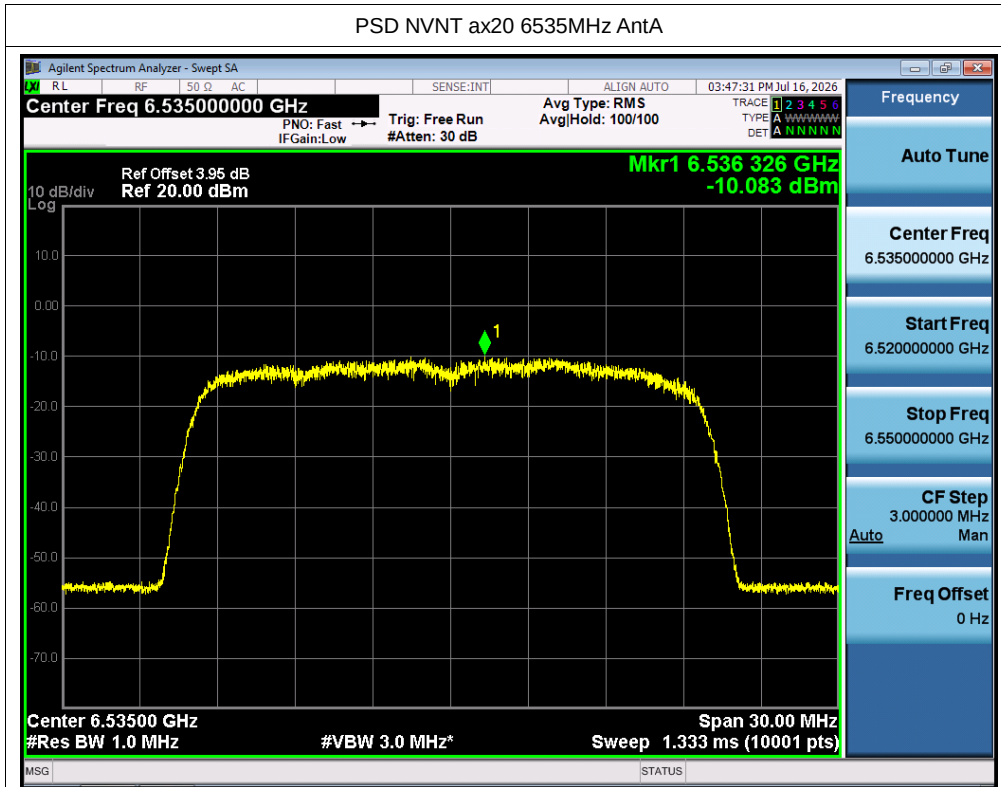


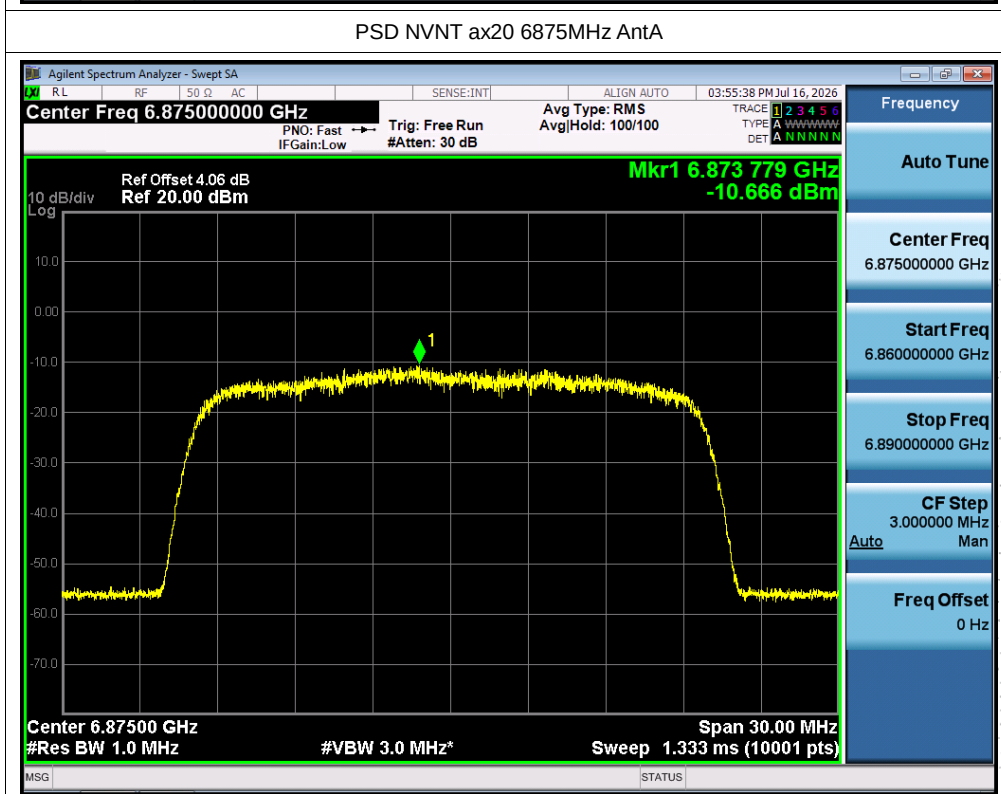
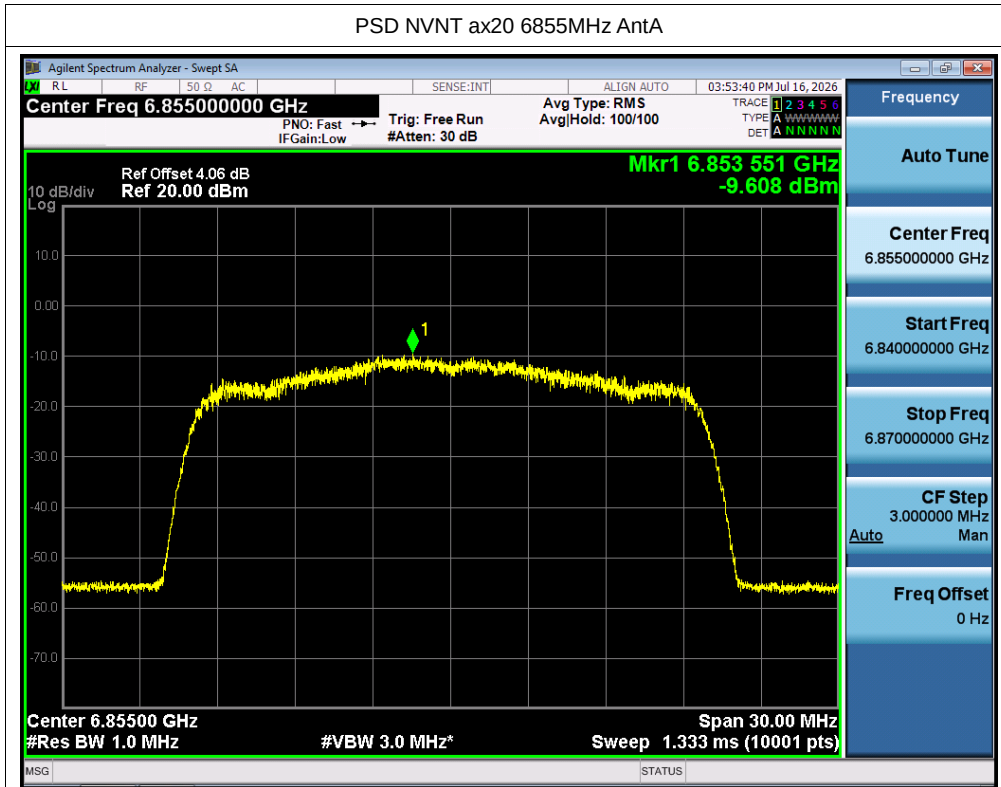


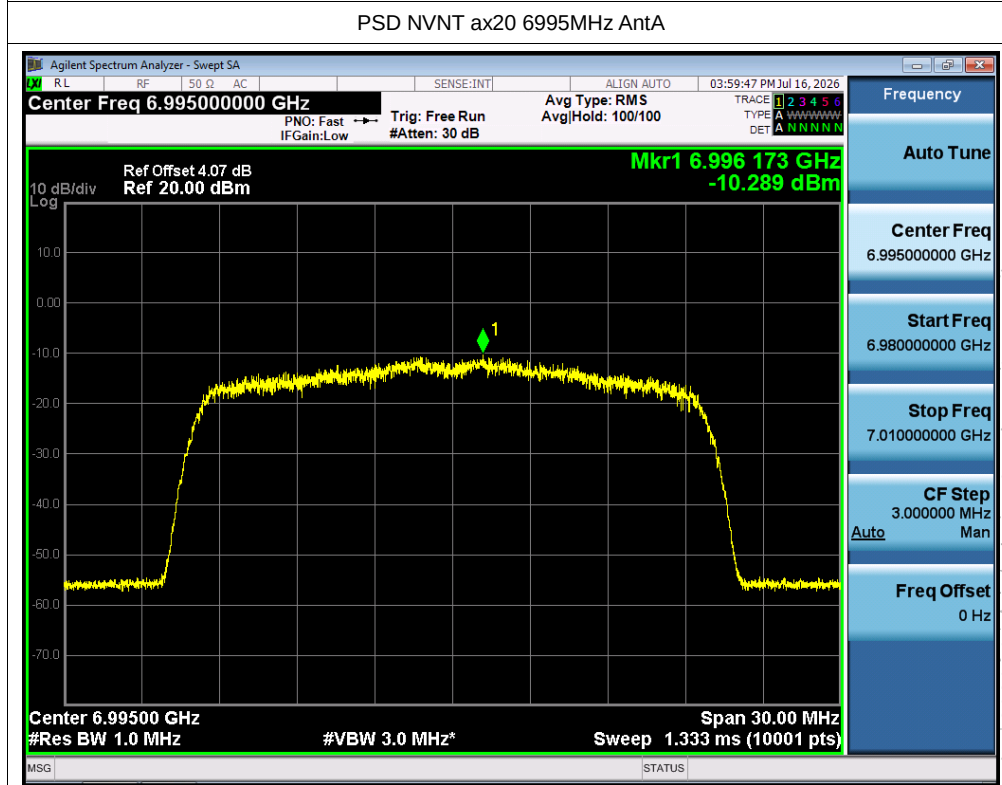
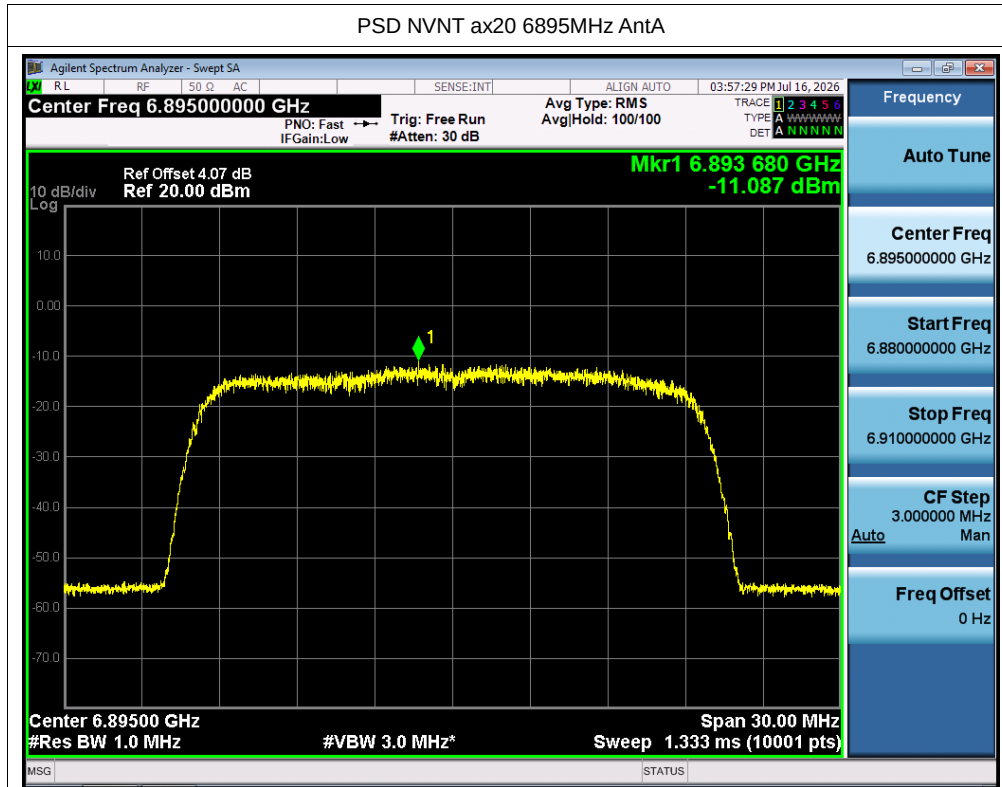


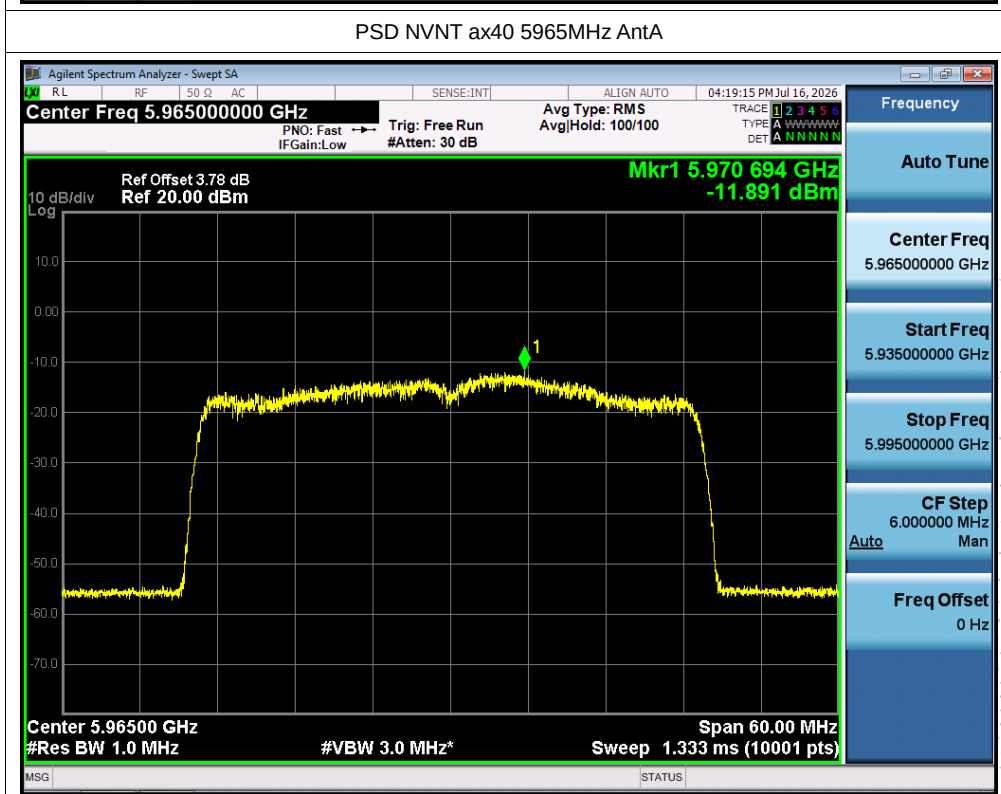
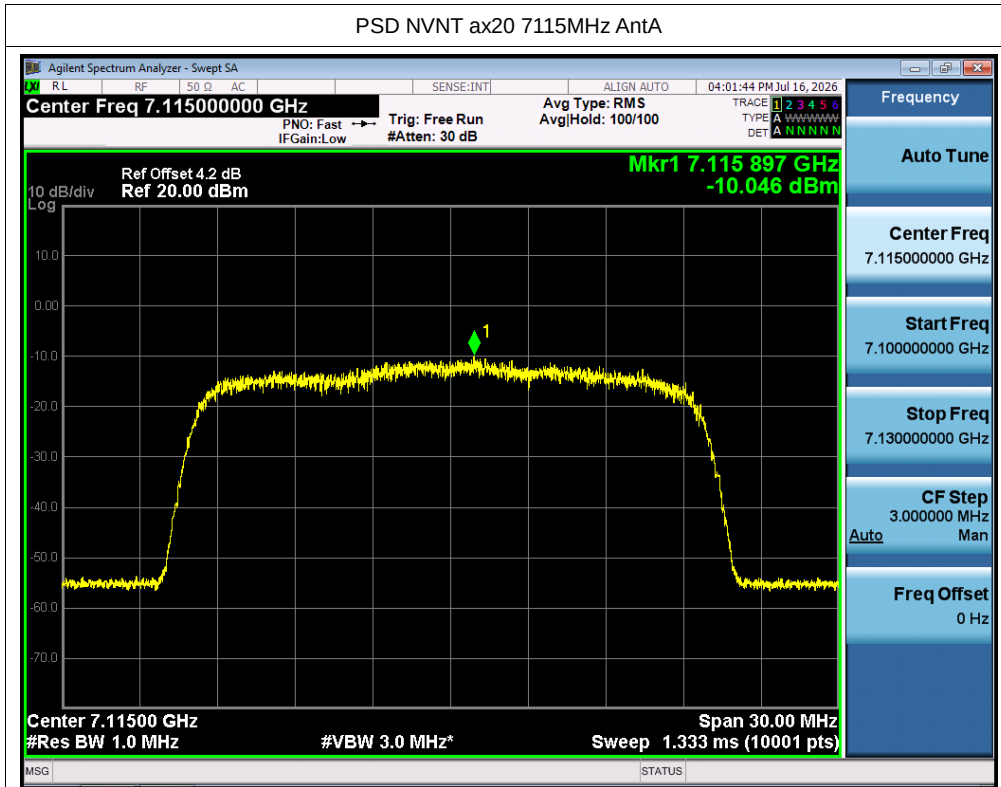


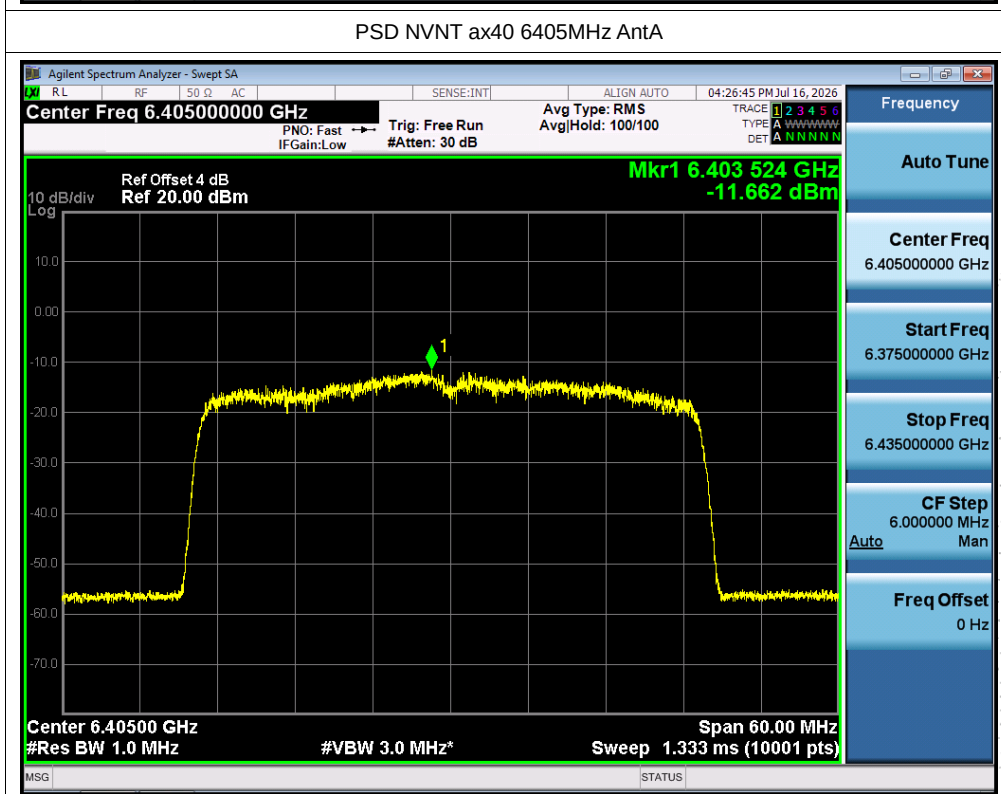
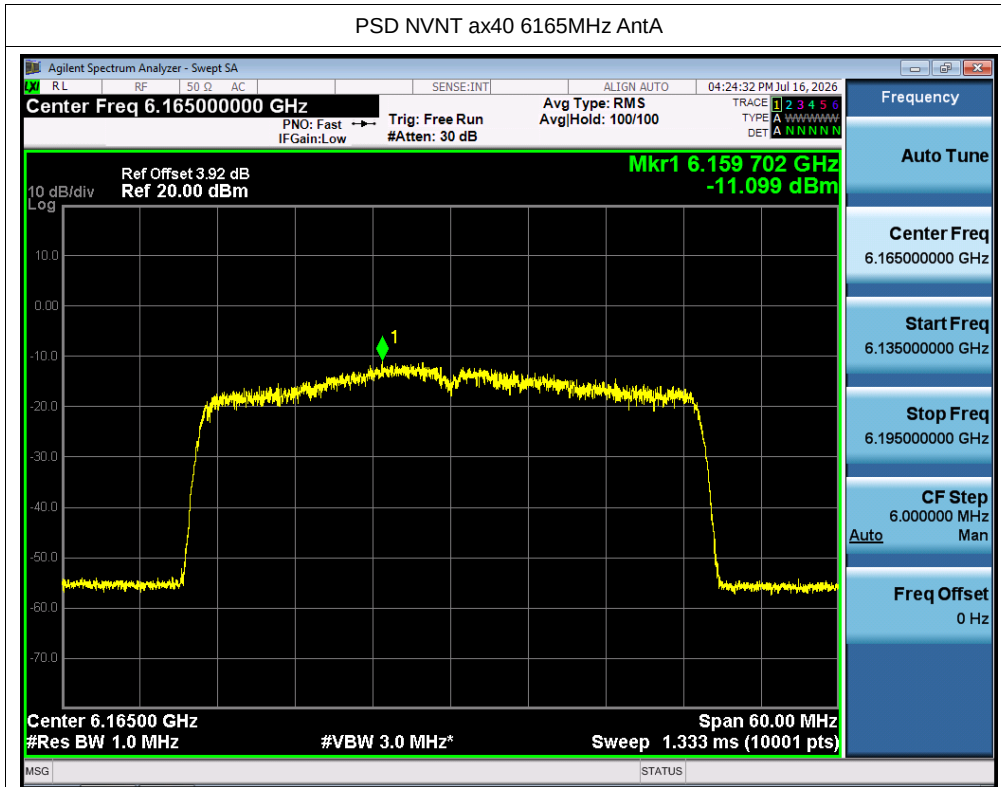


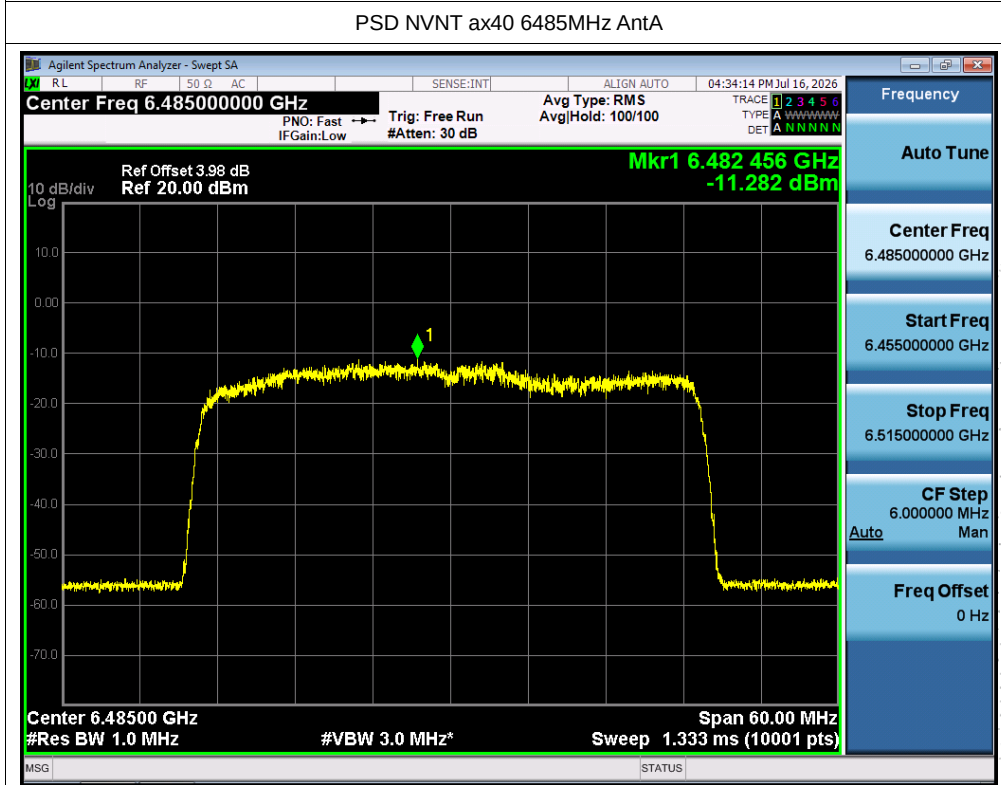
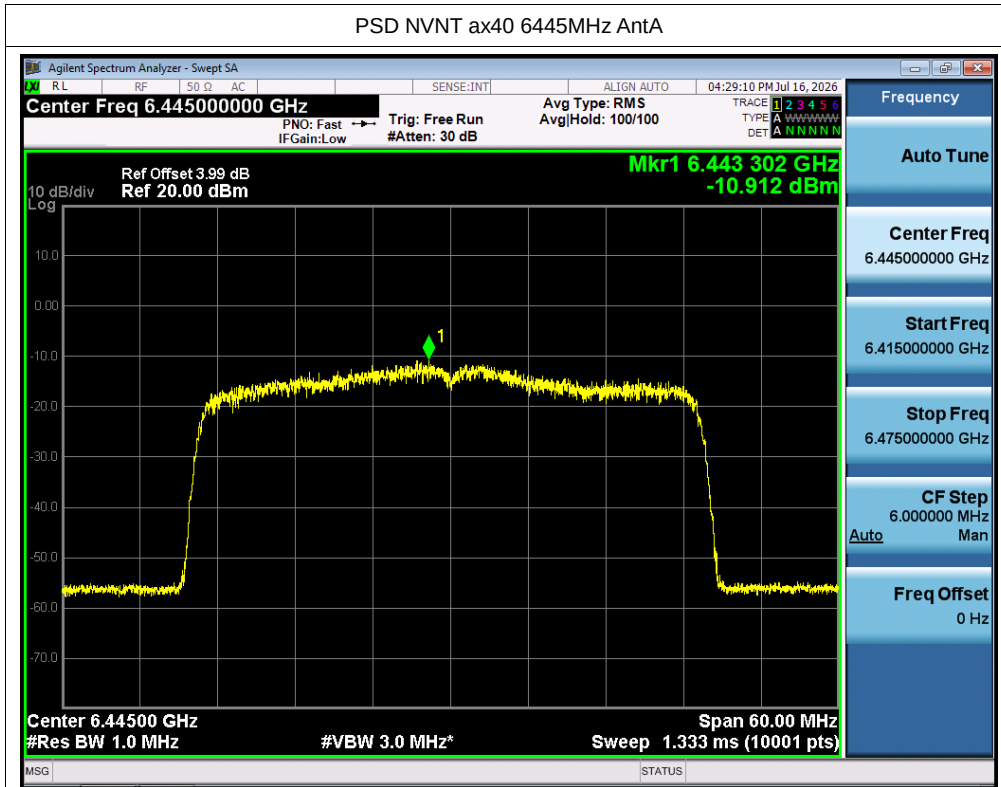


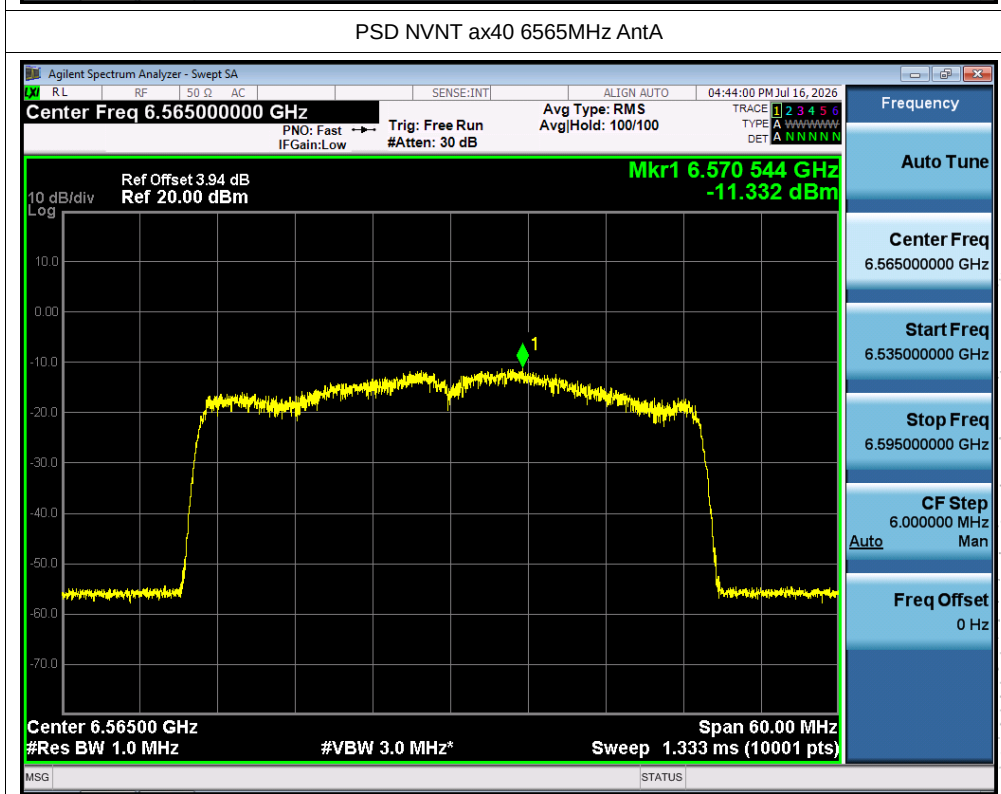
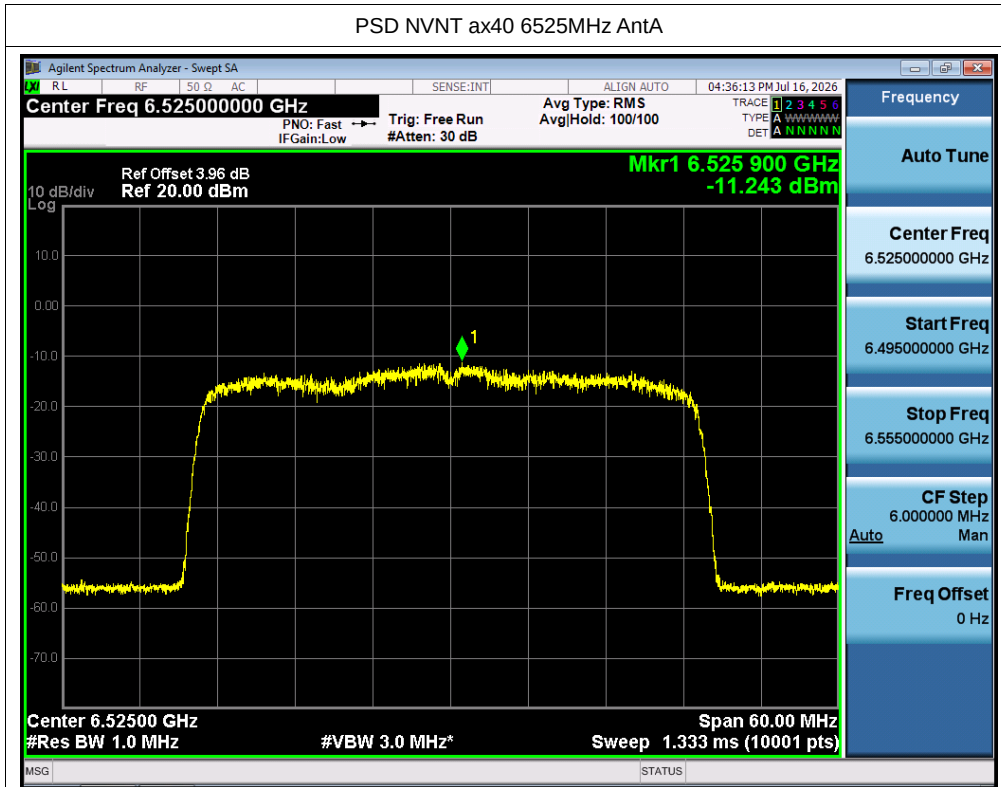


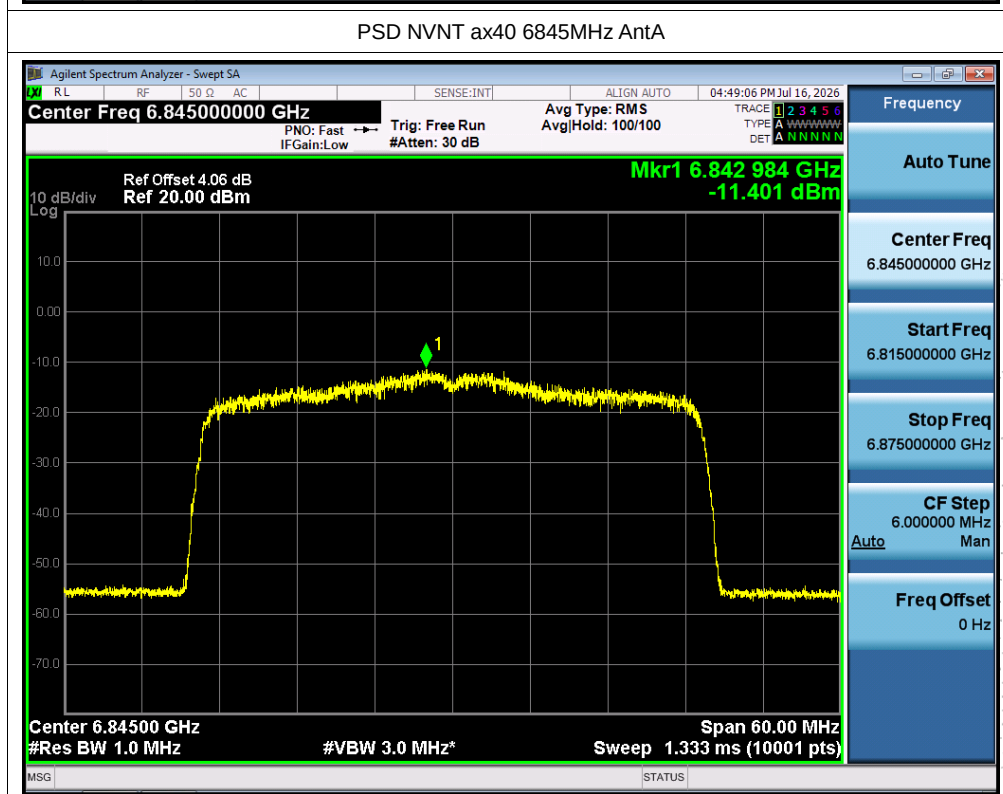
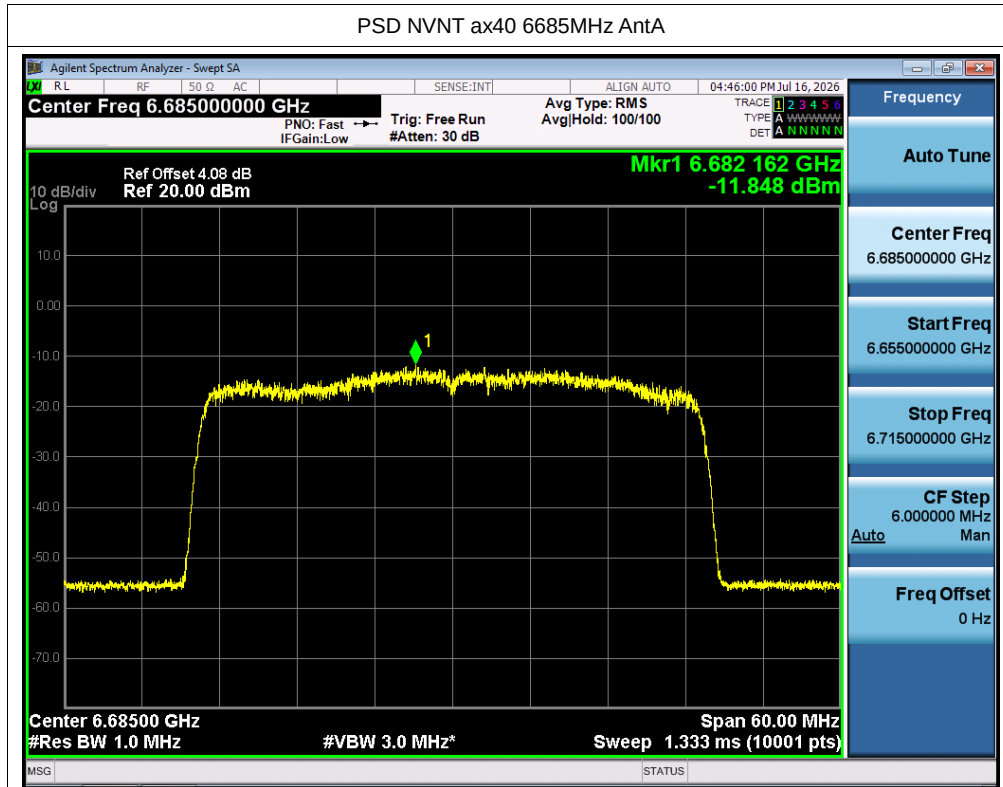


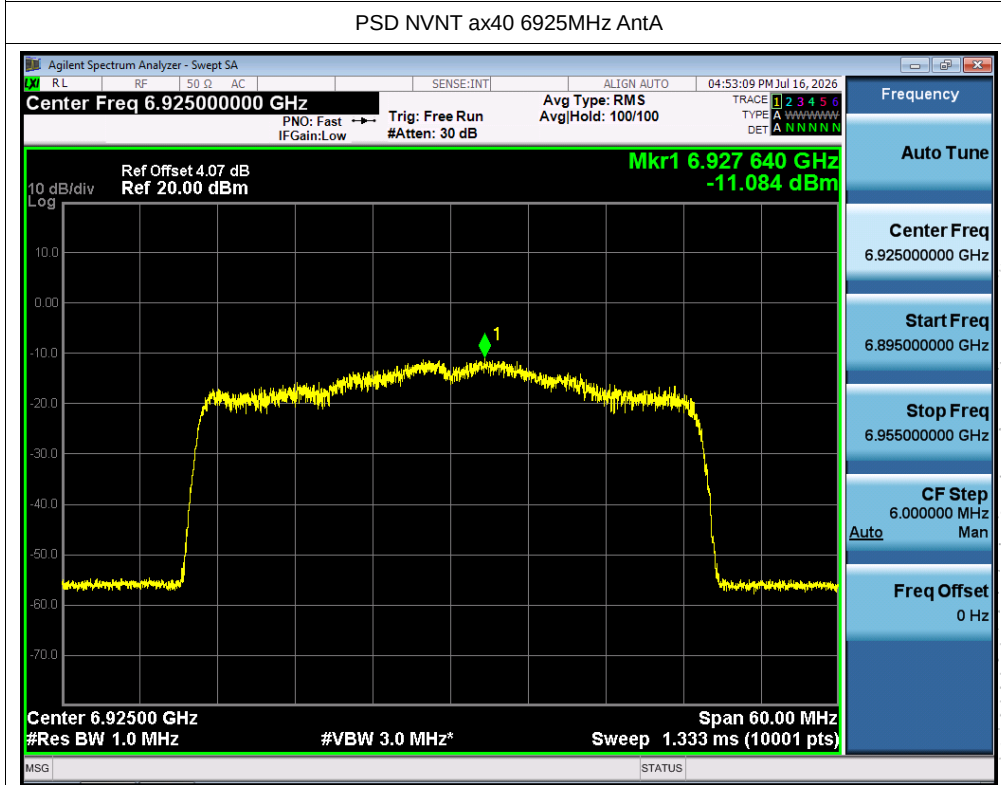
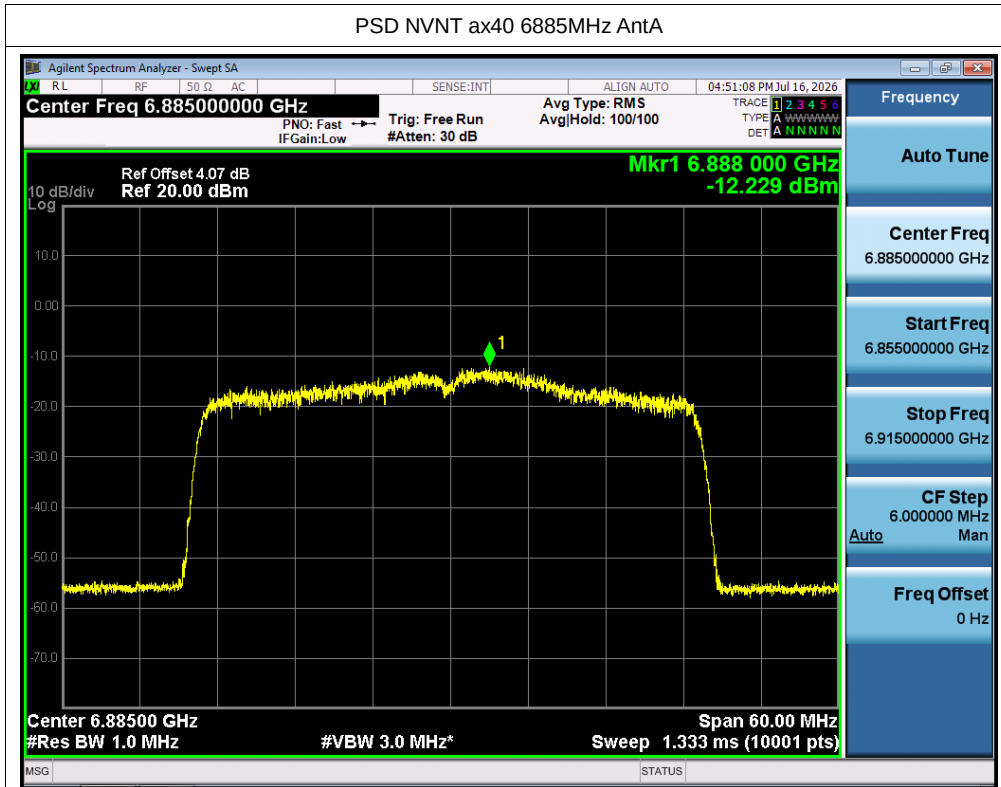


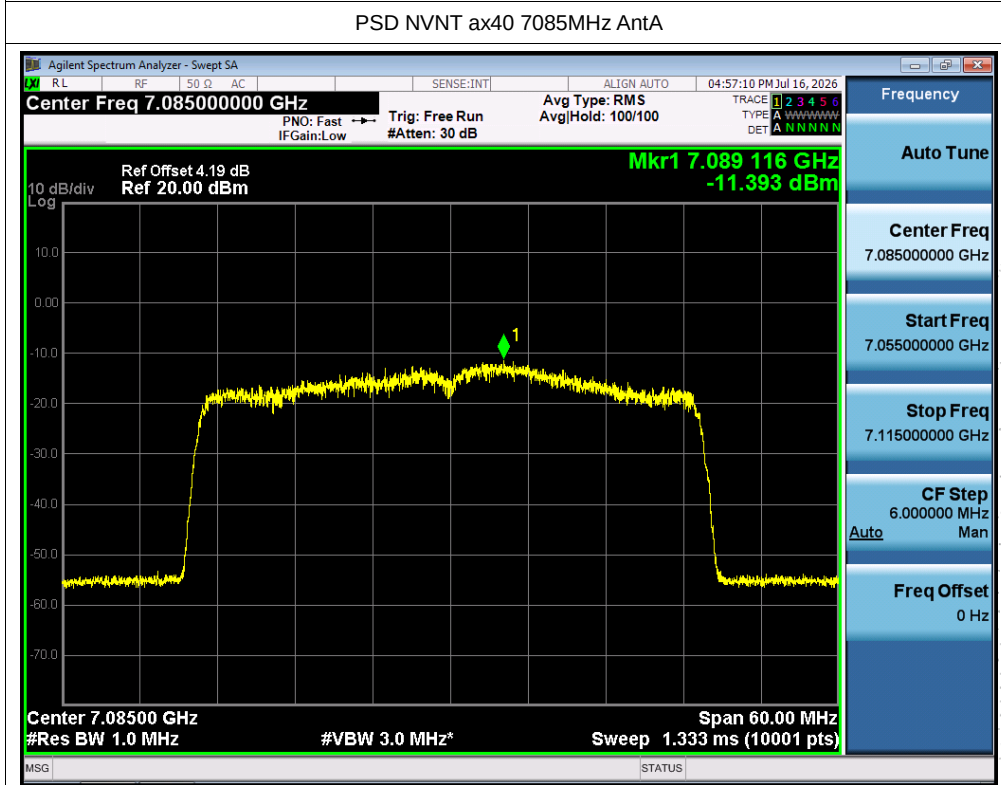
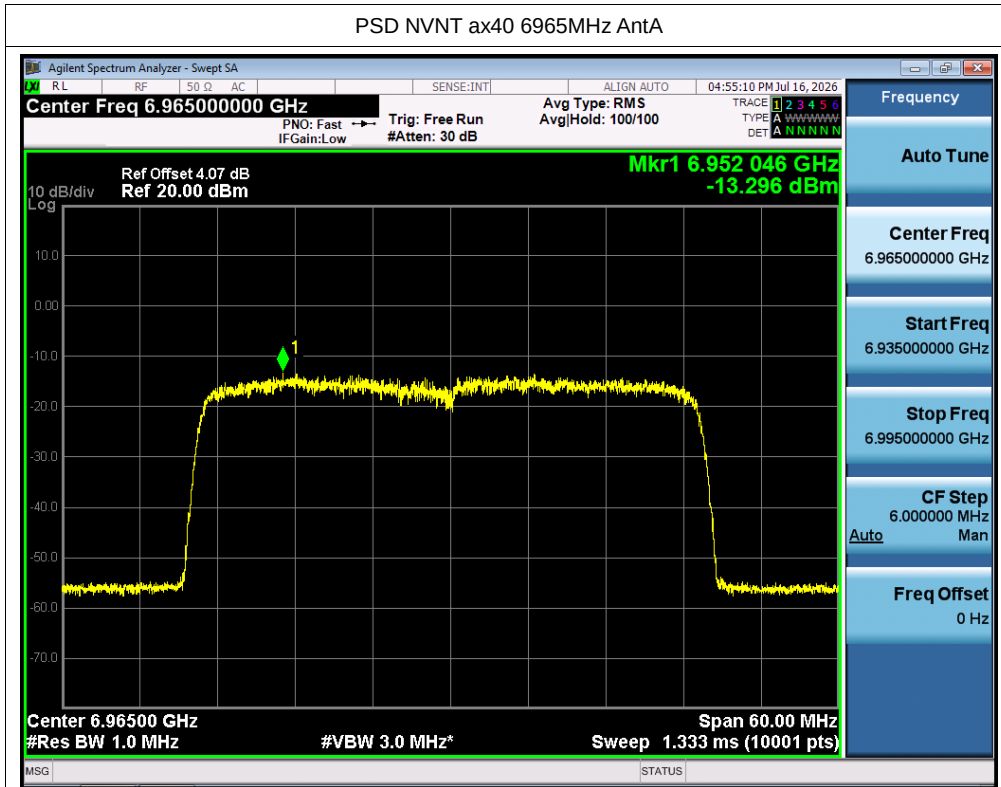


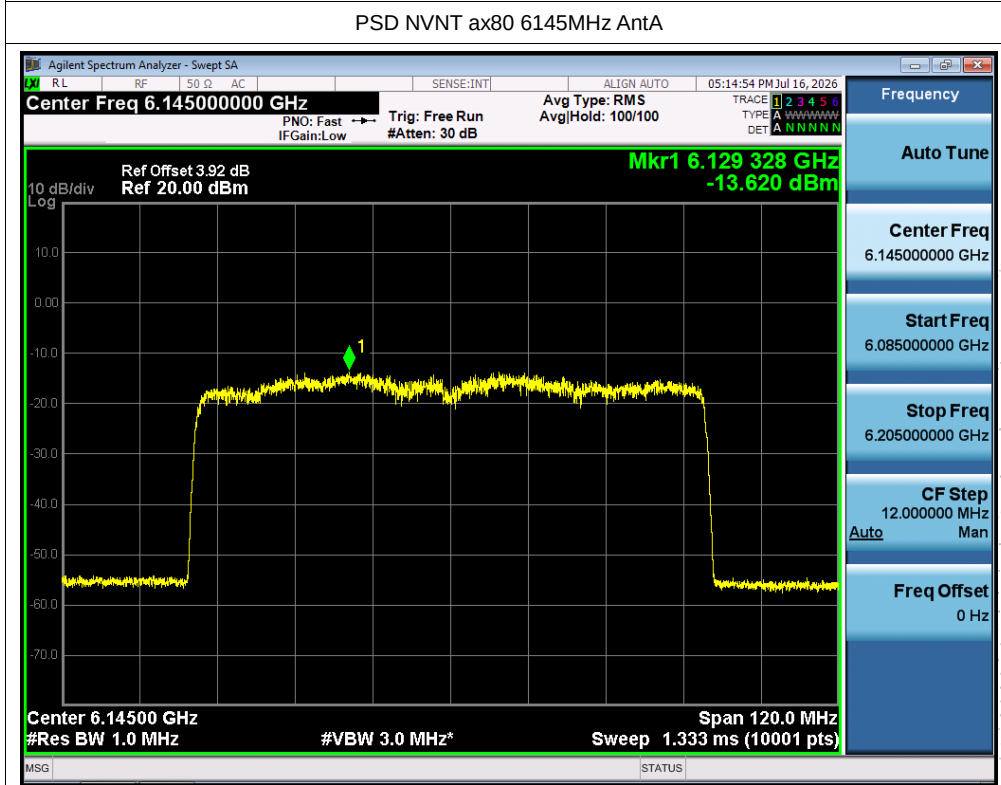
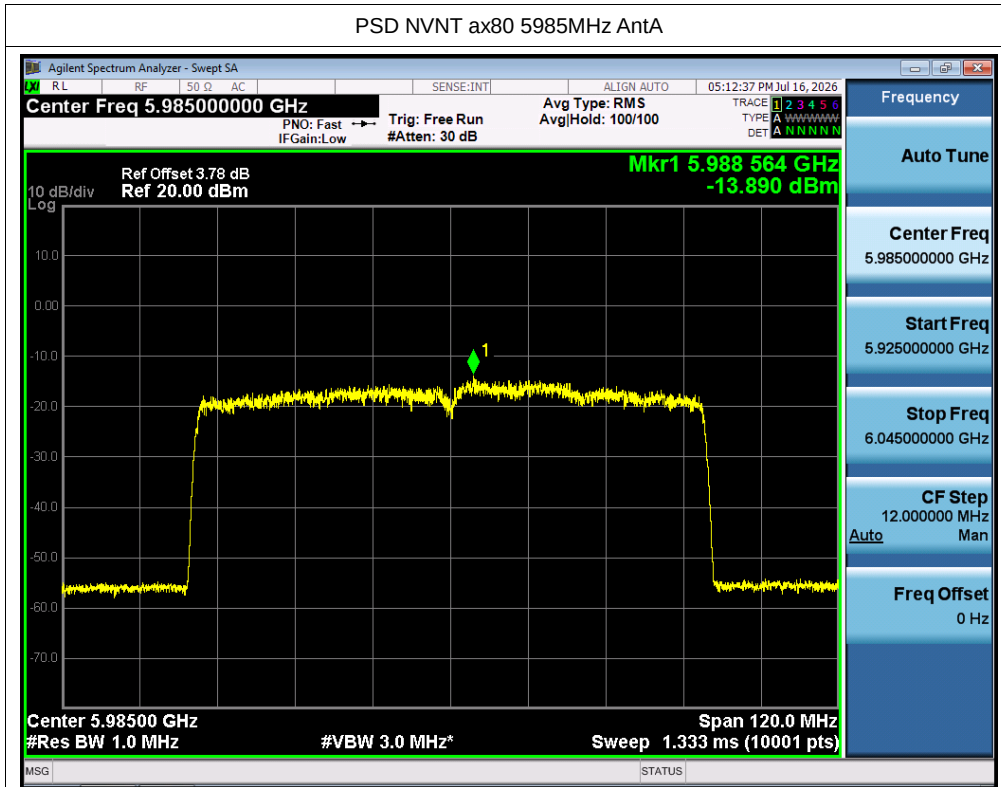


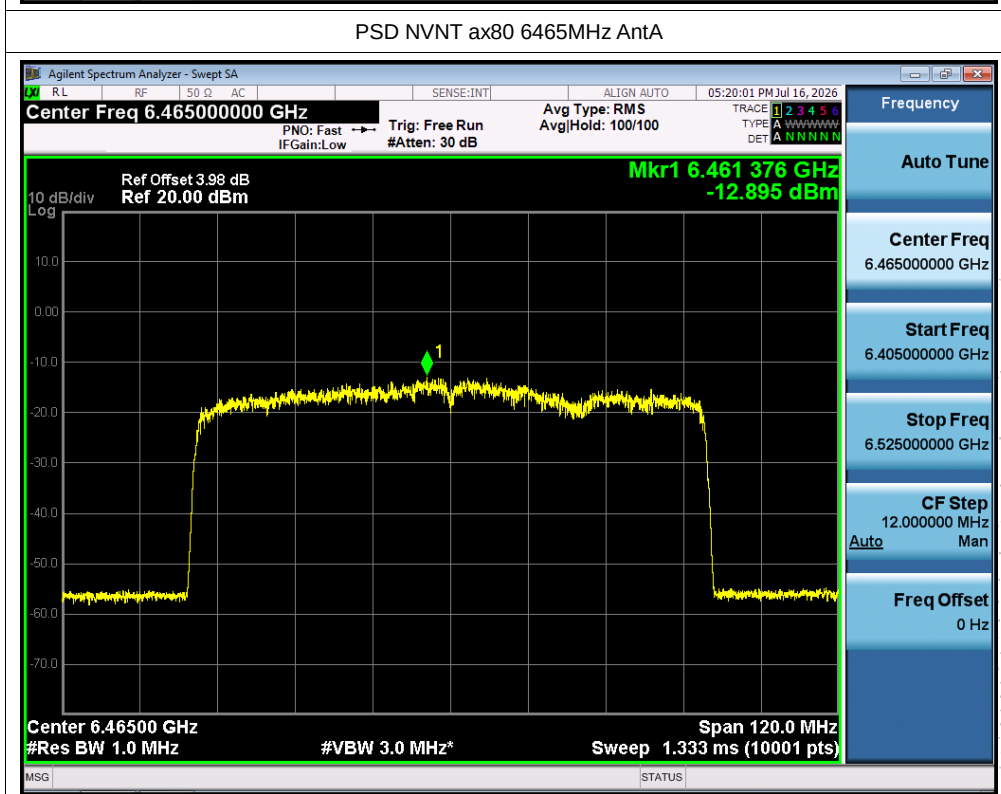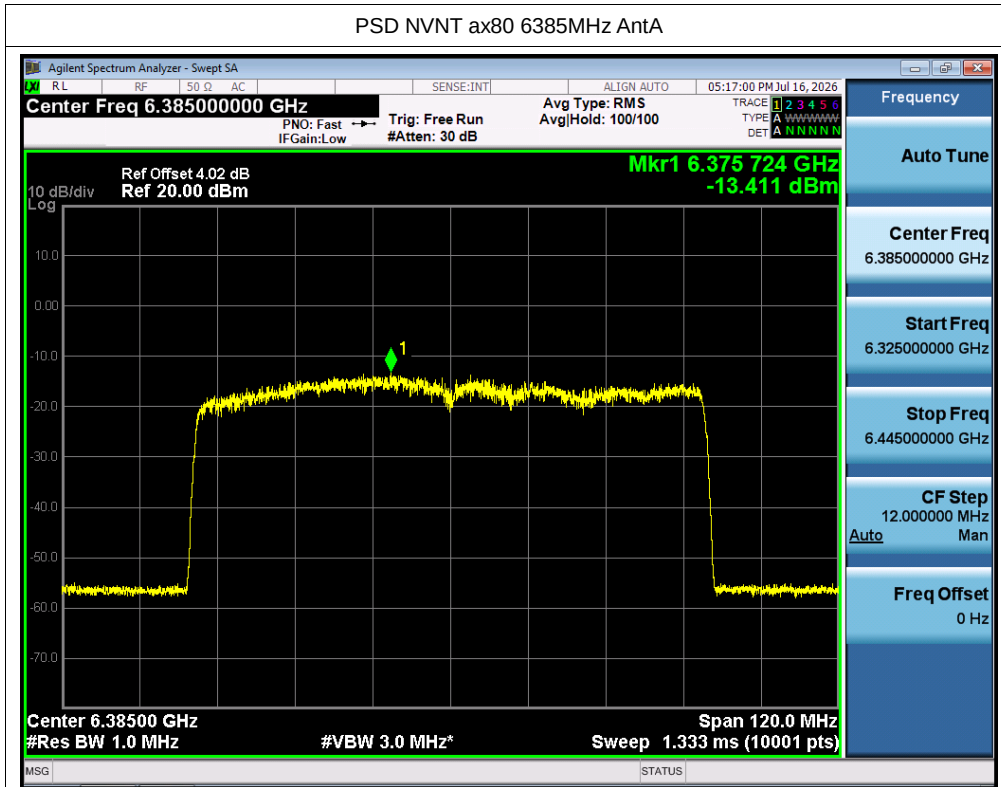

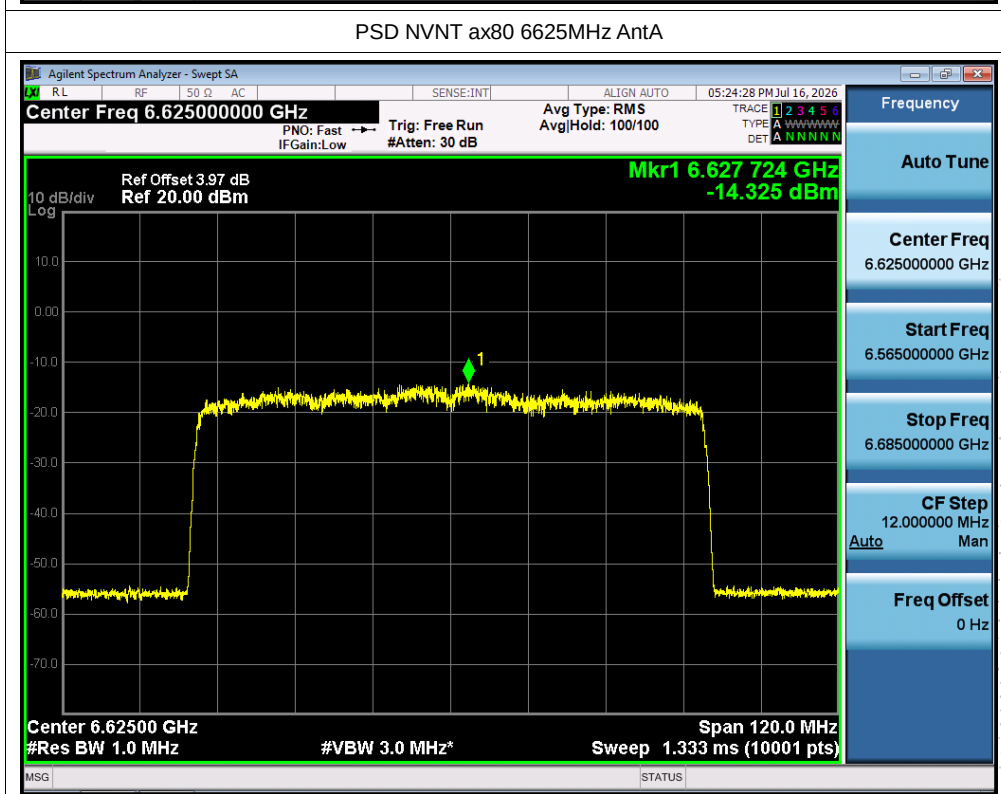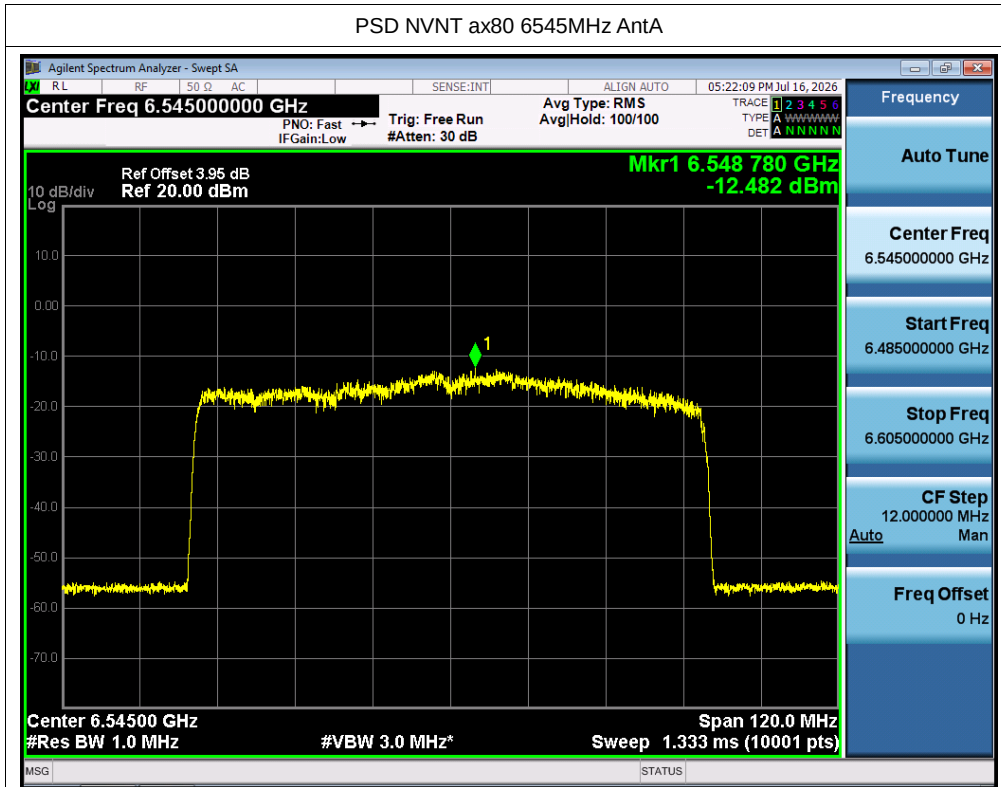

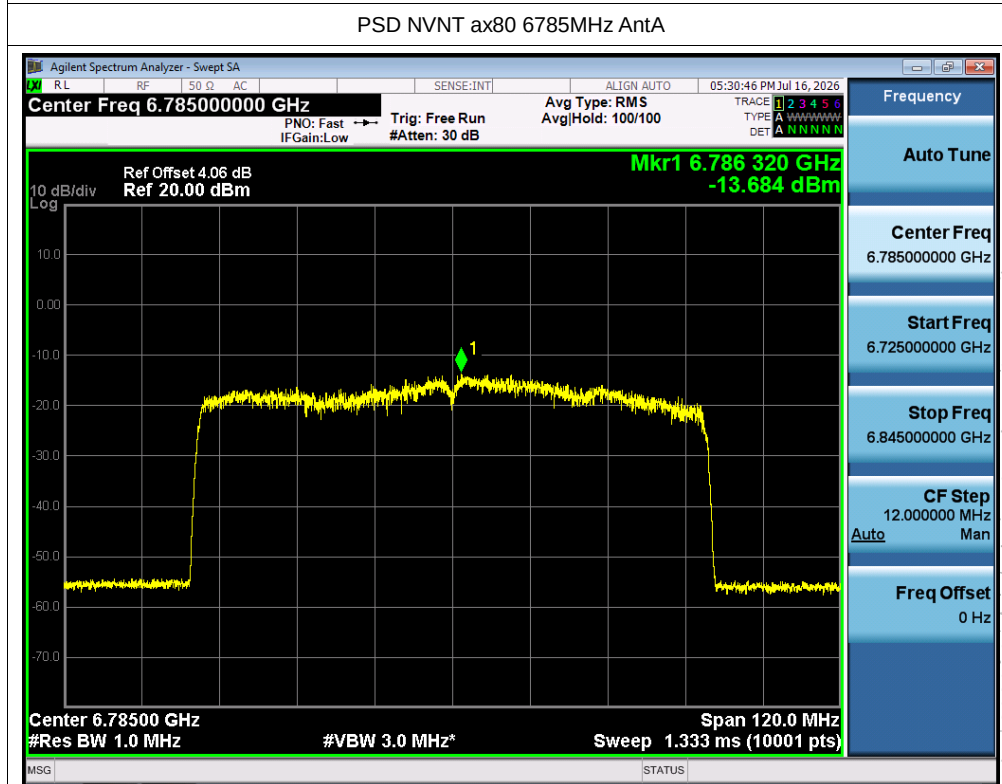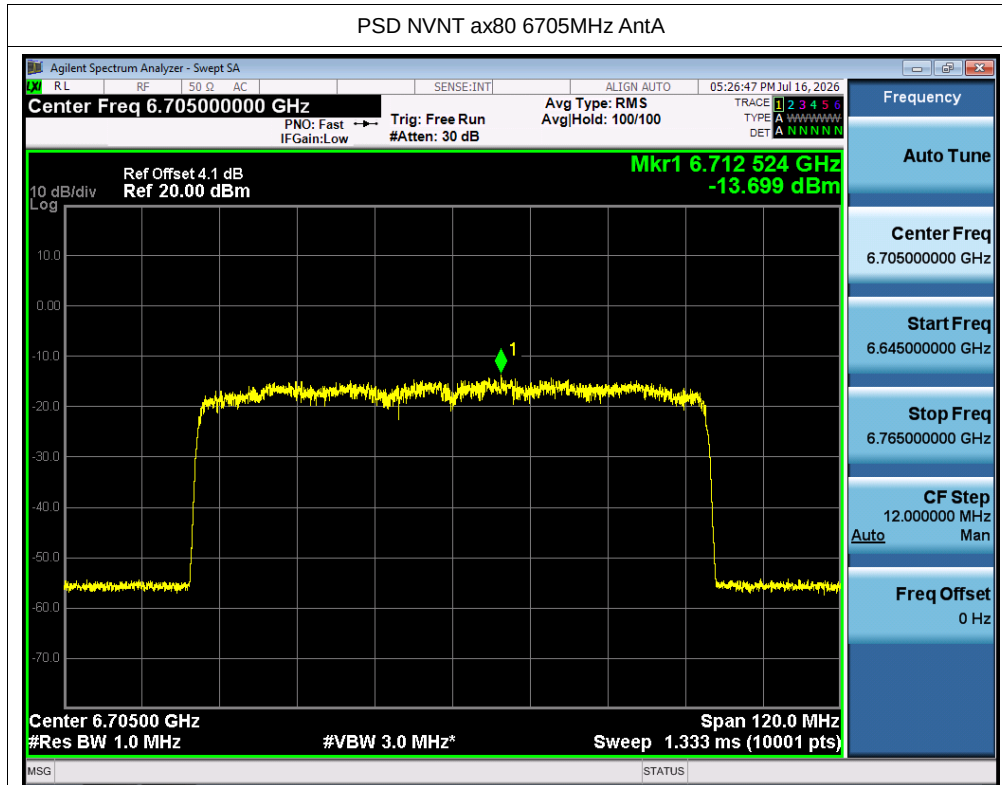


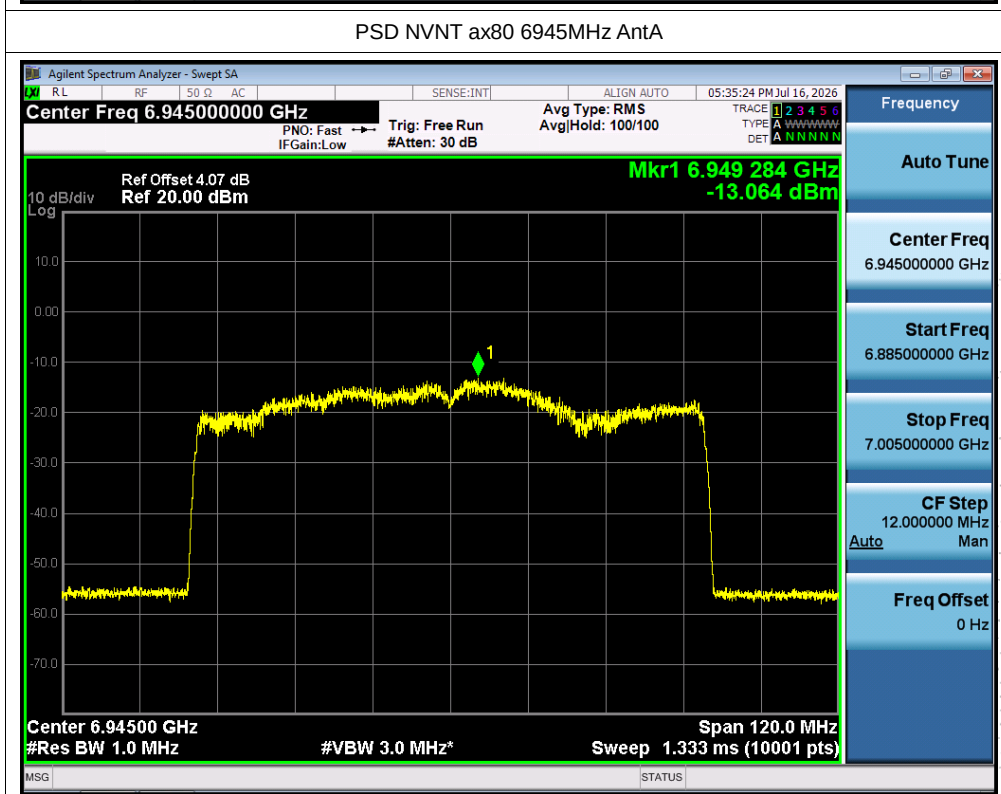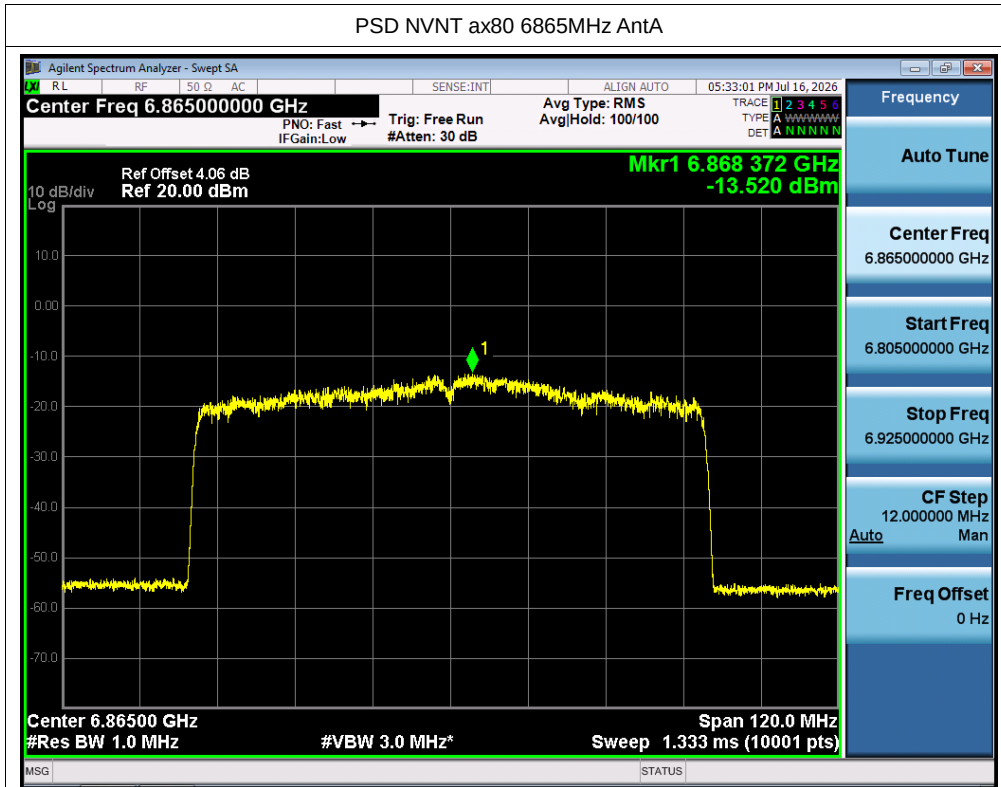

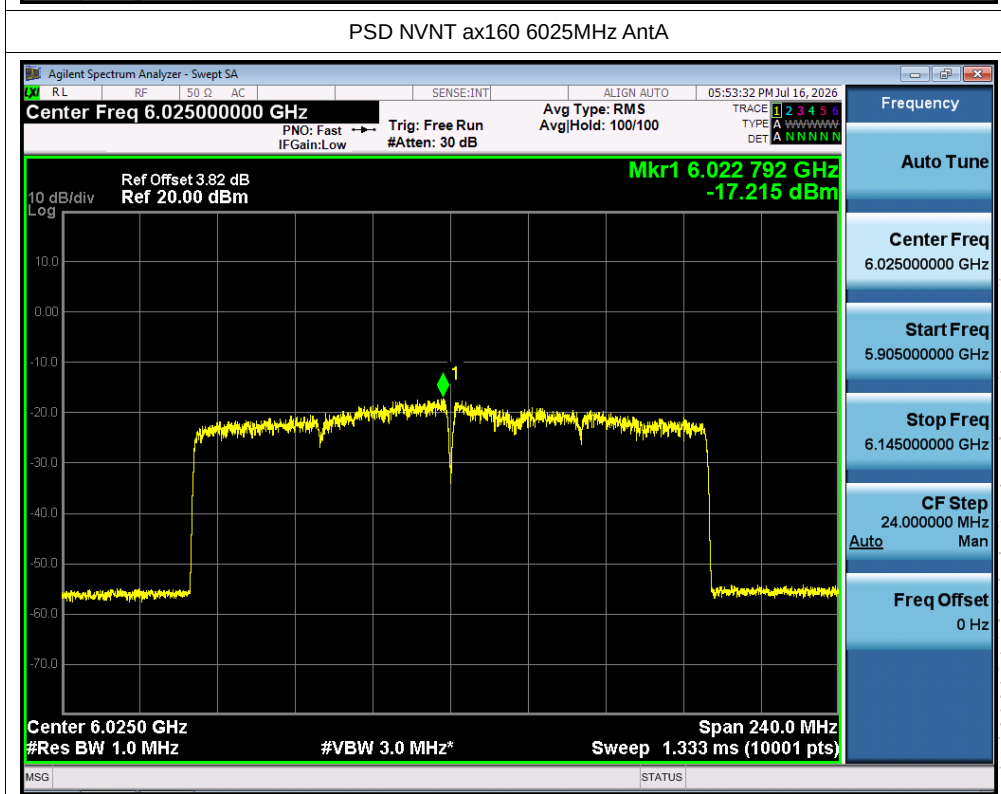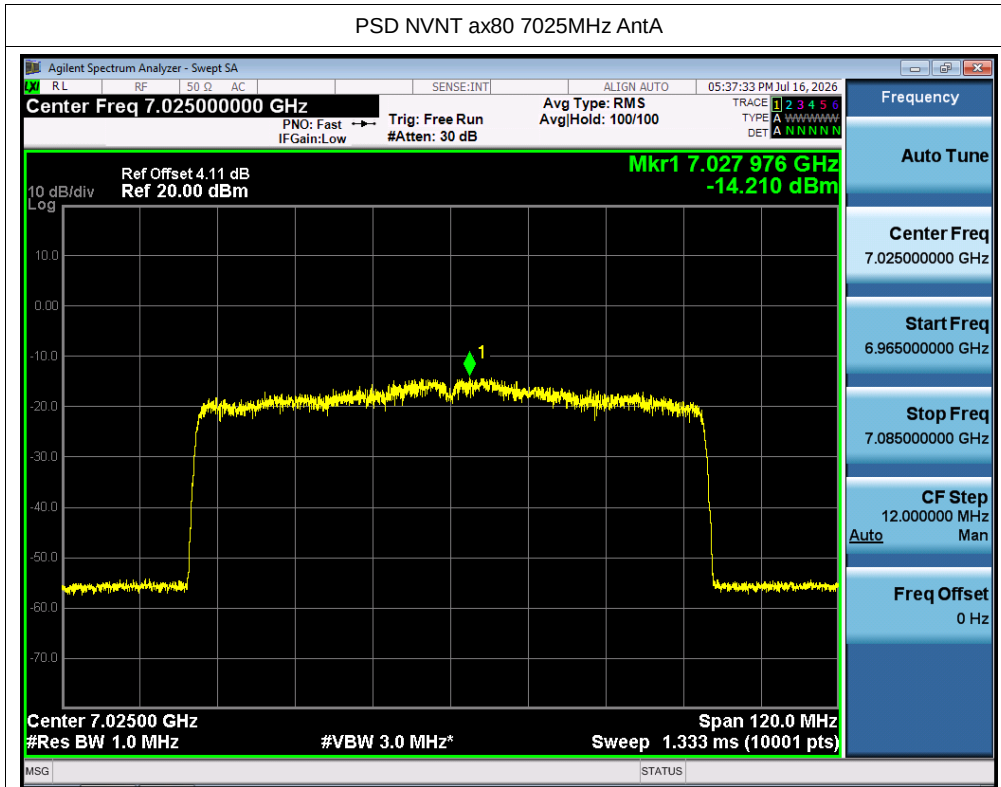




PSD NVNT ax160 6185MHz AntA

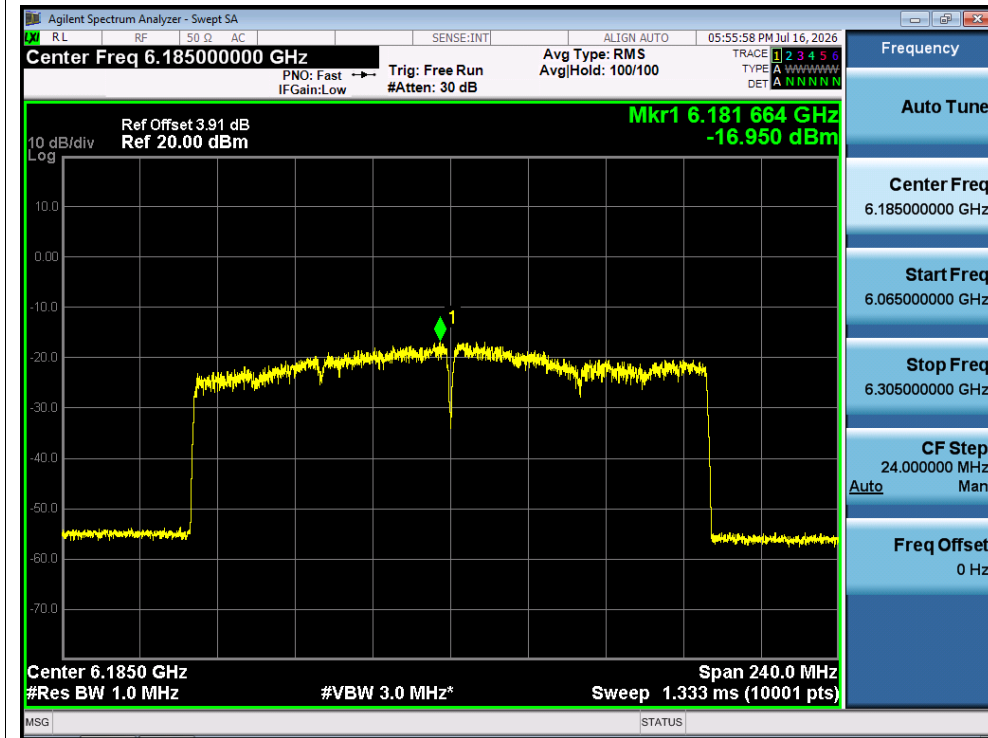


PSD NVNT ax160 6345MHz AntA

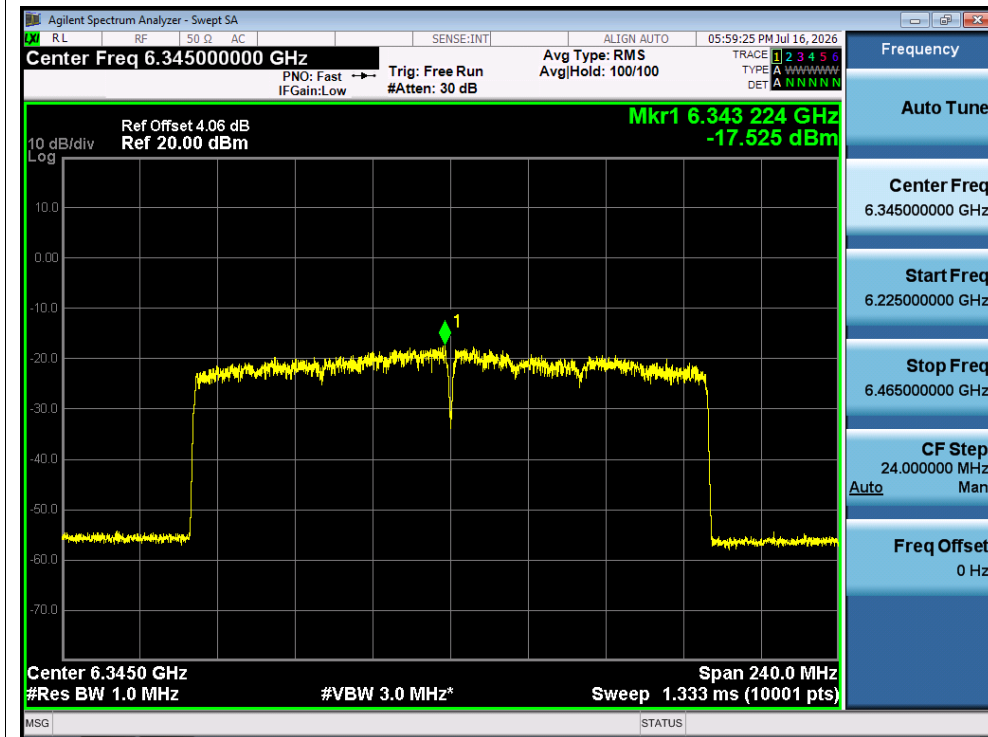




PSD NVNT ax160 6505MHz AntA

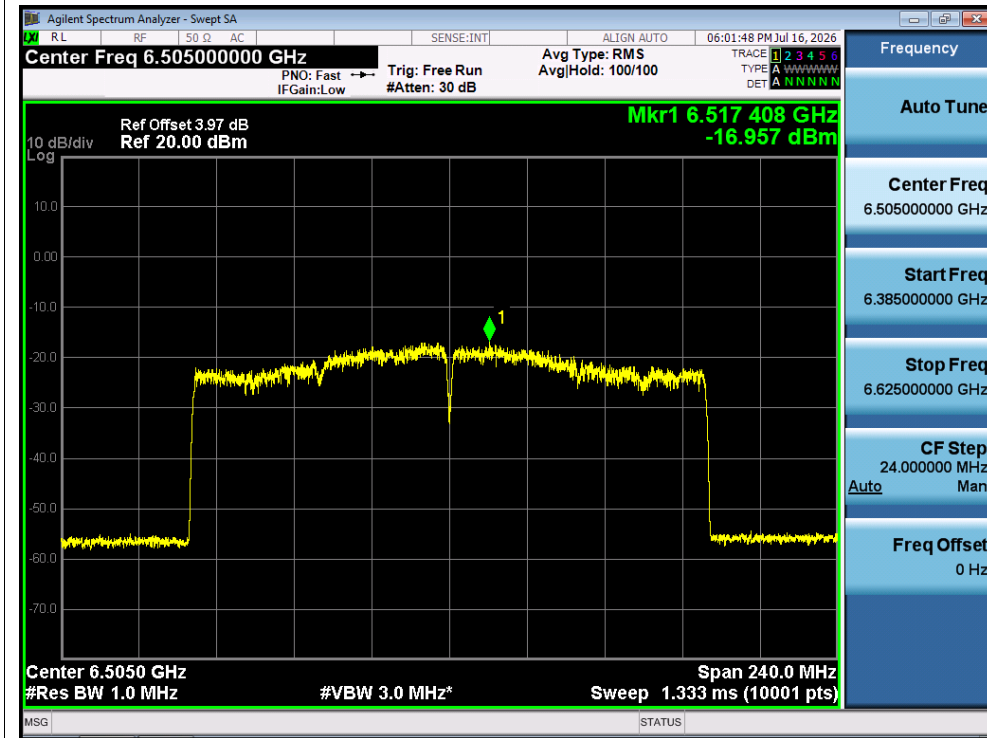


PSD NVNT ax160 6665MHz AntA

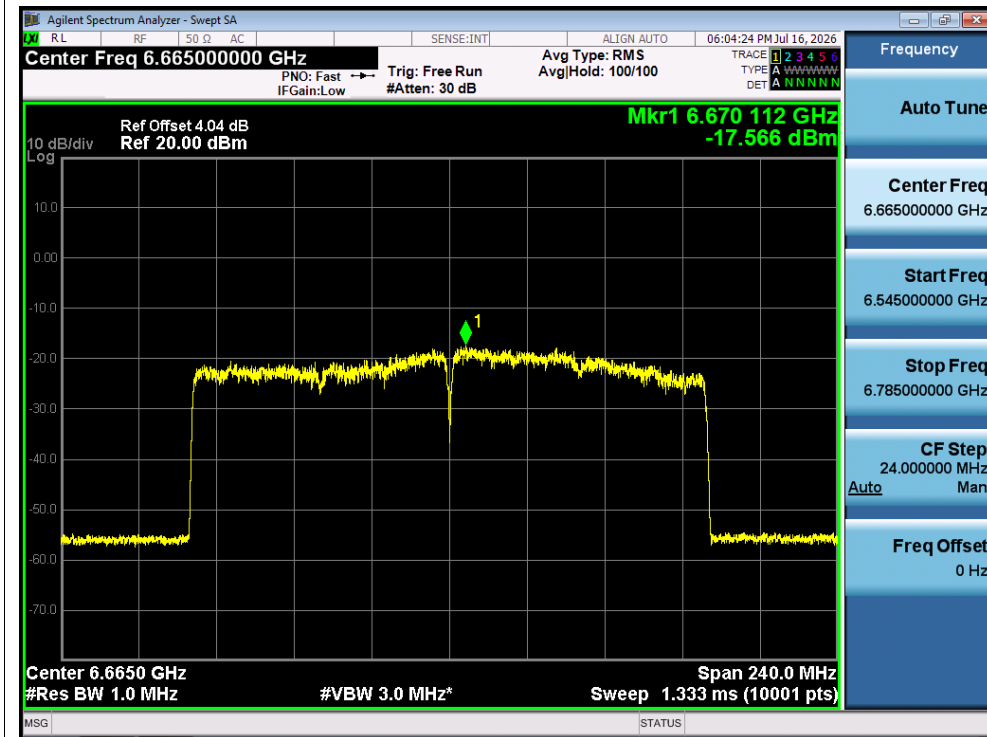








PSD NVNT ax160 6825MHz AntA


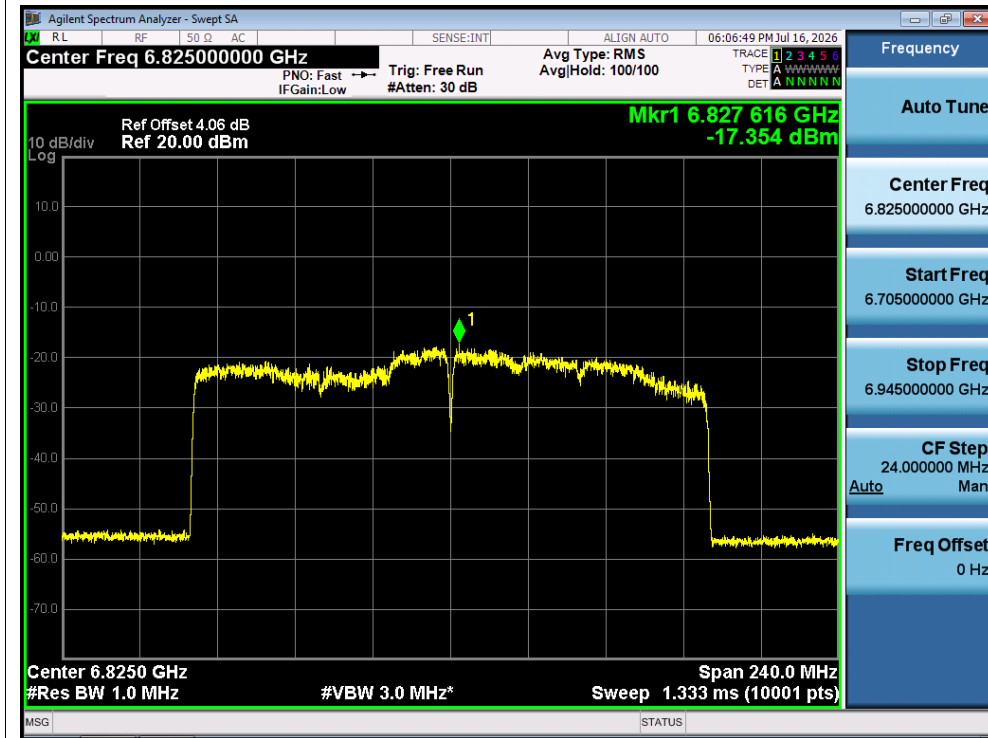




PSD NVNT ax160 6985MHz AntA


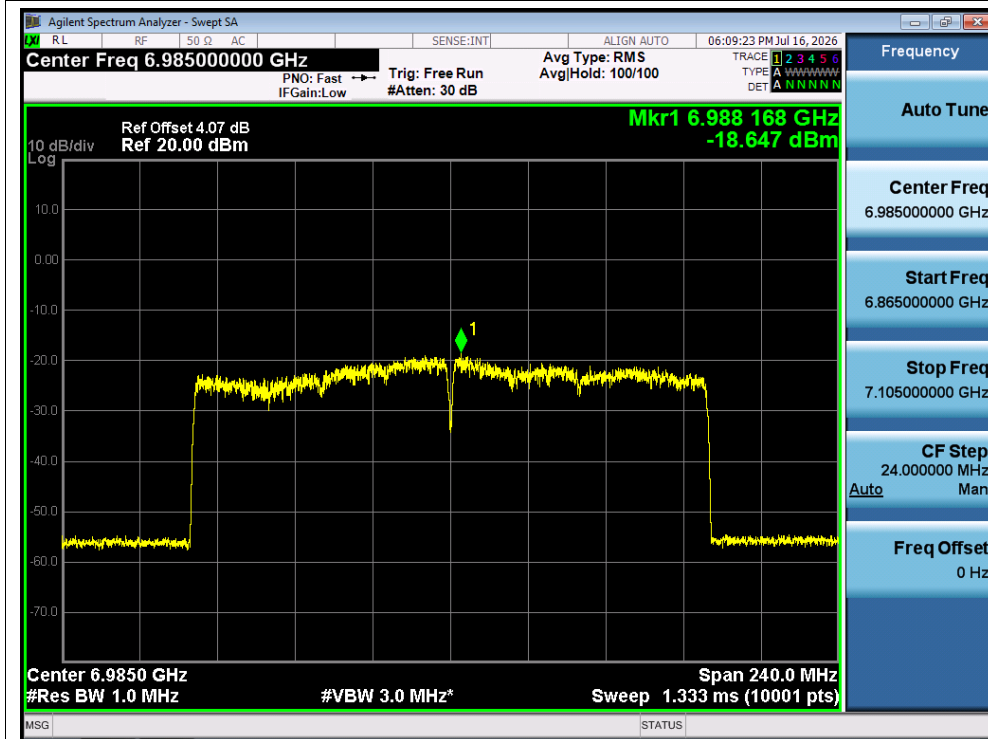


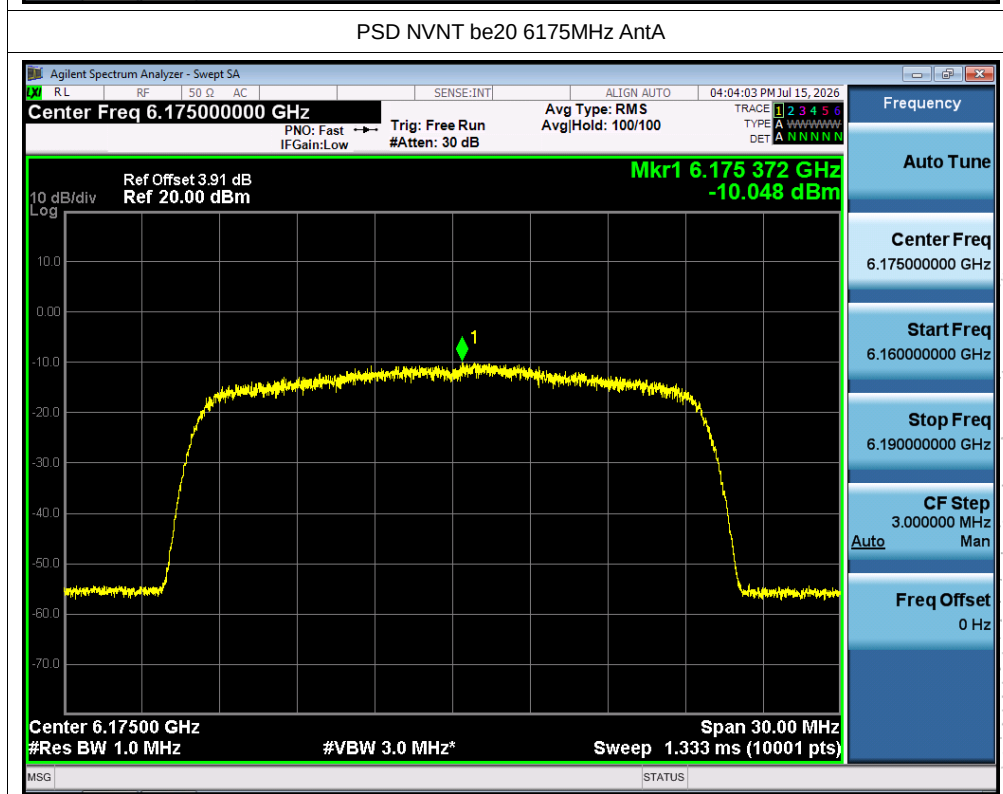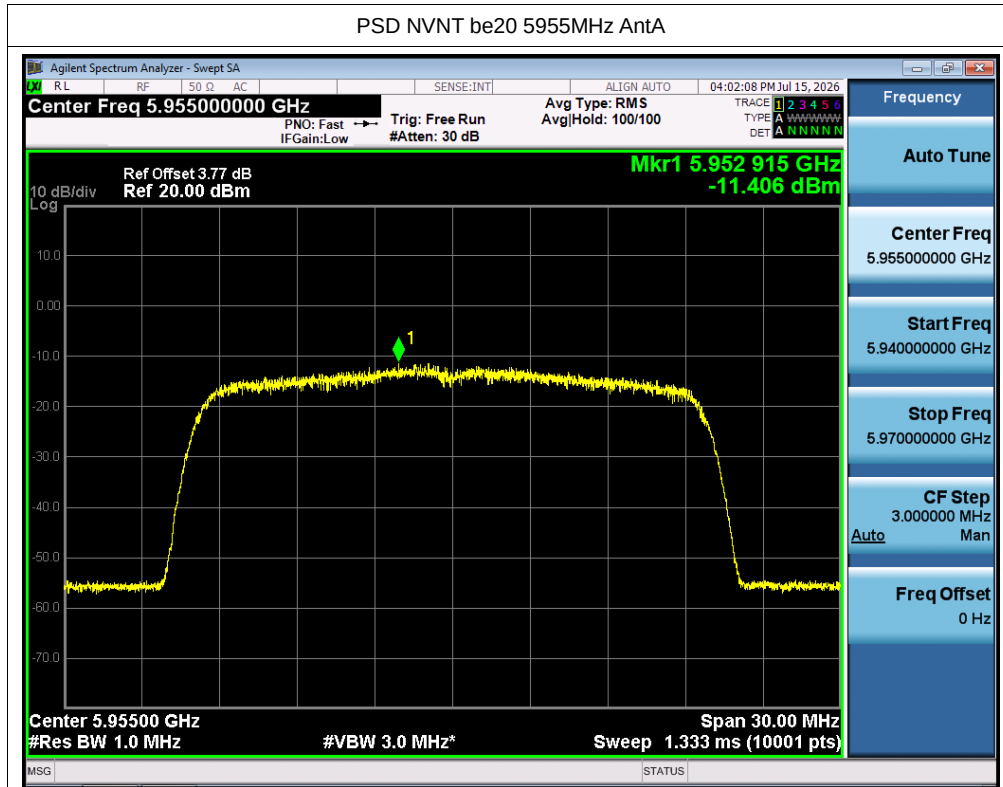

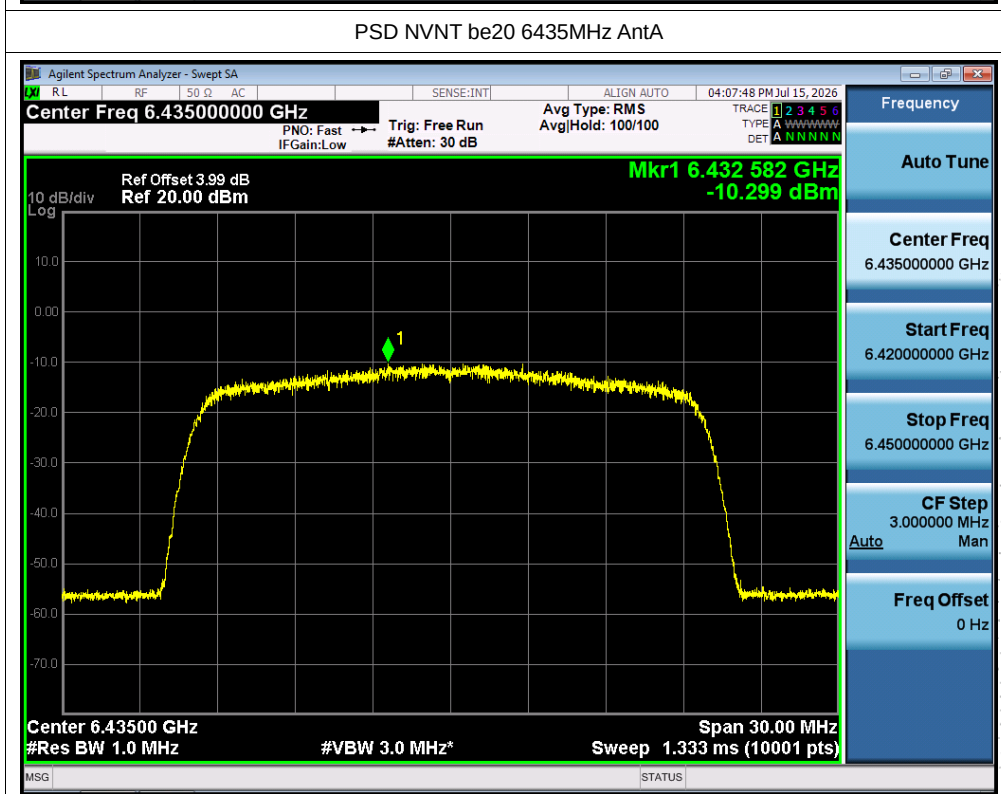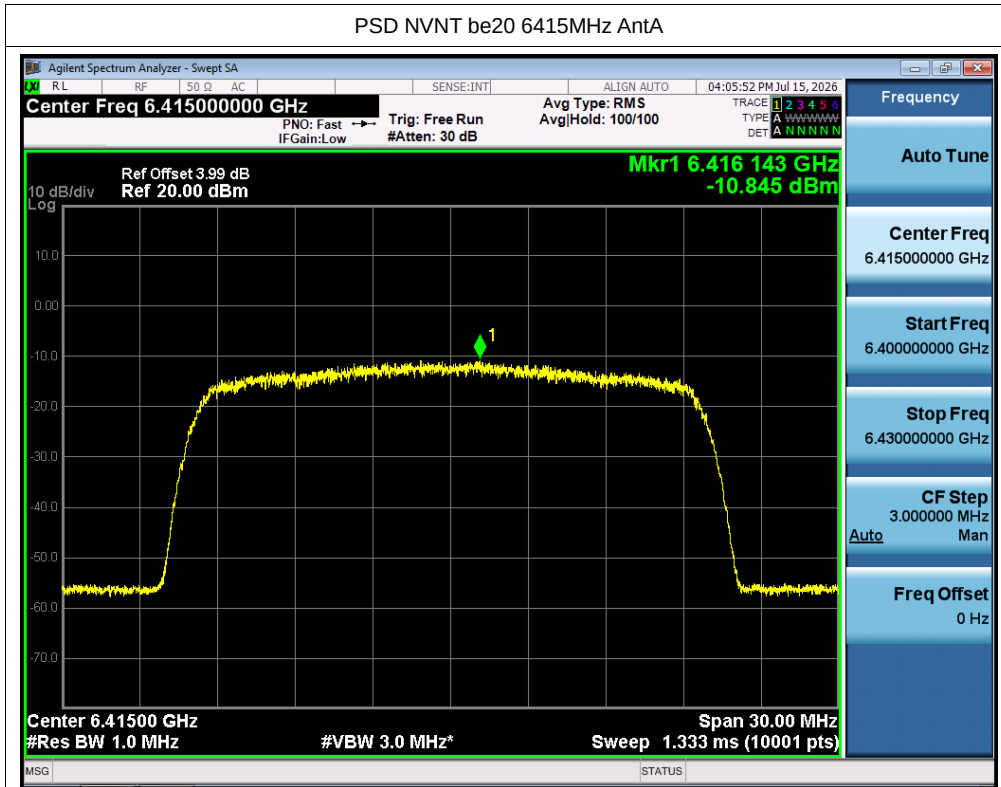

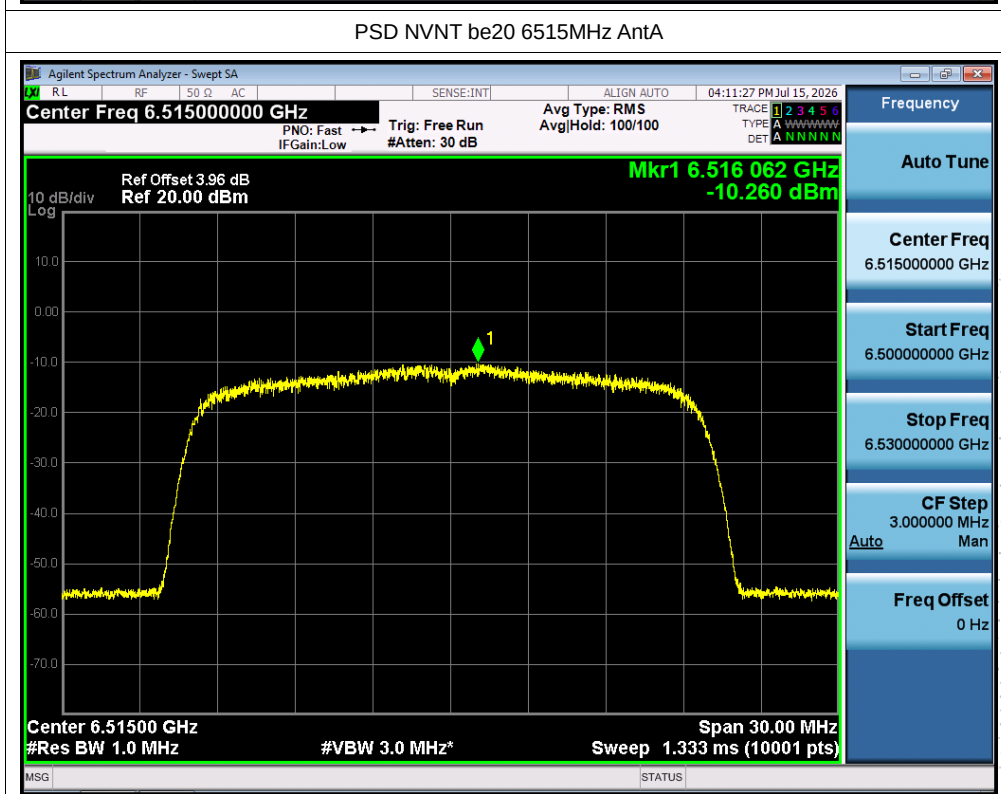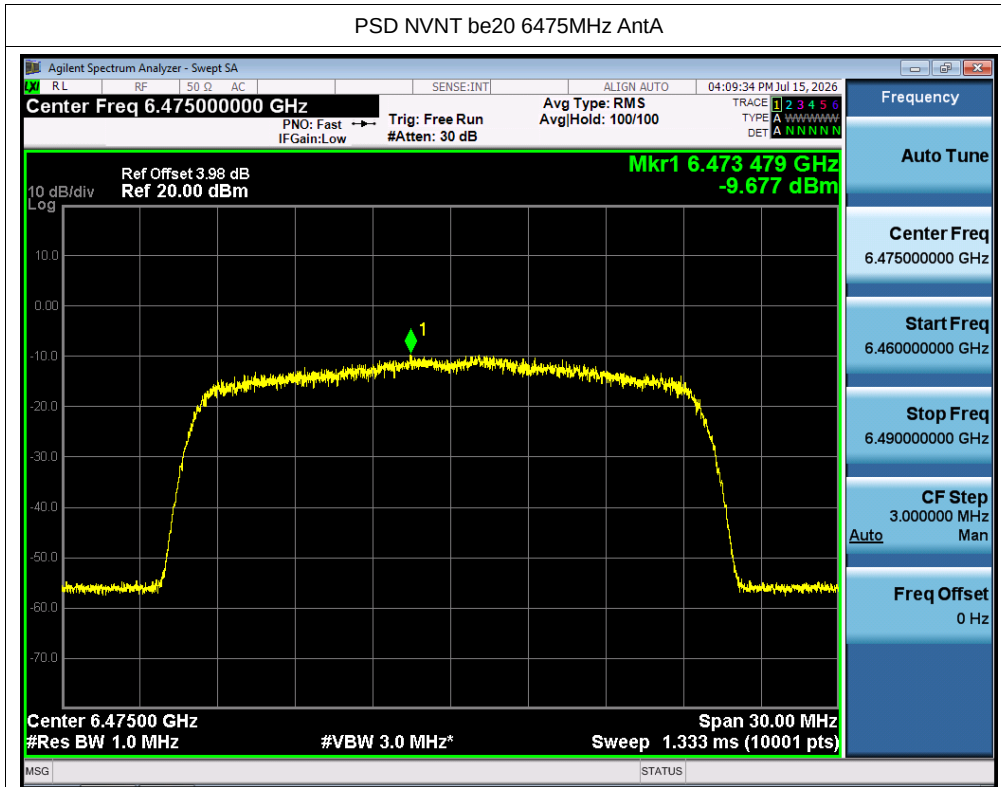


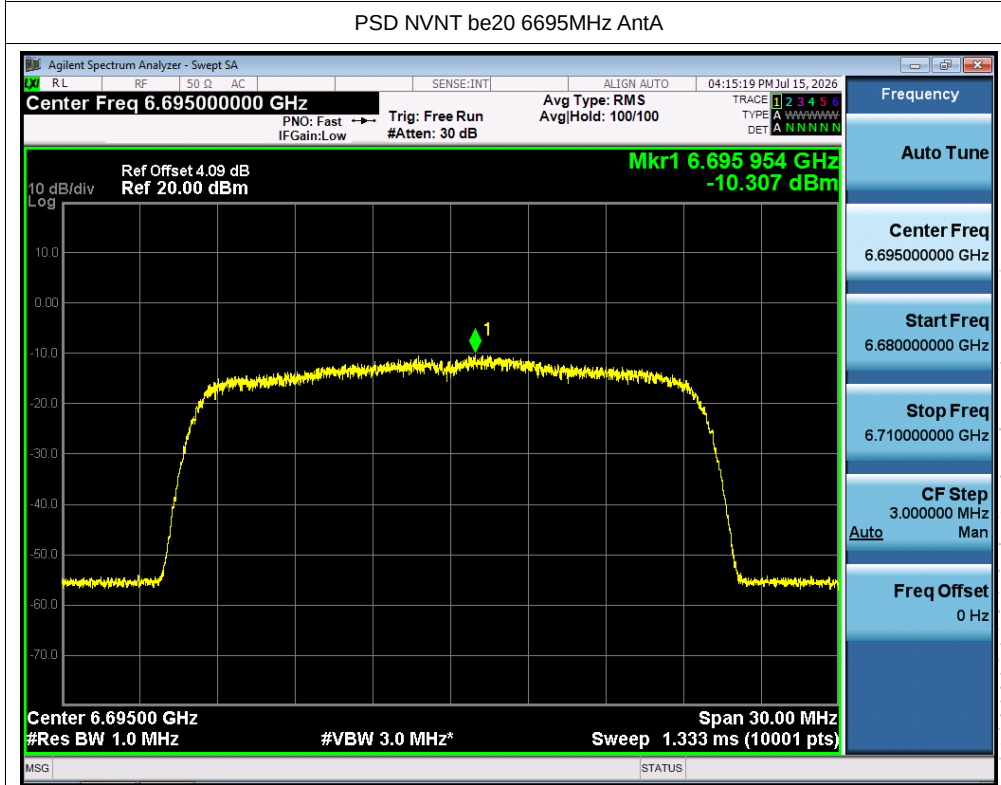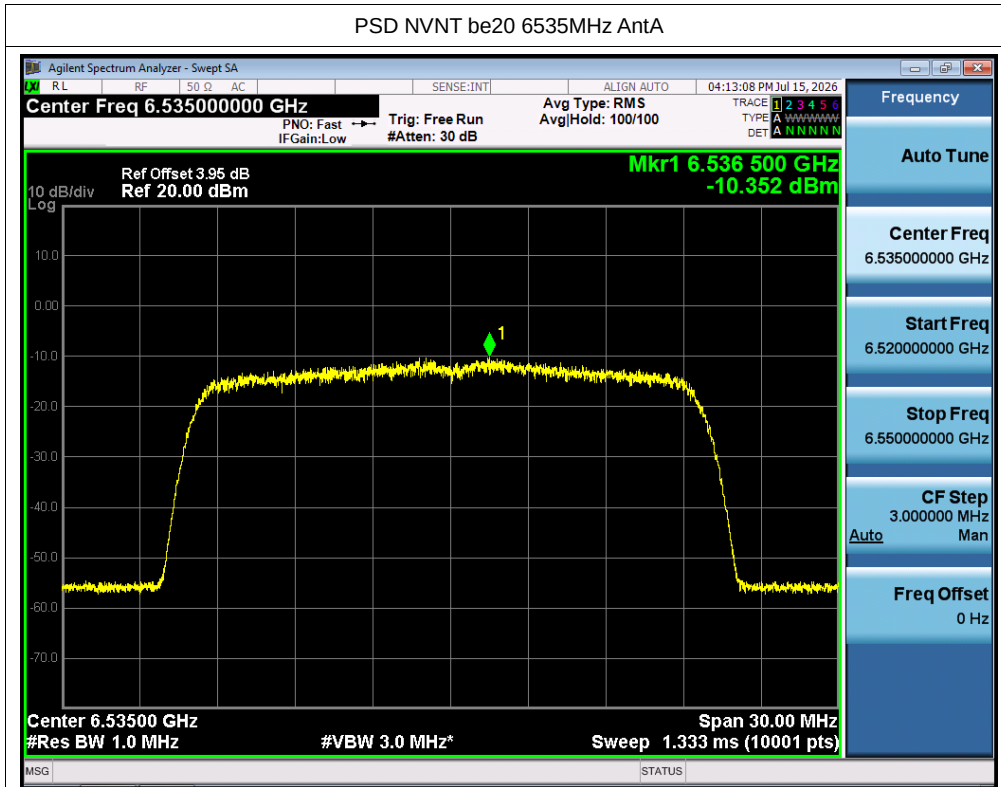

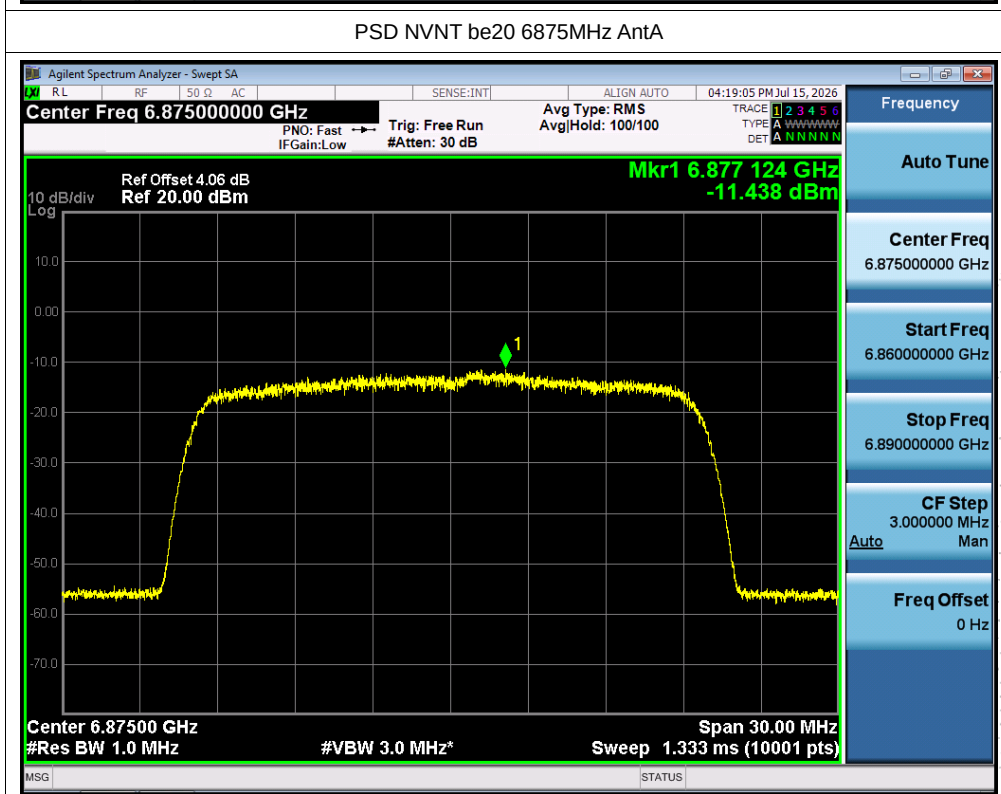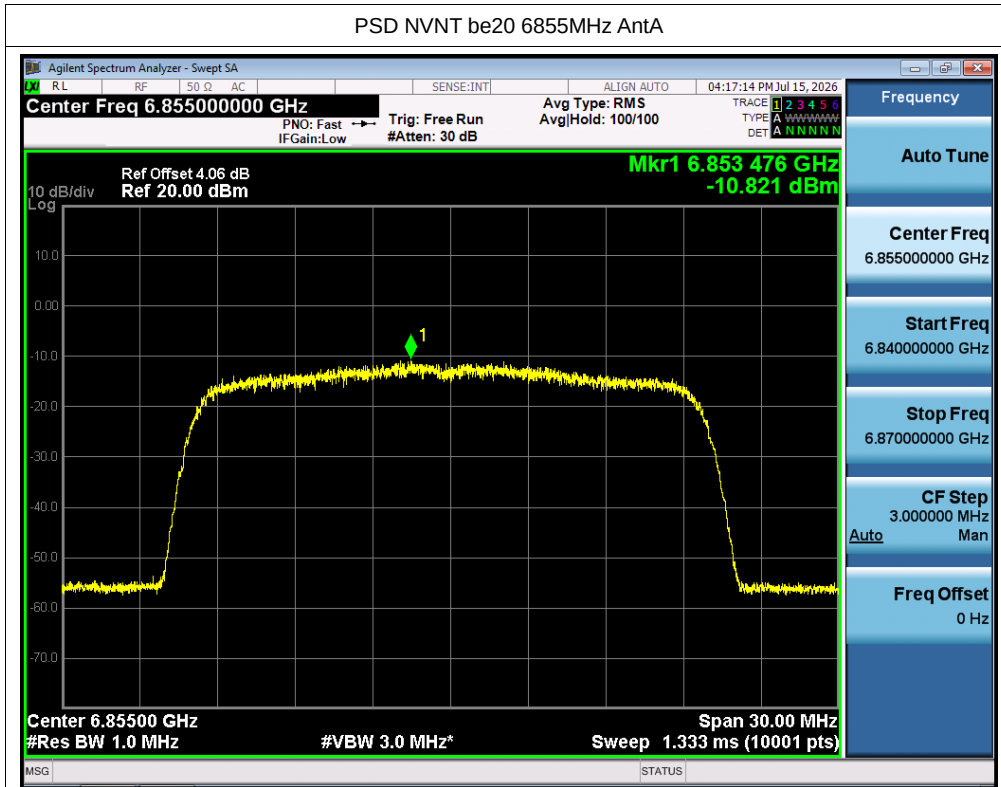



PSD NVNT be20 6895MHz Anta

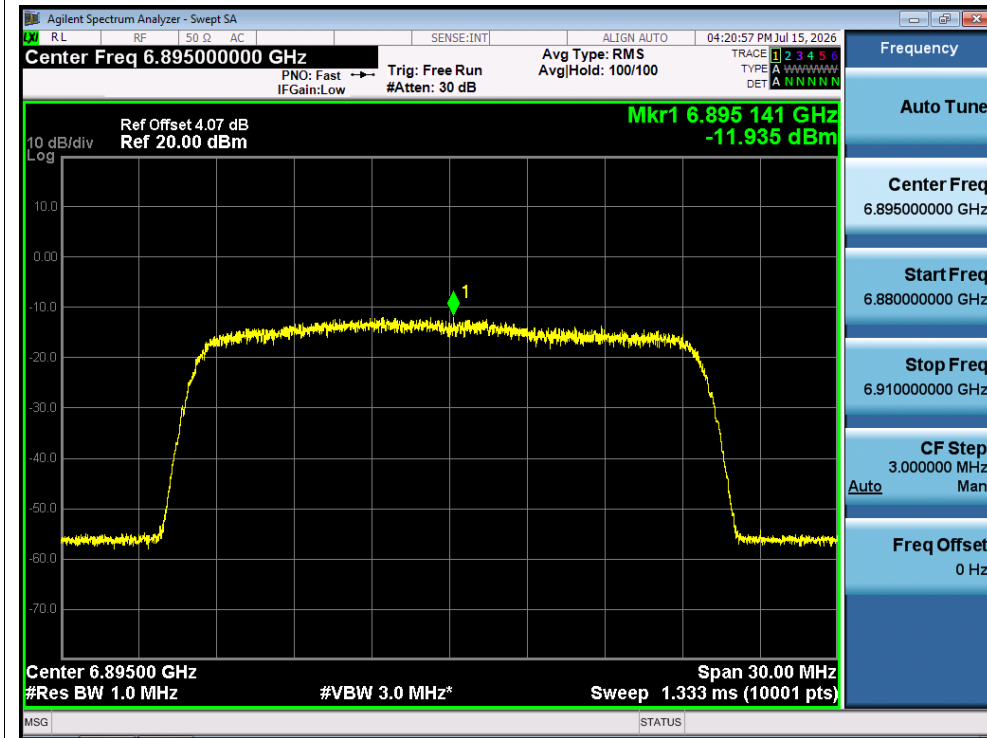

PSD NVNT be20 6995MHz Anta

