





## Duty Cycle NVNT ax20 6995MHz AntB

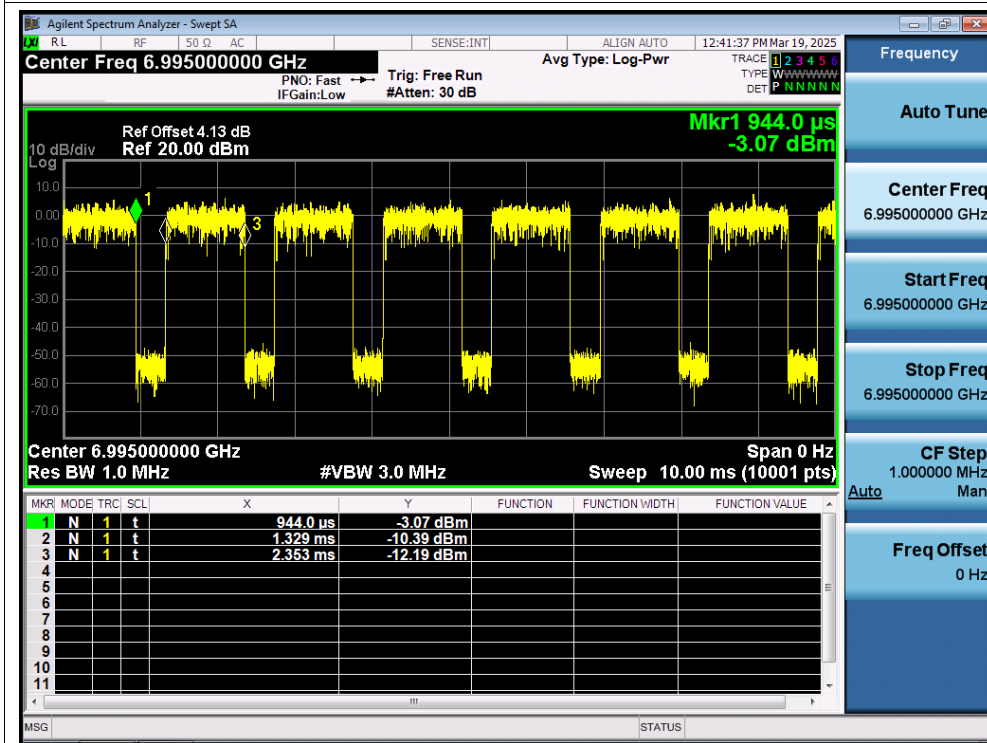


## Duty Cycle NVNT ax20 7115MHz AntB

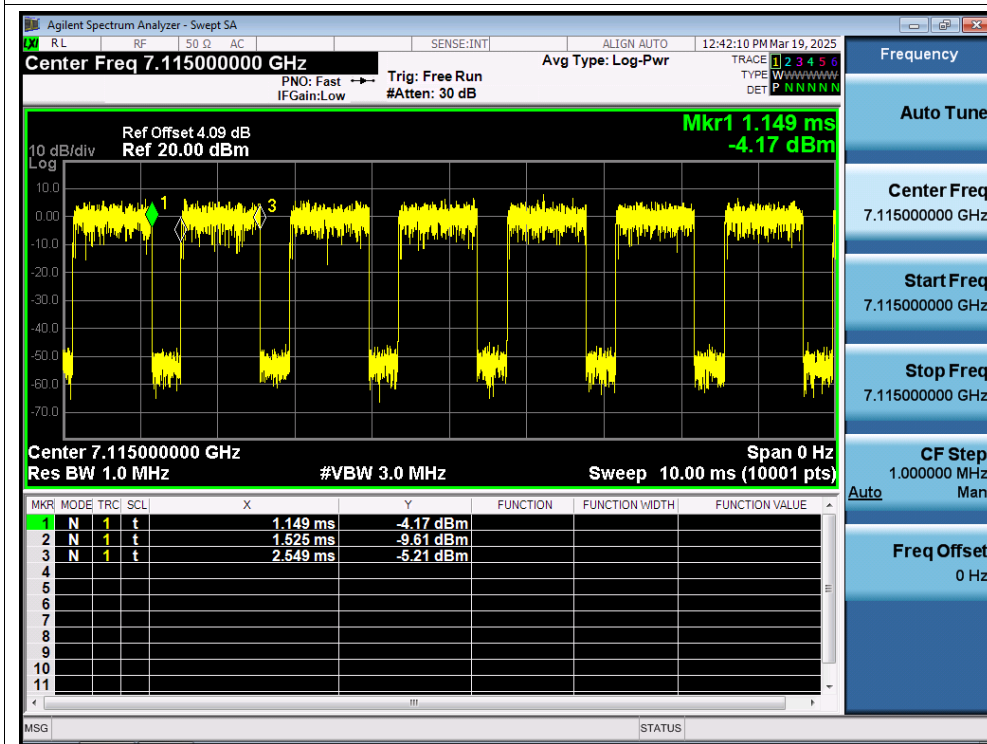




## Duty Cycle NVNT ax40 5965MHz AntA

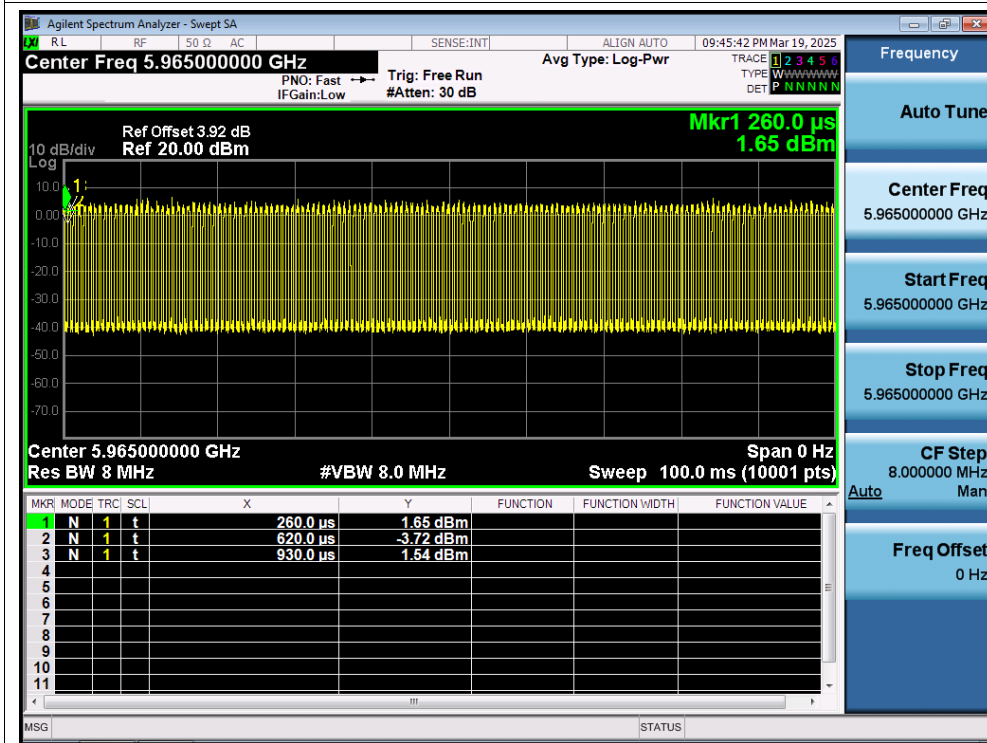


## Duty Cycle NVNT ax40 6165MHz AntA

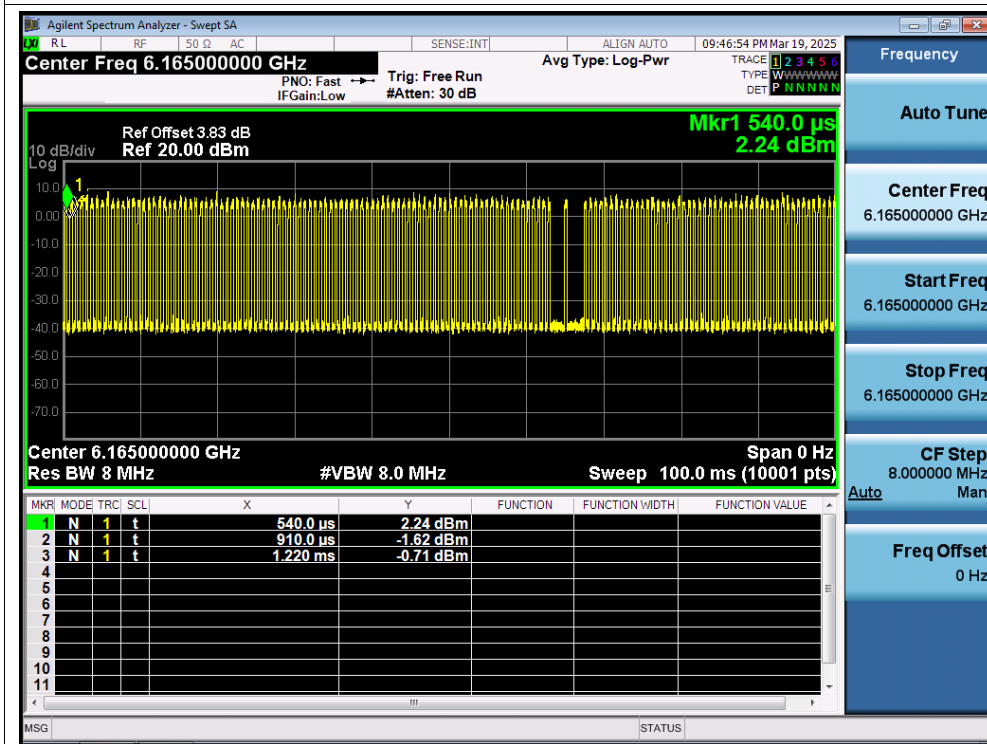




## Duty Cycle NVNT ax40 6405MHz AntA

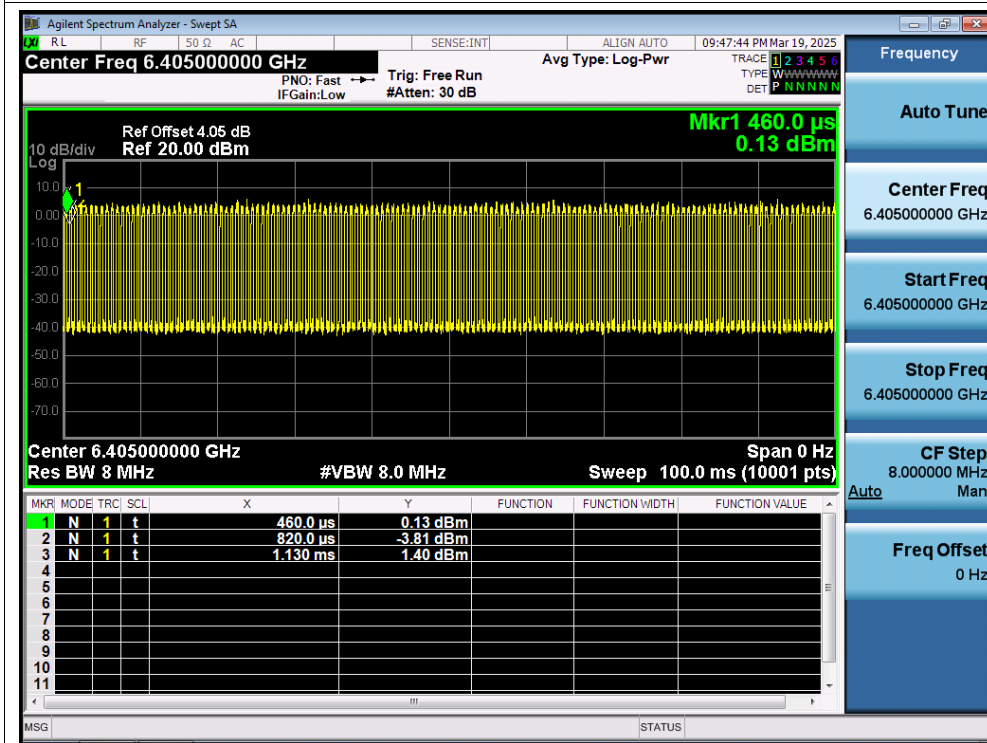


## Duty Cycle NVNT ax40 6445MHz AntA

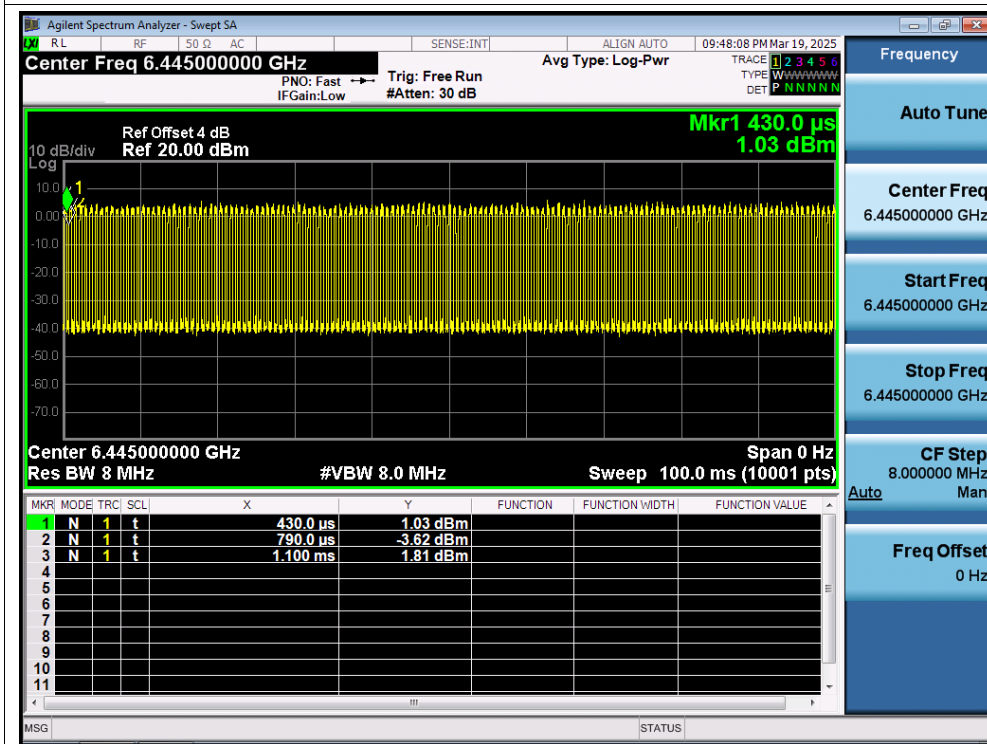




## Duty Cycle NVNT ax40 6485MHz AntA

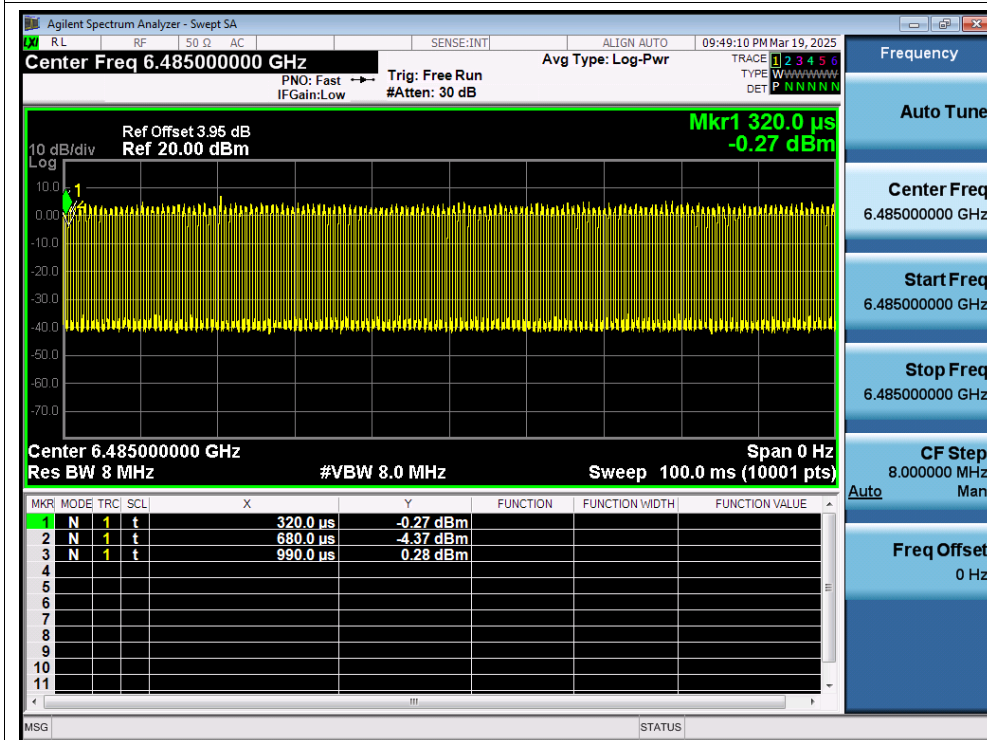


## Duty Cycle NVNT ax40 6525MHz AntA

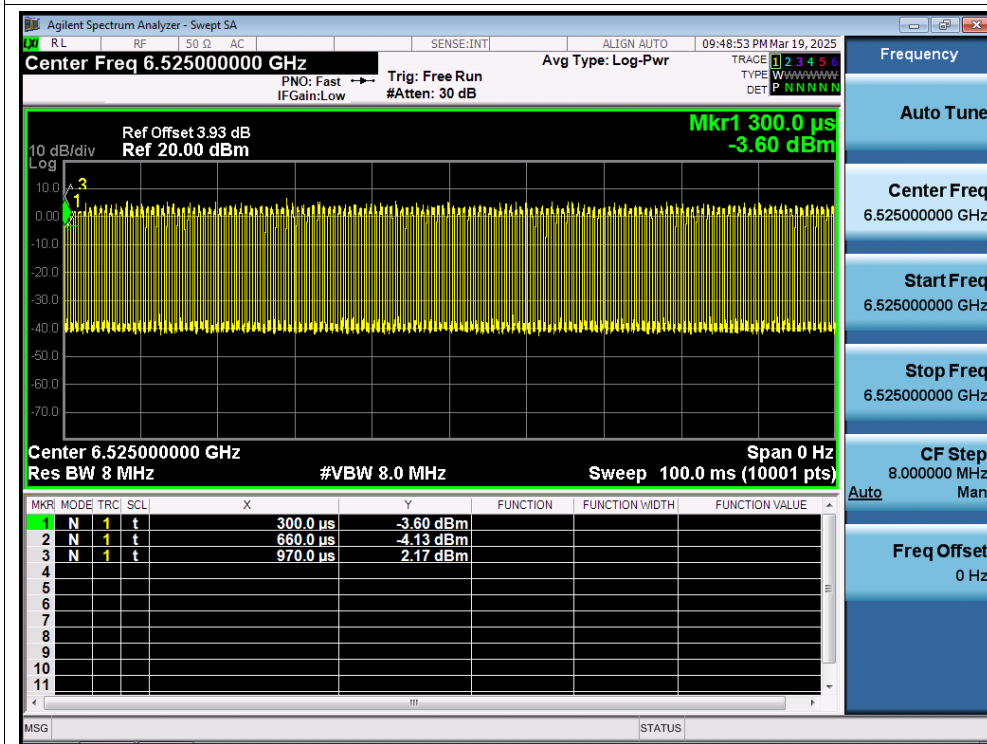




## Duty Cycle NVNT ax40 6565MHz AntA

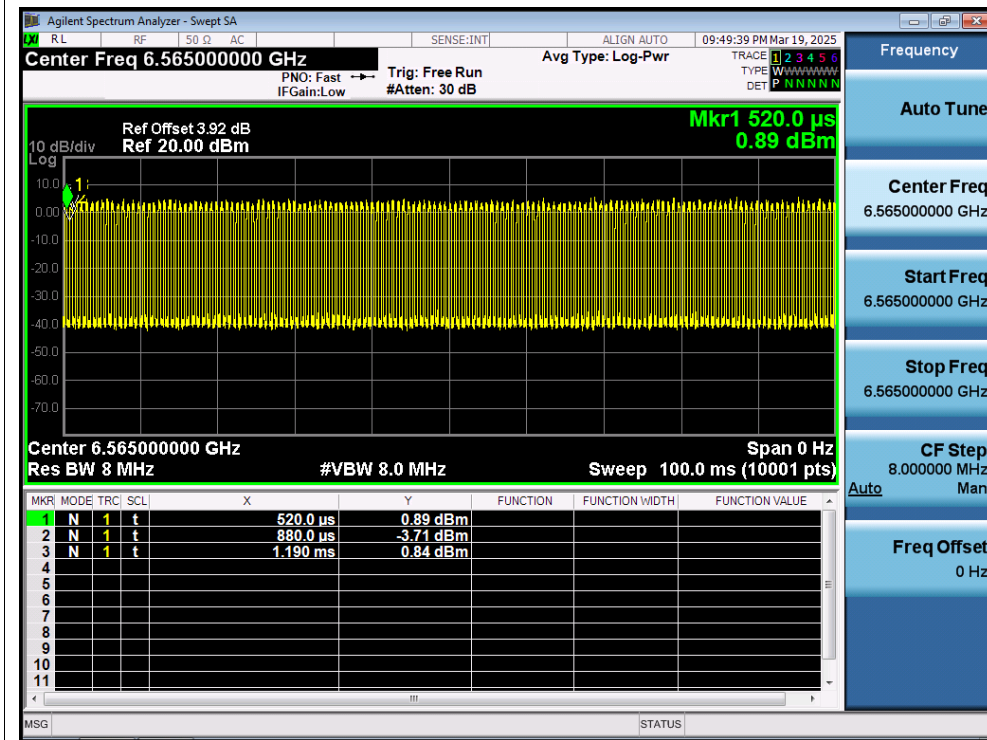


## Duty Cycle NVNT ax40 6685MHz AntA

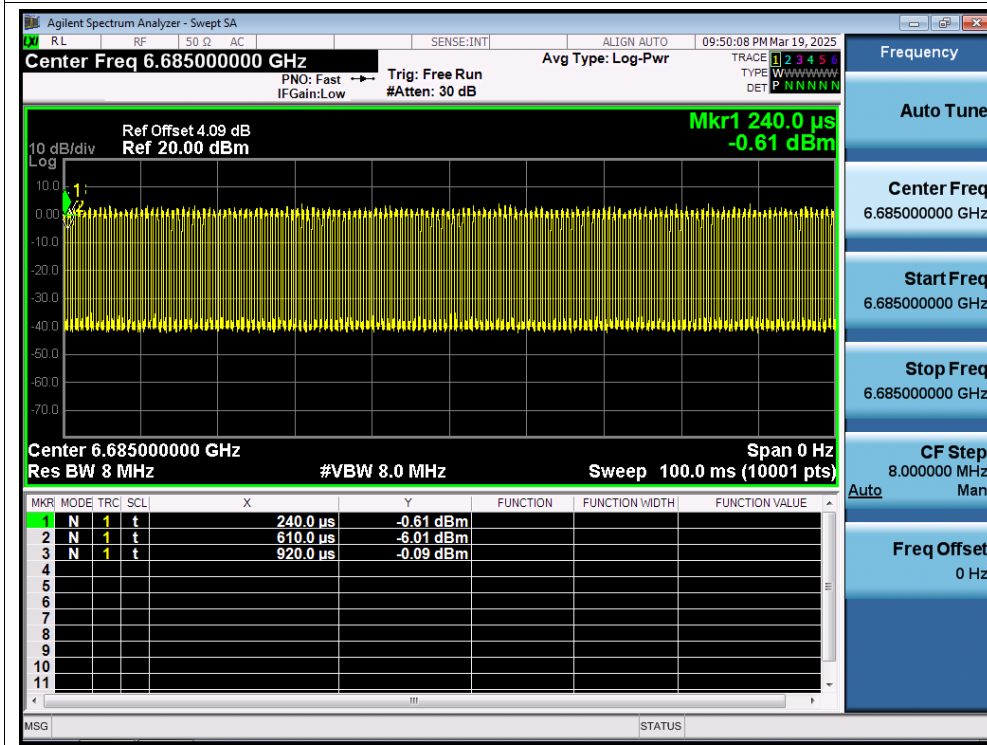




## Duty Cycle NVNT ax40 6845MHz AntA

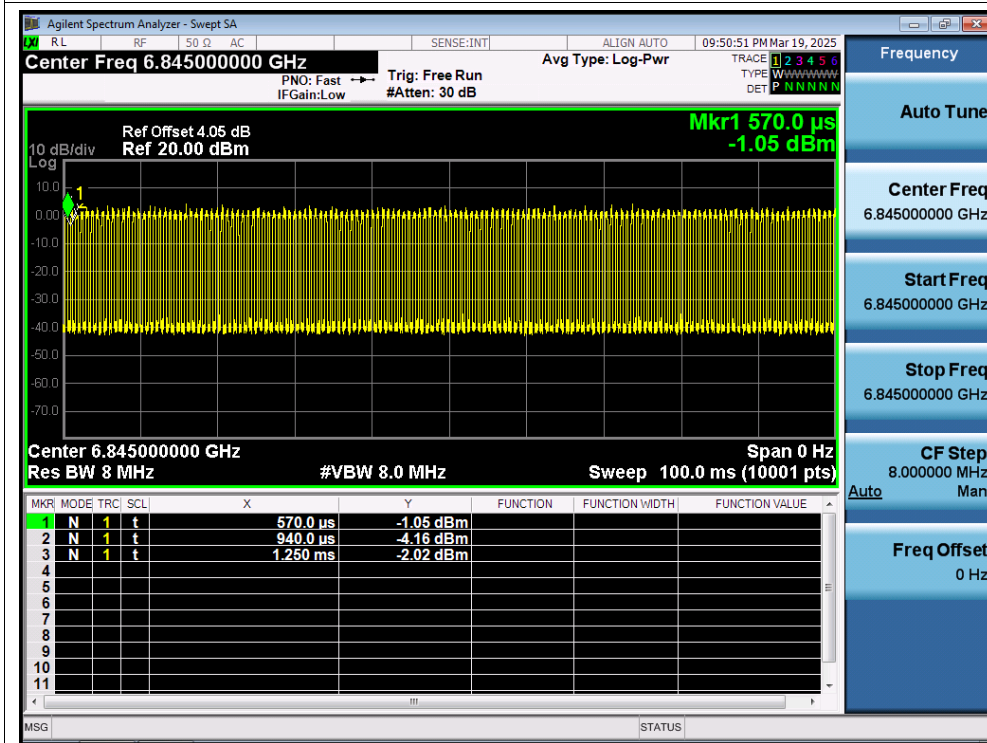


## Duty Cycle NVNT ax40 6885MHz AntA

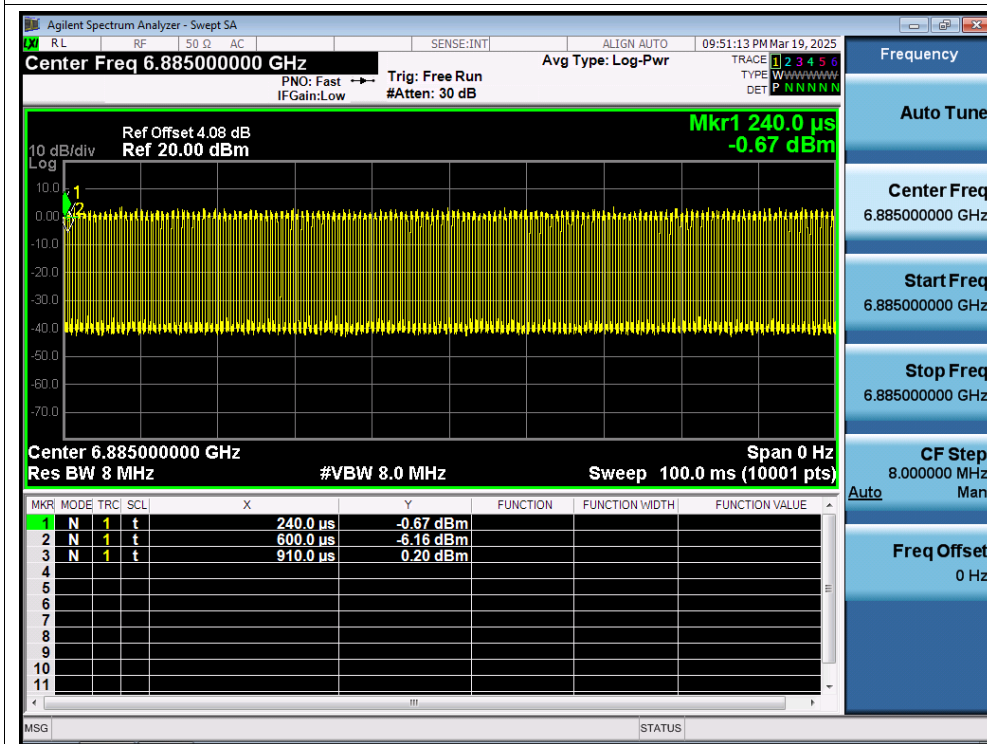




## Duty Cycle NVNT ax40 6925MHz AntA

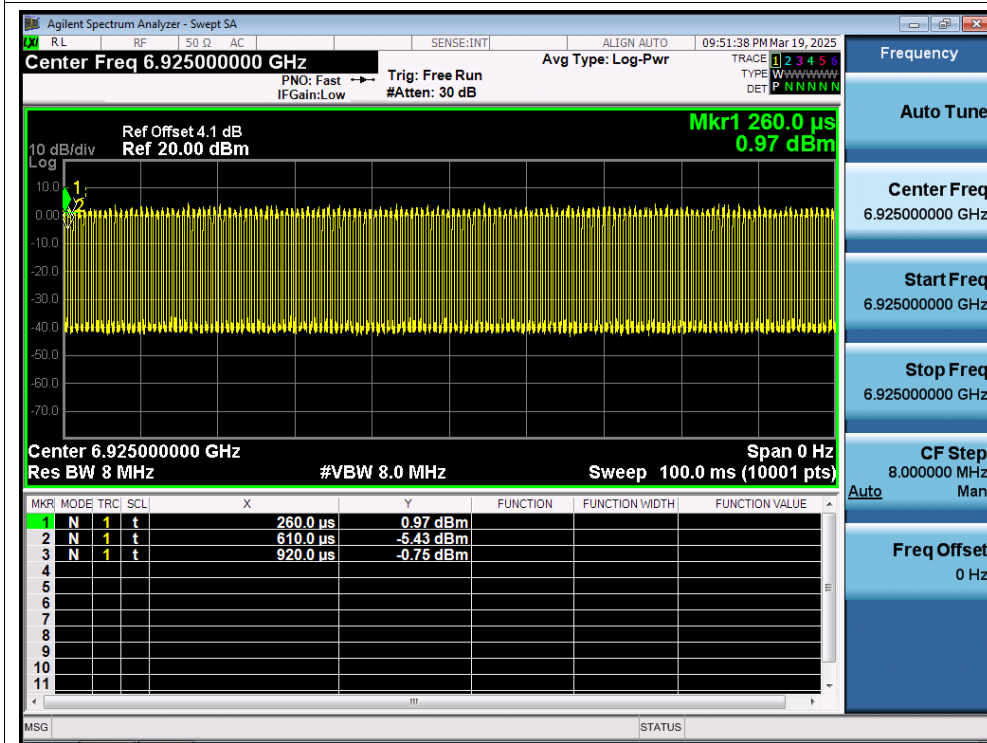


## Duty Cycle NVNT ax40 6965MHz AntA

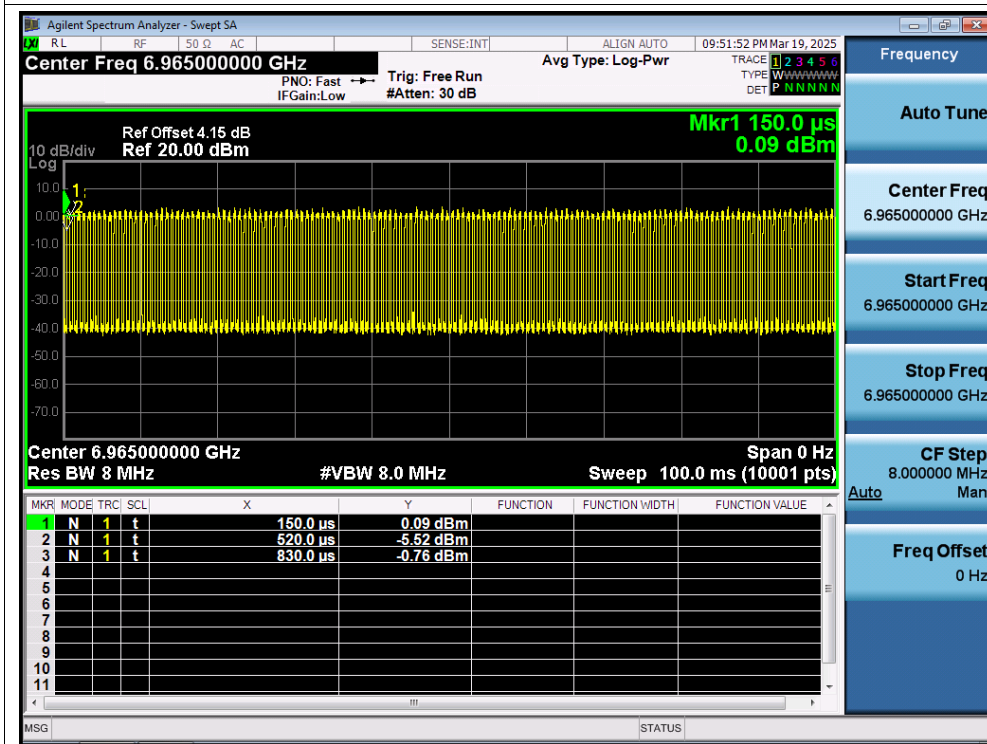




## Duty Cycle NVNT ax40 7085MHz AntA

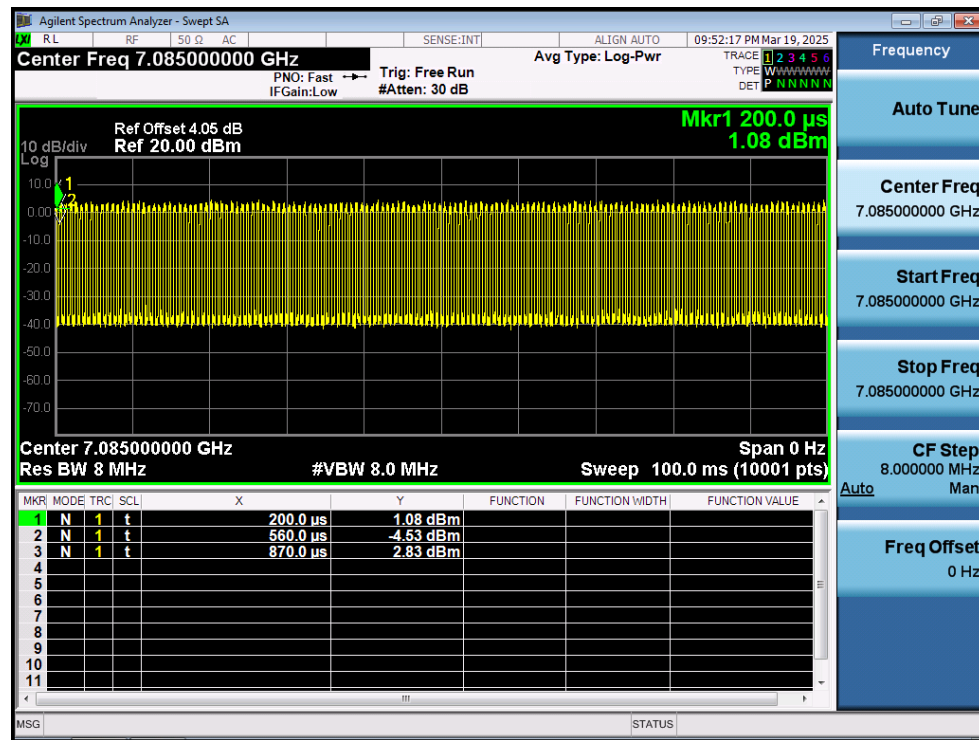


## Duty Cycle NVNT ax40 5965MHz AntB

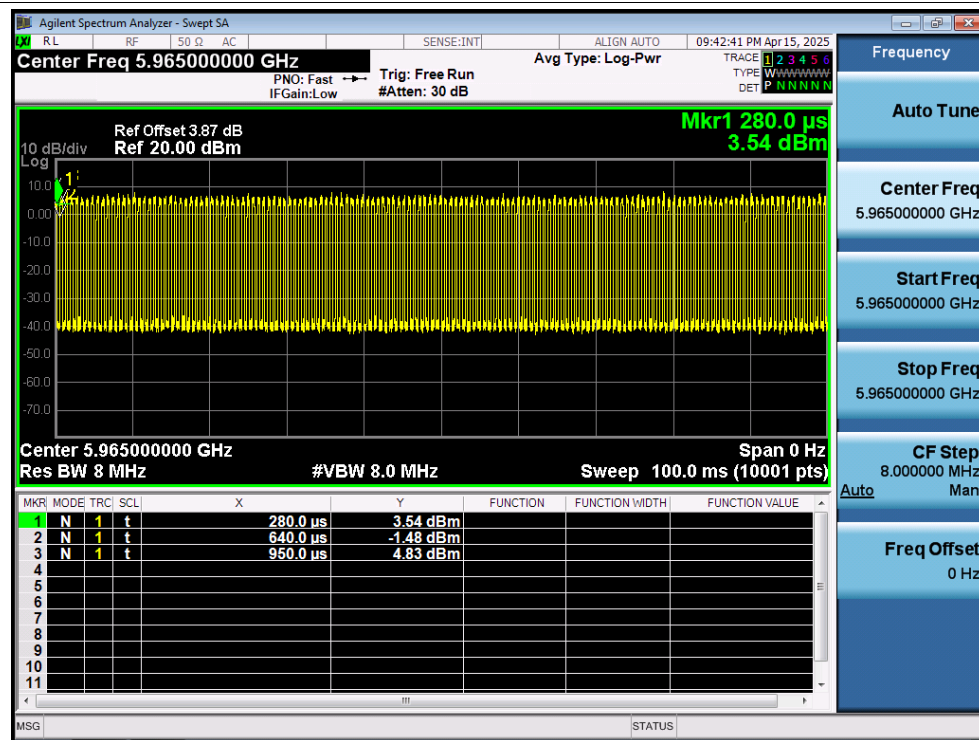




## Duty Cycle NVNT ax40 6165MHz AntB

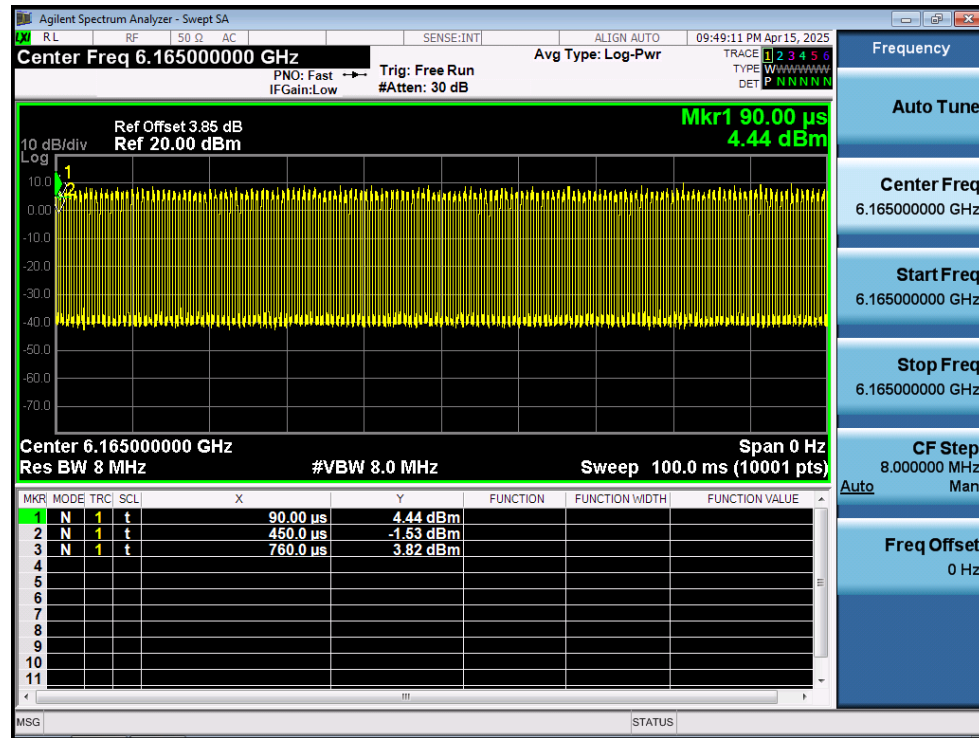


## Duty Cycle NVNT ax40 6405MHz AntB

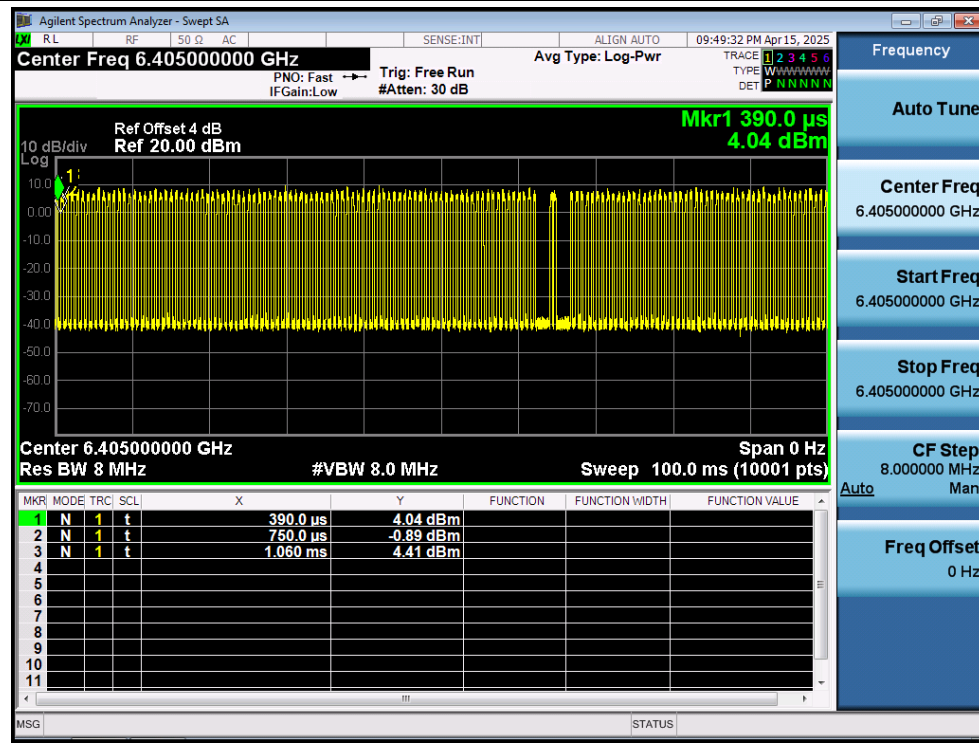




## Duty Cycle NVNT ax40 6445MHz AntB

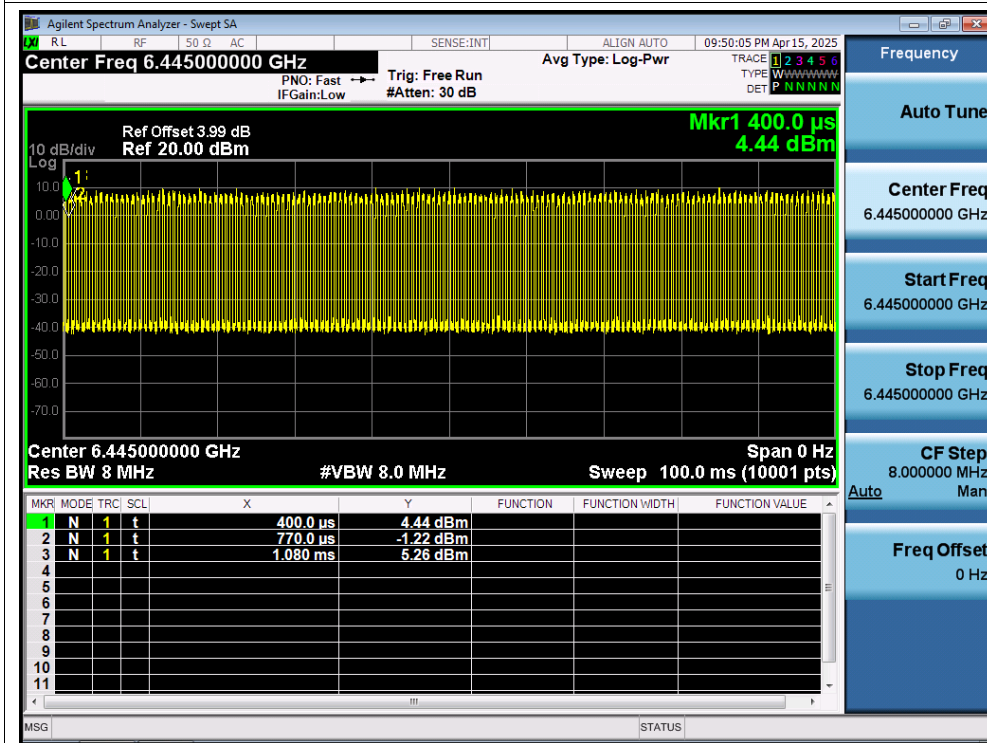


## Duty Cycle NVNT ax40 6485MHz AntB

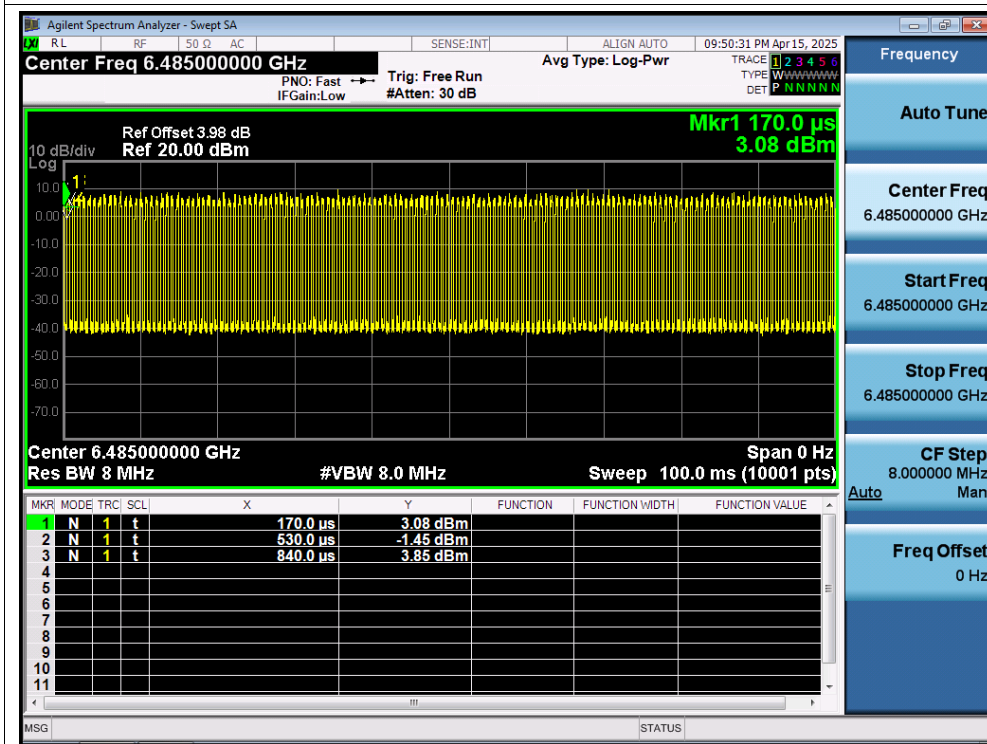




## Duty Cycle NVNT ax40 6525MHz AntB

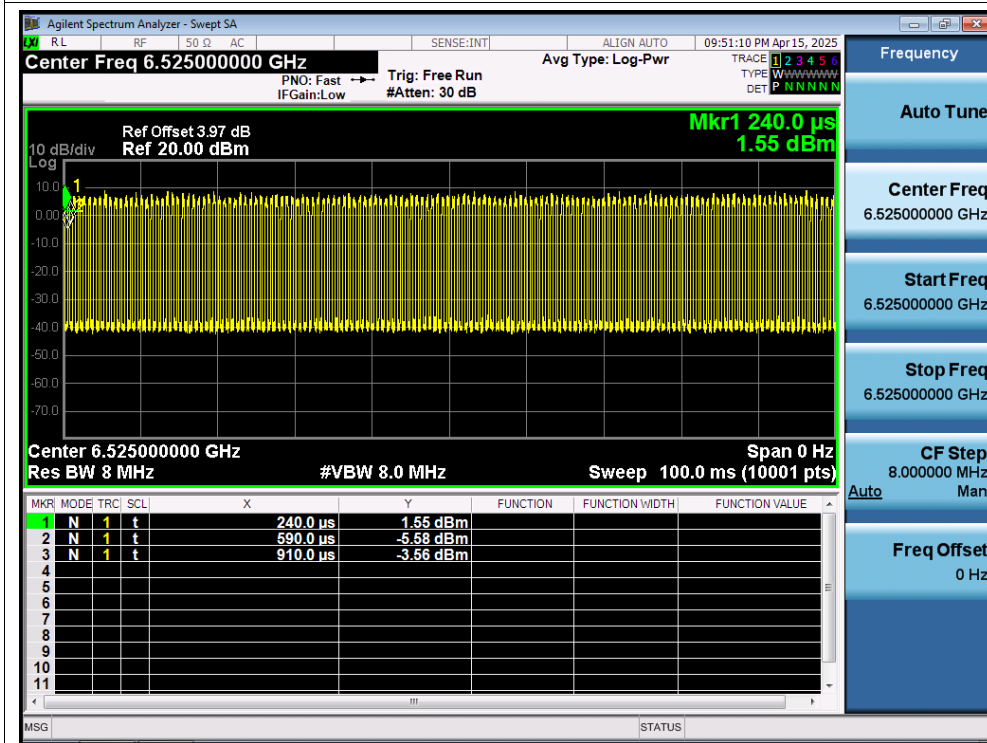


## Duty Cycle NVNT ax40 6565MHz AntB

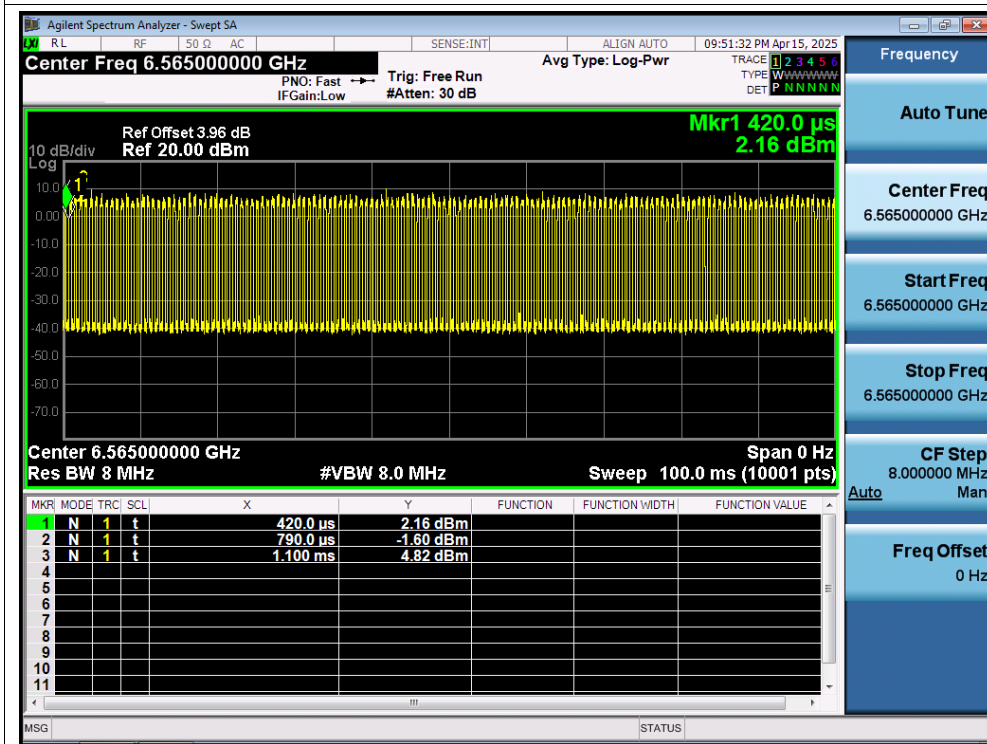




## Duty Cycle NVNT ax40 6685MHz AntB

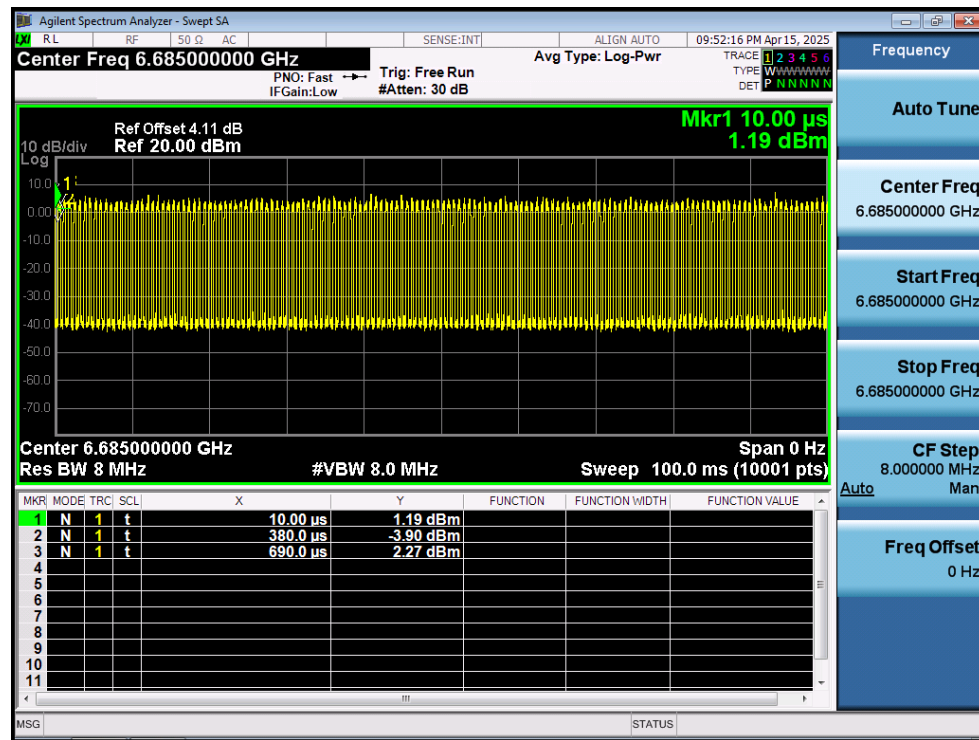


## Duty Cycle NVNT ax40 6845MHz AntB

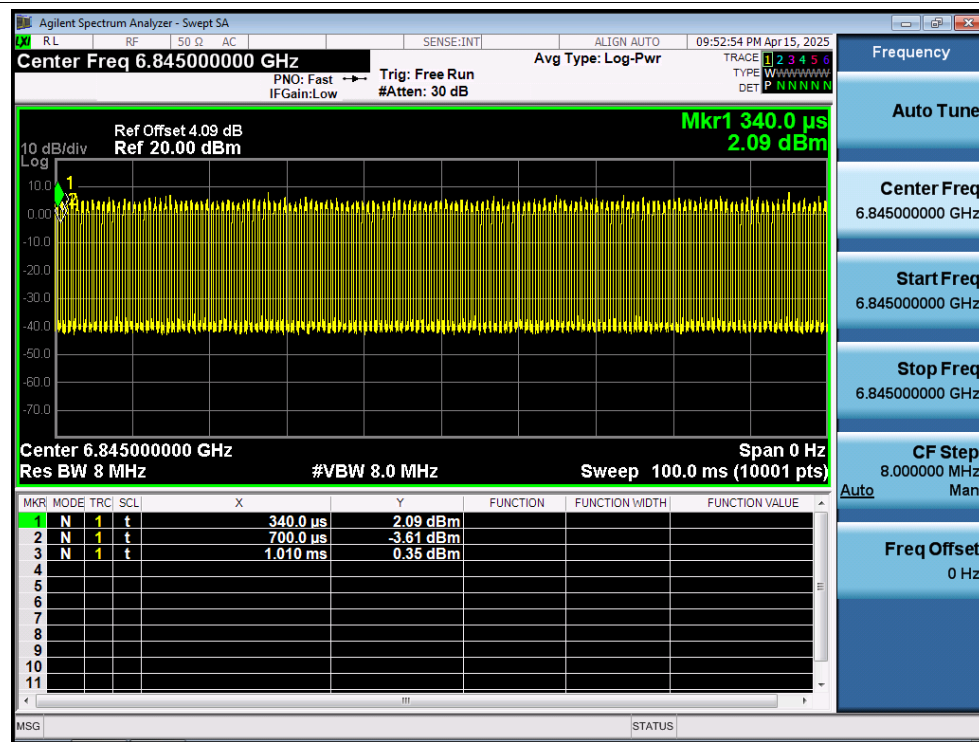




## Duty Cycle NVNT ax40 6885MHz AntB

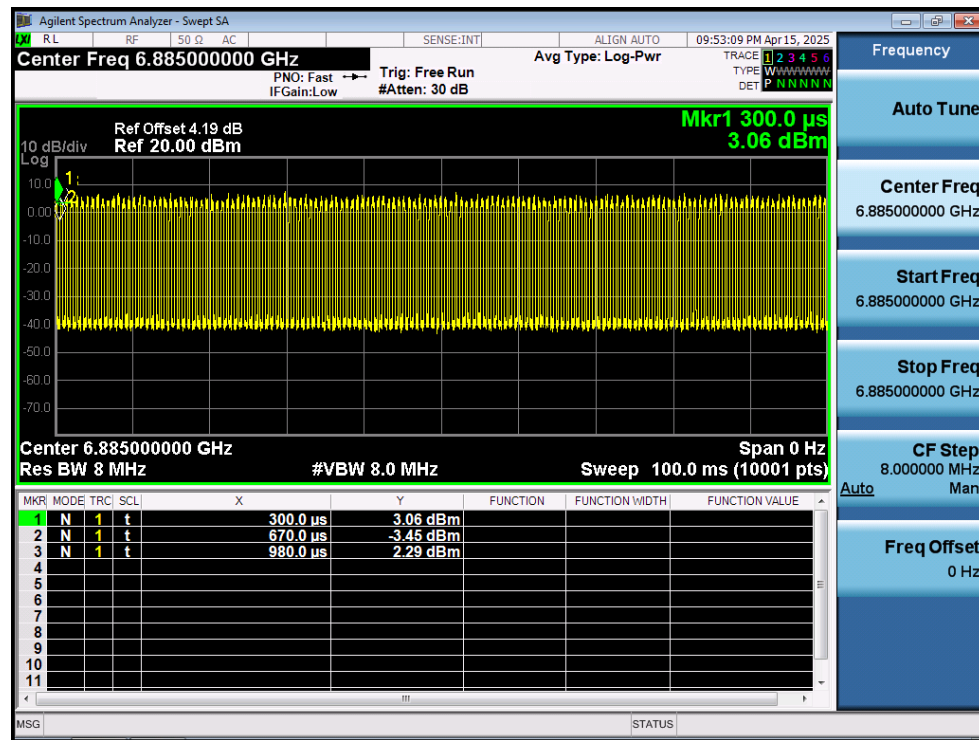


## Duty Cycle NVNT ax40 6925MHz AntB

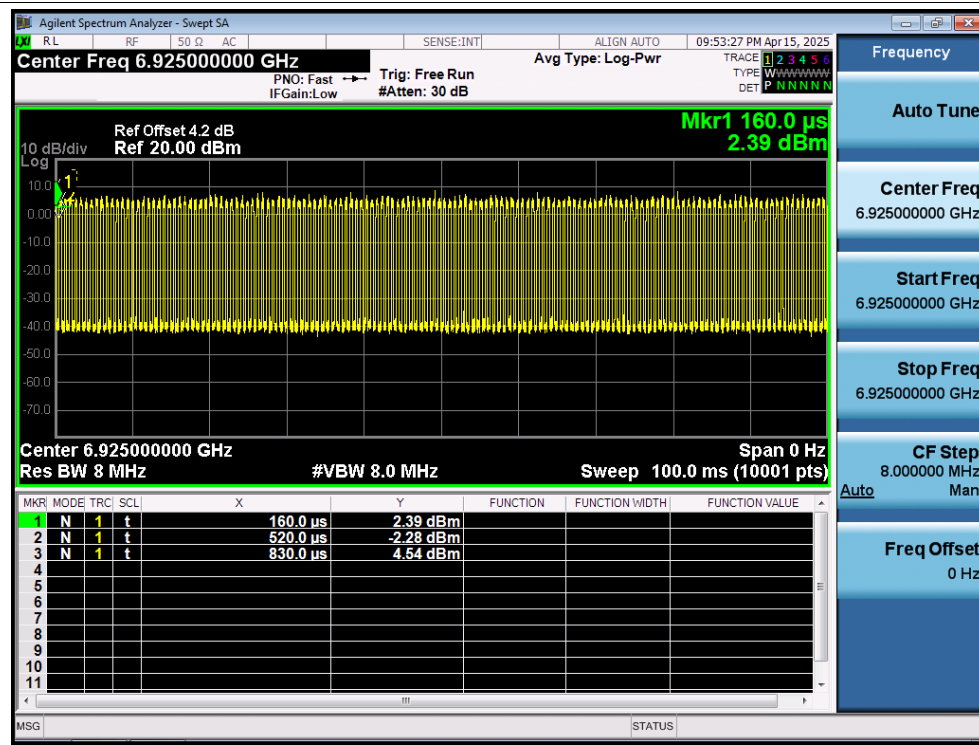




## Duty Cycle NVNT ax40 6965MHz AntB

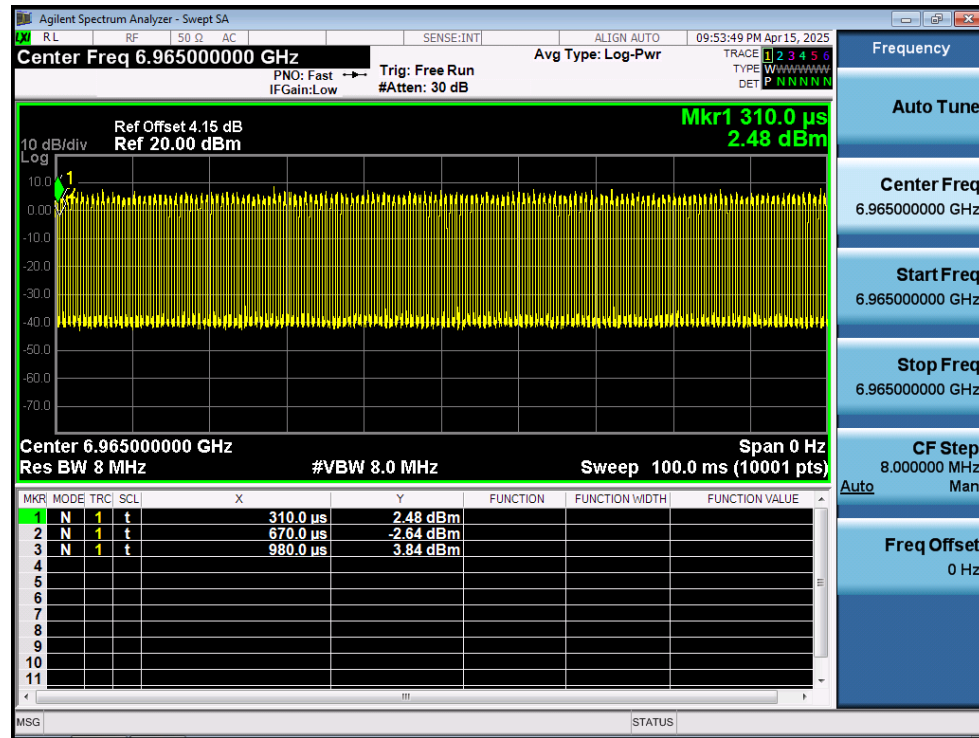


## Duty Cycle NVNT ax40 7085MHz AntB

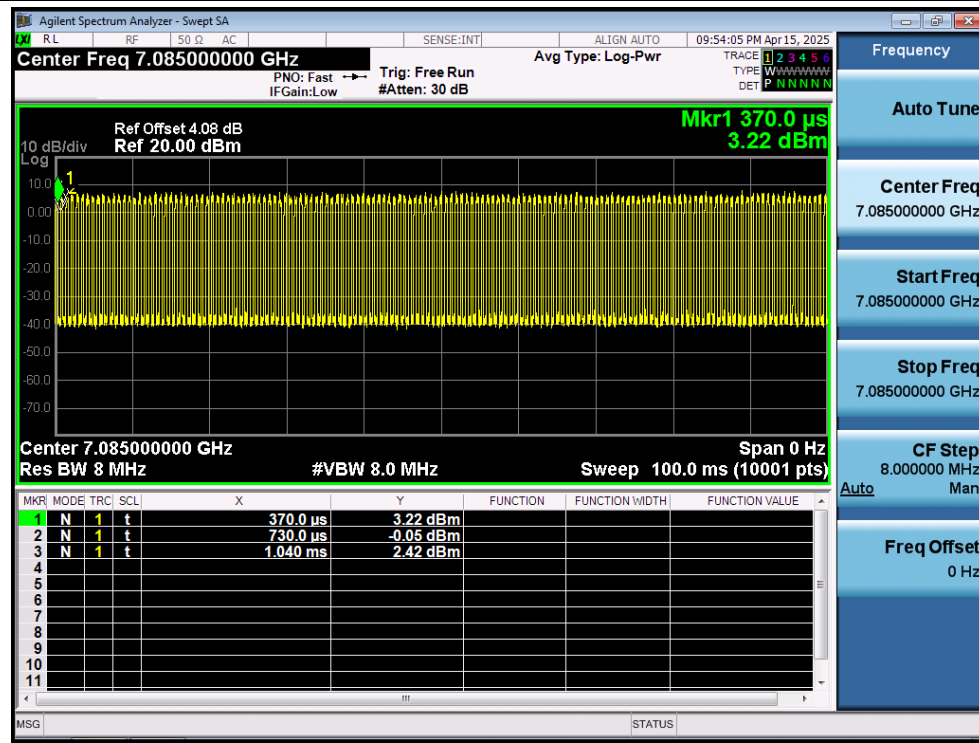




## Duty Cycle NVNT ax80 5985MHz AntA

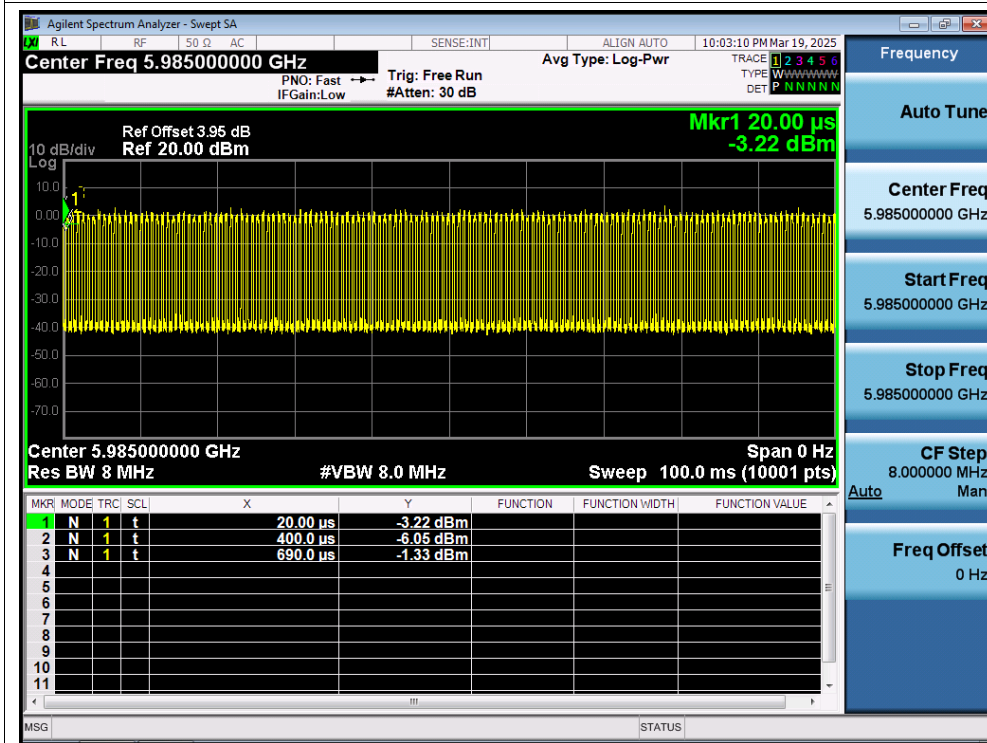


## Duty Cycle NVNT ax80 6145MHz AntA

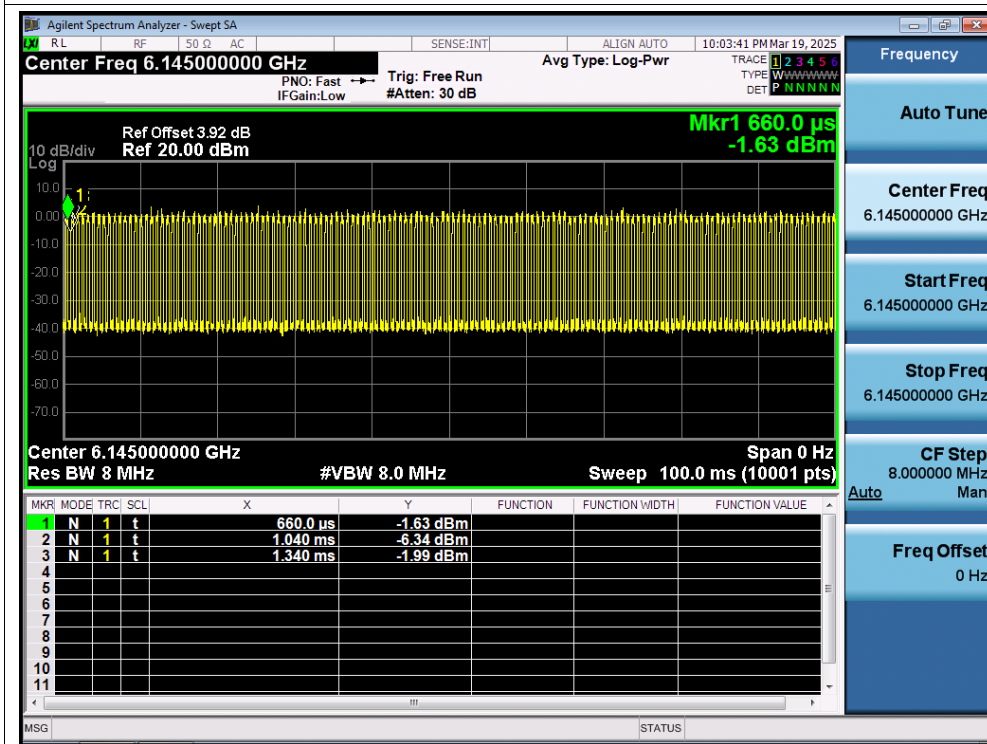




## Duty Cycle NVNT ax80 6385MHz AntA

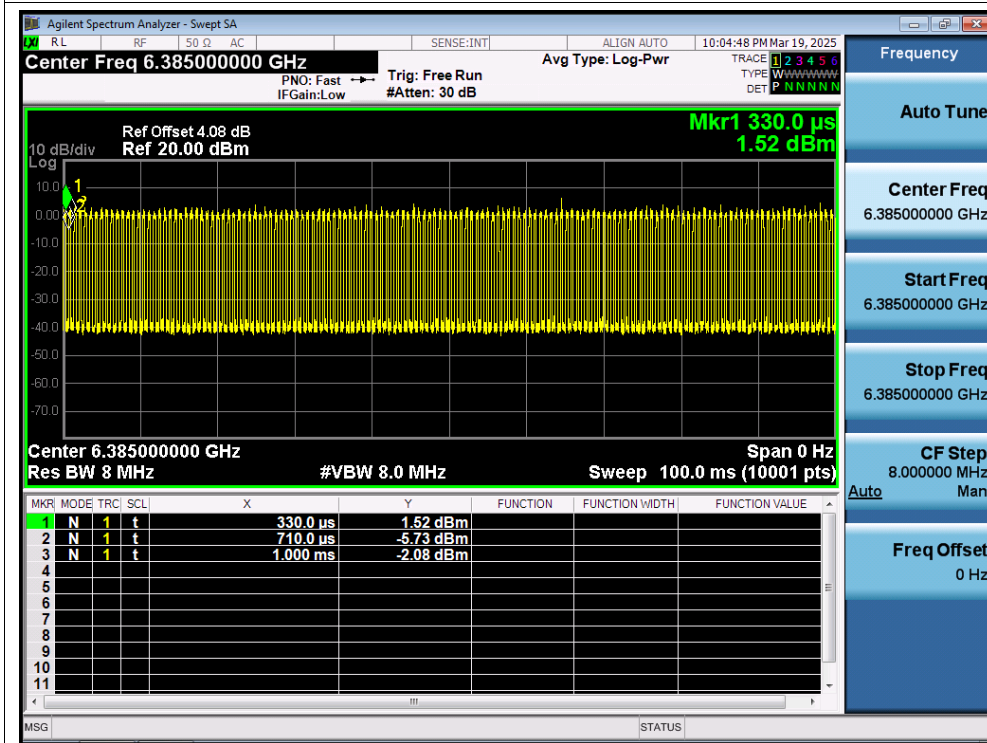


## Duty Cycle NVNT ax80 6465MHz AntA

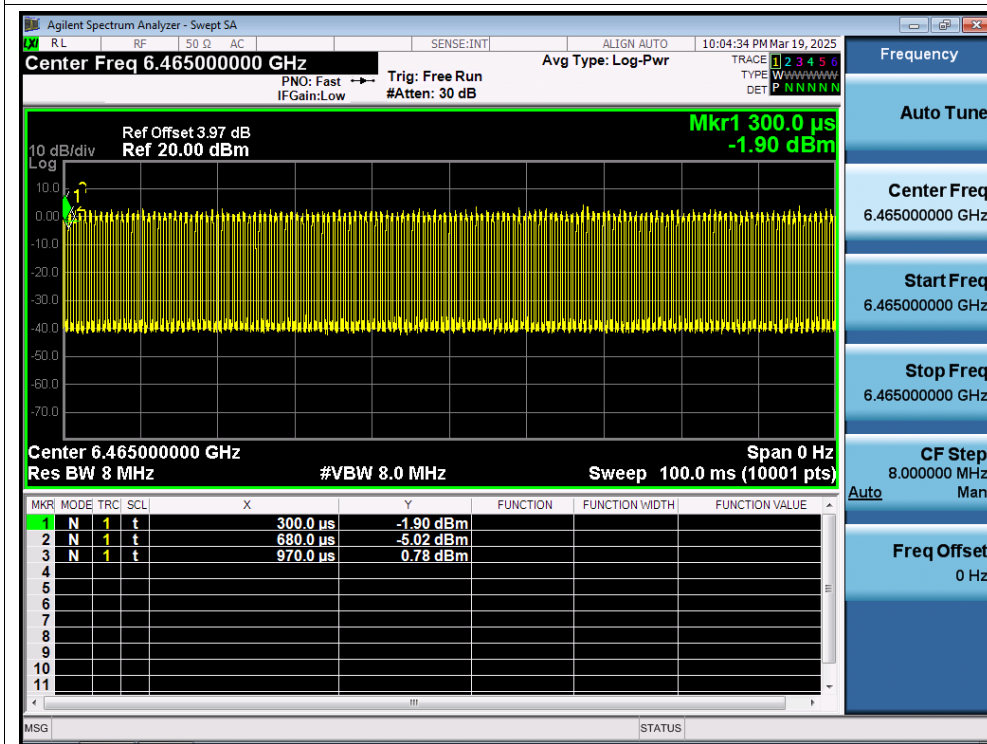




## Duty Cycle NVNT ax80 6545MHz AntA

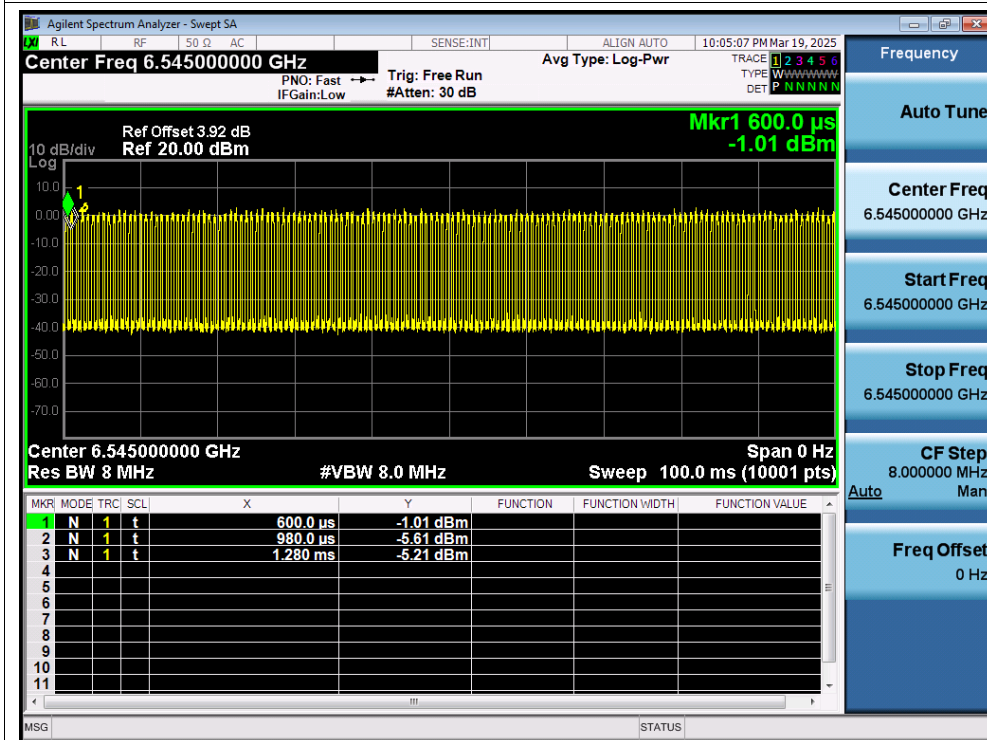


## Duty Cycle NVNT ax80 6625MHz AntA

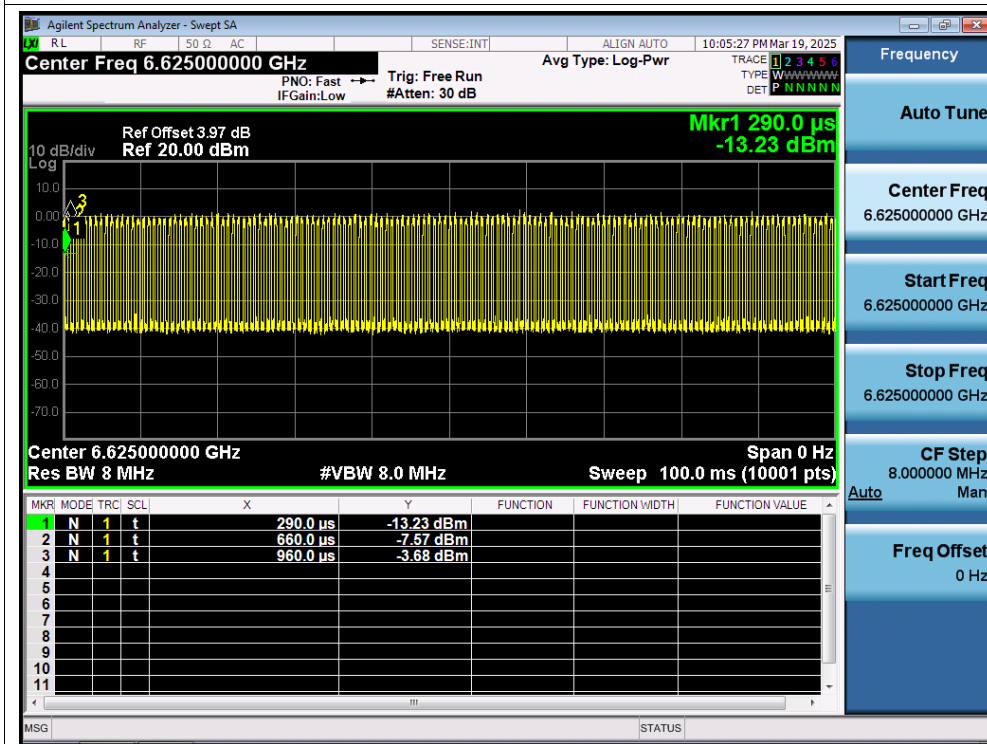




## Duty Cycle NVNT ax80 6705MHz AntA

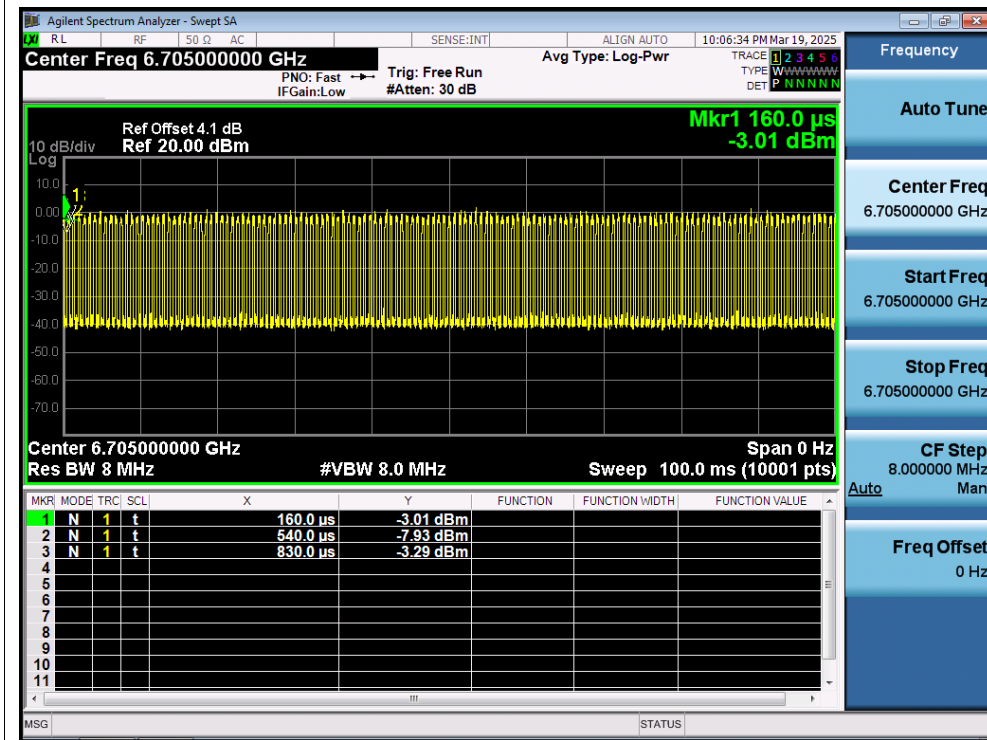


## Duty Cycle NVNT ax80 6785MHz AntA

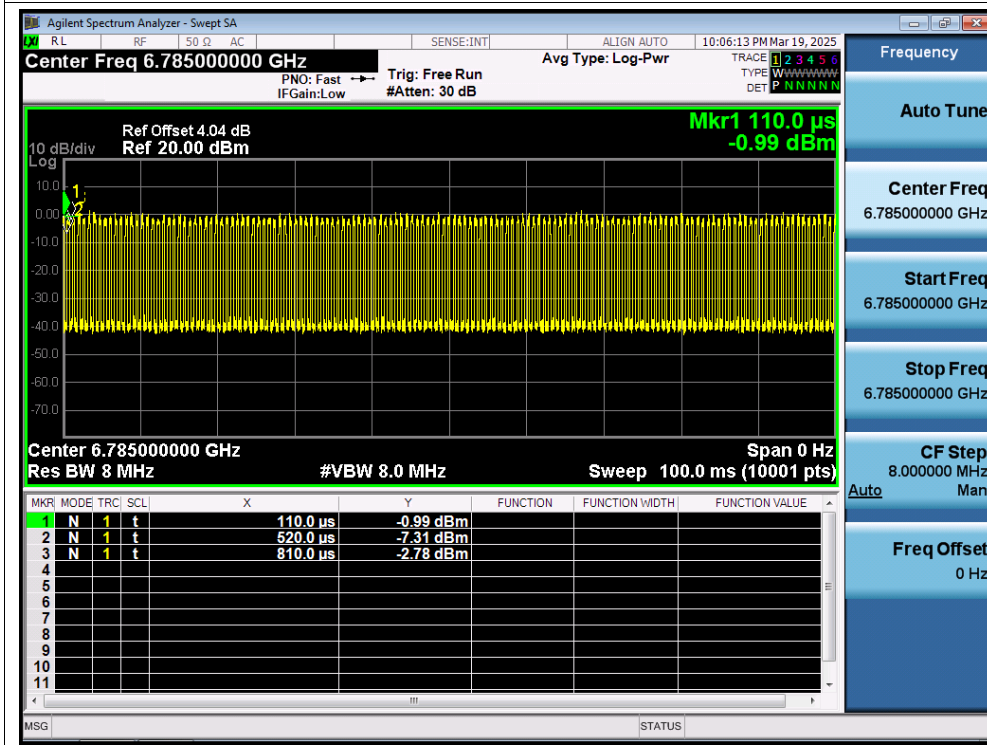




## Duty Cycle NVNT ax80 6865MHz AntA

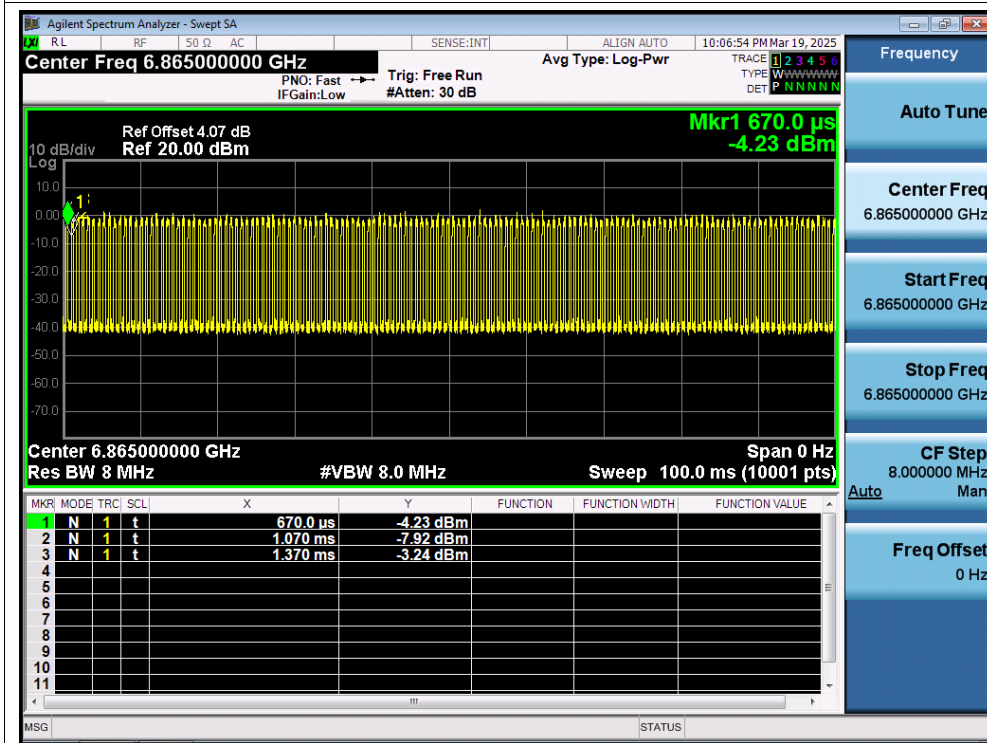


## Duty Cycle NVNT ax80 6945MHz AntA

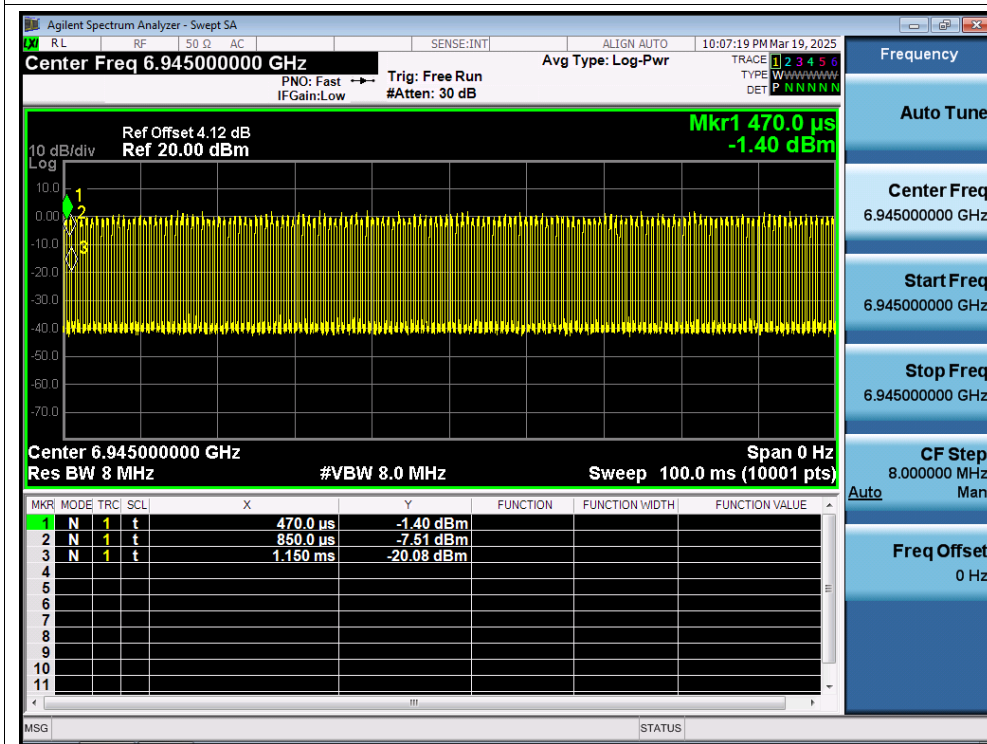




## Duty Cycle NVNT ax80 7025MHz AntA

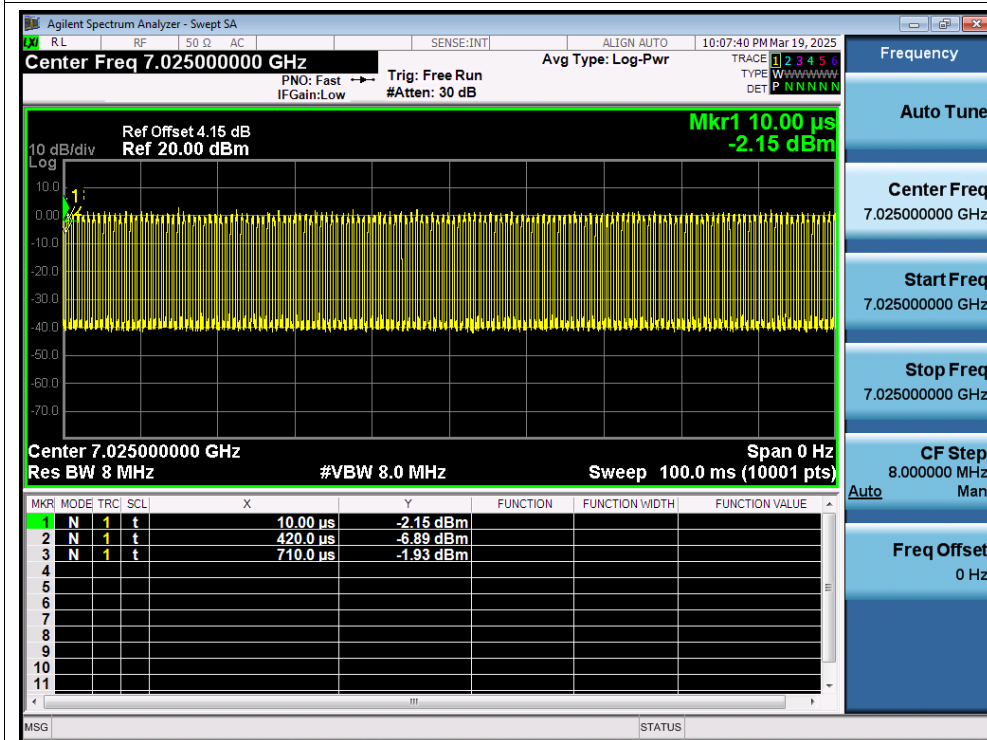


## Duty Cycle NVNT ax80 5985MHz AntB

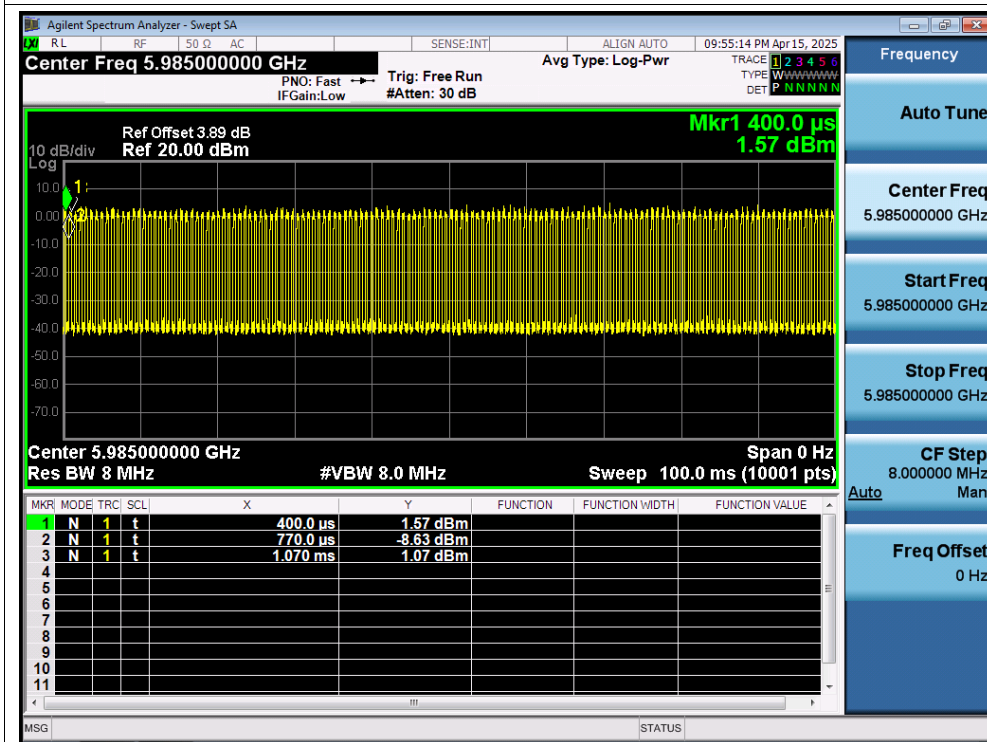




## Duty Cycle NVNT ax80 6145MHz AntB

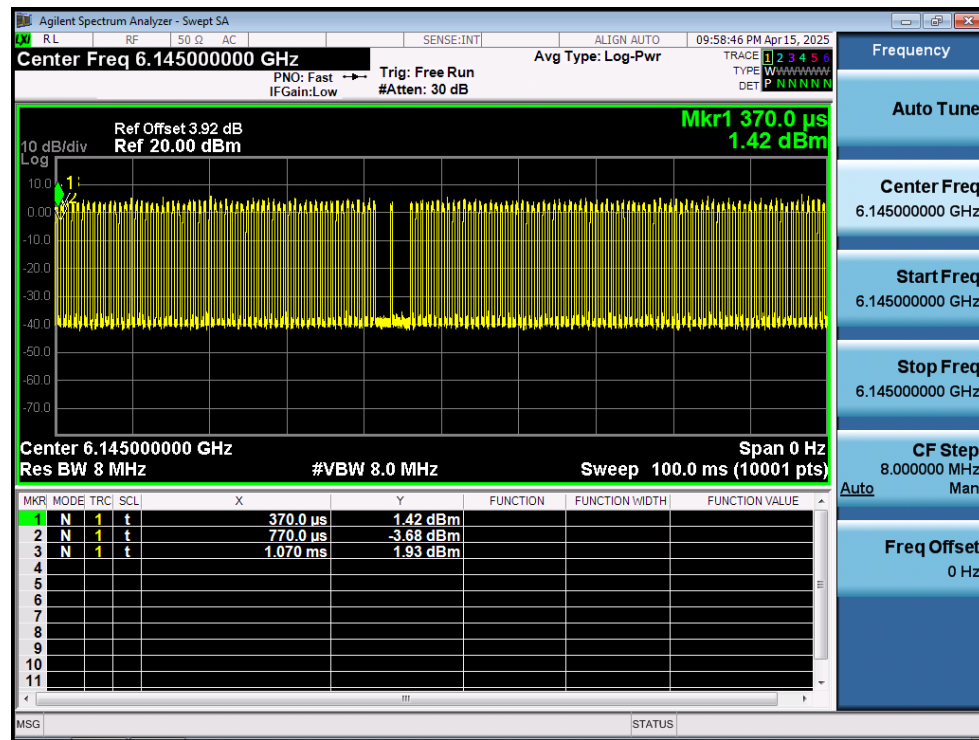


## Duty Cycle NVNT ax80 6385MHz AntB

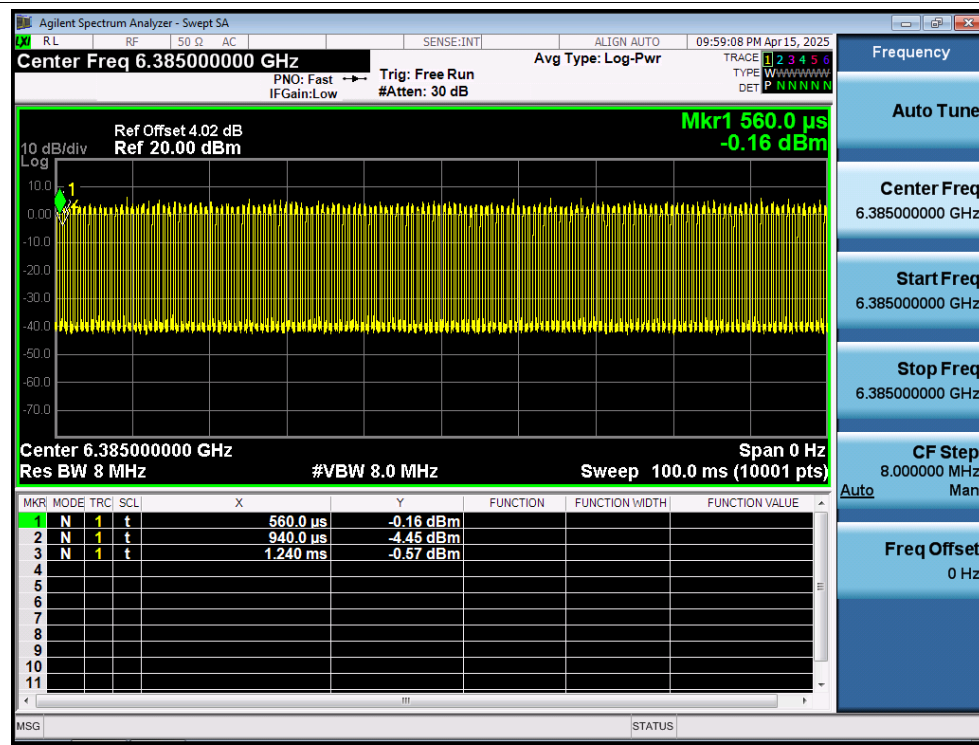




## Duty Cycle NVNT ax80 6465MHz AntB

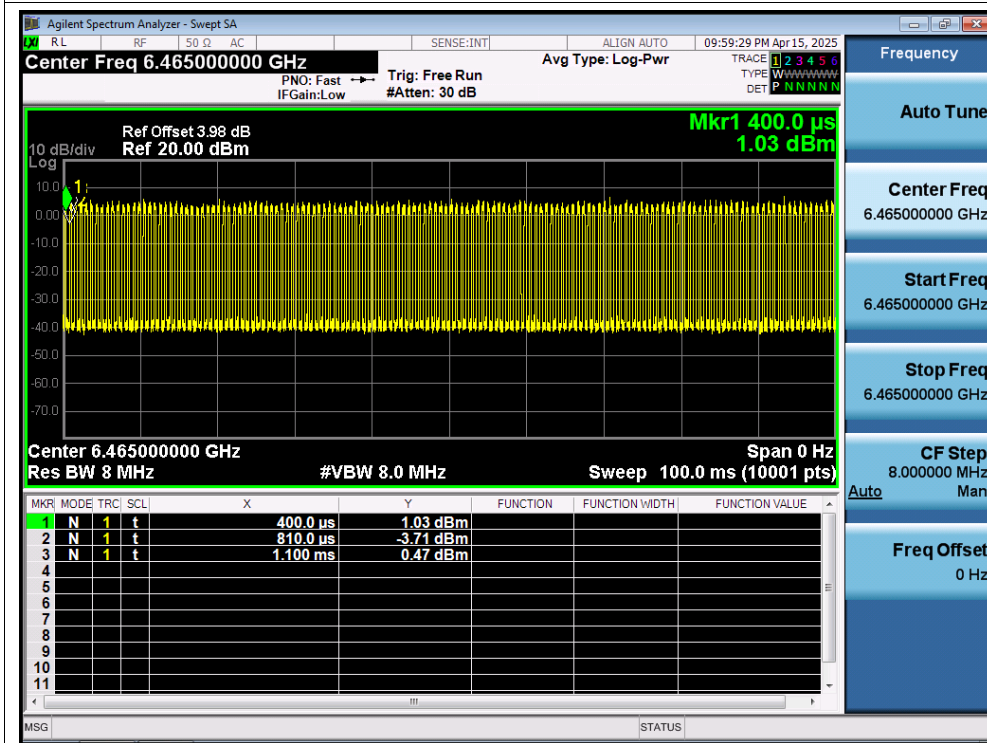


## Duty Cycle NVNT ax80 6545MHz AntB

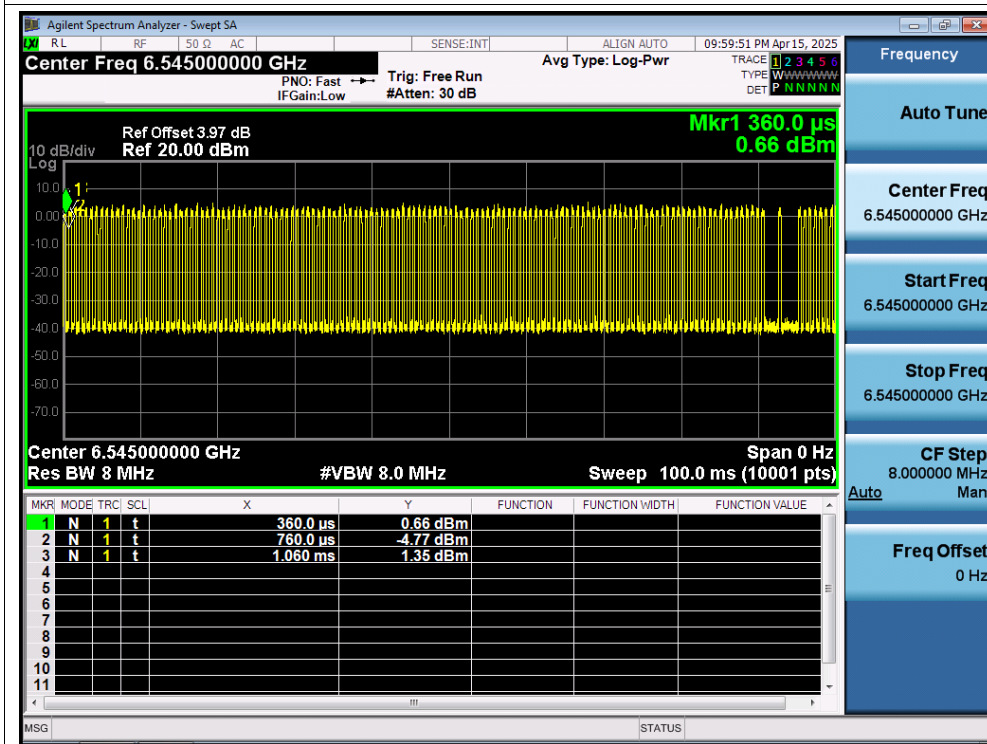




## Duty Cycle NVNT ax80 6625MHz AntB

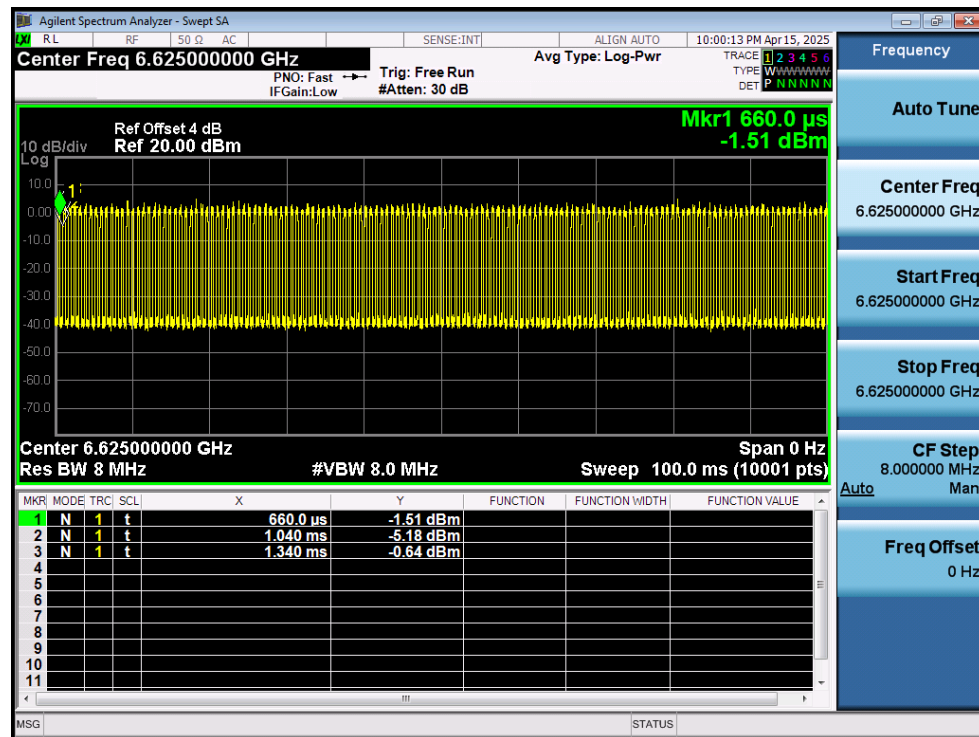


## Duty Cycle NVNT ax80 6705MHz AntB

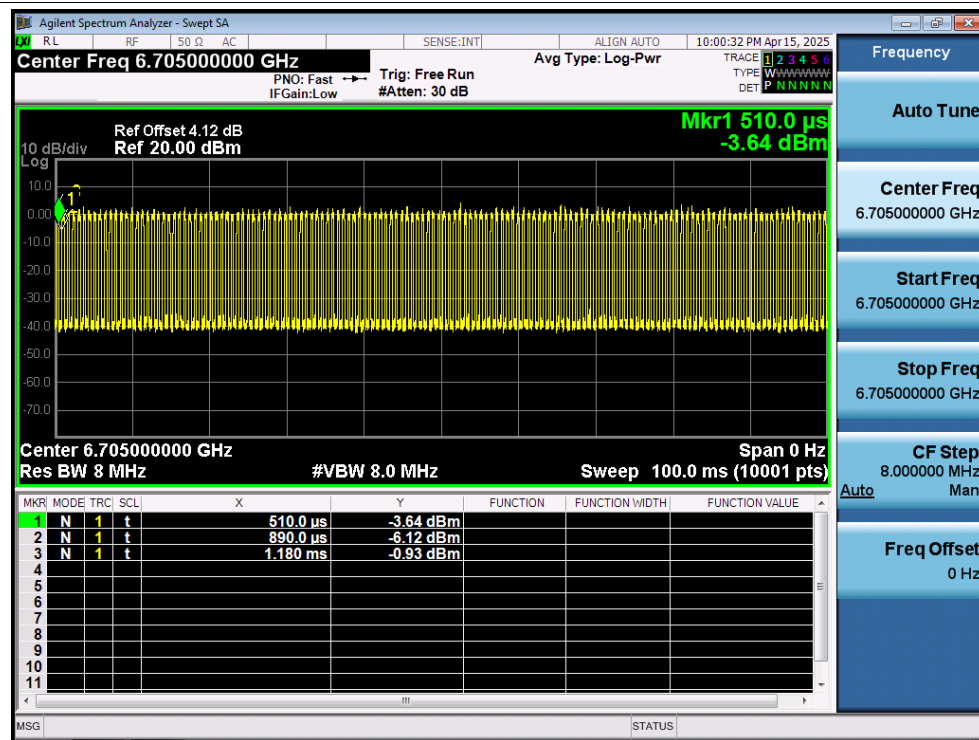




## Duty Cycle NVNT ax80 6785MHz AntB

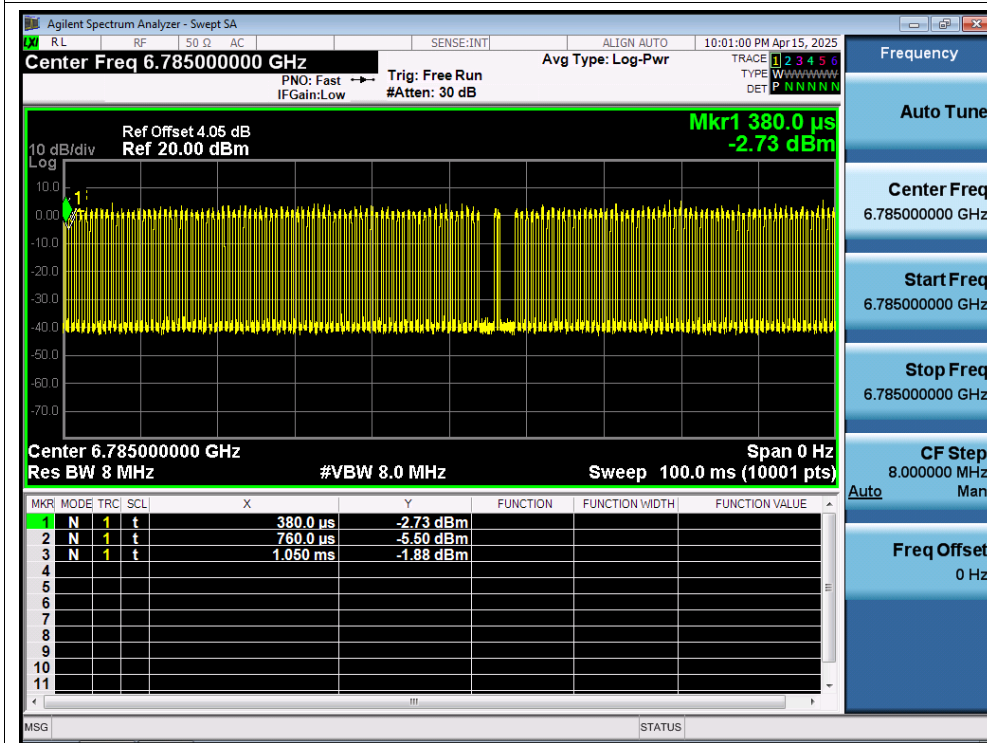


## Duty Cycle NVNT ax80 6865MHz AntB

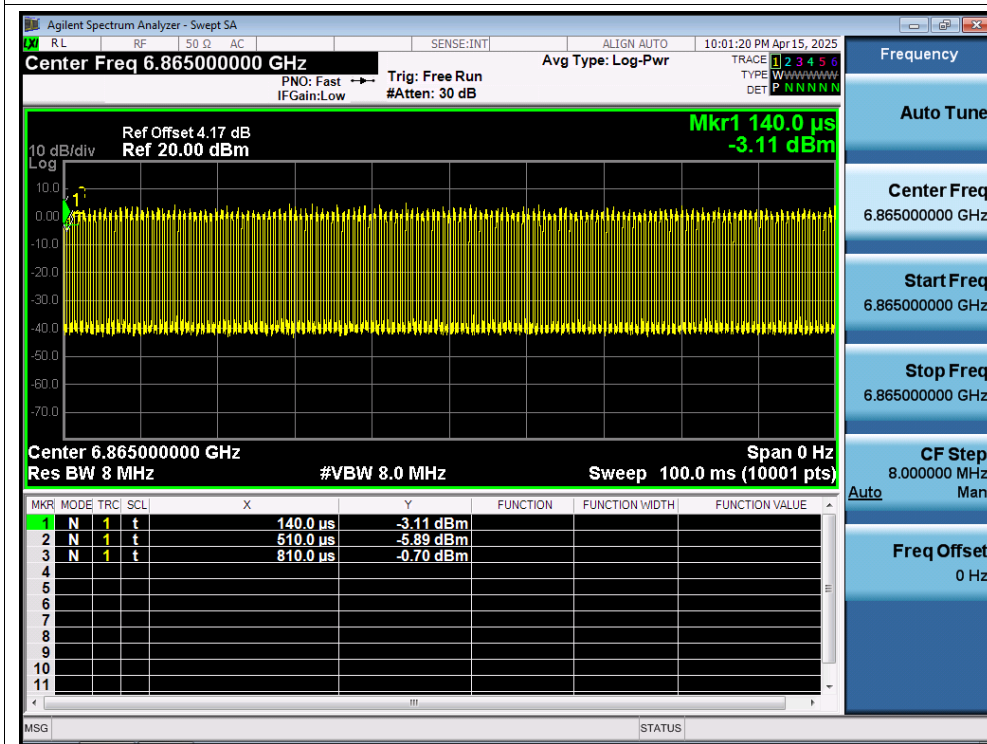




## Duty Cycle NVNT ax80 6945MHz AntB

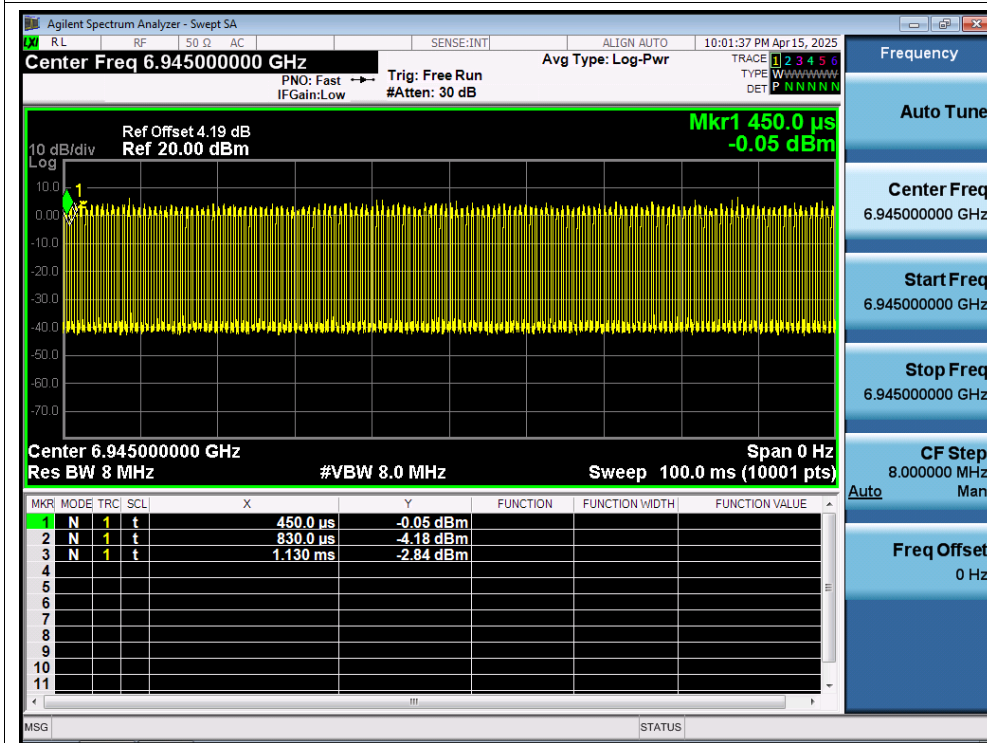


## Duty Cycle NVNT ax80 7025MHz AntB

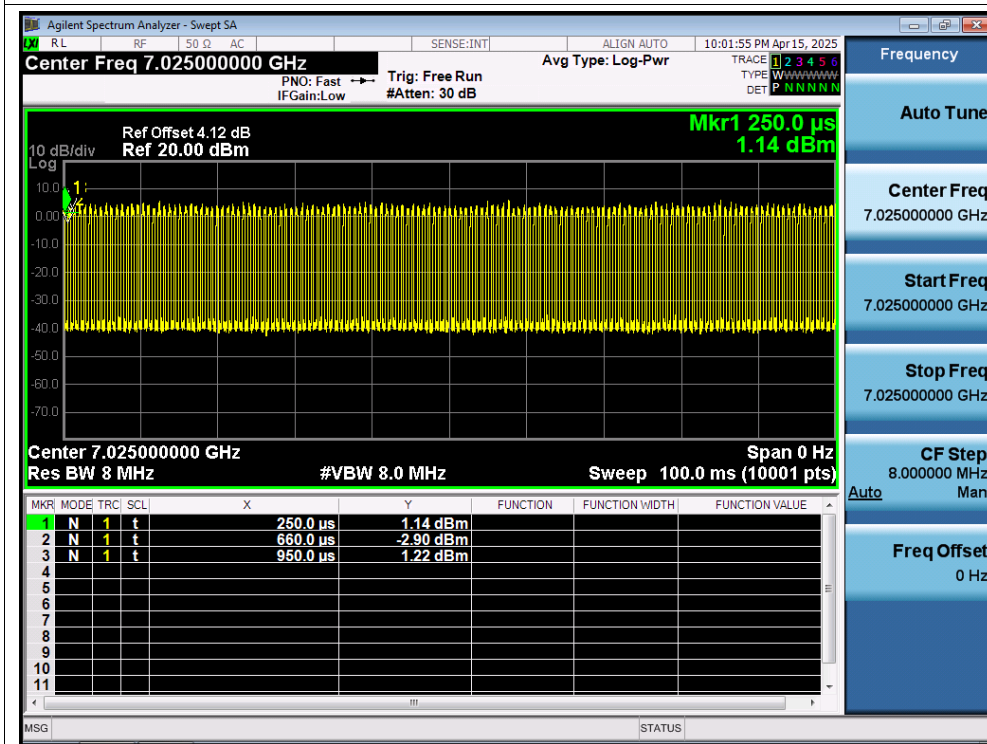




## Duty Cycle NVNT ax160 6025MHz AntA

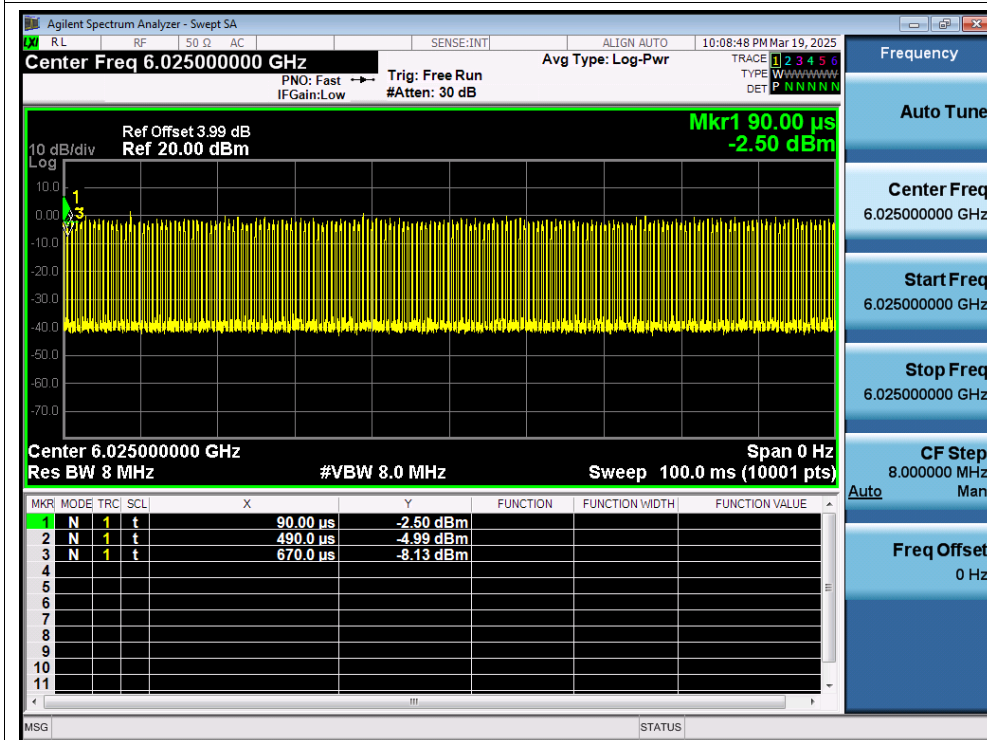


## Duty Cycle NVNT ax160 6185MHz AntA

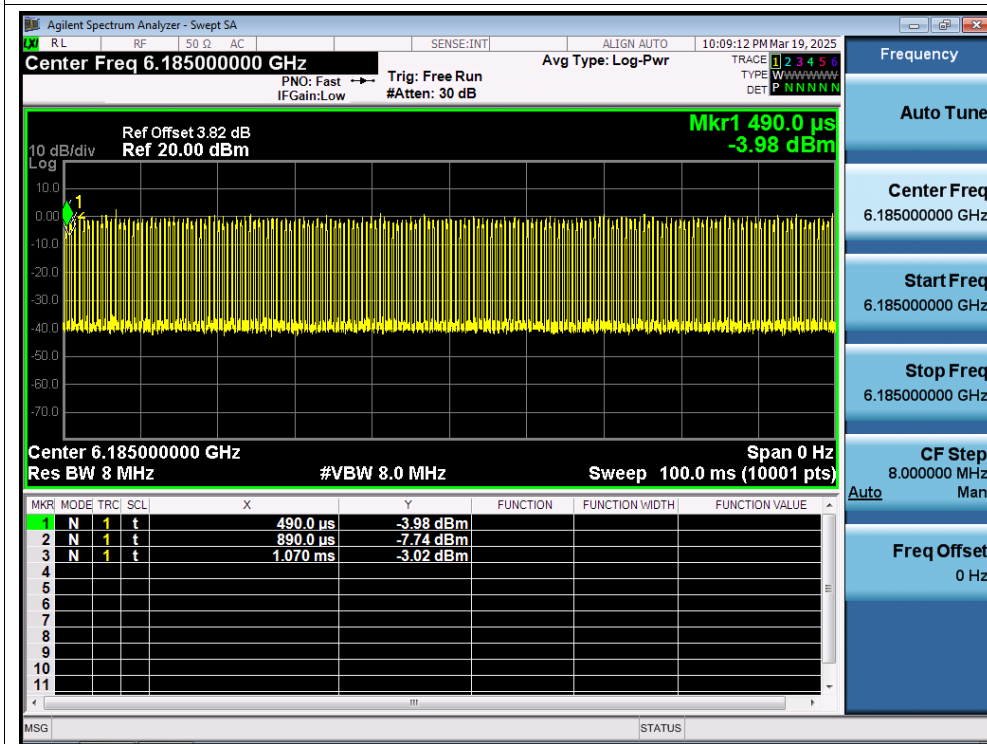




## Duty Cycle NVNT ax160 6345MHz AntA

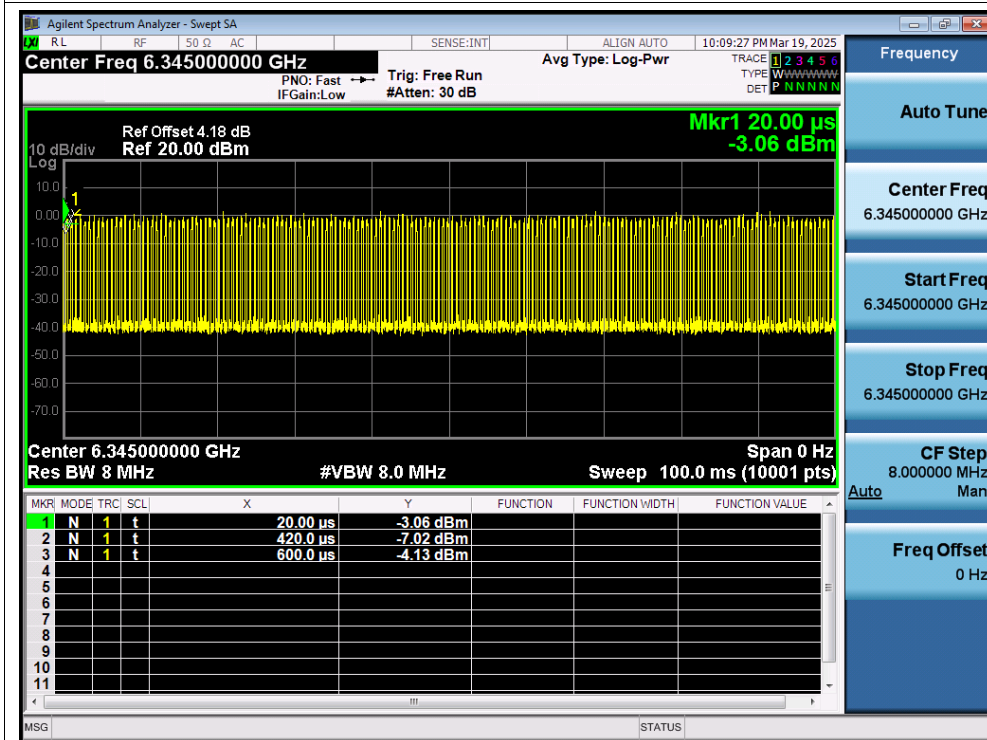


## Duty Cycle NVNT ax160 6505MHz AntA

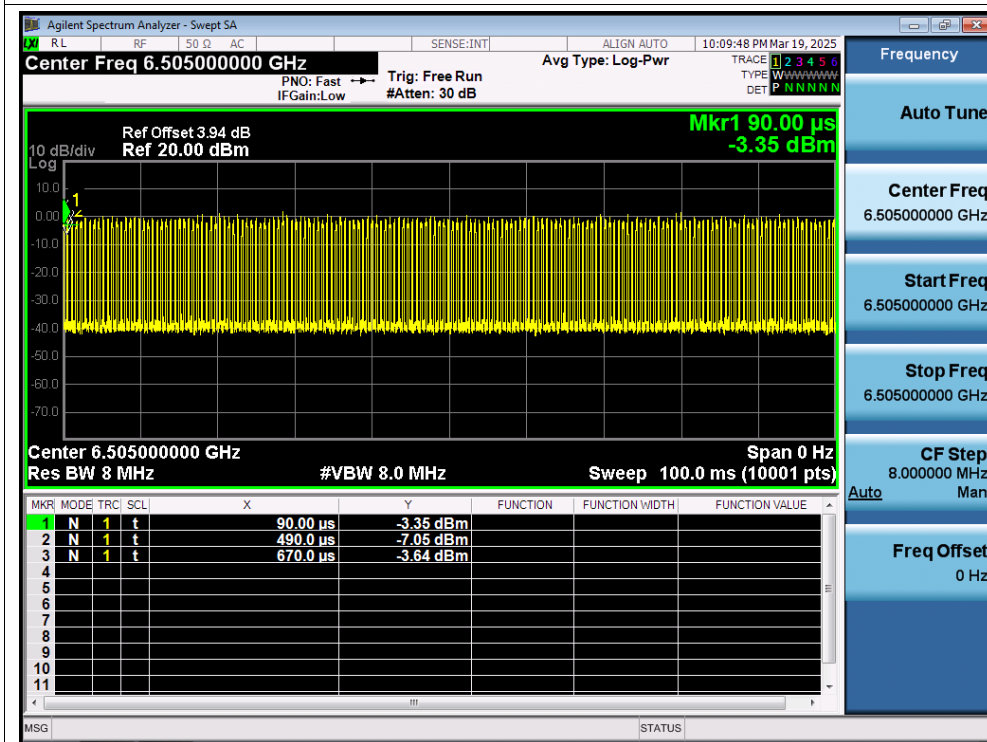




## Duty Cycle NVNT ax160 6665MHz AntA

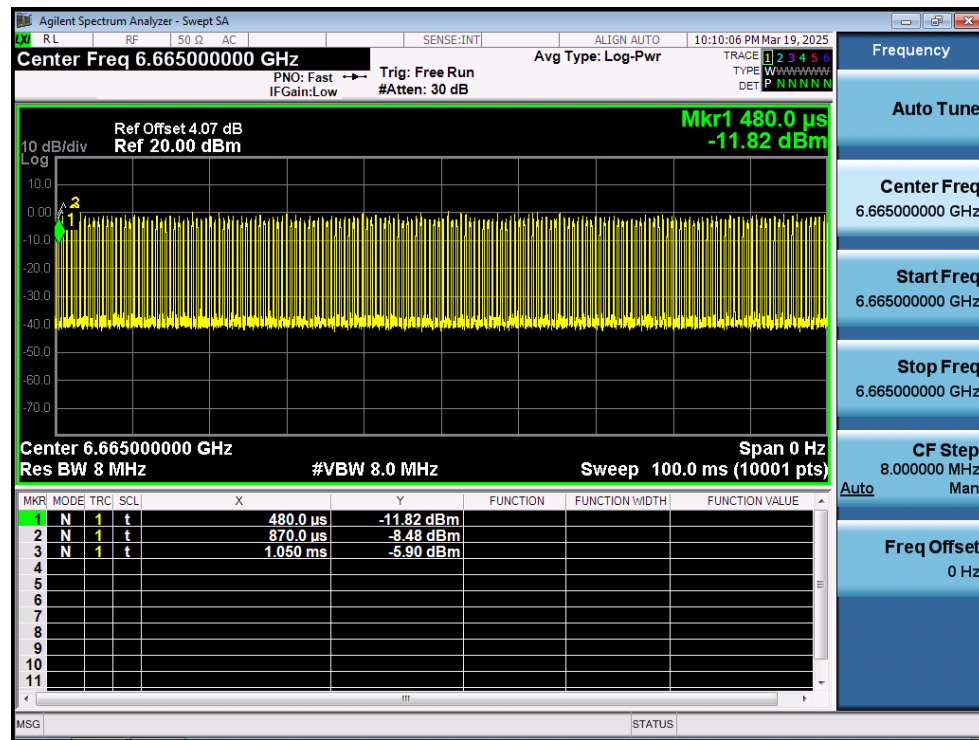


## Duty Cycle NVNT ax160 6825MHz AntA

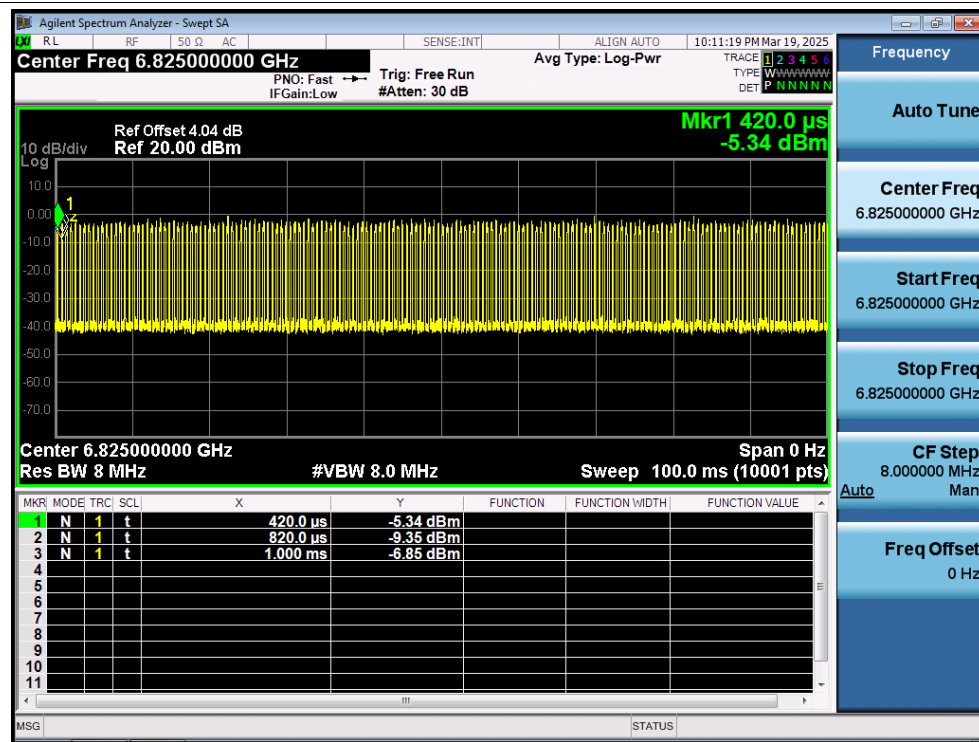




## Duty Cycle NVNT ax160 6985MHz AntA

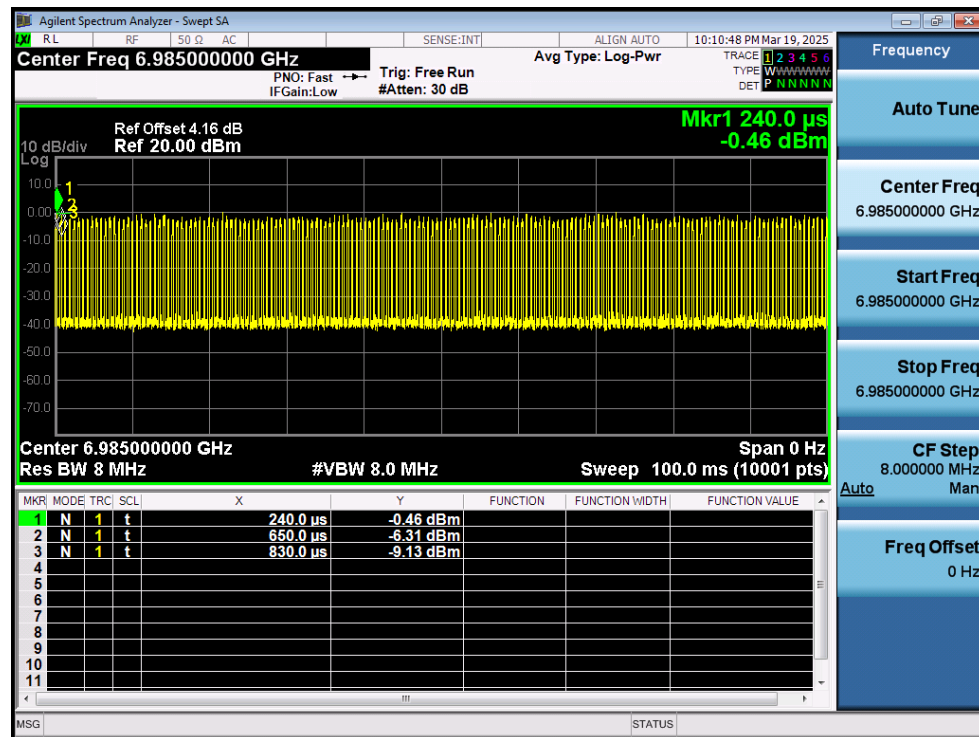


## Duty Cycle NVNT ax160 6025MHz AntB

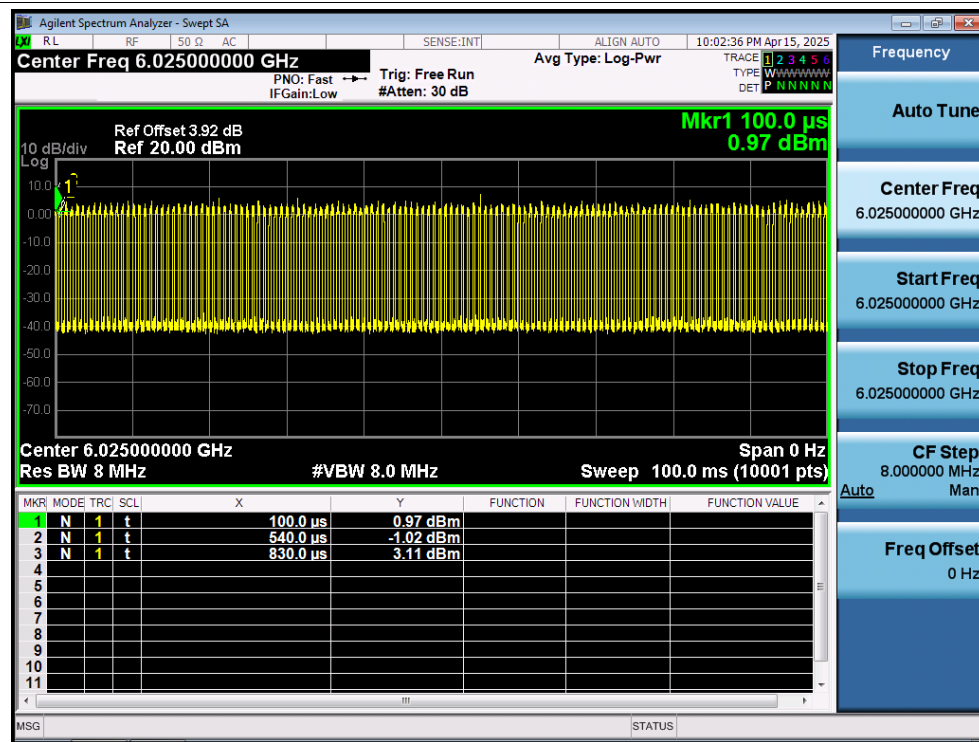




## Duty Cycle NVNT ax160 6185MHz AntB

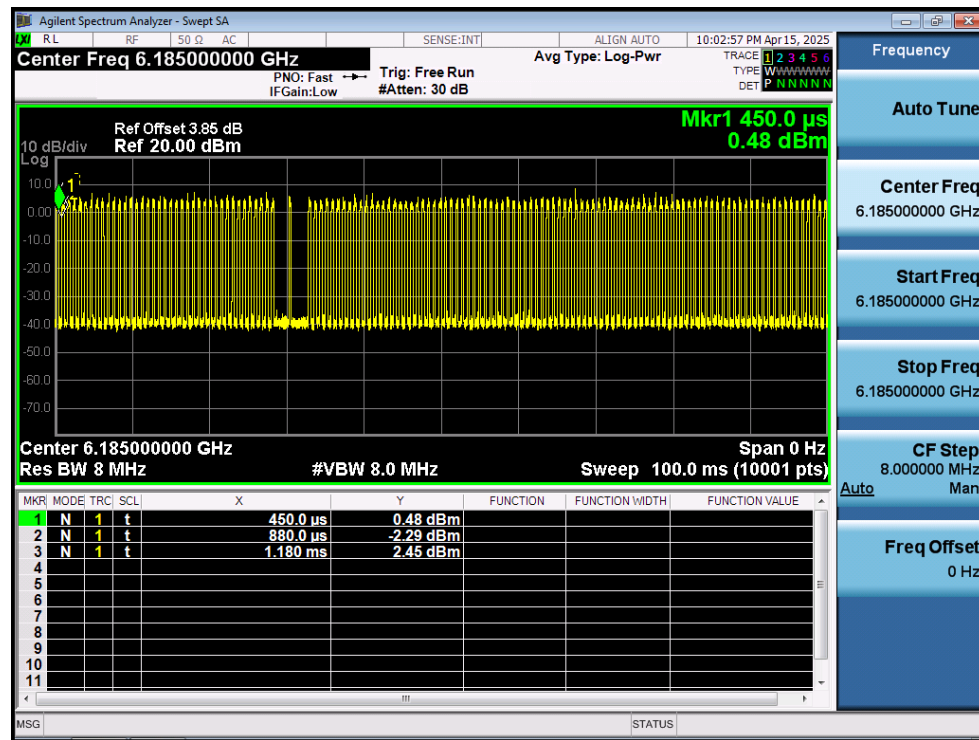


## Duty Cycle NVNT ax160 6345MHz AntB

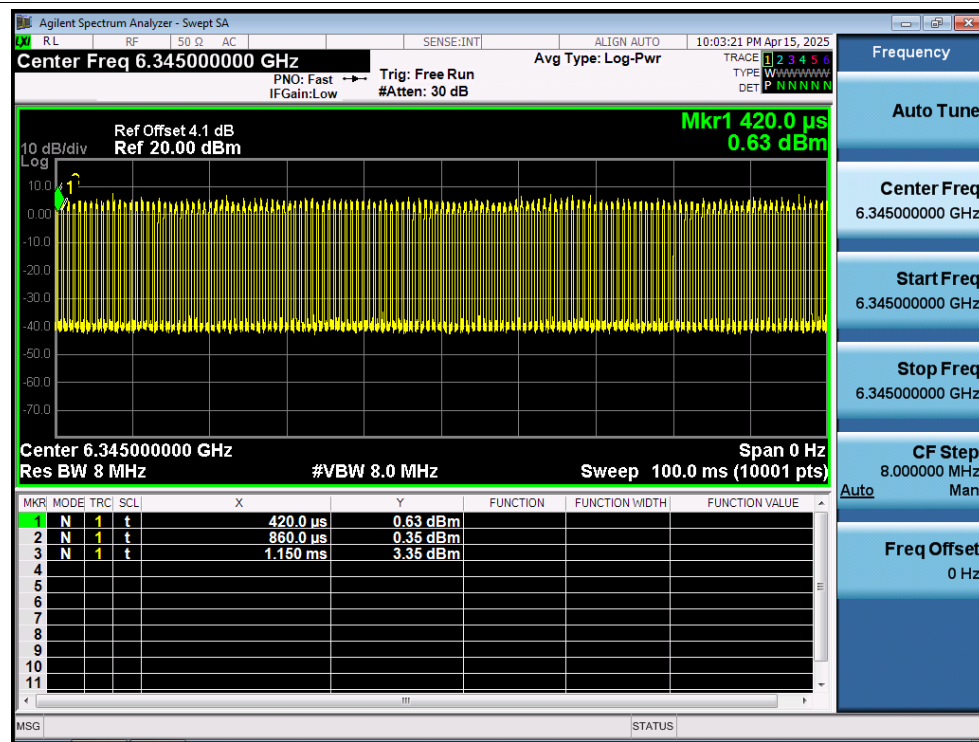




## Duty Cycle NVNT ax160 6505MHz AntB

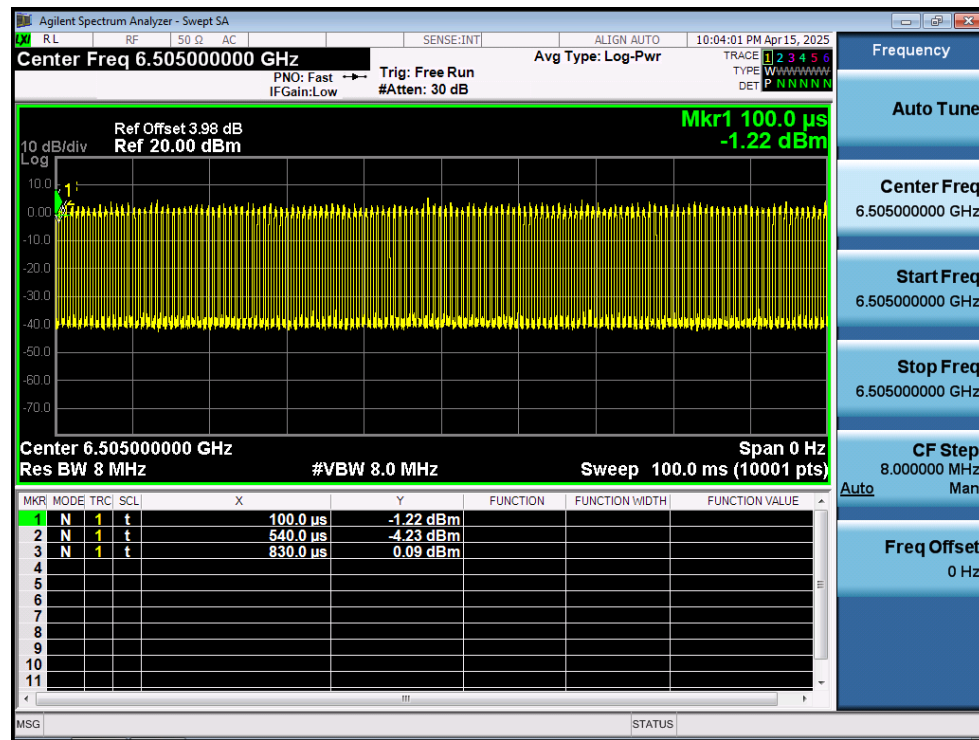


## Duty Cycle NVNT ax160 6665MHz AntB

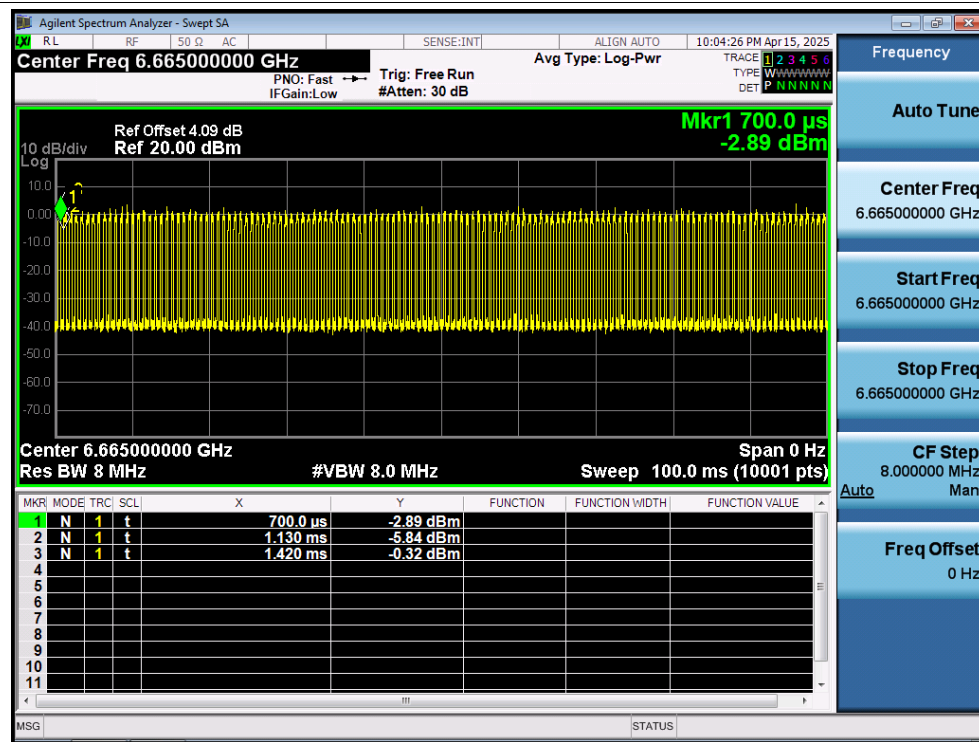




## Duty Cycle NVNT ax160 6825MHz AntB

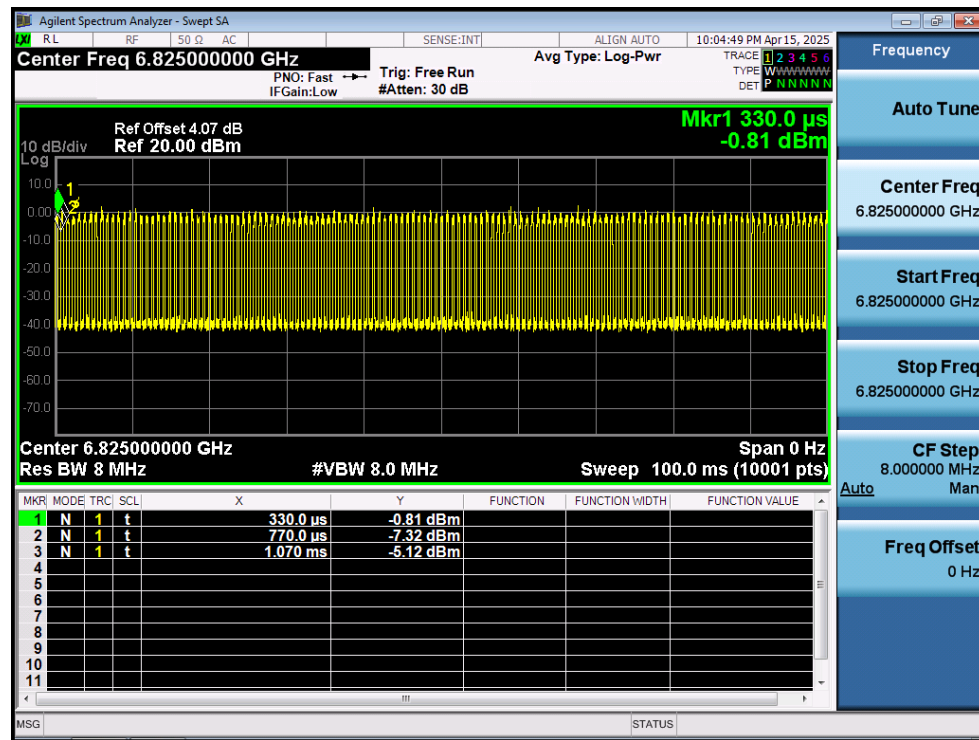

## Duty Cycle NVNT ax160 6985MHz AntB

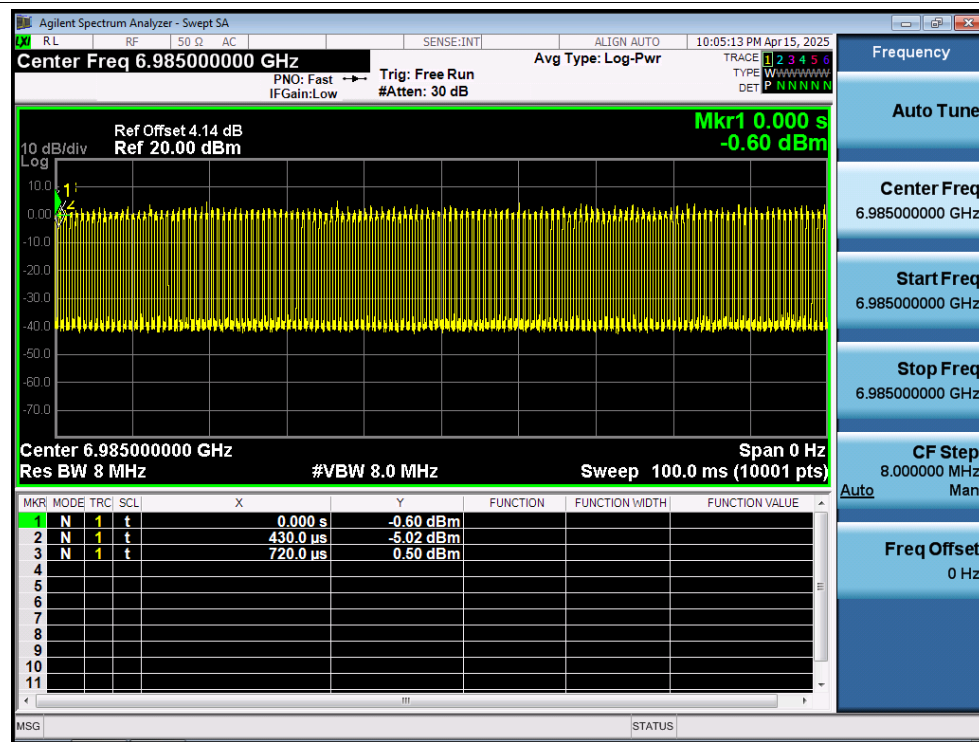

## Appendix D. Maximum Conducted Output Power

| Condition | Mode | Frequency (MHz) | Antenna | Conducted Power (dBm) | Duty Factor (dB) | Result [dBm] | Verdict |
|-----------|------|-----------------|---------|-----------------------|------------------|--------------|---------|
| NVNT      | ax20 | 5955            | AntA    | 5.02                  | 1.33             | 6.35         | Pass    |
| NVNT      | ax20 | 6175            | AntA    | 5.24                  | 1.38             | 6.62         | Pass    |
| NVNT      | ax20 | 6415            | AntA    | 5.13                  | 1.41             | 6.54         | Pass    |
| NVNT      | ax20 | 6435            | AntA    | 5                     | 1.36             | 6.36         | Pass    |
| NVNT      | ax20 | 6475            | AntA    | 4.69                  | 1.41             | 6.1          | Pass    |
| NVNT      | ax20 | 6515            | AntA    | 5.07                  | 1.36             | 6.43         | Pass    |
| NVNT      | ax20 | 6535            | AntA    | 5.06                  | 1.38             | 6.44         | Pass    |
| NVNT      | ax20 | 6695            | AntA    | 5.04                  | 1.33             | 6.37         | Pass    |
| NVNT      | ax20 | 6855            | AntA    | 5.12                  | 1.38             | 6.5          | Pass    |
| NVNT      | ax20 | 6875            | AntA    | 4.56                  | 1.38             | 5.94         | Pass    |
| NVNT      | ax20 | 6895            | AntA    | 4.83                  | 1.38             | 6.21         | Pass    |
| NVNT      | ax20 | 6995            | AntA    | 4.65                  | 1.36             | 6.01         | Pass    |
| NVNT      | ax20 | 7115            | AntA    | 4.68                  | 1.38             | 6.06         | Pass    |
| NVNT      | ax20 | 5955            | AntB    | 5.14                  | 3.33             | 8.47         | Pass    |
| NVNT      | ax20 | 6175            | AntB    | 5.06                  | 3.33             | 8.39         | Pass    |
| NVNT      | ax20 | 6415            | AntB    | 5                     | 3.32             | 8.32         | Pass    |
| NVNT      | ax20 | 6435            | AntB    | 5.13                  | 3.38             | 8.51         | Pass    |
| NVNT      | ax20 | 6475            | AntB    | 4.33                  | 2.32             | 6.65         | Pass    |
| NVNT      | ax20 | 6515            | AntB    | 5.09                  | 1.39             | 6.48         | Pass    |
| NVNT      | ax20 | 6535            | AntB    | 4.89                  | 1.39             | 6.28         | Pass    |
| NVNT      | ax20 | 6695            | AntB    | 4.88                  | 1.39             | 6.27         | Pass    |
| NVNT      | ax20 | 6855            | AntB    | 4.27                  | 1.39             | 5.66         | Pass    |
| NVNT      | ax20 | 6875            | AntB    | 4.99                  | 1.39             | 6.38         | Pass    |
| NVNT      | ax20 | 6895            | AntB    | 4.4                   | 1.36             | 5.76         | Pass    |
| NVNT      | ax20 | 6995            | AntB    | 5.08                  | 1.39             | 6.47         | Pass    |
| NVNT      | ax20 | 7115            | AntB    | 5.4                   | 1.36             | 6.76         | Pass    |
| NVNT      | ax40 | 5965            | AntA    | 5.28                  | 3.35             | 8.63         | Pass    |
| NVNT      | ax40 | 6165            | AntA    | 6.7                   | 3.41             | 10.11        | Pass    |
| NVNT      | ax40 | 6405            | AntA    | 8.04                  | 3.35             | 11.39        | Pass    |
| NVNT      | ax40 | 6445            | AntA    | 7.56                  | 3.35             | 10.91        | Pass    |
| NVNT      | ax40 | 6485            | AntA    | 6.05                  | 3.35             | 9.4          | Pass    |
| NVNT      | ax40 | 6525            | AntA    | 6.01                  | 3.35             | 9.36         | Pass    |
| NVNT      | ax40 | 6565            | AntA    | 6.08                  | 3.35             | 9.43         | Pass    |
| NVNT      | ax40 | 6685            | AntA    | 4.97                  | 3.41             | 8.38         | Pass    |
| NVNT      | ax40 | 6845            | AntA    | 5.09                  | 3.41             | 8.5          | Pass    |
| NVNT      | ax40 | 6885            | AntA    | 5.28                  | 3.35             | 8.63         | Pass    |
| NVNT      | ax40 | 6925            | AntA    | 5.48                  | 3.28             | 8.76         | Pass    |
| NVNT      | ax40 | 6965            | AntA    | 5.25                  | 3.41             | 8.66         | Pass    |
| NVNT      | ax40 | 7085            | AntA    | 6.23                  | 3.35             | 9.58         | Pass    |