

Appendix Test Data

Report No.:	1812C60057312502-01	Test Sample No.:	1-2-2
Start Test Date:	2026-1-23	Finish Test Date:	2026-2-2
Test Engineer:	<i>Alex Peng</i>	Auditor:	<i>Justin Feng</i>
Temperature:	23.0°C	Relative Humidity:	51%
Pressure:	101kPa		



Appendix A1: 26dB Bandwidth

Test Result

Test Mode	Antenna	Frequency[MHz]	26db EBW [MHz]	FL[MHz]	FH[MHz]	Limit[MHz]	Verdict
11A	Ant1	5180	20.440	5169.880	5190.320	---	---
11A	Ant1	5220	20.000	5210.080	5230.080	---	---
11A	Ant1	5240	20.400	5229.800	5250.200	---	---
11A	Ant1	5260	20.240	5249.960	5270.200	---	---
11A	Ant1	5300	20.080	5290.000	5310.080	---	---
11A	Ant1	5320	20.280	5309.880	5330.160	---	---
11A	Ant1	5500	20.240	5489.960	5510.200	---	---
11A	Ant1	5580	20.120	5569.960	5590.080	---	---
11A	Ant1	5700	20.320	5689.920	5710.240	---	---
11A	Ant1	5745	20.120	5734.880	5755.000	---	---
11A	Ant1	5785	20.440	5774.960	5795.400	---	---
11A	Ant1	5825	20.240	5815.000	5835.240	---	---
11N20SISO	Ant1	5180	20.440	5169.760	5190.200	---	---
11N20SISO	Ant1	5220	20.640	5209.720	5230.360	---	---
11N20SISO	Ant1	5240	20.520	5229.800	5250.320	---	---
11N20SISO	Ant1	5260	20.360	5249.800	5270.160	---	---
11N20SISO	Ant1	5300	20.480	5289.720	5310.200	---	---
11N20SISO	Ant1	5320	20.600	5309.720	5330.320	---	---
11N20SISO	Ant1	5500	20.480	5489.800	5510.280	---	---
11N20SISO	Ant1	5580	20.480	5569.840	5590.320	---	---
11N20SISO	Ant1	5700	20.520	5689.680	5710.200	---	---
11N20SISO	Ant1	5745	20.800	5734.680	5755.480	---	---
11N20SISO	Ant1	5785	20.520	5774.720	5795.240	---	---
11N20SISO	Ant1	5825	20.760	5814.760	5835.520	---	---

Shenzhen Anbotech Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotech.com E-mail: service@anbotech.com

11N40SISO	Ant1	5190	41.280	5169.360	5210.640	---	---
11N40SISO	Ant1	5230	40.960	5209.440	5250.400	---	---
11N40SISO	Ant1	5270	41.120	5249.440	5290.560	---	---
11N40SISO	Ant1	5310	40.800	5289.760	5330.560	---	---
11N40SISO	Ant1	5510	41.120	5489.440	5530.560	---	---
11N40SISO	Ant1	5550	41.360	5529.520	5570.880	---	---
11N40SISO	Ant1	5670	40.880	5649.600	5690.480	---	---
11N40SISO	Ant1	5755	40.960	5734.440	5775.400	---	---
11N40SISO	Ant1	5795	41.680	5774.040	5815.720	---	---
11AC20SISO	Ant1	5180	20.560	5169.640	5190.200	---	---
11AC20SISO	Ant1	5220	20.760	5209.720	5230.480	---	---
11AC20SISO	Ant1	5240	20.800	5229.640	5250.440	---	---
11AC20SISO	Ant1	5260	20.680	5249.680	5270.360	---	---
11AC20SISO	Ant1	5300	20.640	5289.760	5310.400	---	---
11AC20SISO	Ant1	5320	20.480	5309.760	5330.240	---	---
11AC20SISO	Ant1	5500	20.760	5489.560	5510.320	---	---
11AC20SISO	Ant1	5580	20.640	5569.720	5590.360	---	---
11AC20SISO	Ant1	5700	20.600	5689.600	5710.200	---	---
11AC20SISO	Ant1	5745	20.400	5734.800	5755.200	---	---
11AC20SISO	Ant1	5785	20.680	5774.640	5795.320	---	---
11AC20SISO	Ant1	5825	20.640	5814.760	5835.400	---	---
11AC40SISO	Ant1	5190	41.440	5169.360	5210.800	---	---
11AC40SISO	Ant1	5230	41.040	5209.600	5250.640	---	---
11AC40SISO	Ant1	5270	40.960	5249.360	5290.320	---	---
11AC40SISO	Ant1	5310	41.280	5289.200	5330.480	---	---
11AC40SISO	Ant1	5510	40.800	5489.600	5530.400	---	---
11AC40SISO	Ant1	5550	40.560	5529.840	5570.400	---	---
11AC40SISO	Ant1	5670	40.800	5649.520	5690.320	---	---
11AC40SISO	Ant1	5755	41.440	5734.280	5775.720	---	---
11AC40SISO	Ant1	5795	41.200	5774.520	5815.720	---	---
11AC80SISO	Ant1	5210	81.600	5169.200	5250.800	---	---
11AC80SISO	Ant1	5290	81.280	5249.520	5330.800	---	---
11AC80SISO	Ant1	5530	81.440	5489.520	5570.960	---	---
11AC80SISO	Ant1	5775	81.760	5734.200	5815.960	---	---
11AX20SISO	Ant1	5180	20.280	5169.920	5190.200	---	---
11AX20SISO	Ant1	5220	20.280	5209.920	5230.200	---	---
11AX20SISO	Ant1	5240	20.200	5229.960	5250.160	---	---
11AX20SISO	Ant1	5260	20.120	5250.000	5270.120	---	---
11AX20SISO	Ant1	5300	20.160	5289.960	5310.120	---	---
11AX20SISO	Ant1	5320	20.240	5309.960	5330.200	---	---
11AX20SISO	Ant1	5500	20.240	5489.920	5510.160	---	---
11AX20SISO	Ant1	5580	20.120	5570.000	5590.120	---	---

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

11AX20SISO	Ant1	5700	20.240	5689.920	5710.160	---	---
11AX20SISO	Ant1	5745	20.280	5734.920	5755.200	---	---
11AX20SISO	Ant1	5785	20.160	5775.000	5795.160	---	---
11AX20SISO	Ant1	5825	20.160	5814.920	5835.080	---	---
11AX40SISO	Ant1	5190	39.920	5170.080	5210.000	---	---
11AX40SISO	Ant1	5230	39.840	5210.160	5250.000	---	---
11AX40SISO	Ant1	5270	39.920	5250.160	5290.080	---	---
11AX40SISO	Ant1	5310	40.000	5290.160	5330.160	---	---
11AX40SISO	Ant1	5510	40.000	5490.000	5530.000	---	---
11AX40SISO	Ant1	5550	40.080	5530.000	5570.080	---	---
11AX40SISO	Ant1	5670	40.000	5650.080	5690.080	---	---
11AX40SISO	Ant1	5755	40.000	5735.000	5775.000	---	---
11AX40SISO	Ant1	5795	40.080	5775.000	5815.080	---	---
11AX80SISO	Ant1	5210	81.280	5169.520	5250.800	---	---
11AX80SISO	Ant1	5290	81.280	5249.520	5330.800	---	---
11AX80SISO	Ant1	5530	81.280	5489.520	5570.800	---	---
11AX80SISO	Ant1	5775	81.280	5734.520	5815.800	---	---

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

Test Graphs



Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com



Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com



Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com



Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com



Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com



Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

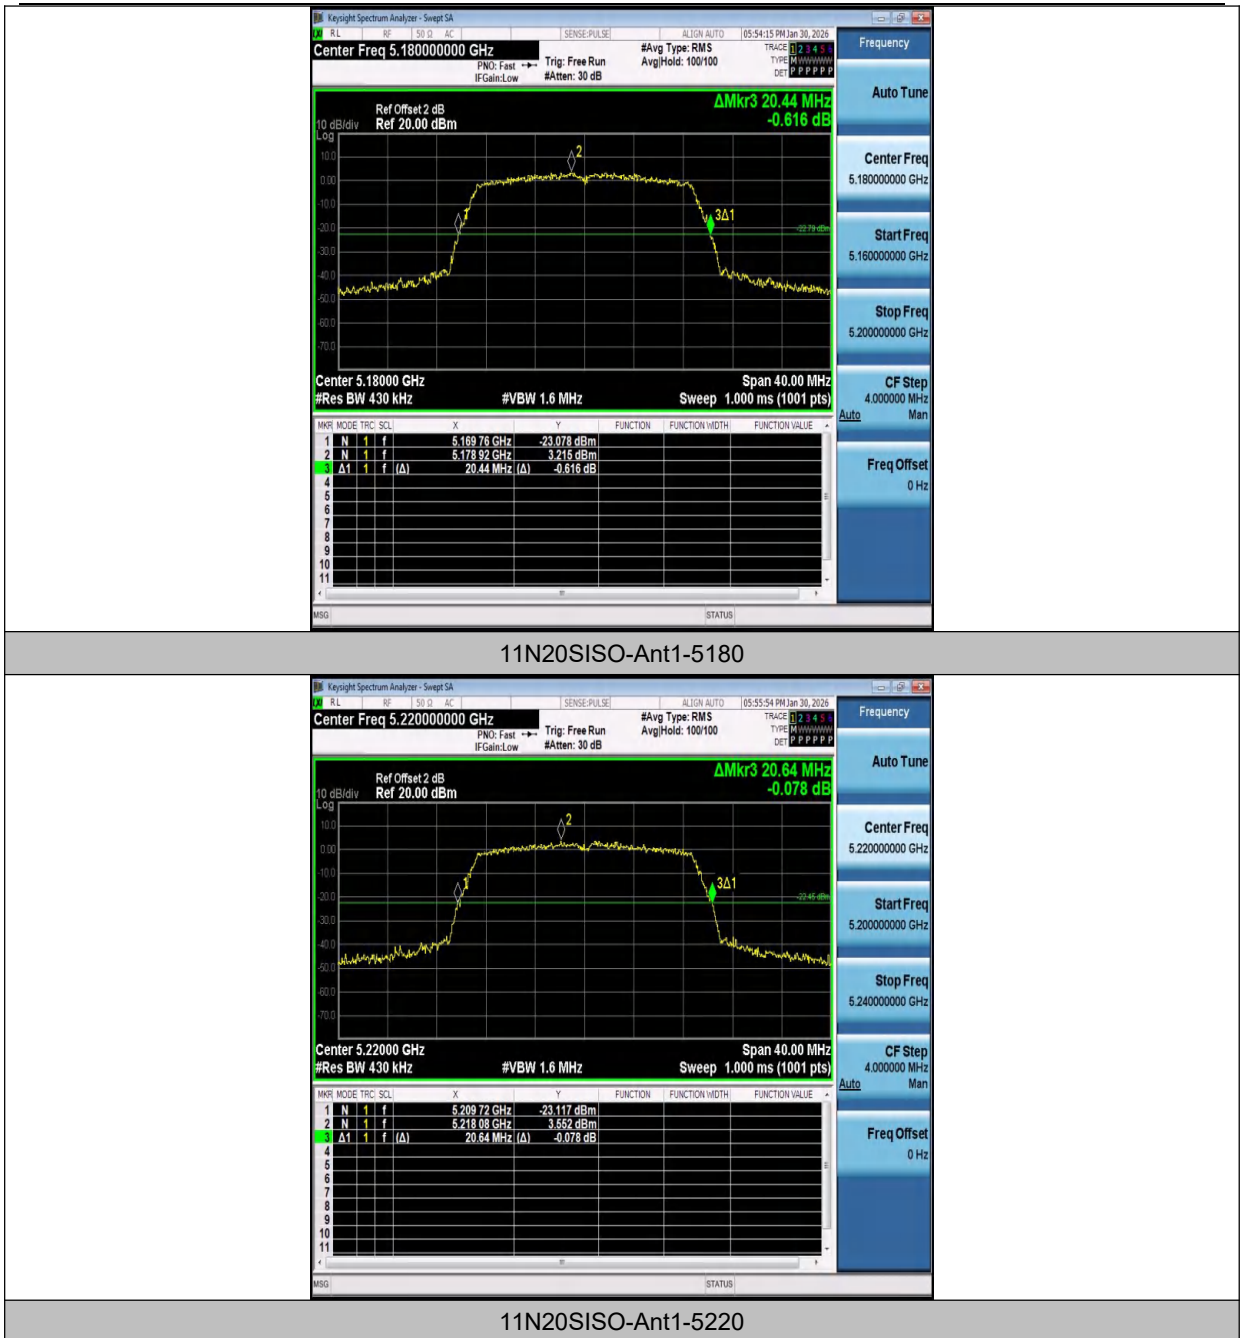





Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com



Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com









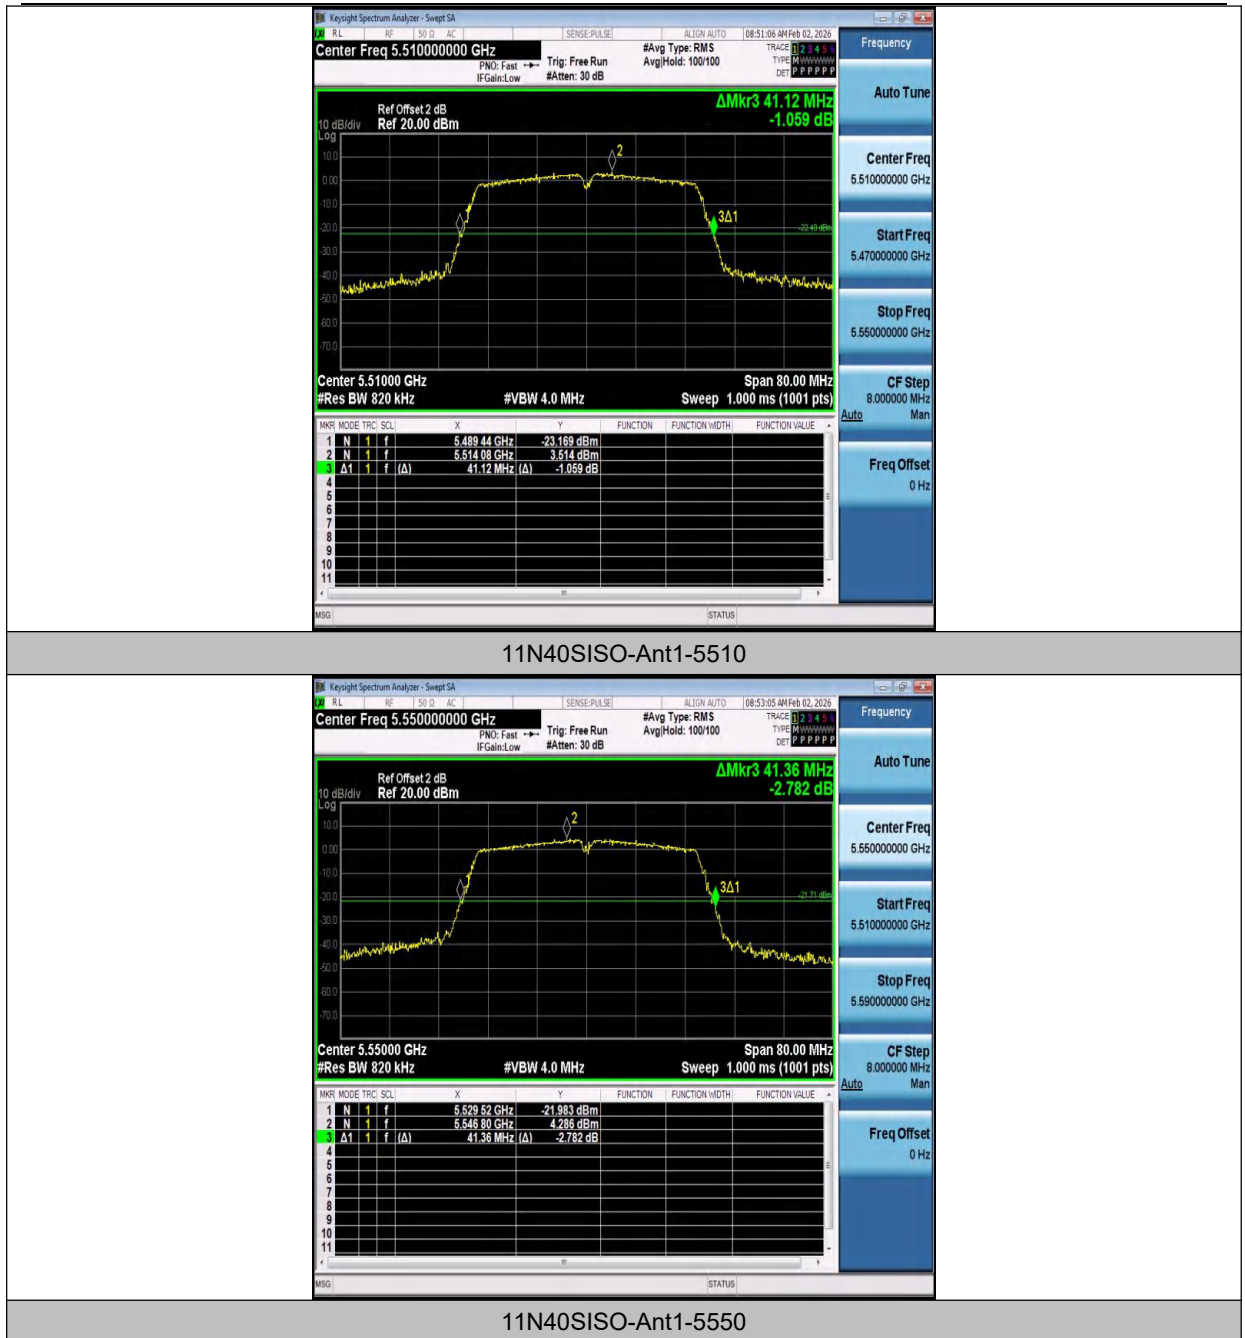


Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com





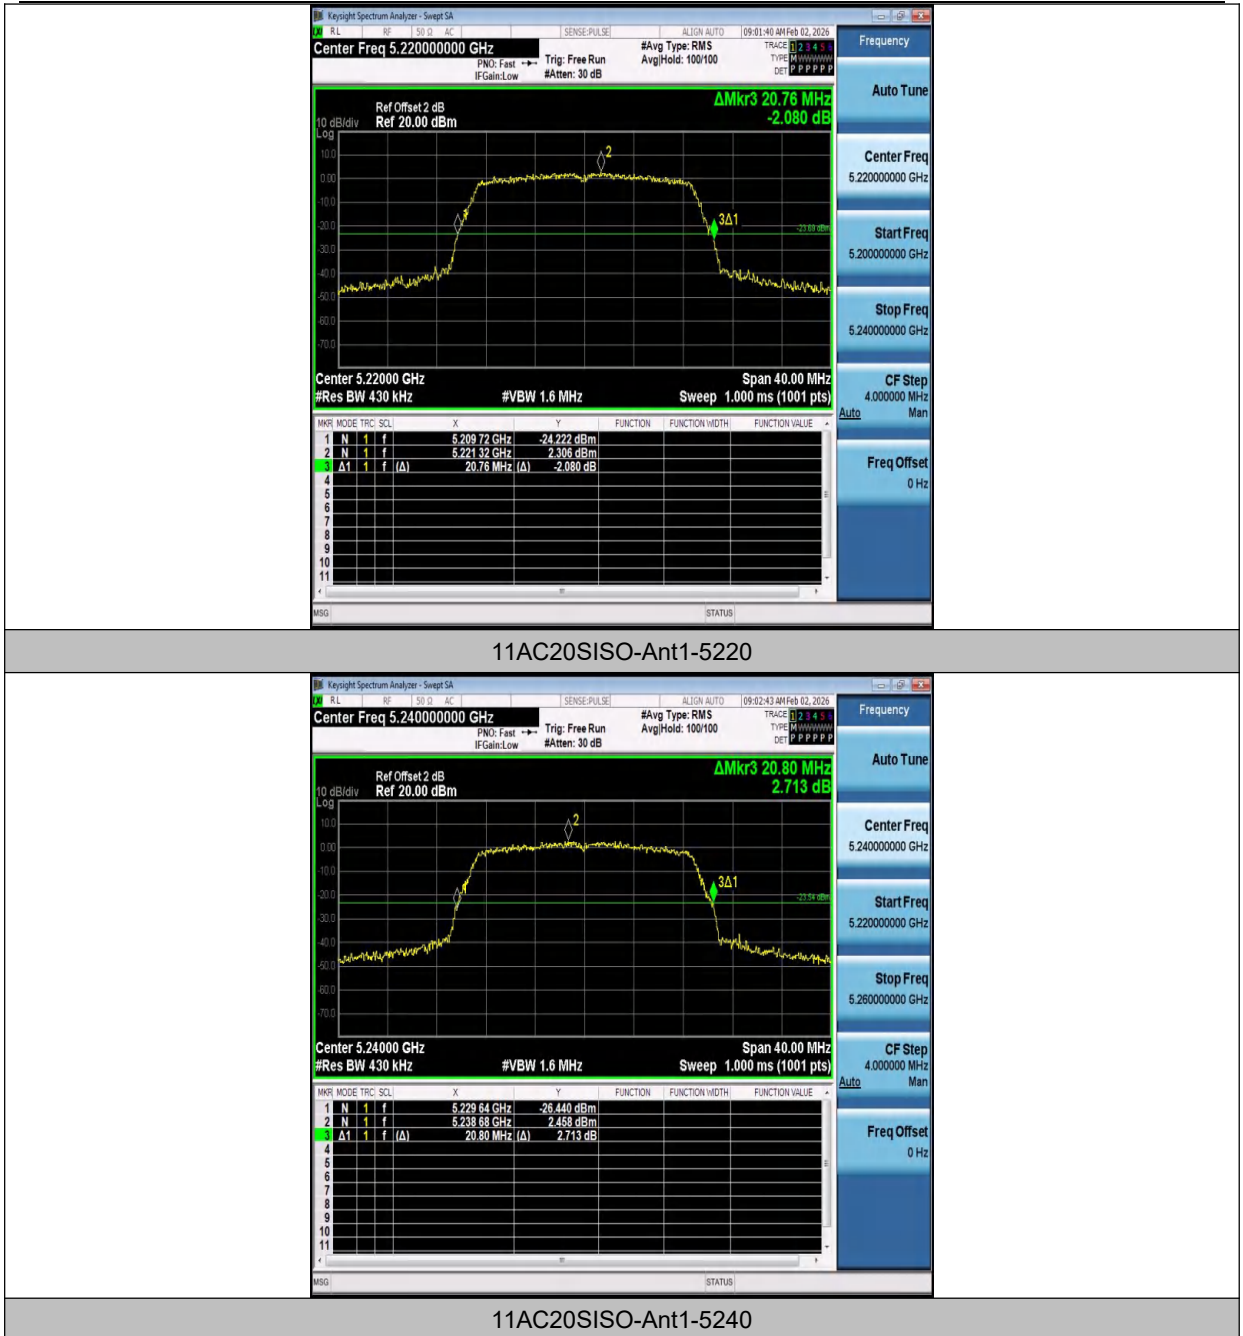








Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com



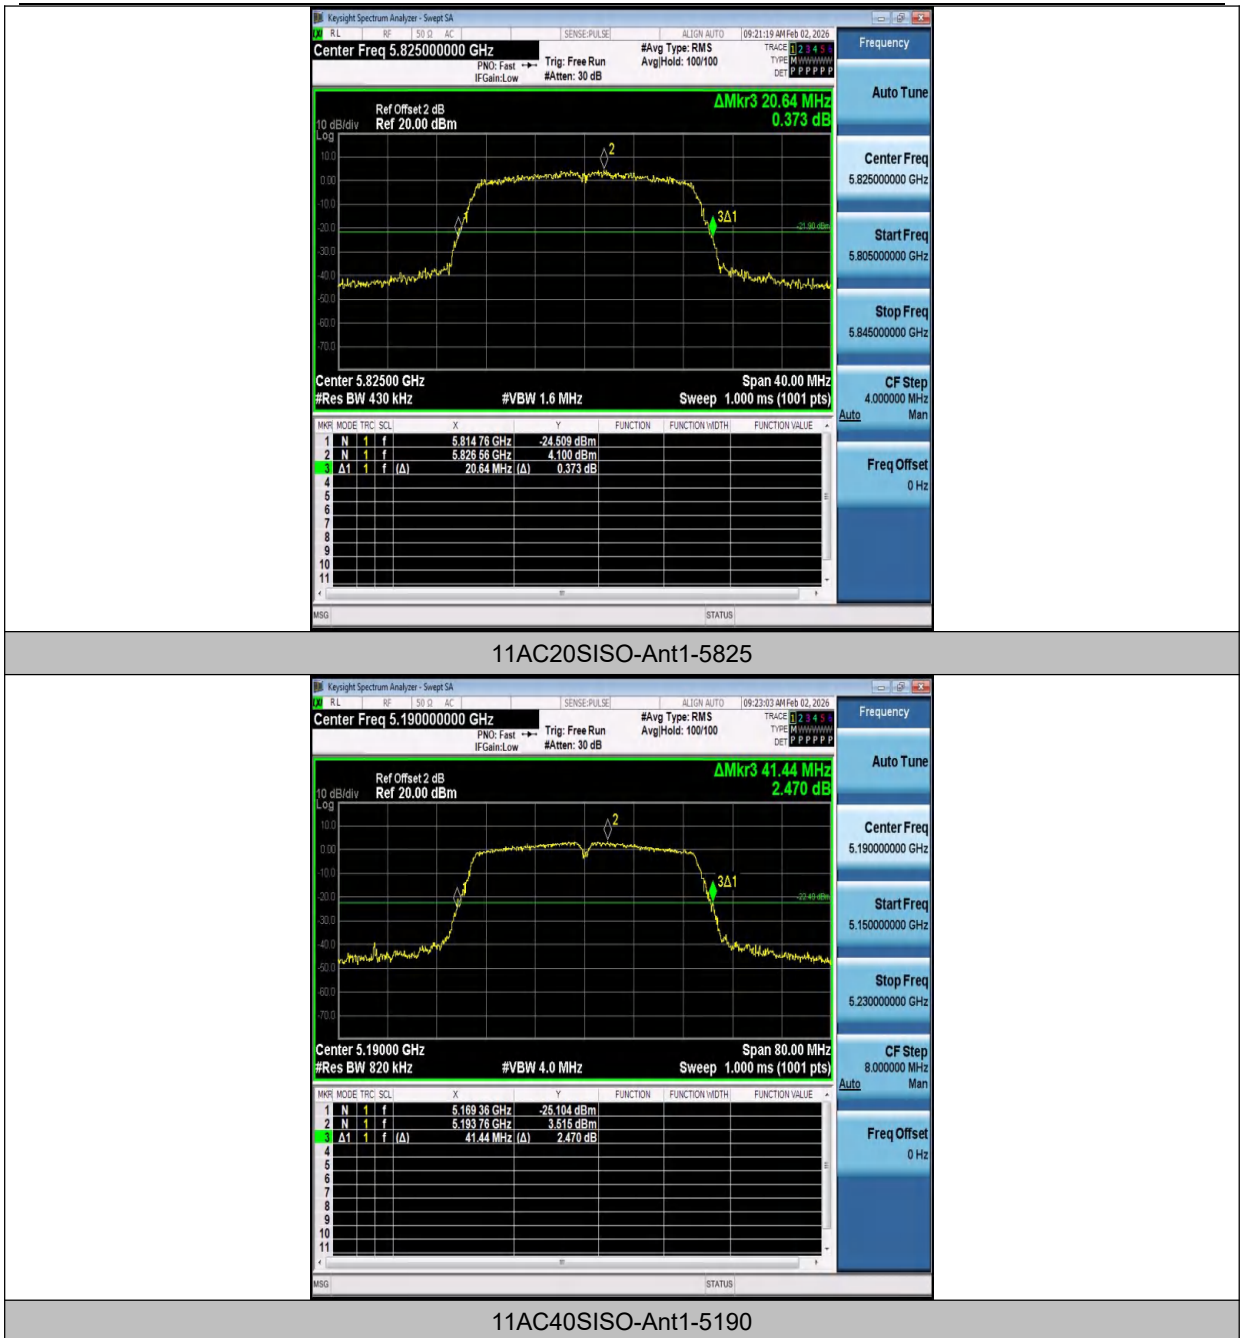



Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com




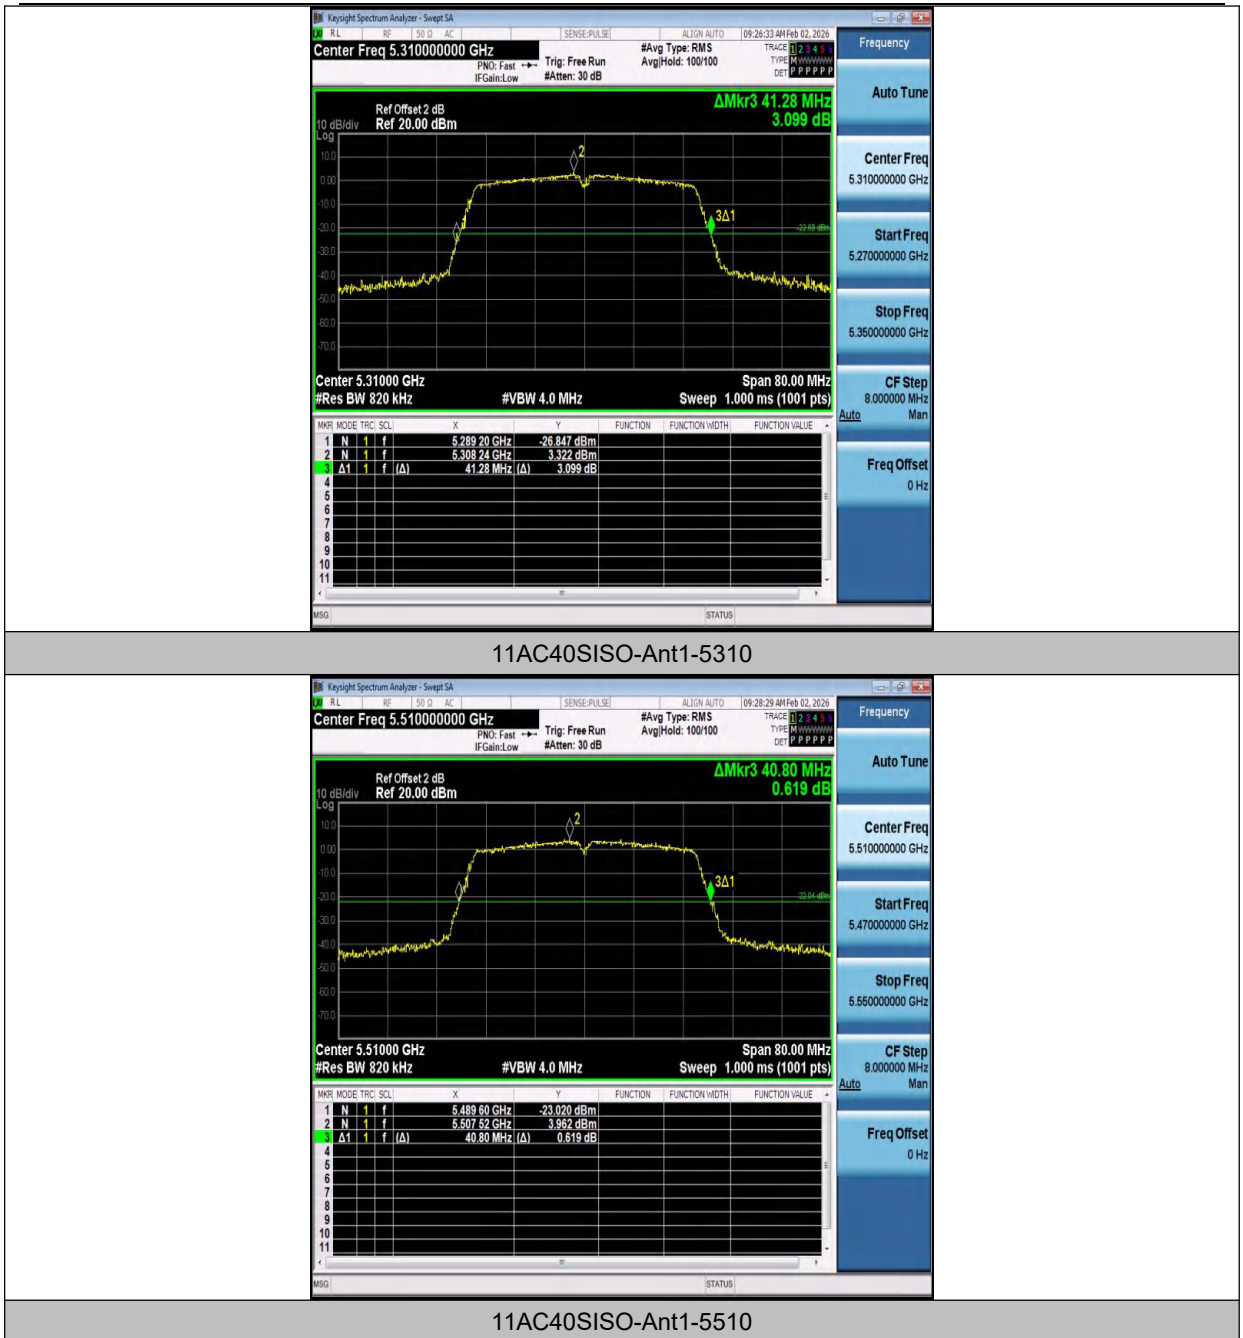

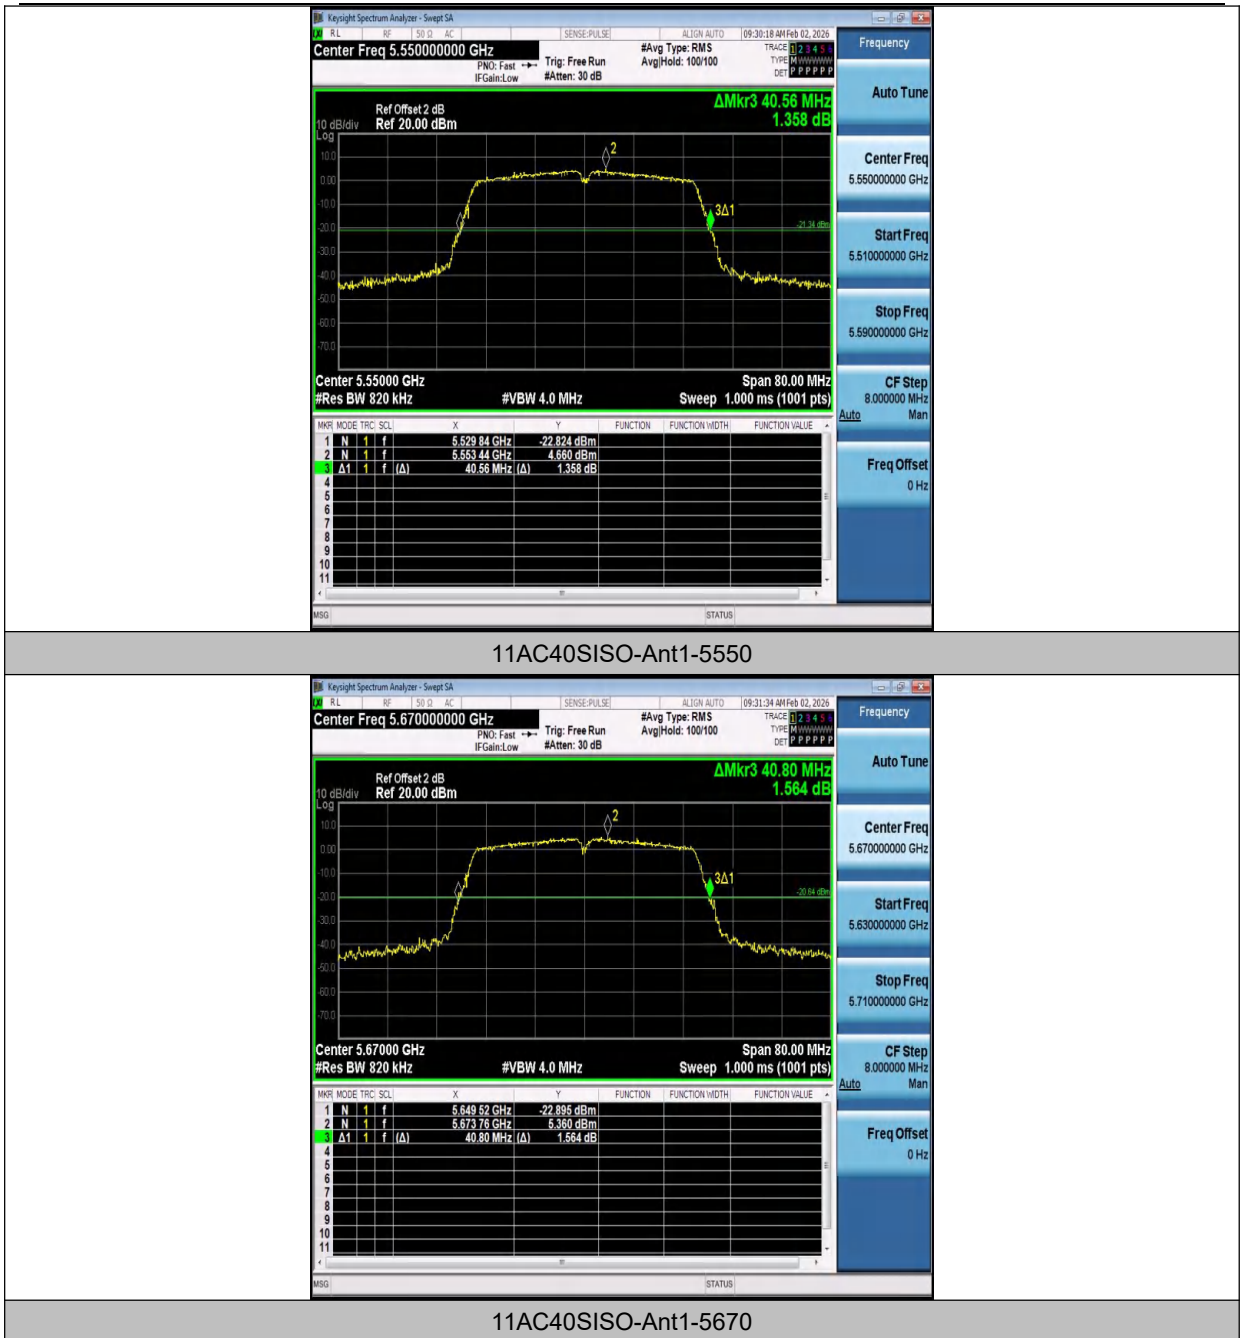





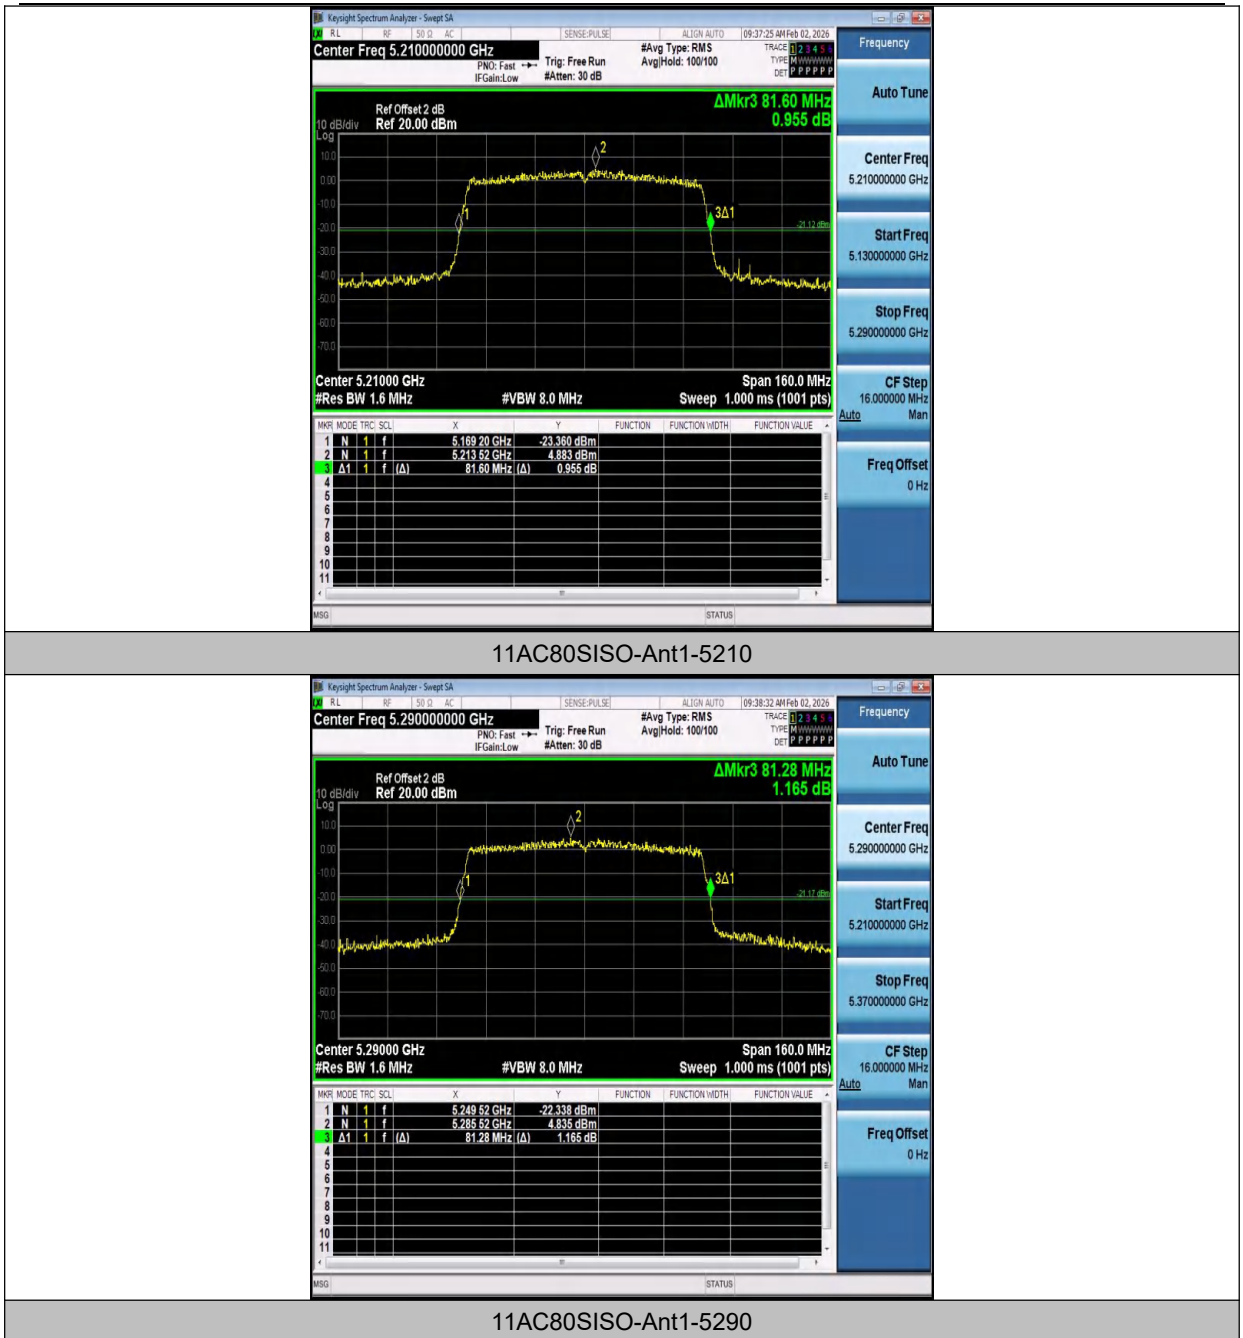


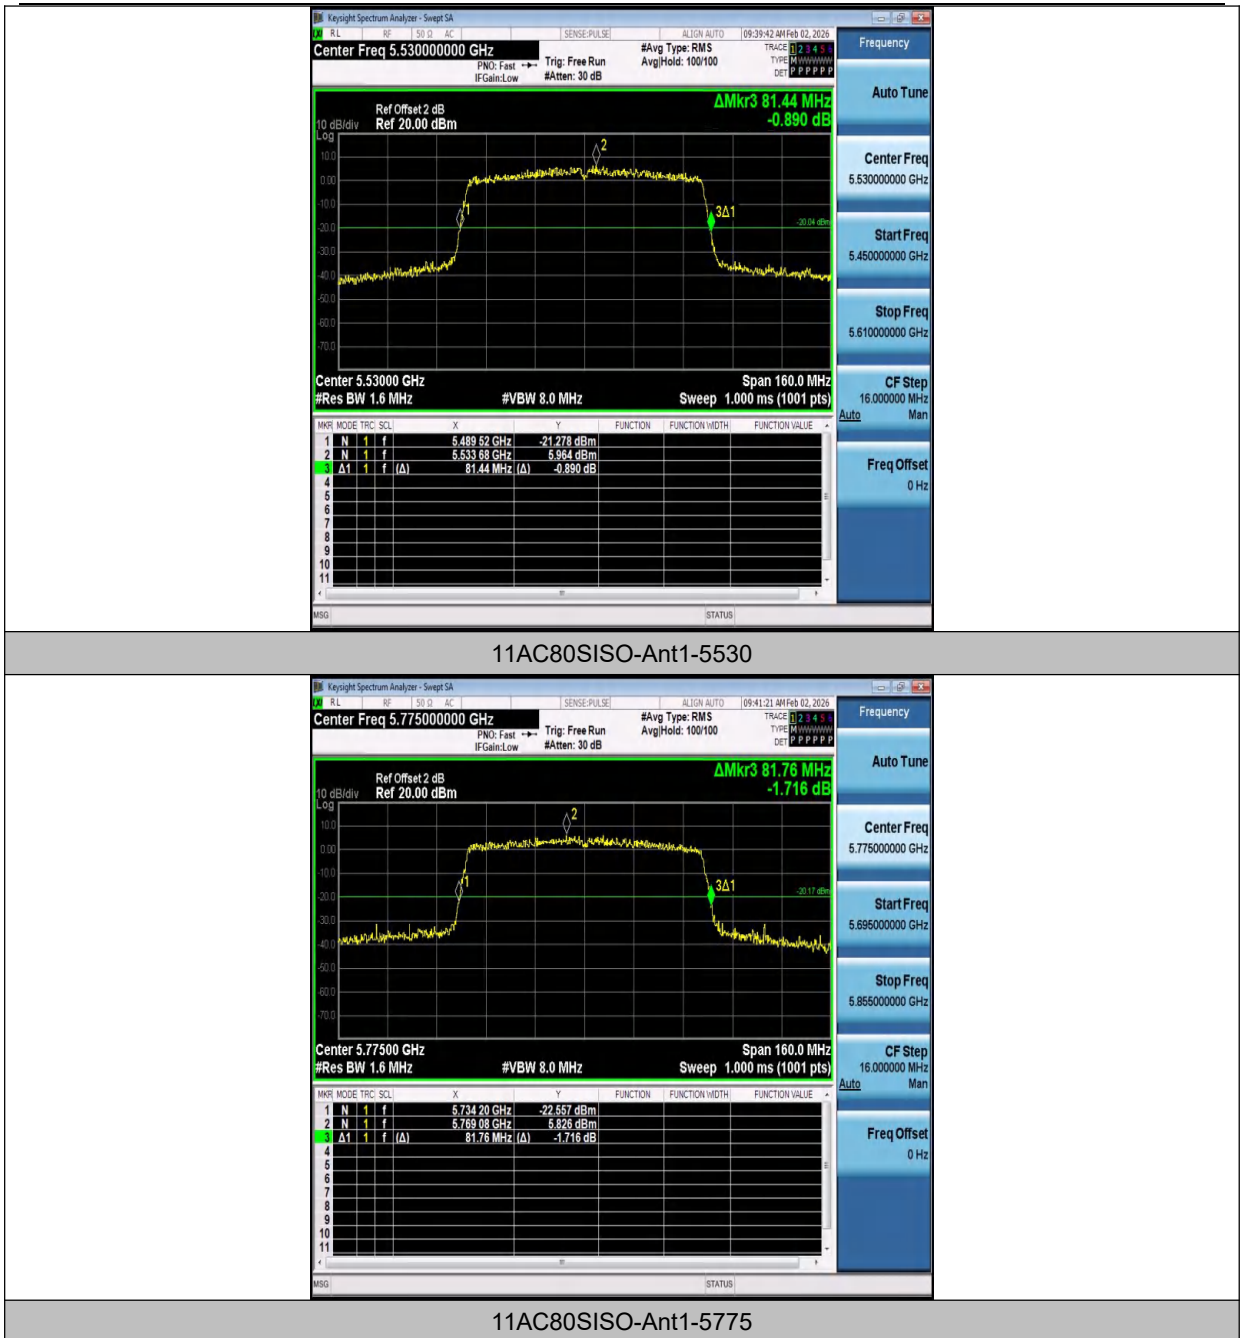



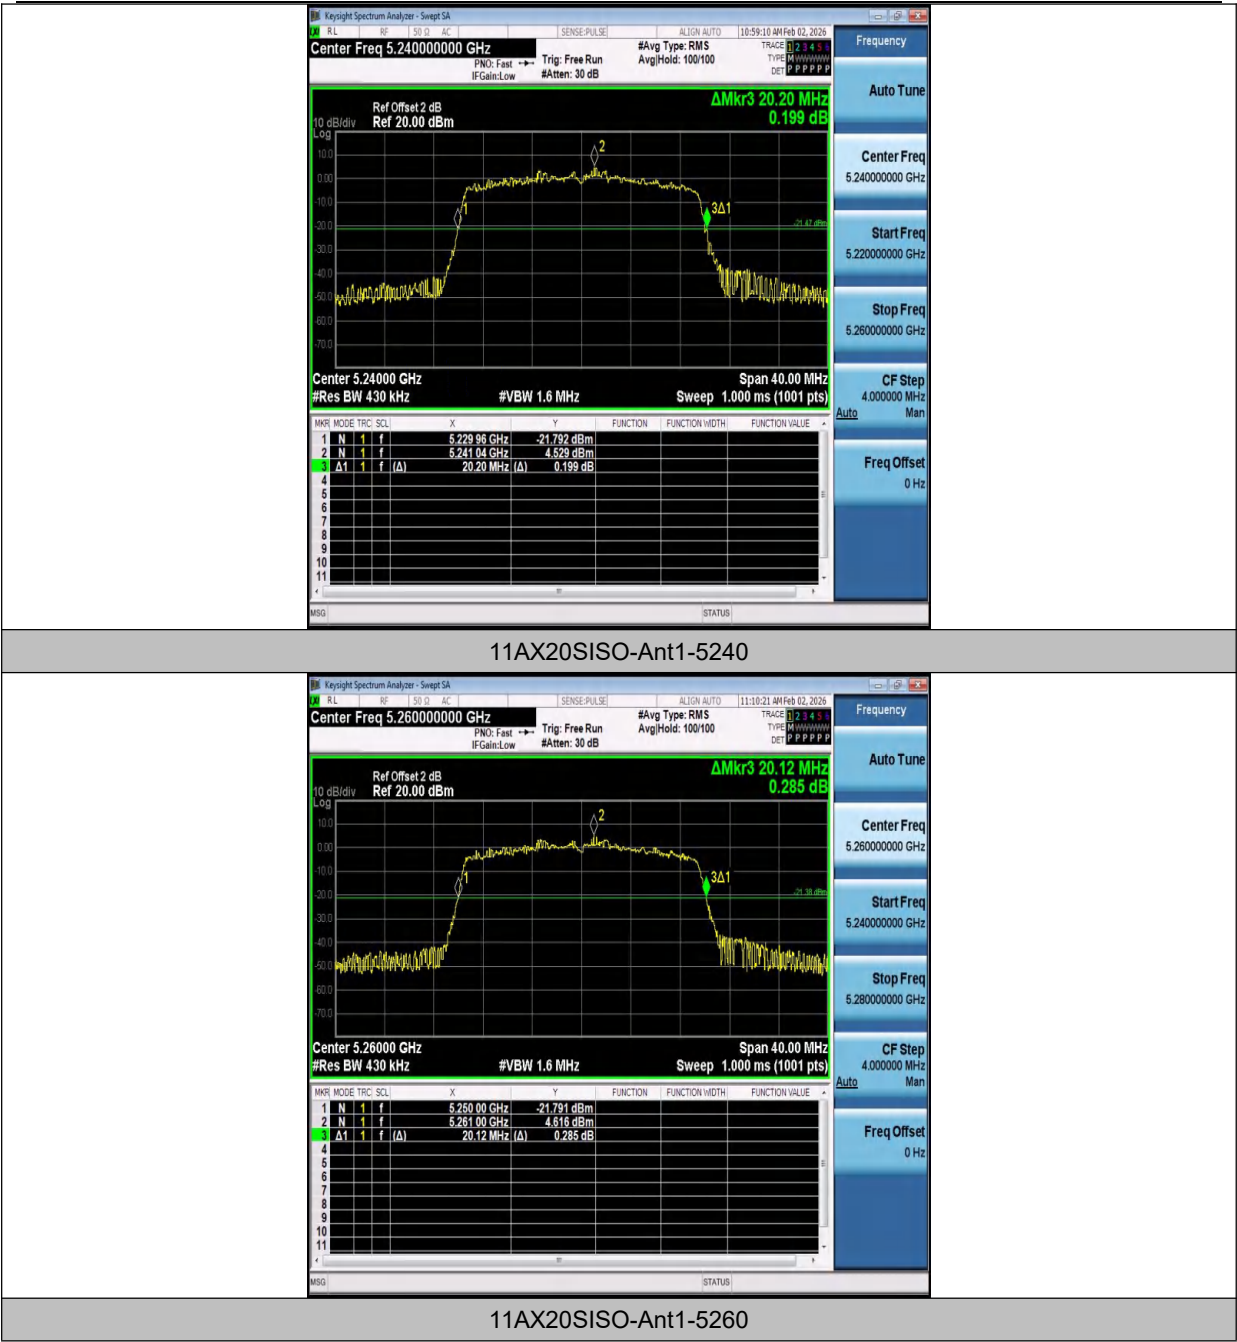

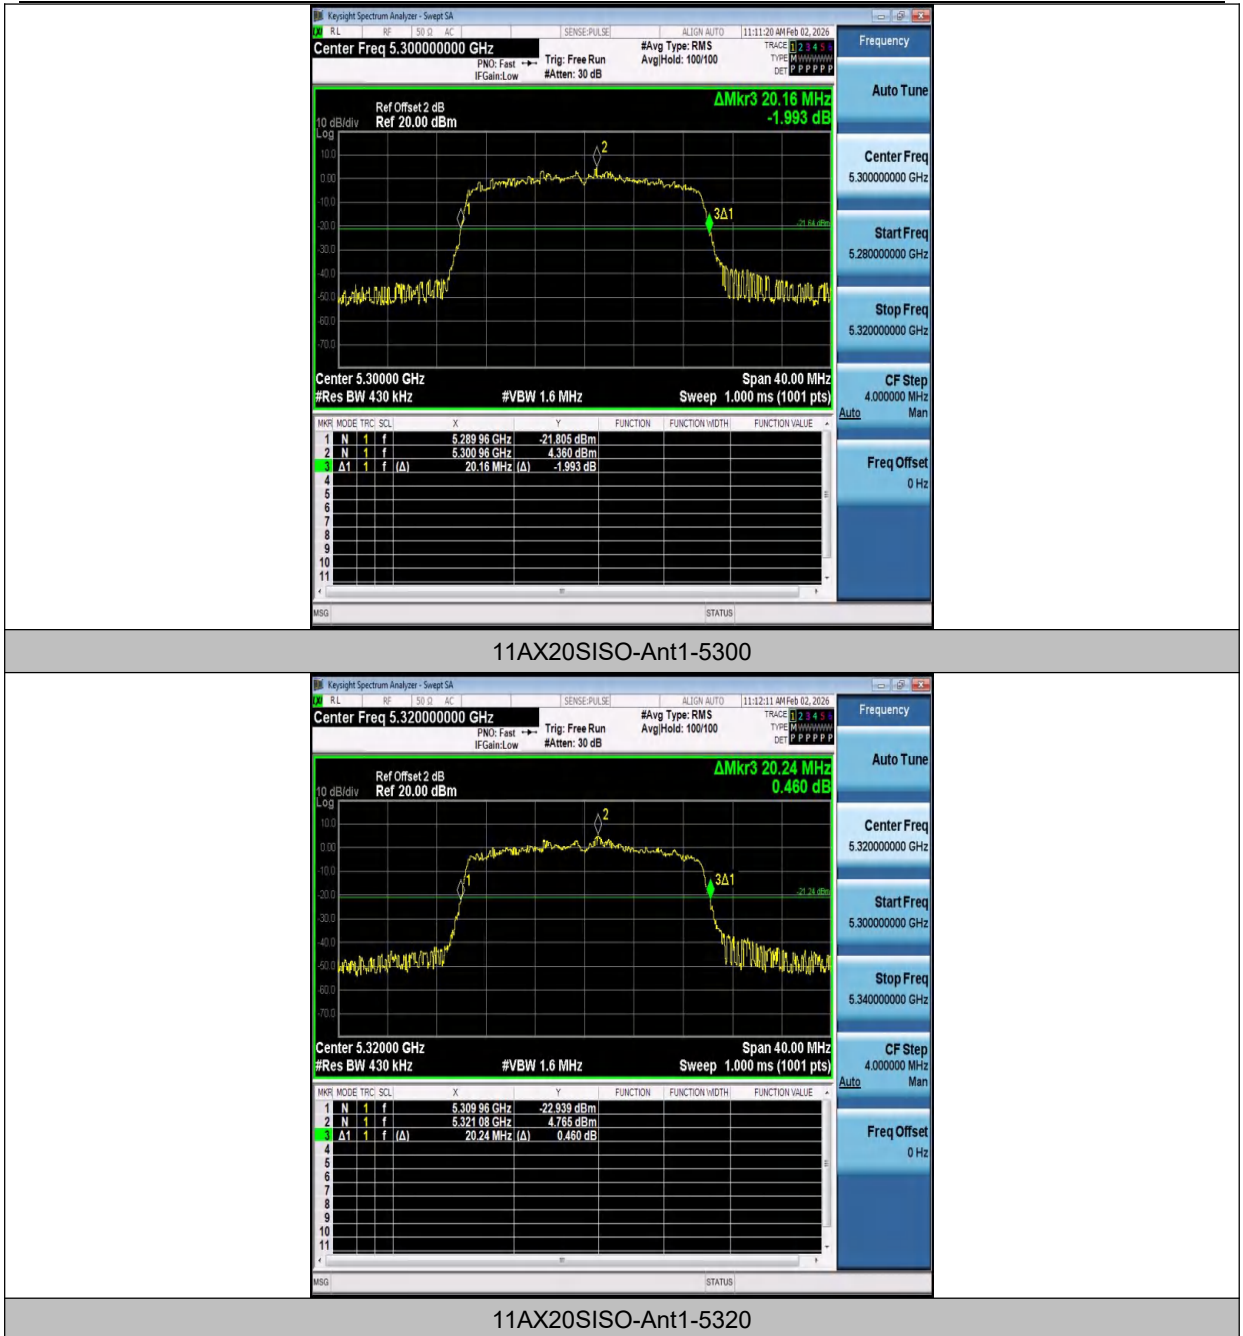


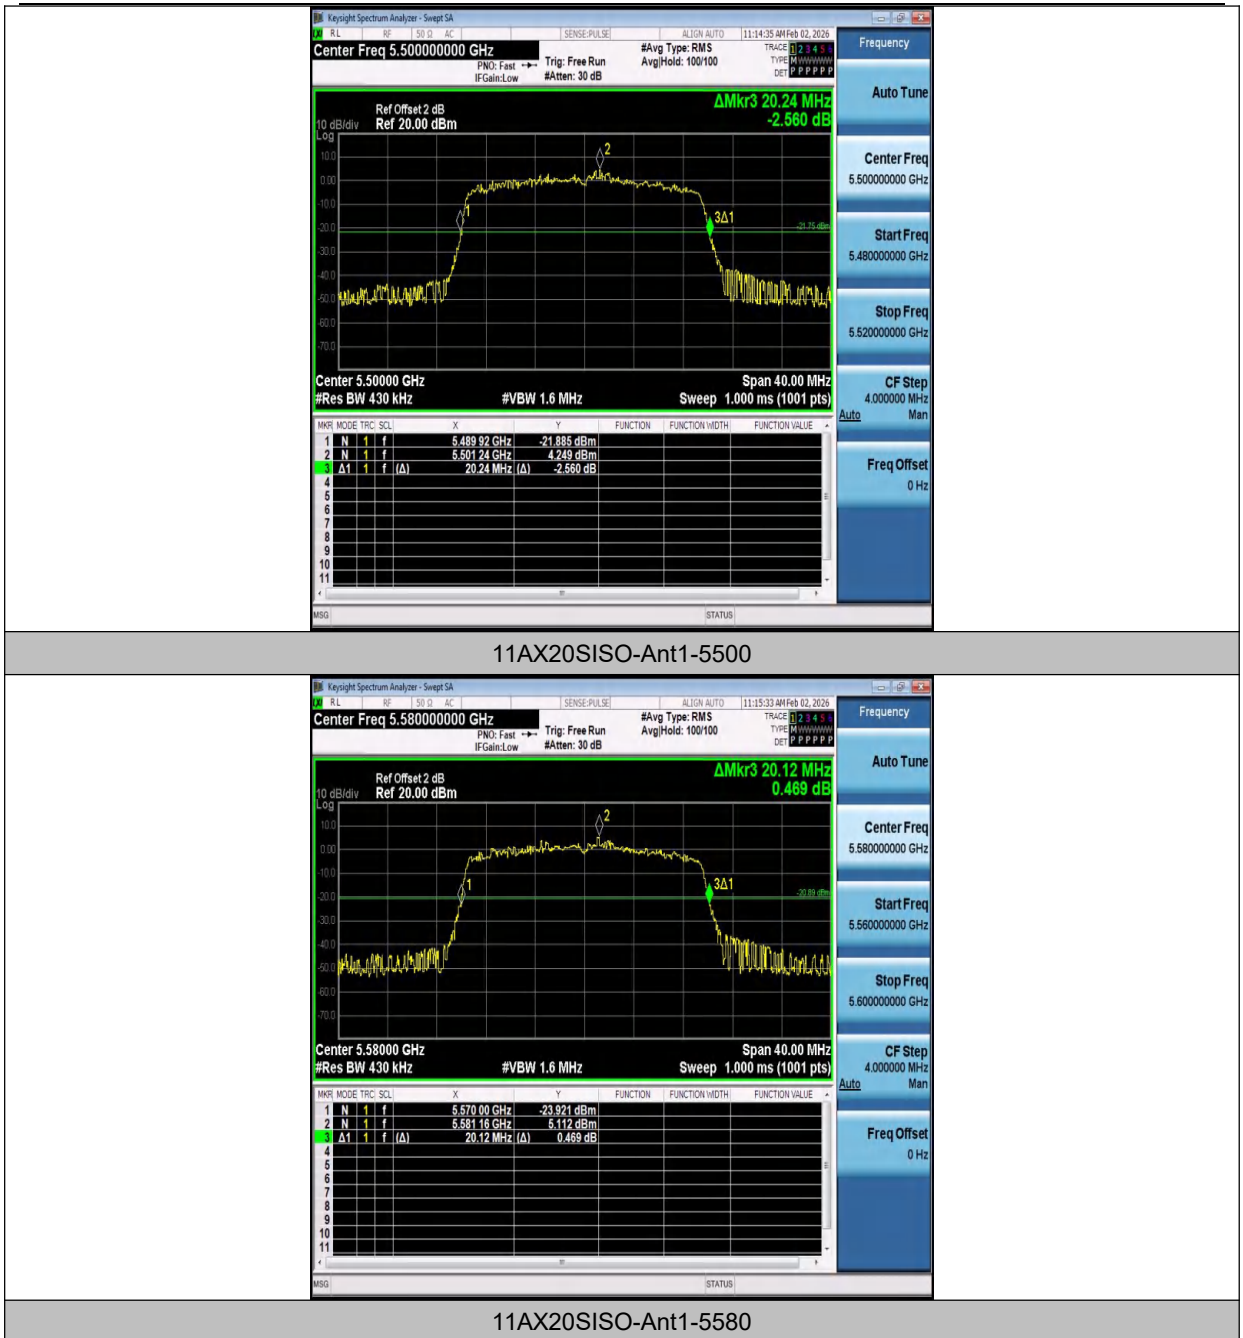


Shenzhen Anbotek Compliance Laboratory Limited


Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

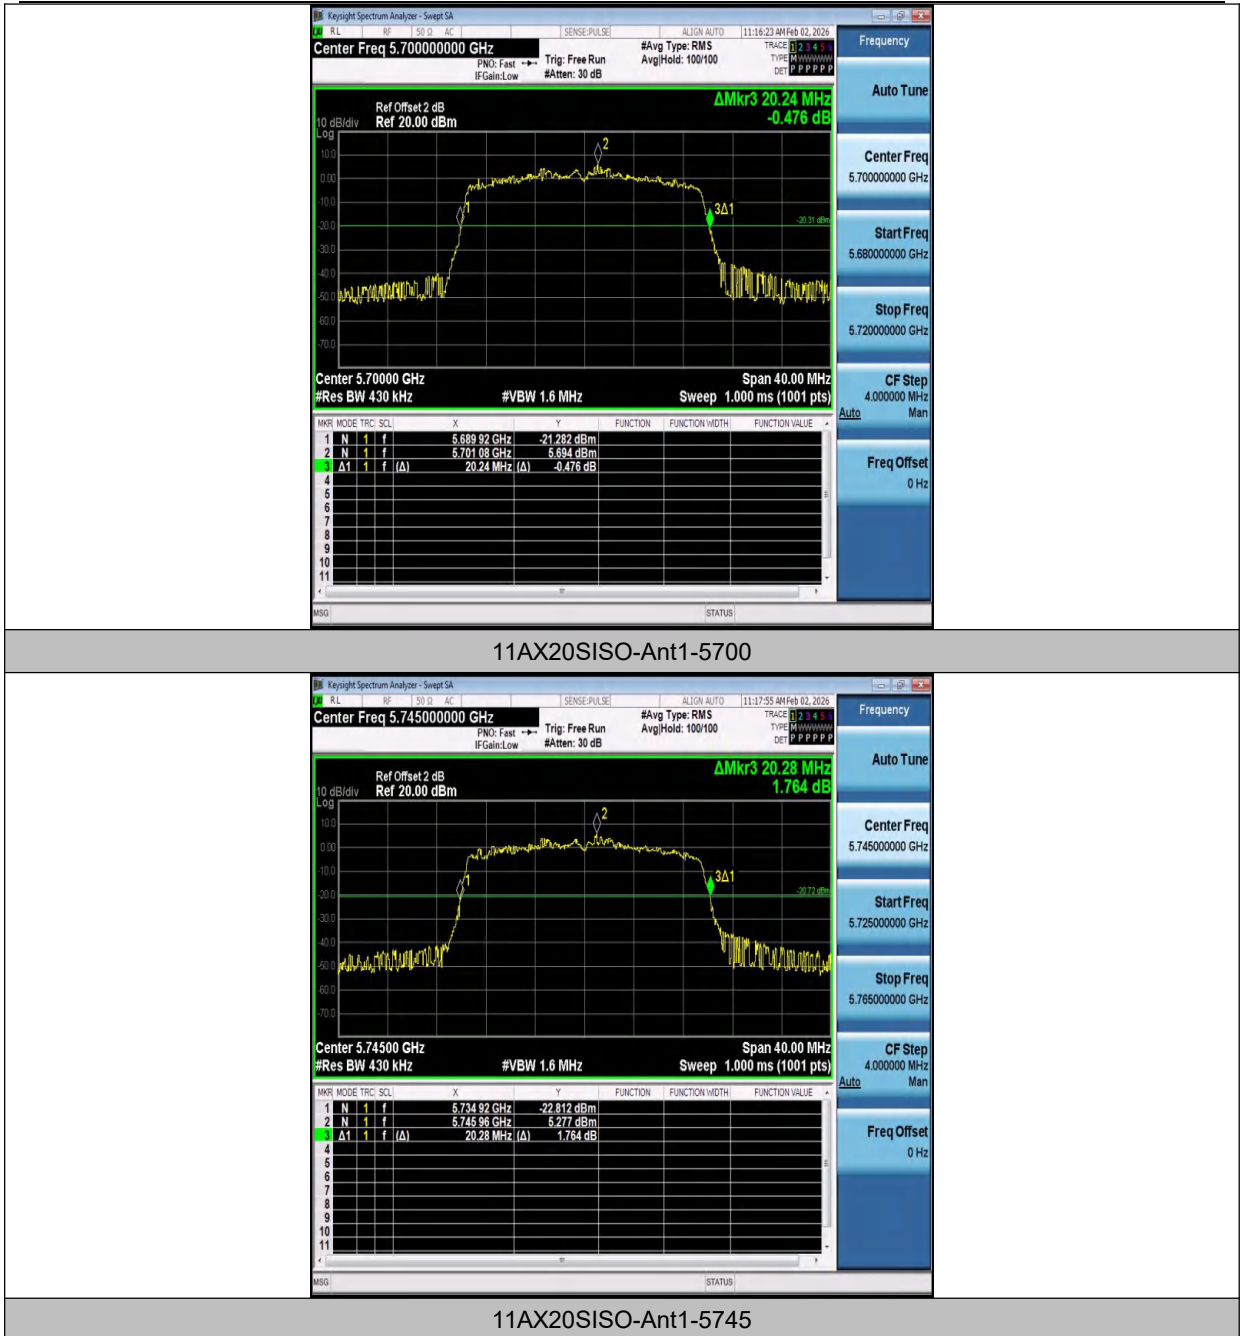



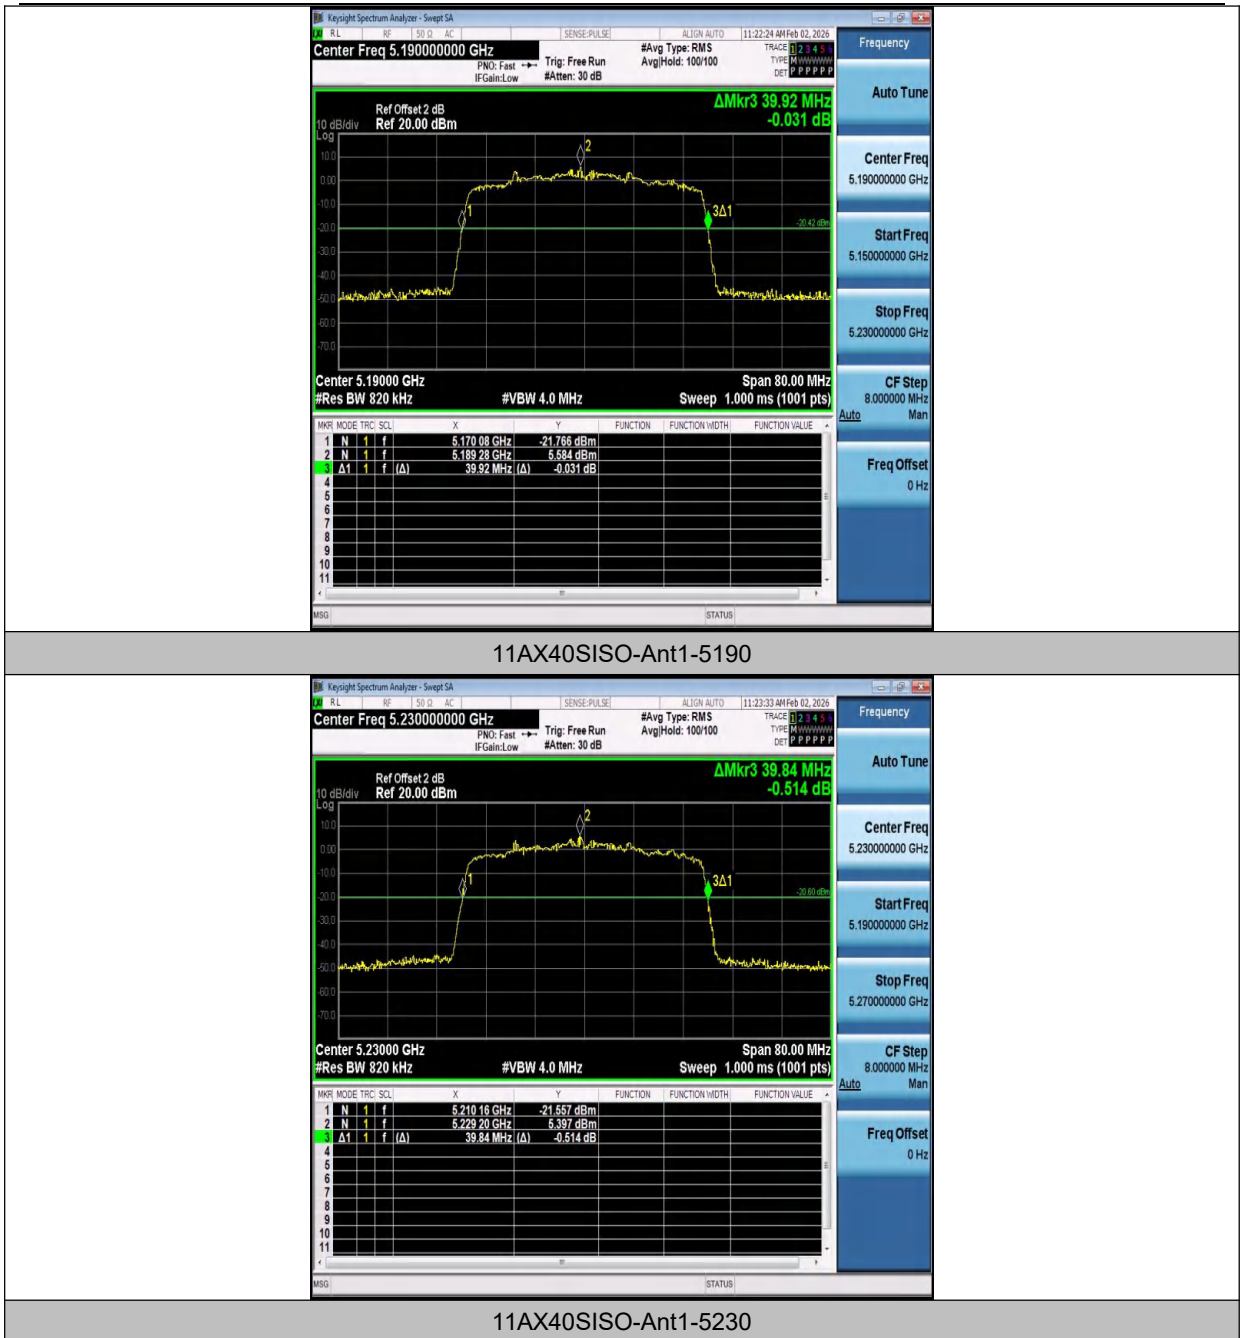

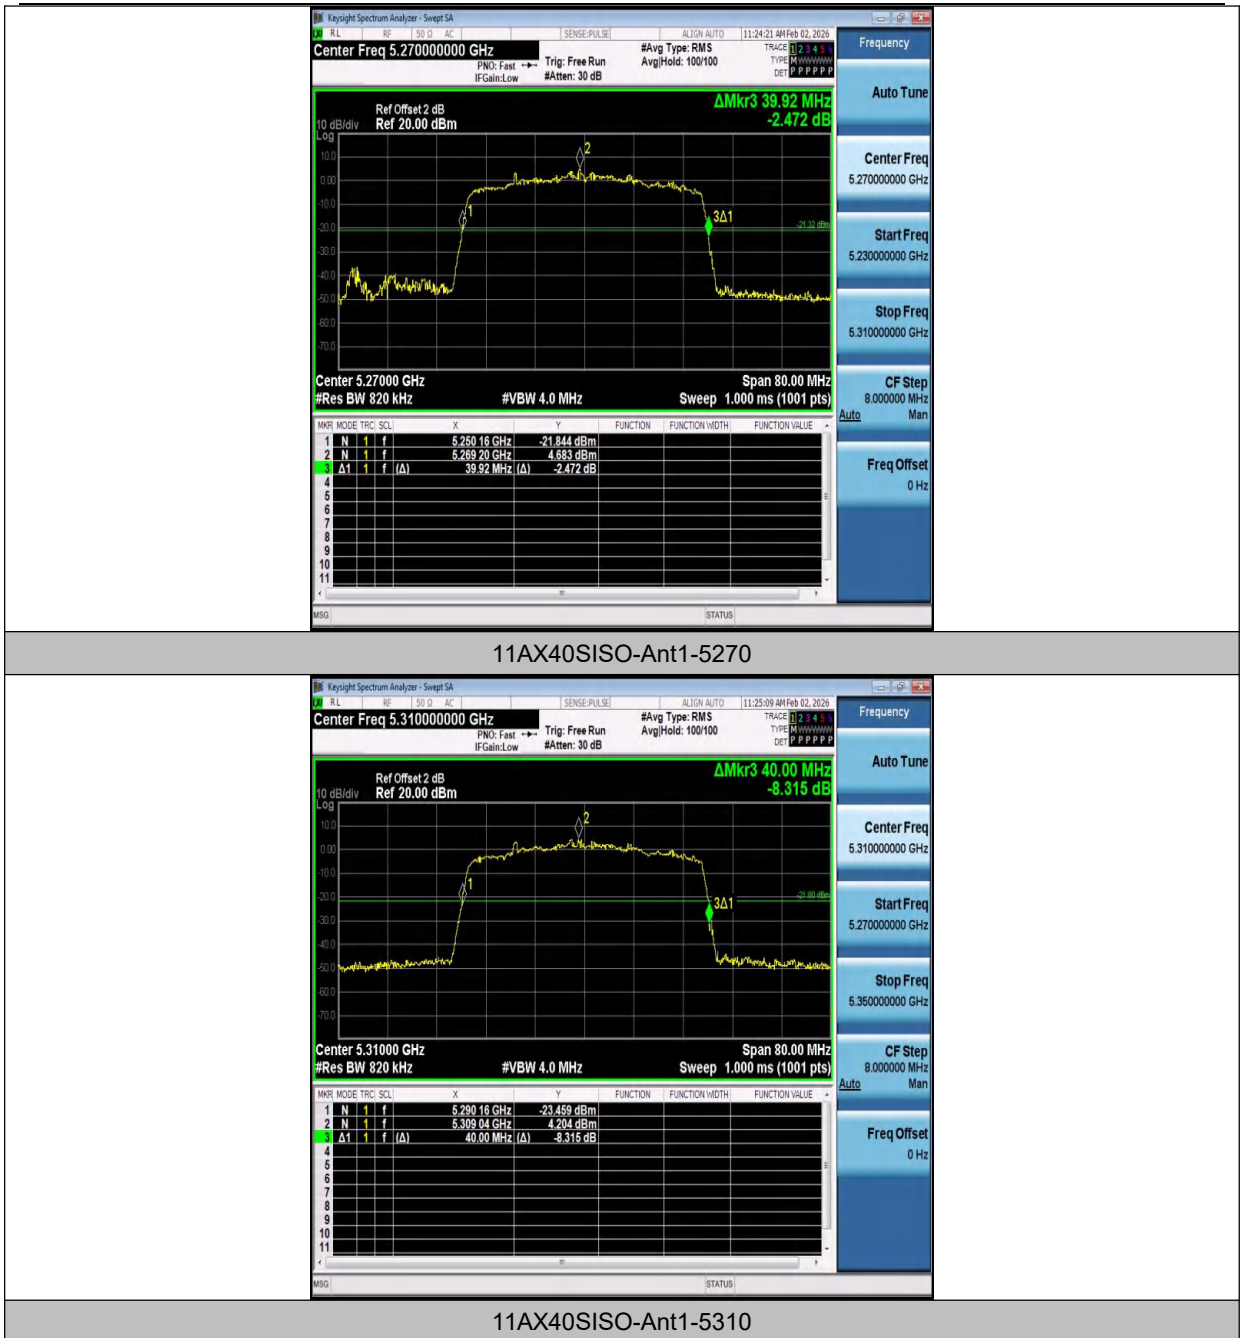


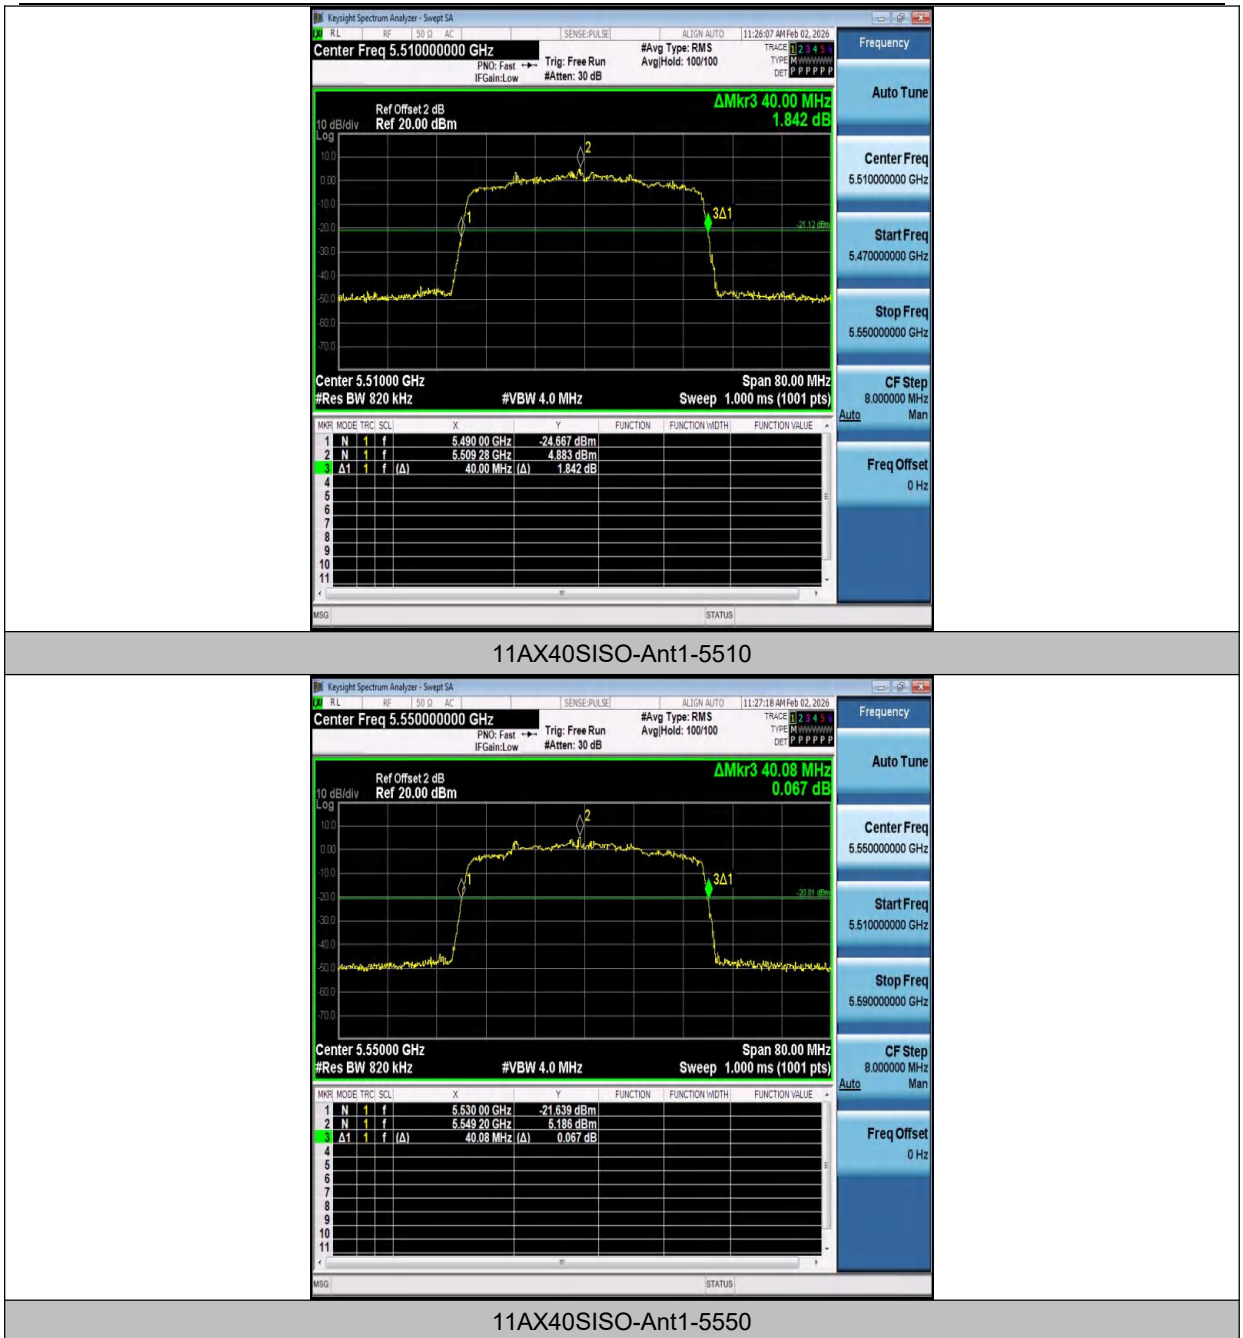


Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

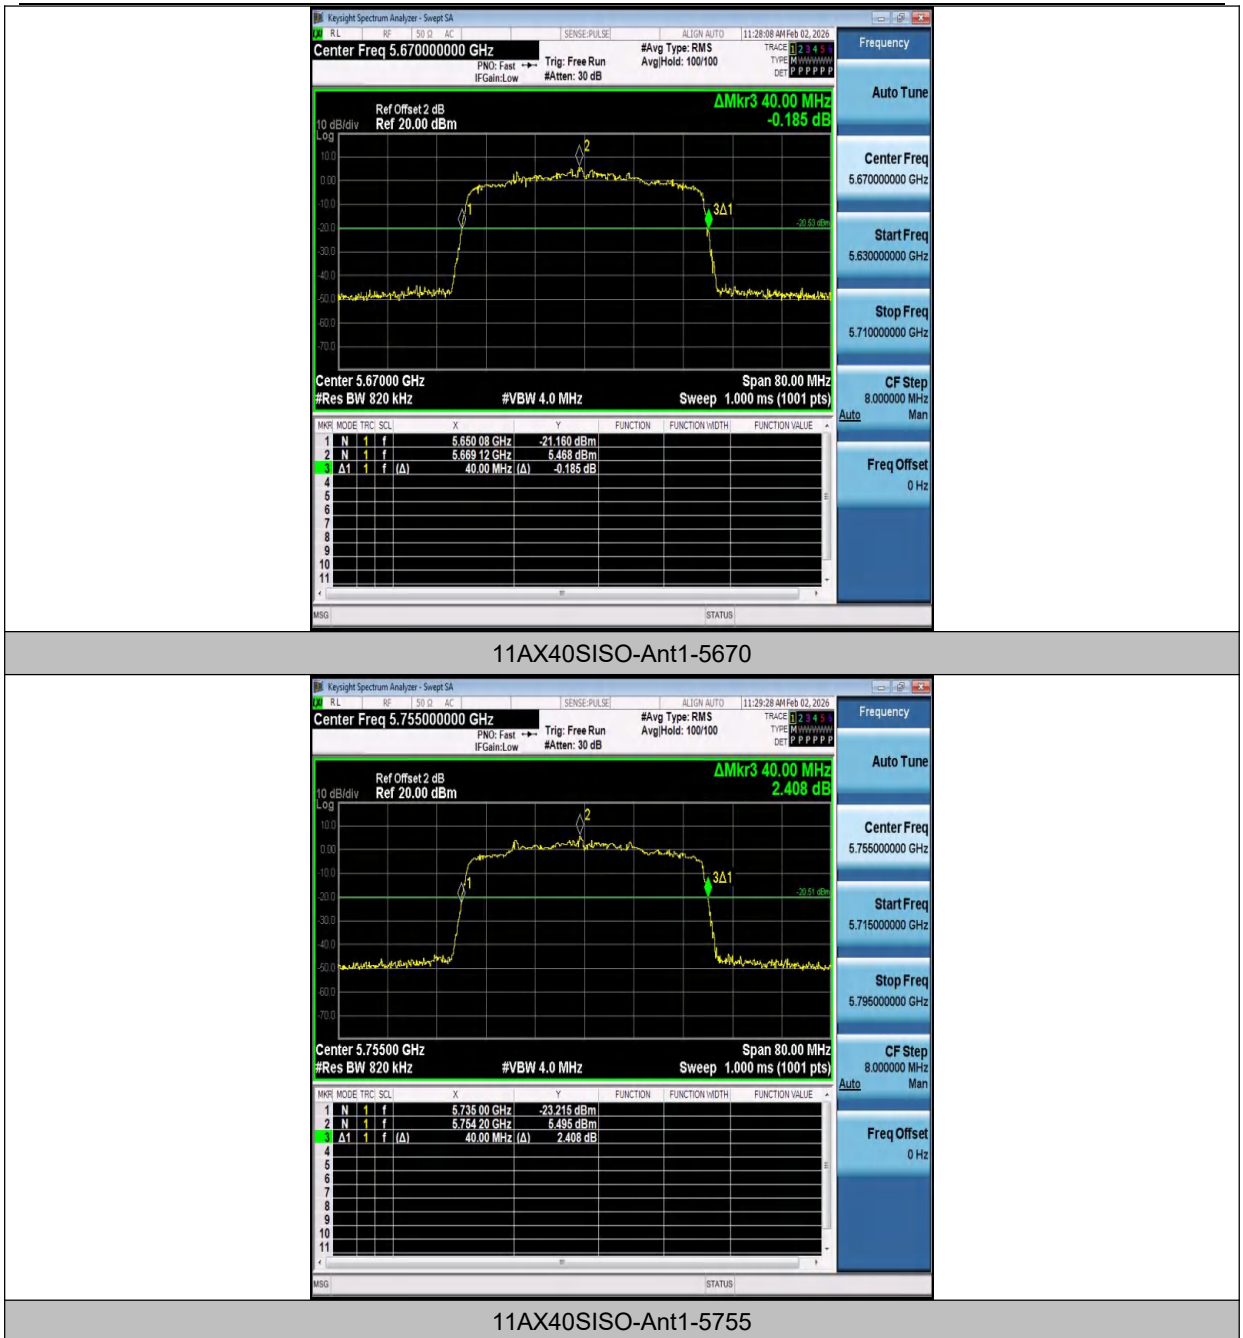


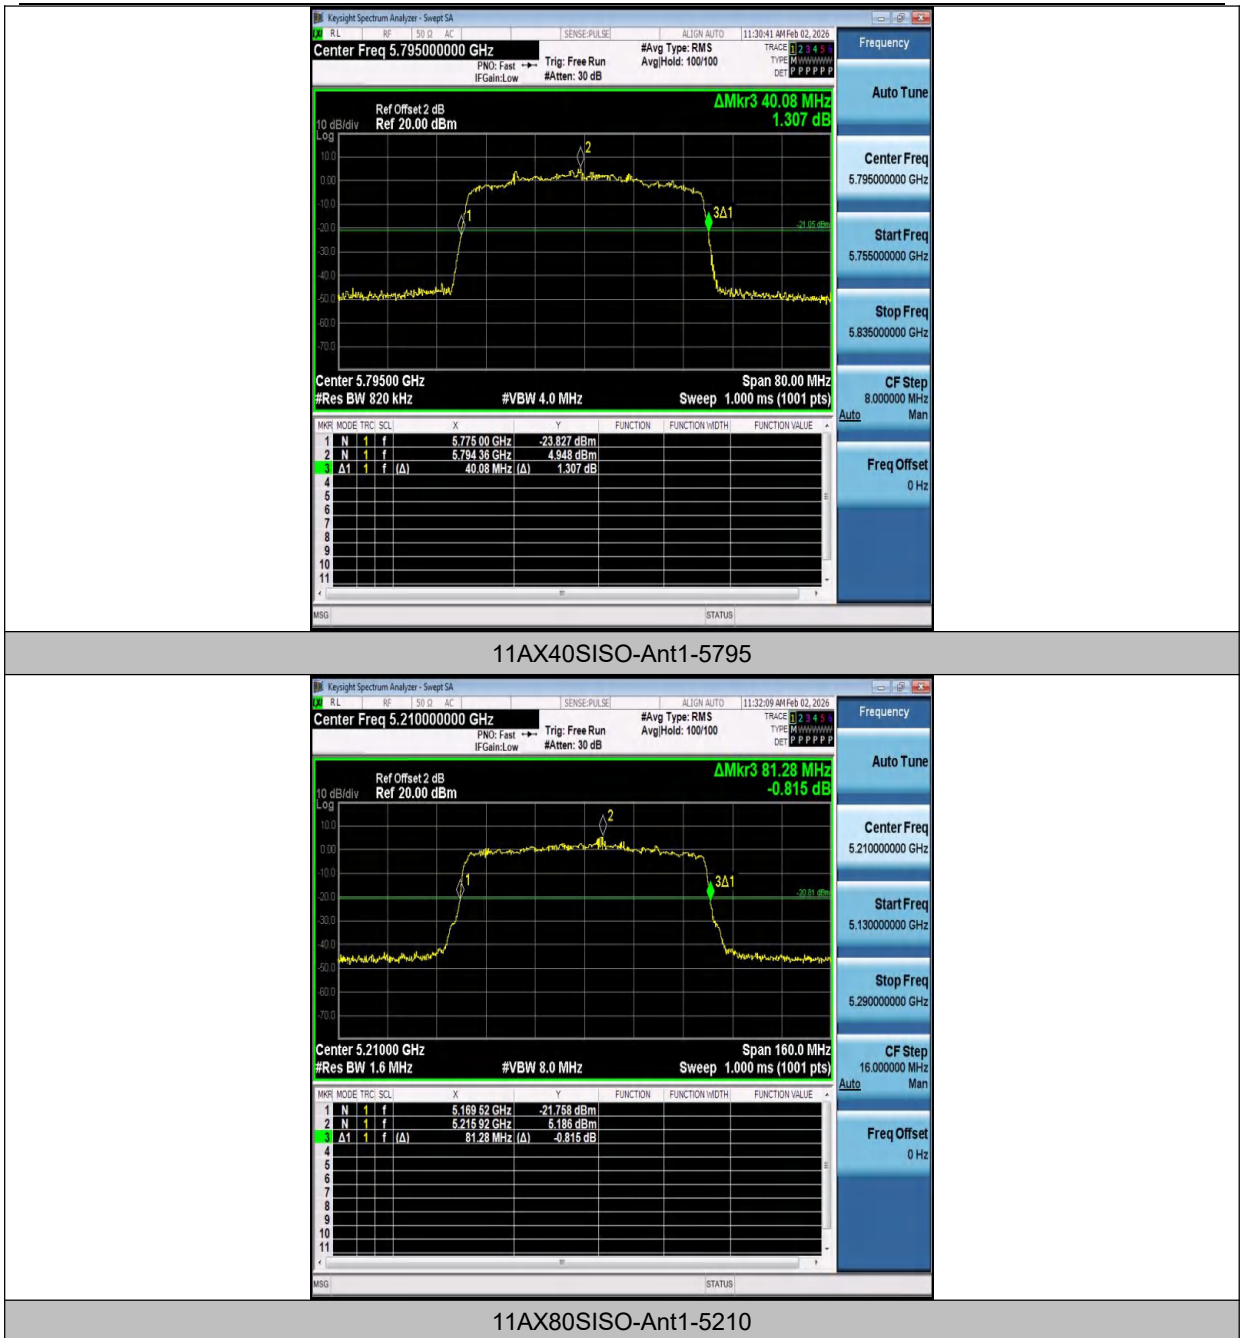

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

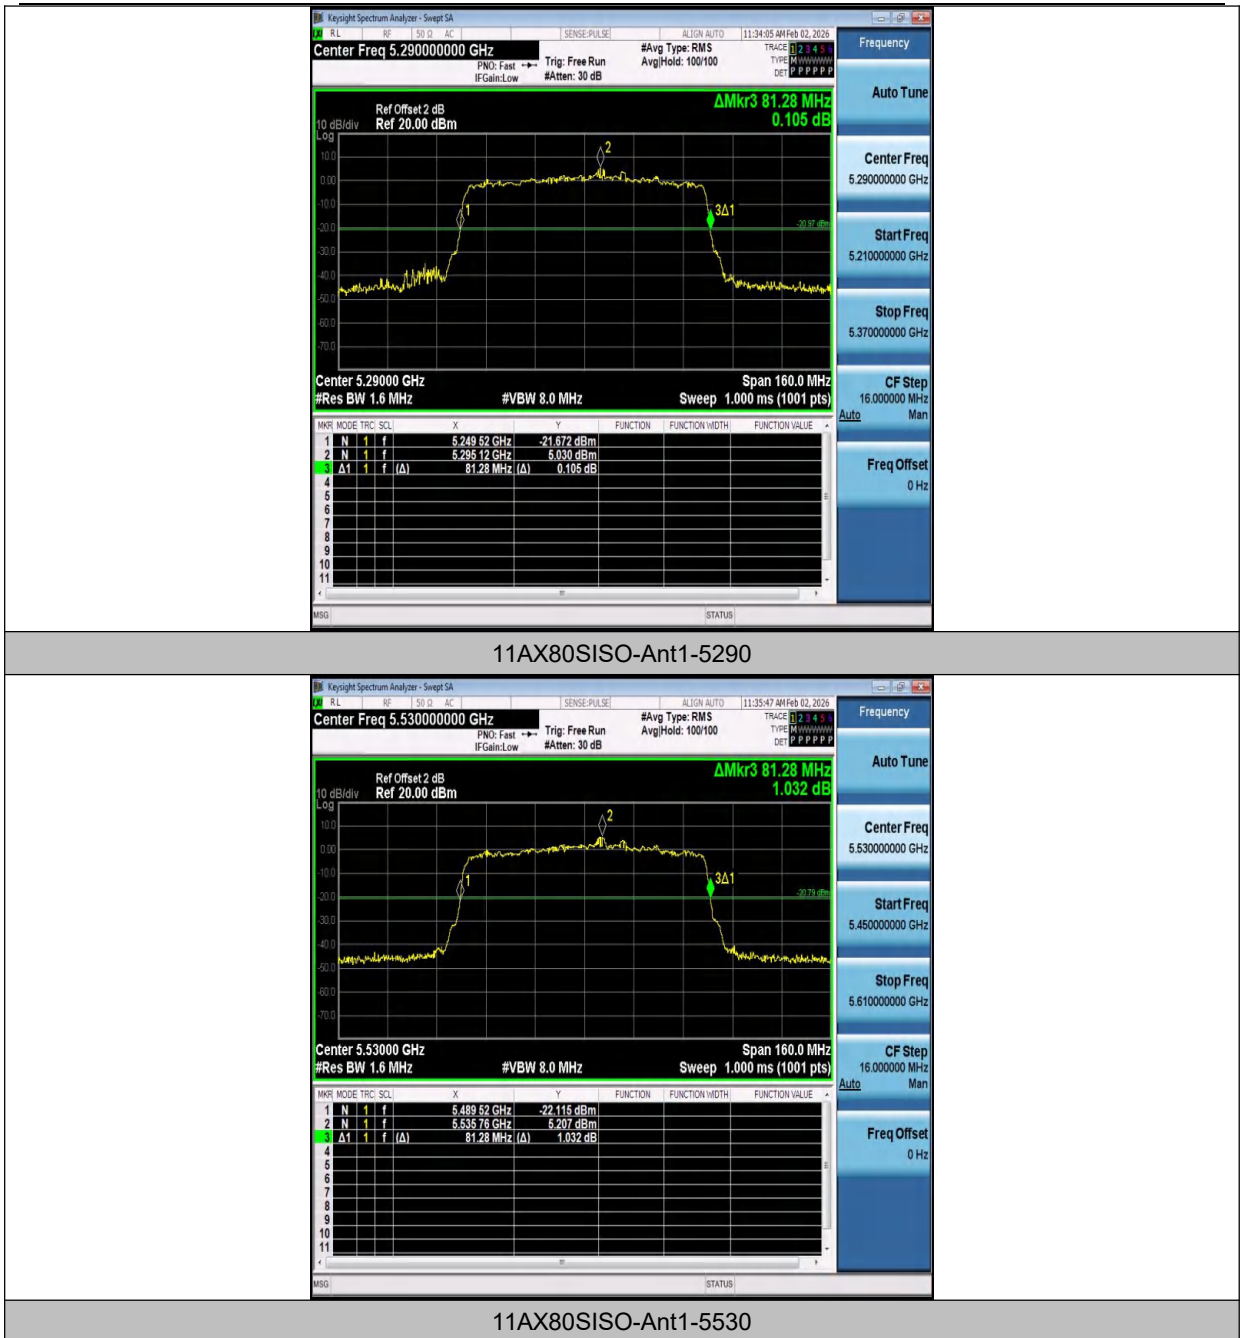

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com



11AX80SISO-Ant1-5775

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

Appendix A2: 99% Occupied Bandwidth

Test Result

Test Mode	Antenna	Frequency[MHz]	OCB [MHz]	FL[MHz]	FH[MHz]	Limit[MHz]	Verdict
11A	Ant1	5180	16.746	5171.6806	5188.4266	---	---
11A	Ant1	5220	16.792	5211.6143	5228.4063	---	---
11A	Ant1	5240	16.820	5231.6466	5248.4666	---	---
11A	Ant1	5260	16.698	5251.6760	5268.3740	---	---
11A	Ant1	5300	16.797	5291.6293	5308.4263	---	---
11A	Ant1	5320	16.841	5311.5901	5328.4311	---	---
11A	Ant1	5500	16.742	5491.6709	5508.4129	---	---
11A	Ant1	5580	16.846	5571.6225	5588.4685	---	---
11A	Ant1	5700	16.804	5691.6583	5708.4623	---	---
11A	Ant1	5745	16.776	5736.6053	5753.3813	---	---
11A	Ant1	5785	16.803	5776.6335	5793.4365	---	---
11A	Ant1	5825	16.729	5816.6767	5833.4057	---	---
11N20SISO	Ant1	5180	17.770	5171.1174	5188.8874	---	---
11N20SISO	Ant1	5220	17.797	5211.0968	5228.8938	---	---
11N20SISO	Ant1	5240	17.774	5231.1095	5248.8835	---	---
11N20SISO	Ant1	5260	17.777	5251.1251	5268.9021	---	---
11N20SISO	Ant1	5300	17.776	5291.1438	5308.9198	---	---
11N20SISO	Ant1	5320	17.735	5311.1478	5328.8828	---	---
11N20SISO	Ant1	5500	17.757	5491.1182	5508.8752	---	---
11N20SISO	Ant1	5580	17.779	5571.1850	5588.9640	---	---
11N20SISO	Ant1	5700	17.800	5691.1422	5708.9422	---	---
11N20SISO	Ant1	5745	17.732	5736.1209	5753.8529	---	---
11N20SISO	Ant1	5785	17.771	5776.1637	5793.9347	---	---
11N20SISO	Ant1	5825	17.715	5816.1433	5833.8583	---	---
11N40SISO	Ant1	5190	36.147	5172.0073	5208.1543	---	---
11N40SISO	Ant1	5230	36.061	5211.9824	5248.0434	---	---
11N40SISO	Ant1	5270	36.172	5251.9276	5288.0996	---	---
11N40SISO	Ant1	5310	36.192	5291.8816	5328.0736	---	---
11N40SISO	Ant1	5510	36.172	5491.9657	5528.1377	---	---
11N40SISO	Ant1	5550	35.974	5532.0834	5568.0574	---	---
11N40SISO	Ant1	5670	36.094	5651.9977	5688.0917	---	---
11N40SISO	Ant1	5755	36.053	5736.9930	5773.0460	---	---
11N40SISO	Ant1	5795	36.179	5776.9858	5813.1648	---	---
11AC20SISO	Ant1	5180	17.779	5171.1466	5188.9256	---	---
11AC20SISO	Ant1	5220	17.813	5211.1512	5228.9642	---	---
11AC20SISO	Ant1	5240	17.716	5231.1503	5248.8663	---	---
11AC20SISO	Ant1	5260	17.779	5251.1355	5268.9145	---	---
11AC20SISO	Ant1	5300	17.804	5291.1018	5308.9058	---	---

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

11AC20SISO	Ant1	5320	17.784	5311.1384	5328.9224	---	---
11AC20SISO	Ant1	5500	17.764	5491.1523	5508.9163	---	---
11AC20SISO	Ant1	5580	17.765	5571.1532	5588.9182	---	---
11AC20SISO	Ant1	5700	17.749	5691.1479	5708.8969	---	---
11AC20SISO	Ant1	5745	17.792	5736.0910	5753.8830	---	---
11AC20SISO	Ant1	5785	17.773	5776.1261	5793.8991	---	---
11AC20SISO	Ant1	5825	17.798	5816.1189	5833.9169	---	---
11AC40SISO	Ant1	5190	36.107	5171.9667	5208.0737	---	---
11AC40SISO	Ant1	5230	36.056	5211.9835	5248.0395	---	---
11AC40SISO	Ant1	5270	36.023	5252.0198	5288.0428	---	---
11AC40SISO	Ant1	5310	36.080	5292.0405	5328.1205	---	---
11AC40SISO	Ant1	5510	36.140	5492.0266	5528.1666	---	---
11AC40SISO	Ant1	5550	36.121	5532.0280	5568.1490	---	---
11AC40SISO	Ant1	5670	36.132	5651.9928	5688.1248	---	---
11AC40SISO	Ant1	5755	36.122	5736.9582	5773.0802	---	---
11AC40SISO	Ant1	5795	36.019	5777.0403	5813.0593	---	---
11AC80SISO	Ant1	5210	75.209	5172.4475	5247.6565	---	---
11AC80SISO	Ant1	5290	75.421	5252.3452	5327.7662	---	---
11AC80SISO	Ant1	5530	75.336	5492.5693	5567.9053	---	---
11AC80SISO	Ant1	5775	75.419	5737.2685	5812.6875	---	---
11AX20SISO	Ant1	5180	18.631	5170.6620	5189.2930	---	---
11AX20SISO	Ant1	5220	18.576	5210.7028	5229.2788	---	---
11AX20SISO	Ant1	5240	18.633	5230.6639	5249.2969	---	---
11AX20SISO	Ant1	5260	18.588	5250.6992	5269.2872	---	---
11AX20SISO	Ant1	5300	18.650	5290.6588	5309.3088	---	---
11AX20SISO	Ant1	5320	18.640	5310.6546	5329.2946	---	---
11AX20SISO	Ant1	5500	18.606	5490.6803	5509.2863	---	---
11AX20SISO	Ant1	5580	18.633	5570.6538	5589.2868	---	---
11AX20SISO	Ant1	5700	18.624	5690.6651	5709.2891	---	---
11AX20SISO	Ant1	5745	18.599	5735.6802	5754.2792	---	---
11AX20SISO	Ant1	5785	18.585	5775.6870	5794.2720	---	---
11AX20SISO	Ant1	5825	18.636	5815.6334	5834.2694	---	---
11AX40SISO	Ant1	5190	36.980	5171.6242	5208.6042	---	---
11AX40SISO	Ant1	5230	37.011	5211.6102	5248.6212	---	---
11AX40SISO	Ant1	5270	37.002	5251.6136	5288.6156	---	---
11AX40SISO	Ant1	5310	36.976	5291.6656	5328.6416	---	---
11AX40SISO	Ant1	5510	37.006	5491.6007	5528.6067	---	---
11AX40SISO	Ant1	5550	37.006	5531.6064	5568.6124	---	---
11AX40SISO	Ant1	5670	37.027	5651.6046	5688.6316	---	---
11AX40SISO	Ant1	5755	36.928	5736.5870	5773.5150	---	---
11AX40SISO	Ant1	5795	37.025	5776.5609	5813.5859	---	---
11AX80SISO	Ant1	5210	76.427	5171.9673	5248.3943	---	---


Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

11AX80SISO	Ant1	5290	76.528	5252.0153	5328.5433	---	---
11AX80SISO	Ant1	5530	76.339	5492.2235	5568.5625	---	---
11AX80SISO	Ant1	5775	76.470	5737.0796	5813.5496	---	---


Test Graphs

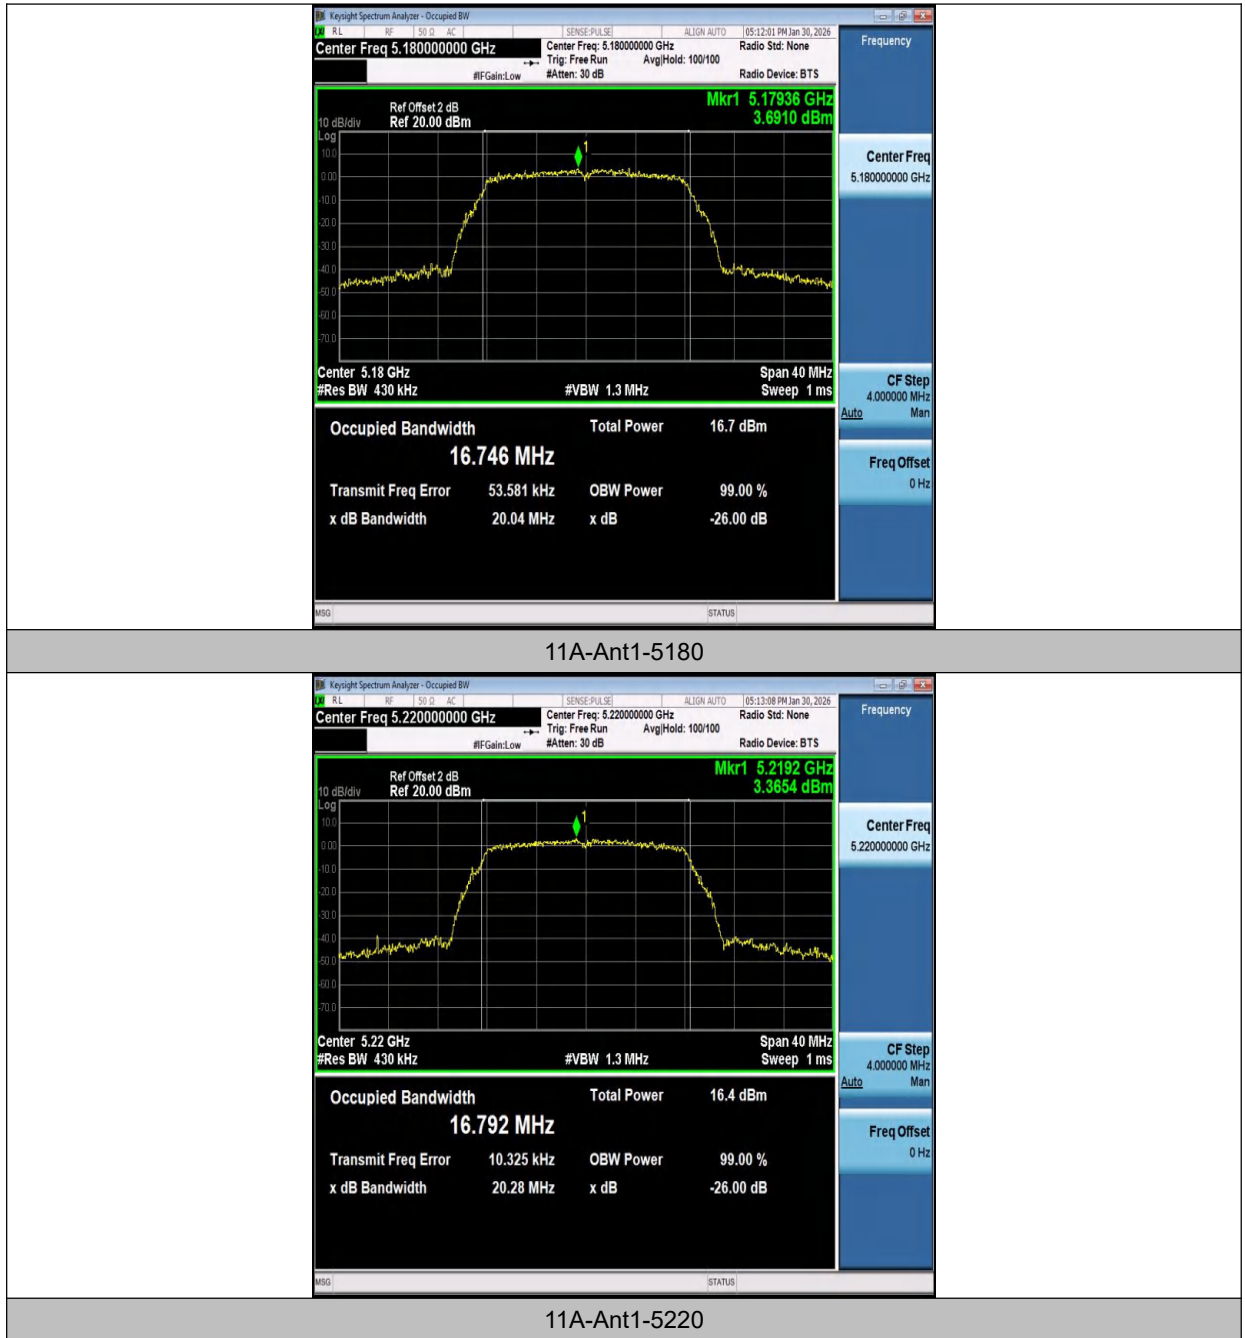



Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

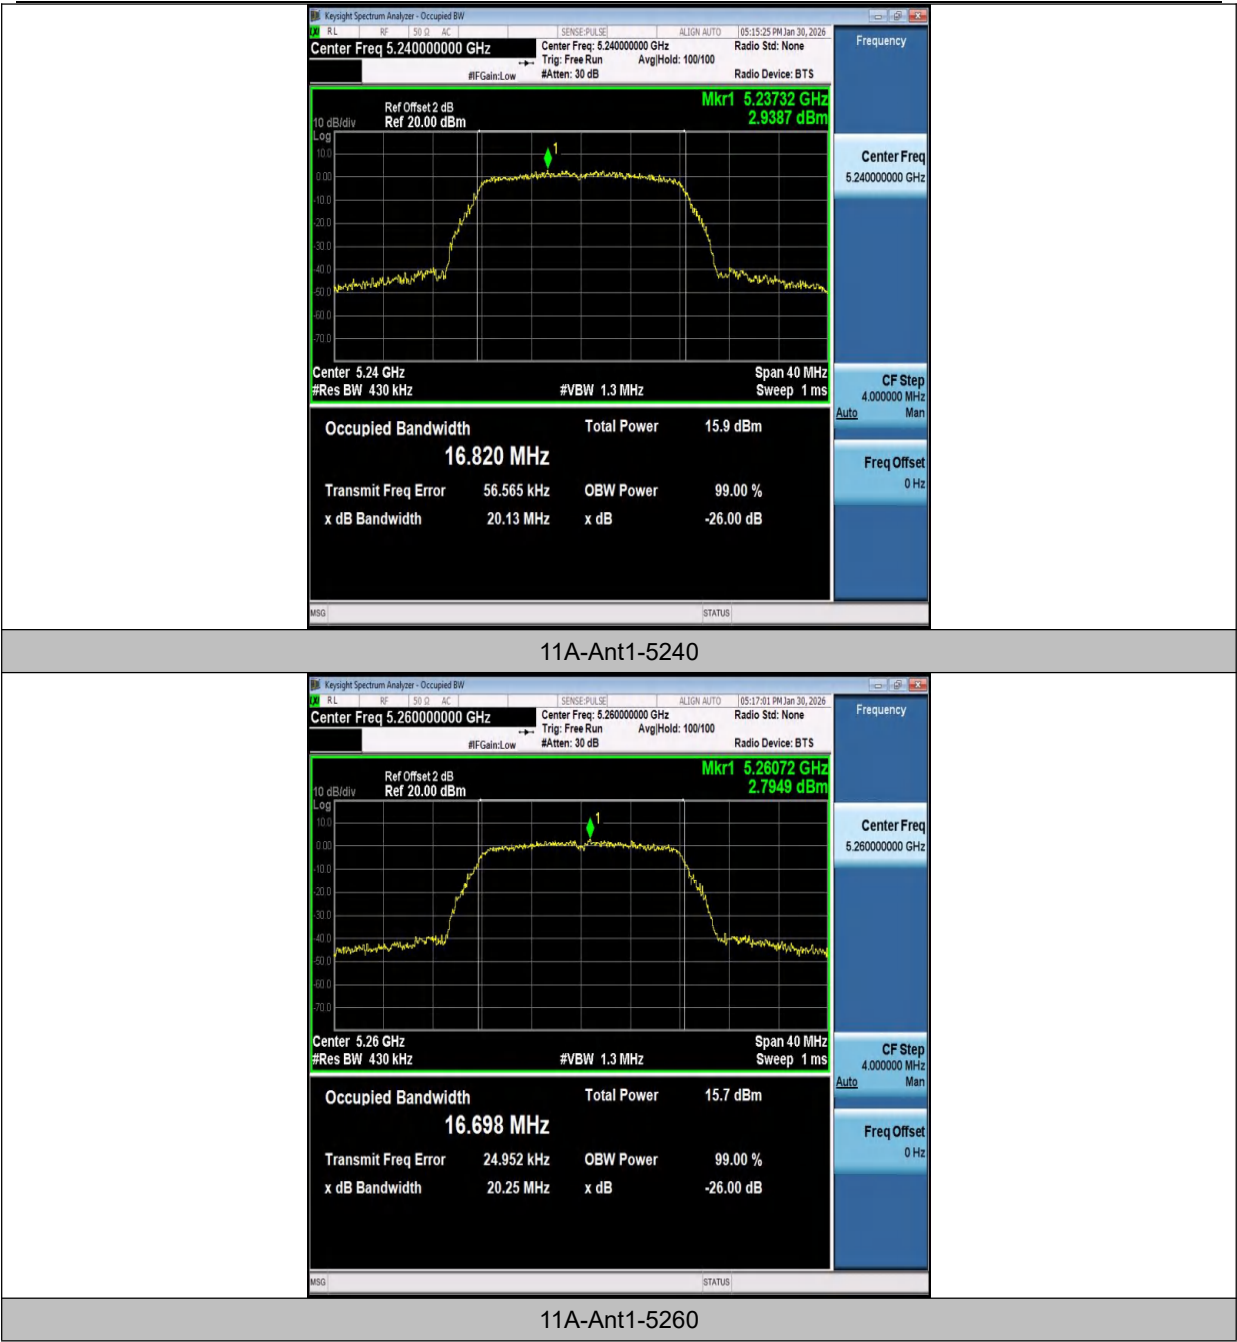

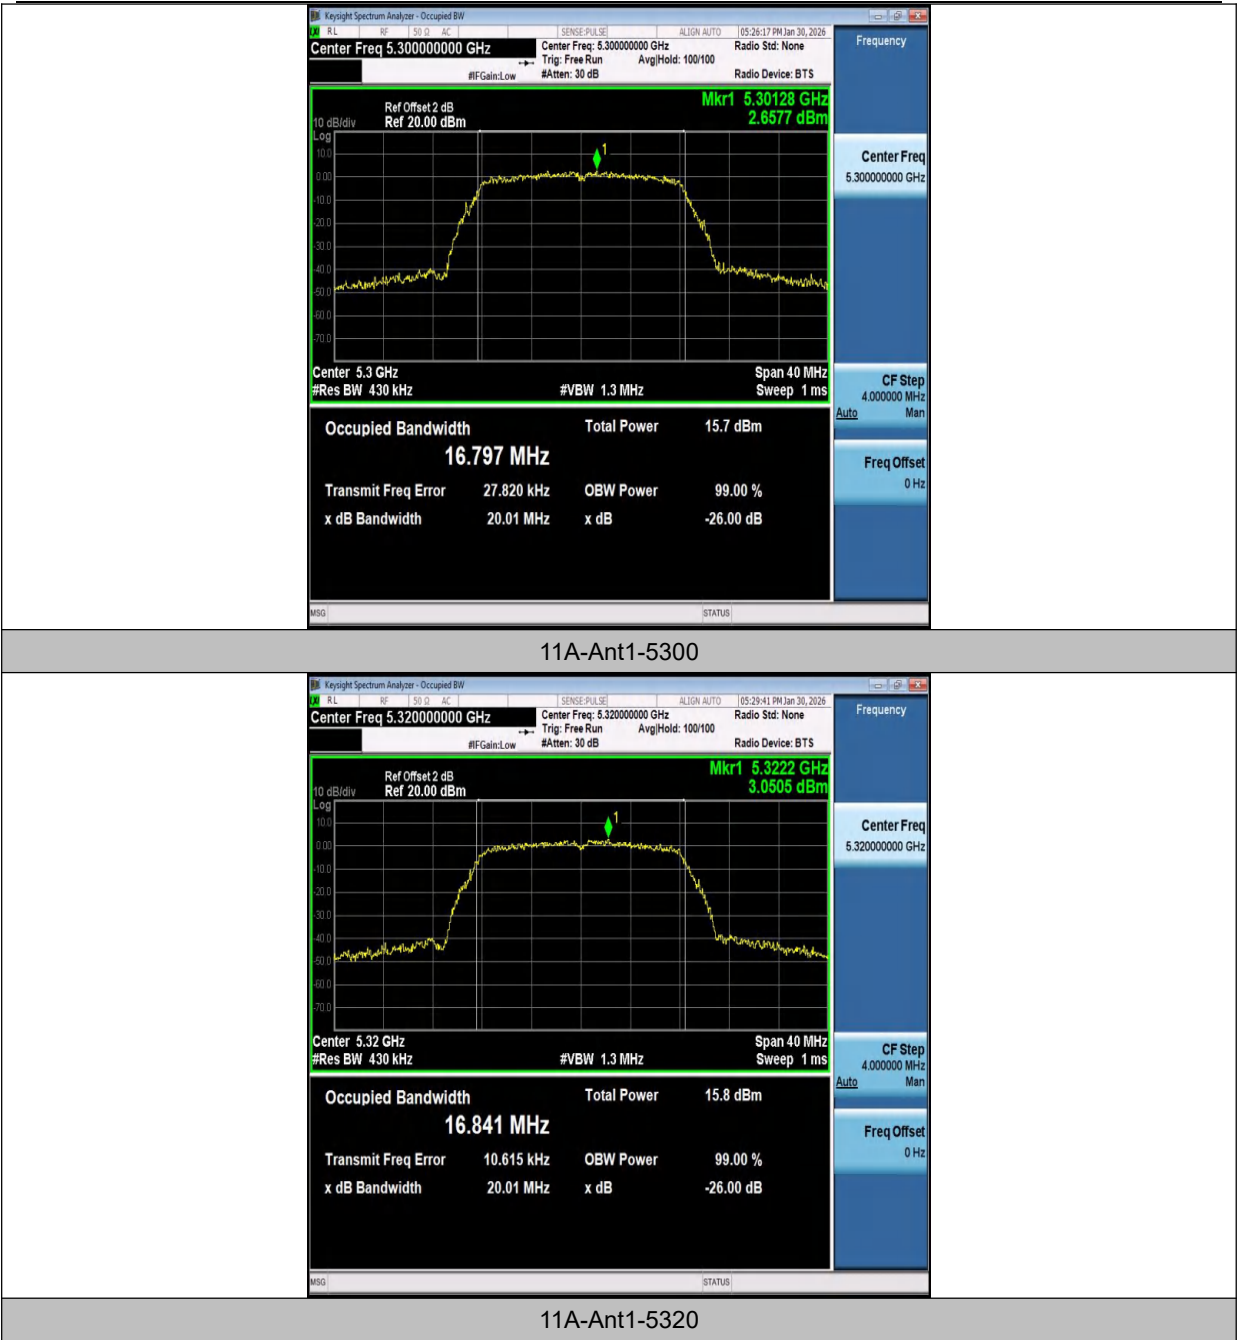


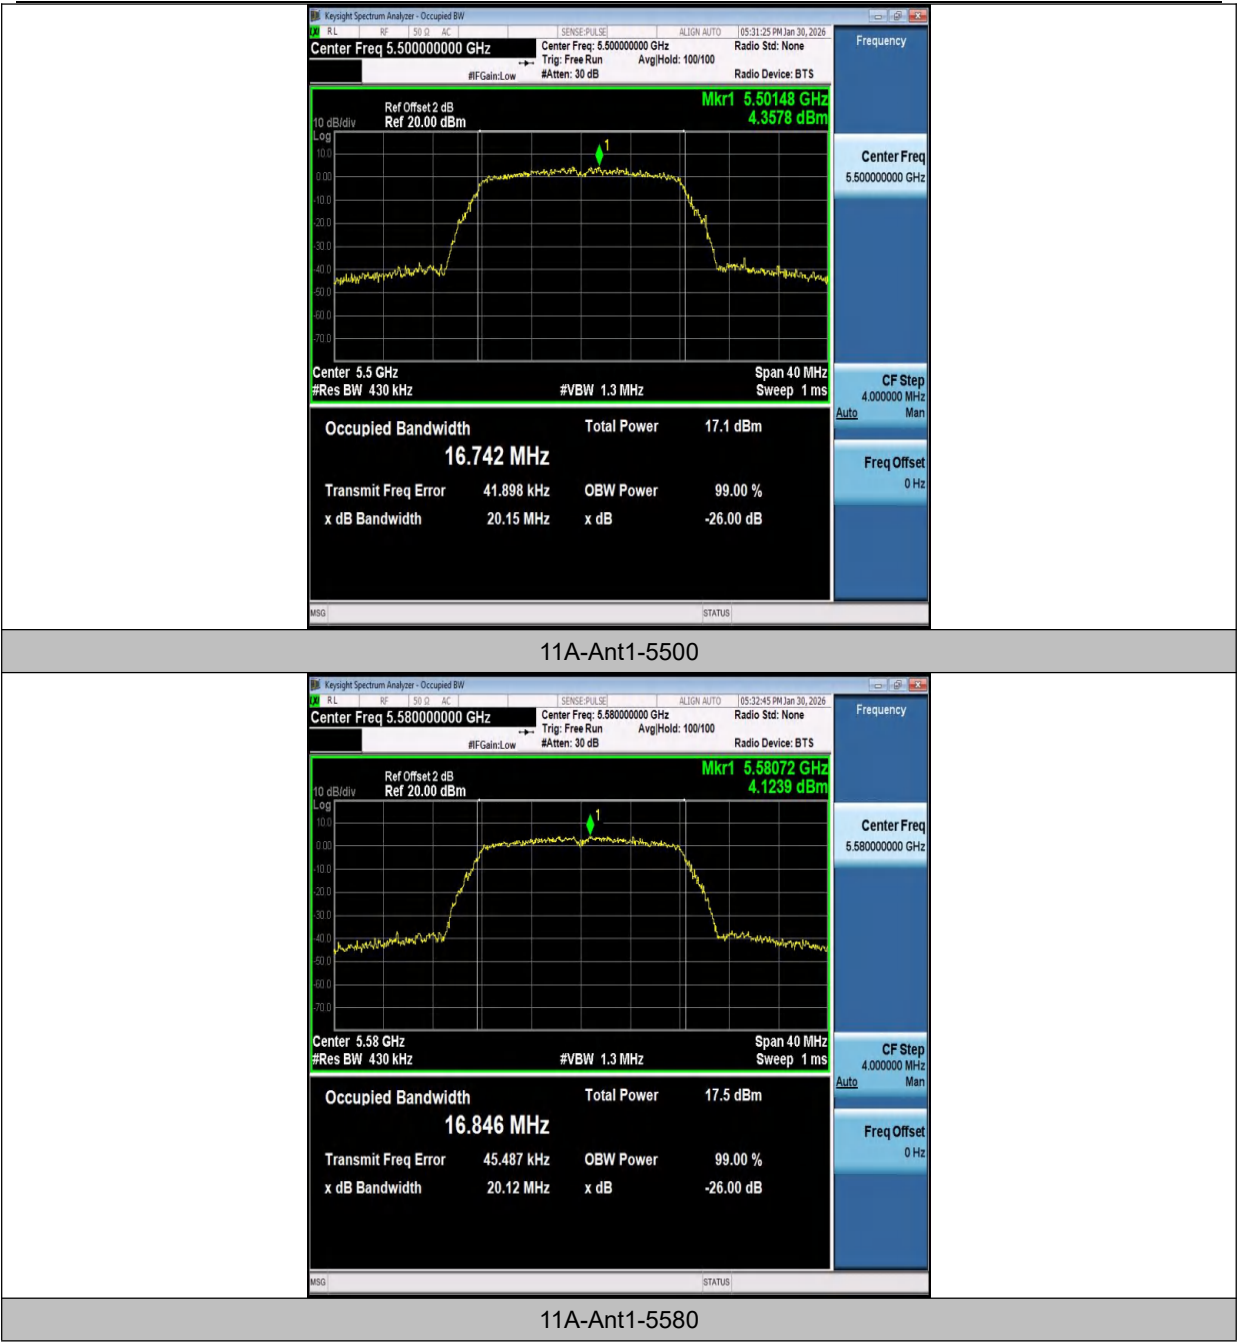


Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

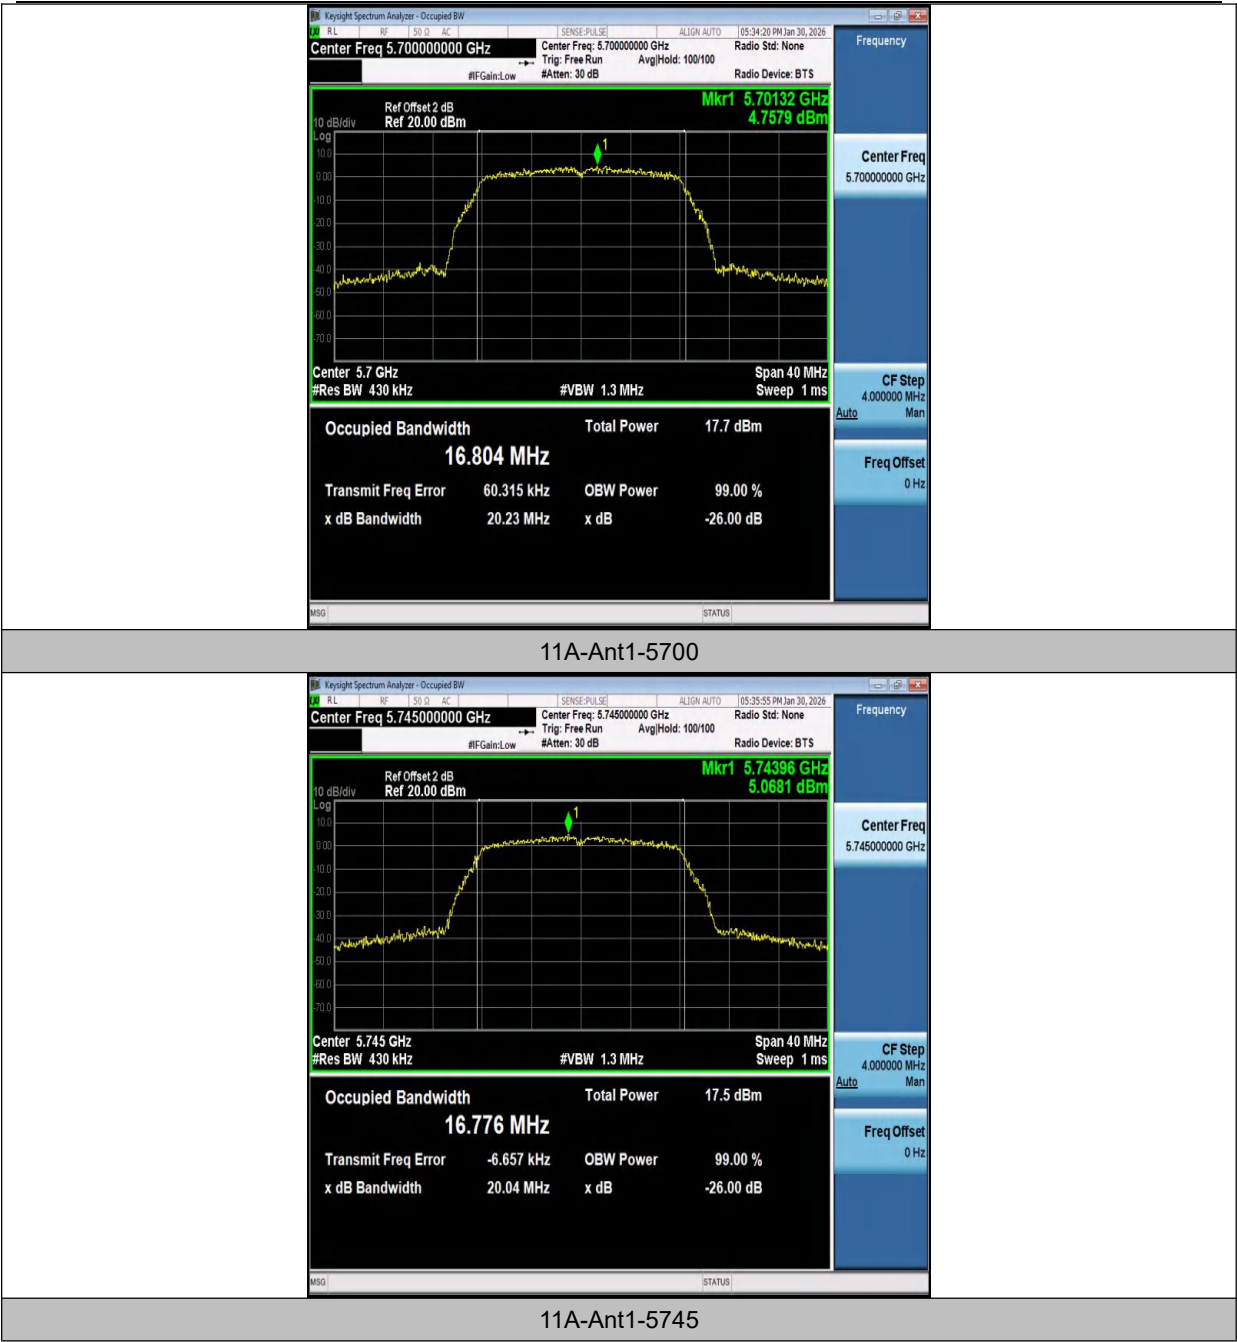


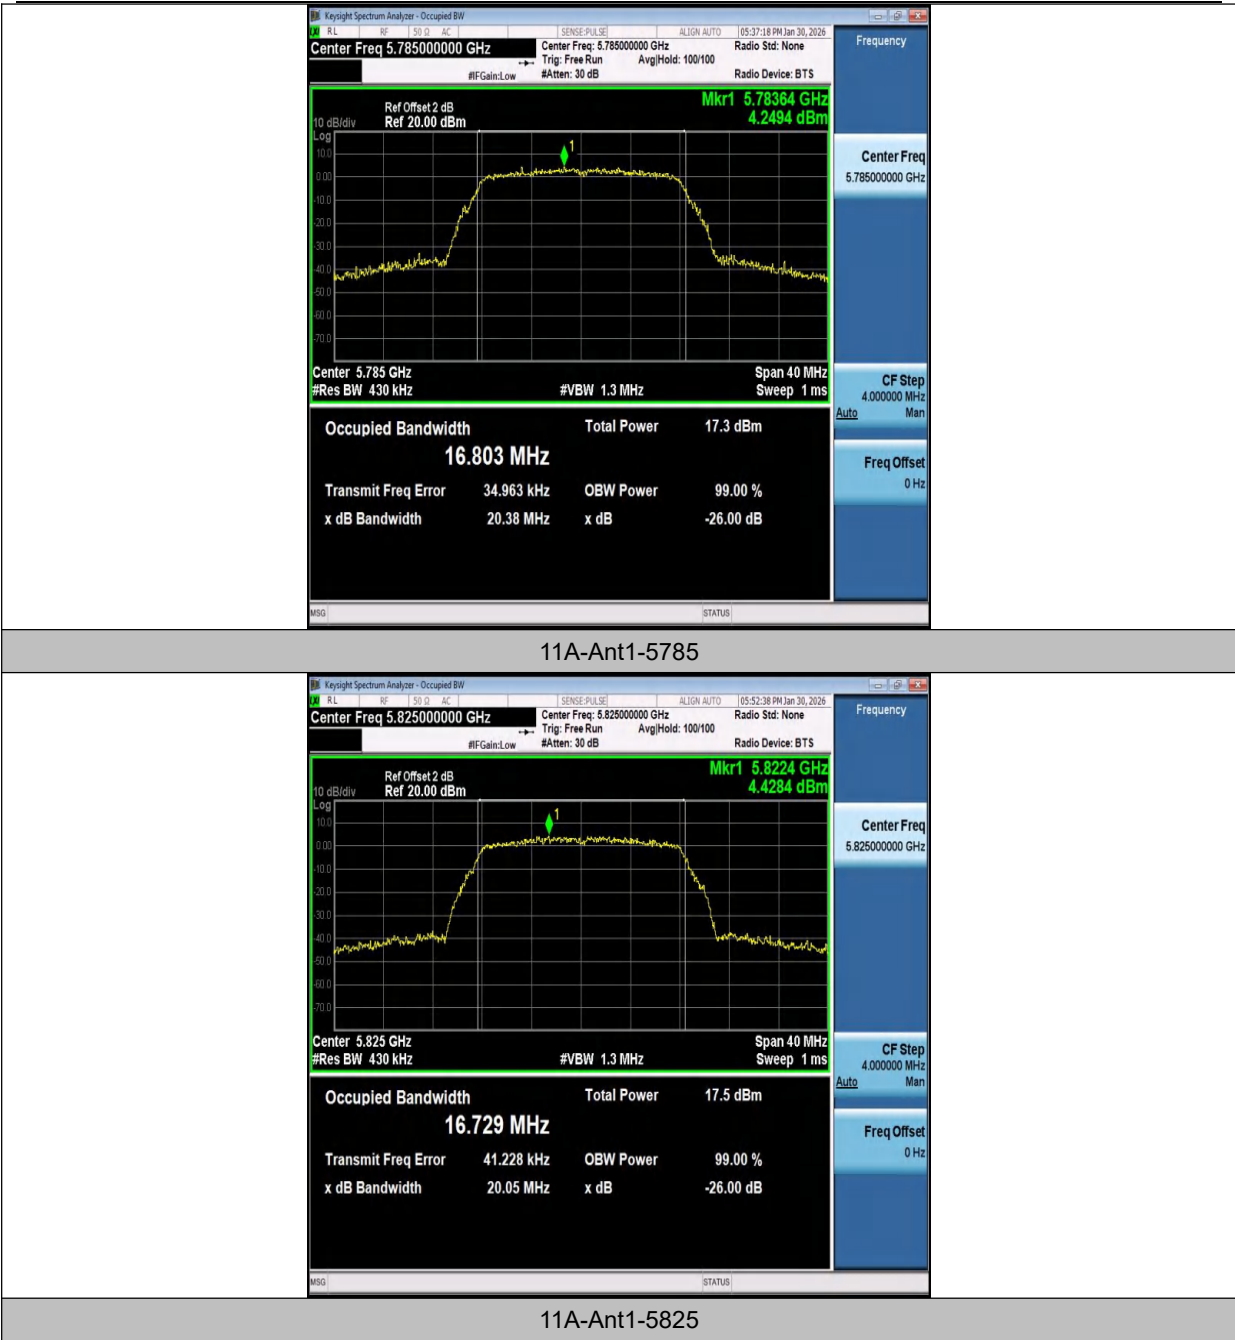

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

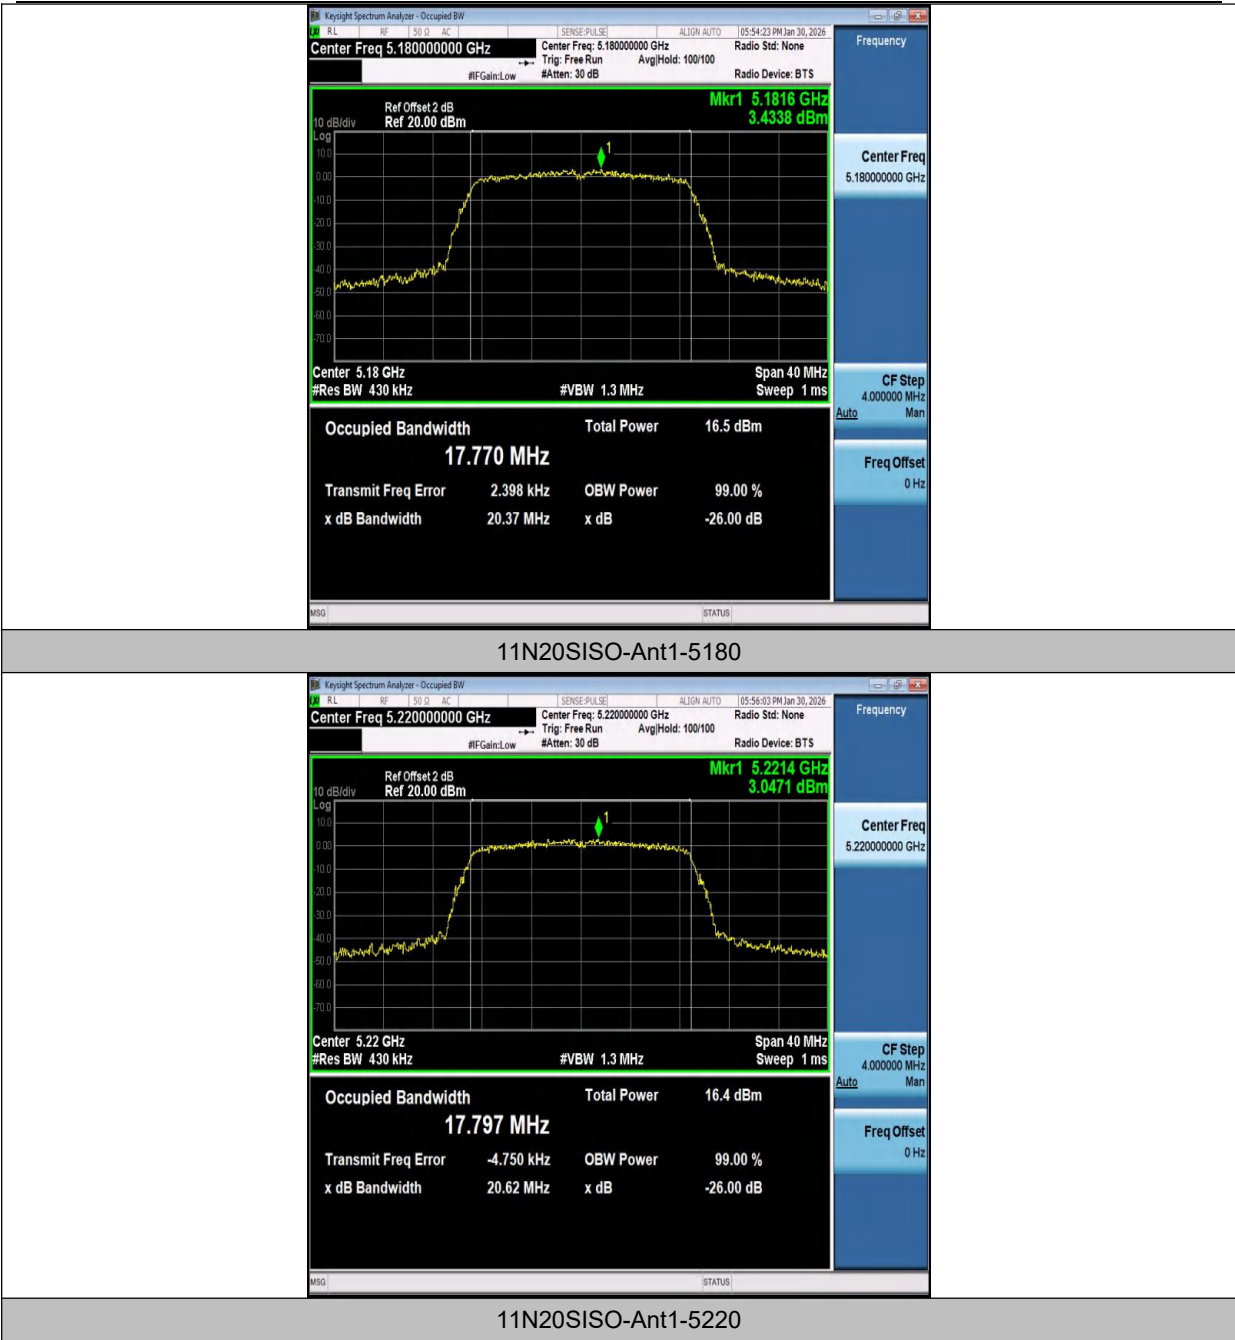

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.