





11A_6415

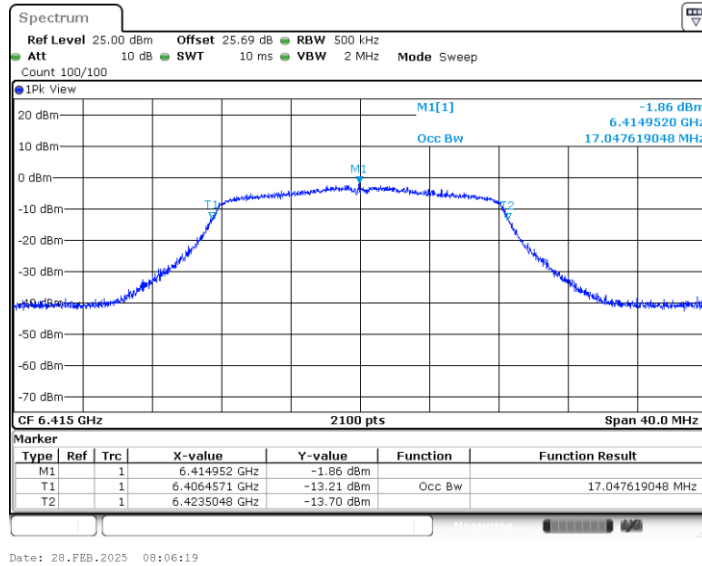


11A_6435

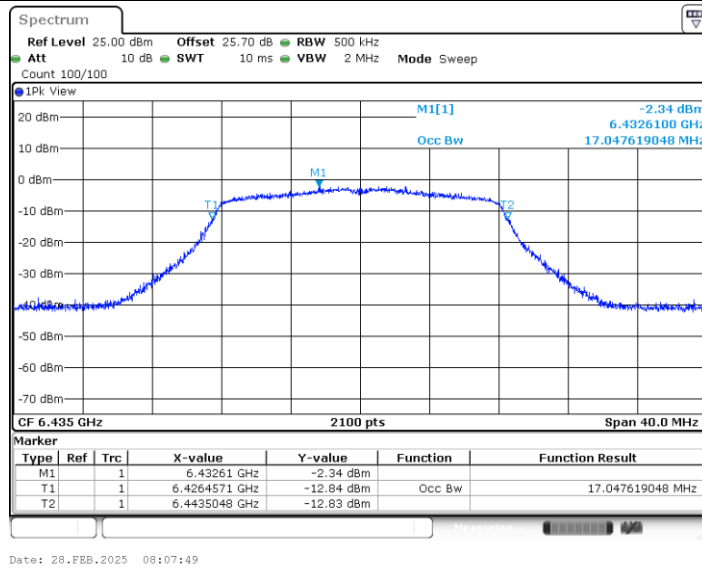




11A_6475

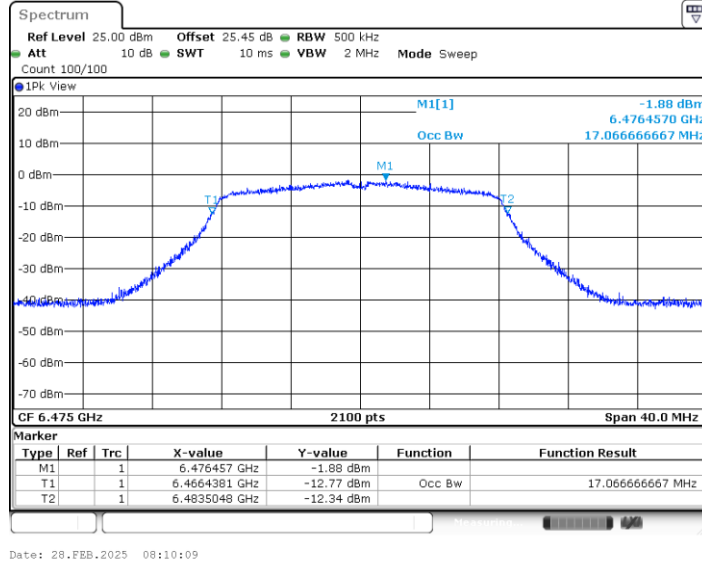


11A_6515

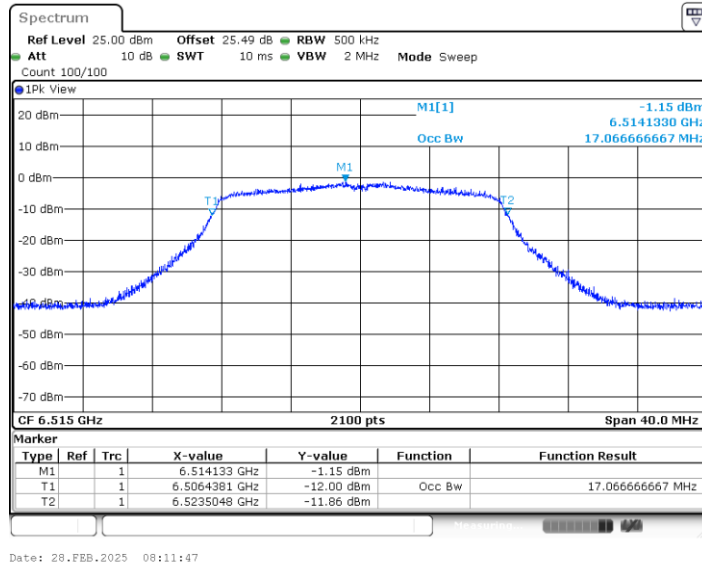




11A_6535

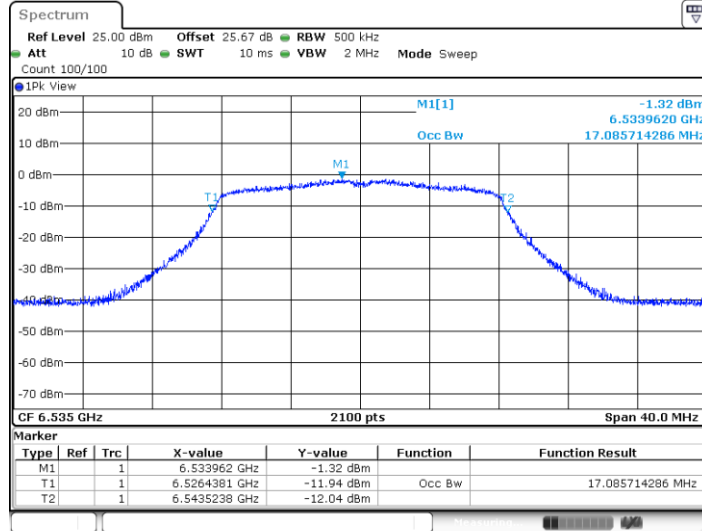

Date: 28.FEB.2025 08:13:53


11A_6695

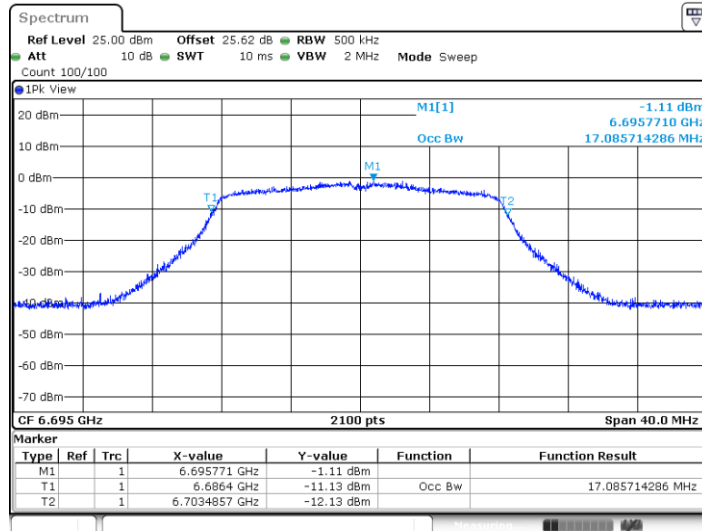

Date: 28.FEB.2025 08:15:38




11A_6855

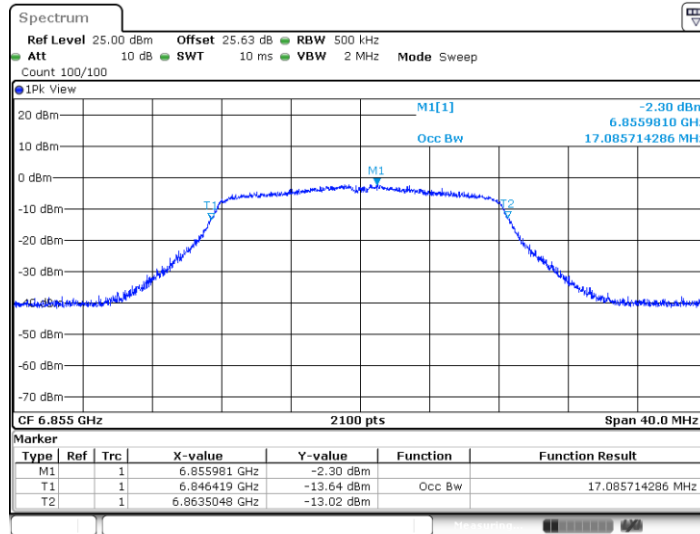

Date: 28.FEB.2025 08:17:48


11A_6875

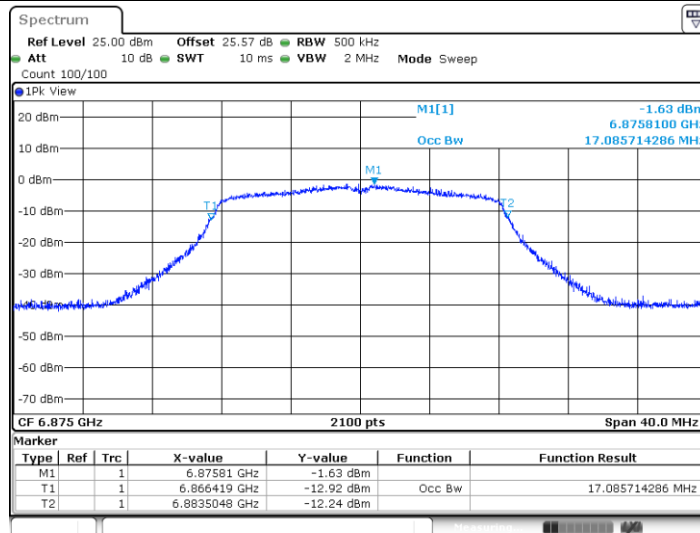


Date: 28.FEB.2025 08:19:14



11A_6895

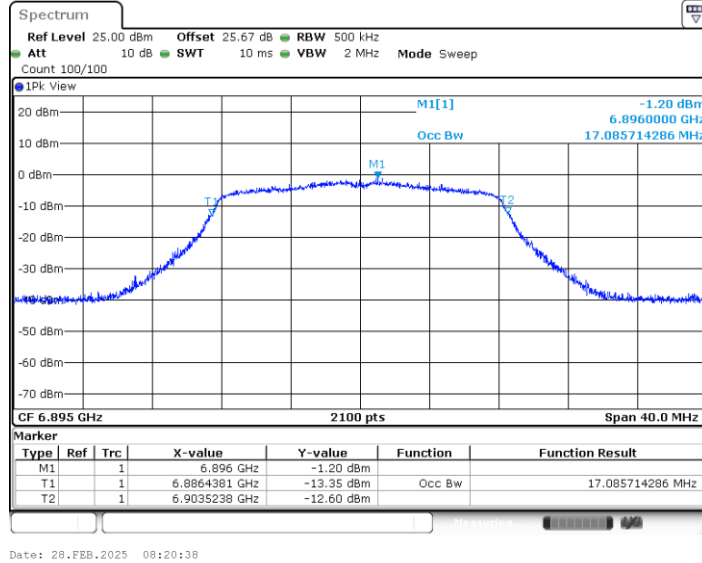


11A_6995

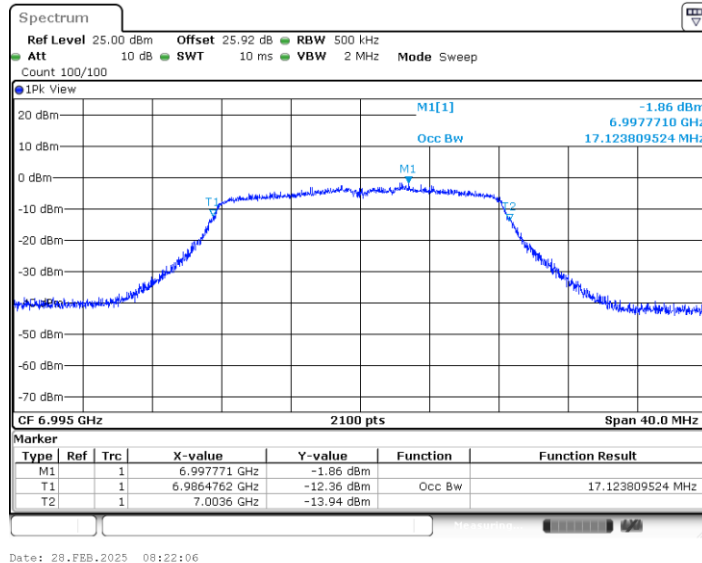




11A_7095

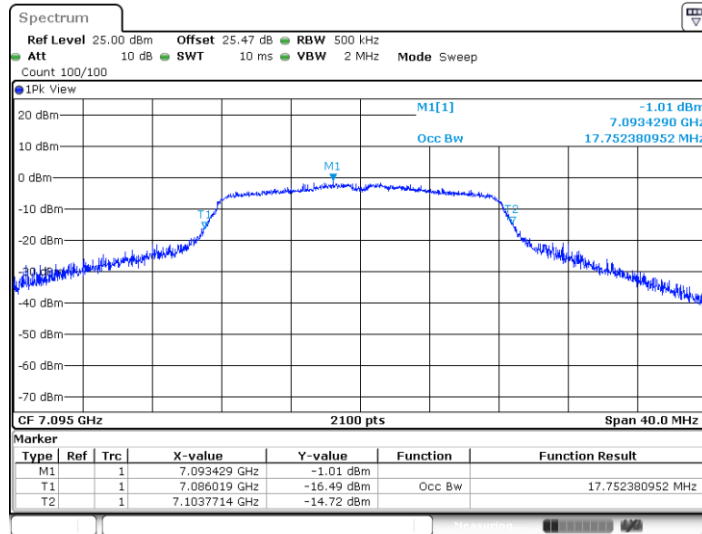

Date: 28.FEB.2025 08:23:42


11A_7115

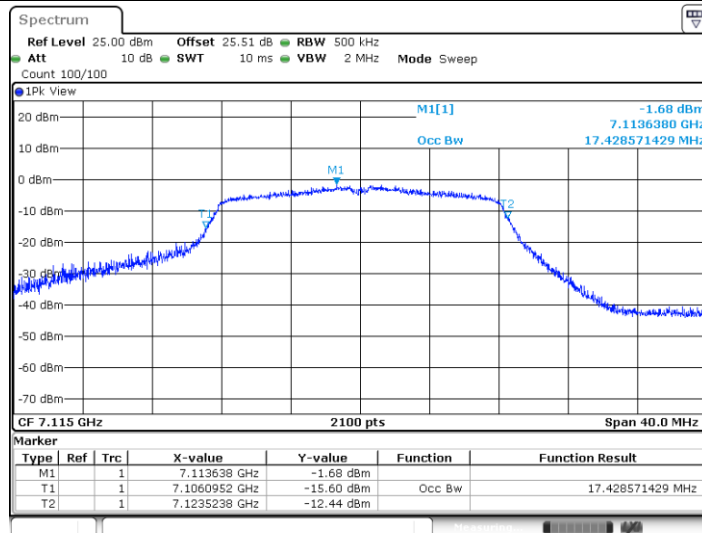


Date: 28.FEB.2025 08:25:20



11AX20SISO_5955

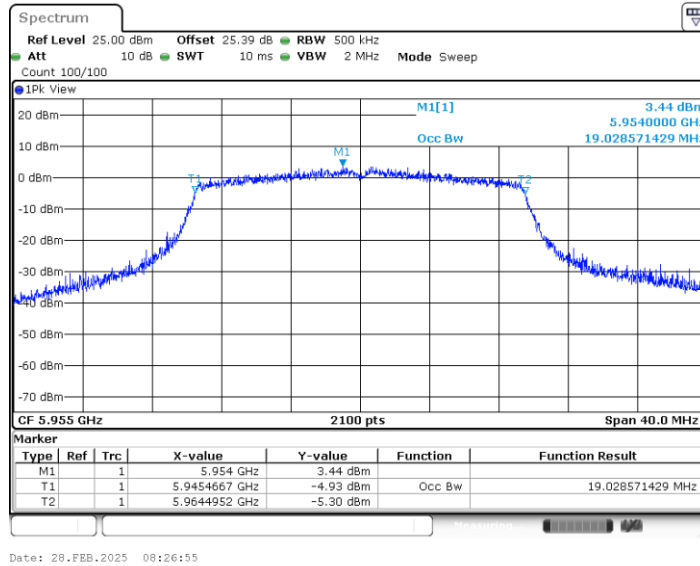


11AX20SISO_6195

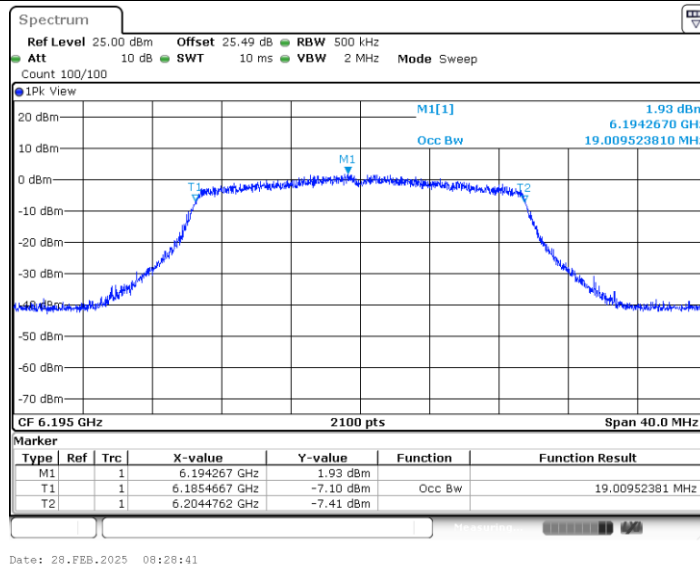




11AX20SISO_6415

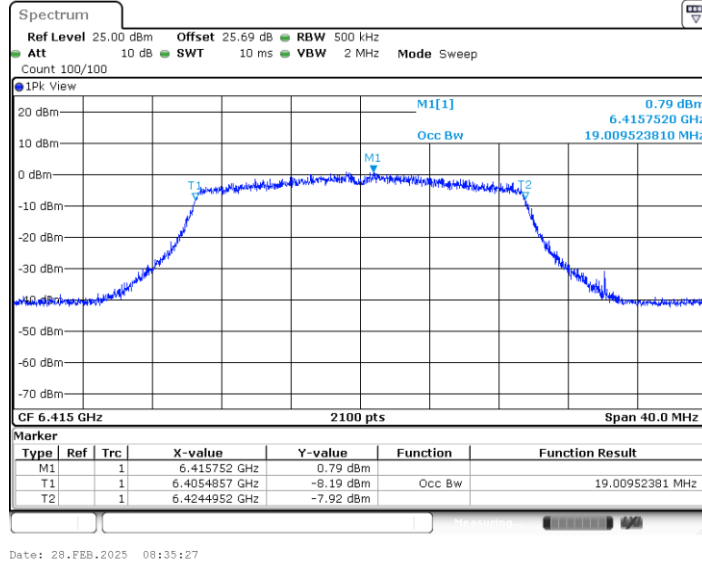


11AX20SISO_6435

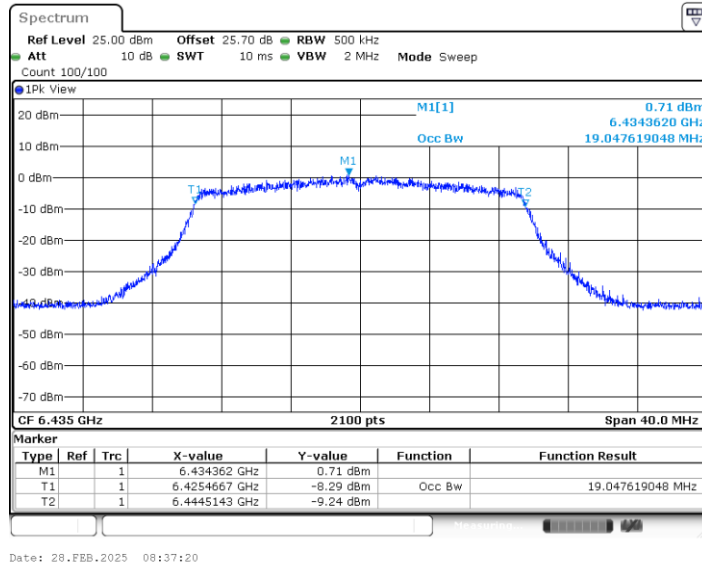




11AX20SISO_6475

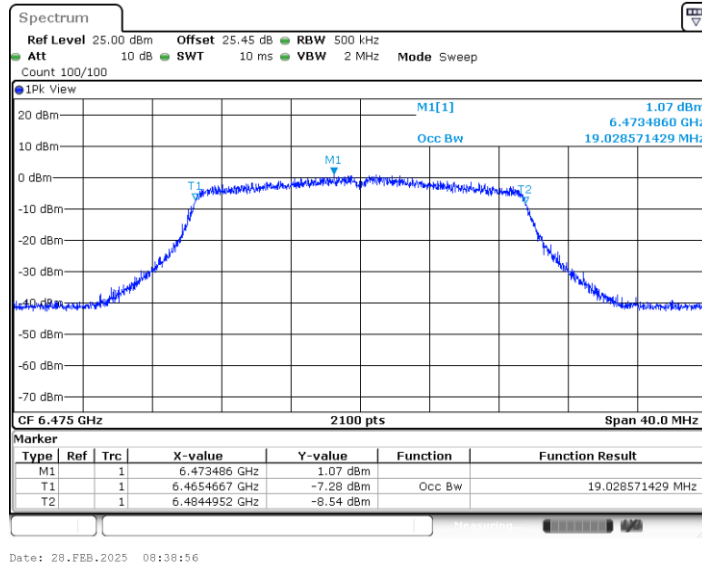


11AX20SISO_6515

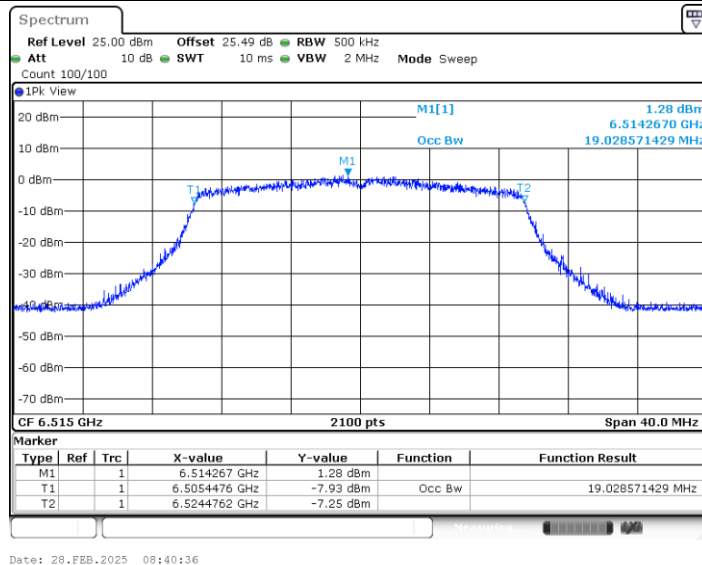




11AX20SISO_6535

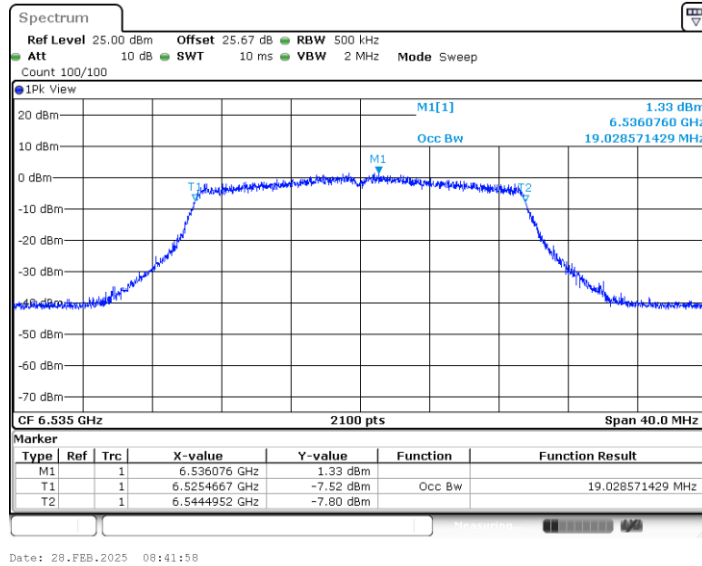


11AX20SISO_6695

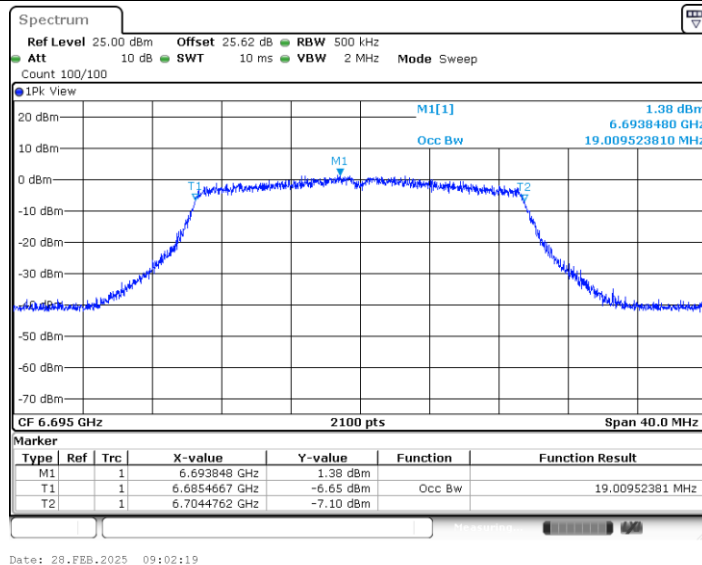




11AX20SISO_6855

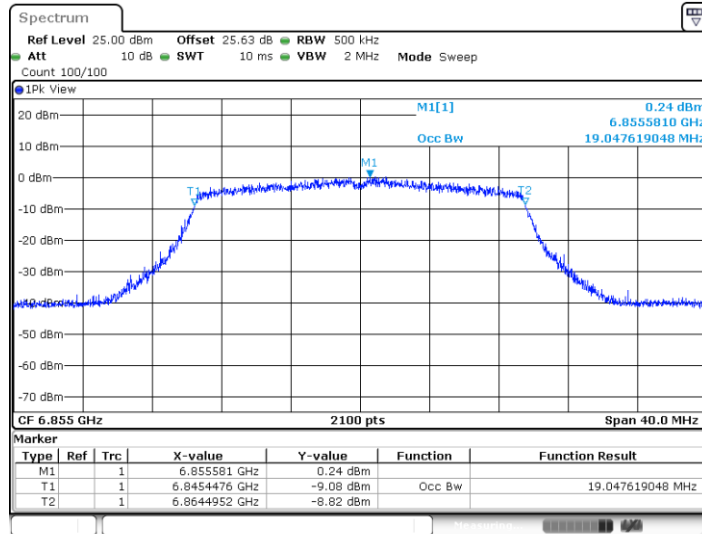

Date: 28.FEB.2025 09:04:05


11AX20SISO_6875

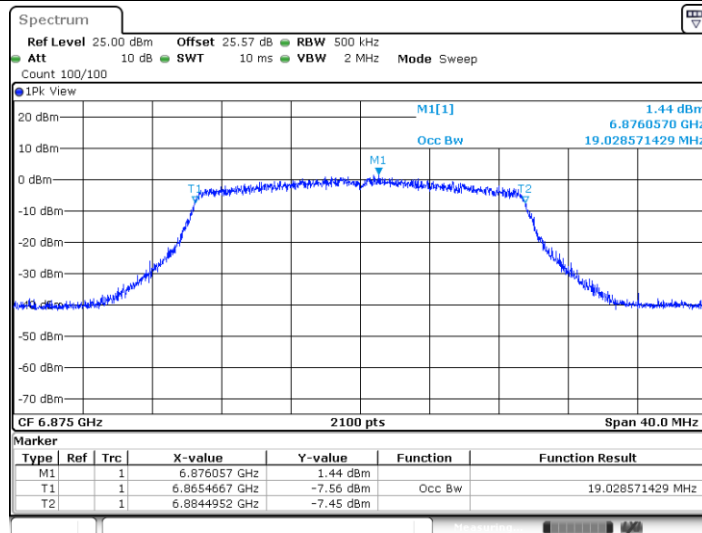


Date: 28.FEB.2025 09:07:03



11AX20SISO_6895

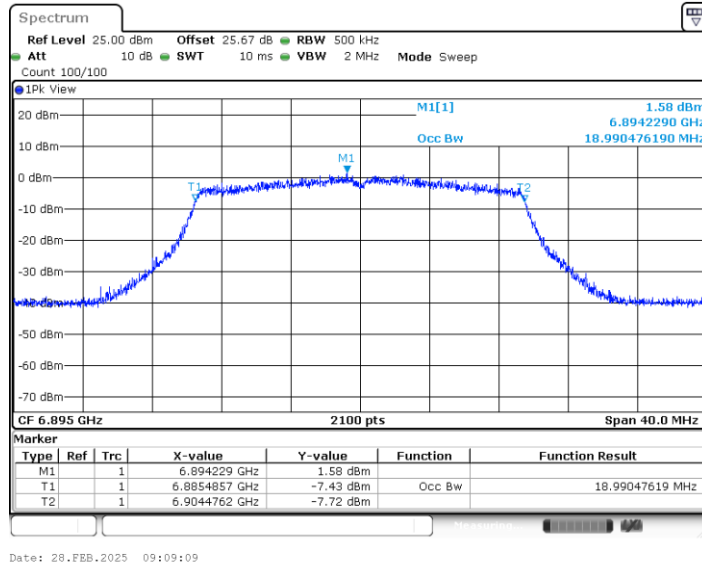


11AX20SISO_6995

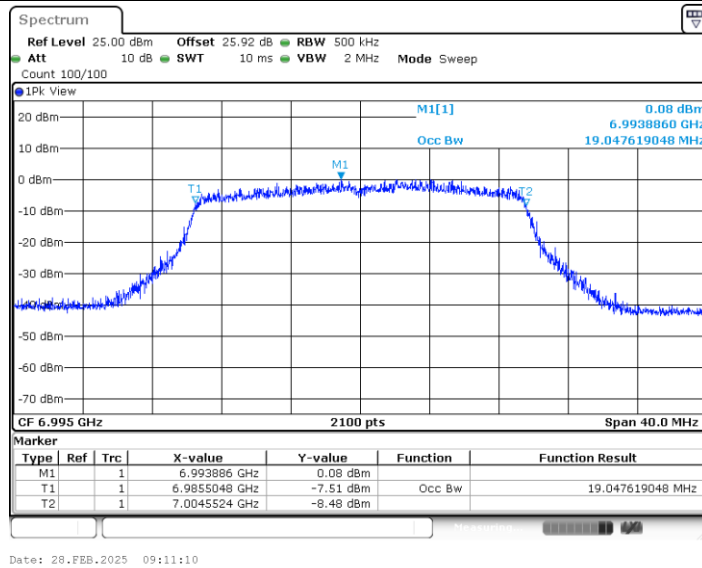




11AX20SISO_7095

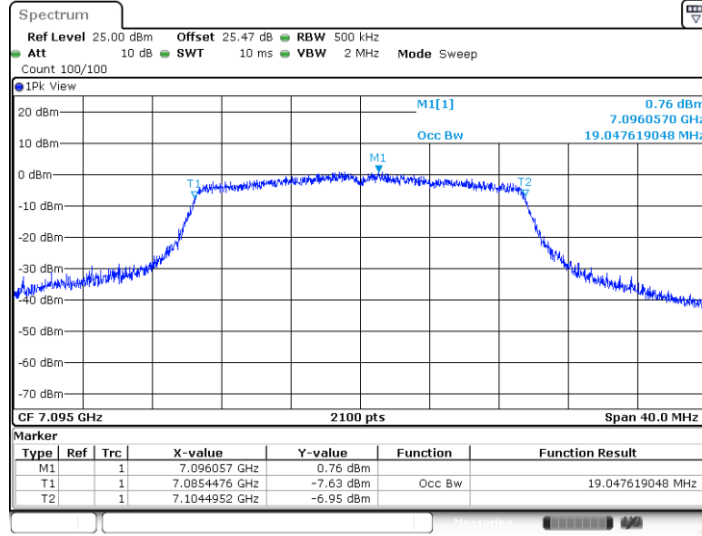

Date: 28.FEB.2025 09:13:04


11AX20SISO_7115

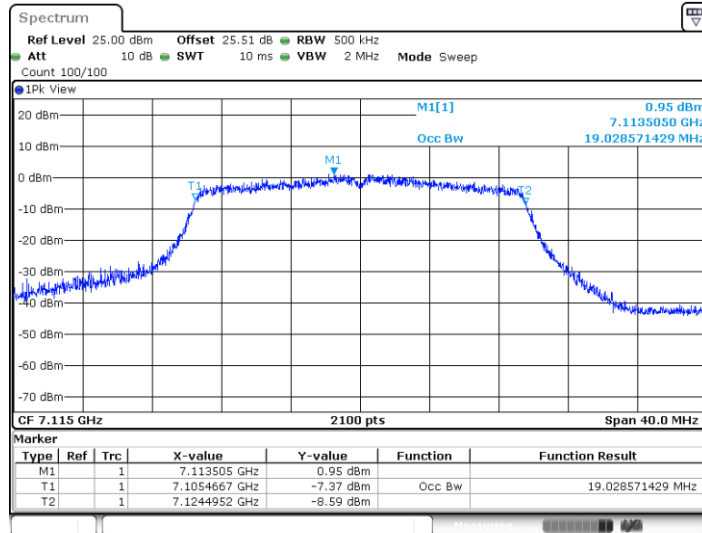


Date: 28.FEB.2025 09:15:04



11AX40SISO_5965

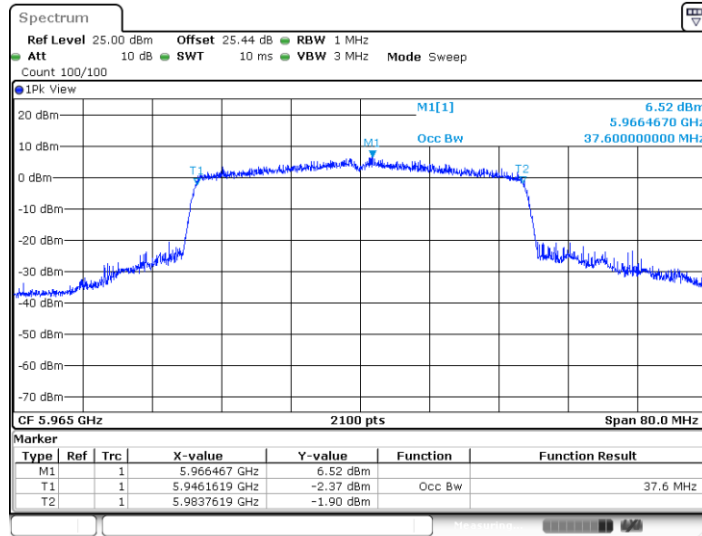


11AX40SISO_6205

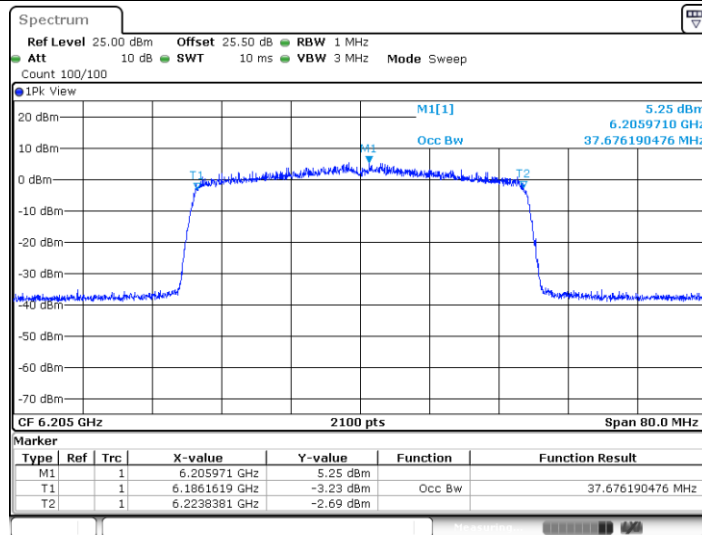




11AX40SISO_6405

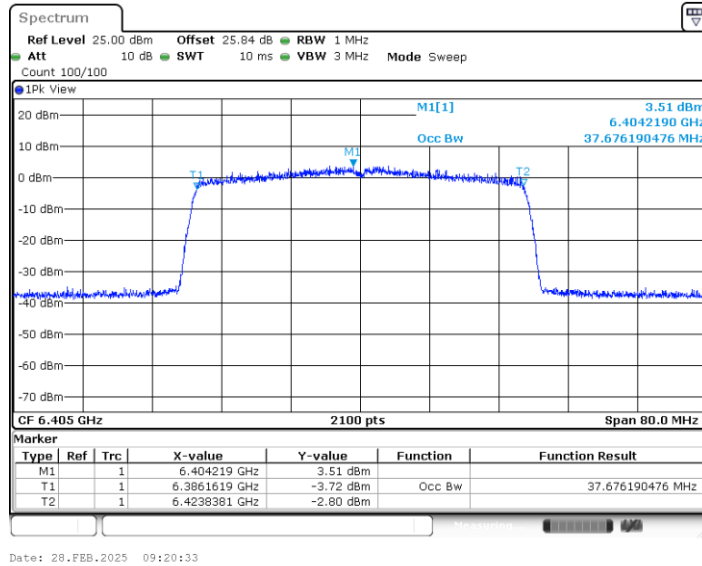


11AX40SISO_6445

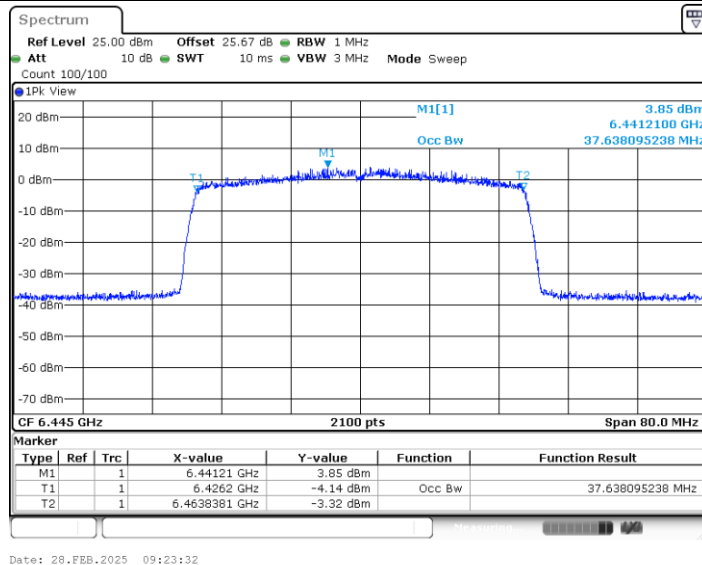




11AX40SISO_6485

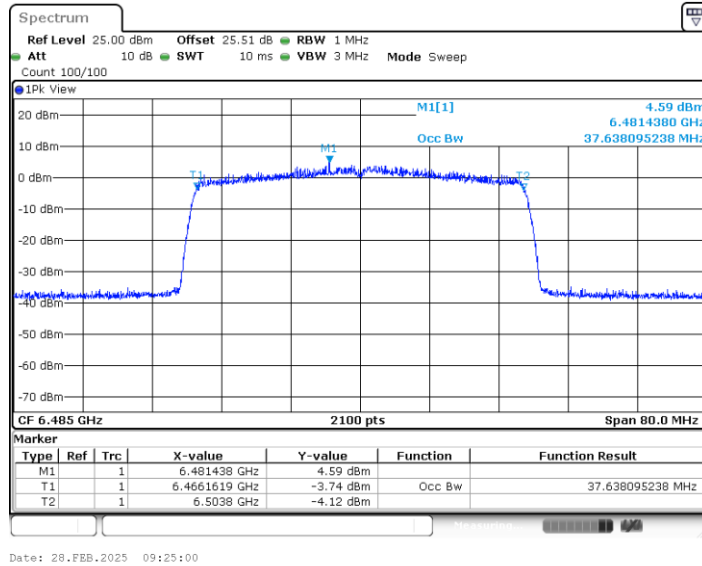


11AX40SISO_6525

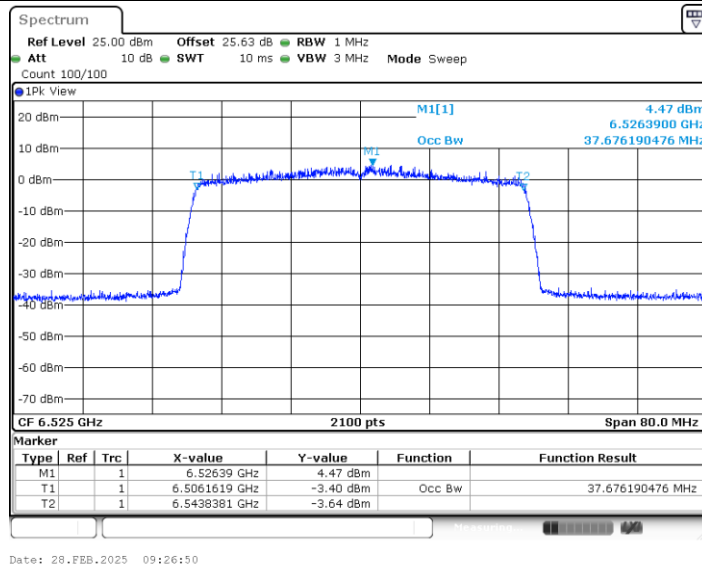




11AX40SISO_6565

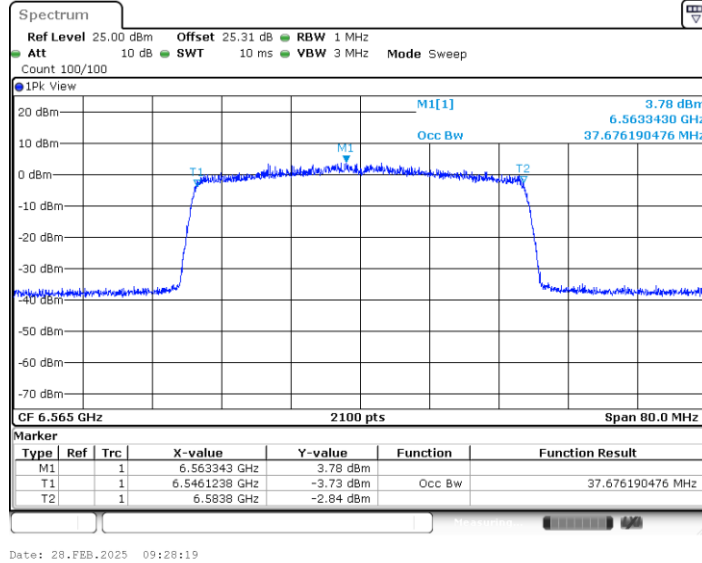


11AX40SISO_6685

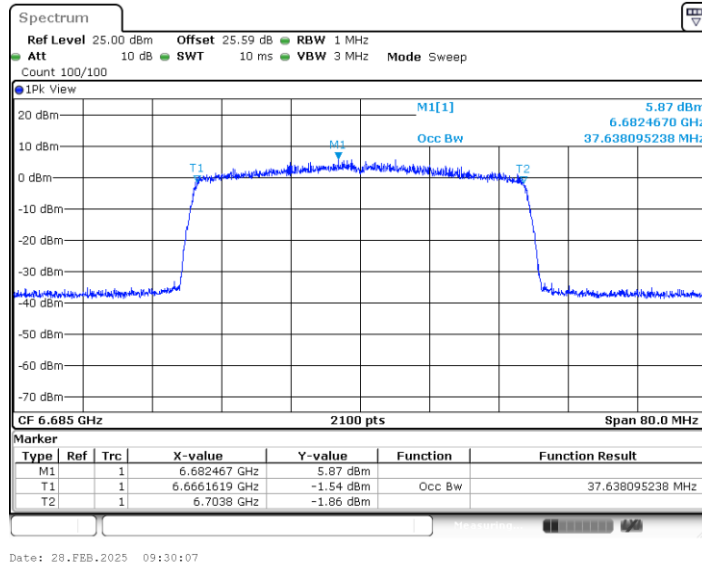




11AX40SISO_6845

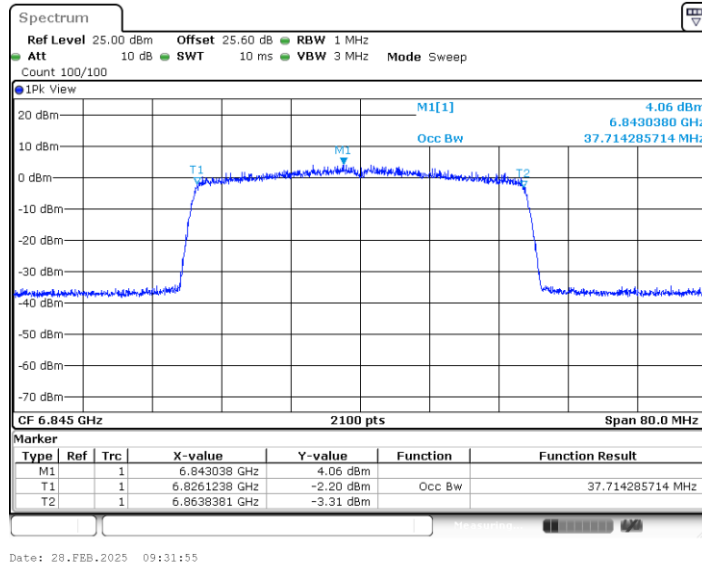


11AX40SISO_6885

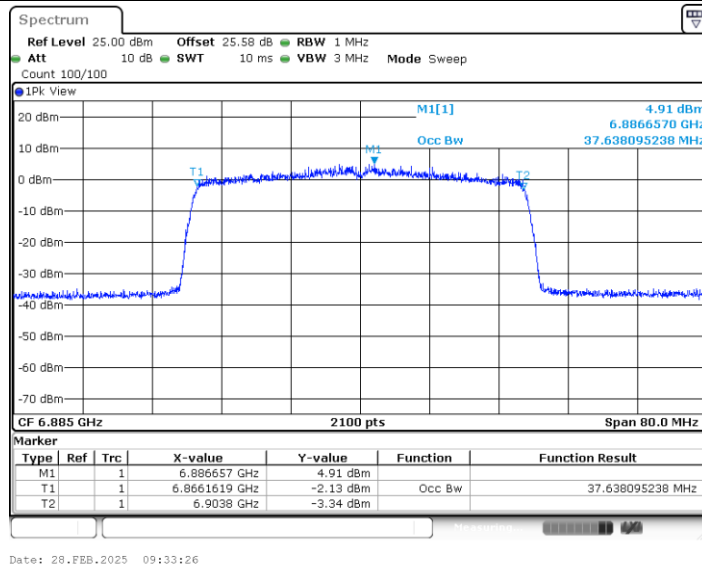




11AX40SISO_6925

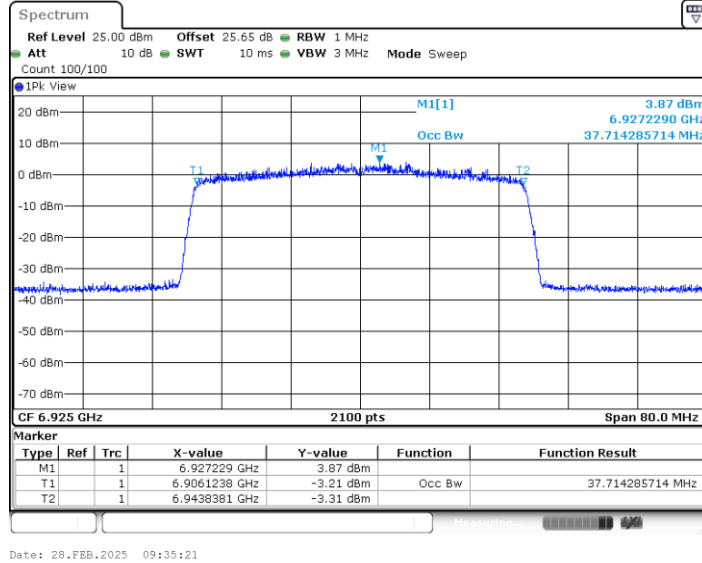


11AX40SISO_7005

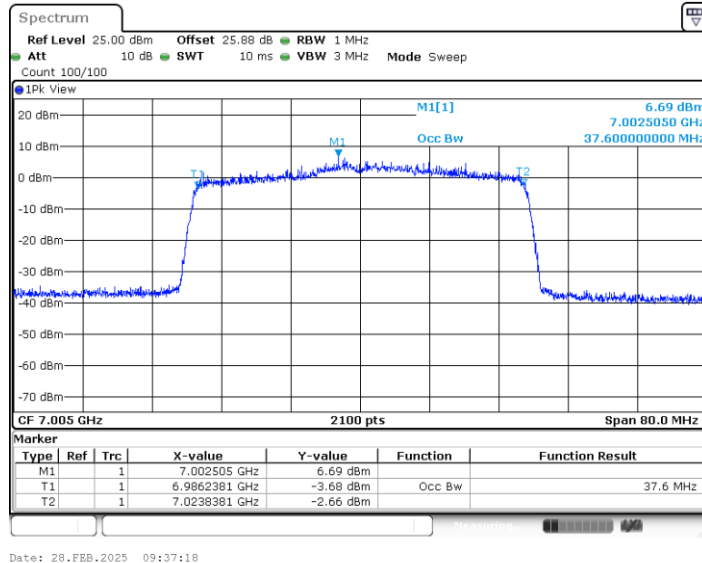




11AX40SISO_7085

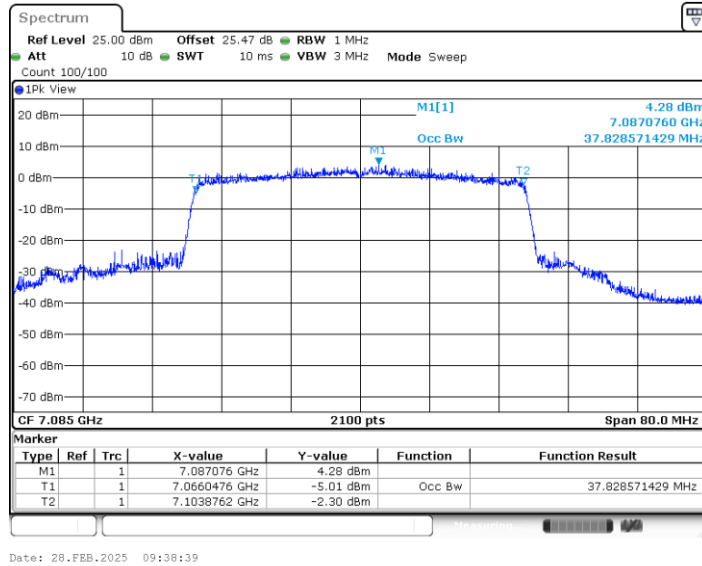


11AX80SISO_5985

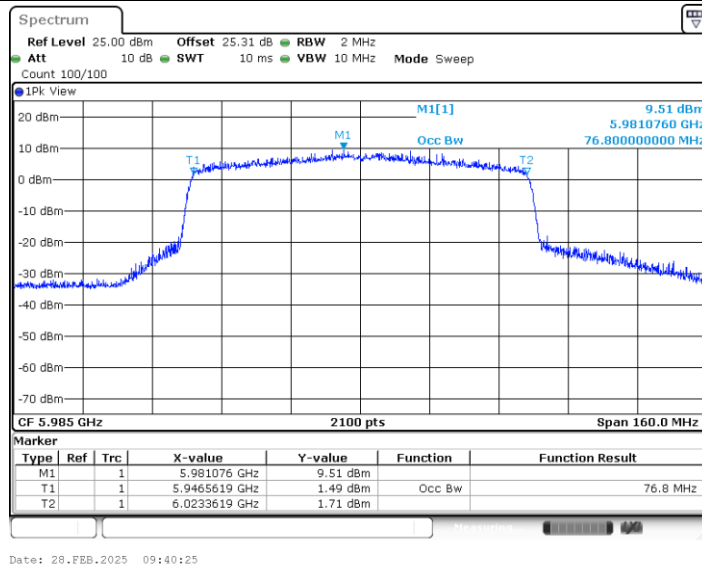




11AX80SISO_6225

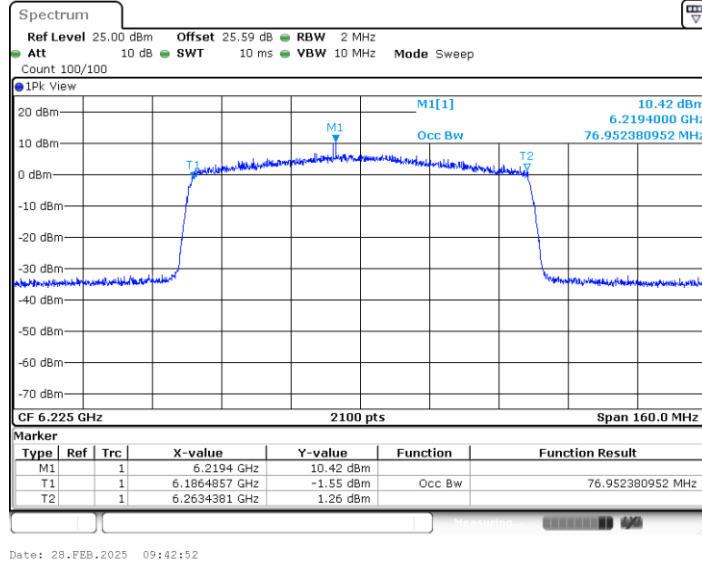


11AX80SISO_6385

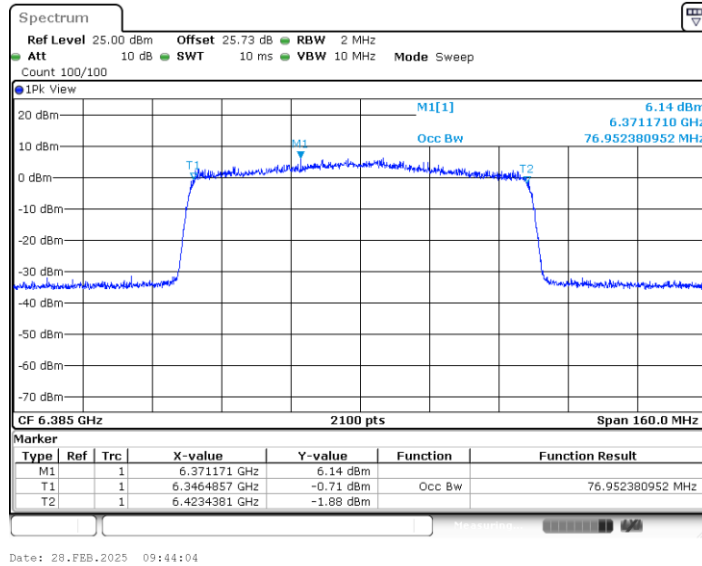




11AX80SISO_6465

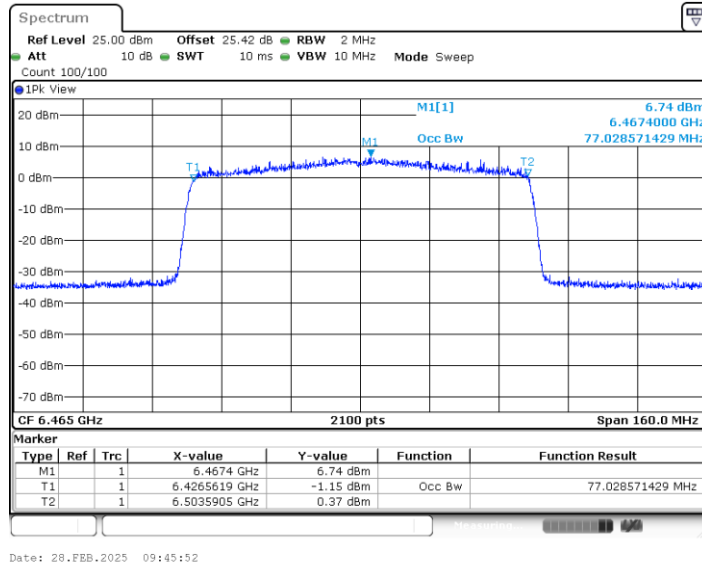


11AX80SISO_6545

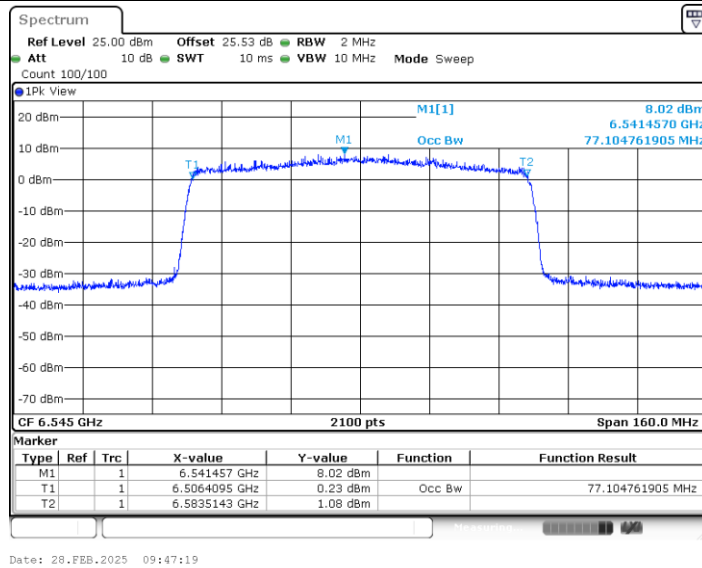




11AX80SISO_6625

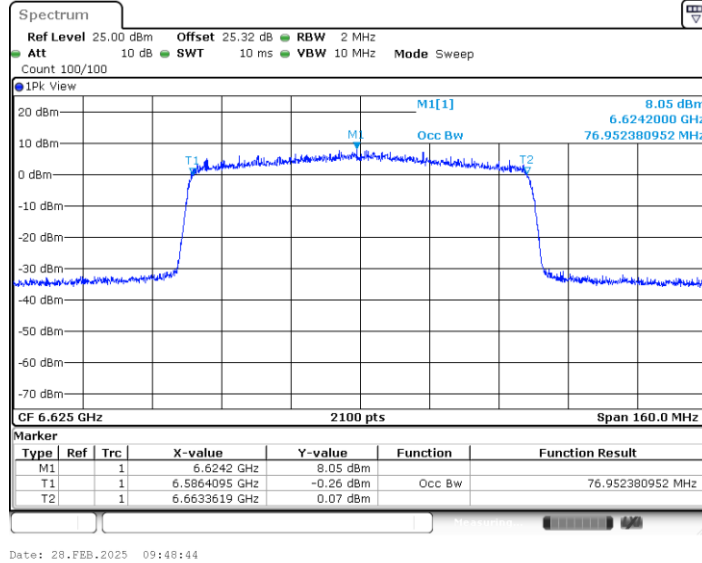


11AX80SISO_6705

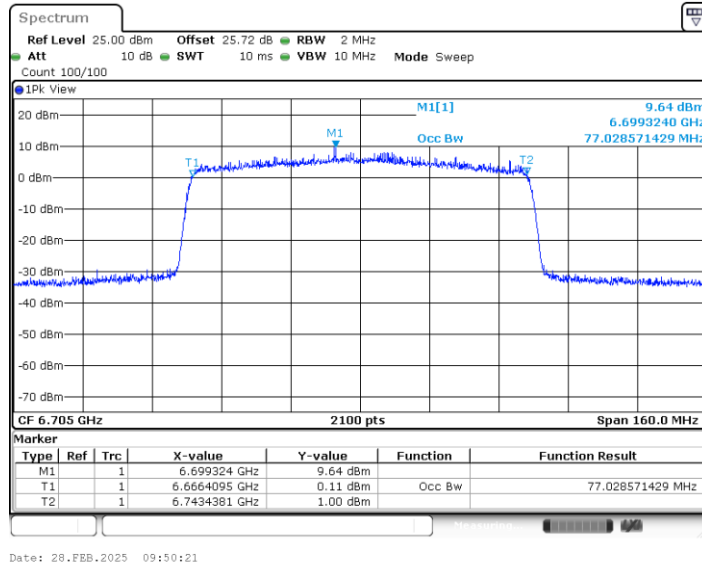




11AX80SISO_6785

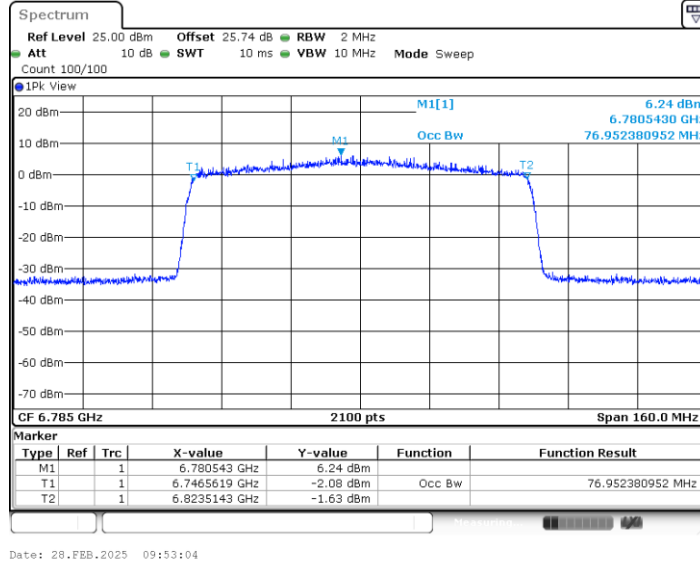


11AX80SISO_6865

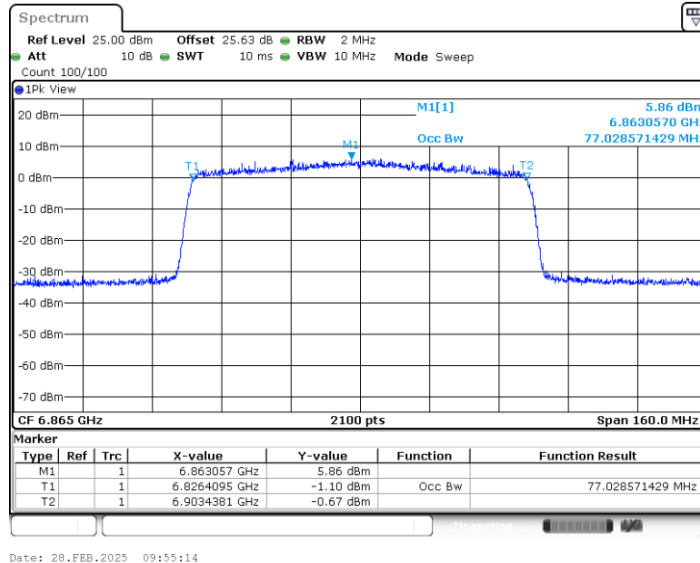




11AX80SISO_6945

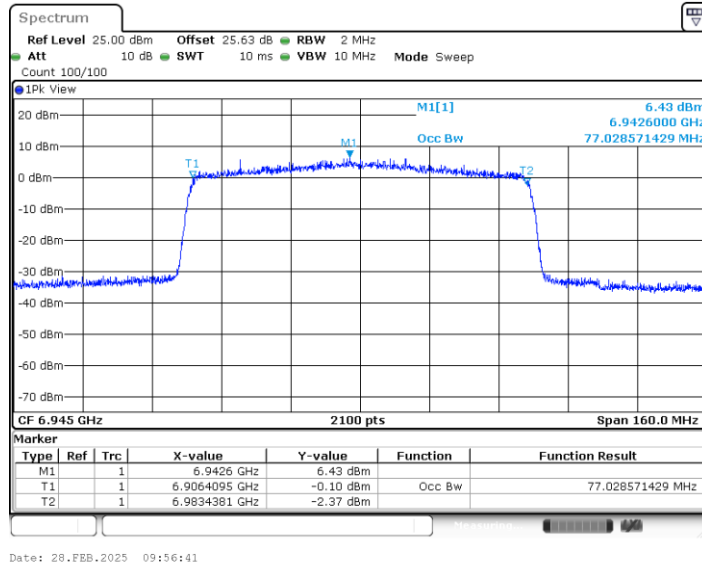


11AX80SISO_7025

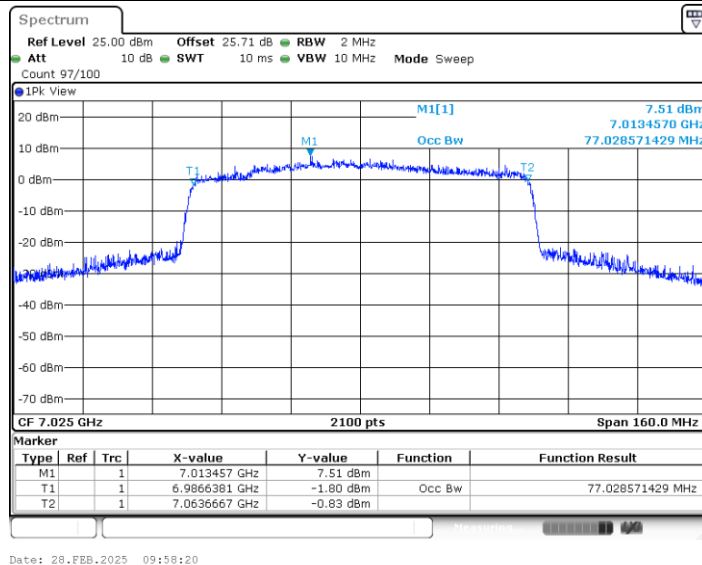




11AX160SISO_6025

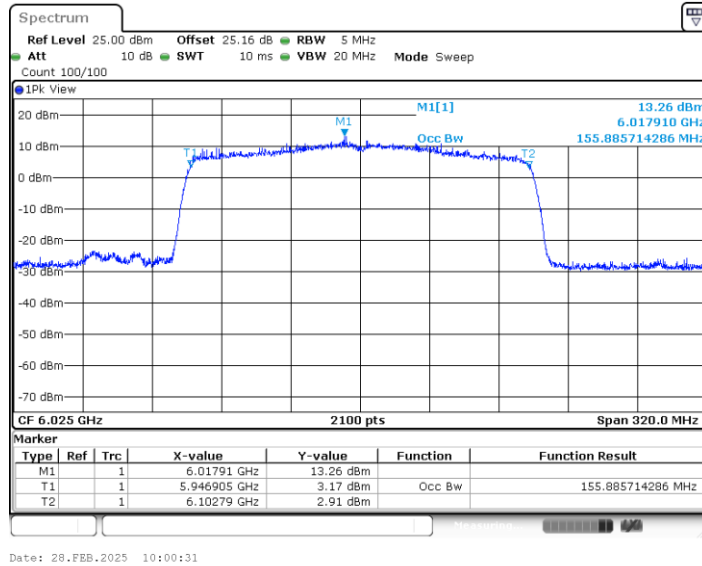


11AX160SISO_6185

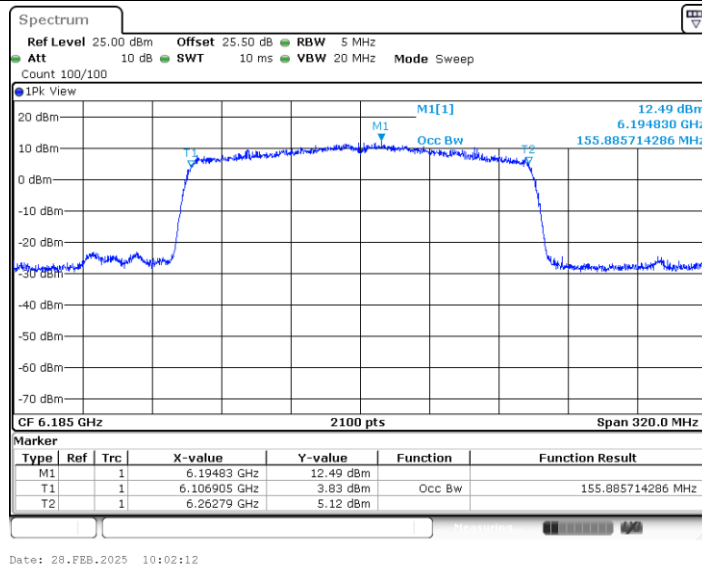




11AX160SISO_6345

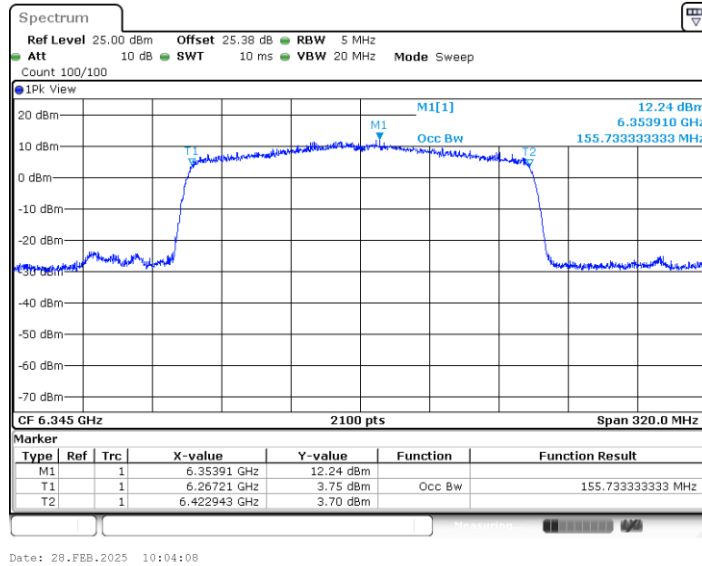


11AX160SISO_6505

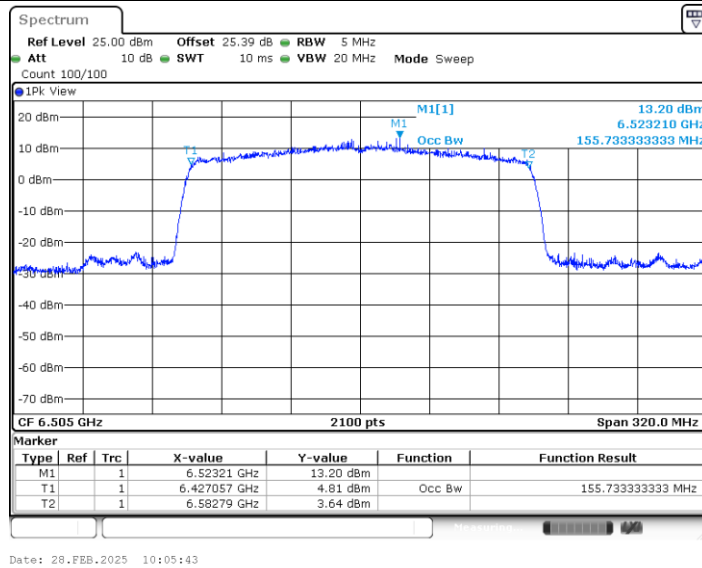





11AX160SISO_6665

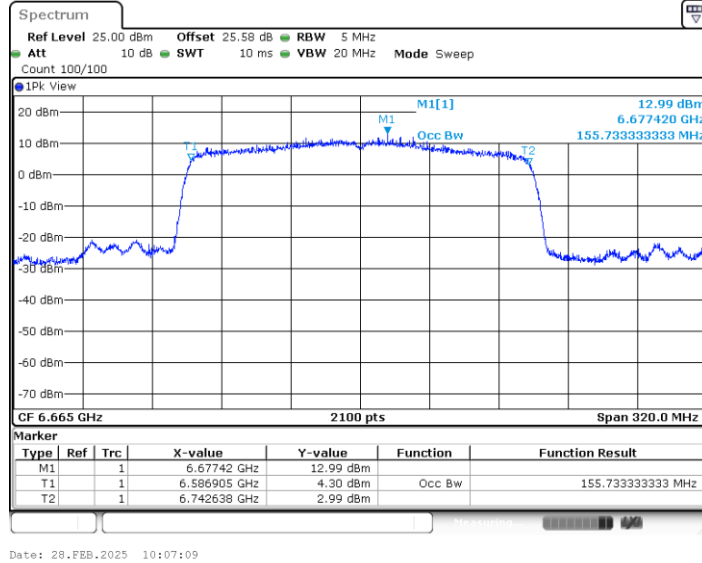

11AX160SISO_6825

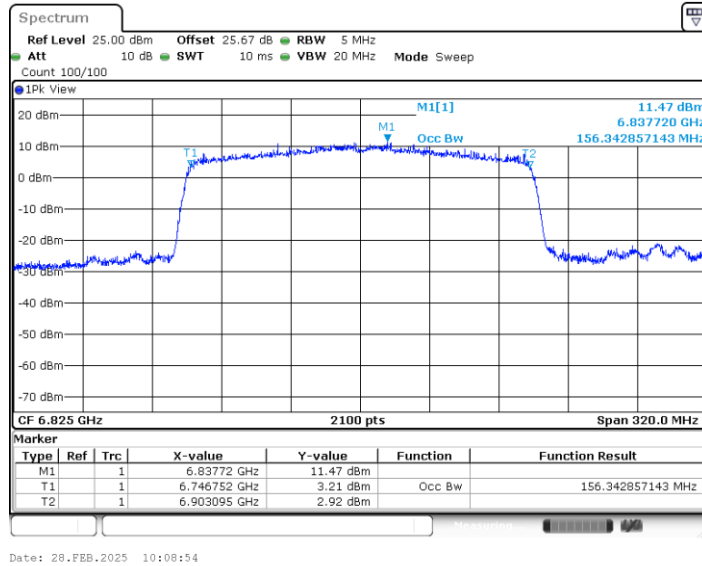

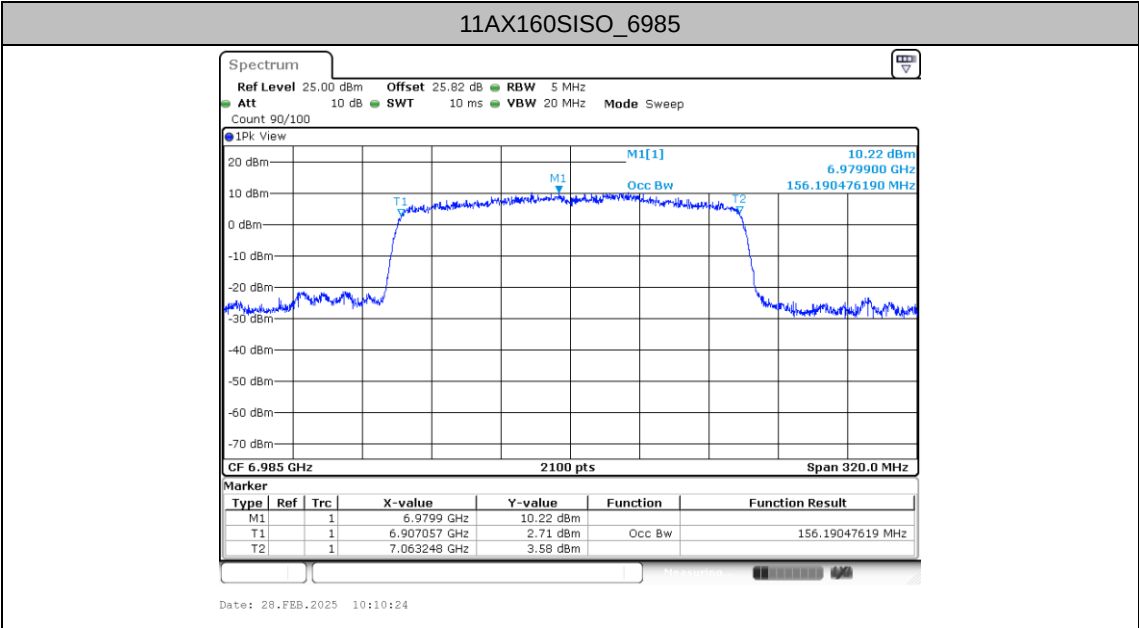



Maximum power spectral density

Test Result

TestMode	Antenna	Freq(MHz)	Result [dBm/MHz]	Gain [dBi]	EIRP [dBm/MHz]	Limit [dBm/MHz]	Verdict
11A	Ant2	5955	-5.48	3.90	-1.58	≤-1.00	PASS
		6195	-5.46	3.90	-1.56	≤-1.00	PASS
		6415	-5.82	3.90	-1.92	≤-1.00	PASS
		6435	-5.41	3.70	-1.71	≤-1.00	PASS
		6475	-5.34	3.70	-1.64	≤-1.00	PASS
		6515	-5.42	3.70	-1.72	≤-1.00	PASS
		6535	-5.21	3.50	-1.71	≤-1.00	PASS
		6695	-5.25	3.50	-1.75	≤-1.00	PASS
		6855	-5.28	3.50	-1.78	≤-1.00	PASS
		6875	-5.33	3.50	-1.83	≤-1.00	PASS
		6895	-5.04	3.50	-1.54	≤-1.00	PASS
		6995	-5.09	3.50	-1.59	≤-1.00	PASS
		7095	-5.37	3.50	-1.87	≤-1.00	PASS
		7115	-5.13	3.50	-1.63	≤-1.00	PASS
11AX20SISO	Ant2	5955	-5.78	3.90	-1.88	≤-1.00	PASS
		6195	-5.54	3.90	-1.64	≤-1.00	PASS
		6415	-5.91	3.90	-2.01	≤-1.00	PASS
		6435	-5.25	3.70	-1.55	≤-1.00	PASS
		6475	-5.65	3.70	-1.95	≤-1.00	PASS
		6515	-5.21	3.70	-1.51	≤-1.00	PASS
		6535	-5.06	3.50	-1.56	≤-1.00	PASS
		6695	-5.46	3.50	-1.96	≤-1.00	PASS
		6855	-5.11	3.50	-1.61	≤-1.00	PASS
		6875	-5.22	3.50	-1.72	≤-1.00	PASS
		6895	-5.41	3.50	-1.91	≤-1.00	PASS
		6995	-5.12	3.50	-1.62	≤-1.00	PASS
		7095	-5.30	3.50	-1.80	≤-1.00	PASS
		7115	-5.13	3.50	-1.63	≤-1.00	PASS
11AX40SISO	Ant2	5965	-5.58	3.90	-1.68	≤-1.00	PASS
		6205	-5.84	3.90	-1.94	≤-1.00	PASS
		6405	-5.48	3.90	-1.58	≤-1.00	PASS
		6445	-5.44	3.70	-1.74	≤-1.00	PASS
		6485	-5.49	3.70	-1.79	≤-1.00	PASS
		6525	-5.55	3.70	-1.85	≤-1.00	PASS
		6565	-5.42	3.50	-1.92	≤-1.00	PASS
		6685	-5.36	3.50	-1.86	≤-1.00	PASS
		6845	-5.48	3.50	-1.98	≤-1.00	PASS
		6885	-5.11	3.50	-1.61	≤-1.00	PASS
		6925	-5.22	3.50	-1.72	≤-1.00	PASS
		7005	-5.09	3.50	-1.59	≤-1.00	PASS
11AX80SISO	Ant2	7085	-5.25	3.50	-1.75	≤-1.00	PASS
		5985	-5.47	3.90	-1.57	≤-1.00	PASS
		6225	-5.98	3.90	-2.08	≤-1.00	PASS




		6385	-5.63	3.90	-1.73	≤ -1.00	PASS
		6465	-5.66	3.70	-1.96	≤ -1.00	PASS
		6545	-5.34	3.70	-1.64	≤ -1.00	PASS
		6625	-5.54	3.50	-2.04	≤ -1.00	PASS
		6705	-5.42	3.50	-1.92	≤ -1.00	PASS
		6785	-5.20	3.50	-1.70	≤ -1.00	PASS
		6865	-5.14	3.50	-1.64	≤ -1.00	PASS
		6945	-5.49	3.50	-1.99	≤ -1.00	PASS
		7025	-5.13	3.50	-1.63	≤ -1.00	PASS
11AX160SISO	Ant2	6025	-5.44	3.90	-1.54	≤ -1.00	PASS
		6185	-5.83	3.90	-1.93	≤ -1.00	PASS
		6345	-5.89	3.90	-1.99	≤ -1.00	PASS
		6505	-5.40	3.70	-1.70	≤ -1.00	PASS
		6665	-5.24	3.50	-1.74	≤ -1.00	PASS
		6825	-5.36	3.50	-1.86	≤ -1.00	PASS
		6985	-5.19	3.50	-1.69	≤ -1.00	PASS

Note: 1.The Duty Cycle Factor and is compensated in the graph.




Test Graphs

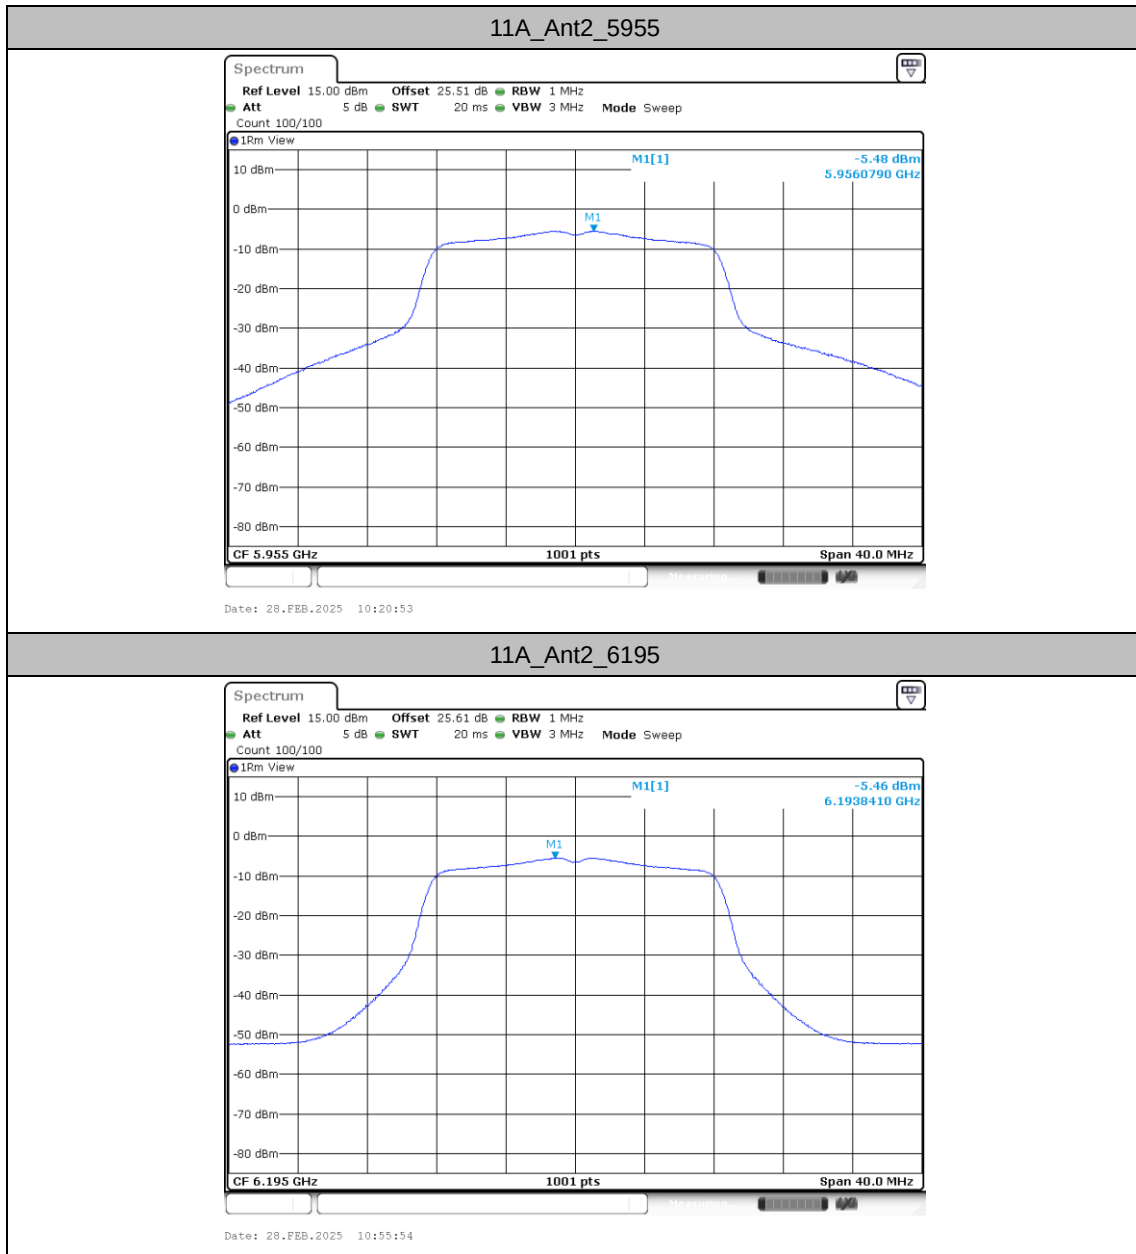




11A_Ant2_6415

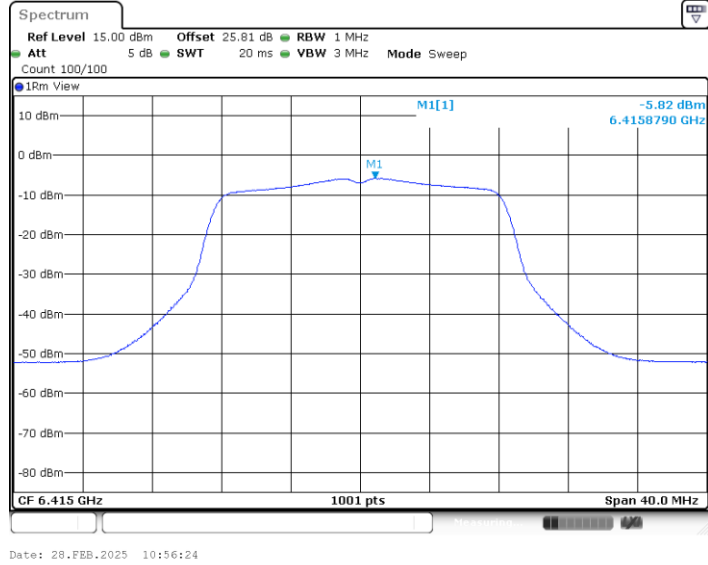


11A_Ant2_6435

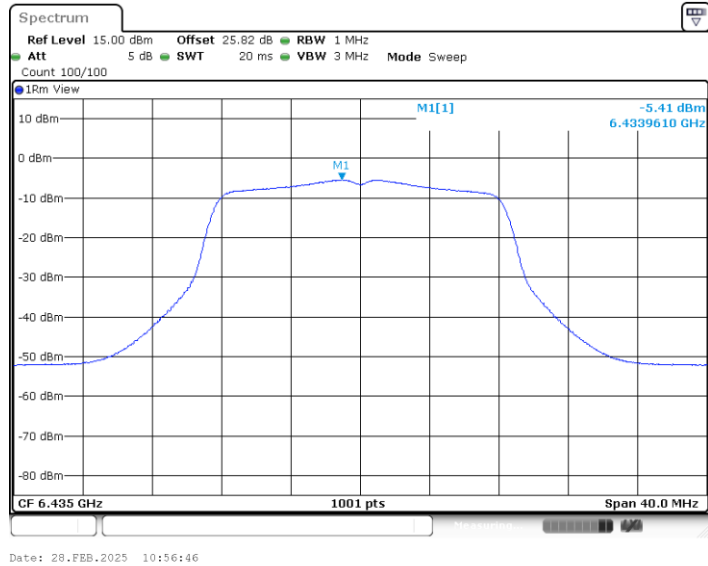




11A_Ant2_6475

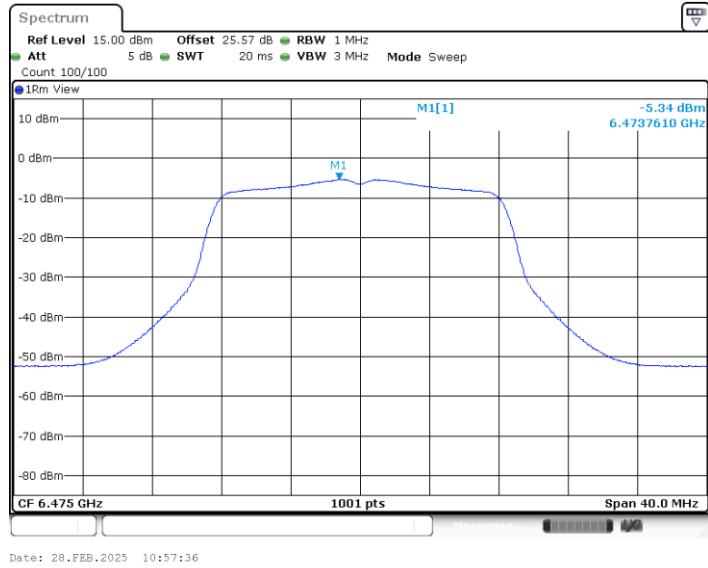


11A_Ant2_6515

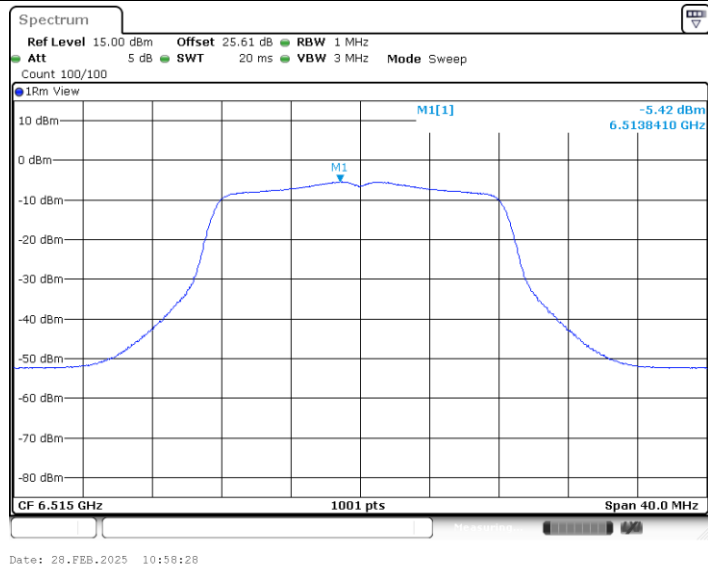




11A_Ant2_6535

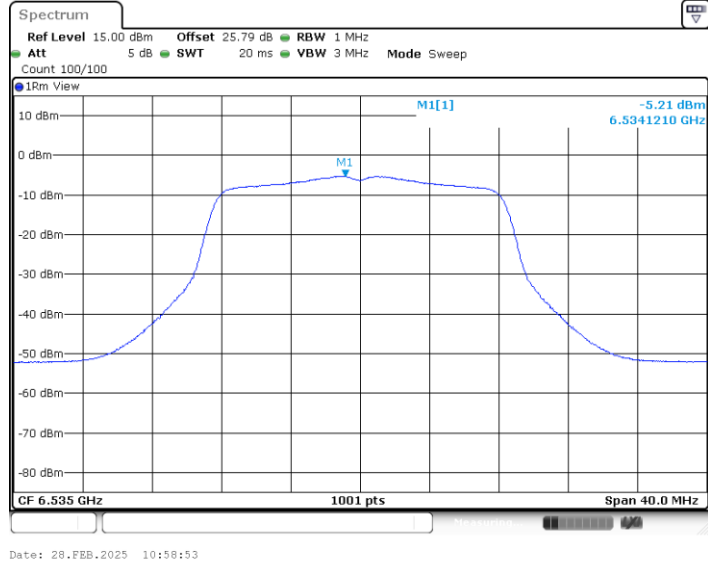


11A_Ant2_6695

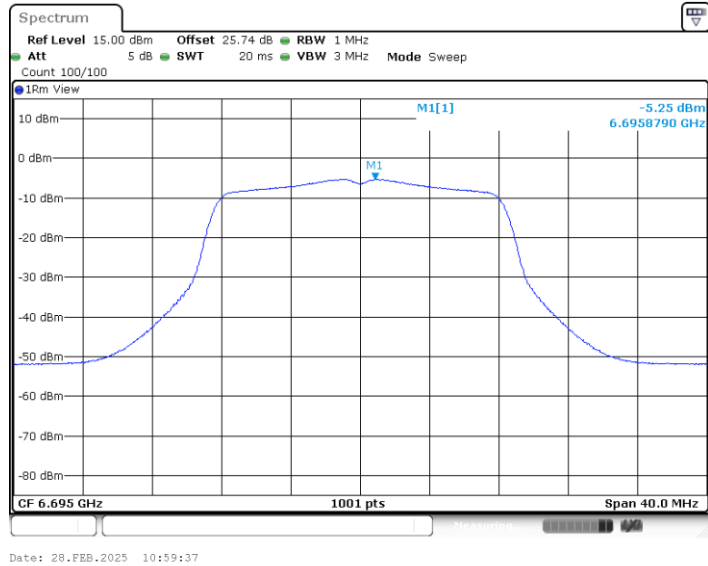




11A_Ant2_6855

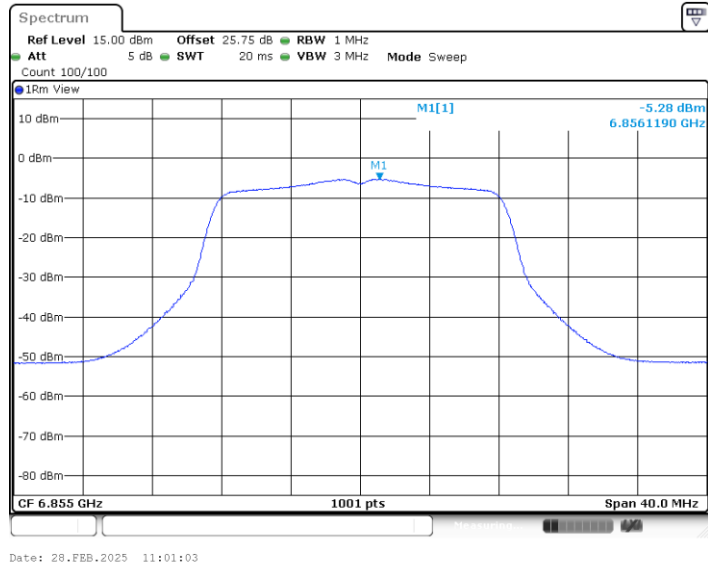


11A_Ant2_6875

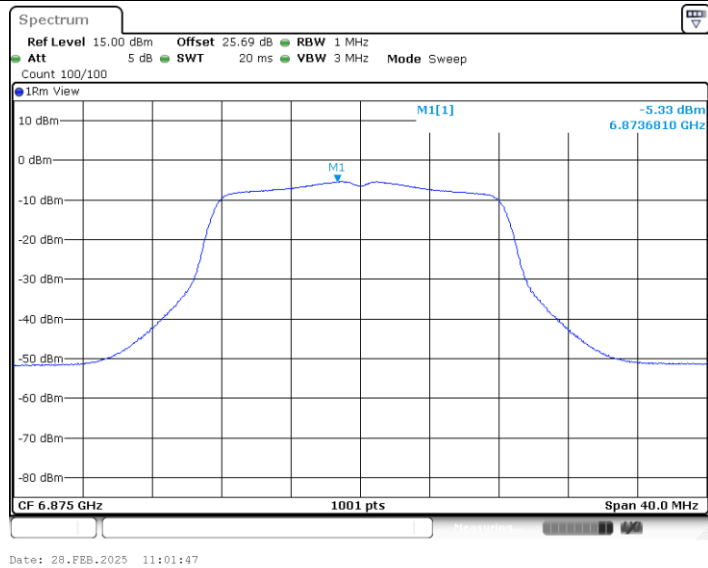




11A_Ant2_6895

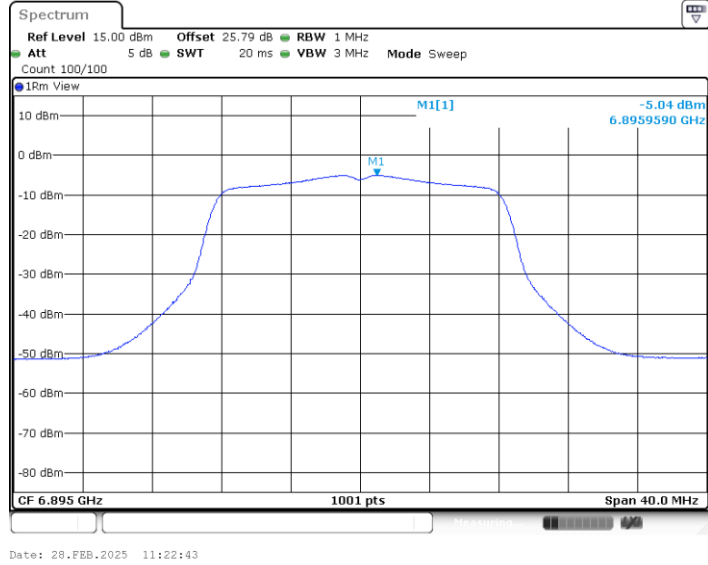


11A_Ant2_6995

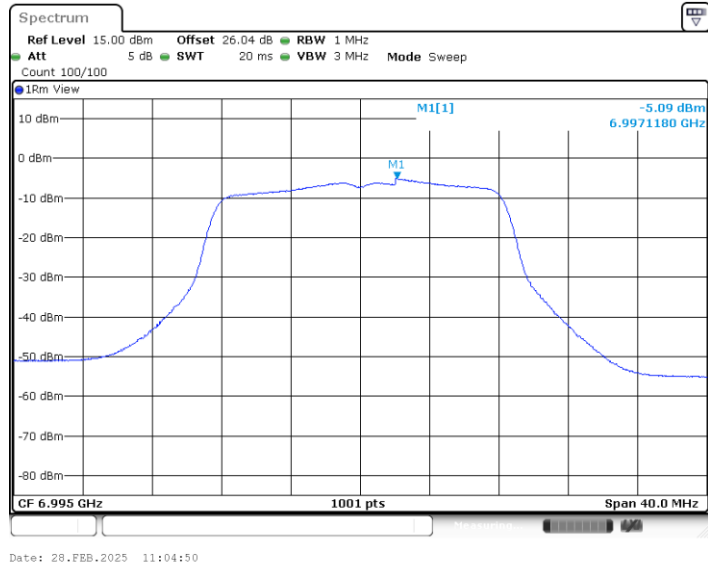




11A_Ant2_7095

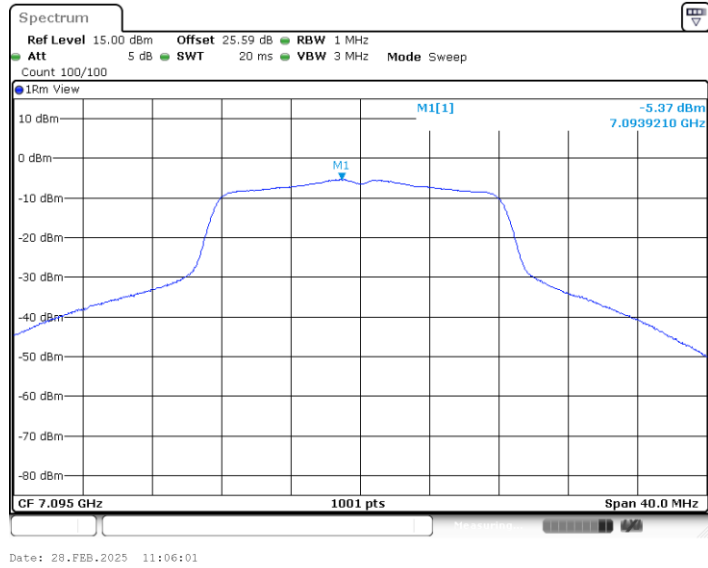


11A_Ant2_7115

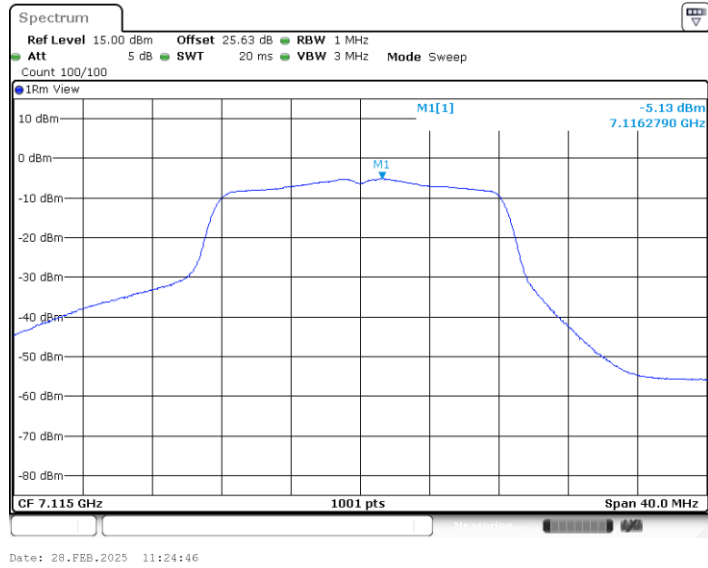




11AX20SISO_Ant2_5955

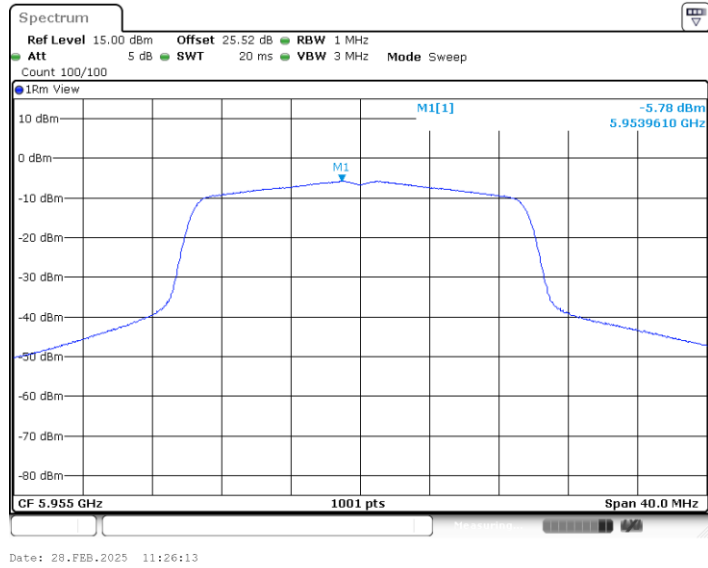


11AX20SISO_Ant2_6195

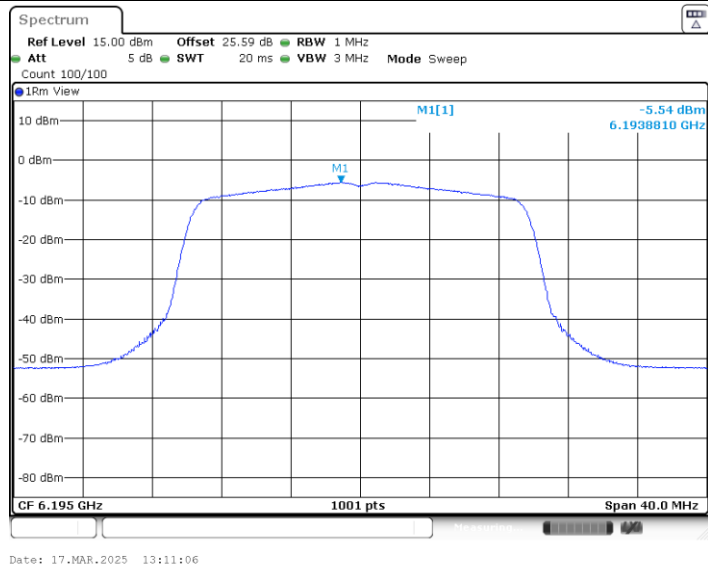




11AX20SISO_Ant2_6415

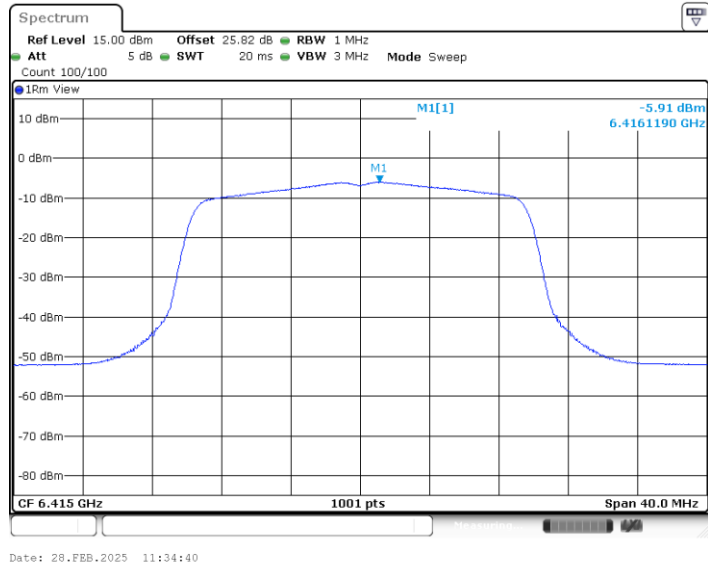


11AX20SISO_Ant2_6435

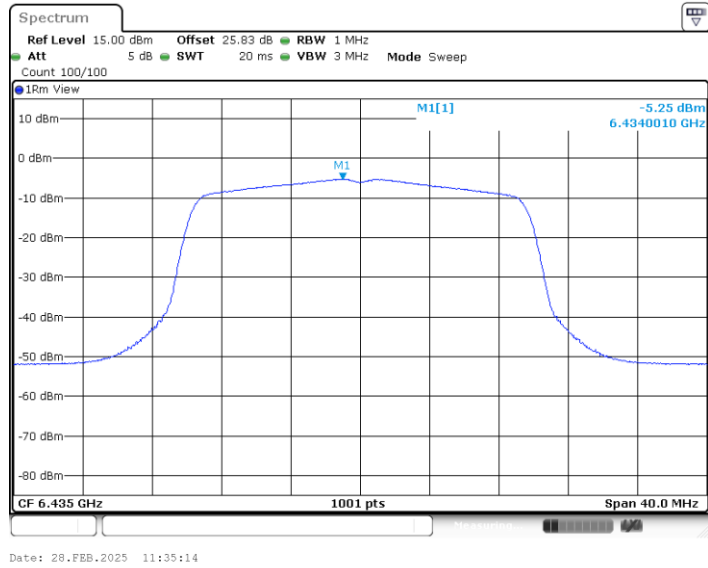




11AX20SISO_Ant2_6475

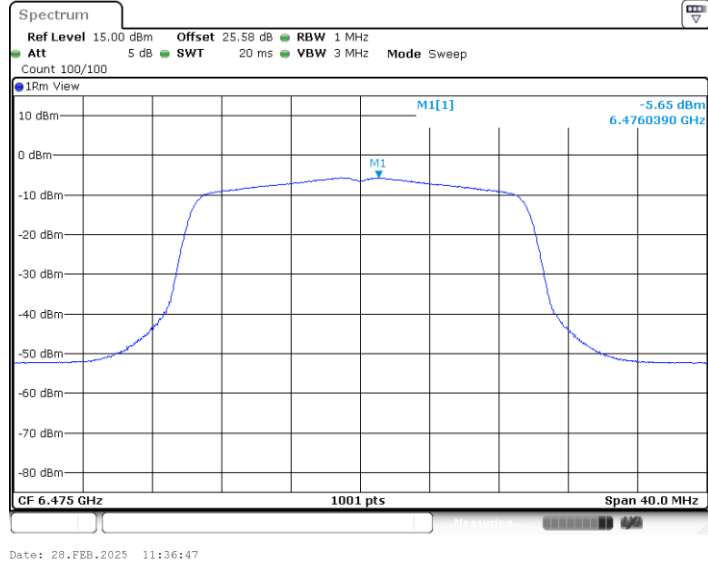


11AX20SISO_Ant2_6515

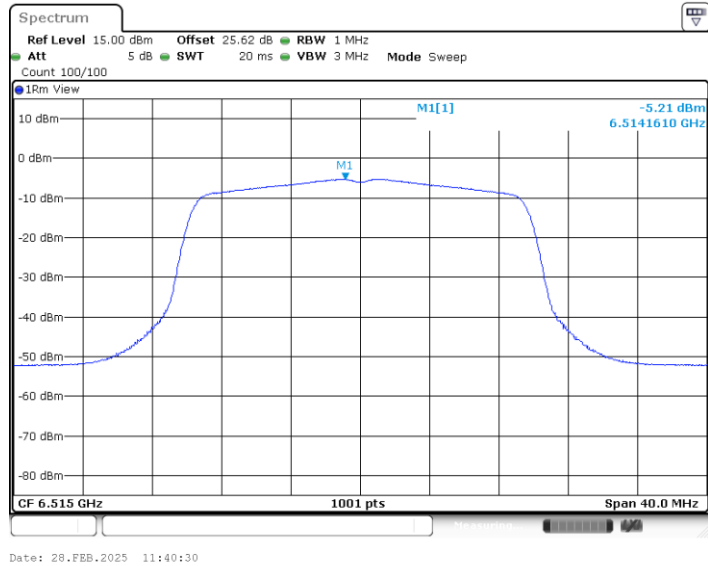




11AX20SISO_Ant2_6535

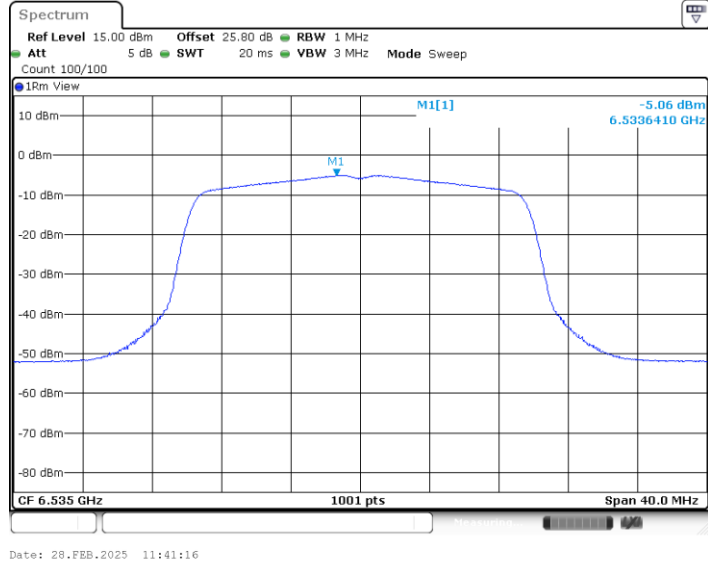


11AX20SISO_Ant2_6695

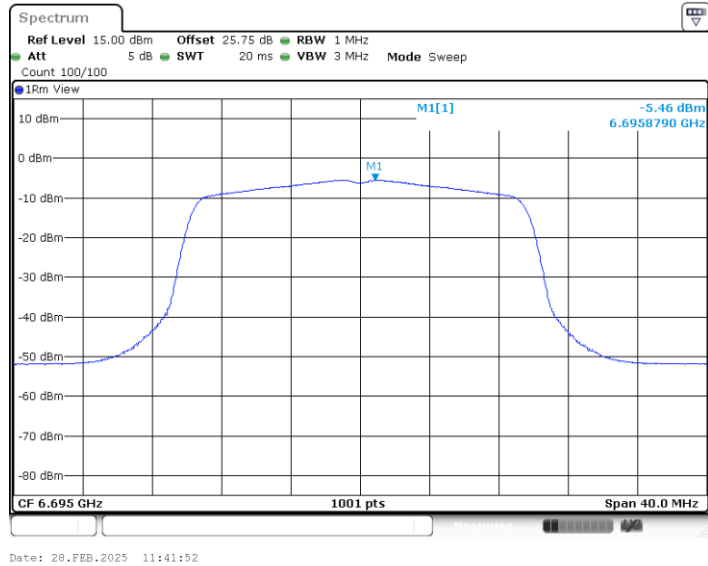




11AX20SISO_Ant2_6855

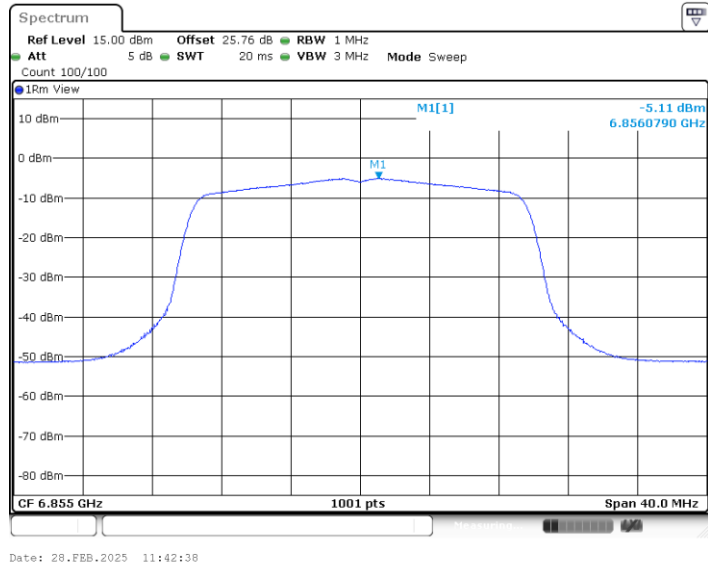


11AX20SISO_Ant2_6875

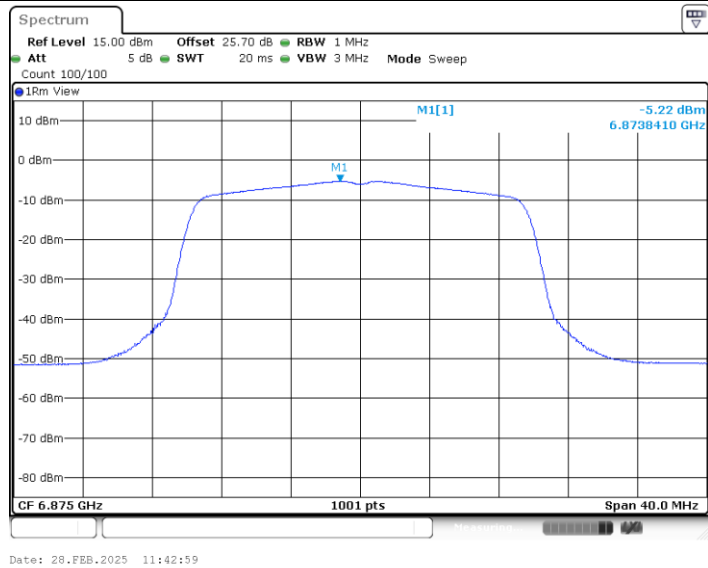




11AX20SISO_Ant2_6895

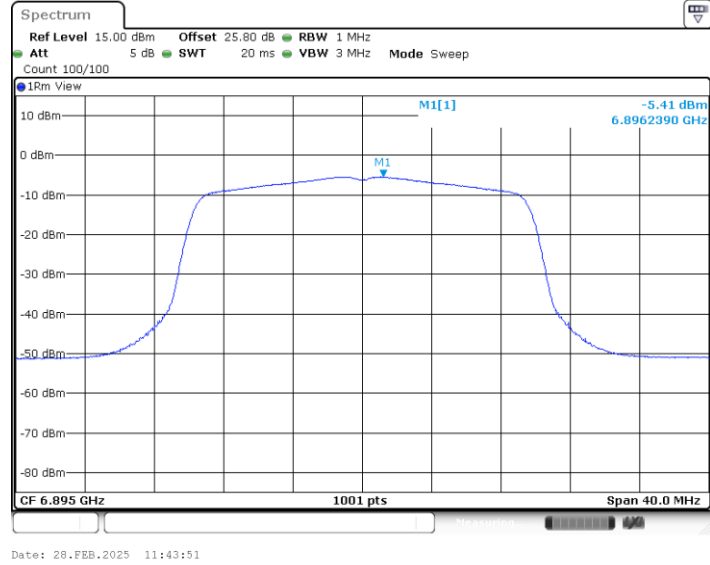


11AX20SISO_Ant2_6995

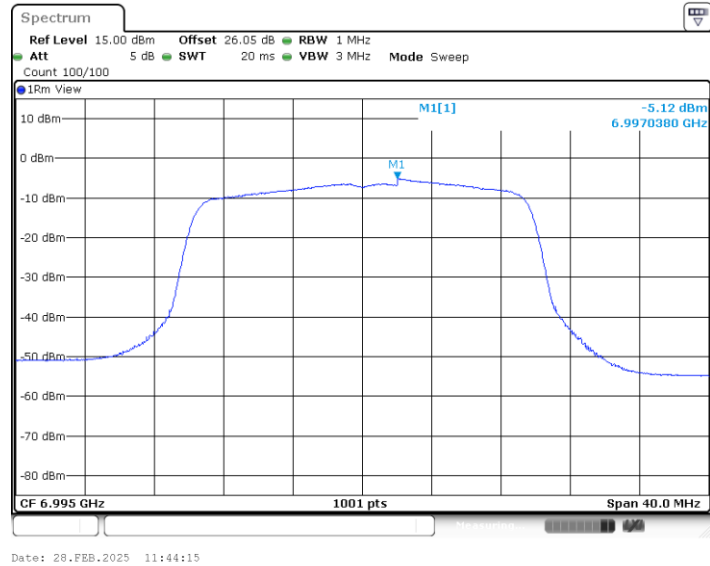




11AX20SISO_Ant2_7095

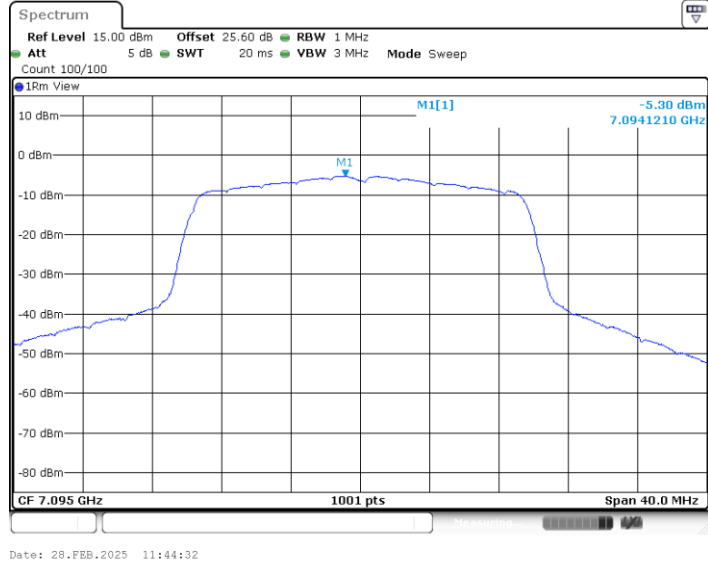


11AX20SISO_Ant2_7115

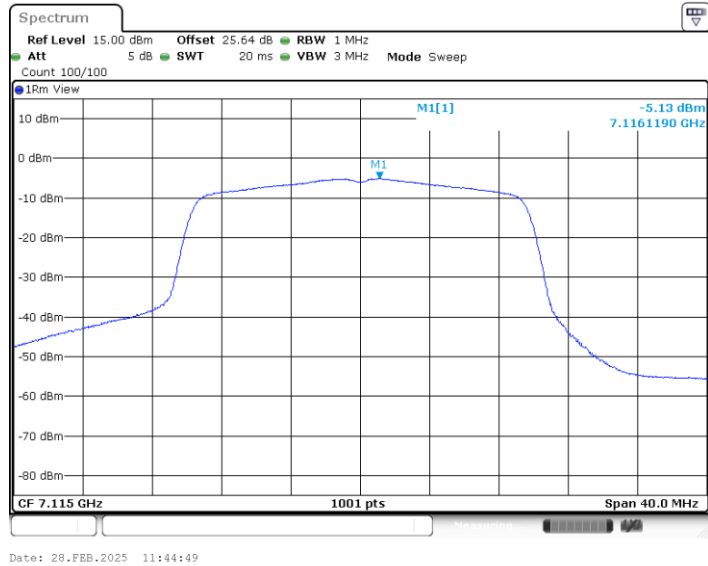




11AX40SISO_Ant2_5965

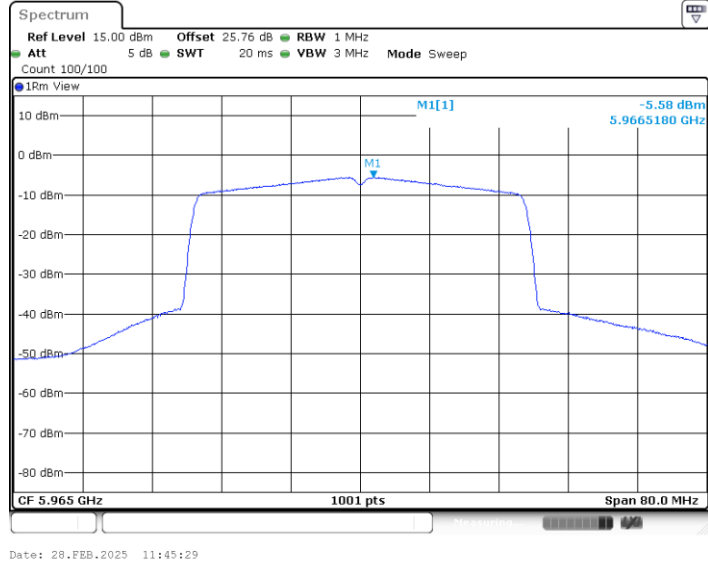


11AX40SISO_Ant2_6205

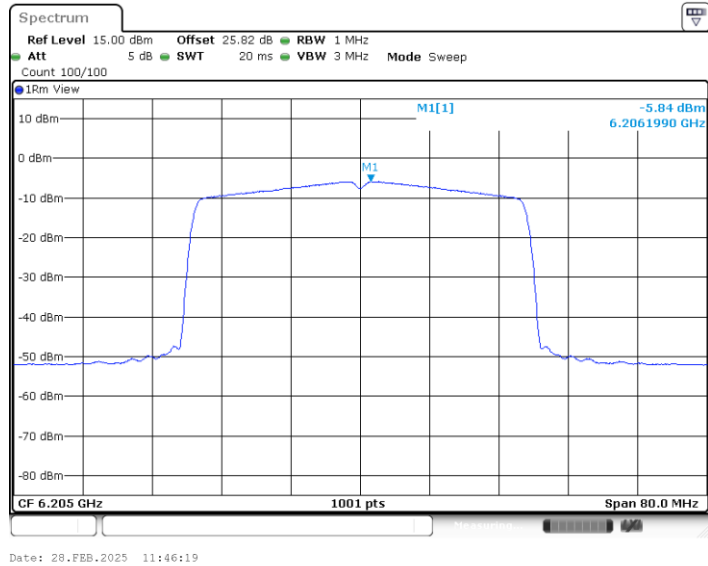




11AX40SISO_Ant2_6405

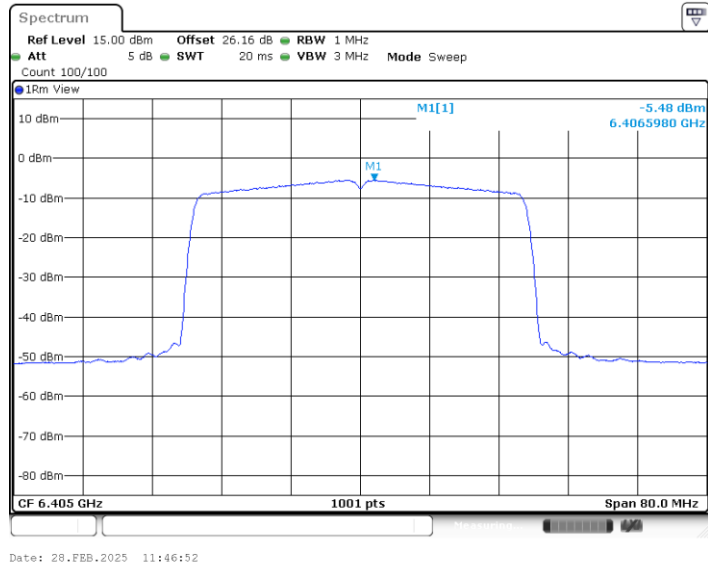


11AX40SISO_Ant2_6445

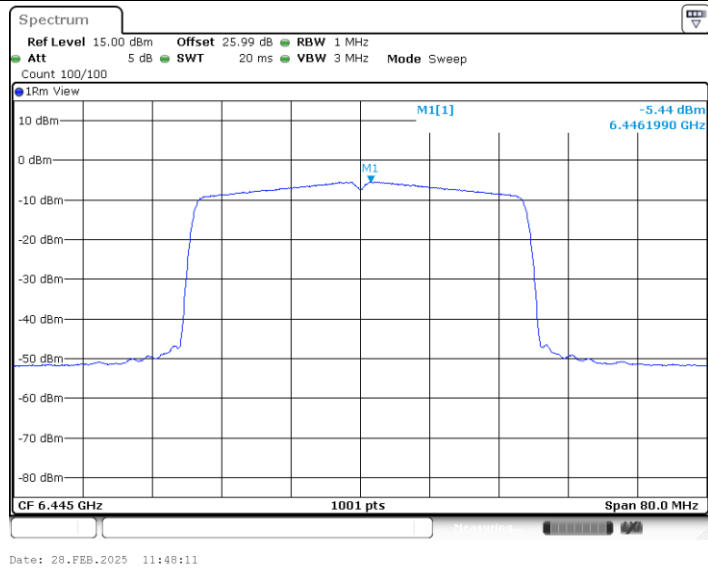




11AX40SISO_Ant2_6485

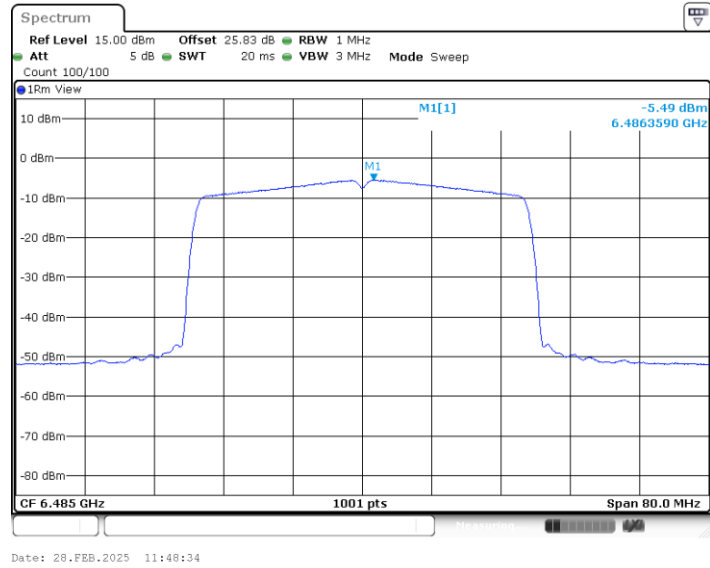


11AX40SISO_Ant2_6525

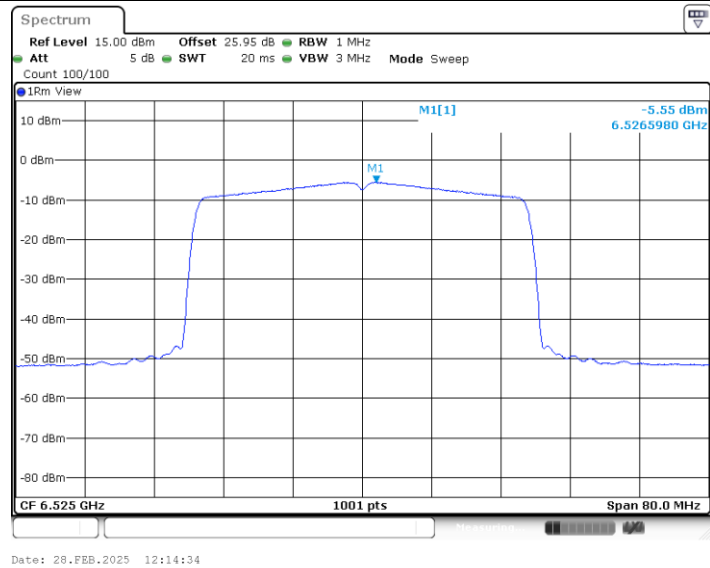




11AX40SISO_Ant2_6565

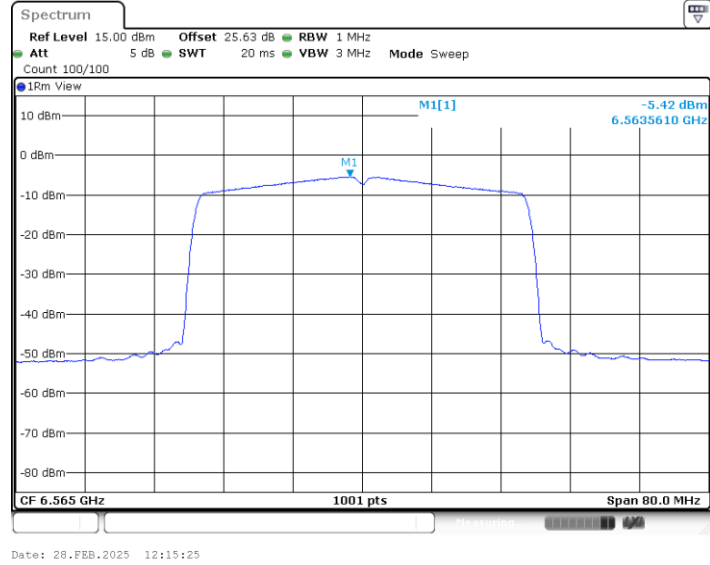


11AX40SISO_Ant2_6685

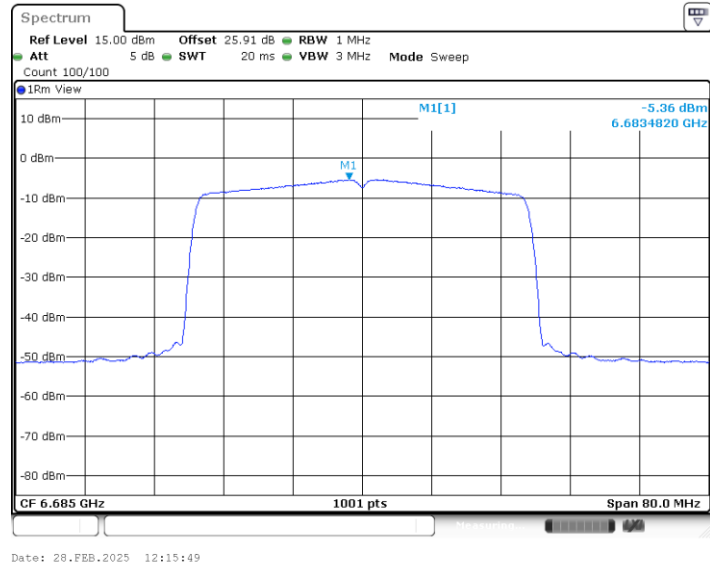




11AX40SISO_Ant2_6845

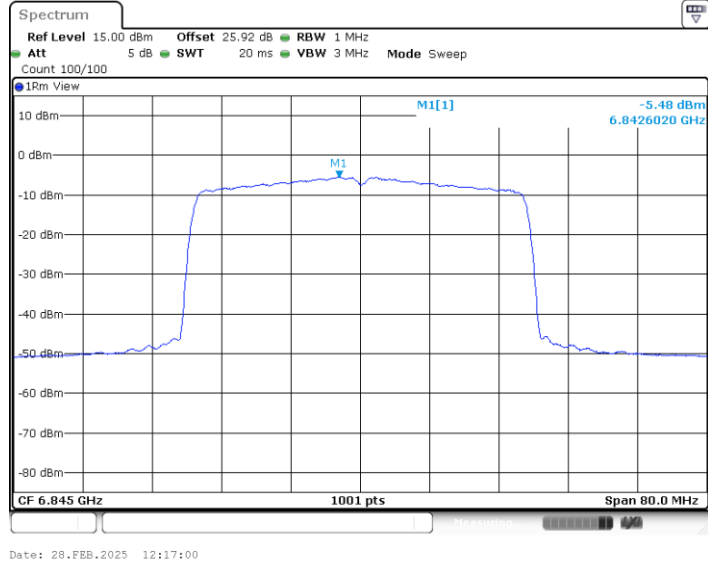


11AX40SISO_Ant2_6885

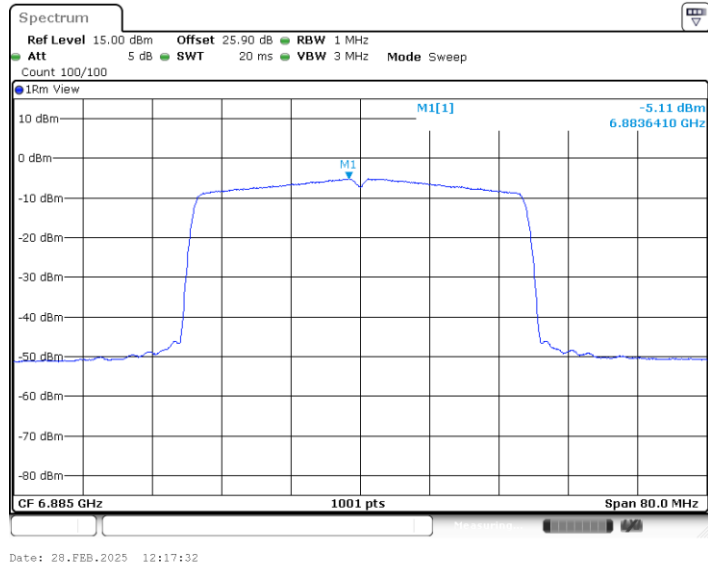




11AX40SISO_Ant2_6925

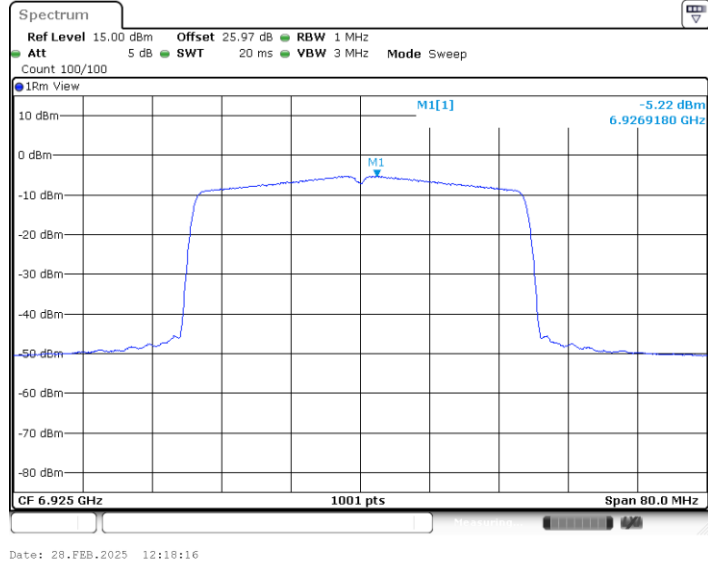


11AX40SISO_Ant2_7005

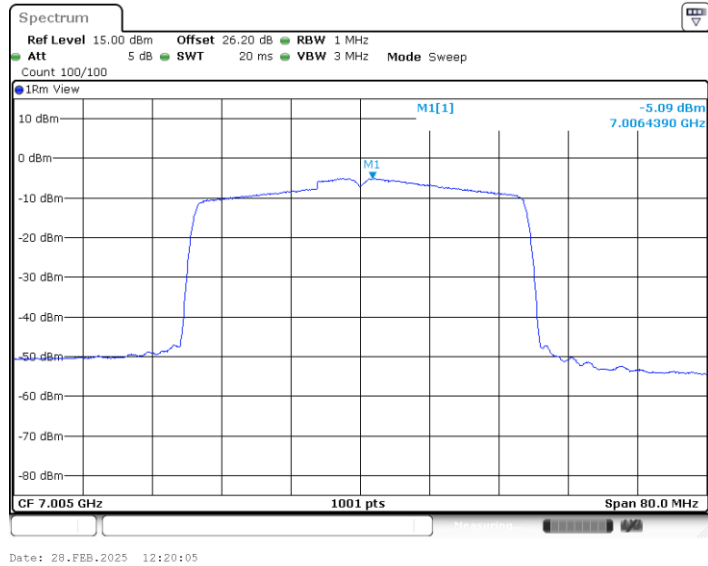




11AX40SISO_Ant2_7085

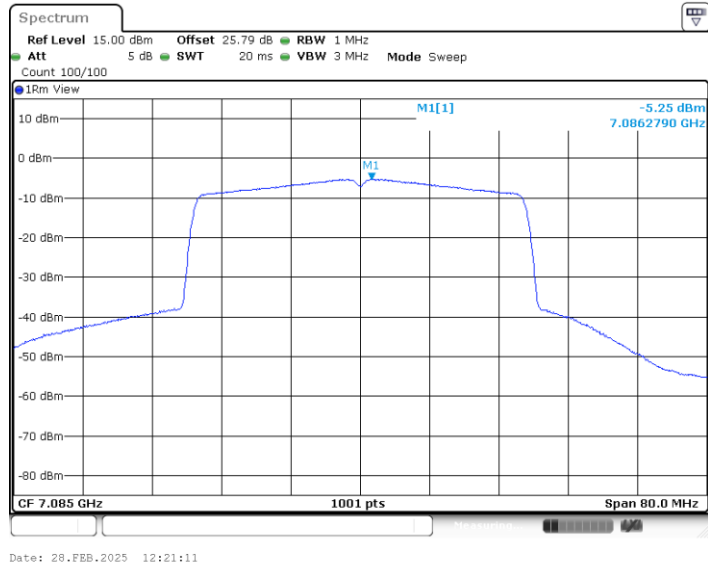


11AX80SISO_Ant2_5985

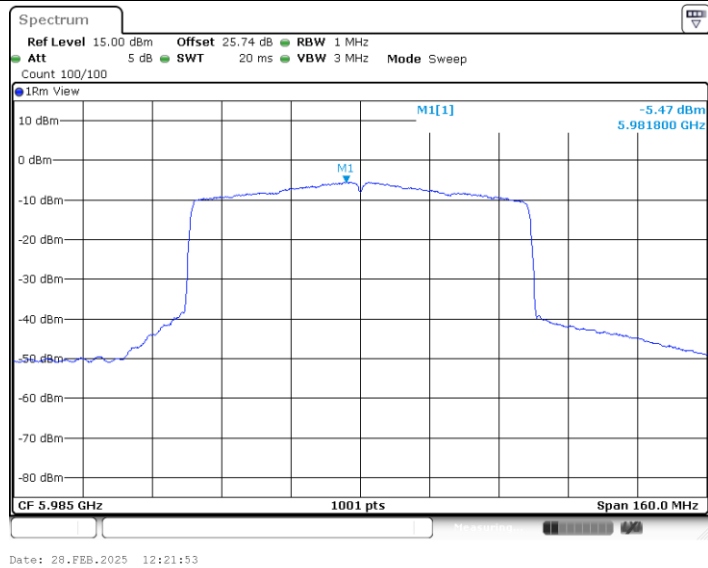




11AX80SISO_Ant2_6225

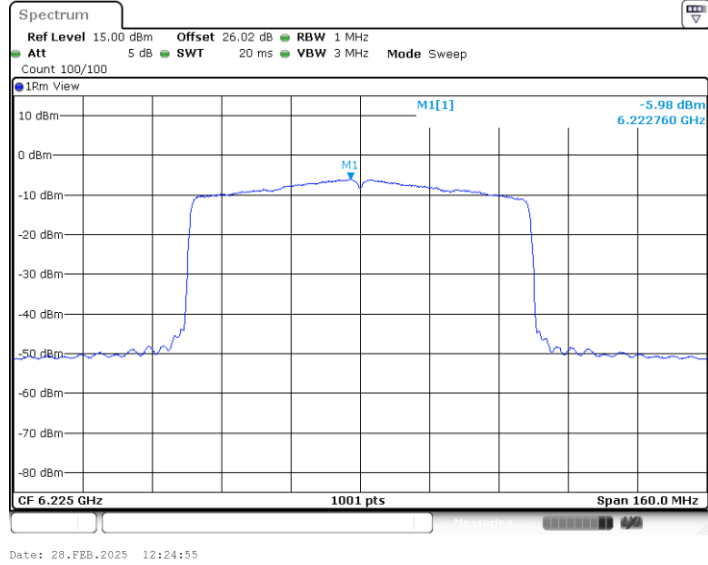


11AX80SISO_Ant2_6385

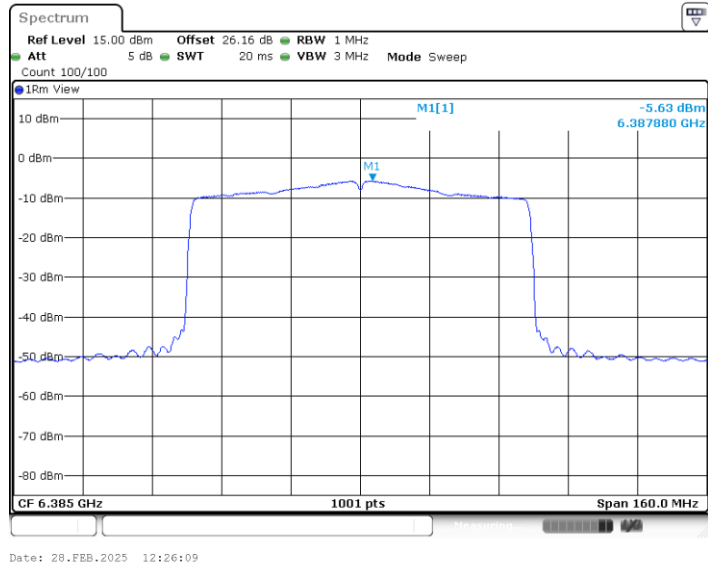




11AX80SISO_Ant2_6465

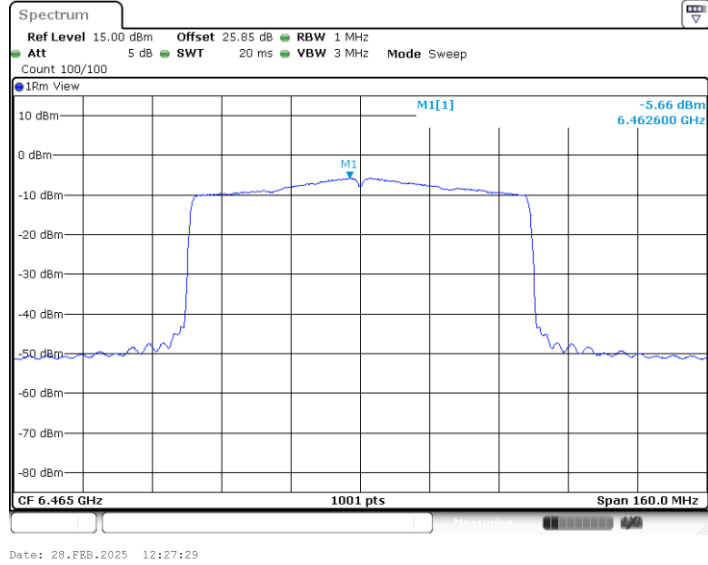


11AX80SISO_Ant2_6545

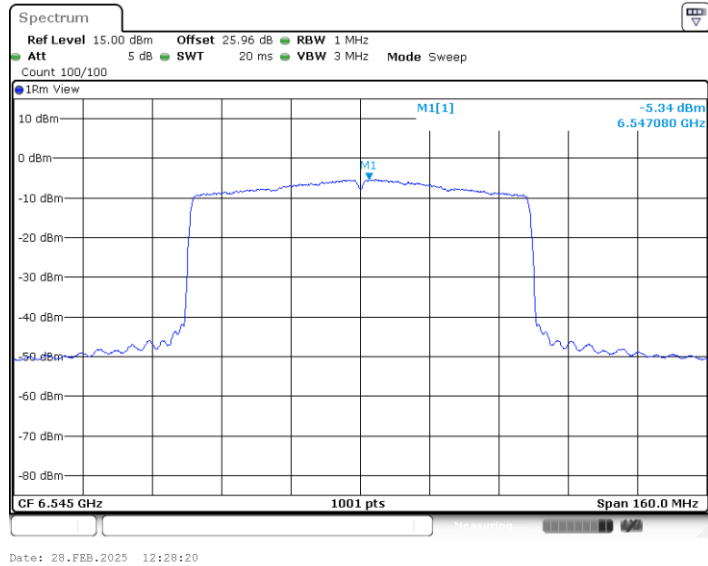



11AX80SISO_Ant2_6625

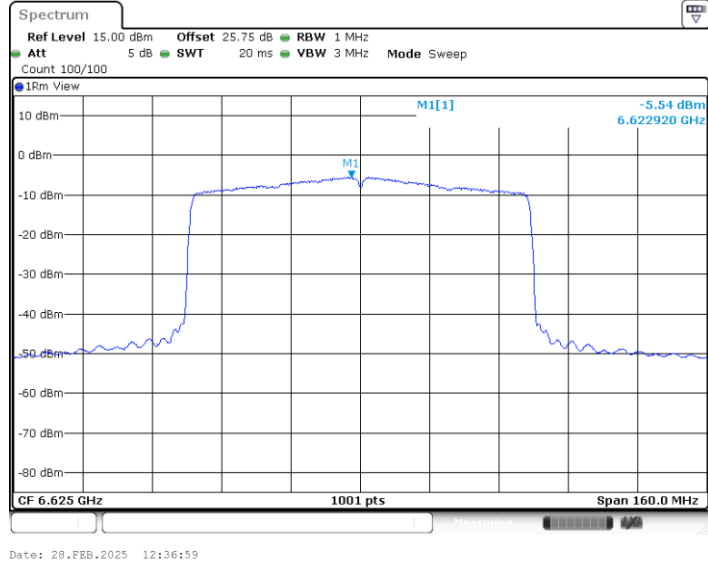

11AX80SISO_Ant2_6705

