




Test report No. : 4790358903-US-R1-V0
Page : 102 of 154
Issued date : 2022/6/7
FCC ID : 2A4GY-LB-TABLET01

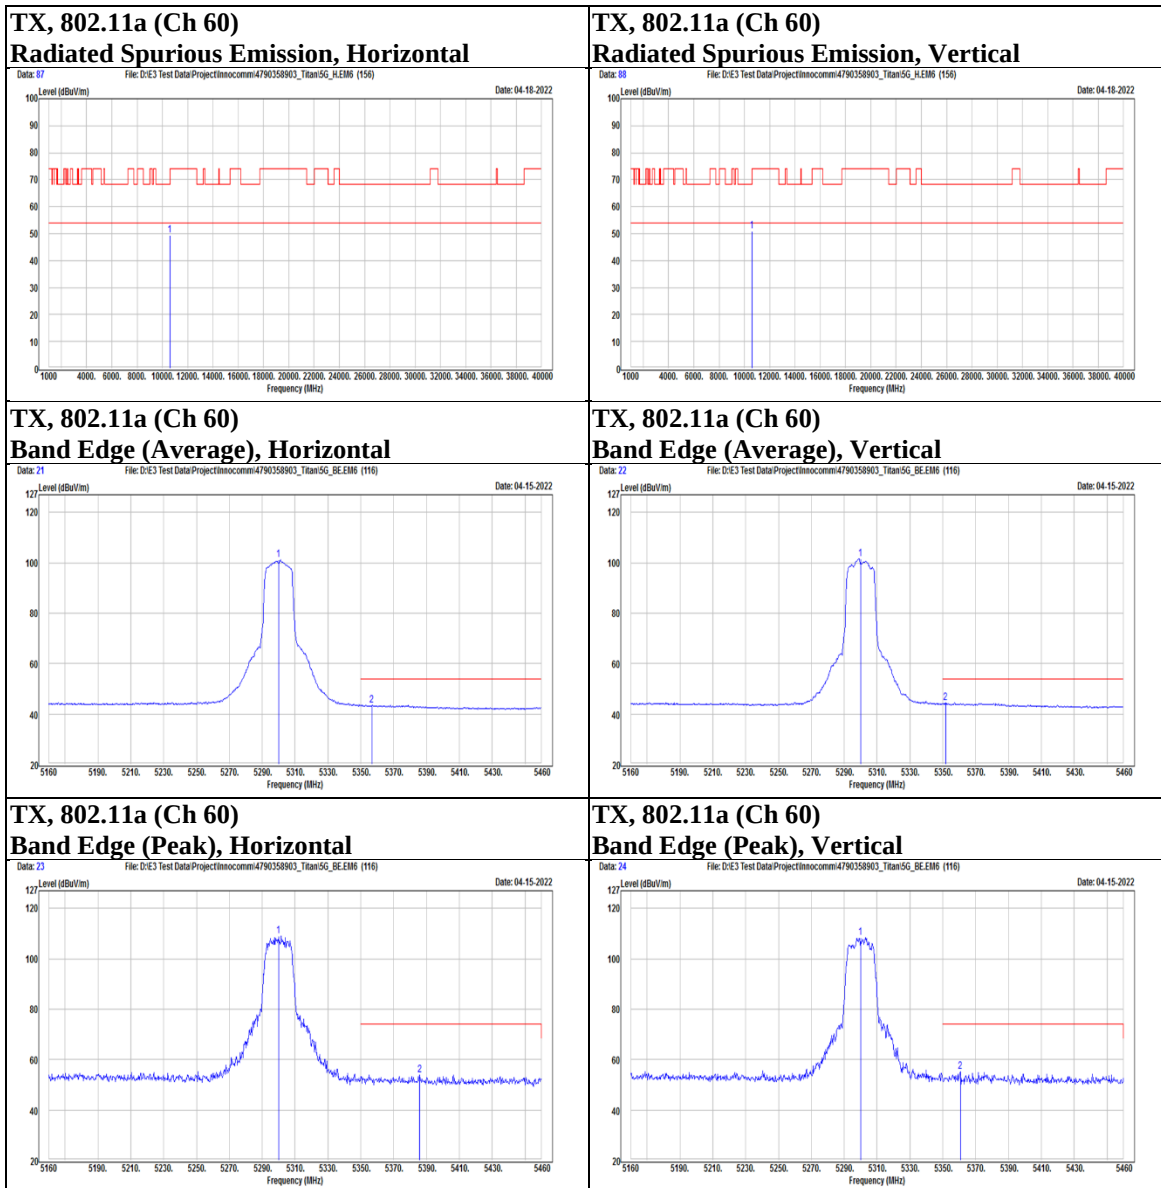

Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan

Telephone : +886-2-7737-3000

Facsimile (FAX) : +886-3-583-7948

Doc No: 17-EM-F0878 / 6.0



Test report No. : 4790358903-US-R1-V0
Page : 103 of 154
Issued date : 2022/6/7
FCC ID : 2A4GY-LB-TABLET01

Mode	802.11a	Channel	64
------	---------	---------	----

Polarization	Notation	Frequency	Reading	Correct	Result	Limit	Margin	Remark
		(MHz)	(dBuV)	(dB/m)	(dBuV/m)	(dBuV/m)	(dB)	
Horizontal	@	5320	95.66	12.86	108.52	N/A	N/A	PK
	@	5320	88.59	12.86	101.45	N/A	N/A	AVG
		5350.2	32.11	13.01	45.12	54	-8.88	AVG
		5370	41.89	13.12	55.01	74	-18.99	PK
	*	10640	32.15	18.03	50.18	74	-23.82	PK
Vertical	@	5320	96.04	12.86	108.9	N/A	N/A	PK
	@	5320	88.82	12.86	101.68	N/A	N/A	AVG
		5360.1	32.2	13.07	45.27	54	-8.73	AVG
		5360.4	42.2	13.07	55.27	74	-18.73	PK
	*	10640	30.9	18.03	48.93	74	-25.07	PK

Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan


Telephone :+886-2-7737-3000

Facsimile (FAX) :+886-3-583-7948

Doc No: 17-EM-F0878 / 6.0



Test report No. : 4790358903-US-R1-V0
Page : 104 of 154
Issued date : 2022/6/7
FCC ID : 2A4GY-LB-TABLET01

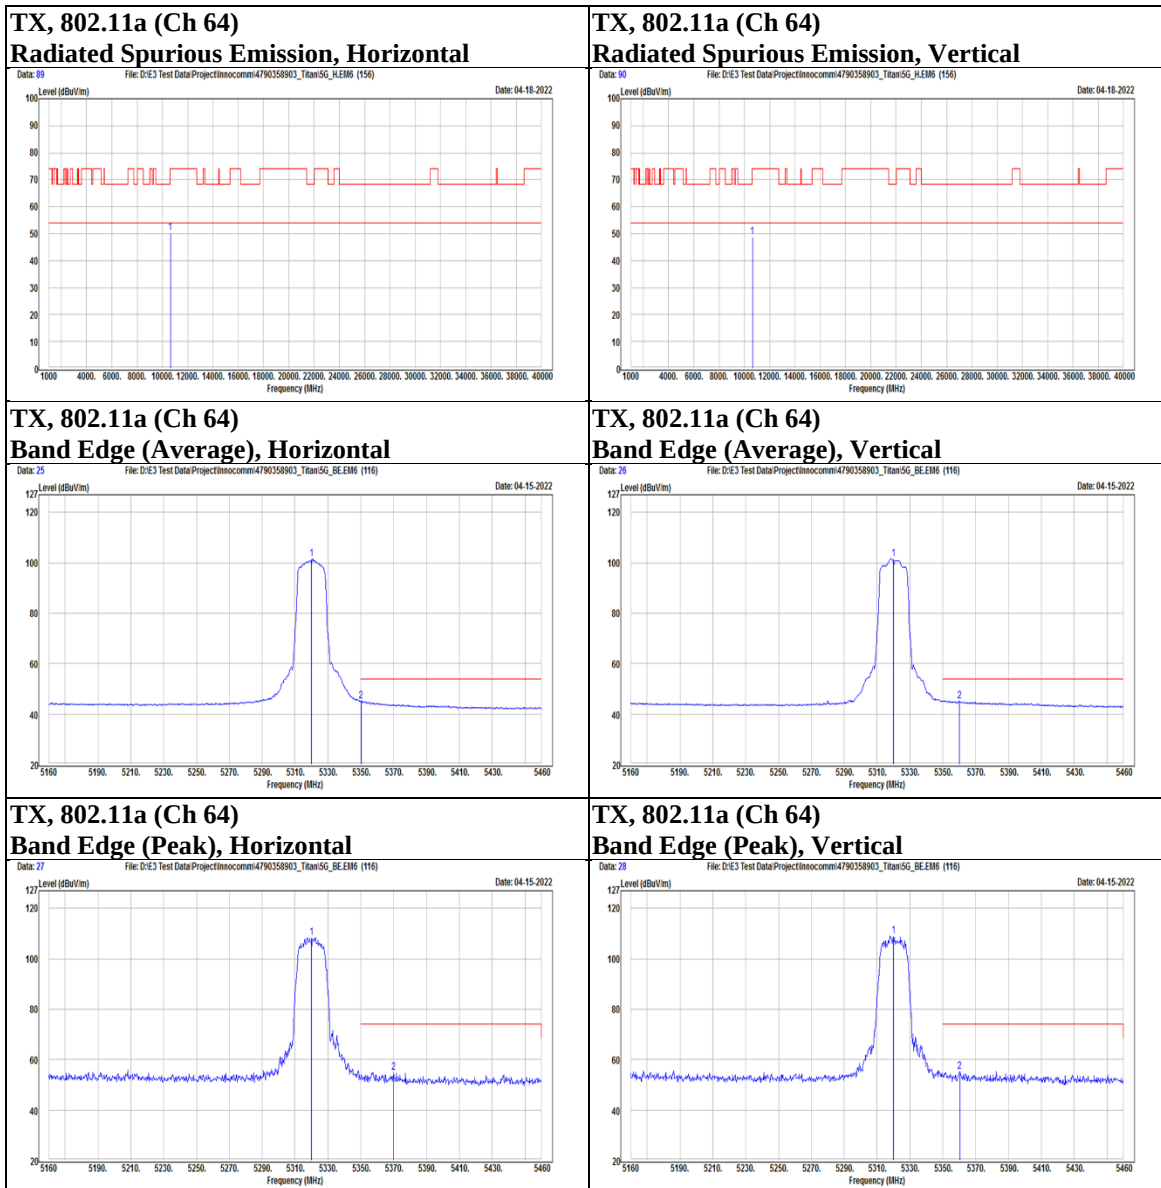

Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan

Telephone : +886-2-7737-3000

Facsimile (FAX) : +886-3-583-7948


Doc No: 17-EM-F0878 / 6.0



Test report No. : 4790358903-US-R1-V0
Page : 105 of 154
Issued date : 2022/6/7
FCC ID : 2A4GY-LB-TABLET01

Mode	802.11a	Channel	100
------	---------	---------	-----

Polarization	Notation	Frequency	Reading	Correct	Result	Limit	Margin	Remark
		(MHz)	(dBuV)	(dB/m)	(dBuV/m)	(dBuV/m)	(dB)	
Horizontal		5423.1	43.2	13.38	56.58	74	-17.42	PK
		5423.1	32.1	13.38	45.48	54	-8.52	AVG
		5462.3	42.21	13.58	55.79	68.2	-12.41	PK
	@	5500	95.21	13.77	108.98	N/A	N/A	PK
	@	5500	85.4	13.77	99.17	N/A	N/A	AVG
	*	11000	31.59	18.41	50	74	-24	PK
Vertical		5426.6	42.66	13.4	56.06	74	-17.94	PK
		5426.6	31.1	13.4	44.5	54	-9.5	AVG
		5464.05	41.87	13.59	55.46	68.2	-12.74	PK
	@	5500	95.97	13.77	109.74	N/A	N/A	PK
	@	5500	85.3	13.77	99.07	N/A	N/A	AVG
	*	11000	30.94	18.41	49.35	74	-24.65	PK

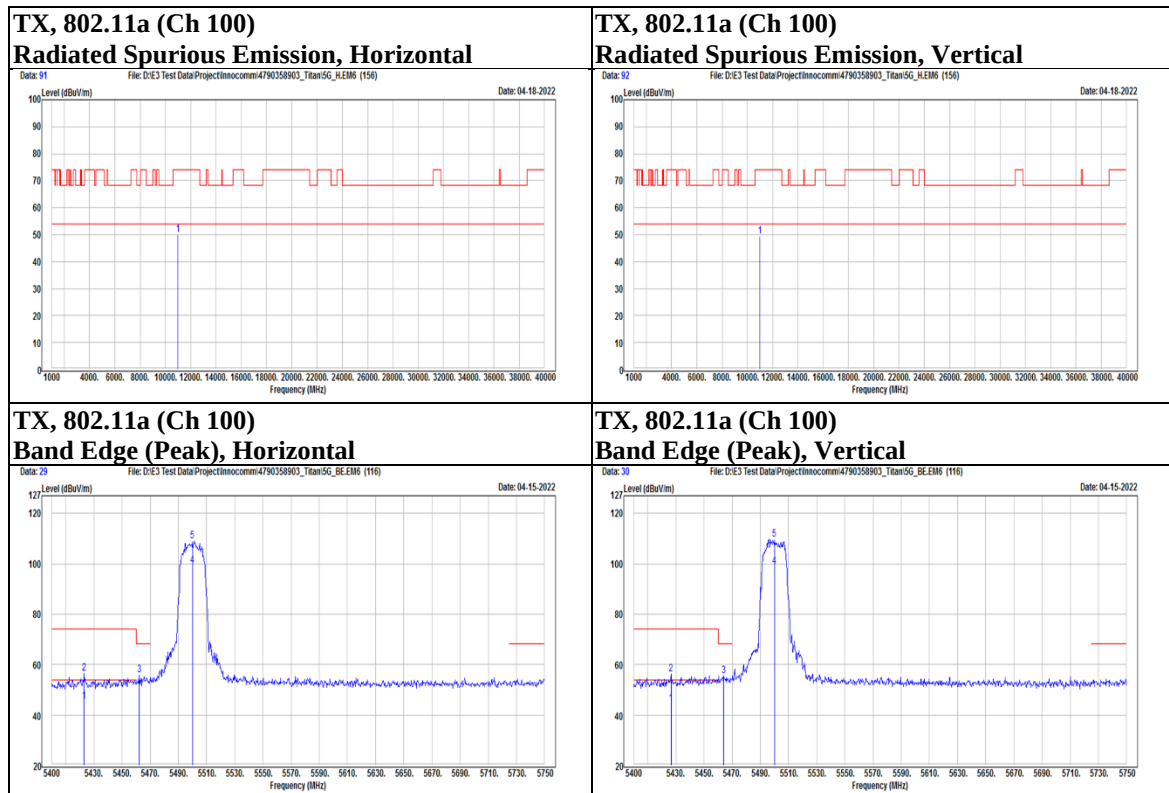

Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan

Telephone : +886-2-7737-3000


Facsimile (FAX) : +886-3-583-7948

Doc No: 17-EM-F0878 / 6.0



Mode	802.11a	Channel	116
------	---------	---------	-----

Polarization	Notation	Frequency (MHz)	Reading (dBuV)	Correct (dB/m)	Result (dBuV/m)	Limit (dBuV/m)	Margin (dB)	Remark
Horizontal		5454.25	40.88	13.54	54.42	74	-19.58	PK
		5454.25	29.2	13.54	42.74	54	-11.26	AVG
		5464.4	39.97	13.59	53.56	68.2	-14.64	PK
	@	5580	95.95	13.76	109.71	N/A	N/A	PK
	@	5580	85.89	13.76	99.65	N/A	N/A	AVG
		5747.9	41.35	14.17	55.52	68.2	-12.68	PK
	*	11160	30.5	18.47	48.97	74	-25.03	PK
Vertical		5438.85	40.15	13.47	53.62	74	-20.38	PK
		5438.85	29.69	13.47	43.16	54	-10.84	AVG
		5468.95	40.73	13.62	54.35	68.2	-13.85	PK
	@	5580	95.55	13.76	109.31	N/A	N/A	PK
	@	5580	85.69	13.76	99.45	N/A	N/A	AVG
		5745.8	40.93	14.16	55.09	68.2	-13.11	PK
	*	11160	30.91	18.47	49.38	74	-24.62	PK

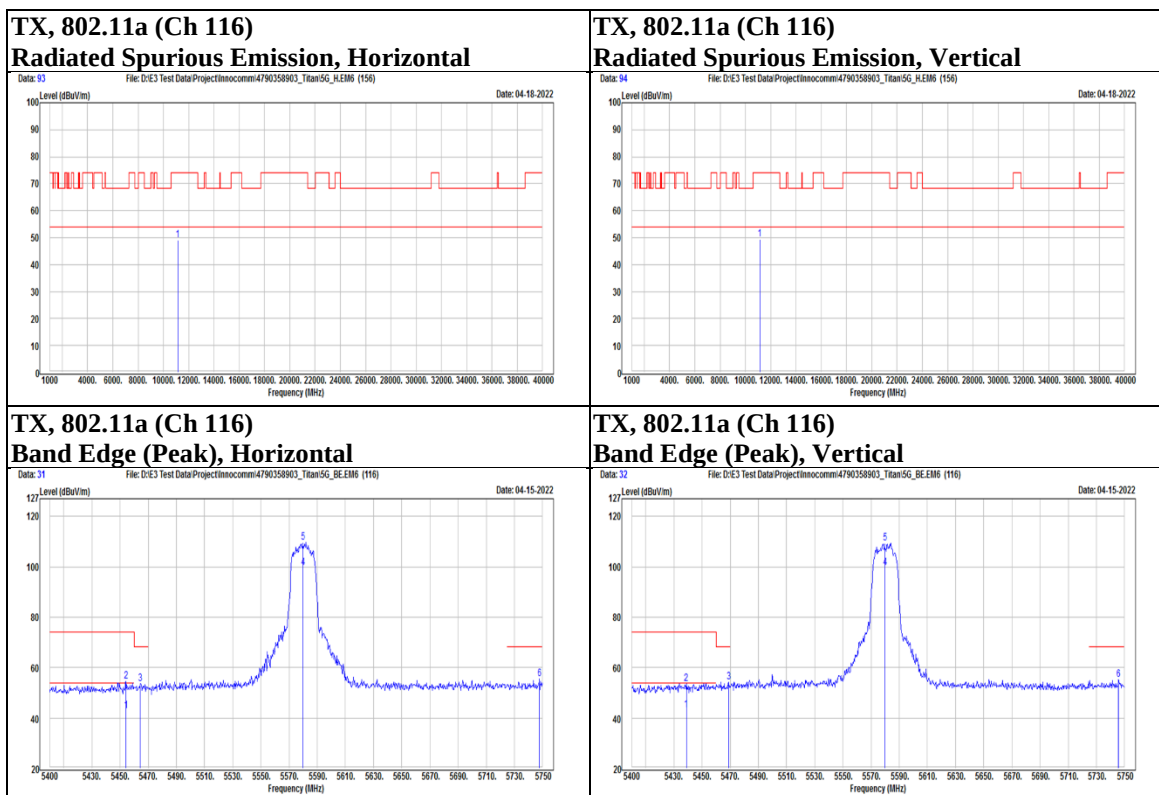

Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan

Telephone : +886-2-7737-3000

Facsimile (FAX) : +886-3-583-7948


Doc No: 17-EM-F0878 / 6.0



Test report No. : 4790358903-US-R1-V0
Page : 107 of 154
Issued date : 2022/6/7
FCC ID : 2A4GY-LB-TABLET01

Mode	802.11a	Channel	140
------	---------	---------	-----

Polarization	Notation	Frequency (MHz)	Reading (dBuV)	Correct (dB/m)	Result (dBuV/m)	Limit (dBuV/m)	Margin (dB)	Remark
Horizontal	@	5700	96.54	13.73	110.27	N/A	N/A	PK
	@	5700	86.1	13.73	99.83	N/A	N/A	AVG
	*	5726.55	52.34	13.97	66.31	68.2	-1.89	PK
	*	11400	30.63	18.85	49.48	74	-24.52	PK
Vertical	@	5700	96.53	13.73	110.26	N/A	N/A	PK
	@	5700	86.5	13.73	100.23	N/A	N/A	AVG
	*	5725.5	48.98	13.96	62.94	68.2	-5.26	PK
	*	11400	30.45	18.85	49.3	74	-24.7	PK

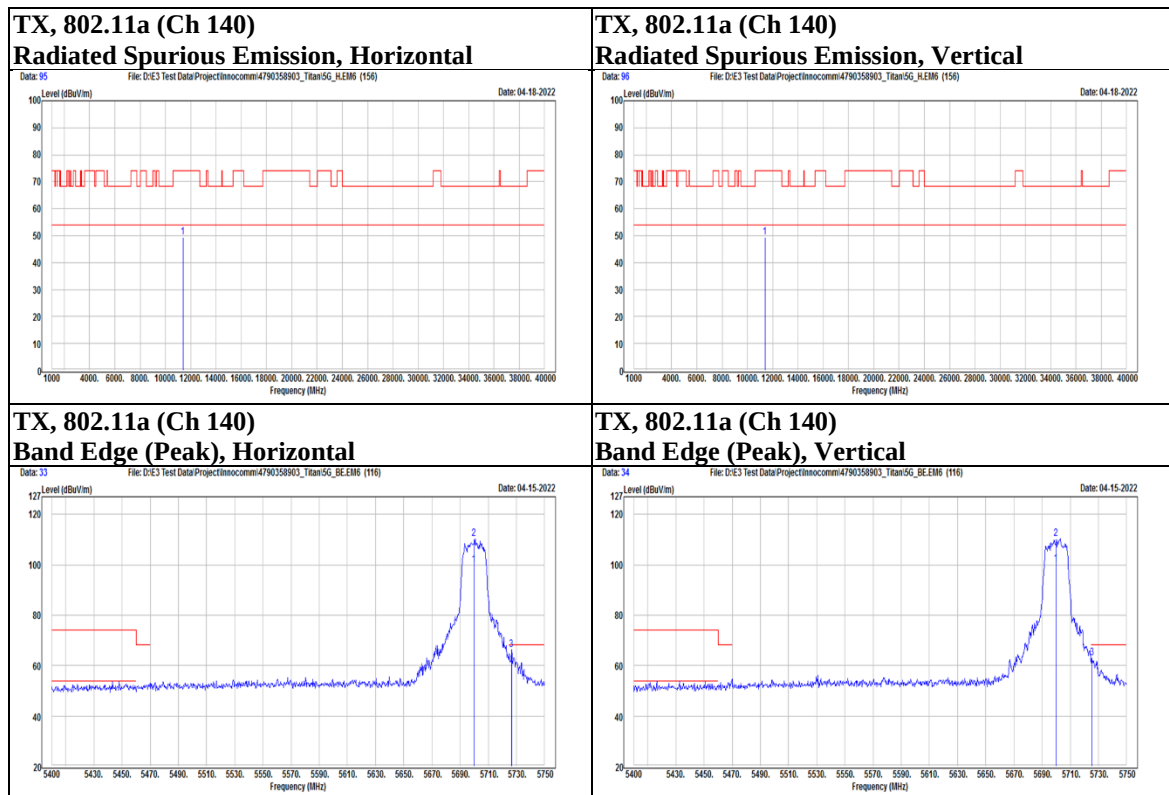

Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan

Telephone : +886-2-7737-3000

Facsimile (FAX) : +886-3-583-7948


Doc No: 17-EM-F0878 / 6.0



Test report No. : 4790358903-US-R1-V0
Page : 108 of 154
Issued date : 2022/6/7
FCC ID : 2A4GY-LB-TABLET01

Mode	802.11a	Channel	149
------	---------	---------	-----

Polarization	Notation	Frequency (MHz)	Reading (dBuV)	Correct (dB/m)	Result (dBuV/m)	Limit (dBuV/m)	Margin (dB)	Remark
Horizontal		5627	41.12	13.68	54.8	68.2	-13.4	PK
		5658	42.58	13.68	56.26	74.14	-17.88	PK
	@	5745	95.26	14.15	109.41	N/A	N/A	PK
	*	11490	31.06	19.33	50.39	74	-23.61	PK
Vertical		5640	42.03	13.67	55.7	68.2	-12.5	PK
		5658	41.49	13.68	55.17	74.14	-18.97	PK
	@	5745	96.39	14.15	110.54	N/A	N/A	PK
	*	11490	32.65	19.33	51.98	74	-22.02	PK

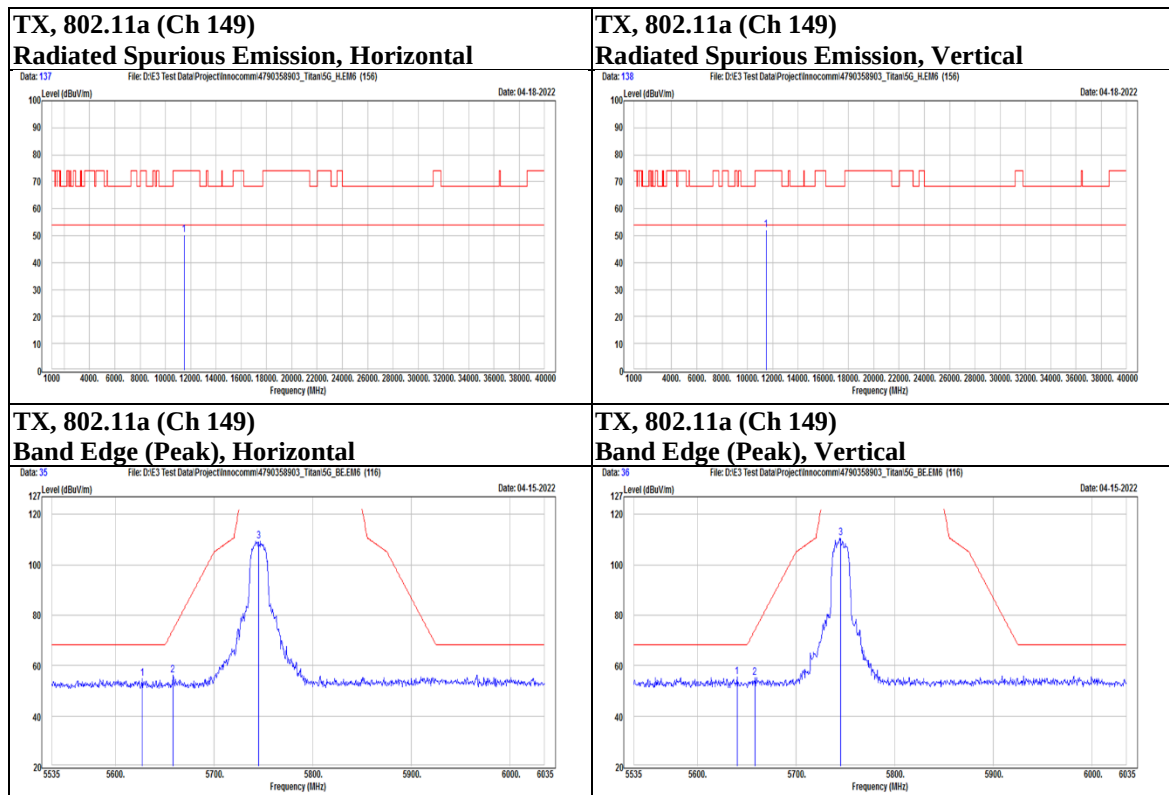

Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan

Telephone : +886-2-7737-3000

Facsimile (FAX) : +886-3-583-7948


Doc No: 17-EM-F0878 / 6.0



Test report No. : 4790358903-US-R1-V0
Page : 109 of 154
Issued date : 2022/6/7
FCC ID : 2A4GY-LB-TABLET01

Mode	802.11a	Channel	157
------	---------	---------	-----

Polarization	Notation	Frequency	Reading	Correct	Result	Limit	Margin	Remark
		(MHz)	(dBuV)	(dB/m)	(dBuV/m)	(dBuV/m)	(dB)	
Horizontal	@	5618.5	42.09	13.68	55.77	68.2	-12.43	PK
		5684.5	40.42	13.71	54.13	93.76	-39.63	PK
		5785	95.75	14.45	110.2	N/A	N/A	PK
	*	5908	40.8	14.97	55.77	80.74	-24.97	PK
		6009	41.38	14.99	56.37	68.2	-11.83	PK
		11570	31.71	19.07	50.78	74	-23.22	PK
Vertical	@	5615	42.06	13.69	55.75	68.2	-12.45	PK
		5684	41.58	13.7	55.28	93.4	-38.12	PK
		5785	96.53	14.45	110.98	N/A	N/A	PK
	*	5894	40.82	14.93	55.75	91.1	-35.35	PK
		6032.5	41.2	14.97	56.17	68.2	-12.03	PK
		11570	31.29	19.07	50.36	74	-23.64	PK

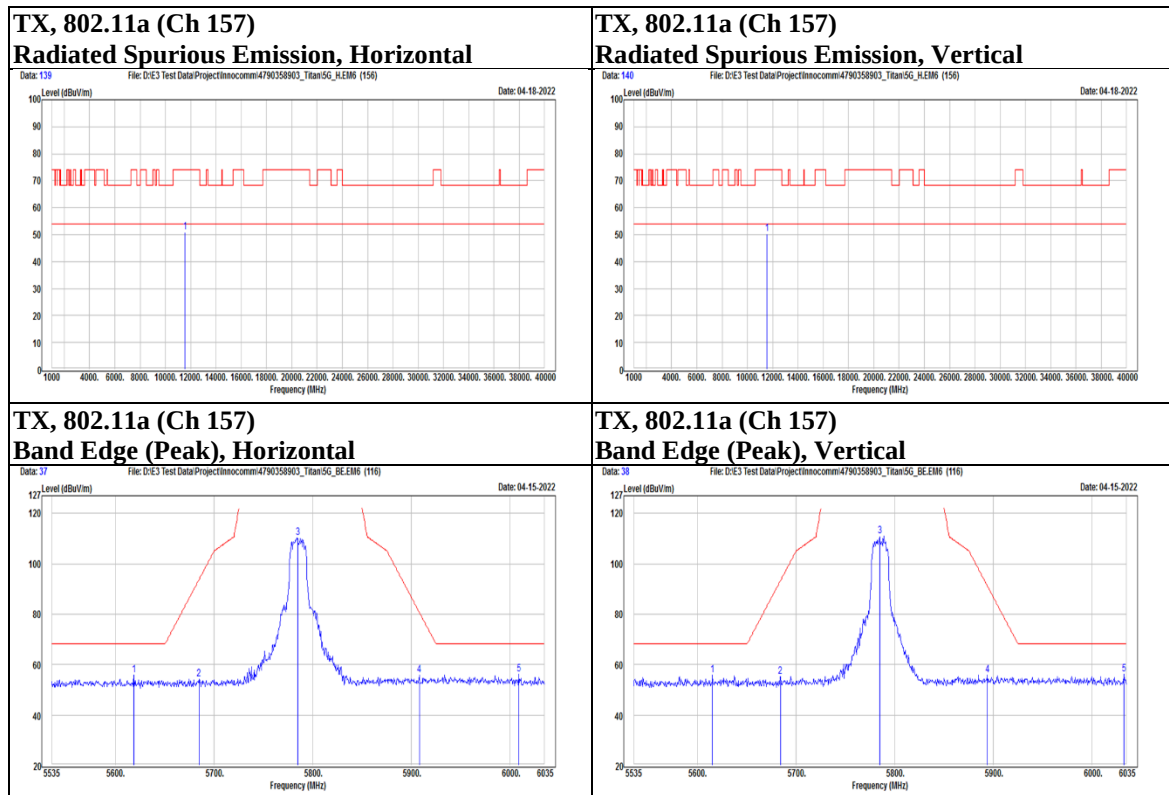

Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan

Telephone : +886-2-7737-3000

Facsimile (FAX) : +886-3-583-7948


Doc No: 17-EM-F0878 / 6.0



Test report No. : 4790358903-US-R1-V0
Page : 110 of 154
Issued date : 2022/6/7
FCC ID : 2A4GY-LB-TABLET01

Mode	802.11a	Channel	165
------	---------	---------	-----

Polarization	Notation	Frequency	Reading	Correct	Result	Limit	Margin	Remark
		(MHz)	(dBuV)	(dB/m)	(dBuV/m)	(dBuV/m)	(dB)	
Horizontal	@	5825	94.82	14.58	109.4	N/A	N/A	PK
		5905.5	41.17	14.97	56.14	82.59	-26.45	PK
		5939	40.91	14.95	55.86	68.2	-12.34	PK
		11650	36.29	18.83	55.12	74	-18.88	PK
		11650	23.07	18.83	41.9	54	-12.1	AVG
Vertical	@	5825	94.75	14.58	109.33	N/A	N/A	PK
		5906	40.83	14.97	55.8	82.22	-26.42	PK
		5963	41.15	14.96	56.11	68.2	-12.09	PK
	*	11650	30.41	18.83	49.24	74	-24.76	PK

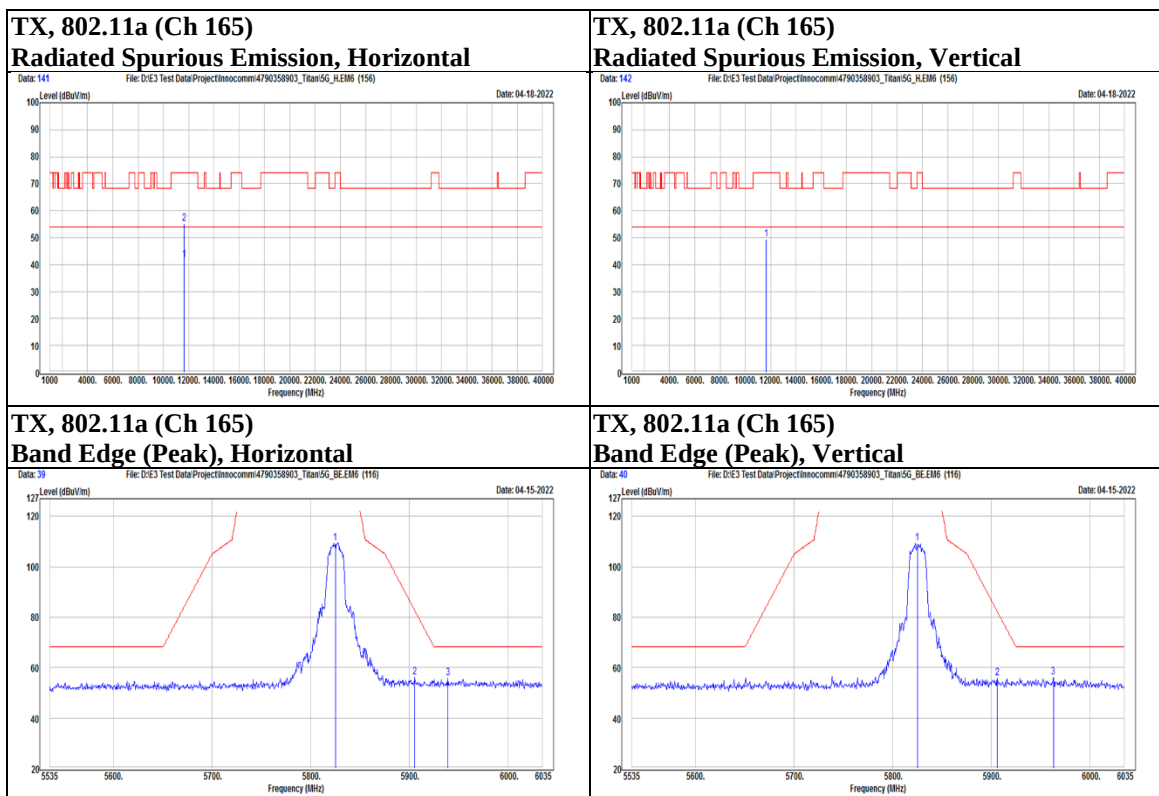

Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan

Telephone : +886-2-7737-3000

Facsimile (FAX) : +886-3-583-7948

Doc No: 17-EM-F0878 / 6.0



Test report No. : 4790358903-US-R1-V0
Page : 111 of 154
Issued date : 2022/6/7
FCC ID : 2A4GY-LB-TABLET01

Mode	802.11ac(VHT20)	Channel	36
------	-----------------	---------	----

Polarization	Notation	Frequency	Reading	Correct	Result	Limit	Margin	Remark
		(MHz)	(dBuV)	(dB/m)	(dBuV/m)	(dBuV/m)	(dB)	
Horizontal		5112.7	42.44	13.43	55.87	74	-18.13	PK
		5148.75	32.3	13.4	45.7	54	-8.3	AVG
	@	5180	93.91	13.31	107.22	N/A	N/A	PK
	@	5180	86.61	13.31	99.92	N/A	N/A	AVG
	*	10360	31.76	17.51	49.27	68.2	-18.93	PK
Vertical		5124.95	42.39	13.43	55.82	74	-18.18	PK
		5149.8	32.44	13.4	45.84	54	-8.16	AVG
	@	5180	94.96	13.31	108.27	N/A	N/A	PK
	@	5180	87.88	13.31	101.19	N/A	N/A	AVG
	*	10360	31.75	17.51	49.26	68.2	-18.94	PK

Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan


Telephone :+886-2-7737-3000

Facsimile (FAX) :+886-3-583-7948

Doc No: 17-EM-F0878 / 6.0



Test report No. : 4790358903-US-R1-V0
Page : 112 of 154
Issued date : 2022/6/7
FCC ID : 2A4GY-LB-TABLET01

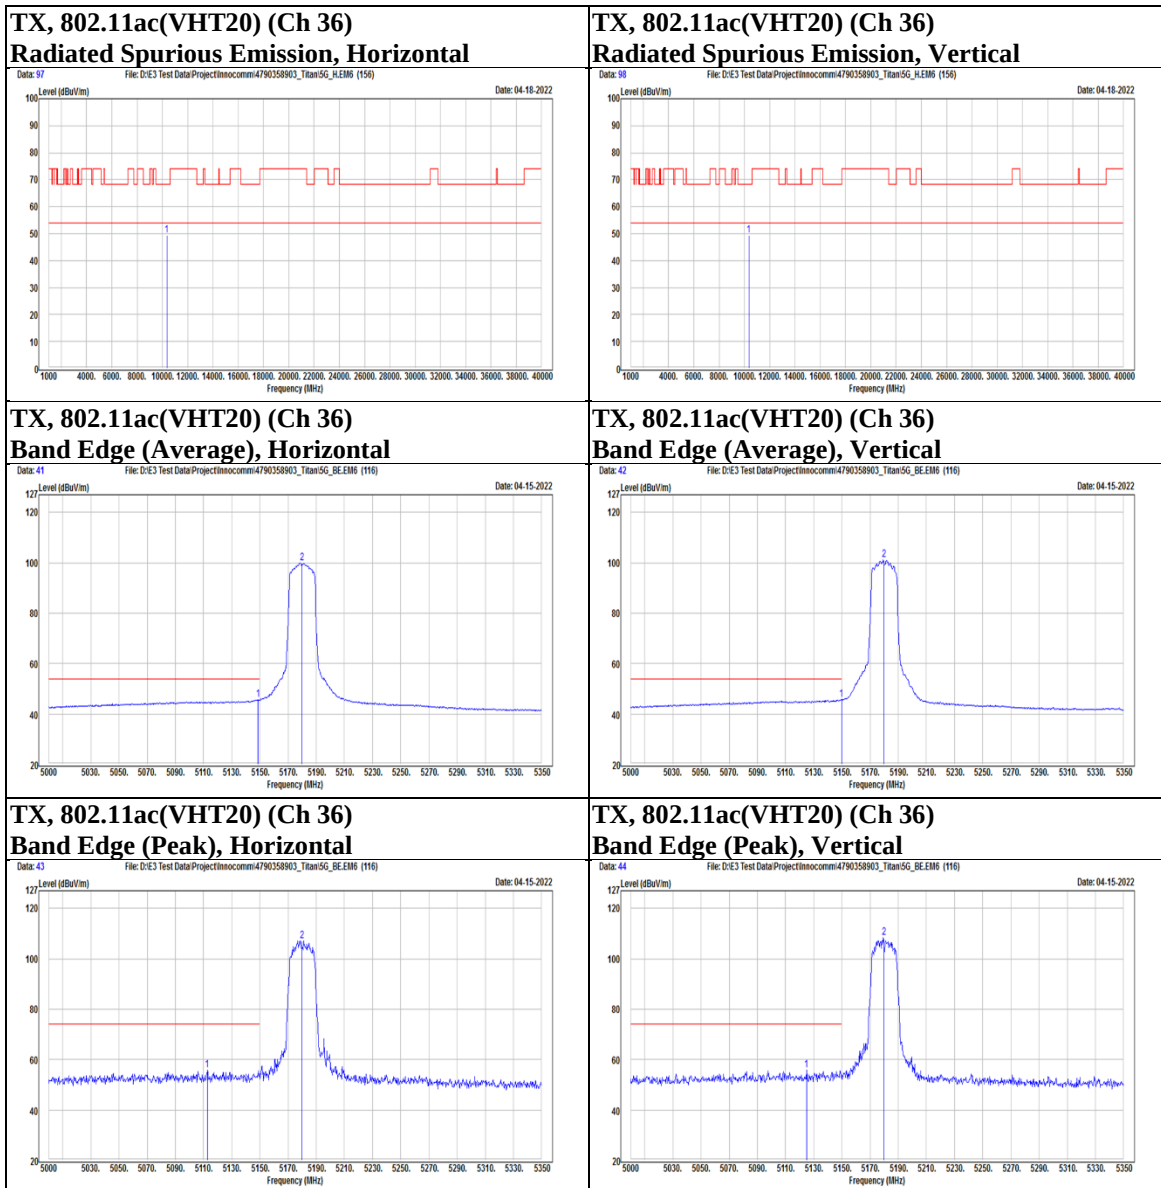

Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan

Telephone : +886-2-7737-3000

Facsimile (FAX) : +886-3-583-7948

Doc No: 17-EM-F0878 / 6.0



Test report No. : 4790358903-US-R1-V0
Page : 113 of 154
Issued date : 2022/6/7
FCC ID : 2A4GY-LB-TABLET01

Mode	802.11ac(VHT20)	Channel	44
------	-----------------	---------	----

Polarization	Notation	Frequency	Reading	Correct	Result	Limit	Margin	Remark
		(MHz)	(dBuV)	(dB/m)	(dBuV/m)	(dBuV/m)	(dB)	
Horizontal		5129.5	41.62	13.41	55.03	74	-18.97	PK
		5148.05	31.32	13.4	44.72	54	-9.28	AVG
	@	5220	94.61	13.12	107.73	N/A	N/A	PK
	@	5220	87.22	13.12	100.34	N/A	N/A	AVG
	*	10440	31.12	17.81	48.93	68.2	-19.27	PK
Vertical		5100.8	41.82	13.44	55.26	74	-18.74	PK
		5144.2	31.54	13.4	44.94	54	-9.06	AVG
	@	5220	93.32	13.12	106.44	N/A	N/A	PK
	@	5220	87.28	13.12	100.4	N/A	N/A	AVG
	*	10440	31.06	17.81	48.87	68.2	-19.33	PK

Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan


Telephone :+886-2-7737-3000

Facsimile (FAX) :+886-3-583-7948

Doc No: 17-EM-F0878 / 6.0



Test report No. : 4790358903-US-R1-V0
Page : 114 of 154
Issued date : 2022/6/7
FCC ID : 2A4GY-LB-TABLET01

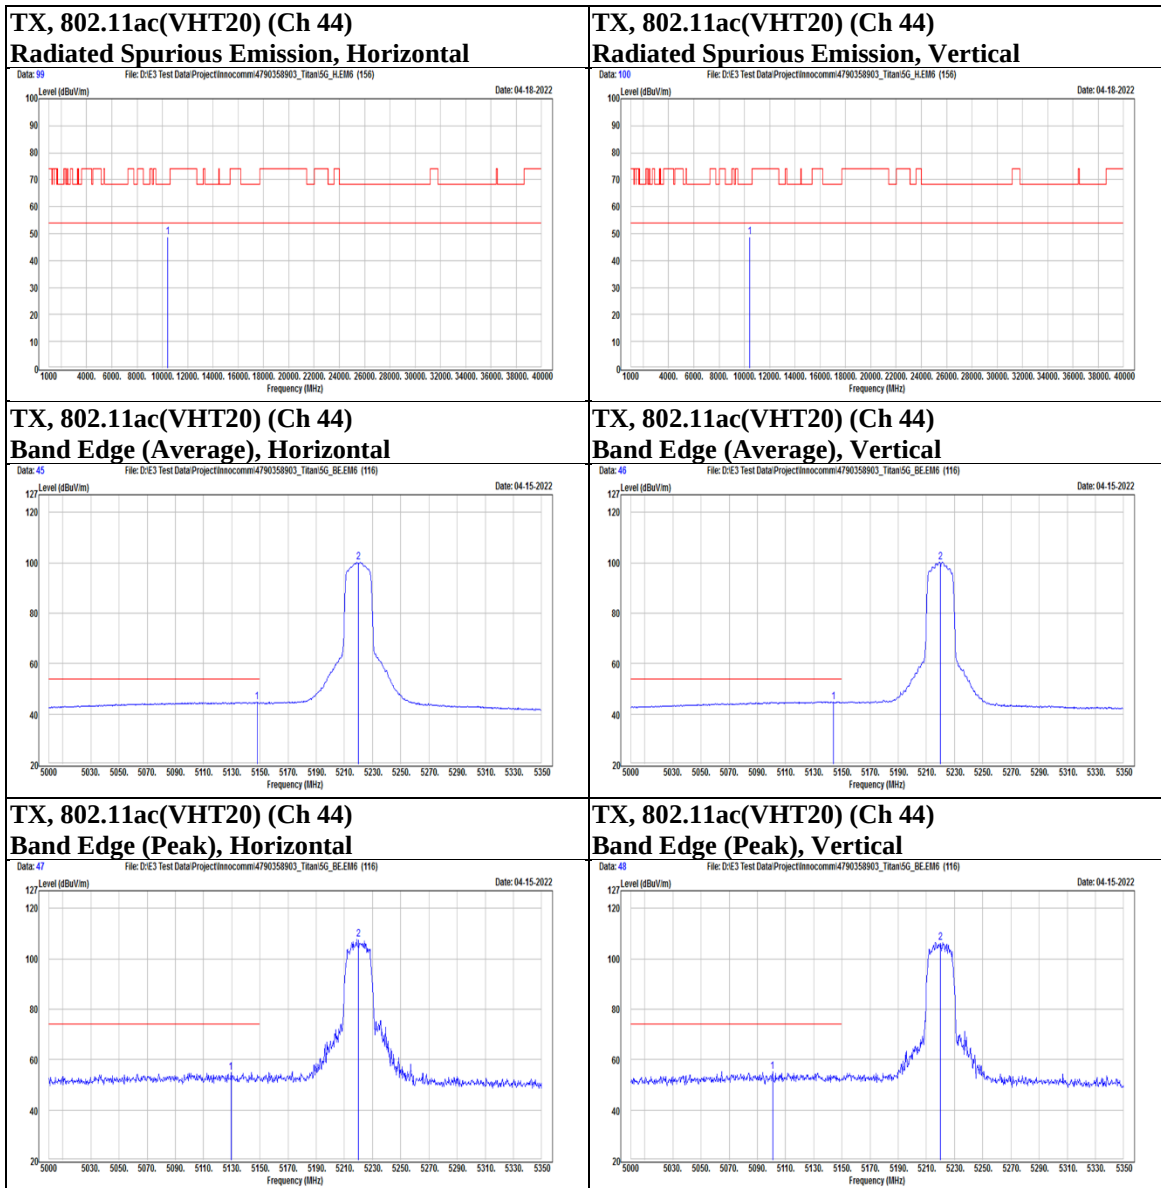

Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan

Telephone : +886-2-7737-3000

Facsimile (FAX) : +886-3-583-7948

Doc No: 17-EM-F0878 / 6.0



Test report No. : 4790358903-US-R1-V0
Page : 115 of 154
Issued date : 2022/6/7
FCC ID : 2A4GY-LB-TABLET01

Mode	802.11ac(VHT20)	Channel	48
------	-----------------	---------	----

Polarization	Notation	Frequency	Reading	Correct	Result	Limit	Margin	Remark
		(MHz)	(dBuV)	(dB/m)	(dBuV/m)	(dBuV/m)	(dB)	
Horizontal		5115.85	42.33	13.43	55.76	74	-18.24	PK
		5117.6	31.07	13.43	44.5	54	-9.5	AVG
	@	5240	94.85	12.97	107.82	N/A	N/A	PK
	@	5240	87.39	12.97	100.36	N/A	N/A	AVG
	*	10480	31.65	17.92	49.57	68.2	-18.63	PK
Vertical		5078.75	41.67	13.29	54.96	74	-19.04	PK
		5142.8	31.36	13.4	44.76	54	-9.24	AVG
	@	5240	94.58	12.97	107.55	N/A	N/A	PK
	@	5240	86.84	12.97	99.81	N/A	N/A	AVG
	*	10480	31	17.92	48.92	68.2	-19.28	PK

Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan


Telephone :+886-2-7737-3000

Facsimile (FAX) :+886-3-583-7948

Doc No: 17-EM-F0878 / 6.0



Test report No. : 4790358903-US-R1-V0
Page : 116 of 154
Issued date : 2022/6/7
FCC ID : 2A4GY-LB-TABLET01

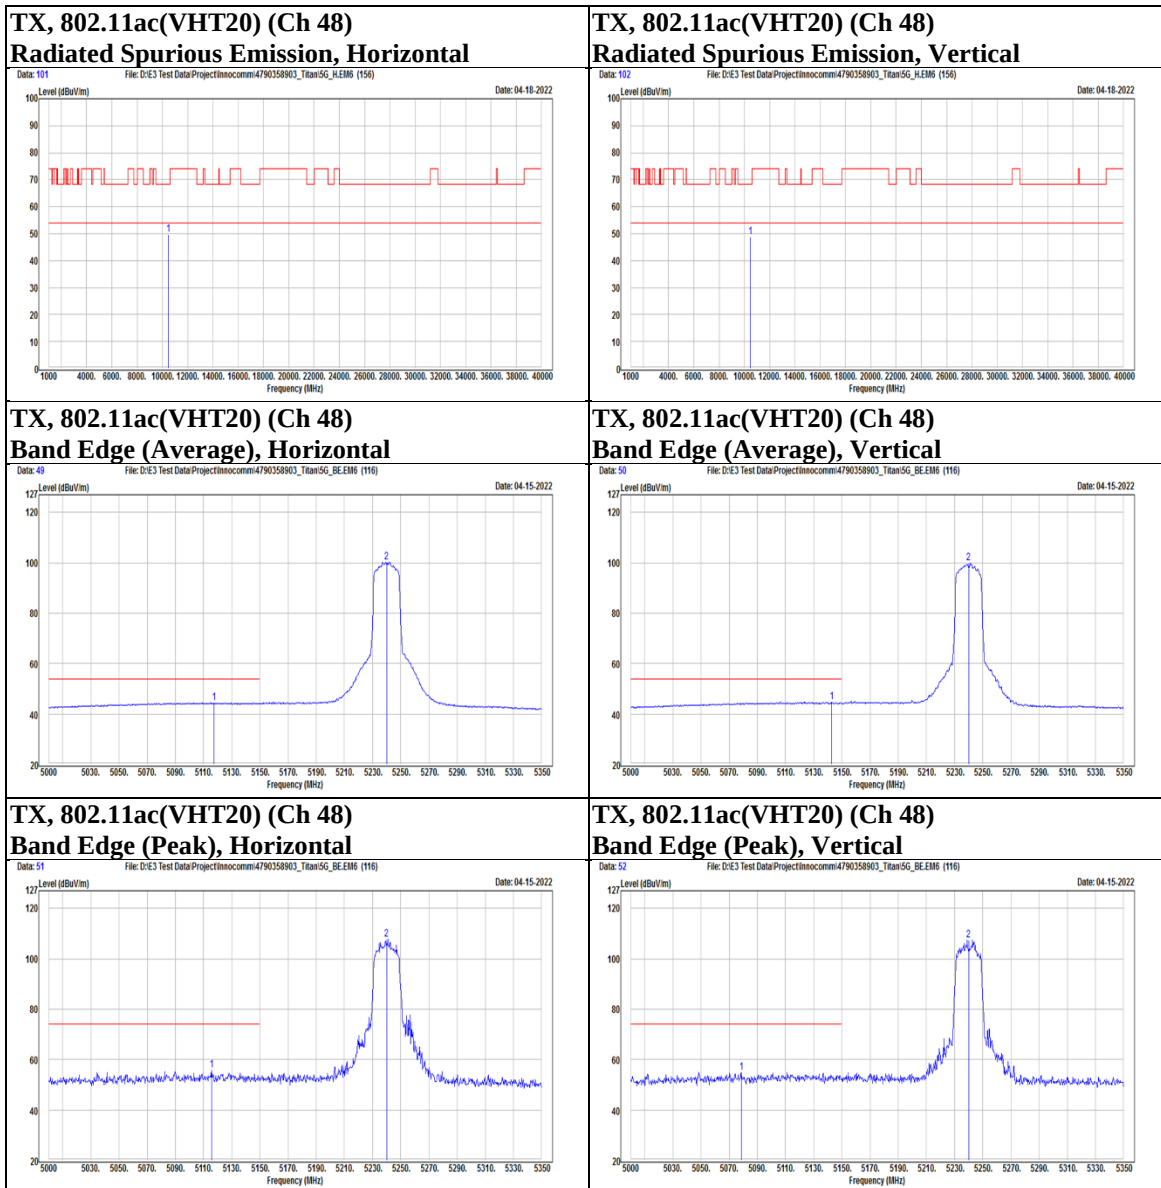

Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan

Telephone : +886-2-7737-3000

Facsimile (FAX) : +886-3-583-7948

Doc No: 17-EM-F0878 / 6.0



Test report No. : 4790358903-US-R1-V0
Page : 117 of 154
Issued date : 2022/6/7
FCC ID : 2A4GY-LB-TABLET01

Mode	802.11ac(VHT20)	Channel	52
------	-----------------	---------	----

Polarization	Notation	Frequency	Reading	Correct	Result	Limit	Margin	Remark
		(MHz)	(dBuV)	(dB/m)	(dBuV/m)	(dBuV/m)	(dB)	
Horizontal	@	5260	94.94	12.88	107.82	N/A	N/A	PK
	@	5260	86.94	12.88	99.82	N/A	N/A	AVG
		5352.6	29.31	13.03	42.34	54	-11.66	AVG
		5354.7	40.45	13.04	53.49	74	-20.51	PK
	*	10520	30.82	17.99	48.81	68.2	-19.39	PK
Vertical	@	5260	95.02	12.88	107.9	N/A	N/A	PK
	@	5260	87.02	12.88	99.9	N/A	N/A	AVG
		5352.9	29.86	13.03	42.89	54	-11.11	AVG
		5451.6	40.46	13.53	53.99	74	-20.01	PK
	*	10520	31.01	17.99	49	68.2	-19.2	PK

Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan


Telephone :+886-2-7737-3000

Facsimile (FAX) :+886-3-583-7948

Doc No: 17-EM-F0878 / 6.0



Test report No. : 4790358903-US-R1-V0
Page : 118 of 154
Issued date : 2022/6/7
FCC ID : 2A4GY-LB-TABLET01

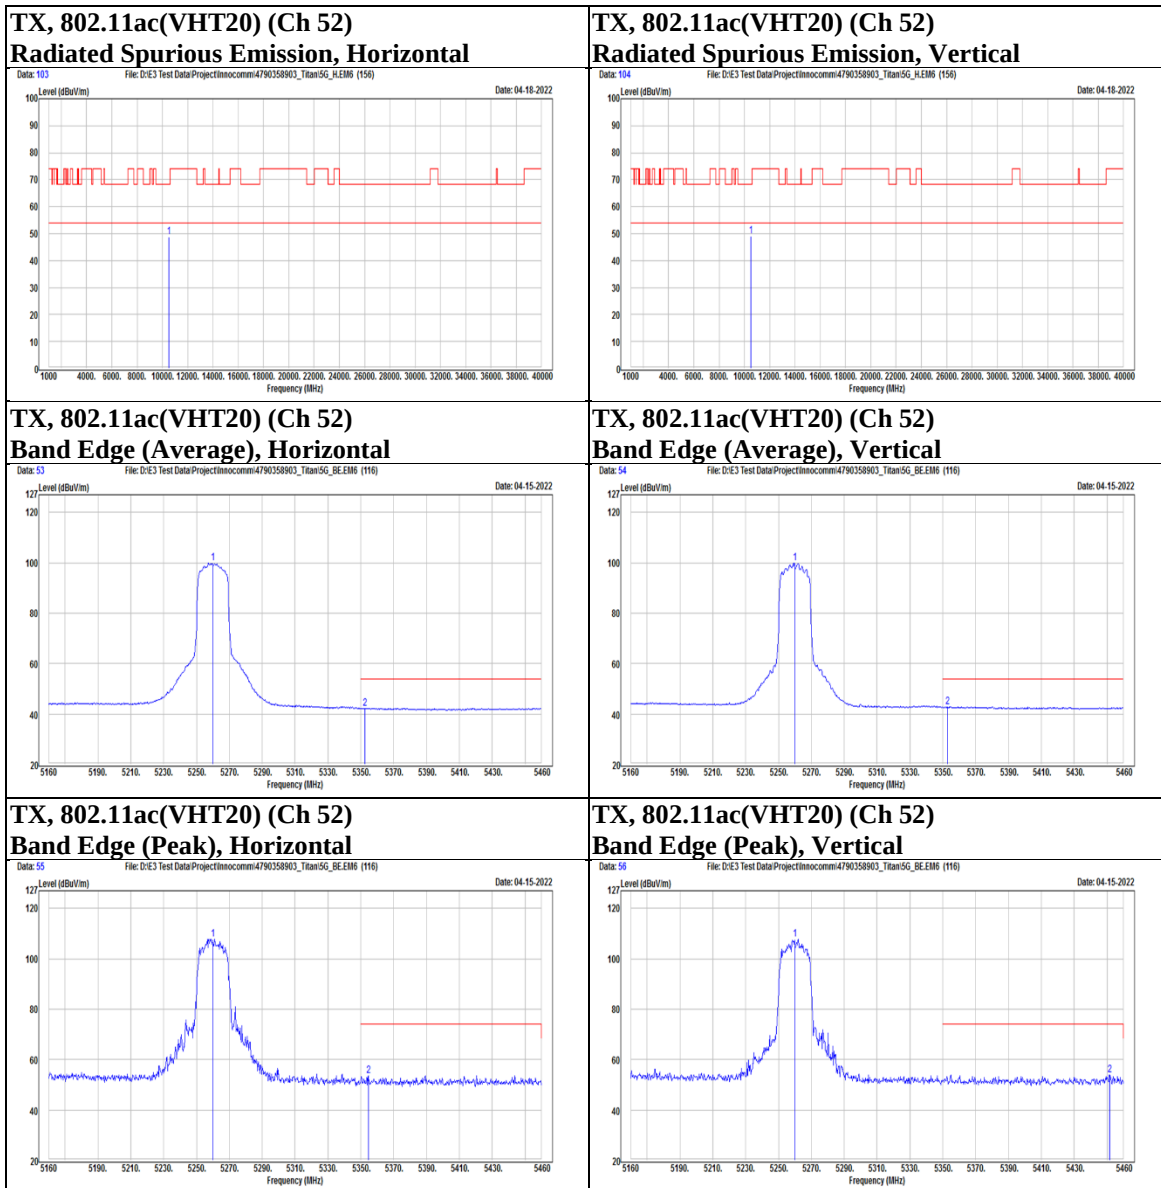

Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan

Telephone : +886-2-7737-3000

Facsimile (FAX) : +886-3-583-7948

Doc No: 17-EM-F0878 / 6.0



Test report No. : 4790358903-US-R1-V0
Page : 119 of 154
Issued date : 2022/6/7
FCC ID : 2A4GY-LB-TABLET01

Mode	802.11ac(VHT20)	Channel	60
------	-----------------	---------	----

Polarization	Notation	Frequency	Reading	Correct	Result	Limit	Margin	Remark
		(MHz)	(dBuV)	(dB/m)	(dBuV/m)	(dBuV/m)	(dB)	
Horizontal	@	5300	95.29	12.77	108.06	N/A	N/A	PK
	@	5300	86.43	12.77	99.2	N/A	N/A	AVG
		5359.2	29.9	13.06	42.96	54	-11.04	AVG
		5379.6	41.1	13.16	54.26	74	-19.74	PK
	*	10600	31.68	18.04	49.72	68.2	-18.48	PK
Vertical	@	5300	94.21	12.77	106.98	N/A	N/A	PK
	@	5300	87	12.77	99.77	N/A	N/A	AVG
		5366.1	42.46	13.09	55.55	74	-18.45	PK
		5374.2	30.39	13.14	43.53	54	-10.47	AVG
	*	10600	31.07	18.04	49.11	68.2	-19.09	PK

Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan


Telephone :+886-2-7737-3000

Facsimile (FAX) :+886-3-583-7948

Doc No: 17-EM-F0878 / 6.0



Test report No. : 4790358903-US-R1-V0
Page : 120 of 154
Issued date : 2022/6/7
FCC ID : 2A4GY-LB-TABLET01

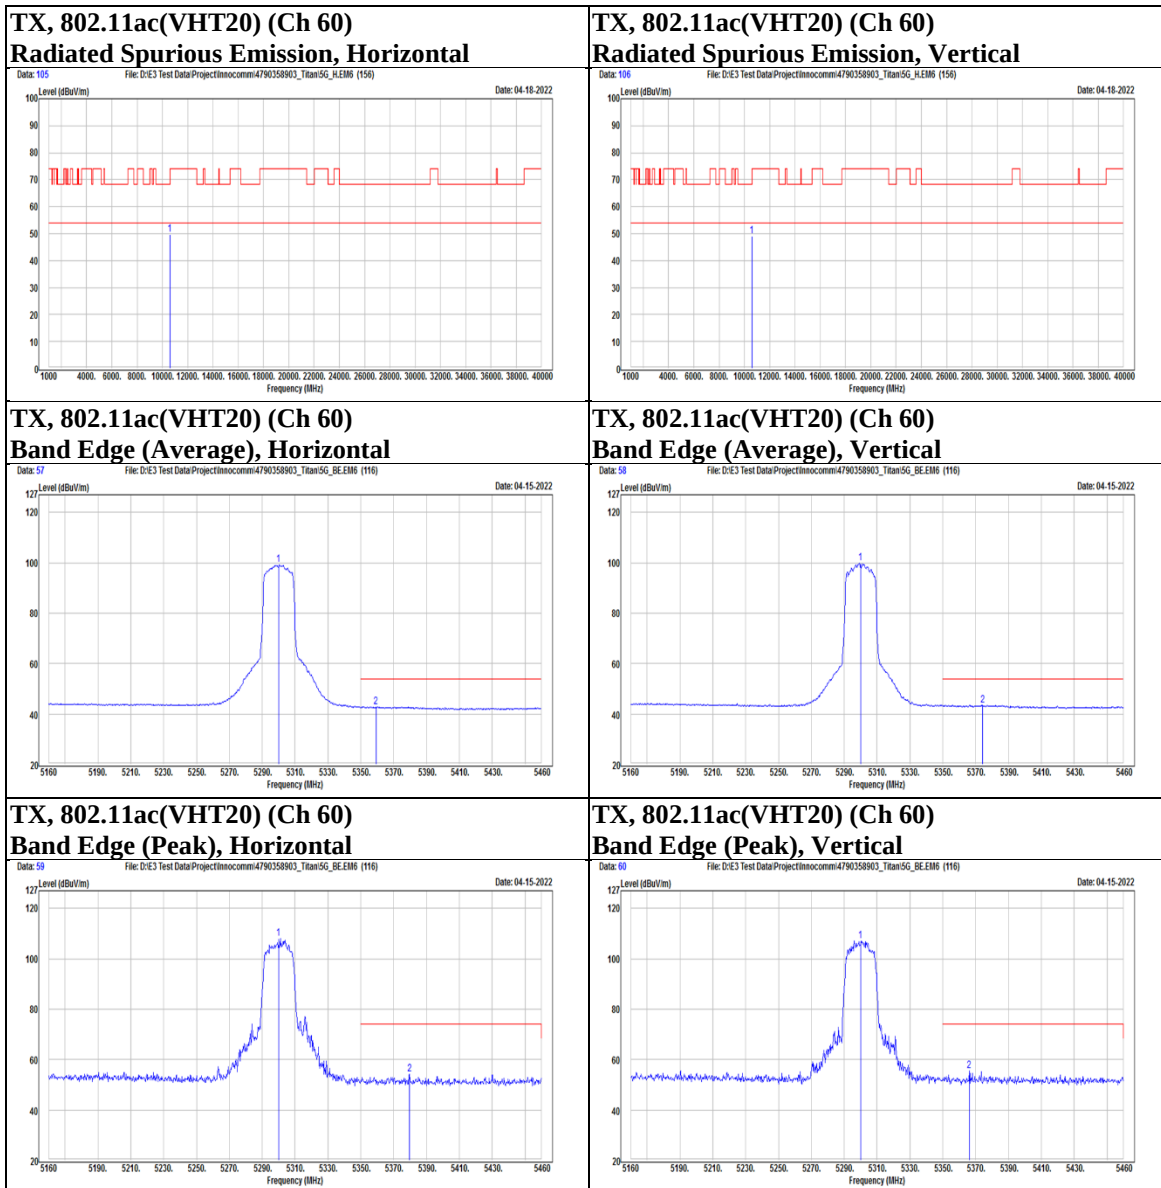

Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan

Telephone : +886-2-7737-3000

Facsimile (FAX) : +886-3-583-7948

Doc No: 17-EM-F0878 / 6.0



Test report No. : 4790358903-US-R1-V0
Page : 121 of 154
Issued date : 2022/6/7
FCC ID : 2A4GY-LB-TABLET01

Mode	802.11ac(VHT20)	Channel	64
------	-----------------	---------	----

Polarization	Notation	Frequency	Reading	Correct	Result	Limit	Margin	Remark
		(MHz)	(dBuV)	(dB/m)	(dBuV/m)	(dBuV/m)	(dB)	
Horizontal	@	5320	94.59	12.86	107.45	N/A	N/A	PK
	@	5320	86.39	12.86	99.25	N/A	N/A	AVG
		5350.8	31.03	13.01	44.04	54	-9.96	AVG
		5397	40.91	13.26	54.17	74	-19.83	PK
	*	10640	31.35	18.03	49.38	74	-24.62	PK
Vertical	@	5320	95.43	12.86	108.29	N/A	N/A	PK
	@	5320	87.01	12.86	99.87	N/A	N/A	AVG
		5351.7	31.3	13.02	44.32	54	-9.68	AVG
		5458.2	42.09	13.56	55.65	74	-18.35	PK
	*	10640	31.87	18.03	49.9	74	-24.1	PK

Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan


Telephone :+886-2-7737-3000

Facsimile (FAX) :+886-3-583-7948

Doc No: 17-EM-F0878 / 6.0



Test report No. : 4790358903-US-R1-V0
Page : 122 of 154
Issued date : 2022/6/7
FCC ID : 2A4GY-LB-TABLET01

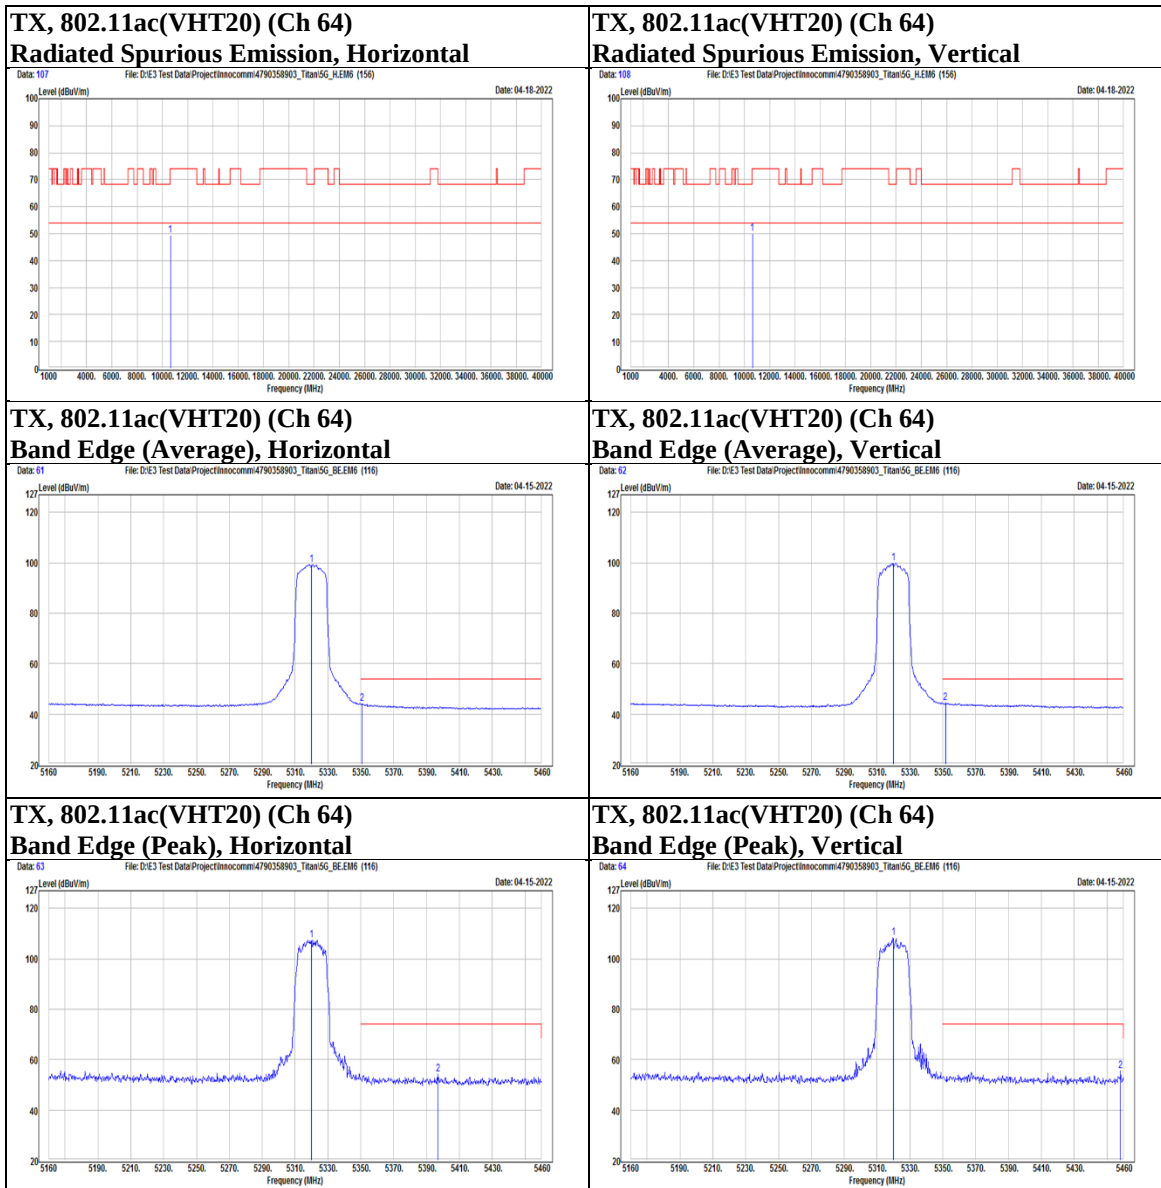

Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan

Telephone : +886-2-7737-3000

Facsimile (FAX) : +886-3-583-7948

Doc No: 17-EM-F0878 / 6.0




Test report No. : 4790358903-US-R1-V0
Page : 123 of 154
Issued date : 2022/6/7
FCC ID : 2A4GY-LB-TABLET01

Mode	802.11ac(VHT20)	Channel	100
------	-----------------	---------	-----

Polarization	Notation	Frequency (MHz)	Reading (dBuV)	Correct (dB/m)	Result (dBuV/m)	Limit (dBuV/m)	Margin (dB)	Remark
Horizontal		5459.5	41.17	13.57	54.74	74	-19.26	PK
		5459.5	30.3	13.57	43.87	54	-10.13	AVG
		5460.2	41.21	13.57	54.78	68.2	-13.42	PK
	@	5500	94.58	13.77	108.35	N/A	N/A	PK
	@	5500	83.9	13.77	97.67	N/A	N/A	AVG
	*	11000	30.58	18.41	48.99	74	-25.01	PK
Vertical		5430.8	41.32	13.42	54.74	74	-19.26	PK
		5430.8	30.1	13.42	43.52	54	-10.48	AVG
		5460.55	41	13.57	54.57	68.2	-13.63	PK
	@	5500	94.79	13.77	108.56	N/A	N/A	PK
	@	5500	84.7	13.77	98.47	N/A	N/A	AVG
	*	11000	31.15	18.41	49.56	74	-24.44	PK


TX, 802.11ac(VHT20) (Ch 100)

Radiated Spurious Emission, Horizontal

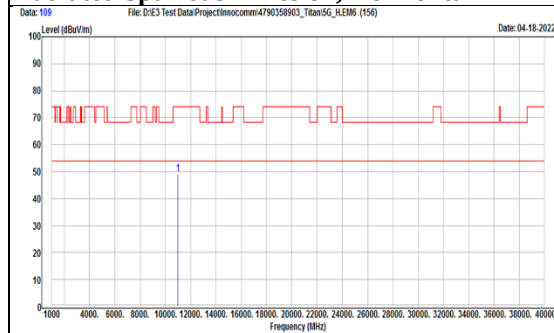


TX, 802.11ac(VHT20) (Ch 100)

Radiated Spurious Emission, Vertical

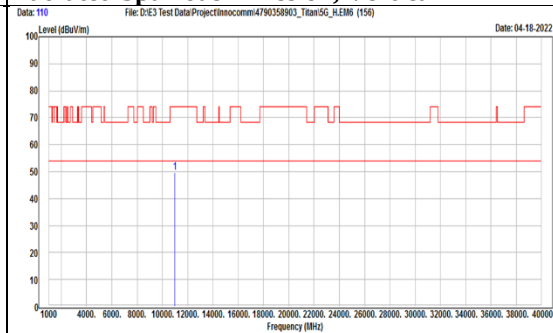


TX, 802.11ac(VHT20) (Ch 100)

Band Edge (Peak), Horizontal

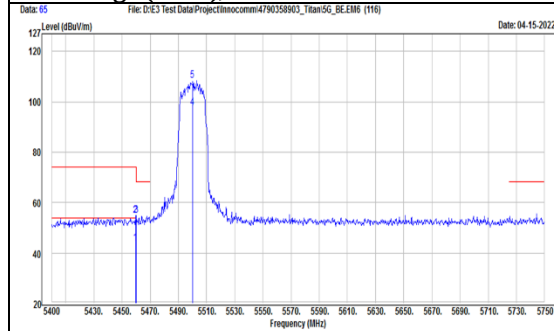

TX, 802.11ac(VHT20) (Ch 100)

Band Edge (Peak), Vertical

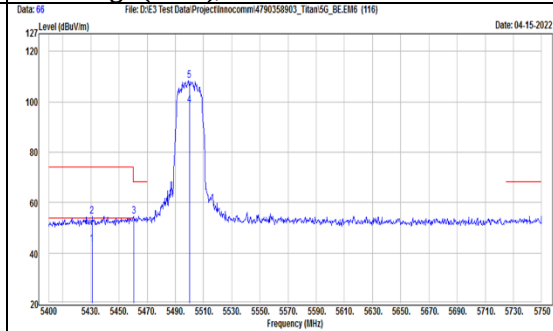

Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan

Telephone : +886-2-7737-3000

Facsimile (FAX) : +886-3-583-7948

Doc No: 17-EM-F0878 / 6.0




Test report No. : 4790358903-US-R1-V0
Page : 124 of 154
Issued date : 2022/6/7
FCC ID : 2A4GY-LB-TABLET01

Mode	802.11ac(VHT20)	Channel	116
------	-----------------	---------	-----

Polarization	Notation	Frequency (MHz)	Reading (dBuV)	Correct (dB/m)	Result (dBuV/m)	Limit (dBuV/m)	Margin (dB)	Remark
Horizontal		5423.45	40.79	13.38	54.17	74	-19.83	PK
		5423.45	29.71	13.38	43.09	54	-10.91	AVG
		5465.8	40.34	13.6	53.94	68.2	-14.26	PK
	@	5580	95.37	13.76	109.13	N/A	N/A	PK
	@	5580	85.29	13.76	99.05	N/A	N/A	AVG
		5731.8	40.48	14.02	54.5	68.2	-13.7	PK
	*	11160	31	18.47	49.47	74	-24.53	PK
Vertical		5456.35	40.75	13.55	54.3	74	-19.7	PK
		5456.35	29.6	13.55	43.15	54	-10.85	AVG
		5466.5	40.51	13.61	54.12	68.2	-14.08	PK
	@	5580	95.43	13.76	109.19	N/A	N/A	PK
	@	5580	84.79	13.76	98.55	N/A	N/A	AVG
		5738.45	40.22	14.09	54.31	68.2	-13.89	PK
	*	11160	30.78	18.47	49.25	74	-24.75	PK


TX, 802.11ac(VHT20) (Ch 116)

Radiated Spurious Emission, Horizontal

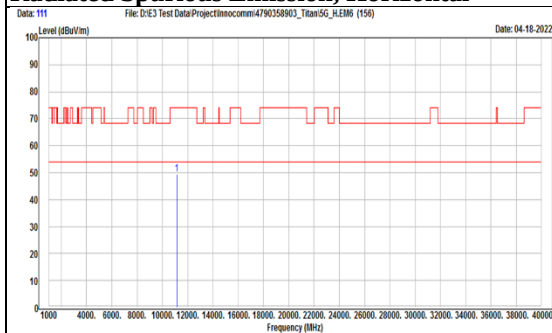


TX, 802.11ac(VHT20) (Ch 116)

Radiated Spurious Emission, Vertical

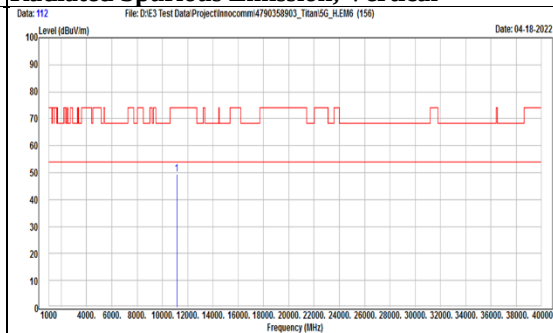


TX, 802.11ac(VHT20) (Ch 116)

Band Edge (Peak), Horizontal

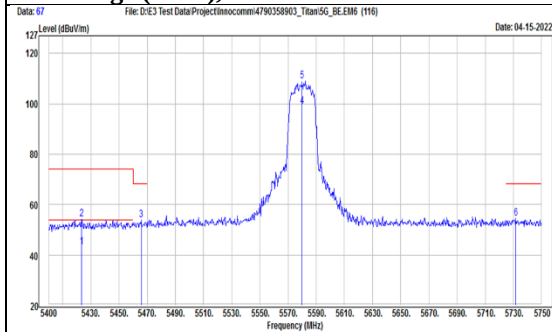

TX, 802.11ac(VHT20) (Ch 116)

Band Edge (Peak), Vertical

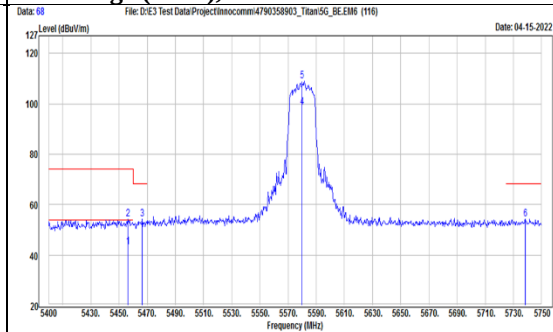

Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan

Telephone : +886-2-7737-3000

Facsimile (FAX) : +886-3-583-7948


Doc No: 17-EM-F0878 / 6.0



Test report No. : 4790358903-US-R1-V0
Page : 125 of 154
Issued date : 2022/6/7
FCC ID : 2A4GY-LB-TABLET01

Mode	802.11ac(VHT20)	Channel	140
------	-----------------	---------	-----

Polarization	Notation	Frequency (MHz)	Reading (dBuV)	Correct (dB/m)	Result (dBuV/m)	Limit (dBuV/m)	Margin (dB)	Remark
Horizontal	@	5700	94.61	13.73	108.34	N/A	N/A	PK
	@	5700	84.3	13.73	98.03	N/A	N/A	AVG
		5725.15	51.08	13.96	65.04	68.2	-3.16	PK
	*	11400	31.7	18.85	50.55	74	-23.45	PK
Vertical	@	5700	96.35	13.73	110.08	N/A	N/A	PK
	@	5700	86.5	13.73	100.23	N/A	N/A	AVG
		5726.55	50.08	13.97	64.05	68.2	-4.15	PK
	*	11400	30.74	18.85	49.59	74	-24.41	PK

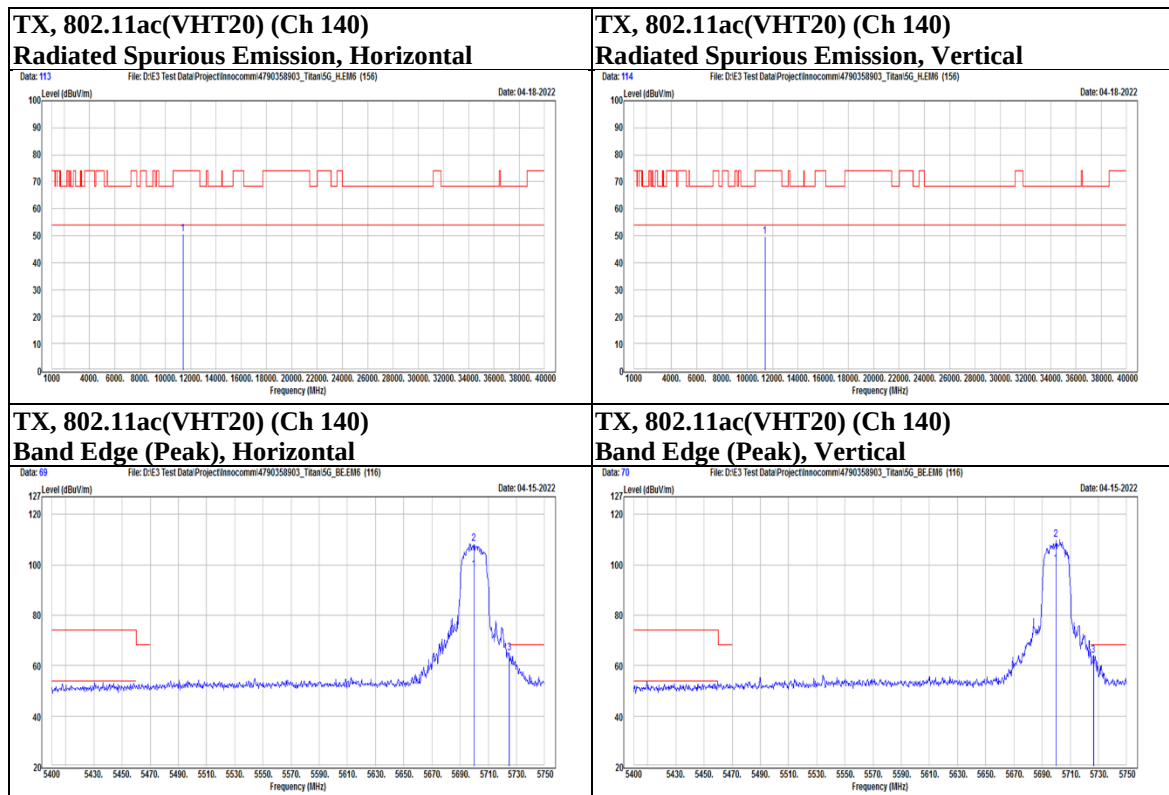

Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan

Telephone : +886-2-7737-3000

Facsimile (FAX) : +886-3-583-7948

Doc No: 17-EM-F0878 / 6.0




Test report No. : 4790358903-US-R1-V0
Page : 126 of 154
Issued date : 2022/6/7
FCC ID : 2A4GY-LB-TABLET01

Mode	802.11ac(VHT20)	Channel	149
------	-----------------	---------	-----

Polarization	Notation	Frequency (MHz)	Reading (dBuV)	Correct (dB/m)	Result (dBuV/m)	Limit (dBuV/m)	Margin (dB)	Remark
Horizontal		5578	40.45	13.76	54.21	68.2	-13.99	PK
		5658.5	41.79	13.68	55.47	74.51	-19.04	PK
	@	5745	95.94	14.15	110.09	N/A	N/A	PK
	*	11490	31.92	19.33	51.25	74	-22.75	PK
Vertical		5558	41.79	13.81	55.6	68.2	-12.6	PK
		5694.5	41.86	13.72	55.58	101.15	-45.57	PK
	@	5745	94.67	14.15	108.82	N/A	N/A	PK
	*	11490	30.89	19.33	50.22	74	-23.78	PK


TX, 802.11ac(VHT20) (Ch 149)

Radiated Spurious Emission, Horizontal

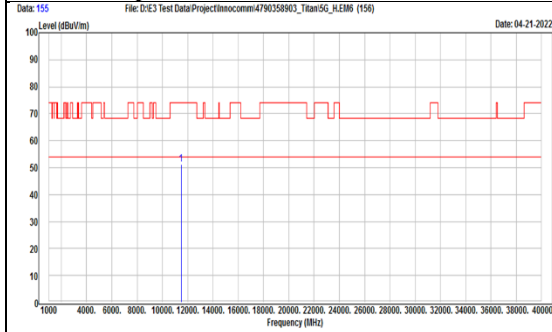


TX, 802.11ac(VHT20) (Ch 149)

Radiated Spurious Emission, Vertical

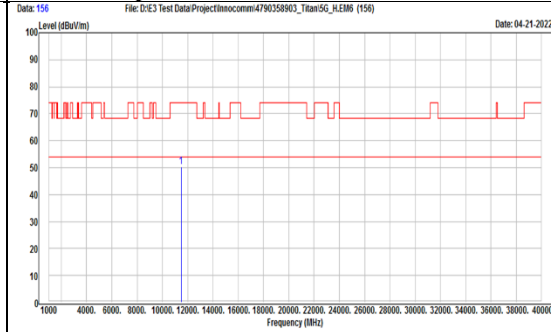


TX, 802.11ac(VHT20) (Ch 149)

Band Edge (Peak), Horizontal

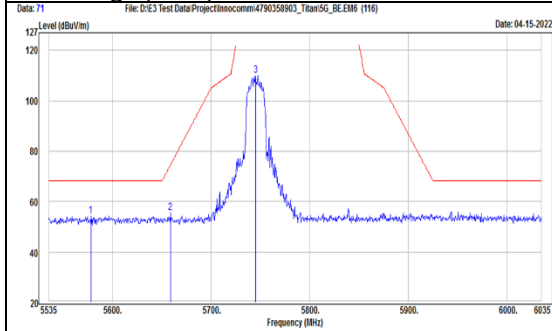

TX, 802.11ac(VHT20) (Ch 149)

Band Edge (Peak), Vertical

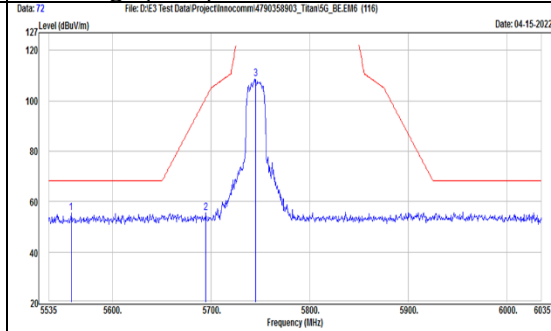

Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan

Telephone : +886-2-7737-3000

Facsimile (FAX) : +886-3-583-7948

Doc No: 17-EM-F0878 / 6.0




Test report No. : 4790358903-US-R1-V0
Page : 127 of 154
Issued date : 2022/6/7
FCC ID : 2A4GY-LB-TABLET01


Mode	802.11ac(VHT20)	Channel	157
------	-----------------	---------	-----

Polarization	Notation	Frequency (MHz)	Reading (dBuV)	Correct (dB/m)	Result (dBuV/m)	Limit (dBuV/m)	Margin (dB)	Remark
Horizontal	@	5625	40.55	13.68	54.23	68.2	-13.97	PK
		5653.5	41.43	13.67	55.1	70.8	-15.7	PK
		5785	94.49	14.45	108.94	N/A	N/A	PK
	*	5896	40.97	14.95	55.92	89.62	-33.7	PK
		5970	41.98	14.96	56.94	68.2	-11.26	PK
		11570	31.17	19.07	50.24	74	-23.76	PK
Vertical	@	5563.5	40.72	13.8	54.52	68.2	-13.68	PK
		5697	44	13.72	57.72	102.99	-45.27	PK
		5785	95.59	14.45	110.04	N/A	N/A	PK
	*	5888	41.21	14.9	56.11	95.55	-39.44	PK
		5965.5	40.89	14.95	55.84	68.2	-12.36	PK
		11570	30.13	19.07	49.2	74	-24.8	PK


TX, 802.11ac(VHT20) (Ch 157)
Radiated Spurious Emission, Horizontal

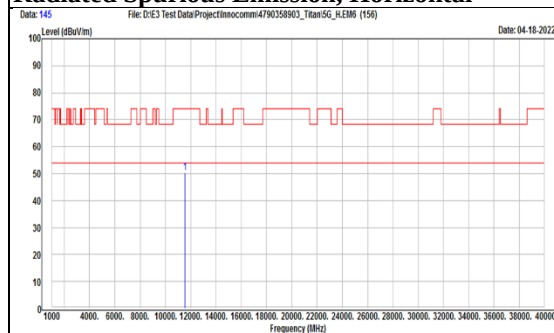


TX, 802.11ac(VHT20) (Ch 157)
Radiated Spurious Emission, Vertical

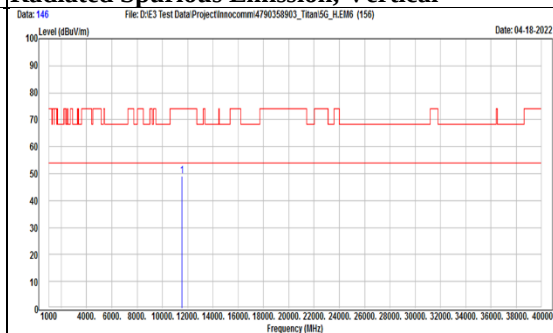

TX, 802.11ac(VHT20) (Ch 157)
Band Edge (Peak), Horizontal

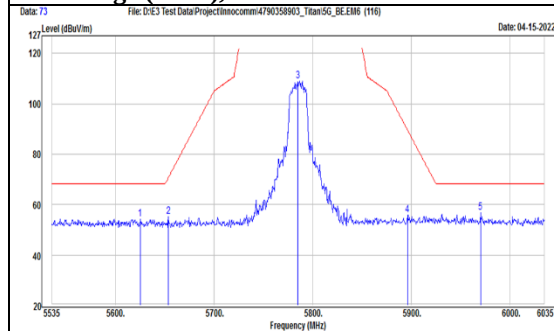

TX, 802.11ac(VHT20) (Ch 157)
Band Edge (Peak), Vertical

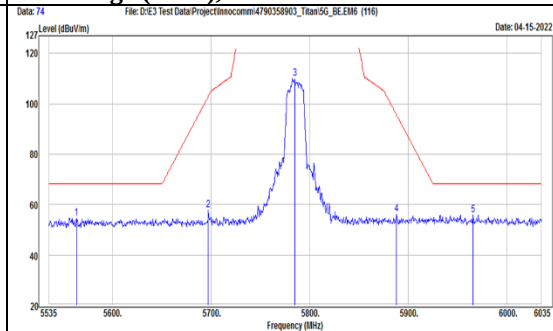

Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan

Telephone : +886-2-7737-3000

Facsimile (FAX) : +886-3-583-7948


Doc No: 17-EM-F0878 / 6.0



Test report No. : 4790358903-US-R1-V0
Page : 128 of 154
Issued date : 2022/6/7
FCC ID : 2A4GY-LB-TABLET01

Mode	802.11ac(VHT20)	Channel	165
------	-----------------	---------	-----

Polarization	Notation	Frequency	Reading	Correct	Result	Limit	Margin	Remark
		(MHz)	(dBuV)	(dB/m)	(dBuV/m)	(dBuV/m)	(dB)	
Horizontal	@	5825	94.57	14.58	109.15	N/A	N/A	PK
		5896.5	41.74	14.95	56.69	89.25	-32.56	PK
		5952	40.57	14.95	55.52	68.2	-12.68	PK
	*	11650	33.05	18.83	51.88	74	-22.12	PK
Vertical	@	5825	94.13	14.58	108.71	N/A	N/A	PK
		5901	40.43	14.98	55.41	85.92	-30.51	PK
		5931.5	41.11	14.96	56.07	68.2	-12.13	PK
	*	11650	30.76	18.83	49.59	74	-24.41	PK

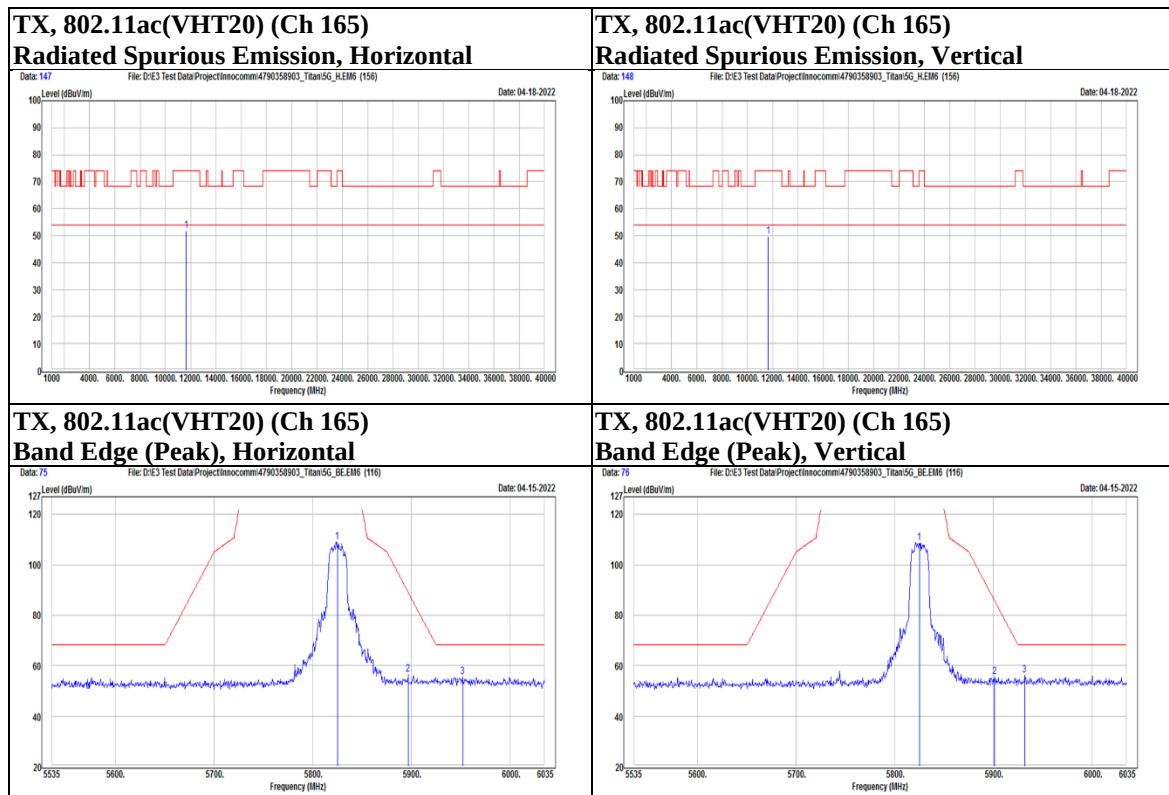

Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan

Telephone : +886-2-7737-3000

Facsimile (FAX) : +886-3-583-7948

Doc No: 17-EM-F0878 / 6.0



Test report No. : 4790358903-US-R1-V0
Page : 129 of 154
Issued date : 2022/6/7
FCC ID : 2A4GY-LB-TABLET01

Mode	802.11ac(VHT40)	Channel	38
------	-----------------	---------	----

Polarization	Notation	Frequency	Reading	Correct	Result	Limit	Margin	Remark
		(MHz)	(dBuV)	(dB/m)	(dBuV/m)	(dBuV/m)	(dB)	
Horizontal		5145.6	45.22	13.4	58.62	74	-15.38	PK
		5149.45	35.62	13.4	49.02	54	-4.98	AVG
	@	5190	90.8	13.29	104.09	N/A	N/A	PK
	@	5190	84.19	13.29	97.48	N/A	N/A	AVG
	*	10380	32.01	17.61	49.62	68.2	-18.58	PK
Vertical		5149.8	45.08	13.4	58.48	74	-15.52	PK
		5149.8	36.65	13.4	50.05	54	-3.95	AVG
	@	5190	91.83	13.29	105.12	N/A	N/A	PK
	@	5190	84.45	13.29	97.74	N/A	N/A	AVG
	*	10380	30.88	17.61	48.49	68.2	-19.71	PK

Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan


Telephone :+886-2-7737-3000

Facsimile (FAX) :+886-3-583-7948

Doc No: 17-EM-F0878 / 6.0



Test report No. : 4790358903-US-R1-V0
Page : 130 of 154
Issued date : 2022/6/7
FCC ID : 2A4GY-LB-TABLET01

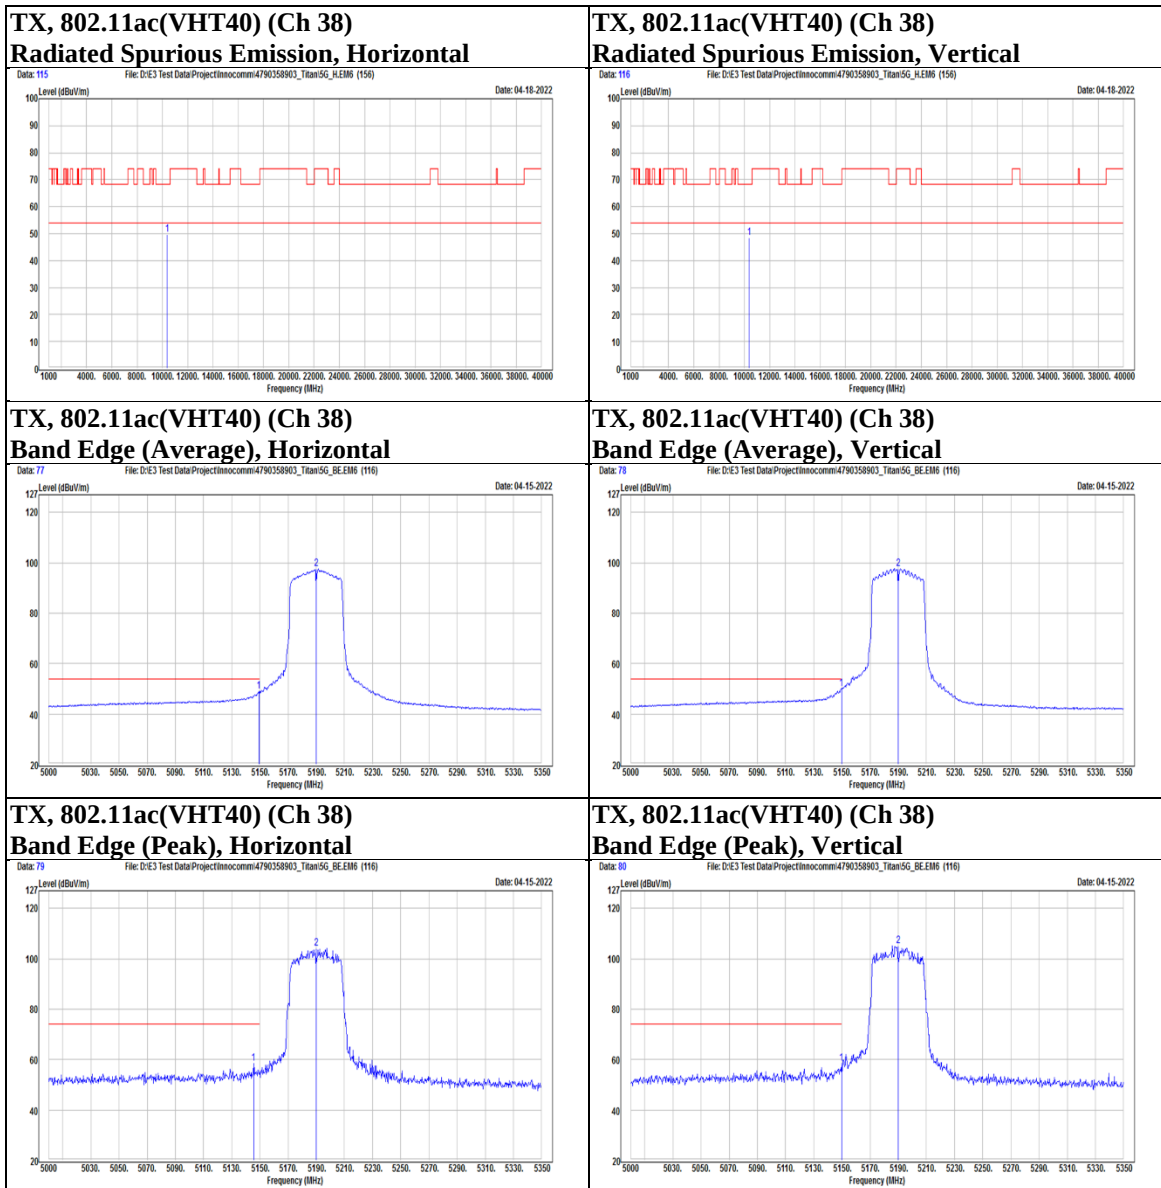

Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan

Telephone : +886-2-7737-3000

Facsimile (FAX) : +886-3-583-7948

Doc No: 17-EM-F0878 / 6.0



Test report No. : 4790358903-US-R1-V0
Page : 131 of 154
Issued date : 2022/6/7
FCC ID : 2A4GY-LB-TABLET01

Mode	802.11ac(VHT40)	Channel	46
------	-----------------	---------	----

Polarization	Notation	Frequency	Reading	Correct	Result	Limit	Margin	Remark
		(MHz)	(dBuV)	(dB/m)	(dBuV/m)	(dBuV/m)	(dB)	
Horizontal		5124.95	31.62	13.43	45.05	54	-8.95	AVG
		5137.9	43.09	13.4	56.49	74	-17.51	PK
	@	5230	91.53	13.05	104.58	N/A	N/A	PK
	@	5230	84.56	13.05	97.61	N/A	N/A	AVG
	*	10460	31.68	17.87	49.55	68.2	-18.65	PK
Vertical		5099.4	42.06	13.44	55.5	74	-18.5	PK
		5142.1	31.66	13.41	45.07	54	-8.93	AVG
	@	5230	91.49	13.05	104.54	N/A	N/A	PK
	@	5230	83.81	13.05	96.86	N/A	N/A	AVG
	*	10460	31.57	17.87	49.44	68.2	-18.76	PK

Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan


Telephone :+886-2-7737-3000

Facsimile (FAX) :+886-3-583-7948

Doc No: 17-EM-F0878 / 6.0



Test report No. : 4790358903-US-R1-V0
Page : 132 of 154
Issued date : 2022/6/7
FCC ID : 2A4GY-LB-TABLET01

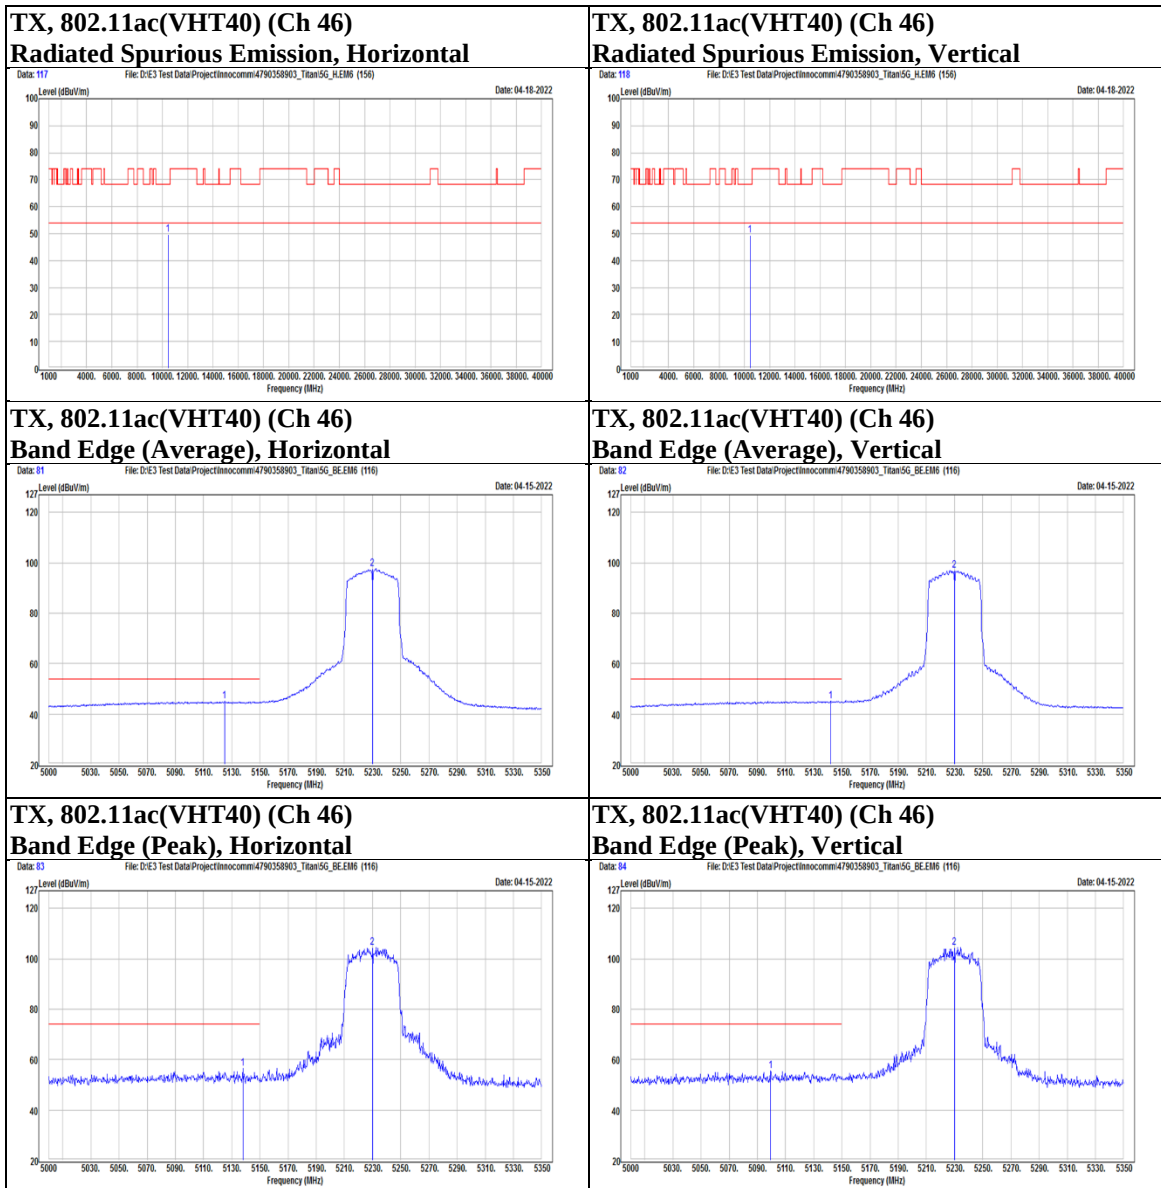

Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan

Telephone : +886-2-7737-3000

Facsimile (FAX) : +886-3-583-7948

Doc No: 17-EM-F0878 / 6.0



Test report No. : 4790358903-US-R1-V0
Page : 133 of 154
Issued date : 2022/6/7
FCC ID : 2A4GY-LB-TABLET01

Mode	802.11ac(VHT40)	Channel	54
------	-----------------	---------	----

Polarization	Notation	Frequency	Reading	Correct	Result	Limit	Margin	Remark
		(MHz)	(dBuV)	(dB/m)	(dBuV/m)	(dBuV/m)	(dB)	
Horizontal	@	5270	93.29	12.85	106.14	N/A	N/A	PK
	@	5270	84.33	12.85	97.18	N/A	N/A	AVG
		5351.4	30.6	13.02	43.62	54	-10.38	AVG
		5365.5	40.59	13.09	53.68	74	-20.32	PK
	*	10540	32.13	18.01	50.14	68.2	-18.06	PK
Vertical	@	5270	91.85	12.85	104.7	N/A	N/A	PK
	@	5270	83.66	12.85	96.51	N/A	N/A	AVG
		5352.6	30.72	13.03	43.75	54	-10.25	AVG
		5379.3	42.32	13.16	55.48	74	-18.52	PK
	*	10540	31.96	18.01	49.97	68.2	-18.23	PK

Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan

Telephone :+886-2-7737-3000

Facsimile (FAX) :+886-3-583-7948

Doc No: 17-EM-F0878 / 6.0