



TEST REPORT

Report No.: MTi260410018-0203E4

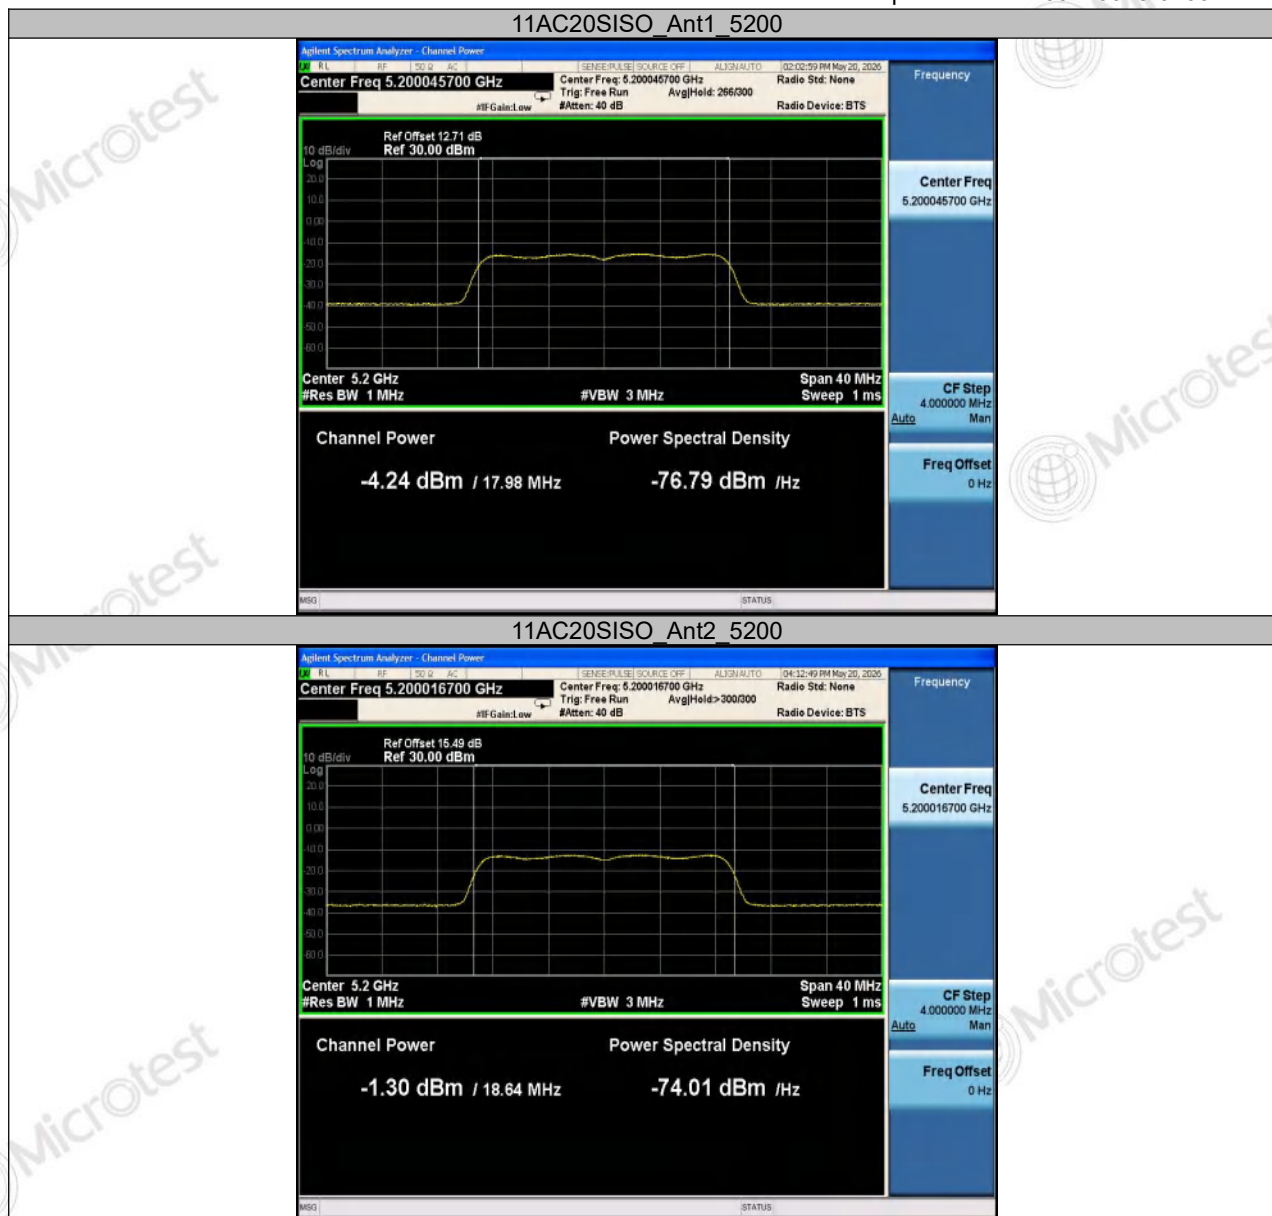


TEST REPORT

Report No.: MTi260410018-0203E4

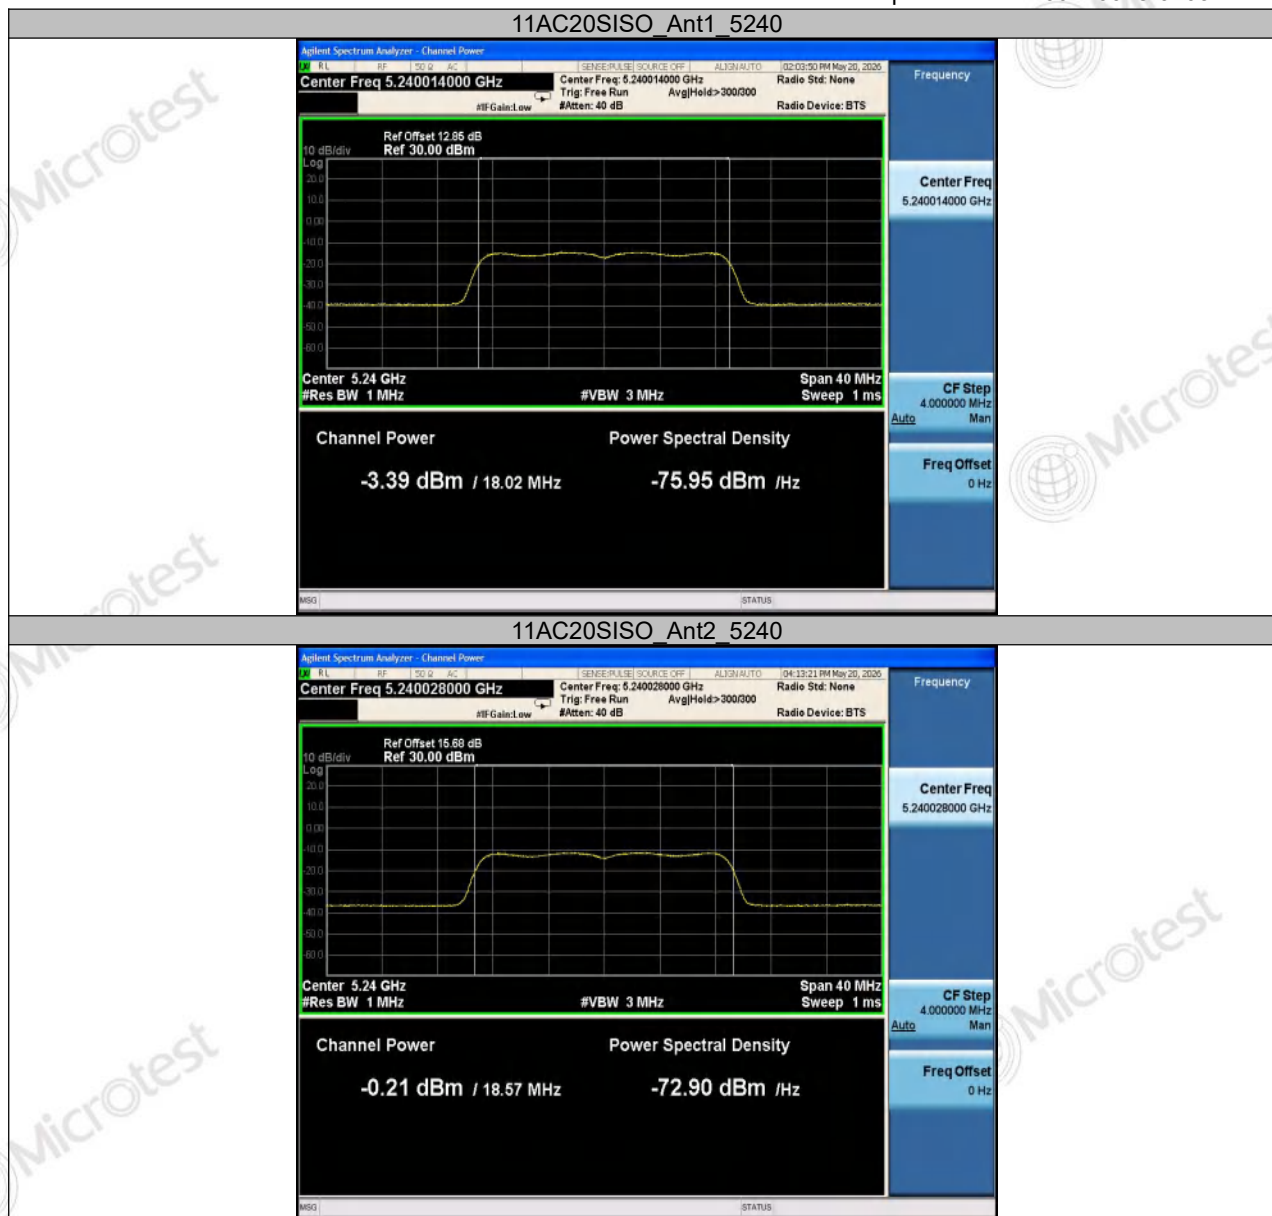


TEST REPORT

Report No.: MTi260410018-0203E4

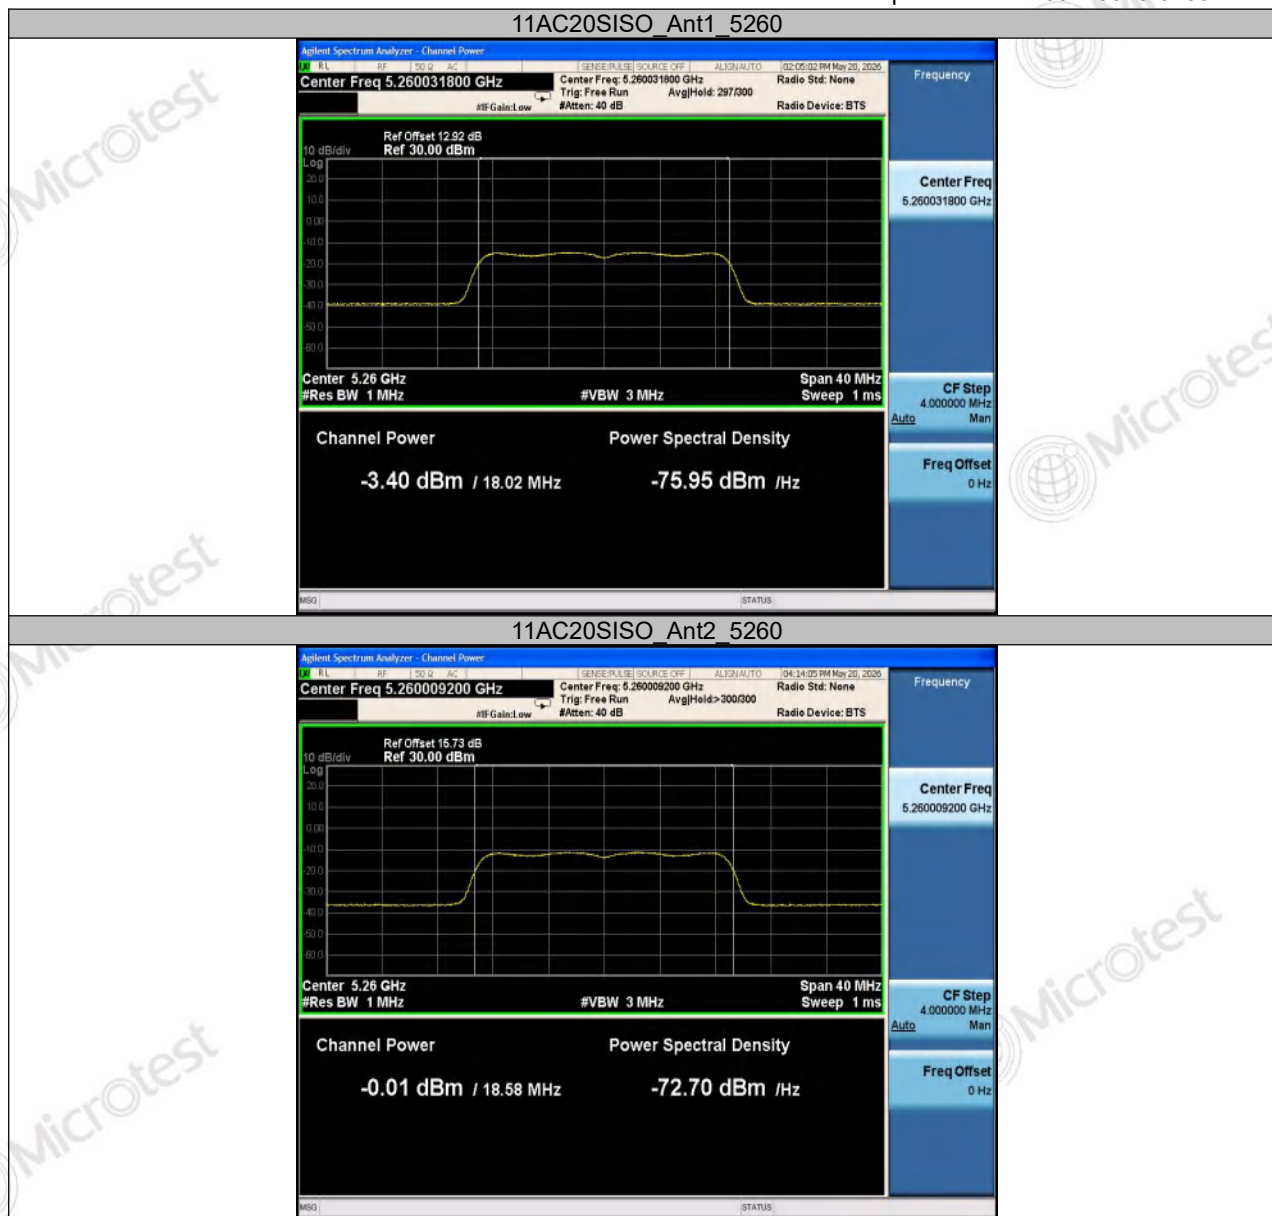


TEST REPORT

Report No.: MTi260410018-0203E4

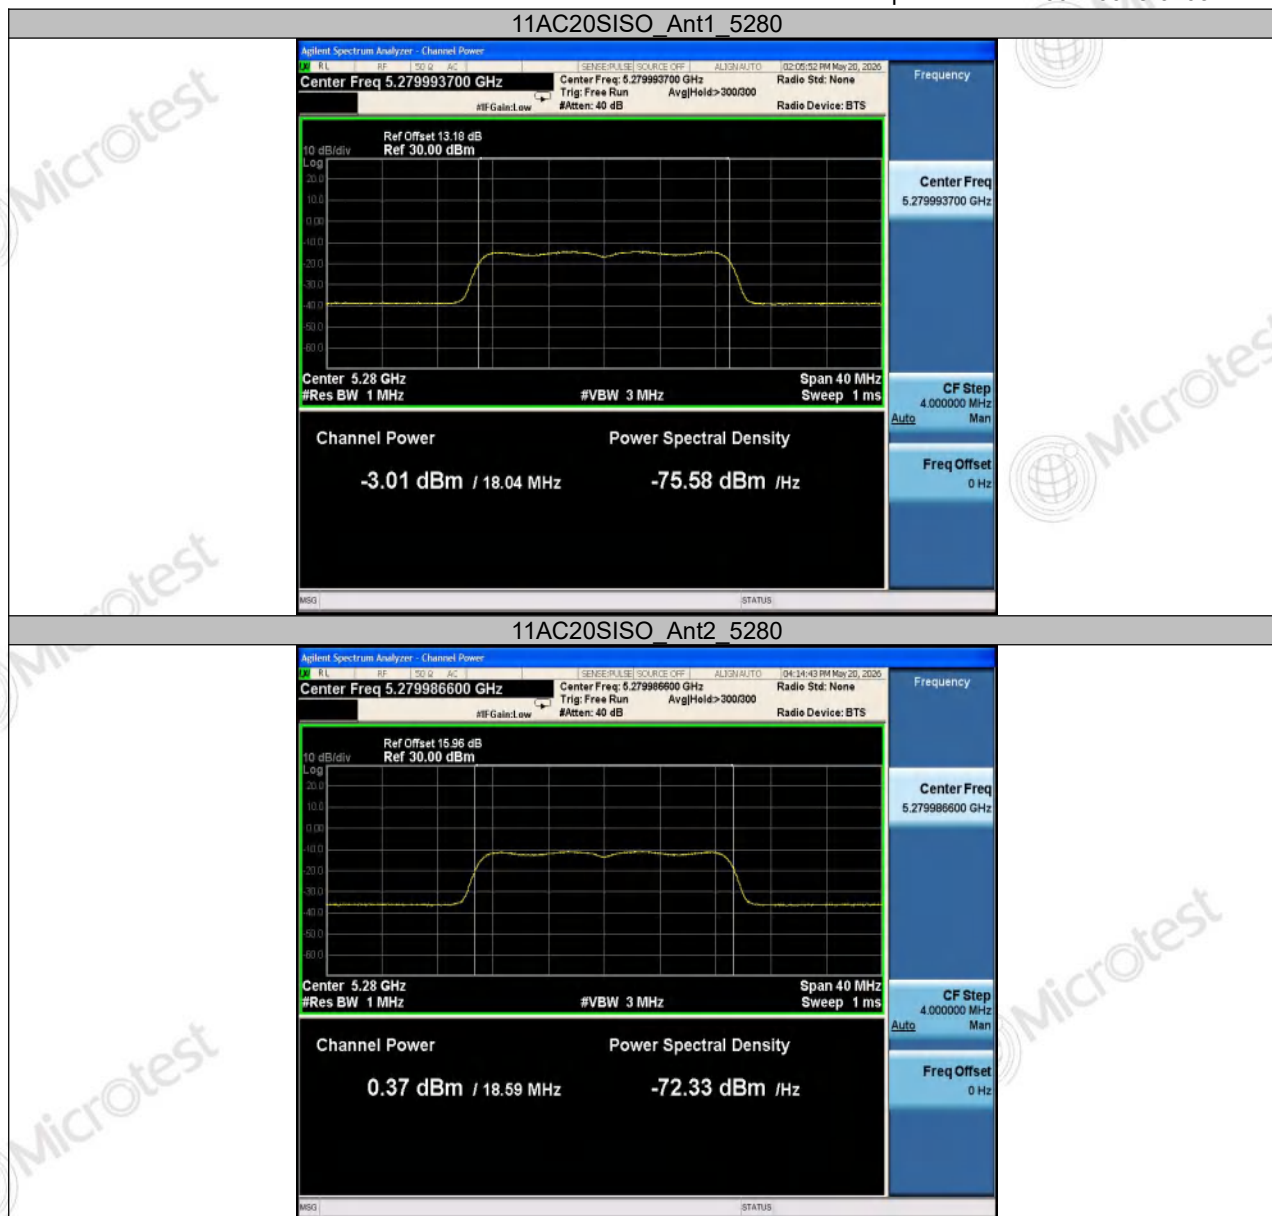


TEST REPORT

Report No.: MTi260410018-0203E4

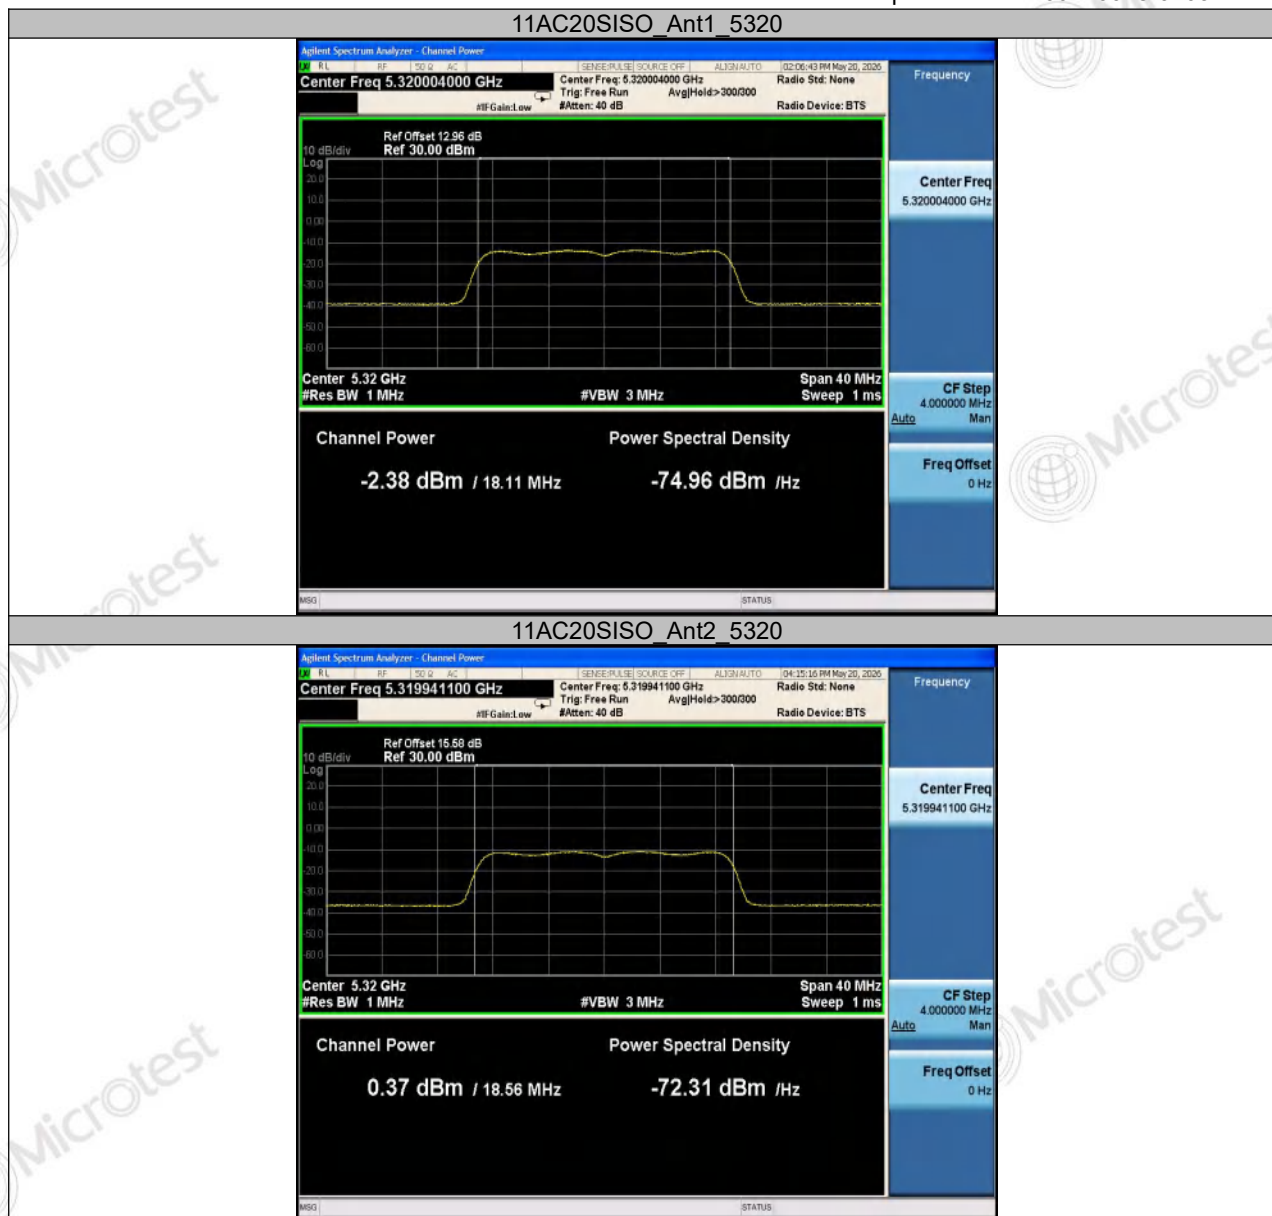


TEST REPORT

Report No.: MTi260410018-0203E4

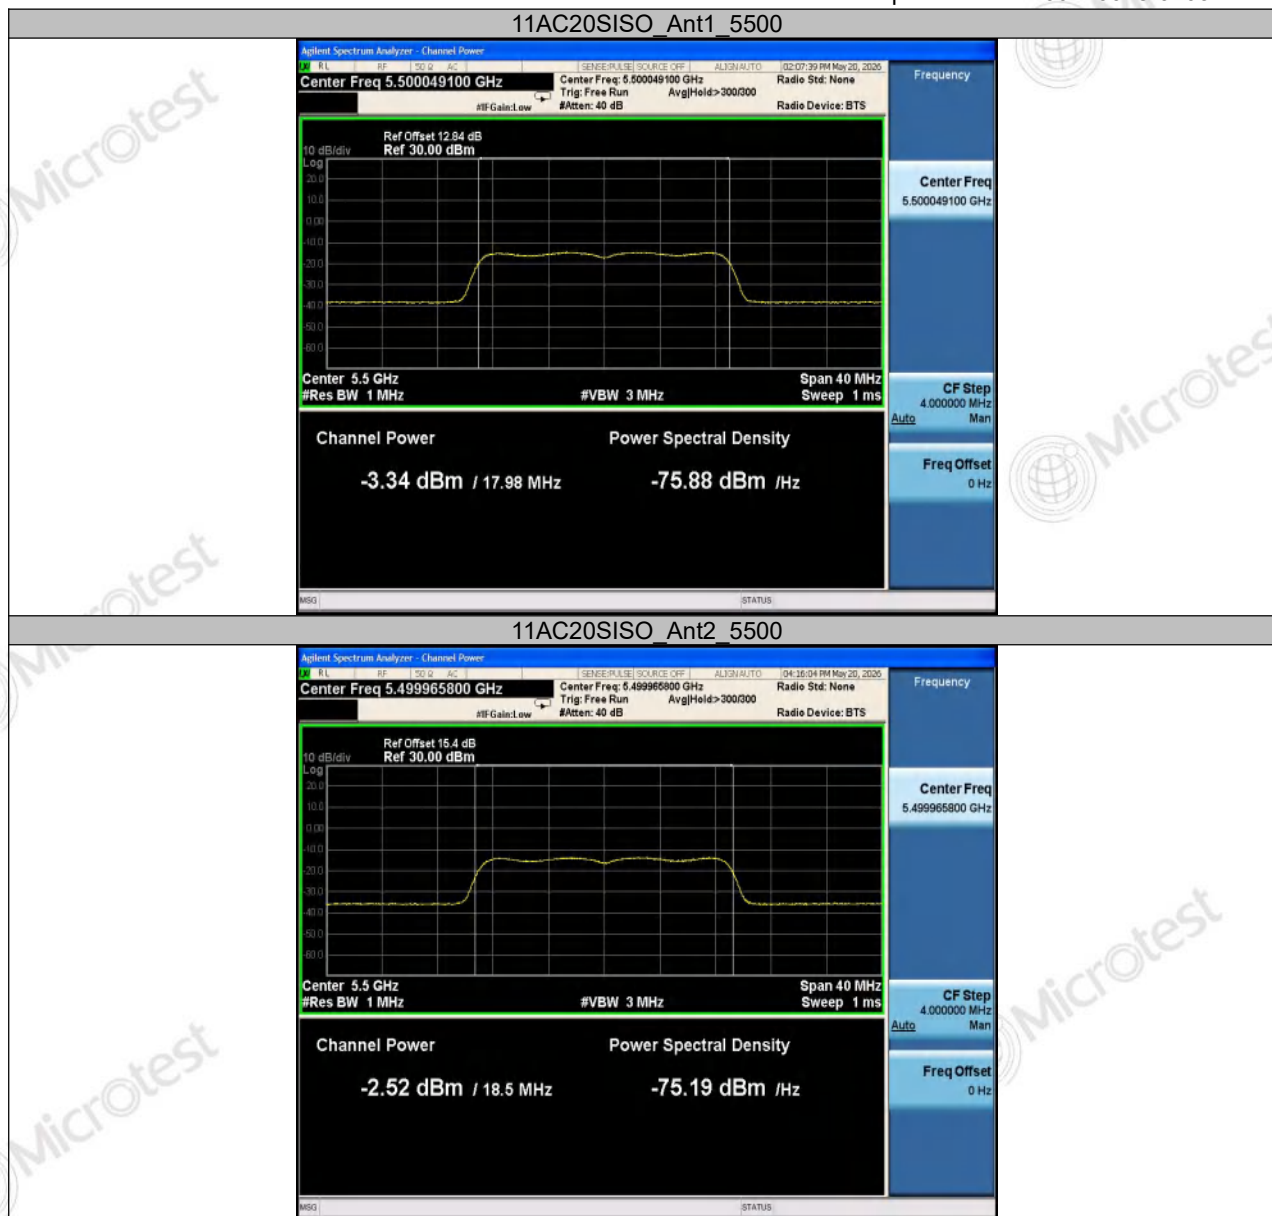


TEST REPORT

Report No.: MTI260410018-0203E4

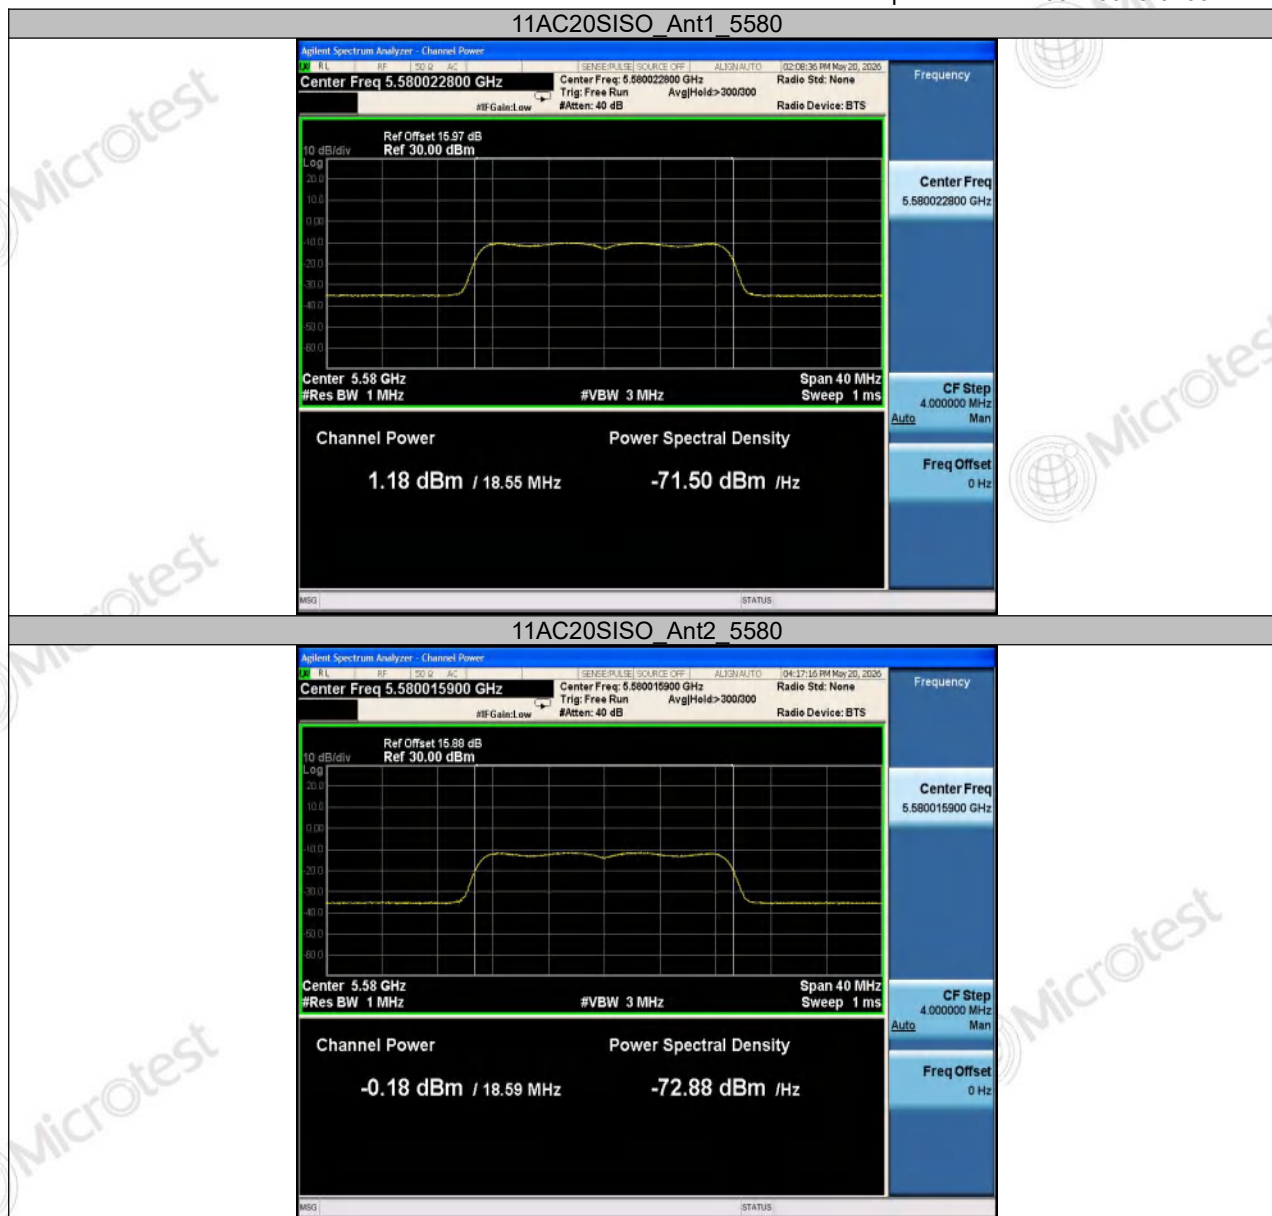


TEST REPORT

Report No.: MTI260410018-0203E4

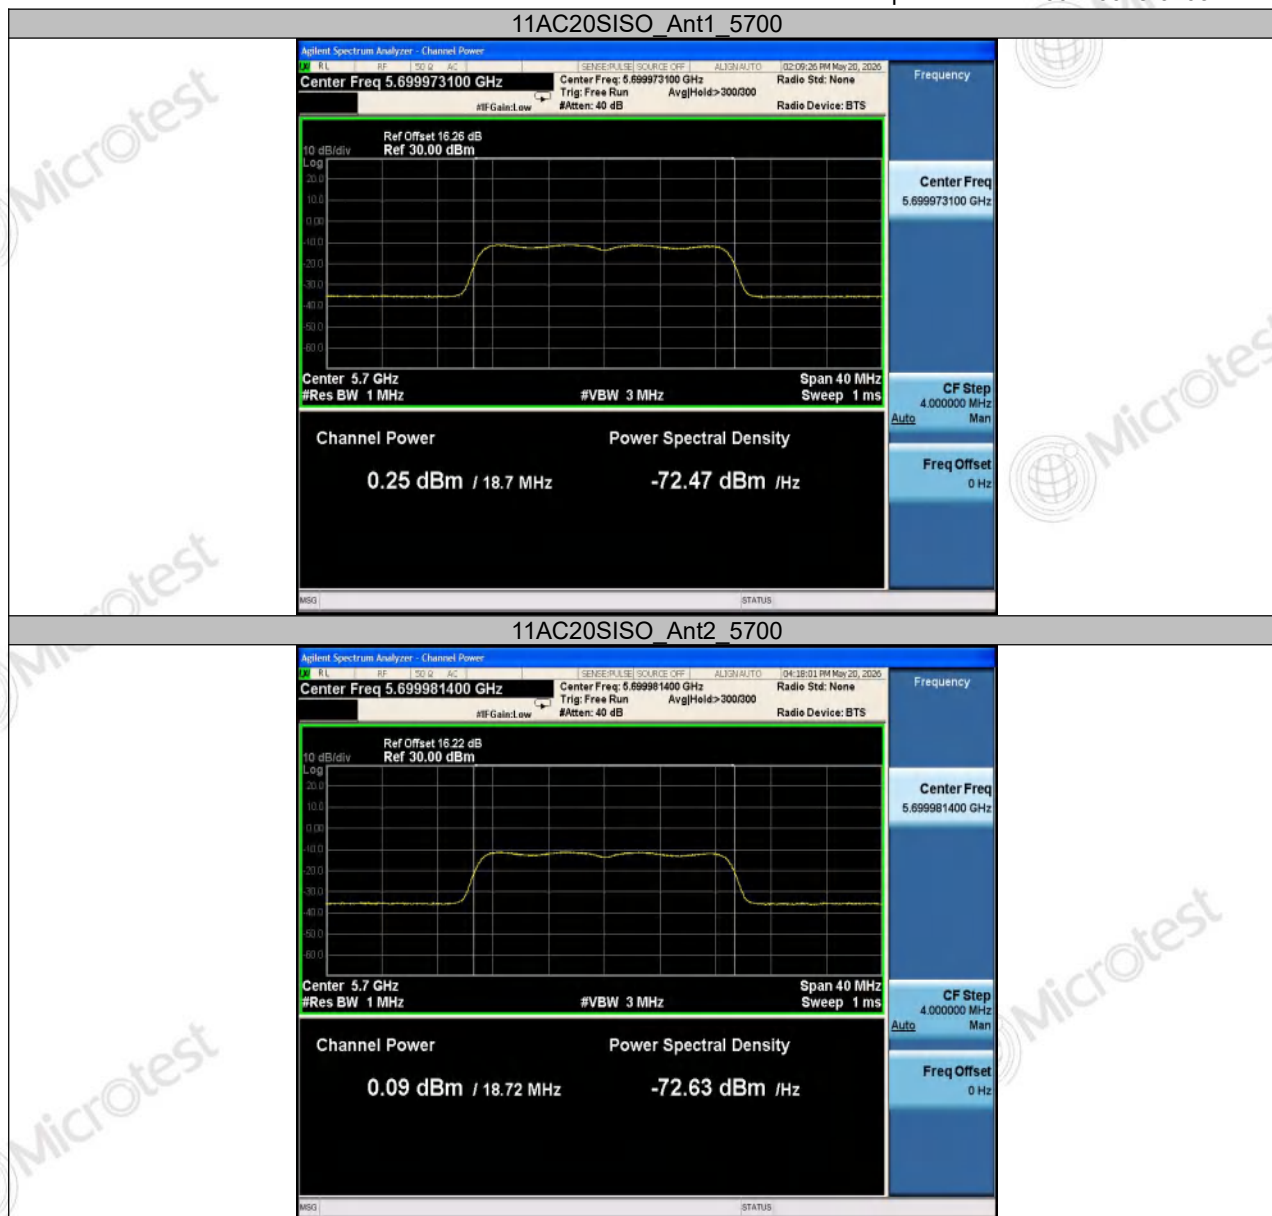


TEST REPORT

Report No.: MTi260410018-0203E4

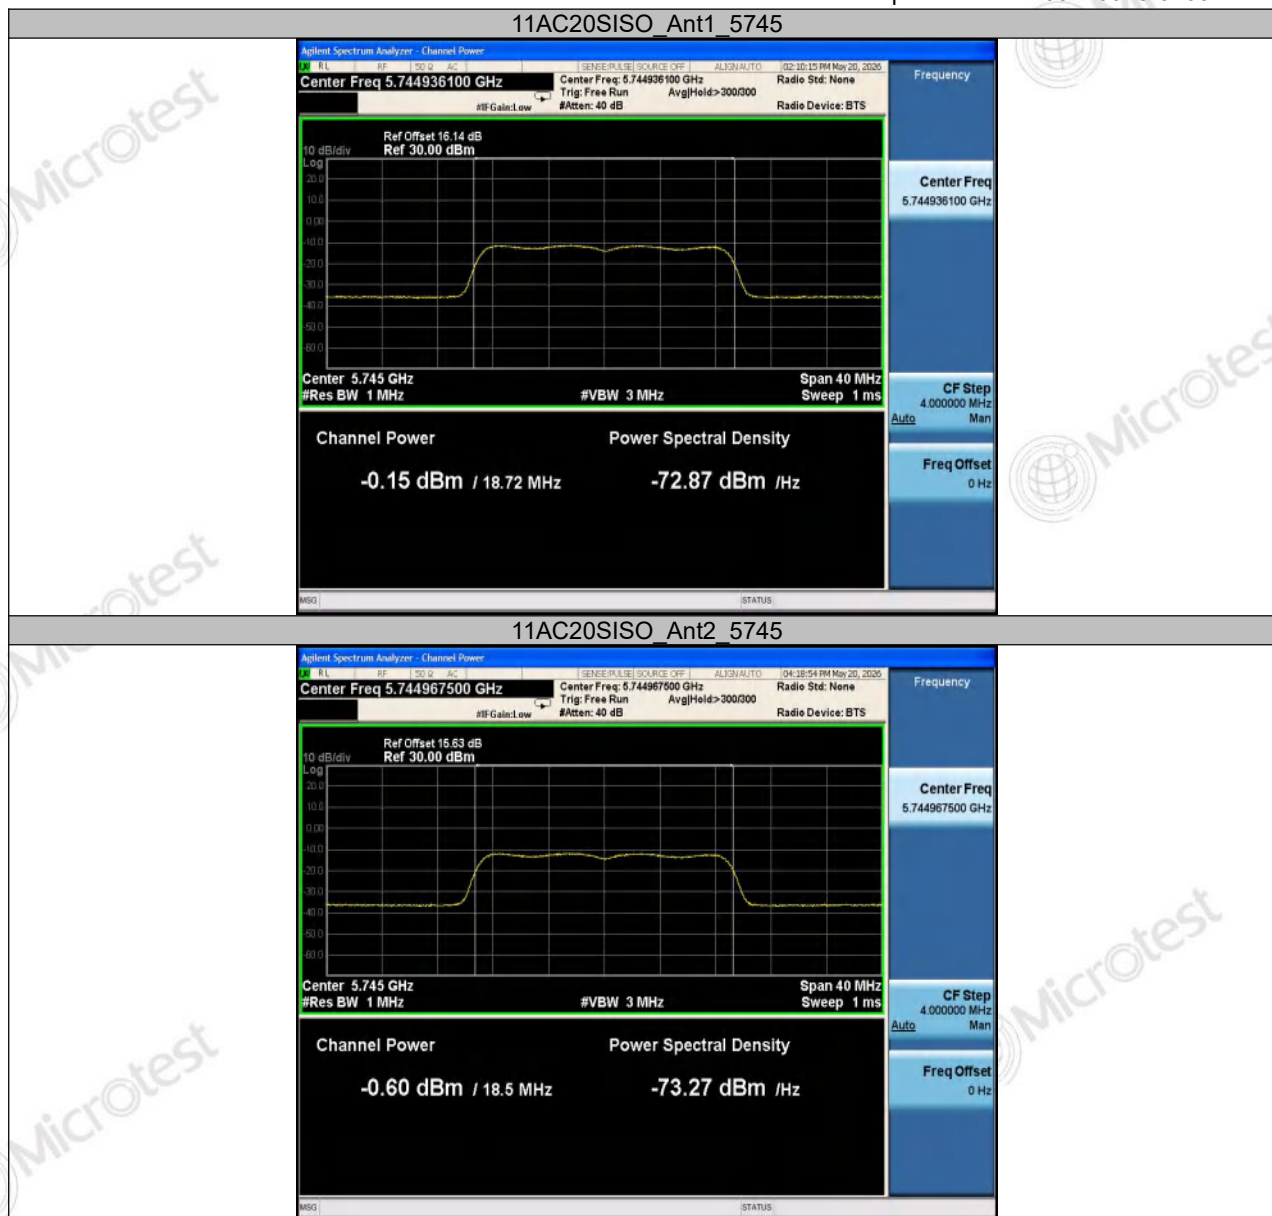


TEST REPORT

Report No.: MTi260410018-0203E4

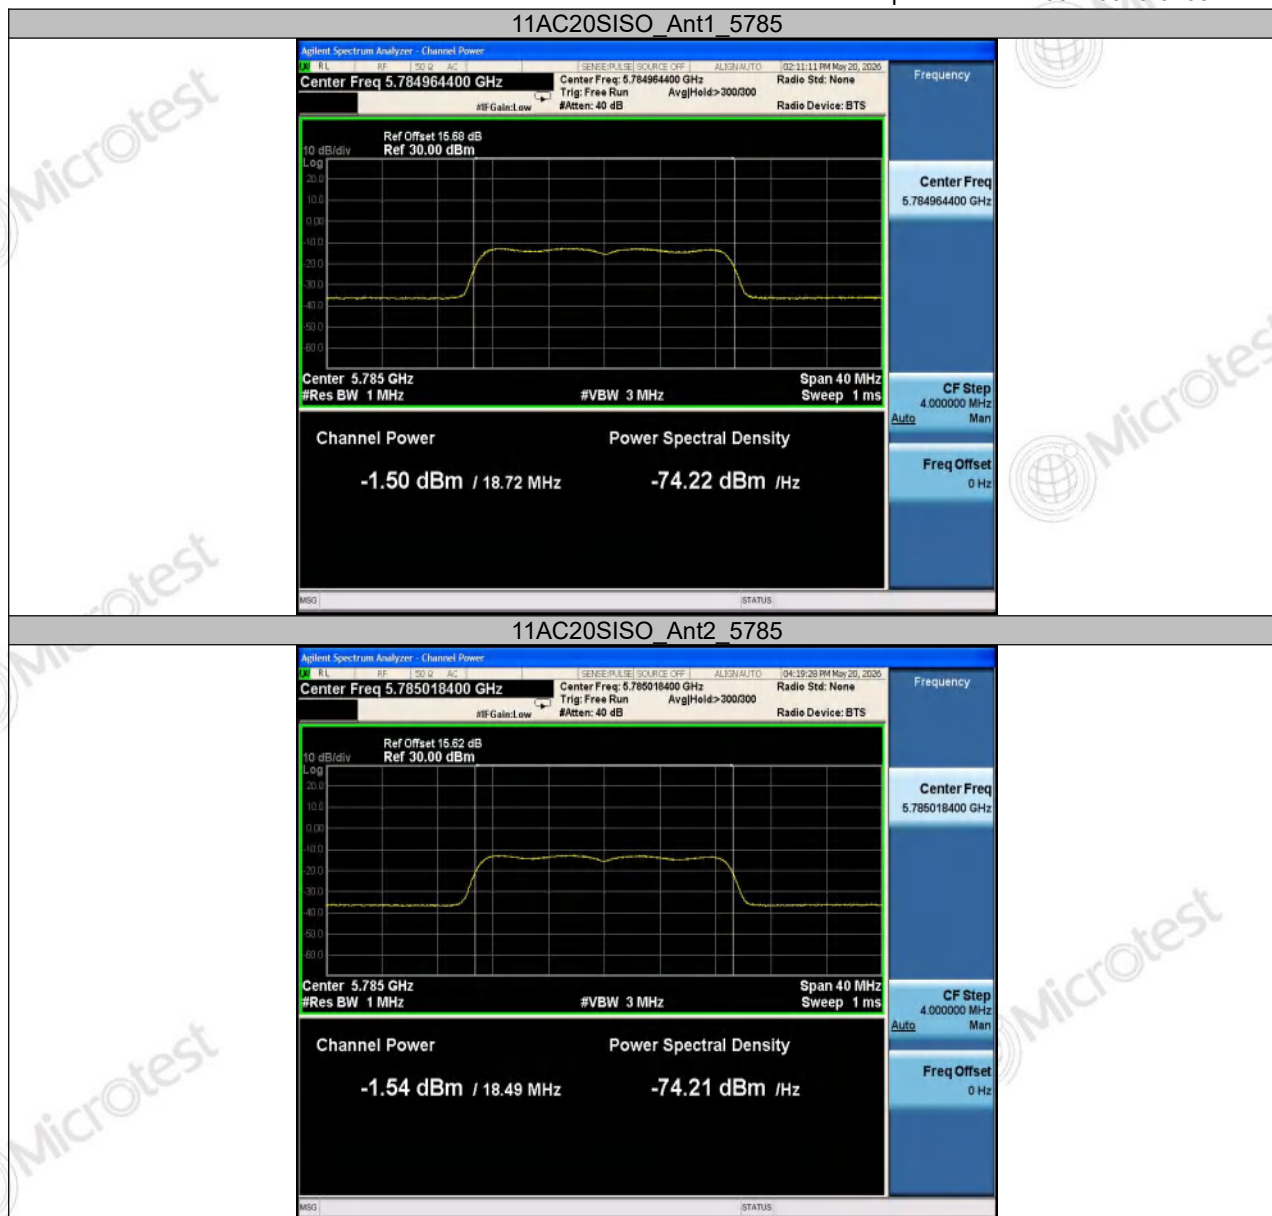


TEST REPORT

Report No.: MTi260410018-0203E4

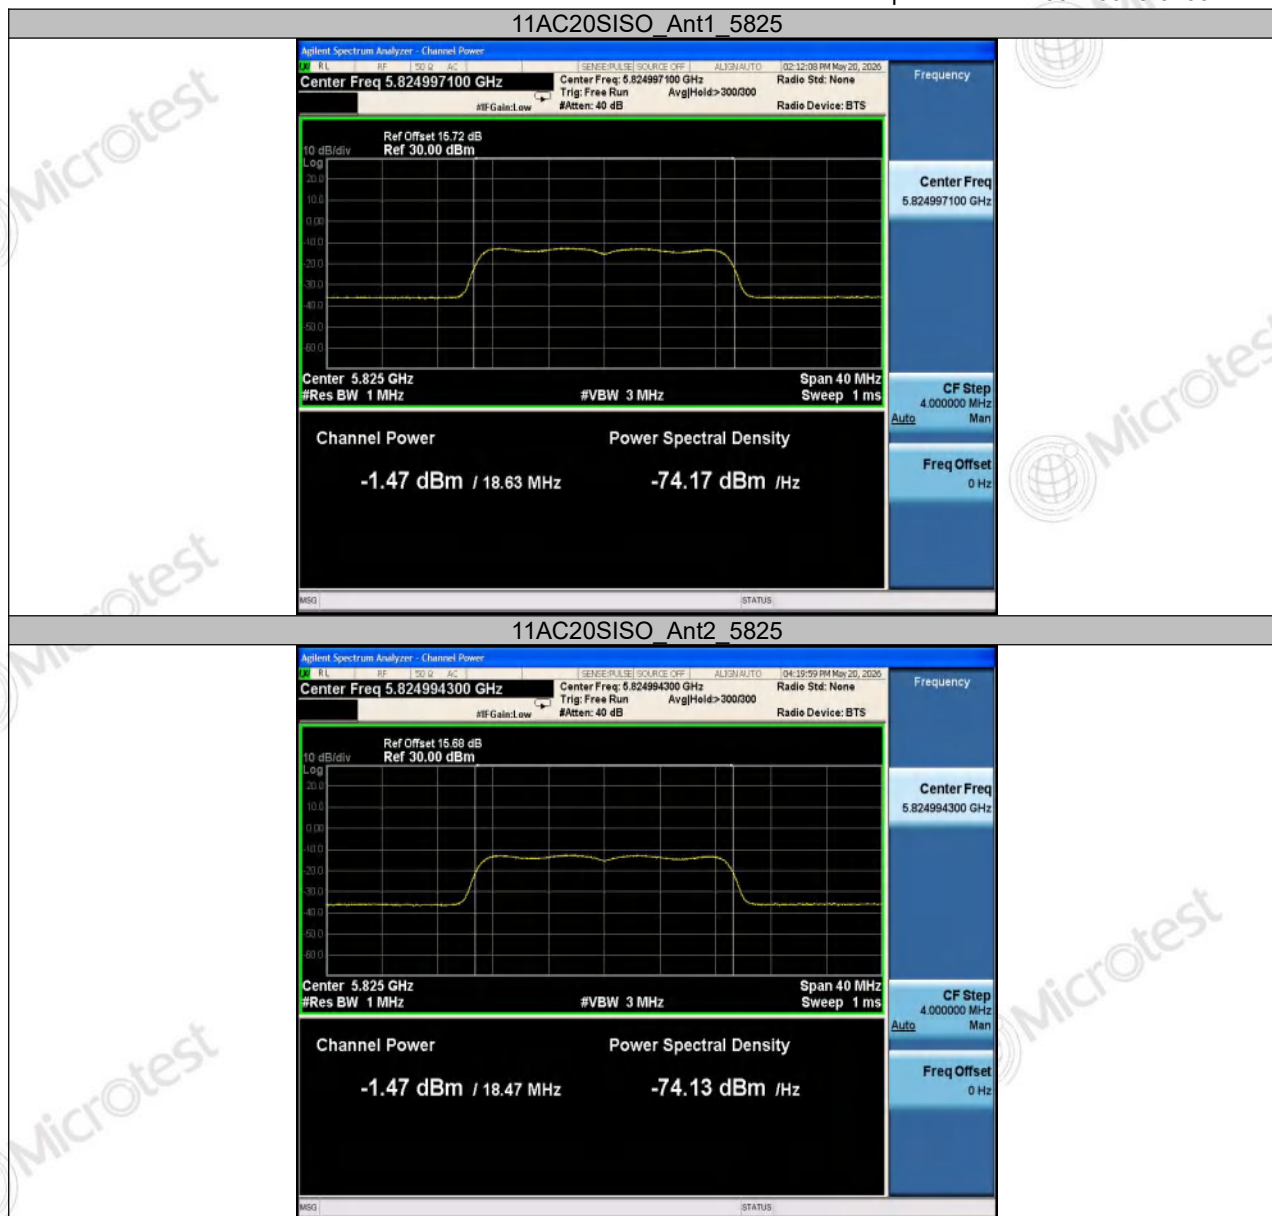


TEST REPORT

Report No.: MTi260410018-0203E4

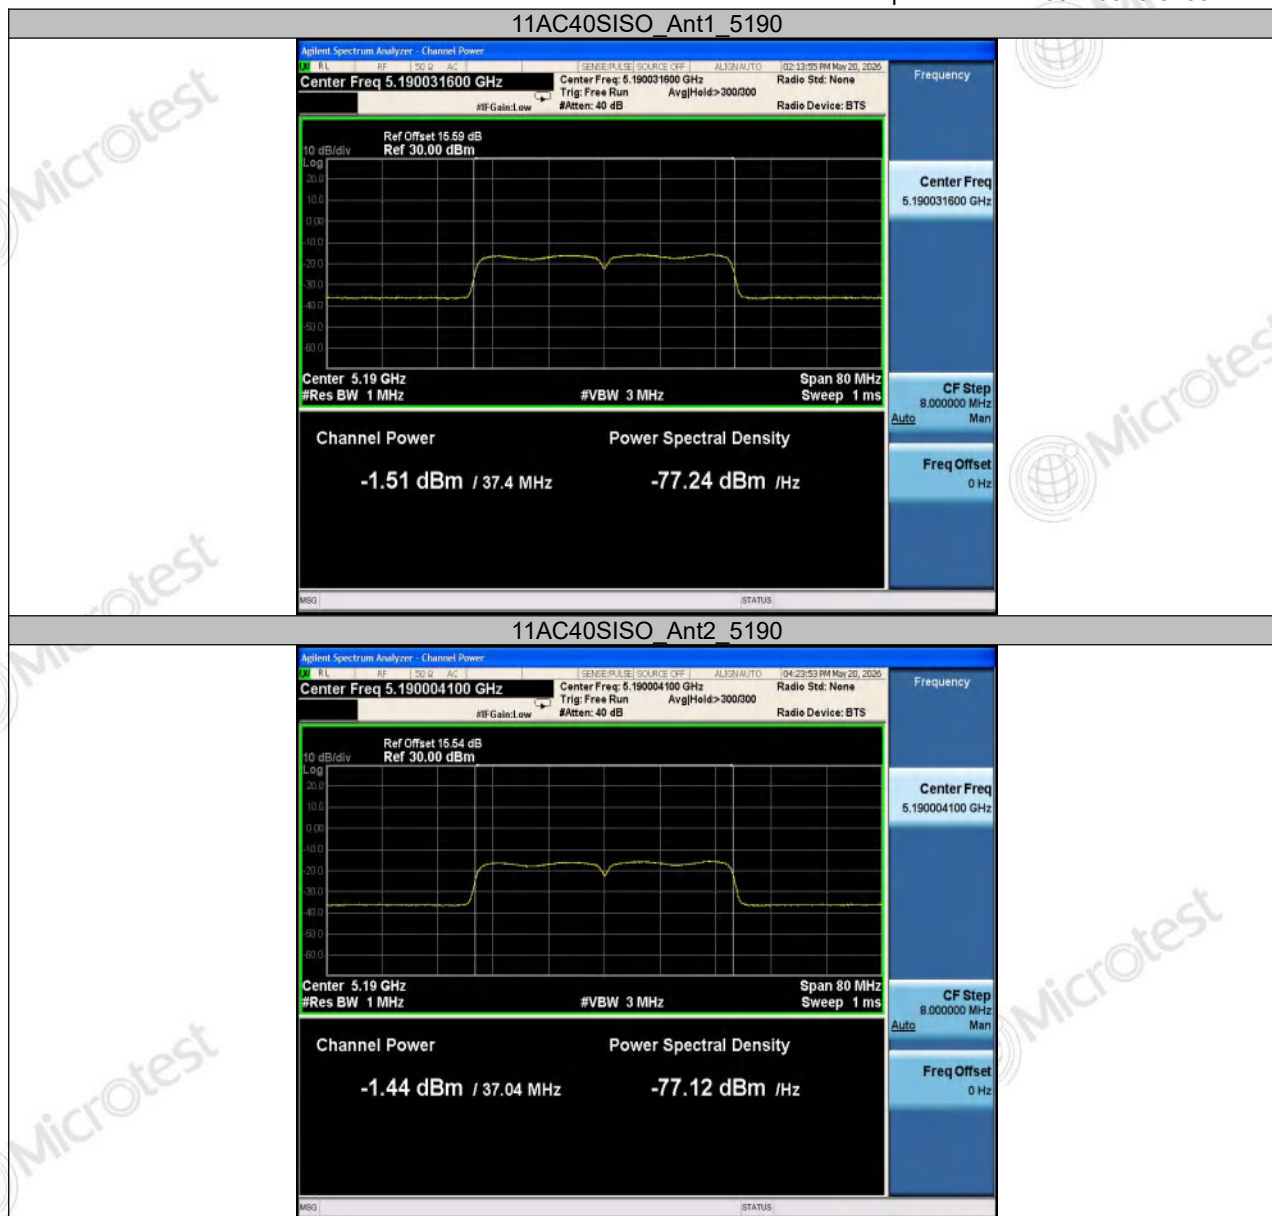


TEST REPORT

Report No.: MTi260410018-0203E4

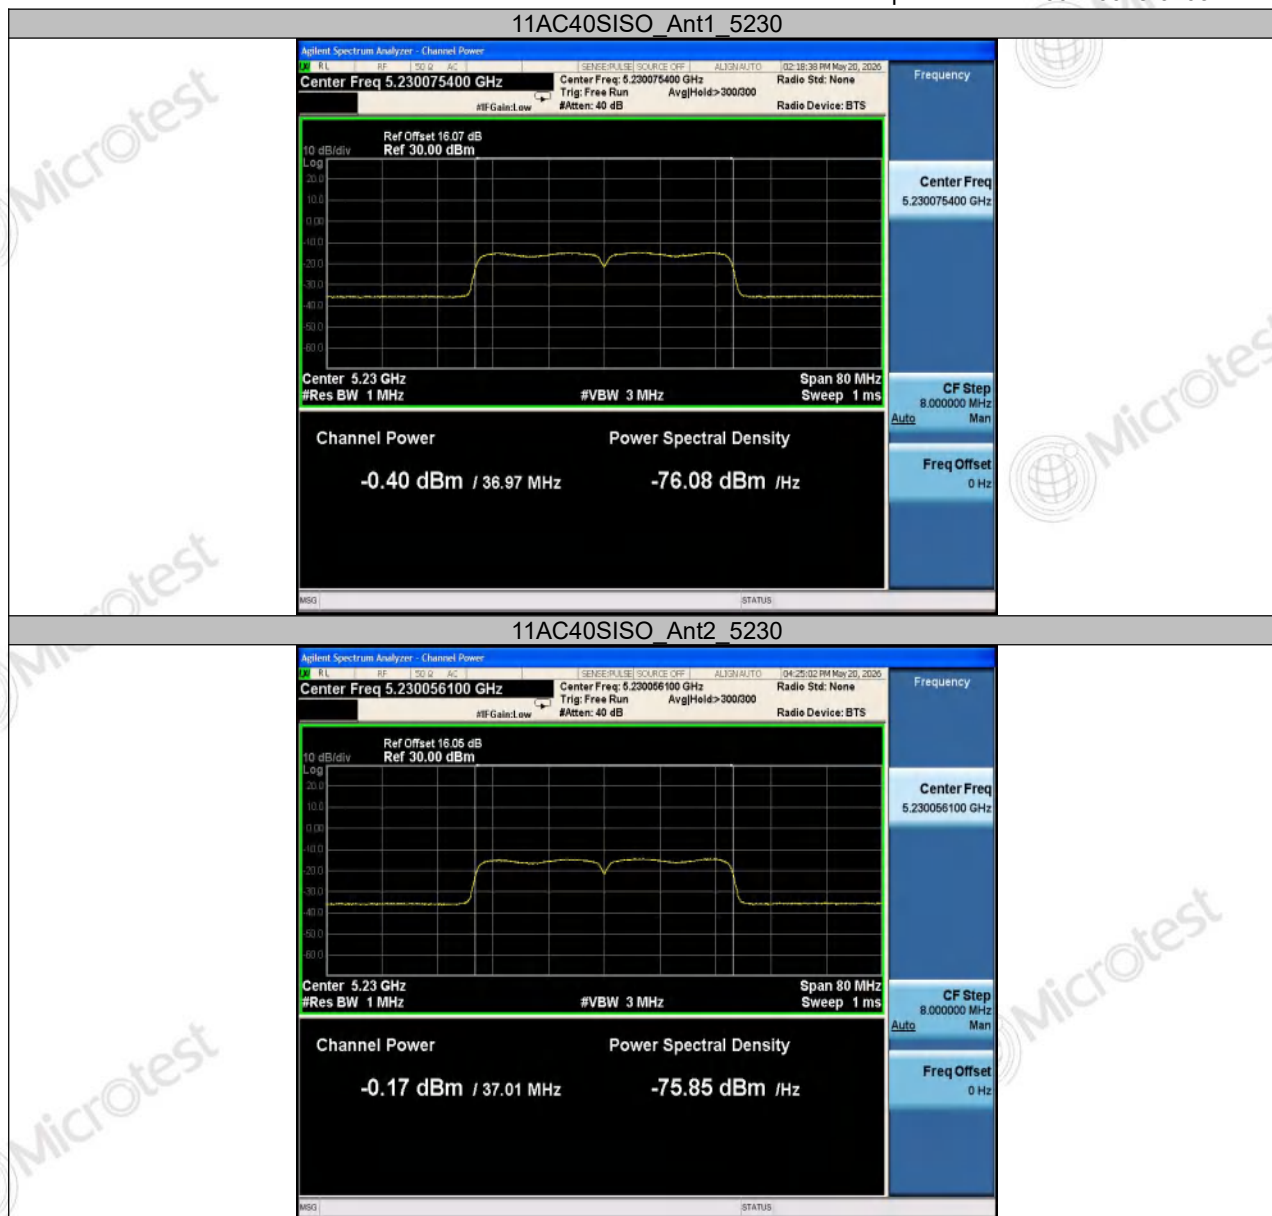


TEST REPORT

Report No.: MTi260410018-0203E4

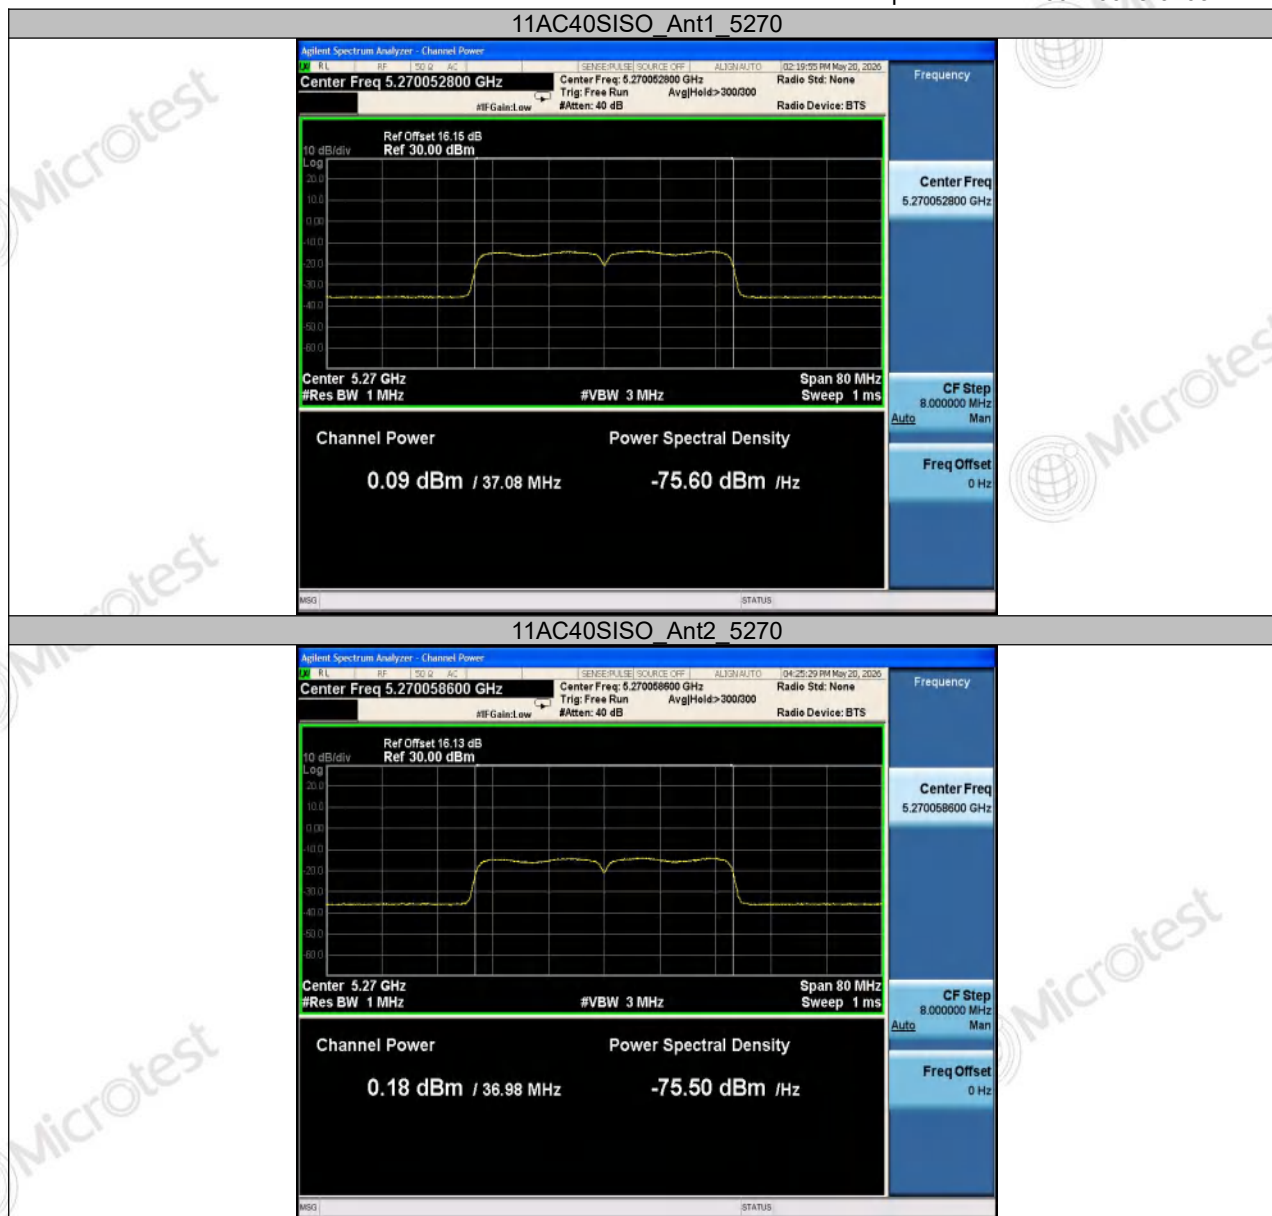


TEST REPORT

Report No.: MTi260410018-0203E4

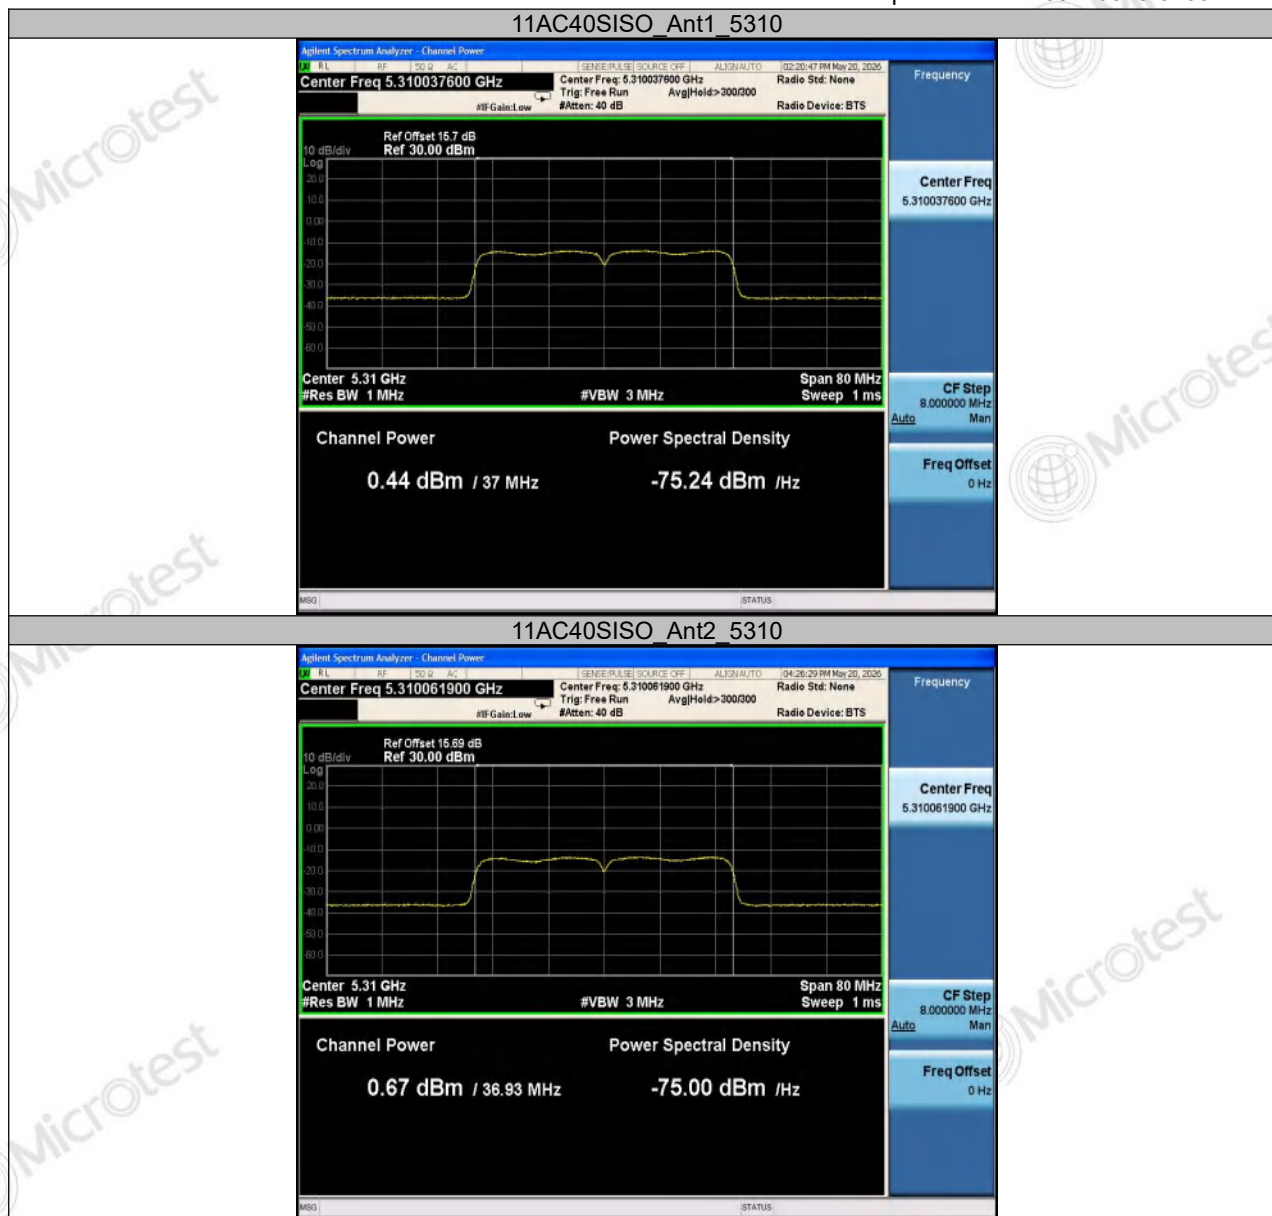


TEST REPORT

Report No.: MTI260410018-0203E4

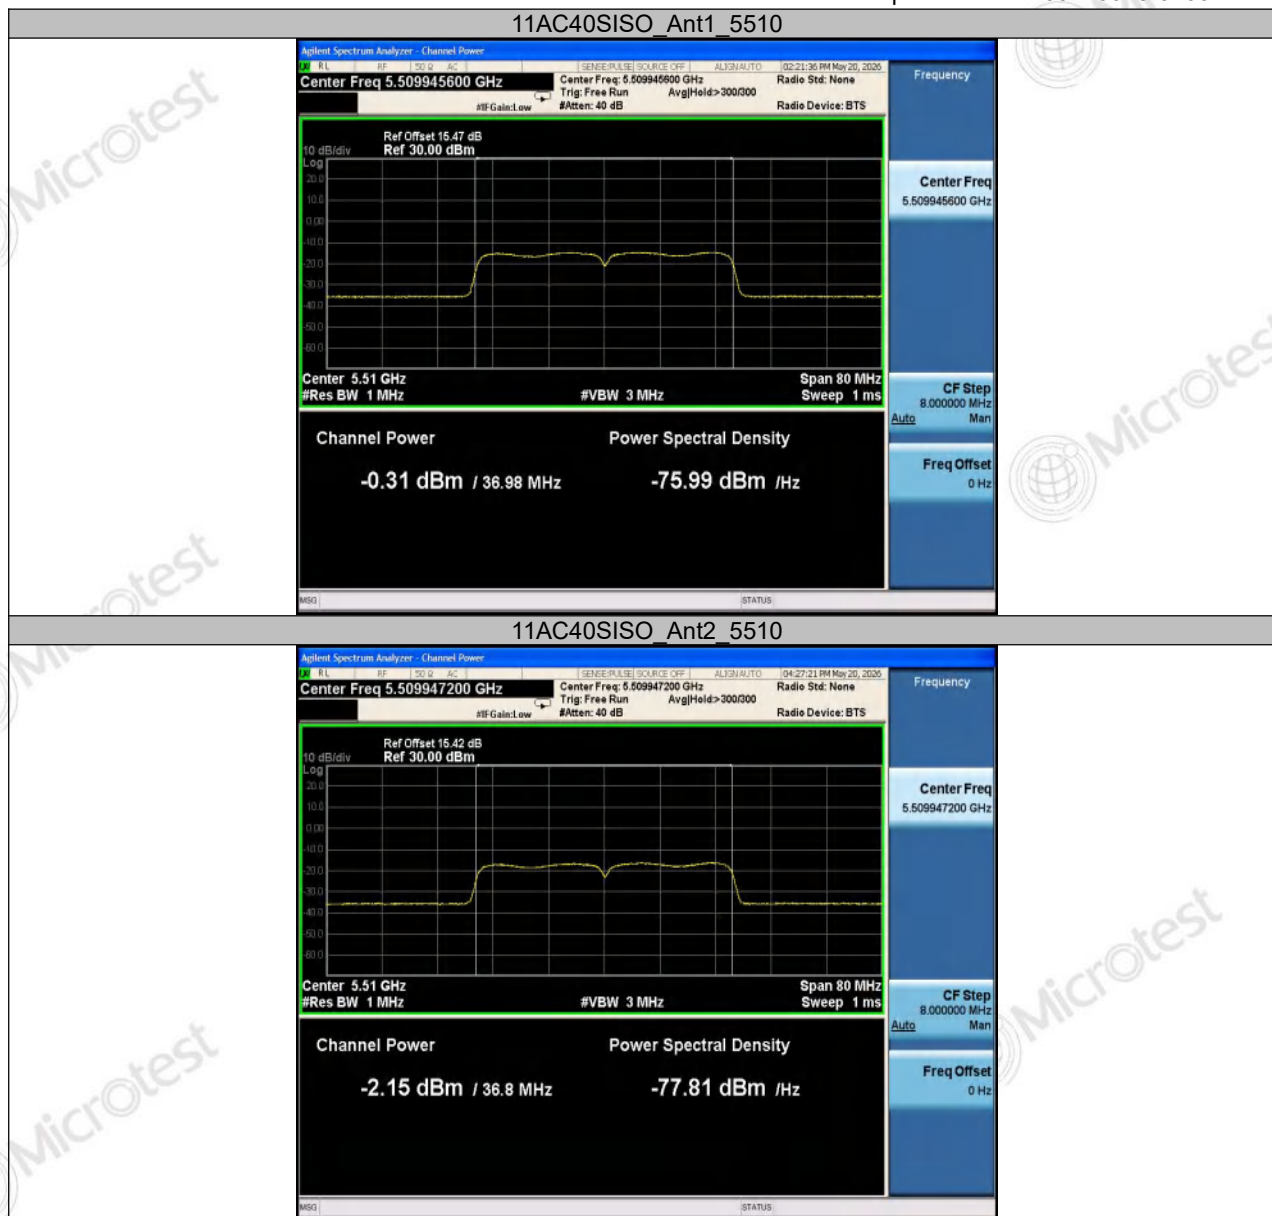


TEST REPORT

Report No.: MTI260410018-0203E4

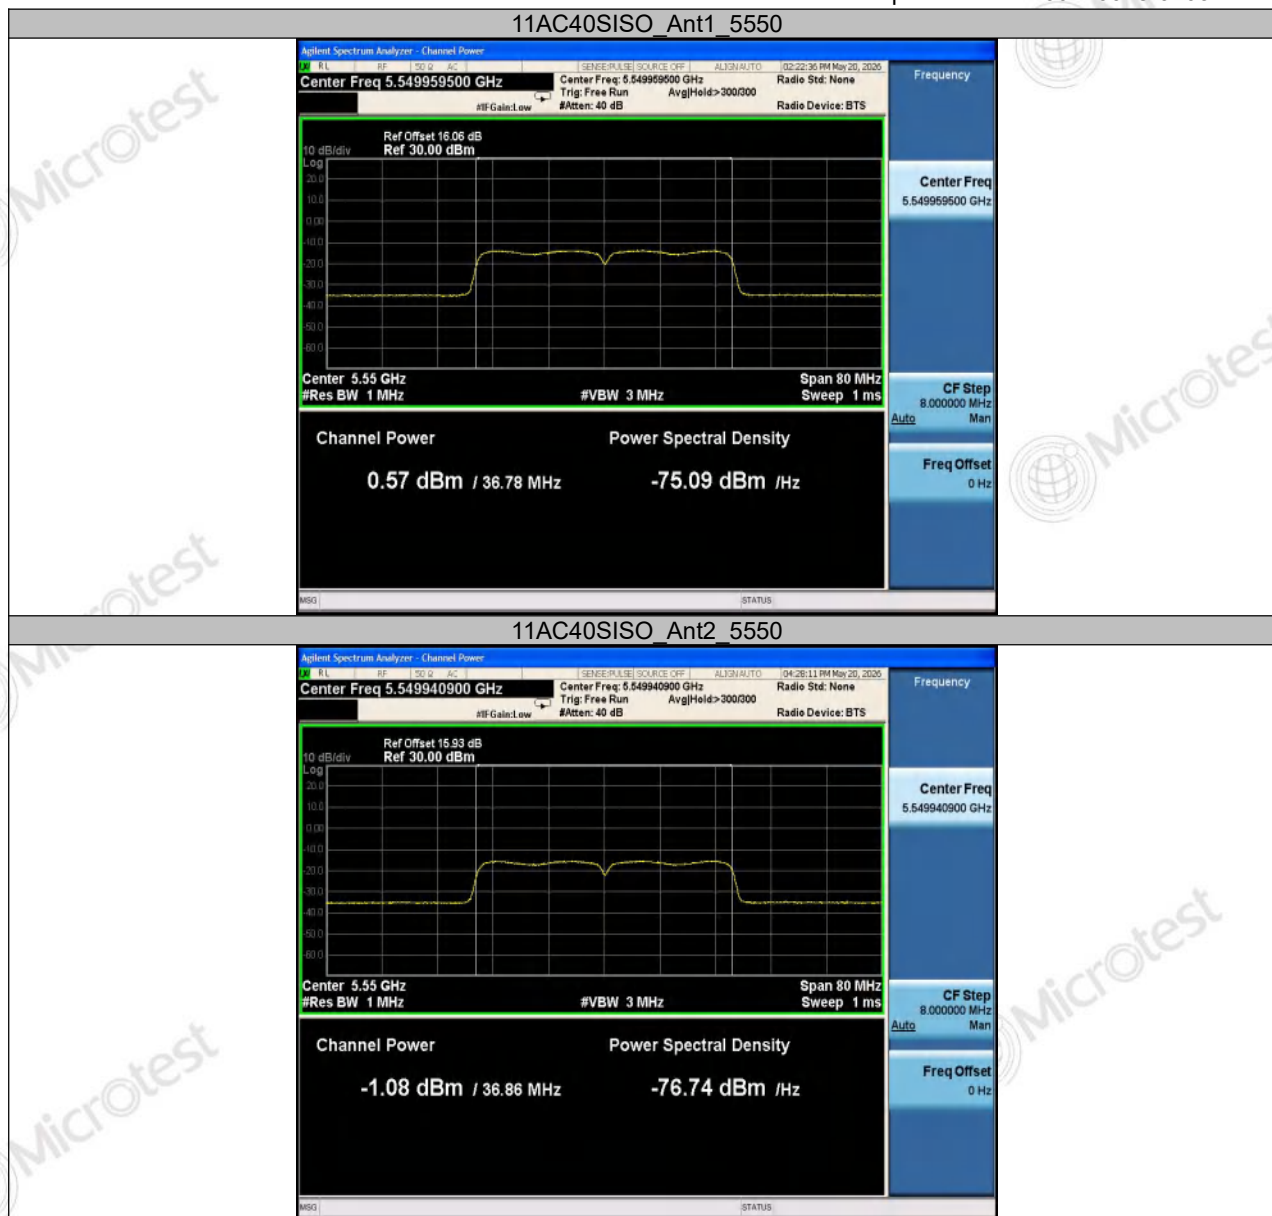


TEST REPORT

Report No.: MTi260410018-0203E4

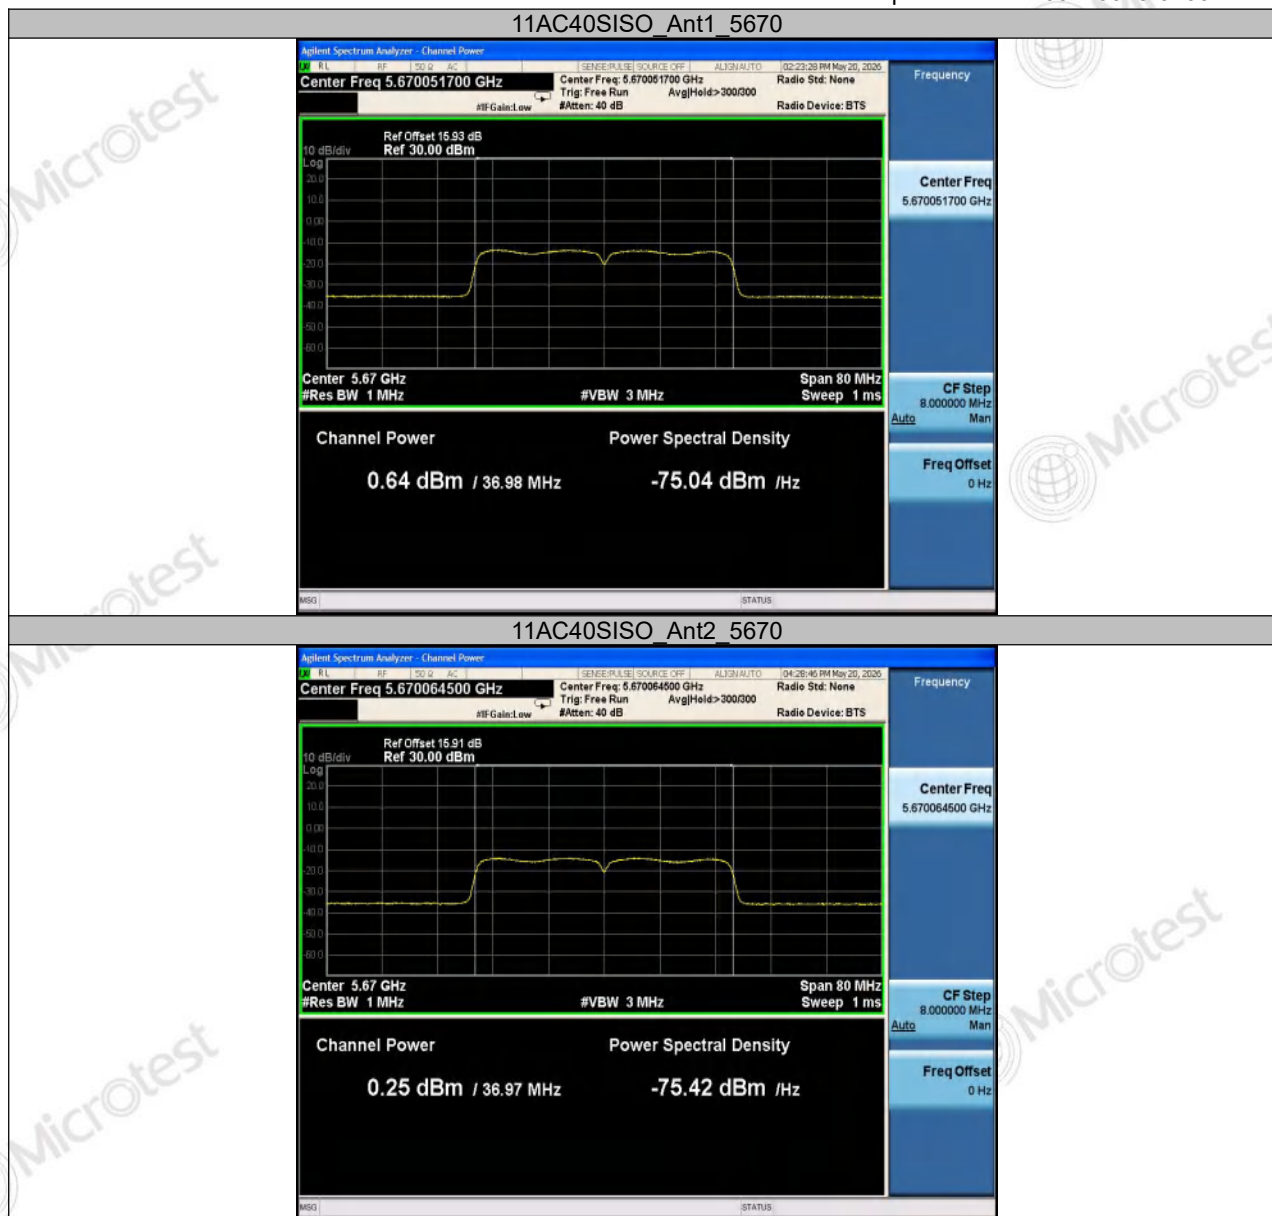


TEST REPORT

Report No.: MTi260410018-0203E4

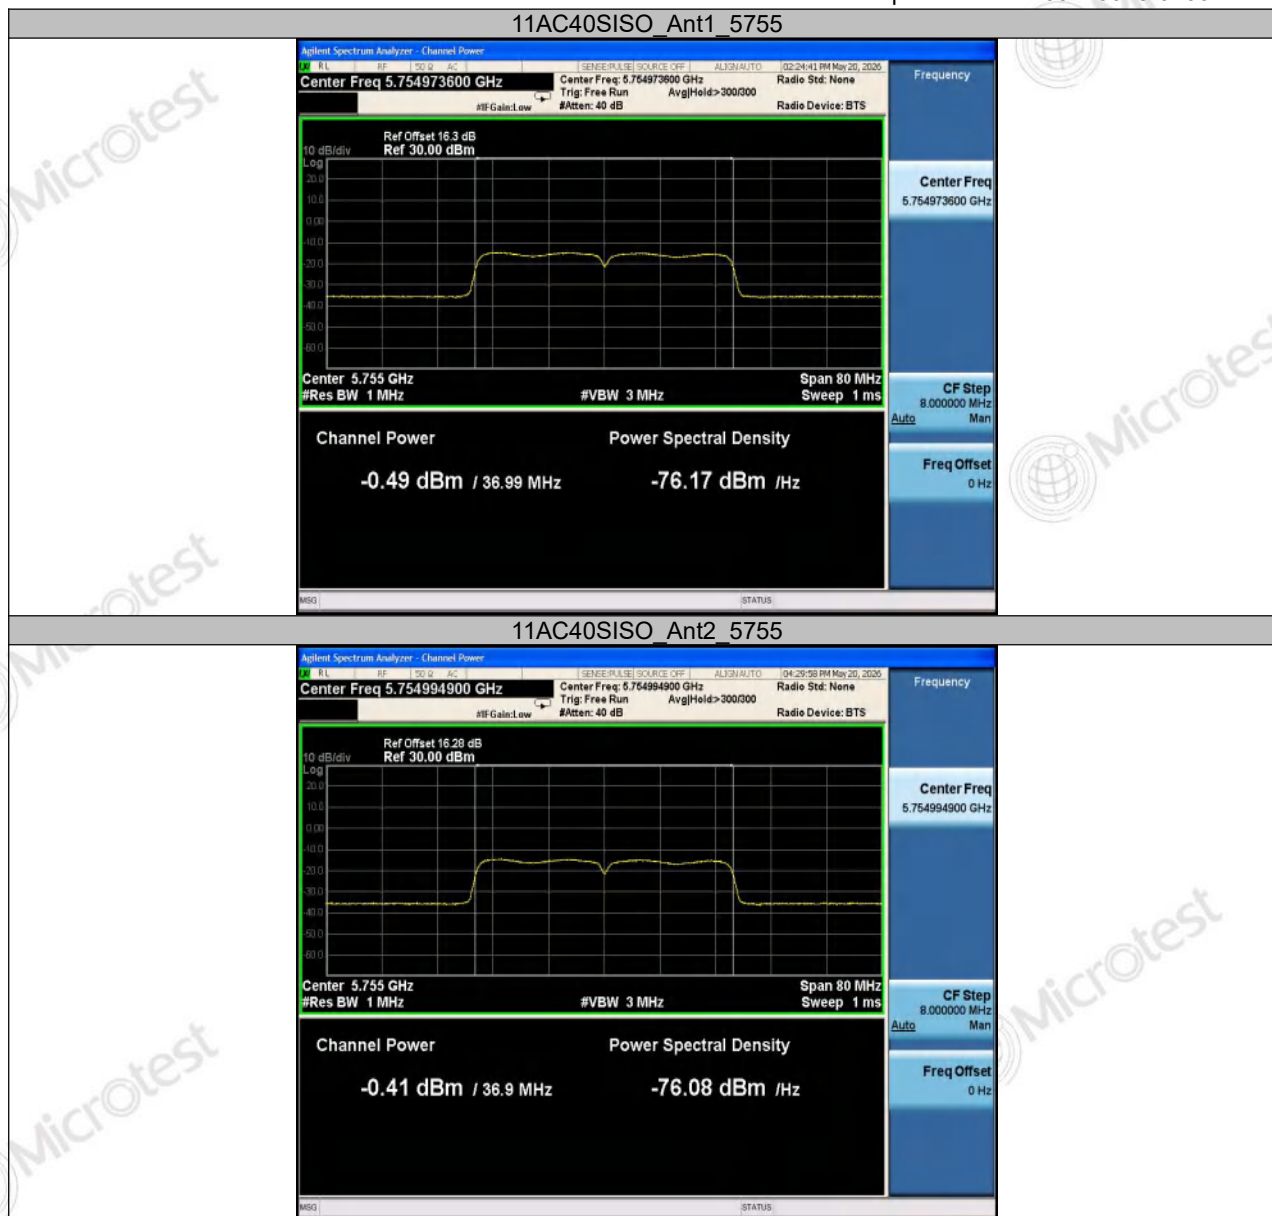


TEST REPORT

Report No.: MTi260410018-0203E4

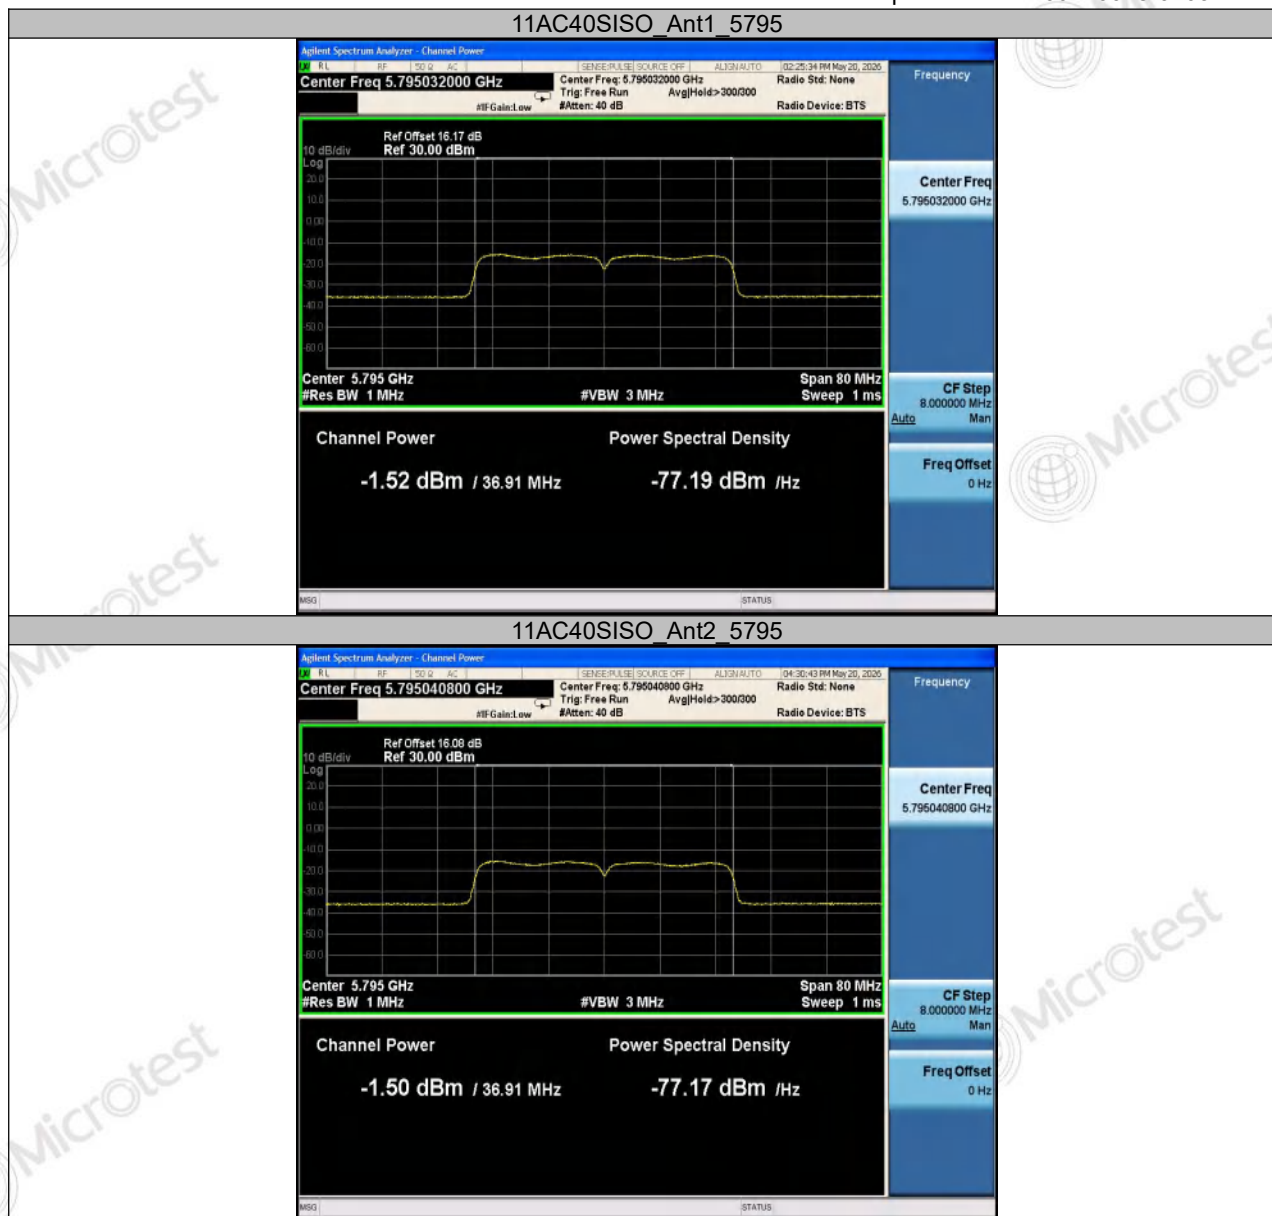


TEST REPORT

Report No.: MTi260410018-0203E4

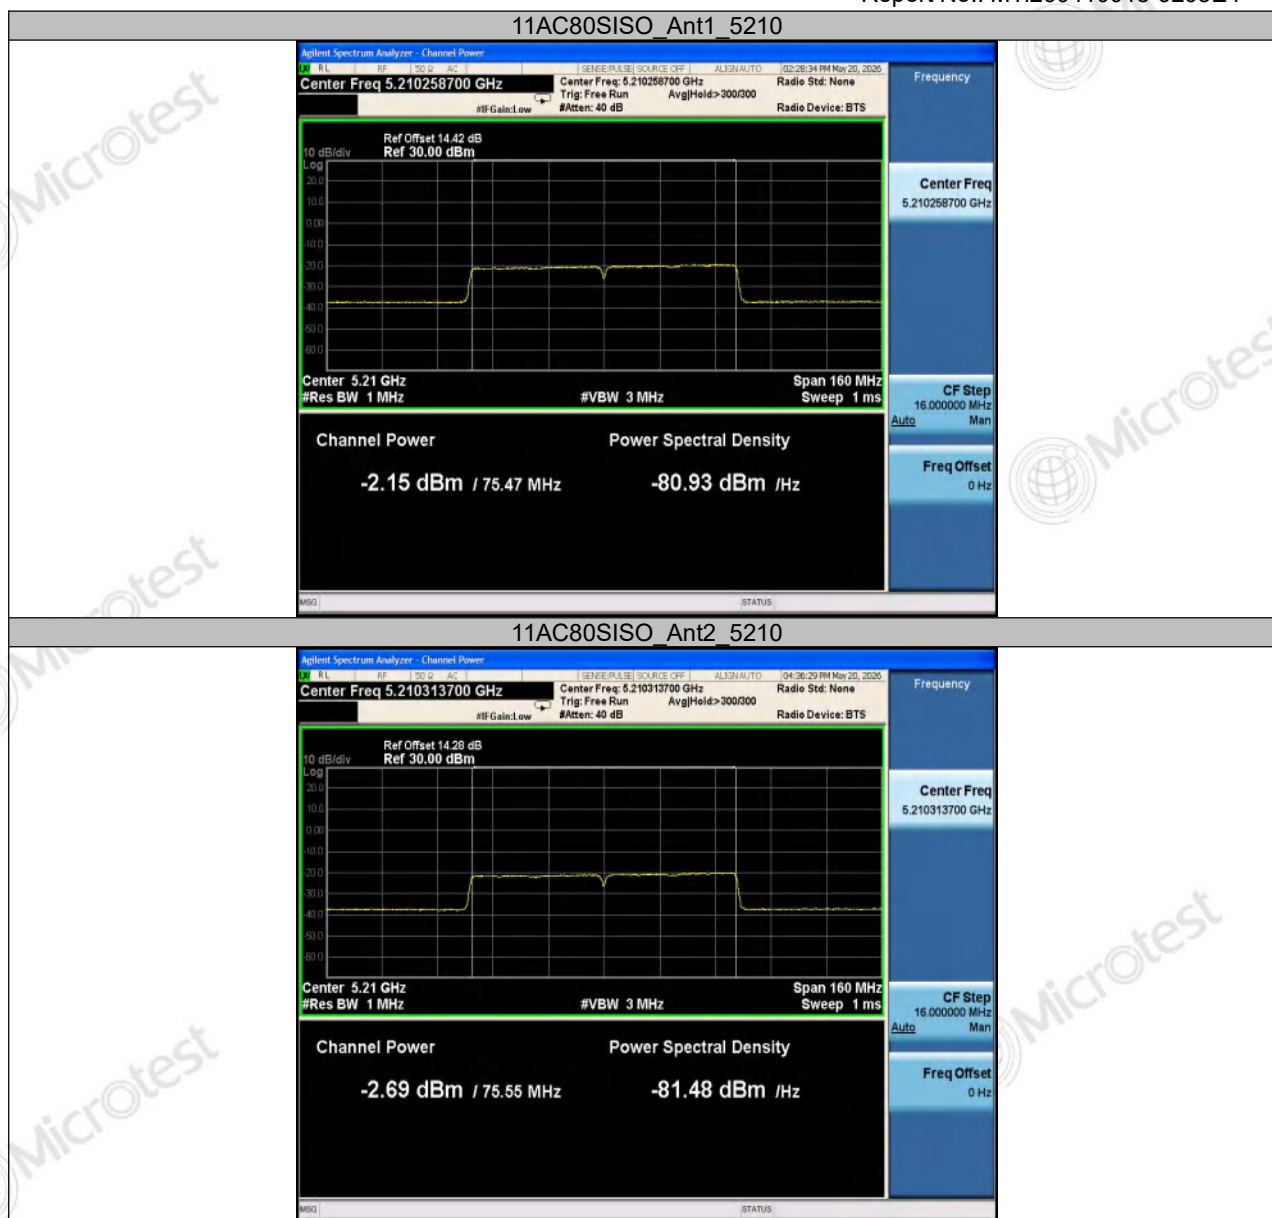


TEST REPORT

Report No.: MTi260410018-0203E4

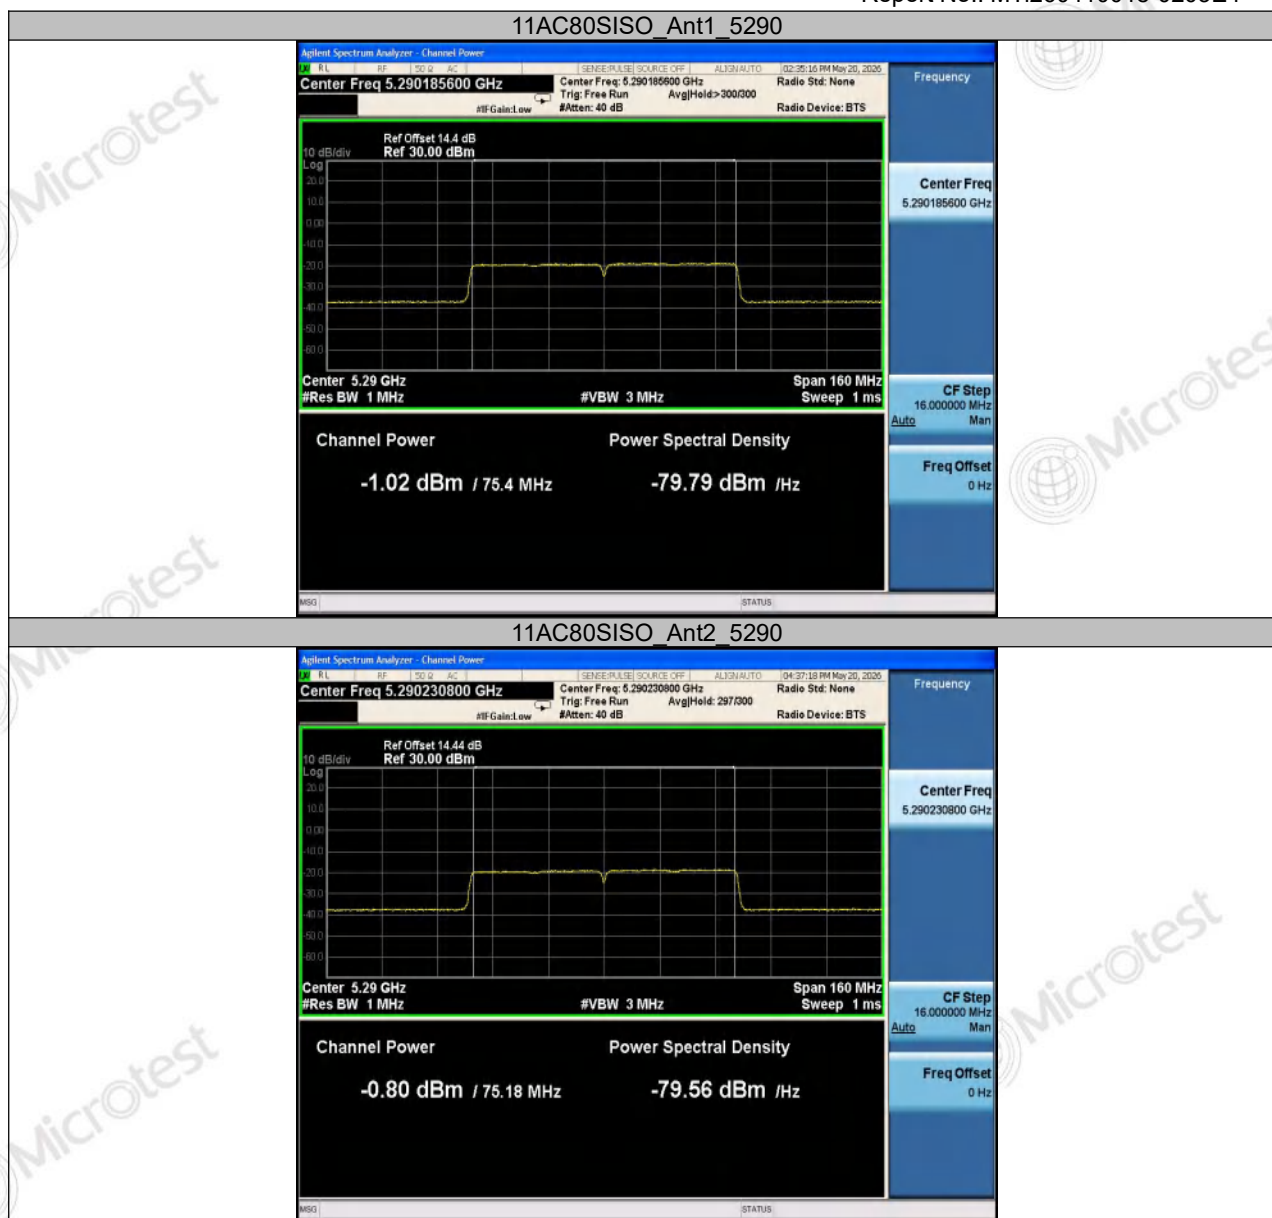


TEST REPORT

Report No.: MTi260410018-0203E4

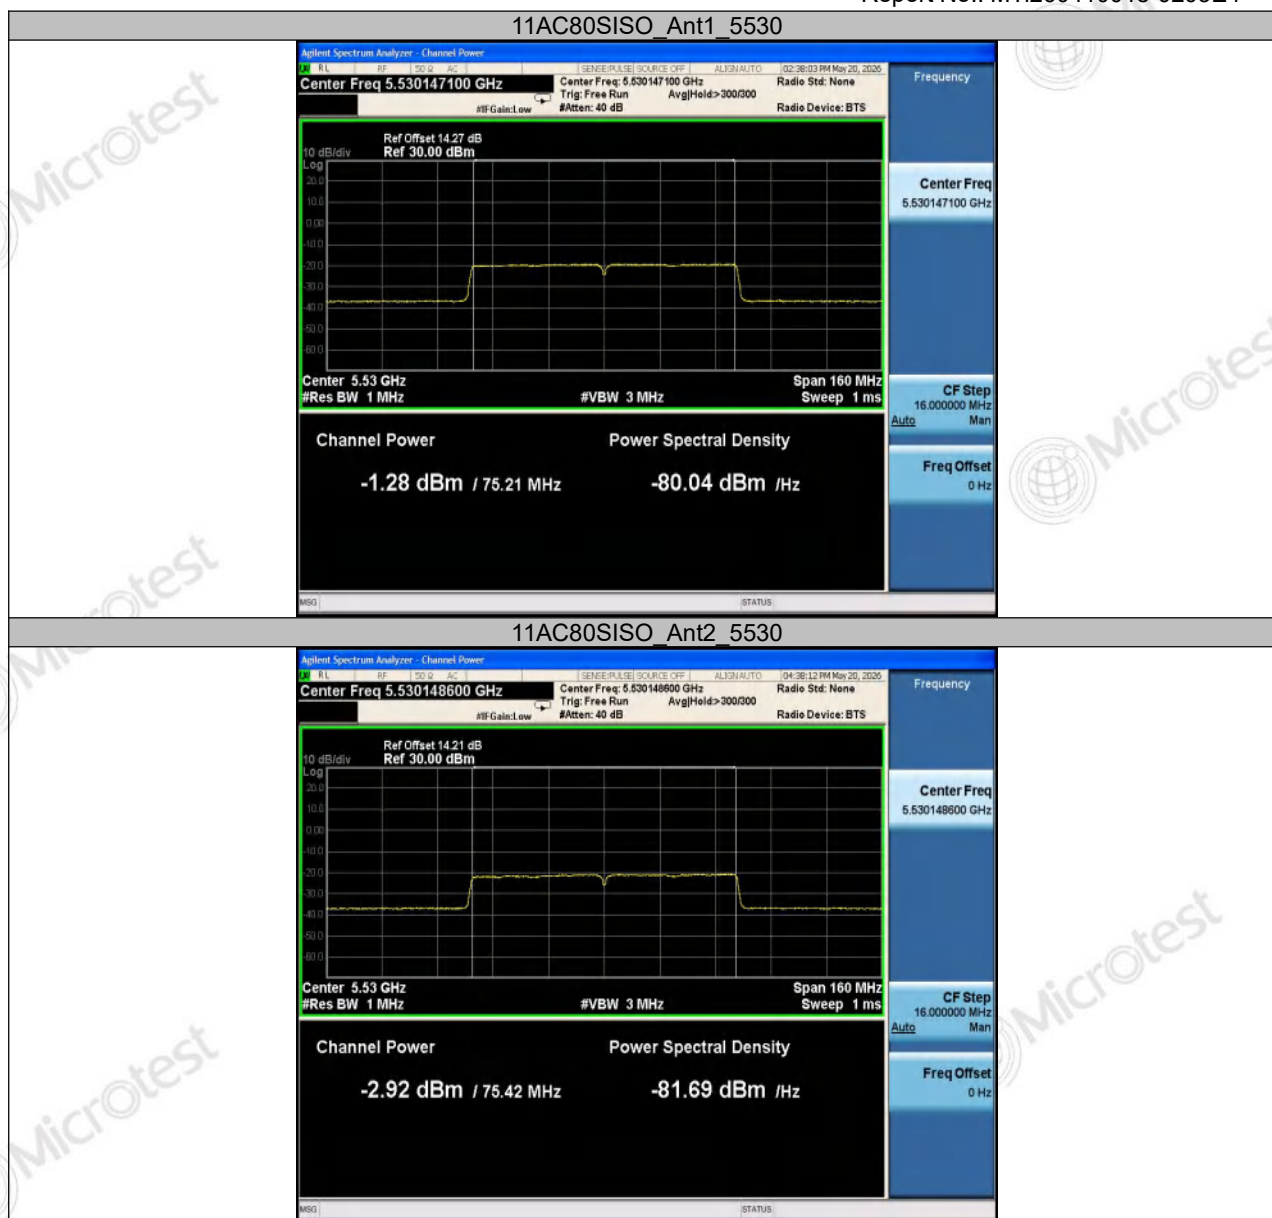

TEST REPORT

Report No.: MTi260410018-0203E4

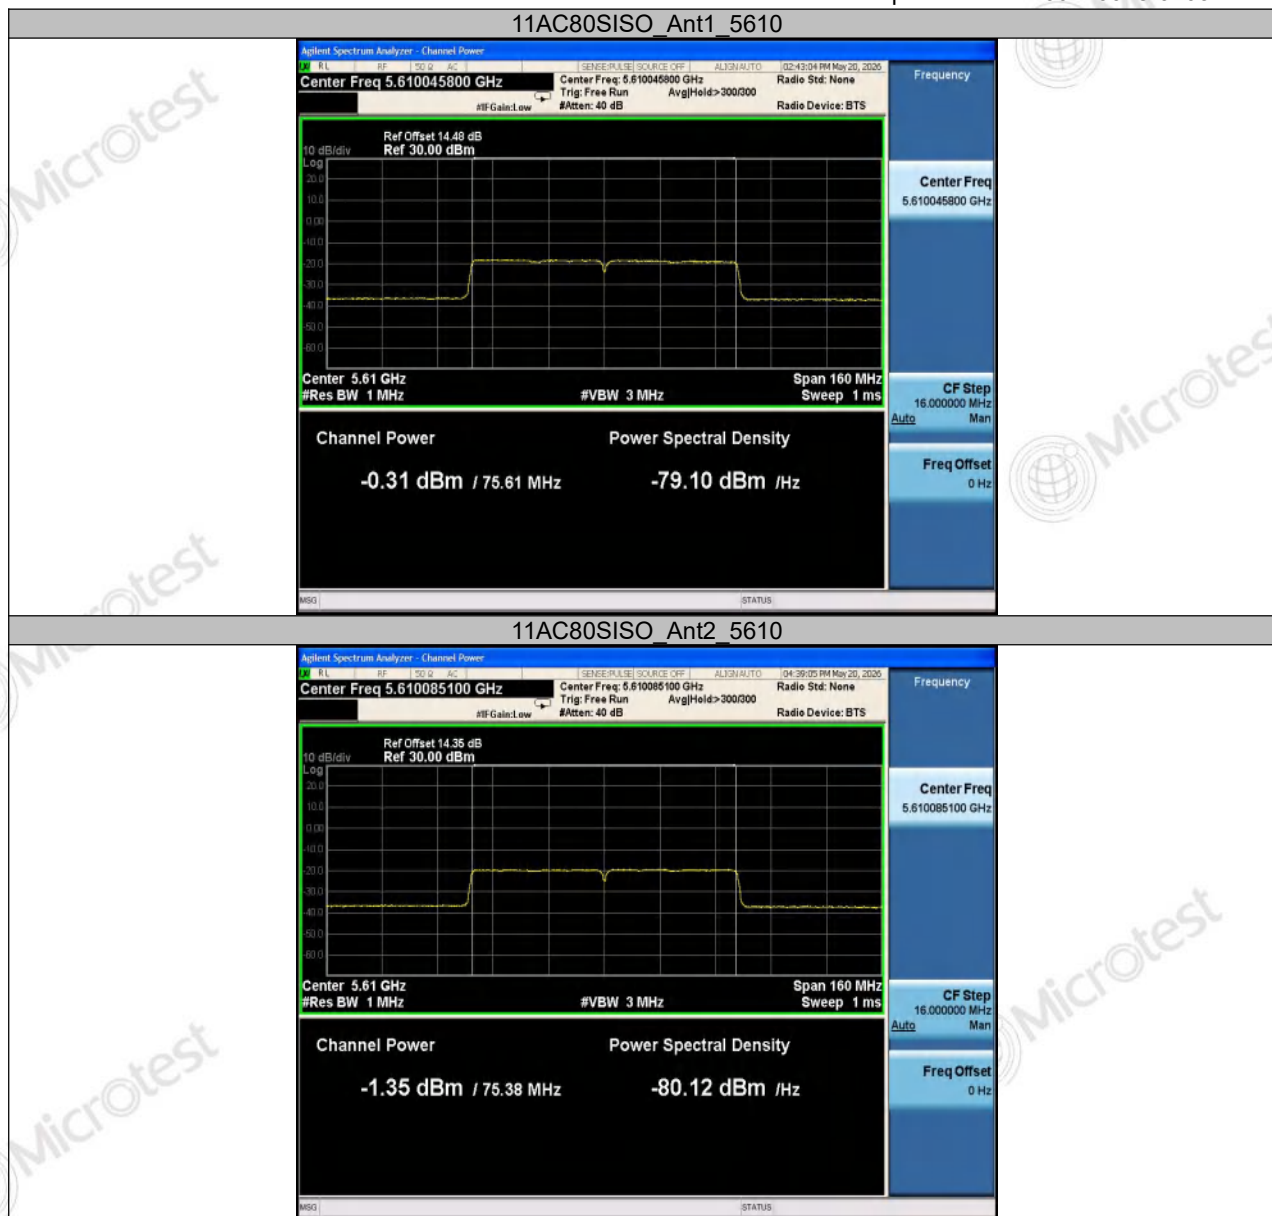


TEST REPORT

Report No.: MTi260410018-0203E4

11AC80SISO_Ant1_5775




11AC80SISO_Ant2_5775

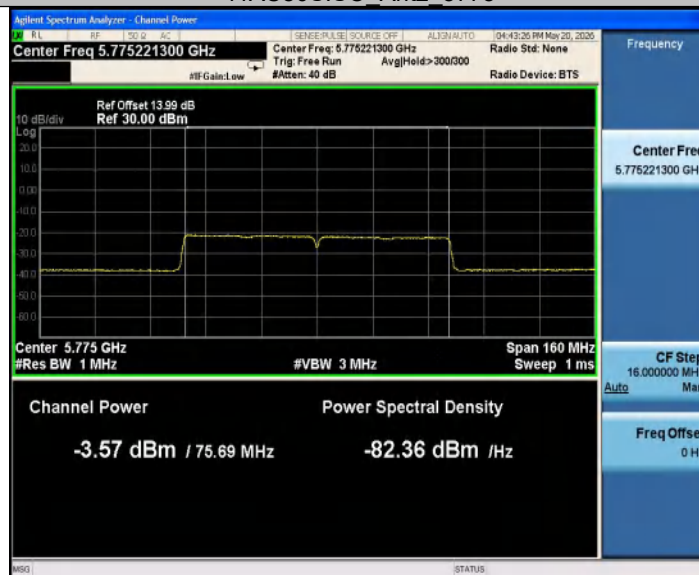


TEST REPORT

Report No.: MTi260410018-0203E4

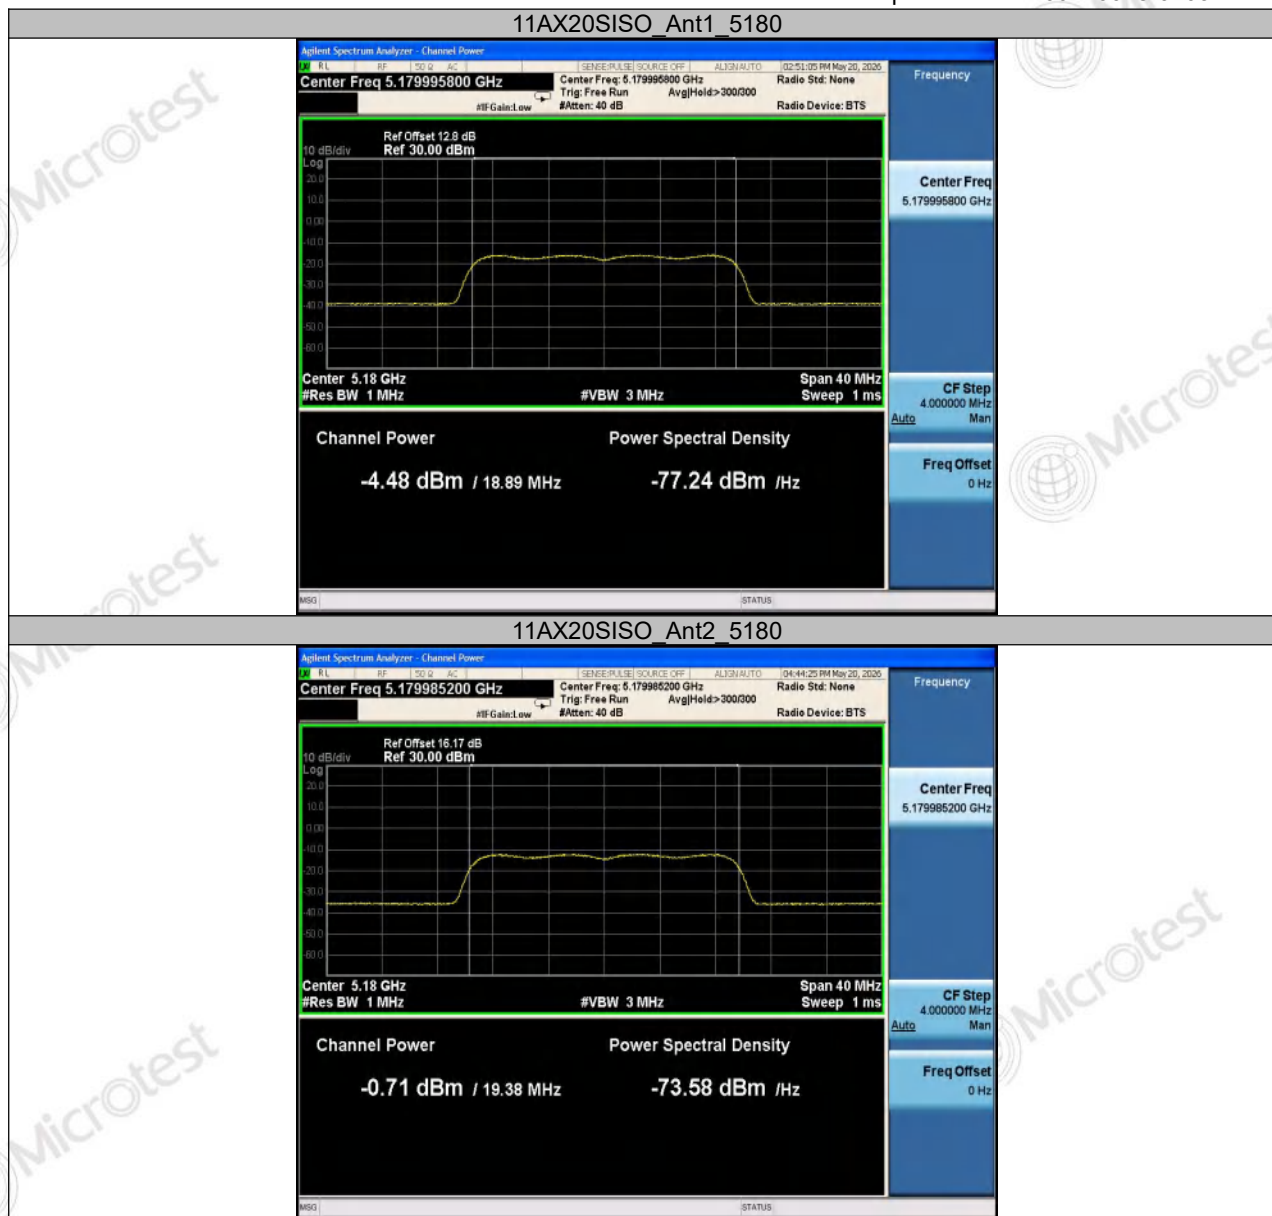


TEST REPORT

Report No.: MTi260410018-0203E4

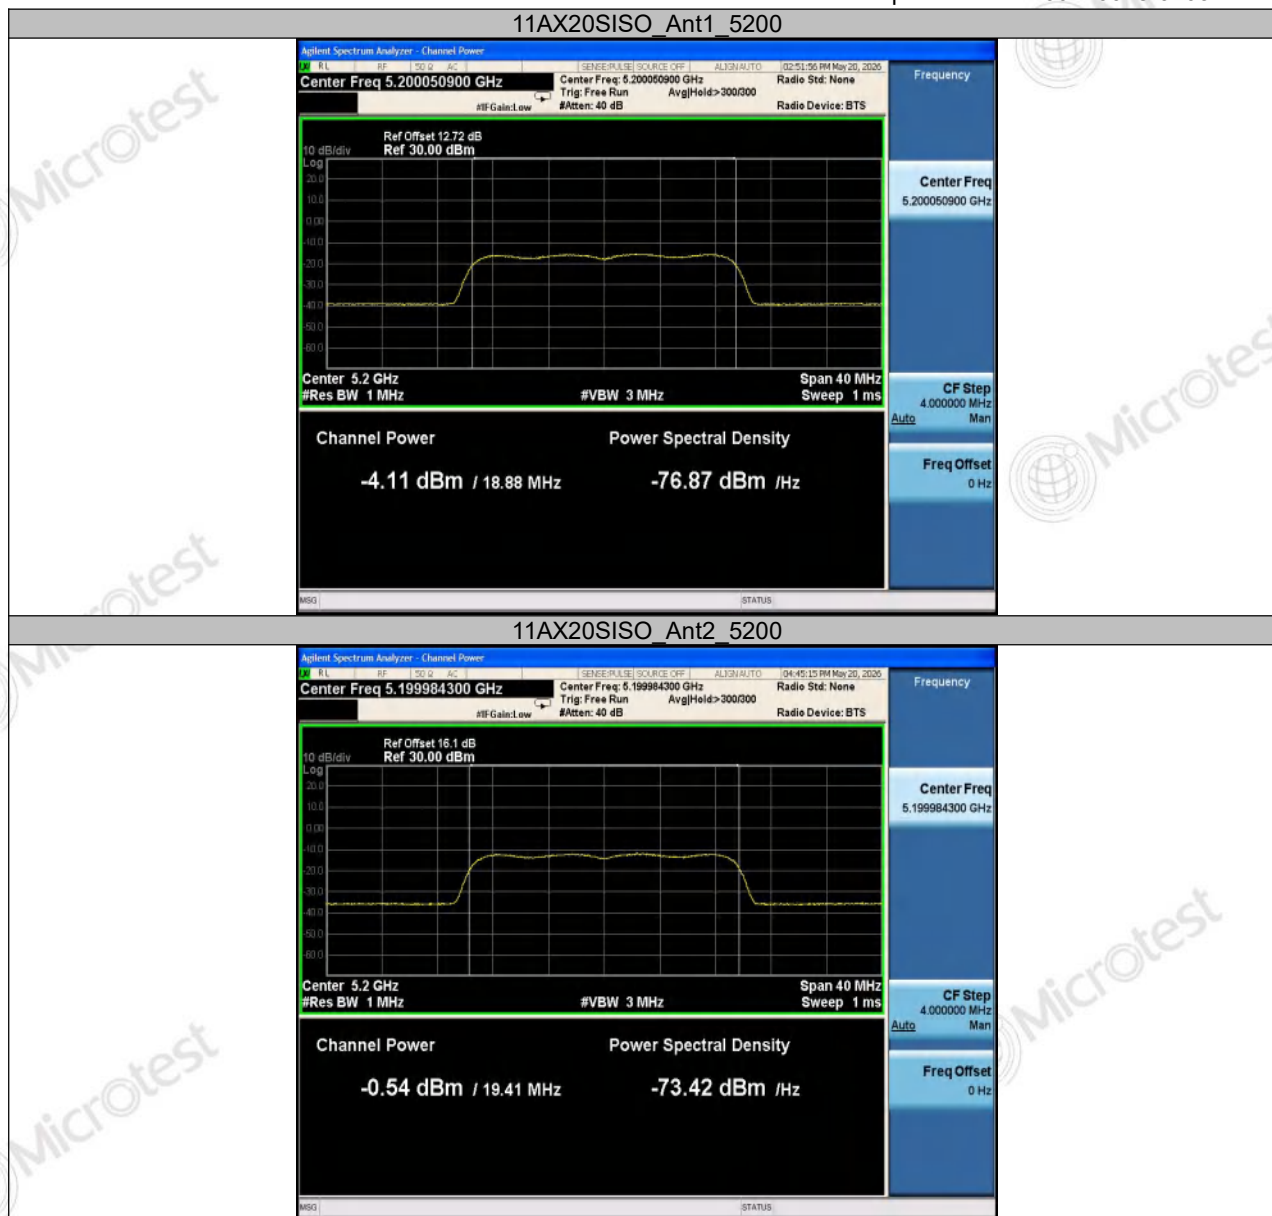


TEST REPORT

Report No.: MTi260410018-0203E4

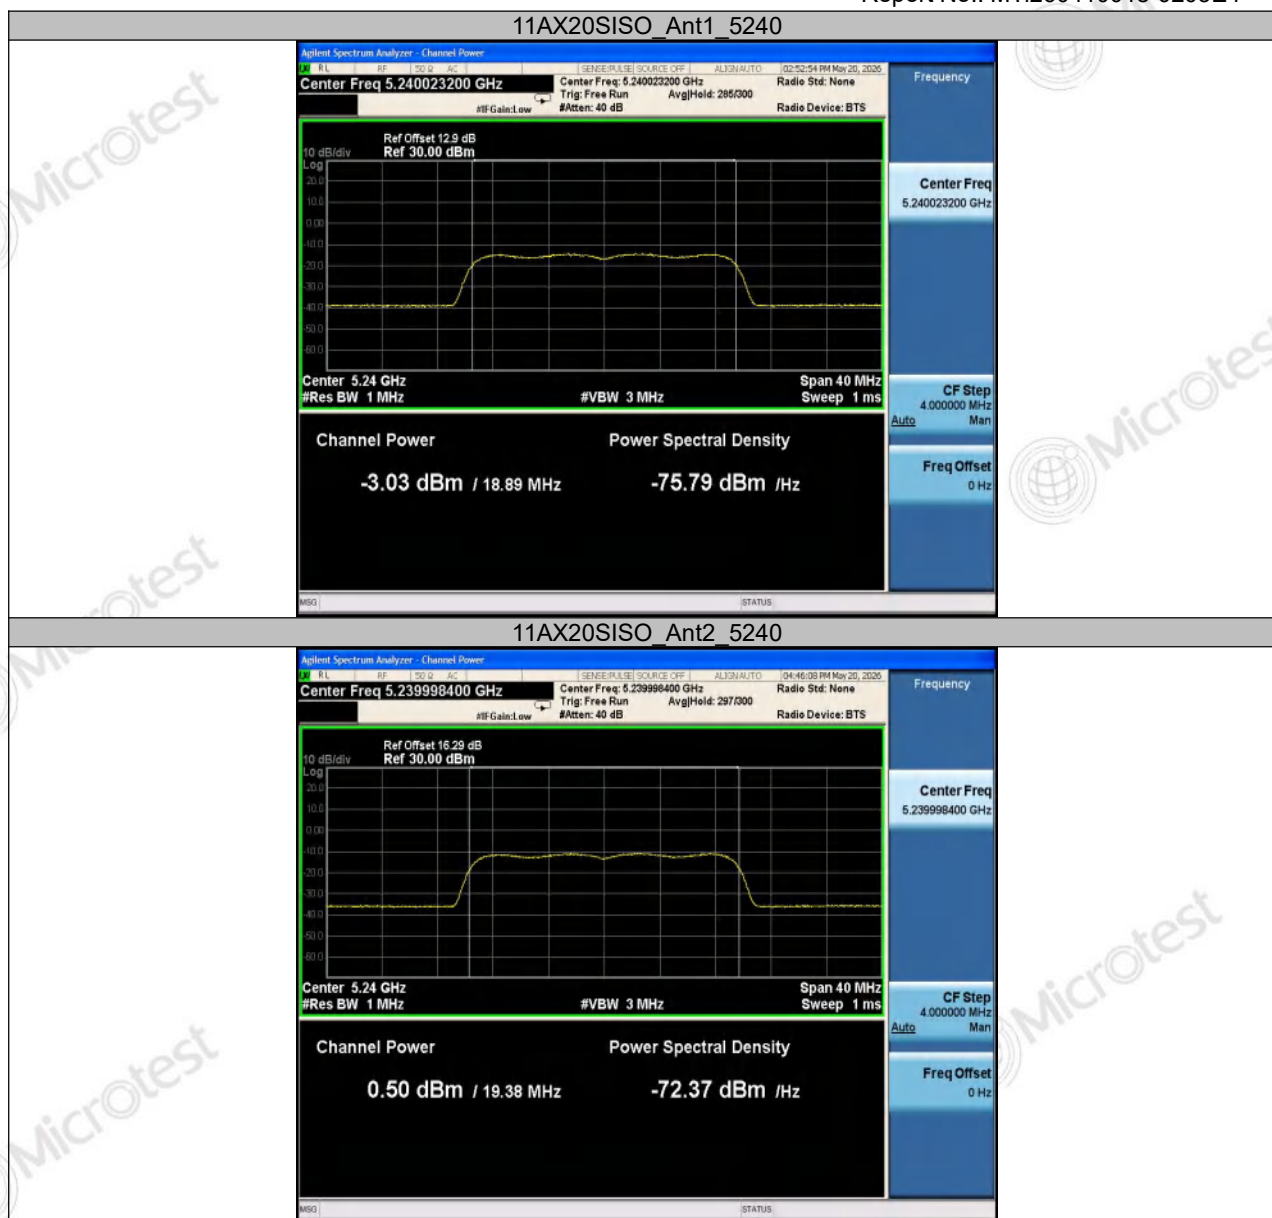


TEST REPORT

Report No.: MTi260410018-0203E4

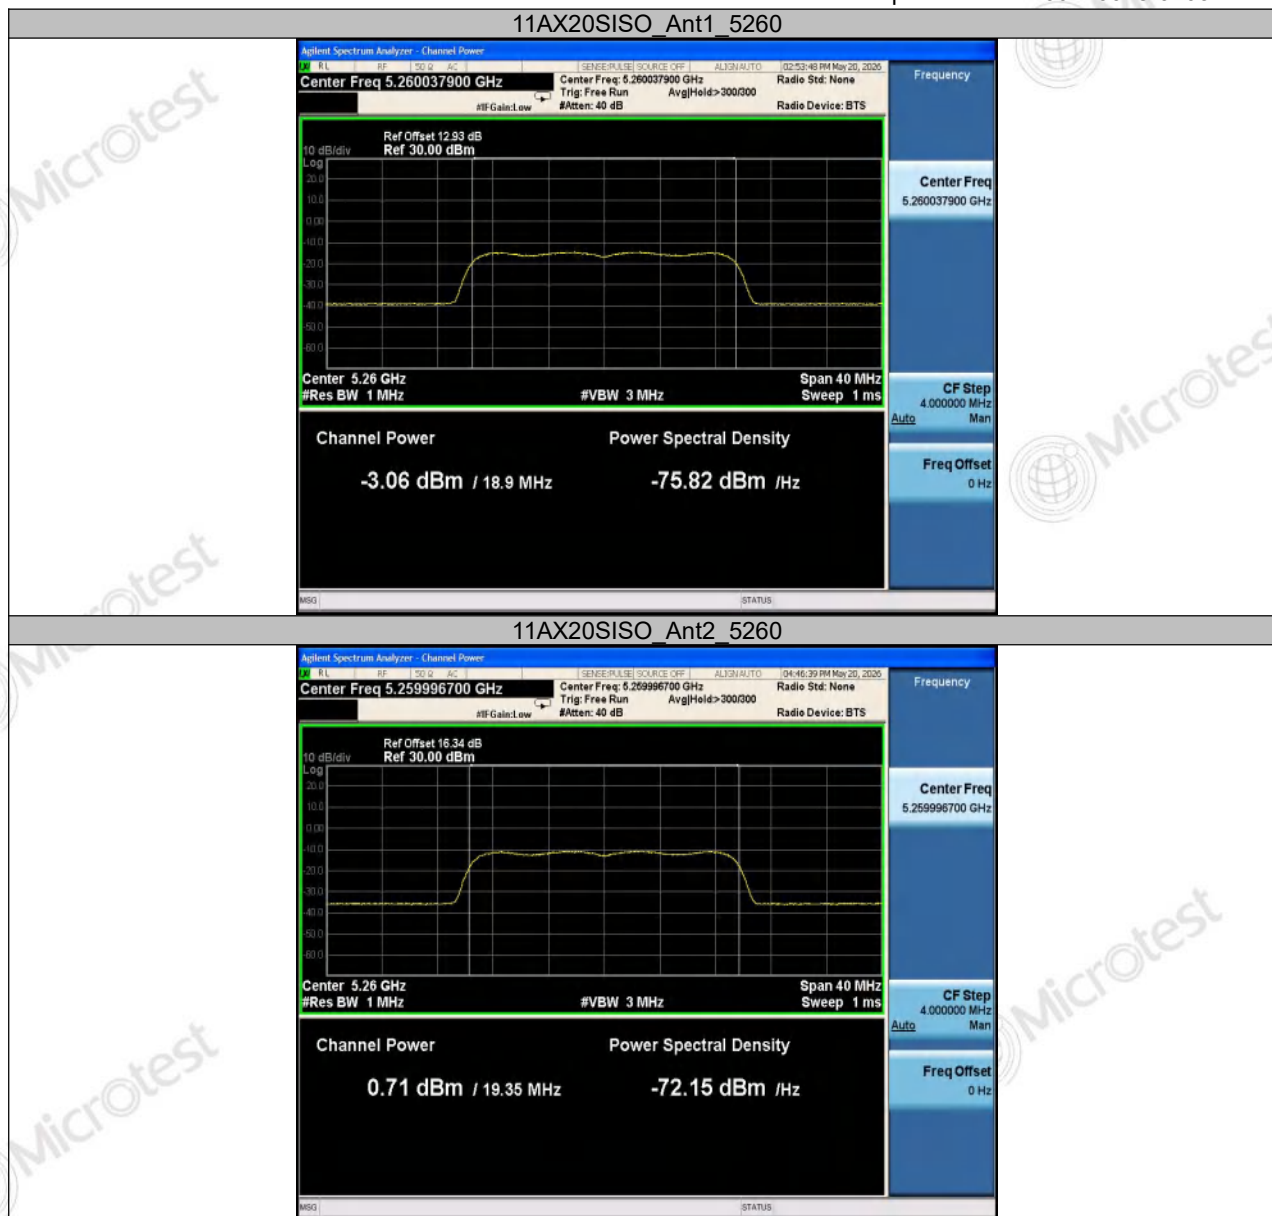


TEST REPORT

Report No.: MTi260410018-0203E4

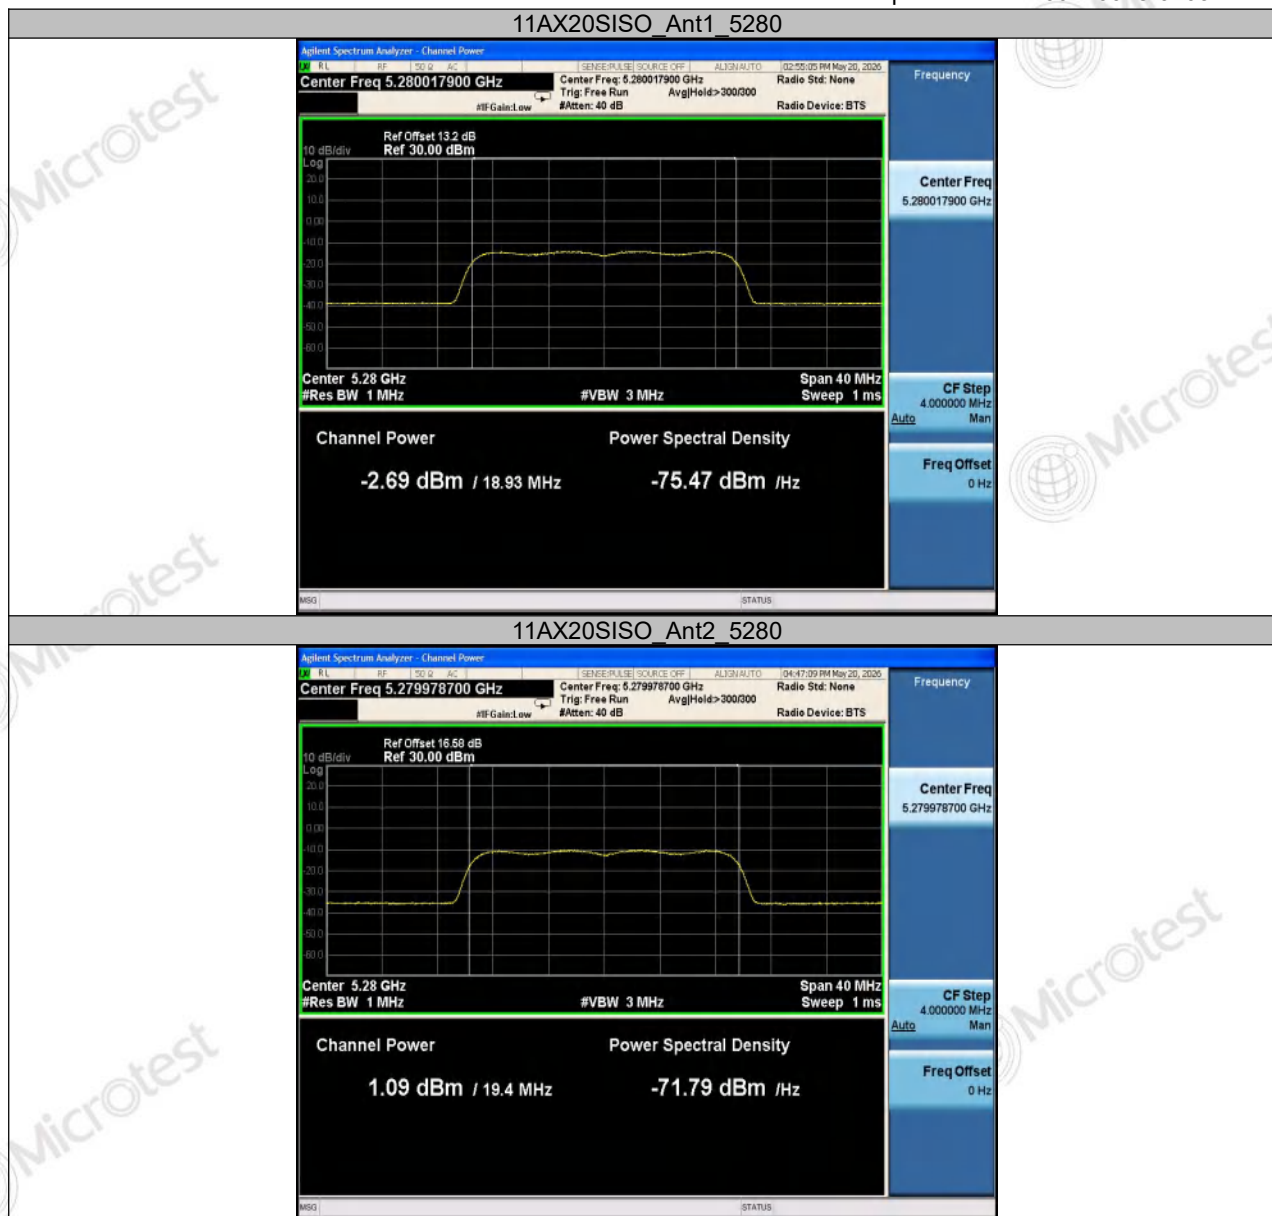


TEST REPORT

Report No.: MTi260410018-0203E4

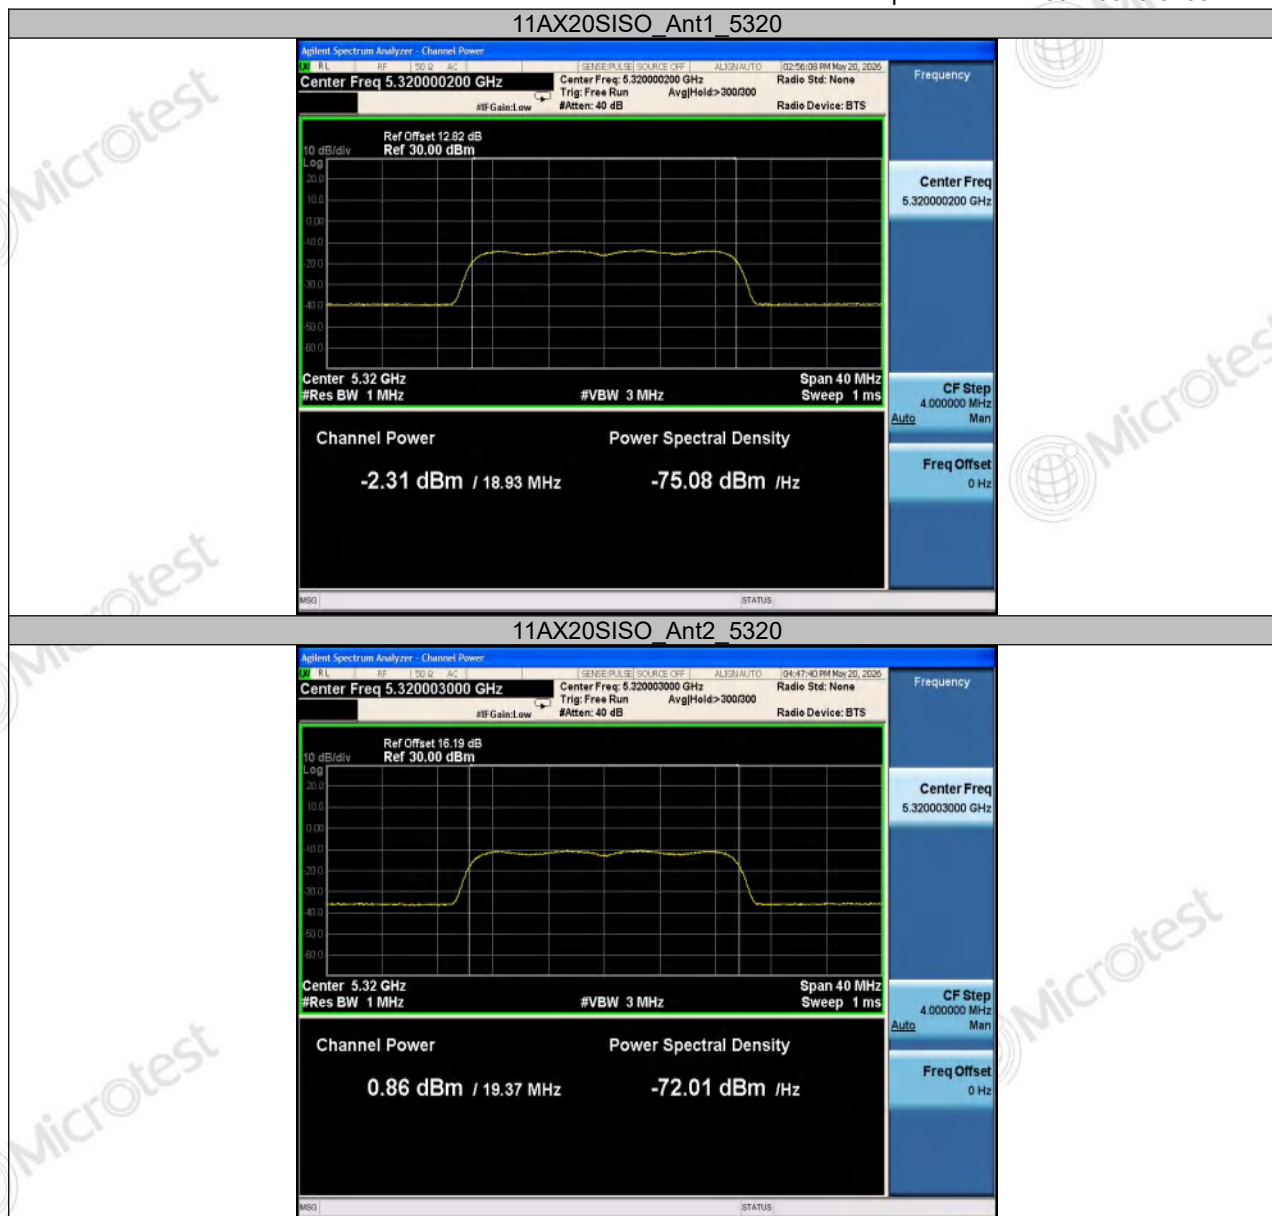


TEST REPORT

Report No.: MTi260410018-0203E4

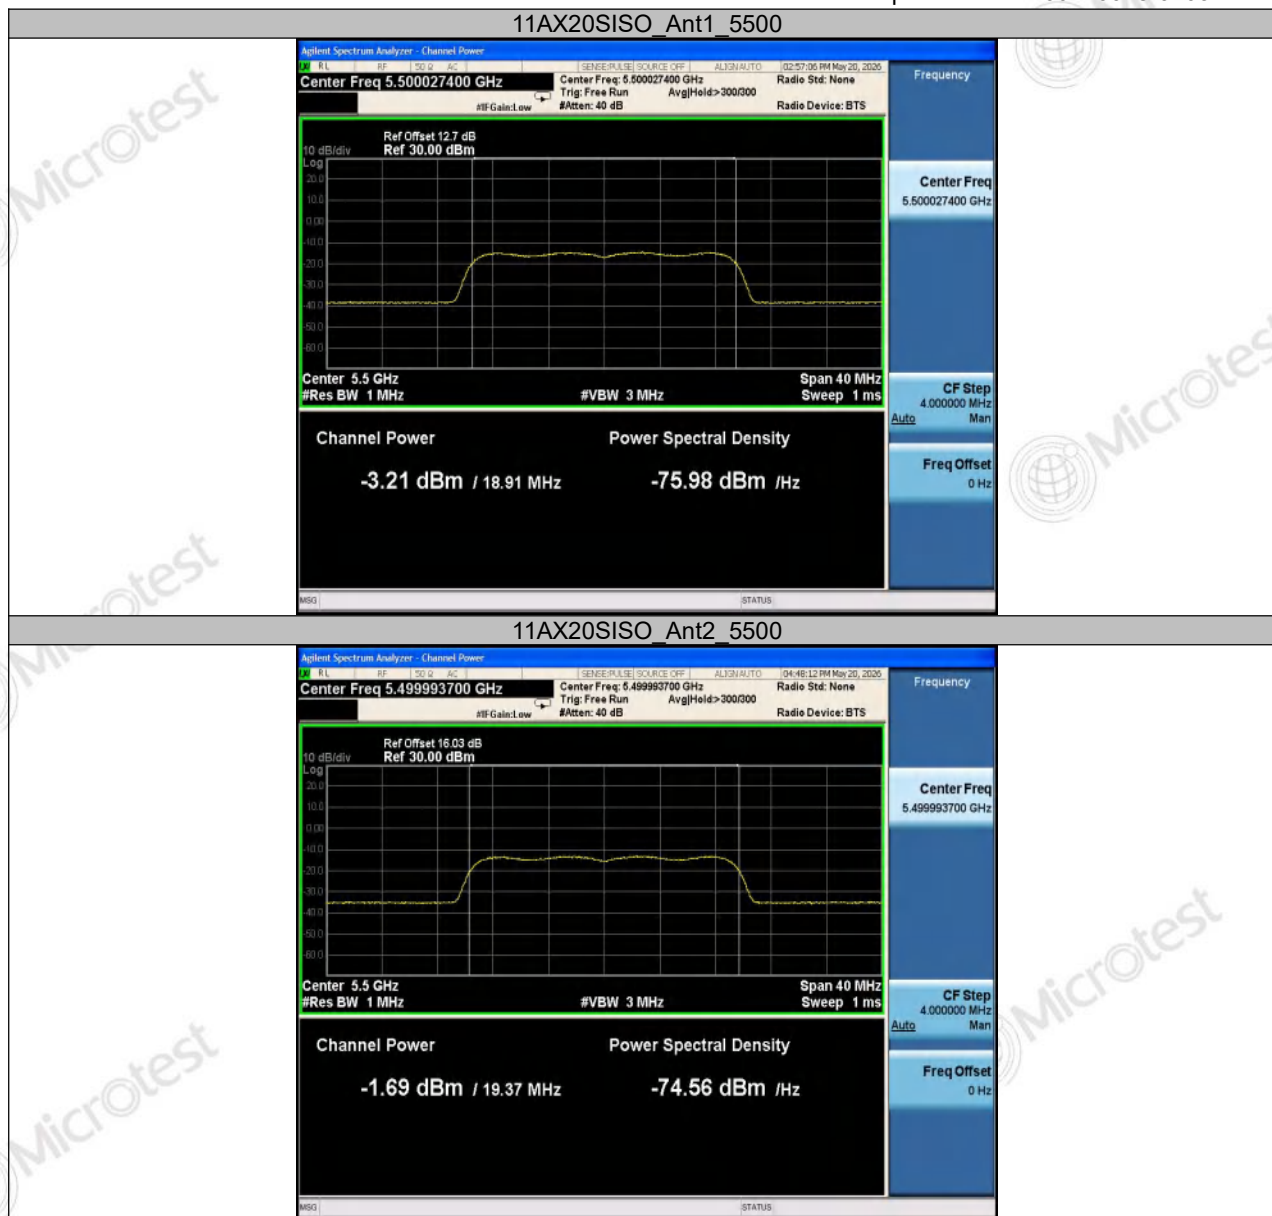


TEST REPORT

Report No.: MTi260410018-0203E4

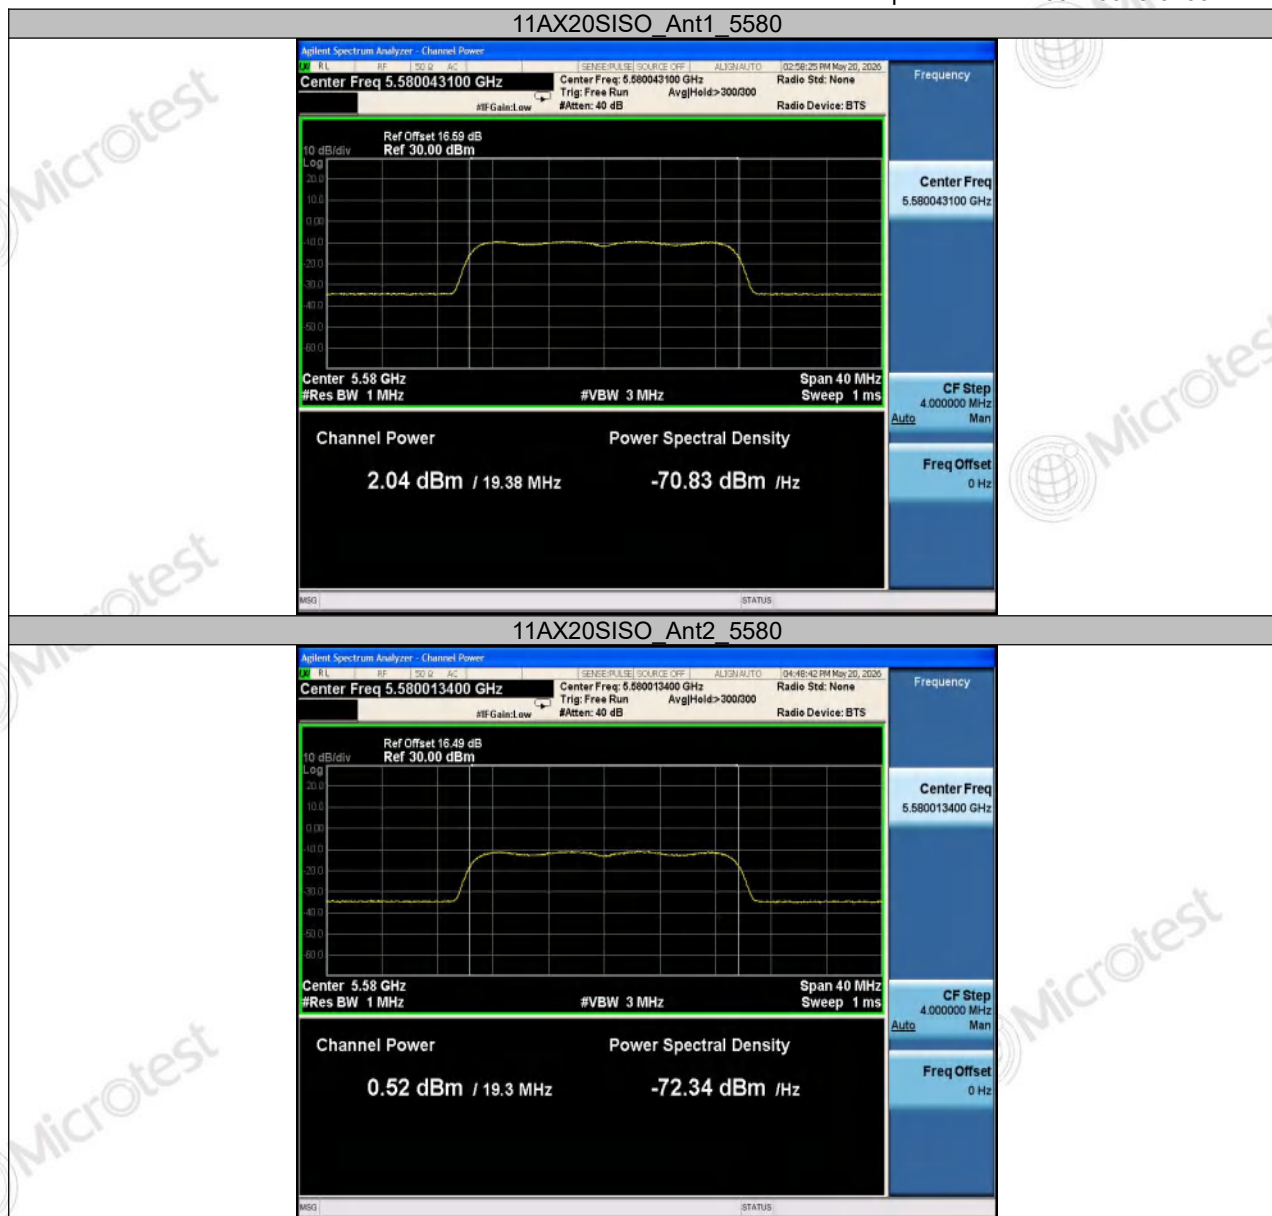


TEST REPORT

Report No.: MTi260410018-0203E4

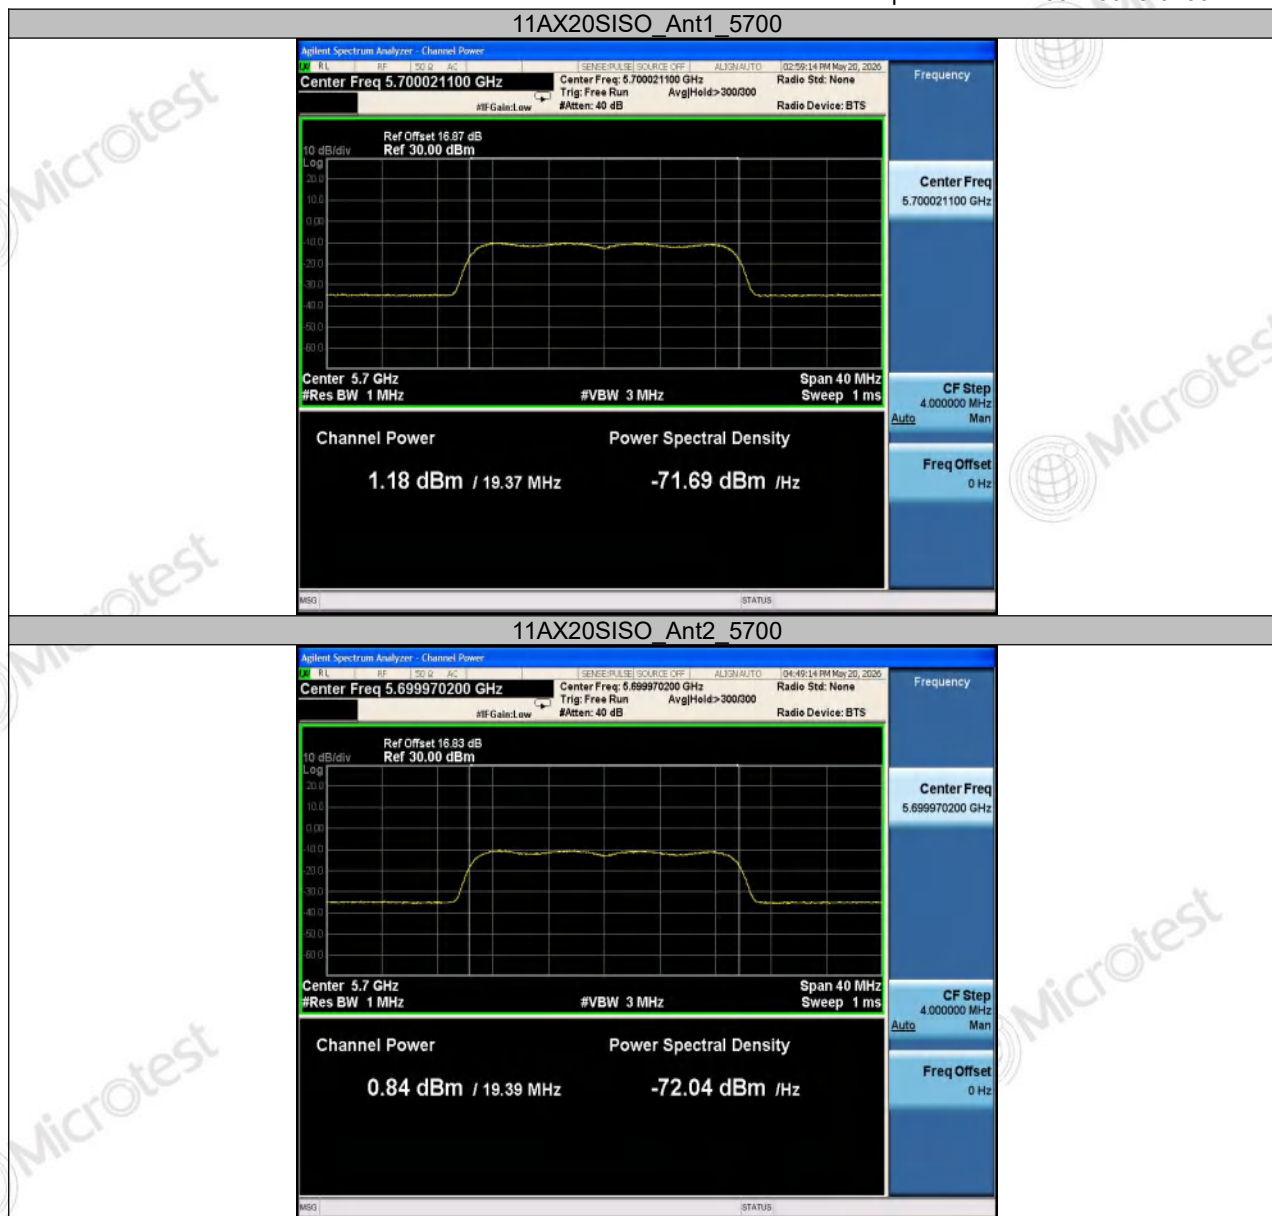


TEST REPORT

Report No.: MTi260410018-0203E4

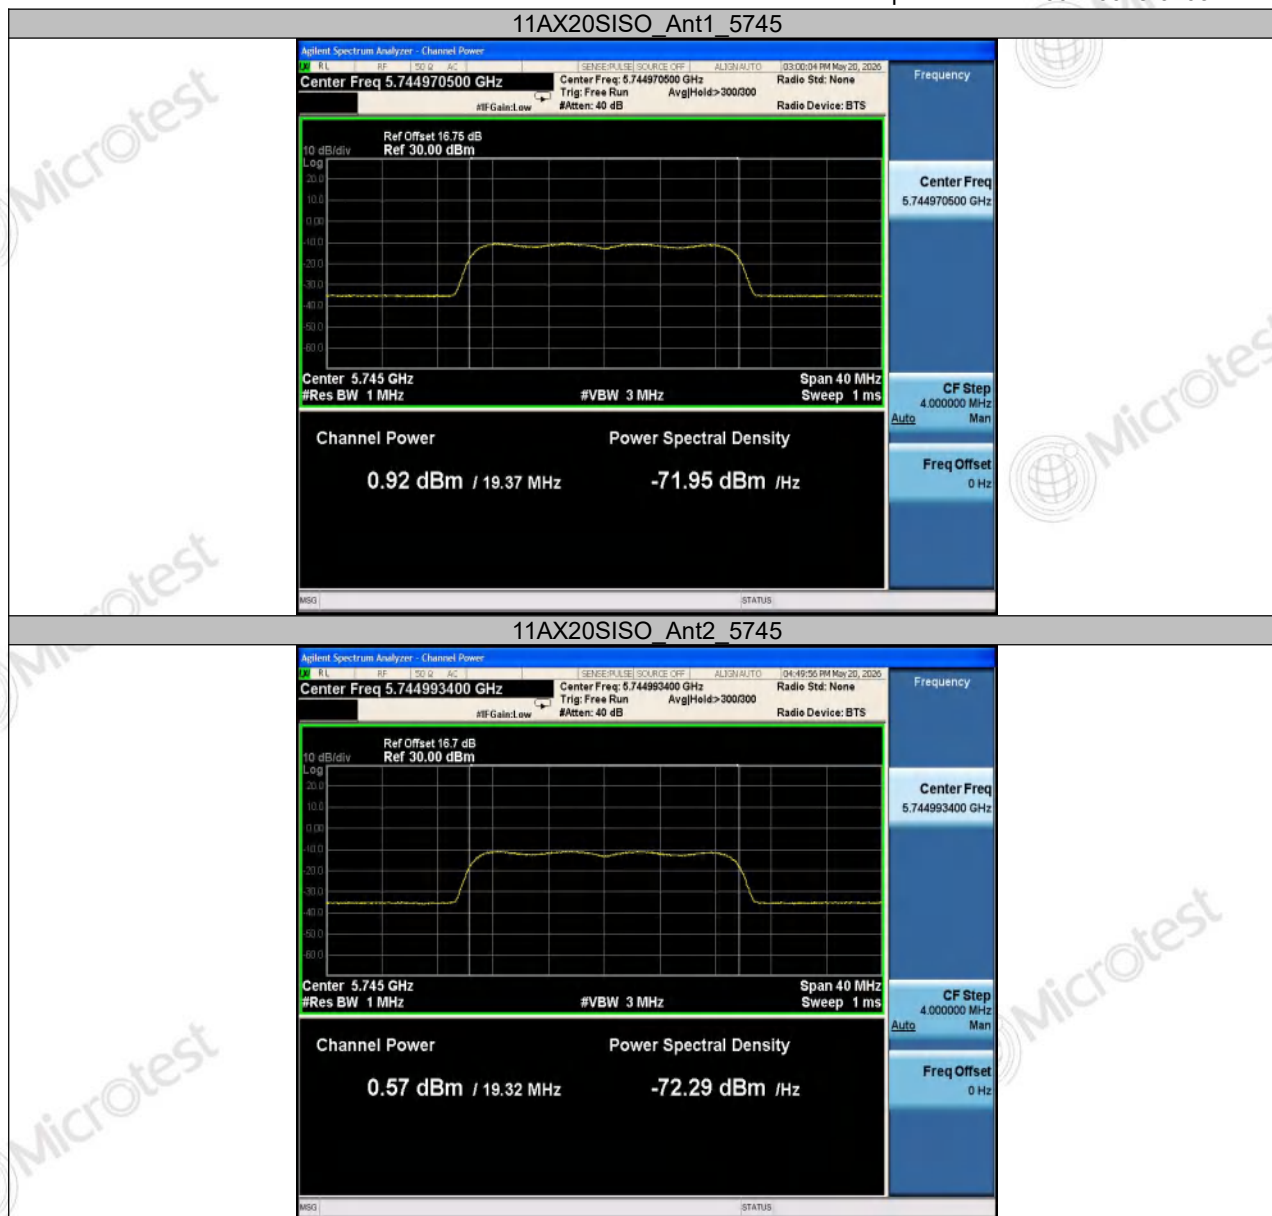


TEST REPORT

Report No.: MTi260410018-0203E4

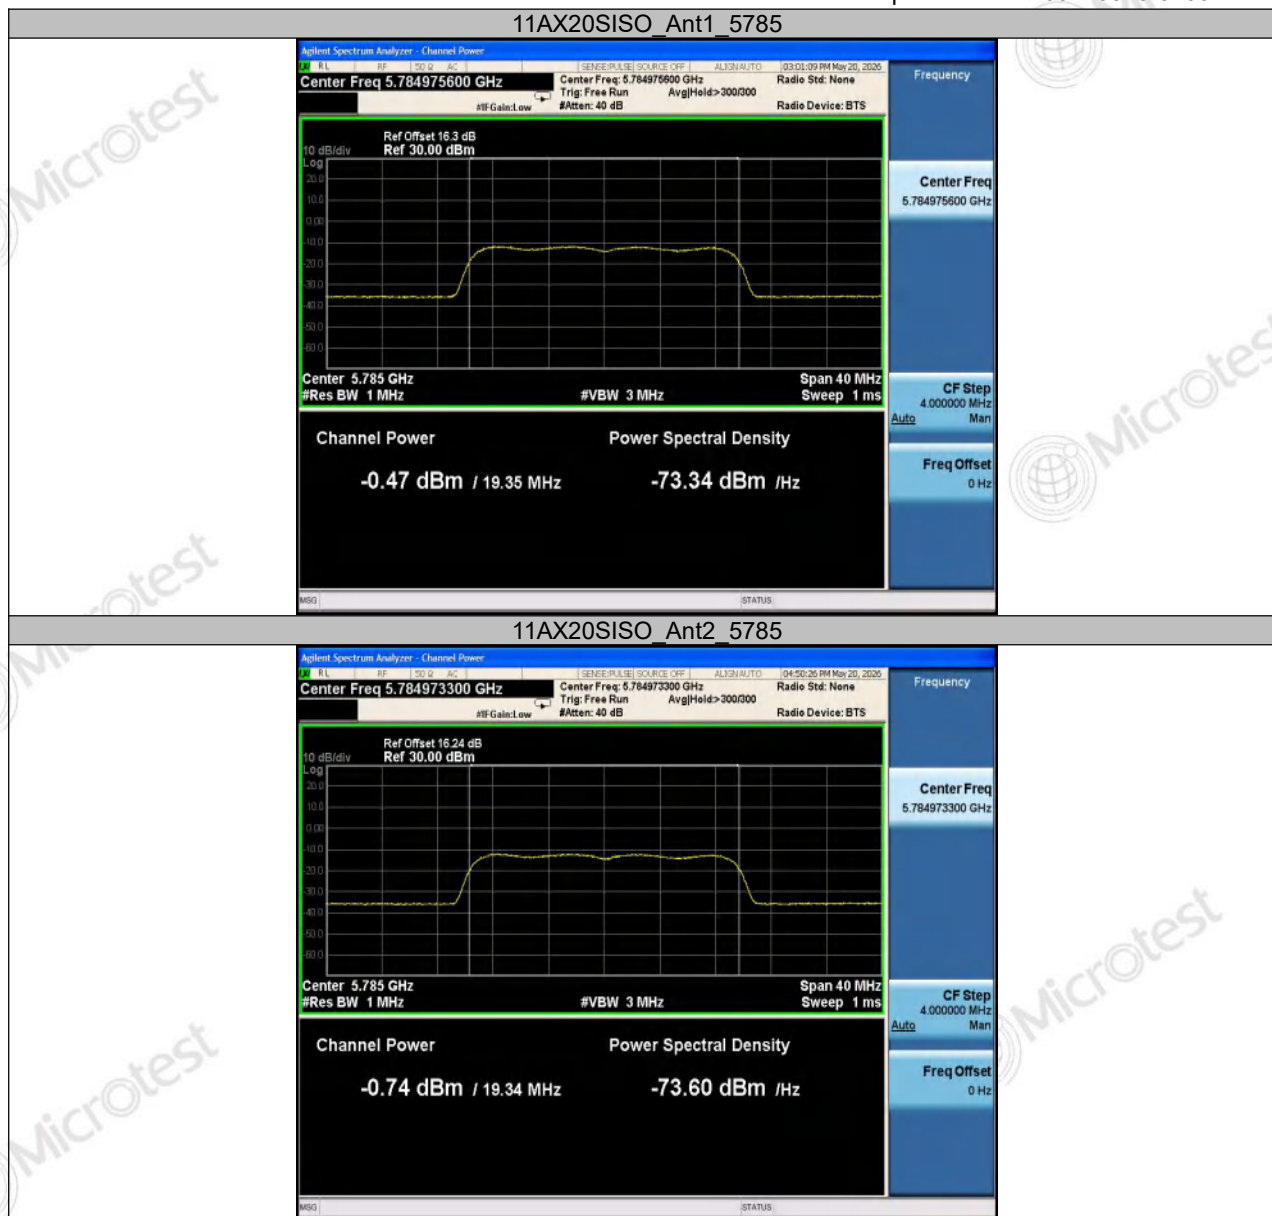


TEST REPORT

Report No.: MTi260410018-0203E4

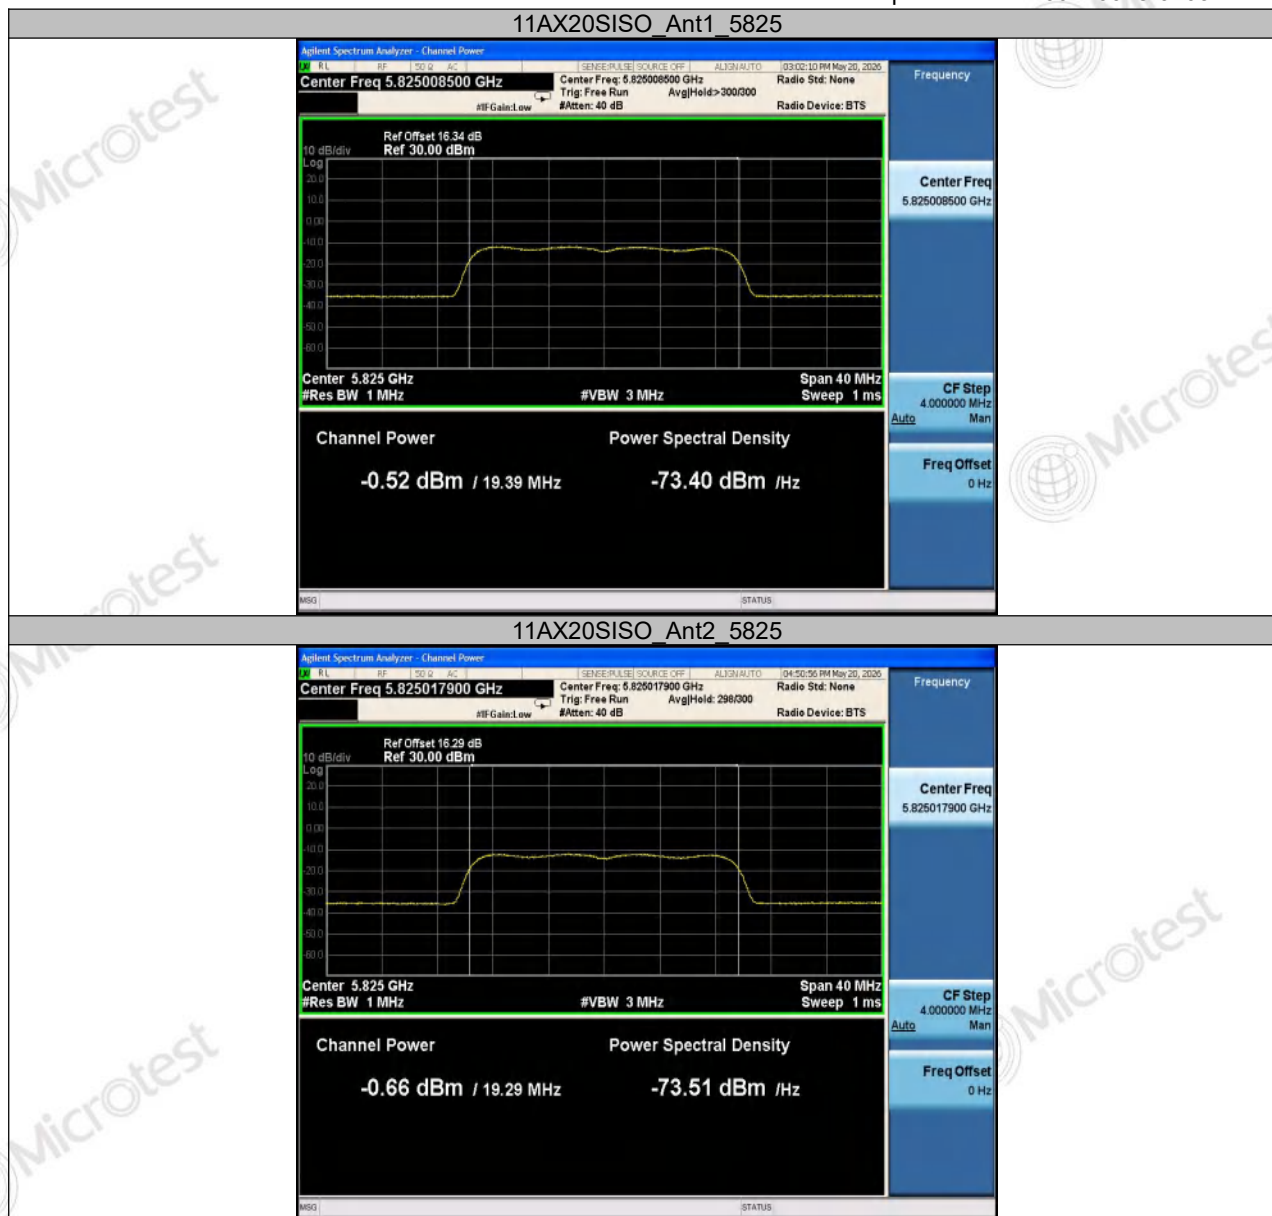


TEST REPORT

Report No.: MTi260410018-0203E4

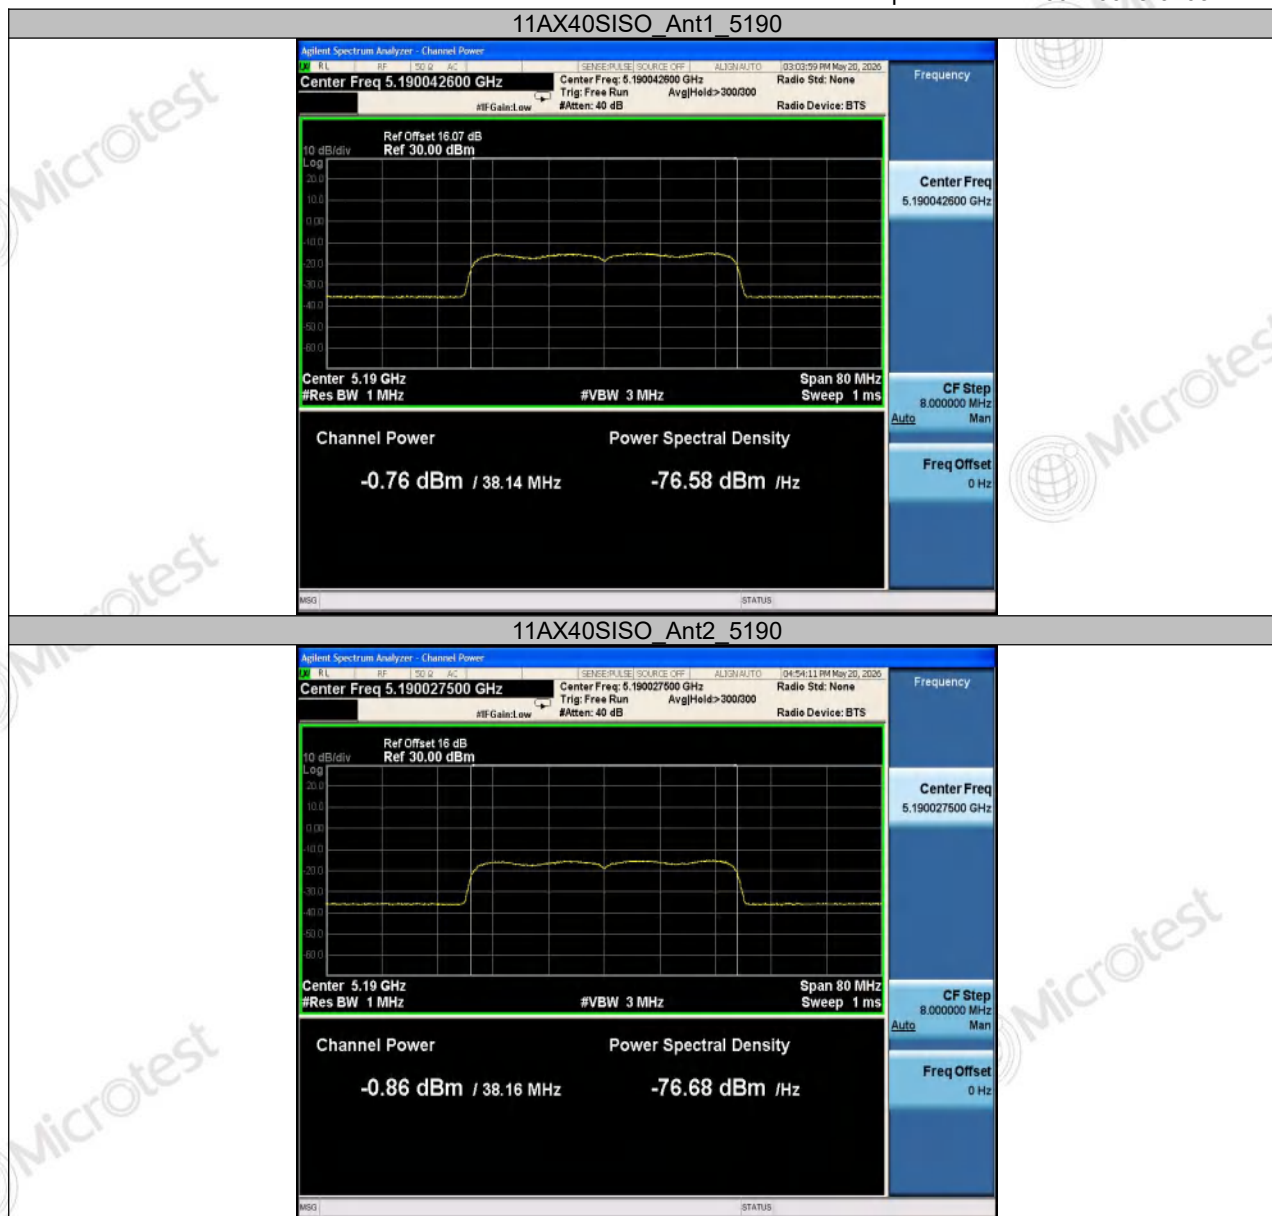


TEST REPORT

Report No.: MTi260410018-0203E4

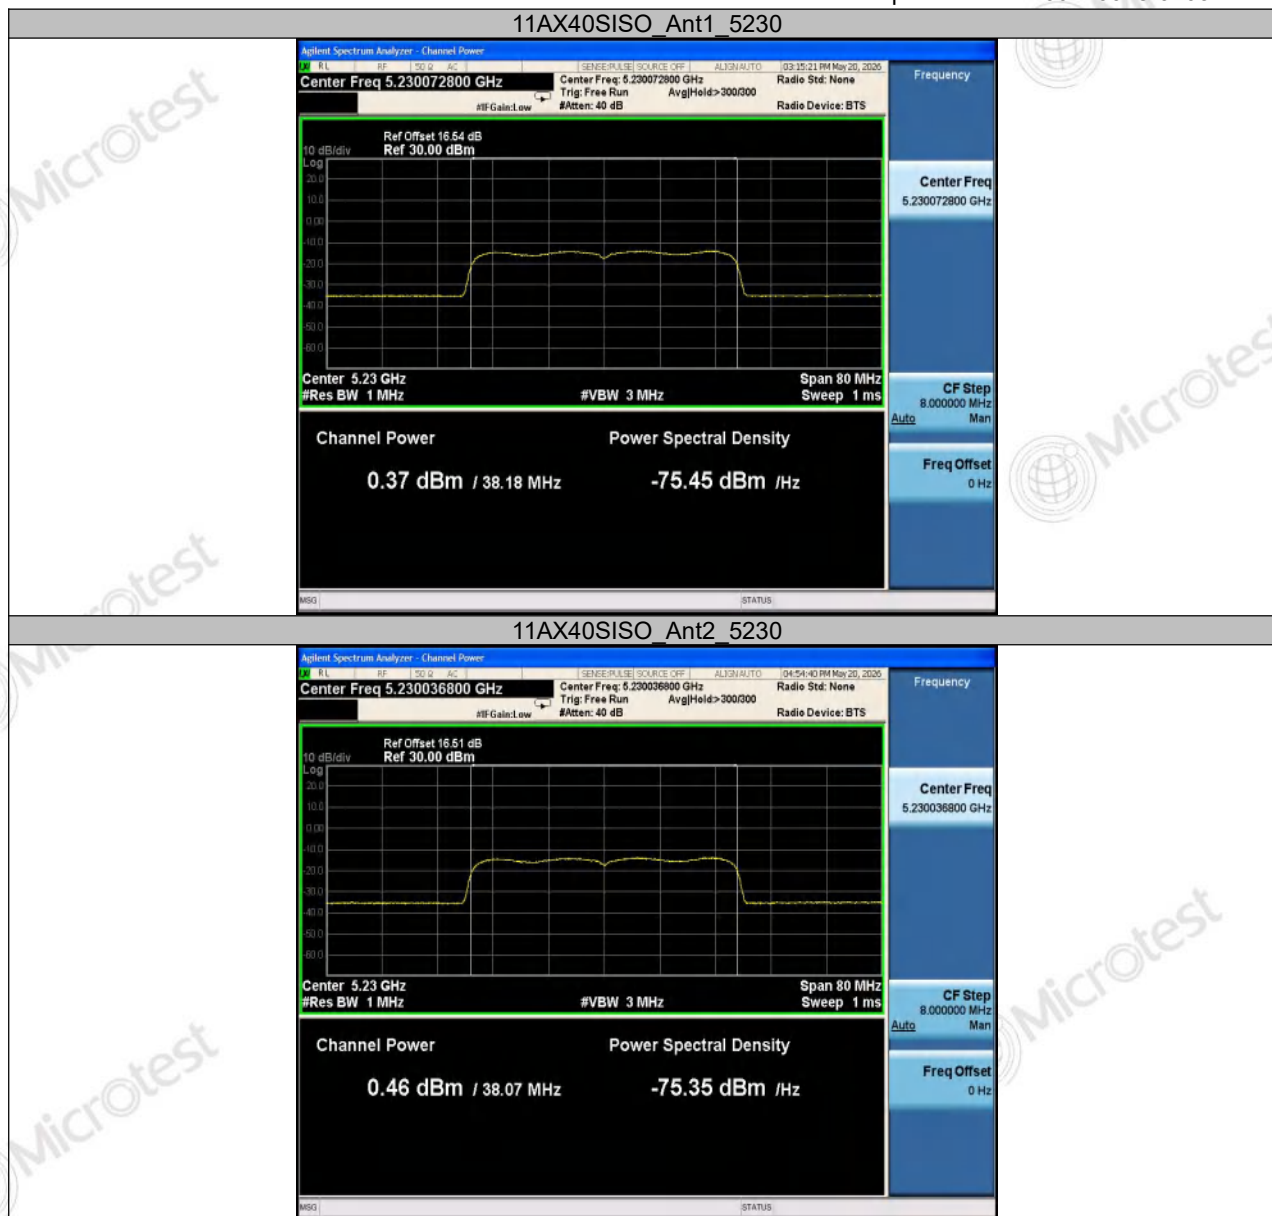


TEST REPORT

Report No.: MTi260410018-0203E4

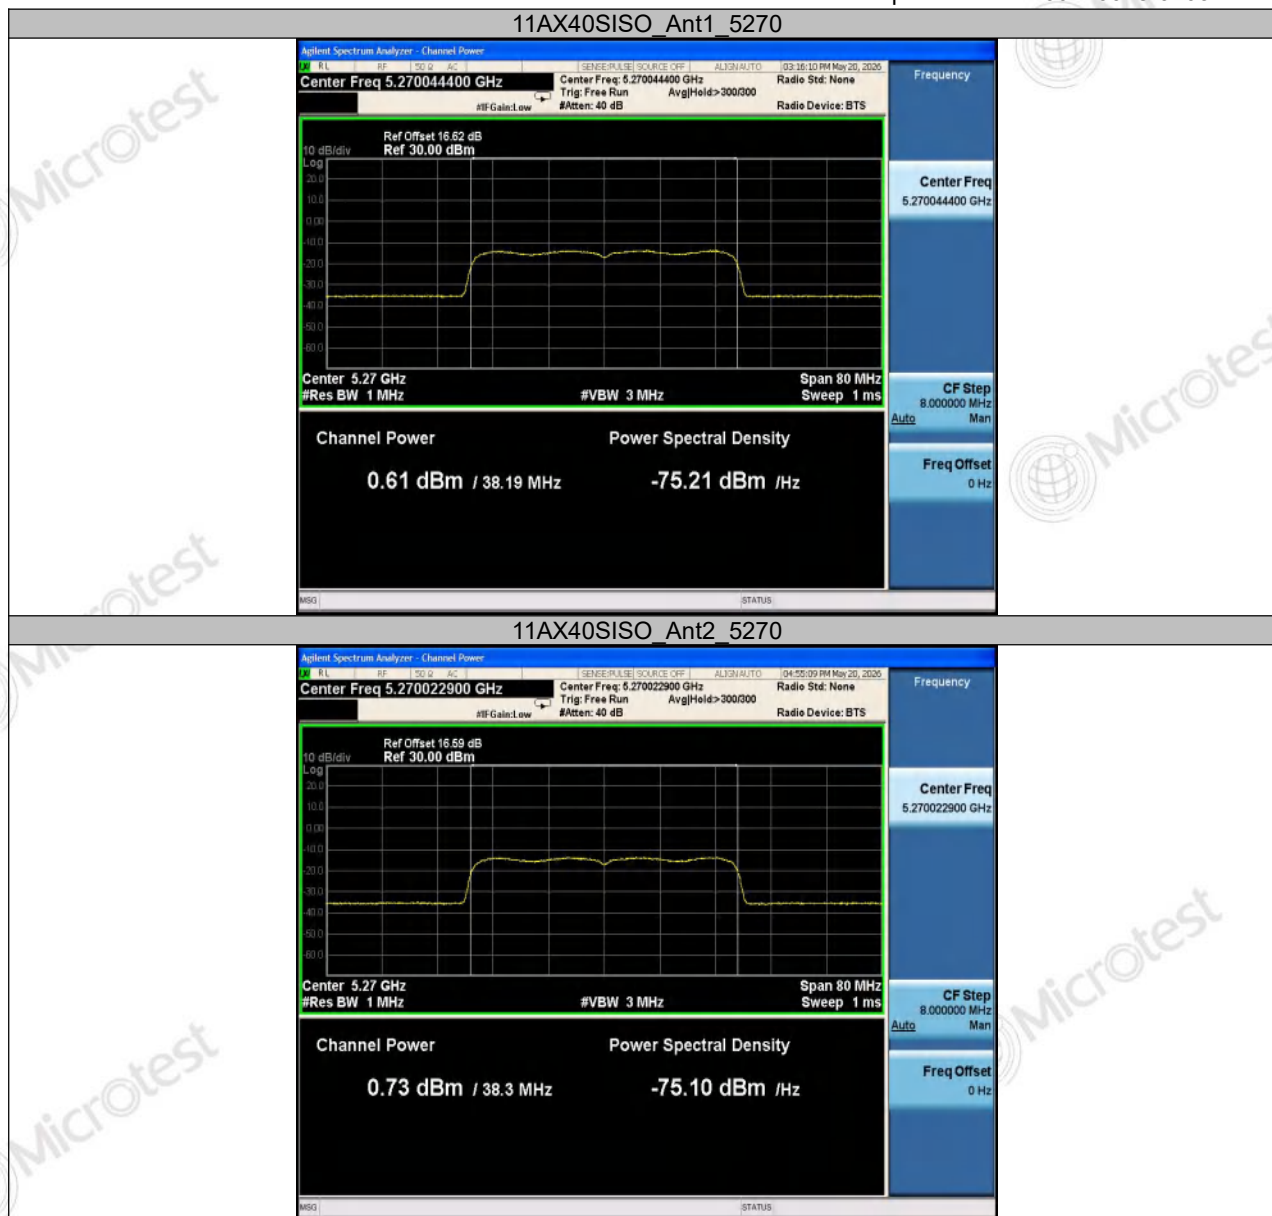


TEST REPORT

Report No.: MTi260410018-0203E4

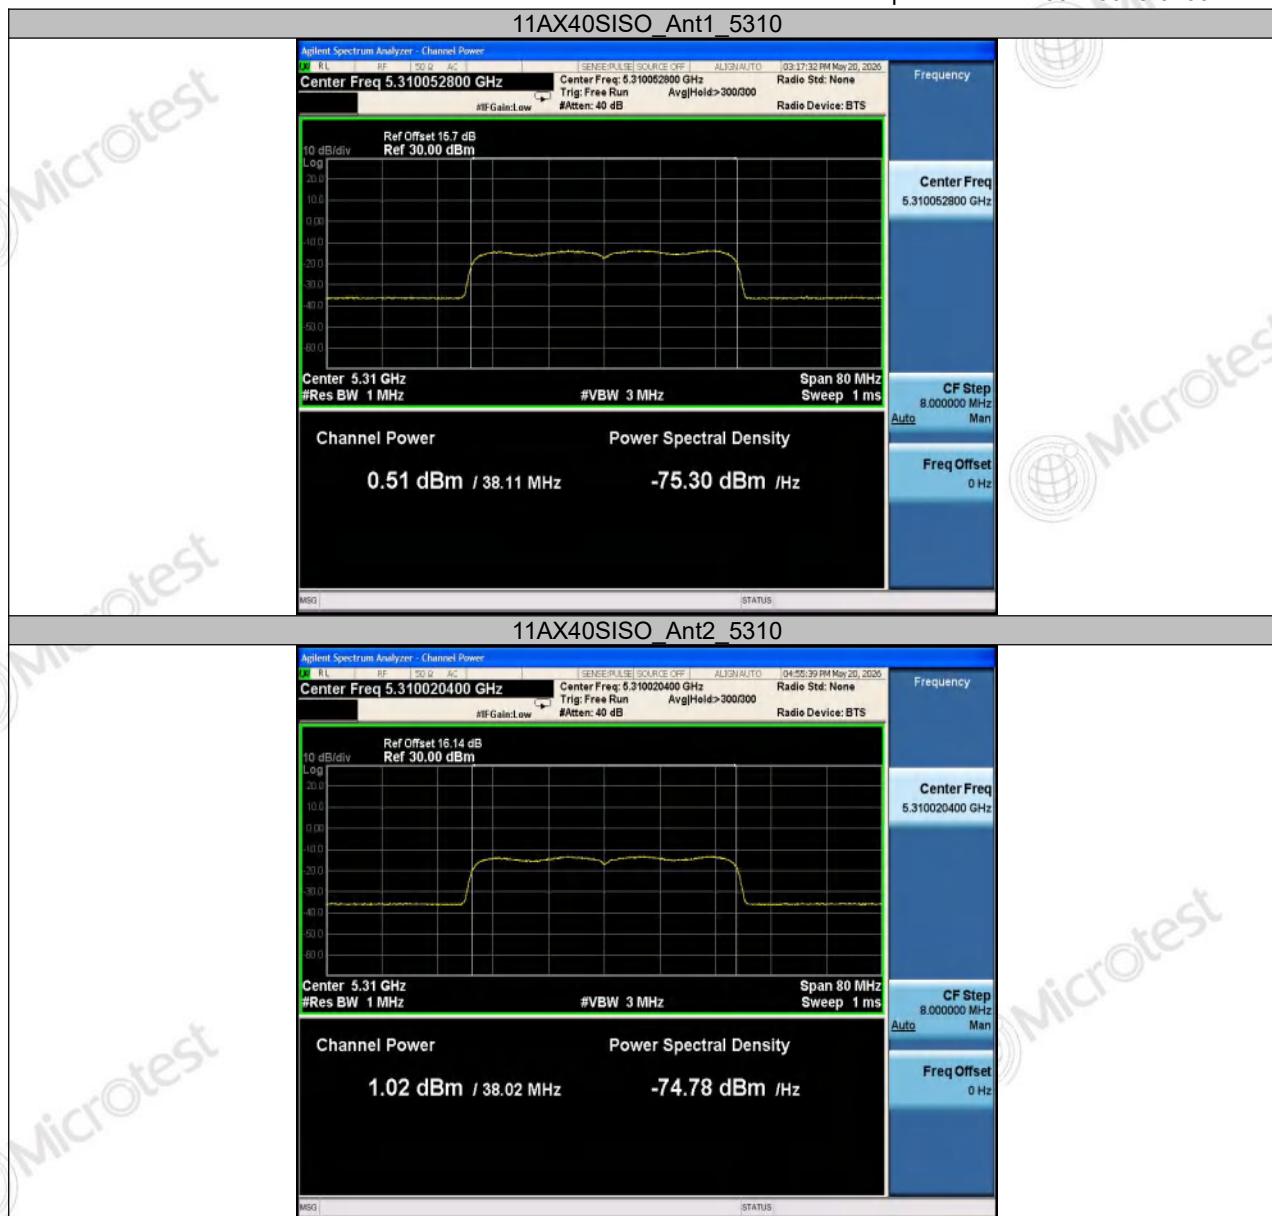


TEST REPORT

Report No.: MTi260410018-0203E4

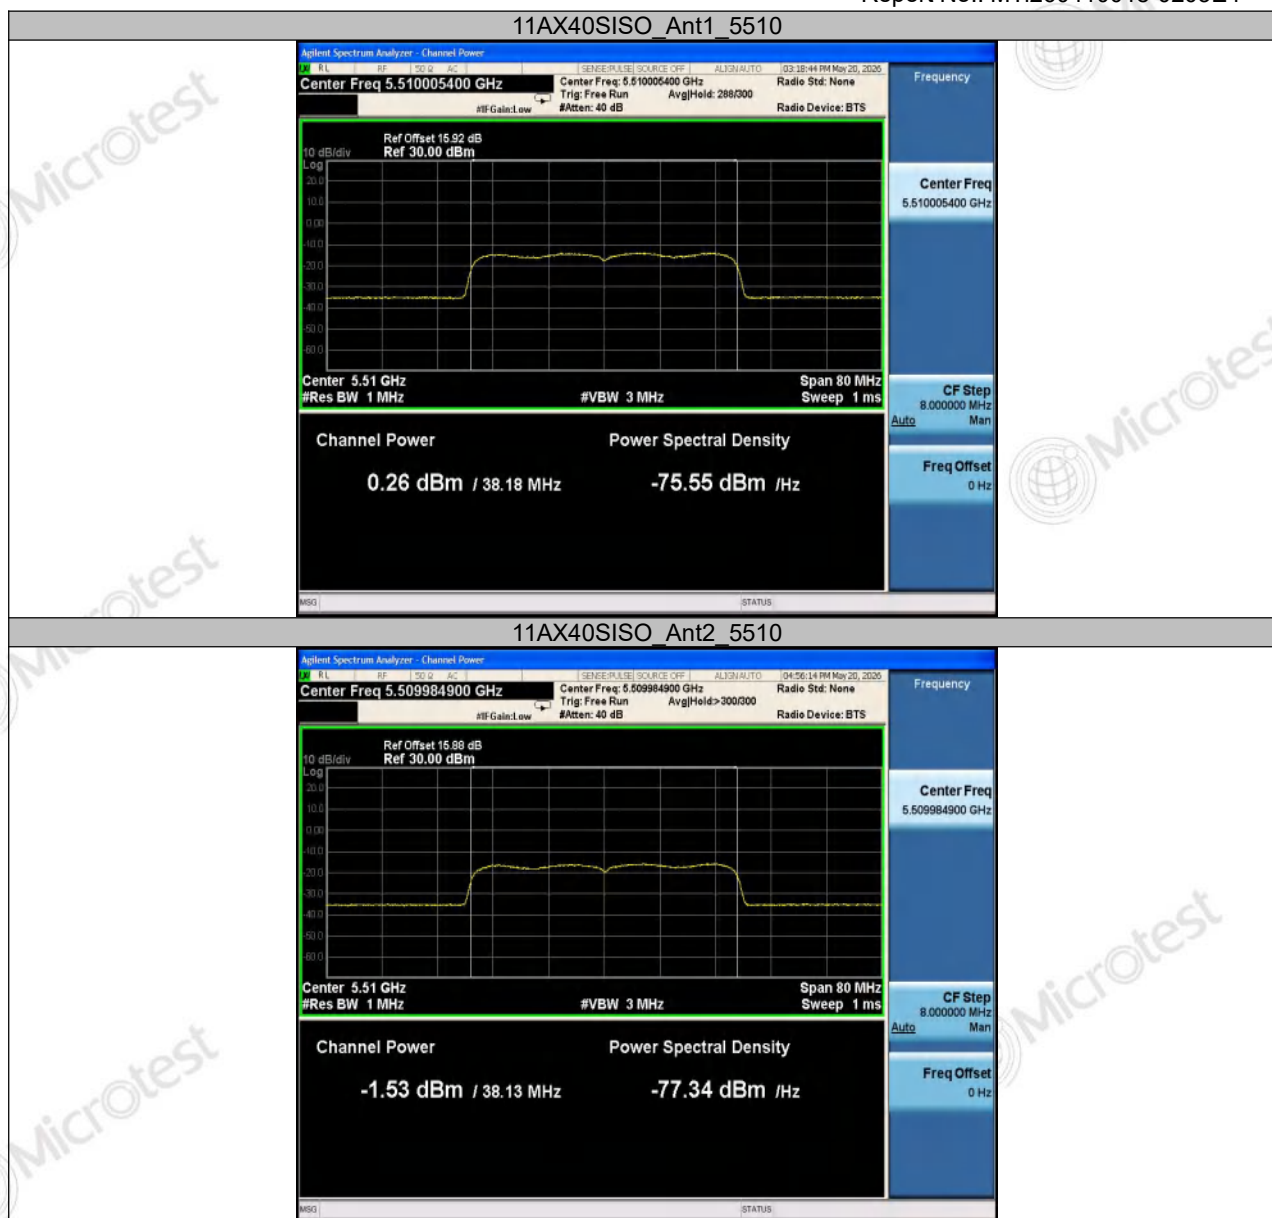


TEST REPORT

Report No.: MTi260410018-0203E4

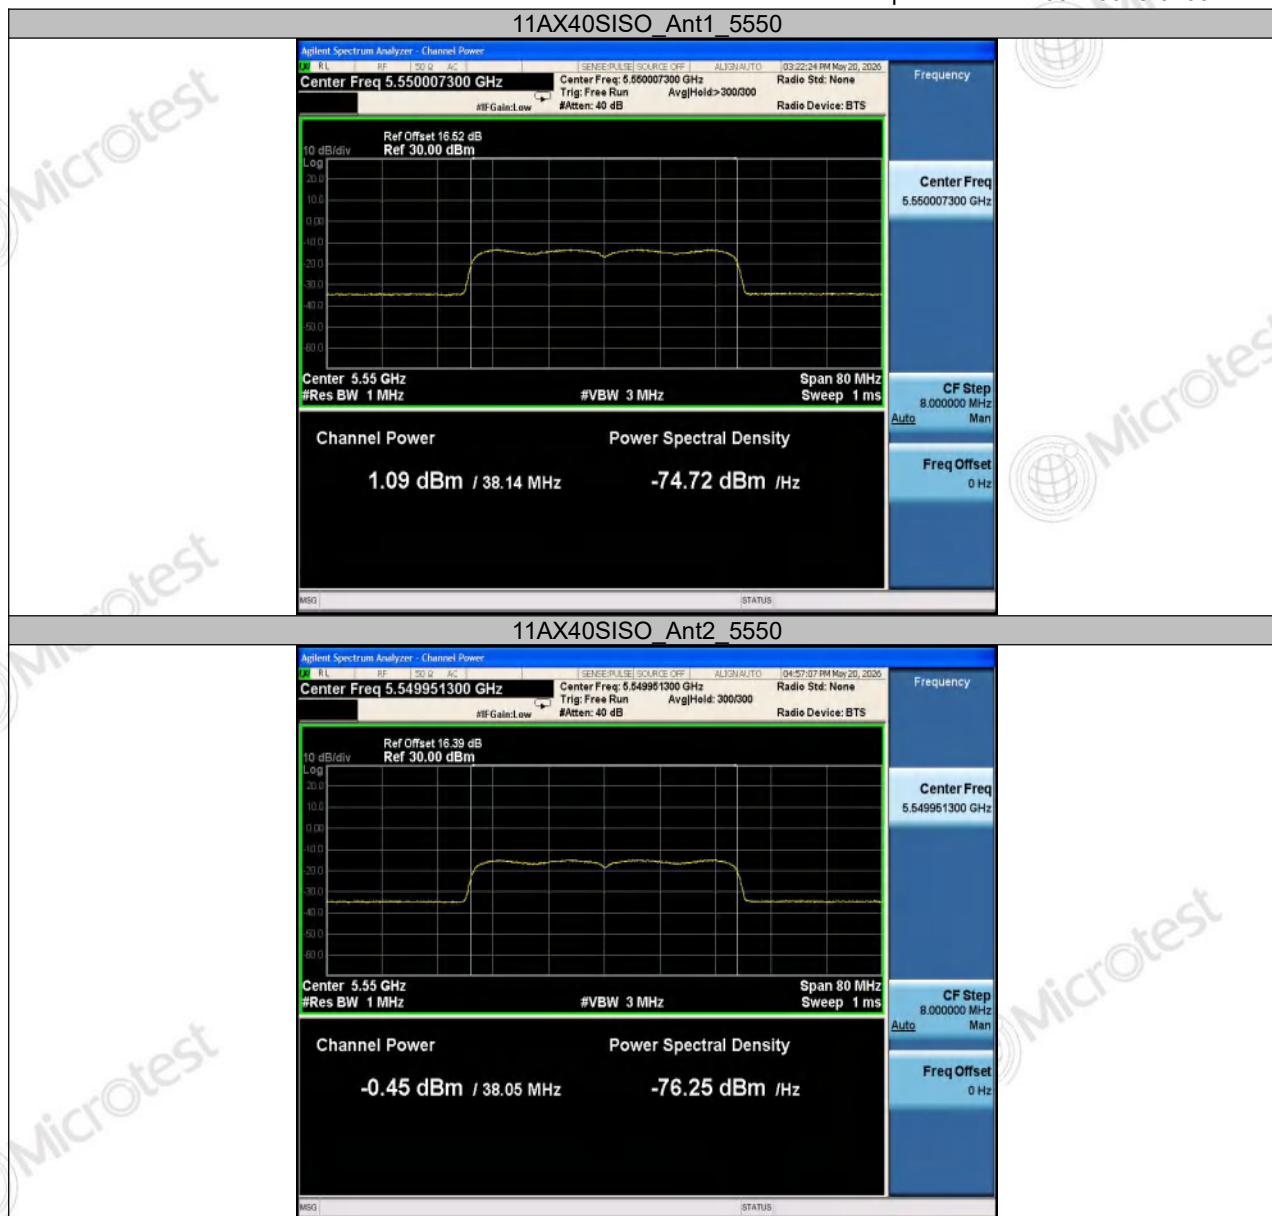


TEST REPORT

Report No.: MTi260410018-0203E4

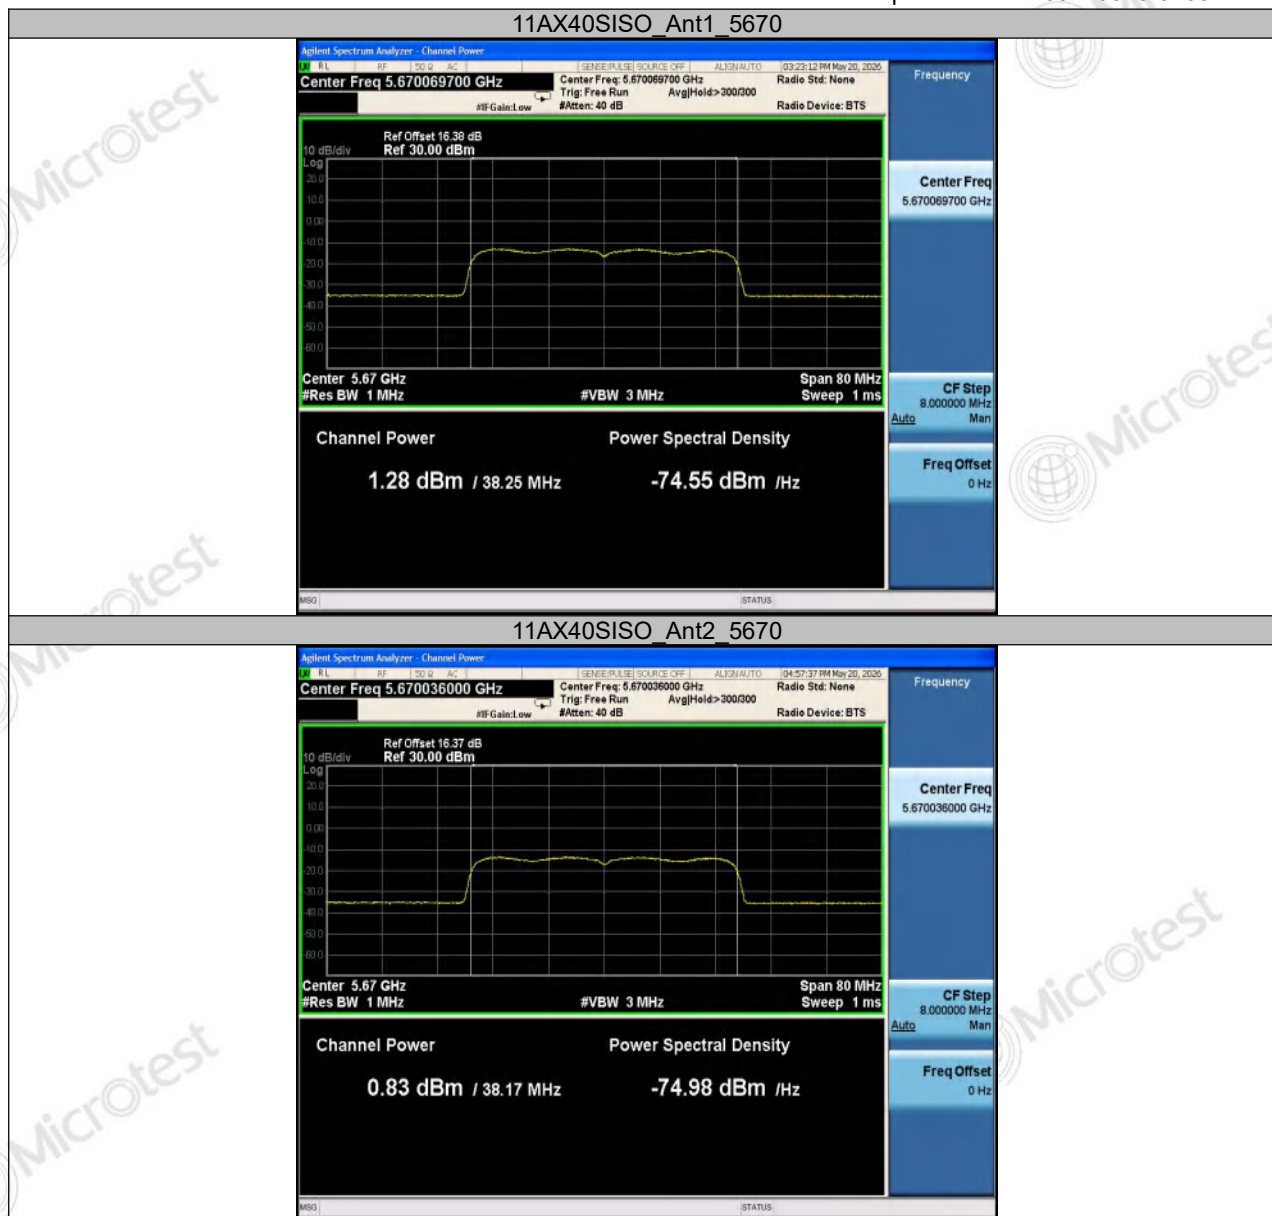


TEST REPORT

Report No.: MTi260410018-0203E4

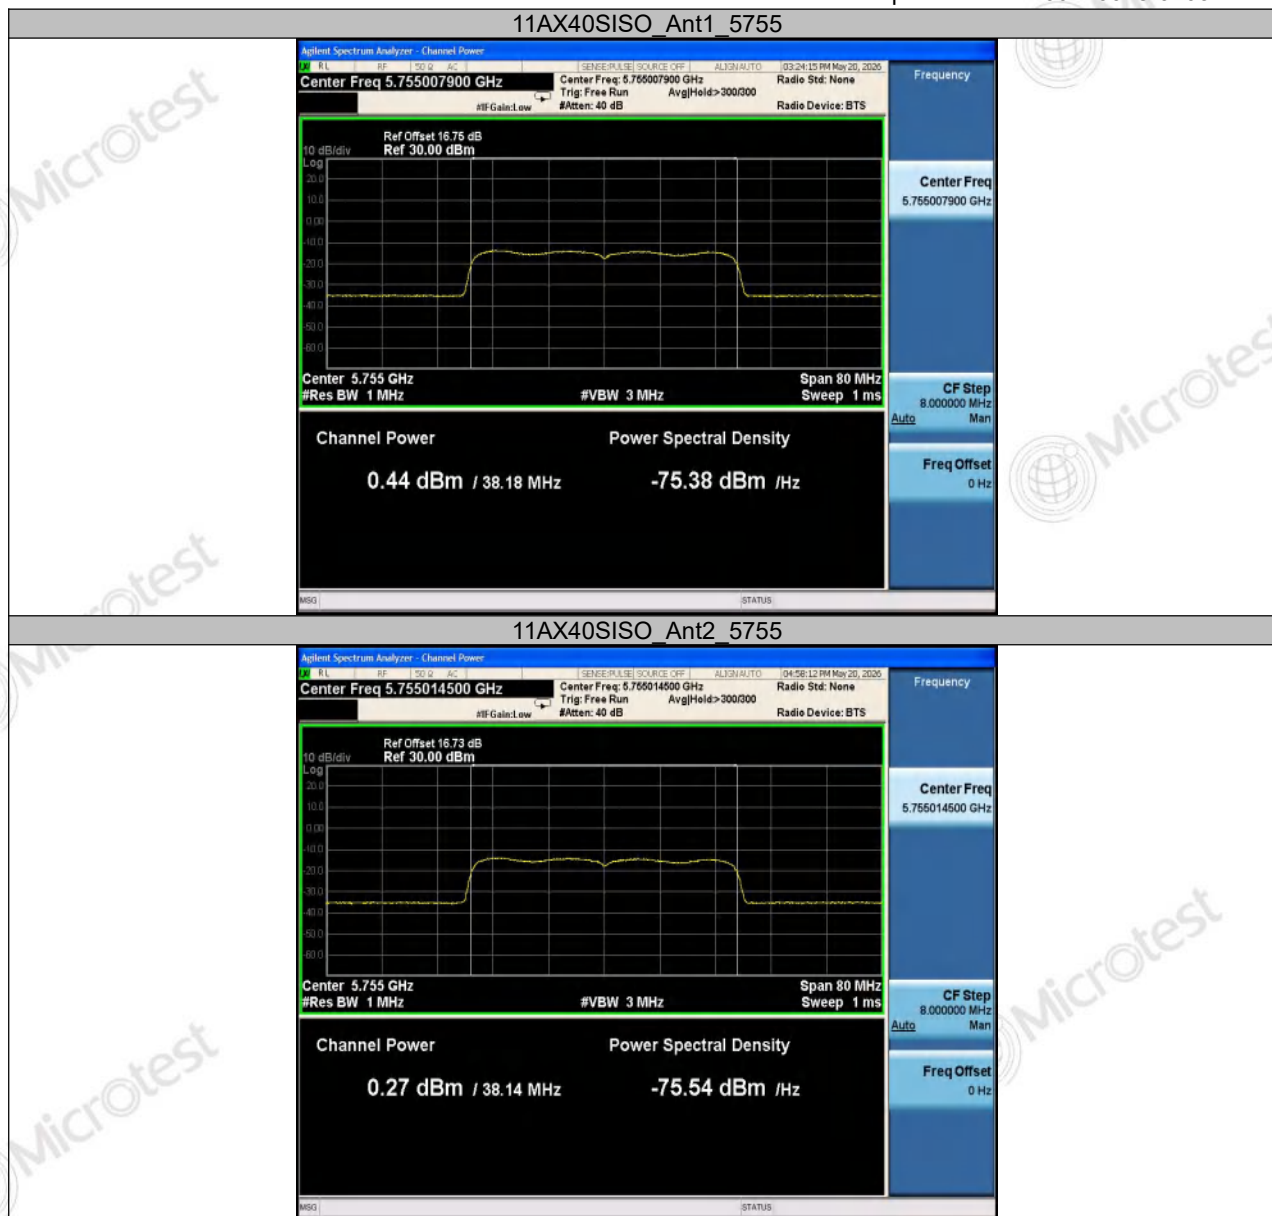


TEST REPORT

Report No.: MTI260410018-0203E4

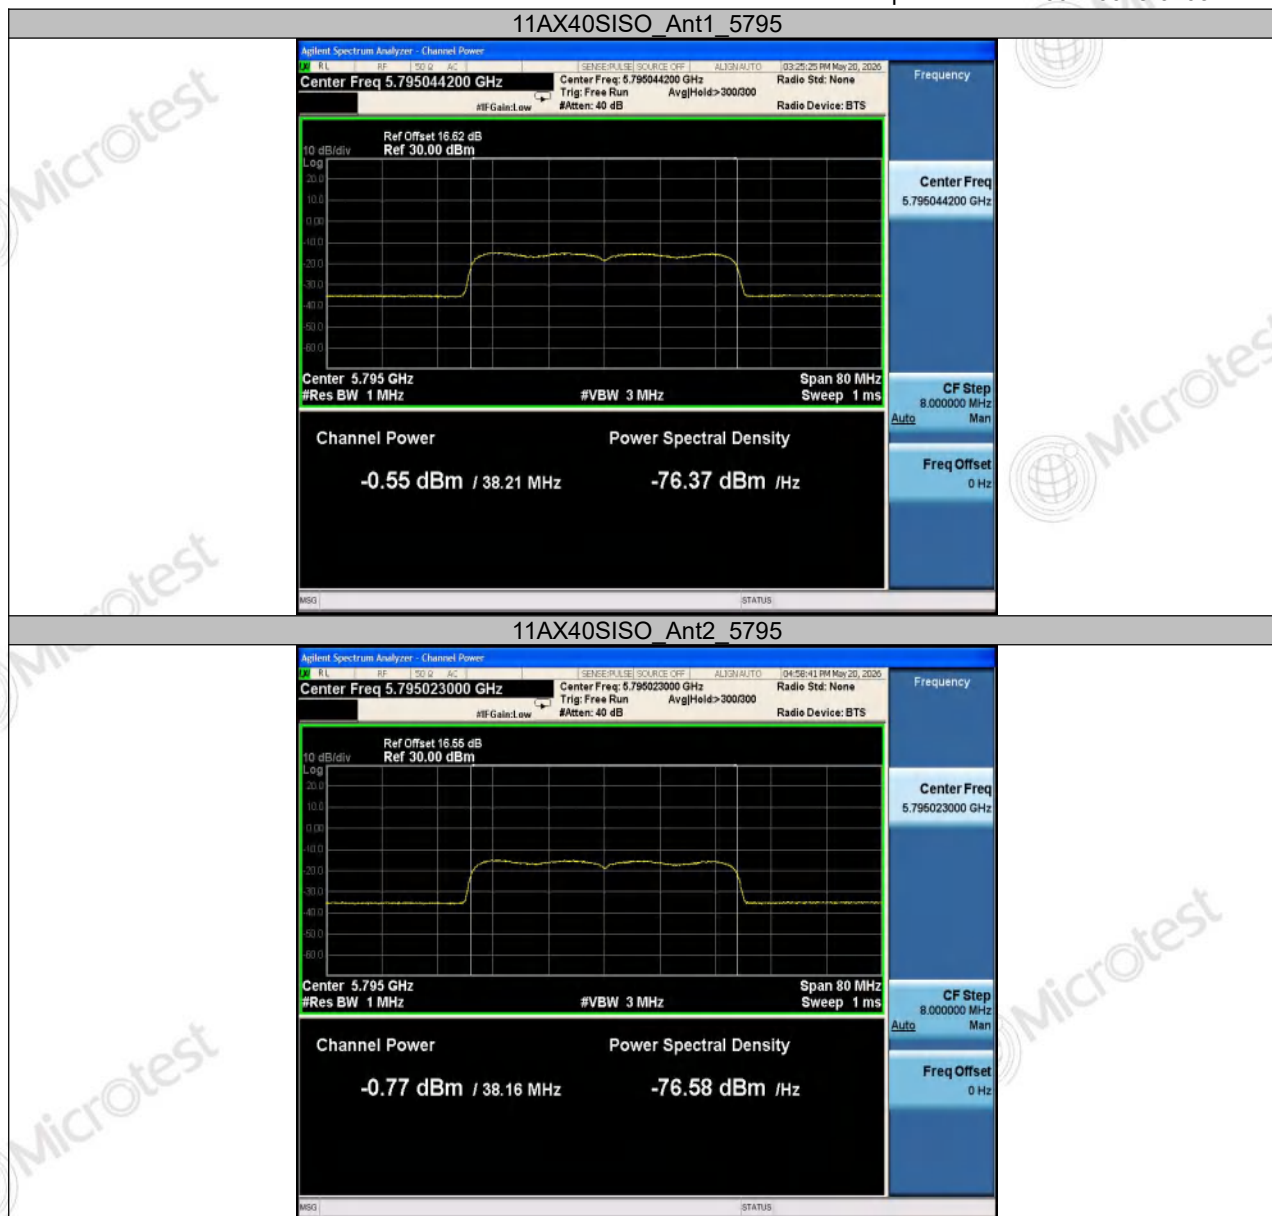


TEST REPORT

Report No.: MTi260410018-0203E4

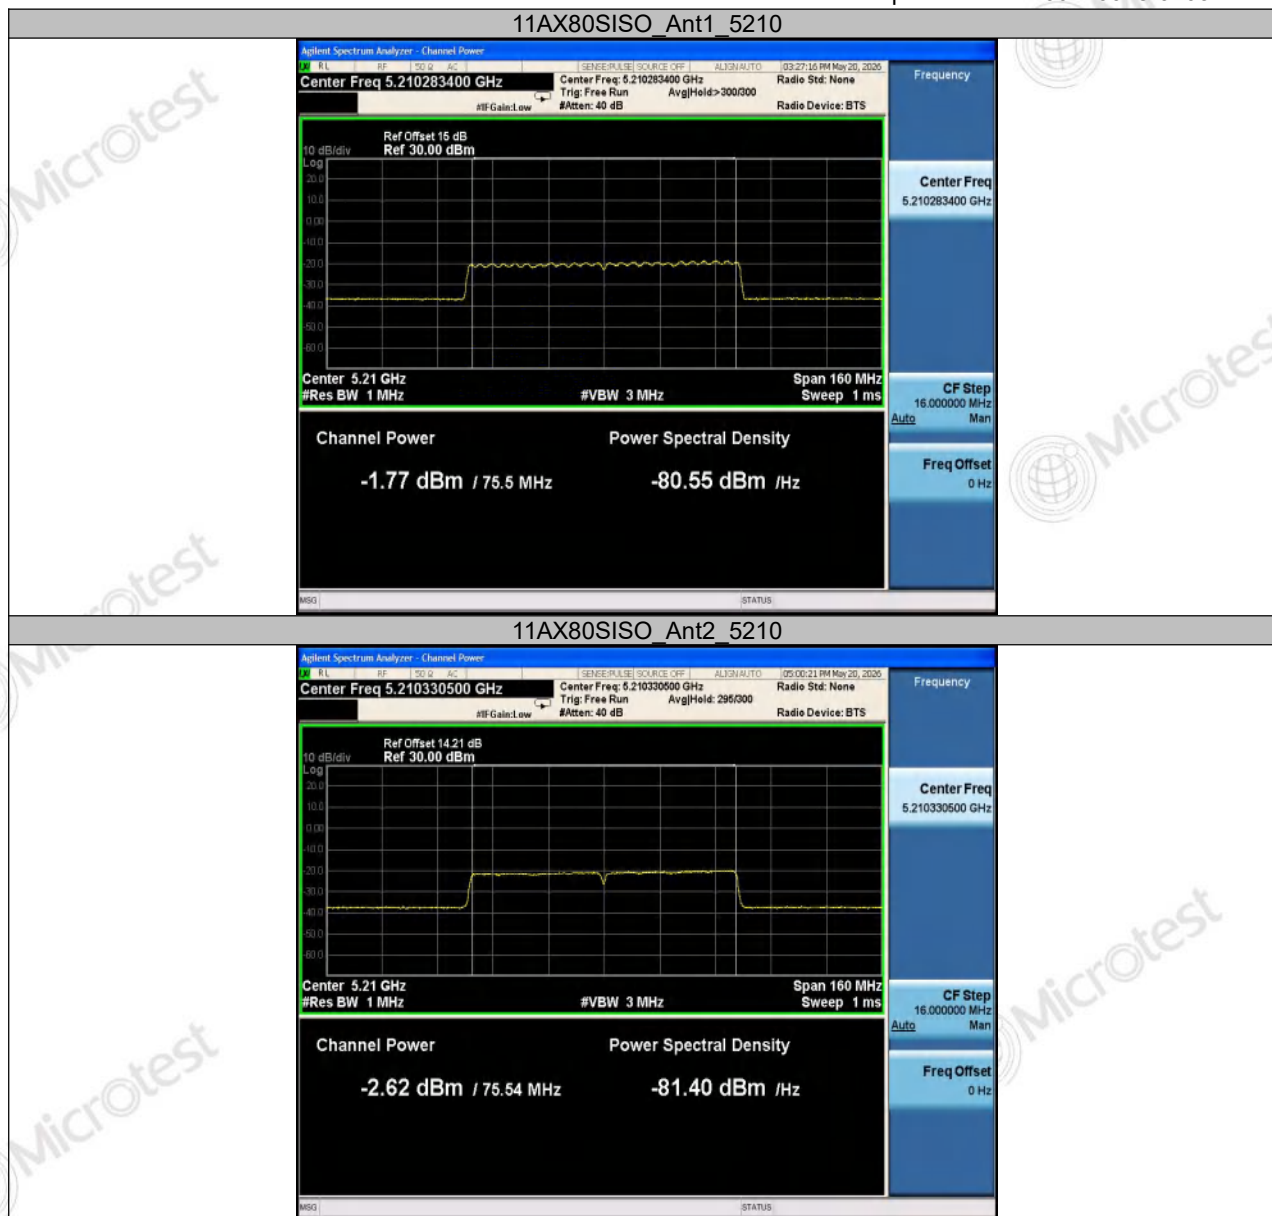


TEST REPORT

Report No.: MTi260410018-0203E4

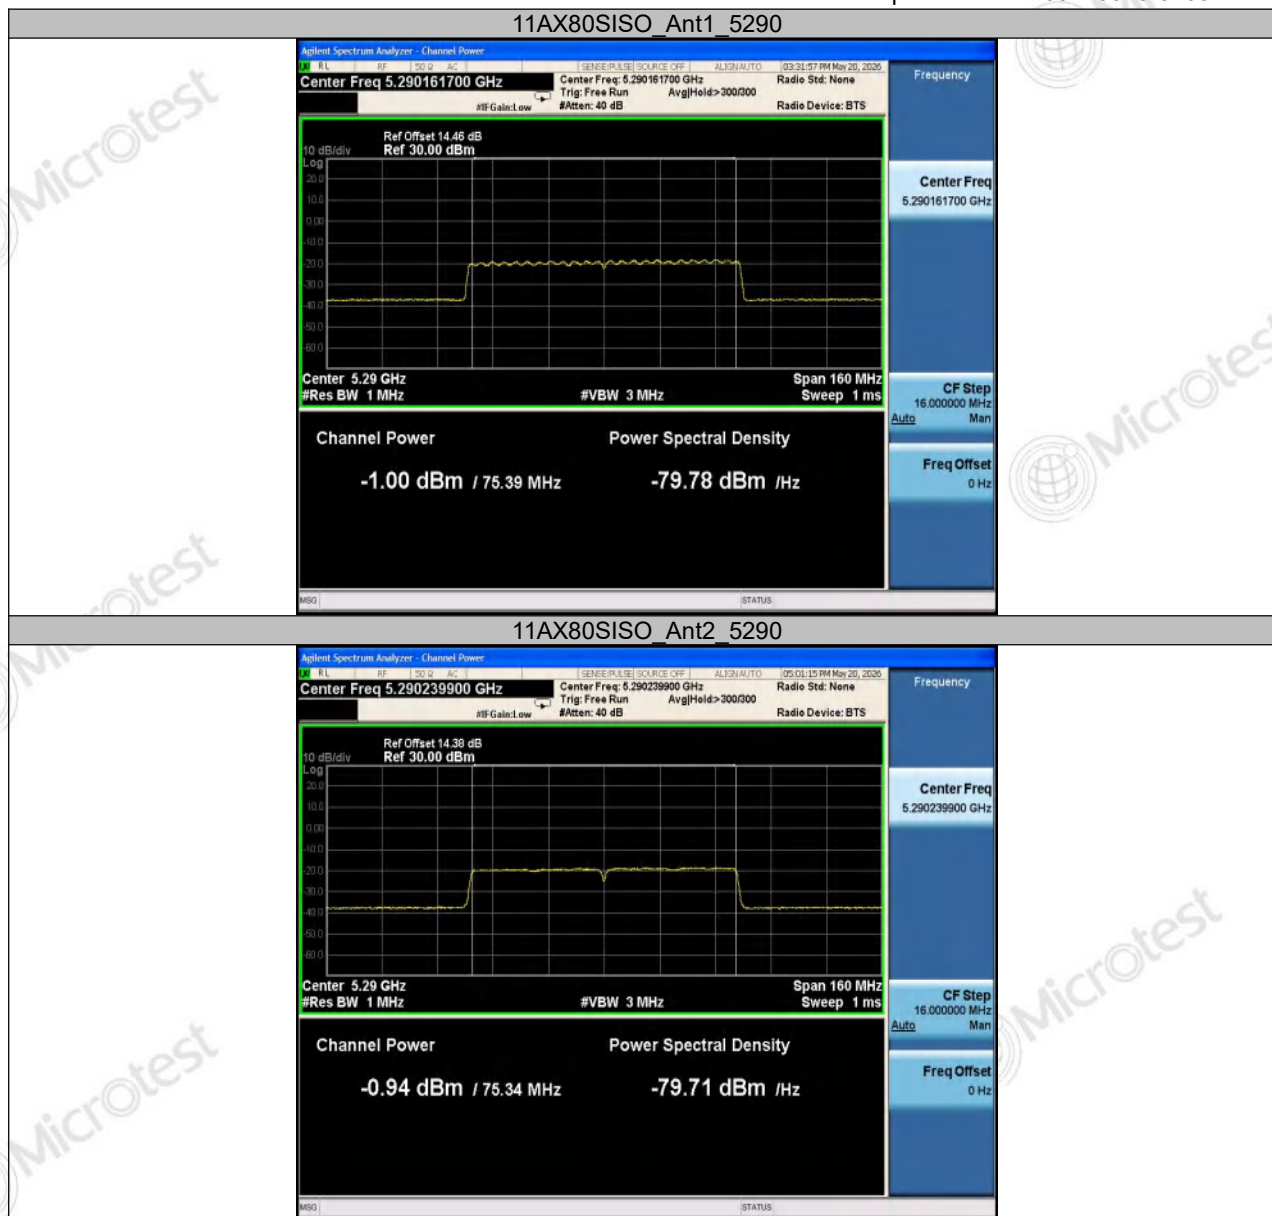


TEST REPORT

Report No.: MTi260410018-0203E4

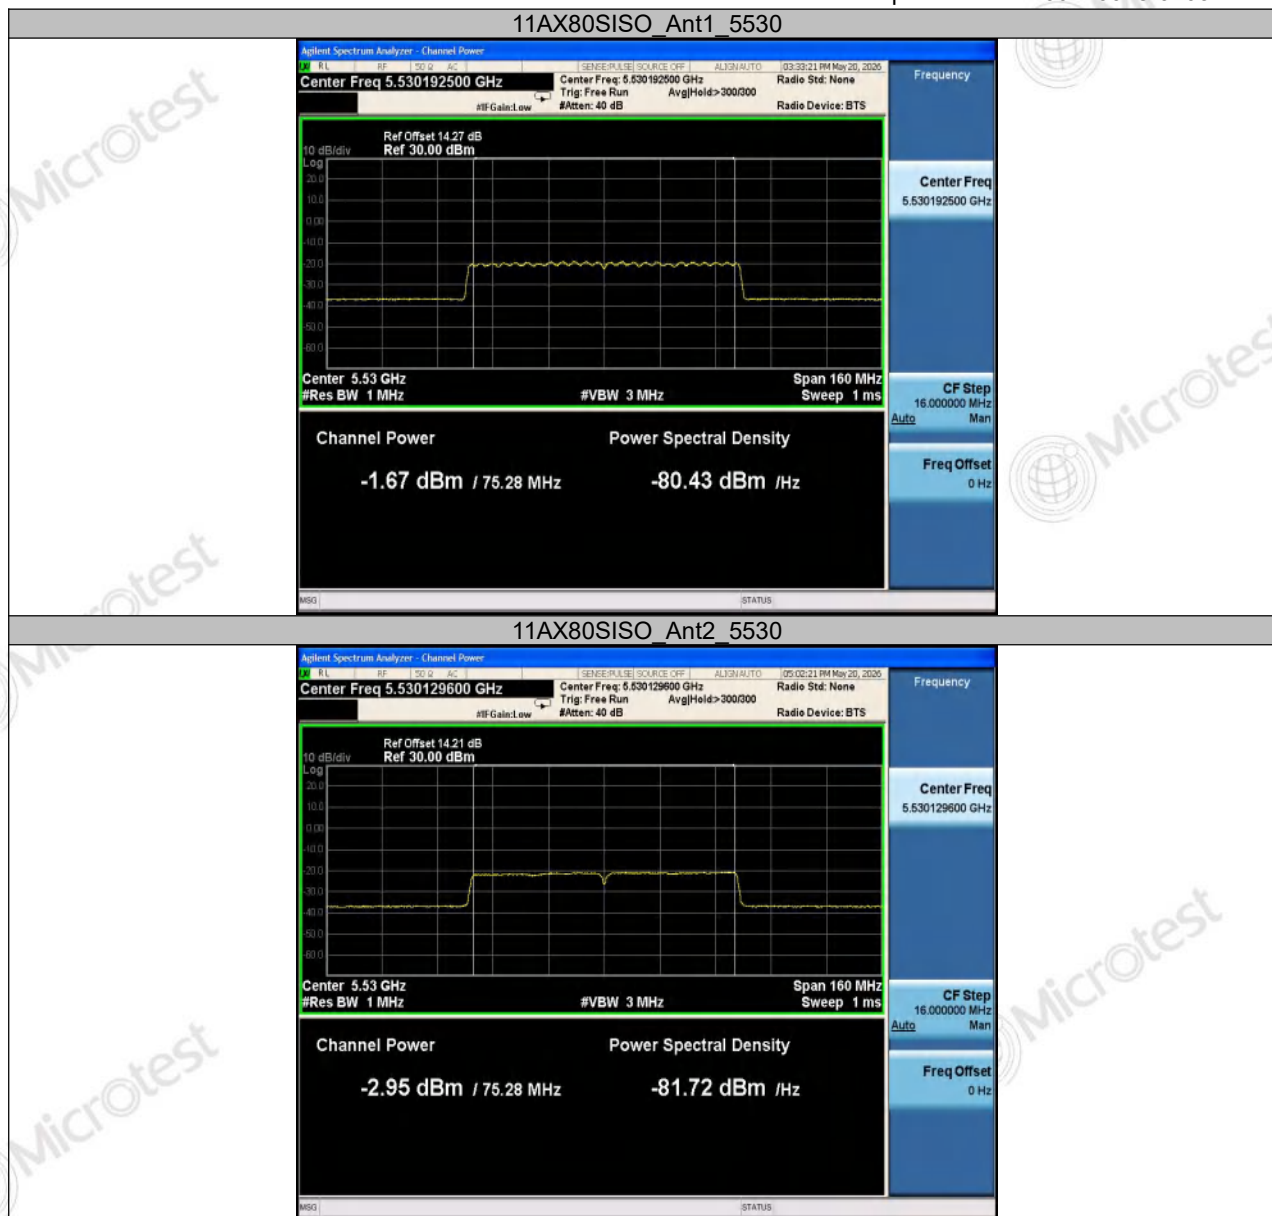


TEST REPORT

Report No.: MTi260410018-0203E4

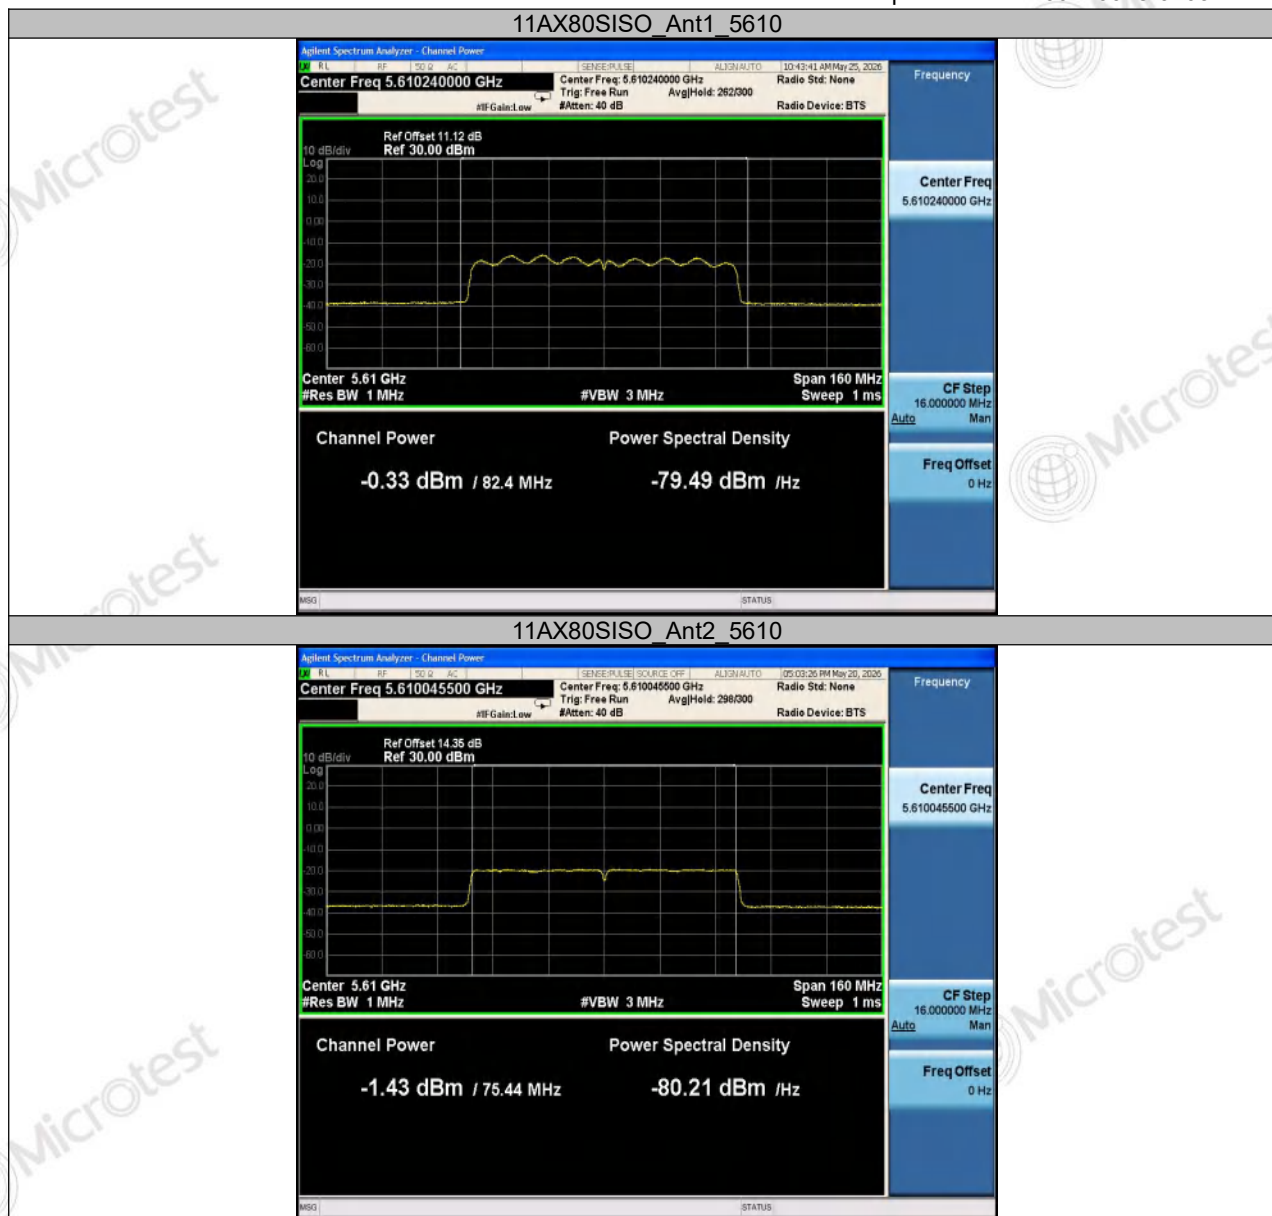

TEST REPORT

Report No.: MTi260410018-0203E4

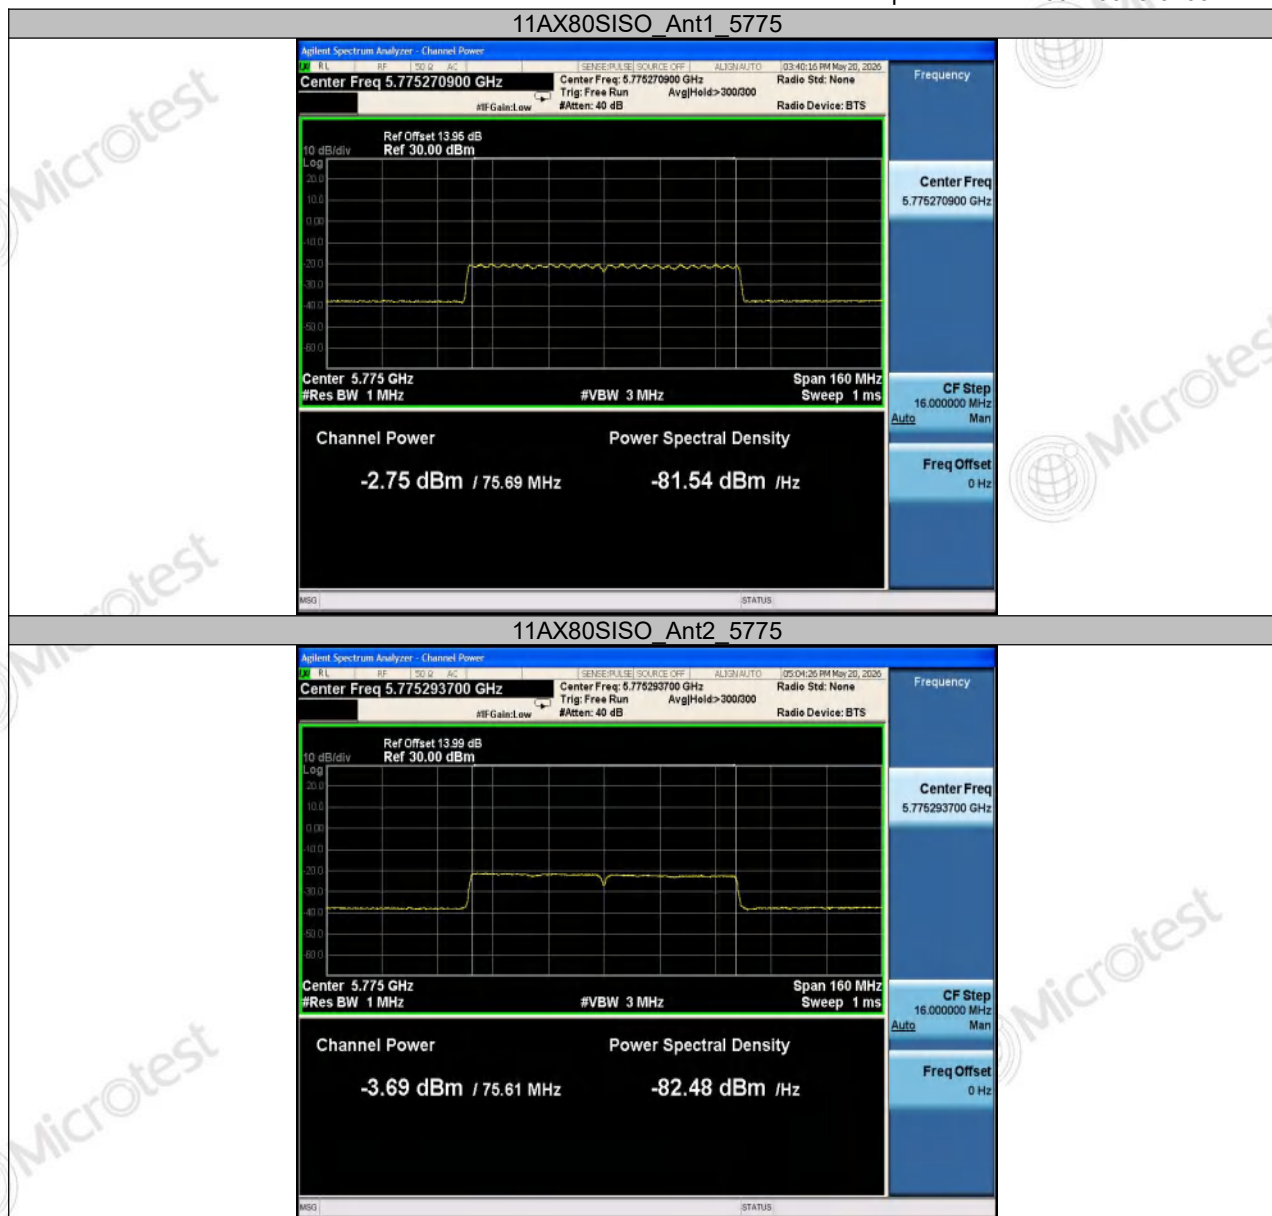

TEST REPORT

Report No.: MTi260410018-0203E4

Appendix D: Maximum power spectral density

Test Result

Test Mode	Antenna	Frequency [MHz]	Result [dBm/MHz]	Limit [dBm/MHz]	Verdict
11A	Ant1	5180	-17.04	≤11.00	PASS
	Ant2	5180	-15.38	≤11.00	PASS
	Ant1	5200	-17.4	≤11.00	PASS
	Ant2	5200	-16.24	≤11.00	PASS
	Ant1	5240	-17.71	≤11.00	PASS
	Ant2	5240	-15.13	≤11.00	PASS
	Ant1	5260	-17.76	≤11.00	PASS
	Ant2	5260	-15.37	≤11.00	PASS
	Ant1	5280	-18.20	≤11.00	PASS
	Ant2	5280	-16.42	≤11.00	PASS
	Ant1	5320	-18.06	≤11.00	PASS
	Ant2	5320	-14.60	≤11.00	PASS
	Ant1	5500	-16.54	≤11.00	PASS
	Ant2	5500	-8.36	≤11.00	PASS
	Ant1	5580	-13.57	≤11.00	PASS
	Ant2	5580	-13.73	≤11.00	PASS
	Ant1	5700	-10.29	≤11.00	PASS
	Ant2	5700	-10.74	≤11.00	PASS
	Ant1	5745	-16.33	≤30.00	PASS
	Ant2	5745	-14.02	≤30.00	PASS
	Ant1	5785	-16.39	≤30.00	PASS
	Ant2	5785	-14.95	≤30.00	PASS
	Ant1	5825	-16.23	≤30.00	PASS
	Ant2	5825	-14.26	≤30.00	PASS
11N20SISO	Ant1	5180	-16.28	≤11.00	PASS
	Ant2	5180	-16.29	≤11.00	PASS
	Ant1	5200	-16.37	≤11.00	PASS
	Ant2	5200	-18.44	≤11.00	PASS
	Ant1	5240	-16.88	≤11.00	PASS
	Ant2	5240	-16.28	≤11.00	PASS
	Ant1	5260	-17.19	≤11.00	PASS
	Ant2	5260	-18.31	≤11.00	PASS
	Ant1	5280	-17.3	≤11.00	PASS
	Ant2	5280	-17.79	≤11.00	PASS
	Ant1	5320	-18.15	≤11.00	PASS
	Ant2	5320	-16.67	≤11.00	PASS
	Ant1	5500	-16.85	≤11.00	PASS
	Ant2	5500	-10.32	≤11.00	PASS
	Ant1	5580	-18.38	≤11.00	PASS
	Ant2	5580	-12.94	≤11.00	PASS
	Ant1	5700	-14.98	≤11.00	PASS
	Ant2	5700	-11.78	≤11.00	PASS
	Ant1	5745	-16.7	≤30.00	PASS
	Ant2	5745	-13.49	≤30.00	PASS
	Ant1	5785	-17.53	≤30.00	PASS
	Ant2	5785	-14.66	≤30.00	PASS
	Ant1	5825	-17.37	≤30.00	PASS
	Ant2	5825	-14.69	≤30.00	PASS
11N40SISO	Ant1	5190	-18.8	≤11.00	PASS
	Ant2	5190	-19.64	≤11.00	PASS
	Ant1	5230	-17.41	≤11.00	PASS
	Ant2	5230	-18.17	≤11.00	PASS
	Ant1	5270	-16.85	≤11.00	PASS
	Ant2	5270	-20.36	≤11.00	PASS
	Ant1	5310	-17.35	≤11.00	PASS

TEST REPORT

Report No.: MTi260410018-0203E4

	Ant2	5310	-19.07	≤11.00	PASS
	Ant1	5510	-19.83	≤11.00	PASS
	Ant2	5510	-15.65	≤11.00	PASS
	Ant1	5550	-21.04	≤11.00	PASS
	Ant2	5550	-14.15	≤11.00	PASS
	Ant1	5670	-21.07	≤11.00	PASS
	Ant2	5670	-15.59	≤11.00	PASS
	Ant1	5755	-18.29	≤30.00	PASS
	Ant2	5755	-17.33	≤30.00	PASS
	Ant1	5795	-20.2	≤30.00	PASS
11AC20SISO	Ant2	5795	-17.75	≤30.00	PASS
	Ant1	5180	-16.32	≤11.00	PASS
	Ant2	5180	-17.18	≤11.00	PASS
	Ant1	5200	-16.28	≤11.00	PASS
	Ant2	5200	-17.49	≤11.00	PASS
	Ant1	5240	-16.57	≤11.00	PASS
	Ant2	5240	-16.06	≤11.00	PASS
	Ant1	5260	-17.15	≤11.00	PASS
	Ant2	5260	-16.74	≤11.00	PASS
	Ant1	5280	-17.08	≤11.00	PASS
	Ant2	5280	-16.76	≤11.00	PASS
	Ant1	5320	-18.03	≤11.00	PASS
	Ant2	5320	-16.20	≤11.00	PASS
	Ant1	5500	-16.49	≤11.00	PASS
	Ant2	5500	-10.43	≤11.00	PASS
	Ant1	5580	-15.01	≤11.00	PASS
	Ant2	5580	-14.62	≤11.00	PASS
	Ant1	5700	-15.58	≤11.00	PASS
	Ant2	5700	-13.01	≤11.00	PASS
	Ant1	5745	-14.48	≤30.00	PASS
	Ant2	5745	-13.80	≤30.00	PASS
	Ant1	5785	-15.32	≤30.00	PASS
	Ant2	5785	-15.04	≤30.00	PASS
	Ant1	5825	-15.67	≤30.00	PASS
11AC40SISO	Ant2	5825	-14.47	≤30.00	PASS
	Ant1	5190	-22.86	≤11.00	PASS
	Ant2	5190	-18.10	≤11.00	PASS
	Ant1	5230	-17.75	≤11.00	PASS
	Ant2	5230	-17.52	≤11.00	PASS
	Ant1	5270	-19.35	≤11.00	PASS
	Ant2	5270	-18.83	≤11.00	PASS
	Ant1	5310	-19.54	≤11.00	PASS
	Ant2	5310	-18.30	≤11.00	PASS
	Ant1	5510	-14.16	≤11.00	PASS
	Ant2	5510	-13.02	≤11.00	PASS
	Ant1	5550	-13.82	≤11.00	PASS
	Ant2	5550	-12.79	≤11.00	PASS
	Ant1	5670	-16.24	≤11.00	PASS
	Ant2	5670	-15.18	≤11.00	PASS
	Ant1	5755	-13.88	≤30.00	PASS
	Ant2	5755	-16.95	≤30.00	PASS
	Ant1	5795	-15.36	≤30.00	PASS
	Ant2	5795	-14.83	≤30.00	PASS
11AC80SISO	Ant1	5210	-17.28	≤11.00	PASS
	Ant2	5210	-17.20	≤11.00	PASS
	Ant1	5290	-15.75	≤11.00	PASS
	Ant2	5290	-14.34	≤11.00	PASS
	Ant1	5530	-15.88	≤11.00	PASS
	Ant2	5530	-15.10	≤11.00	PASS
	Ant1	5610	-19.25	≤11.00	PASS
	Ant2	5610	-15.46	≤11.00	PASS
	Ant1	5775	-20.84	≤30.00	PASS

TEST REPORT

Report No.: MTi260410018-0203E4


11AX20SISO	Ant2	5775	-20.05	≤30.00	PASS
	Ant1	5180	-15.79	≤11.00	PASS
	Ant2	5180	-17.31	≤11.00	PASS
	Ant1	5200	-16.42	≤11.00	PASS
	Ant2	5200	-17.46	≤11.00	PASS
	Ant1	5240	-16.56	≤11.00	PASS
	Ant2	5240	-15.74	≤11.00	PASS
	Ant1	5260	-17.05	≤11.00	PASS
	Ant2	5260	-17.23	≤11.00	PASS
	Ant1	5280	-16.84	≤11.00	PASS
	Ant2	5280	-17.13	≤11.00	PASS
	Ant1	5320	-17.89	≤11.00	PASS
	Ant2	5320	-18.15	≤11.00	PASS
	Ant1	5500	-16.62	≤11.00	PASS
	Ant2	5500	-9.92	≤11.00	PASS
	Ant1	5580	-17.14	≤11.00	PASS
	Ant2	5580	-12.48	≤11.00	PASS
	Ant1	5700	-15.09	≤11.00	PASS
	Ant2	5700	-11.93	≤11.00	PASS
	Ant1	5745	-15.27	≤30.00	PASS
	Ant2	5745	-11.69	≤30.00	PASS
	Ant1	5785	-17.05	≤30.00	PASS
	Ant2	5785	-13.44	≤30.00	PASS
	Ant1	5825	-15.76	≤30.00	PASS
	Ant2	5825	-13.08	≤30.00	PASS
11AX40SISO	Ant1	5190	-19.77	≤11.00	PASS
	Ant2	5190	-18.08	≤11.00	PASS
	Ant1	5230	-18.35	≤11.00	PASS
	Ant2	5230	-16.71	≤11.00	PASS
	Ant1	5270	-20.08	≤11.00	PASS
	Ant2	5270	-18.80	≤11.00	PASS
	Ant1	5310	-19.34	≤11.00	PASS
	Ant2	5310	-17.95	≤11.00	PASS
	Ant1	5510	-13.90	≤11.00	PASS
	Ant2	5510	-12.23	≤11.00	PASS
	Ant1	5550	-13.51	≤11.00	PASS
	Ant2	5550	-13.93	≤11.00	PASS
	Ant1	5670	-15.16	≤11.00	PASS
	Ant2	5670	-14.85	≤11.00	PASS
	Ant1	5755	-17.19	≤30.00	PASS
	Ant2	5755	-14.04	≤30.00	PASS
11AX80SISO	Ant1	5795	-17.92	≤30.00	PASS
	Ant2	5795	-15.08	≤30.00	PASS
	Ant1	5210	-16.94	≤11.00	PASS
	Ant2	5210	-17.41	≤11.00	PASS
	Ant1	5290	-15.81	≤11.00	PASS
	Ant2	5290	-15.02	≤11.00	PASS
	Ant1	5530	-15.40	≤11.00	PASS
	Ant2	5530	-15.24	≤11.00	PASS
	Ant1	5610	-15.69	≤11.00	PASS
	Ant2	5610	-15.88	≤11.00	PASS
	Ant1	5775	-20.53	≤30.00	PASS
	Ant2	5775	-20.47	≤30.00	PASS

Note: 1.The Result and Limit Unit is dBm/500 kHz in the band 5.725–5.85 GHz.
2.The Duty Cycle Factor and RBW Factor is compensated in the graph.

TEST REPORT


Report No.: MTI260410018-0203E4

Test Graphs

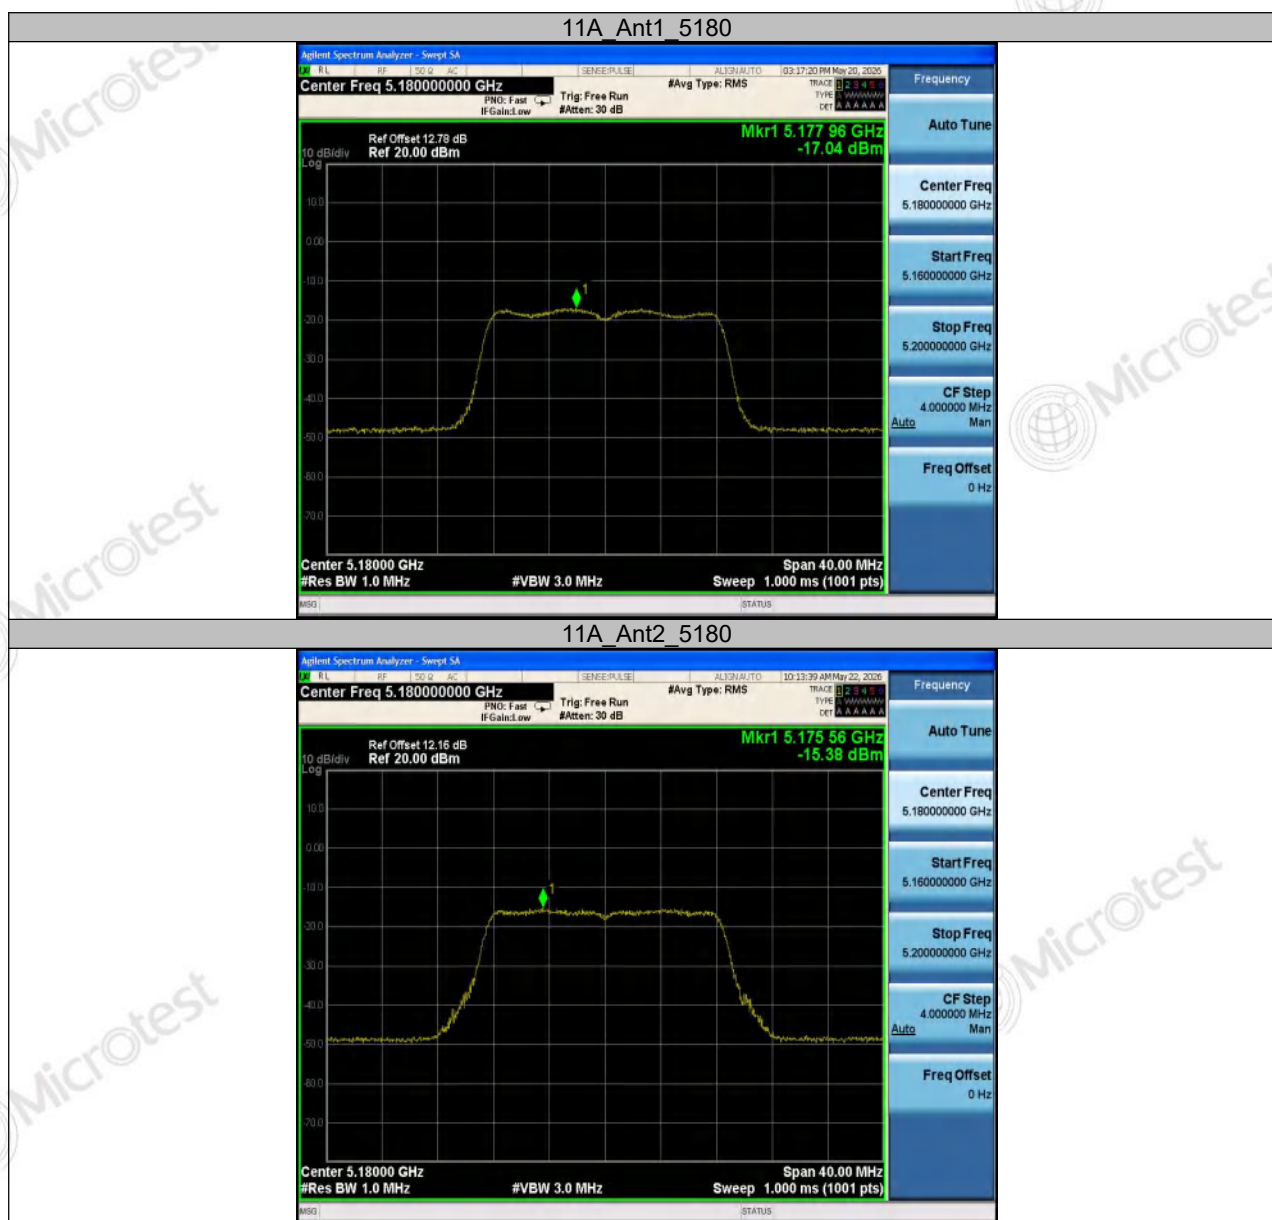


TEST REPORT

Report No.: MTi260410018-0203E4

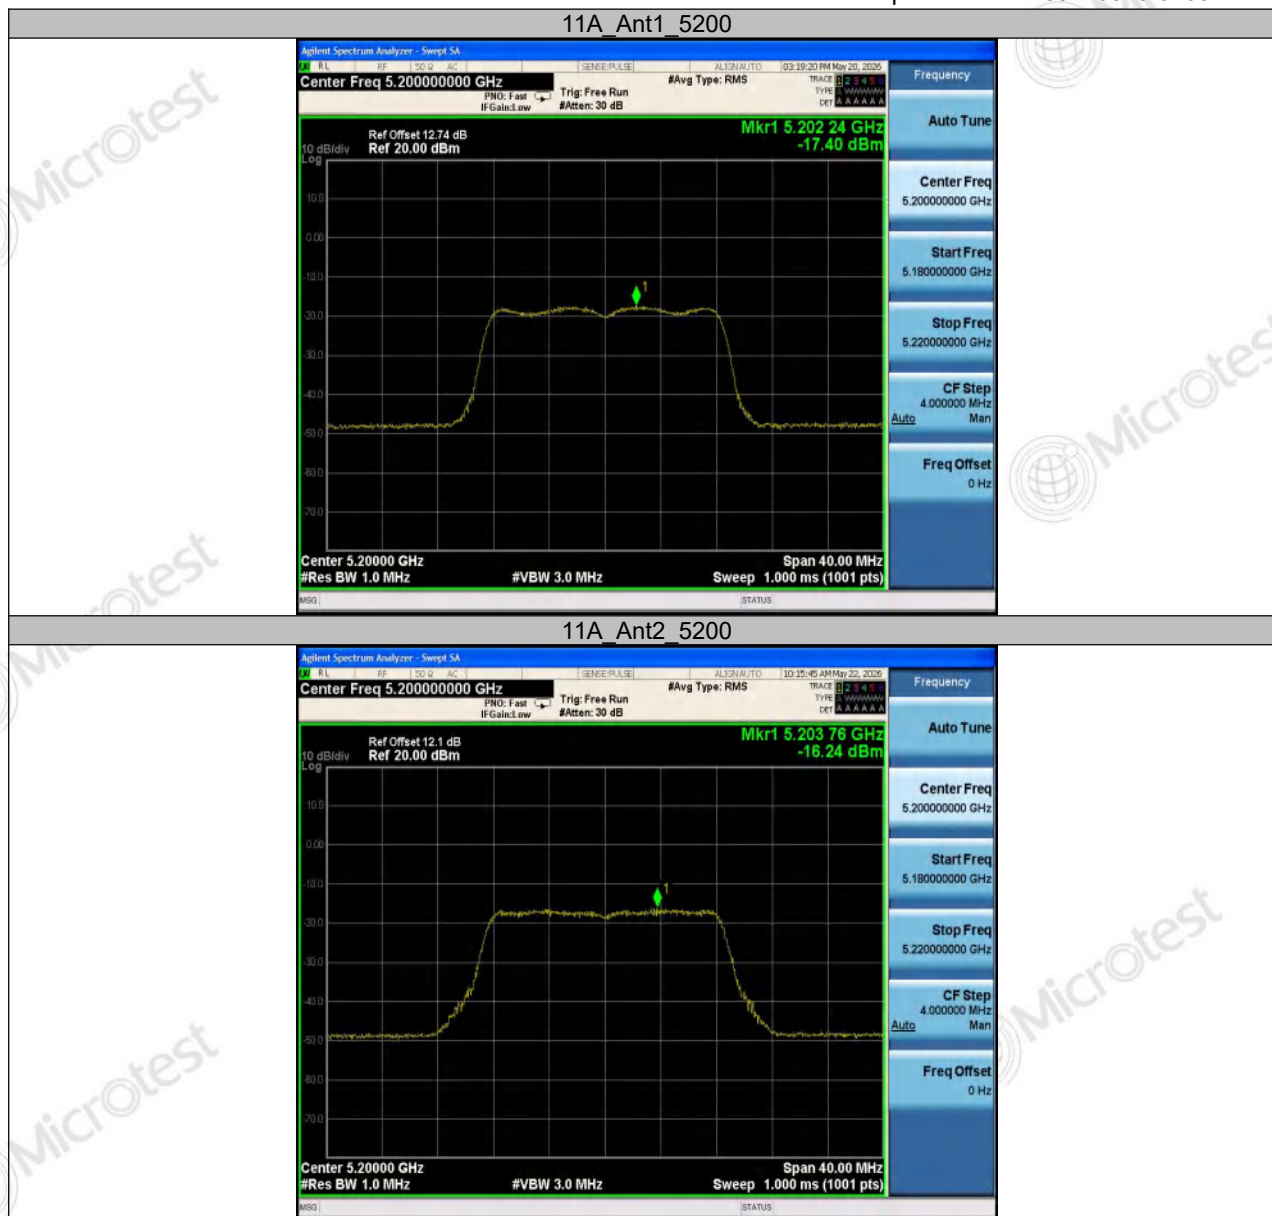


TEST REPORT

Report No.: MTi260410018-0203E4

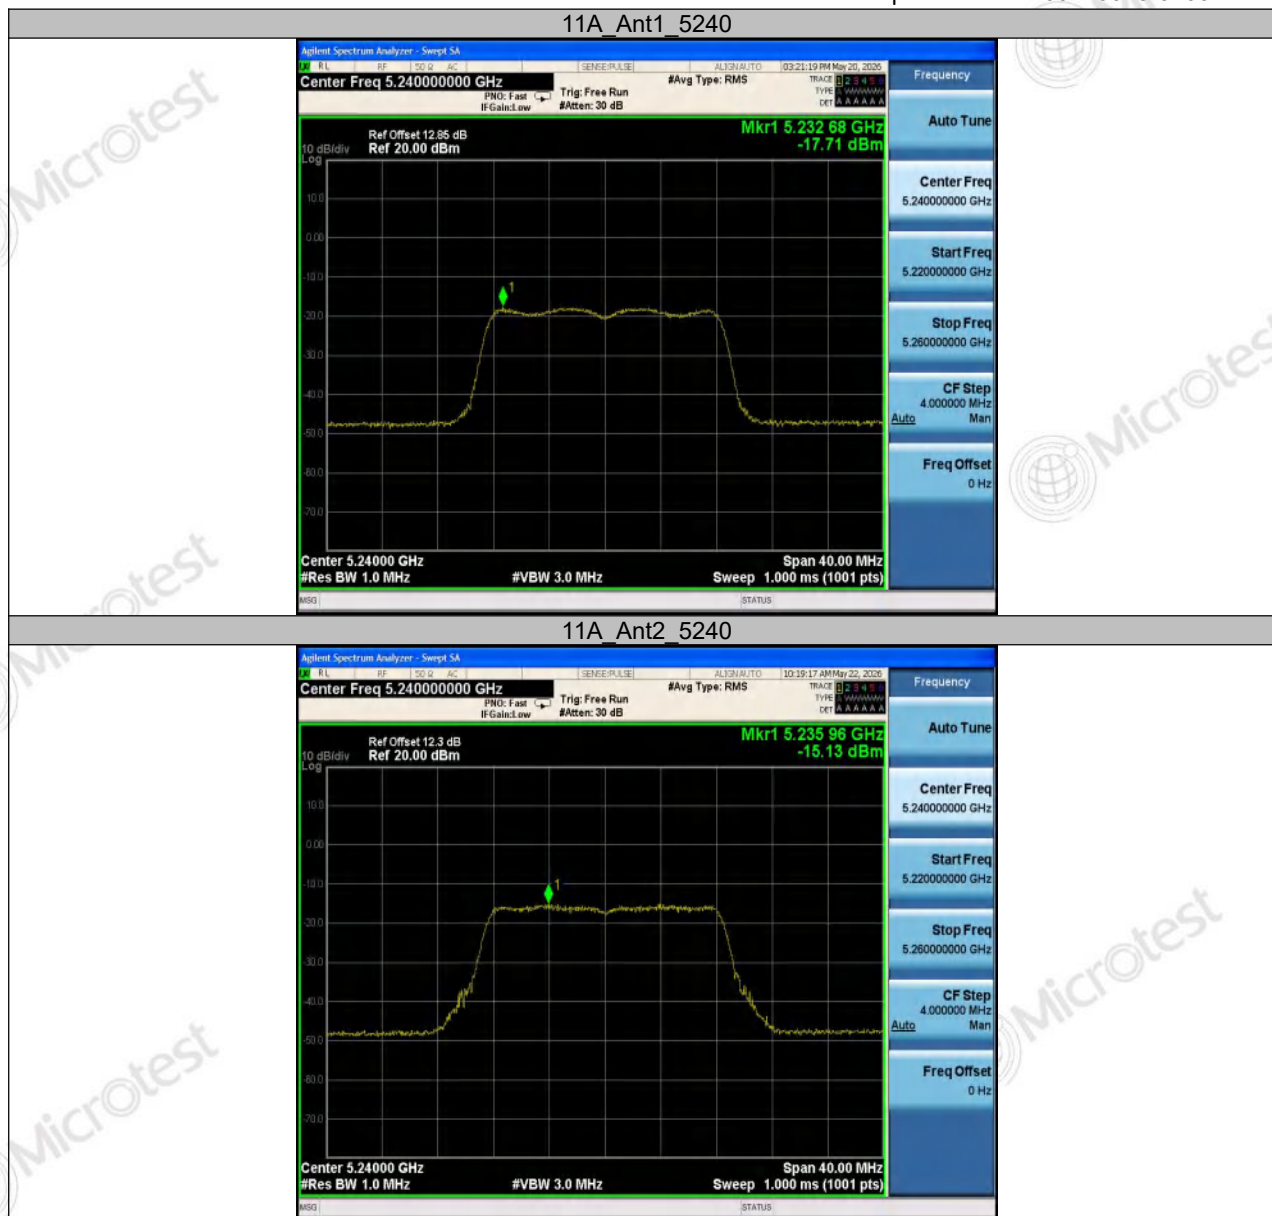


TEST REPORT

Report No.: MTi260410018-0203E4

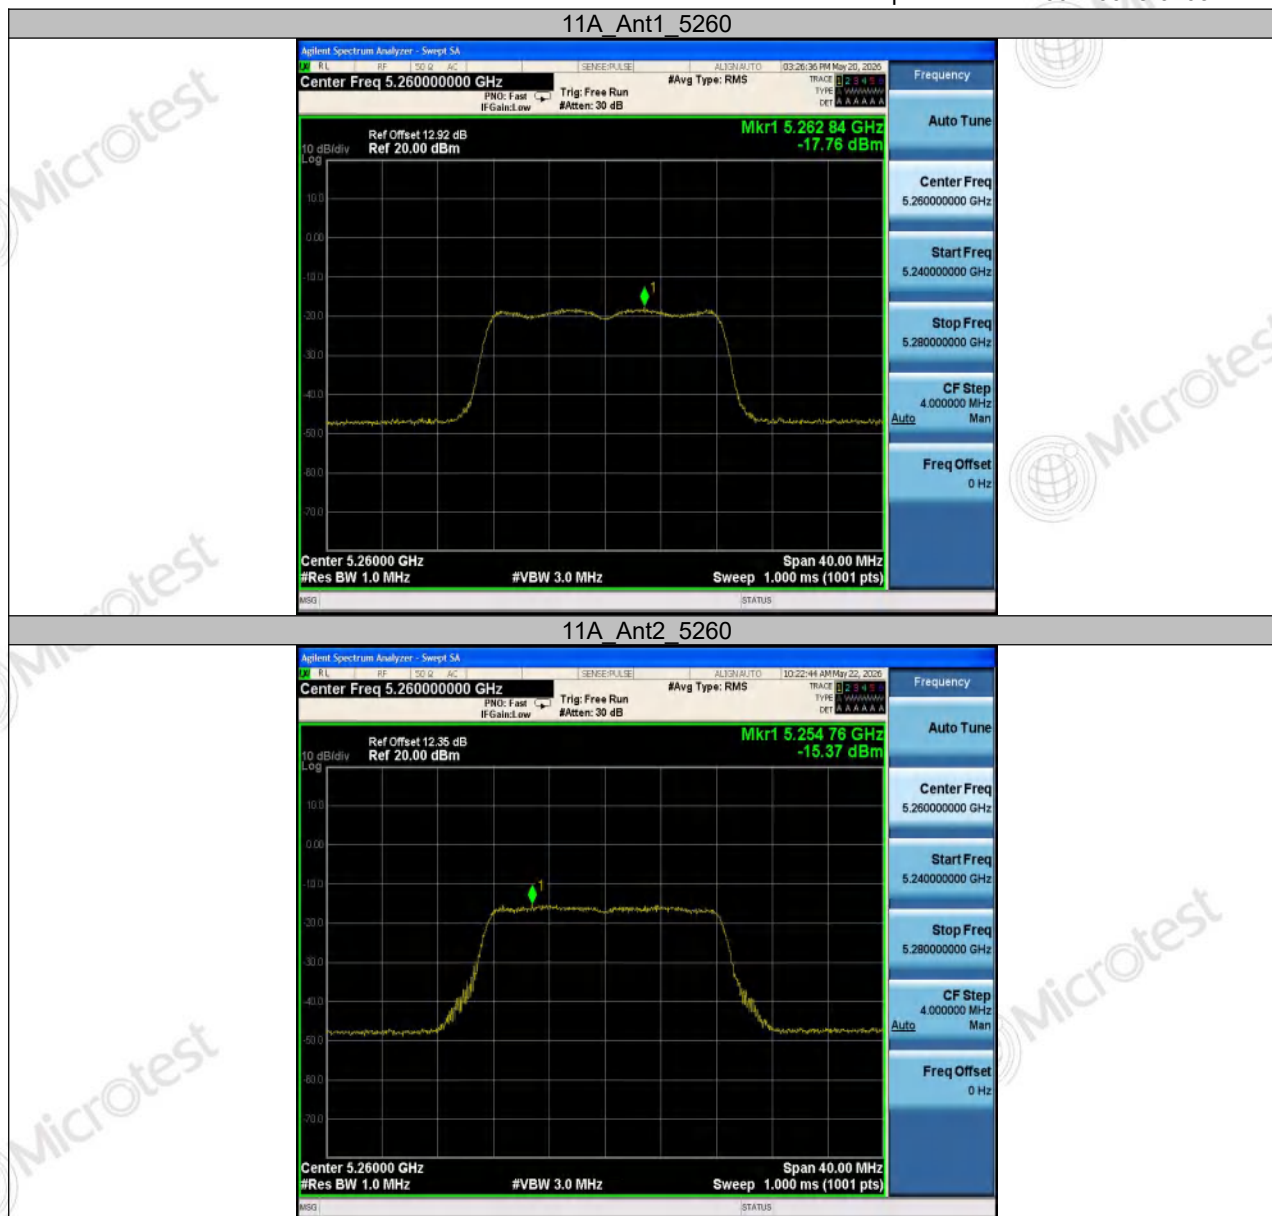


TEST REPORT

Report No.: MTi260410018-0203E4

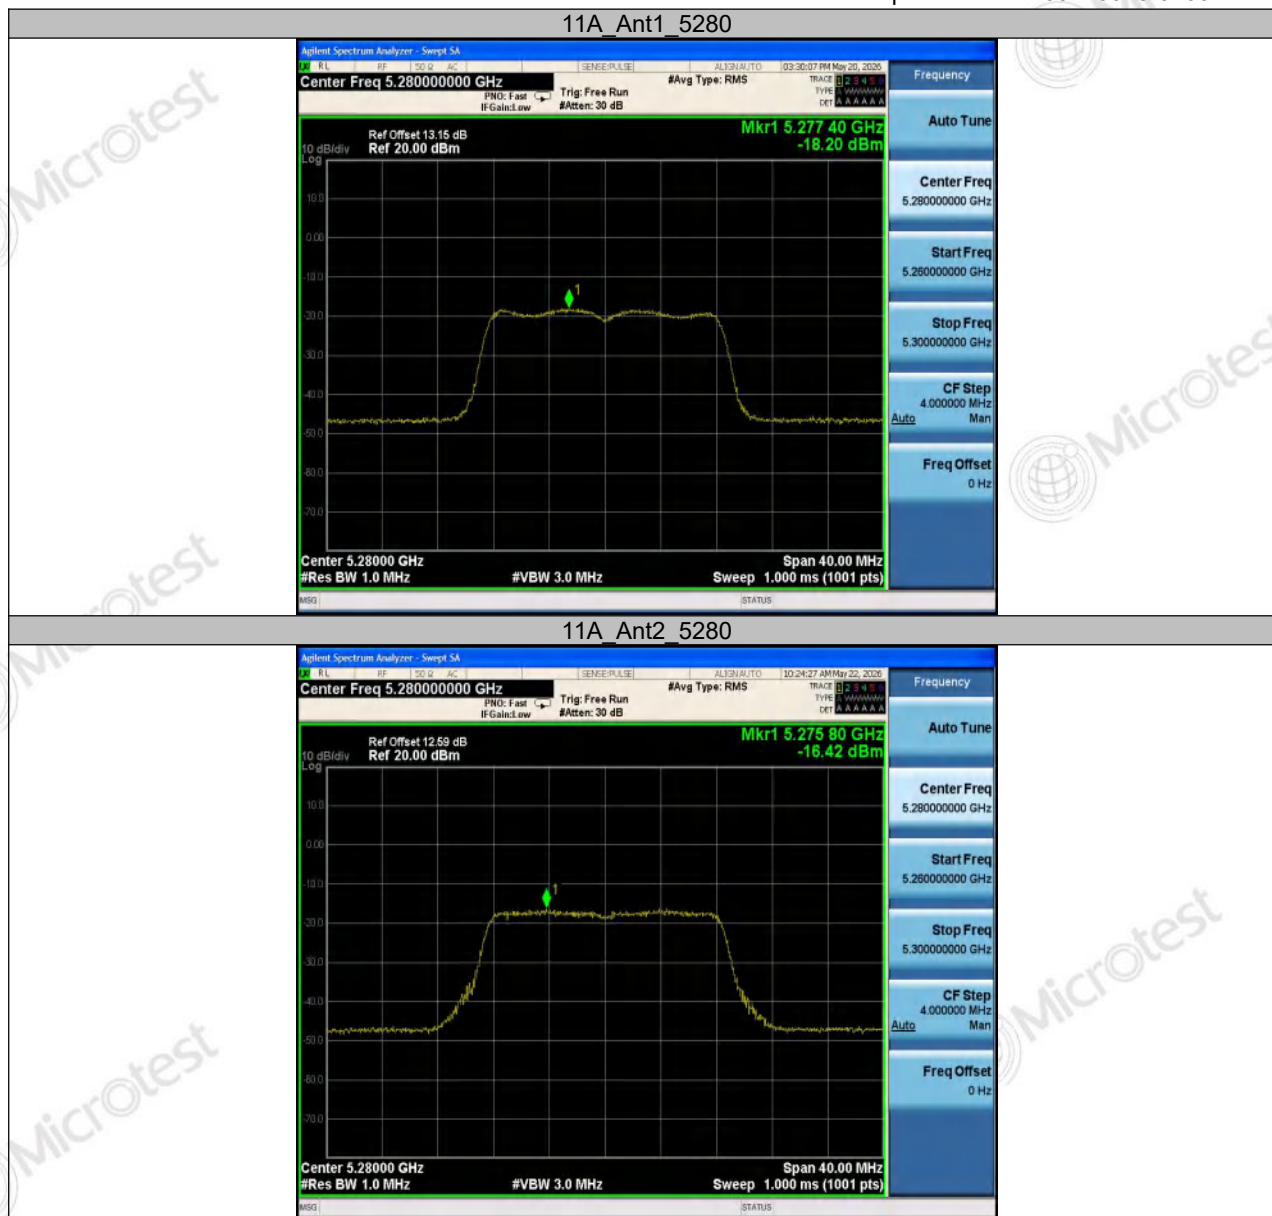


TEST REPORT

Report No.: MTi260410018-0203E4

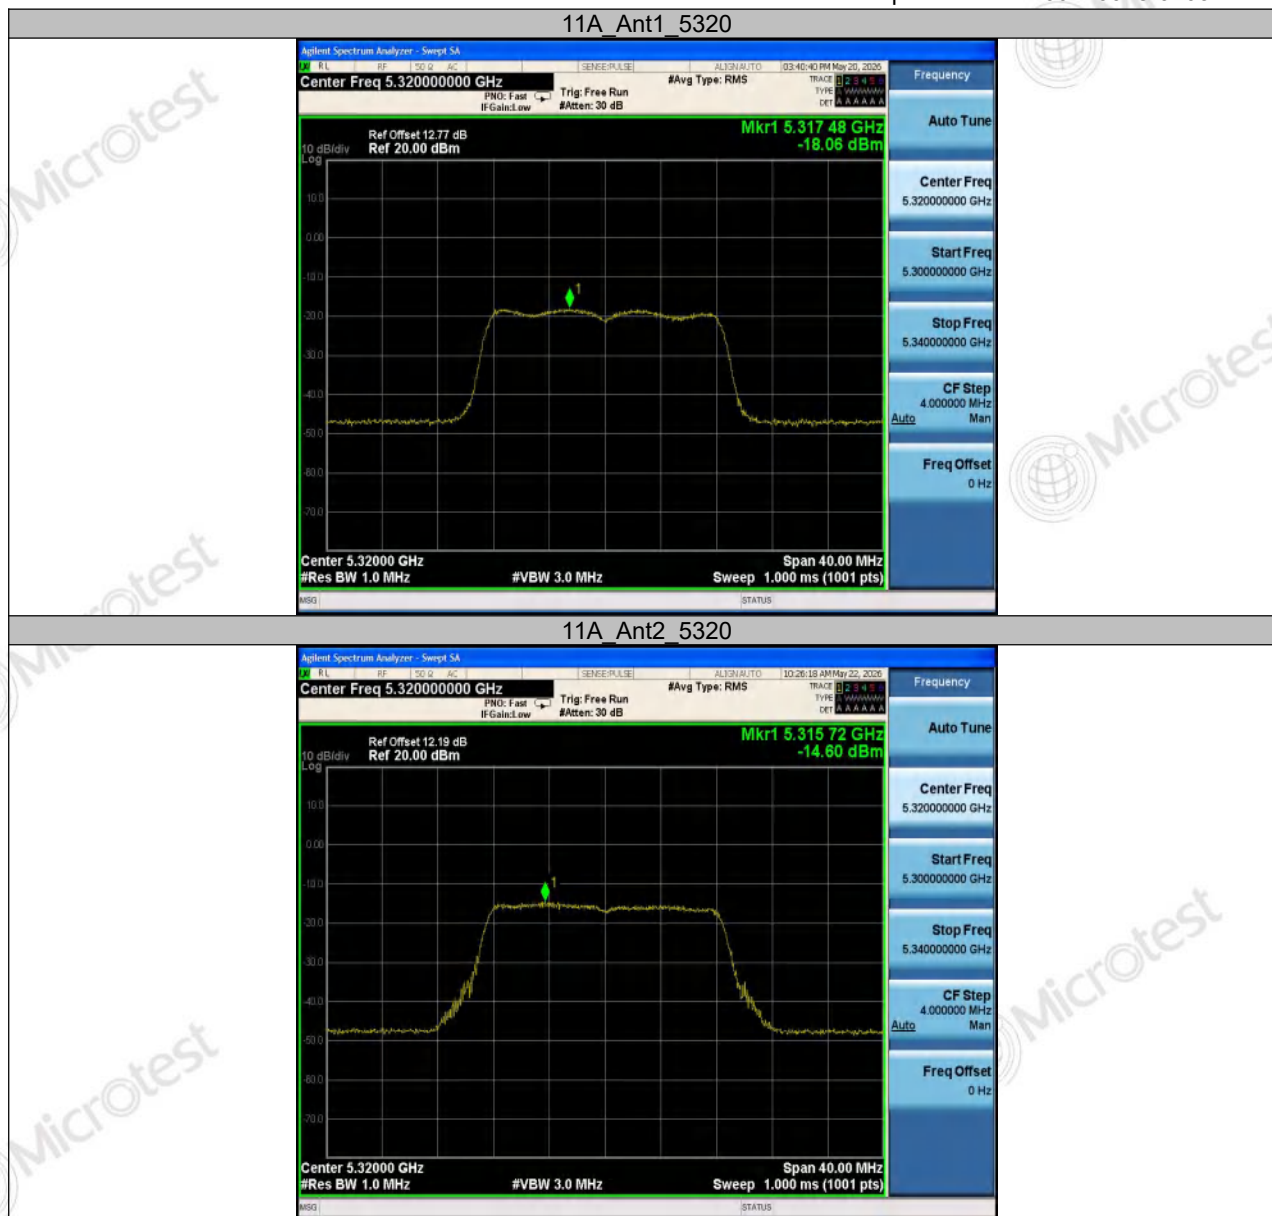

TEST REPORT

Report No.: MTi260410018-0203E4

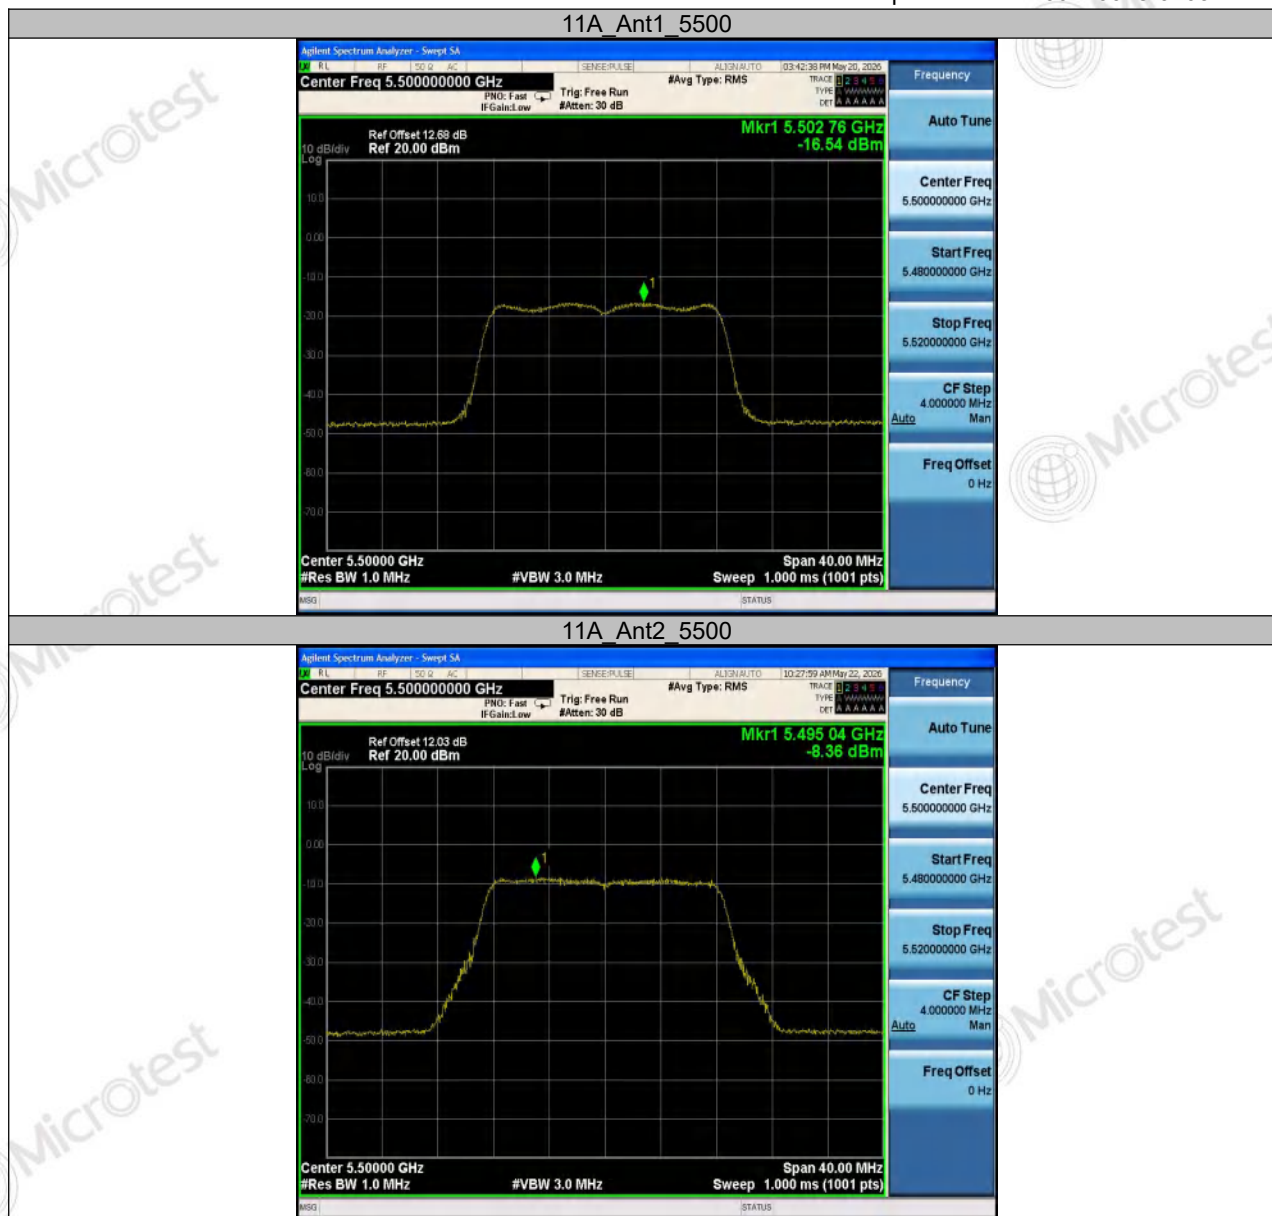

TEST REPORT

Report No.: MTi260410018-0203E4



TEST REPORT

Report No.: MTi260410018-0203E4



TEST REPORT

Report No.: MTI260410018-0203E4



TEST REPORT

Report No.: MTI260410018-0203E4




TEST REPORT

Report No.: MTI260410018-0203E4




TEST REPORT

Report No.: MTi260410018-0203E4

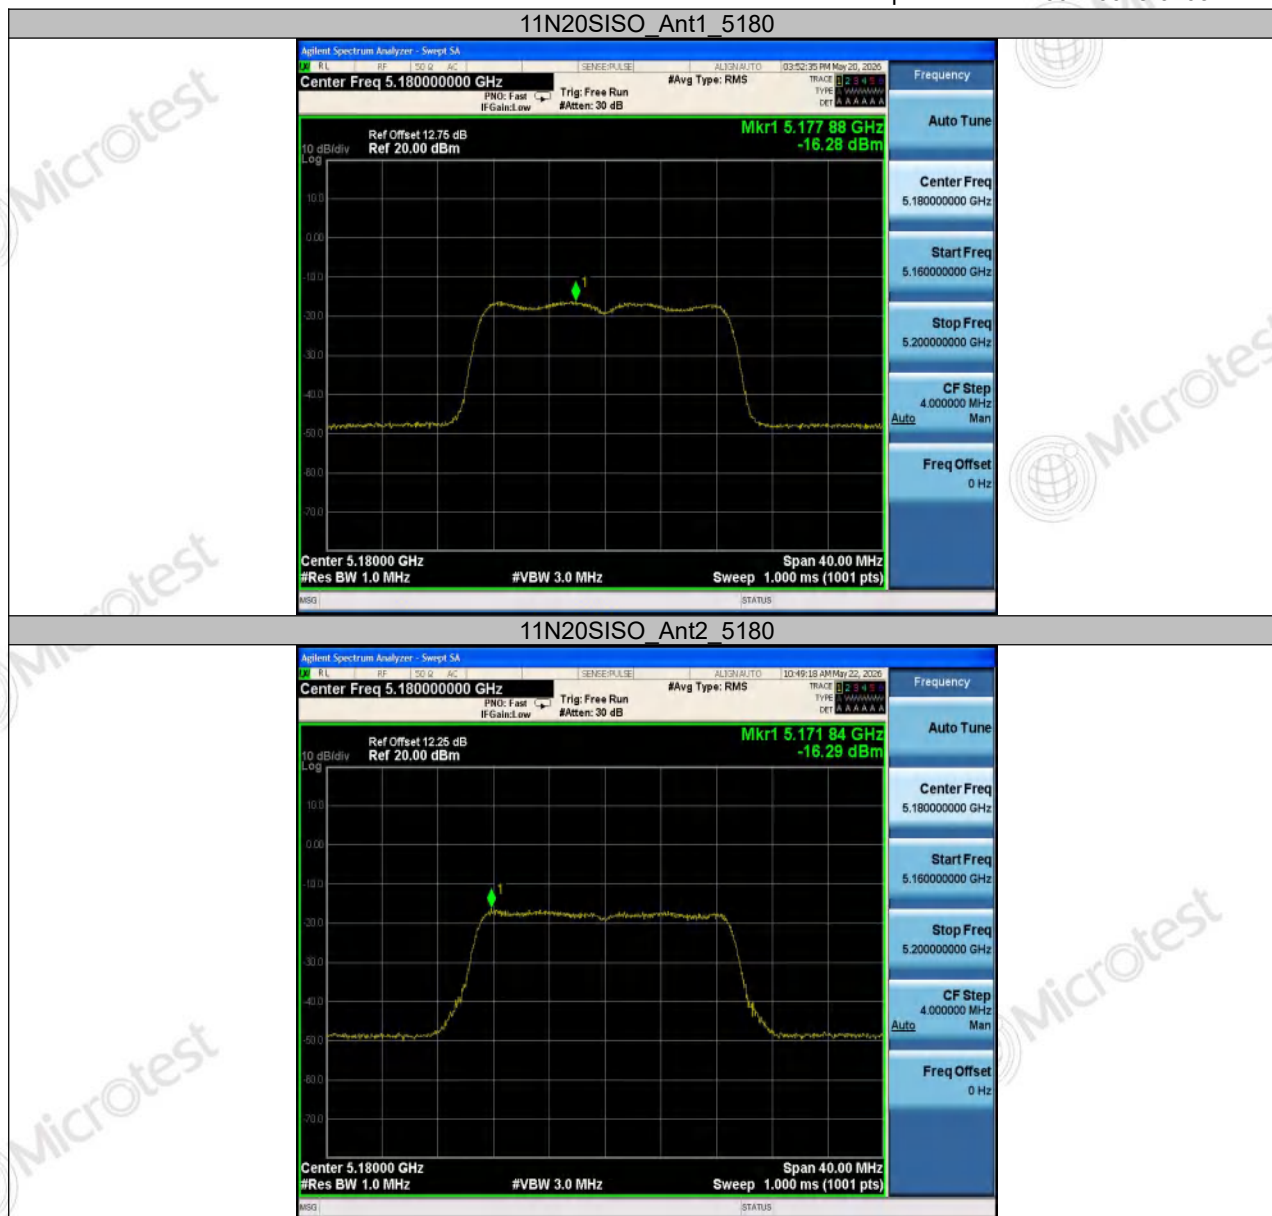

TEST REPORT

Report No.: MTi260410018-0203E4

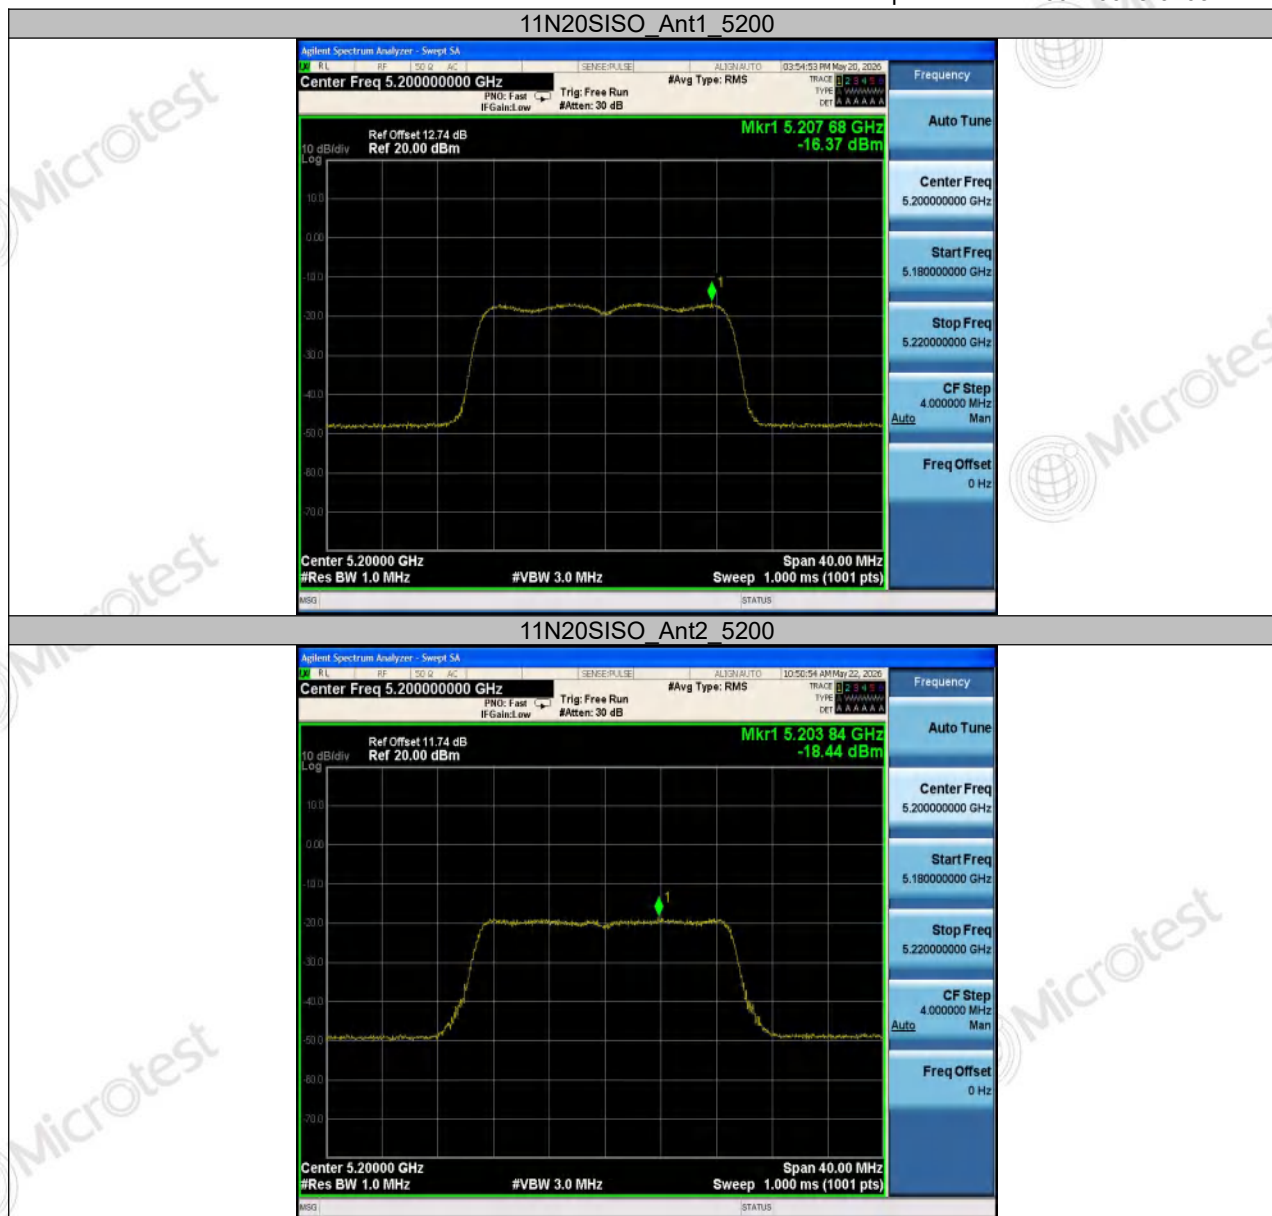


TEST REPORT

Report No.: MTi260410018-0203E4




TEST REPORT

Report No.: MTi260410018-0203E4

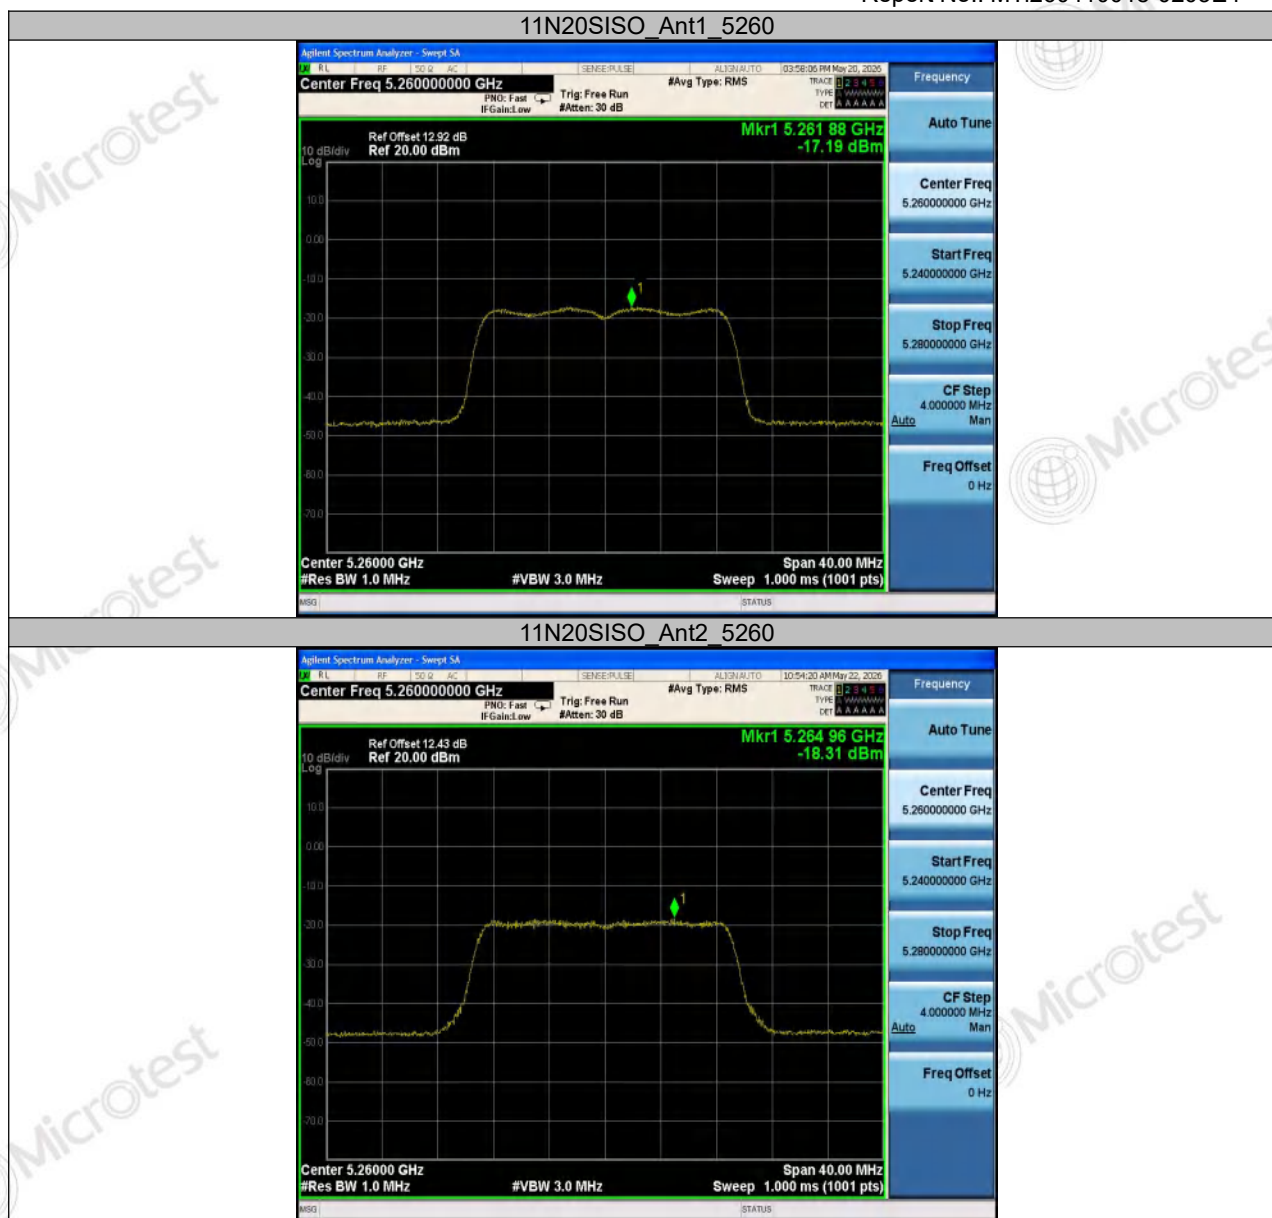


TEST REPORT

Report No.: MTi260410018-0203E4

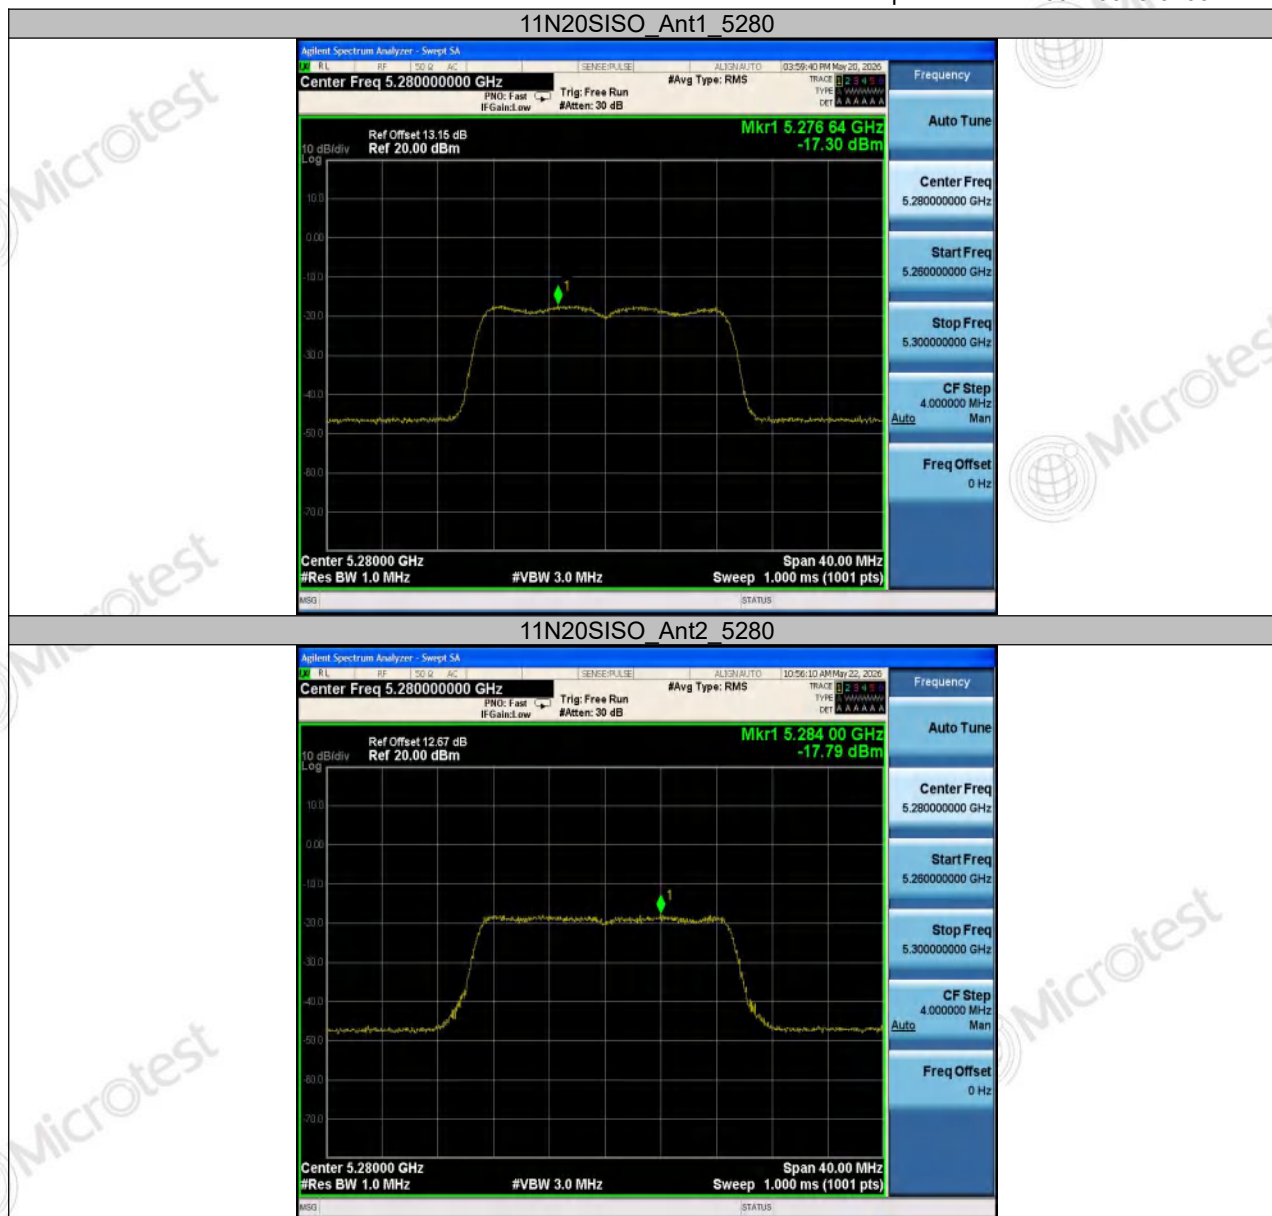


TEST REPORT

Report No.: MTi260410018-0203E4

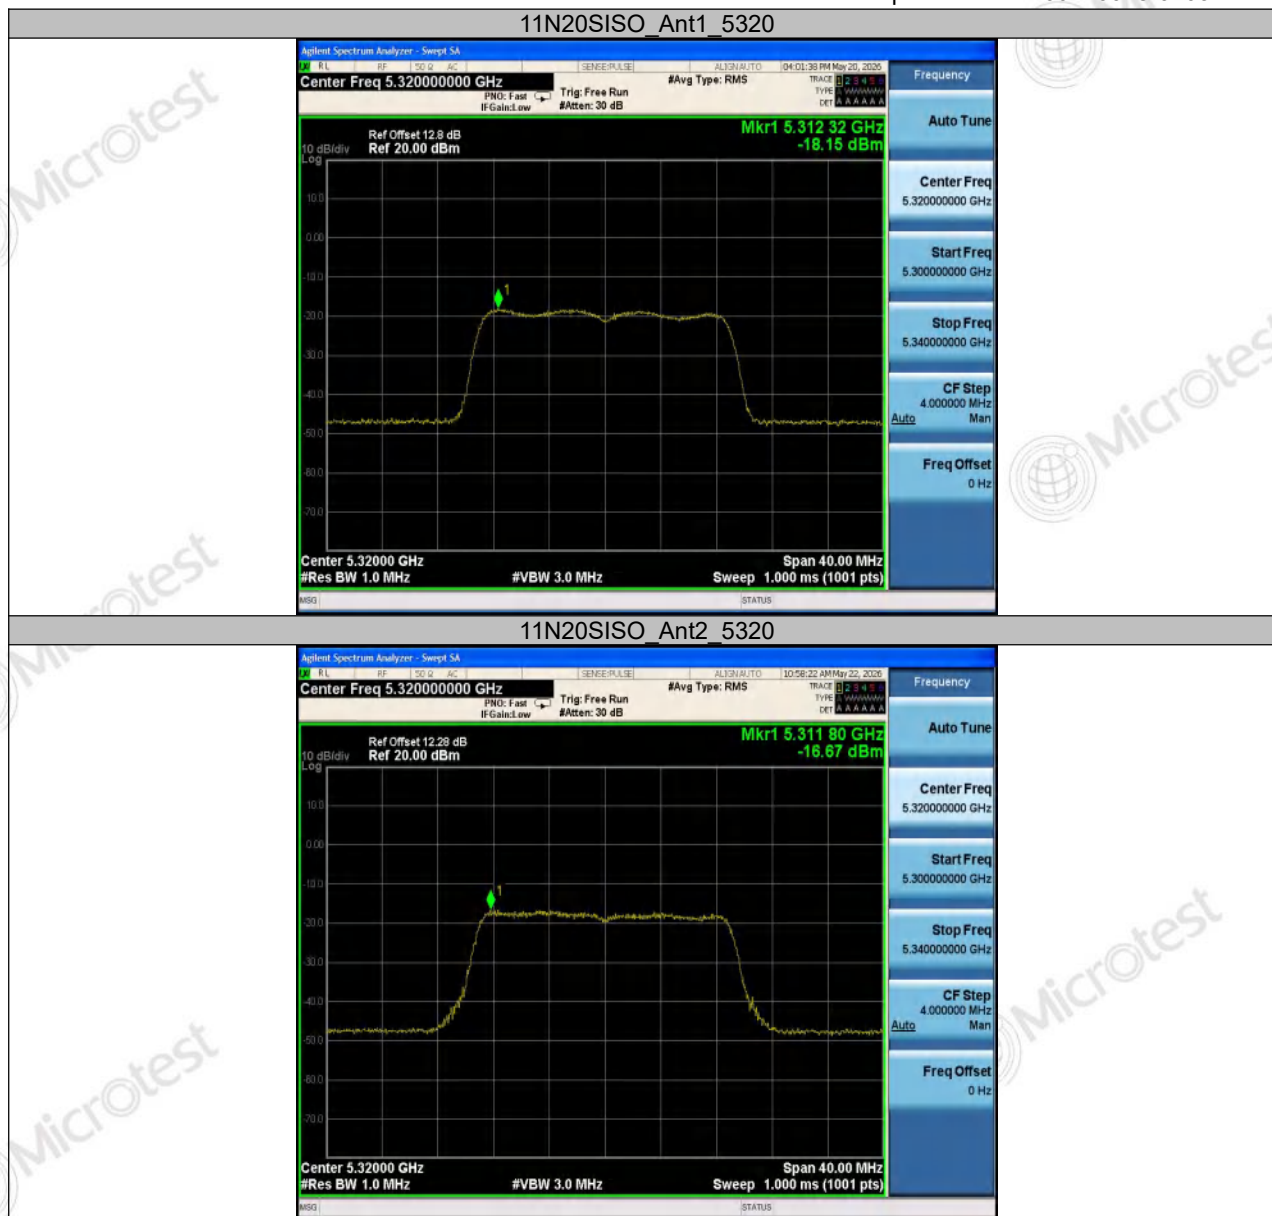

TEST REPORT

Report No.: MTi260410018-0203E4

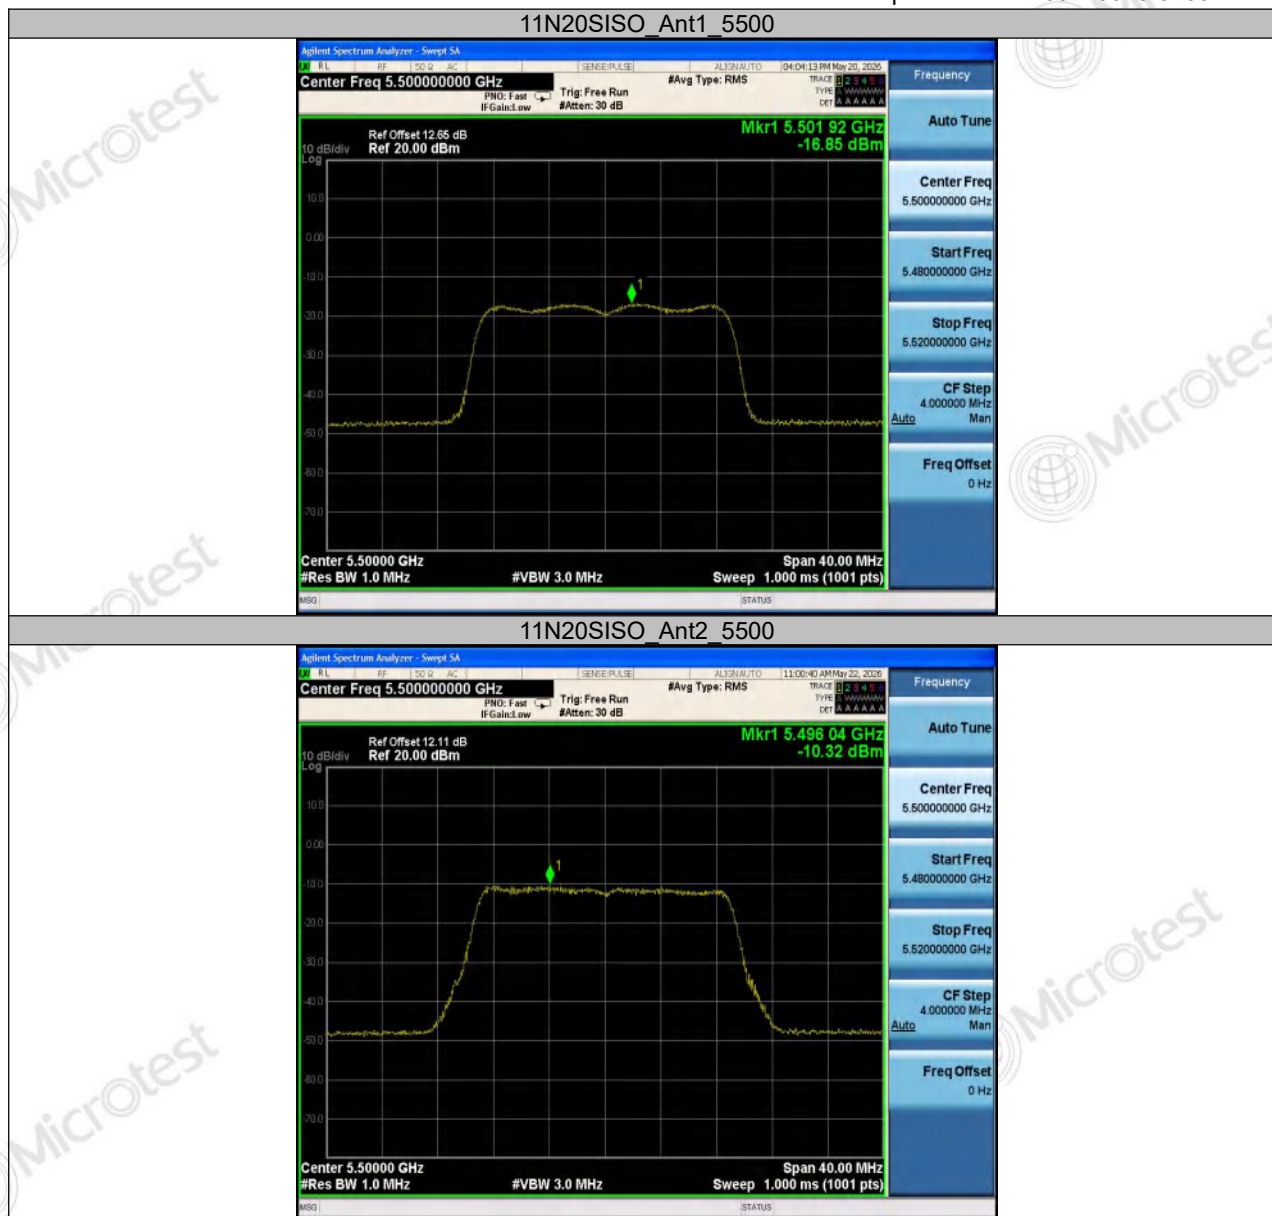

TEST REPORT

Report No.: MTI260410018-0203E4




TEST REPORT

Report No.: MTI260410018-0203E4



TEST REPORT

Report No.: MTI260410018-0203E4

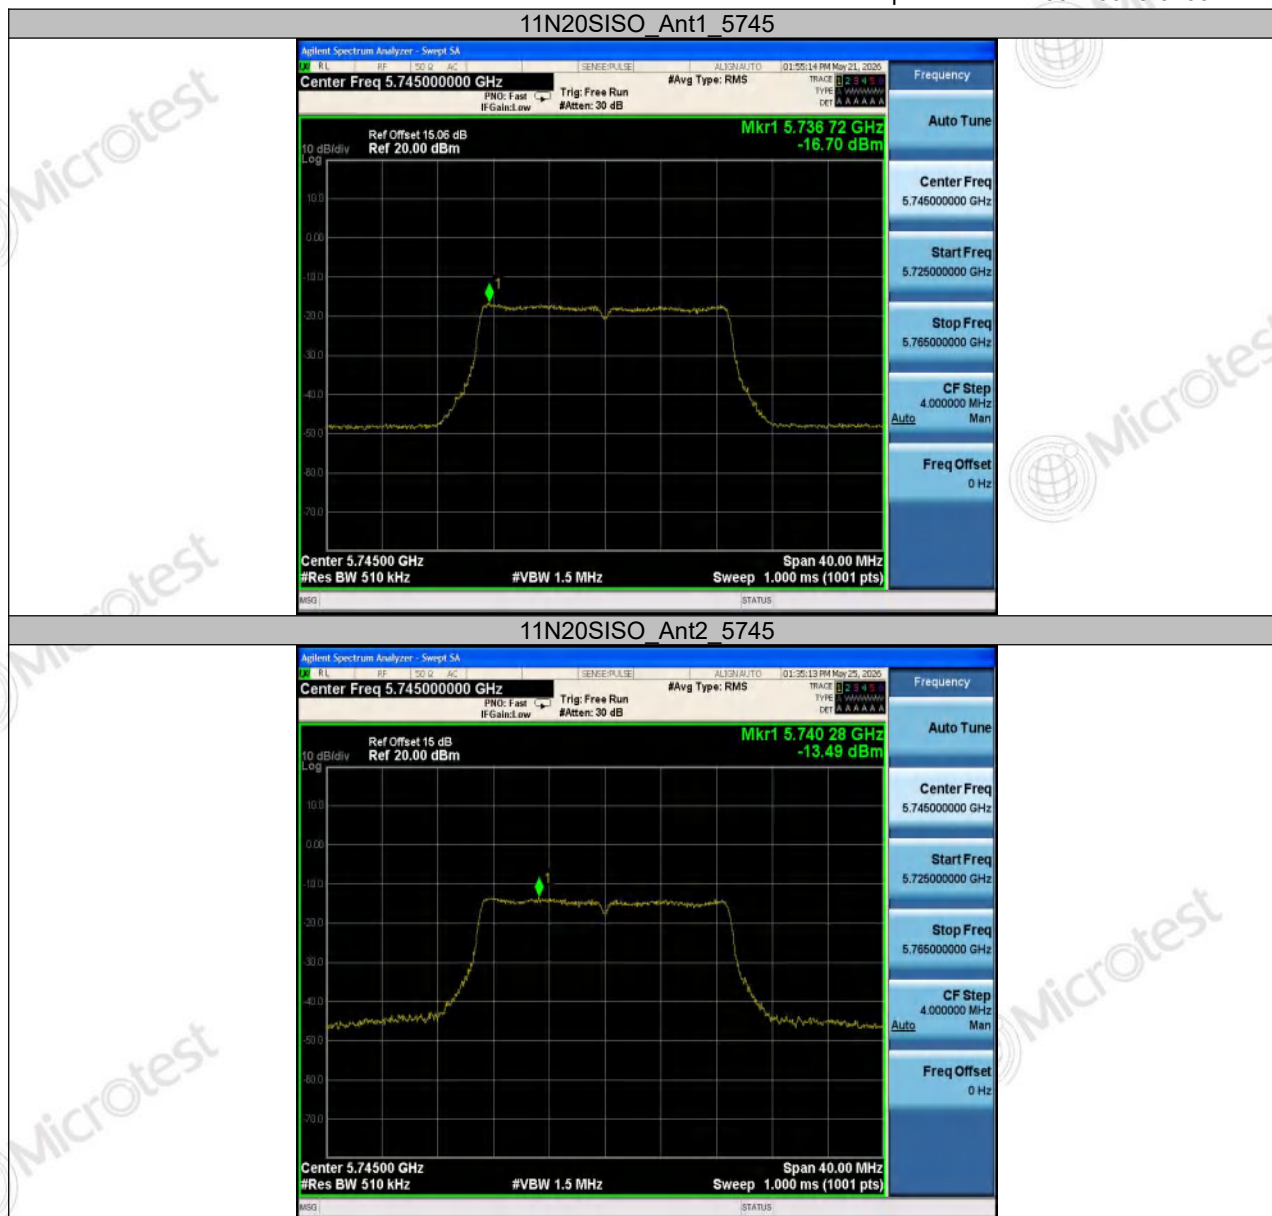


TEST REPORT

Report No.: MTI260410018-0203E4




TEST REPORT

Report No.: MTi260410018-0203E4

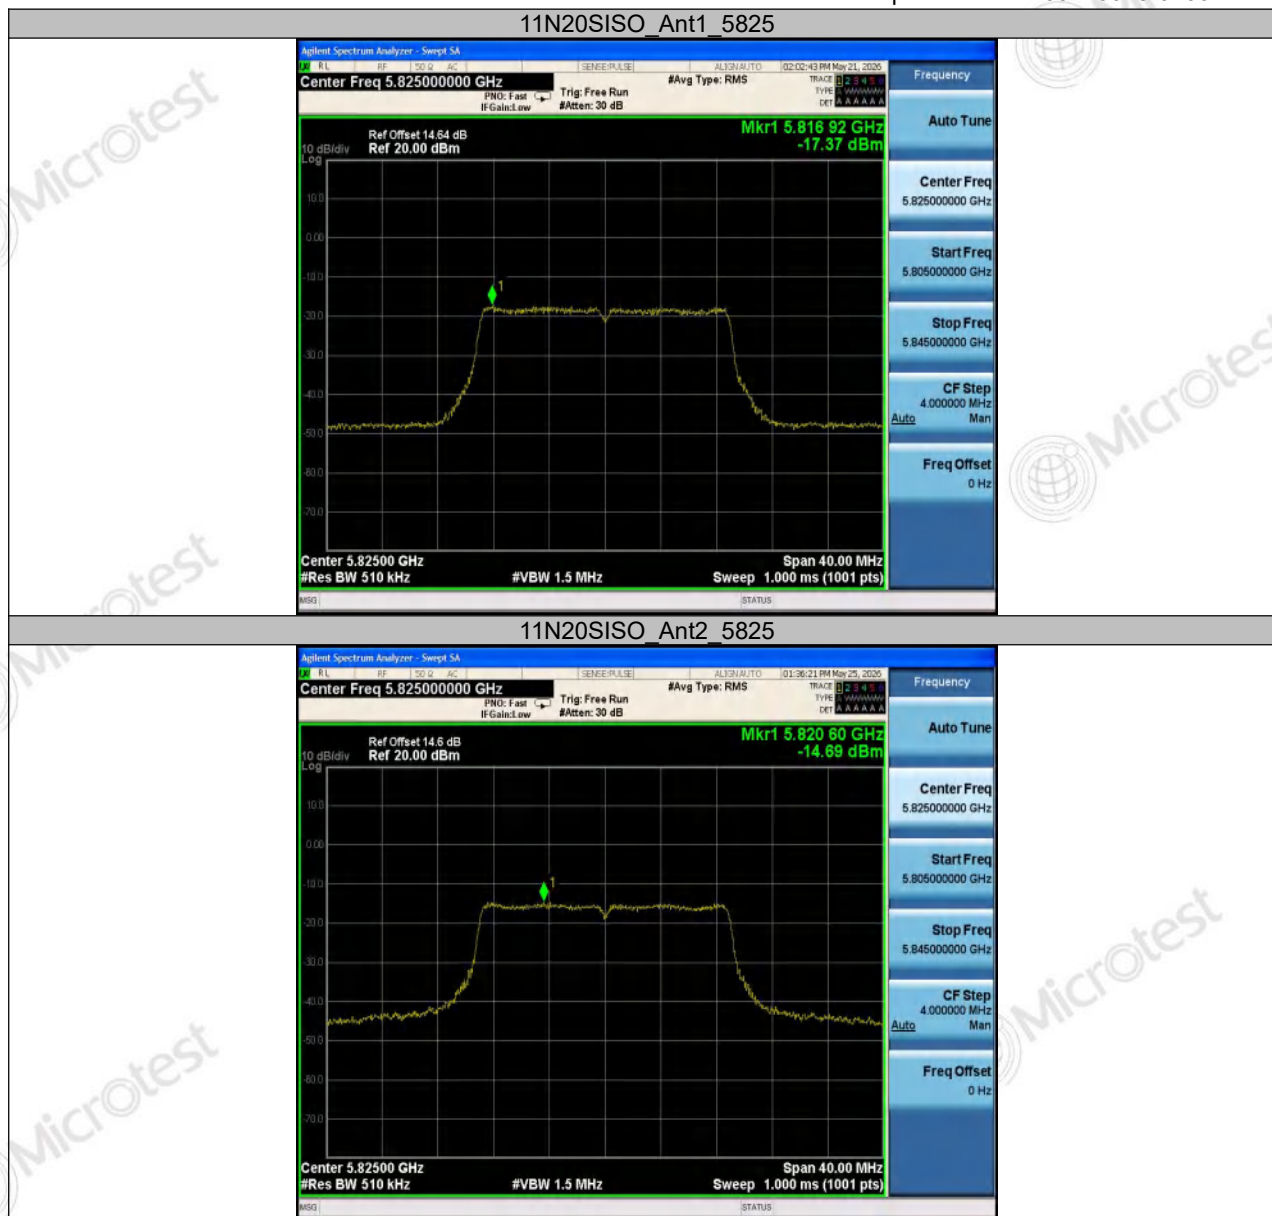


TEST REPORT

Report No.: MTi260410018-0203E4

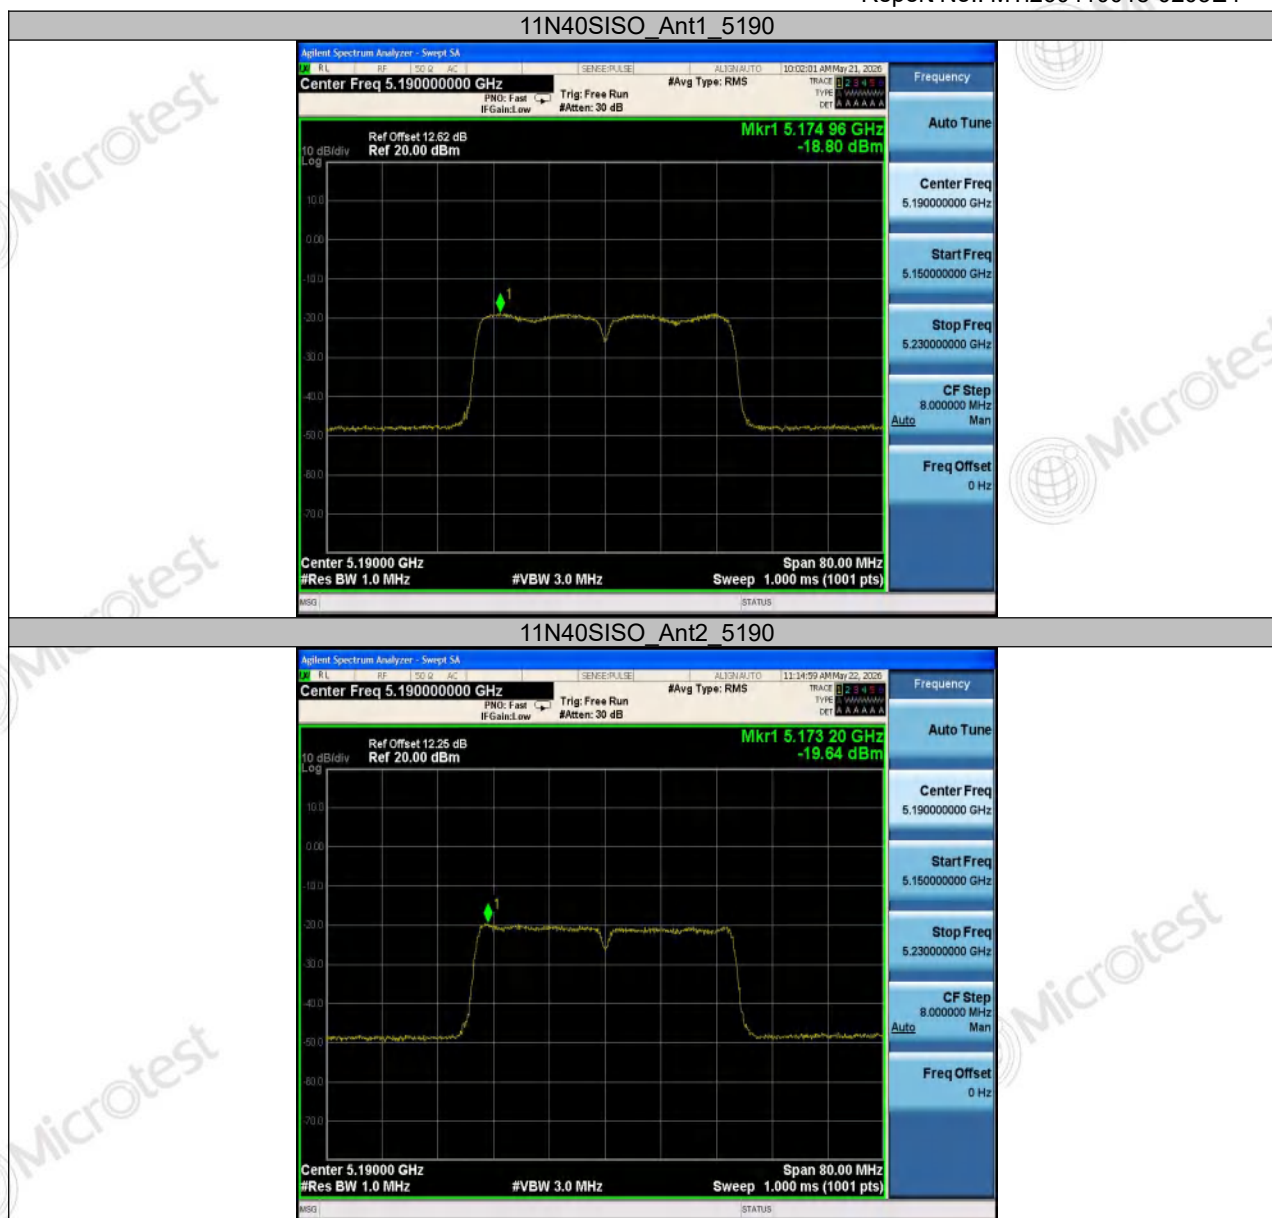

TEST REPORT

Report No.: MTi260410018-0203E4

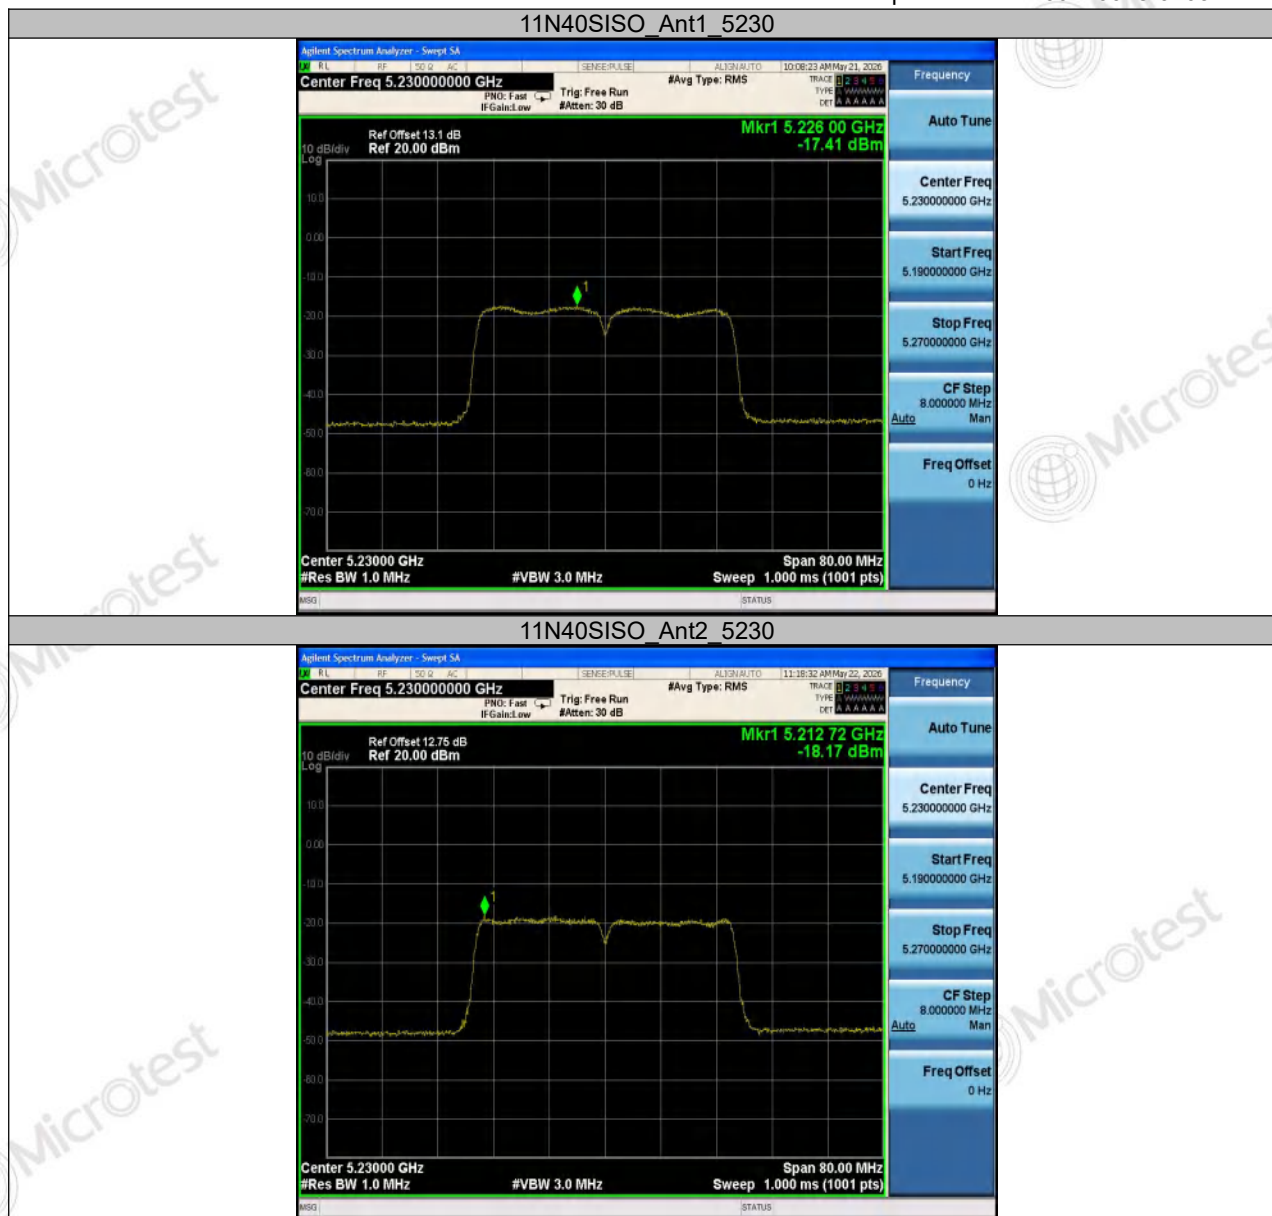


TEST REPORT

Report No.: MTi260410018-0203E4




TEST REPORT

Report No.: MTi260410018-0203E4

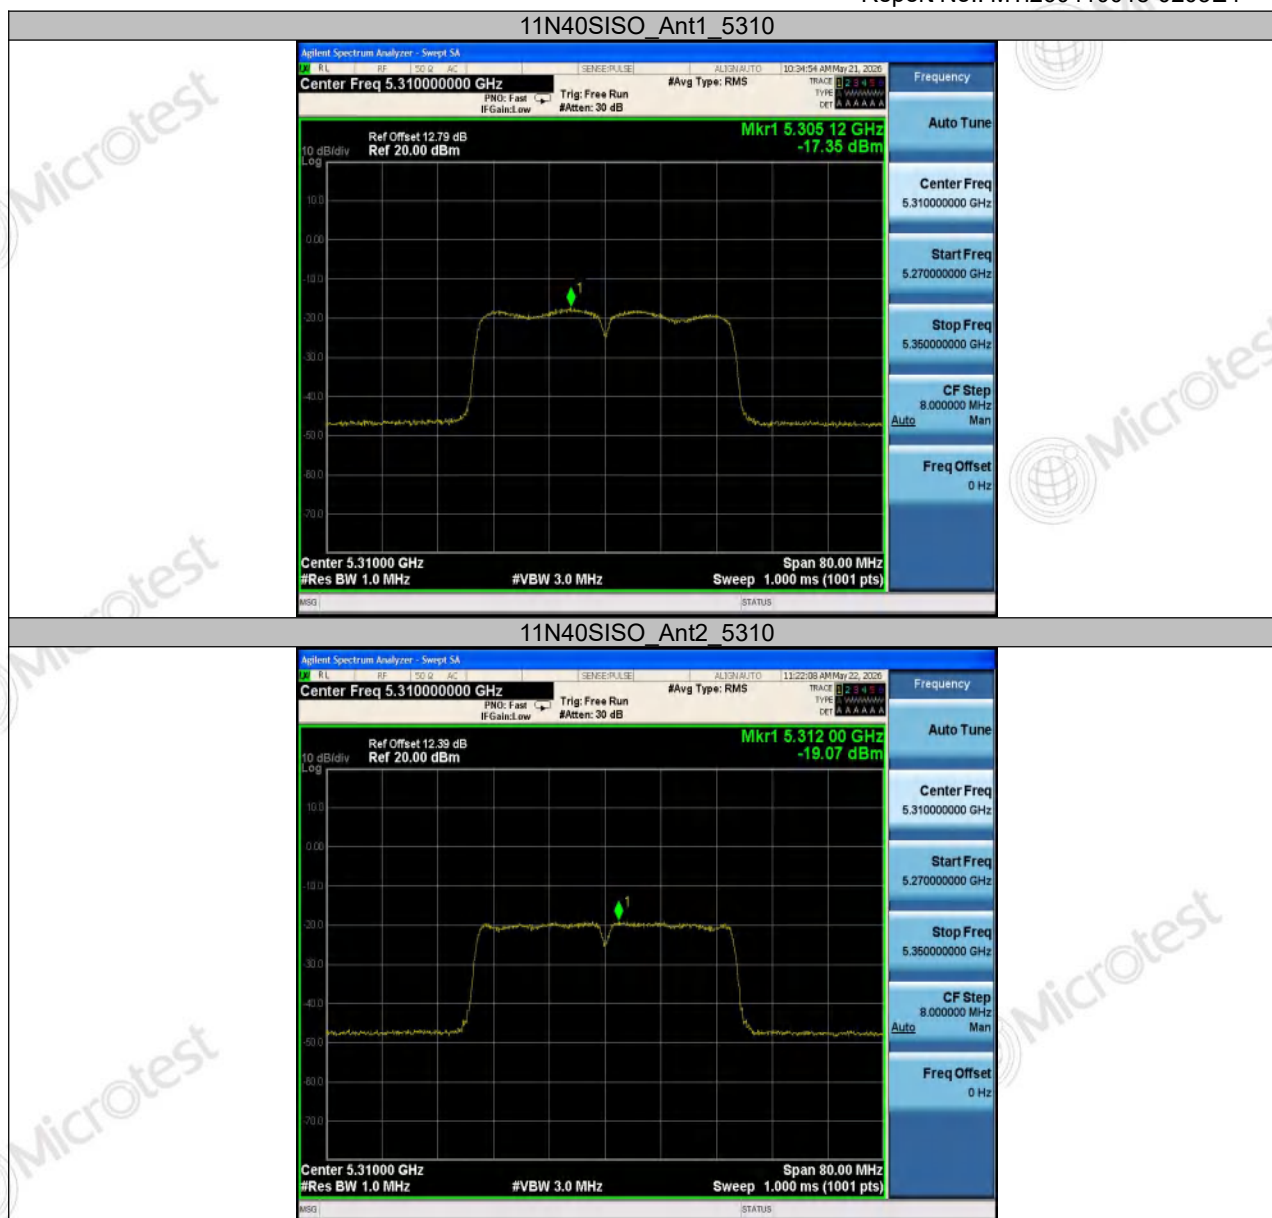


TEST REPORT

Report No.: MTI260410018-0203E4

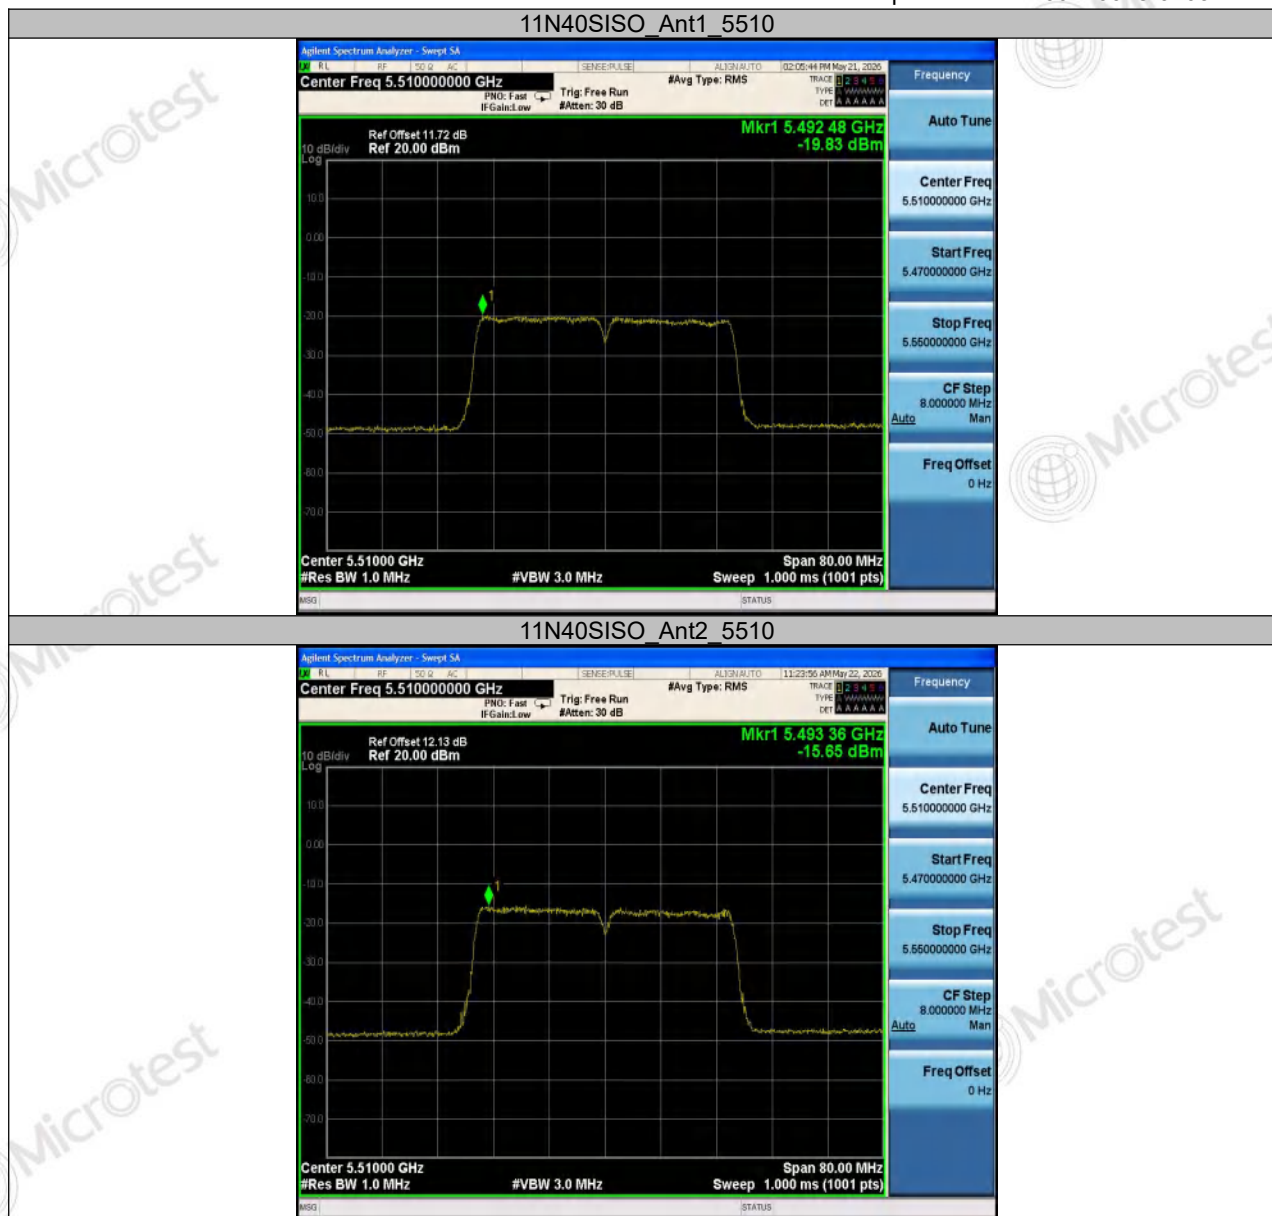


TEST REPORT

Report No.: MTI260410018-0203E4

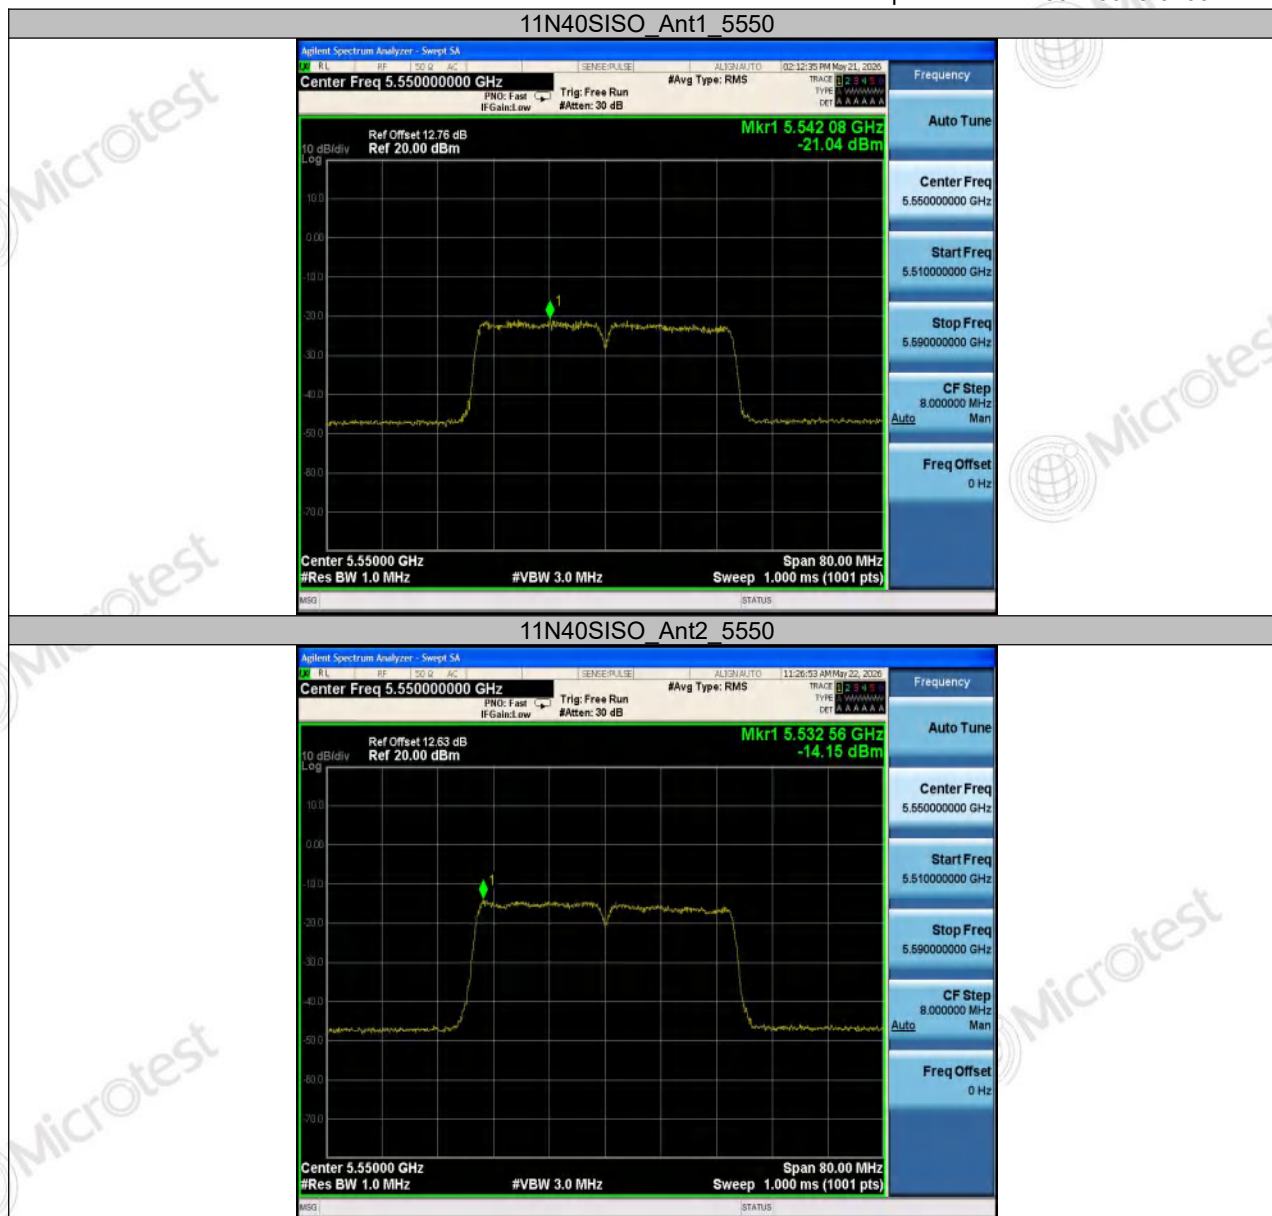


TEST REPORT

Report No.: MTi260410018-0203E4

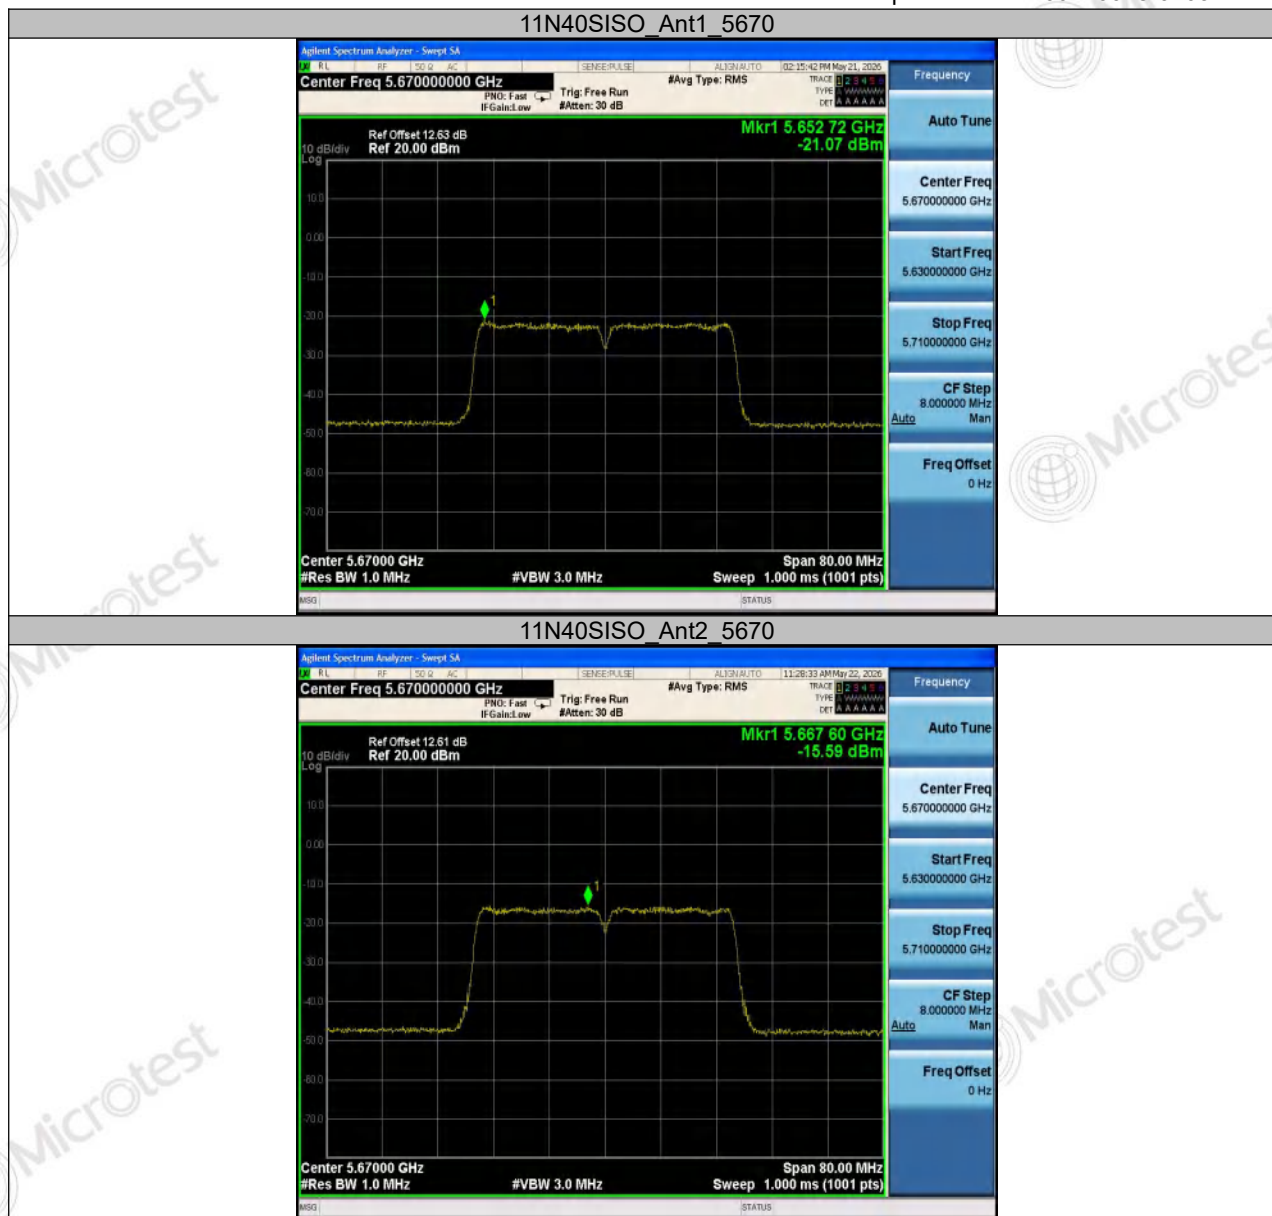


TEST REPORT

Report No.: MTI260410018-0203E4

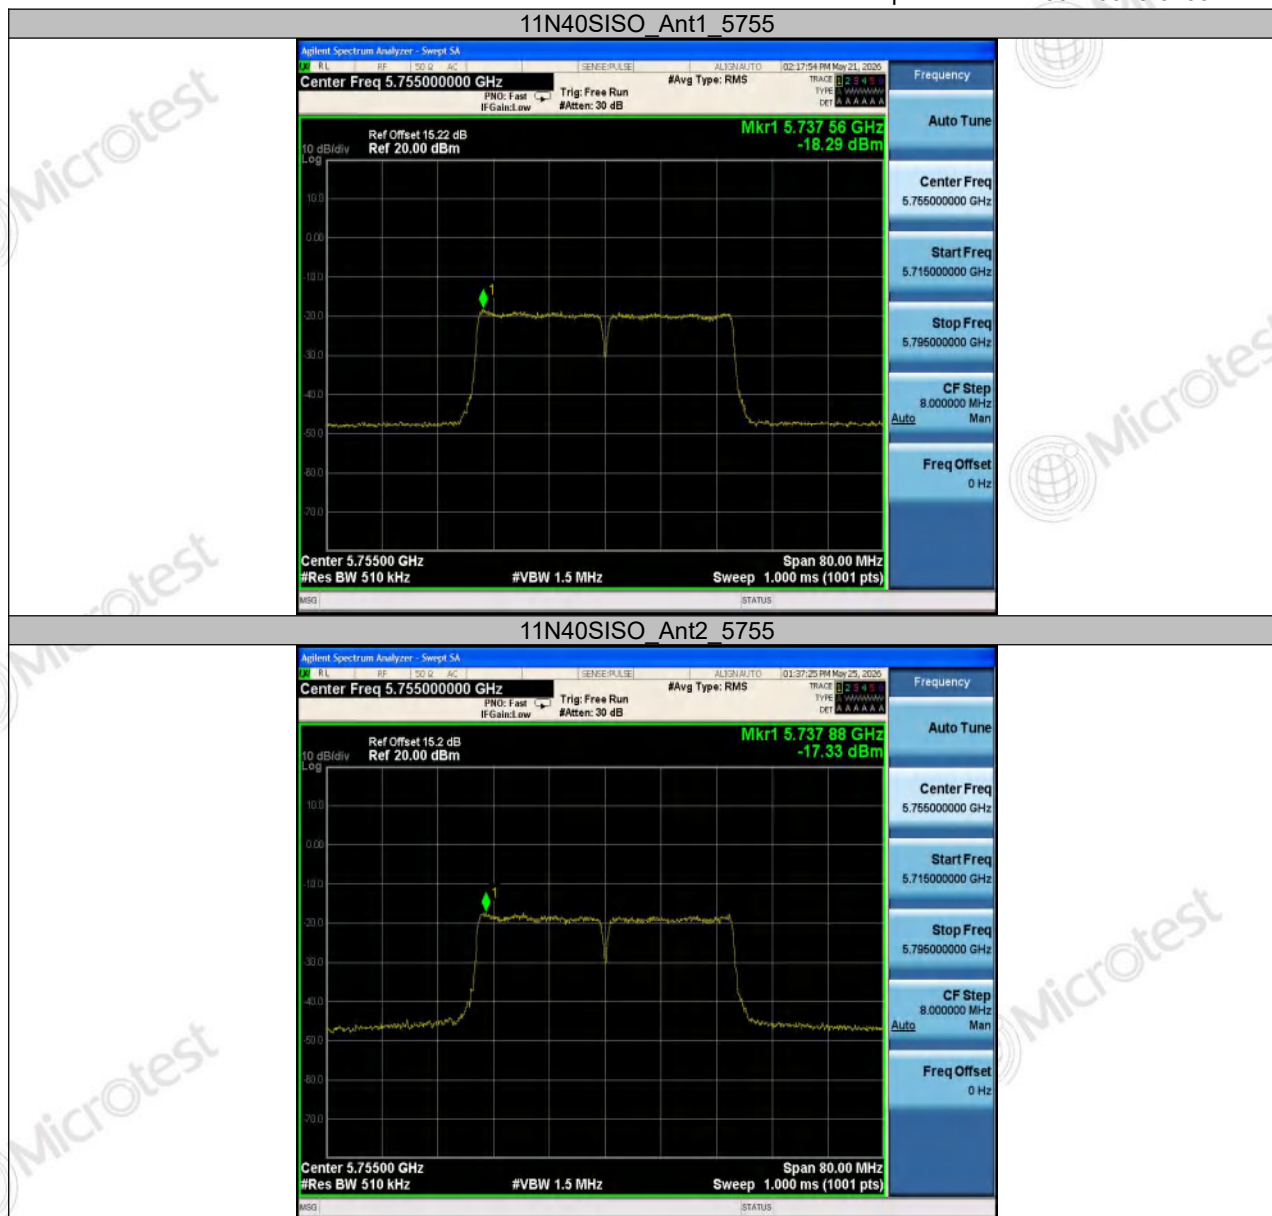


TEST REPORT

Report No.: MTi260410018-0203E4

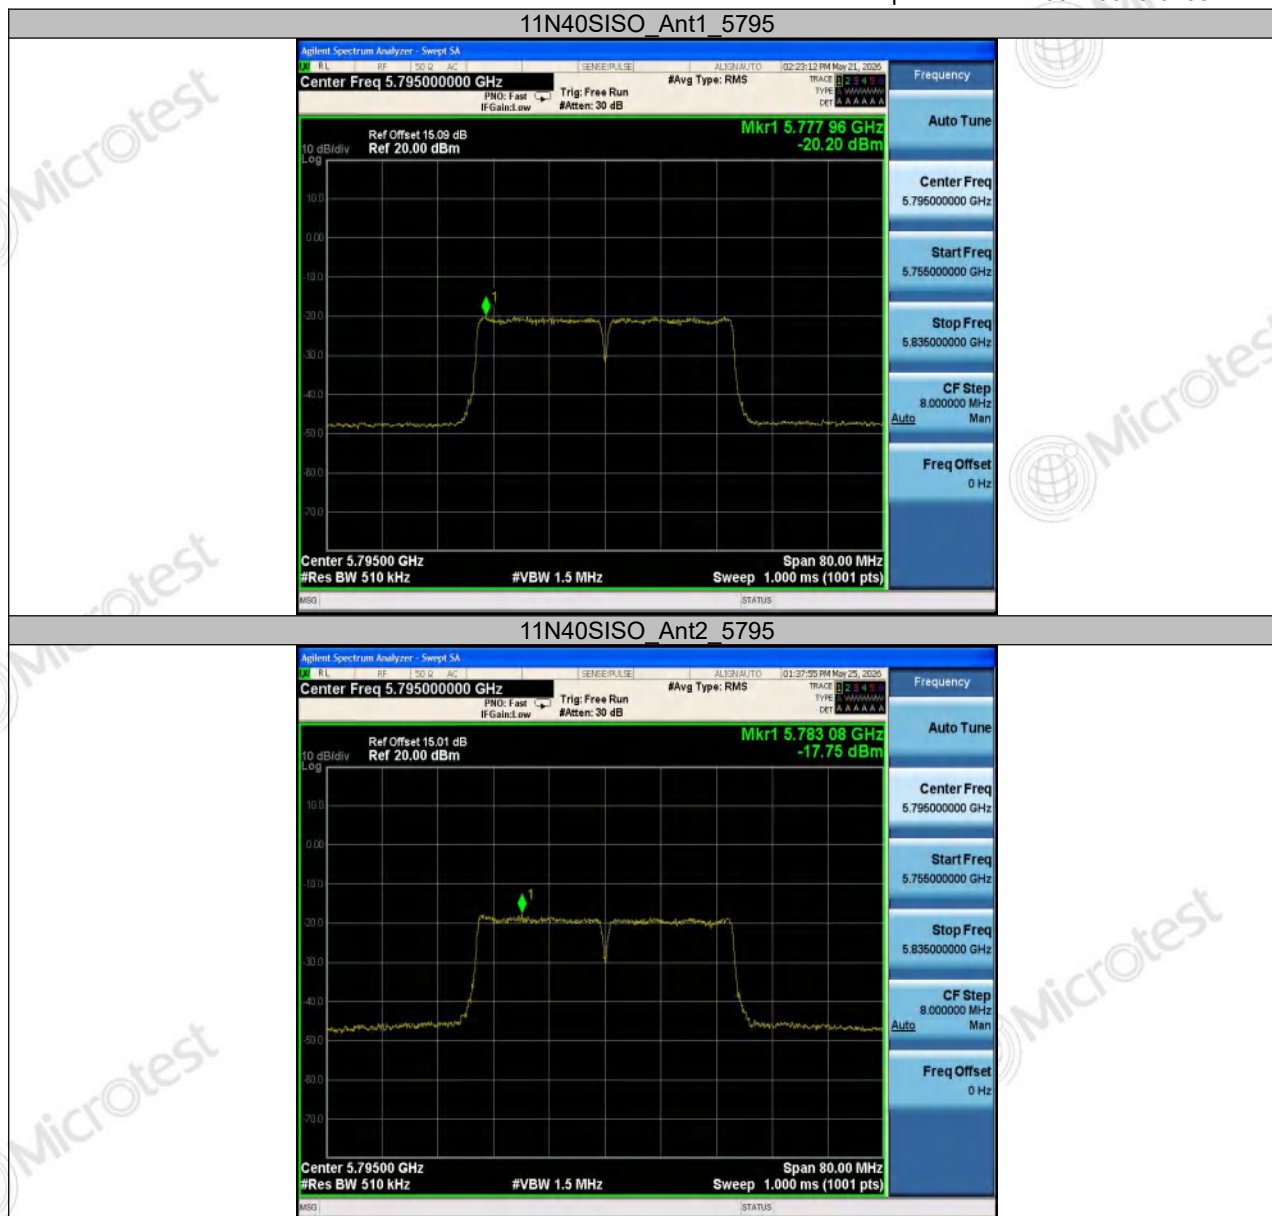


TEST REPORT

Report No.: MTi260410018-0203E4

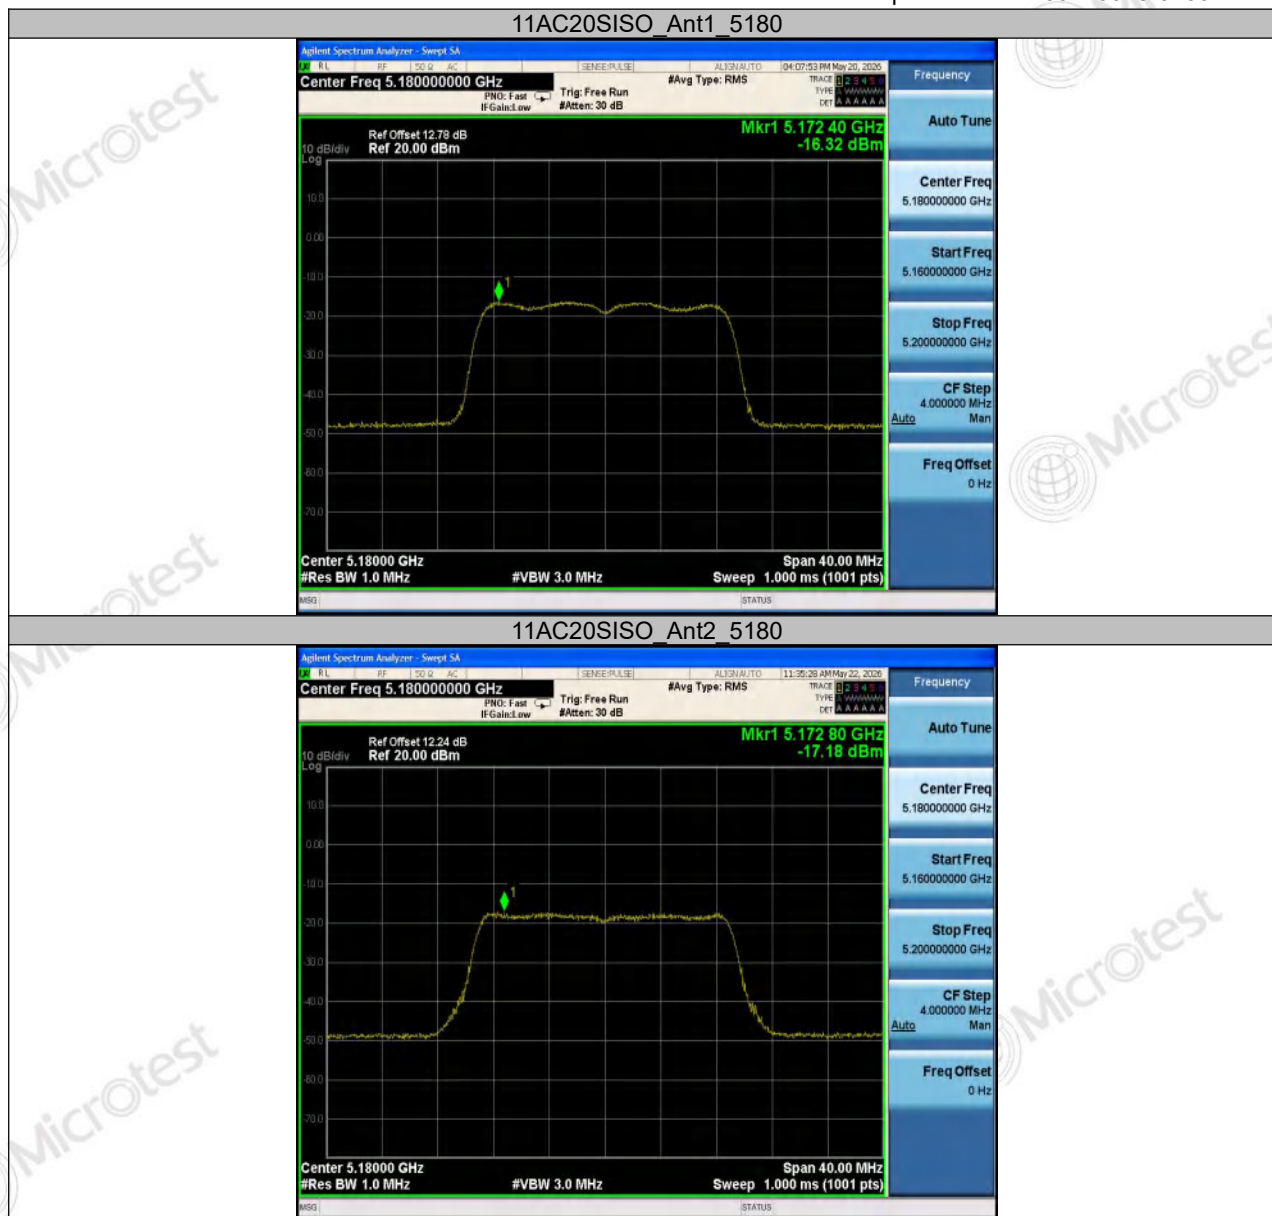


TEST REPORT

Report No.: MTi260410018-0203E4

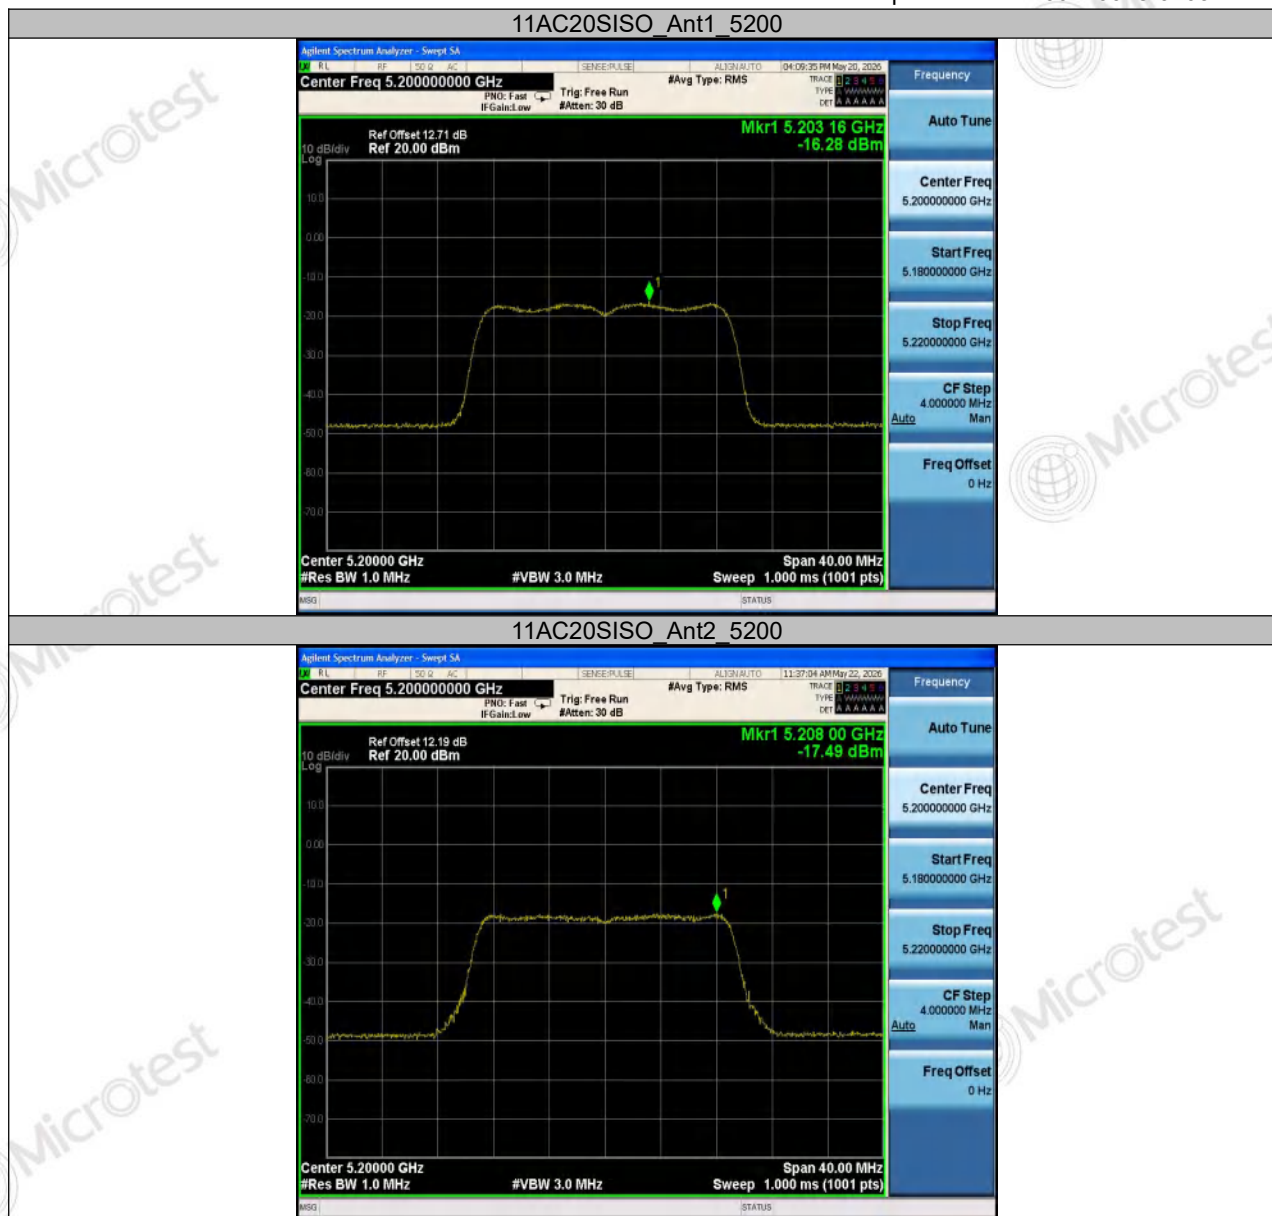

TEST REPORT

Report No.: MTi260410018-0203E4

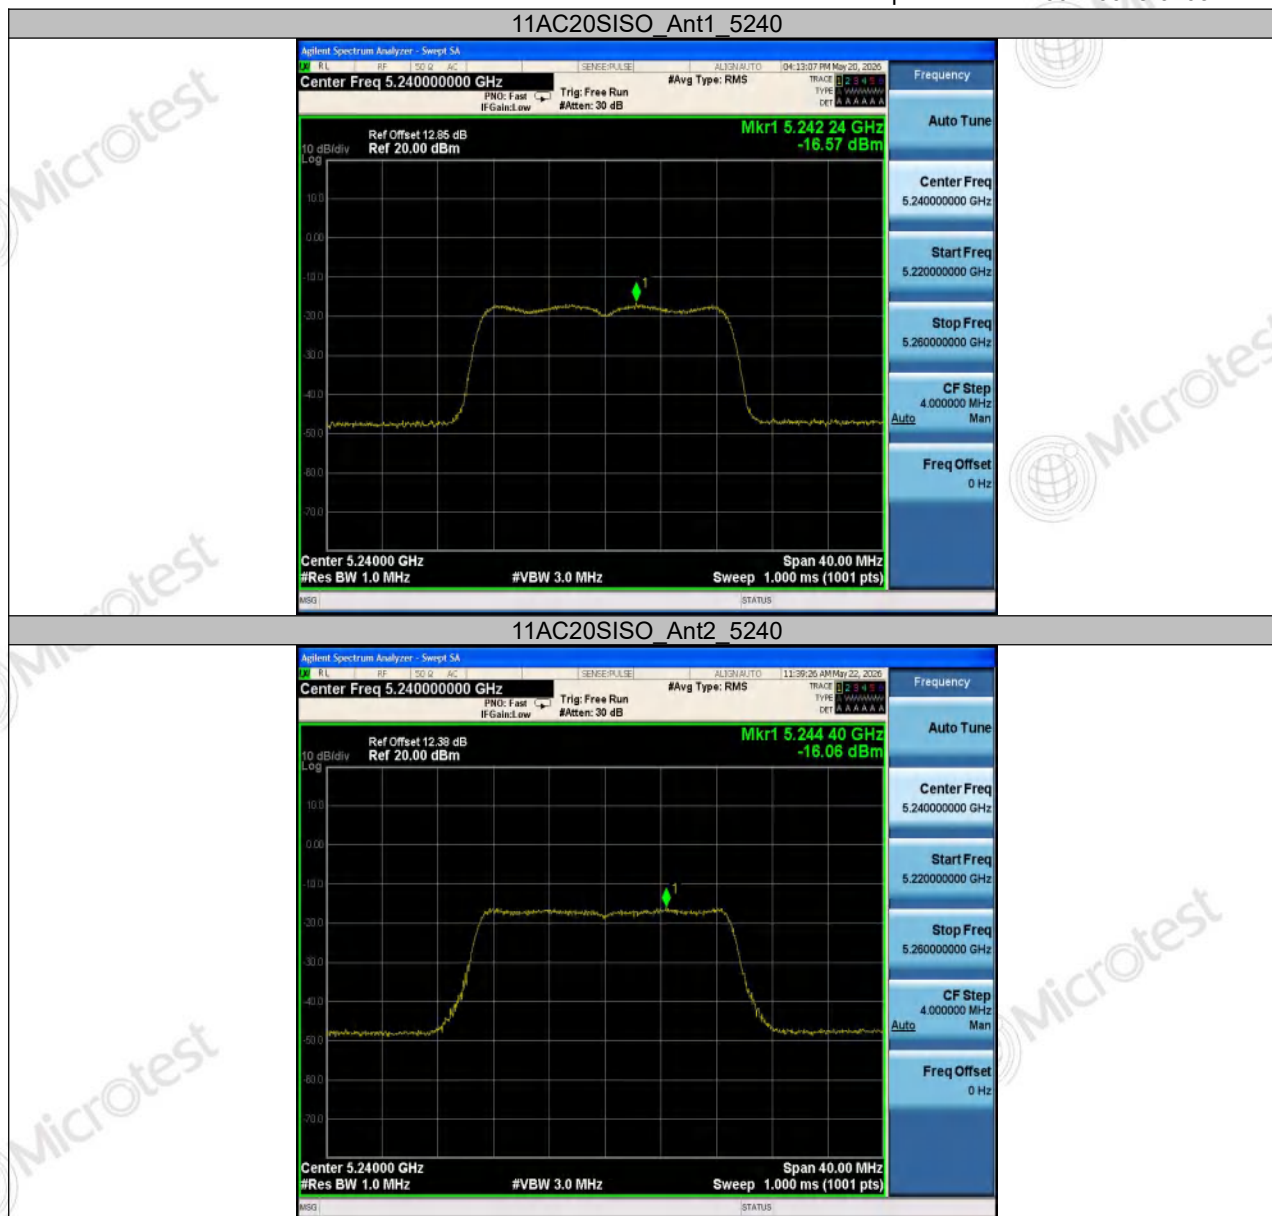

TEST REPORT

Report No.: MTi260410018-0203E4




TEST REPORT

Report No.: MTi260410018-0203E4




TEST REPORT

Report No.: MTi260410018-0203E4

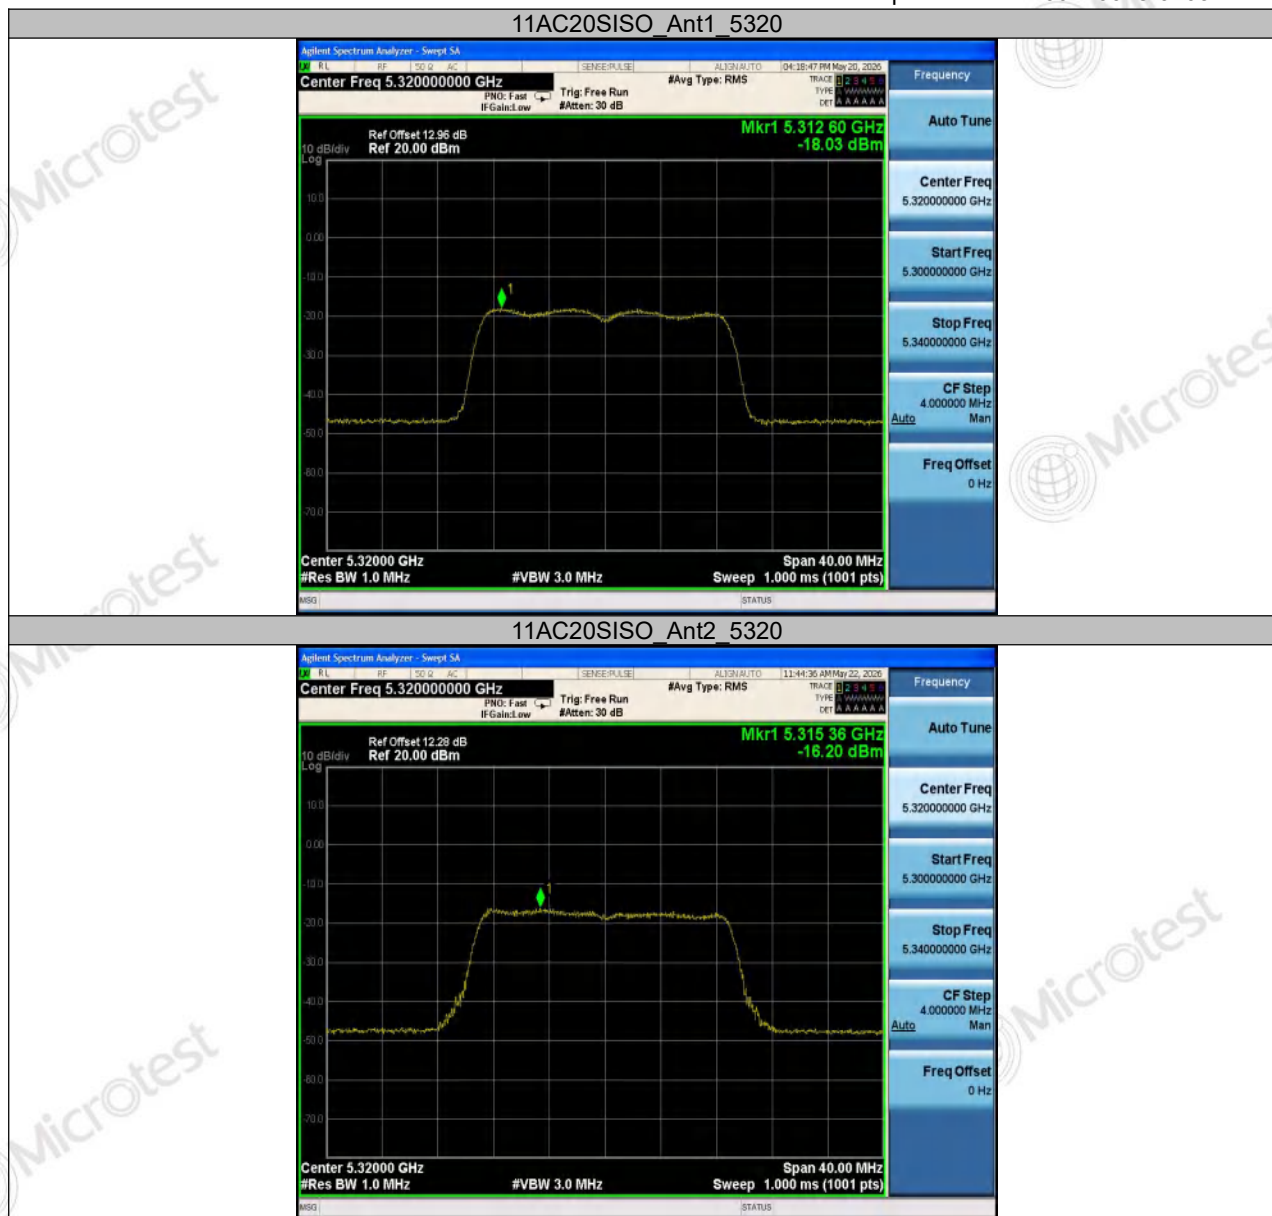

TEST REPORT

Report No.: MTi260410018-0203E4

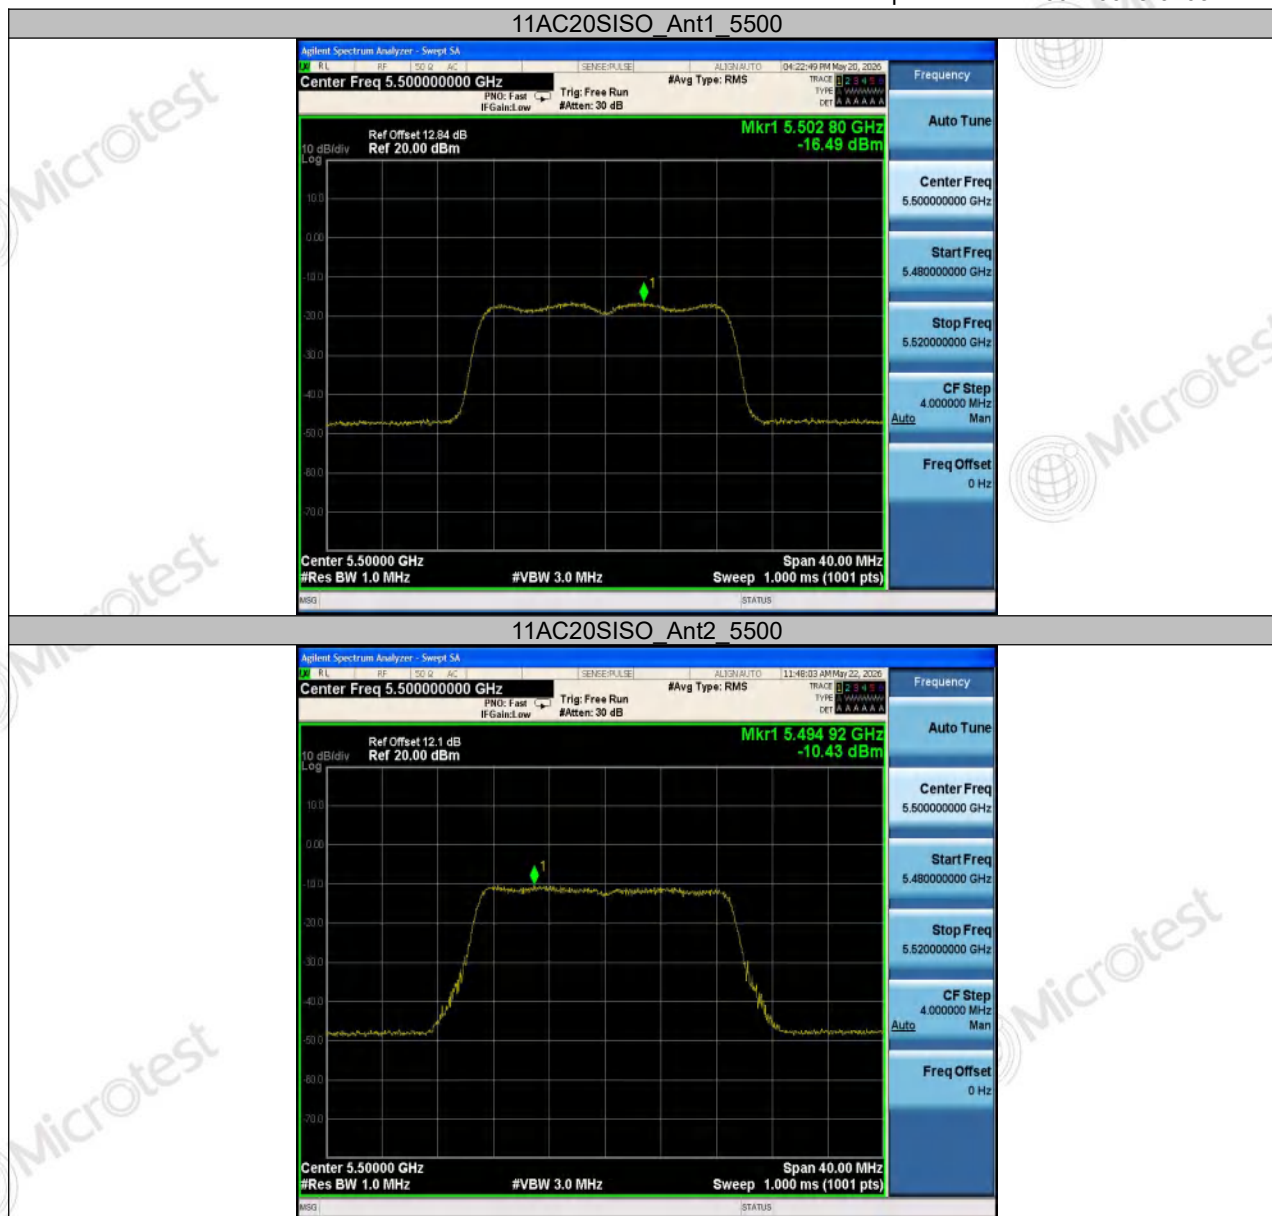

TEST REPORT

Report No.: MTi260410018-0203E4



TEST REPORT

Report No.: MTi260410018-0203E4



TEST REPORT

Report No.: MTi260410018-0203E4



TEST REPORT

Report No.: MTI260410018-0203E4




TEST REPORT

Report No.: MTi260410018-0203E4




TEST REPORT

Report No.: MTi260410018-0203E4

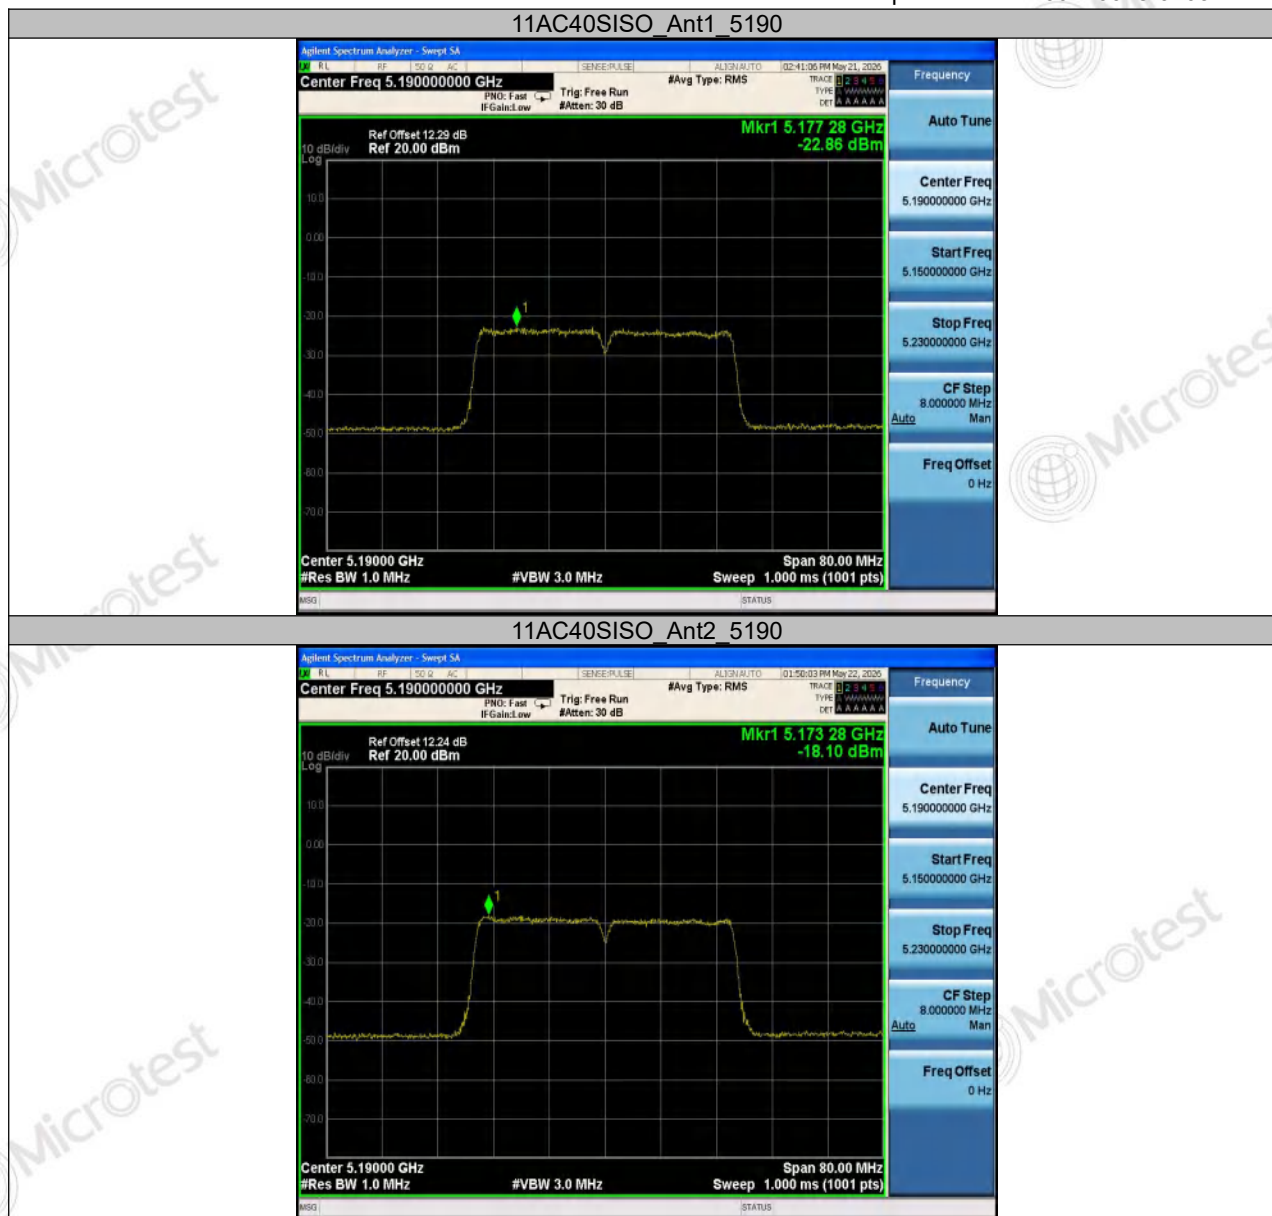


TEST REPORT

Report No.: MTI260410018-0203E4

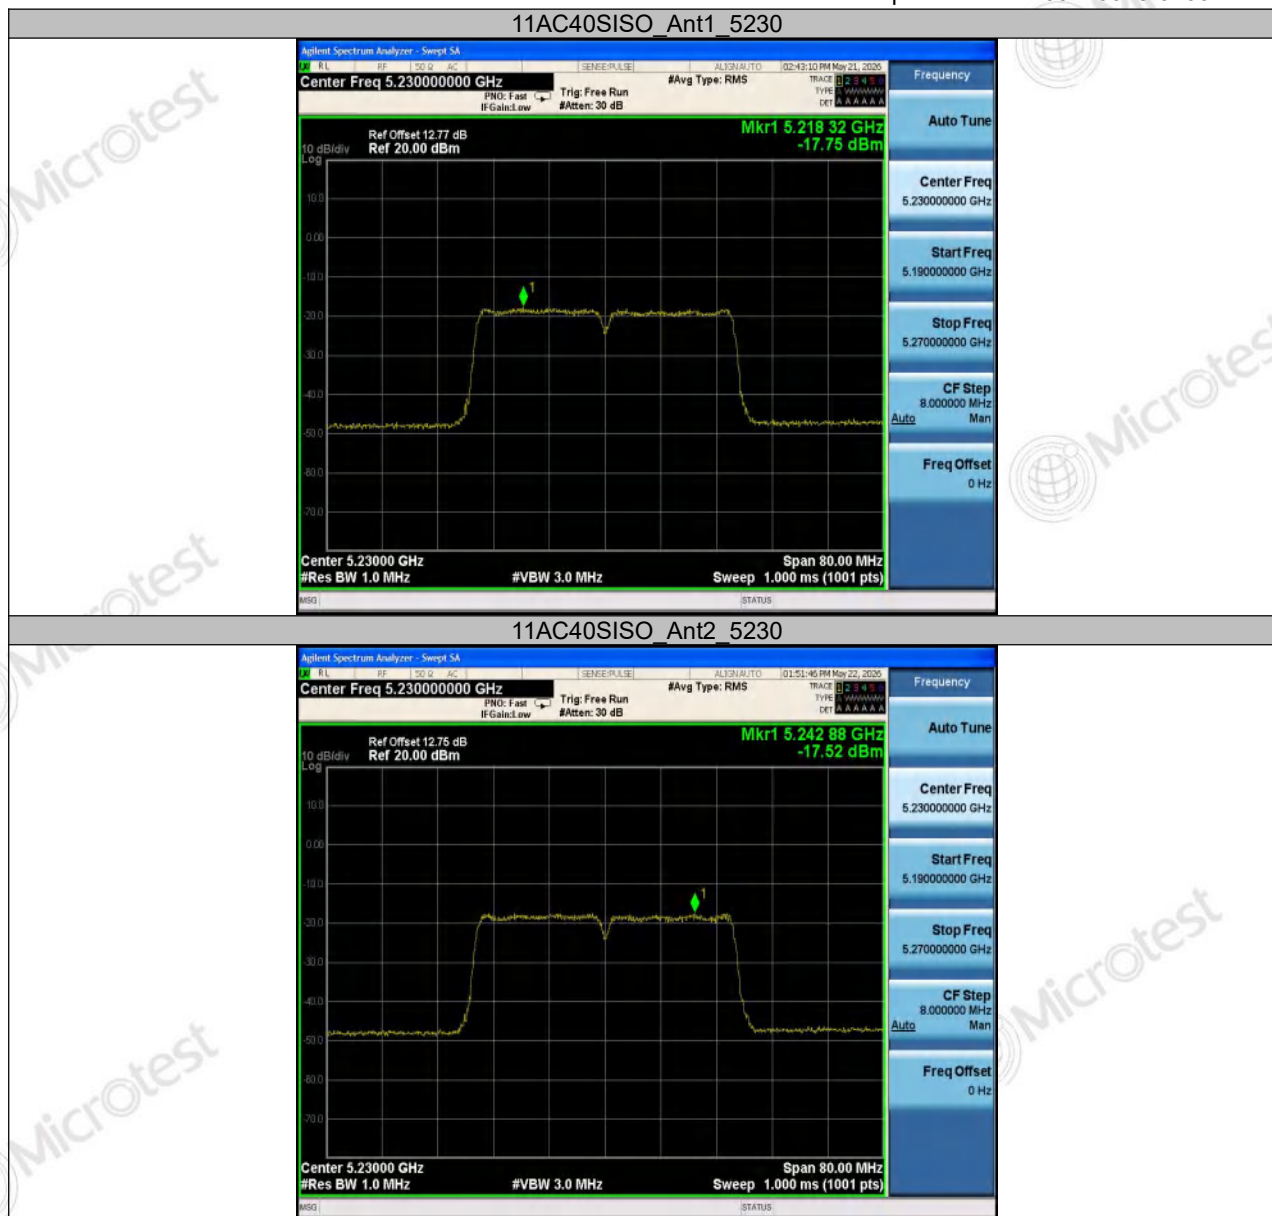


TEST REPORT

Report No.: MTi260410018-0203E4

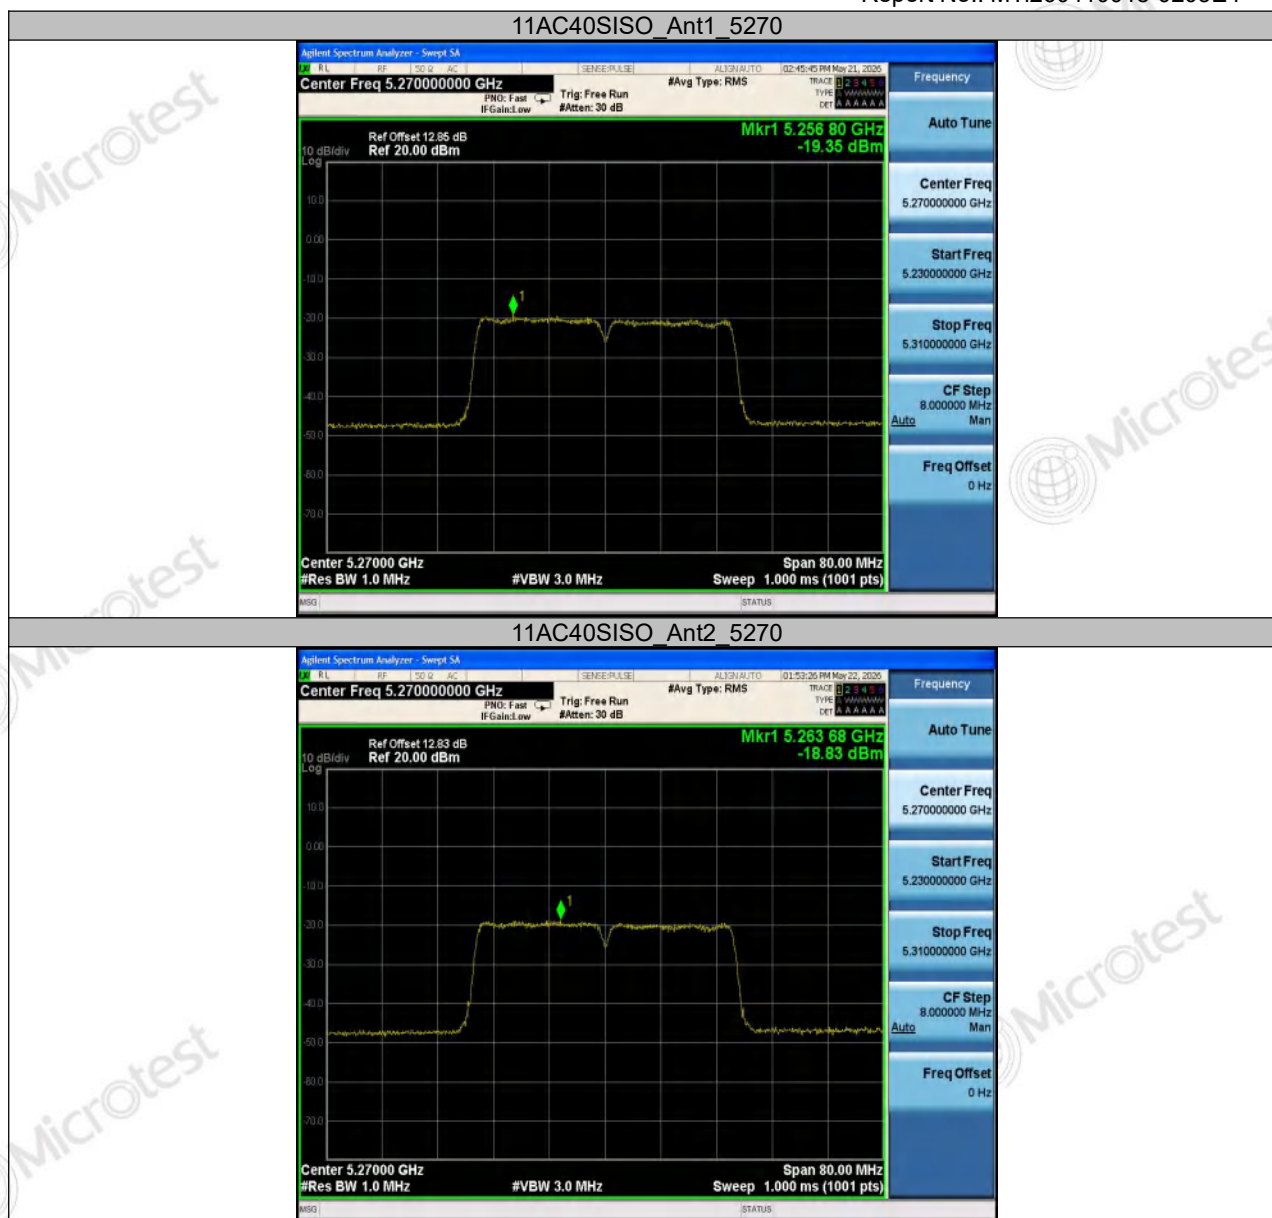


TEST REPORT

Report No.: MTi260410018-0203E4

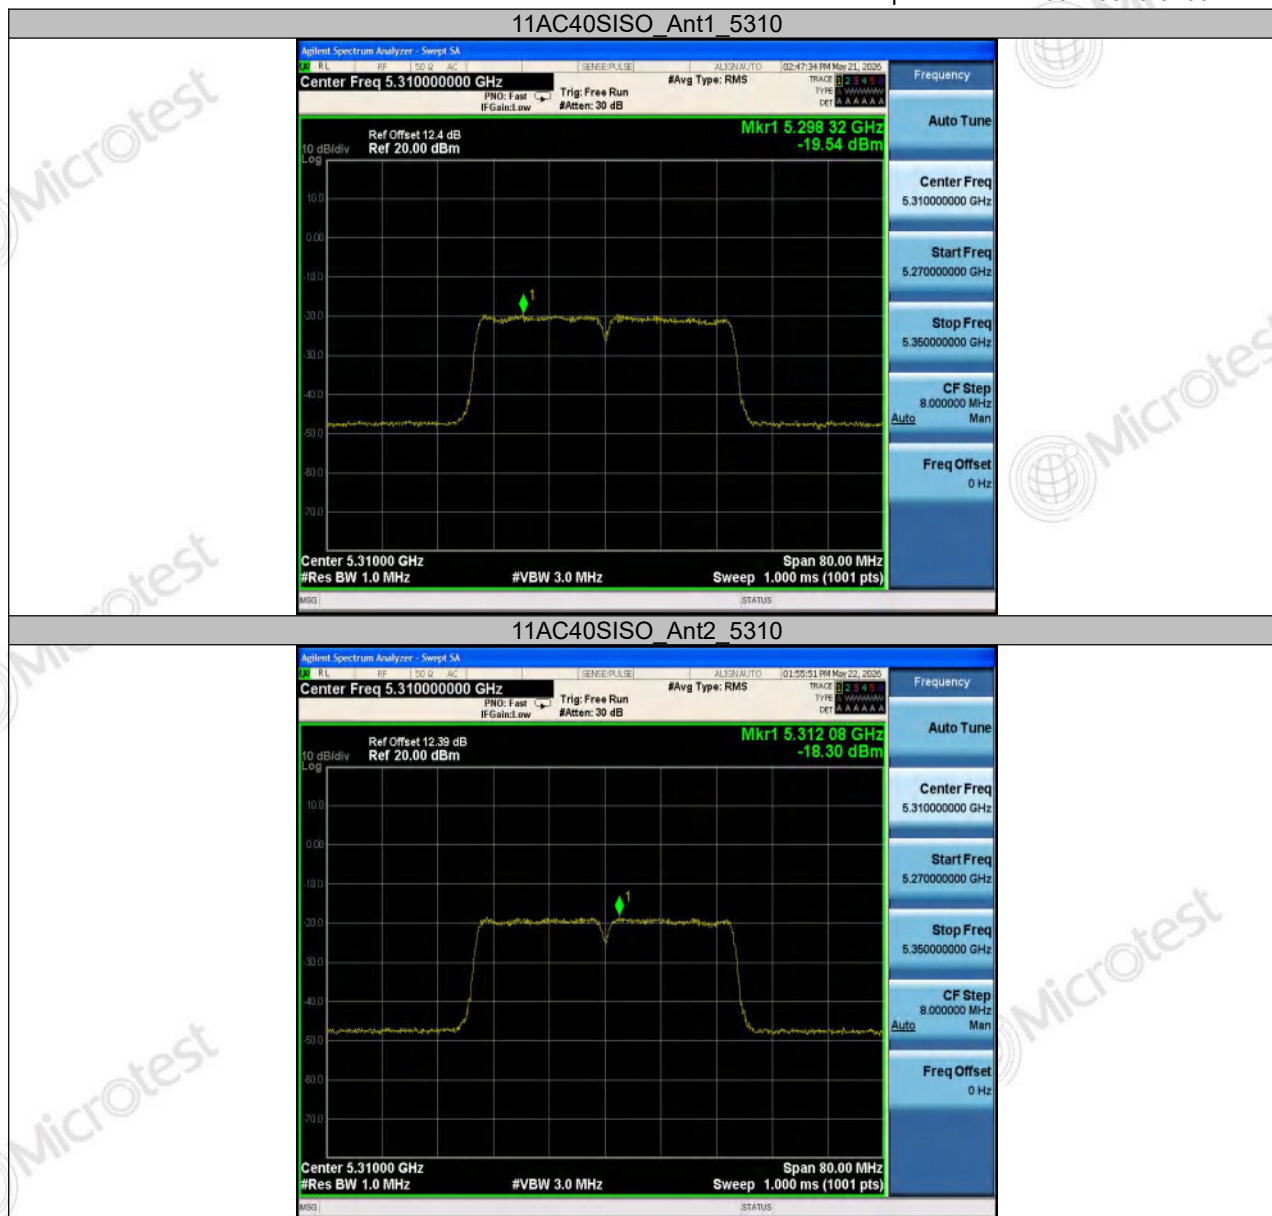


TEST REPORT

Report No.: MTi260410018-0203E4

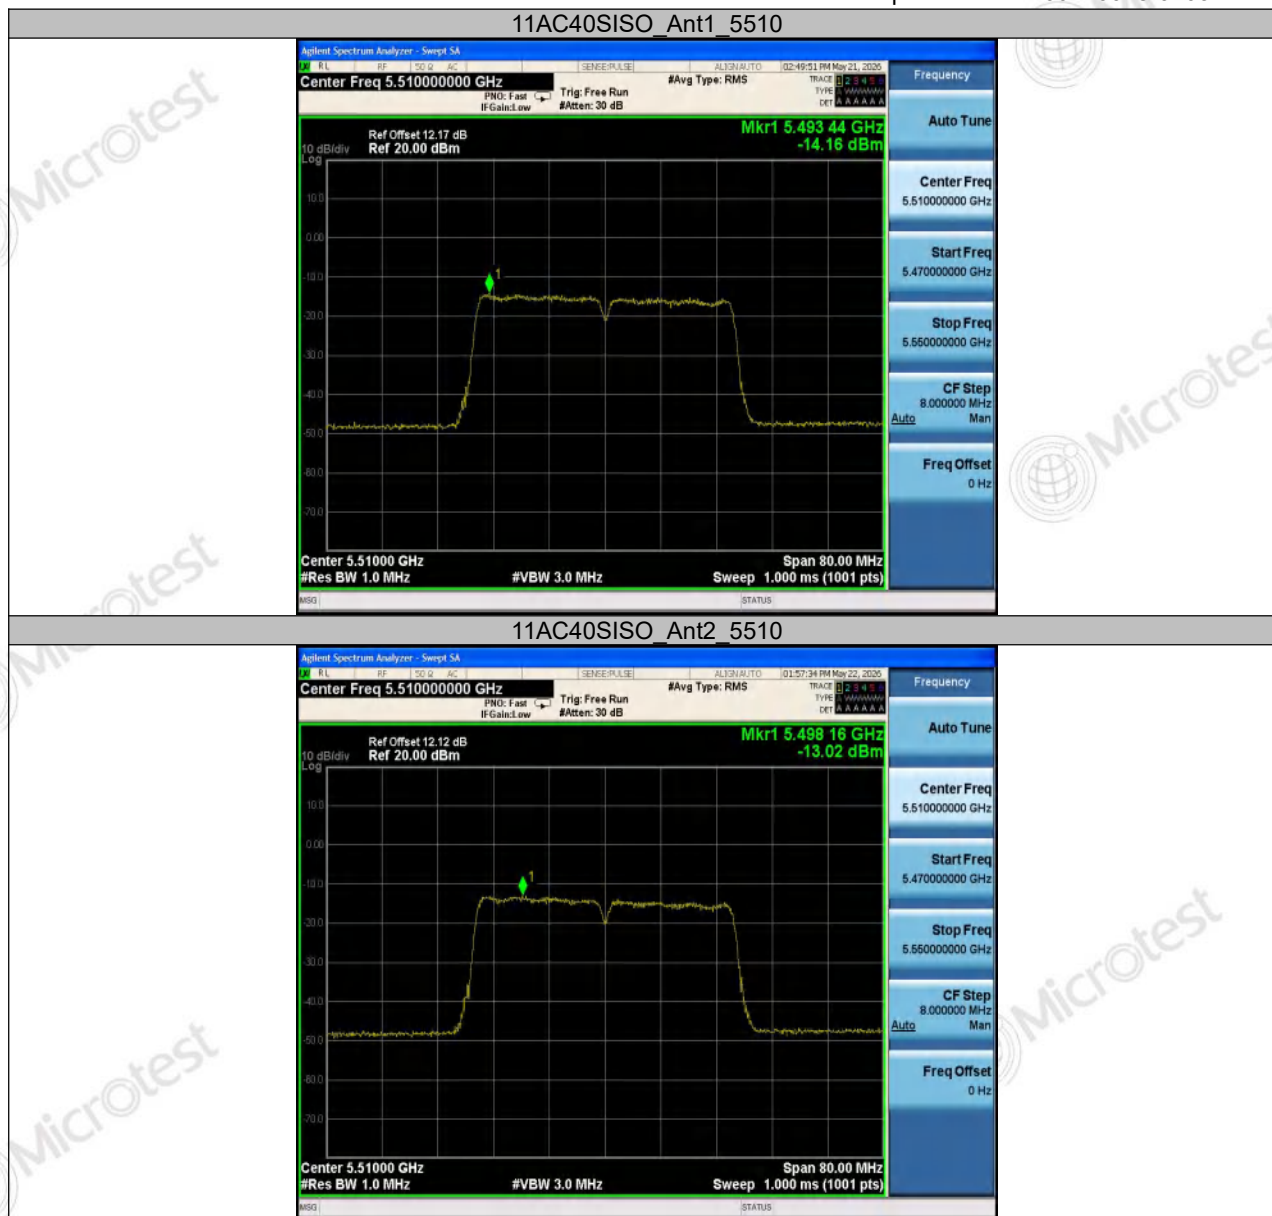


TEST REPORT

Report No.: MTi260410018-0203E4

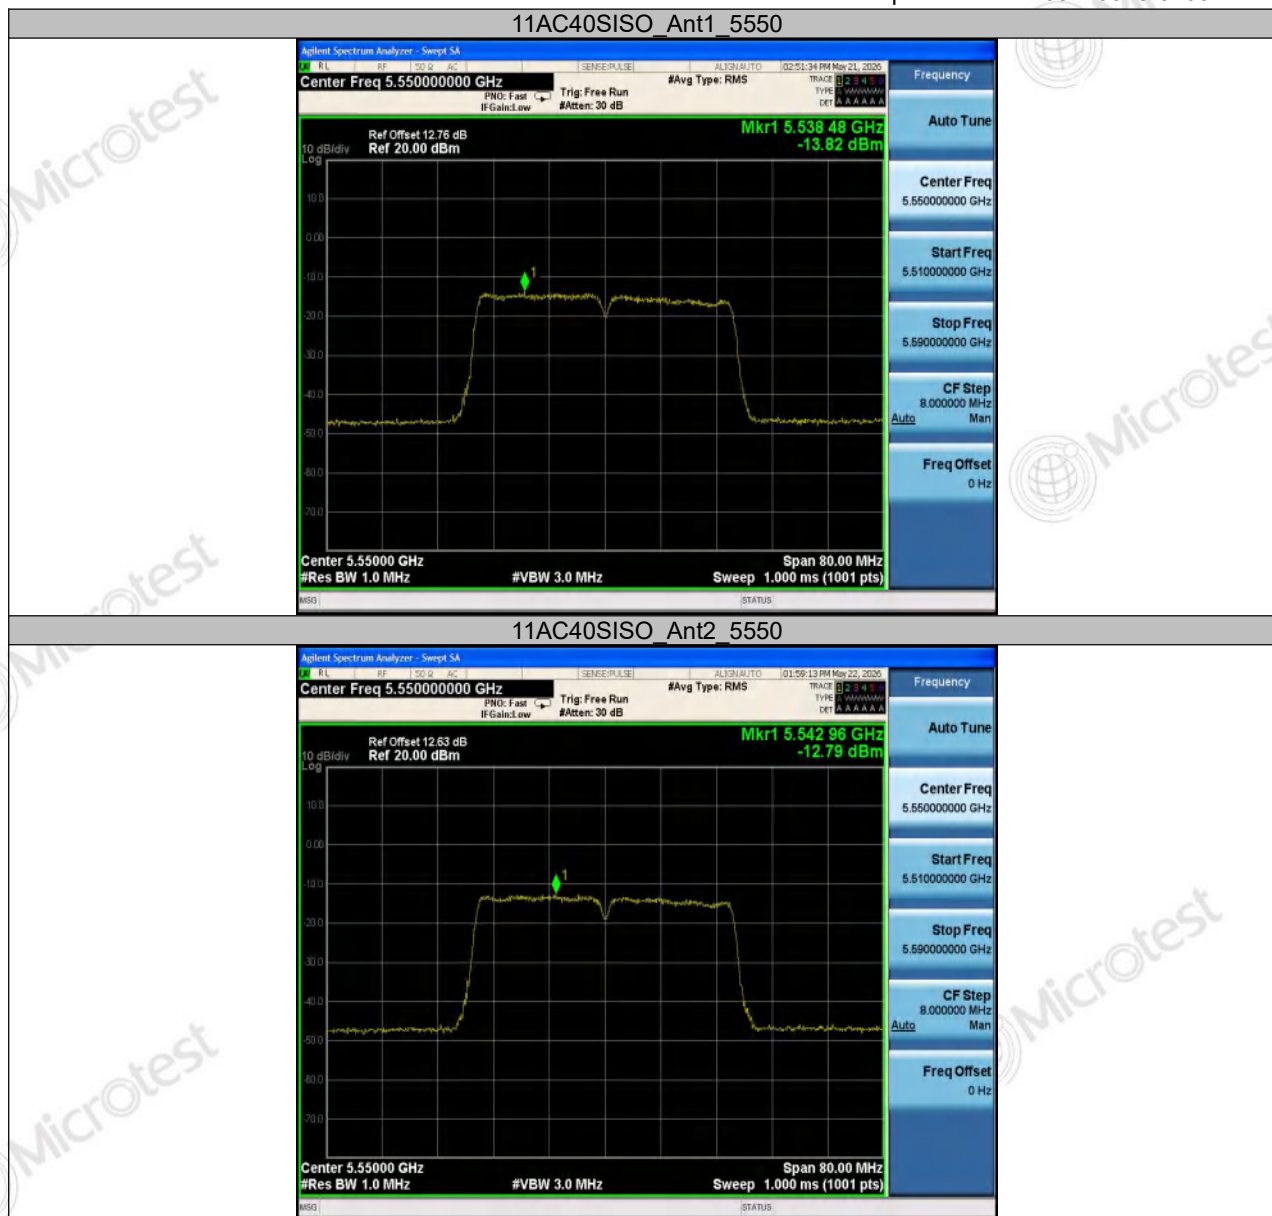


TEST REPORT

Report No.: MTi260410018-0203E4

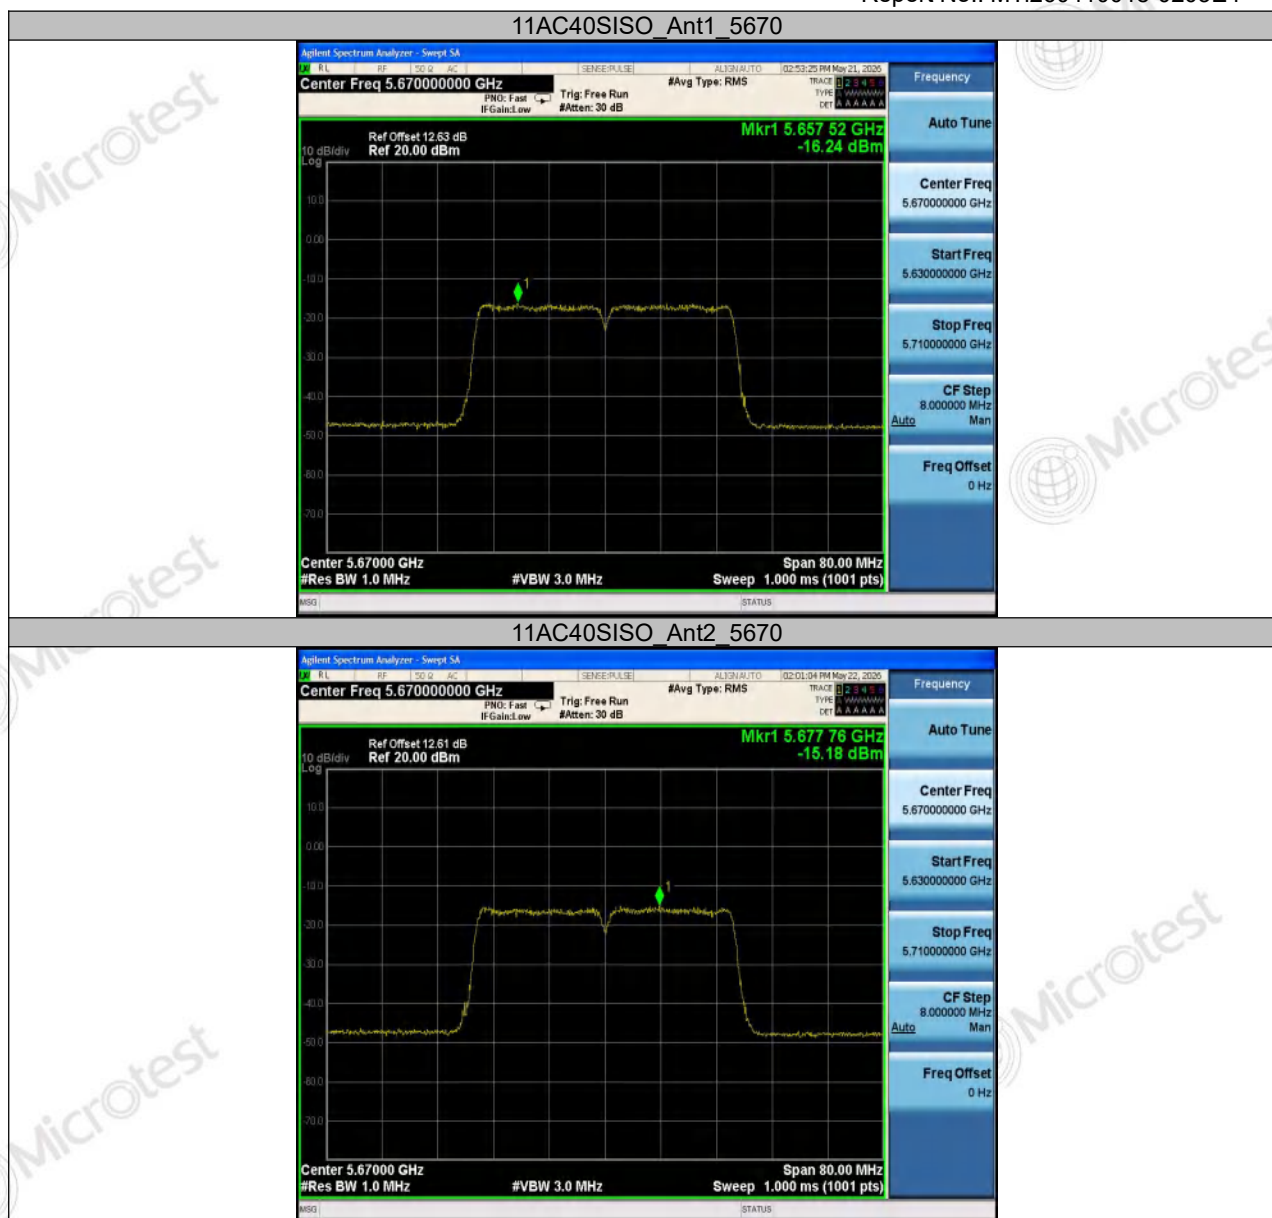


TEST REPORT

Report No.: MTI260410018-0203E4

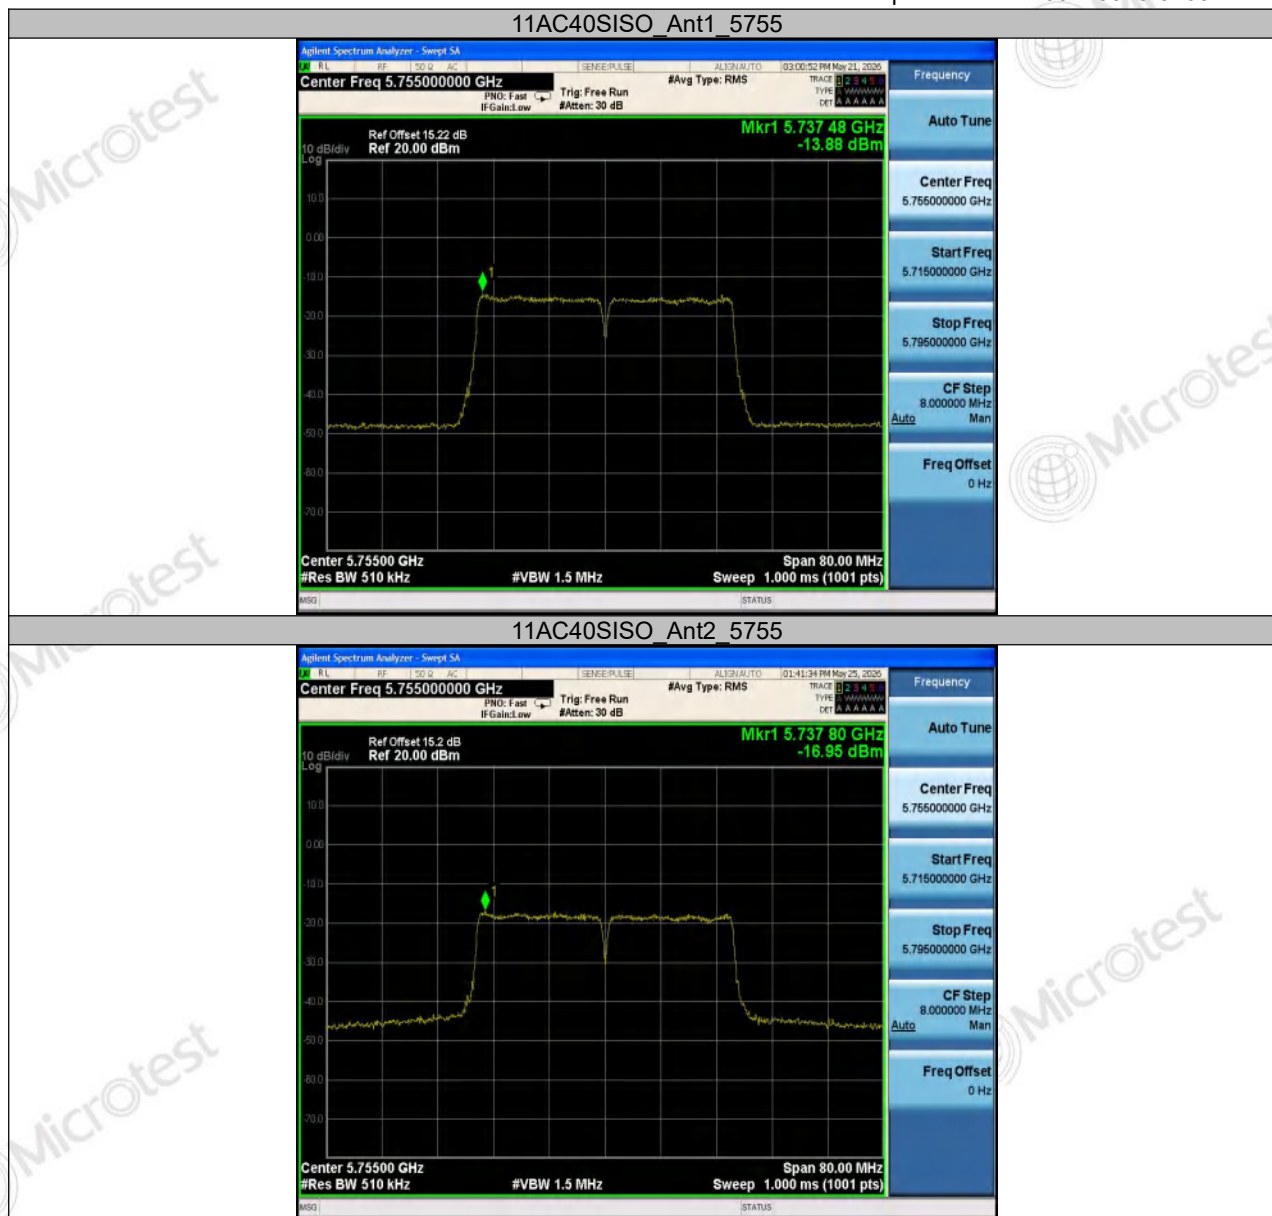

TEST REPORT

Report No.: MTi260410018-0203E4

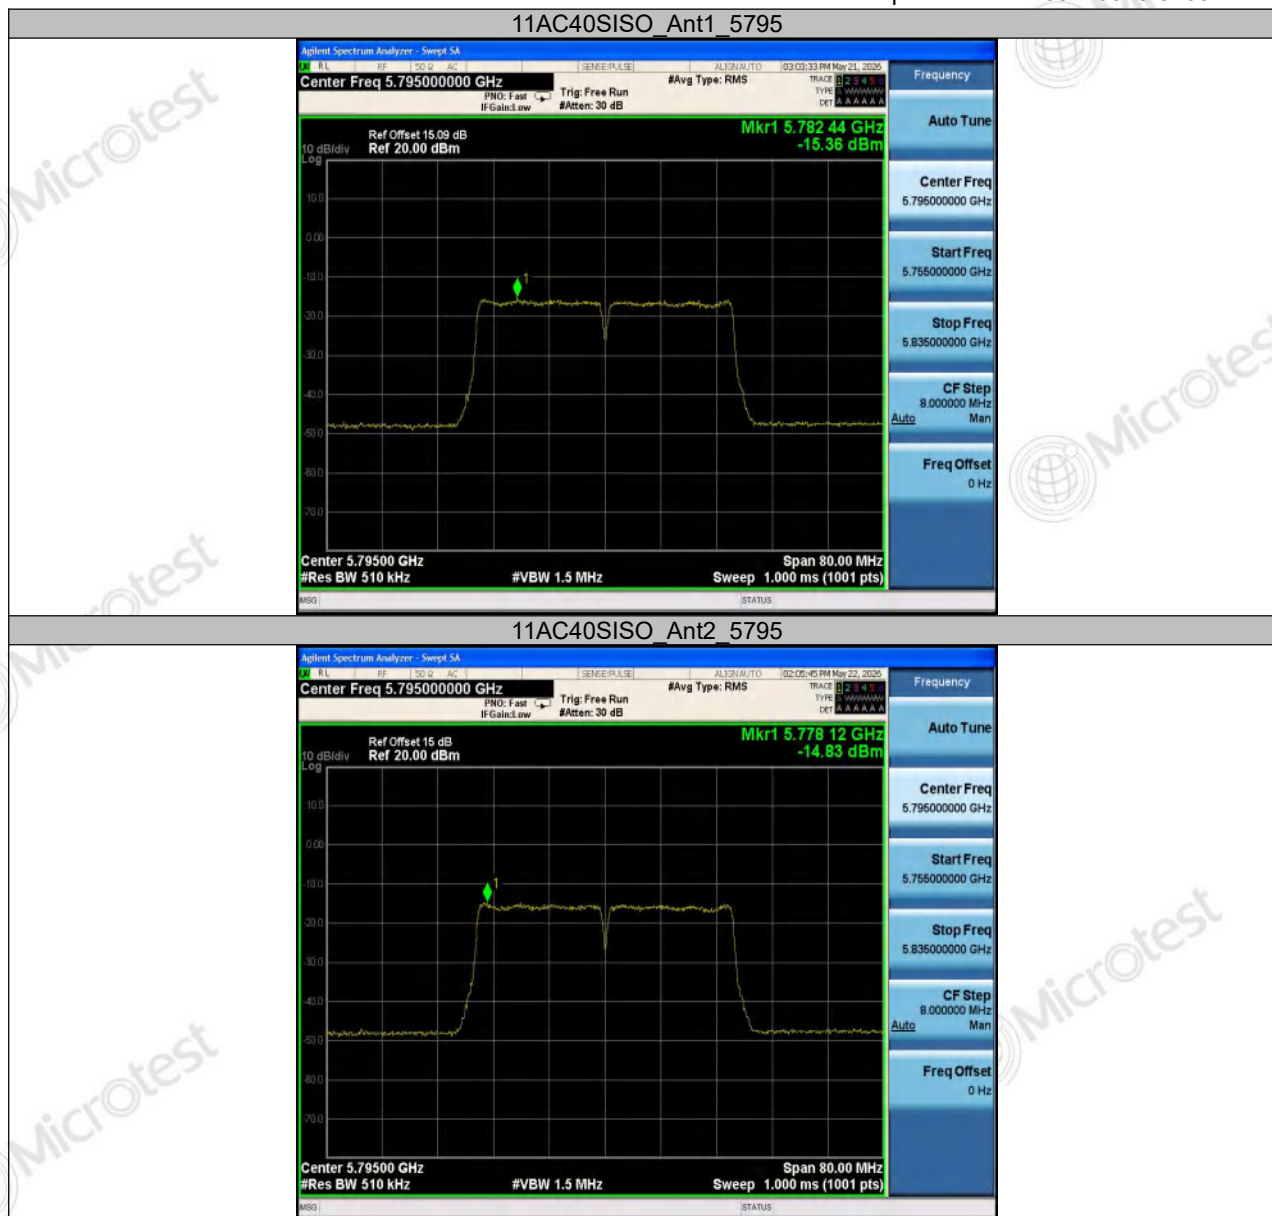

TEST REPORT

Report No.: MTi260410018-0203E4



TEST REPORT

Report No.: MTi260410018-0203E4

