

Appendix C: Maximum conducted output power

Test Result

TestMode	Antenna	Channel	Result[dBm]	Limit[dBm]	Verdict
DH5	Ant1	2402	-0.14	≤20.97	PASS
		2441	-0.25	≤20.97	PASS
		2480	0.44	≤20.97	PASS
2DH5	Ant1	2402	-0.83	≤20.97	PASS
		2441	-0.69	≤20.97	PASS
		2480	-0.29	≤20.97	PASS
3DH5	Ant1	2402	-0.41	≤20.97	PASS
		2441	-0.53	≤20.97	PASS
		2480	0.14	≤20.97	PASS



2DH5_Ant1_2402



2DH5_Ant1_2441



Shenzhen Anbotech Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.

Tel: (86) 755-26066440 Fax: (86) 755-26014772 Email: service@anbotech.com



Hotline

400-003-0500

www.anbotech.com

2DH5_Ant1_2480



3DH5_Ant1_2402




3DH5_Ant1_2441

Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.

Tel: (86) 755-26066440 Fax: (86) 755-26014772 Email: service@anbotek.com

Hotline
400-003-0500
www.anbotek.com

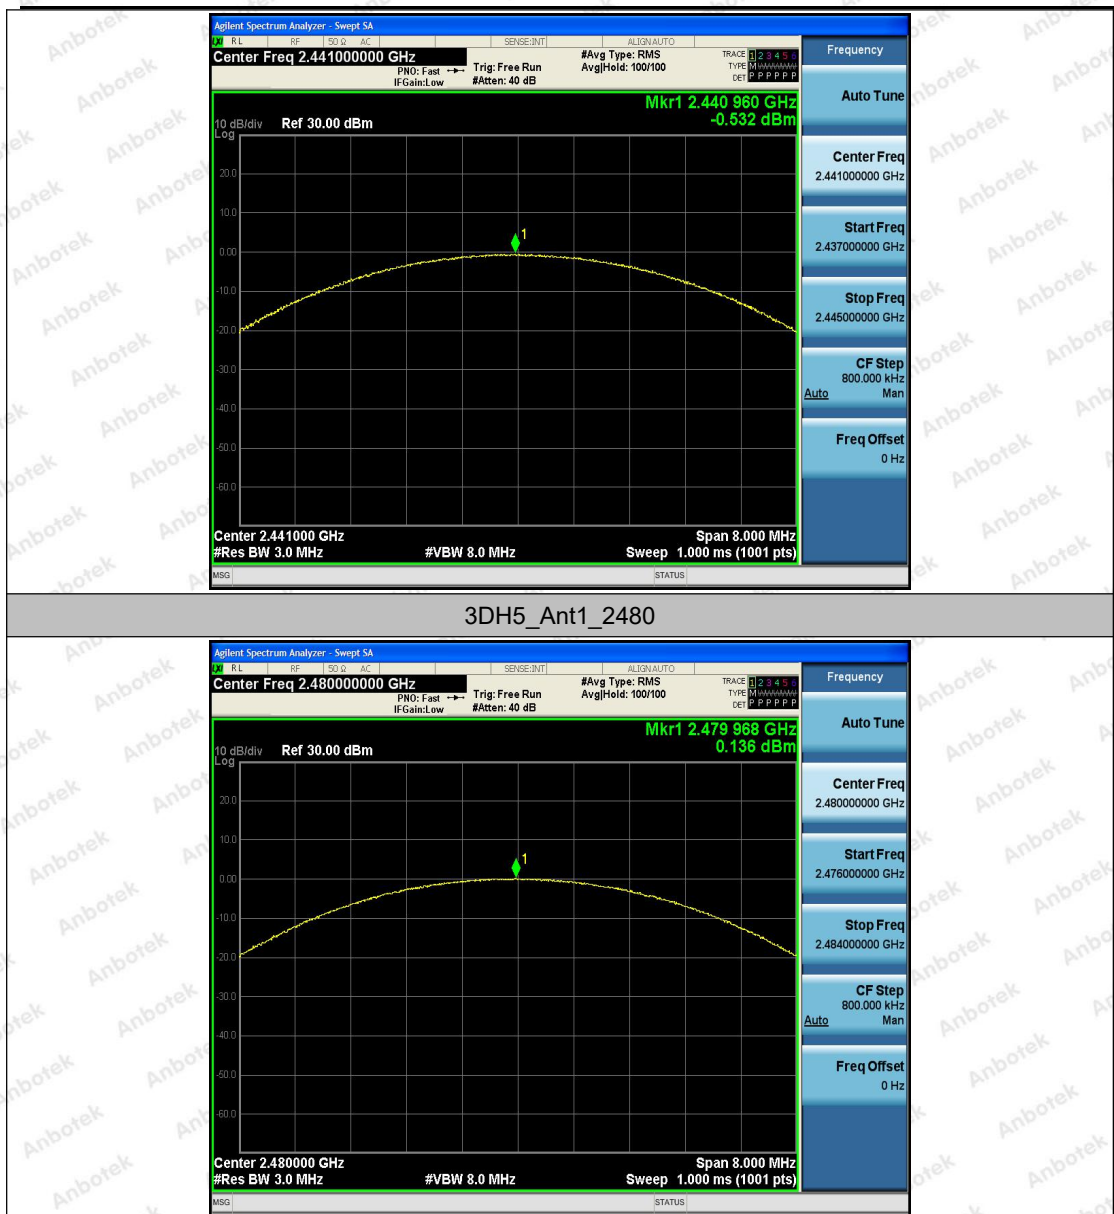

Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.

Tel: (86) 755-26066440 Fax: (86) 755-26014772 Email: service@anbotek.com



Hotline

400-003-0500


www.anbotek.com


Appendix D: Carrier frequency separation

Test Result

TestMode	Antenna	Channel	Result[MHz]	Limit[MHz]	Verdict
DH5	Ant1	Hop	0.834	≥ 0.632	PASS
2DH5	Ant1	Hop	1.056	≥ 0.902	PASS
3DH5	Ant1	Hop	1.04	≥ 0.870	PASS

Test Graphs

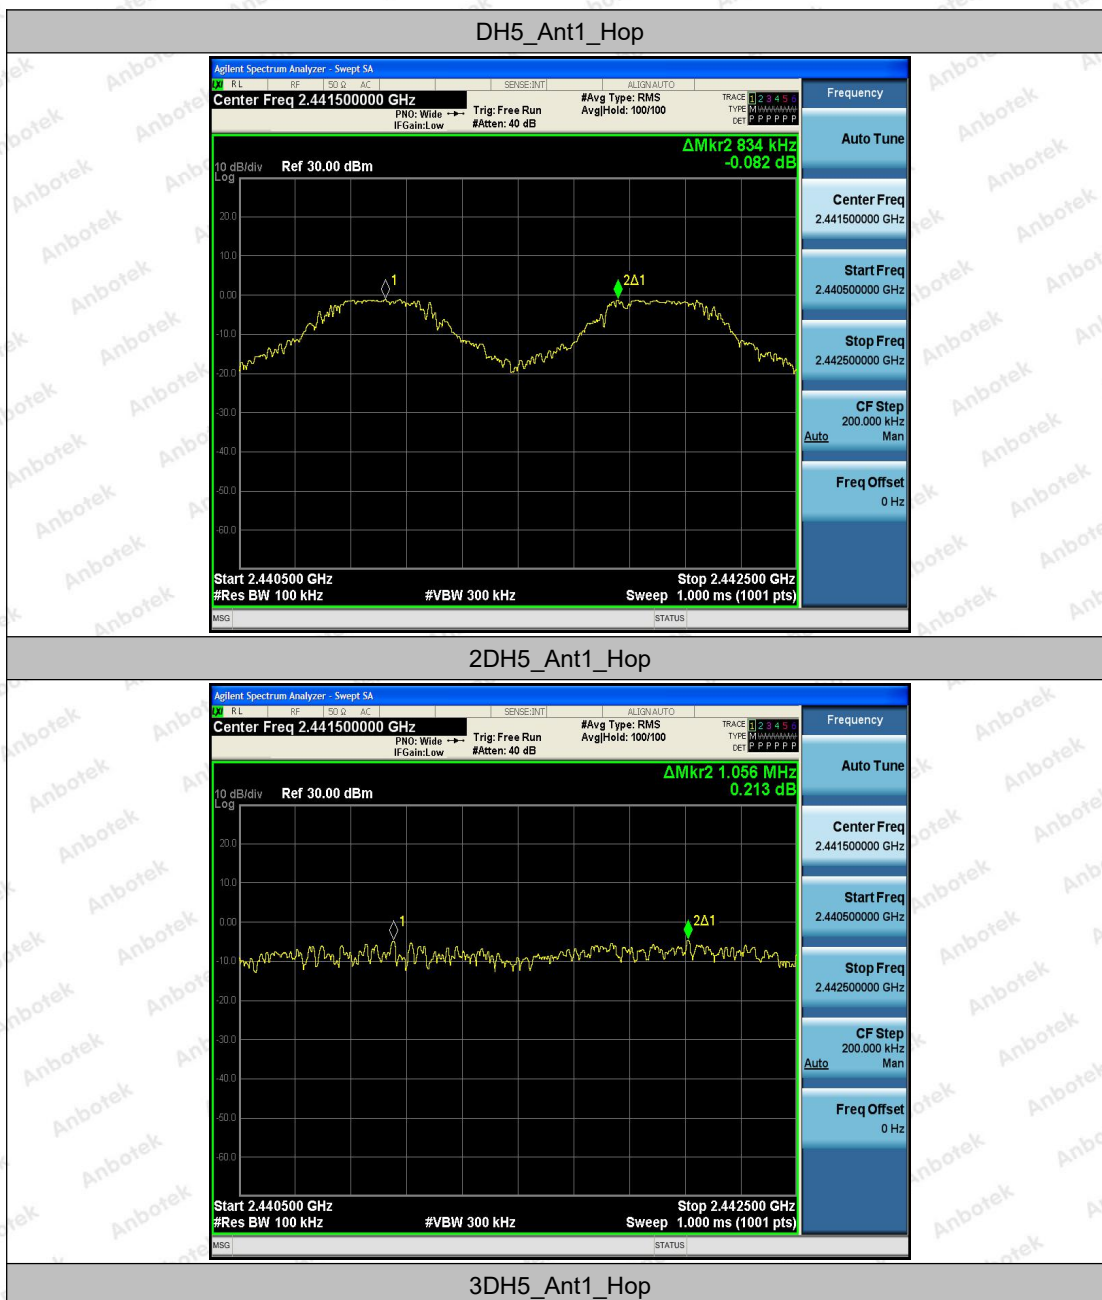

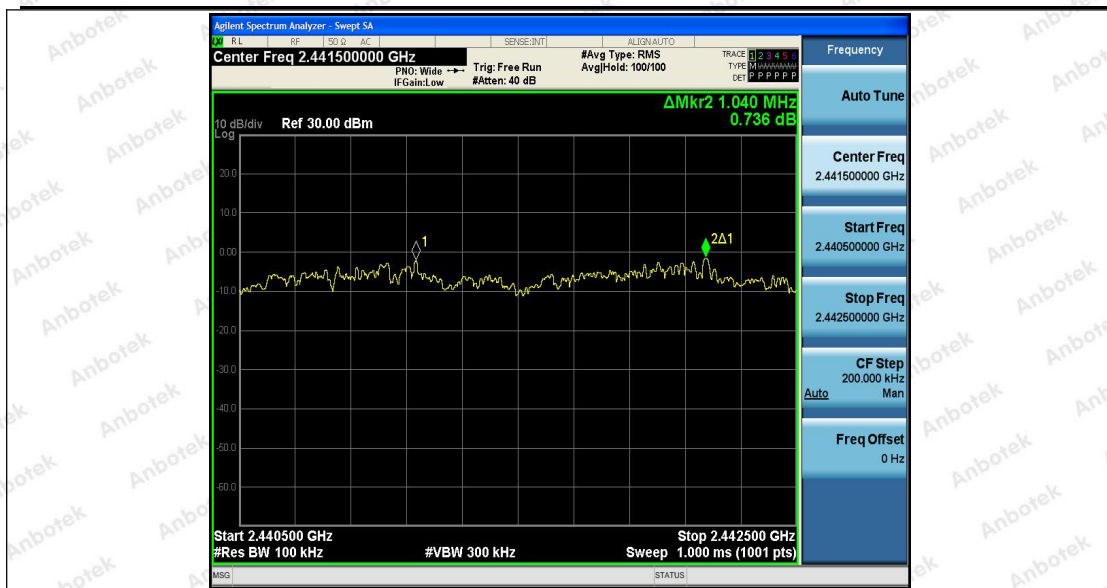

Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.

Tel: (86) 755-26066440 Fax: (86) 755-26014772 Email: service@anbotek.com


Hotline
400-003-0500
www.anbotek.com

Appendix E: Time of occupancy

Test Result

TestMode	Antenna	Channel	BurstWidth [ms]	TotalHops [Num]	Result[s]	Limit[s]	Verdict
DH1	Ant1	Hop	0.37	314	0.117	≤0.4	PASS
DH3	Ant1	Hop	1.63	158	0.257	≤0.4	PASS
DH5	Ant1	Hop	2.88	112	0.322	≤0.4	PASS
2DH1	Ant1	Hop	0.38	313	0.119	≤0.4	PASS
2DH3	Ant1	Hop	1.63	157	0.256	≤0.4	PASS
2DH5	Ant1	Hop	2.88	108	0.311	≤0.4	PASS
3DH1	Ant1	Hop	0.38	314	0.12	≤0.4	PASS
3DH3	Ant1	Hop	1.63	158	0.258	≤0.4	PASS
3DH5	Ant1	Hop	2.88	96	0.277	≤0.4	PASS

Test Graphs

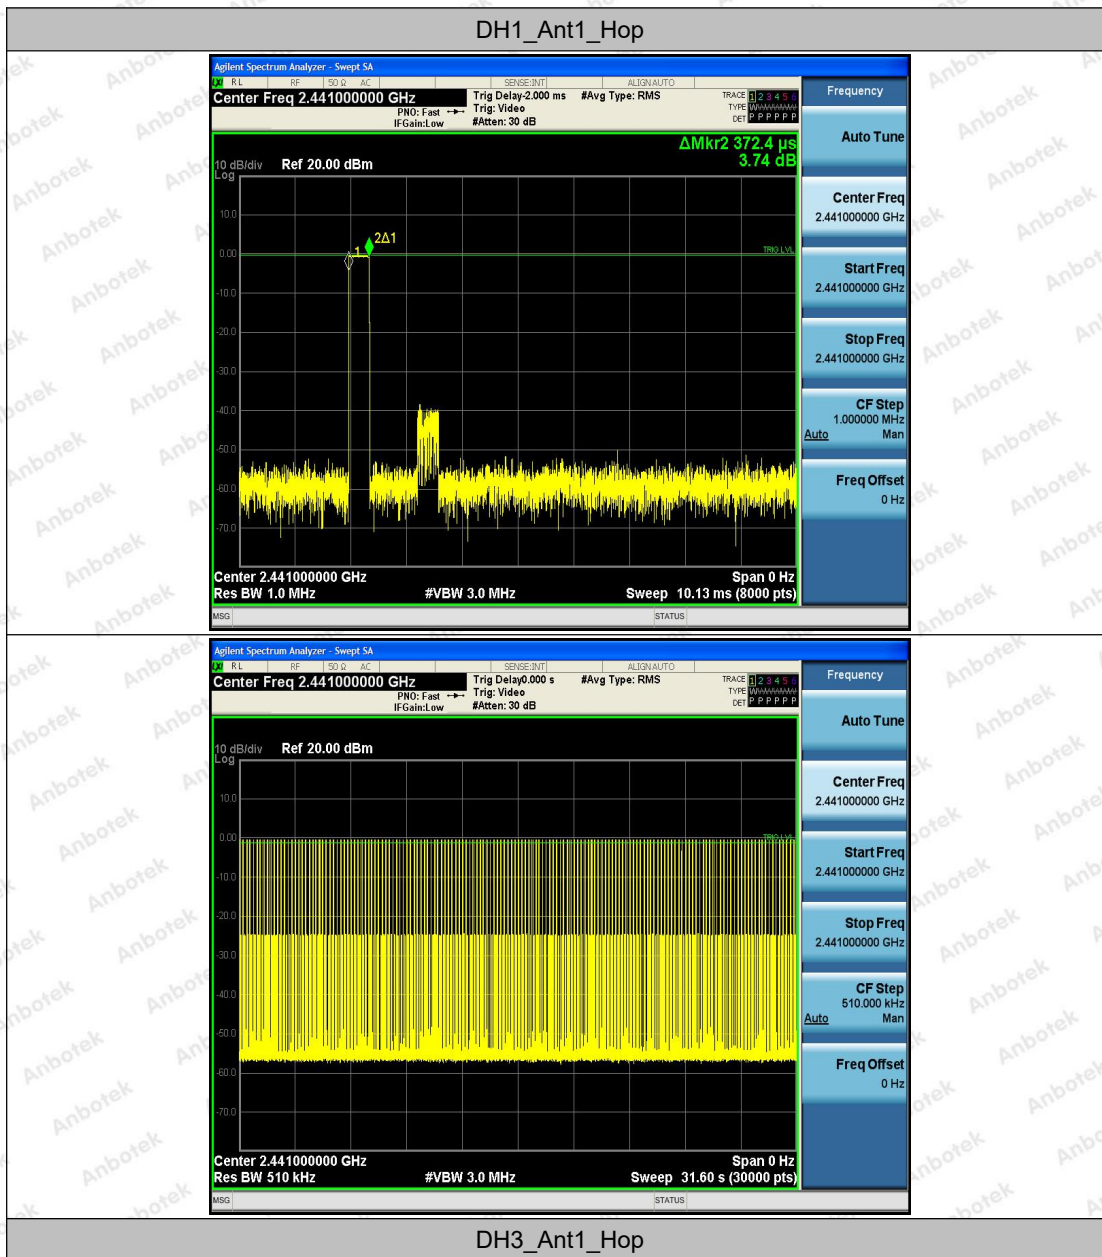




DH5_Ant1_Hop

Shenzhen Anbotech Compliance Laboratory Limited



Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.

Tel: (86) 755-26066440 Fax: (86) 755-26014772 Email: service@anbotech.com

Hotline
400-003-0500
www.anbotech.com

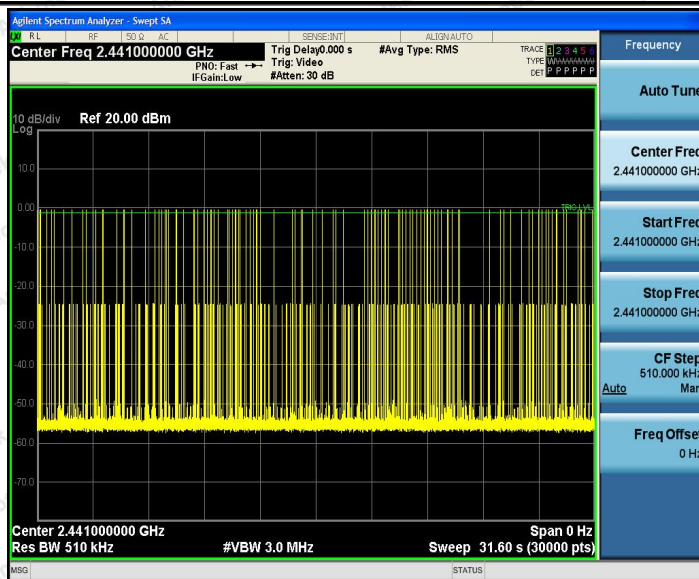

2DH1_Ant1_Hop

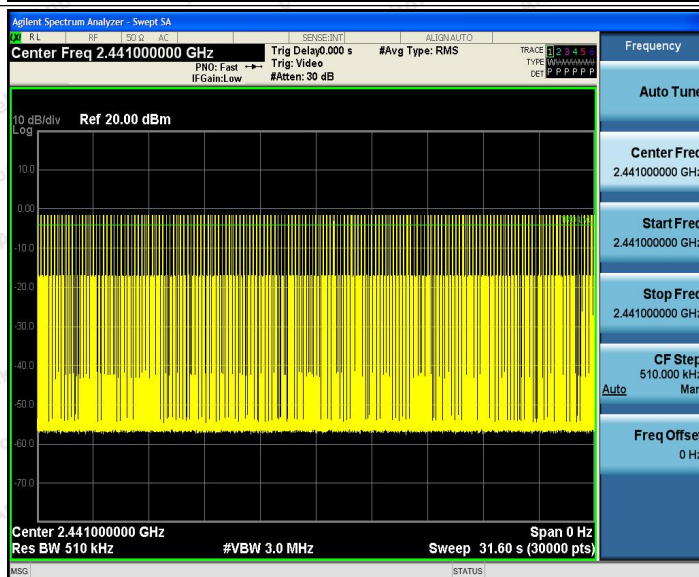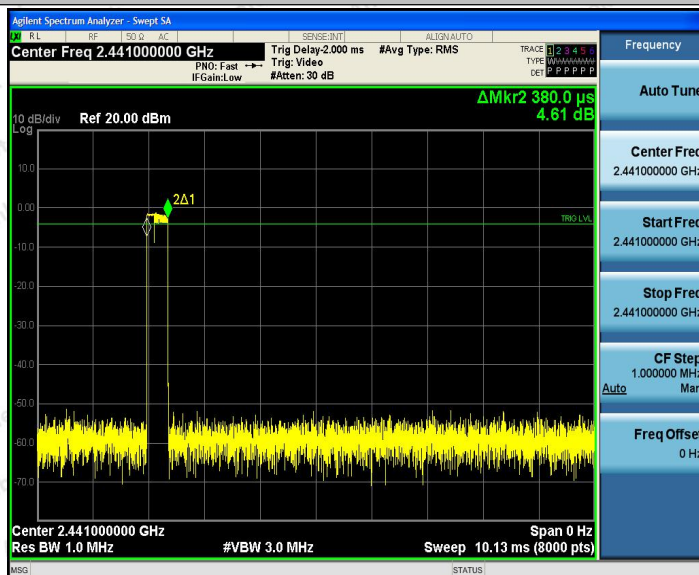


2DH3_Ant1_Hop

Shenzhen Anbotech Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.

Tel: (86) 755-26066440 Fax: (86) 755-26014772 Email: service@anbotech.com

Hotline
400-003-0500
www.anbotech.com

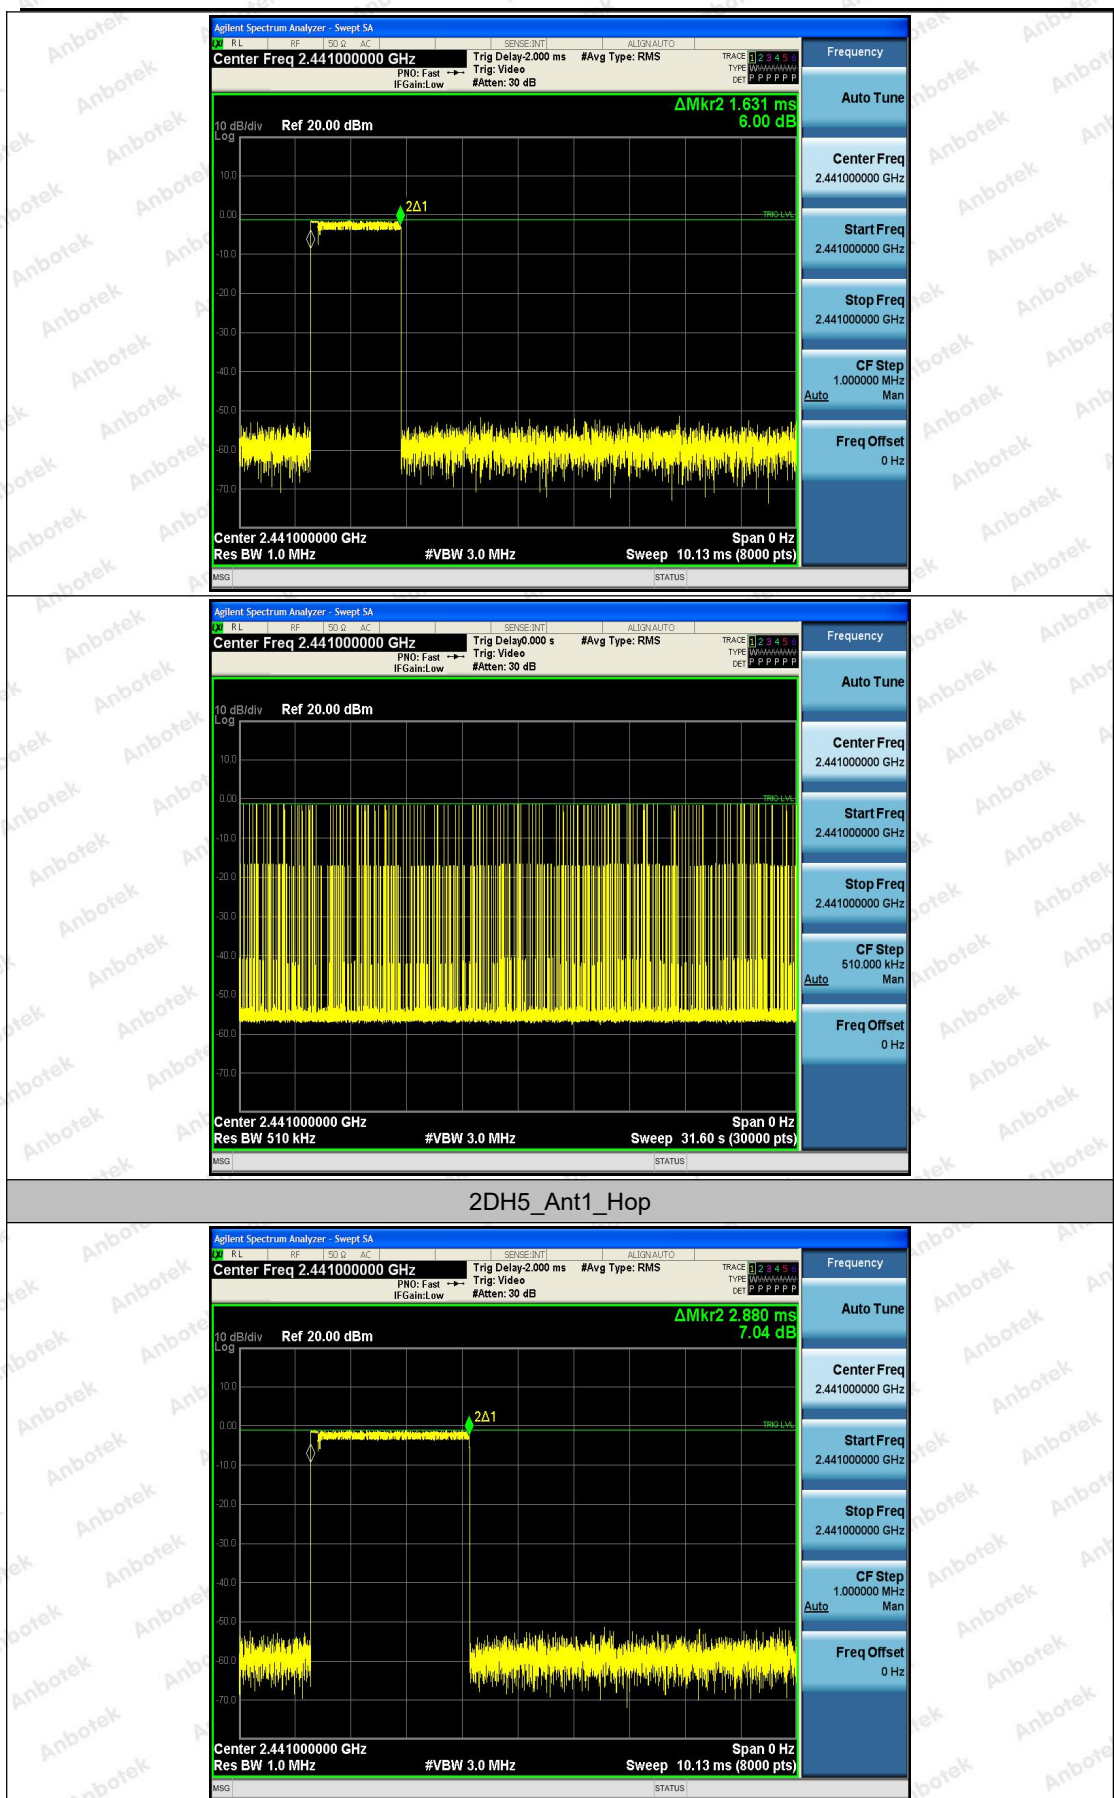


Shenzhen Anbotech Compliance Laboratory Limited



Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.

Tel: (86) 755-26066440 Fax: (86) 755-26014772 Email: service@anbotech.com

Hotline
400-003-0500
www.anbotech.com

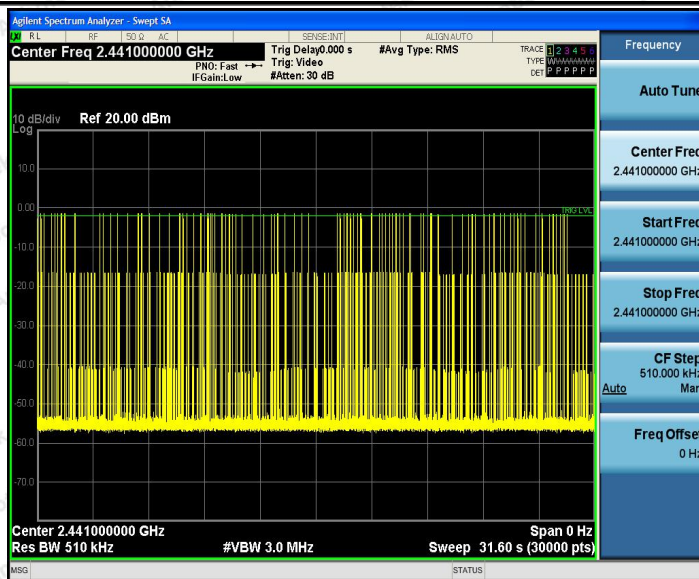

3DH1_Ant1_Hop

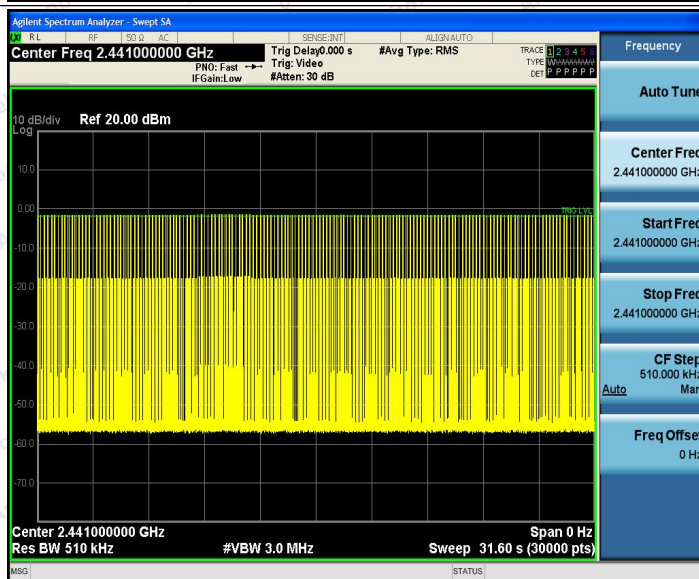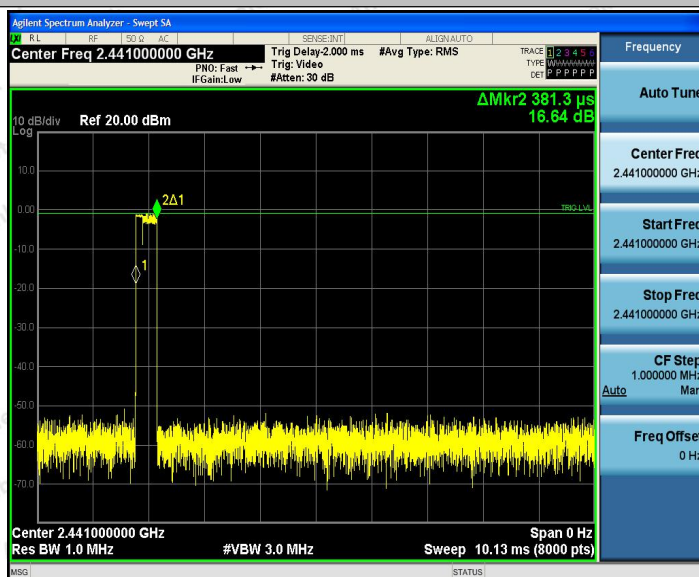

3DH3_Ant1_Hop

Shenzhen Anbotech Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.

Tel: (86) 755-26066440 Fax: (86) 755-26014772 Email: service@anbotech.com

Hotline
400-003-0500
www.anbotech.com