




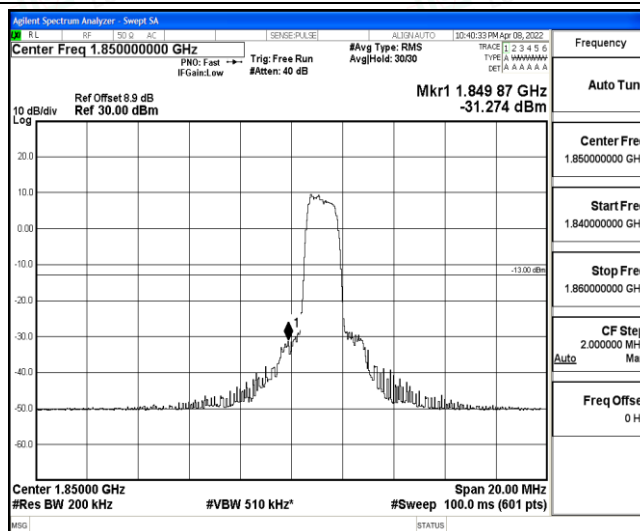

Band2-10MHz-QPSK-18650-6-0-Low--31.27-PASS

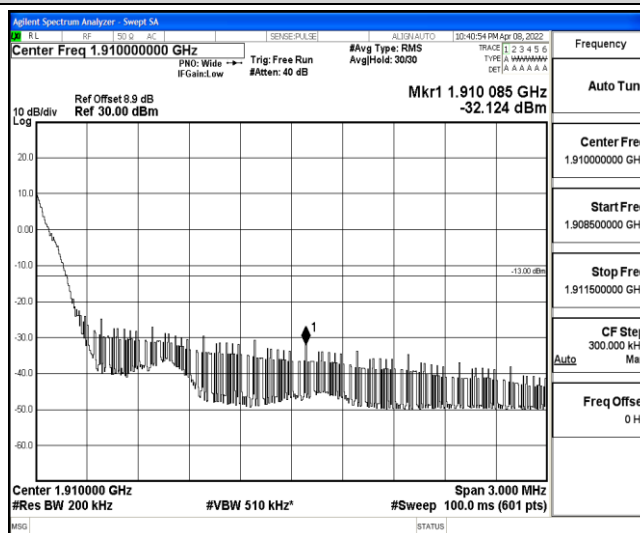


Band2-10MHz-QPSK-19150-1-0-High--32.12-PASS

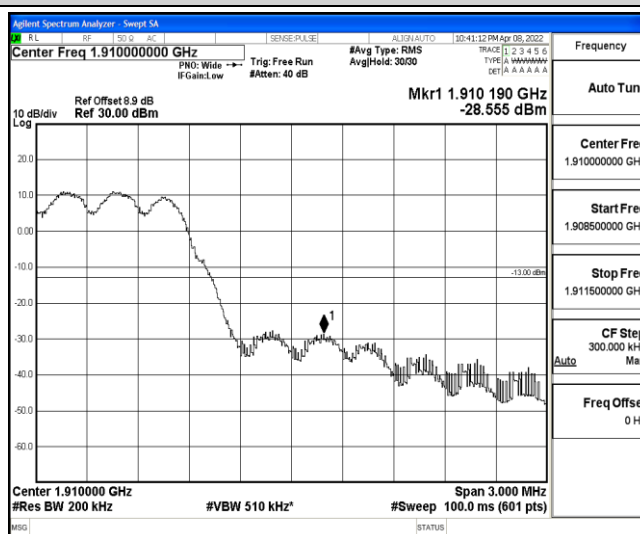


Band2-10MHz-QPSK-19150-6-0-High--28.56-PASS




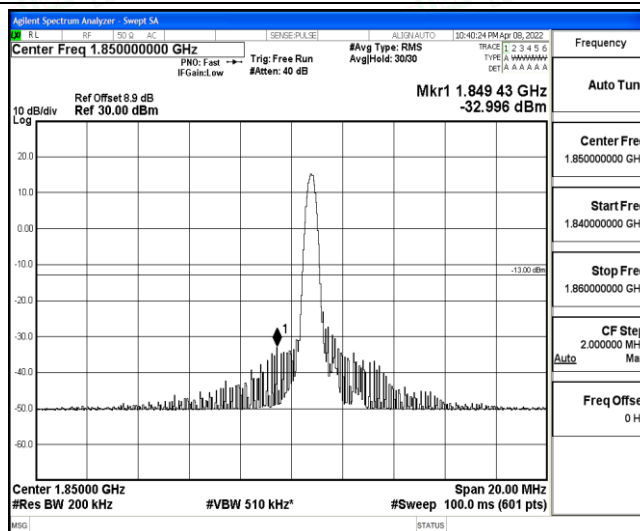

Band2-10MHz-16QAM-18650-1-0-Low--33.00-PASS

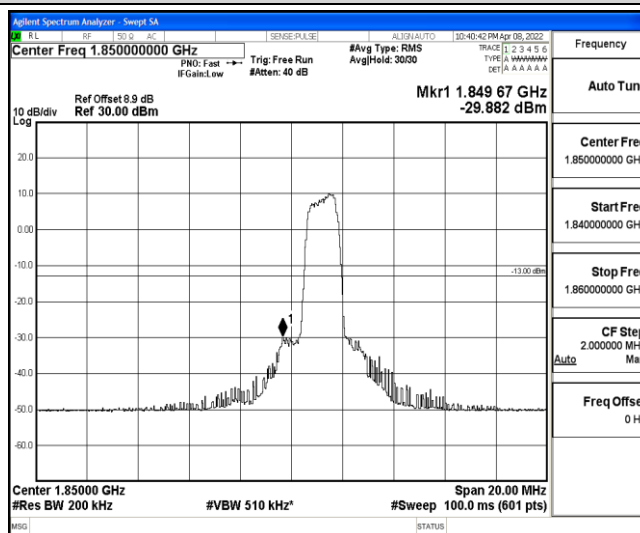


Band2-10MHz-16QAM-18650-6-0-Low--29.88-PASS

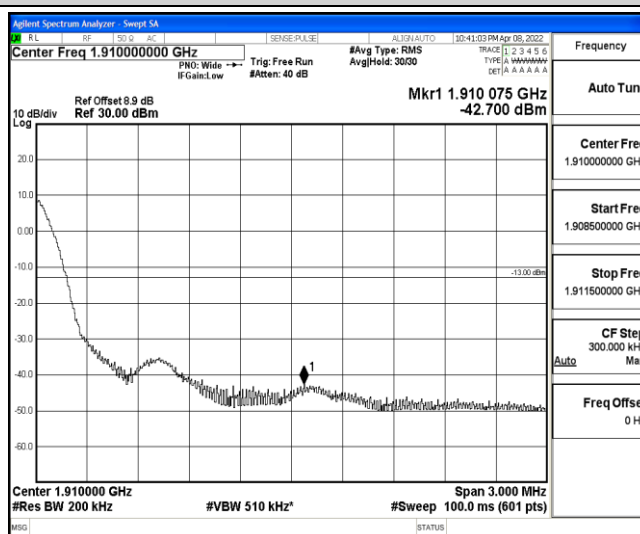


Band2-10MHz-16QAM-19150-1-0-High--42.70-PASS




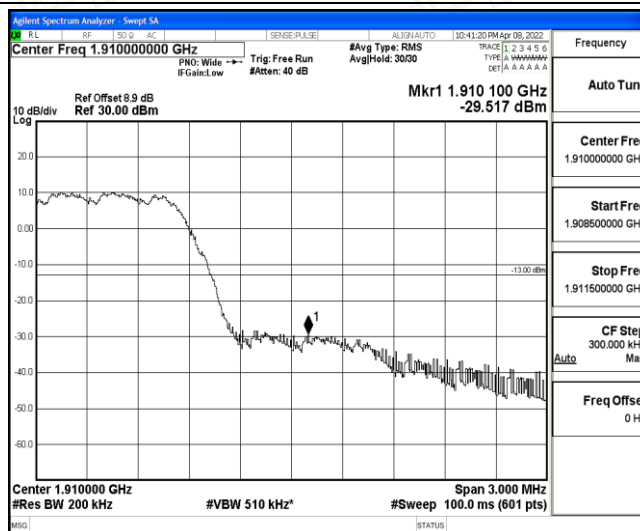

Band2-10MHz-16QAM-19150-6-0-High--29.52-PASS

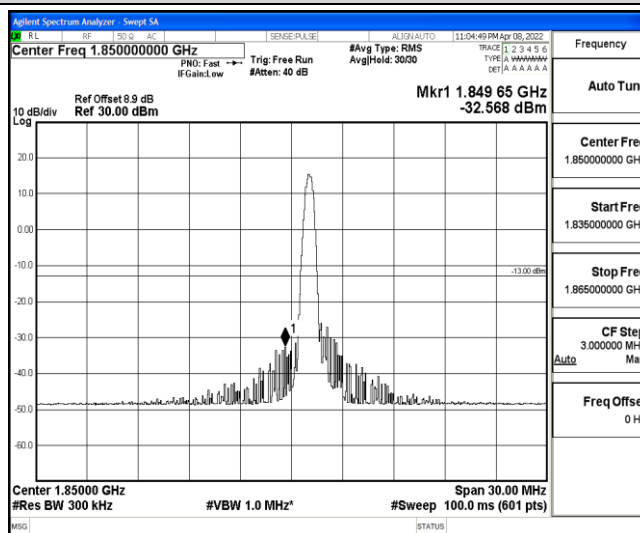


Band2-15MHz-QPSK-18675-1-0-Low--32.57-PASS

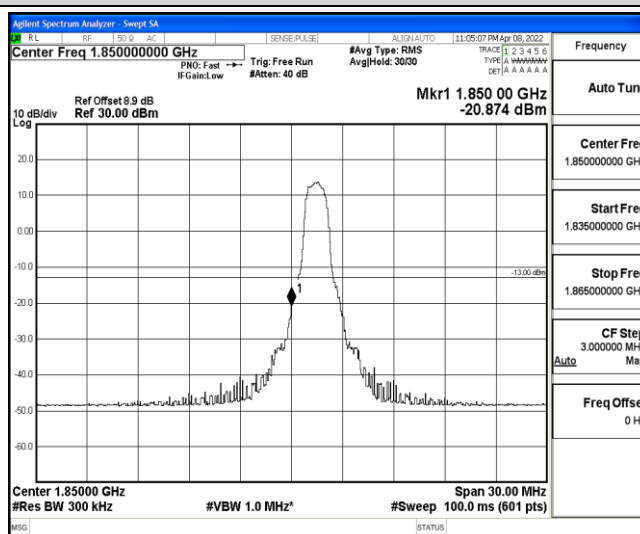


Band2-15MHz-QPSK-18675-6-0-Low--20.87-PASS




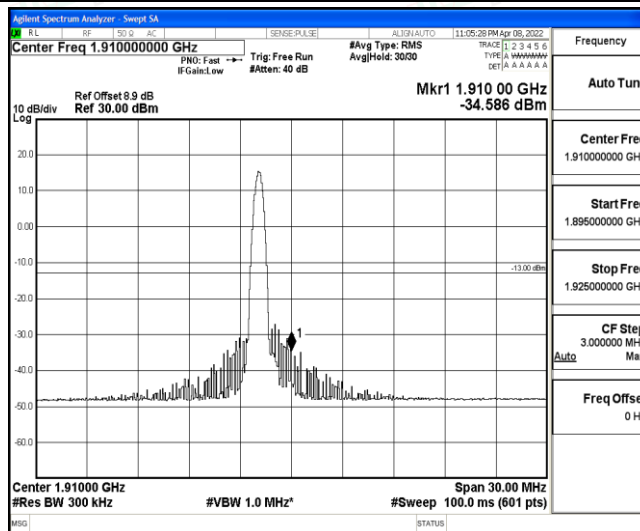

Band2-15MHz-QPSK-19125-1-0-High--34.59-PASS

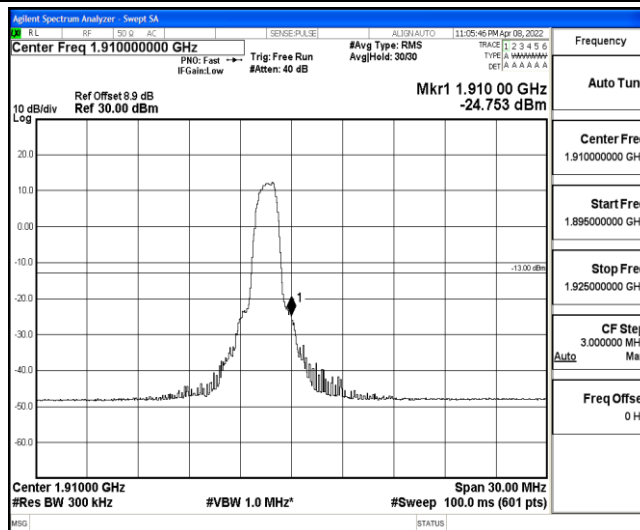

Band2-15MHz-QPSK-19125-6-0-High--24.75-PASS

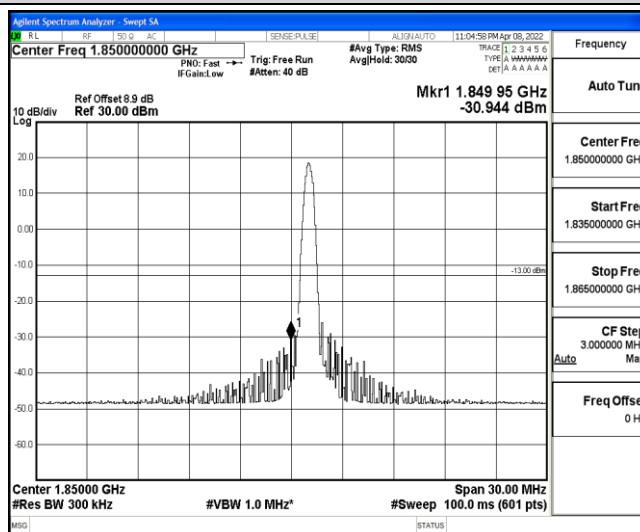

Band2-15MHz-16QAM-18675-1-0-Low--30.94-PASS




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity

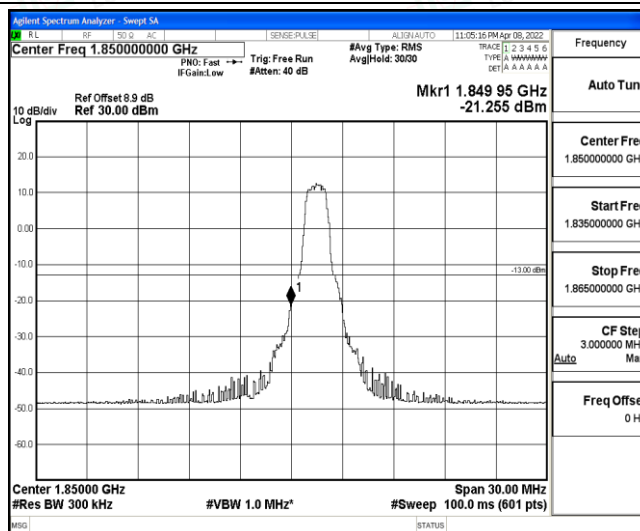

Band2-15MHz-16QAM-18675-6-0-Low--21.26-PASS

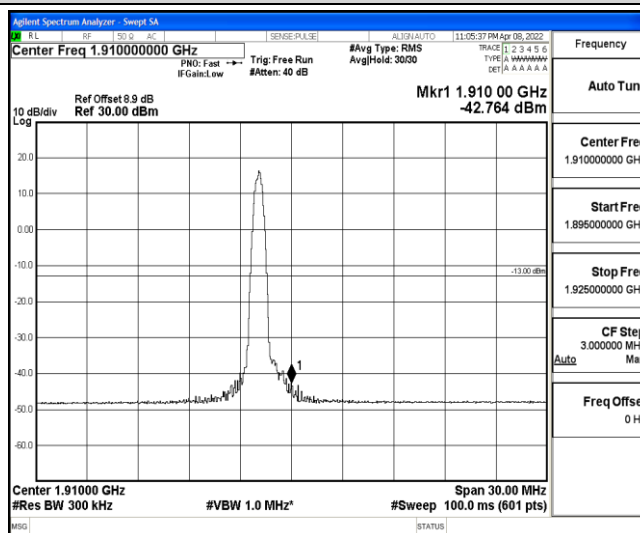


Band2-15MHz-16QAM-19125-1-0-High--42.76-PASS

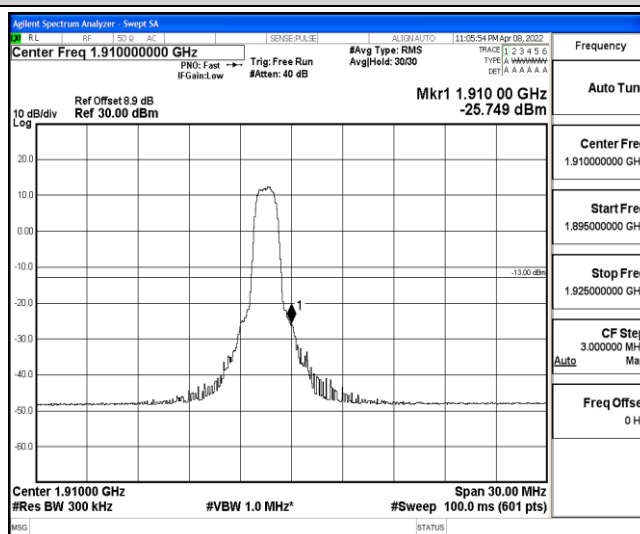


Band2-15MHz-16QAM-19125-6-0-High--25.75-PASS




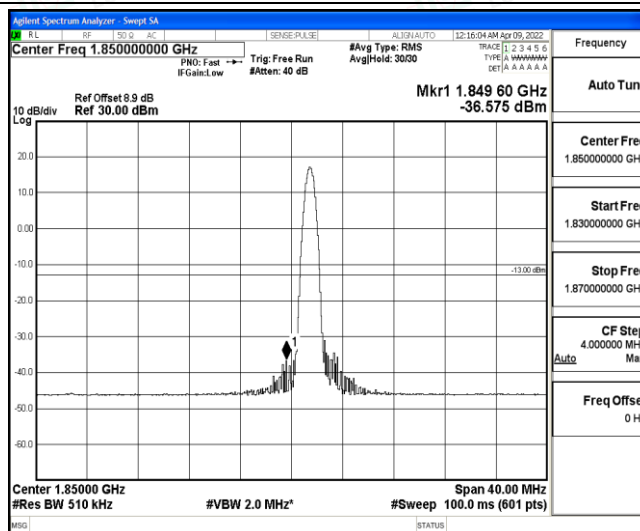

Band2-20MHz-QPSK-18700-1-0-Low--36.57-PASS

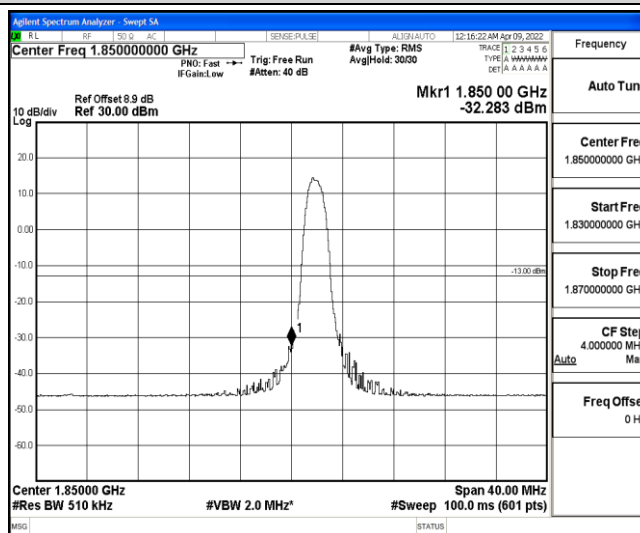


Band2-20MHz-QPSK-18700-6-0-Low--32.28-PASS

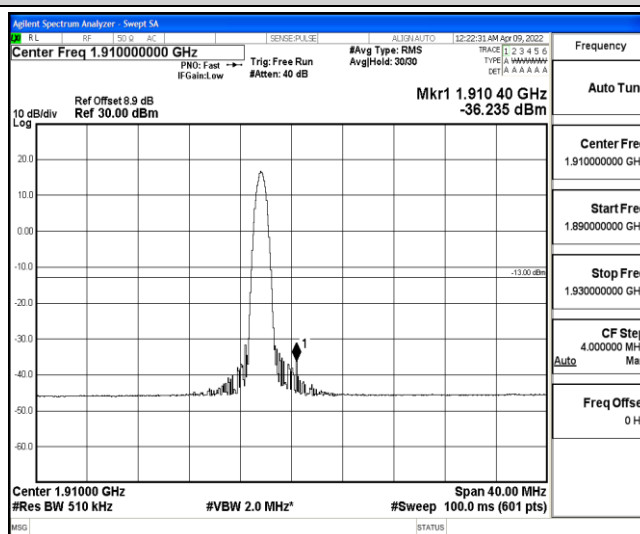


Band2-20MHz-QPSK-19100-1-0-High--36.24-PASS




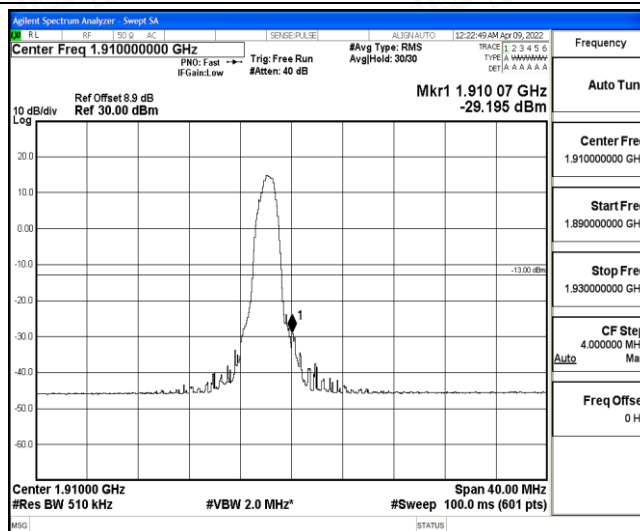

Band2-20MHz-QPSK-19100-6-0-High--29.20-PASS

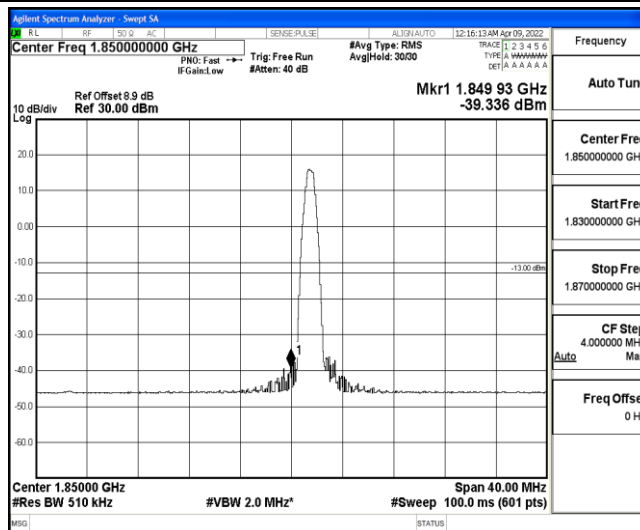


Band2-20MHz-16QAM-18700-1-0-Low--39.34-PASS

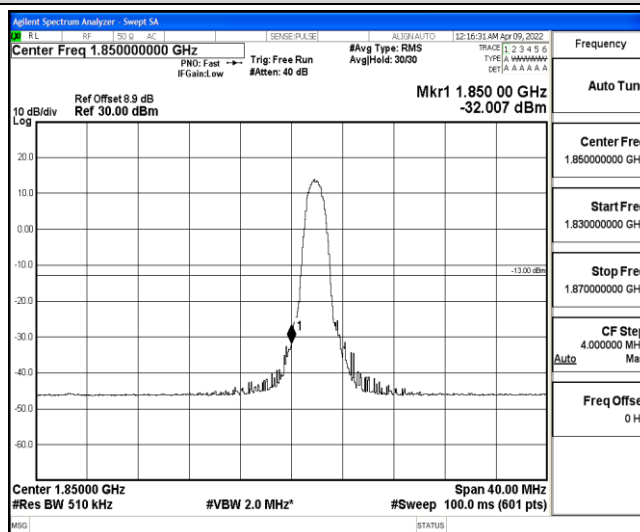


Band2-20MHz-16QAM-18700-6-0-Low--32.01-PASS



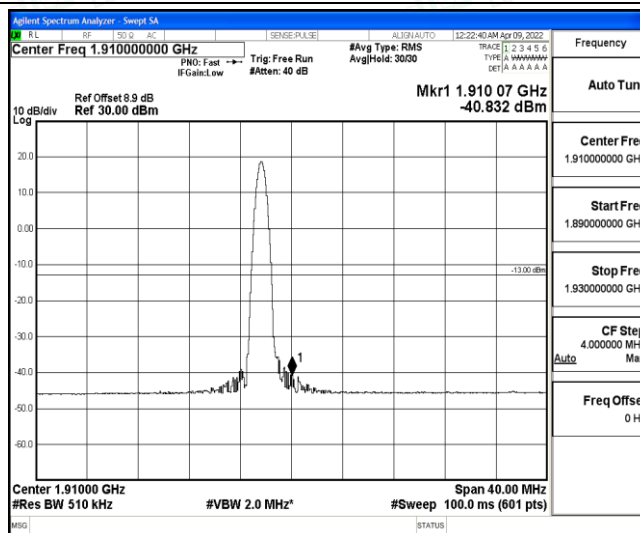

Band2-20MHz-16QAM-19100-1-0-High--40.83-PASS

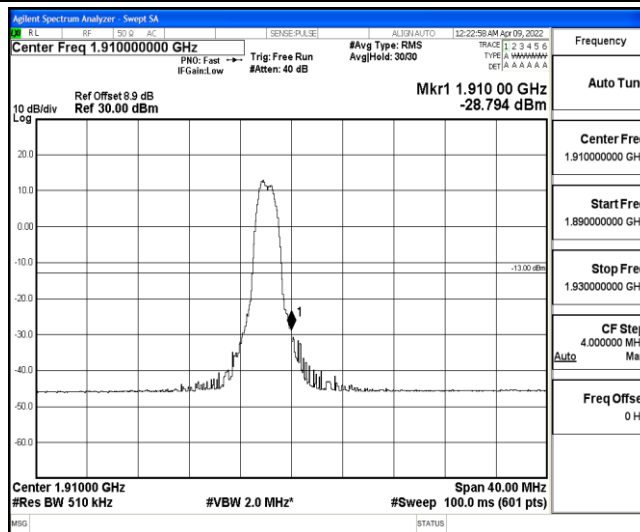

Band2-20MHz-16QAM-19100-6-0-High--28.79-PASS



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



B.5 Conducted Spurious Emission

Test Result

Band	Bandwidth	Modulation	Channel	RB Size	RB Start	NB Index	Start Freq	Stop Freq	Result (dBm)	Verdict
Band2	1.4MHz	18607	QPSK	1	0	Low	30	1000	-35.52	PASS
Band2	1.4MHz	18607	QPSK	1	0	Low	1000	5000	-38.85	PASS
Band2	1.4MHz	18607	QPSK	1	0	Low	5000	12000	-57.22	PASS
Band2	1.4MHz	18607	QPSK	1	0	Low	12000	26500	-42.76	PASS
Band2	1.4MHz	18900	QPSK	1	0	Low	30	1000	-35.68	PASS
Band2	1.4MHz	18900	QPSK	1	0	Low	1000	5000	-38.53	PASS
Band2	1.4MHz	18900	QPSK	1	0	Low	5000	12000	-57.47	PASS
Band2	1.4MHz	18900	QPSK	1	0	Low	12000	26500	-42.76	PASS
Band2	1.4MHz	19193	QPSK	1	0	High	30	1000	-34.87	PASS
Band2	1.4MHz	19193	QPSK	1	0	High	1000	5000	-38.44	PASS
Band2	1.4MHz	19193	QPSK	1	0	High	5000	12000	-57.5	PASS
Band2	1.4MHz	19193	QPSK	1	0	High	12000	26500	-42.69	PASS
Band2	1.4MHz	18607	16QAM	1	0	Low	30	1000	-35.42	PASS
Band2	1.4MHz	18607	16QAM	1	0	Low	1000	5000	-39.44	PASS
Band2	1.4MHz	18607	16QAM	1	0	Low	5000	12000	-57.35	PASS
Band2	1.4MHz	18607	16QAM	1	0	Low	12000	26500	-42.76	PASS
Band2	1.4MHz	18900	16QAM	1	0	Low	30	1000	-34.67	PASS
Band2	1.4MHz	18900	16QAM	1	0	Low	1000	5000	-38.67	PASS
Band2	1.4MHz	18900	16QAM	1	0	Low	5000	12000	-57.51	PASS
Band2	1.4MHz	18900	16QAM	1	0	Low	12000	26500	-42.58	PASS
Band2	1.4MHz	19193	16QAM	1	0	High	30	1000	-35.62	PASS
Band2	1.4MHz	19193	16QAM	1	0	High	1000	5000	-38.54	PASS
Band2	1.4MHz	19193	16QAM	1	0	High	5000	12000	-57.59	PASS
Band2	1.4MHz	19193	16QAM	1	0	High	12000	26500	-42.52	PASS
Band2	3MHz	18615	QPSK	1	0	Low	30	1000	-35.73	PASS
Band2	3MHz	18615	QPSK	1	0	Low	1000	5000	-37.39	PASS
Band2	3MHz	18615	QPSK	1	0	Low	5000	12000	-57.46	PASS
Band2	3MHz	18615	QPSK	1	0	Low	12000	26500	-42.54	PASS
Band2	3MHz	18900	QPSK	1	0	Low	30	1000	-35.43	PASS
Band2	3MHz	18900	QPSK	1	0	Low	1000	5000	-36.54	PASS
Band2	3MHz	18900	QPSK	1	0	Low	5000	12000	-57.41	PASS
Band2	3MHz	18900	QPSK	1	0	Low	12000	26500	-42.76	PASS
Band2	3MHz	19185	QPSK	1	0	High	30	1000	-35.15	PASS
Band2	3MHz	19185	QPSK	1	0	High	1000	5000	-37.94	PASS
Band2	3MHz	19185	QPSK	1	0	High	5000	12000	-57.49	PASS



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



Band2	3MHz	19185	QPSK	1	0	High	12000	26500	-42.82	PASS
Band2	3MHz	18615	16QAM	1	0	Low	30	1000	-35.48	PASS
Band2	3MHz	18615	16QAM	1	0	Low	1000	5000	-38.91	PASS
Band2	3MHz	18615	16QAM	1	0	Low	5000	12000	-57.53	PASS
Band2	3MHz	18615	16QAM	1	0	Low	12000	26500	-42.39	PASS
Band2	3MHz	18900	16QAM	1	0	Low	30	1000	-35.67	PASS
Band2	3MHz	18900	16QAM	1	0	Low	1000	5000	-38.48	PASS
Band2	3MHz	18900	16QAM	1	0	Low	5000	12000	-57.46	PASS
Band2	3MHz	18900	16QAM	1	0	Low	12000	26500	-42.75	PASS
Band2	3MHz	19185	16QAM	1	0	High	30	1000	-35.87	PASS
Band2	3MHz	19185	16QAM	1	0	High	1000	5000	-38.61	PASS
Band2	3MHz	19185	16QAM	1	0	High	5000	12000	-57.48	PASS
Band2	3MHz	19185	16QAM	1	0	High	12000	26500	-42.44	PASS
Band2	5MHz	18625	QPSK	1	0	Low	30	1000	-35.19	PASS
Band2	5MHz	18625	QPSK	1	0	Low	1000	5000	-37.06	PASS
Band2	5MHz	18625	QPSK	1	0	Low	5000	12000	-57.46	PASS
Band2	5MHz	18625	QPSK	1	0	Low	12000	26500	-42.66	PASS
Band2	5MHz	18900	QPSK	1	0	Low	30	1000	-34.82	PASS
Band2	5MHz	18900	QPSK	1	0	Low	1000	5000	-36.8	PASS
Band2	5MHz	18900	QPSK	1	0	Low	5000	12000	-57.4	PASS
Band2	5MHz	18900	QPSK	1	0	Low	12000	26500	-42.58	PASS
Band2	5MHz	19175	QPSK	1	0	High	30	1000	-35.75	PASS
Band2	5MHz	19175	QPSK	1	0	High	1000	5000	-38.14	PASS
Band2	5MHz	19175	QPSK	1	0	High	5000	12000	-57.42	PASS
Band2	5MHz	19175	QPSK	1	0	High	12000	26500	-42.54	PASS
Band2	5MHz	18625	16QAM	1	0	Low	30	1000	-34.8	PASS
Band2	5MHz	18625	16QAM	1	0	Low	1000	5000	-38.37	PASS
Band2	5MHz	18625	16QAM	1	0	Low	5000	12000	-57.4	PASS
Band2	5MHz	18625	16QAM	1	0	Low	12000	26500	-42.79	PASS
Band2	5MHz	18900	16QAM	1	0	Low	30	1000	-34.83	PASS
Band2	5MHz	18900	16QAM	1	0	Low	1000	5000	-38.65	PASS
Band2	5MHz	18900	16QAM	1	0	Low	5000	12000	-57.44	PASS
Band2	5MHz	18900	16QAM	1	0	Low	12000	26500	-42.67	PASS
Band2	5MHz	19175	16QAM	1	0	High	30	1000	-35.83	PASS
Band2	5MHz	19175	16QAM	1	0	High	1000	5000	-38.26	PASS
Band2	5MHz	19175	16QAM	1	0	High	5000	12000	-57.3	PASS
Band2	5MHz	19175	16QAM	1	0	High	12000	26500	-42.64	PASS
Band2	10MHz	18650	QPSK	1	0	Low	30	1000	-35.45	PASS
Band2	10MHz	18650	QPSK	1	0	Low	1000	5000	-38.43	PASS
Band2	10MHz	18650	QPSK	1	0	Low	5000	12000	-57.44	PASS



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



Band2	10MHz	18650	QPSK	1	0	Low	12000	26500	-42.69	PASS
Band2	10MHz	18900	QPSK	1	0	Low	30	1000	-35.41	PASS
Band2	10MHz	18900	QPSK	1	0	Low	1000	5000	-38.59	PASS
Band2	10MHz	18900	QPSK	1	0	Low	5000	12000	-57.2	PASS
Band2	10MHz	18900	QPSK	1	0	Low	12000	26500	-42.62	PASS
Band2	10MHz	19150	QPSK	1	0	High	30	1000	-35.76	PASS
Band2	10MHz	19150	QPSK	1	0	High	1000	5000	-38.57	PASS
Band2	10MHz	19150	QPSK	1	0	High	5000	12000	-57.53	PASS
Band2	10MHz	19150	QPSK	1	0	High	12000	26500	-42.48	PASS
Band2	10MHz	18650	16QAM	1	0	Low	30	1000	-34.86	PASS
Band2	10MHz	18650	16QAM	1	0	Low	1000	5000	-38.66	PASS
Band2	10MHz	18650	16QAM	1	0	Low	5000	12000	-57.41	PASS
Band2	10MHz	18650	16QAM	1	0	Low	12000	26500	-42.71	PASS
Band2	10MHz	18900	16QAM	1	0	Low	30	1000	-34.69	PASS
Band2	10MHz	18900	16QAM	1	0	Low	1000	5000	-38.31	PASS
Band2	10MHz	18900	16QAM	1	0	Low	5000	12000	-57.4	PASS
Band2	10MHz	18900	16QAM	1	0	Low	12000	26500	-42.6	PASS
Band2	10MHz	19150	16QAM	1	0	High	30	1000	-35.73	PASS
Band2	10MHz	19150	16QAM	1	0	High	1000	5000	-38.02	PASS
Band2	10MHz	19150	16QAM	1	0	High	5000	12000	-57.53	PASS
Band2	10MHz	19150	16QAM	1	0	High	12000	26500	-42.78	PASS
Band2	15MHz	18675	QPSK	1	0	Low	30	1000	-35.54	PASS
Band2	15MHz	18675	QPSK	1	0	Low	1000	5000	-38.22	PASS
Band2	15MHz	18675	QPSK	1	0	Low	5000	12000	-57.38	PASS
Band2	15MHz	18675	QPSK	1	0	Low	12000	26500	-42.7	PASS
Band2	15MHz	18900	QPSK	1	0	Low	30	1000	-35.97	PASS
Band2	15MHz	18900	QPSK	1	0	Low	1000	5000	-37	PASS
Band2	15MHz	18900	QPSK	1	0	Low	5000	12000	-57.52	PASS
Band2	15MHz	18900	QPSK	1	0	Low	12000	26500	-42.78	PASS
Band2	15MHz	19125	QPSK	1	0	High	30	1000	-34.87	PASS
Band2	15MHz	19125	QPSK	1	0	High	1000	5000	-38.44	PASS
Band2	15MHz	19125	QPSK	1	0	High	5000	12000	-57.48	PASS
Band2	15MHz	19125	QPSK	1	0	High	12000	26500	-42.77	PASS
Band2	15MHz	18675	16QAM	1	0	Low	30	1000	-33.92	PASS
Band2	15MHz	18675	16QAM	1	0	Low	1000	5000	-38.06	PASS
Band2	15MHz	18675	16QAM	1	0	Low	5000	12000	-57.51	PASS
Band2	15MHz	18675	16QAM	1	0	Low	12000	26500	-42.75	PASS
Band2	15MHz	18900	16QAM	1	0	Low	30	1000	-35.32	PASS
Band2	15MHz	18900	16QAM	1	0	Low	1000	5000	-38.51	PASS
Band2	15MHz	18900	16QAM	1	0	Low	5000	12000	-57.5	PASS



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity




Band2	15MHz	18900	16QAM	1	0	Low	12000	26500	-42.59	PASS
Band2	15MHz	19125	16QAM	1	0	High	30	1000	-35.98	PASS
Band2	15MHz	19125	16QAM	1	0	High	1000	5000	-38.12	PASS
Band2	15MHz	19125	16QAM	1	0	High	5000	12000	-57.23	PASS
Band2	15MHz	19125	16QAM	1	0	High	12000	26500	-42.56	PASS
Band2	20MHz	18700	QPSK	1	0	Low	30	1000	-35.16	PASS
Band2	20MHz	18700	QPSK	1	0	Low	1000	5000	-38.7	PASS
Band2	20MHz	18700	QPSK	1	0	Low	5000	12000	-57.55	PASS
Band2	20MHz	18700	QPSK	1	0	Low	12000	26500	-42.62	PASS
Band2	20MHz	18900	QPSK	1	0	Low	30	1000	-35.95	PASS
Band2	20MHz	18900	QPSK	1	0	Low	1000	5000	-38.55	PASS
Band2	20MHz	18900	QPSK	1	0	Low	5000	12000	-57.2	PASS
Band2	20MHz	18900	QPSK	1	0	Low	12000	26500	-42.78	PASS
Band2	20MHz	19100	QPSK	1	0	High	30	1000	-35.25	PASS
Band2	20MHz	19100	QPSK	1	0	High	1000	5000	-38.38	PASS
Band2	20MHz	19100	QPSK	1	0	High	5000	12000	-57.52	PASS
Band2	20MHz	19100	QPSK	1	0	High	12000	26500	-42.79	PASS
Band2	20MHz	18700	16QAM	1	0	Low	30	1000	-35.7	PASS
Band2	20MHz	18700	16QAM	1	0	Low	1000	5000	-41.64	PASS
Band2	20MHz	18700	16QAM	1	0	Low	5000	12000	-57.51	PASS
Band2	20MHz	18700	16QAM	1	0	Low	12000	26500	-42.56	PASS
Band2	20MHz	18900	16QAM	1	0	Low	30	1000	-35.3	PASS
Band2	20MHz	18900	16QAM	1	0	Low	1000	5000	-39.7	PASS
Band2	20MHz	18900	16QAM	1	0	Low	5000	12000	-57.55	PASS
Band2	20MHz	18900	16QAM	1	0	Low	12000	26500	-42.7	PASS
Band2	20MHz	19100	16QAM	1	0	High	30	1000	-35.43	PASS
Band2	20MHz	19100	16QAM	1	0	High	1000	5000	-38.72	PASS
Band2	20MHz	19100	16QAM	1	0	High	5000	12000	-57.42	PASS
Band2	20MHz	19100	16QAM	1	0	High	12000	26500	-42.62	PASS





Test Graphs

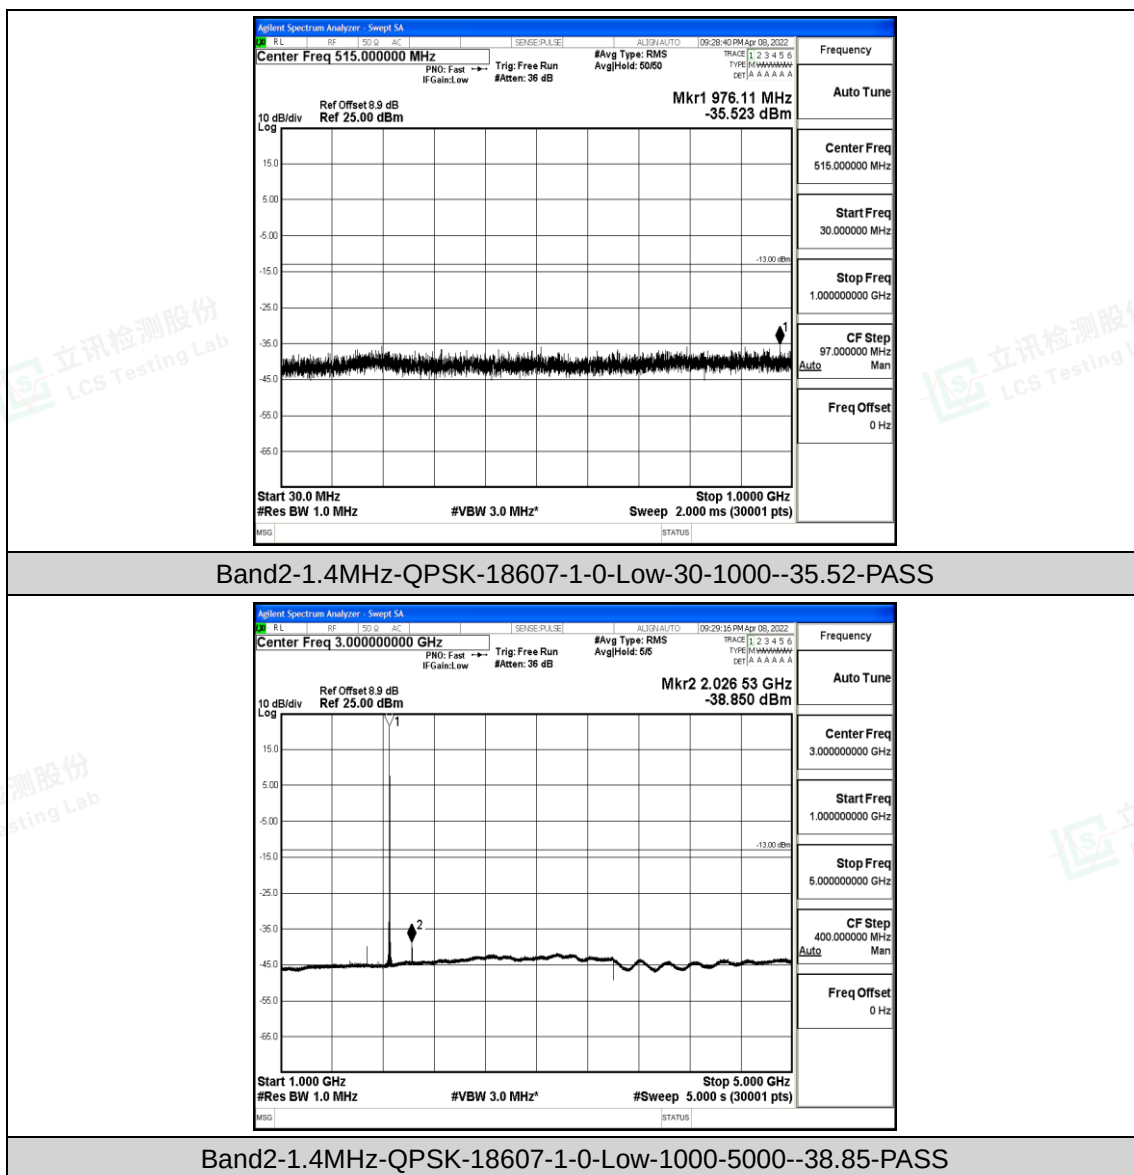


Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity

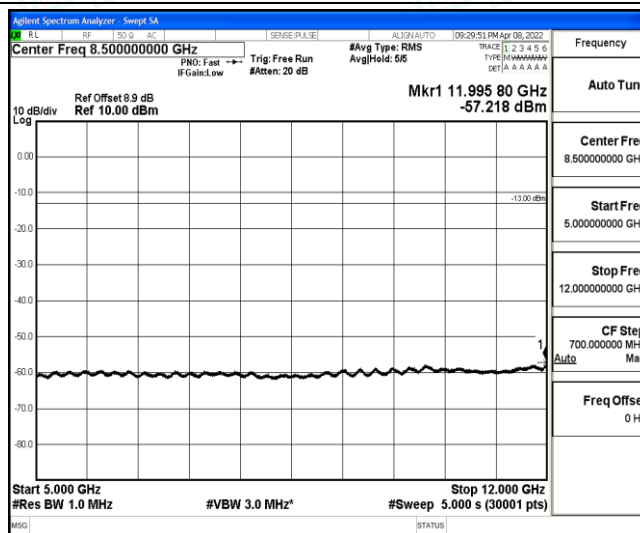

Band2-1.4MHz-QPSK-18607-1-0-Low-5000-12000--57.22-PASS

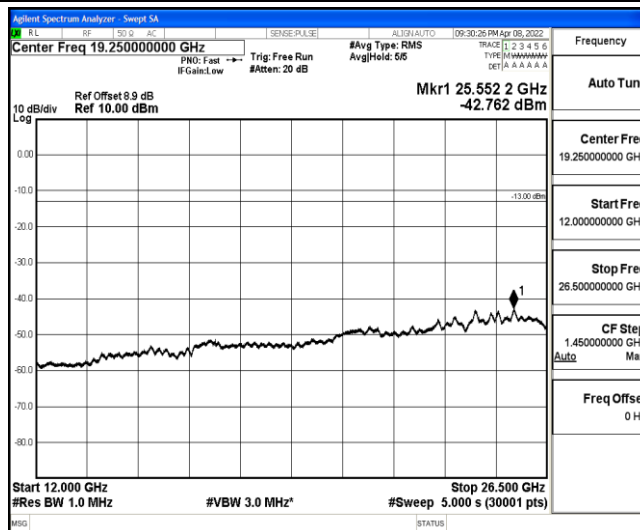

Band2-1.4MHz-QPSK-18607-1-0-Low-12000-26500--42.76-PASS

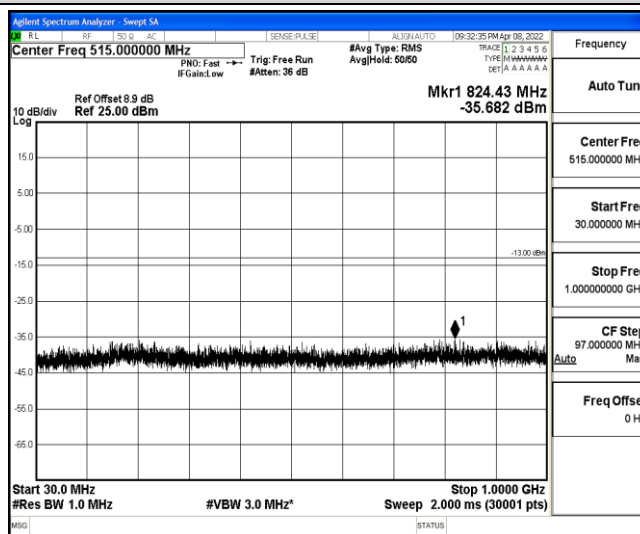

Band2-1.4MHz-QPSK-18900-1-0-Low-30-1000--35.68-PASS




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity

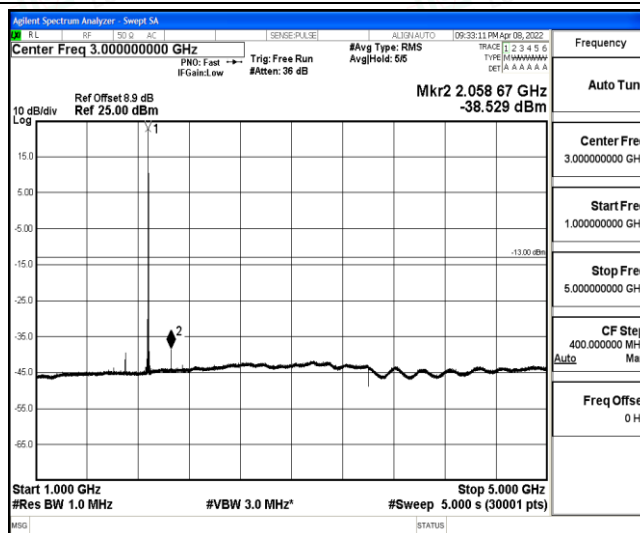

Band2-1.4MHz-QPSK-18900-1-0-Low-1000-5000--38.53-PASS

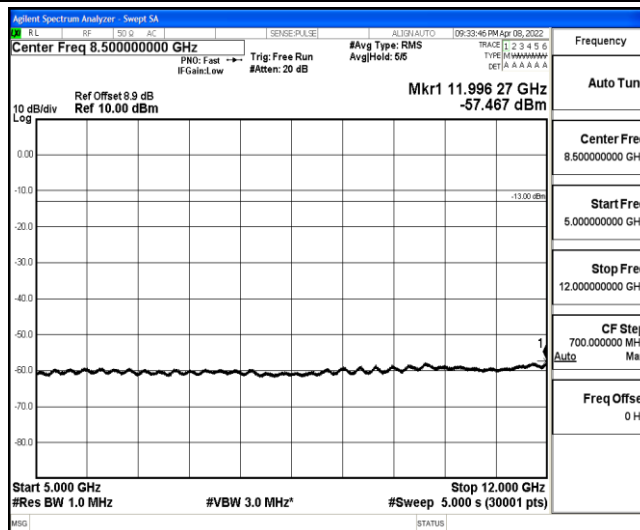


Band2-1.4MHz-QPSK-18900-1-0-Low-5000-12000--57.47-PASS

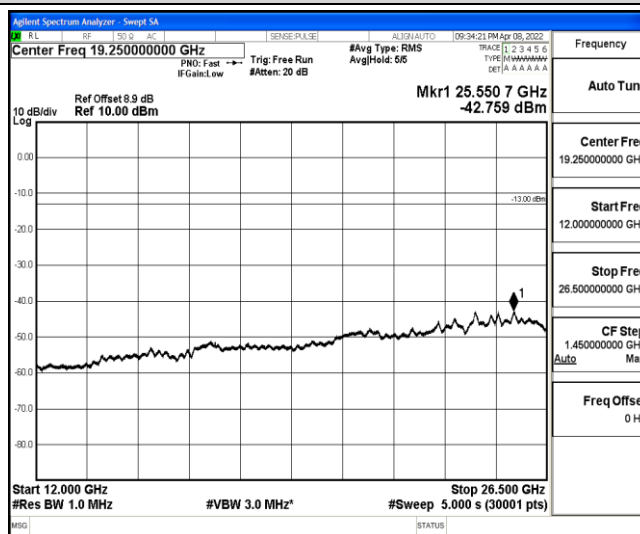


Band2-1.4MHz-QPSK-18900-1-0-Low-12000-26500--42.76-PASS




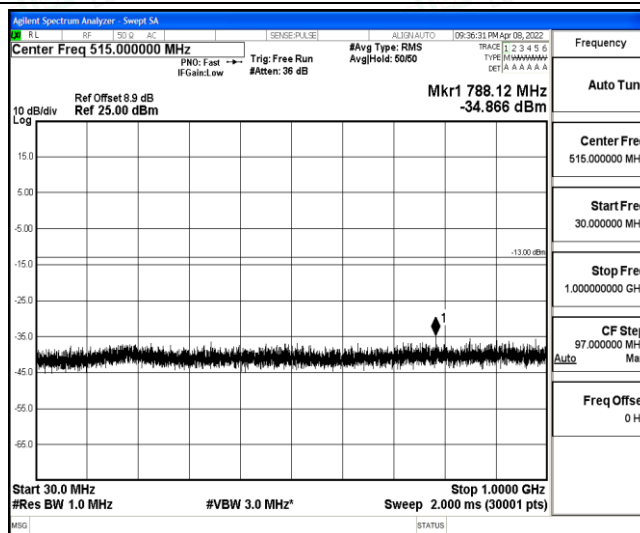

Band2-1.4MHz-QPSK-19193-1-0-High-30-1000--34.87-PASS

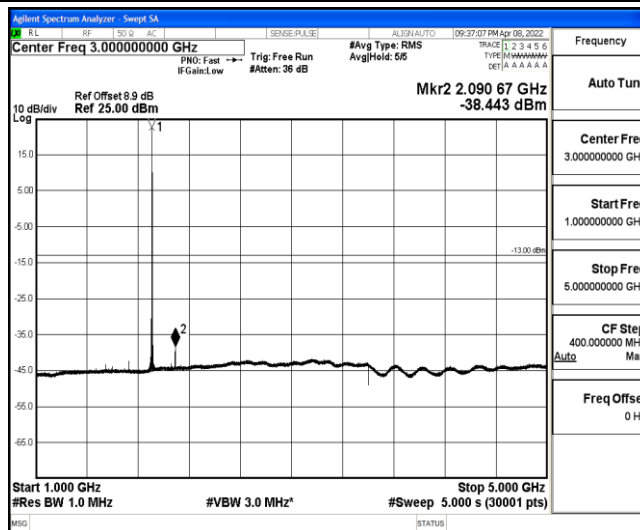

Band2-1.4MHz-QPSK-19193-1-0-High-1000-5000--38.44-PASS

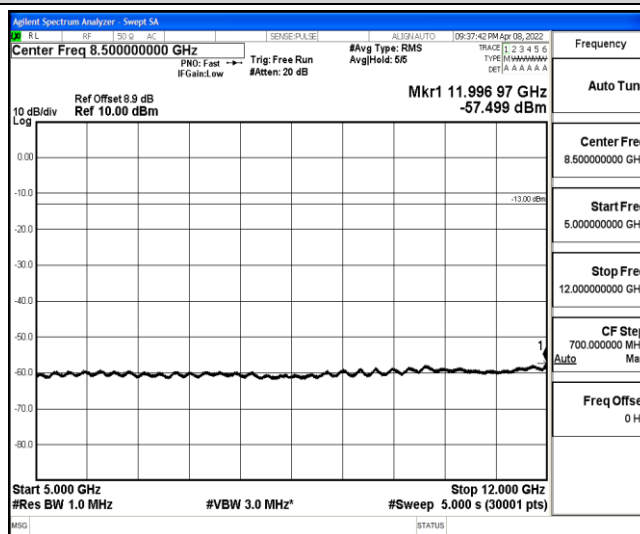

Band2-1.4MHz-QPSK-19193-1-0-High-5000-12000--57.5-PASS




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity

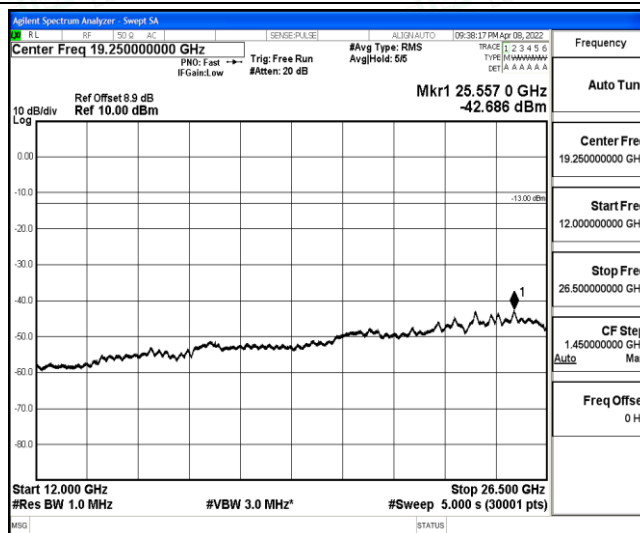

Band2-1.4MHz-QPSK-19193-1-0-High-12000-26500--42.69-PASS

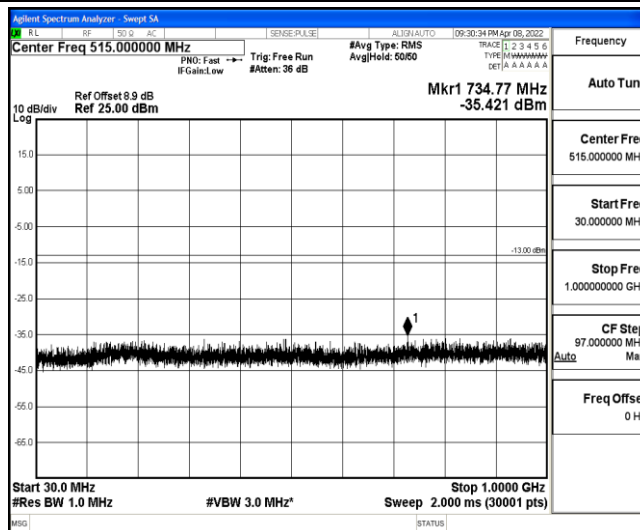

Band2-1.4MHz-16QAM-18607-1-0-Low-30-1000--35.42-PASS

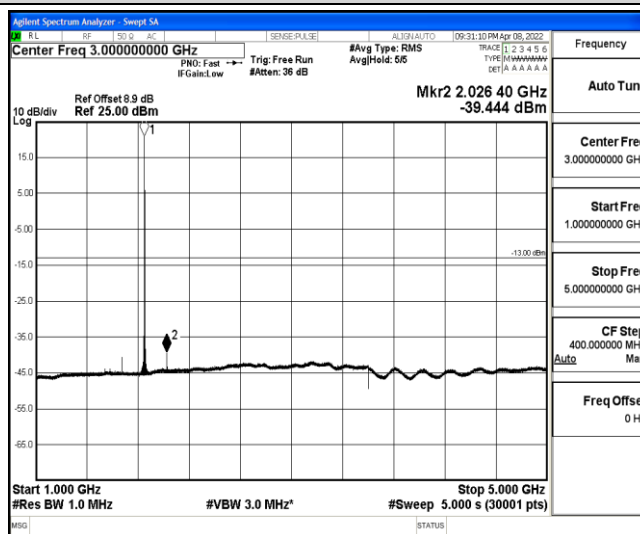

Band2-1.4MHz-16QAM-18607-1-0-Low-1000-5000--39.44-PASS




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity

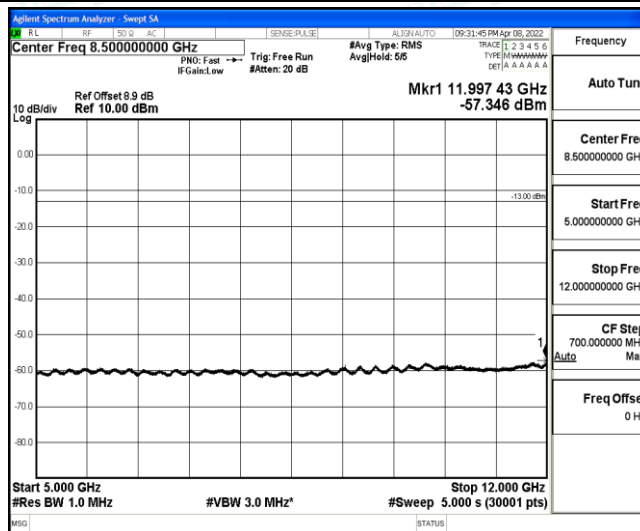

Band2-1.4MHz-16QAM-18607-1-0-Low-5000-12000--57.35-PASS

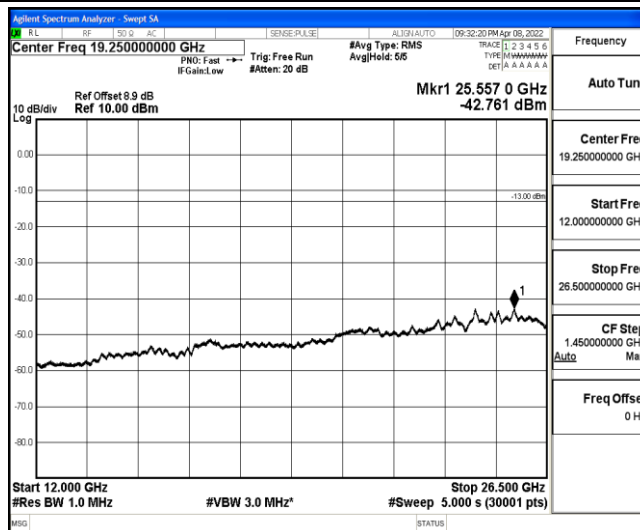

Band2-1.4MHz-16QAM-18607-1-0-Low-12000-26500--42.76-PASS

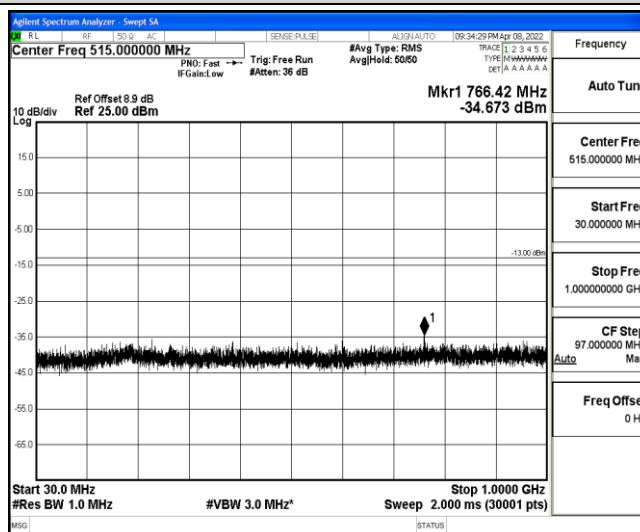

Band2-1.4MHz-16QAM-18900-1-0-Low-30-1000--34.67-PASS




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity

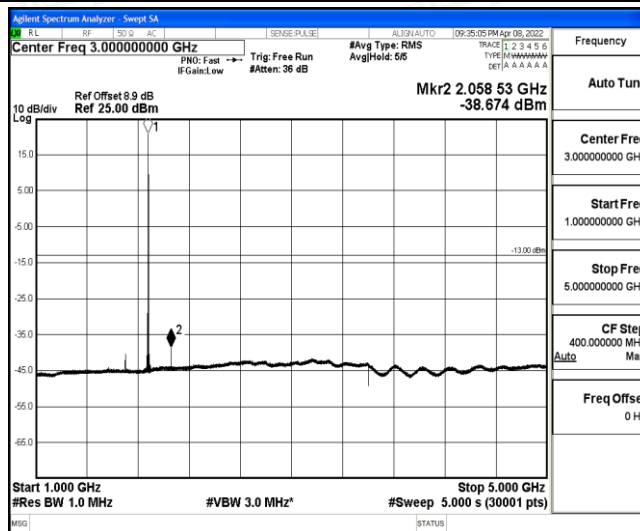

Band2-1.4MHz-16QAM-18900-1-0-Low-1000-5000--38.67-PASS

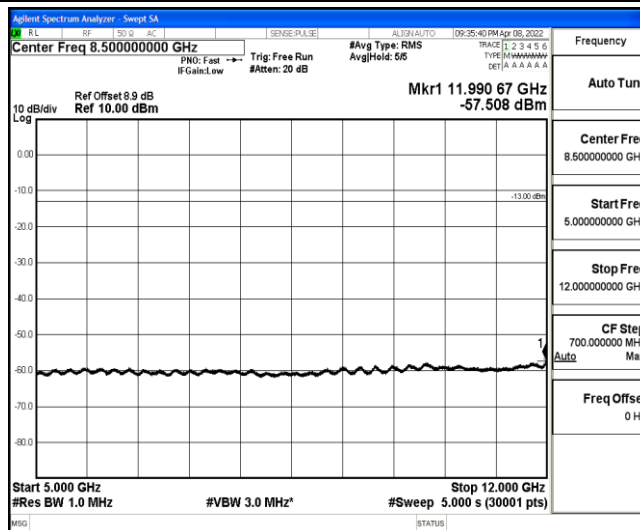

Band2-1.4MHz-16QAM-18900-1-0-Low-5000-12000--57.51-PASS

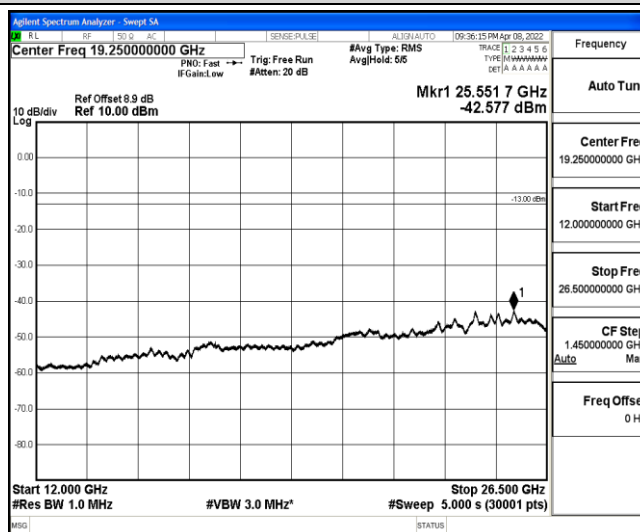

Band2-1.4MHz-16QAM-18900-1-0-Low-12000-26500--42.58-PASS




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity

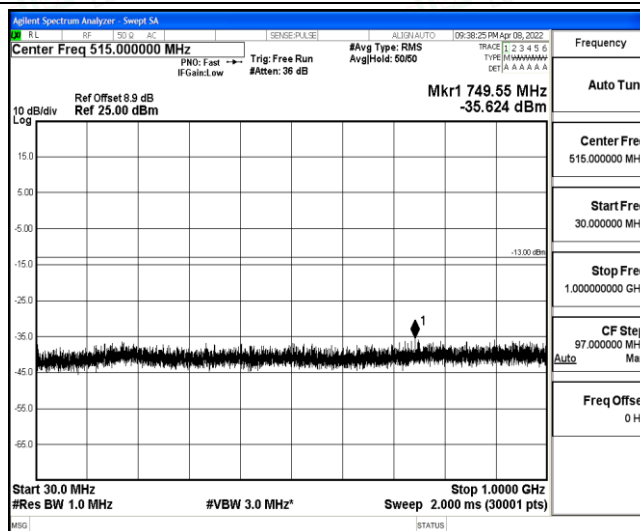

Band2-1.4MHz-16QAM-19193-1-0-High-30-1000--35.62-PASS

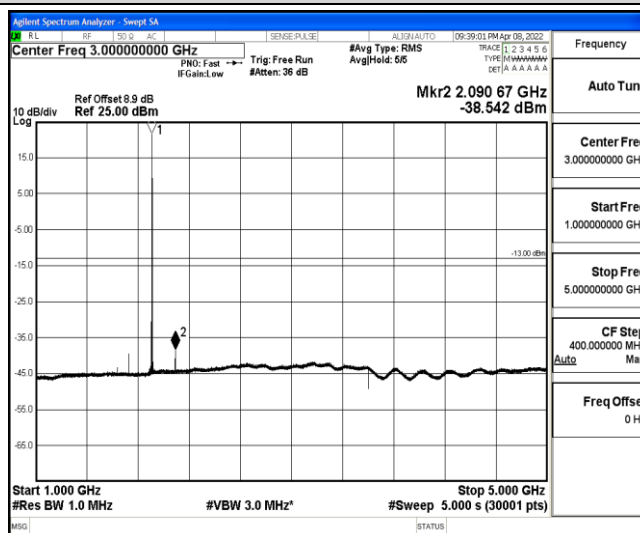


Band2-1.4MHz-16QAM-19193-1-0-High-1000-5000--38.54-PASS

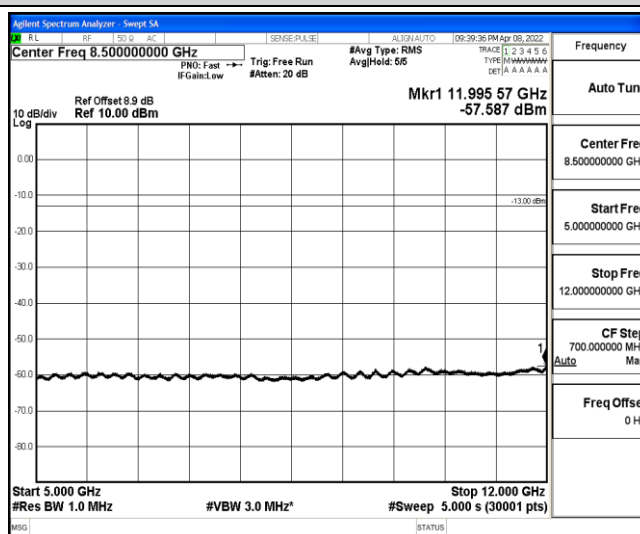


Band2-1.4MHz-16QAM-19193-1-0-High-5000-12000--57.59-PASS




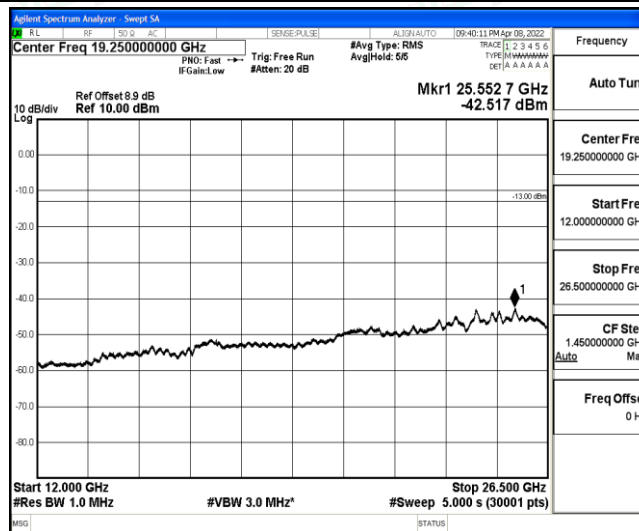

Band2-1.4MHz-16QAM-19193-1-0-High-12000-26500--42.52-PASS

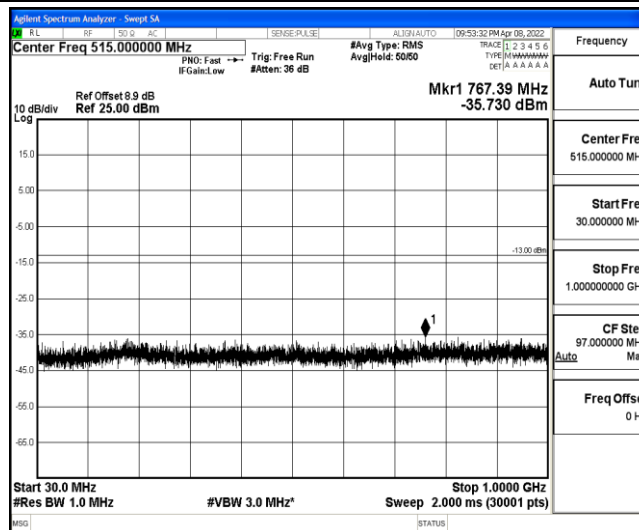


Band2-3MHz-QPSK-18615-1-0-Low-30-1000--35.73-PASS

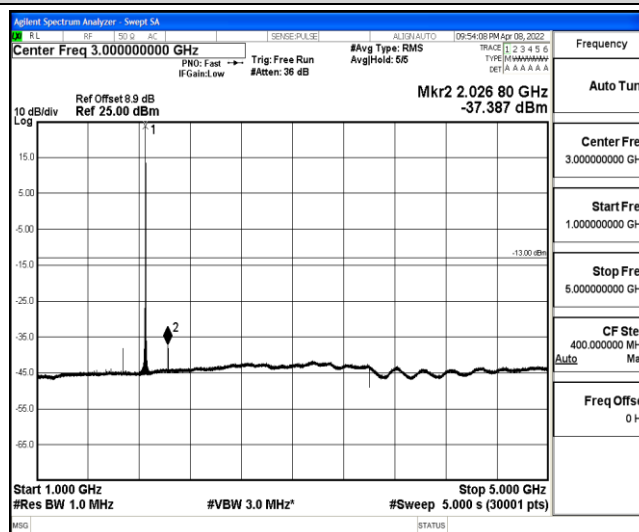


Band2-3MHz-QPSK-18615-1-0-Low-1000-5000--37.39-PASS




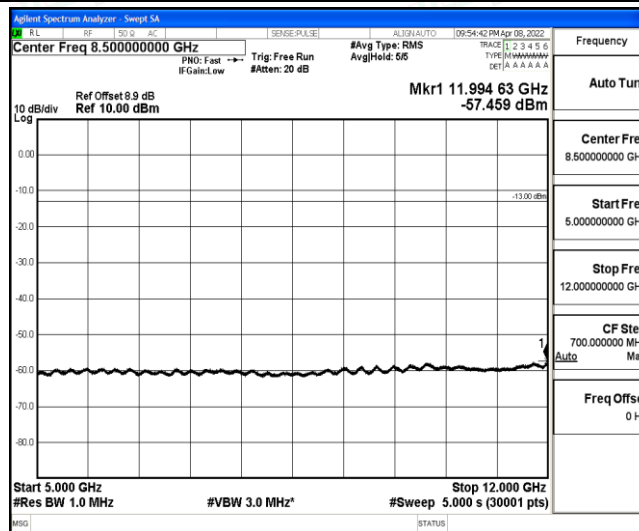

Band2-3MHz-QPSK-18615-1-0-Low-5000-12000--57.46-PASS

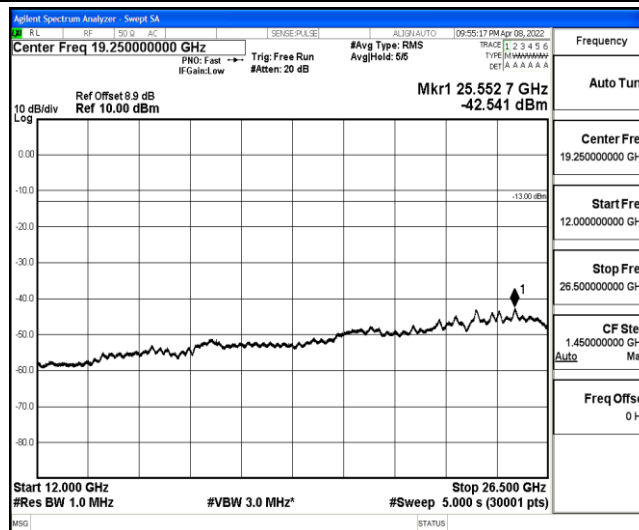


Band2-3MHz-QPSK-18615-1-0-Low-12000-26500--42.54-PASS

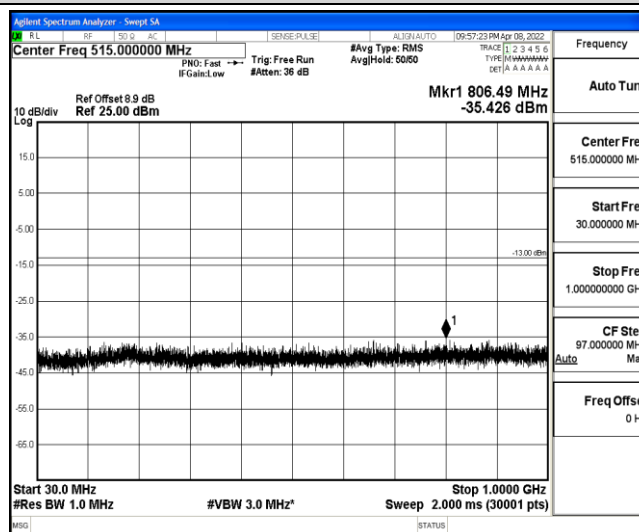


Band2-3MHz-QPSK-18900-1-0-Low-30-1000--35.43-PASS




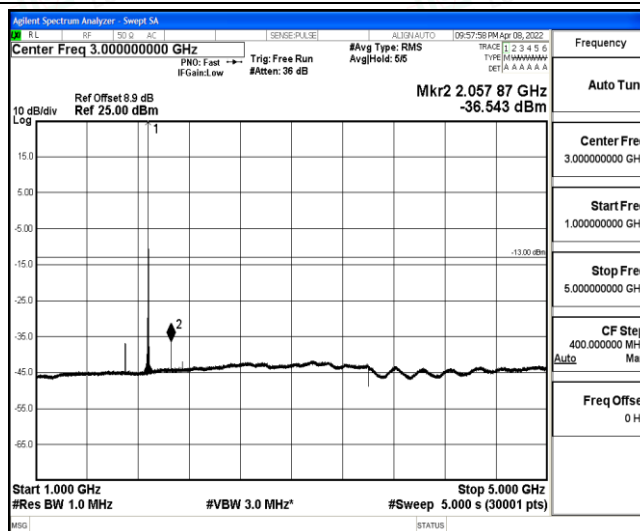

Band2-3MHz-QPSK-18900-1-0-Low-1000-5000--36.54-PASS

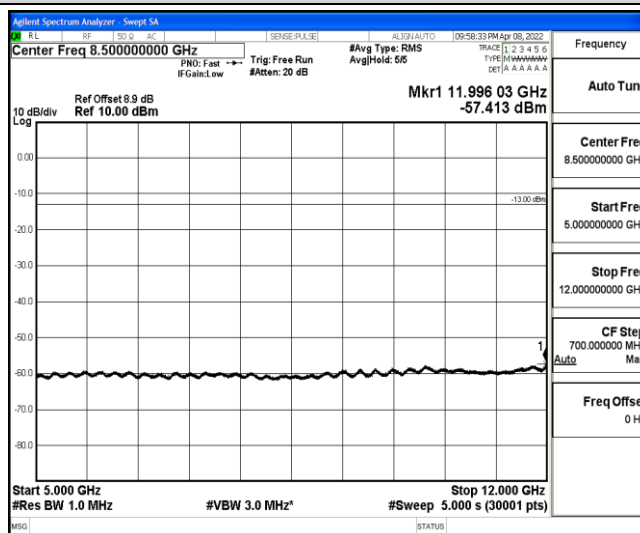


Band2-3MHz-QPSK-18900-1-0-Low-5000-12000--57.41-PASS

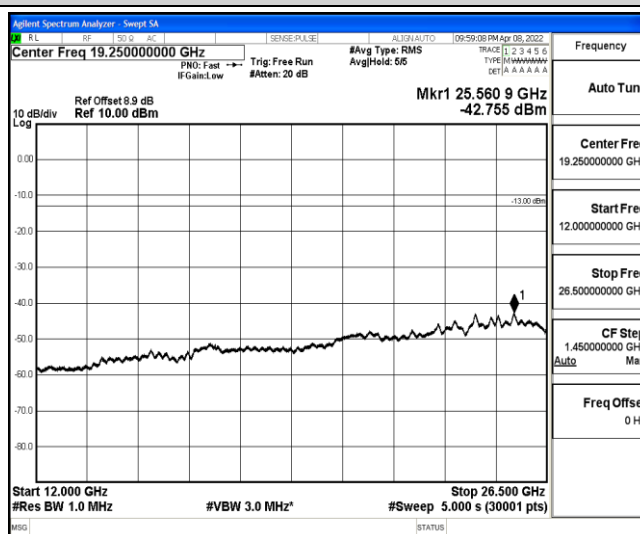


Band2-3MHz-QPSK-18900-1-0-Low-12000-26500--42.76-PASS




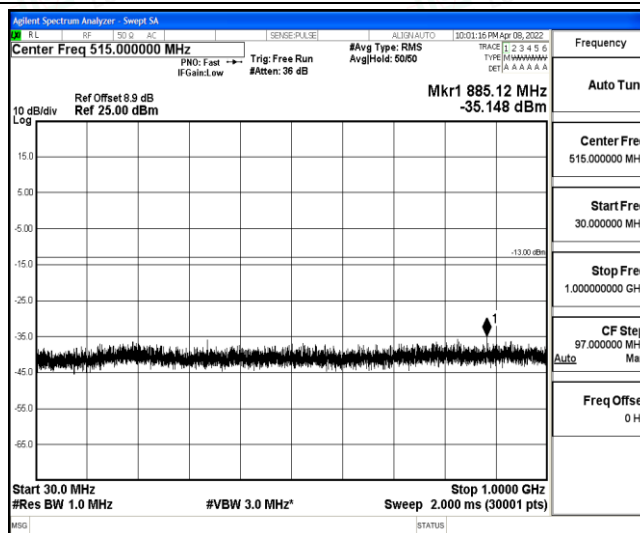

Band2-3MHz-QPSK-19185-1-0-High-30-1000--35.15-PASS

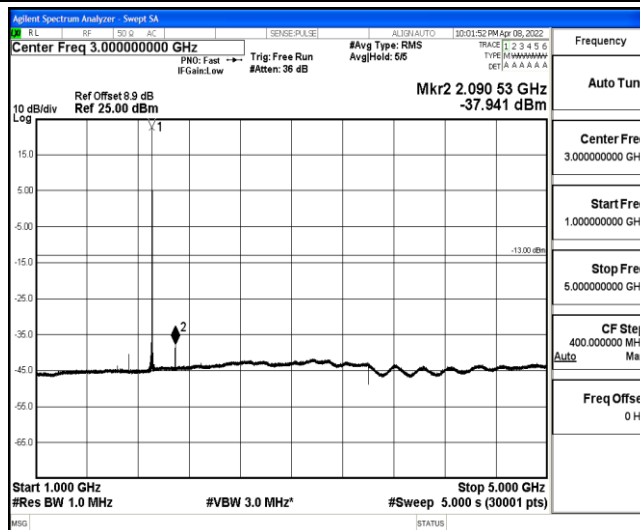

Band2-3MHz-QPSK-19185-1-0-High-1000-5000--37.94-PASS

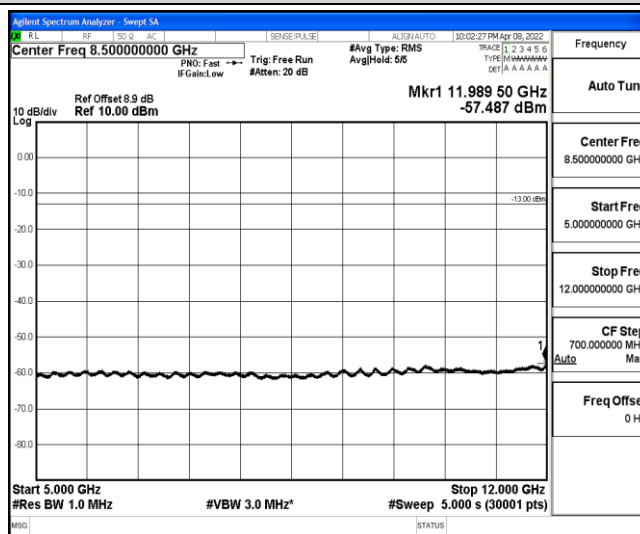

Band2-3MHz-QPSK-19185-1-0-High-5000-12000--57.49-PASS




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity

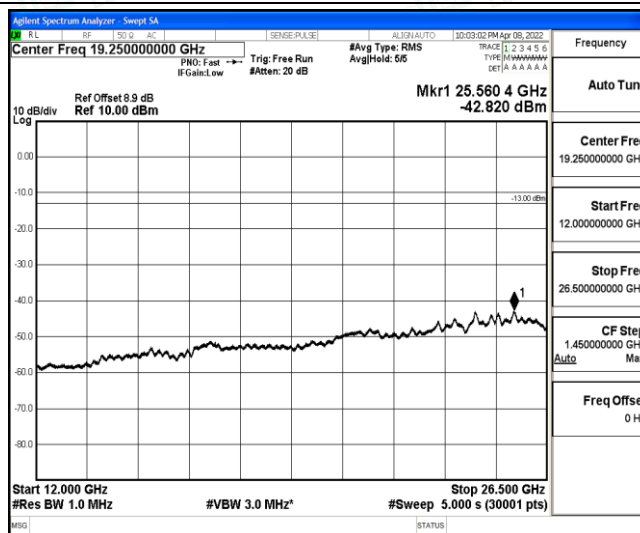

Band2-3MHz-QPSK-19185-1-0-High-12000-26500--42.82-PASS

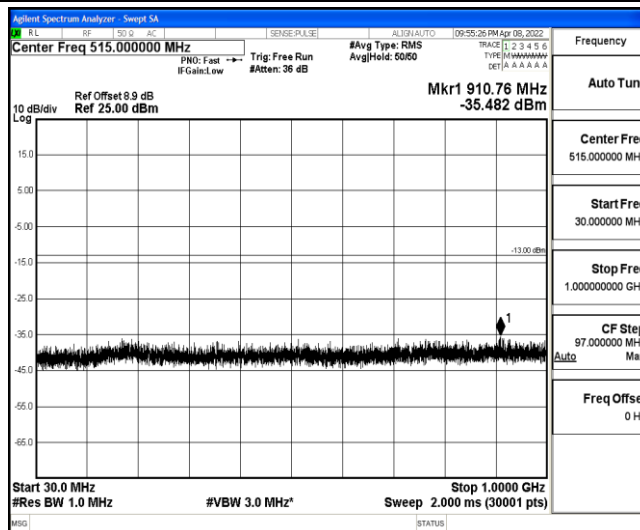

Band2-3MHz-16QAM-18615-1-0-Low-30-1000--35.48-PASS

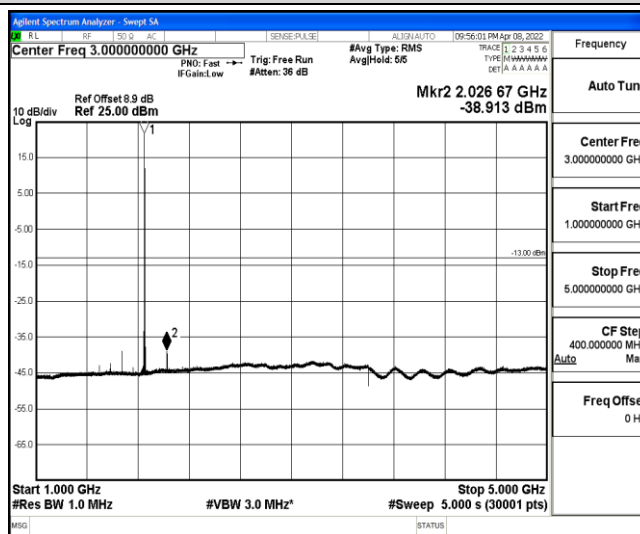

Band2-3MHz-16QAM-18615-1-0-Low-1000-5000--38.91-PASS



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity