






7.2 Test Graphs

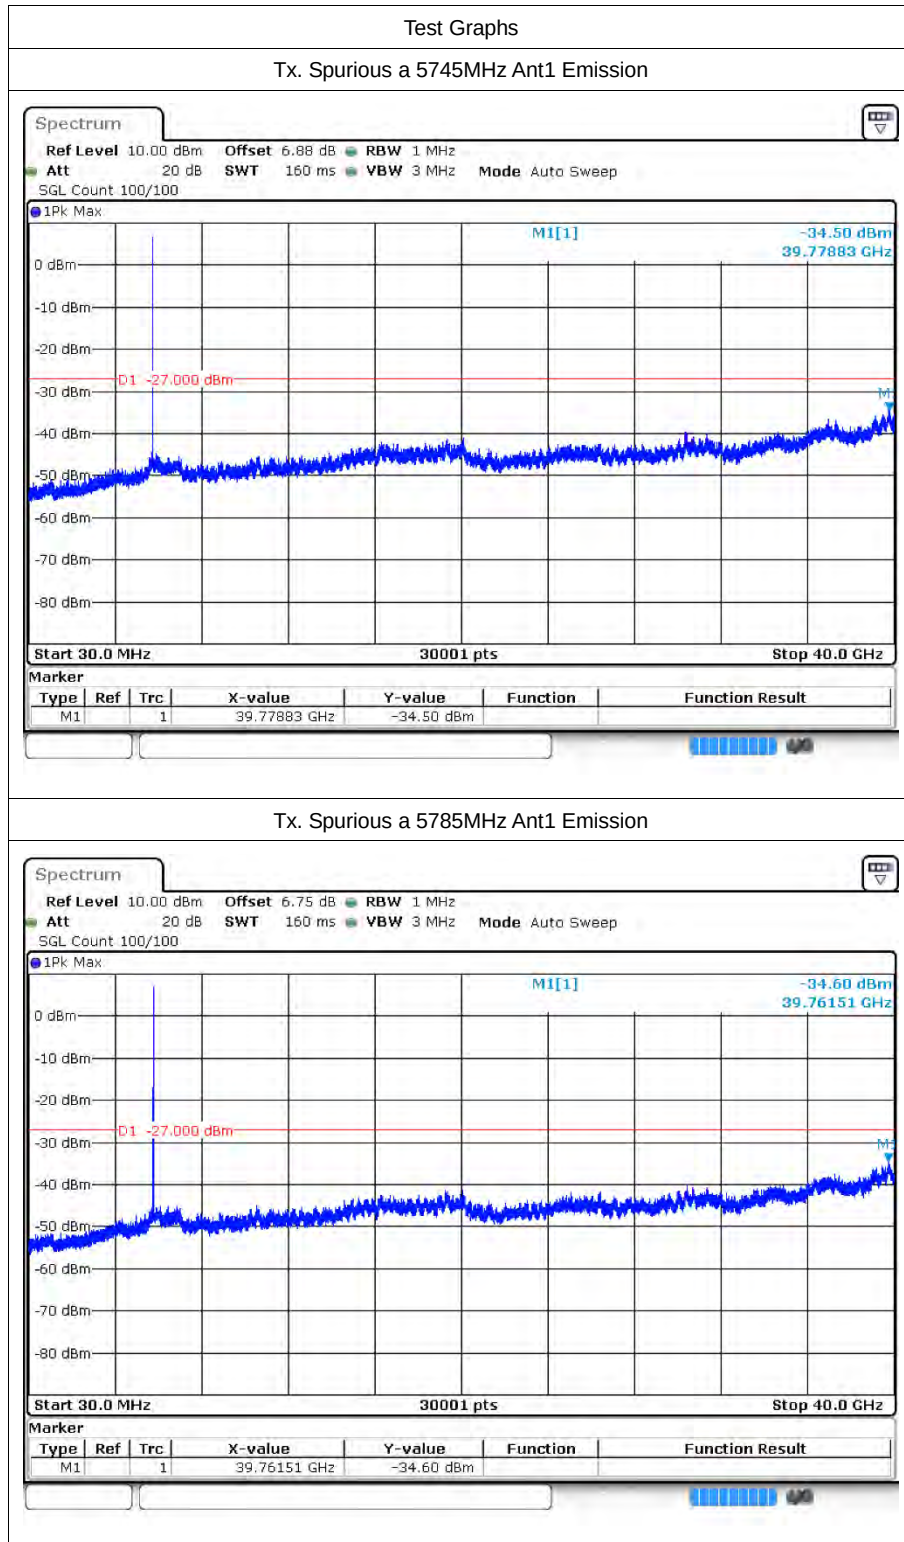


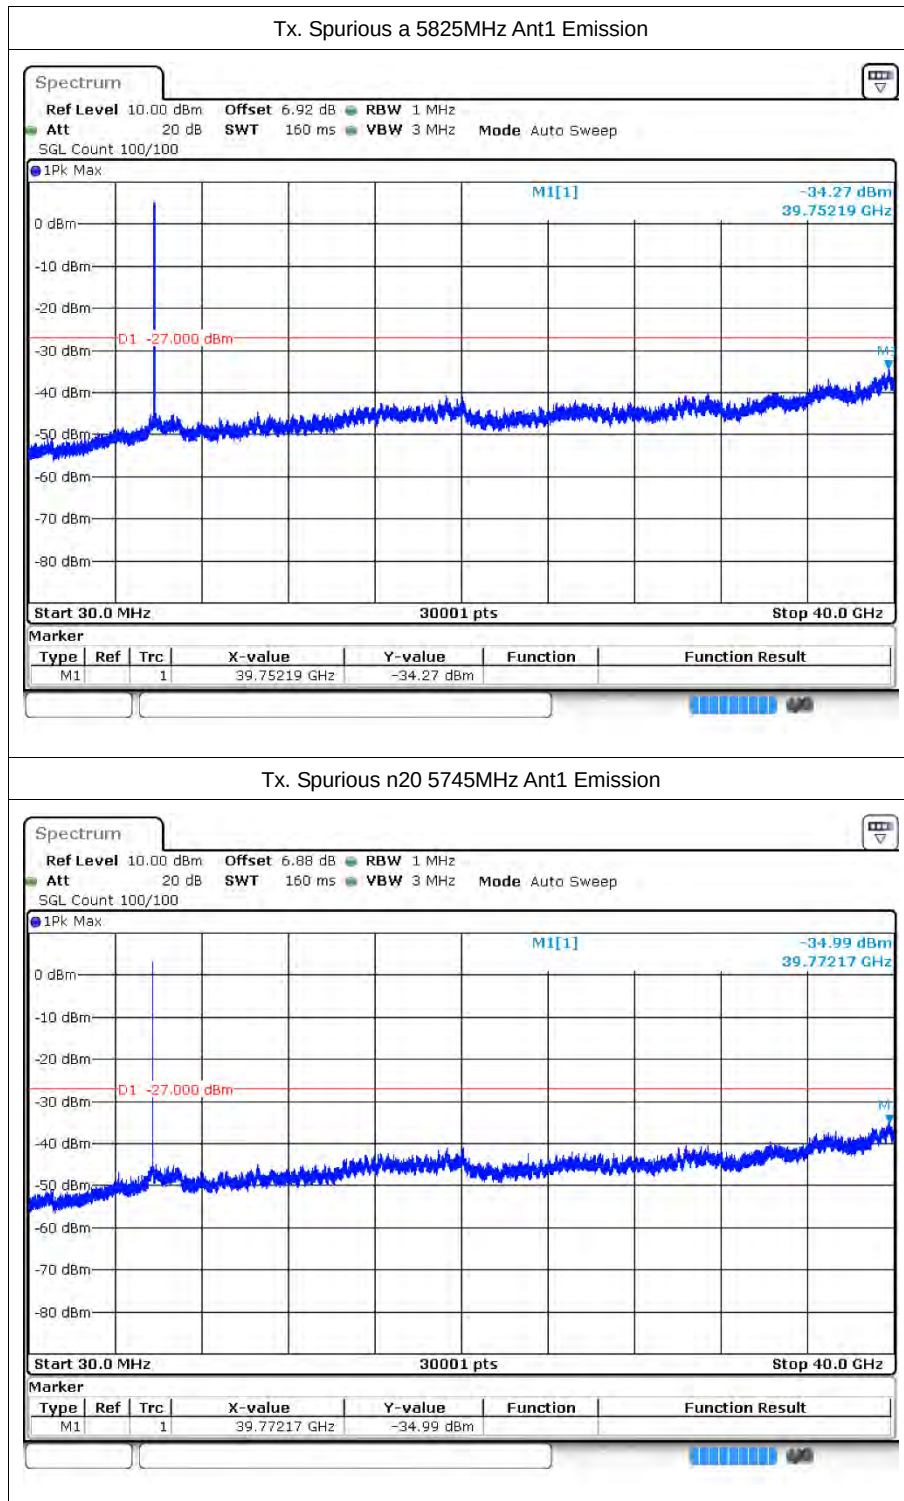


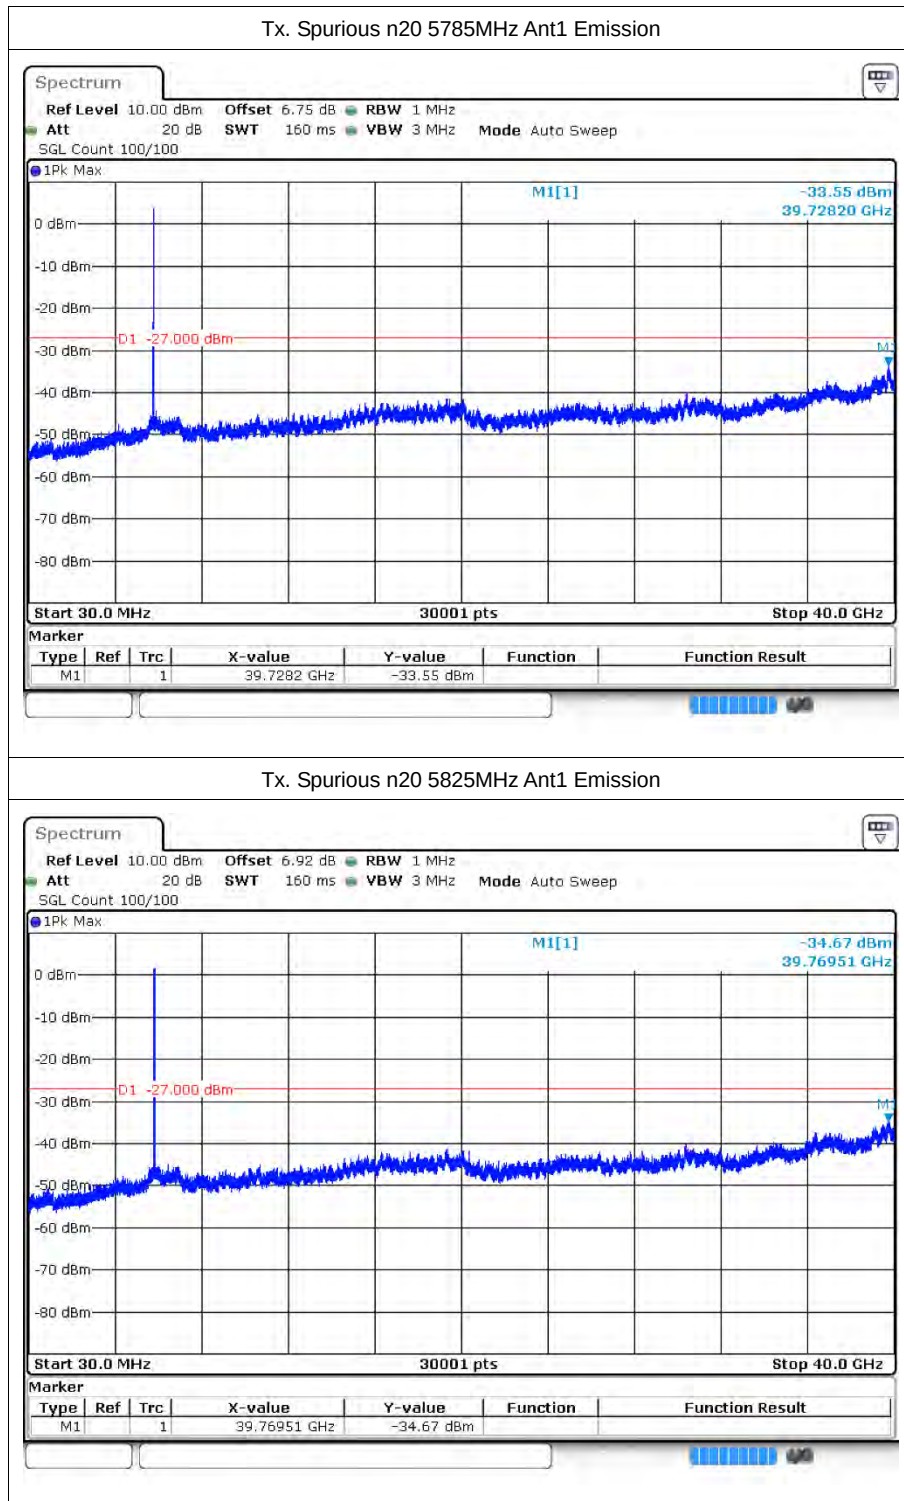

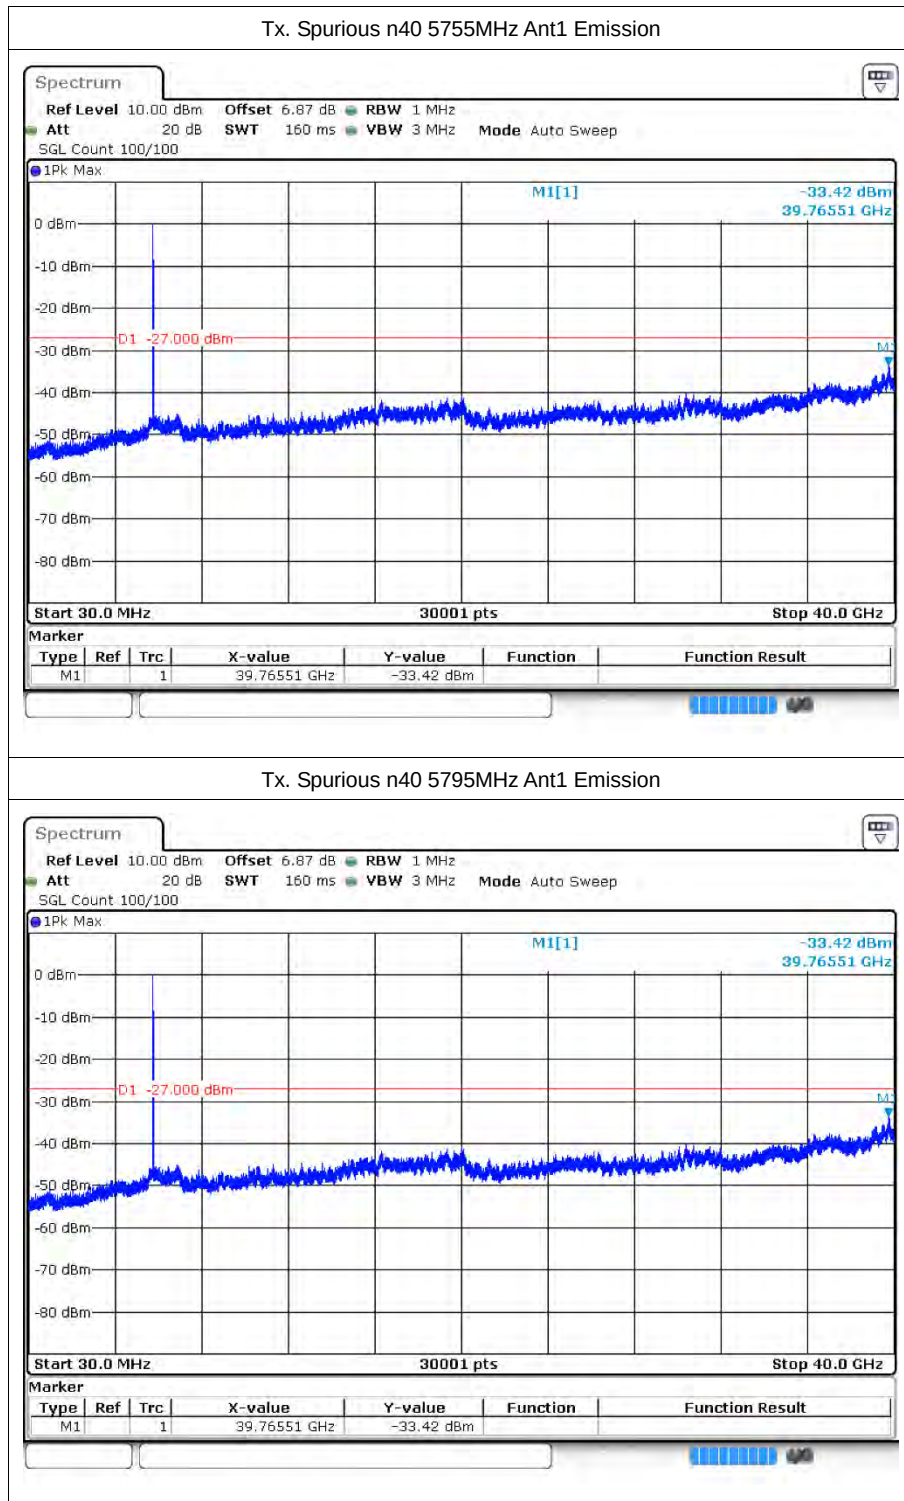


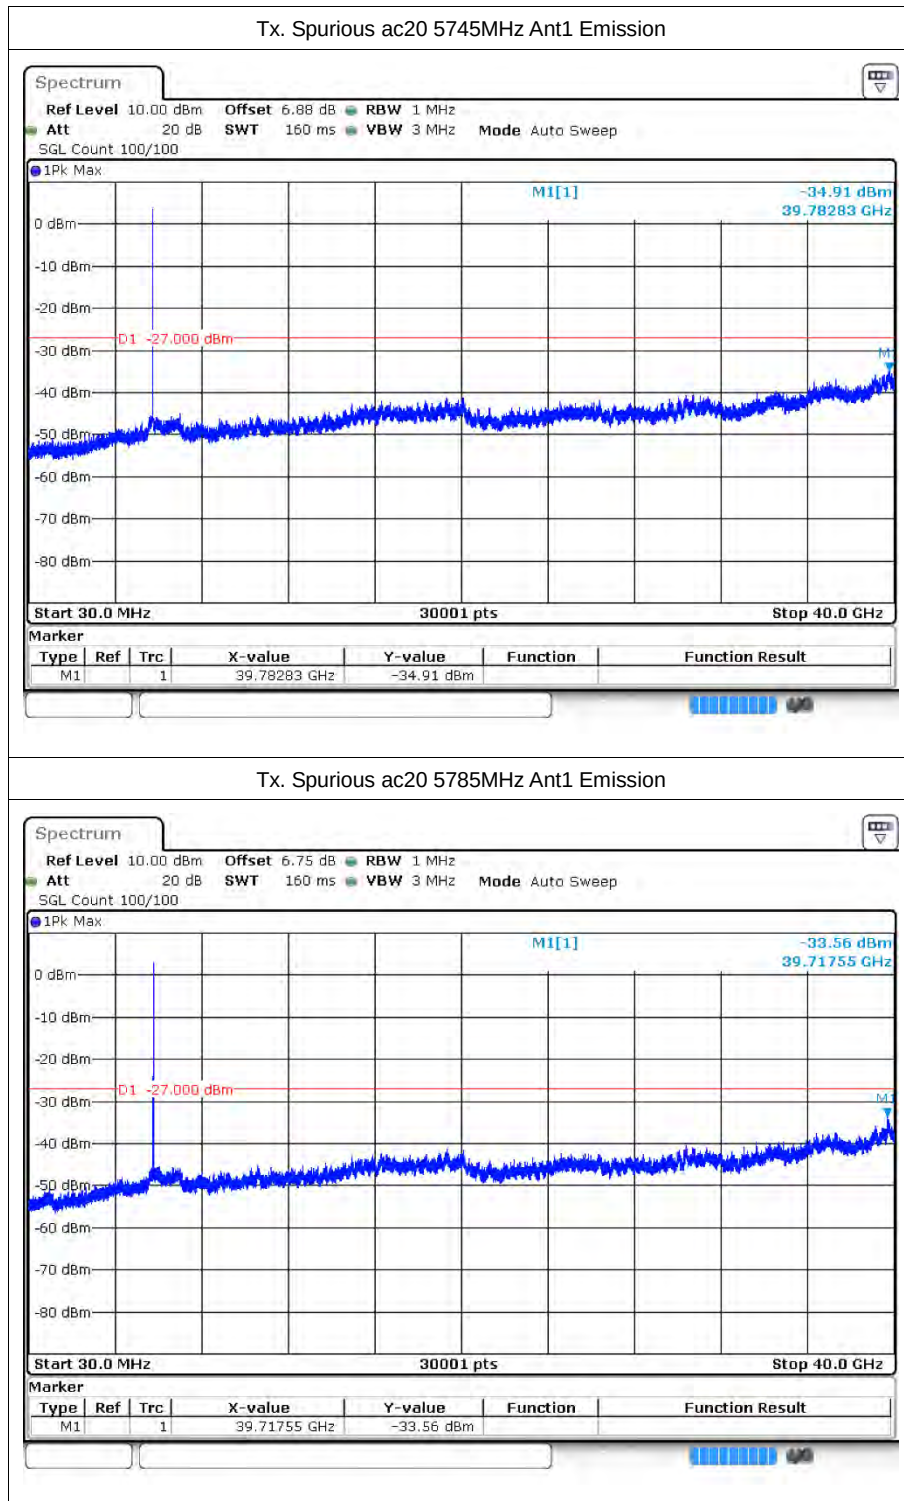

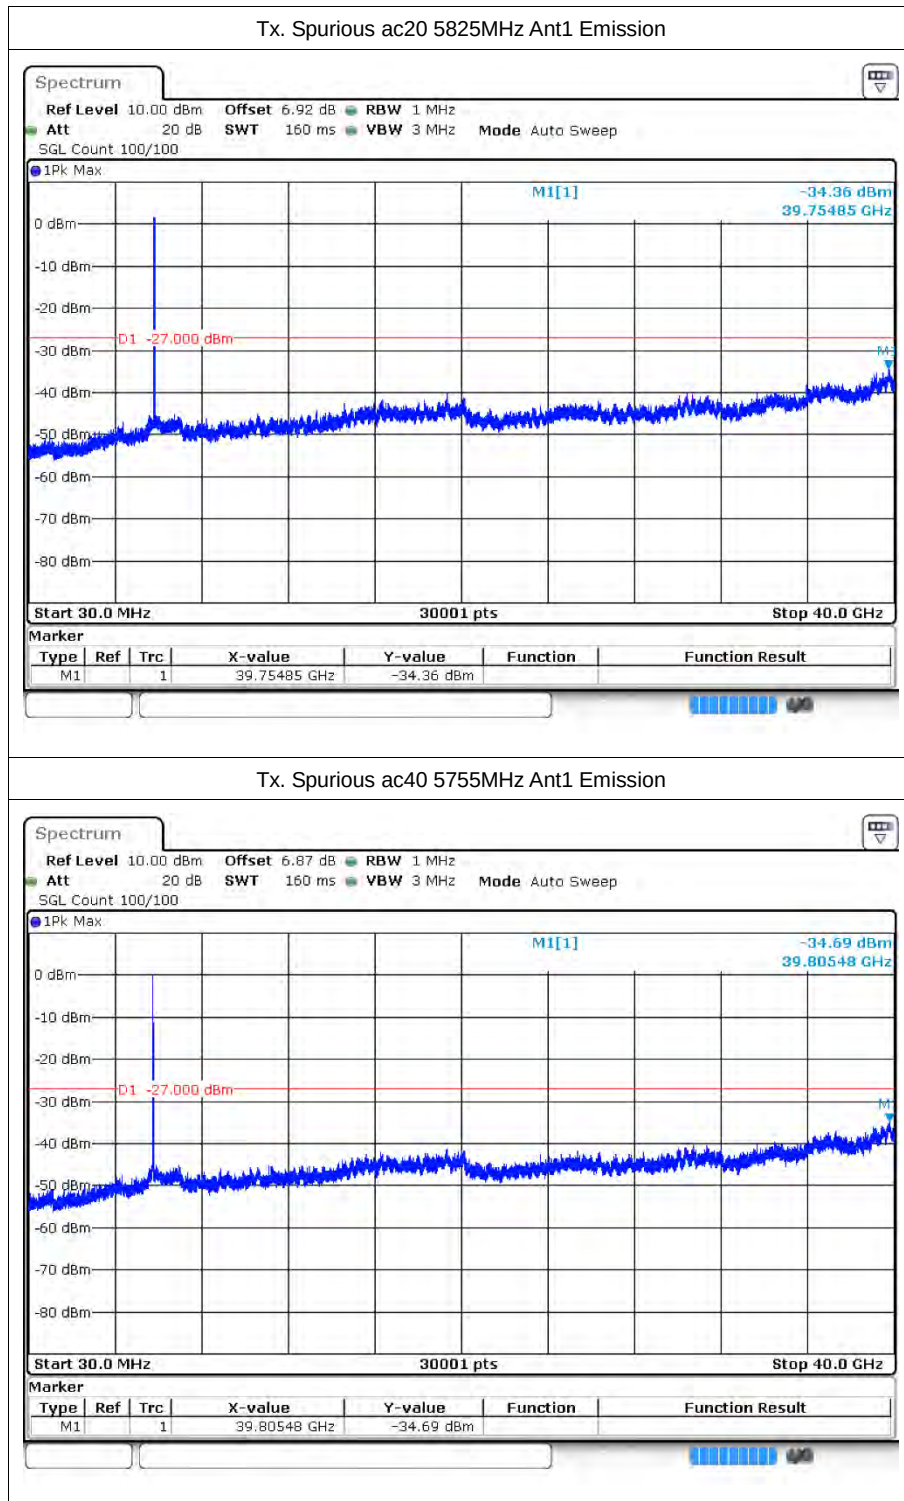


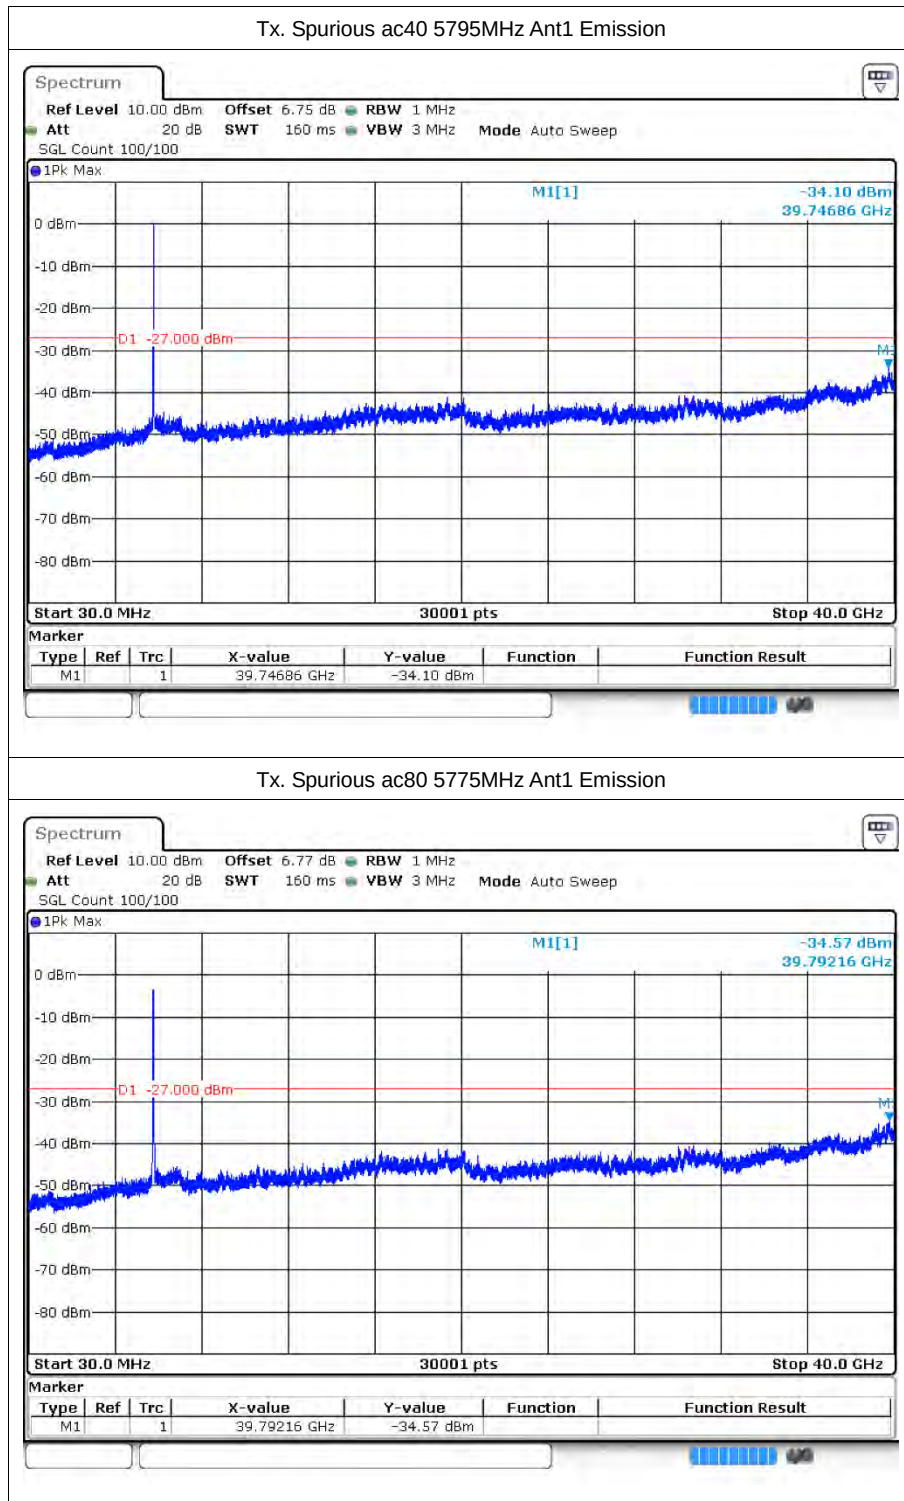



Tx. Spurious a 5745MHz Ant2 Emission

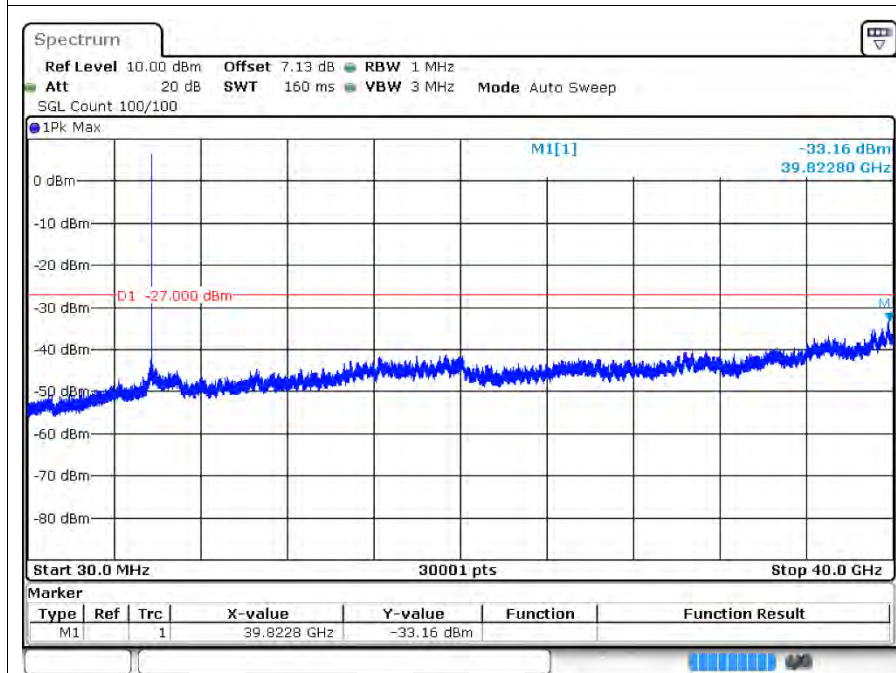



Tx. Spurious a 5785MHz Ant2 Emission

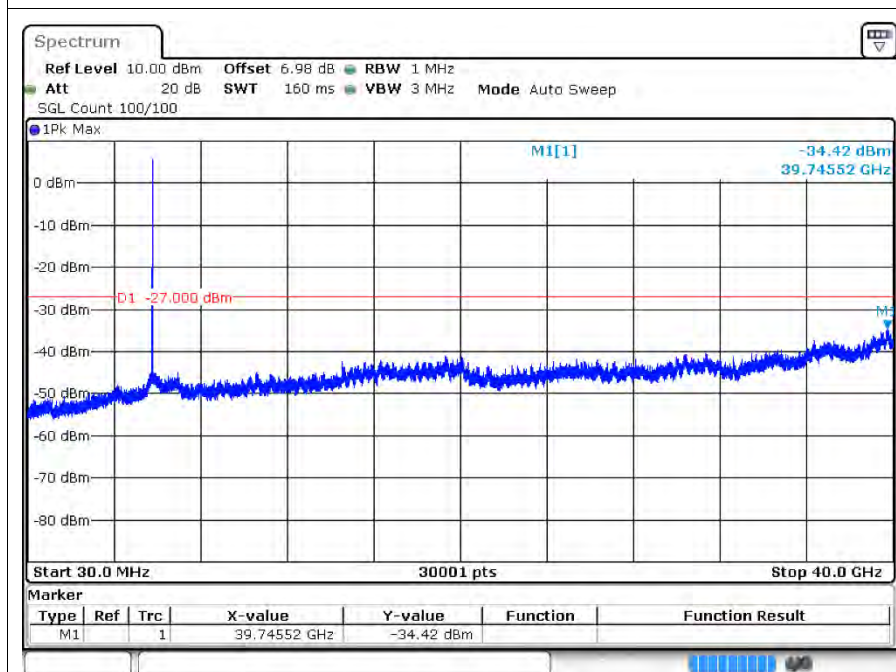


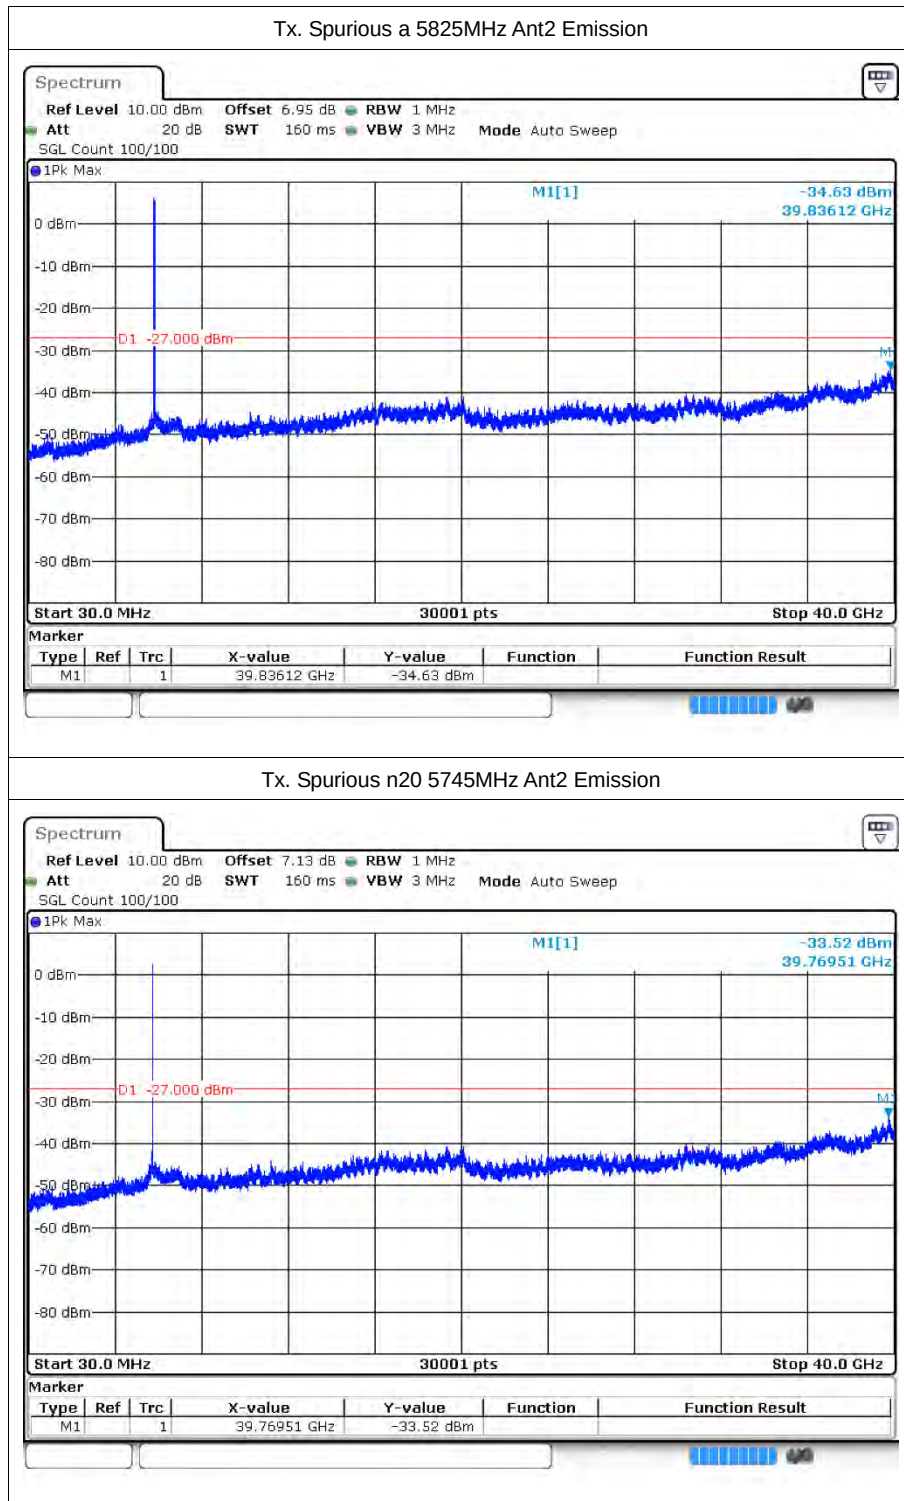


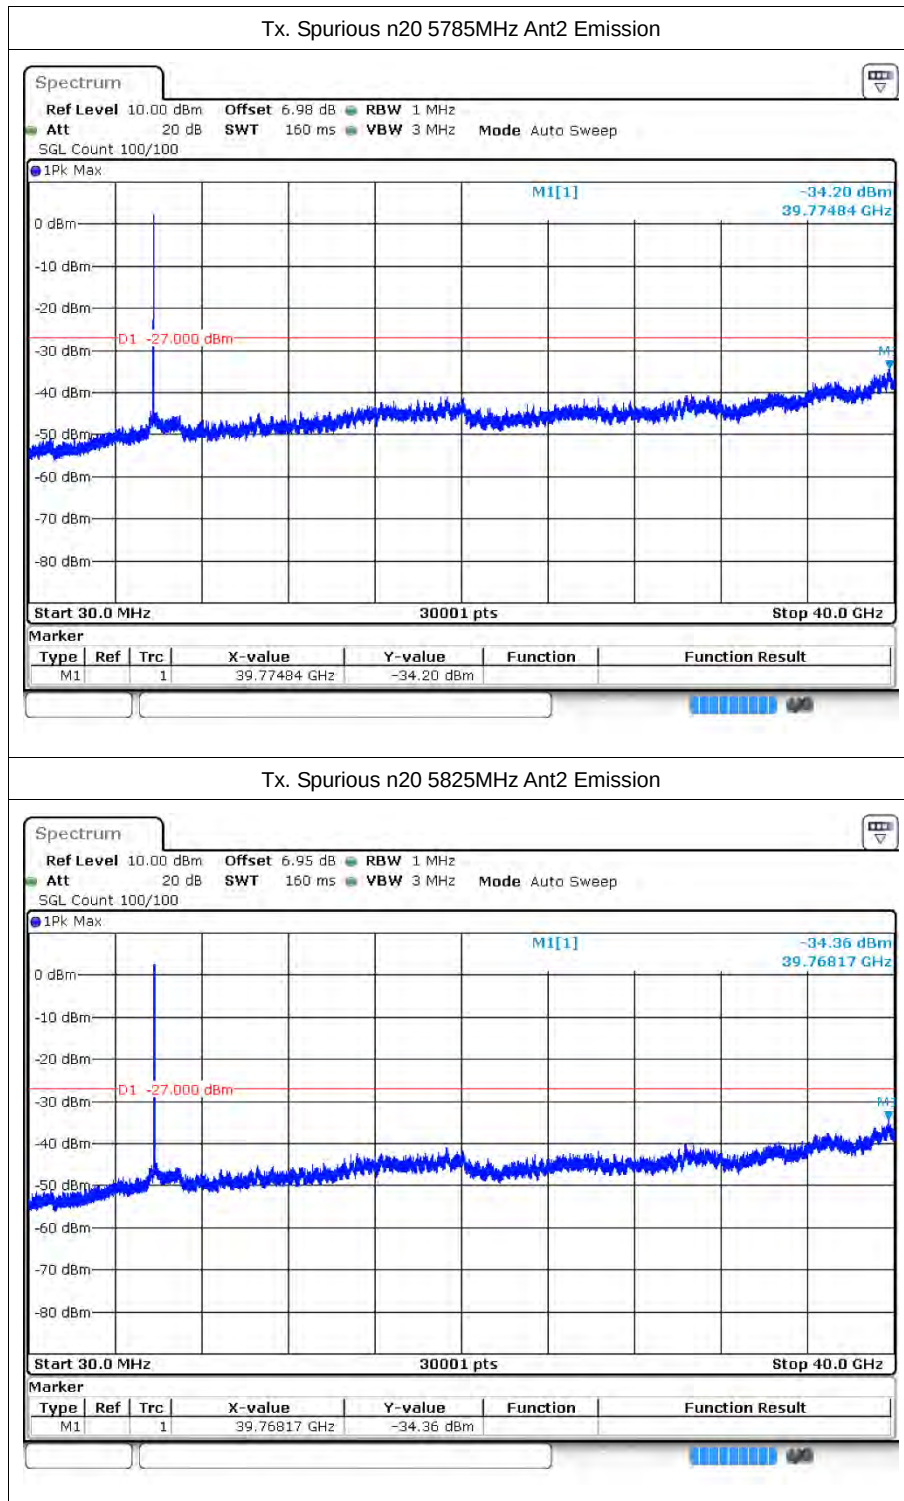

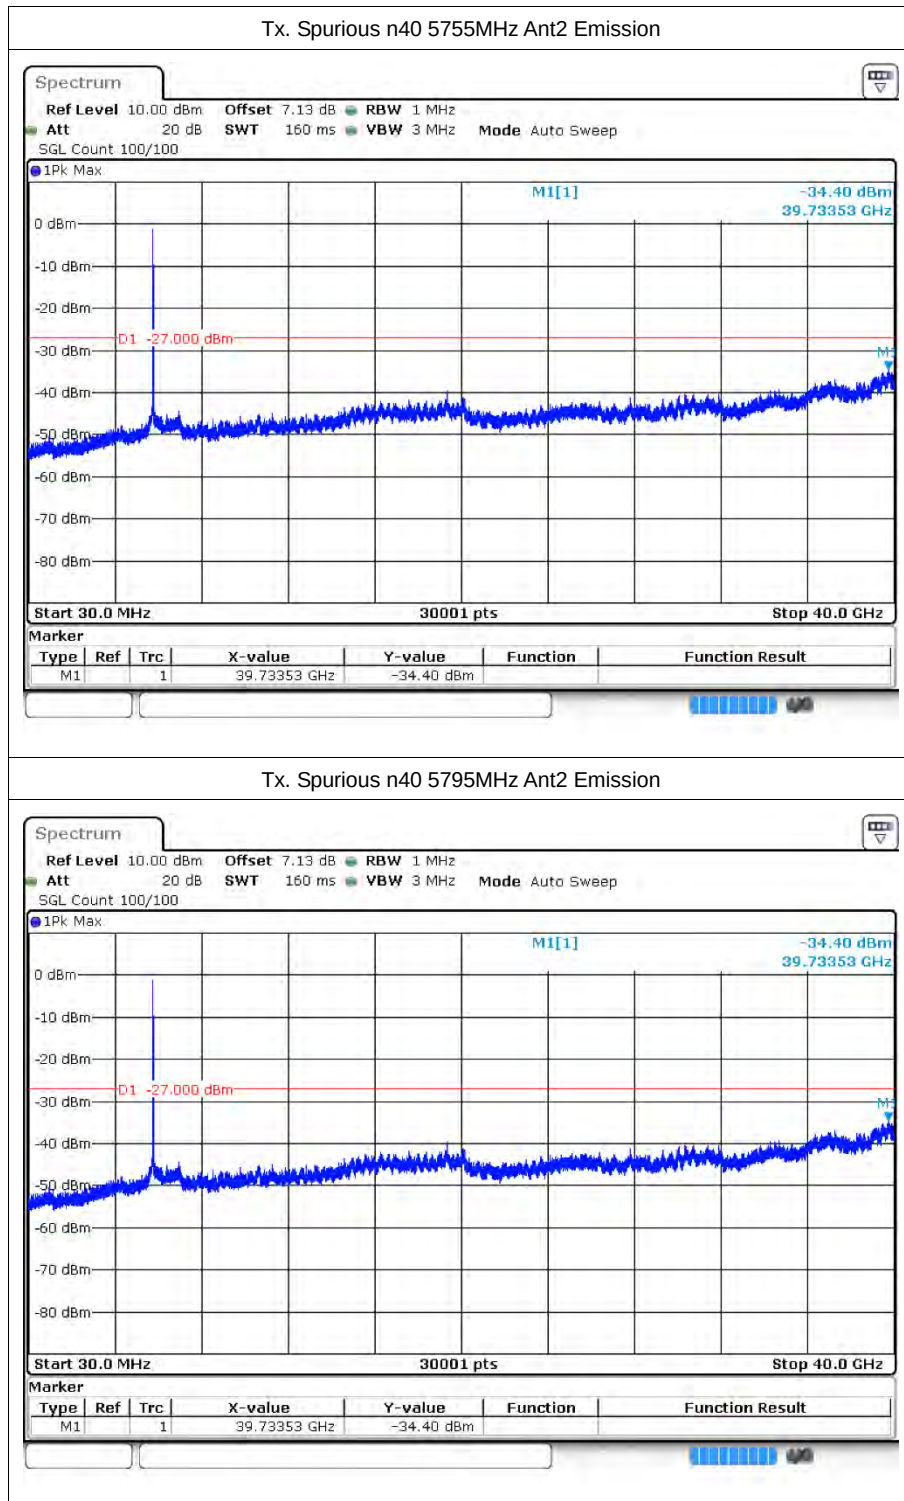

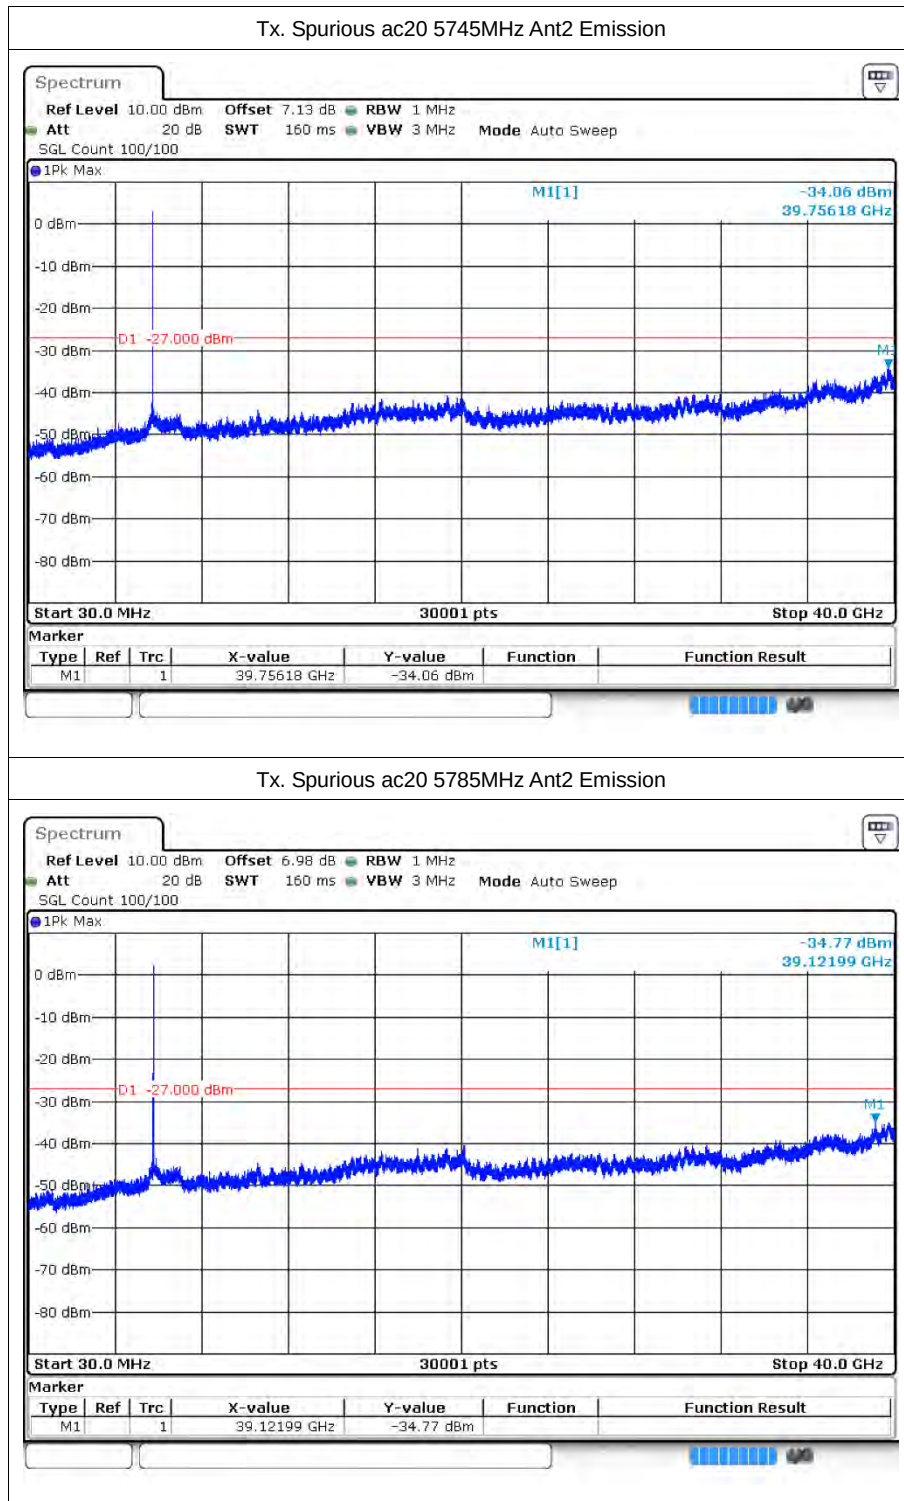

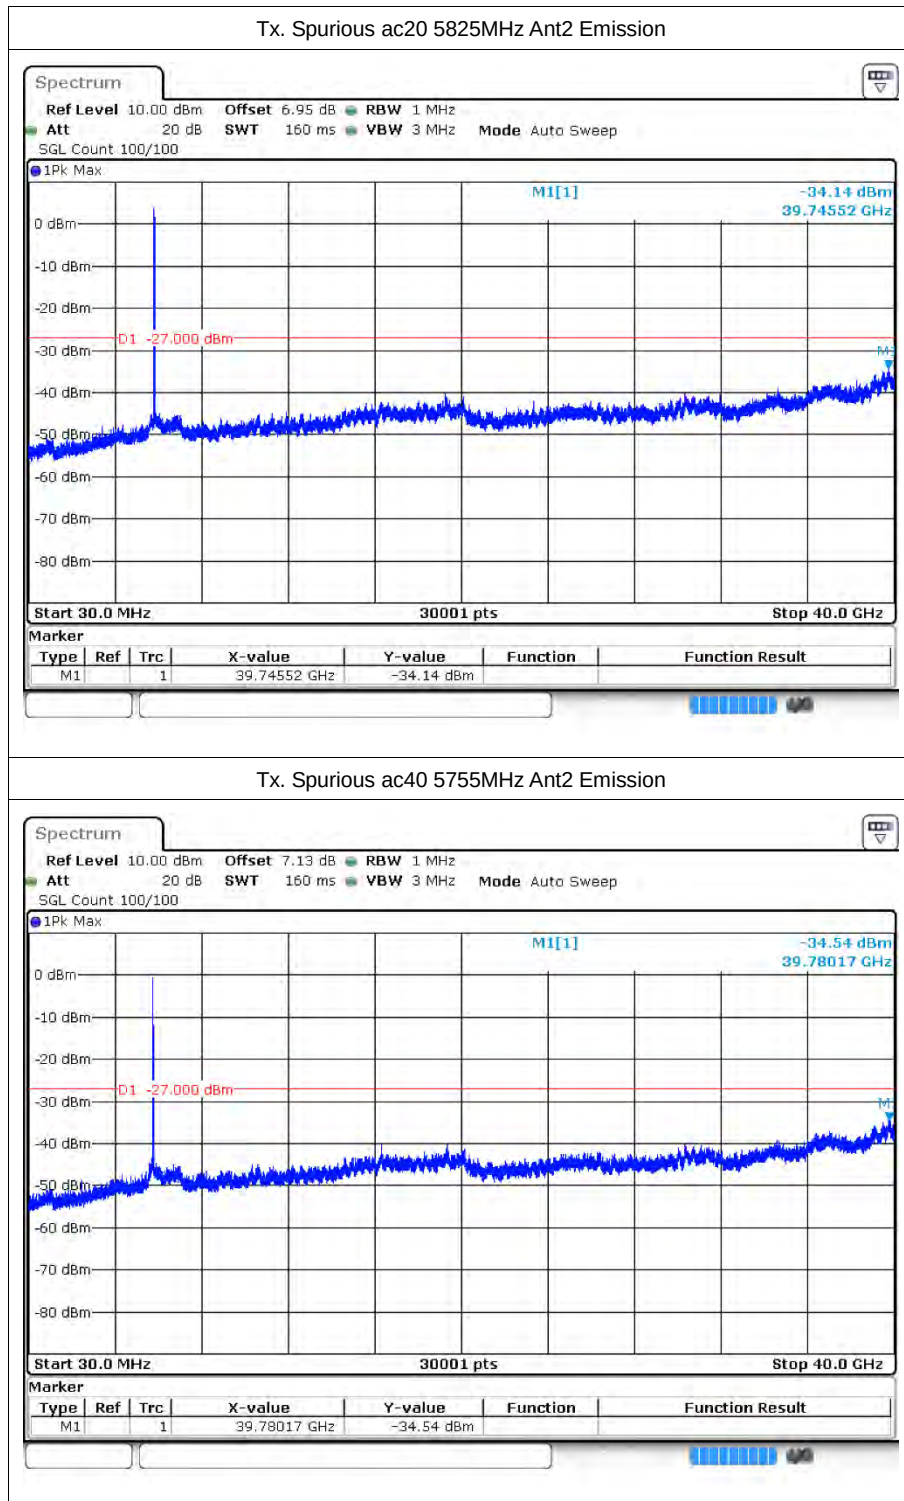

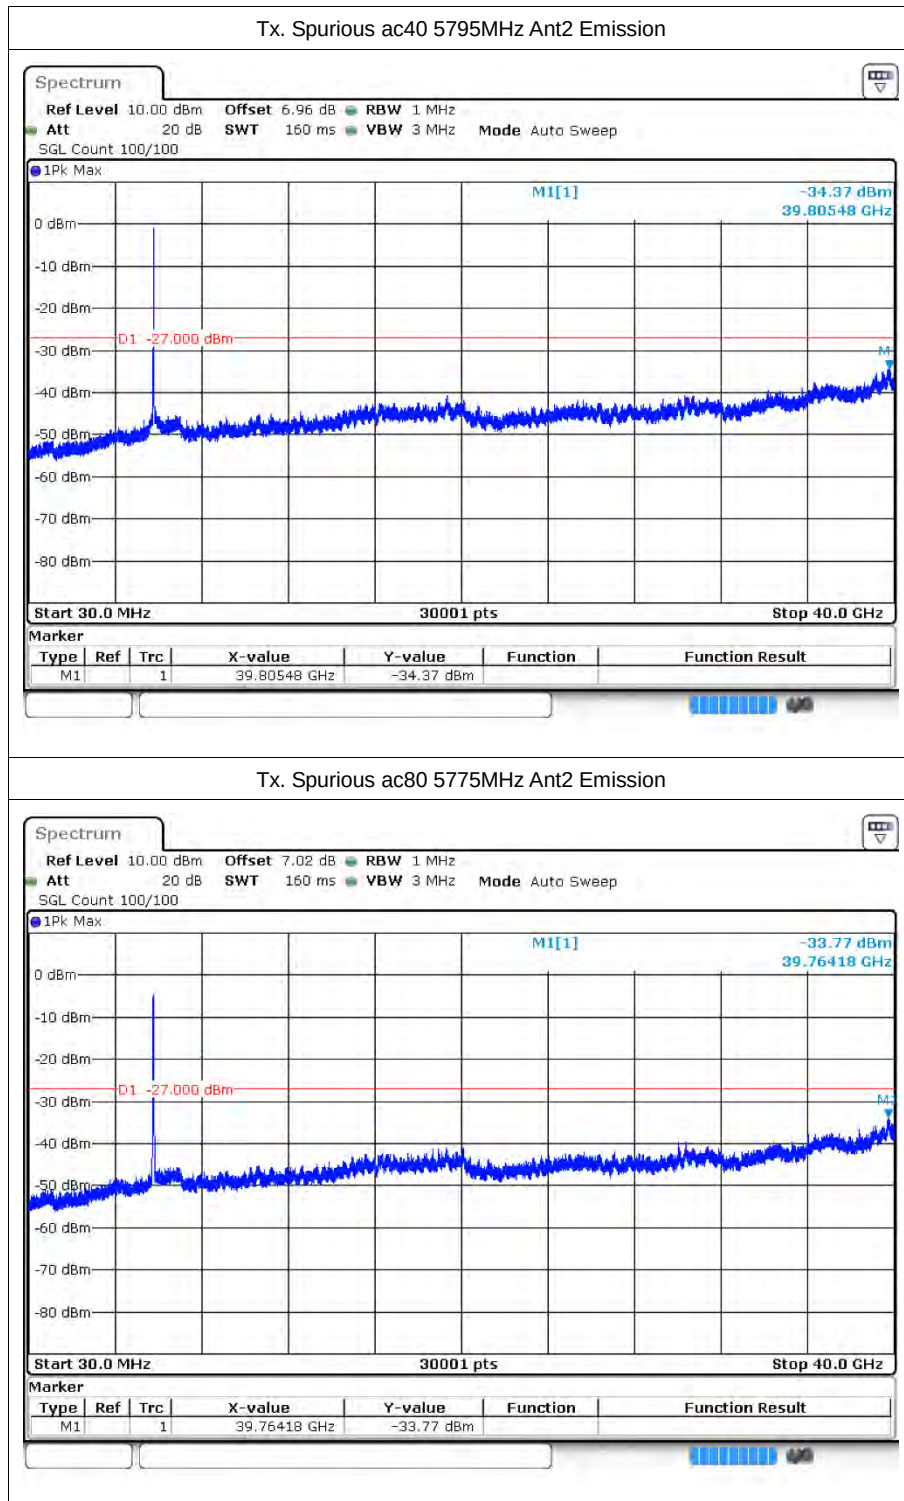



8 Restrict Band

8.1 Test Result

Mode	Frequency (MHz)	Antenna	Spur Freq (MHz)	Power (dBm)	Gain (dBi)	E (dBm)	Detector	Limit (dBm)	Verdict
a	5745	Ant1	5650	-45.63	4.5	-41.13	Peak	-27	Pass
a	5745	Ant1	5650	-53.96	4.5	-49.46	Average	-27	Pass
a	5745	Ant1	5700	-43.93	4.5	-39.43	Peak	10	Pass
a	5745	Ant1	5700	-53.09	4.5	-48.59	Average	10	Pass
a	5745	Ant1	5720	-44.87	4.5	-40.37	Peak	15.6	Pass
a	5745	Ant1	5720	-53.92	4.5	-49.42	Average	15.6	Pass
a	5745	Ant1	5725	-44.86	4.5	-40.36	Peak	27	Pass
a	5745	Ant1	5725	-53.73	4.5	-49.23	Average	27	Pass
a	5825	Ant1	5850	-45.06	4.5	-40.56	Peak	27	Pass
a	5825	Ant1	5850	-53.59	4.5	-49.09	Average	27	Pass
a	5825	Ant1	5855	-46.33	4.5	-41.83	Peak	15.6	Pass
a	5825	Ant1	5855	-52.44	4.5	-47.94	Average	15.6	Pass
a	5825	Ant1	5875	-44.67	4.5	-40.17	Peak	10	Pass
a	5825	Ant1	5875	-52.75	4.5	-48.25	Average	10	Pass
a	5825	Ant1	5925	-47.04	4.5	-42.54	Peak	-27	Pass
a	5825	Ant1	5925	-52.75	4.5	-48.25	Average	-27	Pass
n20	5745	Ant1	5650	-45.2	4.5	-40.7	Peak	-27	Pass
n20	5745	Ant1	5650	-53.88	4.5	-49.38	Average	-27	Pass
n20	5745	Ant1	5700	-47.36	4.5	-42.86	Peak	10	Pass
n20	5745	Ant1	5700	-54.14	4.5	-49.64	Average	10	Pass
n20	5745	Ant1	5720	-46.99	4.5	-42.49	Peak	15.6	Pass
n20	5745	Ant1	5720	-54.06	4.5	-49.56	Average	15.6	Pass
n20	5745	Ant1	5725	-45.26	4.5	-40.76	Peak	27	Pass
n20	5745	Ant1	5725	-54.22	4.5	-49.72	Average	27	Pass
n20	5825	Ant1	5850	-43.74	4.5	-39.24	Peak	27	Pass
n20	5825	Ant1	5850	-53.72	4.5	-49.22	Average	27	Pass
n20	5825	Ant1	5855	-45.22	4.5	-40.72	Peak	15.6	Pass
n20	5825	Ant1	5855	-53.6	4.5	-49.1	Average	15.6	Pass
n20	5825	Ant1	5875	-45.81	4.5	-41.31	Peak	10	Pass
n20	5825	Ant1	5875	-52.81	4.5	-48.31	Average	10	Pass
n20	5825	Ant1	5925	-44.03	4.5	-39.53	Peak	-27	Pass
n20	5825	Ant1	5925	-53.05	4.5	-48.55	Average	-27	Pass
n40	5755	Ant1	5650	-45.72	4.5	-41.22	Peak	-27	Pass
n40	5755	Ant1	5650	-53.92	4.5	-49.42	Average	-27	Pass



n40	5755	Ant1	5700	-46.4	4.5	-41.9	Peak	10	Pass
n40	5755	Ant1	5700	-53.83	4.5	-49.33	Average	10	Pass
n40	5755	Ant1	5720	-45.62	4.5	-41.12	Peak	15.6	Pass
n40	5755	Ant1	5720	-54.11	4.5	-49.61	Average	15.6	Pass
n40	5755	Ant1	5725	-45.83	4.5	-41.33	Peak	27	Pass
n40	5755	Ant1	5725	-53.63	4.5	-49.13	Average	27	Pass
n40	5795	Ant1	5850	-45.97	4.5	-41.47	Peak	27	Pass
n40	5795	Ant1	5850	-53.7	4.5	-49.2	Average	27	Pass
n40	5795	Ant1	5855	-46.19	4.5	-41.69	Peak	15.6	Pass
n40	5795	Ant1	5855	-53.48	4.5	-48.98	Average	15.6	Pass
n40	5795	Ant1	5875	-45.27	4.5	-40.77	Peak	10	Pass
n40	5795	Ant1	5875	-53.28	4.5	-48.78	Average	10	Pass
n40	5795	Ant1	5925	-45.36	4.5	-40.86	Peak	-27	Pass
n40	5795	Ant1	5925	-52.78	4.5	-48.28	Average	-27	Pass
ac20	5745	Ant1	5650	-45.92	4.5	-41.42	Peak	-27	Pass
ac20	5745	Ant1	5650	-54.05	4.5	-49.55	Average	-27	Pass
ac20	5745	Ant1	5700	-46.35	4.5	-41.85	Peak	10	Pass
ac20	5745	Ant1	5700	-53.69	4.5	-49.19	Average	10	Pass
ac20	5745	Ant1	5720	-45.15	4.5	-40.65	Peak	15.6	Pass
ac20	5745	Ant1	5720	-53.49	4.5	-48.99	Average	15.6	Pass
ac20	5745	Ant1	5725	-44.72	4.5	-40.22	Peak	27	Pass
ac20	5745	Ant1	5725	-53.98	4.5	-49.48	Average	27	Pass
ac20	5825	Ant1	5850	-43.89	4.5	-39.39	Peak	27	Pass
ac20	5825	Ant1	5850	-52.67	4.5	-48.17	Average	27	Pass
ac20	5825	Ant1	5855	-44.51	4.5	-40.01	Peak	15.6	Pass
ac20	5825	Ant1	5855	-53.42	4.5	-48.92	Average	15.6	Pass
ac20	5825	Ant1	5875	-45.42	4.5	-40.92	Peak	10	Pass
ac20	5825	Ant1	5875	-52.95	4.5	-48.45	Average	10	Pass
ac20	5825	Ant1	5925	-45.35	4.5	-40.85	Peak	-27	Pass
ac20	5825	Ant1	5925	-53.33	4.5	-48.83	Average	-27	Pass
ac40	5755	Ant1	5650	-46.43	4.5	-41.93	Peak	-27	Pass
ac40	5755	Ant1	5650	-53.53	4.5	-49.03	Average	-27	Pass
ac40	5755	Ant1	5700	-45.72	4.5	-41.22	Peak	10	Pass
ac40	5755	Ant1	5700	-52.85	4.5	-48.35	Average	10	Pass
ac40	5755	Ant1	5720	-45.34	4.5	-40.84	Peak	15.6	Pass
ac40	5755	Ant1	5720	-53.26	4.5	-48.76	Average	15.6	Pass
ac40	5755	Ant1	5725	-44.54	4.5	-40.04	Peak	27	Pass
ac40	5755	Ant1	5725	-53.36	4.5	-48.86	Average	27	Pass
ac40	5795	Ant1	5850	-45.65	4.5	-41.15	Peak	27	Pass
ac40	5795	Ant1	5850	-52.97	4.5	-48.47	Average	27	Pass
ac40	5795	Ant1	5855	-46.24	4.5	-41.74	Peak	15.6	Pass
ac40	5795	Ant1	5855	-52.95	4.5	-48.45	Average	15.6	Pass
ac40	5795	Ant1	5875	-45.8	4.5	-41.3	Peak	10	Pass



ac40	5795	Ant1	5875	-52.82	4.5	-48.32	Average	10	Pass
ac40	5795	Ant1	5925	-45.64	4.5	-41.14	Peak	-27	Pass
ac40	5795	Ant1	5925	-52.76	4.5	-48.26	Average	-27	Pass
ac80	5775	Ant1	5850	-45.68	4.5	-41.18	Peak	27	Pass
ac80	5775	Ant1	5850	-53.68	4.5	-49.18	Average	27	Pass
ac80	5775	Ant1	5855	-45.87	4.5	-41.37	Peak	15.6	Pass
ac80	5775	Ant1	5855	-53.43	4.5	-48.93	Average	15.6	Pass
ac80	5775	Ant1	5875	-46.04	4.5	-41.54	Peak	10	Pass
ac80	5775	Ant1	5875	-53.24	4.5	-48.74	Average	10	Pass
ac80	5775	Ant1	5925	-44.62	4.5	-40.12	Peak	-27	Pass
ac80	5775	Ant1	5925	-53.2	4.5	-48.7	Average	-27	Pass
ac80	5775	Ant1	5850	-45.68	4.5	-41.18	Peak	27	Pass
ac80	5775	Ant1	5850	-53.68	4.5	-49.18	Average	27	Pass
ac80	5775	Ant1	5855	-45.87	4.5	-41.37	Peak	15.6	Pass
ac80	5775	Ant1	5855	-53.43	4.5	-48.93	Average	15.6	Pass
ac80	5775	Ant1	5875	-46.04	4.5	-41.54	Peak	10	Pass
ac80	5775	Ant1	5875	-53.24	4.5	-48.74	Average	10	Pass
ac80	5775	Ant1	5925	-44.62	4.5	-40.12	Peak	-27	Pass
ac80	5775	Ant1	5925	-53.2	4.5	-48.7	Average	-27	Pass
a	5745	Ant2	5650	-45.49	4.5	-40.99	Peak	-27	Pass
a	5745	Ant2	5650	-53.12	4.5	-48.62	Average	-27	Pass
a	5745	Ant2	5700	-45.11	4.5	-40.61	Peak	10	Pass
a	5745	Ant2	5700	-53.06	4.5	-48.56	Average	10	Pass
a	5745	Ant2	5720	-44.54	4.5	-40.04	Peak	15.6	Pass
a	5745	Ant2	5720	-53.87	4.5	-49.37	Average	15.6	Pass
a	5745	Ant2	5725	-45.84	4.5	-41.34	Peak	27	Pass
a	5745	Ant2	5725	-53.26	4.5	-48.76	Average	27	Pass
a	5825	Ant2	5850	-44.31	4.5	-39.81	Peak	27	Pass
a	5825	Ant2	5850	-52.66	4.5	-48.16	Average	27	Pass
a	5825	Ant2	5855	-43.78	4.5	-39.28	Peak	15.6	Pass
a	5825	Ant2	5855	-51.95	4.5	-47.45	Average	15.6	Pass
a	5825	Ant2	5875	-42.13	4.5	-37.63	Peak	10	Pass
a	5825	Ant2	5875	-53	4.5	-48.5	Average	10	Pass
a	5825	Ant2	5925	-46.39	4.5	-41.89	Peak	-27	Pass
a	5825	Ant2	5925	-52.63	4.5	-48.13	Average	-27	Pass
n20	5745	Ant2	5650	-46.57	4.5	-42.07	Peak	-27	Pass
n20	5745	Ant2	5650	-53.77	4.5	-49.27	Average	-27	Pass
n20	5745	Ant2	5700	-46.09	4.5	-41.59	Peak	10	Pass
n20	5745	Ant2	5700	-53.73	4.5	-49.23	Average	10	Pass
n20	5745	Ant2	5720	-46.15	4.5	-41.65	Peak	15.6	Pass
n20	5745	Ant2	5720	-53.47	4.5	-48.97	Average	15.6	Pass
n20	5745	Ant2	5725	-46.08	4.5	-41.58	Peak	27	Pass
n20	5745	Ant2	5725	-53.64	4.5	-49.14	Average	27	Pass



n20	5825	Ant2	5850	-45.92	4.5	-41.42	Peak	27	Pass
n20	5825	Ant2	5850	-53.19	4.5	-48.69	Average	27	Pass
n20	5825	Ant2	5855	-43.66	4.5	-39.16	Peak	15.6	Pass
n20	5825	Ant2	5855	-53.23	4.5	-48.73	Average	15.6	Pass
n20	5825	Ant2	5875	-46.4	4.5	-41.9	Peak	10	Pass
n20	5825	Ant2	5875	-52.79	4.5	-48.29	Average	10	Pass
n20	5825	Ant2	5925	-44.19	4.5	-39.69	Peak	-27	Pass
n20	5825	Ant2	5925	-52.99	4.5	-48.49	Average	-27	Pass
n40	5755	Ant2	5650	-45.97	4.5	-41.47	Peak	-27	Pass
n40	5755	Ant2	5650	-53.39	4.5	-48.89	Average	-27	Pass
n40	5755	Ant2	5700	-45.75	4.5	-41.25	Peak	10	Pass
n40	5755	Ant2	5700	-53.73	4.5	-49.23	Average	10	Pass
n40	5755	Ant2	5720	-44.52	4.5	-40.02	Peak	15.6	Pass
n40	5755	Ant2	5720	-53.8	4.5	-49.3	Average	15.6	Pass
n40	5755	Ant2	5725	-45.89	4.5	-41.39	Peak	27	Pass
n40	5755	Ant2	5725	-53.31	4.5	-48.81	Average	27	Pass
n40	5795	Ant2	5850	-46.59	4.5	-42.09	Peak	27	Pass
n40	5795	Ant2	5850	-53.57	4.5	-49.07	Average	27	Pass
n40	5795	Ant2	5855	-44.57	4.5	-40.07	Peak	15.6	Pass
n40	5795	Ant2	5855	-52.93	4.5	-48.43	Average	15.6	Pass
n40	5795	Ant2	5875	-43.67	4.5	-39.17	Peak	10	Pass
n40	5795	Ant2	5875	-52.93	4.5	-48.43	Average	10	Pass
n40	5795	Ant2	5925	-45.24	4.5	-40.74	Peak	-27	Pass
n40	5795	Ant2	5925	-53.13	4.5	-48.63	Average	-27	Pass
ac20	5745	Ant2	5650	-46.14	4.5	-41.64	Peak	-27	Pass
ac20	5745	Ant2	5650	-53.34	4.5	-48.84	Average	-27	Pass
ac20	5745	Ant2	5700	-44.33	4.5	-39.83	Peak	10	Pass
ac20	5745	Ant2	5700	-52.95	4.5	-48.45	Average	10	Pass
ac20	5745	Ant2	5720	-45.94	4.5	-41.44	Peak	15.6	Pass
ac20	5745	Ant2	5720	-53.65	4.5	-49.15	Average	15.6	Pass
ac20	5745	Ant2	5725	-46.45	4.5	-41.95	Peak	27	Pass
ac20	5745	Ant2	5725	-53.37	4.5	-48.87	Average	27	Pass
ac20	5825	Ant2	5850	-45.36	4.5	-40.86	Peak	27	Pass
ac20	5825	Ant2	5850	-53.02	4.5	-48.52	Average	27	Pass
ac20	5825	Ant2	5855	-43.48	4.5	-38.98	Peak	15.6	Pass
ac20	5825	Ant2	5855	-52.47	4.5	-47.97	Average	15.6	Pass
ac20	5825	Ant2	5875	-43.71	4.5	-39.21	Peak	10	Pass
ac20	5825	Ant2	5875	-52.78	4.5	-48.28	Average	10	Pass
ac20	5825	Ant2	5925	-45.58	4.5	-41.08	Peak	-27	Pass
ac20	5825	Ant2	5925	-52.7	4.5	-48.2	Average	-27	Pass
ac40	5755	Ant2	5650	-45.33	4.5	-40.83	Peak	-27	Pass
ac40	5755	Ant2	5650	-53.07	4.5	-48.57	Average	-27	Pass
ac40	5755	Ant2	5700	-44.65	4.5	-40.15	Peak	10	Pass



ac40	5755	Ant2	5700	-53.01	4.5	-48.51	Average	10	Pass
ac40	5755	Ant2	5720	-45	4.5	-40.5	Peak	15.6	Pass
ac40	5755	Ant2	5720	-53.46	4.5	-48.96	Average	15.6	Pass
ac40	5755	Ant2	5725	-45.14	4.5	-40.64	Peak	27	Pass
ac40	5755	Ant2	5725	-53.06	4.5	-48.56	Average	27	Pass
ac40	5795	Ant2	5850	-45.45	4.5	-40.95	Peak	27	Pass
ac40	5795	Ant2	5850	-53.09	4.5	-48.59	Average	27	Pass
ac40	5795	Ant2	5855	-44.09	4.5	-39.59	Peak	15.6	Pass
ac40	5795	Ant2	5855	-52.93	4.5	-48.43	Average	15.6	Pass
ac40	5795	Ant2	5875	-45.74	4.5	-41.24	Peak	10	Pass
ac40	5795	Ant2	5875	-52.66	4.5	-48.16	Average	10	Pass
ac40	5795	Ant2	5925	-44.67	4.5	-40.17	Peak	-27	Pass
ac40	5795	Ant2	5925	-52.24	4.5	-47.74	Average	-27	Pass
ac80	5775	Ant2	5850	-44.51	4.5	-40.01	Peak	27	Pass
ac80	5775	Ant2	5850	-53.42	4.5	-48.92	Average	27	Pass
ac80	5775	Ant2	5855	-45.1	4.5	-40.6	Peak	15.6	Pass
ac80	5775	Ant2	5855	-52.57	4.5	-48.07	Average	15.6	Pass
ac80	5775	Ant2	5875	-45.76	4.5	-41.26	Peak	10	Pass
ac80	5775	Ant2	5875	-52.98	4.5	-48.48	Average	10	Pass
ac80	5775	Ant2	5925	-43.69	4.5	-39.19	Peak	-27	Pass
ac80	5775	Ant2	5925	-53.11	4.5	-48.61	Average	-27	Pass
ac80	5775	Ant2	5850	-44.51	4.5	-40.01	Peak	27	Pass
ac80	5775	Ant2	5850	-53.42	4.5	-48.92	Average	27	Pass
ac80	5775	Ant2	5855	-45.1	4.5	-40.6	Peak	15.6	Pass
ac80	5775	Ant2	5855	-52.57	4.5	-48.07	Average	15.6	Pass
ac80	5775	Ant2	5875	-45.76	4.5	-41.26	Peak	10	Pass
ac80	5775	Ant2	5875	-52.98	4.5	-48.48	Average	10	Pass
ac80	5775	Ant2	5925	-43.69	4.5	-39.19	Peak	-27	Pass
ac80	5775	Ant2	5925	-53.11	4.5	-48.61	Average	-27	Pass



Mode	Frequency (MHz)	Antenna	Spur Freq (MHz)	Power (dBm)	Gain (dBi)	E (dBm)	Detector	Limit (dBm)	Verdict
n20	5745	Ant1&2	5650	-46.57	7.51	-35.31	Peak	-27	Pass
n20	5745	Ant1&2	5650	-53.77	7.51	-43.30	Average	-27	Pass
n20	5745	Ant1&2	5700	-46.09	7.51	-36.16	Peak	10	Pass
n20	5745	Ant1&2	5700	-53.73	7.51	-43.41	Average	10	Pass
n20	5745	Ant1&2	5720	-46.15	7.51	-36.03	Peak	15.6	Pass
n20	5745	Ant1&2	5720	-53.47	7.51	-43.23	Average	15.6	Pass
n20	5745	Ant1&2	5725	-46.08	7.51	-35.13	Peak	27	Pass
n20	5745	Ant1&2	5725	-53.64	7.51	-43.40	Average	27	Pass
n20	5825	Ant1&2	5850	-45.92	7.51	-34.17	Peak	27	Pass
n20	5825	Ant1&2	5850	-53.19	7.51	-42.93	Average	27	Pass
n20	5825	Ant1&2	5855	-43.66	7.51	-33.85	Peak	15.6	Pass
n20	5825	Ant1&2	5855	-53.23	7.51	-42.89	Average	15.6	Pass
n20	5825	Ant1&2	5875	-46.4	7.51	-35.57	Peak	10	Pass
n20	5825	Ant1&2	5875	-52.79	7.51	-42.28	Average	10	Pass
n20	5825	Ant1&2	5925	-44.19	7.51	-33.59	Peak	-27	Pass
n20	5825	Ant1&2	5925	-52.99	7.51	-42.50	Average	-27	Pass
n40	5755	Ant1&2	5650	-45.97	7.51	-35.32	Peak	-27	Pass
n40	5755	Ant1&2	5650	-53.39	7.51	-43.13	Average	-27	Pass
n40	5755	Ant1&2	5700	-45.75	7.51	-35.54	Peak	10	Pass
n40	5755	Ant1&2	5700	-53.73	7.51	-43.26	Average	10	Pass
n40	5755	Ant1&2	5720	-44.52	7.51	-34.51	Peak	15.6	Pass
n40	5755	Ant1&2	5720	-53.8	7.51	-43.43	Average	15.6	Pass
n40	5755	Ant1&2	5725	-45.89	7.51	-35.34	Peak	27	Pass
n40	5755	Ant1&2	5725	-53.31	7.51	-42.95	Average	27	Pass
n40	5795	Ant1&2	5850	-46.59	7.51	-35.75	Peak	27	Pass
n40	5795	Ant1&2	5850	-53.57	7.51	-43.11	Average	27	Pass
n40	5795	Ant1&2	5855	-44.57	7.51	-34.78	Peak	15.6	Pass
n40	5795	Ant1&2	5855	-52.93	7.51	-42.68	Average	15.6	Pass
n40	5795	Ant1&2	5875	-43.67	7.51	-33.88	Peak	10	Pass
n40	5795	Ant1&2	5875	-52.93	7.51	-42.58	Average	10	Pass
n40	5795	Ant1&2	5925	-45.24	7.51	-34.78	Peak	-27	Pass
n40	5795	Ant1&2	5925	-53.13	7.51	-42.43	Average	-27	Pass
ac20	5745	Ant1&2	5650	-46.14	7.51	-35.51	Peak	-27	Pass
ac20	5745	Ant1&2	5650	-53.34	7.51	-43.16	Average	-27	Pass
ac20	5745	Ant1&2	5700	-44.33	7.51	-34.70	Peak	10	Pass
ac20	5745	Ant1&2	5700	-52.95	7.51	-42.78	Average	10	Pass
ac20	5745	Ant1&2	5720	-45.94	7.51	-35.01	Peak	15.6	Pass
ac20	5745	Ant1&2	5720	-53.65	7.51	-43.05	Average	15.6	Pass
ac20	5745	Ant1&2	5725	-46.45	7.51	-34.98	Peak	27	Pass
ac20	5745	Ant1&2	5725	-53.37	7.51	-43.14	Average	27	Pass



ac20	5825	Ant1&2	5850	-45.36	7.51	-34.04	Peak	27	Pass
ac20	5825	Ant1&2	5850	-53.02	7.51	-42.32	Average	27	Pass
ac20	5825	Ant1&2	5855	-43.48	7.51	-33.44	Peak	15.6	Pass
ac20	5825	Ant1&2	5855	-52.47	7.51	-42.40	Average	15.6	Pass
ac20	5825	Ant1&2	5875	-43.71	7.51	-33.96	Peak	10	Pass
ac20	5825	Ant1&2	5875	-52.78	7.51	-42.34	Average	10	Pass
ac20	5825	Ant1&2	5925	-45.58	7.51	-34.94	Peak	-27	Pass
ac20	5825	Ant1&2	5925	-52.7	7.51	-42.48	Average	-27	Pass
ac40	5755	Ant1&2	5650	-45.33	7.51	-35.32	Peak	-27	Pass
ac40	5755	Ant1&2	5650	-53.07	7.51	-42.77	Average	-27	Pass
ac40	5755	Ant1&2	5700	-44.65	7.51	-34.63	Peak	10	Pass
ac40	5755	Ant1&2	5700	-53.01	7.51	-42.41	Average	10	Pass
ac40	5755	Ant1&2	5720	-45	7.51	-34.65	Peak	15.6	Pass
ac40	5755	Ant1&2	5720	-53.46	7.51	-42.84	Average	15.6	Pass
ac40	5755	Ant1&2	5725	-45.14	7.51	-34.31	Peak	27	Pass
ac40	5755	Ant1&2	5725	-53.06	7.51	-42.69	Average	27	Pass
ac40	5795	Ant1&2	5850	-45.45	7.51	-35.03	Peak	27	Pass
ac40	5795	Ant1&2	5850	-53.09	7.51	-42.51	Average	27	Pass
ac40	5795	Ant1&2	5855	-44.09	7.51	-34.51	Peak	15.6	Pass
ac40	5795	Ant1&2	5855	-52.93	7.51	-42.42	Average	15.6	Pass
ac40	5795	Ant1&2	5875	-45.74	7.51	-35.25	Peak	10	Pass
ac40	5795	Ant1&2	5875	-52.66	7.51	-42.22	Average	10	Pass
ac40	5795	Ant1&2	5925	-44.67	7.51	-34.61	Peak	-27	Pass
ac40	5795	Ant1&2	5925	-52.24	7.51	-41.97	Average	-27	Pass
ac80	5775	Ant1&2	5850	-44.51	7.51	-34.54	Peak	27	Pass
ac80	5775	Ant1&2	5850	-53.42	7.51	-43.03	Average	27	Pass
ac80	5775	Ant1&2	5855	-45.1	7.51	-34.95	Peak	15.6	Pass
ac80	5775	Ant1&2	5855	-52.57	7.51	-42.46	Average	15.6	Pass
ac80	5775	Ant1&2	5875	-45.76	7.51	-35.38	Peak	10	Pass
ac80	5775	Ant1&2	5875	-52.98	7.51	-42.59	Average	10	Pass
ac80	5775	Ant1&2	5925	-43.69	7.51	-33.61	Peak	-27	Pass
ac80	5775	Ant1&2	5925	-53.11	7.51	-42.63	Average	-27	Pass
ac80	5775	Ant1&2	5850	-44.51	7.51	-34.54	Peak	27	Pass
ac80	5775	Ant1&2	5850	-53.42	7.51	-43.03	Average	27	Pass
ac80	5775	Ant1&2	5855	-45.1	7.51	-34.95	Peak	15.6	Pass
ac80	5775	Ant1&2	5855	-52.57	7.51	-42.46	Average	15.6	Pass
ac80	5775	Ant1&2	5875	-45.76	7.51	-35.38	Peak	10	Pass
ac80	5775	Ant1&2	5875	-52.98	7.51	-42.59	Average	10	Pass
ac80	5775	Ant1&2	5925	-43.69	7.51	-33.61	Peak	-27	Pass
ac80	5775	Ant1&2	5925	-53.11	7.51	-42.63	Average	-27	Pass

8.2 Test Graphs

