

Band2	5MHz	16QAM	18900	1RB#0	3000~20000	-31.02	PASS
Band2	5MHz	QPSK	19175	1RB#0	0.009~0.15	-58.48	PASS
Band2	5MHz	QPSK	19175	1RB#0	0.15~30	-58.92	PASS
Band2	5MHz	QPSK	19175	1RB#0	30~1000	-66.30	PASS
Band2	5MHz	QPSK	19175	1RB#0	1000~3000	-52.24	PASS
Band2	5MHz	QPSK	19175	1RB#0	3000~20000	-34.97	PASS
Band2	5MHz	16QAM	19175	1RB#0	0.009~0.15	-57.96	PASS
Band2	5MHz	16QAM	19175	1RB#0	0.15~30	-58.13	PASS
Band2	5MHz	16QAM	19175	1RB#0	30~1000	-66.55	PASS
Band2	5MHz	16QAM	19175	1RB#0	1000~3000	-52.22	PASS
Band2	5MHz	16QAM	19175	1RB#0	3000~20000	-35.05	PASS
Band2	10MHz	QPSK	18650	1RB#0	0.009~0.15	-58.37	PASS
Band2	10MHz	QPSK	18650	1RB#0	0.15~30	-59.44	PASS
Band2	10MHz	QPSK	18650	1RB#0	30~1000	-66.24	PASS
Band2	10MHz	QPSK	18650	1RB#0	1000~3000	-52.37	PASS
Band2	10MHz	QPSK	18650	1RB#0	3000~20000	-32.71	PASS
Band2	10MHz	16QAM	18650	1RB#0	0.009~0.15	-56.33	PASS
Band2	10MHz	16QAM	18650	1RB#0	0.15~30	-59.54	PASS
Band2	10MHz	16QAM	18650	1RB#0	30~1000	-66.66	PASS
Band2	10MHz	16QAM	18650	1RB#0	1000~3000	-52.52	PASS
Band2	10MHz	16QAM	18650	1RB#0	3000~20000	-32.83	PASS
Band2	10MHz	QPSK	18900	1RB#0	0.009~0.15	-65.02	PASS
Band2	10MHz	QPSK	18900	1RB#0	0.15~30	-61.45	PASS
Band2	10MHz	QPSK	18900	1RB#0	30~1000	-66.47	PASS
Band2	10MHz	QPSK	18900	1RB#0	1000~3000	-52.71	PASS
Band2	10MHz	QPSK	18900	1RB#0	3000~20000	-33.13	PASS
Band2	10MHz	16QAM	18900	1RB#0	0.009~0.15	-65.43	PASS
Band2	10MHz	16QAM	18900	1RB#0	0.15~30	-62.63	PASS
Band2	10MHz	16QAM	18900	1RB#0	30~1000	-66.60	PASS
Band2	10MHz	16QAM	18900	1RB#0	1000~3000	-52.38	PASS
Band2	10MHz	16QAM	18900	1RB#0	3000~20000	-32.73	PASS
Band2	10MHz	QPSK	19150	1RB#0	0.009~0.15	-63.13	PASS
Band2	10MHz	QPSK	19150	1RB#0	0.15~30	-62.97	PASS
Band2	10MHz	QPSK	19150	1RB#0	30~1000	-66.89	PASS
Band2	10MHz	QPSK	19150	1RB#0	1000~3000	-52.28	PASS
Band2	10MHz	QPSK	19150	1RB#0	3000~20000	-30.94	PASS
Band2	10MHz	16QAM	19150	1RB#0	0.009~0.15	-55.99	PASS
Band2	10MHz	16QAM	19150	1RB#0	0.15~30	-60.81	PASS
Band2	10MHz	16QAM	19150	1RB#0	30~1000	-66.64	PASS
Band2	10MHz	16QAM	19150	1RB#0	1000~3000	-52.78	PASS
Band2	10MHz	16QAM	19150	1RB#0	3000~20000	-30.48	PASS
Band2	15MHz	QPSK	18675	1RB#0	0.009~0.15	-66.65	PASS

Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community,
 Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.
 Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com



Hotline
 400-003-0500
 www.anbotek.com.cn



Band2	15MHz	QPSK	18675	1RB#0	0.15~30	-60.28	PASS
Band2	15MHz	QPSK	18675	1RB#0	30~1000	-66.51	PASS
Band2	15MHz	QPSK	18675	1RB#0	1000~3000	-52.75	PASS
Band2	15MHz	QPSK	18675	1RB#0	3000~20000	-34.04	PASS
Band2	15MHz	16QAM	18675	1RB#0	0.009~0.15	-55.51	PASS
Band2	15MHz	16QAM	18675	1RB#0	0.15~30	-60.03	PASS
Band2	15MHz	16QAM	18675	1RB#0	30~1000	-66.75	PASS
Band2	15MHz	16QAM	18675	1RB#0	1000~3000	-52.64	PASS
Band2	15MHz	16QAM	18675	1RB#0	3000~20000	-36.16	PASS
Band2	15MHz	QPSK	18900	1RB#0	0.009~0.15	-56.44	PASS
Band2	15MHz	QPSK	18900	1RB#0	0.15~30	-57.27	PASS
Band2	15MHz	QPSK	18900	1RB#0	30~1000	-66.62	PASS
Band2	15MHz	QPSK	18900	1RB#0	1000~3000	-52.81	PASS
Band2	15MHz	QPSK	18900	1RB#0	3000~20000	-33.38	PASS
Band2	15MHz	16QAM	18900	1RB#0	0.009~0.15	-57.73	PASS
Band2	15MHz	16QAM	18900	1RB#0	0.15~30	-58.56	PASS
Band2	15MHz	16QAM	18900	1RB#0	30~1000	-66.54	PASS
Band2	15MHz	16QAM	18900	1RB#0	1000~3000	-52.28	PASS
Band2	15MHz	16QAM	18900	1RB#0	3000~20000	-33.84	PASS
Band2	15MHz	QPSK	19125	1RB#0	0.009~0.15	-60.03	PASS
Band2	15MHz	QPSK	19125	1RB#0	0.15~30	-60.78	PASS
Band2	15MHz	QPSK	19125	1RB#0	30~1000	-66.44	PASS
Band2	15MHz	QPSK	19125	1RB#0	1000~3000	-52.88	PASS
Band2	15MHz	QPSK	19125	1RB#0	3000~20000	-31.56	PASS
Band2	15MHz	16QAM	19125	1RB#0	0.009~0.15	-57.86	PASS
Band2	15MHz	16QAM	19125	1RB#0	0.15~30	-57.96	PASS
Band2	15MHz	16QAM	19125	1RB#0	30~1000	-66.49	PASS
Band2	15MHz	16QAM	19125	1RB#0	1000~3000	-52.50	PASS
Band2	15MHz	16QAM	19125	1RB#0	3000~20000	-30.88	PASS
Band2	20MHz	QPSK	18700	1RB#0	0.009~0.15	-57.18	PASS
Band2	20MHz	QPSK	18700	1RB#0	0.15~30	-55.04	PASS
Band2	20MHz	QPSK	18700	1RB#0	30~1000	-66.42	PASS
Band2	20MHz	QPSK	18700	1RB#0	1000~3000	-52.38	PASS
Band2	20MHz	QPSK	18700	1RB#0	3000~20000	-34.46	PASS
Band2	20MHz	16QAM	18700	1RB#0	0.009~0.15	-57.47	PASS
Band2	20MHz	16QAM	18700	1RB#0	0.15~30	-57.19	PASS
Band2	20MHz	16QAM	18700	1RB#0	30~1000	-66.59	PASS
Band2	20MHz	16QAM	18700	1RB#0	1000~3000	-52.52	PASS
Band2	20MHz	16QAM	18700	1RB#0	3000~20000	-35.16	PASS
Band2	20MHz	QPSK	18900	1RB#0	0.009~0.15	-58.60	PASS
Band2	20MHz	QPSK	18900	1RB#0	0.15~30	-58.11	PASS
Band2	20MHz	QPSK	18900	1RB#0	30~1000	-66.62	PASS

Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community,
 Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.
 Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com





Hotline
 400-003-0500
 www.anbotek.com.cn



Band2	20MHz	QPSK	18900	1RB#0	1000~3000	-52.95	PASS
Band2	20MHz	QPSK	18900	1RB#0	3000~20000	-31.84	PASS
Band2	20MHz	16QAM	18900	1RB#0	0.009~0.15	-58.04	PASS
Band2	20MHz	16QAM	18900	1RB#0	0.15~30	-56.86	PASS
Band2	20MHz	16QAM	18900	1RB#0	30~1000	-66.65	PASS
Band2	20MHz	16QAM	18900	1RB#0	1000~3000	-52.73	PASS
Band2	20MHz	16QAM	18900	1RB#0	3000~20000	-34.63	PASS
Band2	20MHz	QPSK	19100	1RB#0	0.009~0.15	-61.39	PASS
Band2	20MHz	QPSK	19100	1RB#0	0.15~30	-58.40	PASS
Band2	20MHz	QPSK	19100	1RB#0	30~1000	-66.50	PASS
Band2	20MHz	QPSK	19100	1RB#0	1000~3000	-52.57	PASS
Band2	20MHz	QPSK	19100	1RB#0	3000~20000	-33.75	PASS
Band2	20MHz	16QAM	19100	1RB#0	0.009~0.15	-56.68	PASS
Band2	20MHz	16QAM	19100	1RB#0	0.15~30	-57.94	PASS
Band2	20MHz	16QAM	19100	1RB#0	30~1000	-66.64	PASS
Band2	20MHz	16QAM	19100	1RB#0	1000~3000	-52.39	PASS
Band2	20MHz	16QAM	19100	1RB#0	3000~20000	-33.05	PASS

Test Graphs

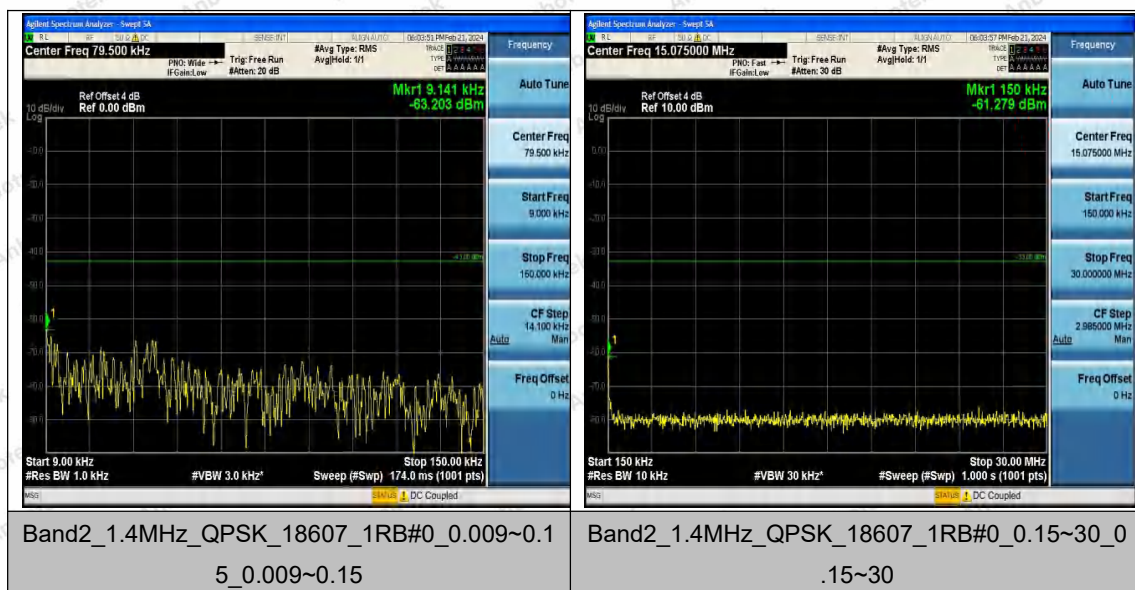

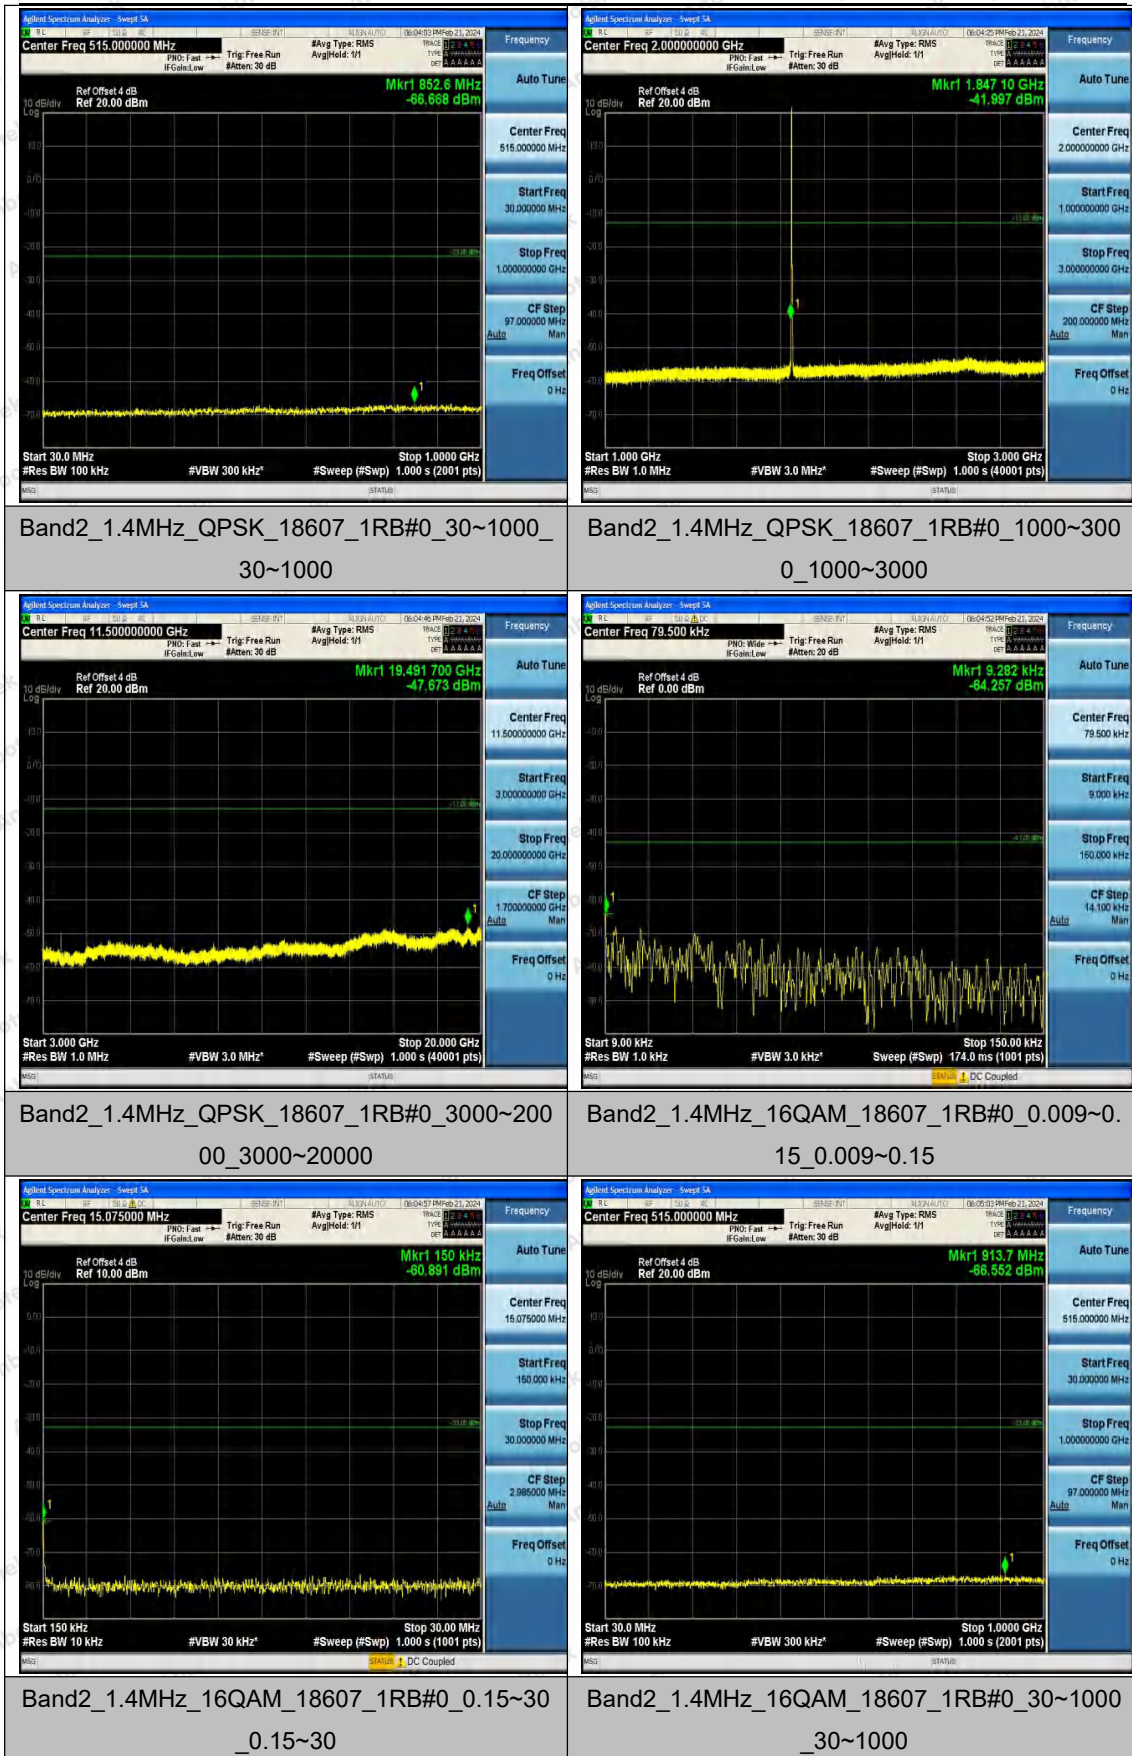


Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.
 Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com



Hotline
 400-003-0500
 www.anbotek.com.cn



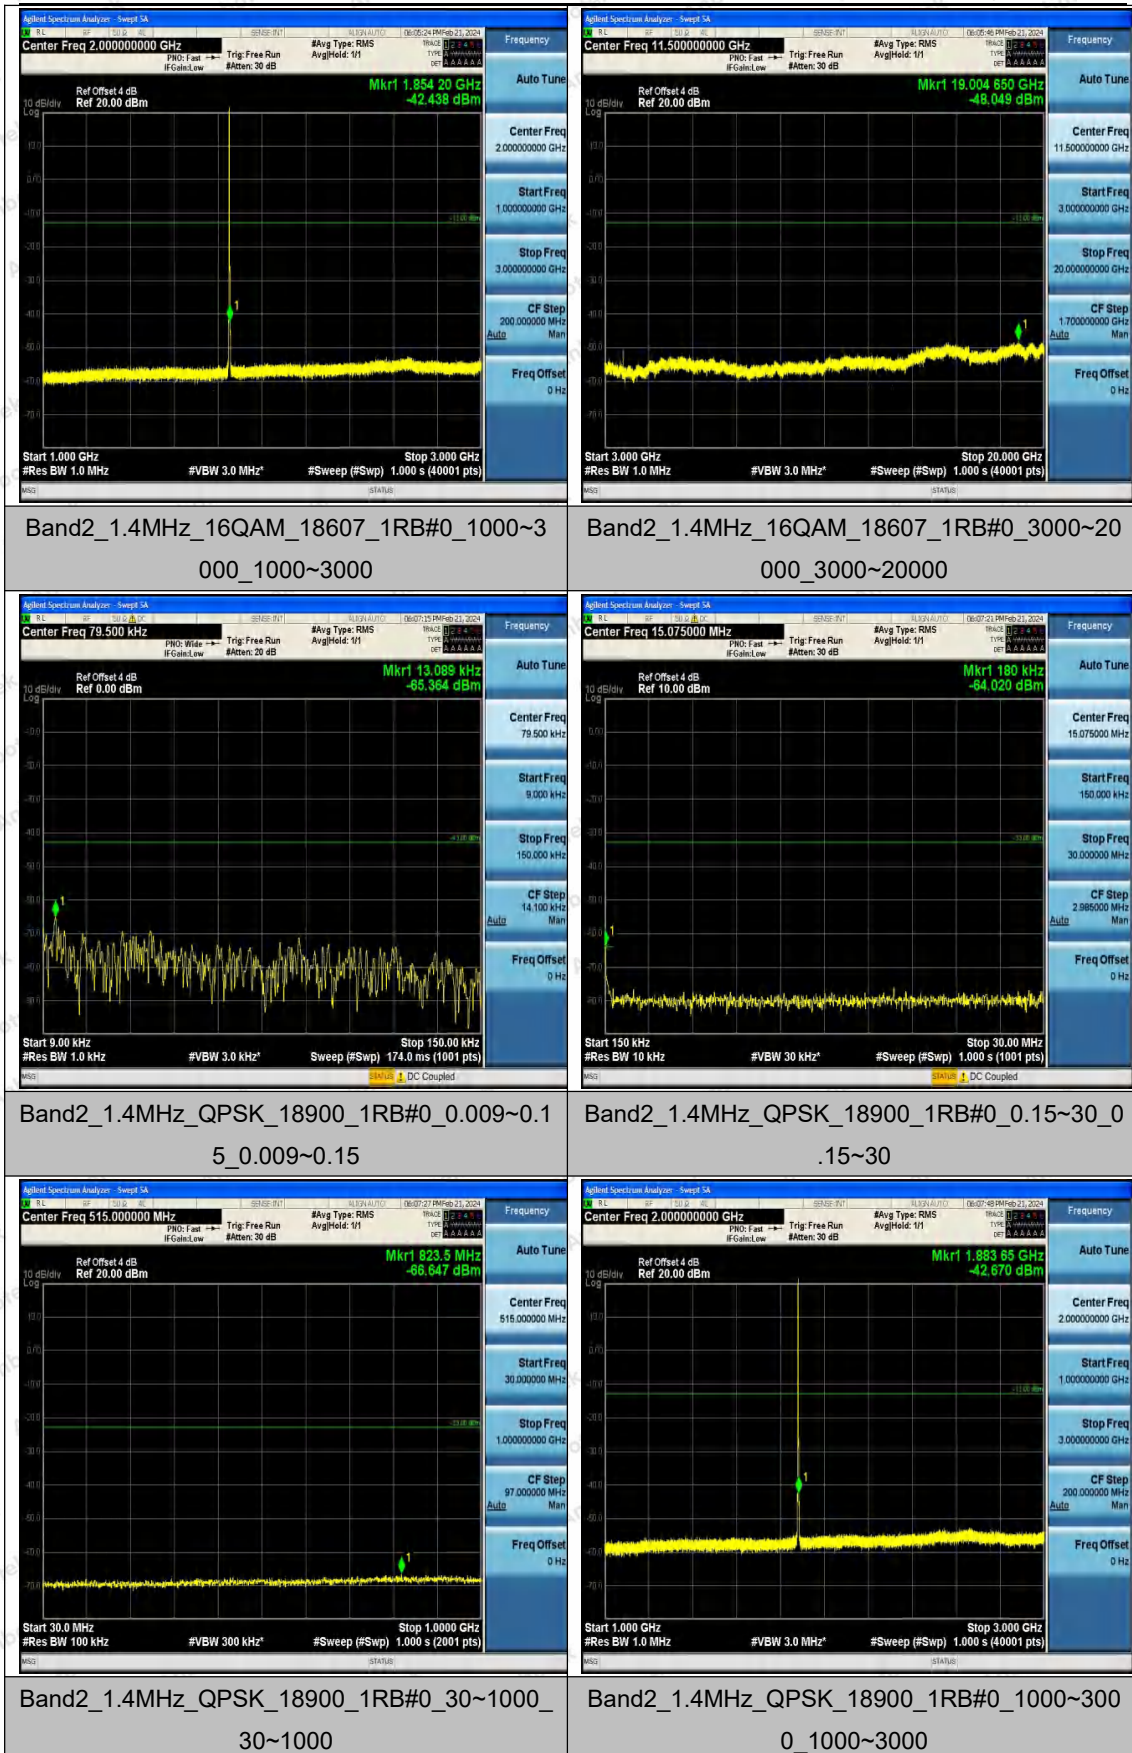


Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.
 Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com



Hotline
 400-003-0500
 www.anbotek.com.cn



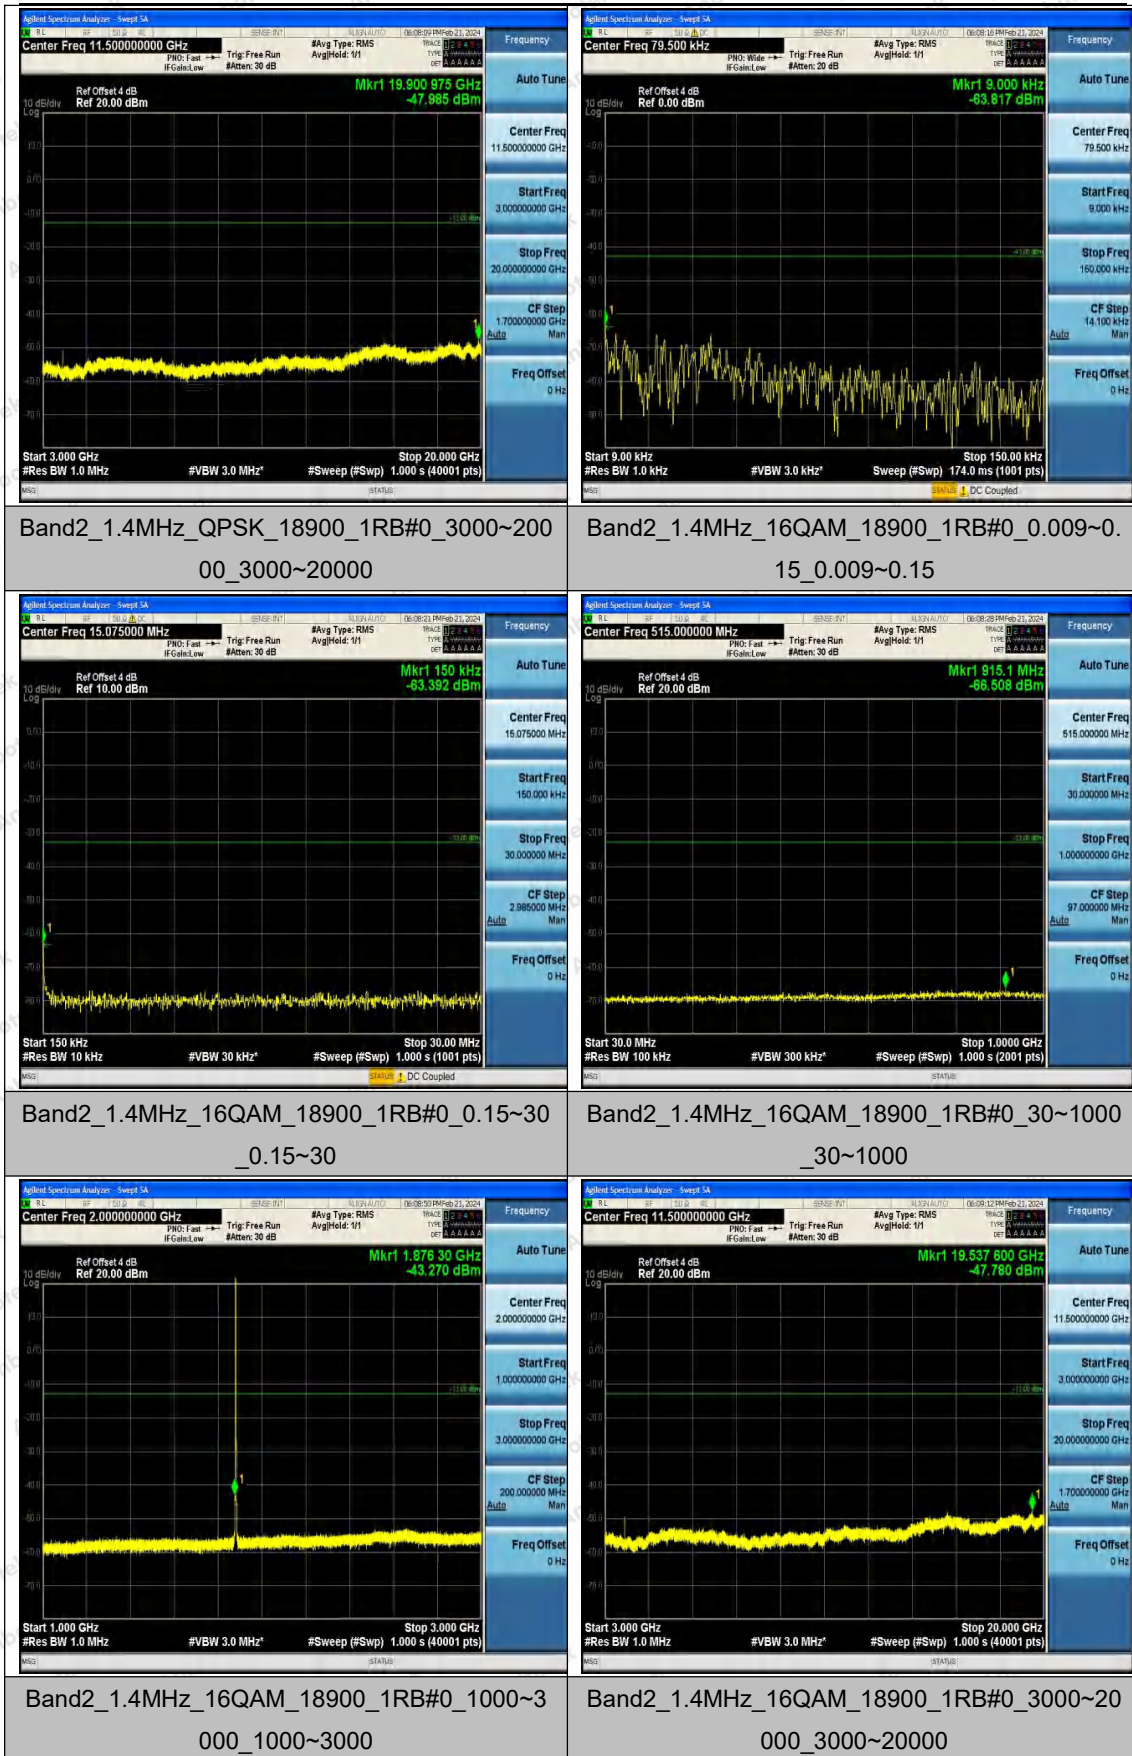


Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.
 Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com



Hotline
 400-003-0500
 www.anbotek.com.cn



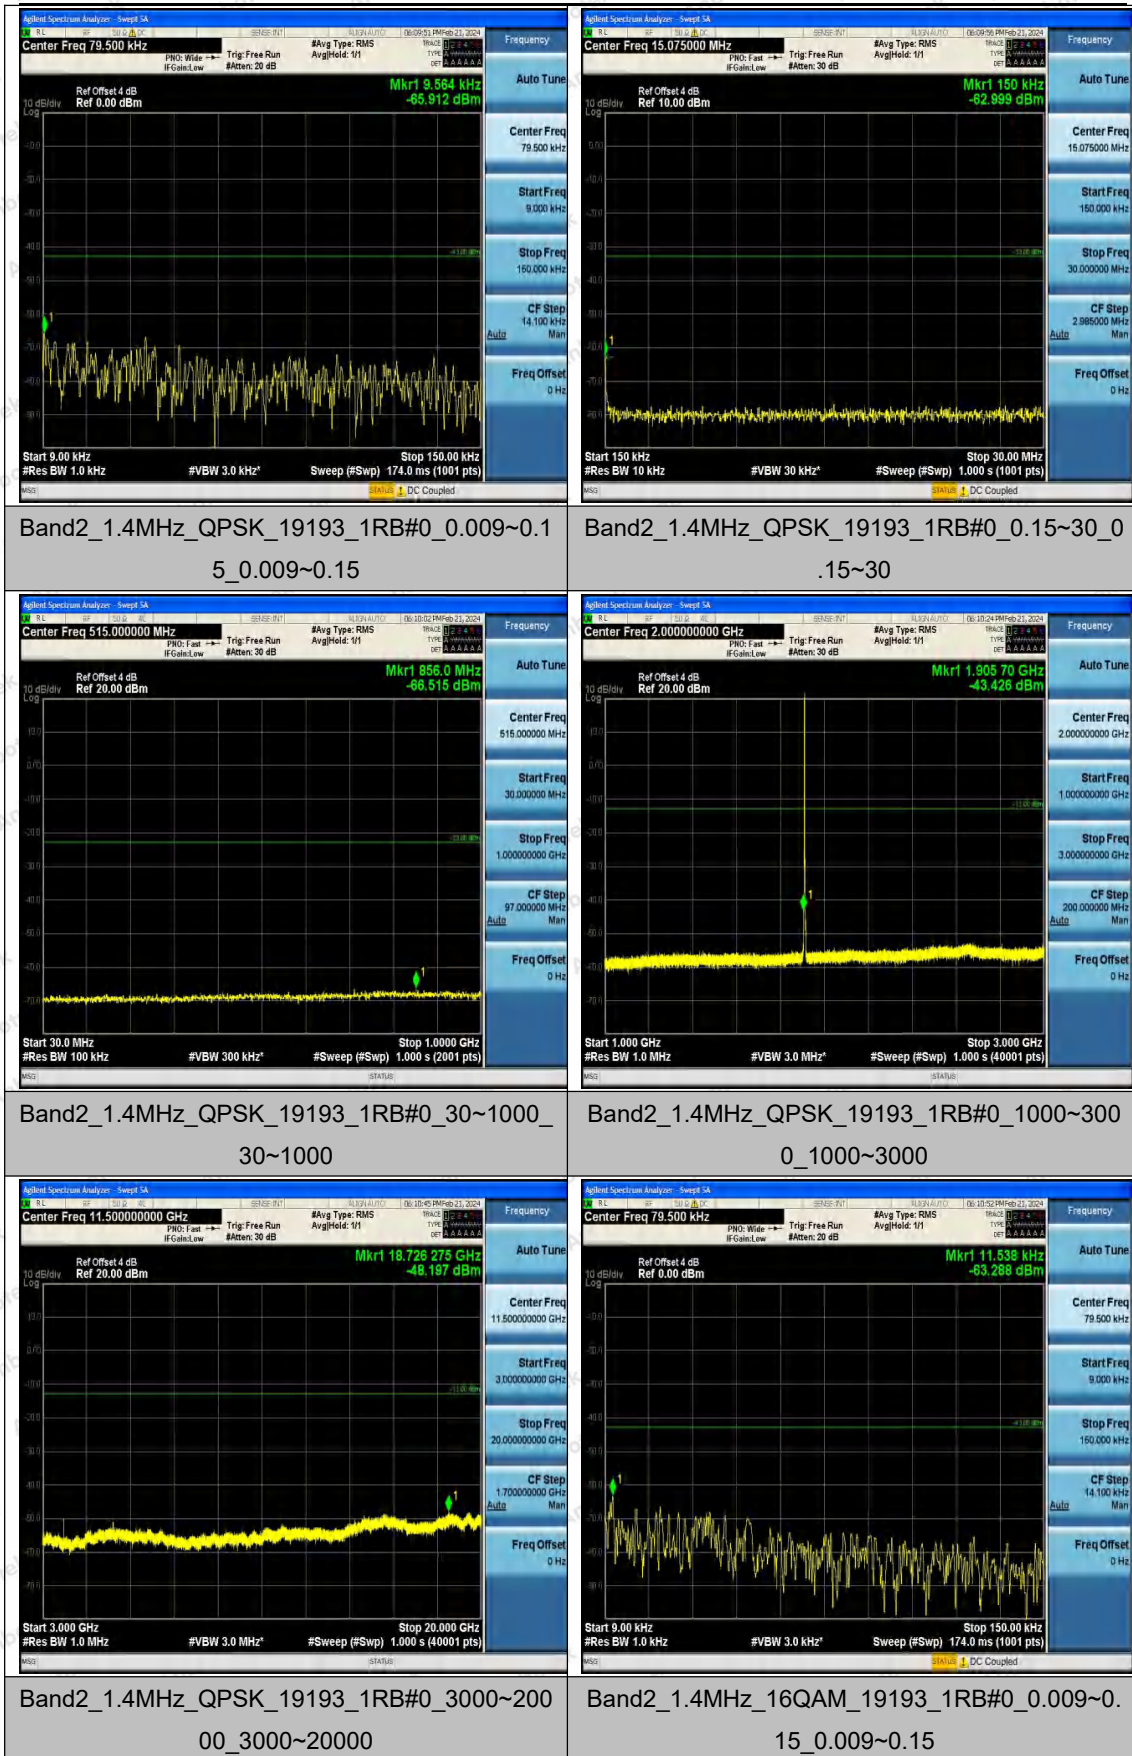


Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.
 Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com



Hotline
 400-003-0500
 www.anbotek.com.cn



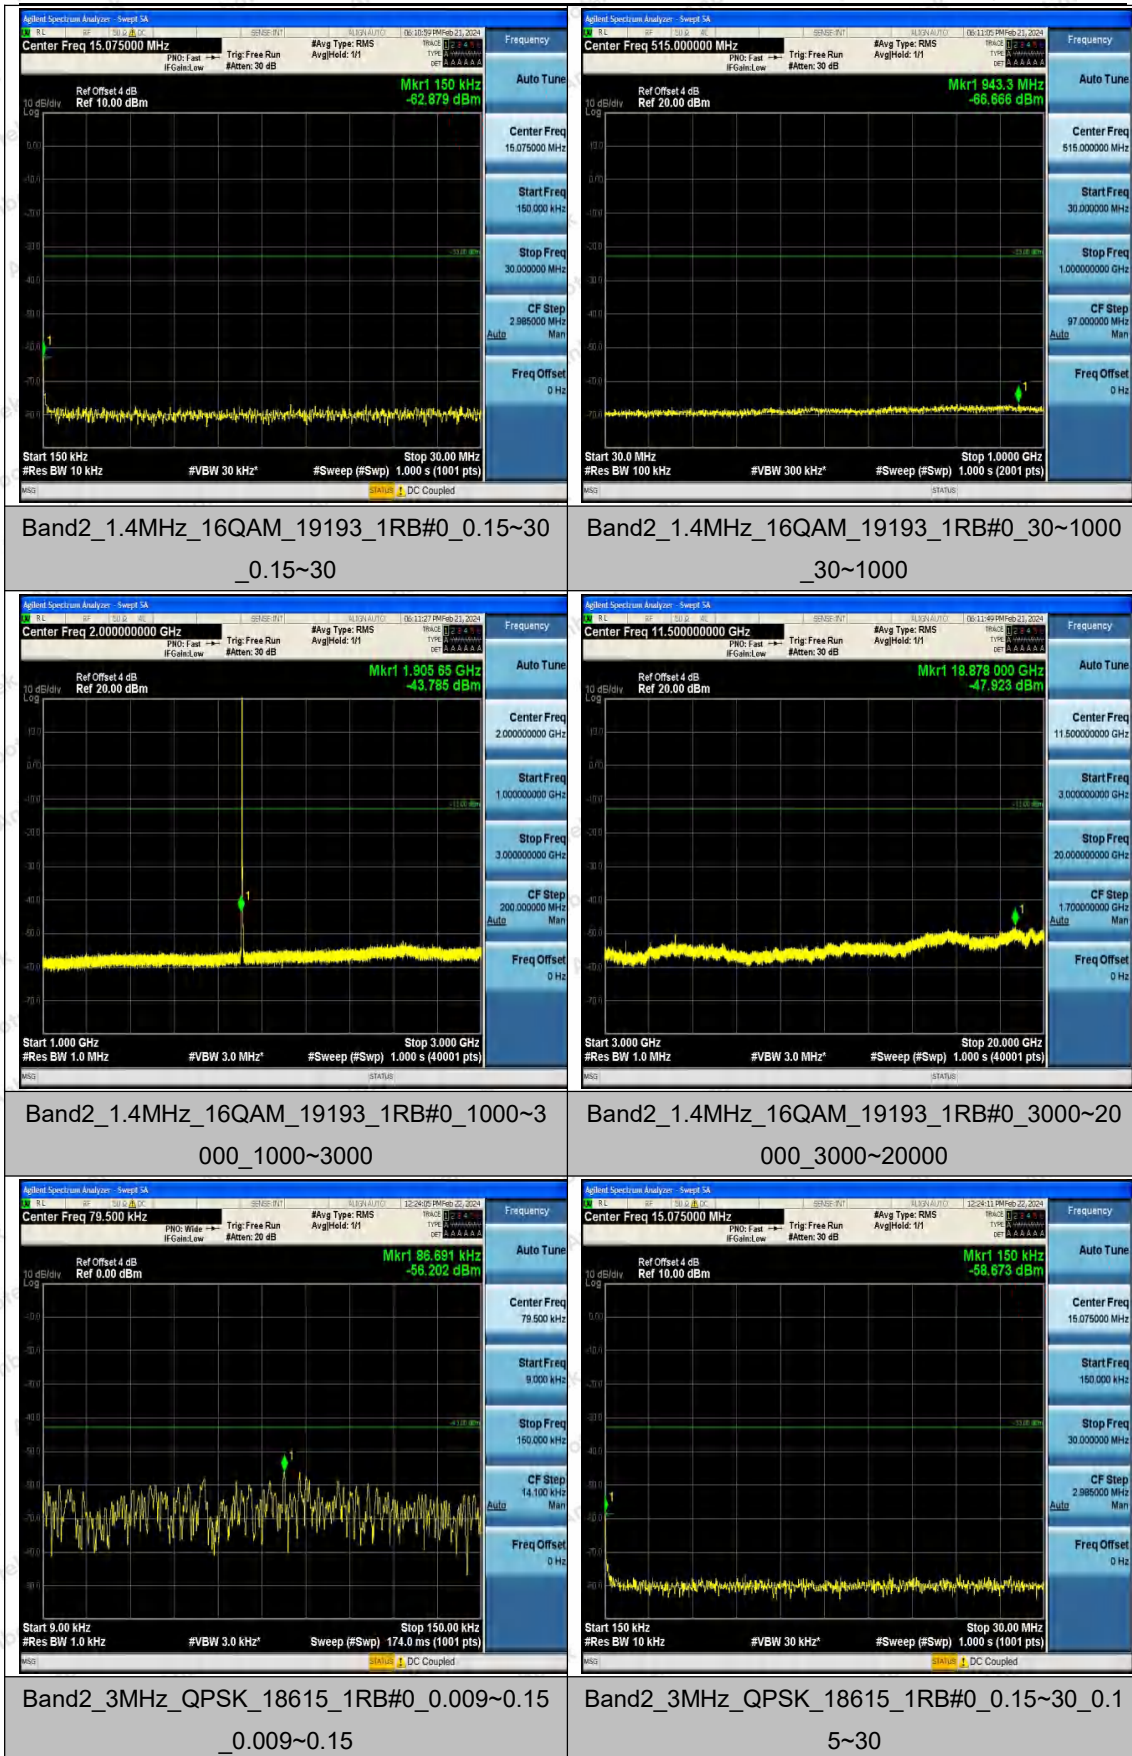


Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.
 Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com



Hotline
 400-003-0500
 www.anbotek.com.cn



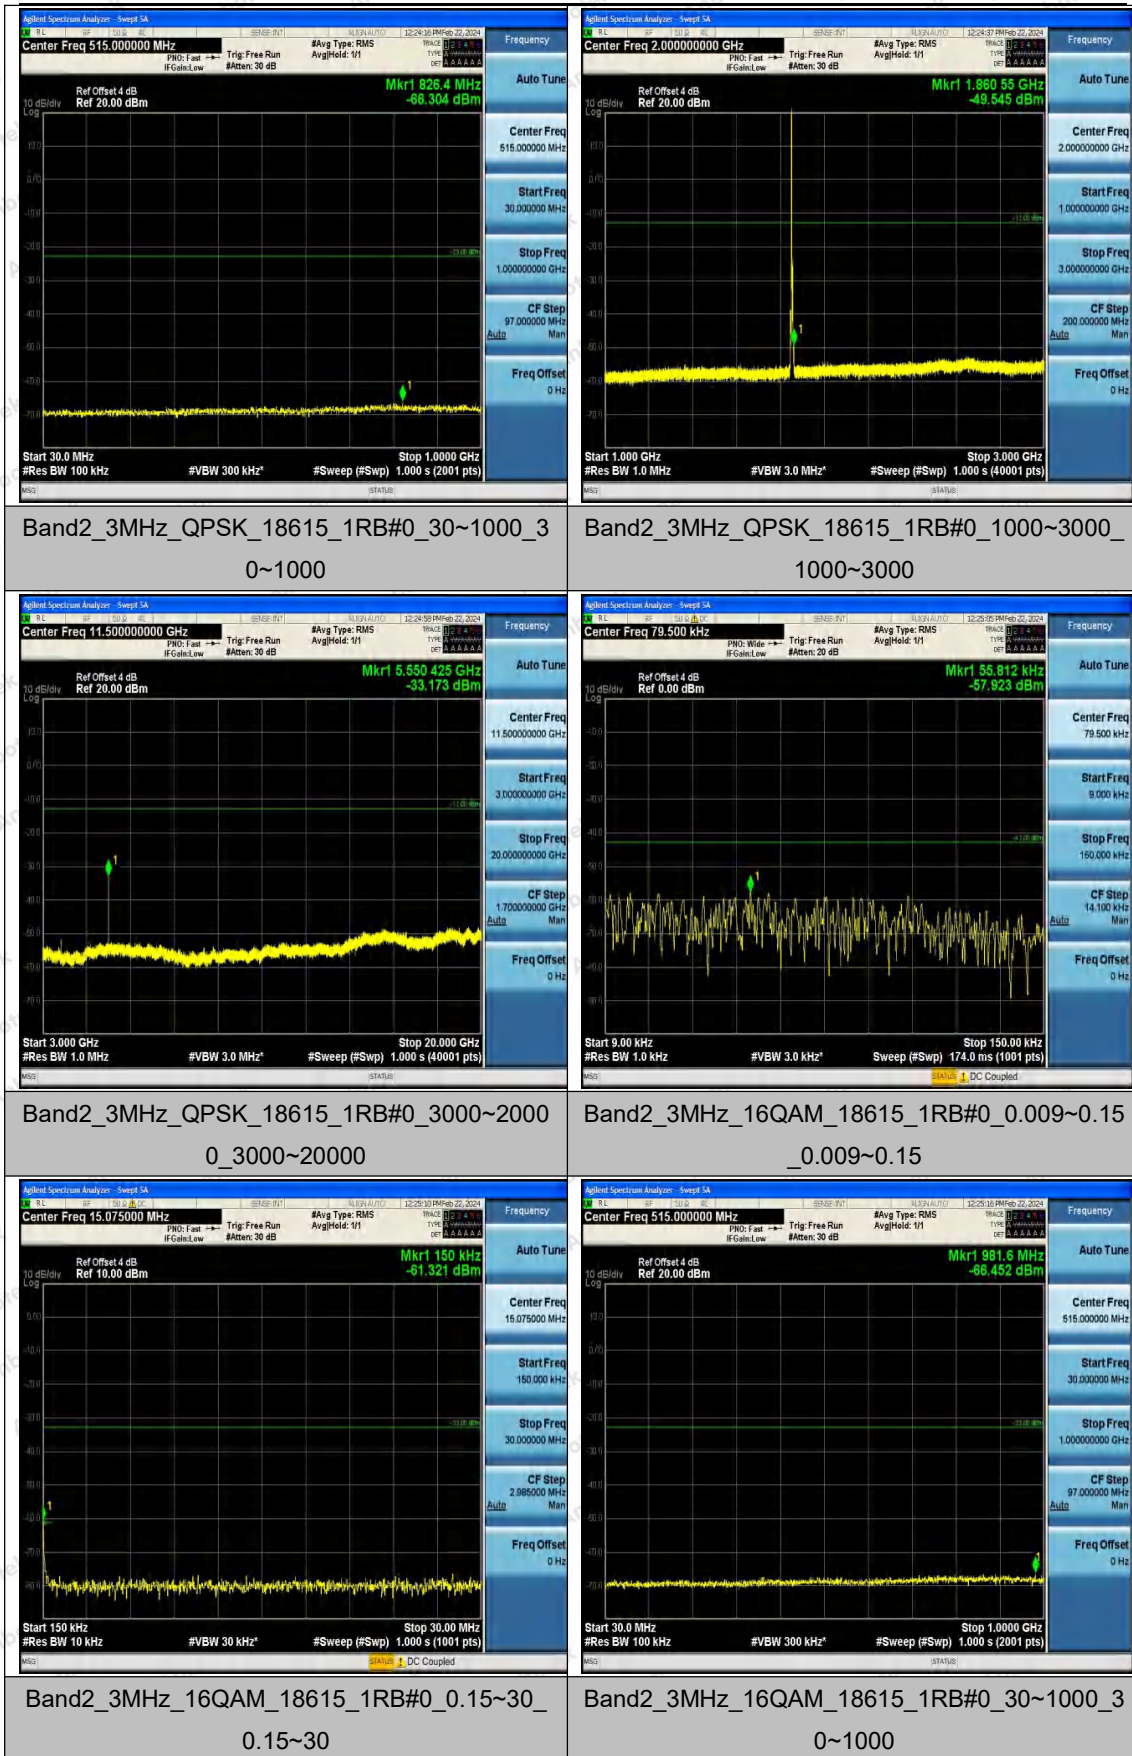


Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.
Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com



Hotline
400-003-0500
www.anbotek.com.cn



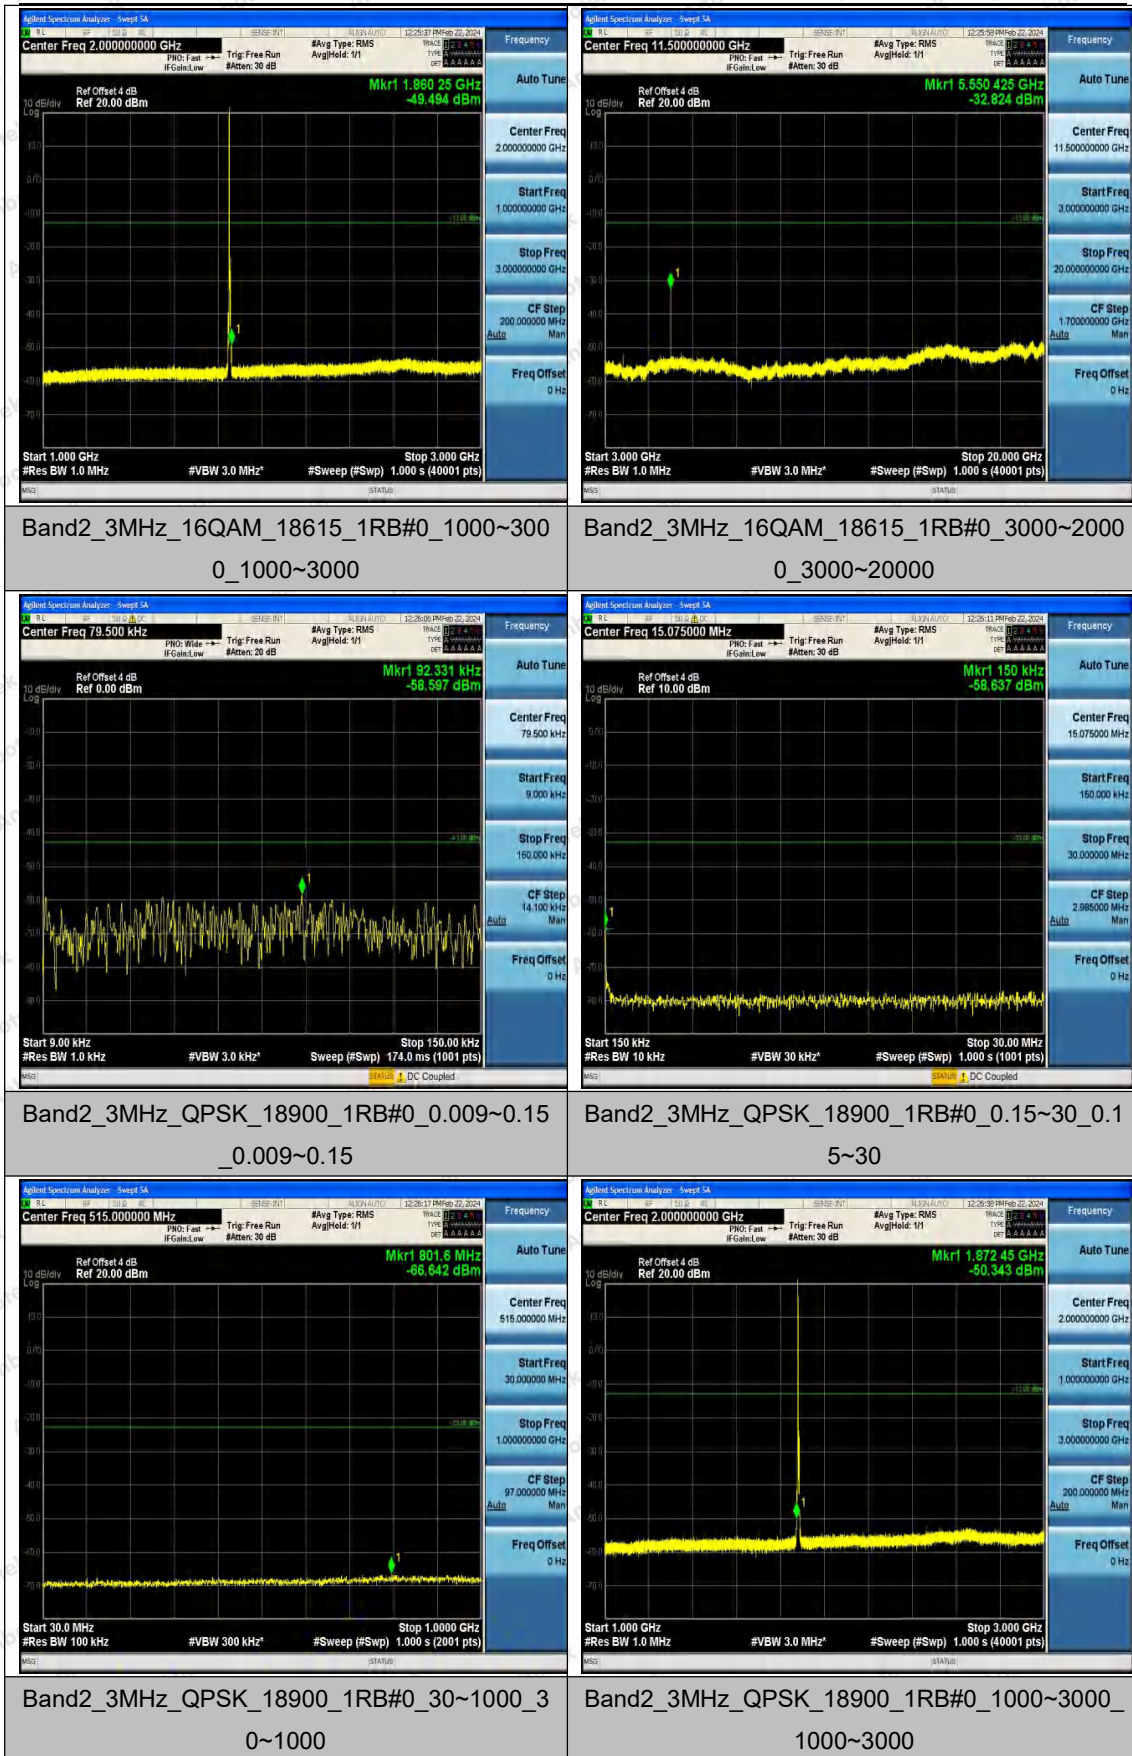


Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.
Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com



Hotline
400-003-0500
www.anbotek.com.cn



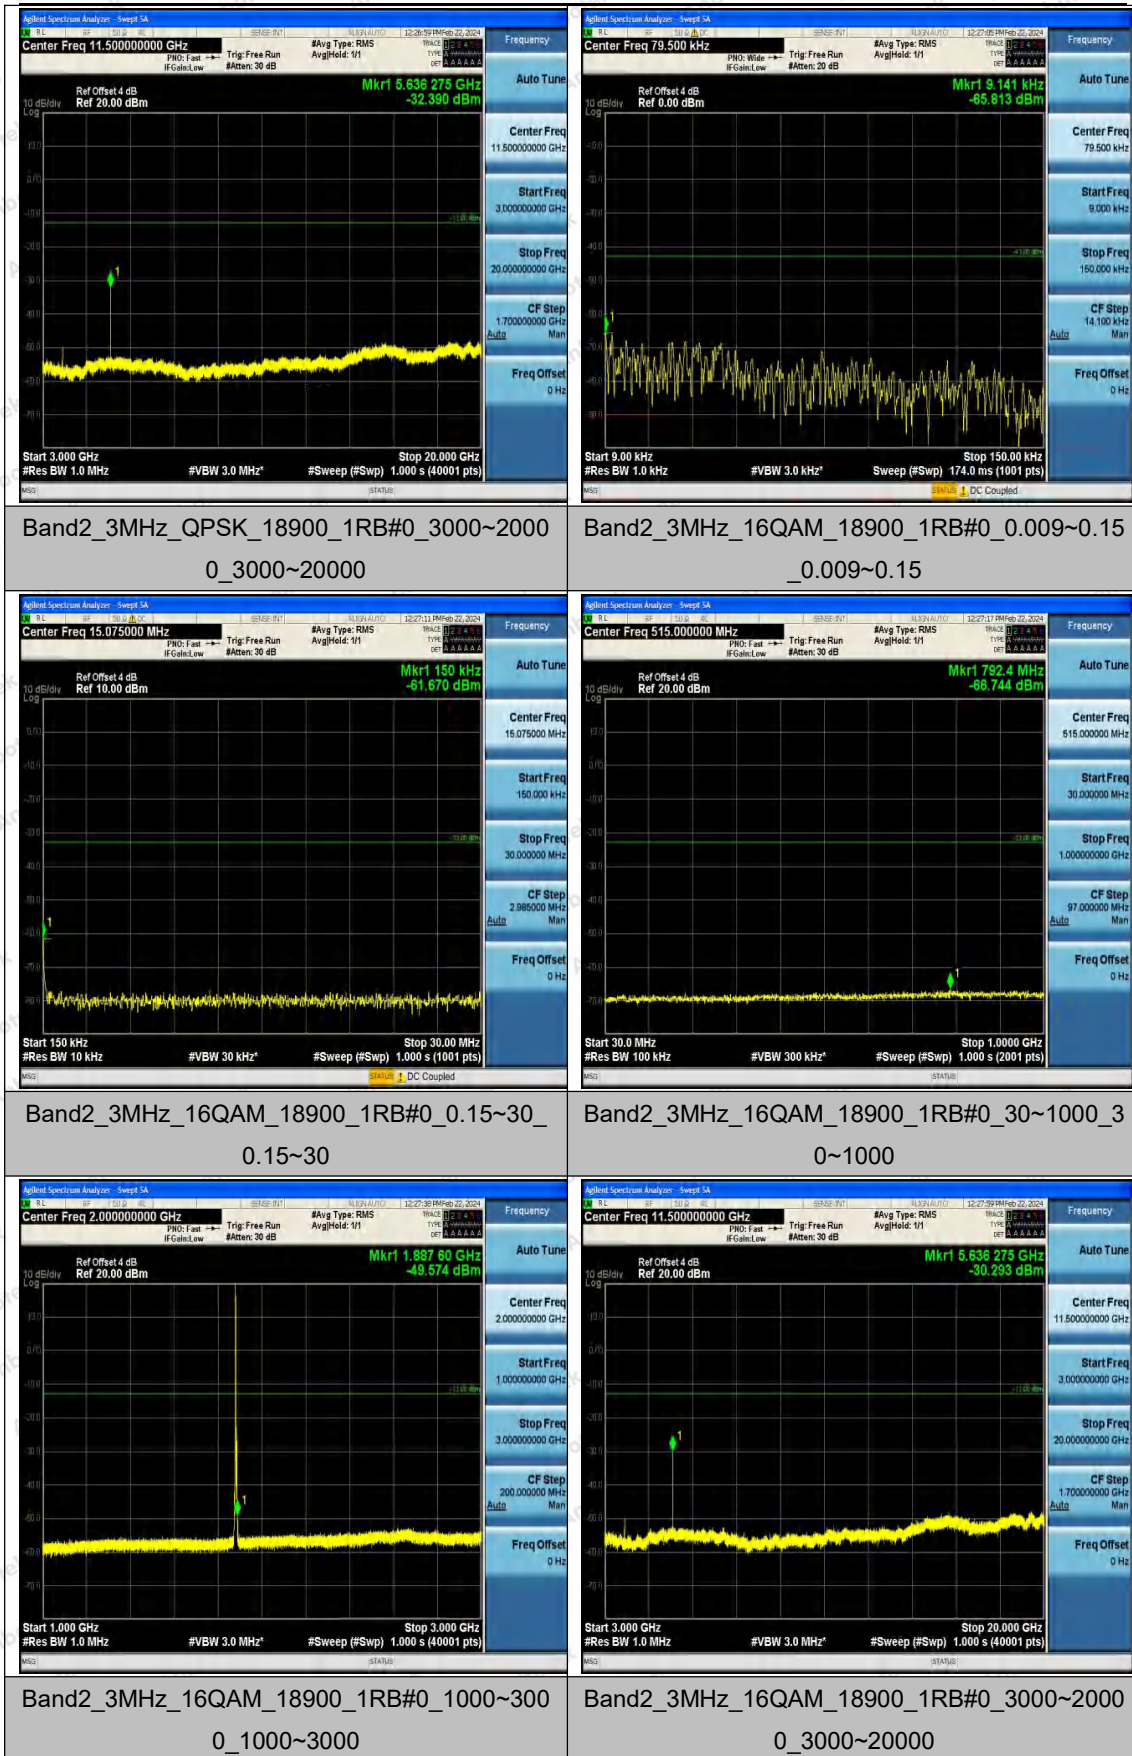


Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.
Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com



Hotline
400-003-0500
www.anbotek.com.cn



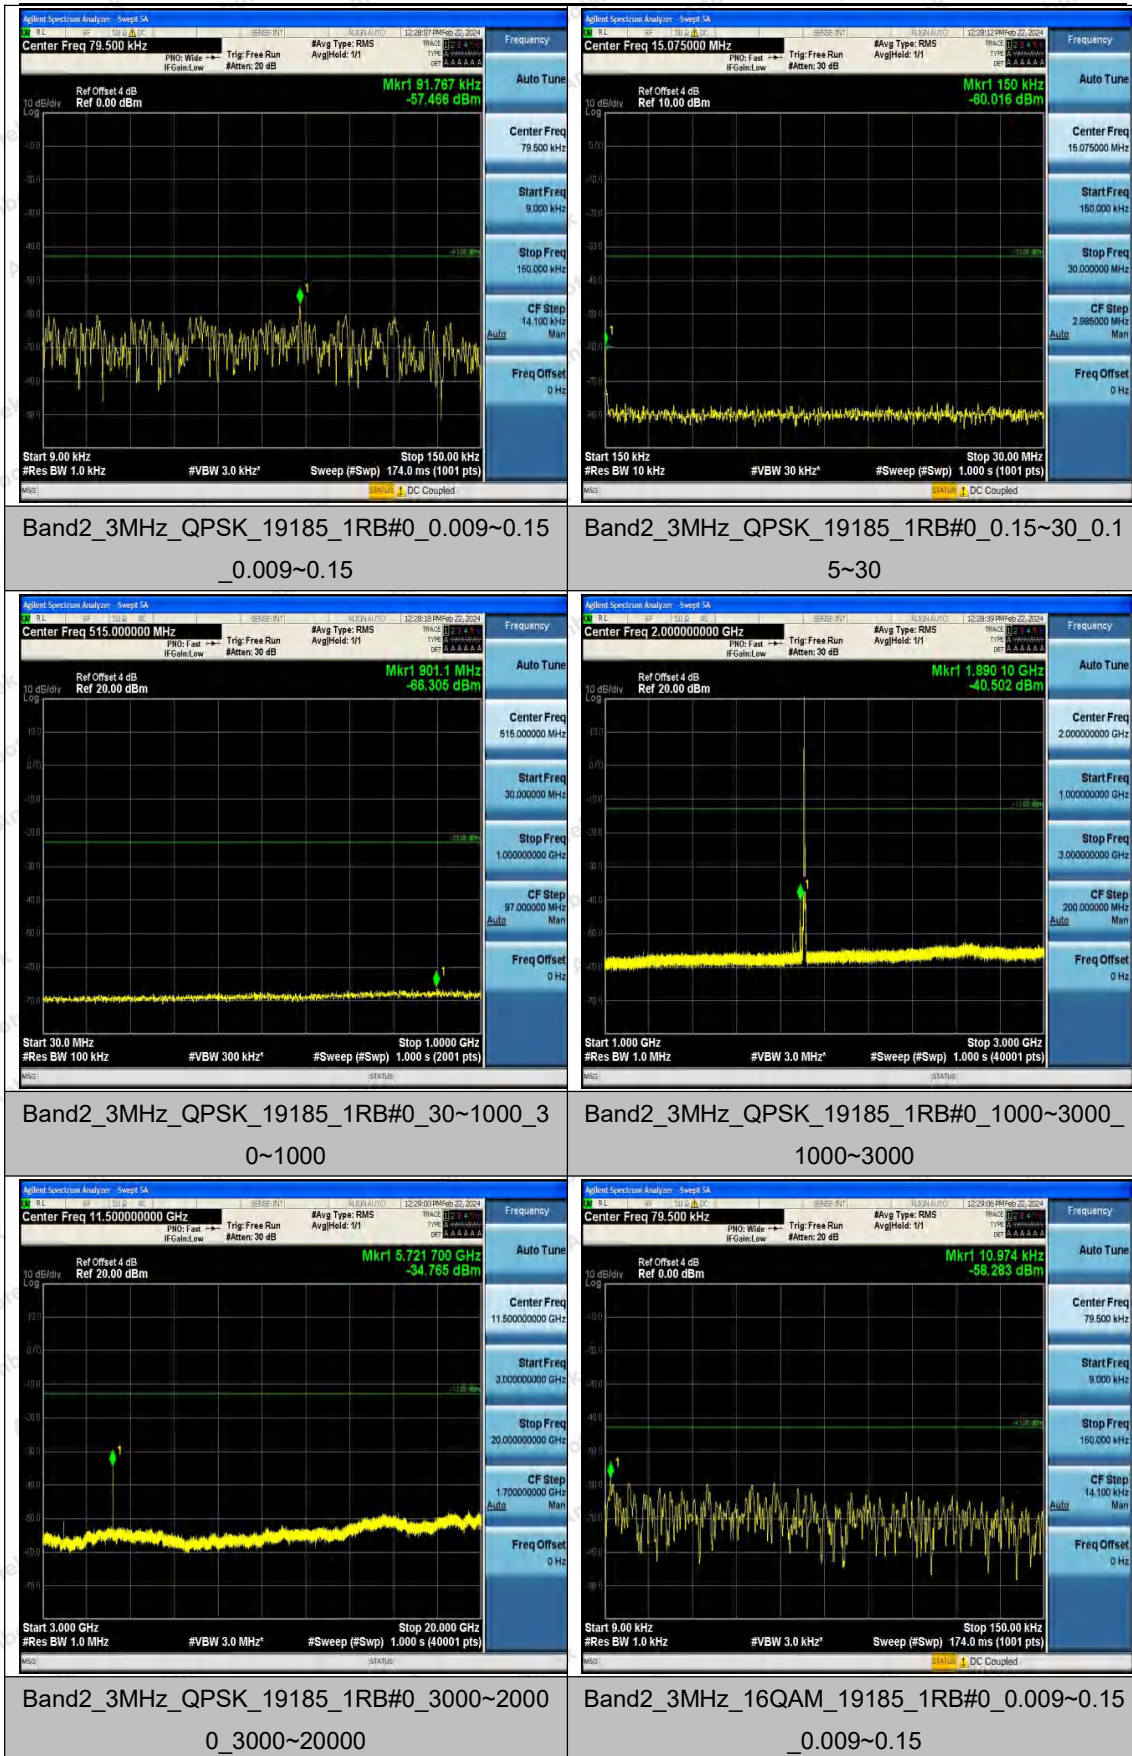


Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.
 Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com



Hotline
 400-003-0500
 www.anbotek.com.cn



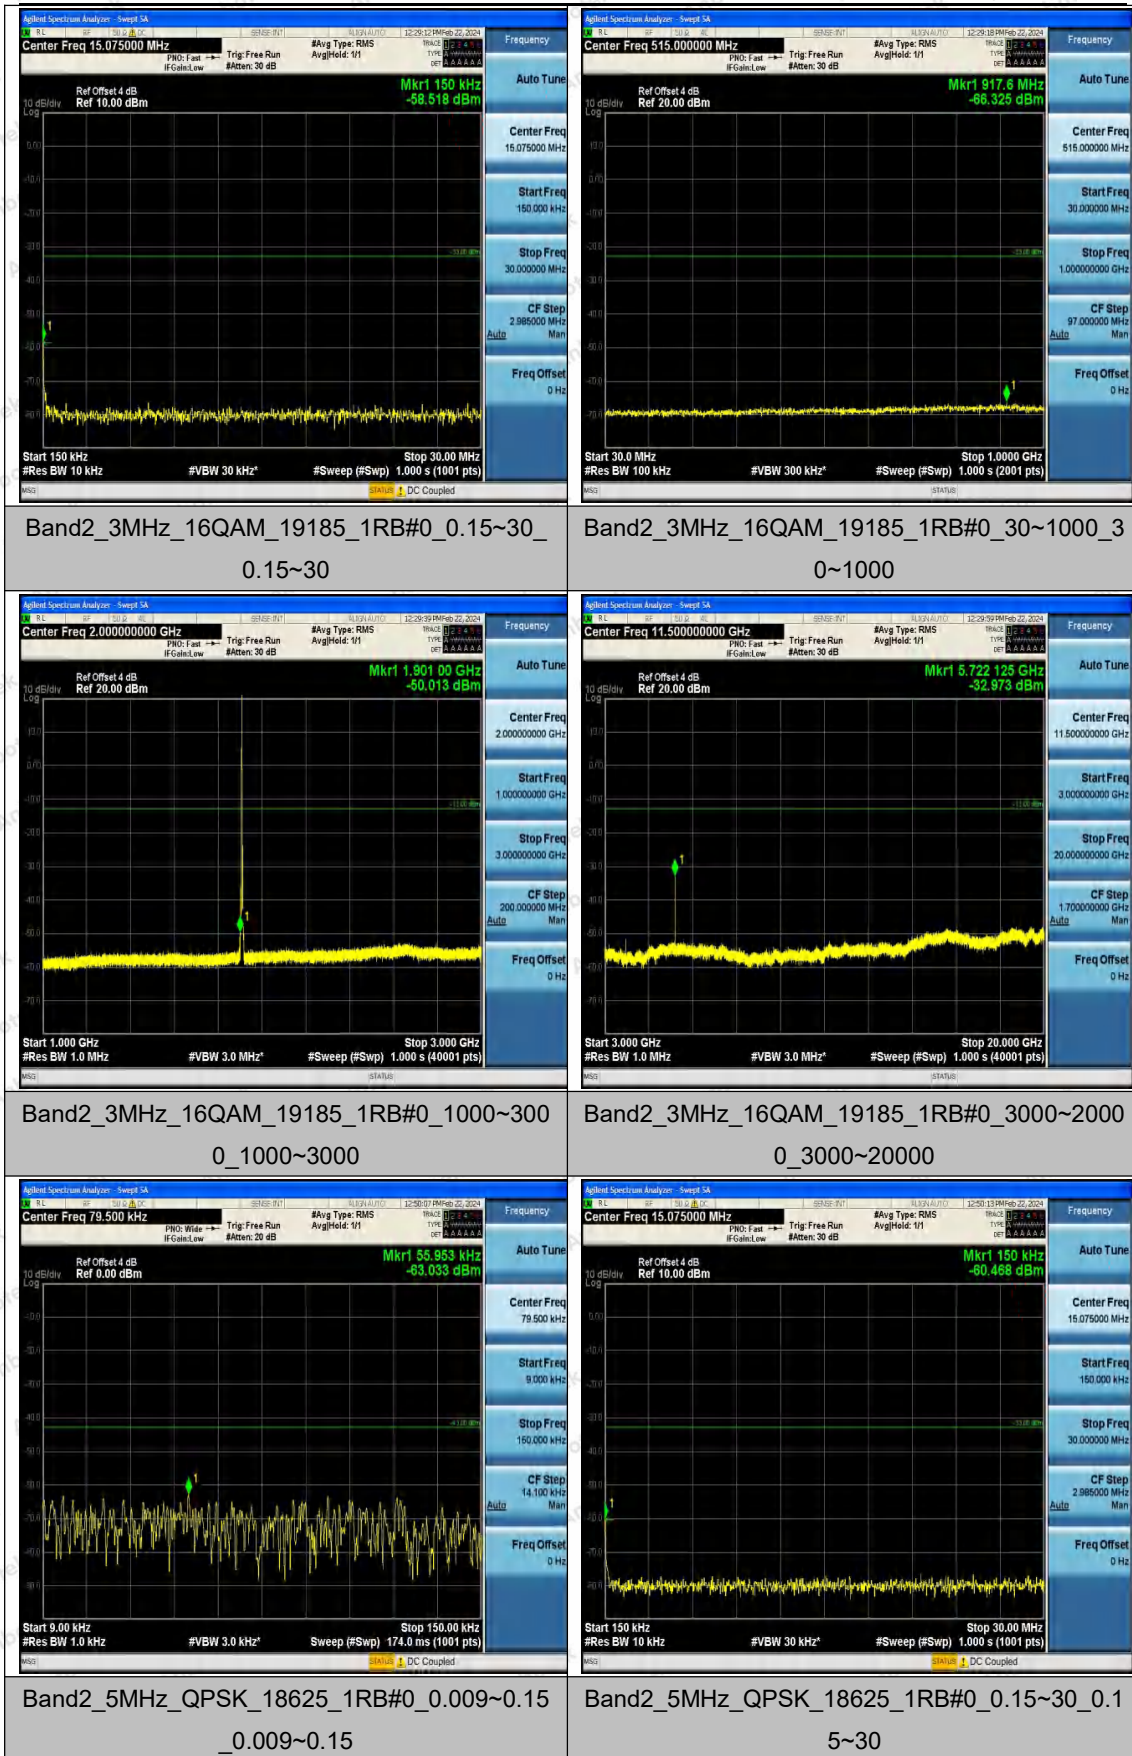


Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.
 Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com



Hotline
 400-003-0500
 www.anbotek.com.cn



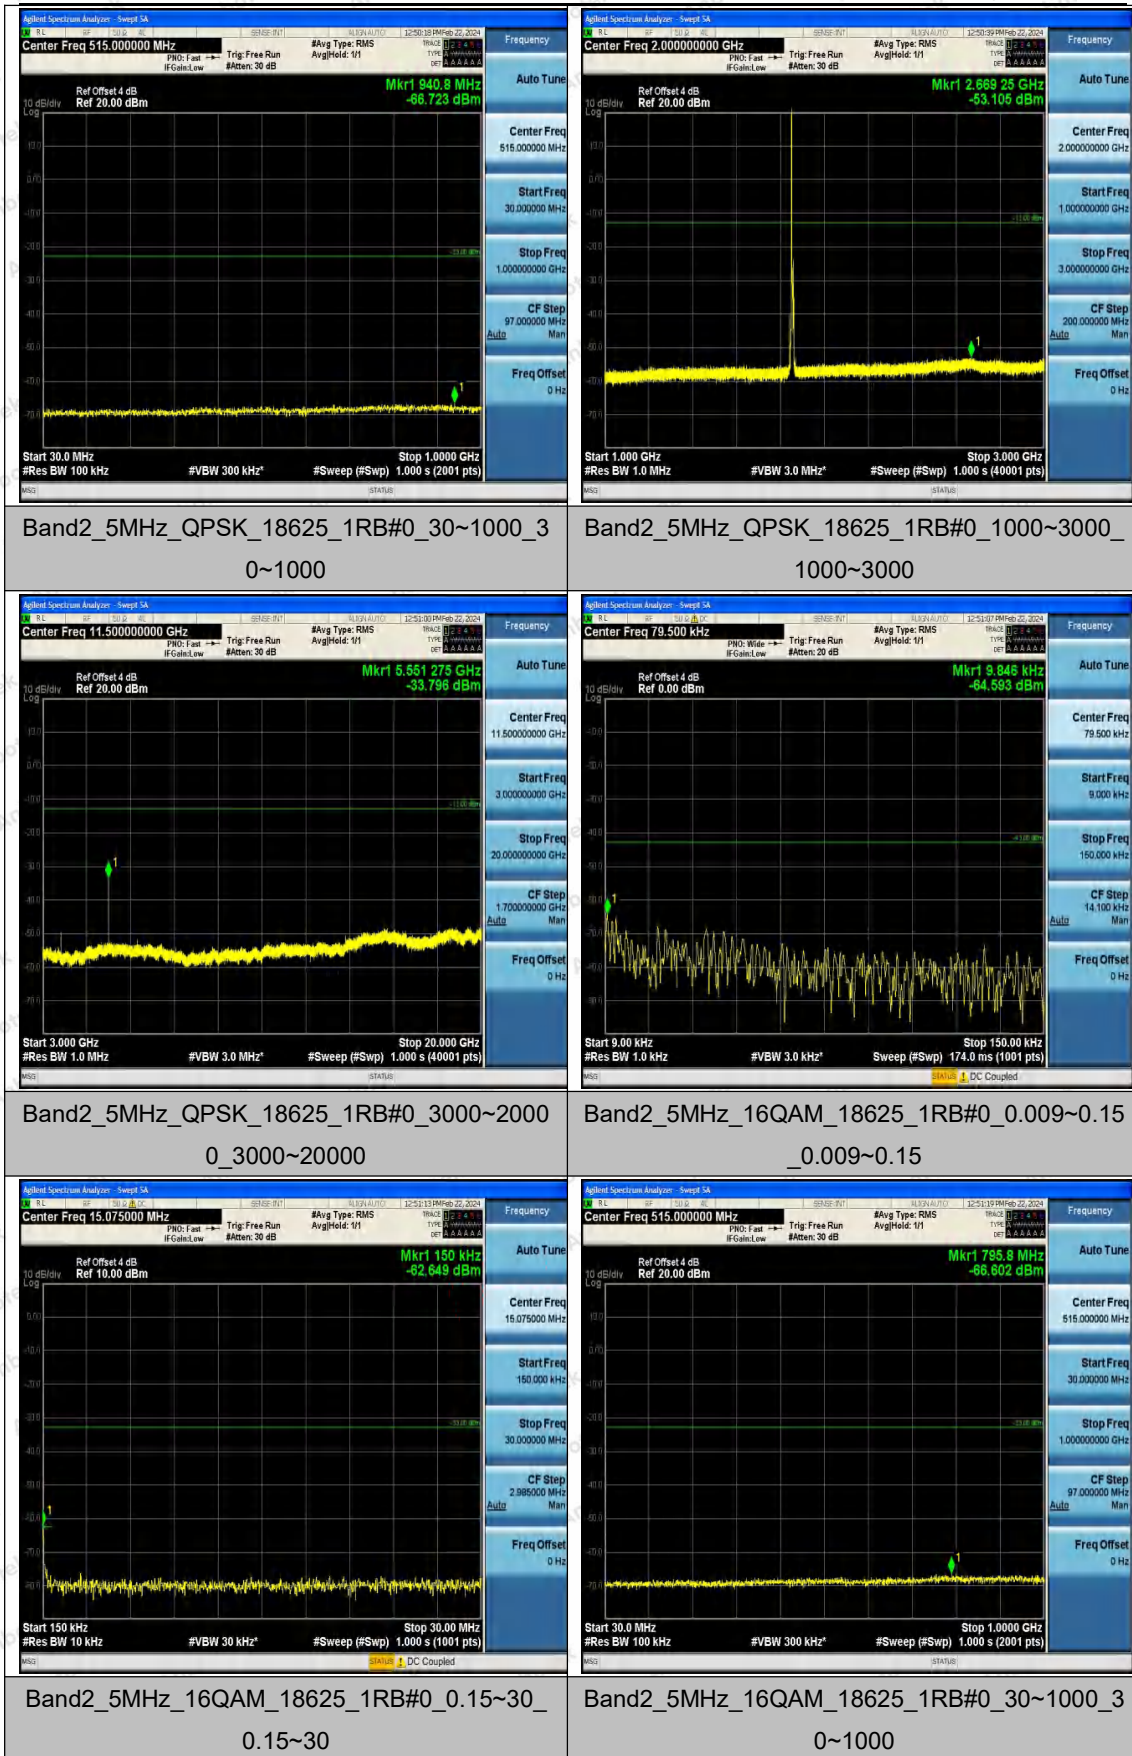


Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.
 Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com



Hotline
 400-003-0500
 www.anbotek.com.cn



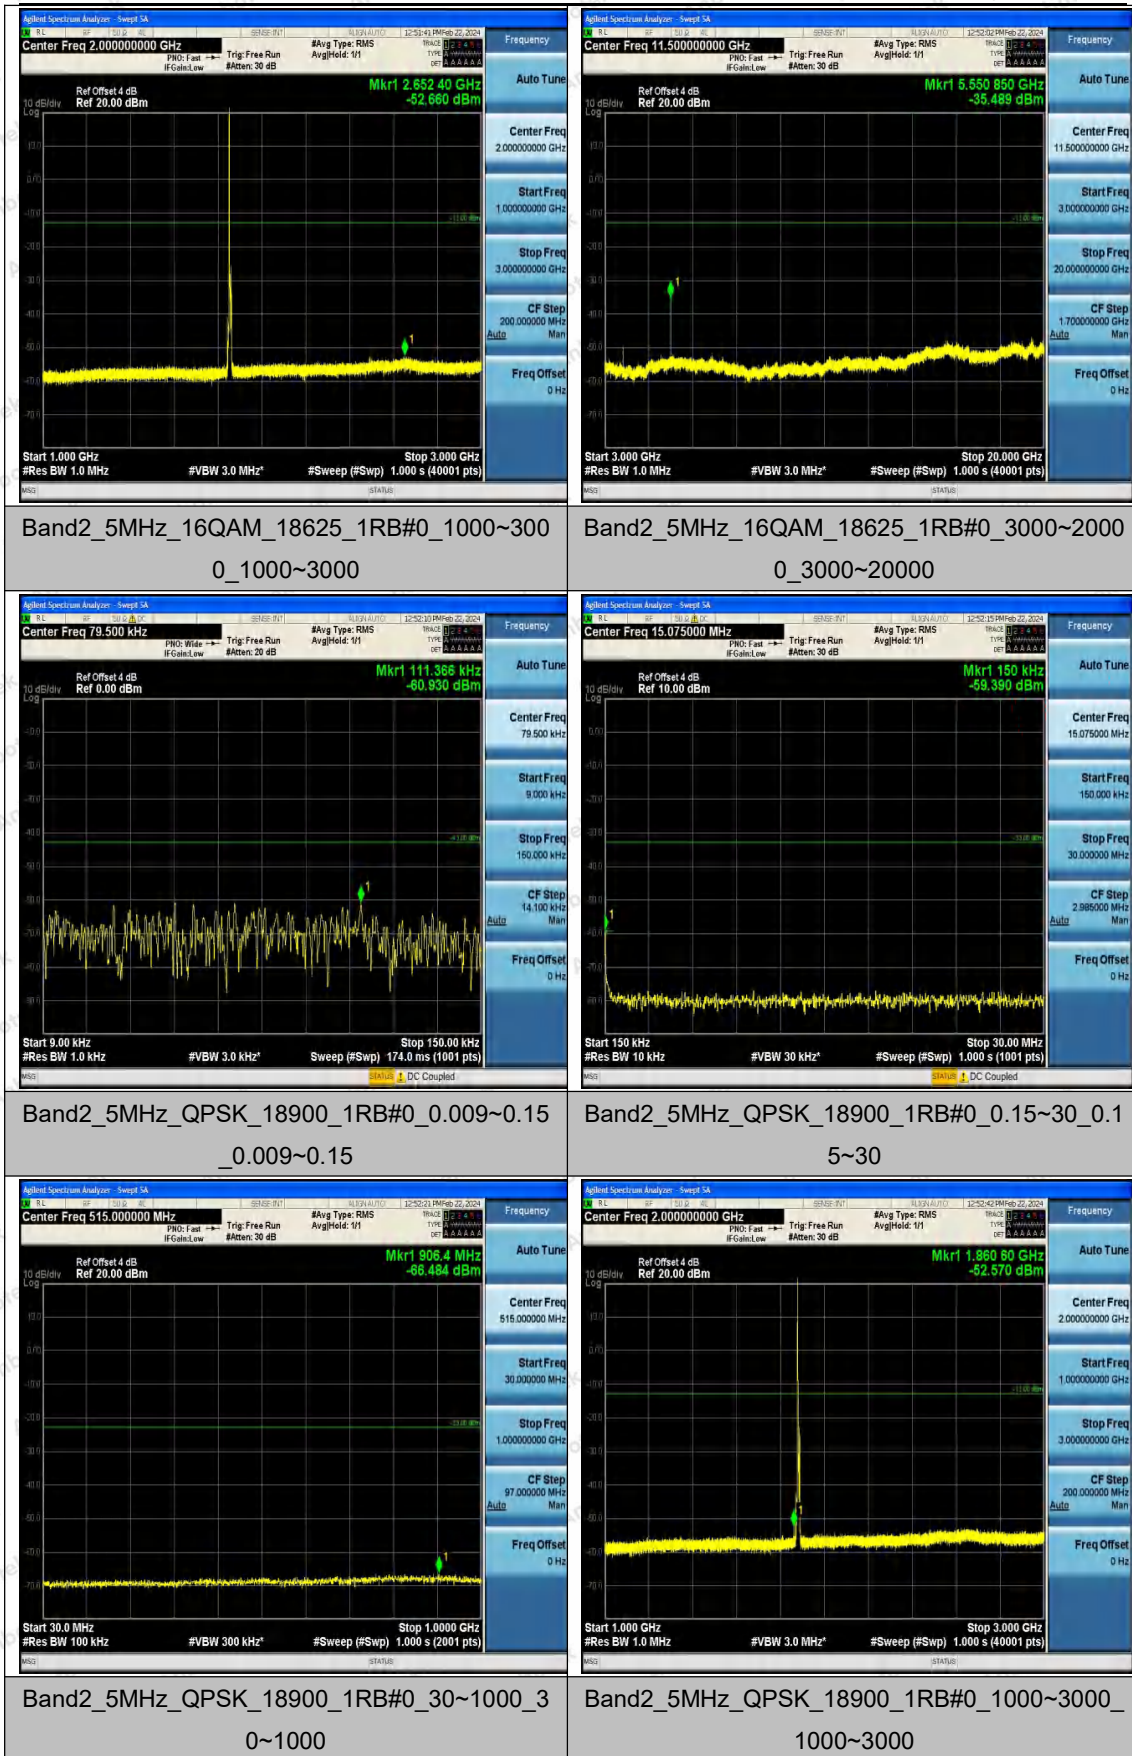


Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.
 Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com



Hotline
 400-003-0500
 www.anbotek.com.cn



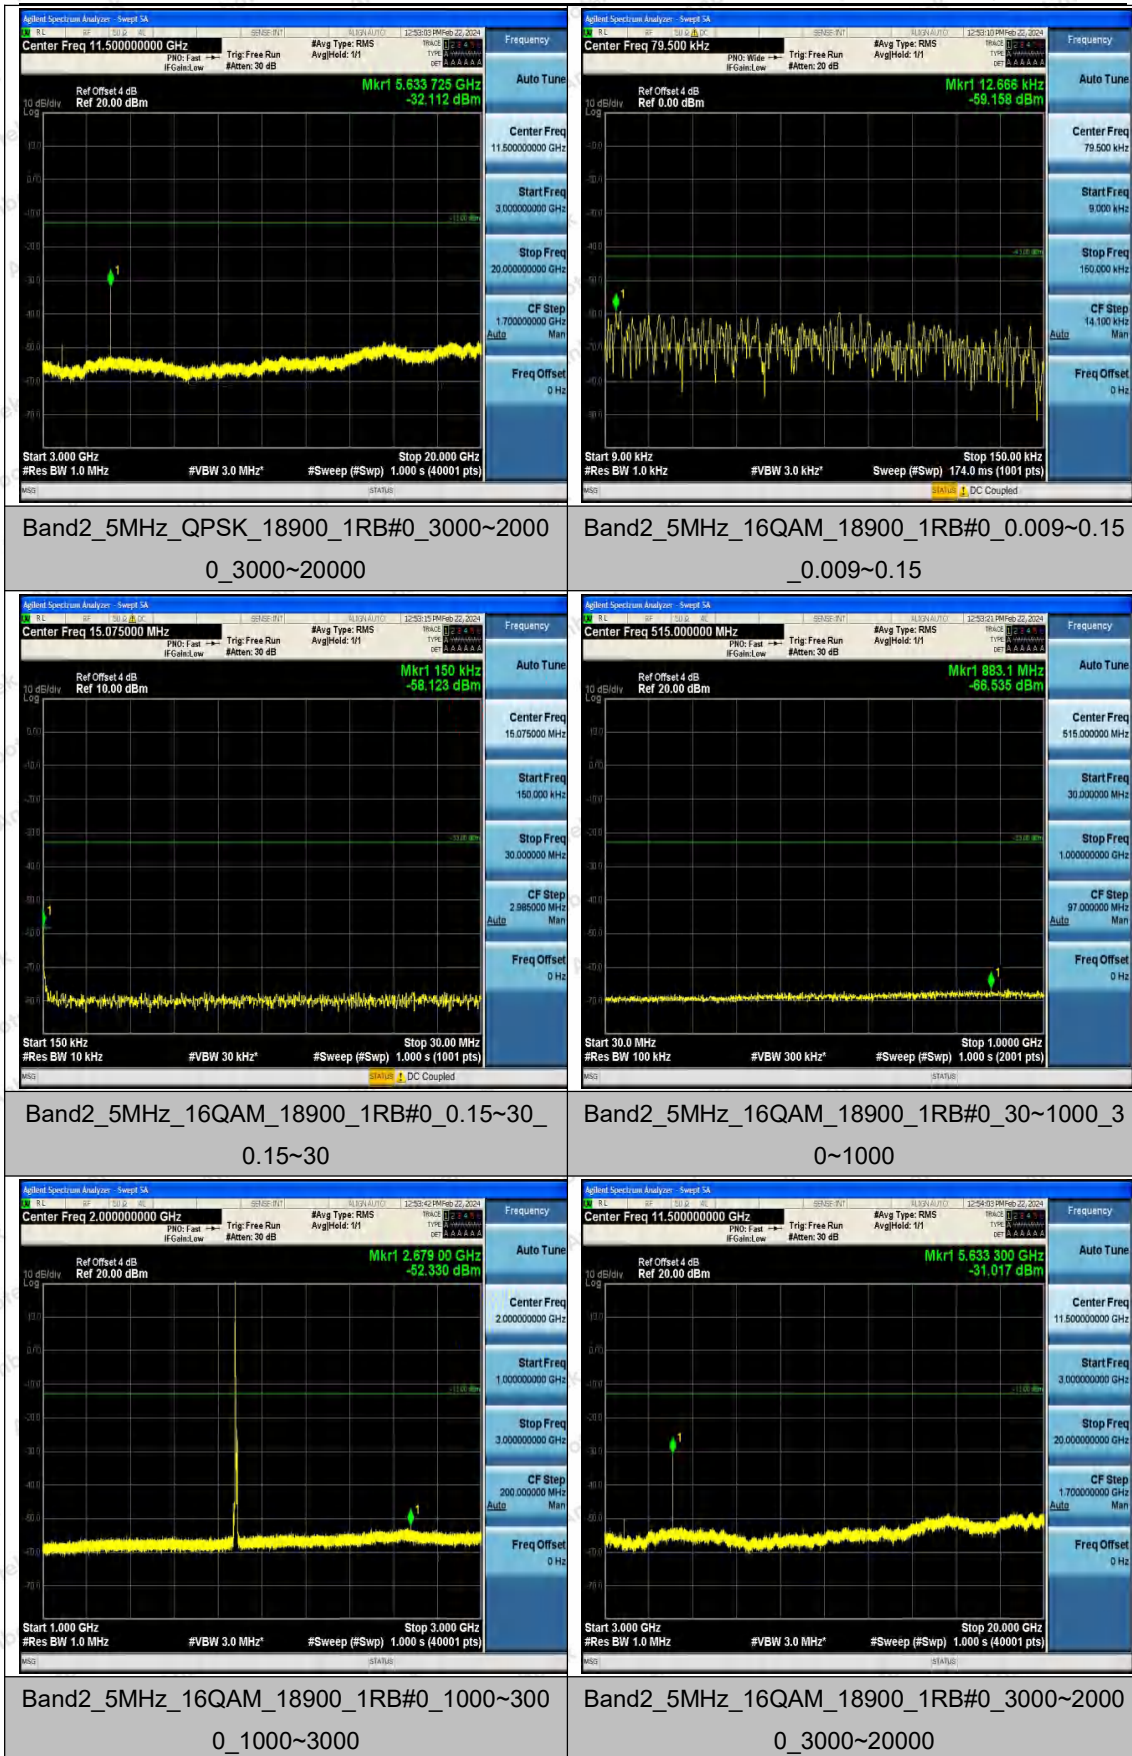


Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.
Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com



Hotline
400-003-0500
www.anbotek.com.cn



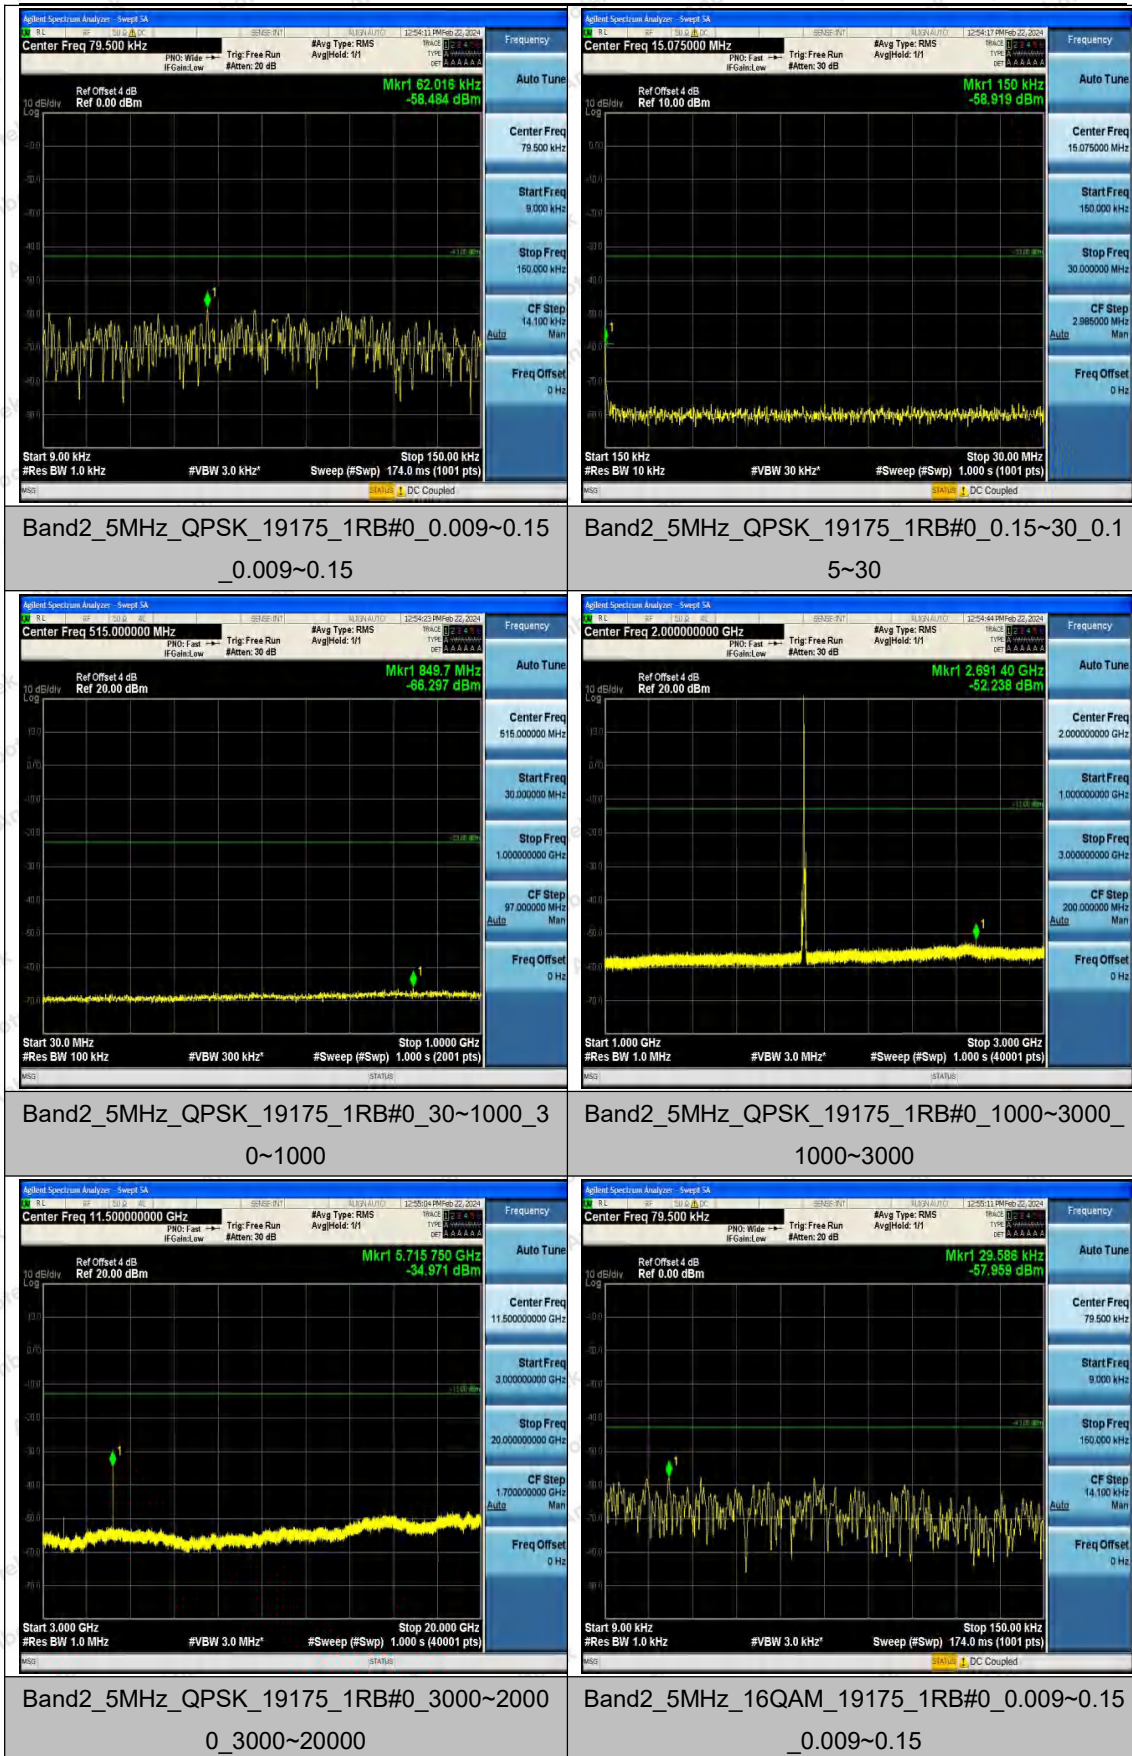


Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.
 Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com



Hotline
 400-003-0500
 www.anbotek.com.cn



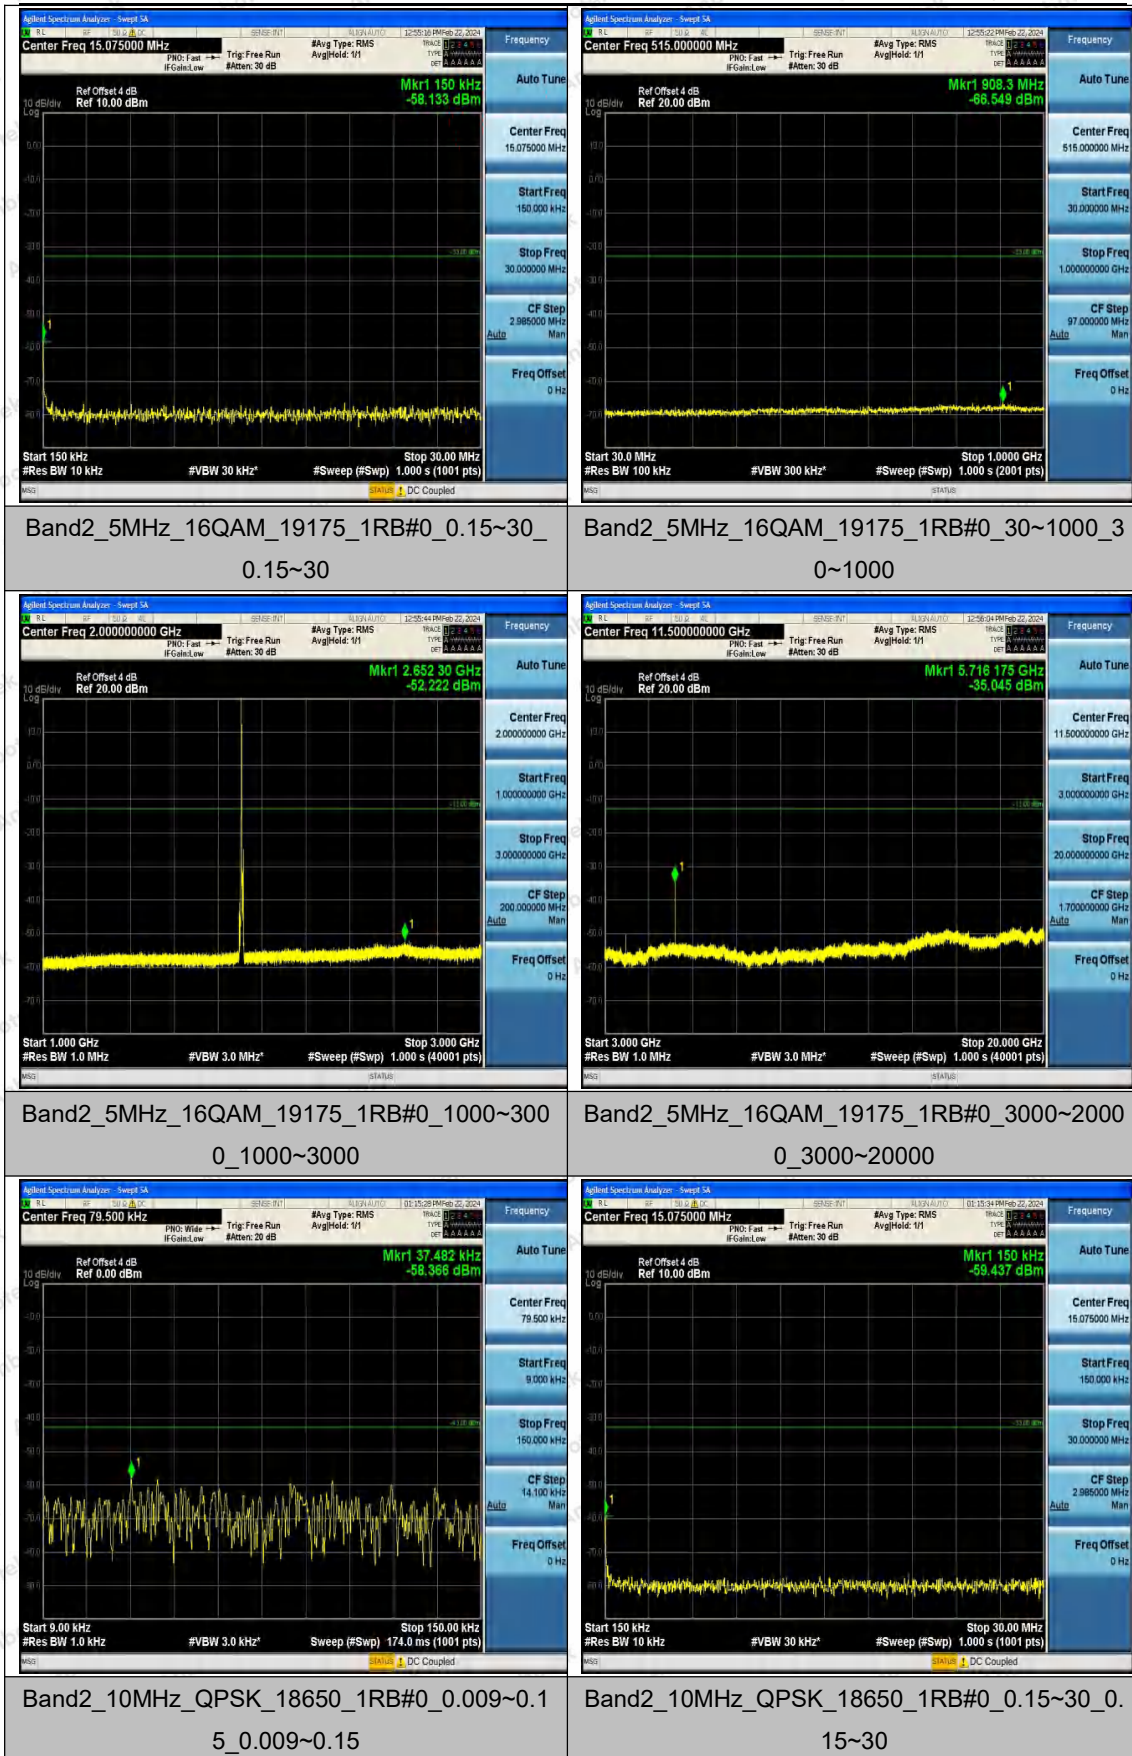


Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.
 Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com



Hotline
 400-003-0500
 www.anbotek.com.cn



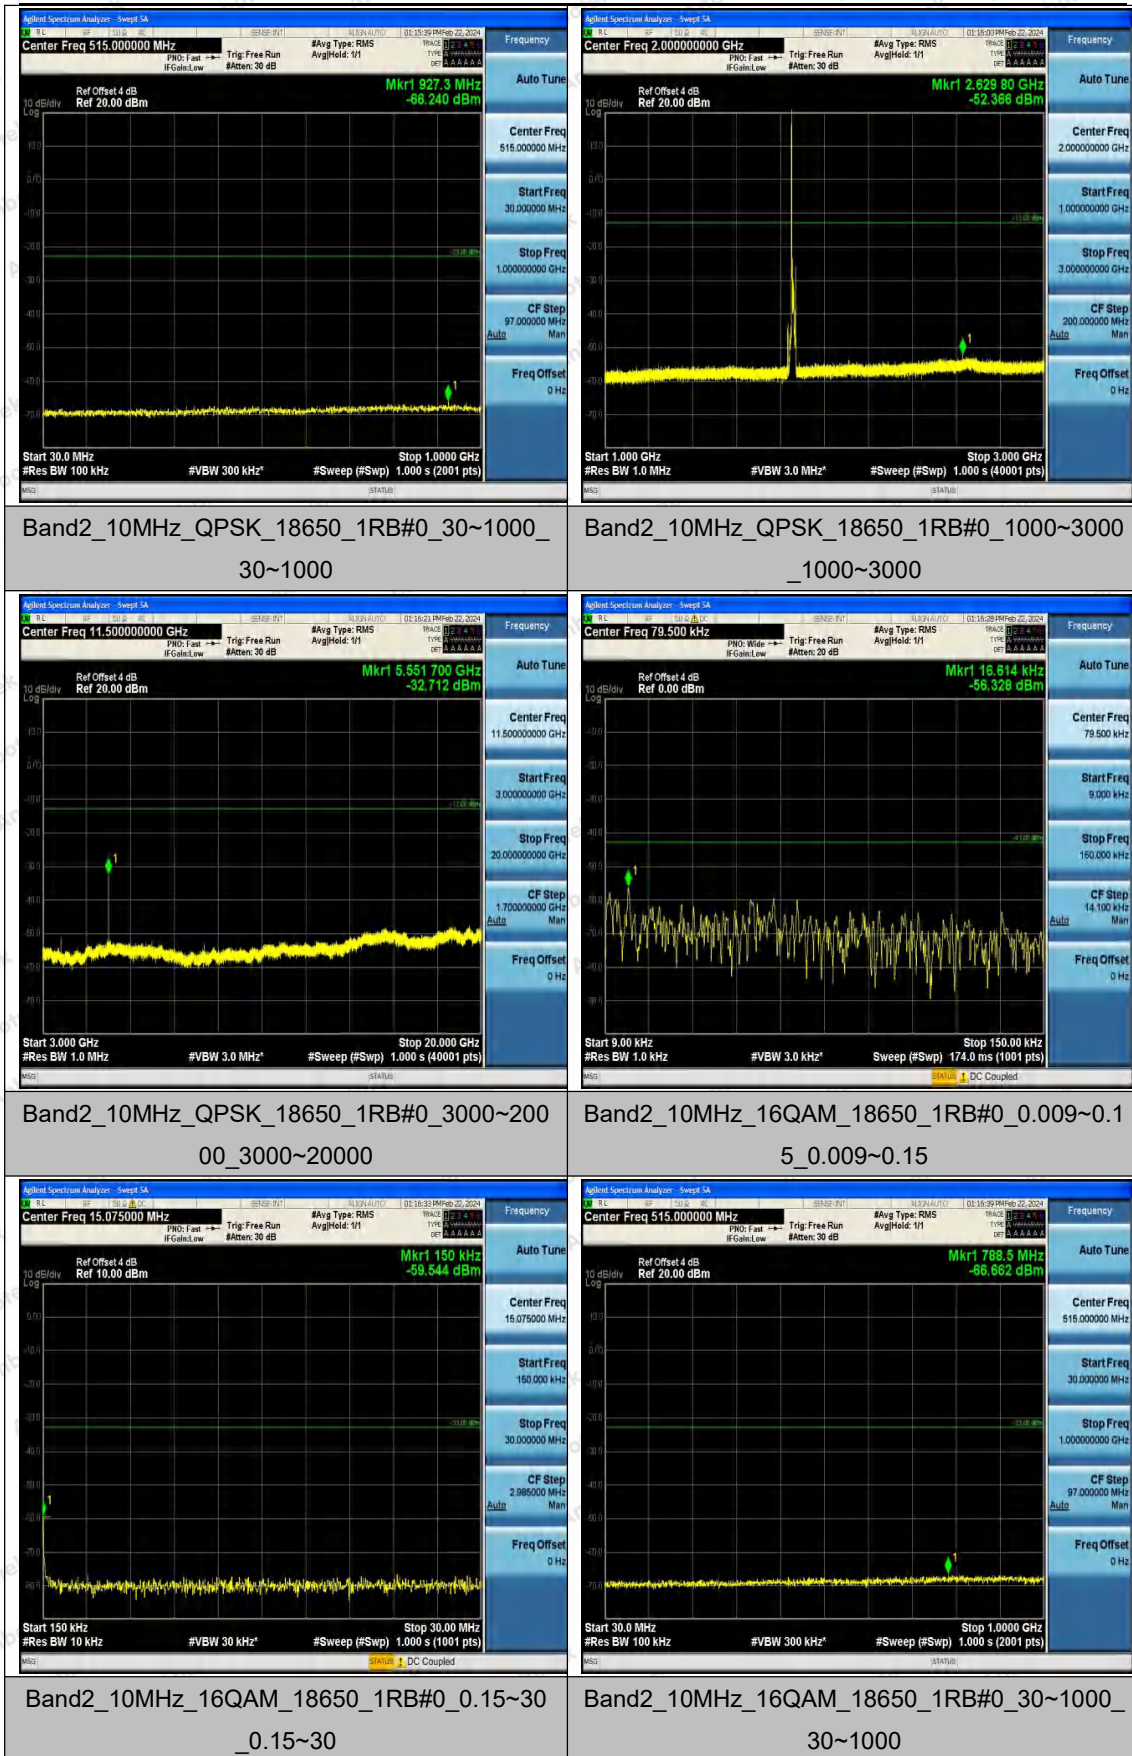


Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.
Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com



Hotline
400-003-0500
www.anbotek.com.cn



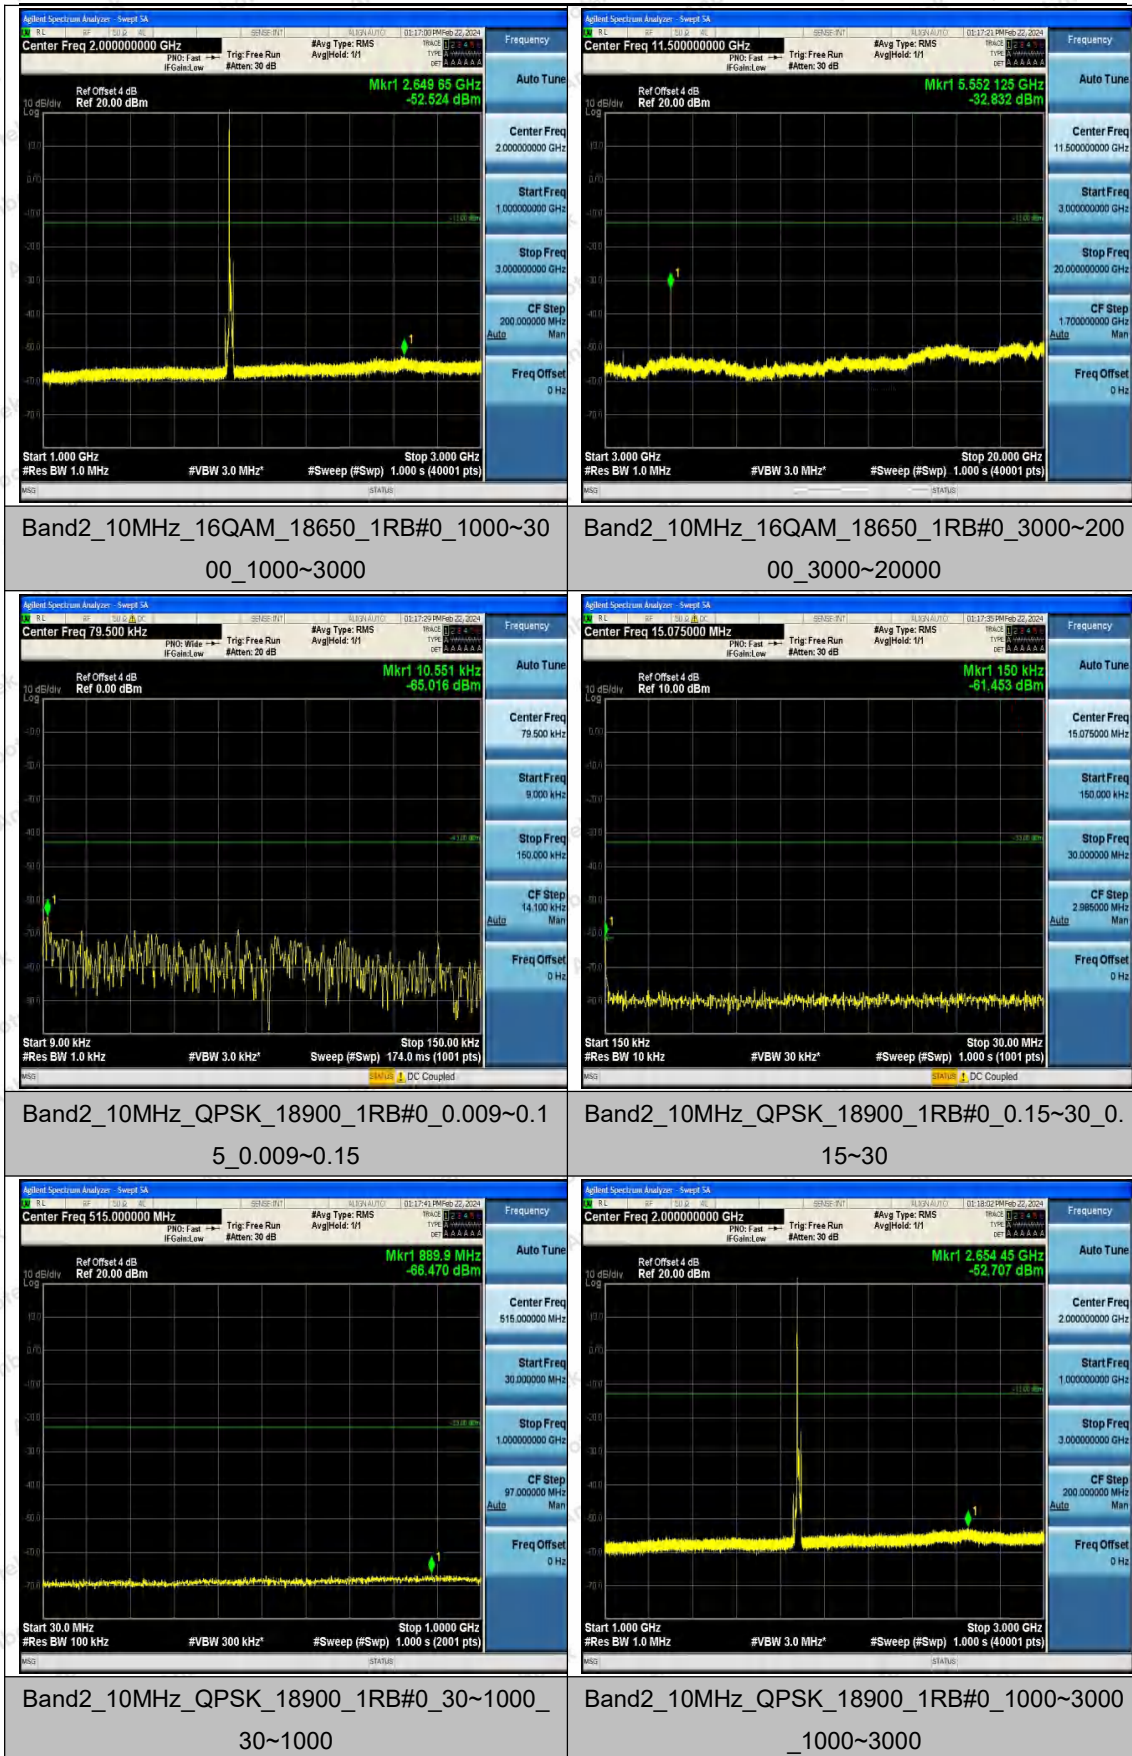


Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.
 Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com



Hotline
 400-003-0500
 www.anbotek.com.cn



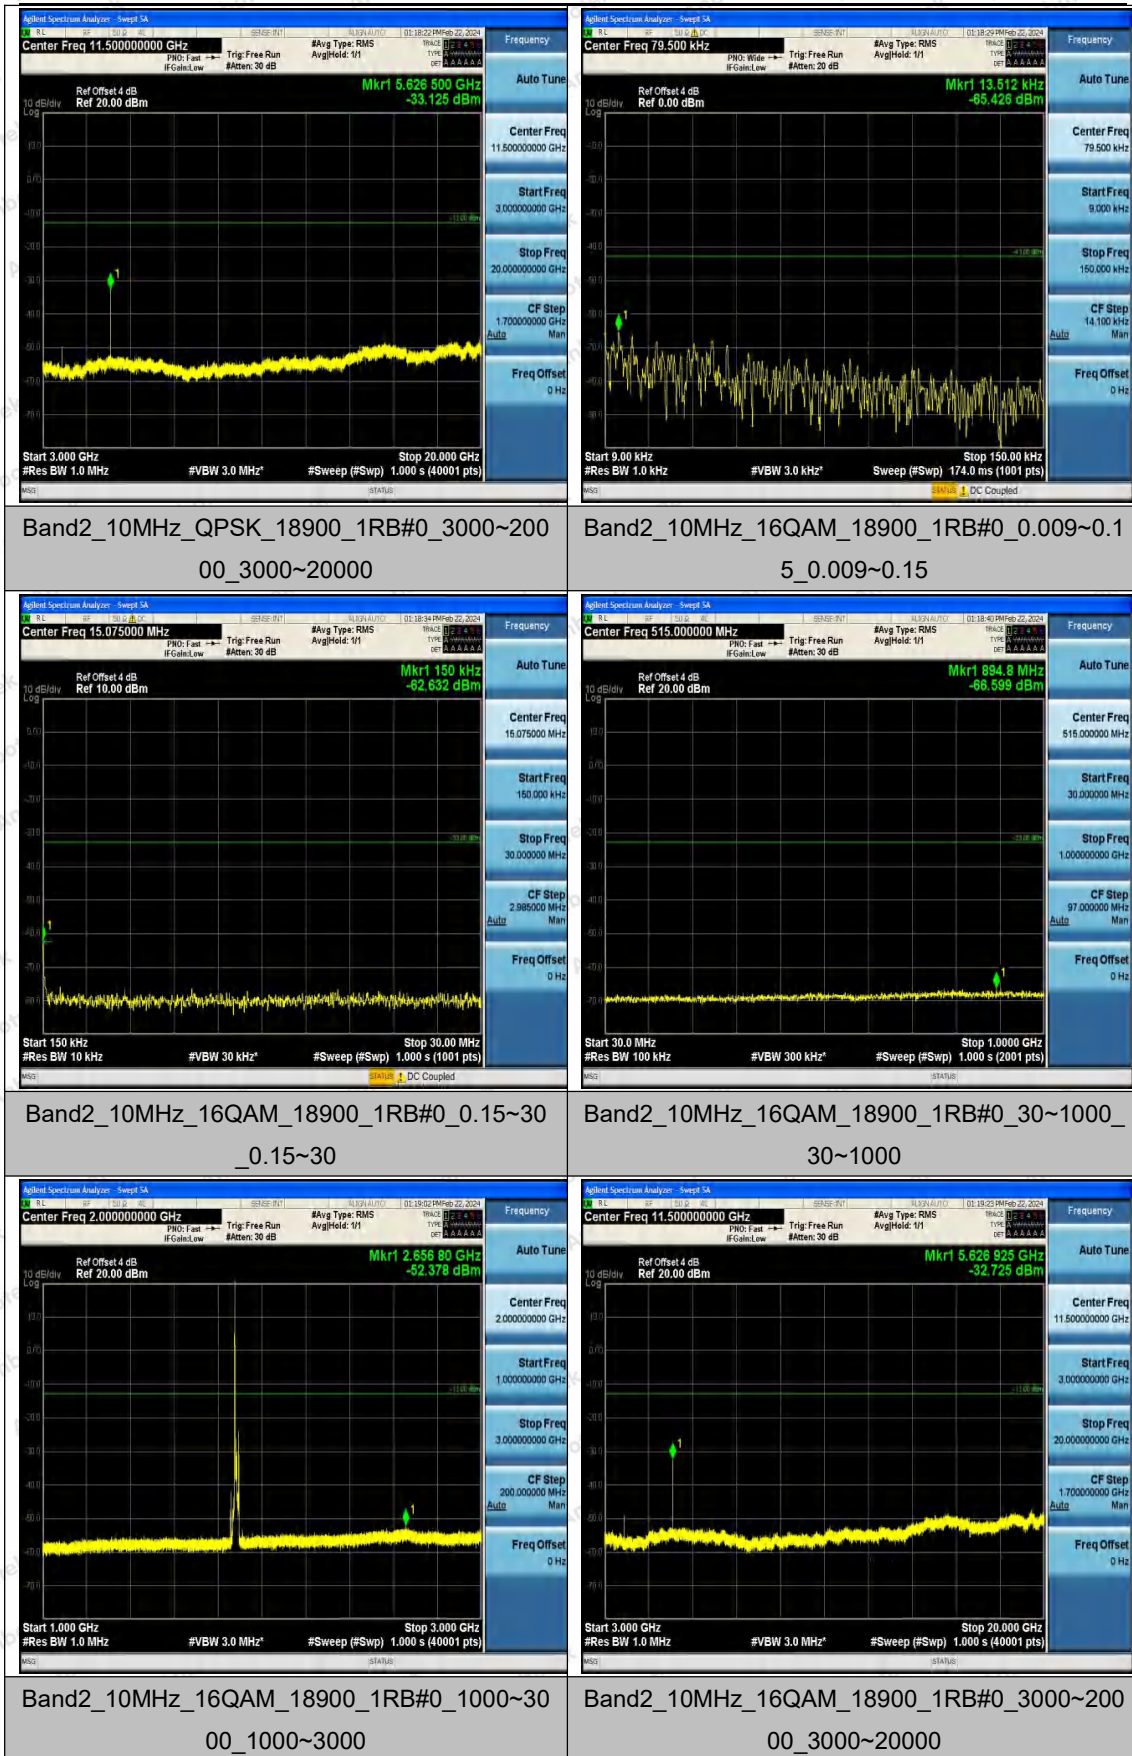


Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.
 Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com



Hotline
 400-003-0500
 www.anbotek.com.cn



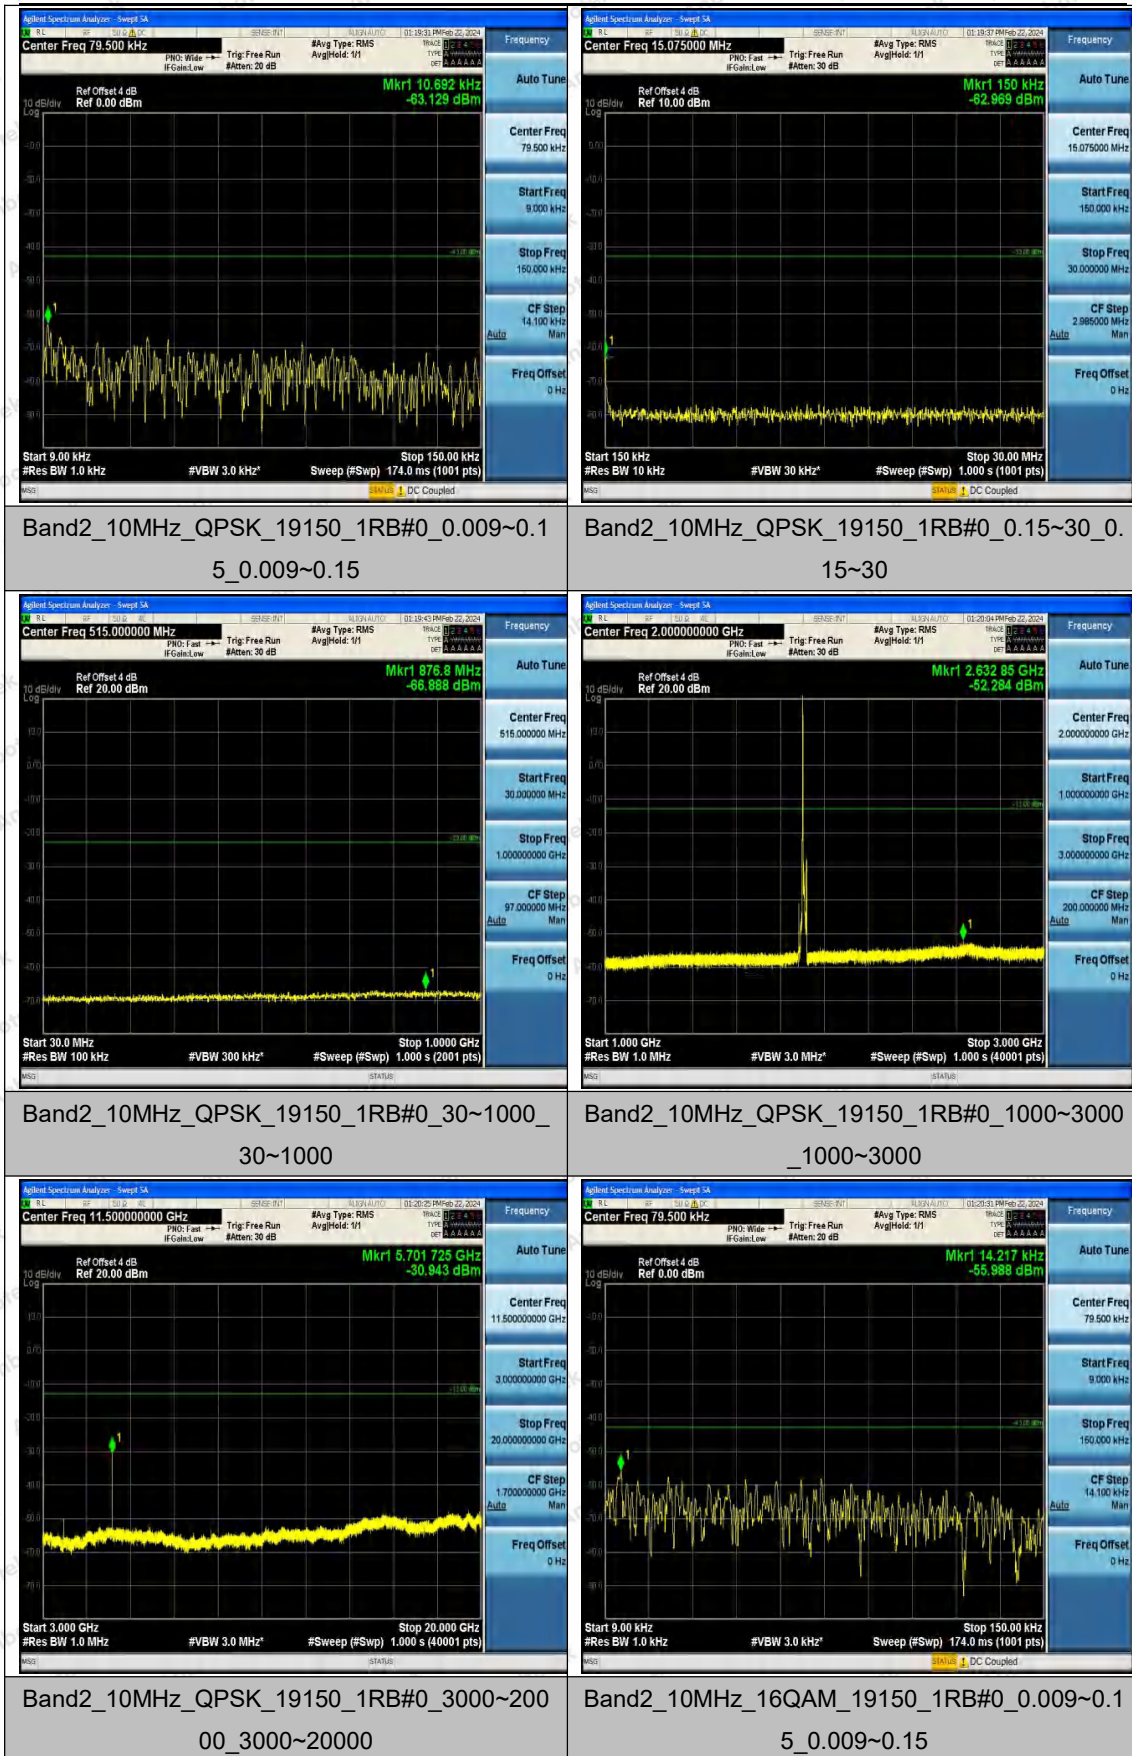


Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.
 Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com



Hotline
 400-003-0500
 www.anbotek.com.cn



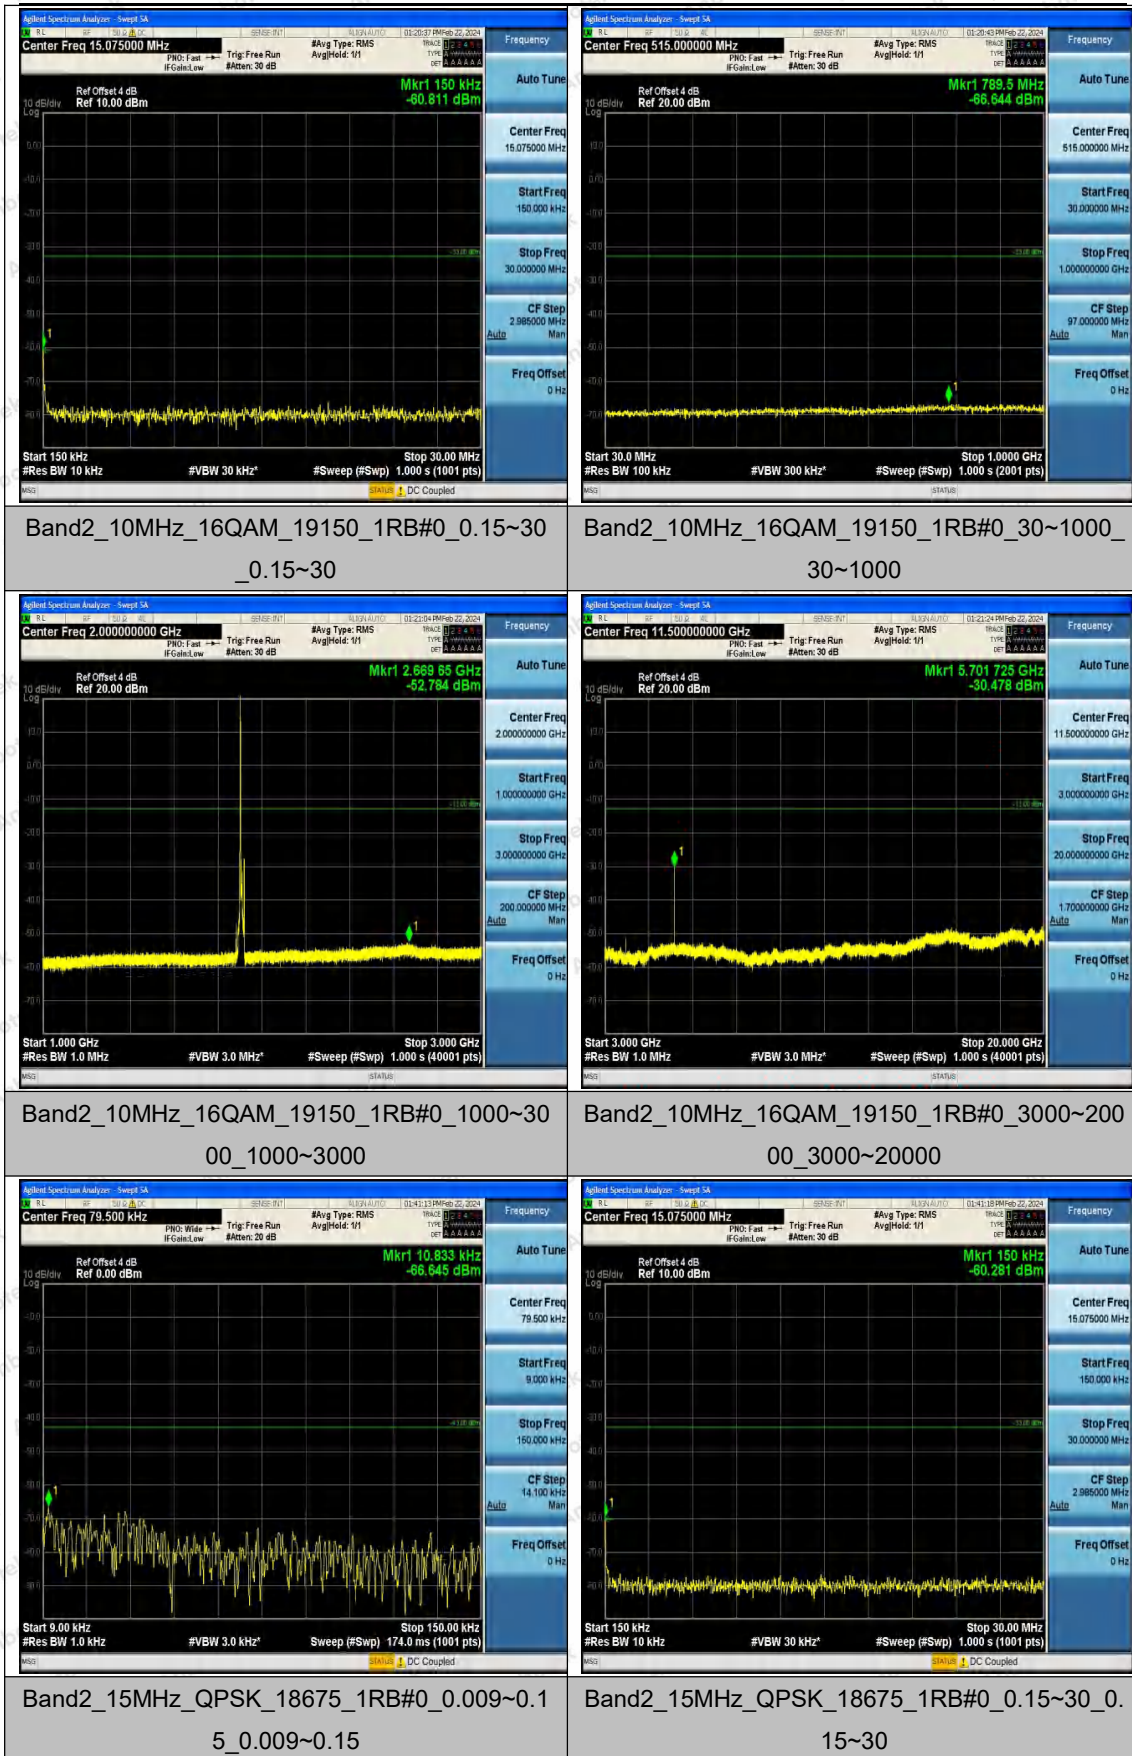


Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.
 Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com



Hotline
 400-003-0500
 www.anbotek.com.cn



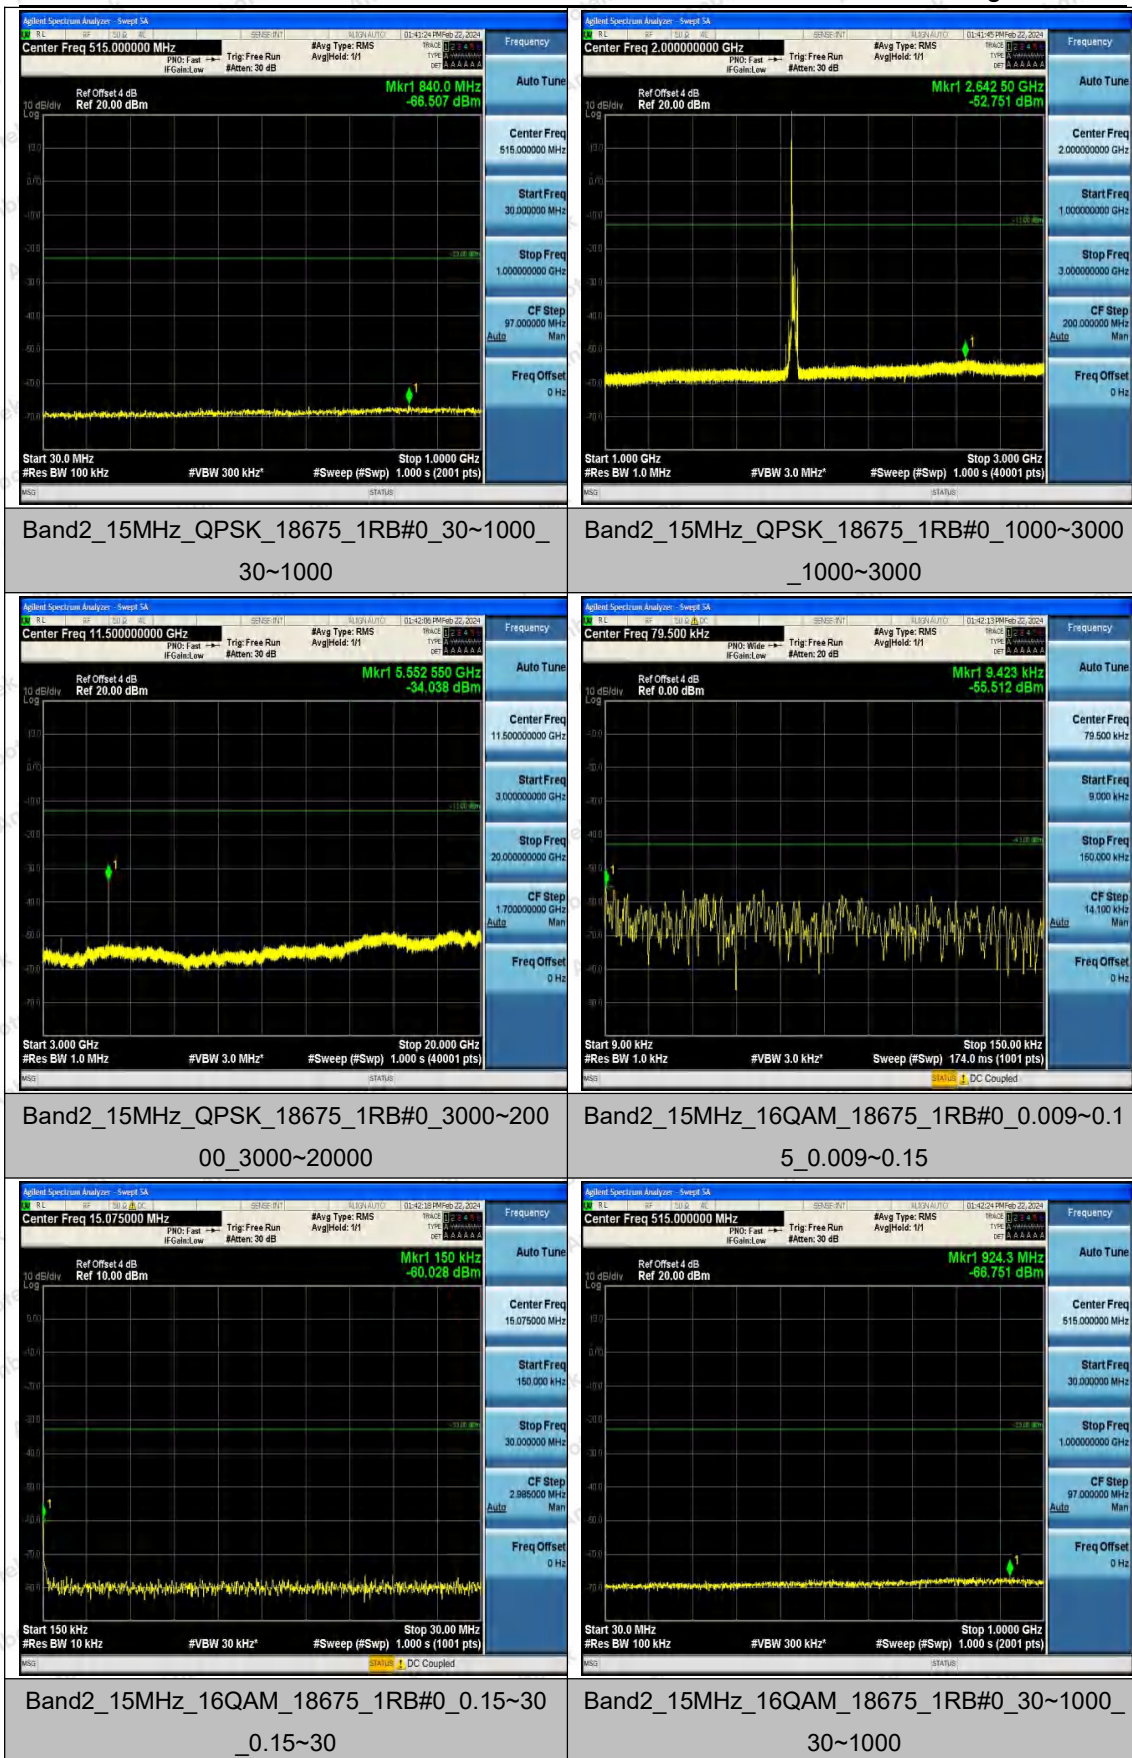


Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.
 Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com



Hotline
 400-003-0500
 www.anbotek.com.cn



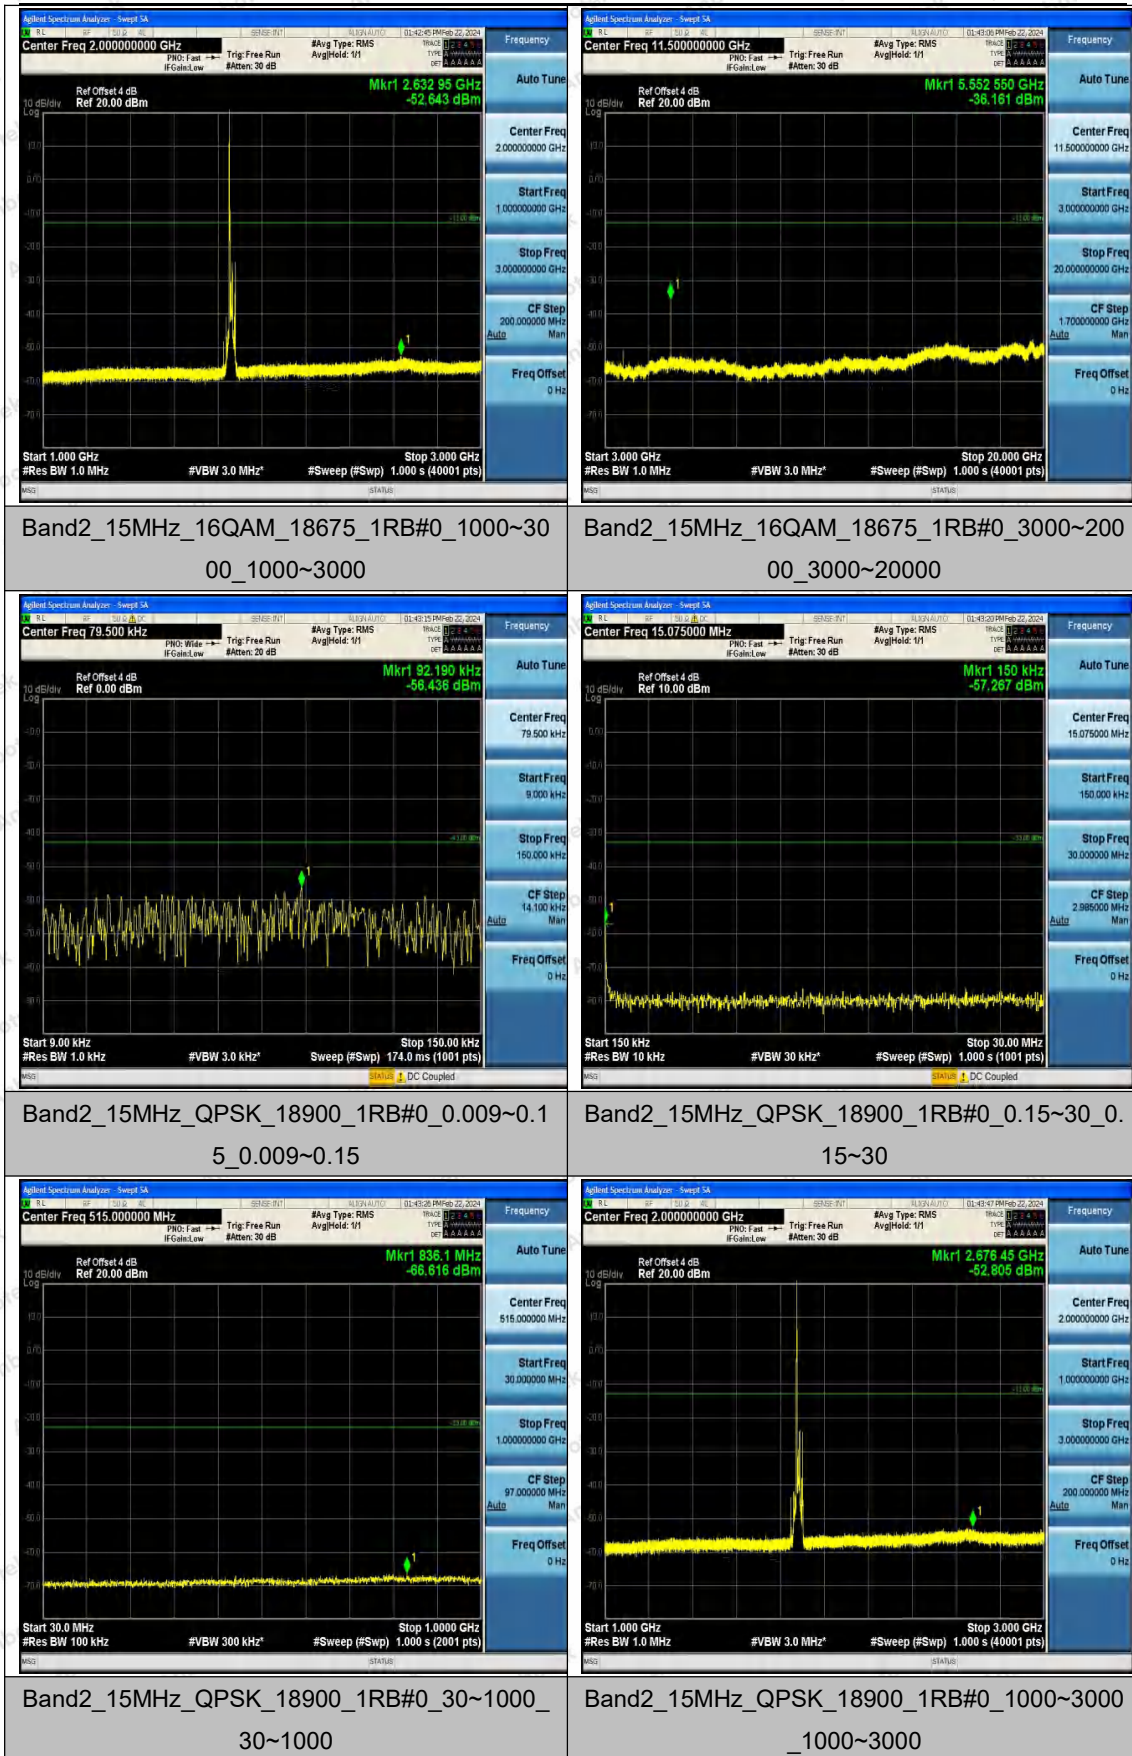


Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.
 Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com



Hotline
 400-003-0500
 www.anbotek.com.cn



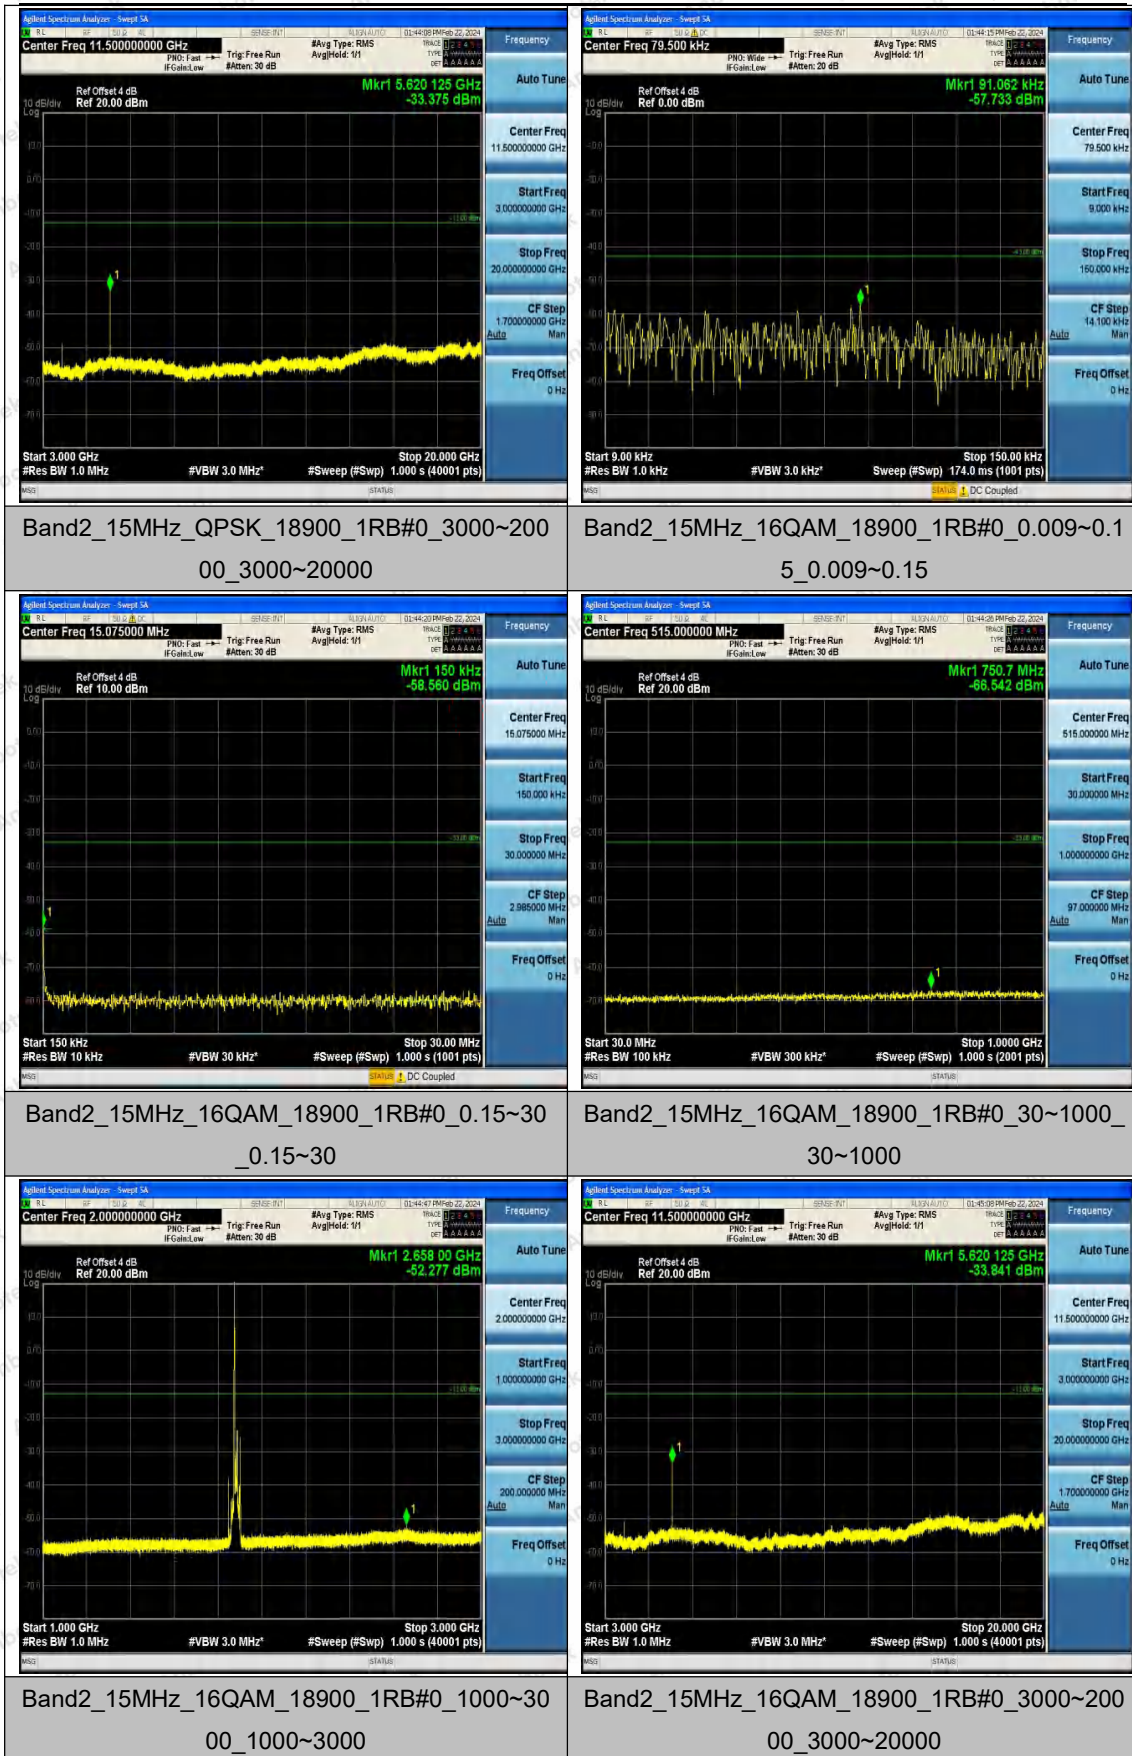


Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.
Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com



Hotline
400-003-0500
www.anbotek.com.cn



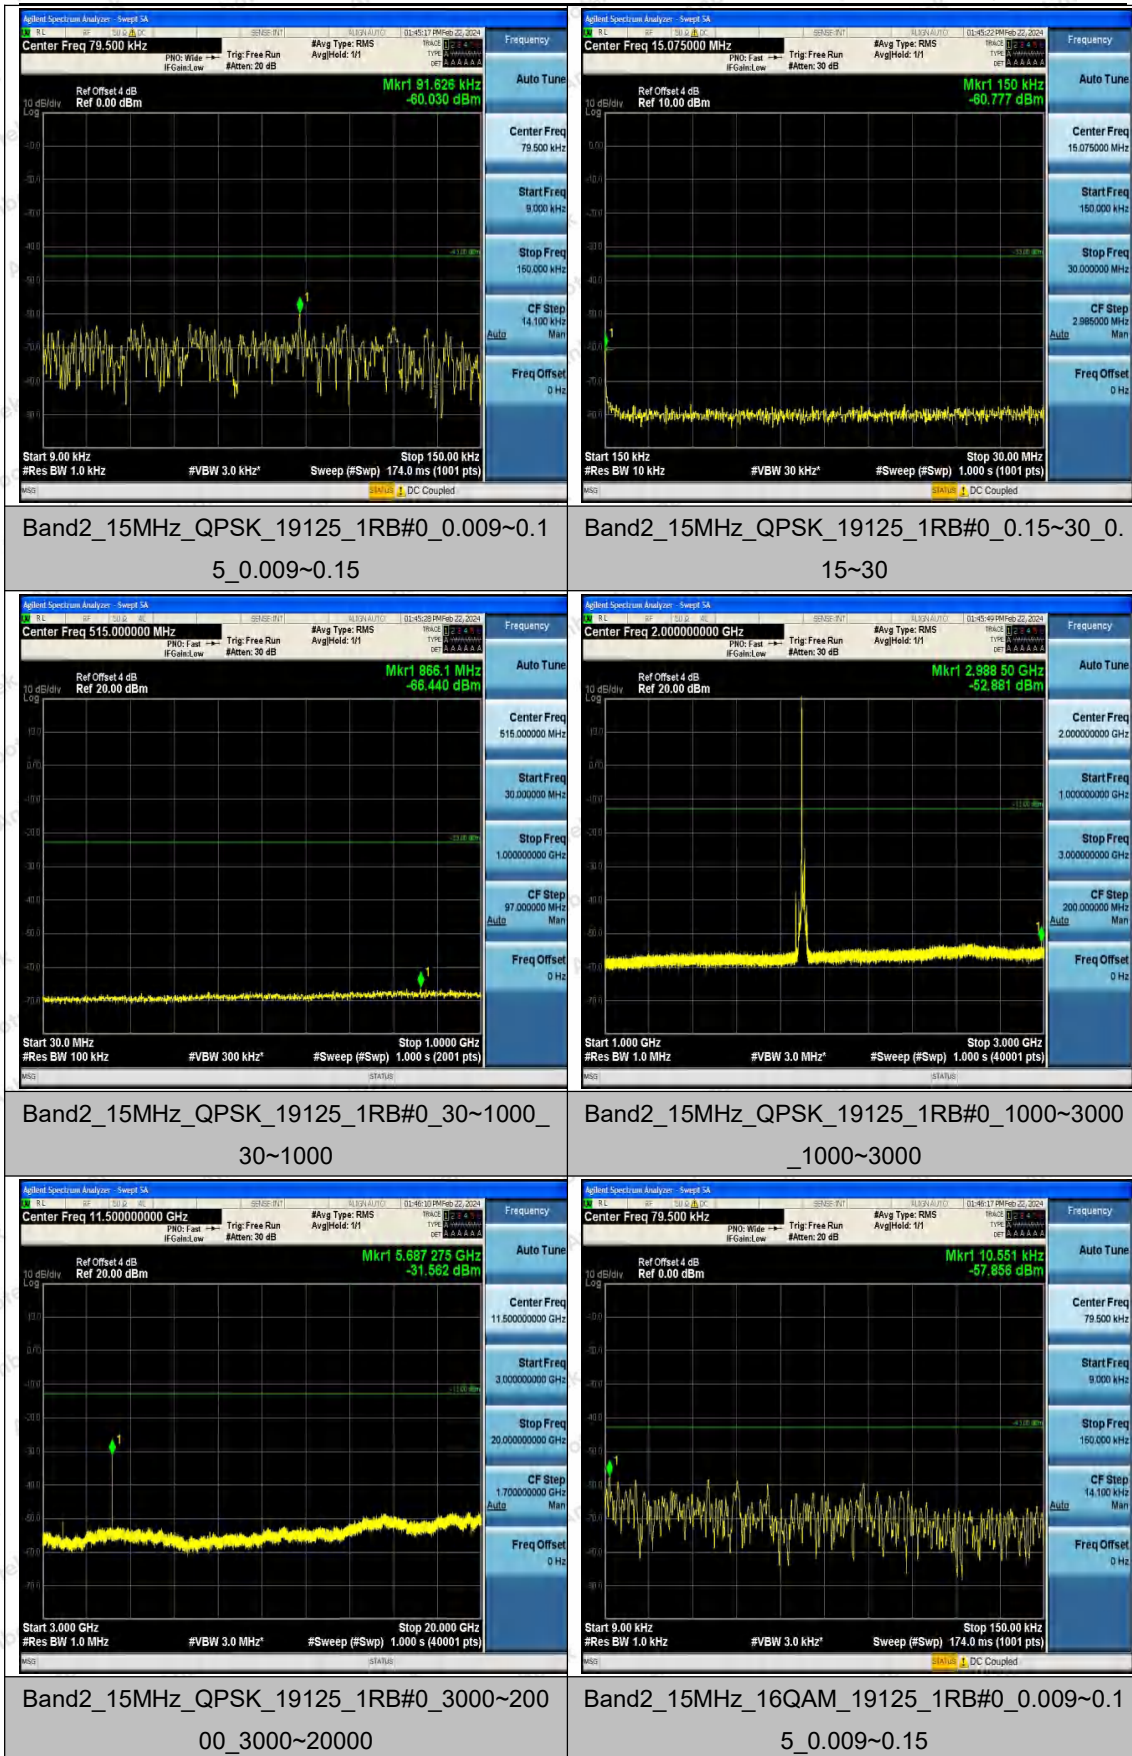


Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.
Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com



Hotline
400-003-0500
www.anbotek.com.cn



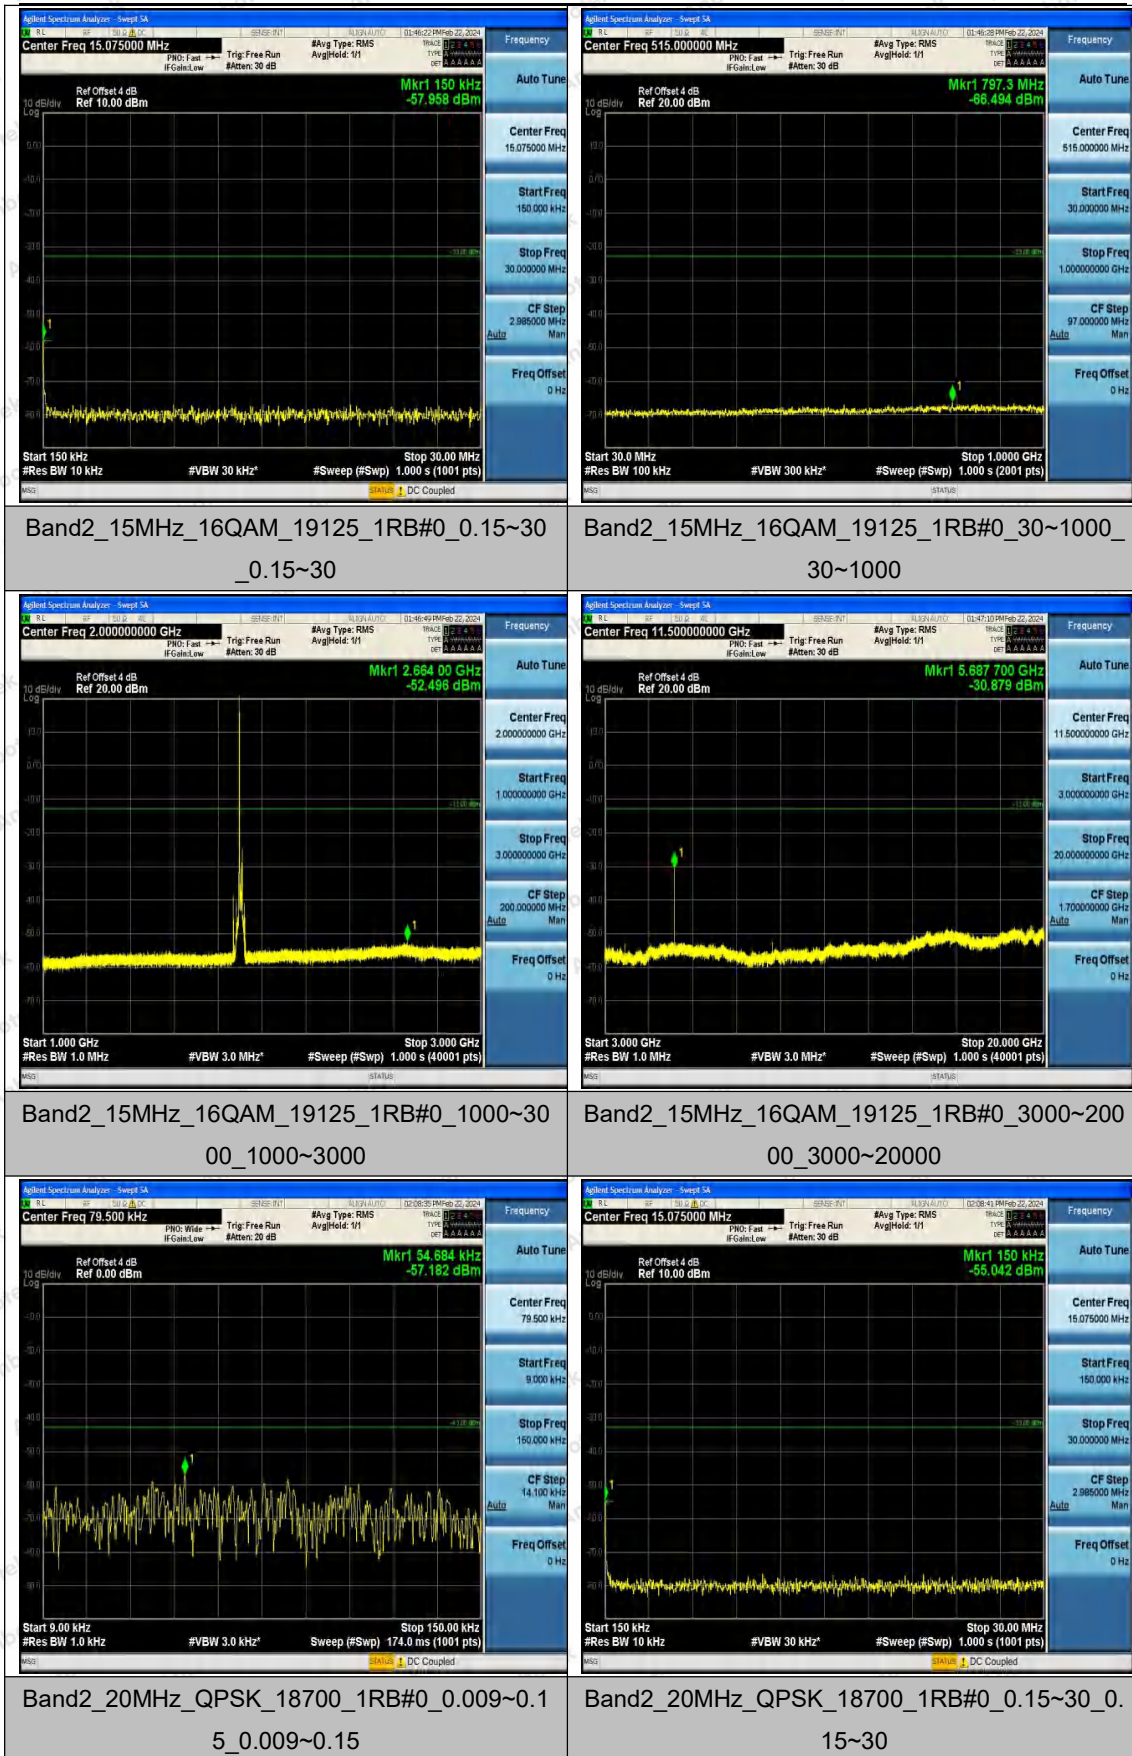


Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.
 Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com



Hotline
 400-003-0500
 www.anbotek.com.cn



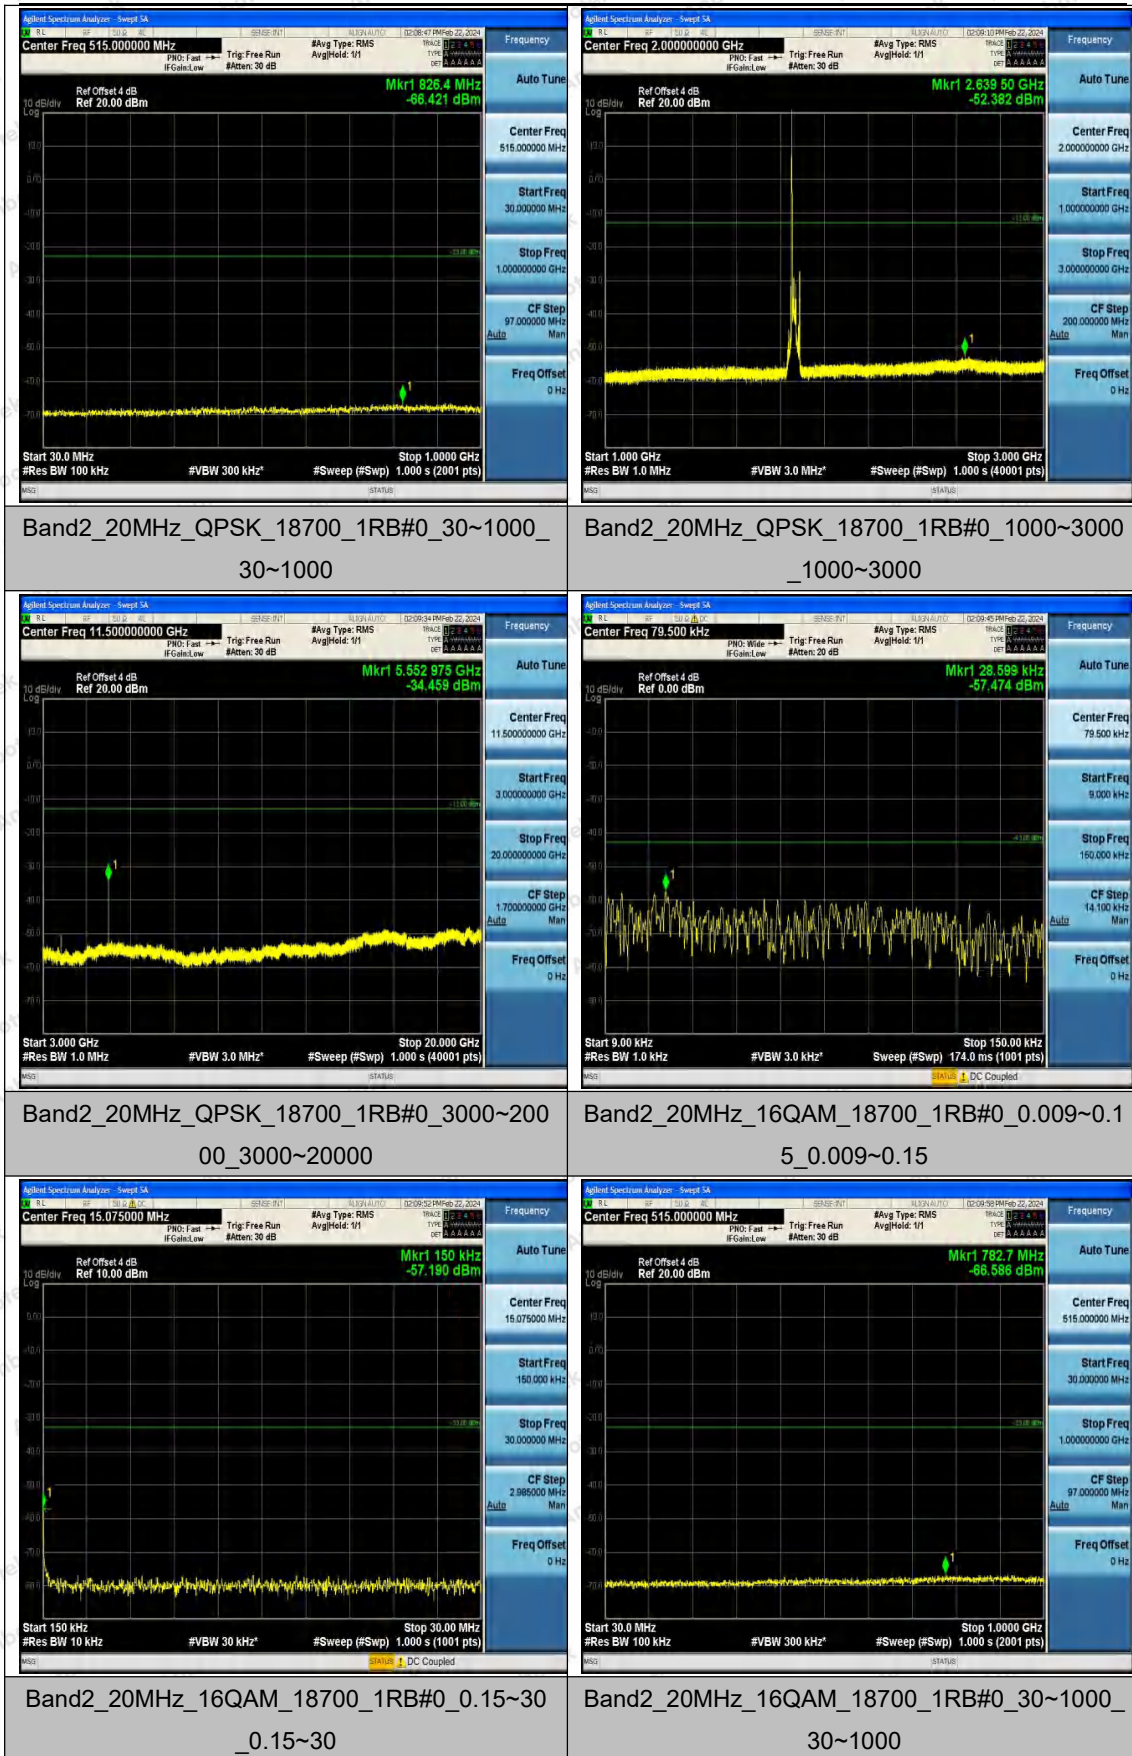


Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.
 Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com



Hotline
 400-003-0500
 www.anbotek.com.cn



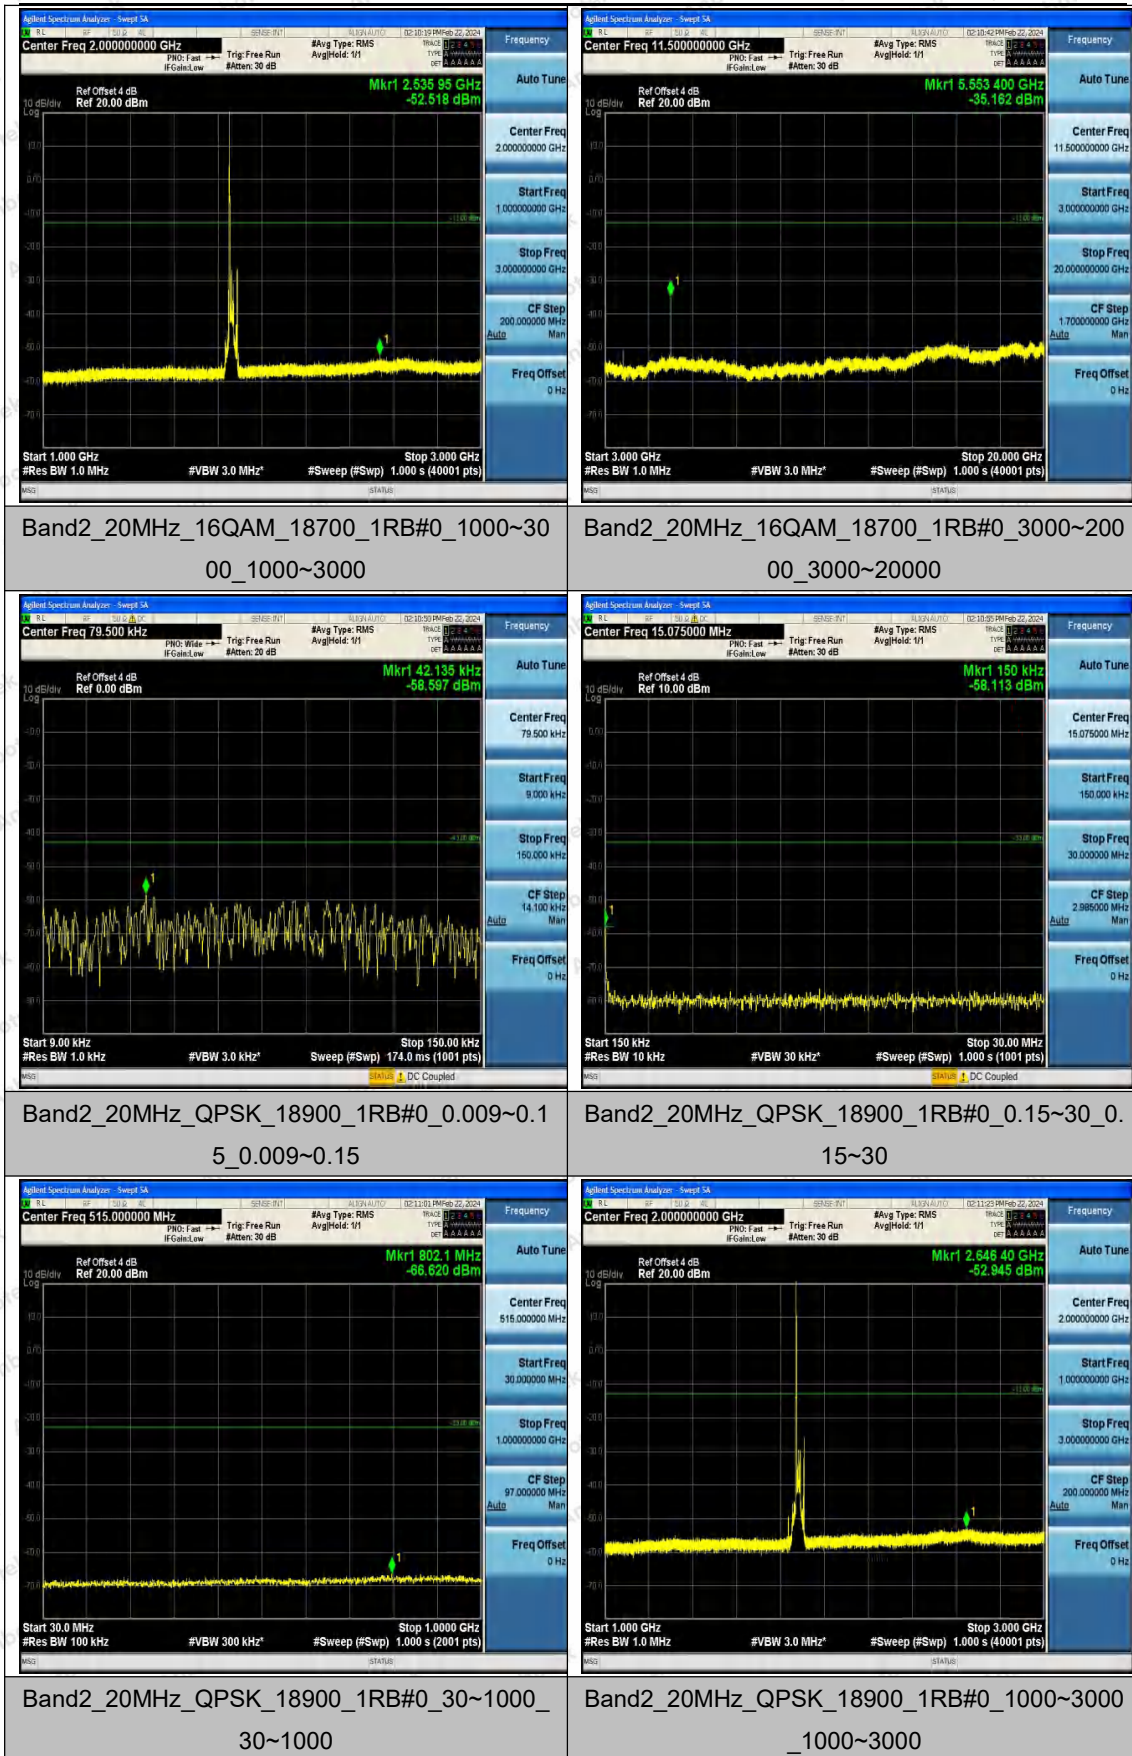


Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.
 Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com



Hotline
 400-003-0500
 www.anbotek.com.cn



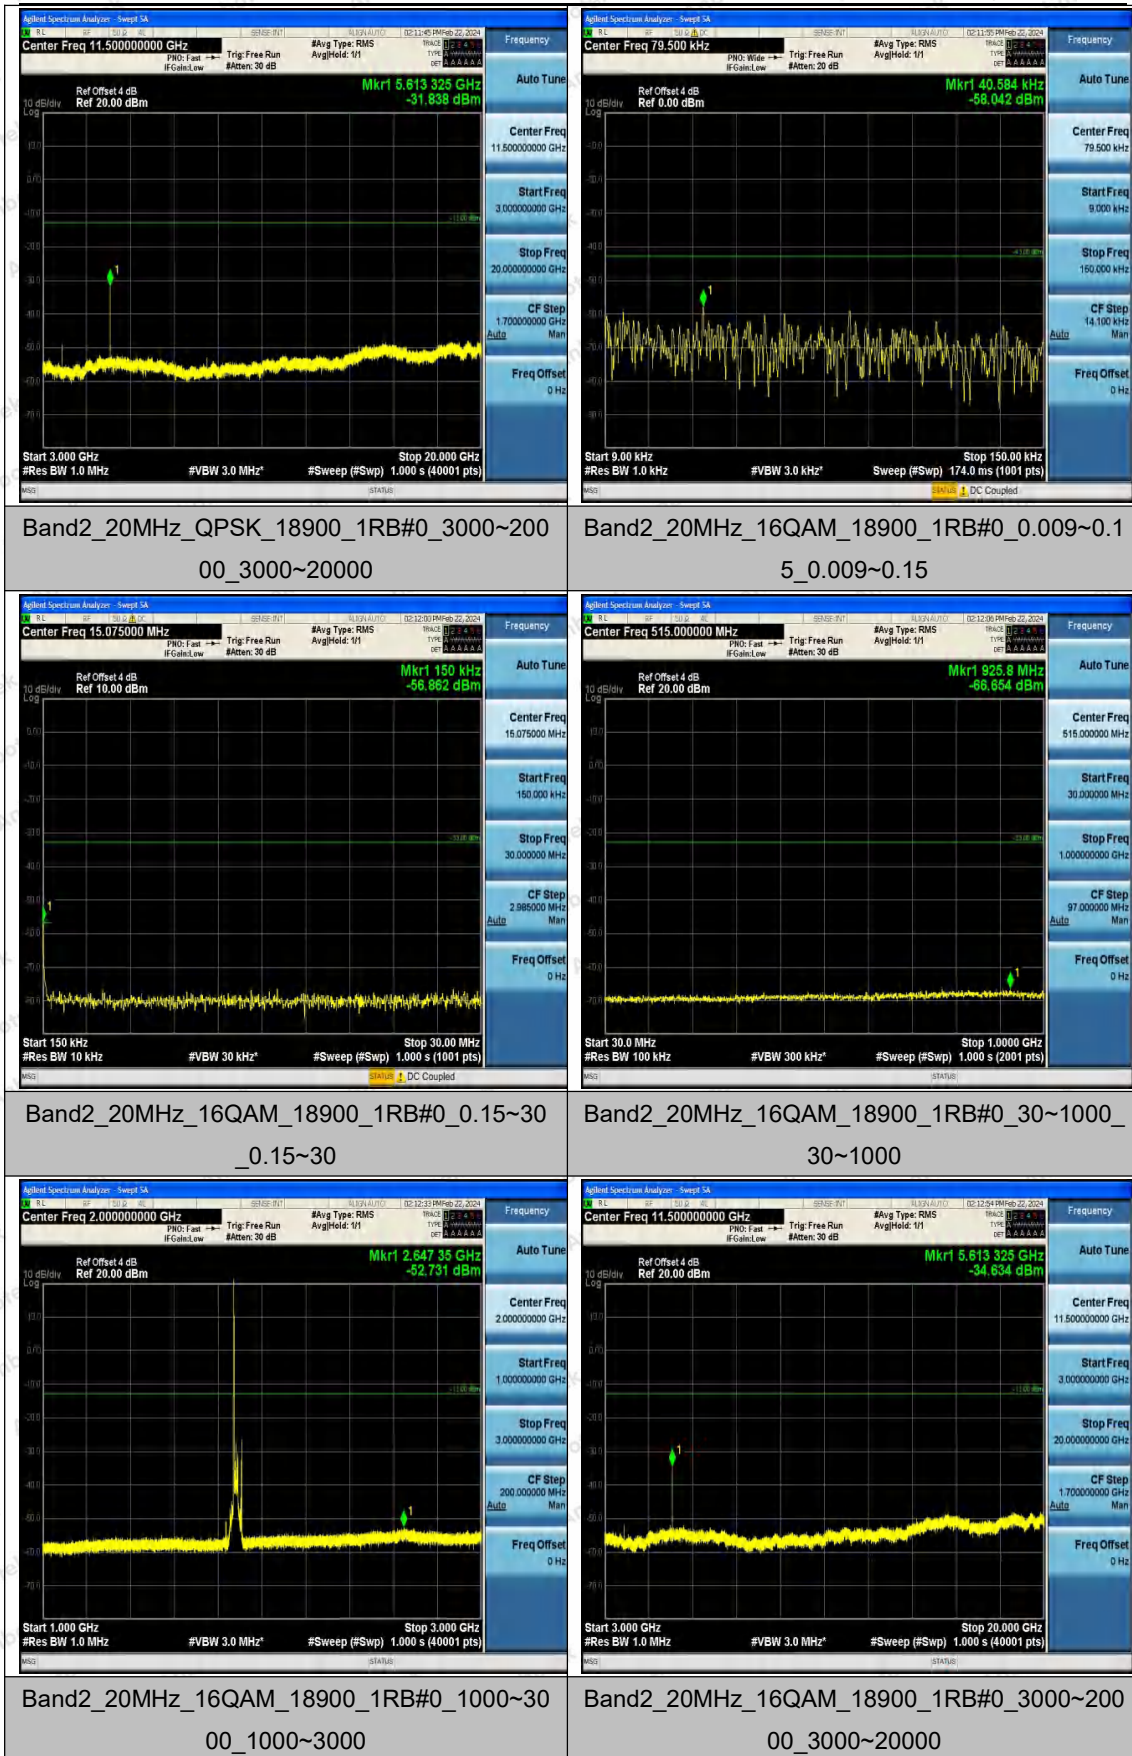


Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.
 Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com



Hotline
 400-003-0500
 www.anbotek.com.cn



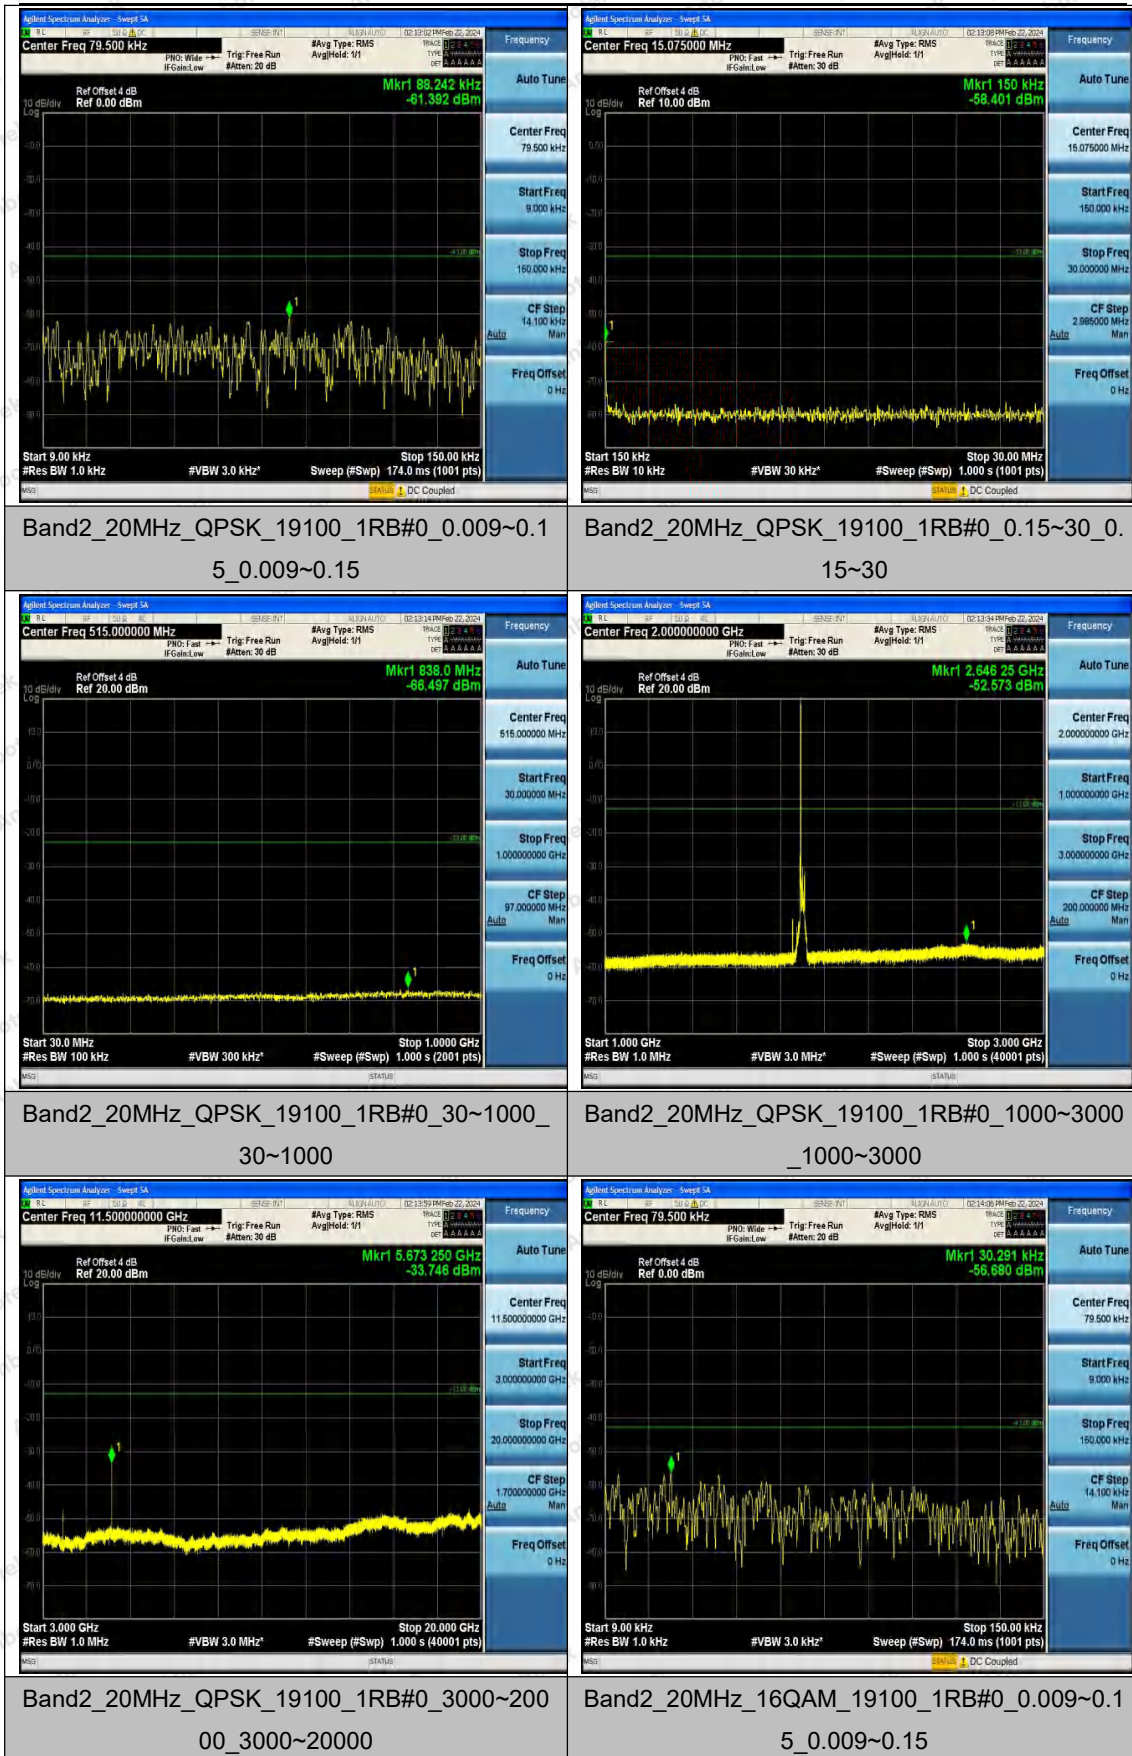


Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.
 Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com



Hotline
 400-003-0500
 www.anbotek.com.cn



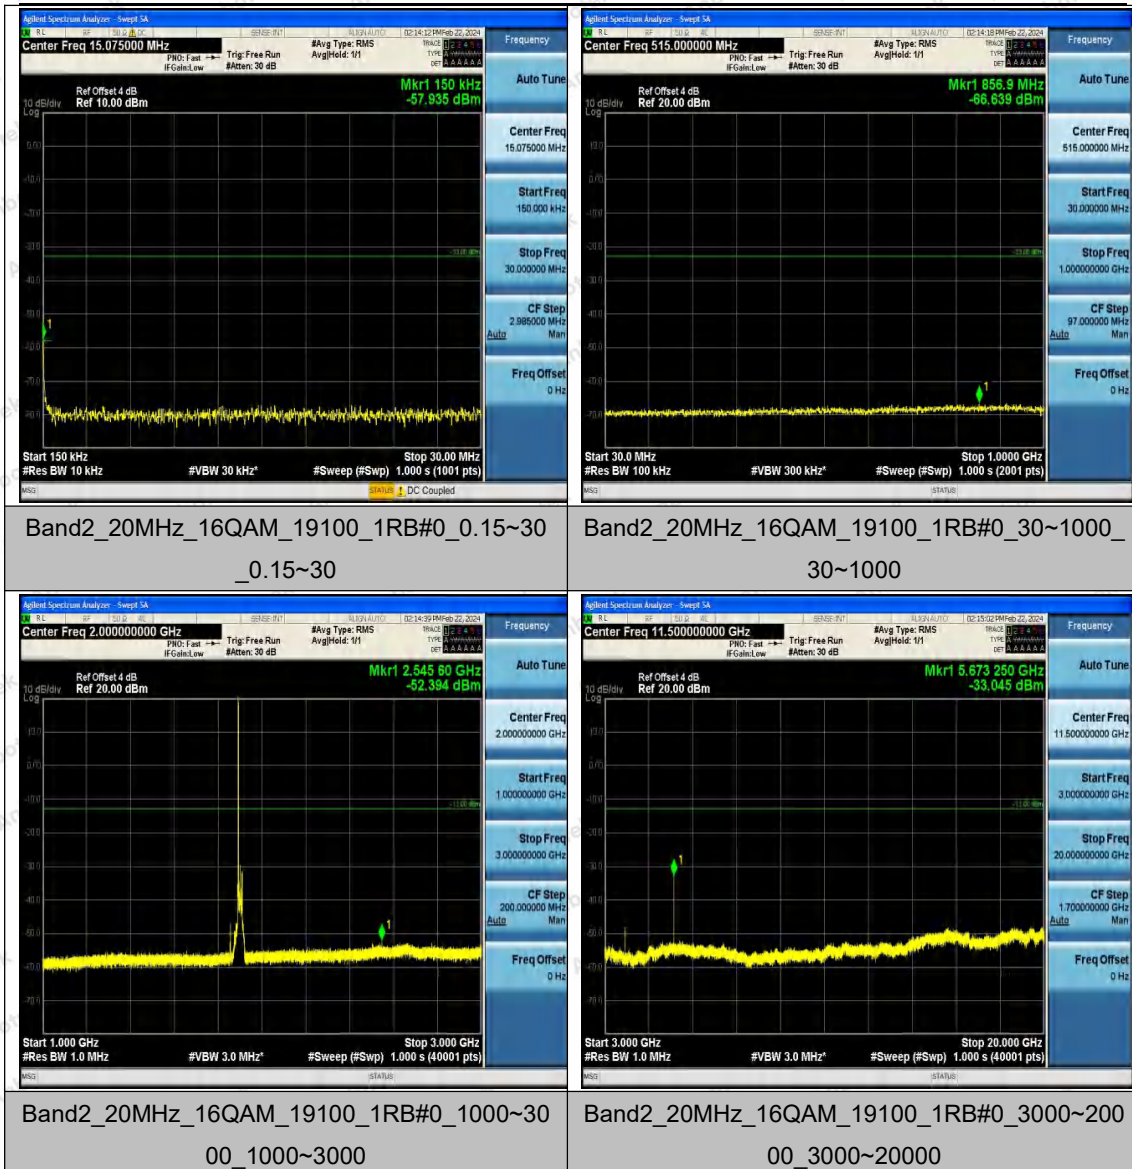

Band2_20MHz_16QAM_19100_1RB#0_0.15~30
_0.15~30

Band2_20MHz_16QAM_19100_1RB#0_30~1000_
30~1000

Band2_20MHz_16QAM_19100_1RB#0_1000~30
00_1000~3000

Band2_20MHz_16QAM_19100_1RB#0_3000~200
00_3000~20000



Appendix F: Frequency Stability

Test Result

Band	Bandwidth	Modulation	Channel	RB Configuration	Voltage		Deviation (Hz)	Deviation (ppm)	Limit (ppm)	Verdict
					Voltage [Vdc]	Temperature (°C)				
Band2	1.4MHz	QPSK	18607	6RB#0	VN	NT	-23.90	-0.012914	±2.5	PASS
Band2	1.4MHz	QPSK	18607	6RB#0	VL	NT	-4.43	-0.002394	±2.5	PASS
Band2	1.4MHz	QPSK	18607	6RB#0	VH	NT	-14.15	-0.007646	±2.5	PASS
Band2	1.4MHz	16QAM	18607	6RB#0	VN	NT	-13.73	-0.007419	±2.5	PASS
Band2	1.4MHz	16QAM	18607	6RB#0	VL	NT	-16.89	-0.009126	±2.5	PASS
Band2	1.4MHz	16QAM	18607	6RB#0	VH	NT	-16.44	-0.008883	±2.5	PASS
Band2	1.4MHz	QPSK	18900	6RB#0	VN	NT	-18.32	-0.009745	±2.5	PASS
Band2	1.4MHz	QPSK	18900	6RB#0	VL	NT	-12.73	-0.006771	±2.5	PASS
Band2	1.4MHz	QPSK	18900	6RB#0	VH	NT	-7.60	-0.004043	±2.5	PASS
Band2	1.4MHz	16QAM	18900	6RB#0	VN	NT	-14.68	-0.007809	±2.5	PASS
Band2	1.4MHz	16QAM	18900	6RB#0	VL	NT	-2.98	-0.001585	±2.5	PASS
Band2	1.4MHz	16QAM	18900	6RB#0	VH	NT	-13.18	-0.007011	±2.5	PASS
Band2	1.4MHz	QPSK	19193	6RB#0	VN	NT	-17.47	-0.009150	±2.5	PASS
Band2	1.4MHz	QPSK	19193	6RB#0	VL	NT	-12.09	-0.006332	±2.5	PASS
Band2	1.4MHz	QPSK	19193	6RB#0	VH	NT	-10.34	-0.005416	±2.5	PASS
Band2	1.4MHz	16QAM	19193	6RB#0	VN	NT	-9.86	-0.005164	±2.5	PASS
Band2	1.4MHz	16QAM	19193	6RB#0	VL	NT	-12.85	-0.006730	±2.5	PASS
Band2	1.4MHz	16QAM	19193	6RB#0	VH	NT	-10.21	-0.005348	±2.5	PASS
Band2	3MHz	QPSK	18615	15RB#0	VN	NT	-5.16	-0.002787	±2.5	PASS
Band2	3MHz	QPSK	18615	15RB#0	VL	NT	-10.56	-0.005703	±2.5	PASS
Band2	3MHz	QPSK	18615	15RB#0	VH	NT	-4.66	-0.002517	±2.5	PASS
Band2	3MHz	16QAM	18615	15RB#0	VN	NT	-4.48	-0.002420	±2.5	PASS
Band2	3MHz	16QAM	18615	15RB#0	VL	NT	-6.49	-0.003505	±2.5	PASS
Band2	3MHz	16QAM	18615	15RB#0	VH	NT	-17.12	-0.009247	±2.5	PASS
Band2	3MHz	QPSK	18900	15RB#0	VN	NT	13.60	0.007234	±2.5	PASS
Band2	3MHz	QPSK	18900	15RB#0	VL	NT	-15.01	-0.007984	±2.5	PASS
Band2	3MHz	QPSK	18900	15RB#0	VH	NT	-15.51	-0.008250	±2.5	PASS
Band2	3MHz	16QAM	18900	15RB#0	VN	NT	-12.97	-0.006899	±2.5	PASS
Band2	3MHz	16QAM	18900	15RB#0	VL	NT	-12.26	-0.006521	±2.5	PASS
Band2	3MHz	16QAM	18900	15RB#0	VH	NT	-9.68	-0.005149	±2.5	PASS
Band2	3MHz	QPSK	19185	15RB#0	VN	NT	-14.25	-0.007467	±2.5	PASS
Band2	3MHz	QPSK	19185	15RB#0	VL	NT	-17.88	-0.009369	±2.5	PASS
Band2	3MHz	QPSK	19185	15RB#0	VH	NT	-12.49	-0.006544	±2.5	PASS
Band2	3MHz	16QAM	19185	15RB#0	VN	NT	5.46	0.002861	±2.5	PASS
Band2	3MHz	16QAM	19185	15RB#0	VL	NT	-3.09	-0.001619	±2.5	PASS

Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.
Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com



Hotline
400-003-0500
www.anbotek.com.cn



Band2	3MHz	16QAM	19185	15RB#0	VH	NT	-21.60	-0.011318	±2.5	PASS
Band2	5MHz	QPSK	18625	25RB#0	VN	NT	-16.92	-0.009134	±2.5	PASS
Band2	5MHz	QPSK	18625	25RB#0	VL	NT	-21.03	-0.011352	±2.5	PASS
Band2	5MHz	QPSK	18625	25RB#0	VH	NT	4.89	0.002640	±2.5	PASS
Band2	5MHz	16QAM	18625	25RB#0	VN	NT	-8.84	-0.004772	±2.5	PASS
Band2	5MHz	16QAM	18625	25RB#0	VL	NT	-16.87	-0.009107	±2.5	PASS
Band2	5MHz	16QAM	18625	25RB#0	VH	NT	-15.86	-0.008561	±2.5	PASS
Band2	5MHz	QPSK	18900	25RB#0	VN	NT	-14.68	-0.007809	±2.5	PASS
Band2	5MHz	QPSK	18900	25RB#0	VL	NT	-22.32	-0.011872	±2.5	PASS
Band2	5MHz	QPSK	18900	25RB#0	VH	NT	-20.74	-0.011032	±2.5	PASS
Band2	5MHz	16QAM	18900	25RB#0	VN	NT	-3.26	-0.001734	±2.5	PASS
Band2	5MHz	16QAM	18900	25RB#0	VL	NT	-8.27	-0.004399	±2.5	PASS
Band2	5MHz	16QAM	18900	25RB#0	VH	NT	-10.37	-0.005516	±2.5	PASS
Band2	5MHz	QPSK	19175	25RB#0	VN	NT	-14.73	-0.007722	±2.5	PASS
Band2	5MHz	QPSK	19175	25RB#0	VL	NT	-8.80	-0.004613	±2.5	PASS
Band2	5MHz	QPSK	19175	25RB#0	VH	NT	3.12	0.001636	±2.5	PASS
Band2	5MHz	16QAM	19175	25RB#0	VN	NT	-15.13	-0.007932	±2.5	PASS
Band2	5MHz	16QAM	19175	25RB#0	VL	NT	-19.30	-0.010118	±2.5	PASS
Band2	5MHz	16QAM	19175	25RB#0	VH	NT	-10.89	-0.005709	±2.5	PASS
Band2	10MHz	QPSK	18650	50RB#0	VN	NT	-13.82	-0.007450	±2.5	PASS
Band2	10MHz	QPSK	18650	50RB#0	VL	NT	-9.74	-0.005251	±2.5	PASS
Band2	10MHz	QPSK	18650	50RB#0	VH	NT	-11.93	-0.006431	±2.5	PASS
Band2	10MHz	16QAM	18650	50RB#0	VN	NT	-5.16	-0.002782	±2.5	PASS
Band2	10MHz	16QAM	18650	50RB#0	VL	NT	-9.38	-0.005057	±2.5	PASS
Band2	10MHz	16QAM	18650	50RB#0	VH	NT	-11.01	-0.005935	±2.5	PASS
Band2	10MHz	QPSK	18900	50RB#0	VN	NT	4.33	0.002303	±2.5	PASS
Band2	10MHz	QPSK	18900	50RB#0	VL	NT	-14.13	-0.007516	±2.5	PASS
Band2	10MHz	QPSK	18900	50RB#0	VH	NT	-10.97	-0.005835	±2.5	PASS
Band2	10MHz	16QAM	18900	50RB#0	VN	NT	-18.91	-0.010059	±2.5	PASS
Band2	10MHz	16QAM	18900	50RB#0	VL	NT	-9.76	-0.005191	±2.5	PASS
Band2	10MHz	16QAM	18900	50RB#0	VH	NT	-15.65	-0.008324	±2.5	PASS
Band2	10MHz	QPSK	19150	50RB#0	VN	NT	-17.18	-0.009018	±2.5	PASS
Band2	10MHz	QPSK	19150	50RB#0	VL	NT	-17.91	-0.009402	±2.5	PASS
Band2	10MHz	QPSK	19150	50RB#0	VH	NT	-16.39	-0.008604	±2.5	PASS
Band2	10MHz	16QAM	19150	50RB#0	VN	NT	-11.82	-0.006205	±2.5	PASS
Band2	10MHz	16QAM	19150	50RB#0	VL	NT	-6.28	-0.003297	±2.5	PASS
Band2	10MHz	16QAM	19150	50RB#0	VH	NT	-11.57	-0.006073	±2.5	PASS
Band2	15MHz	QPSK	18675	75RB#0	VN	NT	-11.92	-0.006417	±2.5	PASS
Band2	15MHz	QPSK	18675	75RB#0	VL	NT	6.95	0.003742	±2.5	PASS
Band2	15MHz	QPSK	18675	75RB#0	VH	NT	-11.86	-0.006385	±2.5	PASS
Band2	15MHz	16QAM	18675	75RB#0	VN	NT	-10.99	-0.005917	±2.5	PASS

Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community,
 Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.
 Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com



Hotline
 400-003-0500
 www.anbotek.com.cn



Band2	15MHz	16QAM	18675	75RB#0	VL	NT	5.18	0.002789	±2.5	PASS
Band2	15MHz	16QAM	18675	75RB#0	VH	NT	4.19	0.002256	±2.5	PASS
Band2	15MHz	QPSK	18900	75RB#0	VN	NT	-20.47	-0.010888	±2.5	PASS
Band2	15MHz	QPSK	18900	75RB#0	VL	NT	-18.31	-0.009739	±2.5	PASS
Band2	15MHz	QPSK	18900	75RB#0	VH	NT	-15.82	-0.008415	±2.5	PASS
Band2	15MHz	16QAM	18900	75RB#0	VN	NT	-16.42	-0.008734	±2.5	PASS
Band2	15MHz	16QAM	18900	75RB#0	VL	NT	-15.44	-0.008213	±2.5	PASS
Band2	15MHz	16QAM	18900	75RB#0	VH	NT	-16.81	-0.008941	±2.5	PASS
Band2	15MHz	QPSK	19125	75RB#0	VN	NT	-11.59	-0.006092	±2.5	PASS
Band2	15MHz	QPSK	19125	75RB#0	VL	NT	-12.60	-0.006623	±2.5	PASS
Band2	15MHz	QPSK	19125	75RB#0	VH	NT	-19.56	-0.010281	±2.5	PASS
Band2	15MHz	16QAM	19125	75RB#0	VN	NT	-17.32	-0.009104	±2.5	PASS
Band2	15MHz	16QAM	19125	75RB#0	VL	NT	-11.47	-0.006029	±2.5	PASS
Band2	15MHz	16QAM	19125	75RB#0	VH	NT	-19.25	-0.010118	±2.5	PASS
Band2	20MHz	QPSK	18700	100RB#0	VN	NT	-13.33	-0.007167	±2.5	PASS
Band2	20MHz	QPSK	18700	100RB#0	VL	NT	-10.26	-0.005516	±2.5	PASS
Band2	20MHz	QPSK	18700	100RB#0	VH	NT	5.64	0.003032	±2.5	PASS
Band2	20MHz	16QAM	18700	100RB#0	VN	NT	-10.53	-0.005661	±2.5	PASS
Band2	20MHz	16QAM	18700	100RB#0	VL	NT	-3.58	-0.001925	±2.5	PASS
Band2	20MHz	16QAM	18700	100RB#0	VH	NT	-12.02	-0.006462	±2.5	PASS
Band2	20MHz	QPSK	18900	100RB#0	VN	NT	-10.80	-0.005745	±2.5	PASS
Band2	20MHz	QPSK	18900	100RB#0	VL	NT	-7.40	-0.003936	±2.5	PASS
Band2	20MHz	QPSK	18900	100RB#0	VH	NT	-10.61	-0.005644	±2.5	PASS
Band2	20MHz	16QAM	18900	100RB#0	VN	NT	-9.50	-0.005053	±2.5	PASS
Band2	20MHz	16QAM	18900	100RB#0	VL	NT	-11.79	-0.006271	±2.5	PASS
Band2	20MHz	16QAM	18900	100RB#0	VH	NT	-13.88	-0.007383	±2.5	PASS
Band2	20MHz	QPSK	19100	100RB#0	VN	NT	-14.98	-0.007884	±2.5	PASS
Band2	20MHz	QPSK	19100	100RB#0	VL	NT	-14.42	-0.007589	±2.5	PASS
Band2	20MHz	QPSK	19100	100RB#0	VH	NT	-14.83	-0.007805	±2.5	PASS
Band2	20MHz	16QAM	19100	100RB#0	VN	NT	-19.97	-0.010511	±2.5	PASS
Band2	20MHz	16QAM	19100	100RB#0	VL	NT	-19.25	-0.010132	±2.5	PASS
Band2	20MHz	16QAM	19100	100RB#0	VH	NT	-17.05	-0.008974	±2.5	PASS

Temperature										
Band	Bandwidth	Modulation	Channel	RB Configuration	Voltage [Vdc]	Temperature (°C)	Deviation (Hz)	Deviation (ppm)	Limit (ppm)	Verdict
Band2	1.4MHz	QPSK	18607	6RB#0	NV	-30	-8.98	-0.004852	±2.5	PASS
Band2	1.4MHz	QPSK	18607	6RB#0	NV	-20	-12.85	-0.006943	±2.5	PASS
Band2	1.4MHz	QPSK	18607	6RB#0	NV	-10	-11.79	-0.006371	±2.5	PASS
Band2	1.4MHz	QPSK	18607	6RB#0	NV	0	-10.77	-0.005819	±2.5	PASS
Band2	1.4MHz	QPSK	18607	6RB#0	NV	10	-13.70	-0.007403	±2.5	PASS



Band2	1.4MHz	QPSK	18607	6RB#0	NV	20	-12.03	-0.006500	±2.5	PASS
Band2	1.4MHz	QPSK	18607	6RB#0	NV	30	-8.78	-0.004744	±2.5	PASS
Band2	1.4MHz	QPSK	18607	6RB#0	NV	40	-11.24	-0.006073	±2.5	PASS
Band2	1.4MHz	QPSK	18607	6RB#0	NV	50	-7.04	-0.003804	±2.5	PASS
Band2	1.4MHz	16QAM	18607	6RB#0	NV	-30	-16.25	-0.008780	±2.5	PASS
Band2	1.4MHz	16QAM	18607	6RB#0	NV	-20	-19.76	-0.010677	±2.5	PASS
Band2	1.4MHz	16QAM	18607	6RB#0	NV	-10	-13.93	-0.007527	±2.5	PASS
Band2	1.4MHz	16QAM	18607	6RB#0	NV	0	-13.29	-0.007181	±2.5	PASS
Band2	1.4MHz	16QAM	18607	6RB#0	NV	10	-9.17	-0.004955	±2.5	PASS
Band2	1.4MHz	16QAM	18607	6RB#0	NV	20	-7.62	-0.004117	±2.5	PASS
Band2	1.4MHz	16QAM	18607	6RB#0	NV	30	-14.28	-0.007716	±2.5	PASS
Band2	1.4MHz	16QAM	18607	6RB#0	NV	40	-15.54	-0.008397	±2.5	PASS
Band2	1.4MHz	16QAM	18607	6RB#0	NV	50	-11.46	-0.006192	±2.5	PASS
Band2	1.4MHz	QPSK	18900	6RB#0	NV	-30	-3.85	-0.002048	±2.5	PASS
Band2	1.4MHz	QPSK	18900	6RB#0	NV	-20	-12.15	-0.006463	±2.5	PASS
Band2	1.4MHz	QPSK	18900	6RB#0	NV	-10	-16.04	-0.008532	±2.5	PASS
Band2	1.4MHz	QPSK	18900	6RB#0	NV	0	-12.95	-0.006888	±2.5	PASS
Band2	1.4MHz	QPSK	18900	6RB#0	NV	10	-13.22	-0.007032	±2.5	PASS
Band2	1.4MHz	QPSK	18900	6RB#0	NV	20	-7.32	-0.003894	±2.5	PASS
Band2	1.4MHz	QPSK	18900	6RB#0	NV	30	-9.80	-0.005213	±2.5	PASS
Band2	1.4MHz	QPSK	18900	6RB#0	NV	40	-14.61	-0.007771	±2.5	PASS
Band2	1.4MHz	QPSK	18900	6RB#0	NV	50	-15.28	-0.008128	±2.5	PASS
Band2	1.4MHz	16QAM	18900	6RB#0	NV	-30	-15.94	-0.008479	±2.5	PASS
Band2	1.4MHz	16QAM	18900	6RB#0	NV	-20	-17.47	-0.009293	±2.5	PASS
Band2	1.4MHz	16QAM	18900	6RB#0	NV	-10	-12.63	-0.006718	±2.5	PASS
Band2	1.4MHz	16QAM	18900	6RB#0	NV	0	-14.78	-0.007862	±2.5	PASS
Band2	1.4MHz	16QAM	18900	6RB#0	NV	10	-10.49	-0.005580	±2.5	PASS
Band2	1.4MHz	16QAM	18900	6RB#0	NV	20	-16.75	-0.008910	±2.5	PASS
Band2	1.4MHz	16QAM	18900	6RB#0	NV	30	-14.61	-0.007771	±2.5	PASS
Band2	1.4MHz	16QAM	18900	6RB#0	NV	40	-14.23	-0.007569	±2.5	PASS
Band2	1.4MHz	16QAM	18900	6RB#0	NV	50	-4.91	-0.002612	±2.5	PASS
Band2	1.4MHz	QPSK	19193	6RB#0	NV	-30	-17.32	-0.009071	±2.5	PASS
Band2	1.4MHz	QPSK	19193	6RB#0	NV	-20	-15.78	-0.008265	±2.5	PASS
Band2	1.4MHz	QPSK	19193	6RB#0	NV	-10	-10.51	-0.005505	±2.5	PASS
Band2	1.4MHz	QPSK	19193	6RB#0	NV	0	-2.68	-0.001404	±2.5	PASS
Band2	1.4MHz	QPSK	19193	6RB#0	NV	10	-11.66	-0.006107	±2.5	PASS
Band2	1.4MHz	QPSK	19193	6RB#0	NV	20	4.48	0.002346	±2.5	PASS
Band2	1.4MHz	QPSK	19193	6RB#0	NV	30	-14.25	-0.007463	±2.5	PASS
Band2	1.4MHz	QPSK	19193	6RB#0	NV	40	-12.87	-0.006741	±2.5	PASS
Band2	1.4MHz	QPSK	19193	6RB#0	NV	50	-16.54	-0.008663	±2.5	PASS
Band2	1.4MHz	16QAM	19193	6RB#0	NV	-30	-13.05	-0.006835	±2.5	PASS

Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community,
 Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.
 Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com



Hotline
 400-003-0500
 www.anbotek.com.cn



Band2	1.4MHz	16QAM	19193	6RB#0	NV	-20	-13.82	-0.007238	±2.5	PASS
Band2	1.4MHz	16QAM	19193	6RB#0	NV	-10	-12.17	-0.006374	±2.5	PASS
Band2	1.4MHz	16QAM	19193	6RB#0	NV	0	-11.14	-0.005835	±2.5	PASS
Band2	1.4MHz	16QAM	19193	6RB#0	NV	10	8.85	0.004635	±2.5	PASS
Band2	1.4MHz	16QAM	19193	6RB#0	NV	20	-7.68	-0.004022	±2.5	PASS
Band2	1.4MHz	16QAM	19193	6RB#0	NV	30	-6.09	-0.003190	±2.5	PASS
Band2	1.4MHz	16QAM	19193	6RB#0	NV	40	-13.92	-0.007291	±2.5	PASS
Band2	1.4MHz	16QAM	19193	6RB#0	NV	50	-14.51	-0.007600	±2.5	PASS
Band2	3MHz	QPSK	18615	15RB#0	NV	-30	-14.38	-0.007767	±2.5	PASS
Band2	3MHz	QPSK	18615	15RB#0	NV	-20	-3.69	-0.001993	±2.5	PASS
Band2	3MHz	QPSK	18615	15RB#0	NV	-10	-14.09	-0.007610	±2.5	PASS
Band2	3MHz	QPSK	18615	15RB#0	NV	0	-4.01	-0.002166	±2.5	PASS
Band2	3MHz	QPSK	18615	15RB#0	NV	10	-14.63	-0.007902	±2.5	PASS
Band2	3MHz	QPSK	18615	15RB#0	NV	20	-16.75	-0.009047	±2.5	PASS
Band2	3MHz	QPSK	18615	15RB#0	NV	30	-15.11	-0.008161	±2.5	PASS
Band2	3MHz	QPSK	18615	15RB#0	NV	40	-9.38	-0.005066	±2.5	PASS
Band2	3MHz	QPSK	18615	15RB#0	NV	50	-12.82	-0.006924	±2.5	PASS
Band2	3MHz	16QAM	18615	15RB#0	NV	-30	-13.45	-0.007264	±2.5	PASS
Band2	3MHz	16QAM	18615	15RB#0	NV	-20	-16.57	-0.008950	±2.5	PASS
Band2	3MHz	16QAM	18615	15RB#0	NV	-10	-15.11	-0.008161	±2.5	PASS
Band2	3MHz	16QAM	18615	15RB#0	NV	0	-3.52	-0.001901	±2.5	PASS
Band2	3MHz	16QAM	18615	15RB#0	NV	10	-13.66	-0.007378	±2.5	PASS
Band2	3MHz	16QAM	18615	15RB#0	NV	20	-13.29	-0.007178	±2.5	PASS
Band2	3MHz	16QAM	18615	15RB#0	NV	30	-12.69	-0.006854	±2.5	PASS
Band2	3MHz	16QAM	18615	15RB#0	NV	40	-9.56	-0.005163	±2.5	PASS
Band2	3MHz	16QAM	18615	15RB#0	NV	50	-11.32	-0.006114	±2.5	PASS
Band2	3MHz	QPSK	18900	15RB#0	NV	-30	-12.40	-0.006596	±2.5	PASS
Band2	3MHz	QPSK	18900	15RB#0	NV	-20	-13.22	-0.007032	±2.5	PASS
Band2	3MHz	QPSK	18900	15RB#0	NV	-10	-14.45	-0.007686	±2.5	PASS
Band2	3MHz	QPSK	18900	15RB#0	NV	0	-10.70	-0.005691	±2.5	PASS
Band2	3MHz	QPSK	18900	15RB#0	NV	10	-6.41	-0.003410	±2.5	PASS
Band2	3MHz	QPSK	18900	15RB#0	NV	20	-11.63	-0.006186	±2.5	PASS
Band2	3MHz	QPSK	18900	15RB#0	NV	30	-16.84	-0.008957	±2.5	PASS
Band2	3MHz	QPSK	18900	15RB#0	NV	40	-17.41	-0.009261	±2.5	PASS
Band2	3MHz	QPSK	18900	15RB#0	NV	50	-14.83	-0.007888	±2.5	PASS
Band2	3MHz	16QAM	18900	15RB#0	NV	-30	-11.12	-0.005915	±2.5	PASS
Band2	3MHz	16QAM	18900	15RB#0	NV	-20	-11.82	-0.006287	±2.5	PASS
Band2	3MHz	16QAM	18900	15RB#0	NV	-10	-11.79	-0.006271	±2.5	PASS
Band2	3MHz	16QAM	18900	15RB#0	NV	0	-6.12	-0.003255	±2.5	PASS
Band2	3MHz	16QAM	18900	15RB#0	NV	10	9.71	0.005165	±2.5	PASS
Band2	3MHz	16QAM	18900	15RB#0	NV	20	-8.37	-0.004452	±2.5	PASS

Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community,
 Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.
 Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com



Hotline

400-003-0500

www.anbotek.com.cn



Band2	3MHz	16QAM	18900	15RB#0	NV	30	-9.73	-0.005176	±2.5	PASS
Band2	3MHz	16QAM	18900	15RB#0	NV	40	-9.97	-0.005303	±2.5	PASS
Band2	3MHz	16QAM	18900	15RB#0	NV	50	-8.55	-0.004548	±2.5	PASS
Band2	3MHz	QPSK	19185	15RB#0	NV	-30	-17.04	-0.008928	±2.5	PASS
Band2	3MHz	QPSK	19185	15RB#0	NV	-20	-13.46	-0.007053	±2.5	PASS
Band2	3MHz	QPSK	19185	15RB#0	NV	-10	-14.25	-0.007467	±2.5	PASS
Band2	3MHz	QPSK	19185	15RB#0	NV	0	-12.90	-0.006759	±2.5	PASS
Band2	3MHz	QPSK	19185	15RB#0	NV	10	-16.09	-0.008431	±2.5	PASS
Band2	3MHz	QPSK	19185	15RB#0	NV	20	-15.29	-0.008012	±2.5	PASS
Band2	3MHz	QPSK	19185	15RB#0	NV	30	-13.65	-0.007152	±2.5	PASS
Band2	3MHz	QPSK	19185	15RB#0	NV	40	-13.65	-0.007152	±2.5	PASS
Band2	3MHz	QPSK	19185	15RB#0	NV	50	-3.73	-0.001954	±2.5	PASS
Band2	3MHz	16QAM	19185	15RB#0	NV	-30	-14.42	-0.007556	±2.5	PASS
Band2	3MHz	16QAM	19185	15RB#0	NV	-20	-10.57	-0.005538	±2.5	PASS
Band2	3MHz	16QAM	19185	15RB#0	NV	-10	-13.29	-0.006964	±2.5	PASS
Band2	3MHz	16QAM	19185	15RB#0	NV	0	-13.30	-0.006969	±2.5	PASS
Band2	3MHz	16QAM	19185	15RB#0	NV	10	-5.31	-0.002782	±2.5	PASS
Band2	3MHz	16QAM	19185	15RB#0	NV	20	-11.12	-0.005827	±2.5	PASS
Band2	3MHz	16QAM	19185	15RB#0	NV	30	-14.39	-0.007540	±2.5	PASS
Band2	3MHz	16QAM	19185	15RB#0	NV	40	-13.25	-0.006943	±2.5	PASS
Band2	3MHz	16QAM	19185	15RB#0	NV	50	-8.87	-0.004648	±2.5	PASS
Band2	5MHz	QPSK	18625	25RB#0	NV	-30	-12.50	-0.006748	±2.5	PASS
Band2	5MHz	QPSK	18625	25RB#0	NV	-20	-15.16	-0.008184	±2.5	PASS
Band2	5MHz	QPSK	18625	25RB#0	NV	-10	2.22	0.001198	±2.5	PASS
Band2	5MHz	QPSK	18625	25RB#0	NV	0	-13.02	-0.007028	±2.5	PASS
Band2	5MHz	QPSK	18625	25RB#0	NV	10	-18.74	-0.010116	±2.5	PASS
Band2	5MHz	QPSK	18625	25RB#0	NV	20	-19.64	-0.010602	±2.5	PASS
Band2	5MHz	QPSK	18625	25RB#0	NV	30	-22.30	-0.012038	±2.5	PASS
Band2	5MHz	QPSK	18625	25RB#0	NV	40	-15.68	-0.008464	±2.5	PASS
Band2	5MHz	QPSK	18625	25RB#0	NV	50	-8.21	-0.004432	±2.5	PASS
Band2	5MHz	16QAM	18625	25RB#0	NV	-30	-10.70	-0.005776	±2.5	PASS
Band2	5MHz	16QAM	18625	25RB#0	NV	-20	-14.55	-0.007854	±2.5	PASS
Band2	5MHz	16QAM	18625	25RB#0	NV	-10	-14.51	-0.007833	±2.5	PASS
Band2	5MHz	16QAM	18625	25RB#0	NV	0	-15.74	-0.008497	±2.5	PASS
Band2	5MHz	16QAM	18625	25RB#0	NV	10	-16.98	-0.009166	±2.5	PASS
Band2	5MHz	16QAM	18625	25RB#0	NV	20	-16.77	-0.009053	±2.5	PASS
Band2	5MHz	16QAM	18625	25RB#0	NV	30	-4.22	-0.002278	±2.5	PASS
Band2	5MHz	16QAM	18625	25RB#0	NV	40	-13.12	-0.007082	±2.5	PASS
Band2	5MHz	16QAM	18625	25RB#0	NV	50	-10.97	-0.005922	±2.5	PASS
Band2	5MHz	QPSK	18900	25RB#0	NV	-30	-4.38	-0.002330	±2.5	PASS
Band2	5MHz	QPSK	18900	25RB#0	NV	-20	-13.23	-0.007037	±2.5	PASS

Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community,
 Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.
 Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com



Hotline
 400-003-0500
 www.anbotek.com.cn



Band2	5MHz	QPSK	18900	25RB#0	NV	-10	-11.84	-0.006298	±2.5	PASS
Band2	5MHz	QPSK	18900	25RB#0	NV	0	-13.20	-0.007021	±2.5	PASS
Band2	5MHz	QPSK	18900	25RB#0	NV	10	-9.54	-0.005074	±2.5	PASS
Band2	5MHz	QPSK	18900	25RB#0	NV	20	-2.09	-0.001112	±2.5	PASS
Band2	5MHz	QPSK	18900	25RB#0	NV	30	-13.90	-0.007394	±2.5	PASS
Band2	5MHz	QPSK	18900	25RB#0	NV	40	-19.07	-0.010144	±2.5	PASS
Band2	5MHz	QPSK	18900	25RB#0	NV	50	-6.95	-0.003697	±2.5	PASS
Band2	5MHz	16QAM	18900	25RB#0	NV	-30	-12.47	-0.006633	±2.5	PASS
Band2	5MHz	16QAM	18900	25RB#0	NV	-20	-10.27	-0.005463	±2.5	PASS
Band2	5MHz	16QAM	18900	25RB#0	NV	-10	-15.39	-0.008186	±2.5	PASS
Band2	5MHz	16QAM	18900	25RB#0	NV	0	-13.42	-0.007138	±2.5	PASS
Band2	5MHz	16QAM	18900	25RB#0	NV	10	-14.49	-0.007707	±2.5	PASS
Band2	5MHz	16QAM	18900	25RB#0	NV	20	-6.95	-0.003697	±2.5	PASS
Band2	5MHz	16QAM	18900	25RB#0	NV	30	-8.27	-0.004399	±2.5	PASS
Band2	5MHz	16QAM	18900	25RB#0	NV	40	-14.02	-0.007457	±2.5	PASS
Band2	5MHz	16QAM	18900	25RB#0	NV	50	4.51	0.002399	±2.5	PASS
Band2	5MHz	QPSK	19175	25RB#0	NV	-30	7.70	0.004037	±2.5	PASS
Band2	5MHz	QPSK	19175	25RB#0	NV	-20	-10.71	-0.005615	±2.5	PASS
Band2	5MHz	QPSK	19175	25RB#0	NV	-10	3.25	0.001704	±2.5	PASS
Band2	5MHz	QPSK	19175	25RB#0	NV	0	-14.39	-0.007544	±2.5	PASS
Band2	5MHz	QPSK	19175	25RB#0	NV	10	-15.86	-0.008315	±2.5	PASS
Band2	5MHz	QPSK	19175	25RB#0	NV	20	-19.31	-0.010123	±2.5	PASS
Band2	5MHz	QPSK	19175	25RB#0	NV	30	-21.14	-0.011083	±2.5	PASS
Band2	5MHz	QPSK	19175	25RB#0	NV	40	-16.29	-0.008540	±2.5	PASS
Band2	5MHz	QPSK	19175	25RB#0	NV	50	-9.44	-0.004949	±2.5	PASS
Band2	5MHz	16QAM	19175	25RB#0	NV	-30	-12.72	-0.006668	±2.5	PASS
Band2	5MHz	16QAM	19175	25RB#0	NV	-20	-19.03	-0.009976	±2.5	PASS
Band2	5MHz	16QAM	19175	25RB#0	NV	-10	-12.20	-0.006396	±2.5	PASS
Band2	5MHz	16QAM	19175	25RB#0	NV	0	-9.58	-0.005022	±2.5	PASS
Band2	5MHz	16QAM	19175	25RB#0	NV	10	-6.42	-0.003366	±2.5	PASS
Band2	5MHz	16QAM	19175	25RB#0	NV	20	-11.53	-0.006045	±2.5	PASS
Band2	5MHz	16QAM	19175	25RB#0	NV	30	-12.65	-0.006632	±2.5	PASS
Band2	5MHz	16QAM	19175	25RB#0	NV	40	-5.81	-0.003046	±2.5	PASS
Band2	5MHz	16QAM	19175	25RB#0	NV	50	-10.31	-0.005405	±2.5	PASS
Band2	10MHz	QPSK	18650	50RB#0	NV	-30	2.95	0.001590	±2.5	PASS
Band2	10MHz	QPSK	18650	50RB#0	NV	-20	-14.15	-0.007628	±2.5	PASS
Band2	10MHz	QPSK	18650	50RB#0	NV	-10	-9.68	-0.005218	±2.5	PASS
Band2	10MHz	QPSK	18650	50RB#0	NV	0	11.29	0.006086	±2.5	PASS
Band2	10MHz	QPSK	18650	50RB#0	NV	10	8.87	0.004782	±2.5	PASS
Band2	10MHz	QPSK	18650	50RB#0	NV	20	-12.66	-0.006825	±2.5	PASS
Band2	10MHz	QPSK	18650	50RB#0	NV	30	-12.00	-0.006469	±2.5	PASS

Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community,
 Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.
 Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com



Hotline
 400-003-0500
 www.anbotek.com.cn



Band2	10MHz	QPSK	18650	50RB#0	NV	40	-9.43	-0.005084	±2.5	PASS
Band2	10MHz	QPSK	18650	50RB#0	NV	50	2.96	0.001596	±2.5	PASS
Band2	10MHz	16QAM	18650	50RB#0	NV	-30	-11.54	-0.006221	±2.5	PASS
Band2	10MHz	16QAM	18650	50RB#0	NV	-20	8.60	0.004636	±2.5	PASS
Band2	10MHz	16QAM	18650	50RB#0	NV	-10	-11.46	-0.006178	±2.5	PASS
Band2	10MHz	16QAM	18650	50RB#0	NV	0	-15.79	-0.008512	±2.5	PASS
Band2	10MHz	16QAM	18650	50RB#0	NV	10	7.97	0.004296	±2.5	PASS
Band2	10MHz	16QAM	18650	50RB#0	NV	20	-15.64	-0.008431	±2.5	PASS
Band2	10MHz	16QAM	18650	50RB#0	NV	30	-18.04	-0.009725	±2.5	PASS
Band2	10MHz	16QAM	18650	50RB#0	NV	40	-18.40	-0.009919	±2.5	PASS
Band2	10MHz	16QAM	18650	50RB#0	NV	50	-9.53	-0.005137	±2.5	PASS
Band2	10MHz	QPSK	18900	50RB#0	NV	-30	-11.46	-0.006096	±2.5	PASS
Band2	10MHz	QPSK	18900	50RB#0	NV	-20	-13.82	-0.007351	±2.5	PASS
Band2	10MHz	QPSK	18900	50RB#0	NV	-10	-7.28	-0.003872	±2.5	PASS
Band2	10MHz	QPSK	18900	50RB#0	NV	0	-17.05	-0.009069	±2.5	PASS
Band2	10MHz	QPSK	18900	50RB#0	NV	10	-11.34	-0.006032	±2.5	PASS
Band2	10MHz	QPSK	18900	50RB#0	NV	20	-16.94	-0.009011	±2.5	PASS
Band2	10MHz	QPSK	18900	50RB#0	NV	30	-2.90	-0.001543	±2.5	PASS
Band2	10MHz	QPSK	18900	50RB#0	NV	40	-4.42	-0.002351	±2.5	PASS
Band2	10MHz	QPSK	18900	50RB#0	NV	50	-5.09	-0.002707	±2.5	PASS
Band2	10MHz	16QAM	18900	50RB#0	NV	-30	-14.63	-0.007782	±2.5	PASS
Band2	10MHz	16QAM	18900	50RB#0	NV	-20	-13.88	-0.007383	±2.5	PASS
Band2	10MHz	16QAM	18900	50RB#0	NV	-10	-3.75	-0.001995	±2.5	PASS
Band2	10MHz	16QAM	18900	50RB#0	NV	0	-12.75	-0.006782	±2.5	PASS
Band2	10MHz	16QAM	18900	50RB#0	NV	10	-12.02	-0.006394	±2.5	PASS
Band2	10MHz	16QAM	18900	50RB#0	NV	20	-12.00	-0.006383	±2.5	PASS
Band2	10MHz	16QAM	18900	50RB#0	NV	30	-10.44	-0.005553	±2.5	PASS
Band2	10MHz	16QAM	18900	50RB#0	NV	40	-14.82	-0.007883	±2.5	PASS
Band2	10MHz	16QAM	18900	50RB#0	NV	50	-15.22	-0.008096	±2.5	PASS
Band2	10MHz	QPSK	19150	50RB#0	NV	-30	-14.78	-0.007759	±2.5	PASS
Band2	10MHz	QPSK	19150	50RB#0	NV	-20	-13.05	-0.006850	±2.5	PASS
Band2	10MHz	QPSK	19150	50RB#0	NV	-10	7.17	0.003764	±2.5	PASS
Band2	10MHz	QPSK	19150	50RB#0	NV	0	-18.02	-0.009459	±2.5	PASS
Band2	10MHz	QPSK	19150	50RB#0	NV	10	-16.78	-0.008808	±2.5	PASS
Band2	10MHz	QPSK	19150	50RB#0	NV	20	-8.64	-0.004535	±2.5	PASS
Band2	10MHz	QPSK	19150	50RB#0	NV	30	-14.92	-0.007832	±2.5	PASS
Band2	10MHz	QPSK	19150	50RB#0	NV	40	-8.93	-0.004688	±2.5	PASS
Band2	10MHz	QPSK	19150	50RB#0	NV	50	-11.83	-0.006210	±2.5	PASS
Band2	10MHz	16QAM	19150	50RB#0	NV	-30	-11.43	-0.006000	±2.5	PASS
Band2	10MHz	16QAM	19150	50RB#0	NV	-20	-8.64	-0.004535	±2.5	PASS
Band2	10MHz	16QAM	19150	50RB#0	NV	-10	-9.51	-0.004992	±2.5	PASS

Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community,
 Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.
 Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com



Hotline

400-003-0500

www.anbotek.com.cn



Band2	10MHz	16QAM	19150	50RB#0	NV	0	-13.76	-0.007223	±2.5	PASS
Band2	10MHz	16QAM	19150	50RB#0	NV	10	5.89	0.003092	±2.5	PASS
Band2	10MHz	16QAM	19150	50RB#0	NV	20	-17.29	-0.009076	±2.5	PASS
Band2	10MHz	16QAM	19150	50RB#0	NV	30	-11.42	-0.005995	±2.5	PASS
Band2	10MHz	16QAM	19150	50RB#0	NV	40	-5.14	-0.002698	±2.5	PASS
Band2	10MHz	16QAM	19150	50RB#0	NV	50	-5.26	-0.002761	±2.5	PASS
Band2	15MHz	QPSK	18675	75RB#0	NV	-30	-7.21	-0.003882	±2.5	PASS
Band2	15MHz	QPSK	18675	75RB#0	NV	-20	-8.55	-0.004603	±2.5	PASS
Band2	15MHz	QPSK	18675	75RB#0	NV	-10	4.73	0.002546	±2.5	PASS
Band2	15MHz	QPSK	18675	75RB#0	NV	0	-3.52	-0.001895	±2.5	PASS
Band2	15MHz	QPSK	18675	75RB#0	NV	10	-15.19	-0.008178	±2.5	PASS
Band2	15MHz	QPSK	18675	75RB#0	NV	20	-15.34	-0.008258	±2.5	PASS
Band2	15MHz	QPSK	18675	75RB#0	NV	30	8.85	0.004764	±2.5	PASS
Band2	15MHz	QPSK	18675	75RB#0	NV	40	-7.72	-0.004156	±2.5	PASS
Band2	15MHz	QPSK	18675	75RB#0	NV	50	-21.57	-0.011612	±2.5	PASS
Band2	15MHz	16QAM	18675	75RB#0	NV	-30	5.94	0.003198	±2.5	PASS
Band2	15MHz	16QAM	18675	75RB#0	NV	-20	-7.24	-0.003898	±2.5	PASS
Band2	15MHz	16QAM	18675	75RB#0	NV	-10	-13.28	-0.007149	±2.5	PASS
Band2	15MHz	16QAM	18675	75RB#0	NV	0	9.23	0.004969	±2.5	PASS
Band2	15MHz	16QAM	18675	75RB#0	NV	10	-11.26	-0.006062	±2.5	PASS
Band2	15MHz	16QAM	18675	75RB#0	NV	20	-5.19	-0.002794	±2.5	PASS
Band2	15MHz	16QAM	18675	75RB#0	NV	30	-11.79	-0.006347	±2.5	PASS
Band2	15MHz	16QAM	18675	75RB#0	NV	40	-10.71	-0.005766	±2.5	PASS
Band2	15MHz	16QAM	18675	75RB#0	NV	50	-16.99	-0.009147	±2.5	PASS
Band2	15MHz	QPSK	18900	75RB#0	NV	-30	-17.84	-0.009489	±2.5	PASS
Band2	15MHz	QPSK	18900	75RB#0	NV	-20	-14.75	-0.007846	±2.5	PASS
Band2	15MHz	QPSK	18900	75RB#0	NV	-10	-14.62	-0.007777	±2.5	PASS
Band2	15MHz	QPSK	18900	75RB#0	NV	0	-20.76	-0.011043	±2.5	PASS
Band2	15MHz	QPSK	18900	75RB#0	NV	10	-15.46	-0.008223	±2.5	PASS
Band2	15MHz	QPSK	18900	75RB#0	NV	20	-16.91	-0.008995	±2.5	PASS
Band2	15MHz	QPSK	18900	75RB#0	NV	30	-17.61	-0.009367	±2.5	PASS
Band2	15MHz	QPSK	18900	75RB#0	NV	40	-17.15	-0.009122	±2.5	PASS
Band2	15MHz	QPSK	18900	75RB#0	NV	50	-15.12	-0.008043	±2.5	PASS
Band2	15MHz	16QAM	18900	75RB#0	NV	-30	-17.15	-0.009122	±2.5	PASS
Band2	15MHz	16QAM	18900	75RB#0	NV	-20	-15.65	-0.008324	±2.5	PASS
Band2	15MHz	16QAM	18900	75RB#0	NV	-10	-13.19	-0.007016	±2.5	PASS
Band2	15MHz	16QAM	18900	75RB#0	NV	0	-20.18	-0.010734	±2.5	PASS
Band2	15MHz	16QAM	18900	75RB#0	NV	10	-8.84	-0.004702	±2.5	PASS
Band2	15MHz	16QAM	18900	75RB#0	NV	20	-17.87	-0.009505	±2.5	PASS
Band2	15MHz	16QAM	18900	75RB#0	NV	30	-14.95	-0.007952	±2.5	PASS
Band2	15MHz	16QAM	18900	75RB#0	NV	40	-14.23	-0.007569	±2.5	PASS

Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community,
 Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.
 Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com



Hotline
 400-003-0500

www.anbotek.com.cn



Band2	15MHz	16QAM	18900	75RB#0	NV	50	-15.72	-0.008362	±2.5	PASS
Band2	15MHz	QPSK	19125	75RB#0	NV	-30	-12.95	-0.006807	±2.5	PASS
Band2	15MHz	QPSK	19125	75RB#0	NV	-20	-13.59	-0.007143	±2.5	PASS
Band2	15MHz	QPSK	19125	75RB#0	NV	-10	-6.01	-0.003159	±2.5	PASS
Band2	15MHz	QPSK	19125	75RB#0	NV	0	-12.70	-0.006675	±2.5	PASS
Band2	15MHz	QPSK	19125	75RB#0	NV	10	-17.95	-0.009435	±2.5	PASS
Band2	15MHz	QPSK	19125	75RB#0	NV	20	-10.49	-0.005514	±2.5	PASS
Band2	15MHz	QPSK	19125	75RB#0	NV	30	-14.41	-0.007574	±2.5	PASS
Band2	15MHz	QPSK	19125	75RB#0	NV	40	-14.99	-0.007879	±2.5	PASS
Band2	15MHz	QPSK	19125	75RB#0	NV	50	-14.73	-0.007742	±2.5	PASS
Band2	15MHz	16QAM	19125	75RB#0	NV	-30	-6.59	-0.003464	±2.5	PASS
Band2	15MHz	16QAM	19125	75RB#0	NV	-20	-6.18	-0.003248	±2.5	PASS
Band2	15MHz	16QAM	19125	75RB#0	NV	-10	-5.95	-0.003127	±2.5	PASS
Band2	15MHz	16QAM	19125	75RB#0	NV	0	-7.17	-0.003769	±2.5	PASS
Band2	15MHz	16QAM	19125	75RB#0	NV	10	-4.82	-0.002534	±2.5	PASS
Band2	15MHz	16QAM	19125	75RB#0	NV	20	-1.93	-0.001014	±2.5	PASS
Band2	15MHz	16QAM	19125	75RB#0	NV	30	-14.33	-0.007532	±2.5	PASS
Band2	15MHz	16QAM	19125	75RB#0	NV	40	-10.57	-0.005556	±2.5	PASS
Band2	15MHz	16QAM	19125	75RB#0	NV	50	-9.90	-0.005204	±2.5	PASS
Band2	20MHz	QPSK	18700	100RB#0	NV	-30	-13.32	-0.007161	±2.5	PASS
Band2	20MHz	QPSK	18700	100RB#0	NV	-20	-8.15	-0.004382	±2.5	PASS
Band2	20MHz	QPSK	18700	100RB#0	NV	-10	-6.35	-0.003414	±2.5	PASS
Band2	20MHz	QPSK	18700	100RB#0	NV	0	-5.75	-0.003091	±2.5	PASS
Band2	20MHz	QPSK	18700	100RB#0	NV	10	-19.43	-0.010446	±2.5	PASS
Band2	20MHz	QPSK	18700	100RB#0	NV	20	6.59	0.003543	±2.5	PASS
Band2	20MHz	QPSK	18700	100RB#0	NV	30	-13.69	-0.007360	±2.5	PASS
Band2	20MHz	QPSK	18700	100RB#0	NV	40	3.66	0.001968	±2.5	PASS
Band2	20MHz	QPSK	18700	100RB#0	NV	50	7.17	0.003855	±2.5	PASS
Band2	20MHz	16QAM	18700	100RB#0	NV	-30	-17.87	-0.009608	±2.5	PASS
Band2	20MHz	16QAM	18700	100RB#0	NV	-20	7.67	0.004124	±2.5	PASS
Band2	20MHz	16QAM	18700	100RB#0	NV	-10	-8.61	-0.004629	±2.5	PASS
Band2	20MHz	16QAM	18700	100RB#0	NV	0	-7.60	-0.004086	±2.5	PASS
Band2	20MHz	16QAM	18700	100RB#0	NV	10	-13.18	-0.007086	±2.5	PASS
Band2	20MHz	16QAM	18700	100RB#0	NV	20	-12.35	-0.006640	±2.5	PASS
Band2	20MHz	16QAM	18700	100RB#0	NV	30	-4.15	-0.002231	±2.5	PASS
Band2	20MHz	16QAM	18700	100RB#0	NV	40	-14.82	-0.007968	±2.5	PASS
Band2	20MHz	16QAM	18700	100RB#0	NV	50	-3.32	-0.001785	±2.5	PASS
Band2	20MHz	QPSK	18900	100RB#0	NV	-30	-14.71	-0.007824	±2.5	PASS
Band2	20MHz	QPSK	18900	100RB#0	NV	-20	-11.23	-0.005973	±2.5	PASS
Band2	20MHz	QPSK	18900	100RB#0	NV	-10	-13.23	-0.007037	±2.5	PASS
Band2	20MHz	QPSK	18900	100RB#0	NV	0	-14.48	-0.007702	±2.5	PASS

Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community,
 Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.
 Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com



Hotline
 400-003-0500

www.anbotek.com.cn



Band2	20MHz	QPSK	18900	100RB#0	NV	10	-21.89	-0.011644	±2.5	PASS
Band2	20MHz	QPSK	18900	100RB#0	NV	20	-14.92	-0.007936	±2.5	PASS
Band2	20MHz	QPSK	18900	100RB#0	NV	30	-7.05	-0.003750	±2.5	PASS
Band2	20MHz	QPSK	18900	100RB#0	NV	40	-19.53	-0.010388	±2.5	PASS
Band2	20MHz	QPSK	18900	100RB#0	NV	50	-14.88	-0.007915	±2.5	PASS
Band2	20MHz	16QAM	18900	100RB#0	NV	-30	-19.41	-0.010324	±2.5	PASS
Band2	20MHz	16QAM	18900	100RB#0	NV	-20	-15.31	-0.008144	±2.5	PASS
Band2	20MHz	16QAM	18900	100RB#0	NV	-10	-13.45	-0.007154	±2.5	PASS
Band2	20MHz	16QAM	18900	100RB#0	NV	0	-16.82	-0.008947	±2.5	PASS
Band2	20MHz	16QAM	18900	100RB#0	NV	10	-12.47	-0.006633	±2.5	PASS
Band2	20MHz	16QAM	18900	100RB#0	NV	20	-15.49	-0.008239	±2.5	PASS
Band2	20MHz	16QAM	18900	100RB#0	NV	30	-12.60	-0.006702	±2.5	PASS
Band2	20MHz	16QAM	18900	100RB#0	NV	40	-15.94	-0.008479	±2.5	PASS
Band2	20MHz	16QAM	18900	100RB#0	NV	50	-11.60	-0.006170	±2.5	PASS
Band2	20MHz	QPSK	19100	100RB#0	NV	-30	-11.56	-0.006084	±2.5	PASS
Band2	20MHz	QPSK	19100	100RB#0	NV	-20	-16.22	-0.008537	±2.5	PASS
Band2	20MHz	QPSK	19100	100RB#0	NV	-10	-19.68	-0.010358	±2.5	PASS
Band2	20MHz	QPSK	19100	100RB#0	NV	0	-15.91	-0.008374	±2.5	PASS
Band2	20MHz	QPSK	19100	100RB#0	NV	10	-14.20	-0.007474	±2.5	PASS
Band2	20MHz	QPSK	19100	100RB#0	NV	20	-18.65	-0.009816	±2.5	PASS
Band2	20MHz	QPSK	19100	100RB#0	NV	30	-12.32	-0.006484	±2.5	PASS
Band2	20MHz	QPSK	19100	100RB#0	NV	40	-5.88	-0.003095	±2.5	PASS
Band2	20MHz	QPSK	19100	100RB#0	NV	50	-19.64	-0.010337	±2.5	PASS
Band2	20MHz	16QAM	19100	100RB#0	NV	-30	-19.38	-0.010200	±2.5	PASS
Band2	20MHz	16QAM	19100	100RB#0	NV	-20	-6.37	-0.003353	±2.5	PASS
Band2	20MHz	16QAM	19100	100RB#0	NV	-10	-8.34	-0.004389	±2.5	PASS
Band2	20MHz	16QAM	19100	100RB#0	NV	0	-7.21	-0.003795	±2.5	PASS
Band2	20MHz	16QAM	19100	100RB#0	NV	10	-18.12	-0.009537	±2.5	PASS
Band2	20MHz	16QAM	19100	100RB#0	NV	20	-8.27	-0.004353	±2.5	PASS
Band2	20MHz	16QAM	19100	100RB#0	NV	30	-9.36	-0.004926	±2.5	PASS
Band2	20MHz	16QAM	19100	100RB#0	NV	40	-7.94	-0.004179	±2.5	PASS
Band2	20MHz	16QAM	19100	100RB#0	NV	50	-9.41	-0.004953	±2.5	PASS

---END---

Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community,
 Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.
 Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com



Hotline
 400-003-0500
 www.anbotek.com.cn

