

Appendix Test Data

Report No.:	18220WC40024206	Test Sample No.:	1-2-2
Start Test Date:	2024.02.02	Finish Test Date:	2024.02.27.
Test Engineer:	Hayman Chen	Auditor:	Justin Feng
Temperature:	24.3℃	Relative Humidity:	57 %
Pressure:	101 kPa		

Appendix A: Conducted Output Power

Test Result

Band	Bandwidth	Modulation	Channel	RB Configuration	Result(dBm)	Verdict
Band38	5MHz	QPSK	37775	1RB#0	22.67	PASS
Band38	5MHz	16QAM	37775	1RB#0	21.95	PASS
Band38	5MHz	QPSK	37775	1RB#12	22.76	PASS
Band38	5MHz	16QAM	37775	1RB#12	22.03	PASS
Band38	5MHz	QPSK	37775	1RB#24	22.65	PASS
Band38	5MHz	16QAM	37775	1RB#24	21.97	PASS
Band38	5MHz	QPSK	37775	12RB#0	21.71	PASS
Band38	5MHz	16QAM	37775	12RB#0	20.82	PASS
Band38	5MHz	QPSK	37775	12RB#6	21.72	PASS
Band38	5MHz	16QAM	37775	12RB#6	20.77	PASS
Band38	5MHz	QPSK	37775	12RB#13	21.74	PASS
Band38	5MHz	16QAM	37775	12RB#13	20.76	PASS
Band38	5MHz	QPSK	37775	25RB#0	21.83	PASS
Band38	5MHz	16QAM	37775	25RB#0	20.84	PASS
Band38	5MHz	QPSK	38000	1RB#0	22.56	PASS
Band38	5MHz	16QAM	38000	1RB#0	21.76	PASS
Band38	5MHz	QPSK	38000	1RB#12	22.63	PASS
Band38	5MHz	16QAM	38000	1RB#12	21.79	PASS
Band38	5MHz	QPSK	38000	1RB#24	22.54	PASS
Band38	5MHz	16QAM	38000	1RB#24	21.68	PASS
Band38	5MHz	QPSK	38000	12RB#0	21.50	PASS
Band38	5MHz	16QAM	38000	12RB#0	20.36	PASS
Band38	5MHz	QPSK	38000	12RB#6	21.51	PASS
Band38	5MHz	16QAM	38000	12RB#6	20.35	PASS
Band38	5MHz	QPSK	38000	12RB#13	21.45	PASS
Band38	5MHz	16QAM	38000	12RB#13	20.30	PASS



Band38	5MHz	QPSK	38000	25RB#0	21.50	PASS
Band38	5MHz	16QAM	38000	25RB#0	20.39	PASS
Band38	5MHz	QPSK	38225	1RB#0	22.51	PASS
Band38	5MHz	16QAM	38225	1RB#0	21.74	PASS
Band38	5MHz	QPSK	38225	1RB#12	22.65	PASS
Band38	5MHz	16QAM	38225	1RB#12	21.88	PASS
Band38	5MHz	QPSK	38225	1RB#24	22.58	PASS
Band38	5MHz	16QAM	38225	1RB#24	21.82	PASS
Band38	5MHz	QPSK	38225	12RB#0	21.62	PASS
Band38	5MHz	16QAM	38225	12RB#0	20.57	PASS
Band38	5MHz	QPSK	38225	12RB#6	21.59	PASS
Band38	5MHz	16QAM	38225	12RB#6	20.51	PASS
Band38	5MHz	QPSK	38225	12RB#13	21.63	PASS
Band38	5MHz	16QAM	38225	12RB#13	20.61	PASS
Band38	5MHz	QPSK	38225	25RB#0	21.61	PASS
Band38	5MHz	16QAM	38225	25RB#0	20.55	PASS
Band38	10MHz	QPSK	37800	1RB#0	22.77	PASS
Band38	10MHz	16QAM	37800	1RB#0	22.11	PASS
Band38	10MHz	QPSK	37800	1RB#24	22.98	PASS
Band38	10MHz	16QAM	37800	1RB#24	22.32	PASS
Band38	10MHz	QPSK	37800	1RB#49	22.75	PASS
Band38	10MHz	16QAM	37800	1RB#49	22.06	PASS
Band38	10MHz	QPSK	37800	25RB#0	21.89	PASS
Band38	10MHz	16QAM	37800	25RB#0	20.91	PASS
Band38	10MHz	QPSK	37800	25RB#12	21.89	PASS
Band38	10MHz	16QAM	37800	25RB#12	20.83	PASS
Band38	10MHz	QPSK	37800	25RB#25	21.96	PASS
Band38	10MHz	16QAM	37800	25RB#25	20.82	PASS
Band38	10MHz	QPSK	37800	50RB#0	21.77	PASS
Band38	10MHz	16QAM	37800	50RB#0	20.77	PASS
Band38	10MHz	QPSK	38000	1RB#0	22.64	PASS
Band38	10MHz	16QAM	38000	1RB#0	21.43	PASS
Band38	10MHz	QPSK	38000	1RB#24	22.86	PASS
Band38	10MHz	16QAM	38000	1RB#24	21.64	PASS
Band38	10MHz	QPSK	38000	1RB#49	22.62	PASS
Band38	10MHz	16QAM	38000	1RB#49	21.37	PASS
Band38	10MHz	QPSK	38000	25RB#0	21.60	PASS
Band38	10MHz	16QAM	38000	25RB#0	20.55	PASS
Band38	10MHz	QPSK	38000	25RB#12	21.60	PASS
Band38	10MHz	16QAM	38000	25RB#12	20.55	PASS
Band38	10MHz	QPSK	38000	25RB#25	21.55	PASS
Band38	10MHz	16QAM	38000	25RB#25	20.43	PASS

Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community,
 Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.
 Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com



Hotline
 400-003-0500
 www.anbotek.com.cn



Band38	10MHz	QPSK	38000	50RB#0	21.50	PASS
Band38	10MHz	16QAM	38000	50RB#0	20.45	PASS
Band38	10MHz	QPSK	38200	1RB#0	22.60	PASS
Band38	10MHz	16QAM	38200	1RB#0	21.51	PASS
Band38	10MHz	QPSK	38200	1RB#24	22.92	PASS
Band38	10MHz	16QAM	38200	1RB#24	21.85	PASS
Band38	10MHz	QPSK	38200	1RB#49	22.77	PASS
Band38	10MHz	16QAM	38200	1RB#49	21.73	PASS
Band38	10MHz	QPSK	38200	25RB#0	21.63	PASS
Band38	10MHz	16QAM	38200	25RB#0	20.54	PASS
Band38	10MHz	QPSK	38200	25RB#12	21.63	PASS
Band38	10MHz	16QAM	38200	25RB#12	20.54	PASS
Band38	10MHz	QPSK	38200	25RB#25	21.71	PASS
Band38	10MHz	16QAM	38200	25RB#25	20.66	PASS
Band38	10MHz	QPSK	38200	50RB#0	21.66	PASS
Band38	10MHz	16QAM	38200	50RB#0	20.56	PASS
Band38	15MHz	QPSK	37825	1RB#0	22.73	PASS
Band38	15MHz	16QAM	37825	1RB#0	22.05	PASS
Band38	15MHz	QPSK	37825	1RB#38	22.77	PASS
Band38	15MHz	16QAM	37825	1RB#38	22.15	PASS
Band38	15MHz	QPSK	37825	1RB#74	22.64	PASS
Band38	15MHz	16QAM	37825	1RB#74	21.90	PASS
Band38	15MHz	QPSK	37825	38RB#0	21.83	PASS
Band38	15MHz	16QAM	37825	38RB#0	21.86	PASS
Band38	15MHz	QPSK	37825	38RB#18	21.80	PASS
Band38	15MHz	16QAM	37825	38RB#18	21.76	PASS
Band38	15MHz	QPSK	37825	38RB#37	21.68	PASS
Band38	15MHz	16QAM	37825	38RB#37	21.74	PASS
Band38	15MHz	QPSK	37825	75RB#0	21.65	PASS
Band38	15MHz	16QAM	37825	75RB#0	20.80	PASS
Band38	15MHz	QPSK	38000	1RB#0	22.67	PASS
Band38	15MHz	16QAM	38000	1RB#0	21.52	PASS
Band38	15MHz	QPSK	38000	1RB#38	22.79	PASS
Band38	15MHz	16QAM	38000	1RB#38	21.60	PASS
Band38	15MHz	QPSK	38000	1RB#74	22.57	PASS
Band38	15MHz	16QAM	38000	1RB#74	21.39	PASS
Band38	15MHz	QPSK	38000	38RB#0	21.68	PASS
Band38	15MHz	16QAM	38000	38RB#0	21.67	PASS
Band38	15MHz	QPSK	38000	38RB#18	21.68	PASS
Band38	15MHz	16QAM	38000	38RB#18	21.67	PASS
Band38	15MHz	QPSK	38000	38RB#37	21.71	PASS
Band38	15MHz	16QAM	38000	38RB#37	21.68	PASS

Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community,
 Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.
 Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com



Hotline
 400-003-0500
 www.anbotek.com.cn



Band38	15MHz	QPSK	38000	75RB#0	21.68	PASS
Band38	15MHz	16QAM	38000	75RB#0	20.58	PASS
Band38	15MHz	QPSK	38175	1RB#0	22.50	PASS
Band38	15MHz	16QAM	38175	1RB#0	21.39	PASS
Band38	15MHz	QPSK	38175	1RB#38	22.69	PASS
Band38	15MHz	16QAM	38175	1RB#38	21.58	PASS
Band38	15MHz	QPSK	38175	1RB#74	22.64	PASS
Band38	15MHz	16QAM	38175	1RB#74	21.60	PASS
Band38	15MHz	QPSK	38175	38RB#0	21.74	PASS
Band38	15MHz	16QAM	38175	38RB#0	21.73	PASS
Band38	15MHz	QPSK	38175	38RB#18	21.72	PASS
Band38	15MHz	16QAM	38175	38RB#18	21.73	PASS
Band38	15MHz	QPSK	38175	38RB#37	21.75	PASS
Band38	15MHz	16QAM	38175	38RB#37	21.78	PASS
Band38	15MHz	QPSK	38175	75RB#0	21.75	PASS
Band38	15MHz	16QAM	38175	75RB#0	20.58	PASS
Band38	20MHz	QPSK	37850	1RB#0	22.57	PASS
Band38	20MHz	16QAM	37850	1RB#0	21.74	PASS
Band38	20MHz	QPSK	37850	1RB#49	22.93	PASS
Band38	20MHz	16QAM	37850	1RB#49	22.05	PASS
Band38	20MHz	QPSK	37850	1RB#99	22.50	PASS
Band38	20MHz	16QAM	37850	1RB#99	21.53	PASS
Band38	20MHz	QPSK	37850	50RB#0	21.73	PASS
Band38	20MHz	16QAM	37850	50RB#0	20.75	PASS
Band38	20MHz	QPSK	37850	50RB#25	21.73	PASS
Band38	20MHz	16QAM	37850	50RB#25	20.73	PASS
Band38	20MHz	QPSK	37850	50RB#50	21.70	PASS
Band38	20MHz	16QAM	37850	50RB#50	20.64	PASS
Band38	20MHz	QPSK	37850	100RB#0	21.73	PASS
Band38	20MHz	16QAM	37850	100RB#0	20.71	PASS
Band38	20MHz	QPSK	38000	1RB#0	22.49	PASS
Band38	20MHz	16QAM	38000	1RB#0	21.05	PASS
Band38	20MHz	QPSK	38000	1RB#49	22.82	PASS
Band38	20MHz	16QAM	38000	1RB#49	21.38	PASS
Band38	20MHz	QPSK	38000	1RB#99	22.41	PASS
Band38	20MHz	16QAM	38000	1RB#99	20.93	PASS
Band38	20MHz	QPSK	38000	50RB#0	21.56	PASS
Band38	20MHz	16QAM	38000	50RB#0	20.57	PASS
Band38	20MHz	QPSK	38000	50RB#25	21.60	PASS
Band38	20MHz	16QAM	38000	50RB#25	20.57	PASS
Band38	20MHz	QPSK	38000	50RB#50	21.43	PASS
Band38	20MHz	16QAM	38000	50RB#50	20.36	PASS

Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community,
 Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.
 Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com



Hotline
 400-003-0500
 www.anbotek.com.cn



Band38	20MHz	QPSK	38000	100RB#0	21.47	PASS
Band38	20MHz	16QAM	38000	100RB#0	20.45	PASS
Band38	20MHz	QPSK	38150	1RB#0	22.38	PASS
Band38	20MHz	16QAM	38150	1RB#0	21.14	PASS
Band38	20MHz	QPSK	38150	1RB#49	22.81	PASS
Band38	20MHz	16QAM	38150	1RB#49	21.60	PASS
Band38	20MHz	QPSK	38150	1RB#99	22.54	PASS
Band38	20MHz	16QAM	38150	1RB#99	21.35	PASS
Band38	20MHz	QPSK	38150	50RB#0	21.49	PASS
Band38	20MHz	16QAM	38150	50RB#0	20.37	PASS
Band38	20MHz	QPSK	38150	50RB#25	21.44	PASS
Band38	20MHz	16QAM	38150	50RB#25	20.32	PASS
Band38	20MHz	QPSK	38150	50RB#50	21.57	PASS
Band38	20MHz	16QAM	38150	50RB#50	20.44	PASS
Band38	20MHz	QPSK	38150	100RB#0	21.56	PASS
Band38	20MHz	16QAM	38150	100RB#0	20.46	PASS



Appendix B: Peak-to-Average Ratio(CCDF)

Test Result

Band	Bandwidth	Modulation	Channel	RB Configuration	Result(dB)	Limit(dB)	Verdict
Band38	5MHz	QPSK	37775	1RB#0	8.81	13	PASS
Band38	5MHz	16QAM	37775	1RB#0	9.25	13	PASS
Band38	5MHz	QPSK	37775	25RB#0	9.15	13	PASS
Band38	5MHz	16QAM	37775	25RB#0	9.05	13	PASS
Band38	5MHz	QPSK	38000	1RB#0	7.33	13	PASS
Band38	5MHz	16QAM	38000	1RB#0	8.11	13	PASS
Band38	5MHz	QPSK	38000	25RB#0	7.58	13	PASS
Band38	5MHz	16QAM	38000	25RB#0	8.34	13	PASS
Band38	5MHz	QPSK	38225	1RB#0	7.44	13	PASS
Band38	5MHz	16QAM	38225	1RB#0	7.89	13	PASS
Band38	5MHz	QPSK	38225	25RB#0	8.08	13	PASS
Band38	5MHz	16QAM	38225	25RB#0	8.71	13	PASS
Band38	10MHz	QPSK	37800	1RB#0	8.71	13	PASS
Band38	10MHz	16QAM	37800	1RB#0	9.28	13	PASS
Band38	10MHz	QPSK	37800	50RB#0	9.88	13	PASS
Band38	10MHz	16QAM	37800	50RB#0	10.09	13	PASS
Band38	10MHz	QPSK	38000	1RB#0	7.46	13	PASS
Band38	10MHz	16QAM	38000	1RB#0	8.16	13	PASS
Band38	10MHz	QPSK	38000	50RB#0	8.40	13	PASS
Band38	10MHz	16QAM	38000	50RB#0	8.69	13	PASS
Band38	10MHz	QPSK	38200	1RB#0	7.24	13	PASS
Band38	10MHz	16QAM	38200	1RB#0	8.13	13	PASS
Band38	10MHz	QPSK	38200	50RB#0	7.78	13	PASS
Band38	10MHz	16QAM	38200	50RB#0	8.69	13	PASS
Band38	15MHz	QPSK	37825	1RB#0	8.44	13	PASS
Band38	15MHz	16QAM	37825	1RB#0	9.80	13	PASS
Band38	15MHz	QPSK	37825	75RB#0	9.62	13	PASS
Band38	15MHz	16QAM	37825	75RB#0	9.76	13	PASS
Band38	15MHz	QPSK	38000	1RB#0	8.04	13	PASS
Band38	15MHz	16QAM	38000	1RB#0	8.98	13	PASS
Band38	15MHz	QPSK	38000	75RB#0	8.04	13	PASS
Band38	15MHz	16QAM	38000	75RB#0	9.42	13	PASS
Band38	15MHz	QPSK	38175	1RB#0	6.78	13	PASS
Band38	15MHz	16QAM	38175	1RB#0	7.99	13	PASS
Band38	15MHz	QPSK	38175	75RB#0	7.90	13	PASS
Band38	15MHz	16QAM	38175	75RB#0	9.29	13	PASS
Band38	20MHz	QPSK	37850	1RB#0	9.17	13	PASS

Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.
Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com



Hotline
400-003-0500
www.anbotek.com.cn



Band38	20MHz	16QAM	37850	1RB#0	8.78	13	PASS
Band38	20MHz	QPSK	37850	100RB#0	9.01	13	PASS
Band38	20MHz	16QAM	37850	100RB#0	9.86	13	PASS
Band38	20MHz	QPSK	38000	1RB#0	8.12	13	PASS
Band38	20MHz	16QAM	38000	1RB#0	8.98	13	PASS
Band38	20MHz	QPSK	38000	100RB#0	8.51	13	PASS
Band38	20MHz	16QAM	38000	100RB#0	8.80	13	PASS
Band38	20MHz	QPSK	38150	1RB#0	7.38	13	PASS
Band38	20MHz	16QAM	38150	1RB#0	8.28	13	PASS
Band38	20MHz	QPSK	38150	100RB#0	8.03	13	PASS
Band38	20MHz	16QAM	38150	100RB#0	8.93	13	PASS

Shenzhen Anbotek Compliance Laboratory Limited


Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community,
Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.
Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com



Hotline
400-003-0500
www.anbotek.com.cn



Test Graphs

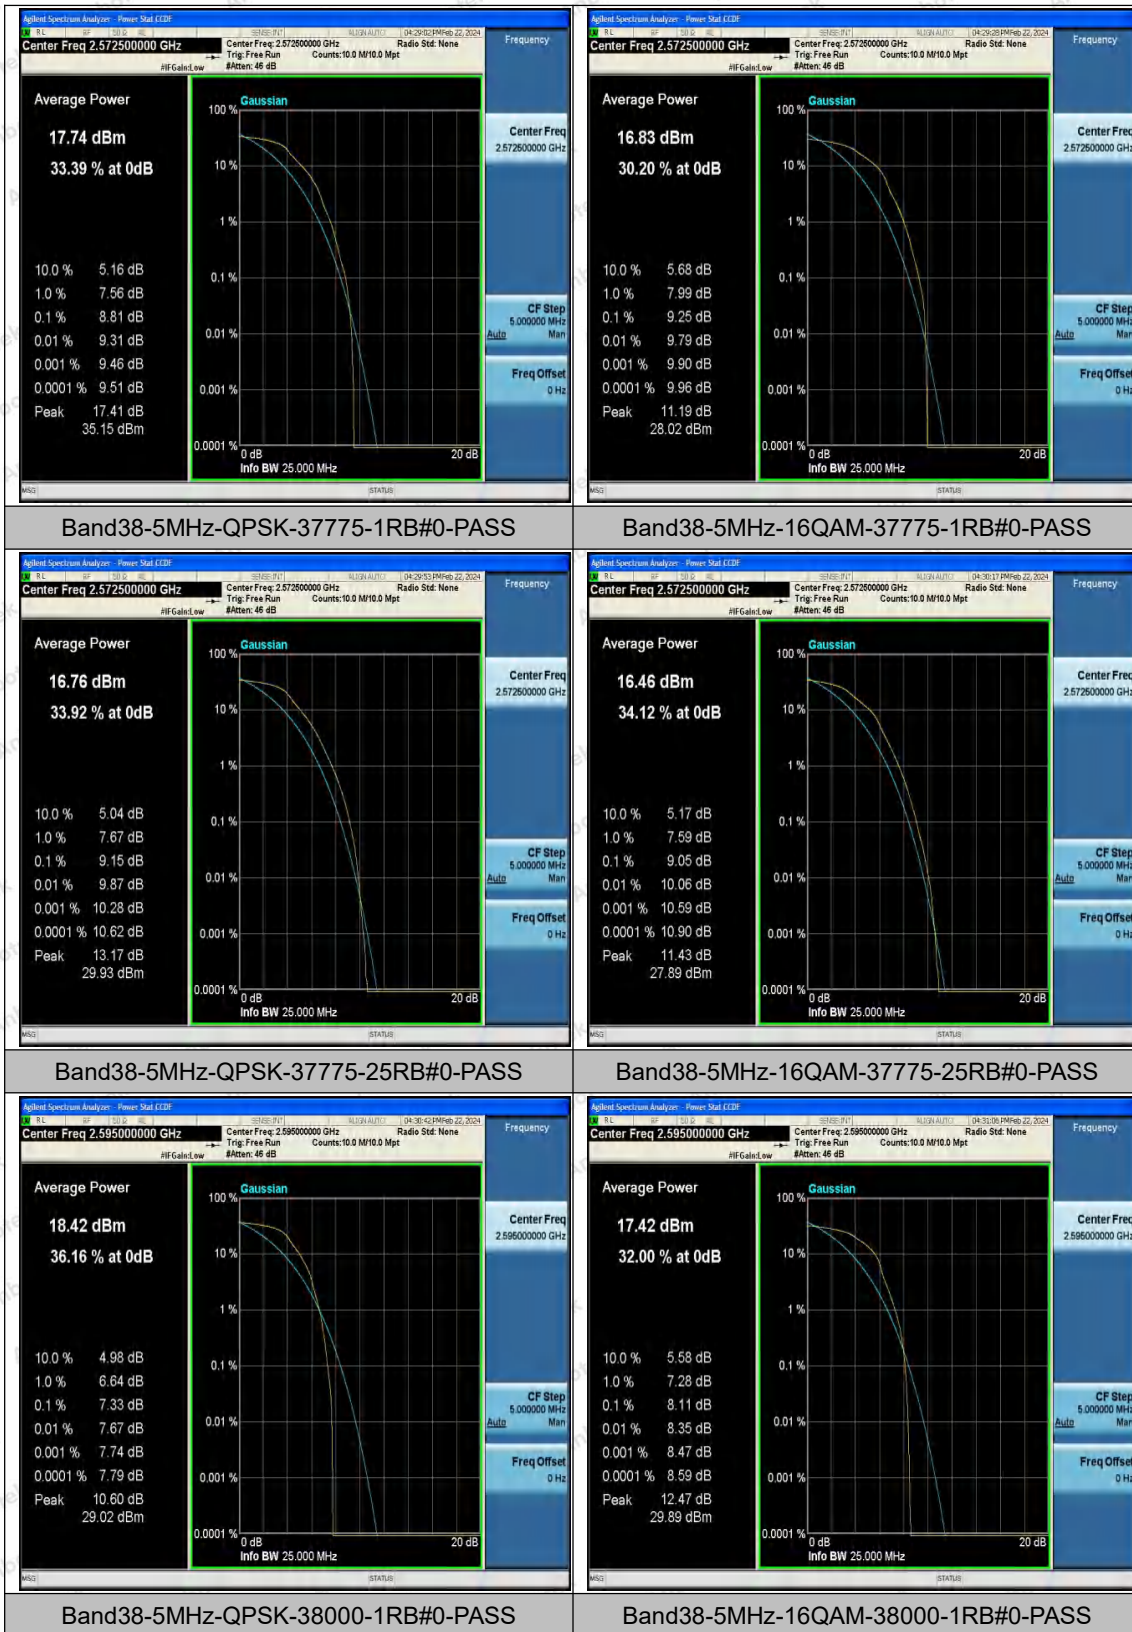


Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.
Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com





Hotline
400-003-0500
www.anbotek.com.cn




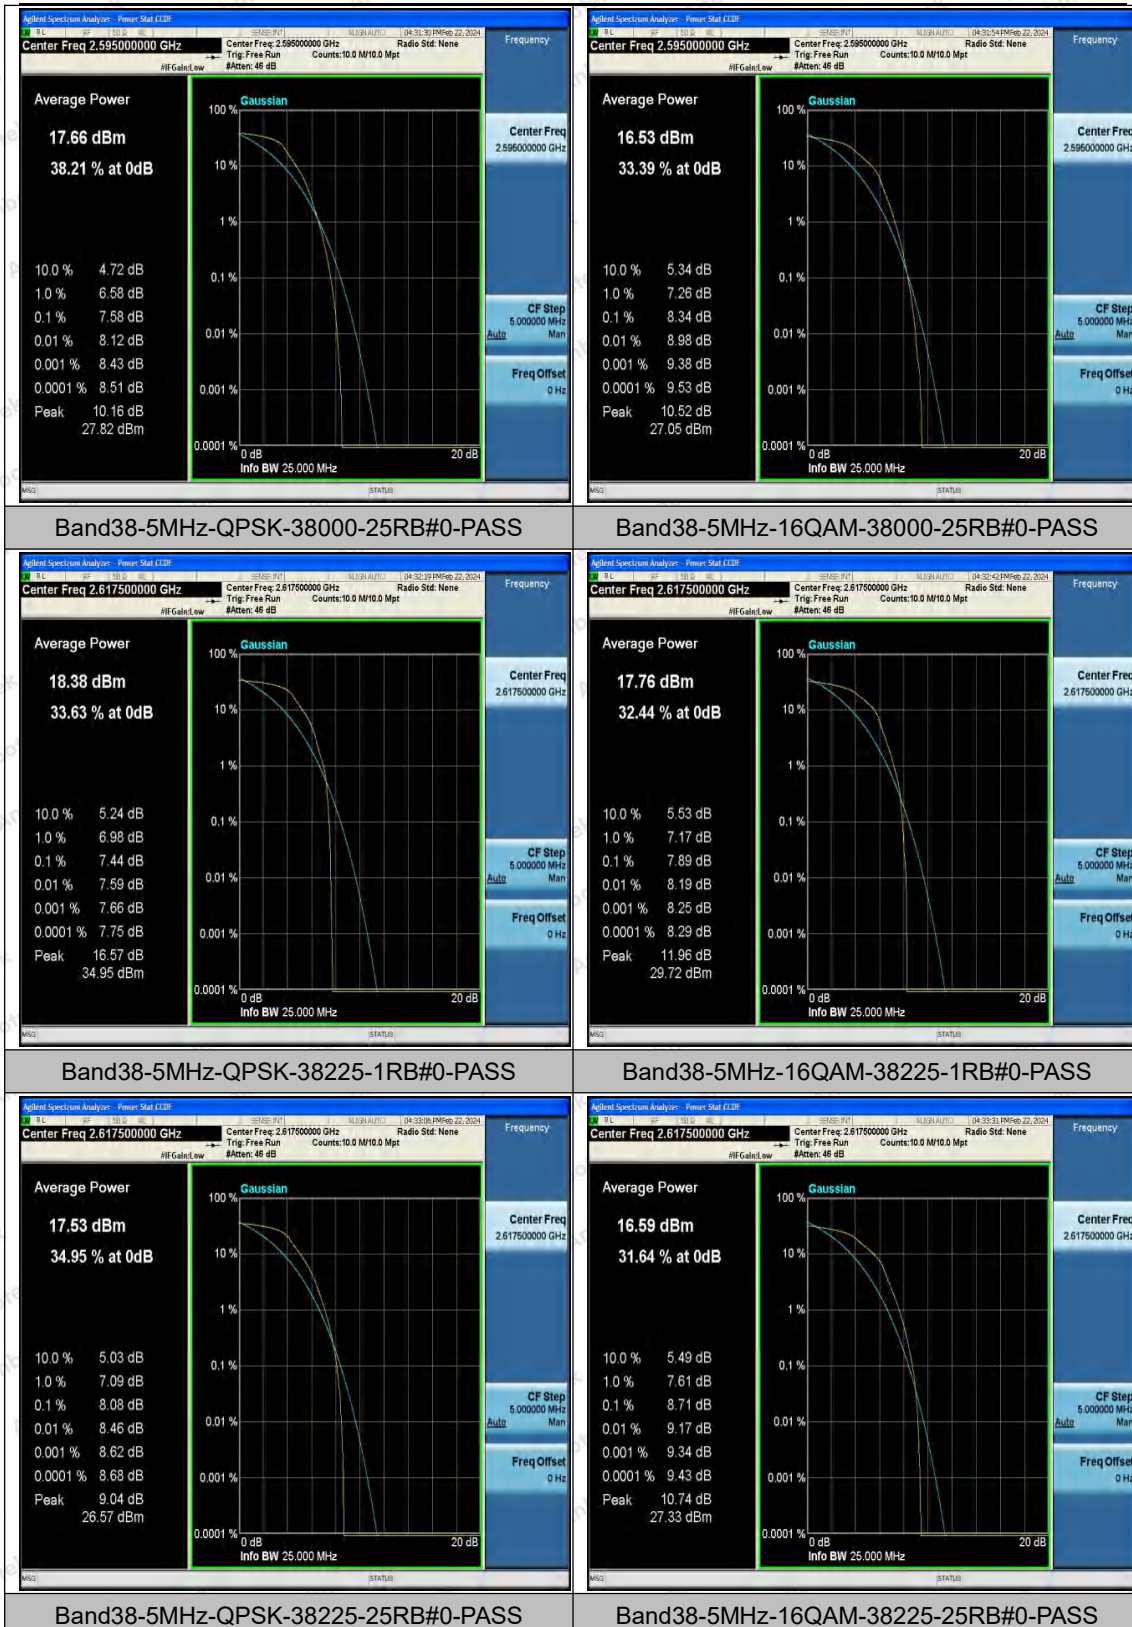





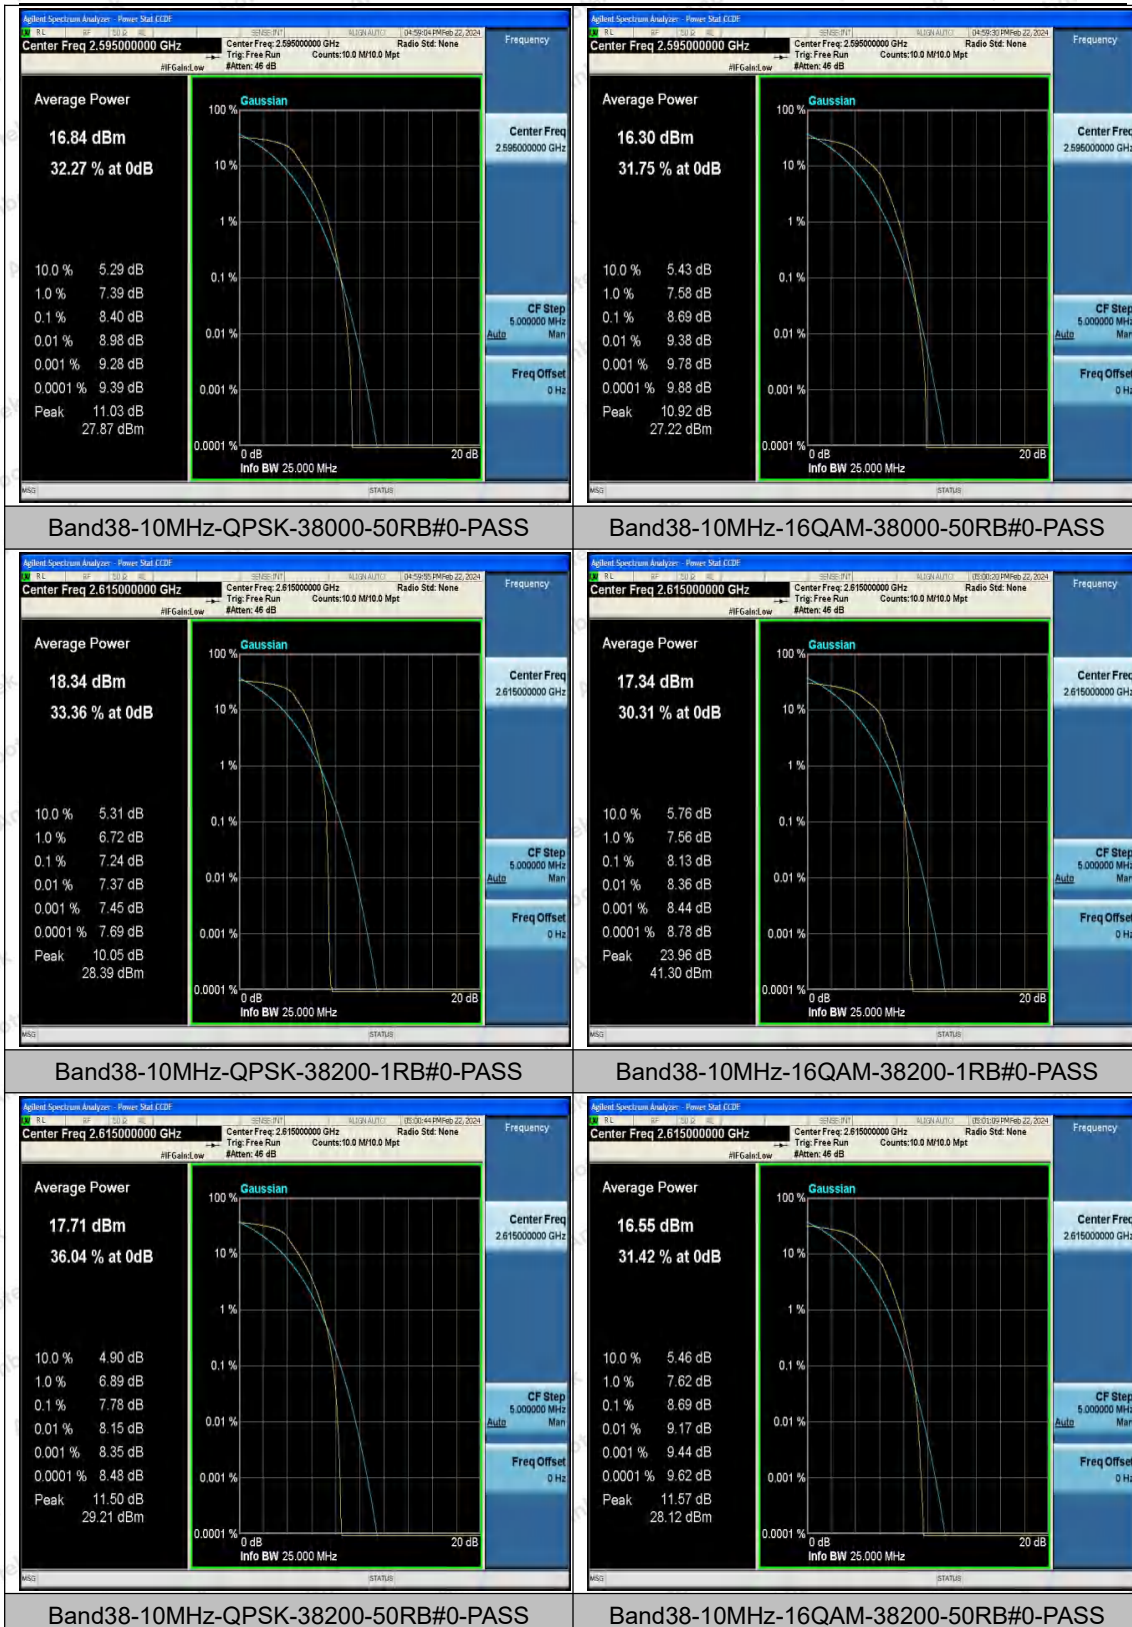

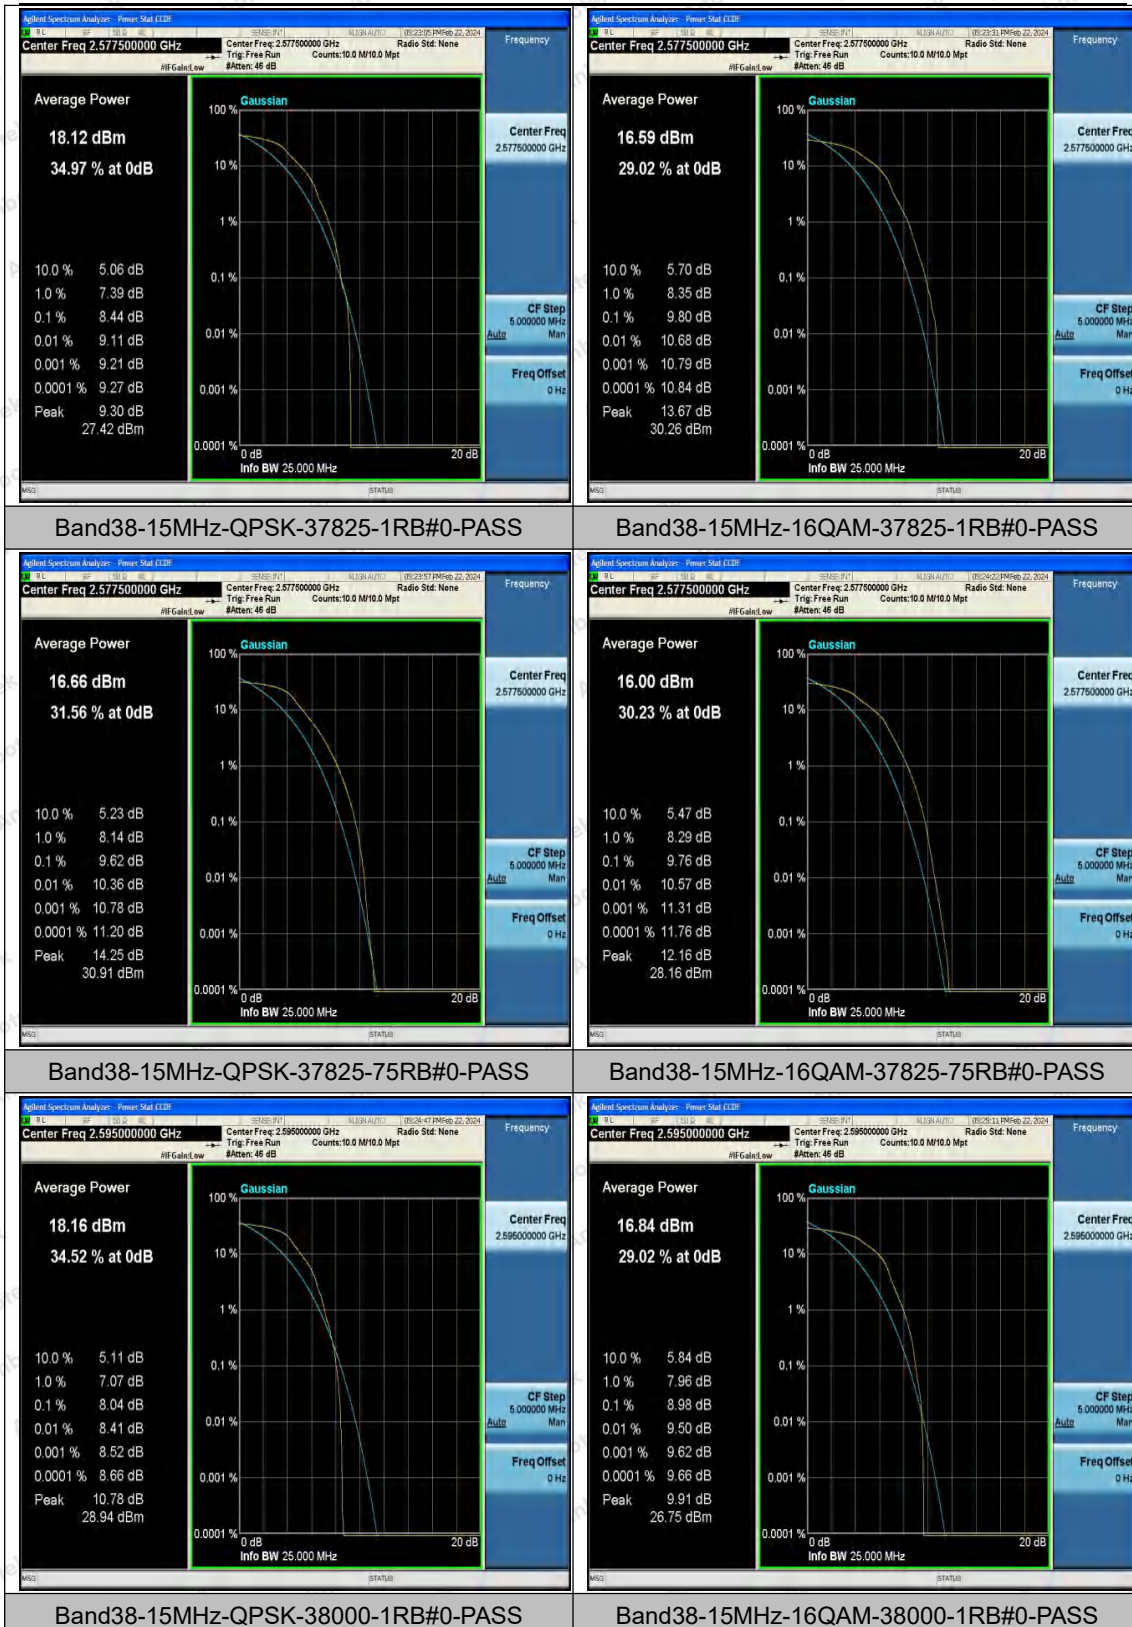

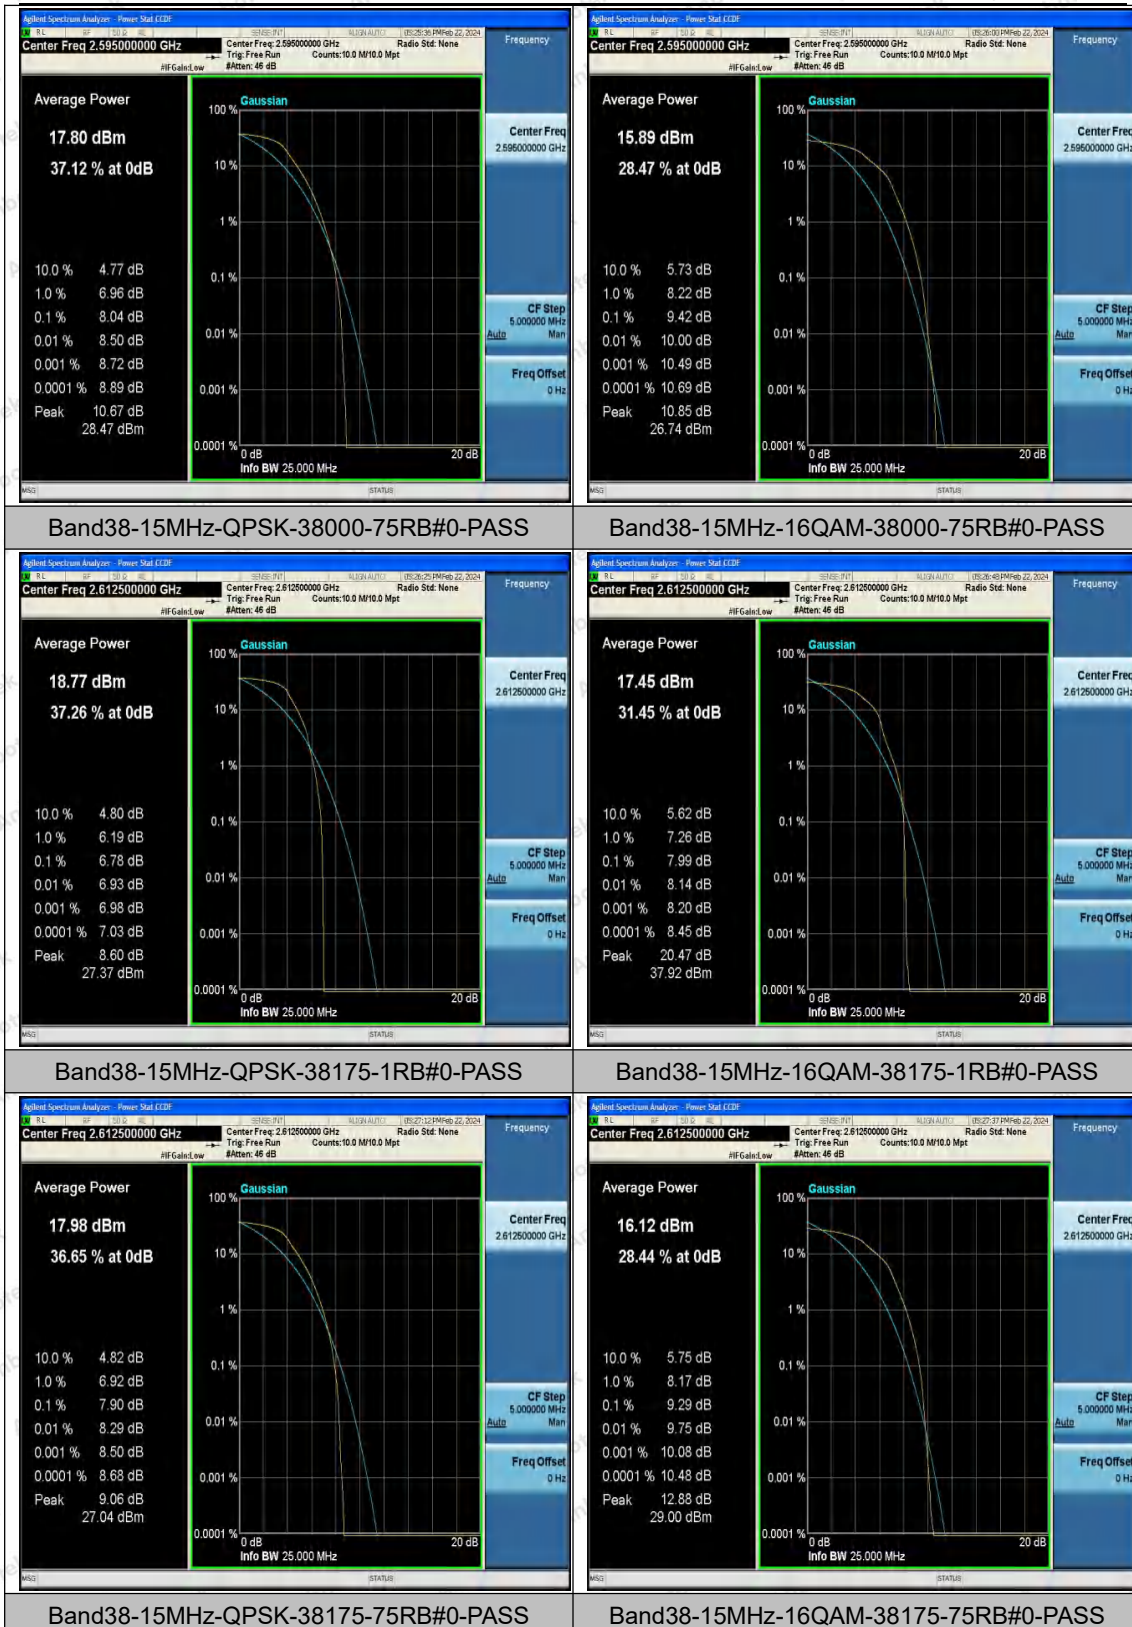

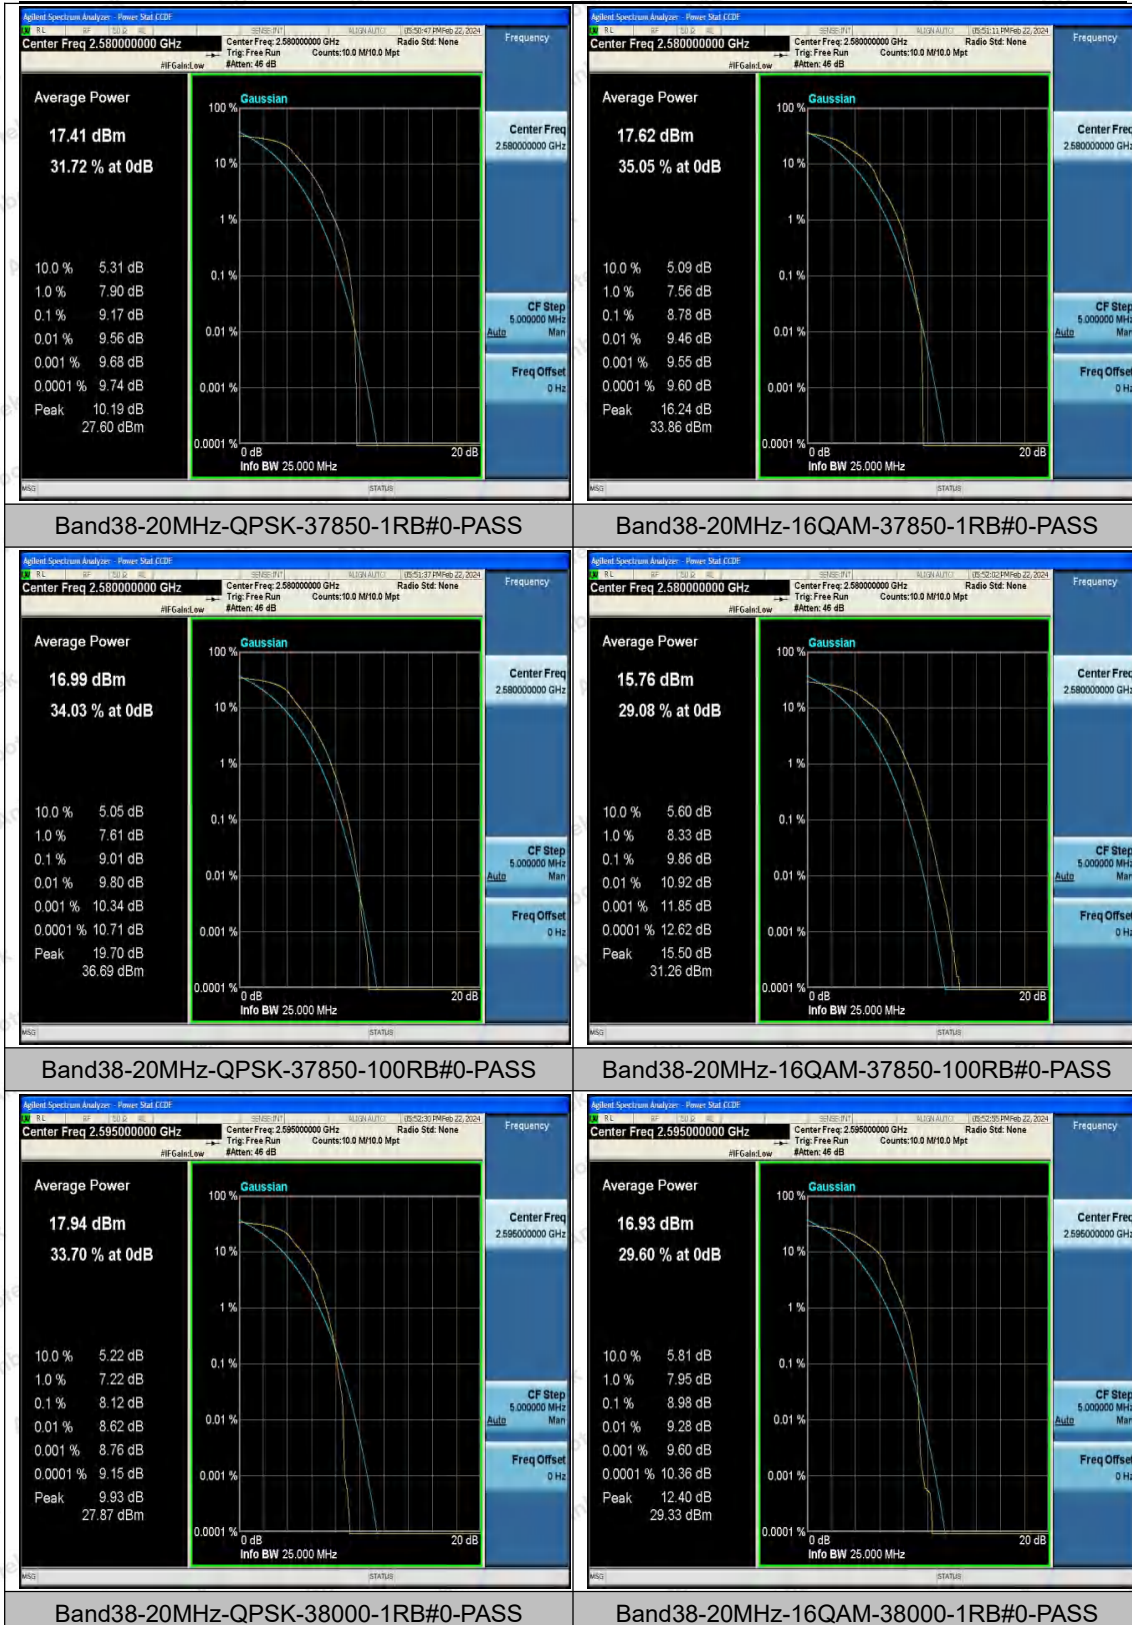

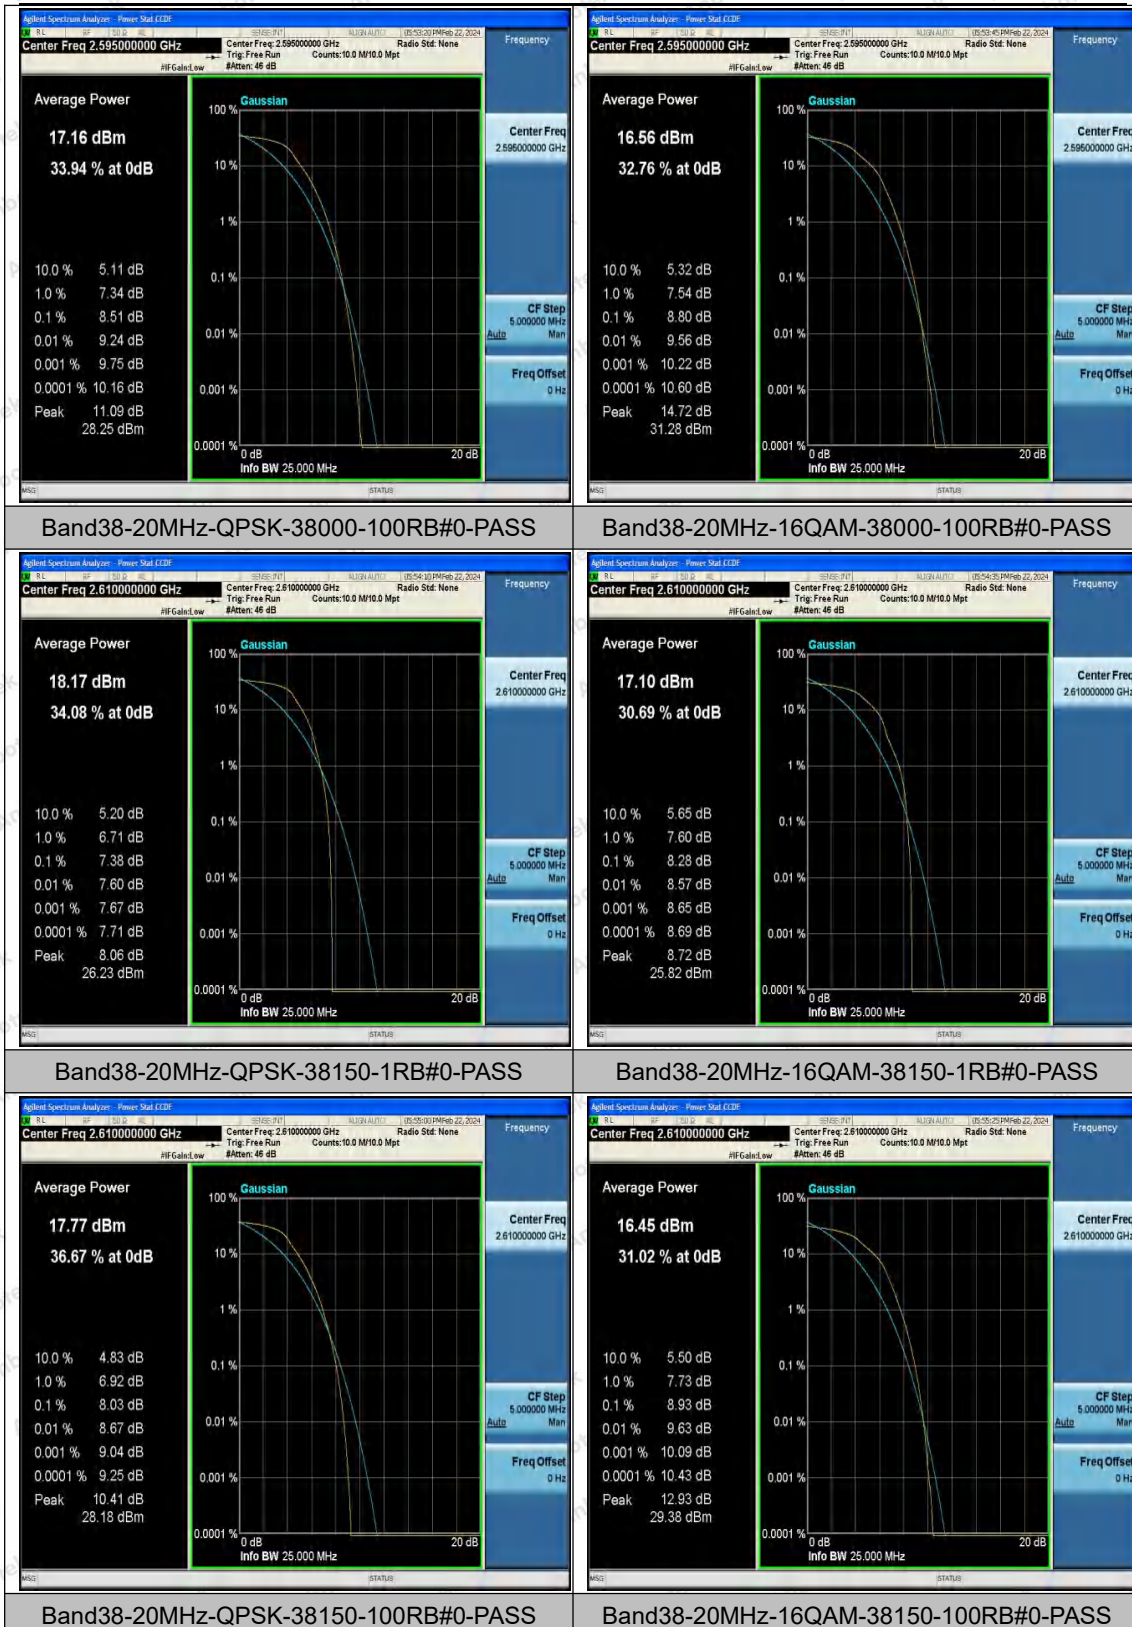

Appendix C: 26dB Bandwidth and Occupied Bandwidth

Test Result

Band	Bandwidth	Modulation	Channel	RB Configuration	Occupied Bandwidth (MHz)	26dB Bandwidth (MHz)	Verdict
Band38	5MHz	QPSK	37775	25RB#0	4.5007	6.333	PASS
Band38	5MHz	16QAM	37775	25RB#0	4.5001	8.222	PASS
Band38	5MHz	QPSK	38000	25RB#0	4.5097	6.274	PASS
Band38	5MHz	16QAM	38000	25RB#0	4.5089	6.796	PASS
Band38	5MHz	QPSK	38225	25RB#0	4.5046	5.984	PASS
Band38	5MHz	16QAM	38225	25RB#0	4.5067	6.184	PASS
Band38	10MHz	QPSK	37800	50RB#0	8.9850	12.71	PASS
Band38	10MHz	16QAM	37800	50RB#0	9.0172	13.49	PASS
Band38	10MHz	QPSK	38000	50RB#0	9.0081	15.82	PASS
Band38	10MHz	16QAM	38000	50RB#0	9.0205	14.87	PASS
Band38	10MHz	QPSK	38200	50RB#0	8.9923	15.09	PASS
Band38	10MHz	16QAM	38200	50RB#0	8.9899	13.18	PASS
Band38	15MHz	QPSK	37825	75RB#0	13.338	18.31	PASS
Band38	15MHz	16QAM	37825	75RB#0	13.534	22.86	PASS
Band38	15MHz	QPSK	38000	75RB#0	13.512	18.96	PASS
Band38	15MHz	16QAM	38000	75RB#0	13.555	21.25	PASS
Band38	15MHz	QPSK	38175	75RB#0	13.469	21.06	PASS
Band38	15MHz	16QAM	38175	75RB#0	13.535	25.23	PASS
Band38	20MHz	QPSK	37850	100RB#0	17.911	24.31	PASS
Band38	20MHz	16QAM	37850	100RB#0	17.940	27.20	PASS
Band38	20MHz	QPSK	38000	100RB#0	17.947	28.09	PASS
Band38	20MHz	16QAM	38000	100RB#0	17.971	25.82	PASS
Band38	20MHz	QPSK	38150	100RB#0	18.009	26.42	PASS
Band38	20MHz	16QAM	38150	100RB#0	17.914	32.02	PASS



Test Graphs




Shenzhen Anbotek Compliance Laboratory Limited


Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.
Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com




Hotline
400-003-0500
www.anbotek.com.cn



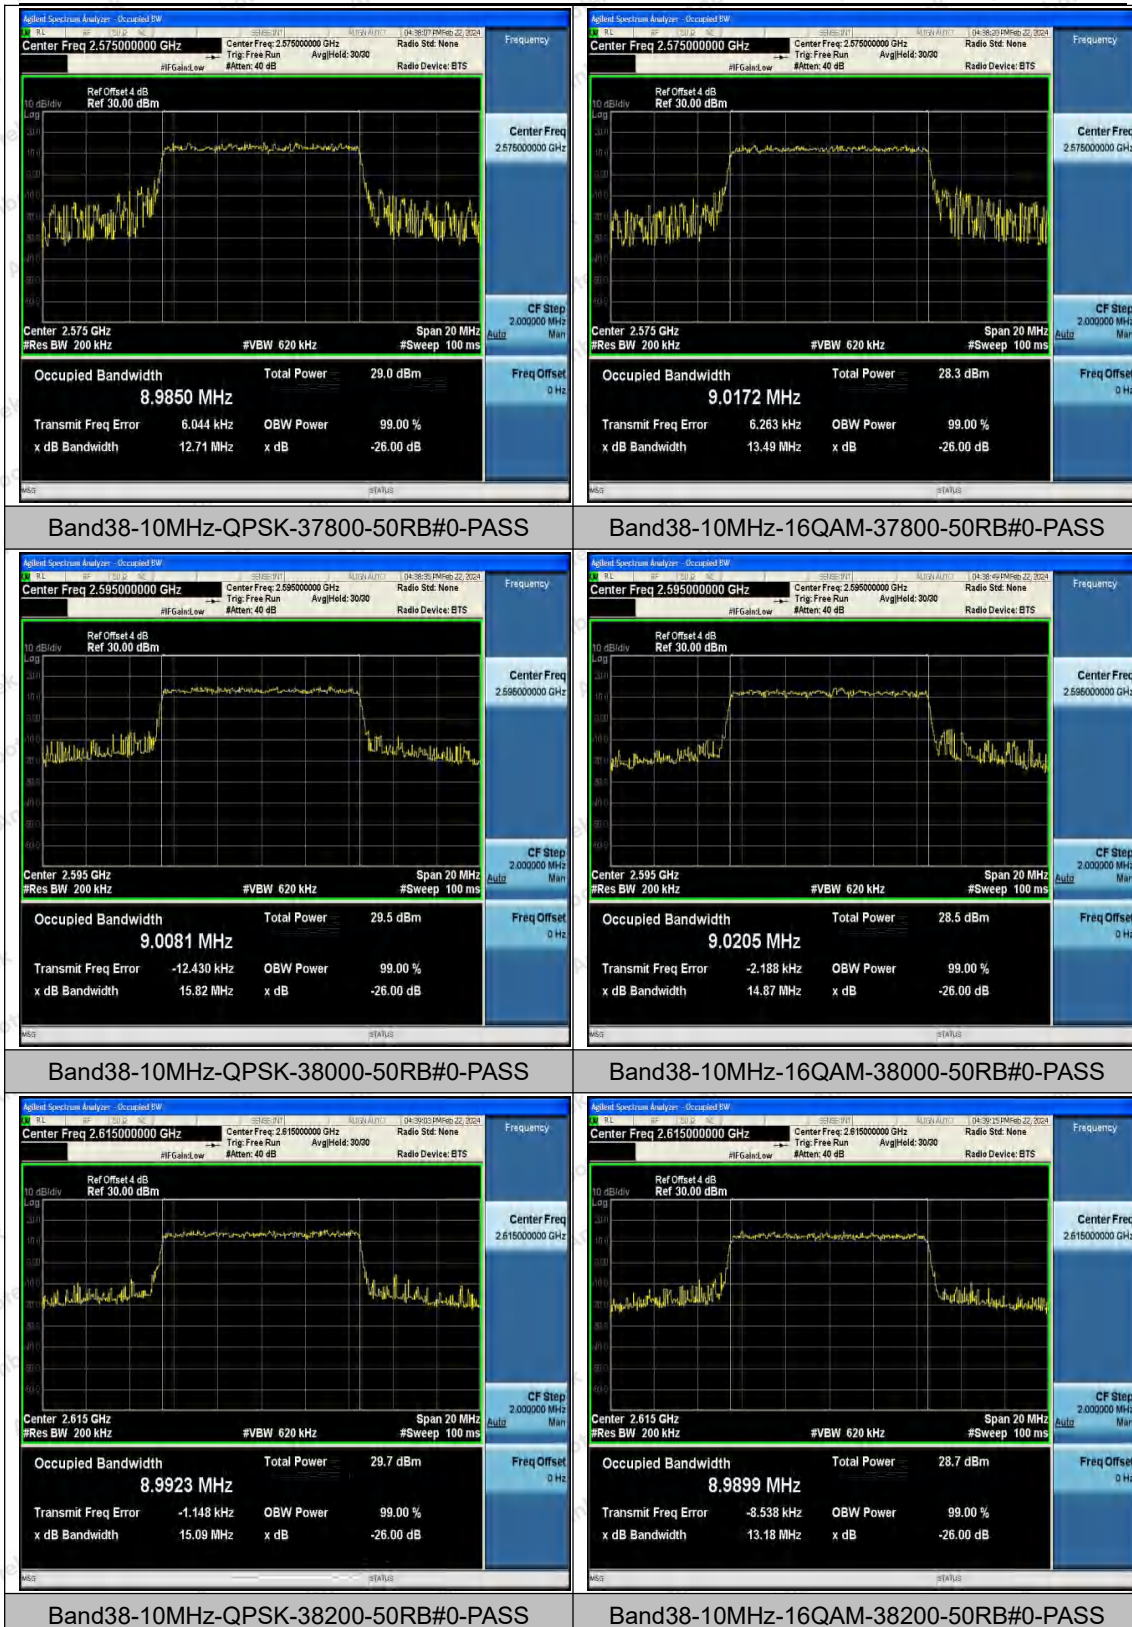

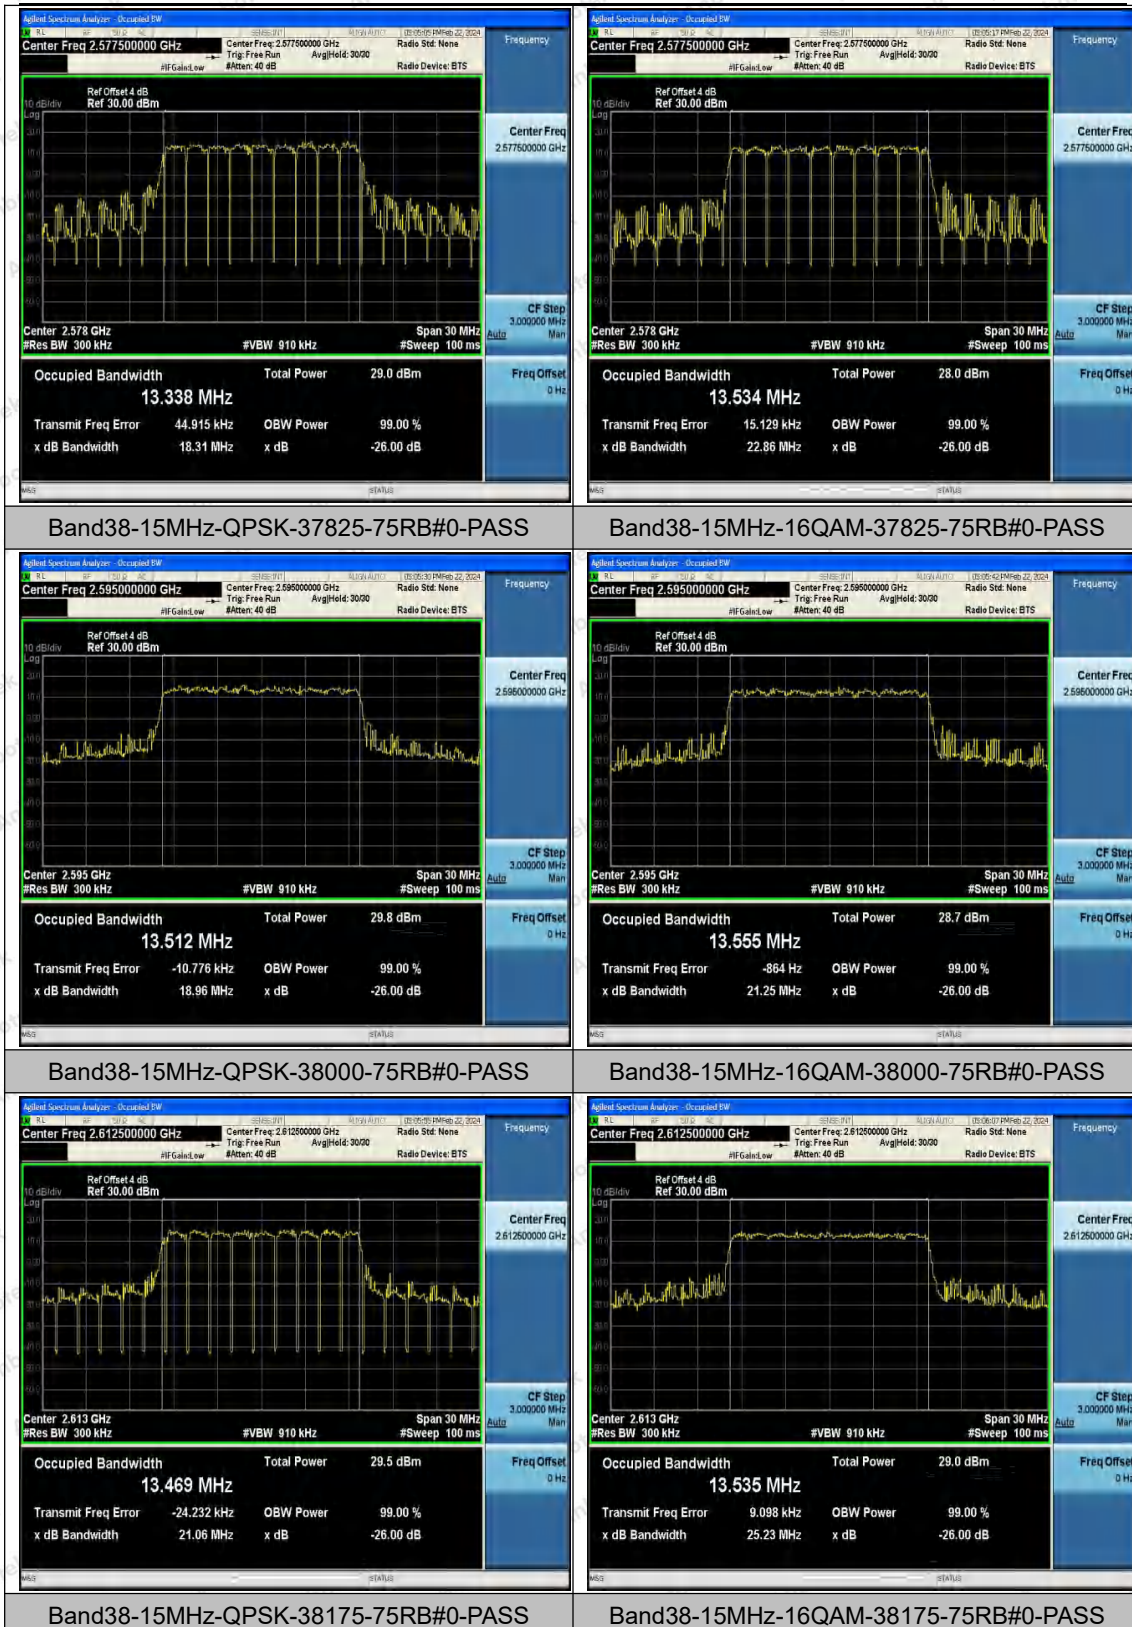

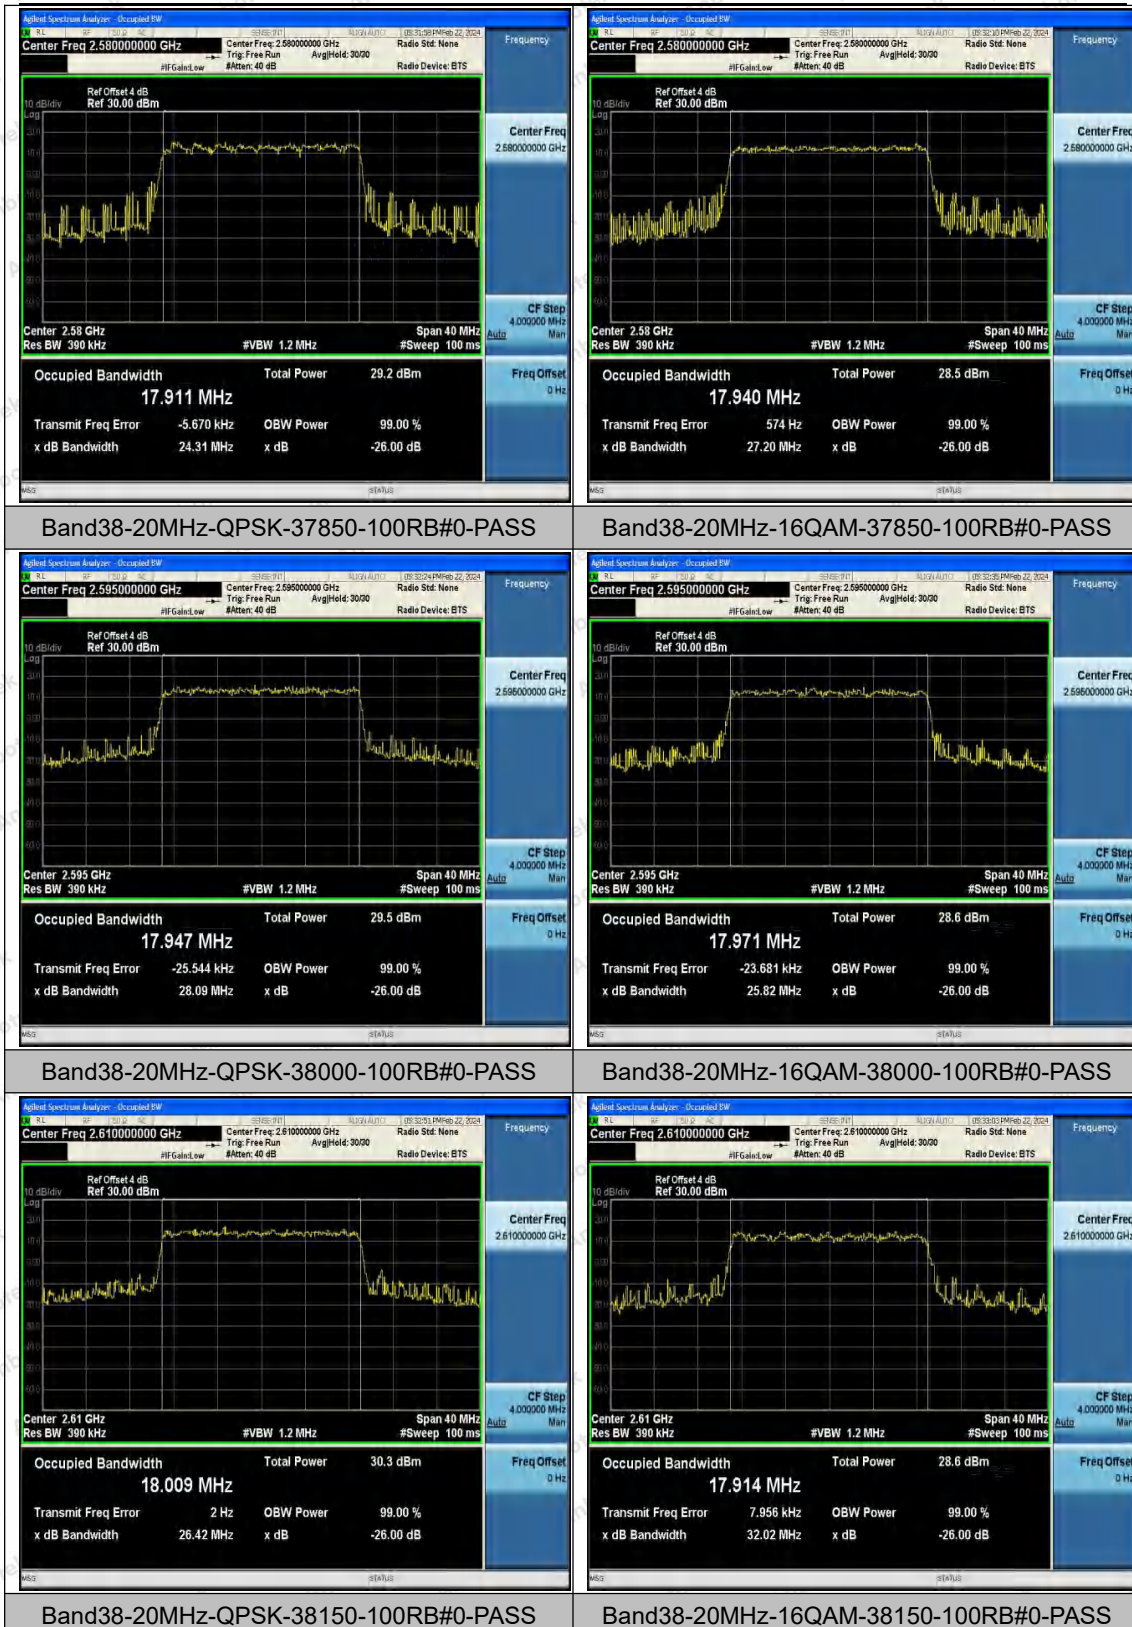

Appendix D: Band Edge


Test Result

Band	Bandwidth	Modulation	Channel	RB Configuration	Result(dBm)	Verdict
Band38	5MHz	QPSK	37775	1RB#0	-19.76	PASS
Band38	5MHz	16QAM	37775	1RB#0	-18.39	PASS
Band38	5MHz	QPSK	37775	1RB#24	-32.16	PASS
Band38	5MHz	16QAM	37775	1RB#24	-33.98	PASS
Band38	5MHz	QPSK	37775	25RB#0	-46.46	PASS
Band38	5MHz	16QAM	37775	25RB#0	-51.66	PASS
Band38	5MHz	QPSK	38225	1RB#0	-30.51	PASS
Band38	5MHz	16QAM	38225	1RB#0	-33.68	PASS
Band38	5MHz	QPSK	38225	1RB#24	-16.30	PASS
Band38	5MHz	16QAM	38225	1RB#24	-19.22	PASS
Band38	5MHz	QPSK	38225	25RB#0	-26.99	PASS
Band38	5MHz	16QAM	38225	25RB#0	-29.70	PASS
Band38	10MHz	QPSK	37800	1RB#0	-21.31	PASS
Band38	10MHz	16QAM	37800	1RB#0	-22.85	PASS
Band38	10MHz	QPSK	37800	1RB#49	-30.02	PASS
Band38	10MHz	16QAM	37800	1RB#49	-32.34	PASS
Band38	10MHz	QPSK	37800	50RB#0	-48.90	PASS
Band38	10MHz	16QAM	37800	50RB#0	-49.38	PASS
Band38	10MHz	QPSK	38200	1RB#0	-28.79	PASS
Band38	10MHz	16QAM	38200	1RB#0	-30.41	PASS
Band38	10MHz	QPSK	38200	1RB#49	-18.31	PASS
Band38	10MHz	16QAM	38200	1RB#49	-19.72	PASS
Band38	10MHz	QPSK	38200	50RB#0	-24.94	PASS
Band38	10MHz	16QAM	38200	50RB#0	-27.80	PASS
Band38	15MHz	QPSK	37825	1RB#0	-20.83	PASS
Band38	15MHz	16QAM	37825	1RB#0	-21.35	PASS
Band38	15MHz	QPSK	37825	1RB#74	-28.98	PASS
Band38	15MHz	16QAM	37825	1RB#74	-31.71	PASS
Band38	15MHz	QPSK	37825	75RB#0	-46.09	PASS
Band38	15MHz	16QAM	37825	75RB#0	-46.63	PASS
Band38	15MHz	QPSK	38175	1RB#0	-28.20	PASS
Band38	15MHz	16QAM	38175	1RB#0	-30.52	PASS
Band38	15MHz	QPSK	38175	1RB#74	-19.82	PASS
Band38	15MHz	16QAM	38175	1RB#74	-23.23	PASS
Band38	15MHz	QPSK	38175	75RB#0	-21.71	PASS
Band38	15MHz	16QAM	38175	75RB#0	-25.44	PASS
Band38	20MHz	QPSK	37850	1RB#0	-22.12	PASS



Band38	20MHz	16QAM	37850	1RB#0	-25.26	PASS
Band38	20MHz	QPSK	37850	1RB#99	-36.10	PASS
Band38	20MHz	16QAM	37850	1RB#99	-49.75	PASS
Band38	20MHz	QPSK	37850	100RB#0	-46.54	PASS
Band38	20MHz	16QAM	37850	100RB#0	-46.87	PASS
Band38	20MHz	QPSK	38150	1RB#0	-29.68	PASS
Band38	20MHz	16QAM	38150	1RB#0	-31.24	PASS
Band38	20MHz	QPSK	38150	1RB#99	-23.27	PASS
Band38	20MHz	16QAM	38150	1RB#99	-25.72	PASS
Band38	20MHz	QPSK	38150	100RB#0	-26.60	PASS
Band38	20MHz	16QAM	38150	100RB#0	-28.67	PASS

Test Graphs

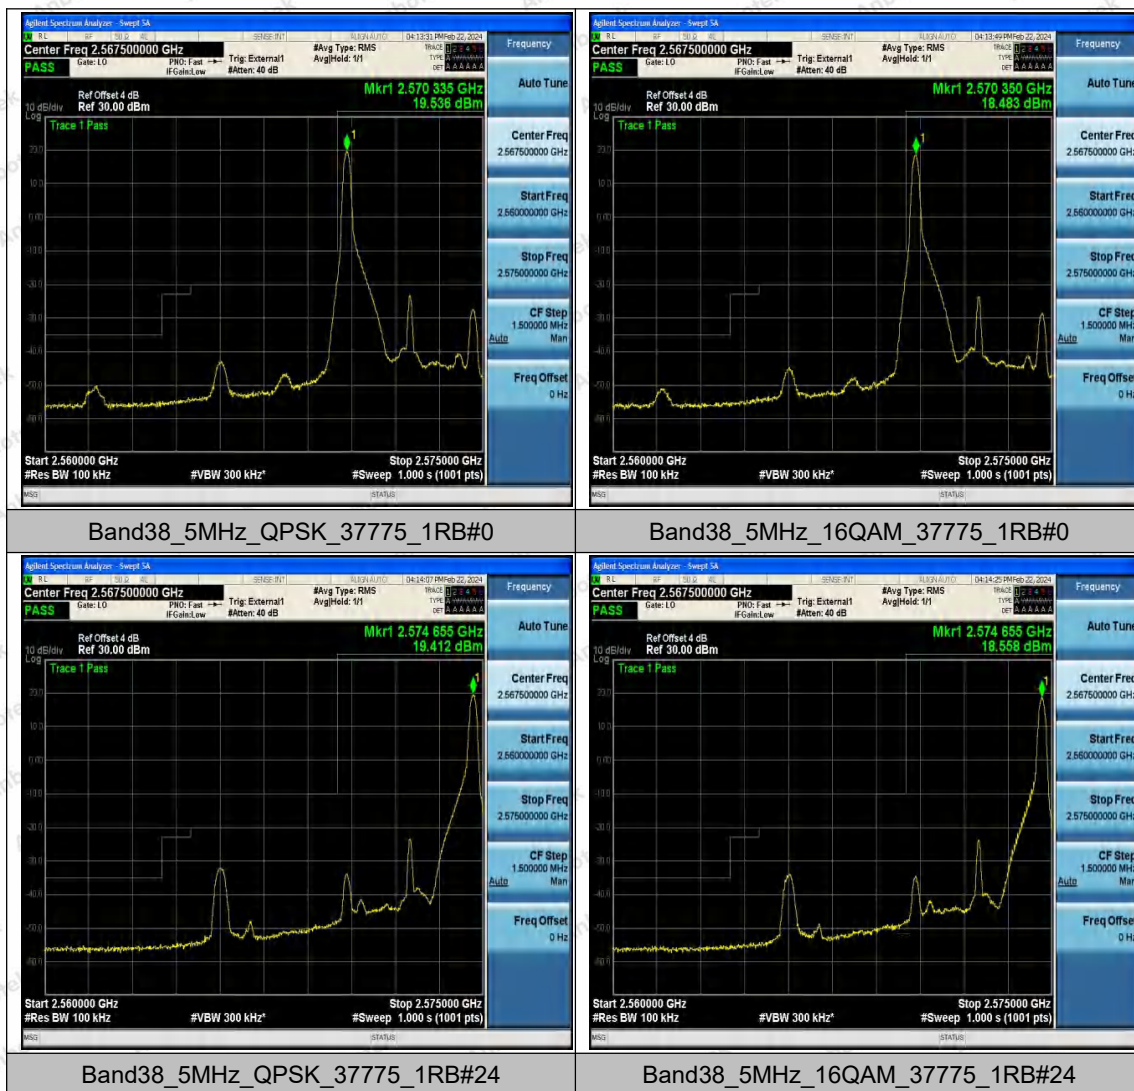

Shenzhen Anbotek Compliance Laboratory Limited


Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.
Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com




Hotline
400-003-0500
www.anbotek.com.cn





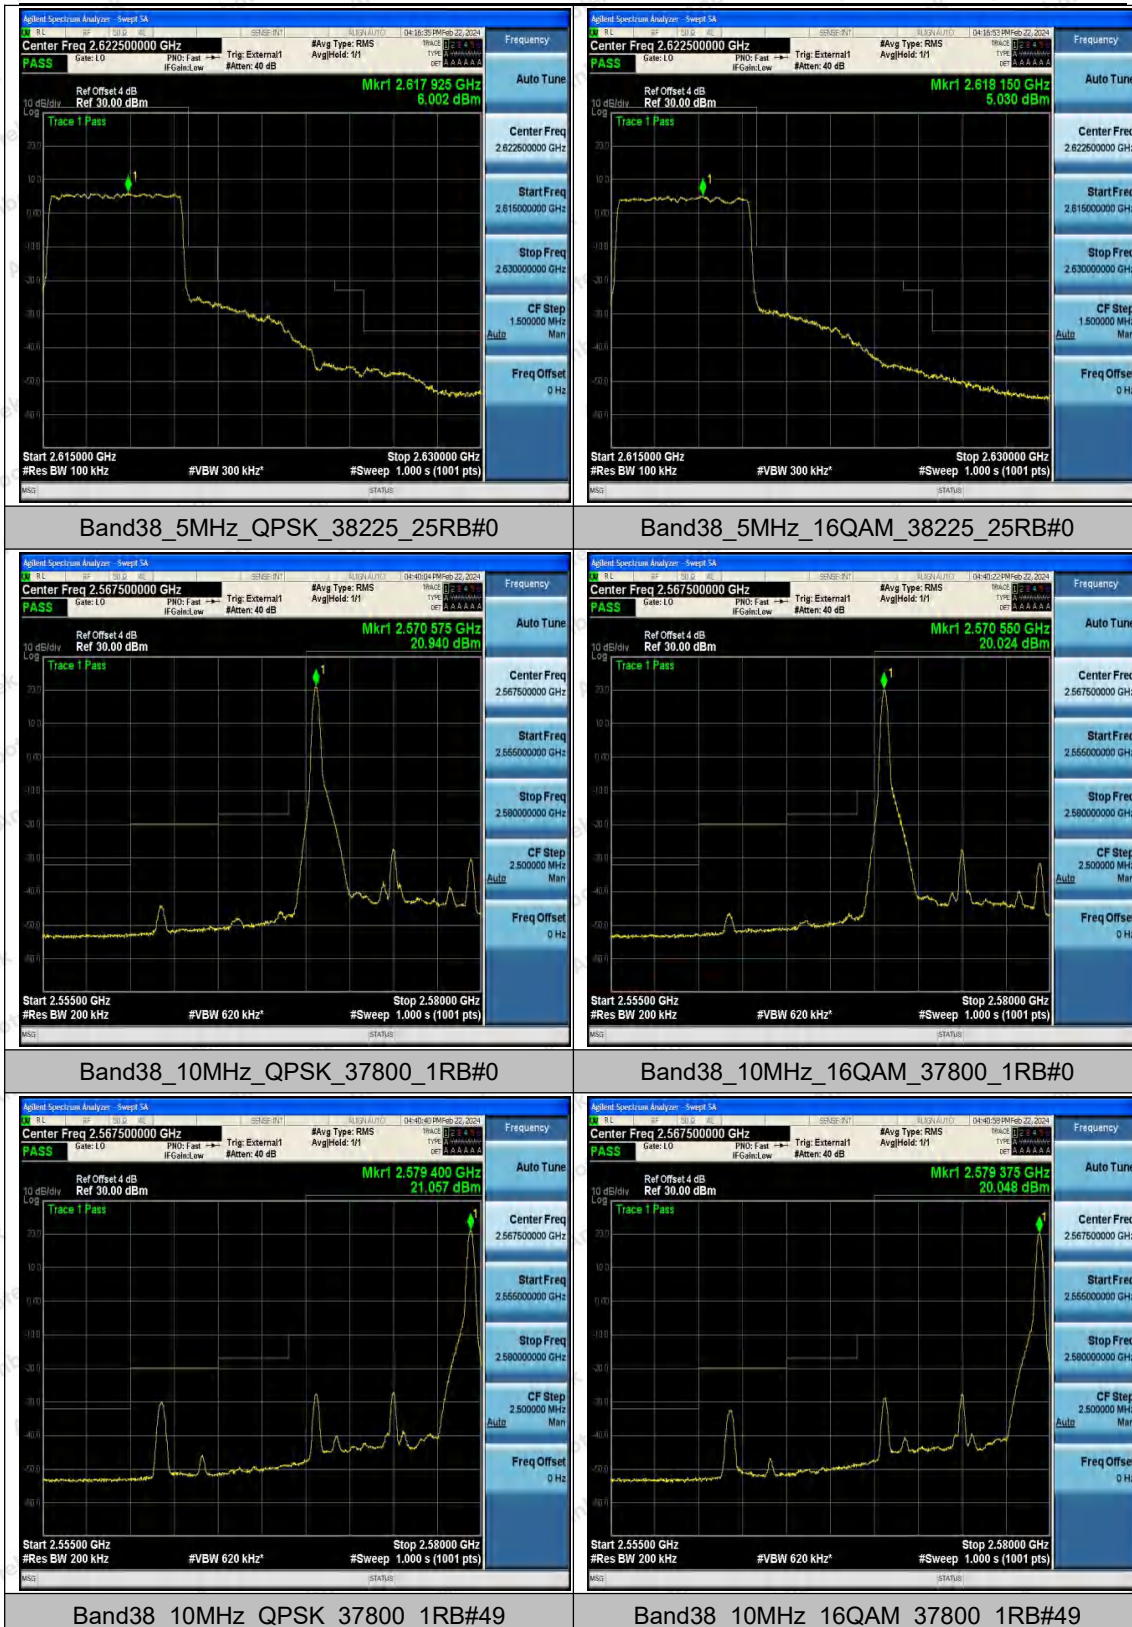

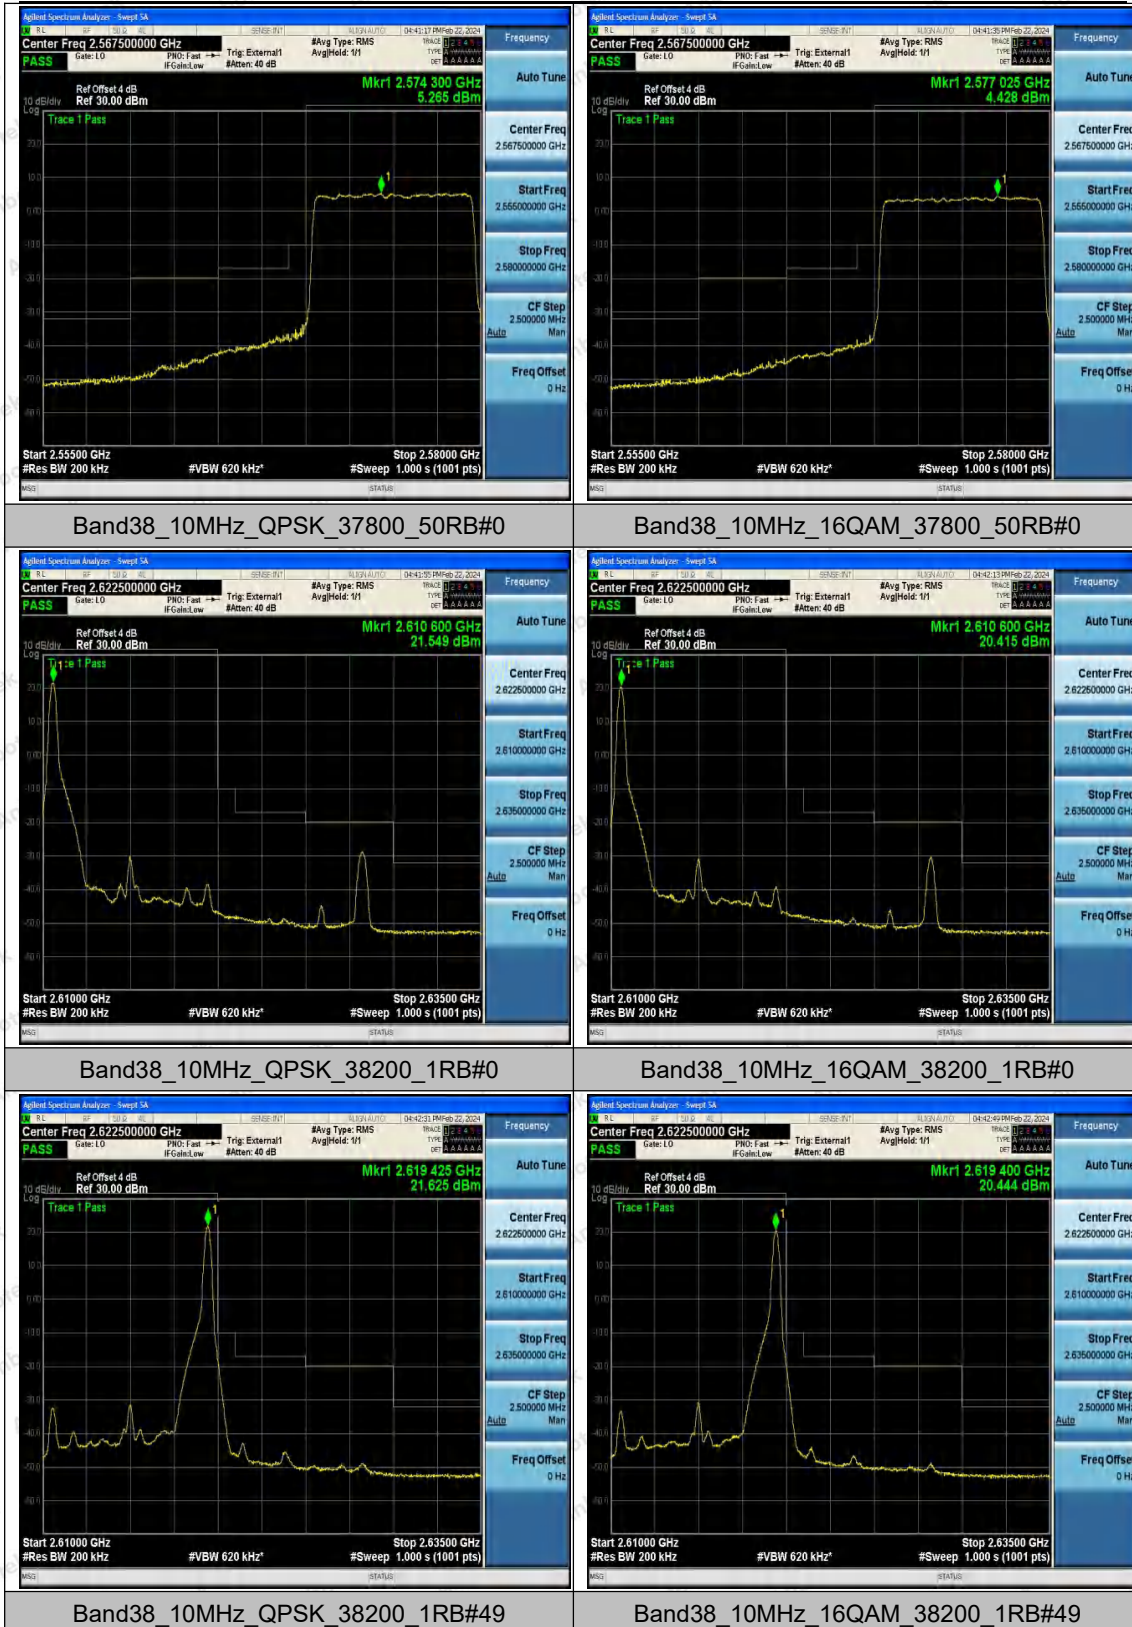



Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.
Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com




Hotline
400-003-0500
www.anbotek.com.cn







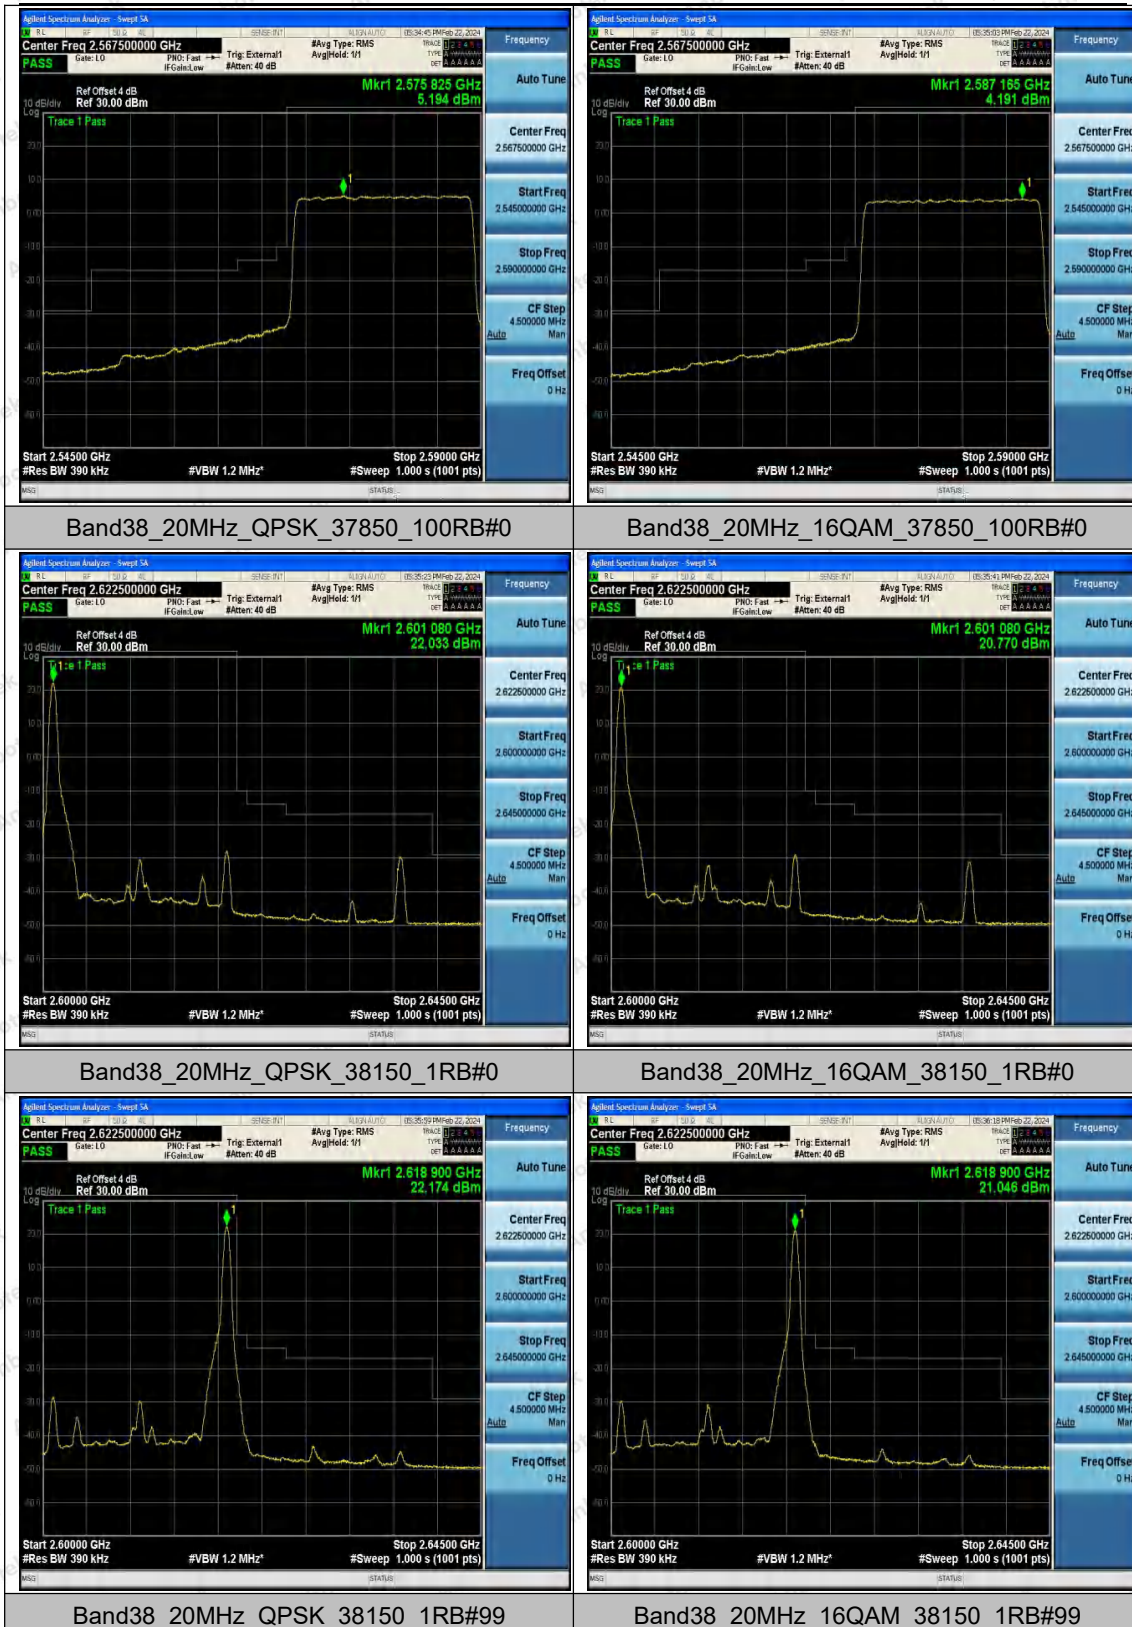

Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.
Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com



Hotline
400-003-0500
www.anbotek.com.cn





Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.
Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com



Hotline
400-003-0500
www.anbotek.com.cn



Appendix E: Conducted Spurious Emission

Test Result

Band	Bandwidth	Modulation	Channel	RB Configuration	Frequency Range	Result (dBm)	Verdict
Band38	5MHz	QPSK	37775	1RB#0	0.009~0.15	-68.72	PASS
Band38	5MHz	QPSK	37775	1RB#0	0.15~30	-60.34	PASS
Band38	5MHz	QPSK	37775	1RB#0	30~1000	-66.65	PASS
Band38	5MHz	QPSK	37775	1RB#0	20000~27000	-42.05	PASS
Band38	5MHz	16QAM	37775	1RB#0	0.009~0.15	-67.70	PASS
Band38	5MHz	16QAM	37775	1RB#0	0.15~30	-61.11	PASS
Band38	5MHz	16QAM	37775	1RB#0	30~1000	-66.75	PASS
Band38	5MHz	16QAM	37775	1RB#0	20000~27000	-41.99	PASS
Band38	5MHz	QPSK	38000	1RB#0	0.009~0.15	-70.21	PASS
Band38	5MHz	QPSK	38000	1RB#0	0.15~30	-70.08	PASS
Band38	5MHz	QPSK	38000	1RB#0	30~1000	-62.61	PASS
Band38	5MHz	QPSK	38000	1RB#0	20000~27000	-41.62	PASS
Band38	5MHz	16QAM	38000	1RB#0	0.009~0.15	-69.36	PASS
Band38	5MHz	16QAM	38000	1RB#0	0.15~30	-70.42	PASS
Band38	5MHz	16QAM	38000	1RB#0	30~1000	-63.77	PASS
Band38	5MHz	16QAM	38000	1RB#0	20000~27000	-41.88	PASS
Band38	5MHz	QPSK	38225	1RB#0	0.009~0.15	-67.71	PASS
Band38	5MHz	QPSK	38225	1RB#0	0.15~30	-67.48	PASS
Band38	5MHz	QPSK	38225	1RB#0	30~1000	-62.50	PASS
Band38	5MHz	QPSK	38225	1RB#0	20000~27000	-41.72	PASS
Band38	5MHz	16QAM	38225	1RB#0	0.009~0.15	-68.92	PASS
Band38	5MHz	16QAM	38225	1RB#0	0.15~30	-67.68	PASS
Band38	5MHz	16QAM	38225	1RB#0	30~1000	-64.99	PASS
Band38	5MHz	16QAM	38225	1RB#0	20000~27000	-41.99	PASS
Band38	10MHz	QPSK	37800	1RB#0	0.009~0.15	-68.16	PASS
Band38	10MHz	QPSK	37800	1RB#0	0.15~30	-58.61	PASS
Band38	10MHz	QPSK	37800	1RB#0	30~1000	-66.70	PASS
Band38	10MHz	QPSK	37800	1RB#0	20000~27000	-41.92	PASS
Band38	10MHz	16QAM	37800	1RB#0	0.009~0.15	-68.62	PASS
Band38	10MHz	16QAM	37800	1RB#0	0.15~30	-60.86	PASS
Band38	10MHz	16QAM	37800	1RB#0	30~1000	-66.89	PASS
Band38	10MHz	16QAM	37800	1RB#0	20000~27000	-41.94	PASS
Band38	10MHz	QPSK	38000	1RB#0	0.009~0.15	-69.58	PASS
Band38	10MHz	QPSK	38000	1RB#0	0.15~30	-59.48	PASS
Band38	10MHz	QPSK	38000	1RB#0	30~1000	-66.57	PASS
Band38	10MHz	QPSK	38000	1RB#0	20000~27000	-41.40	PASS
Band38	10MHz	16QAM	38000	1RB#0	0.009~0.15	-69.22	PASS

Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.
Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com



Hotline
400-003-0500
www.anbotek.com.cn



Band38	10MHz	16QAM	38000	1RB#0	0.15~30	-61.81	PASS
Band38	10MHz	16QAM	38000	1RB#0	30~1000	-66.72	PASS
Band38	10MHz	16QAM	38000	1RB#0	20000~27000	-41.76	PASS
Band38	10MHz	QPSK	38200	1RB#0	0.009~0.15	-69.50	PASS
Band38	10MHz	QPSK	38200	1RB#0	0.15~30	-68.43	PASS
Band38	10MHz	QPSK	38200	1RB#0	30~1000	-63.11	PASS
Band38	10MHz	QPSK	38200	1RB#0	20000~27000	-41.84	PASS
Band38	10MHz	16QAM	38200	1RB#0	0.009~0.15	-66.83	PASS
Band38	10MHz	16QAM	38200	1RB#0	0.15~30	-70.16	PASS
Band38	10MHz	16QAM	38200	1RB#0	30~1000	-64.68	PASS
Band38	10MHz	16QAM	38200	1RB#0	20000~27000	-41.81	PASS
Band38	15MHz	QPSK	37825	1RB#0	0.009~0.15	-67.98	PASS
Band38	15MHz	QPSK	37825	1RB#0	0.15~30	-59.06	PASS
Band38	15MHz	QPSK	37825	1RB#0	30~1000	-66.61	PASS
Band38	15MHz	QPSK	37825	1RB#0	20000~27000	-41.94	PASS
Band38	15MHz	16QAM	37825	1RB#0	0.009~0.15	-68.11	PASS
Band38	15MHz	16QAM	37825	1RB#0	0.15~30	-62.36	PASS
Band38	15MHz	16QAM	37825	1RB#0	30~1000	-66.49	PASS
Band38	15MHz	16QAM	37825	1RB#0	20000~27000	-42.07	PASS
Band38	15MHz	QPSK	38000	1RB#0	0.009~0.15	-68.47	PASS
Band38	15MHz	QPSK	38000	1RB#0	0.15~30	-58.26	PASS
Band38	15MHz	QPSK	38000	1RB#0	30~1000	-66.79	PASS
Band38	15MHz	QPSK	38000	1RB#0	20000~27000	-41.88	PASS
Band38	15MHz	16QAM	38000	1RB#0	0.009~0.15	-68.67	PASS
Band38	15MHz	16QAM	38000	1RB#0	0.15~30	-61.51	PASS
Band38	15MHz	16QAM	38000	1RB#0	30~1000	-66.80	PASS
Band38	15MHz	16QAM	38000	1RB#0	20000~27000	-41.65	PASS
Band38	15MHz	QPSK	38175	1RB#0	0.009~0.15	-69.97	PASS
Band38	15MHz	QPSK	38175	1RB#0	0.15~30	-68.11	PASS
Band38	15MHz	QPSK	38175	1RB#0	30~1000	-62.48	PASS
Band38	15MHz	QPSK	38175	1RB#0	20000~27000	-42.06	PASS
Band38	15MHz	16QAM	38175	1RB#0	0.009~0.15	-68.46	PASS
Band38	15MHz	16QAM	38175	1RB#0	0.15~30	-71.40	PASS
Band38	15MHz	16QAM	38175	1RB#0	30~1000	-64.01	PASS
Band38	15MHz	16QAM	38175	1RB#0	20000~27000	-41.64	PASS
Band38	20MHz	QPSK	37850	1RB#0	0.009~0.15	-68.71	PASS
Band38	20MHz	QPSK	37850	1RB#0	0.15~30	-59.42	PASS
Band38	20MHz	QPSK	37850	1RB#0	30~1000	-66.75	PASS
Band38	20MHz	QPSK	37850	1RB#0	20000~27000	-41.65	PASS
Band38	20MHz	16QAM	37850	1RB#0	0.009~0.15	-68.34	PASS
Band38	20MHz	16QAM	37850	1RB#0	0.15~30	-61.98	PASS
Band38	20MHz	16QAM	37850	1RB#0	30~1000	-66.48	PASS

Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community,
 Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.
 Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com





Hotline
 400-003-0500
 www.anbotek.com.cn



Band38	20MHz	16QAM	37850	1RB#0	20000~27000	-41.94	PASS
Band38	20MHz	QPSK	38000	1RB#0	0.009~0.15	-69.73	PASS
Band38	20MHz	QPSK	38000	1RB#0	0.15~30	-58.40	PASS
Band38	20MHz	QPSK	38000	1RB#0	30~1000	-66.61	PASS
Band38	20MHz	QPSK	38000	1RB#0	20000~27000	-41.98	PASS
Band38	20MHz	16QAM	38000	1RB#0	0.009~0.15	-66.80	PASS
Band38	20MHz	16QAM	38000	1RB#0	0.15~30	-61.31	PASS
Band38	20MHz	16QAM	38000	1RB#0	30~1000	-66.74	PASS
Band38	20MHz	16QAM	38000	1RB#0	20000~27000	-41.80	PASS
Band38	20MHz	QPSK	38150	1RB#0	0.009~0.15	-68.81	PASS
Band38	20MHz	QPSK	38150	1RB#0	0.15~30	-69.19	PASS
Band38	20MHz	QPSK	38150	1RB#0	30~1000	-62.57	PASS
Band38	20MHz	QPSK	38150	1RB#0	20000~27000	-41.70	PASS
Band38	20MHz	16QAM	38150	1RB#0	0.009~0.15	-67.85	PASS
Band38	20MHz	16QAM	38150	1RB#0	0.15~30	-69.31	PASS
Band38	20MHz	16QAM	38150	1RB#0	30~1000	-64.47	PASS
Band38	20MHz	16QAM	38150	1RB#0	20000~27000	-41.78	PASS

Test Graphs

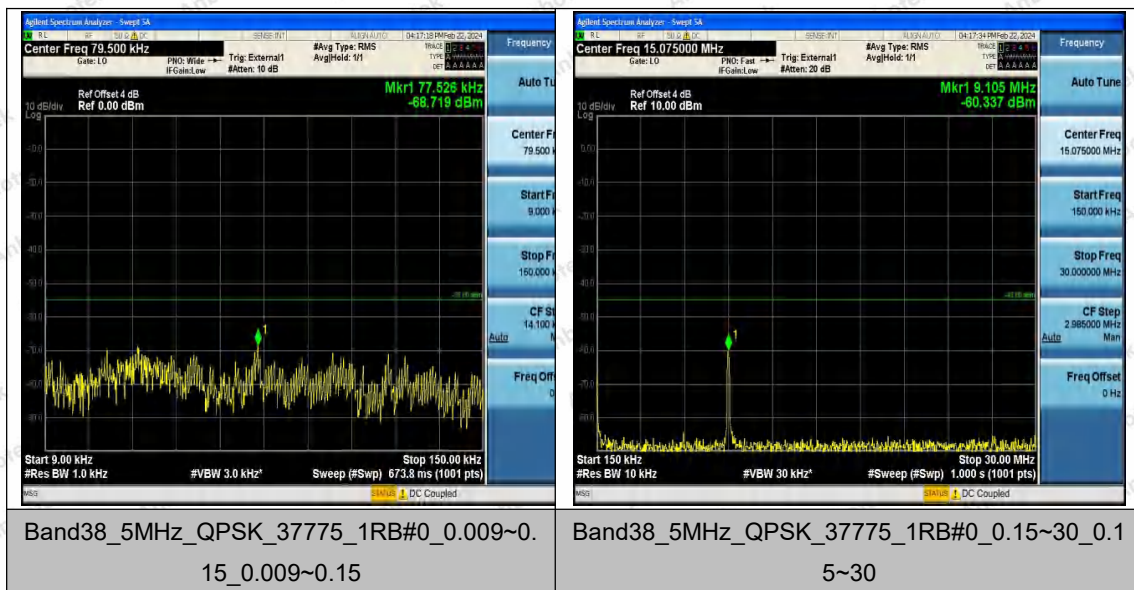

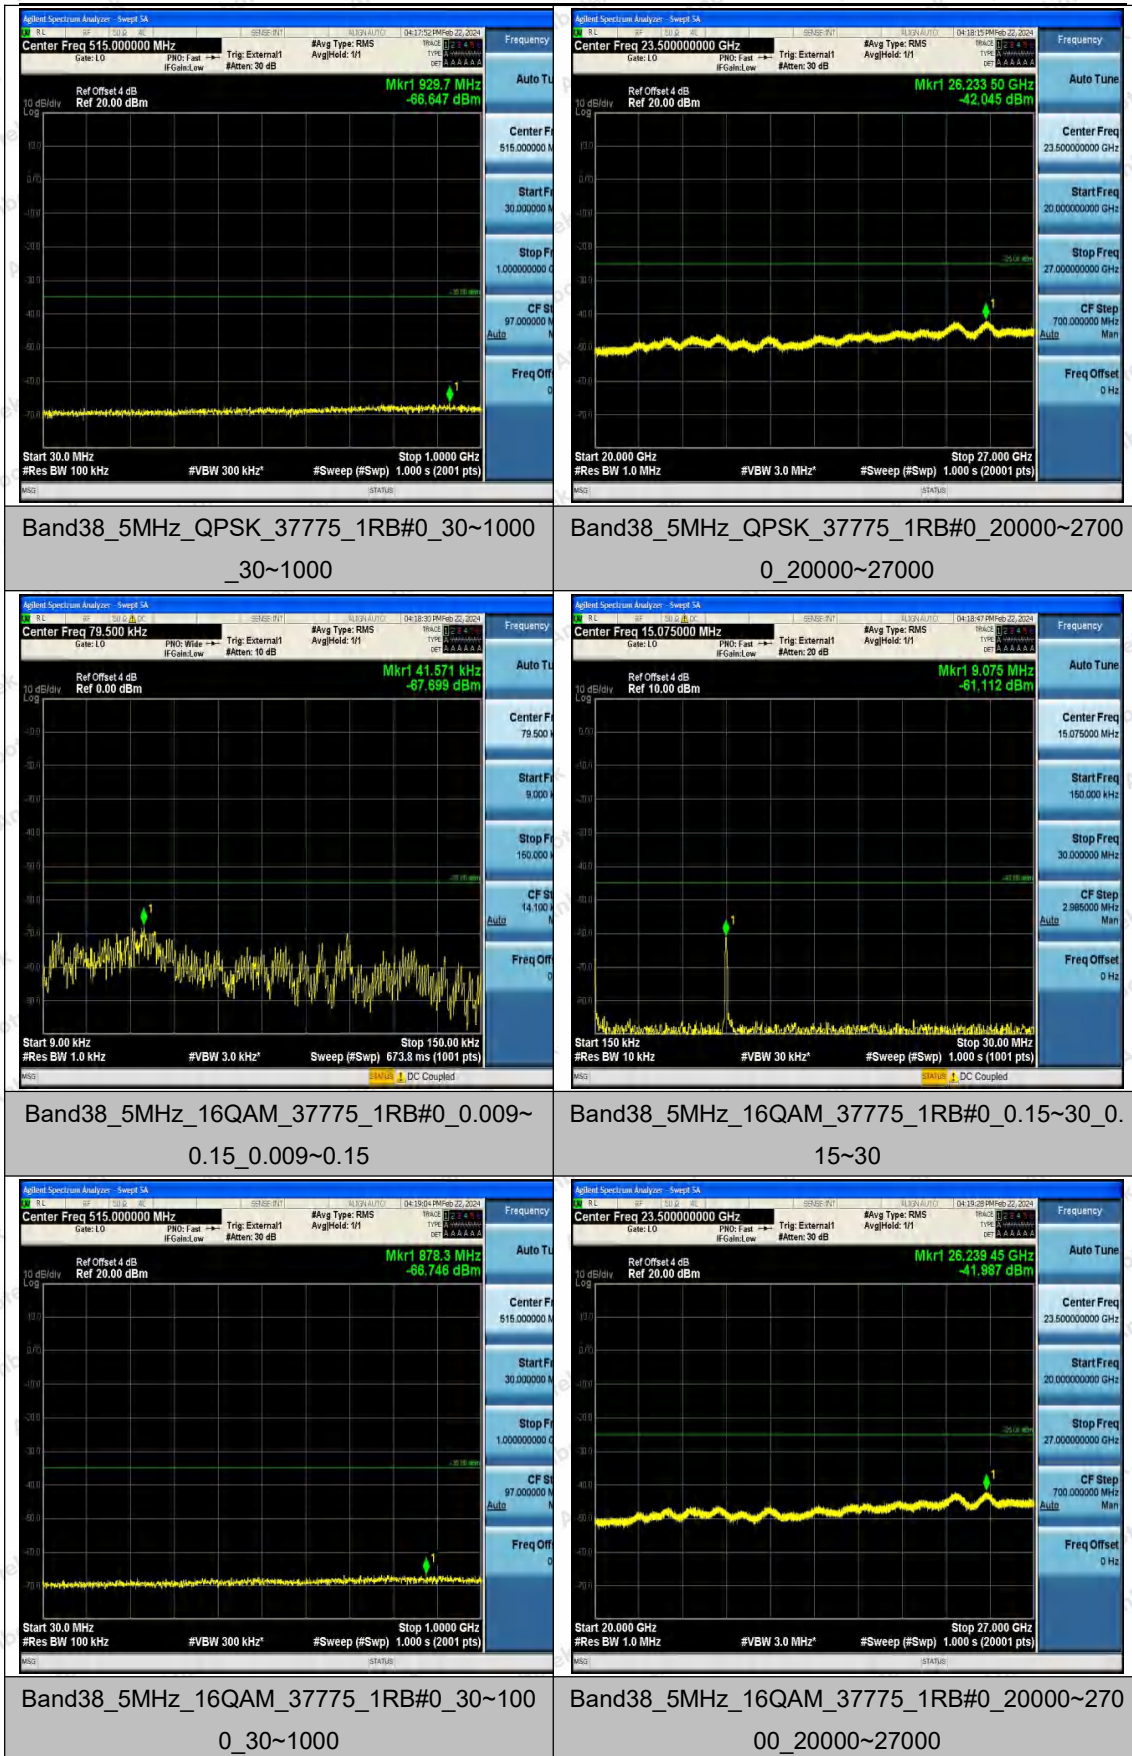


Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.
 Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com



Hotline
 400-003-0500
 www.anbotek.com.cn



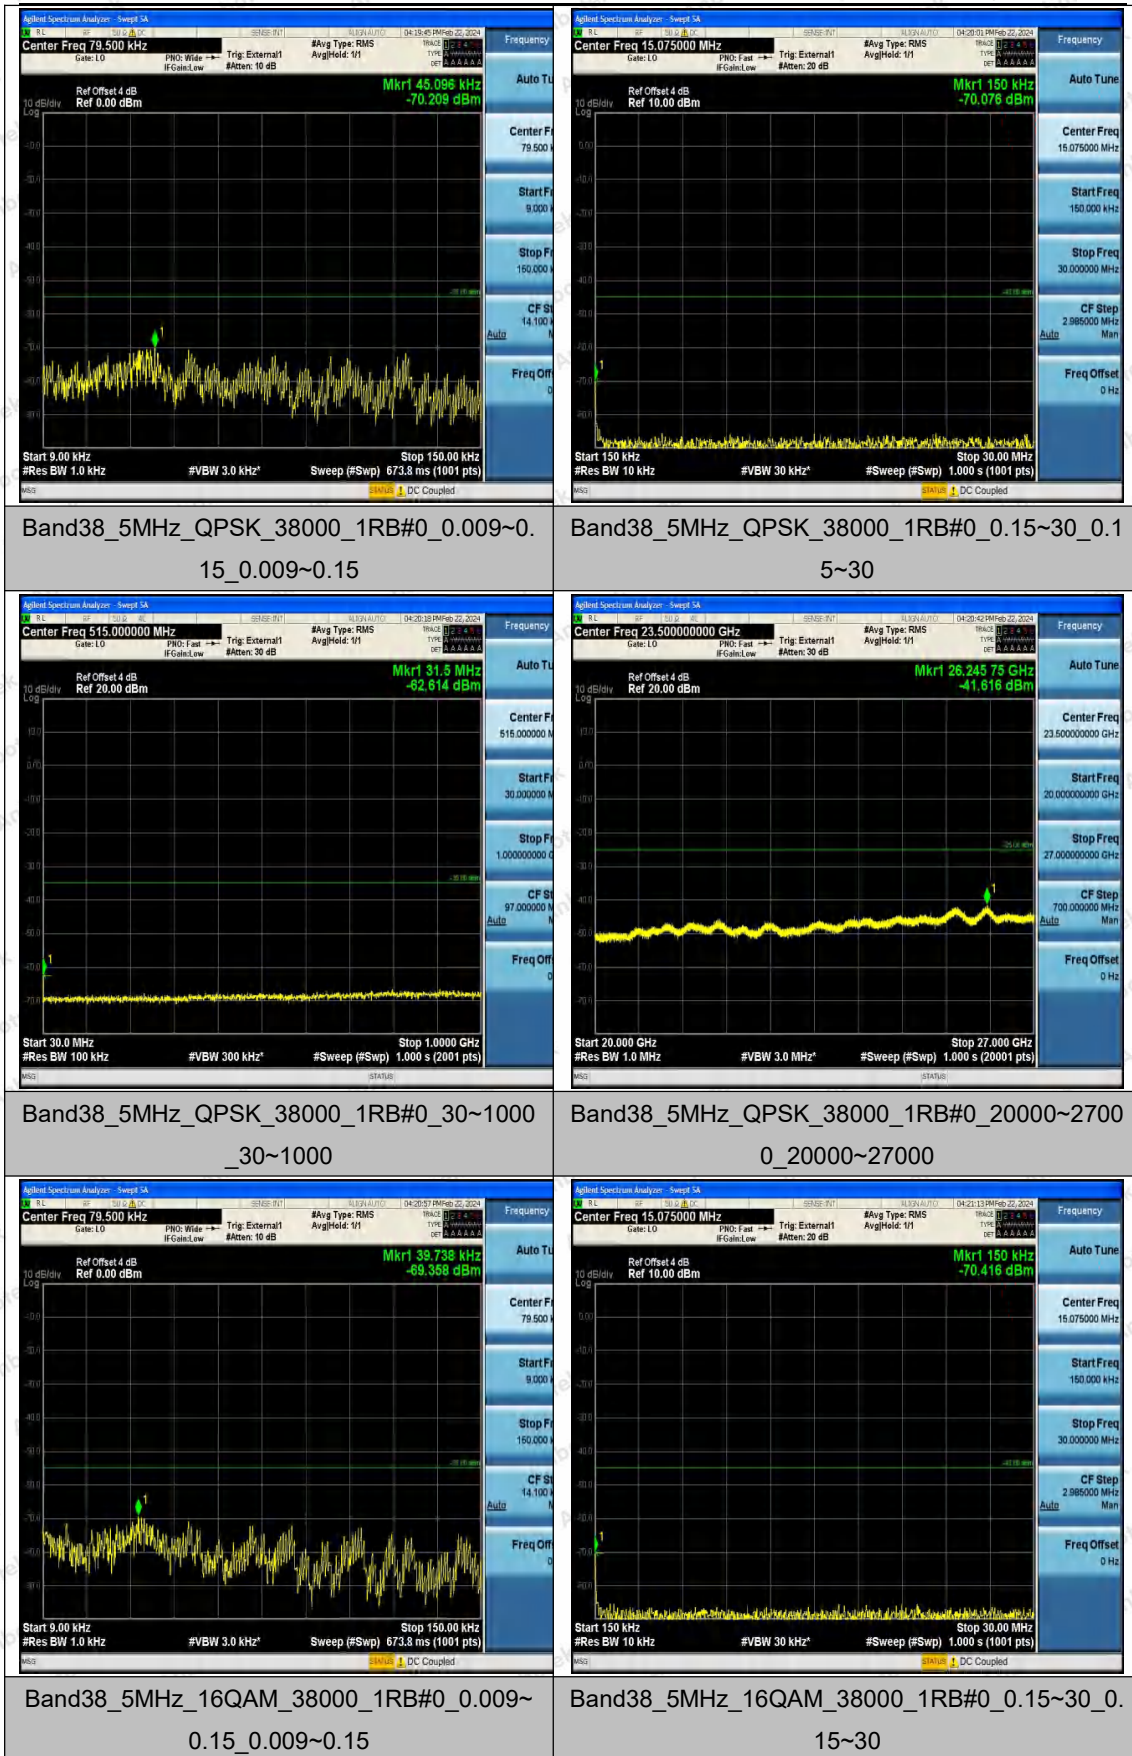


Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.
 Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com



Hotline
 400-003-0500
 www.anbotek.com.cn



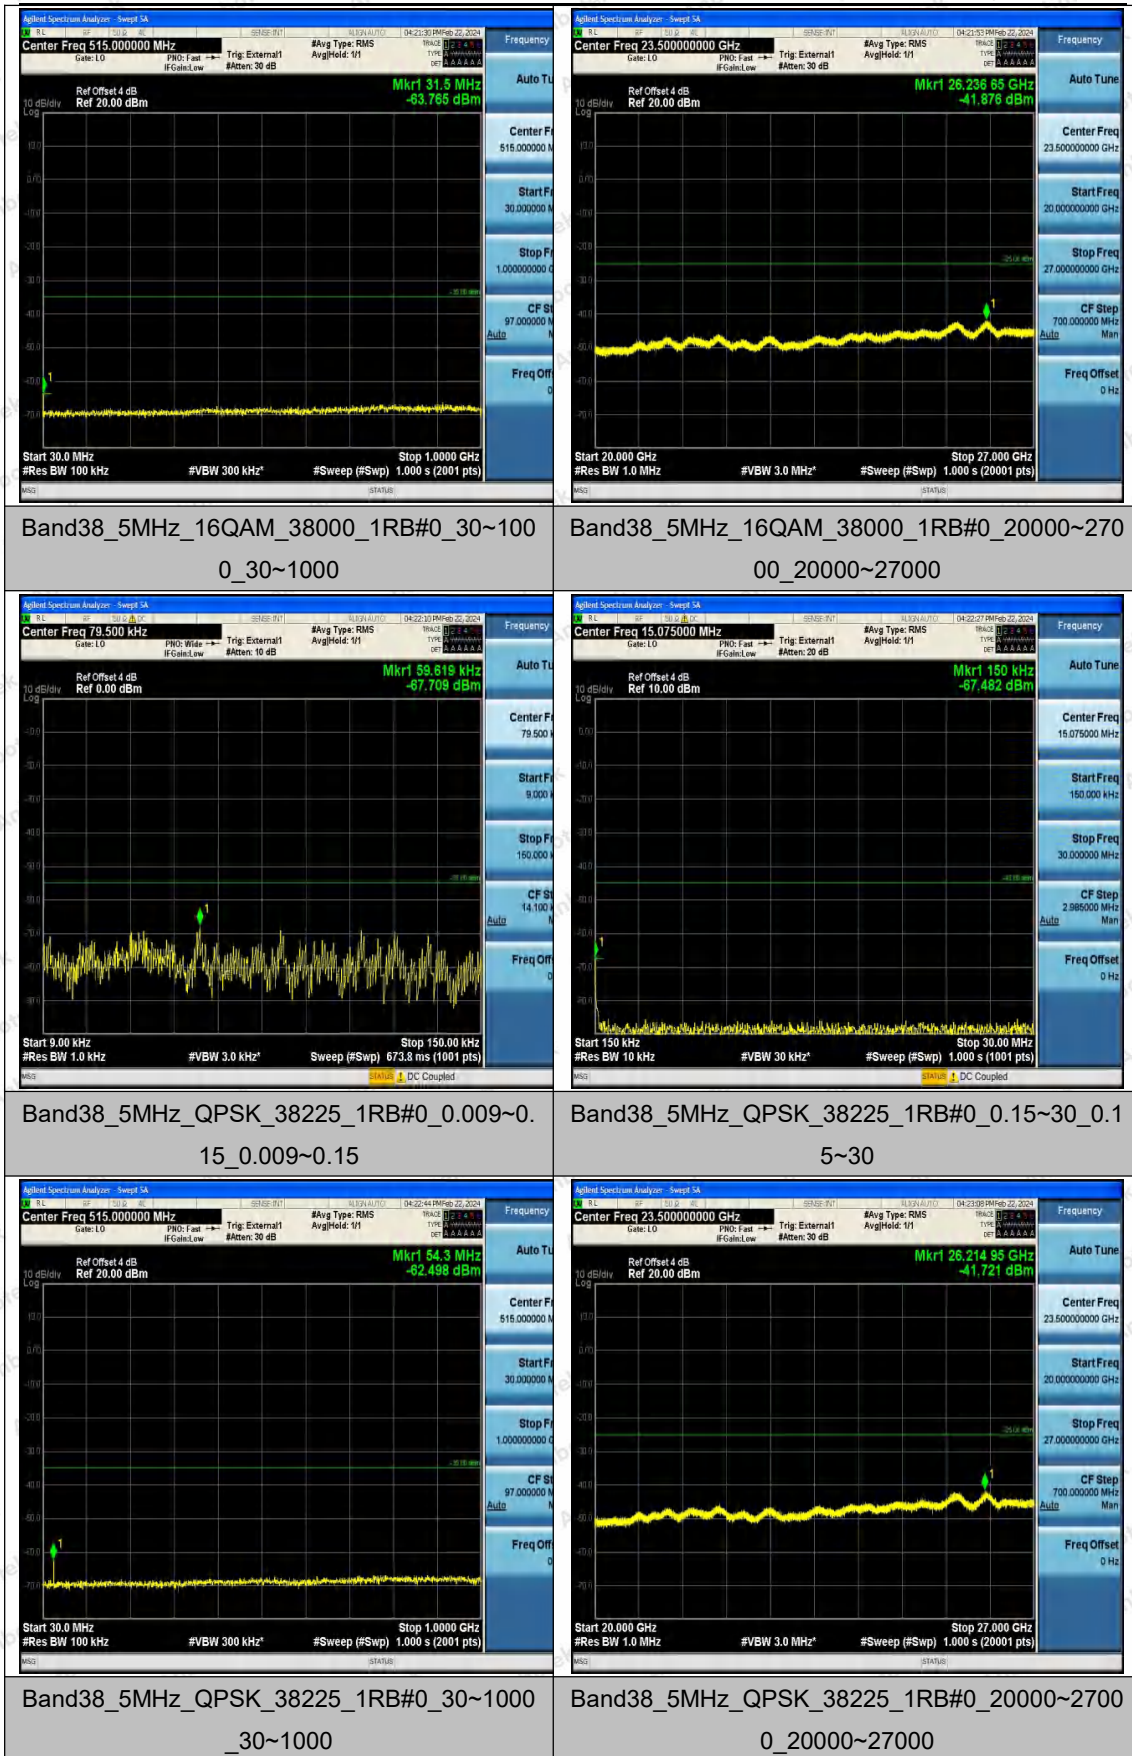


Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.
 Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com



Hotline
 400-003-0500
 www.anbotek.com.cn



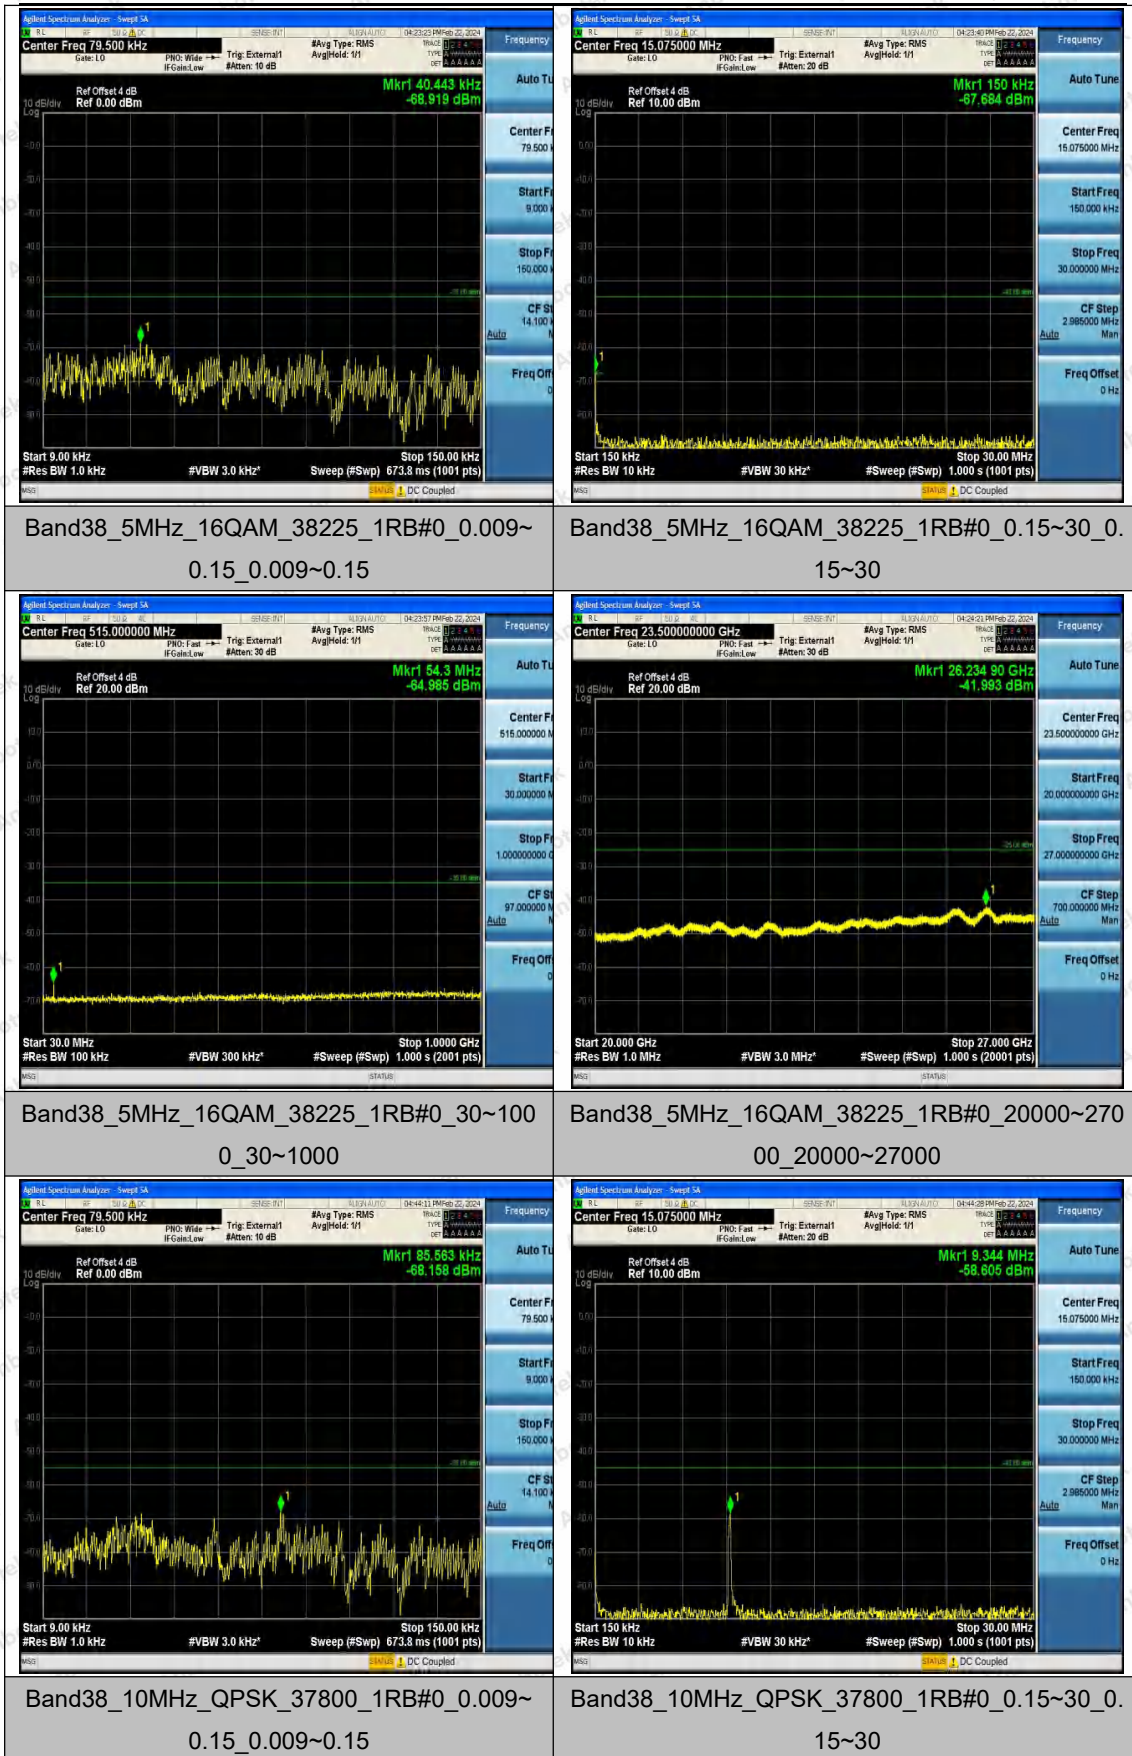


Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.
 Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com



Hotline
 400-003-0500
 www.anbotek.com.cn



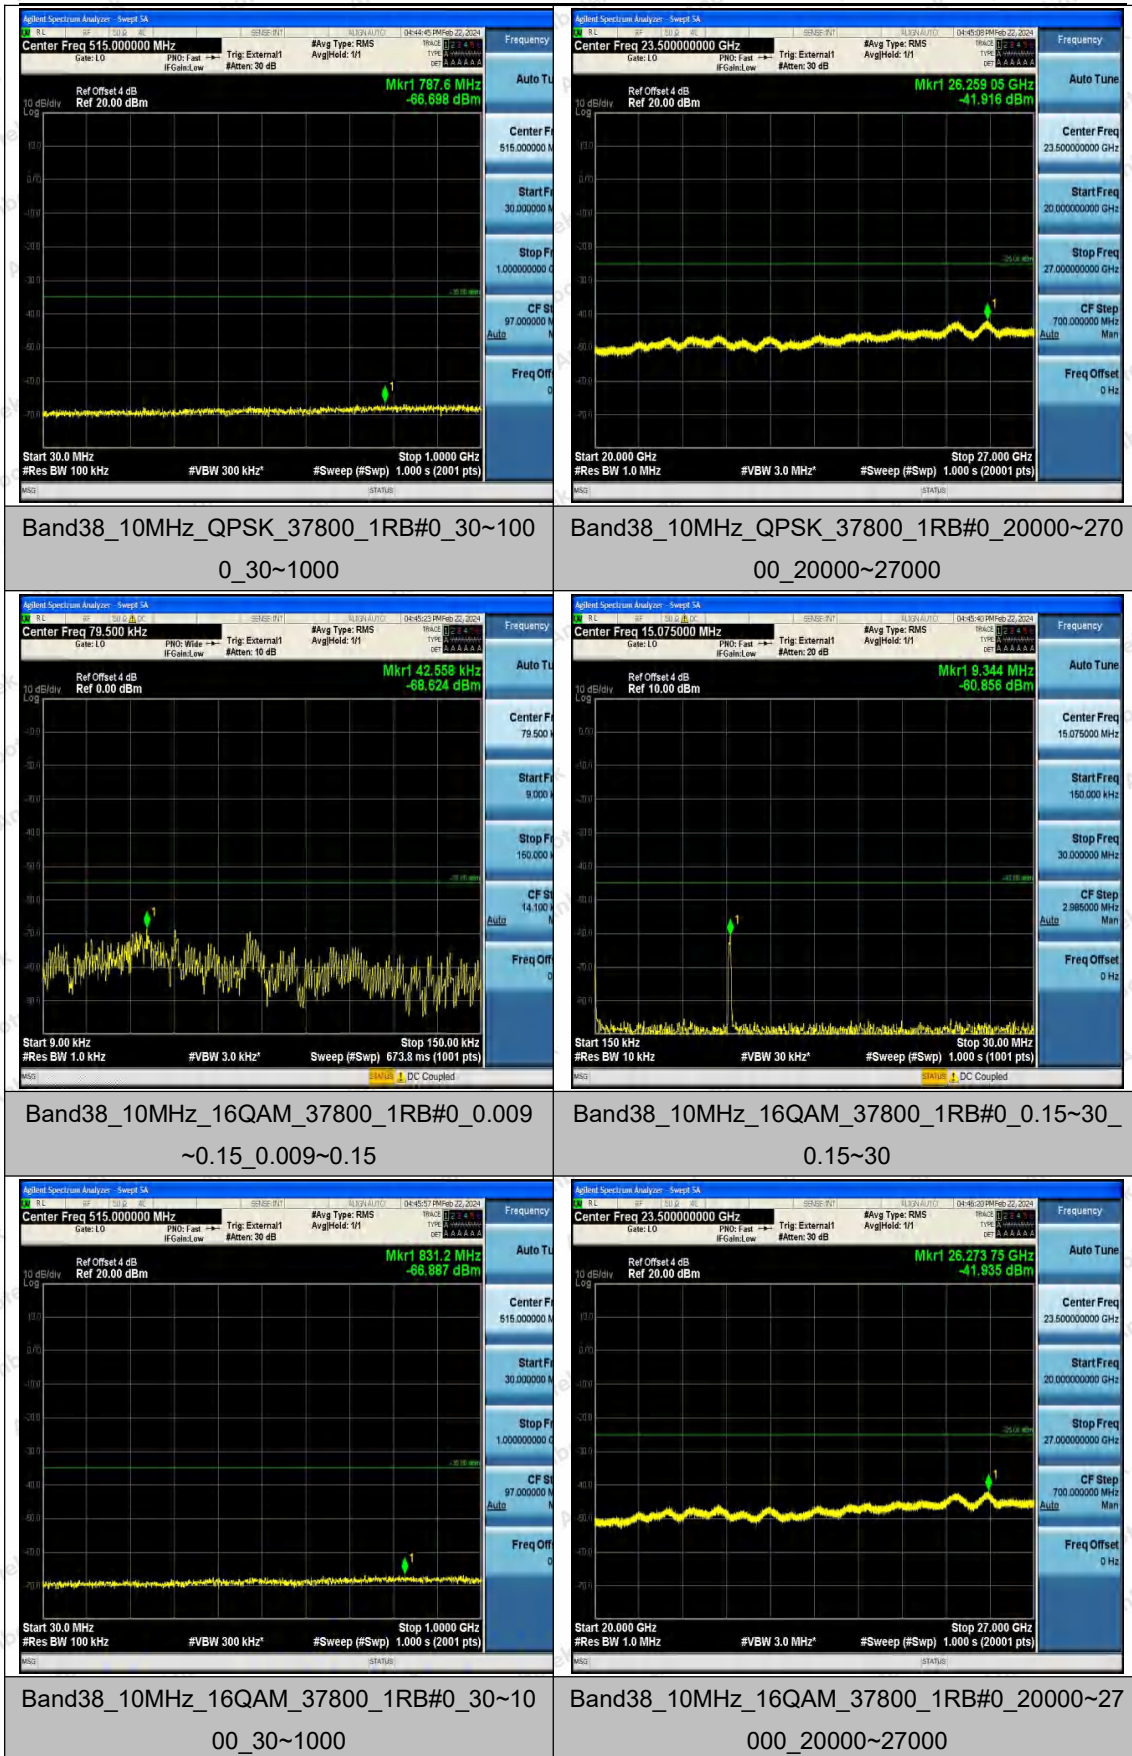


Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.
Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com

Hotline 400-003-0500
www.anbotek.com.cn



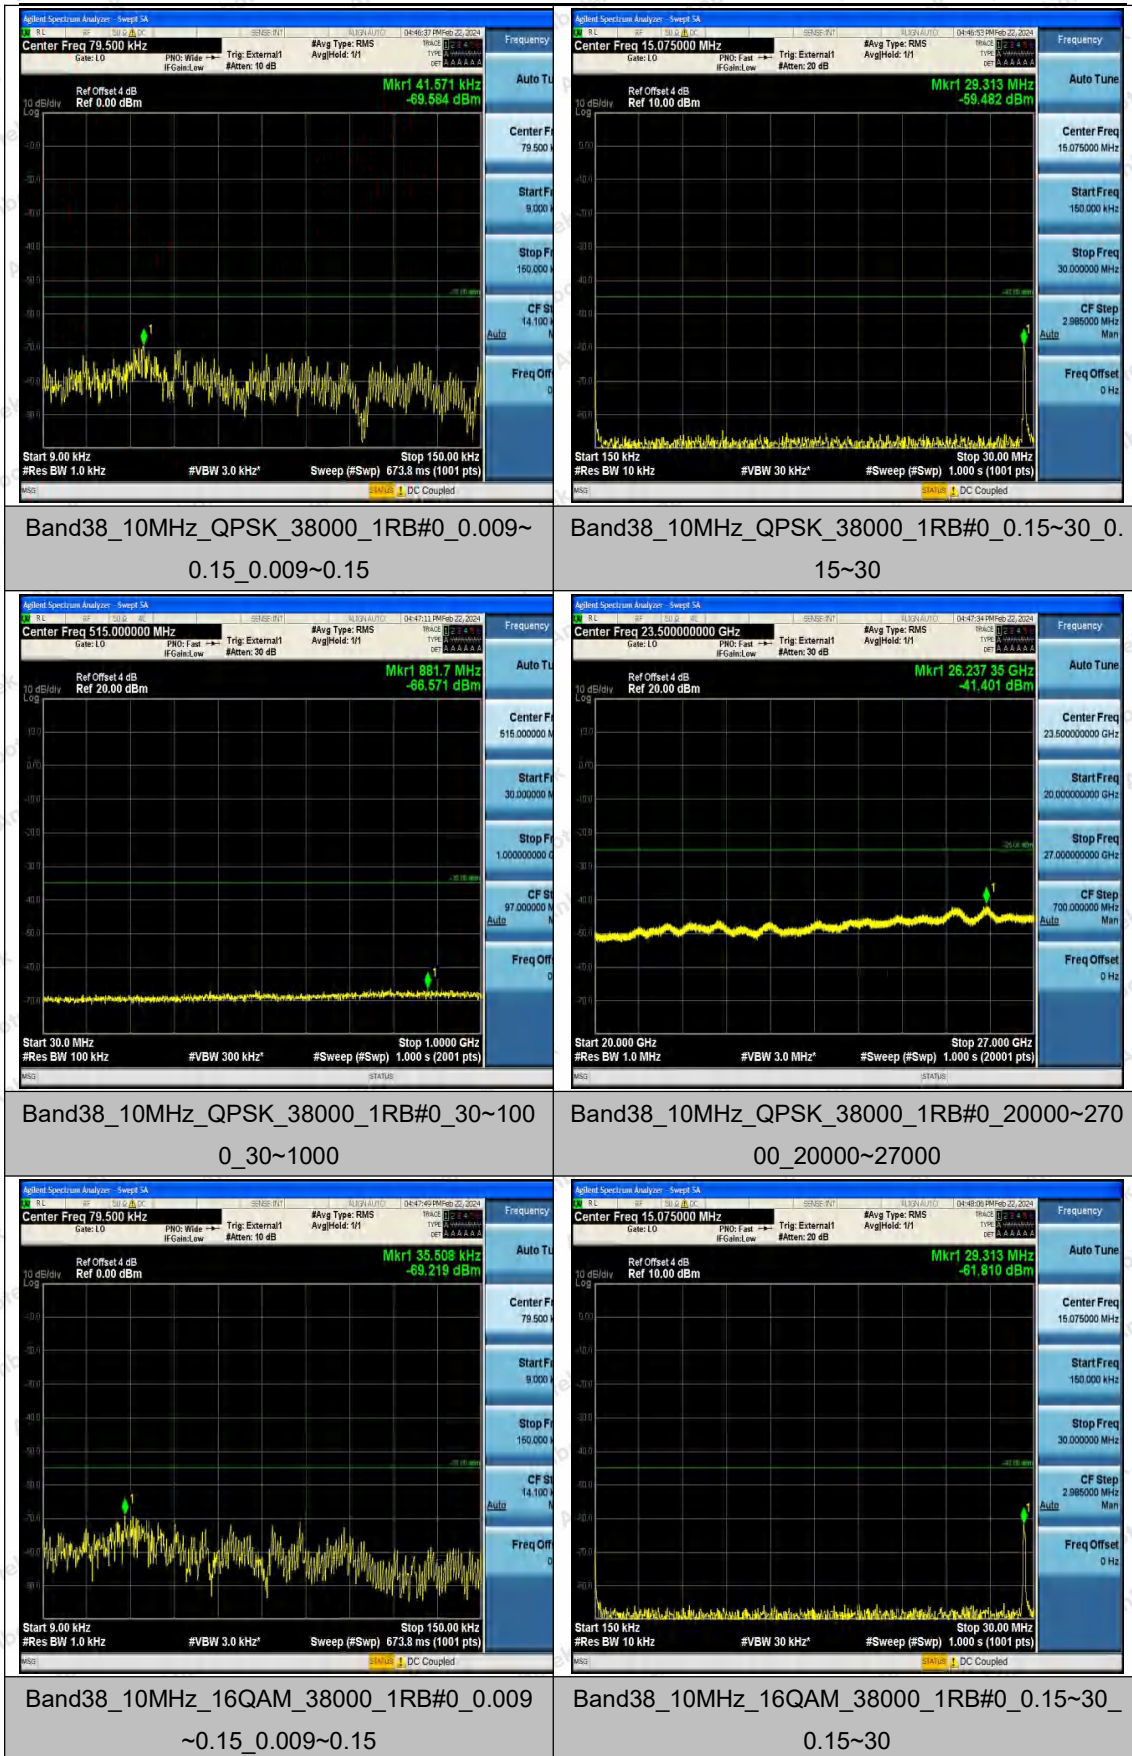


Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.
 Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com



Hotline
 400-003-0500
 www.anbotek.com.cn



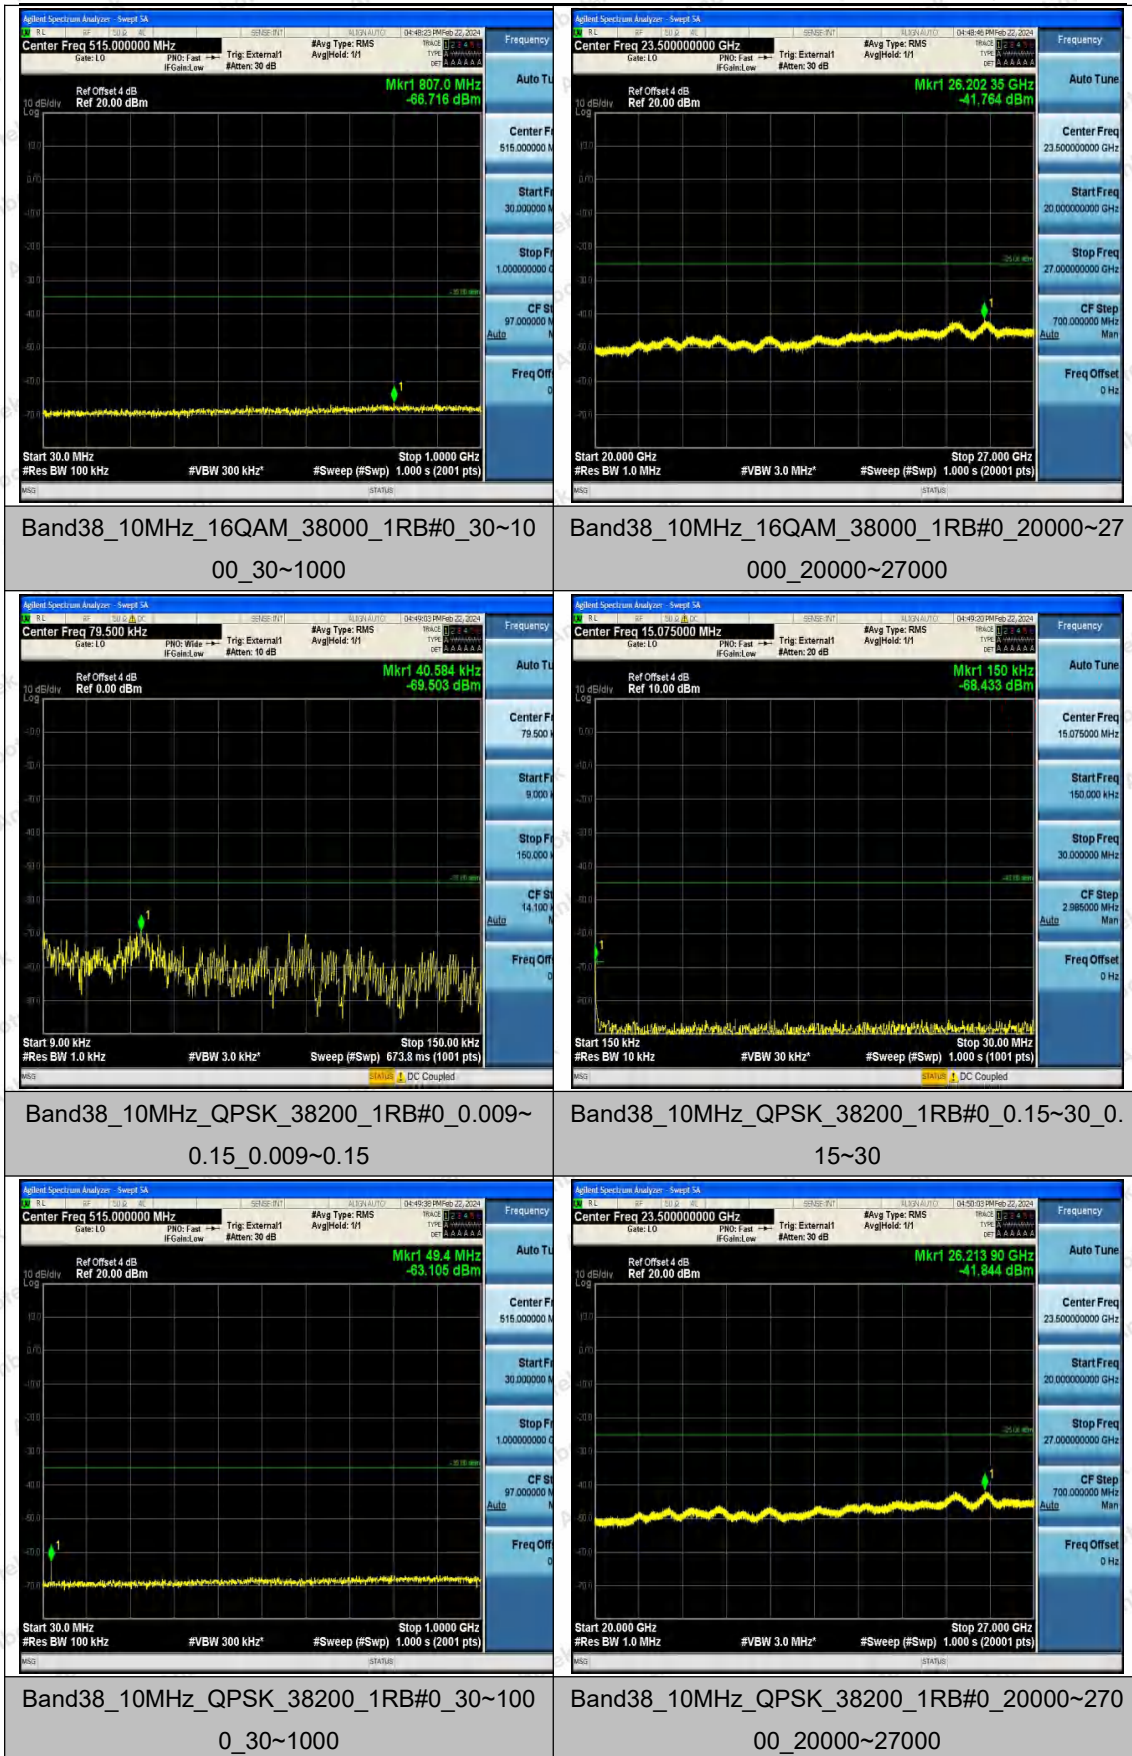


Shenzhen Anbotek Compliance Laboratory Limited


Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.
 Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com



Hotline
 400-003-0500
 www.anbotek.com.cn



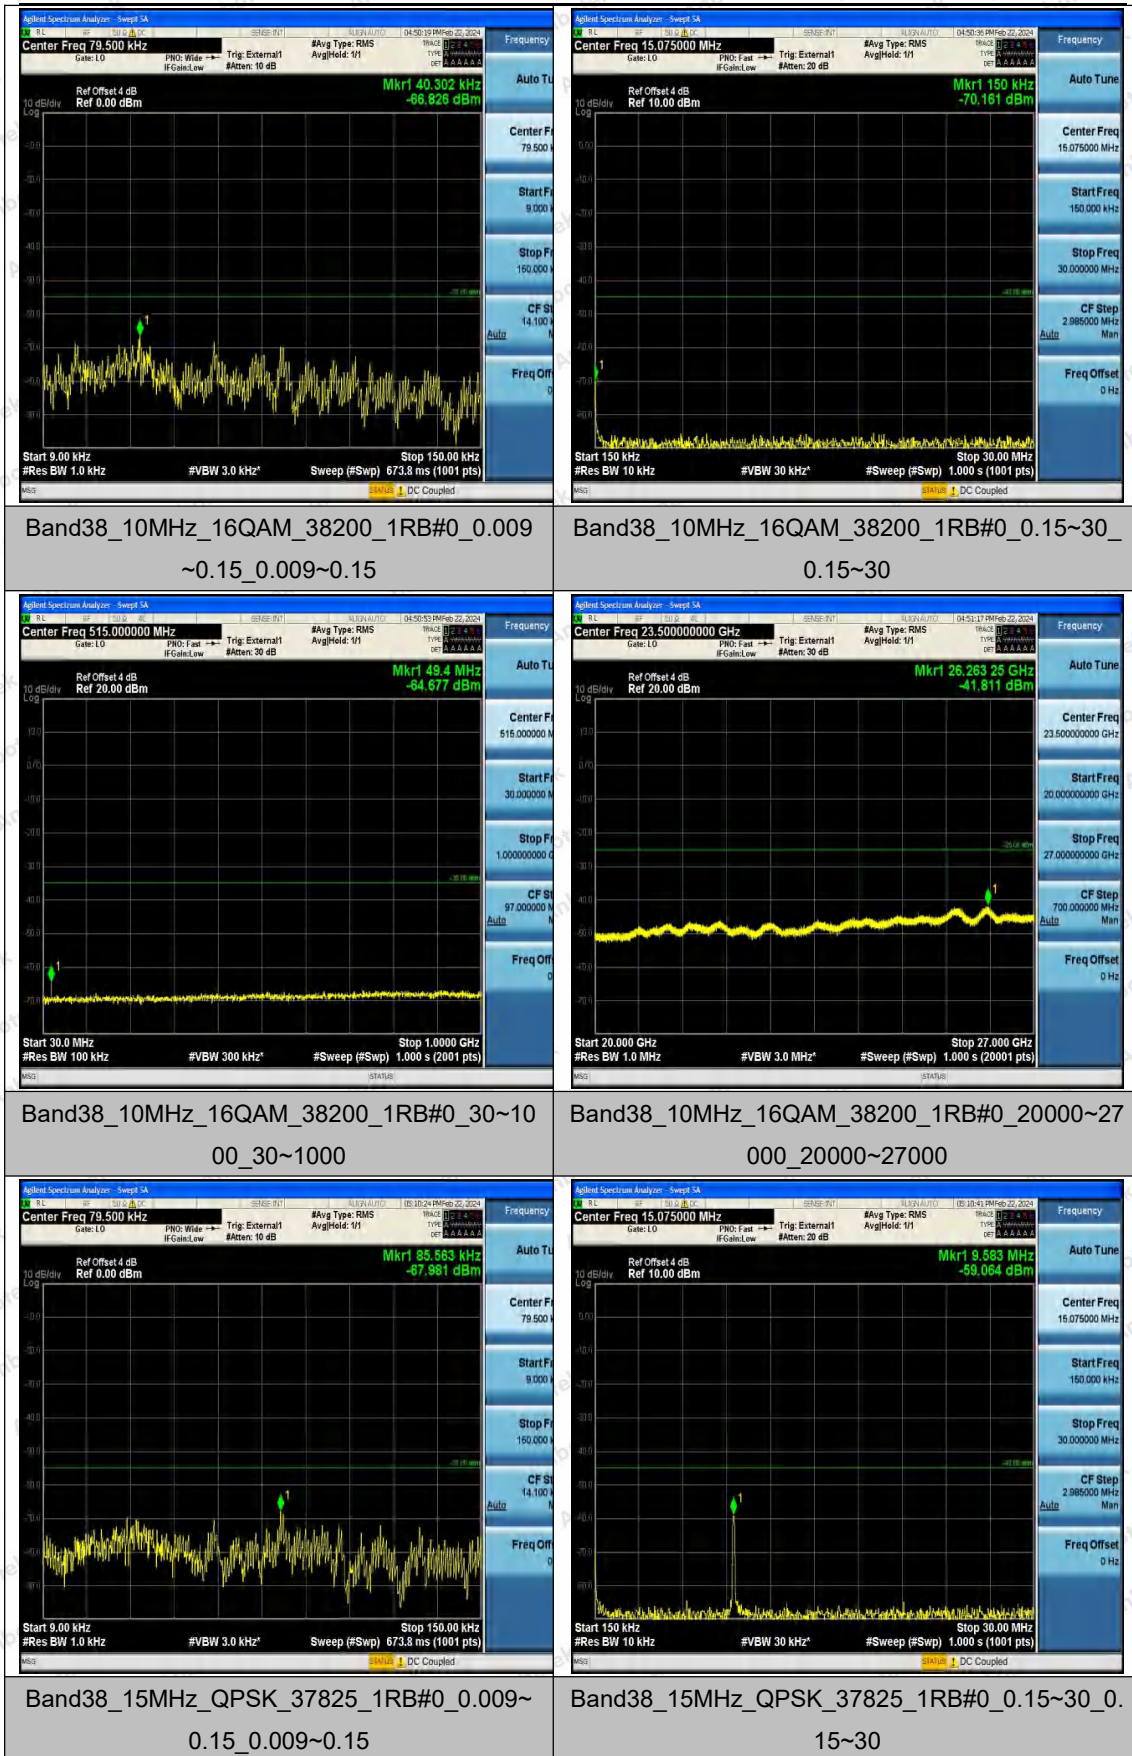

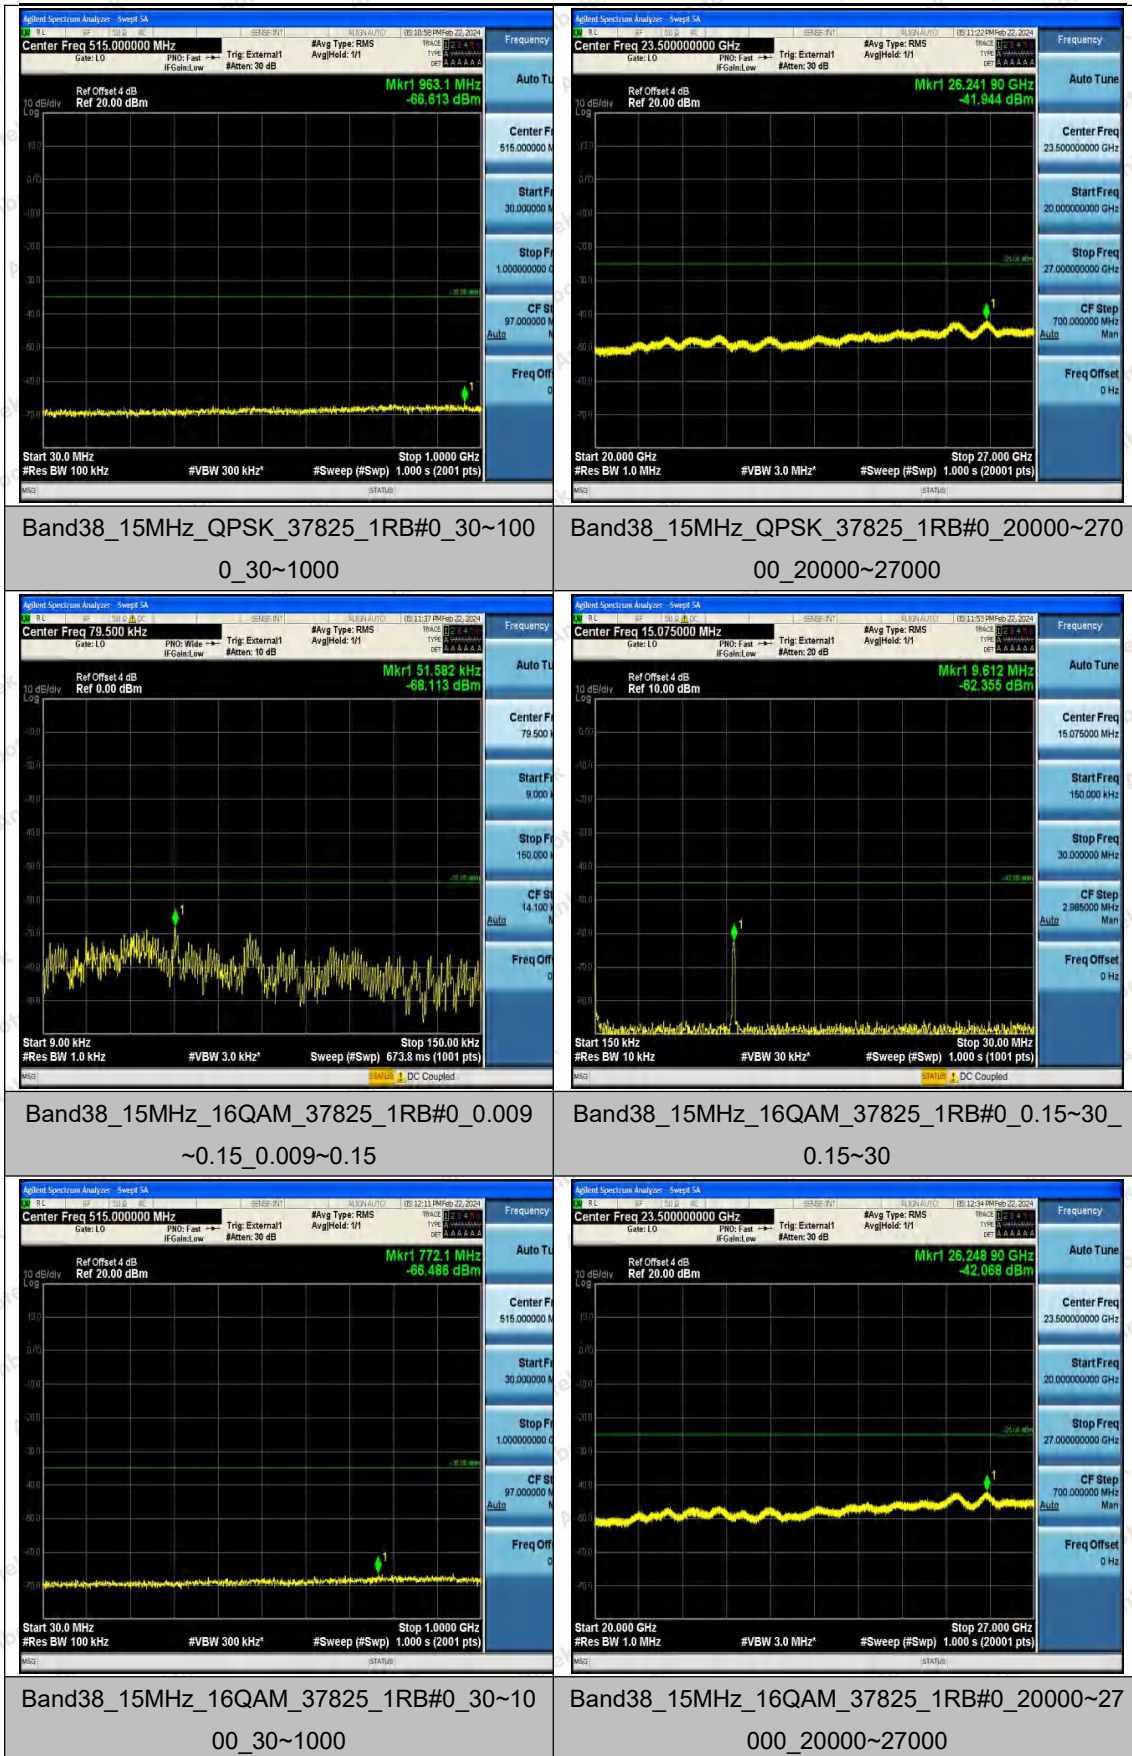


Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.
 Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com



Hotline
 400-003-0500
 www.anbotek.com.cn



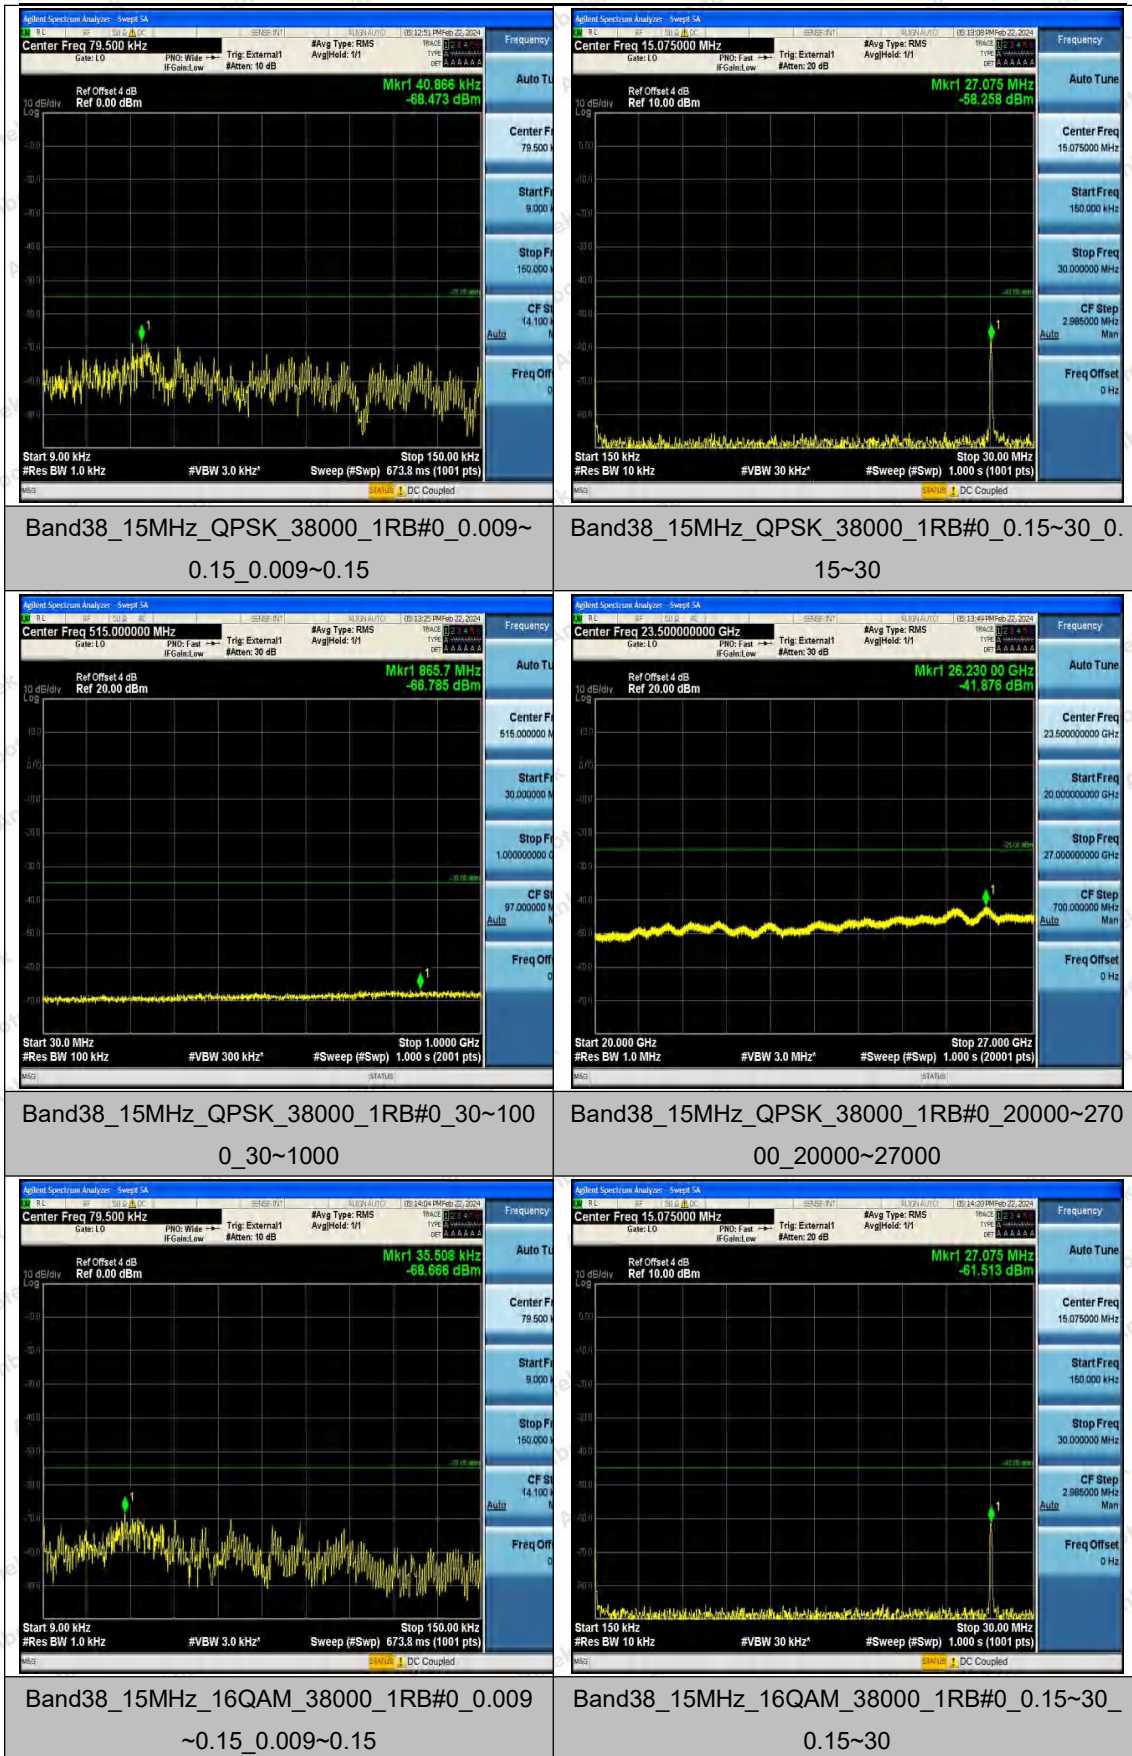


Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.
Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com



Hotline
400-003-0500
www.anbotek.com.cn



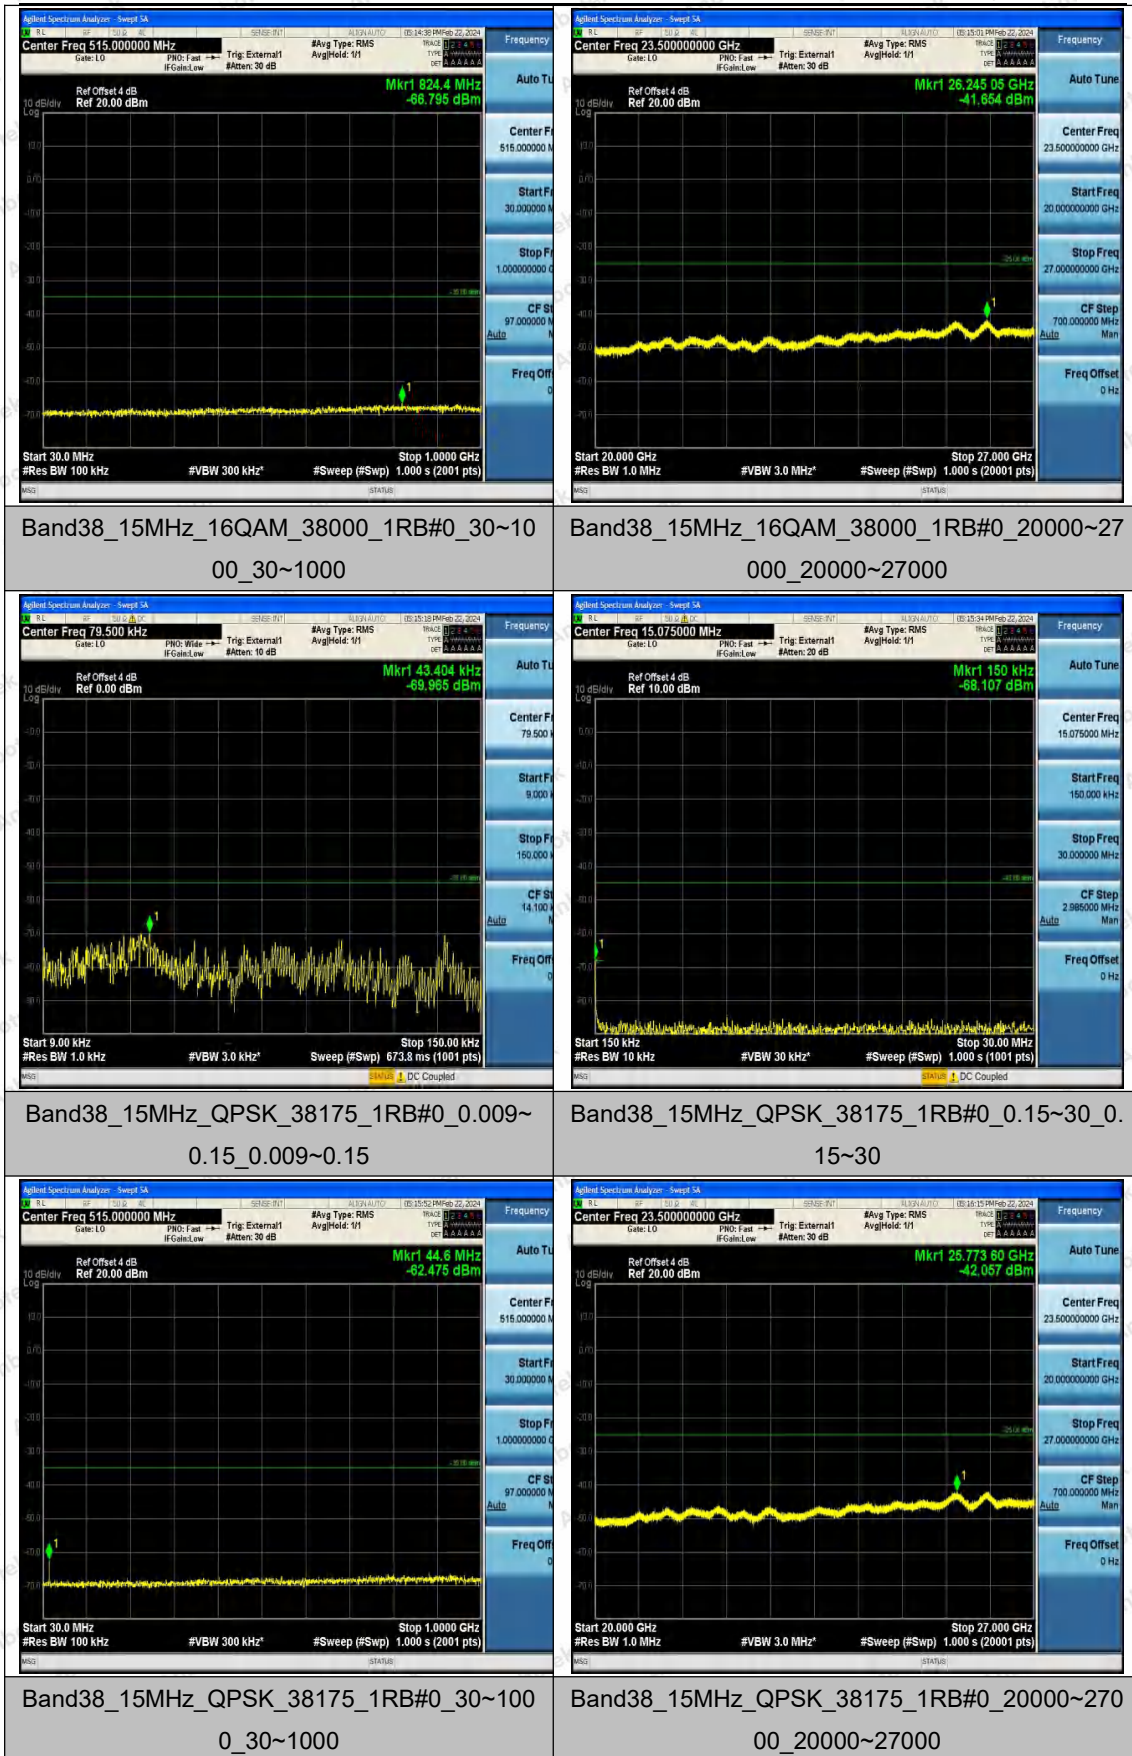


Shenzhen Anbotek Compliance Laboratory Limited


Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.
 Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com



Hotline
 400-003-0500
 www.anbotek.com.cn



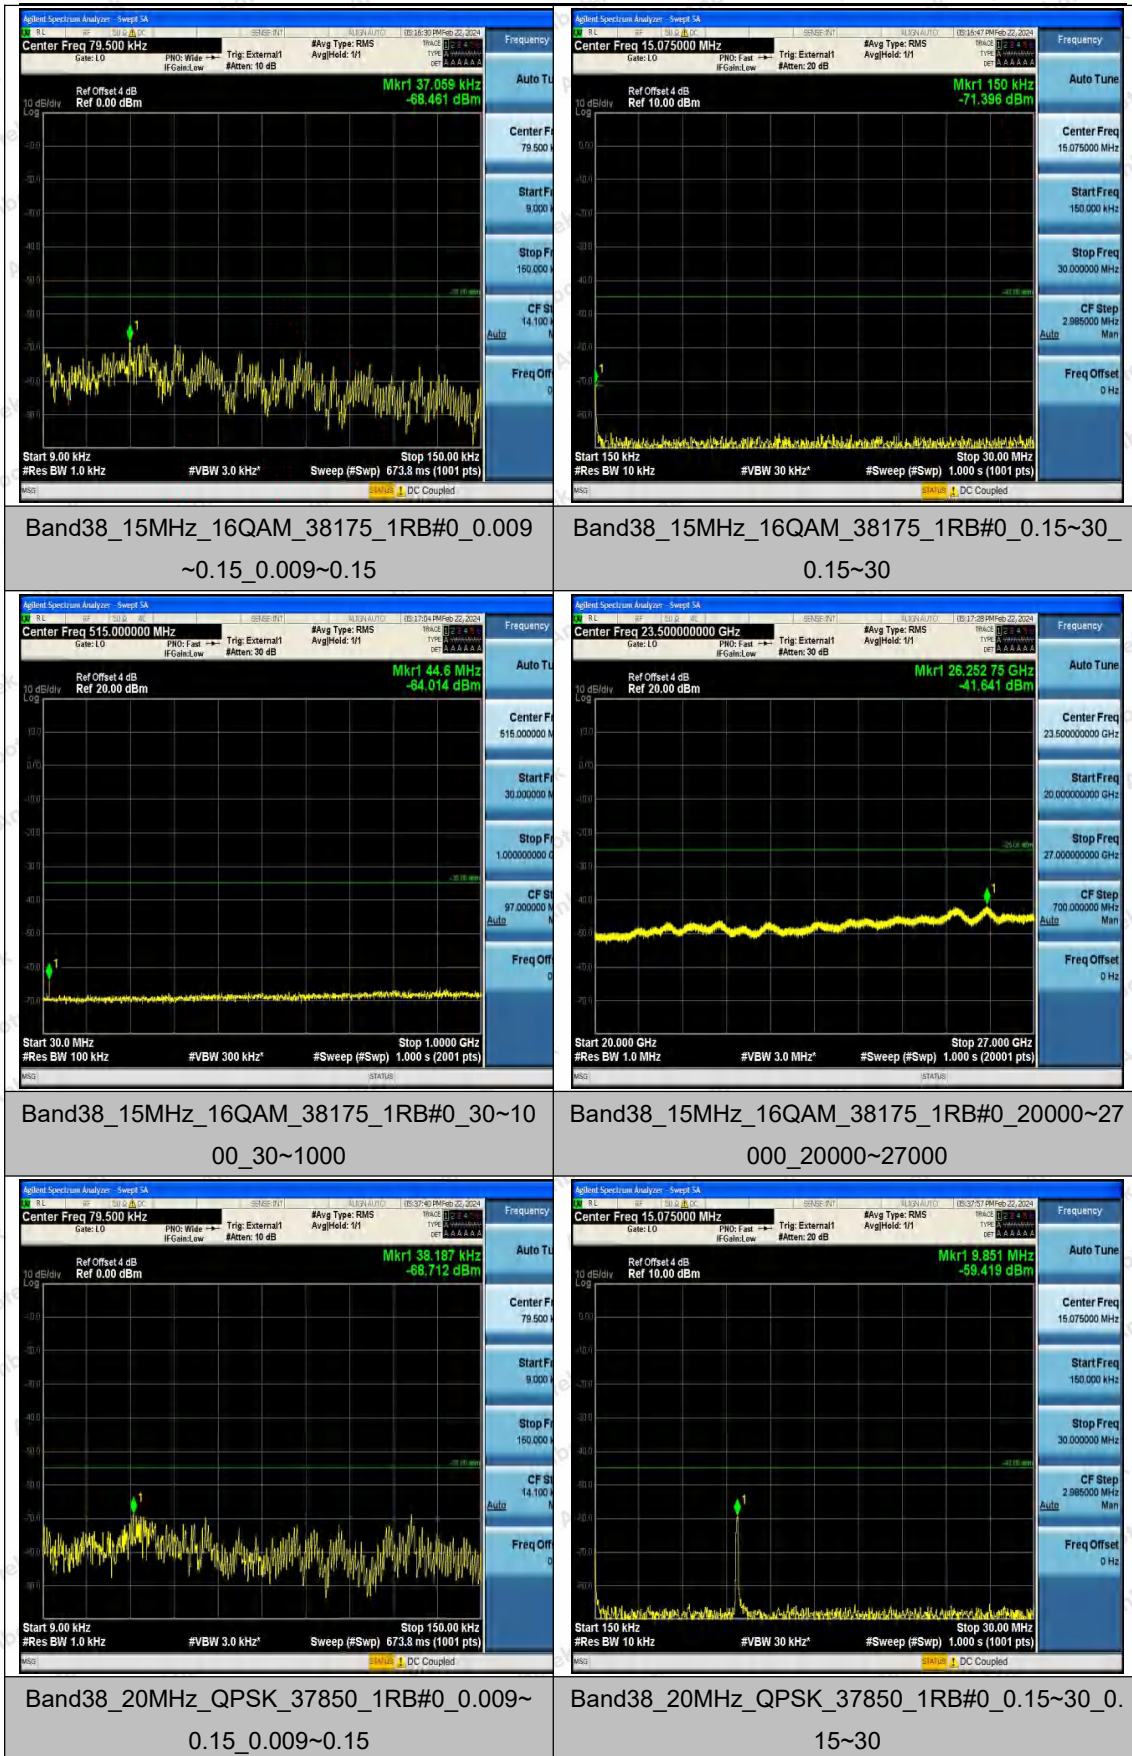

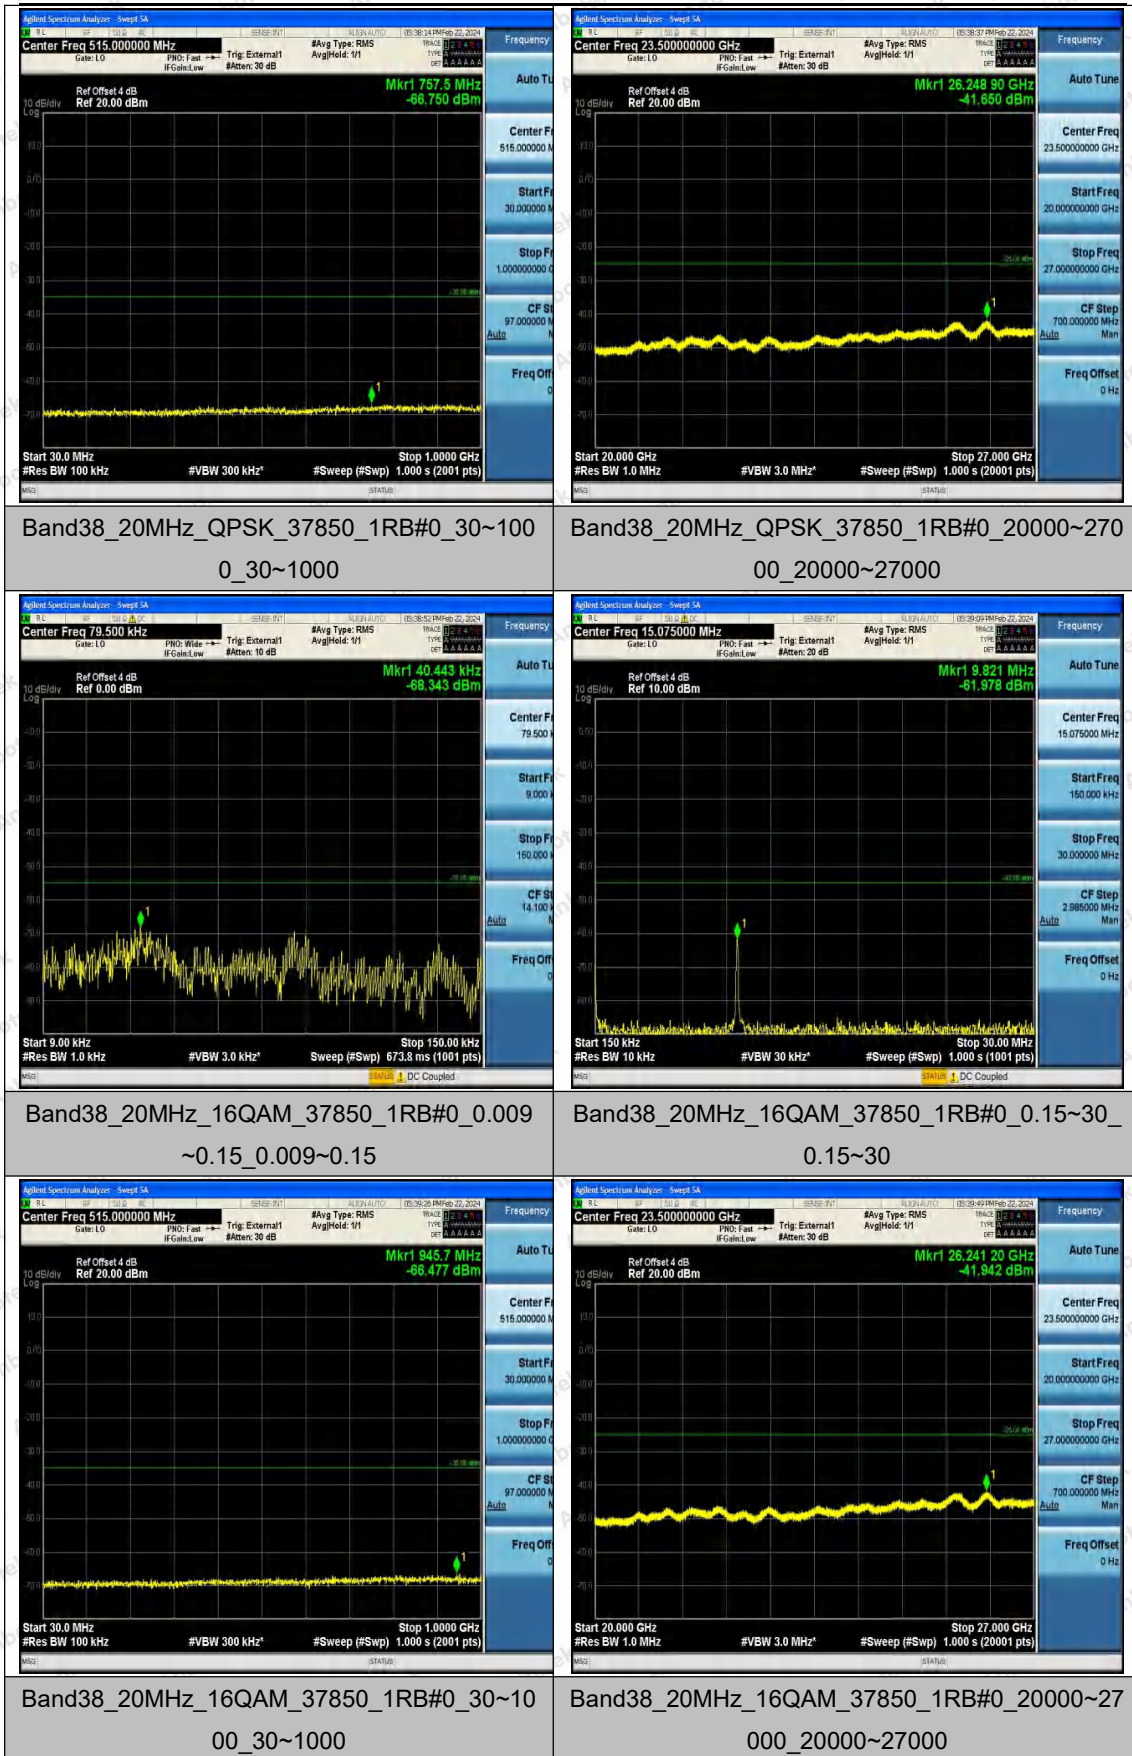


Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.
 Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com



Hotline
 400-003-0500
 www.anbotek.com.cn



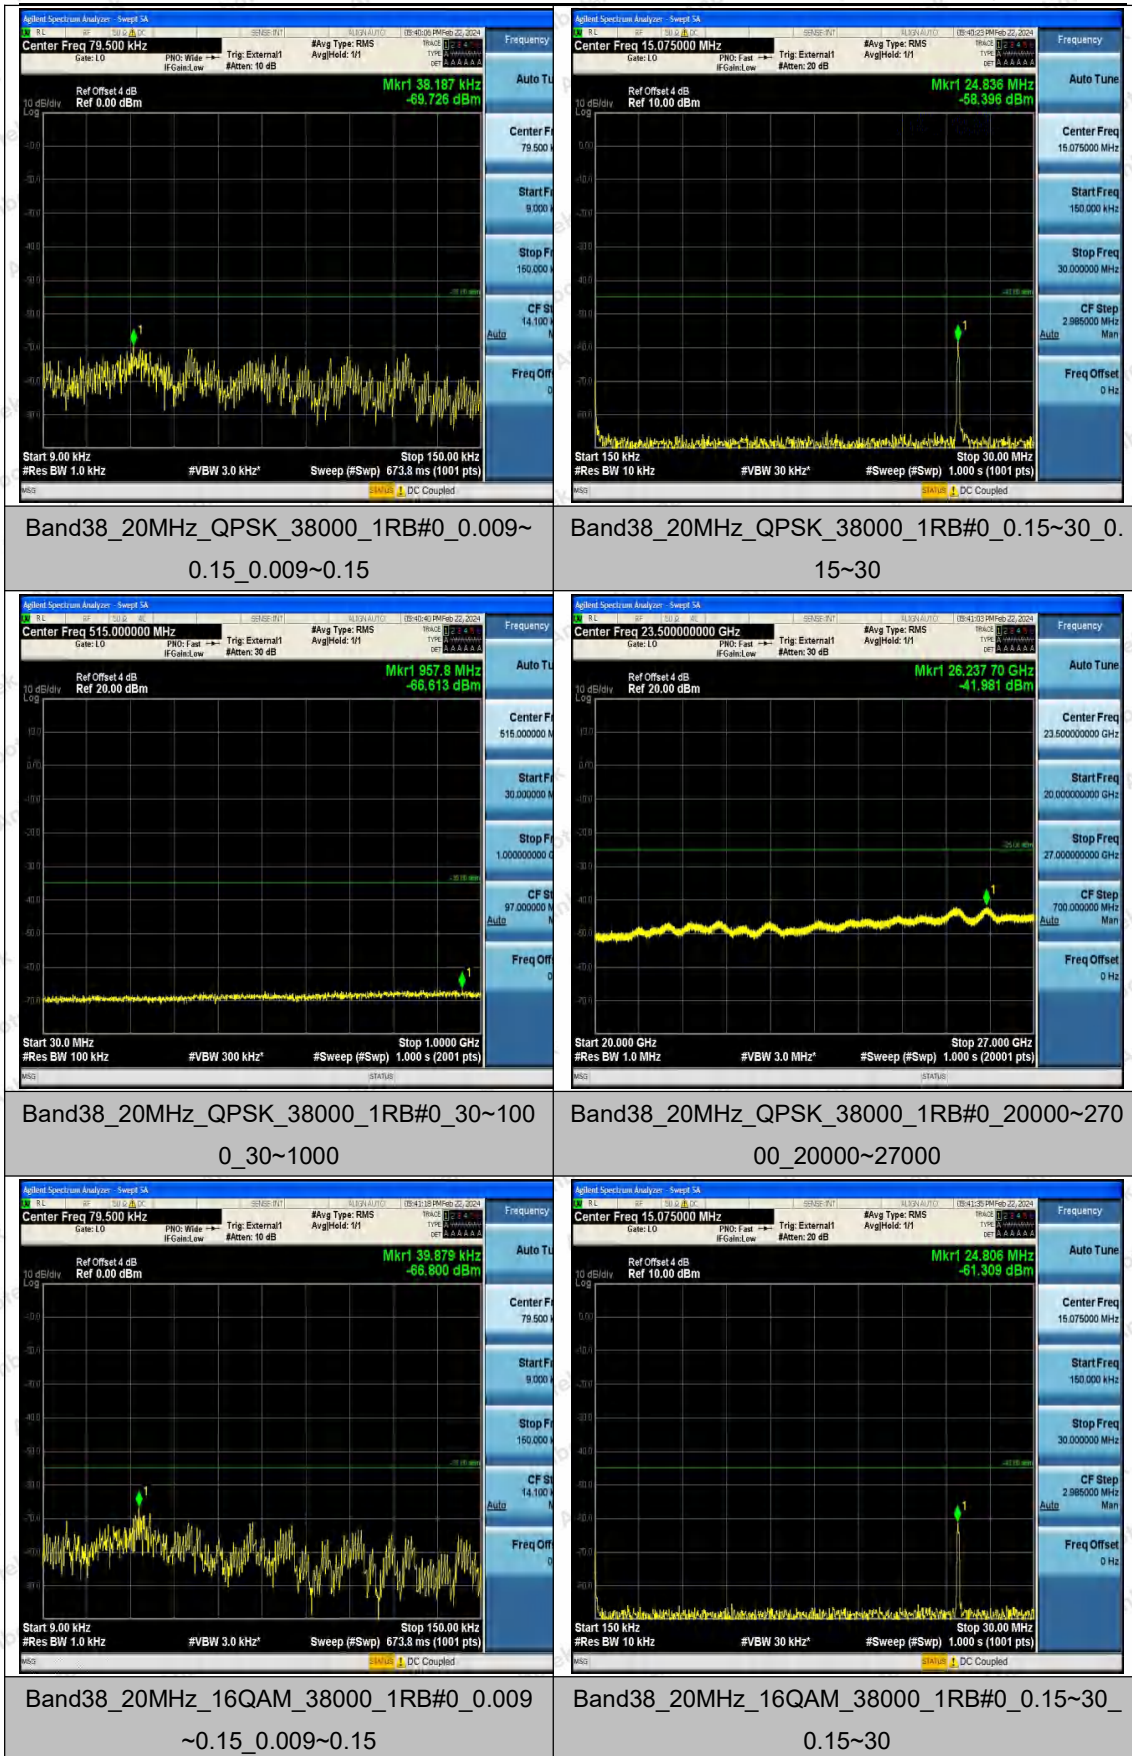


Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.
 Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com



Hotline
 400-003-0500
 www.anbotek.com.cn



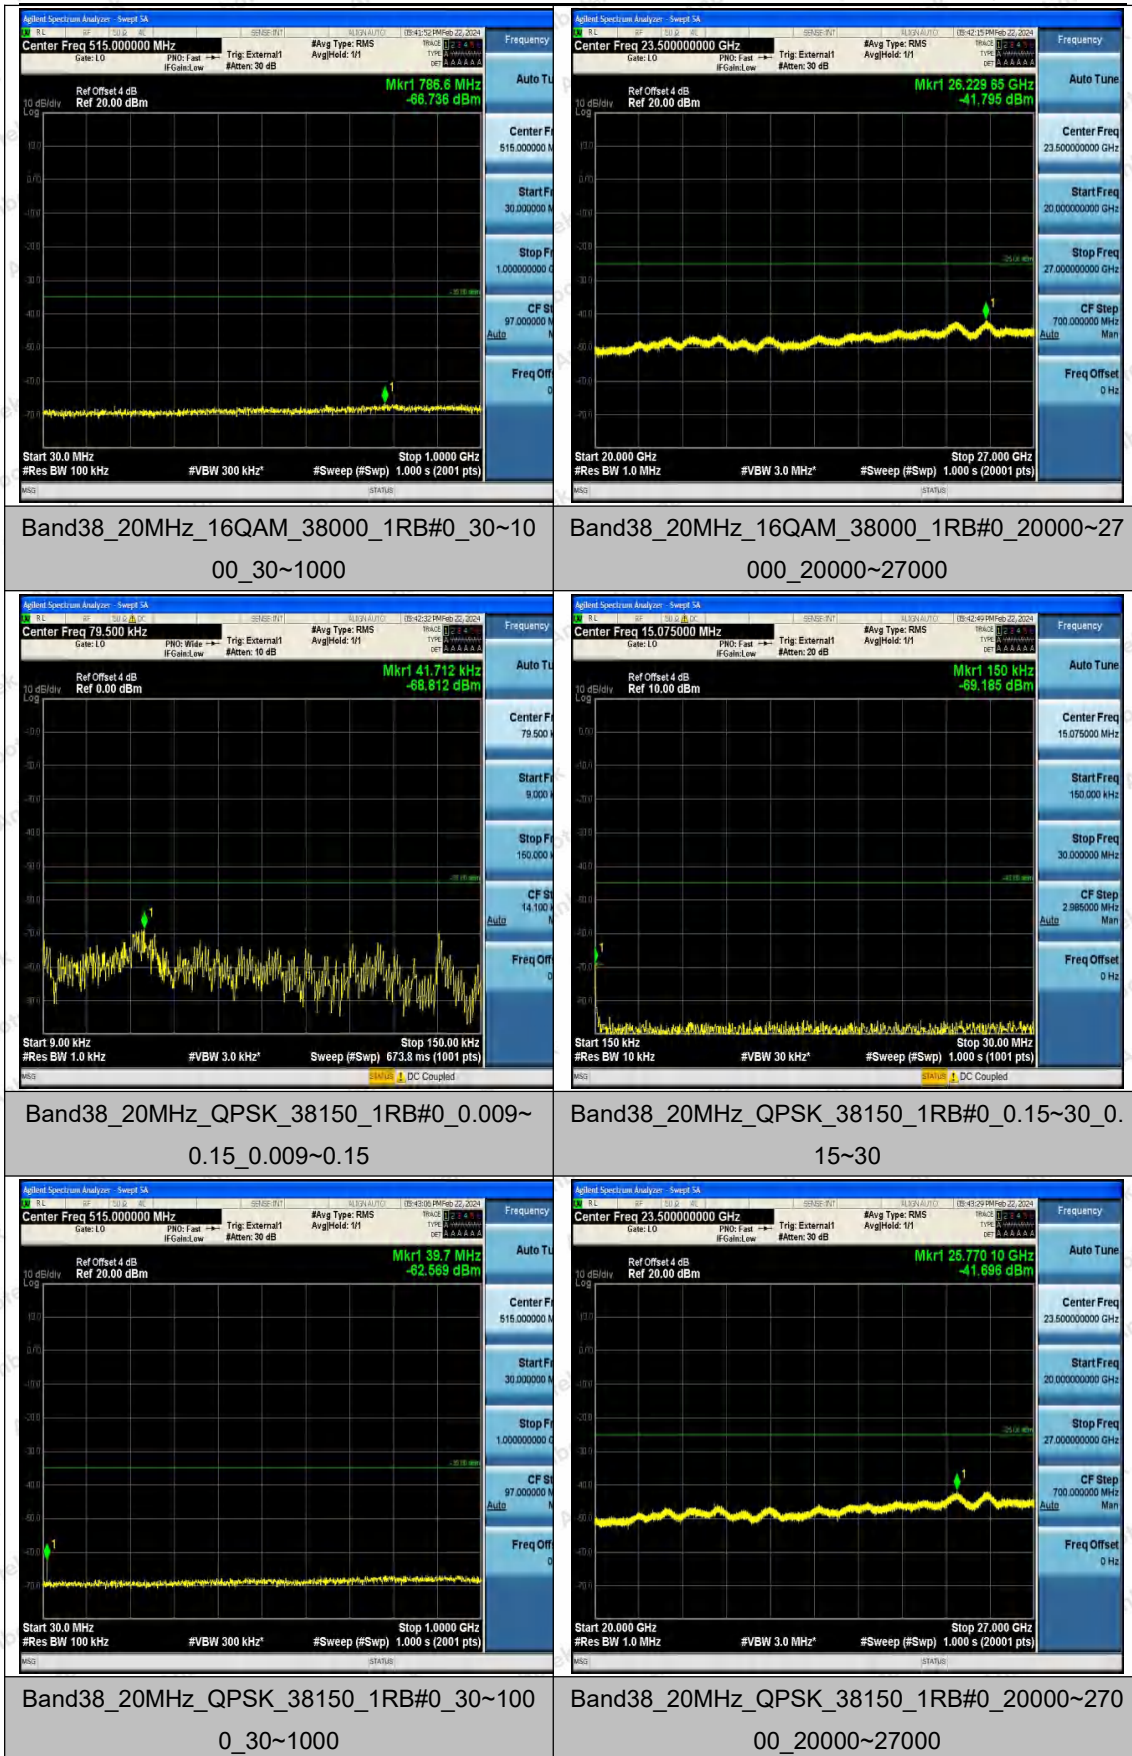


Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.
 Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com



Hotline
 400-003-0500
 www.anbotek.com.cn



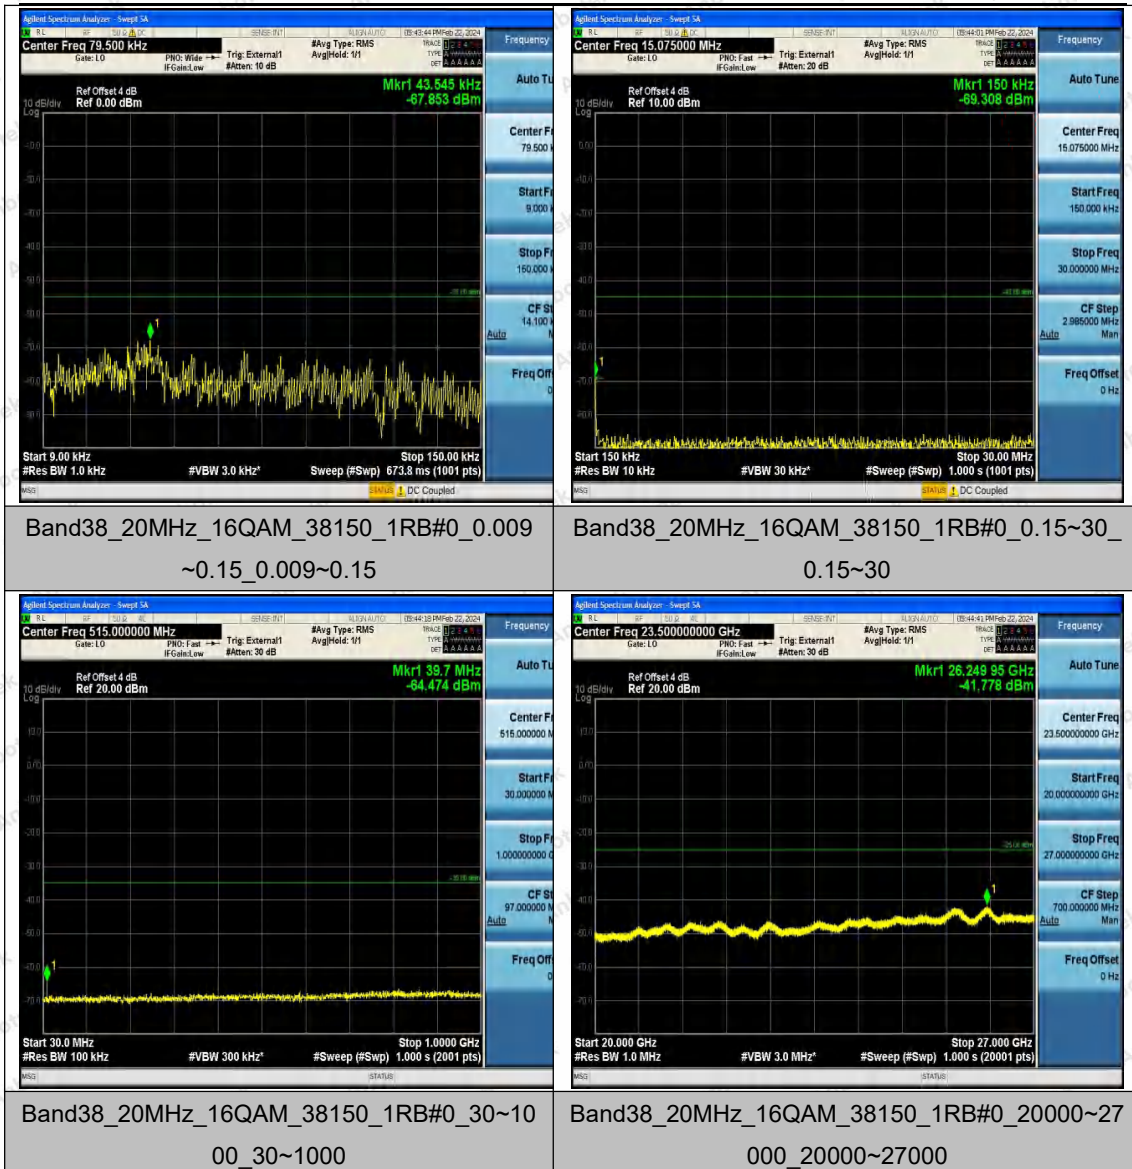

Appendix F: Frequency Stability

Test Result

Band	Bandwidth	Modulation	Channel	RB Configuration	Voltage		Deviation (Hz)	Deviation (ppm)	Limit (ppm)	Verdict
					Voltage [Vdc]	Temperature (°C)				
Band38	5MHz	QPSK	37775	25RB#0	VN	NT	11.93	0.004638	±2.5	PASS
Band38	5MHz	QPSK	37775	25RB#0	VL	NT	-10.34	-0.004019	±2.5	PASS
Band38	5MHz	QPSK	37775	25RB#0	VH	NT	10.51	0.004086	±2.5	PASS
Band38	5MHz	16QAM	37775	25RB#0	VN	NT	14.08	0.005473	±2.5	PASS
Band38	5MHz	16QAM	37775	25RB#0	VL	NT	18.55	0.007211	±2.5	PASS
Band38	5MHz	16QAM	37775	25RB#0	VH	NT	16.57	0.006441	±2.5	PASS
Band38	5MHz	QPSK	38000	25RB#0	VN	NT	15.12	0.005827	±2.5	PASS
Band38	5MHz	QPSK	38000	25RB#0	VL	NT	-7.28	-0.002805	±2.5	PASS
Band38	5MHz	QPSK	38000	25RB#0	VH	NT	12.86	0.004956	±2.5	PASS
Band38	5MHz	16QAM	38000	25RB#0	VN	NT	26.97	0.010393	±2.5	PASS
Band38	5MHz	16QAM	38000	25RB#0	VL	NT	30.07	0.011588	±2.5	PASS
Band38	5MHz	16QAM	38000	25RB#0	VH	NT	18.14	0.006990	±2.5	PASS
Band38	5MHz	QPSK	38225	25RB#0	VN	NT	13.88	0.005303	±2.5	PASS
Band38	5MHz	QPSK	38225	25RB#0	VL	NT	-12.67	-0.004840	±2.5	PASS
Band38	5MHz	QPSK	38225	25RB#0	VH	NT	-12.62	-0.004821	±2.5	PASS
Band38	5MHz	16QAM	38225	25RB#0	VN	NT	-29.41	-0.011236	±2.5	PASS
Band38	5MHz	16QAM	38225	25RB#0	VL	NT	-27.68	-0.010575	±2.5	PASS
Band38	5MHz	16QAM	38225	25RB#0	VH	NT	-31.91	-0.012191	±2.5	PASS
Band38	10MHz	QPSK	37800	50RB#0	VN	NT	-19.50	-0.007573	±2.5	PASS
Band38	10MHz	QPSK	37800	50RB#0	VL	NT	7.84	0.003045	±2.5	PASS
Band38	10MHz	QPSK	37800	50RB#0	VH	NT	-13.93	-0.005410	±2.5	PASS
Band38	10MHz	16QAM	37800	50RB#0	VN	NT	-10.54	-0.004093	±2.5	PASS
Band38	10MHz	16QAM	37800	50RB#0	VL	NT	8.15	0.003165	±2.5	PASS
Band38	10MHz	16QAM	37800	50RB#0	VH	NT	-13.96	-0.005421	±2.5	PASS
Band38	10MHz	QPSK	38000	50RB#0	VN	NT	-16.47	-0.006347	±2.5	PASS
Band38	10MHz	QPSK	38000	50RB#0	VL	NT	-12.37	-0.004767	±2.5	PASS
Band38	10MHz	QPSK	38000	50RB#0	VH	NT	-20.91	-0.008058	±2.5	PASS
Band38	10MHz	16QAM	38000	50RB#0	VN	NT	-24.52	-0.009449	±2.5	PASS
Band38	10MHz	16QAM	38000	50RB#0	VL	NT	-10.69	-0.004119	±2.5	PASS
Band38	10MHz	16QAM	38000	50RB#0	VH	NT	-20.34	-0.007838	±2.5	PASS
Band38	10MHz	QPSK	38200	50RB#0	VN	NT	3.63	0.001388	±2.5	PASS
Band38	10MHz	QPSK	38200	50RB#0	VL	NT	-29.45	-0.011262	±2.5	PASS
Band38	10MHz	QPSK	38200	50RB#0	VH	NT	-25.41	-0.009717	±2.5	PASS
Band38	10MHz	16QAM	38200	50RB#0	VN	NT	-10.46	-0.004000	±2.5	PASS
Band38	10MHz	16QAM	38200	50RB#0	VL	NT	-14.08	-0.005384	±2.5	PASS

Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.
Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com



Hotline
400-003-0500
www.anbotek.com.cn



Band38	10MHz	16QAM	38200	50RB#0	VH	NT	-10.96	-0.004191	±2.5	PASS
Band38	15MHz	QPSK	37825	75RB#0	VN	NT	-4.94	-0.001917	±2.5	PASS
Band38	15MHz	QPSK	37825	75RB#0	VL	NT	-12.29	-0.004768	±2.5	PASS
Band38	15MHz	QPSK	37825	75RB#0	VH	NT	10.26	0.003981	±2.5	PASS
Band38	15MHz	16QAM	37825	75RB#0	VN	NT	-22.07	-0.008563	±2.5	PASS
Band38	15MHz	16QAM	37825	75RB#0	VL	NT	-21.29	-0.008260	±2.5	PASS
Band38	15MHz	16QAM	37825	75RB#0	VH	NT	12.73	0.004939	±2.5	PASS
Band38	15MHz	QPSK	38000	75RB#0	VN	NT	-15.35	-0.005915	±2.5	PASS
Band38	15MHz	QPSK	38000	75RB#0	VL	NT	-17.50	-0.006744	±2.5	PASS
Band38	15MHz	QPSK	38000	75RB#0	VH	NT	-8.70	-0.003353	±2.5	PASS
Band38	15MHz	16QAM	38000	75RB#0	VN	NT	-11.04	-0.004254	±2.5	PASS
Band38	15MHz	16QAM	38000	75RB#0	VL	NT	7.97	0.003071	±2.5	PASS
Band38	15MHz	16QAM	38000	75RB#0	VH	NT	-17.45	-0.006724	±2.5	PASS
Band38	15MHz	QPSK	38175	75RB#0	VN	NT	-3.78	-0.001447	±2.5	PASS
Band38	15MHz	QPSK	38175	75RB#0	VL	NT	-23.19	-0.008877	±2.5	PASS
Band38	15MHz	QPSK	38175	75RB#0	VH	NT	-20.38	-0.007801	±2.5	PASS
Band38	15MHz	16QAM	38175	75RB#0	VN	NT	-15.82	-0.006056	±2.5	PASS
Band38	15MHz	16QAM	38175	75RB#0	VL	NT	-16.97	-0.006496	±2.5	PASS
Band38	15MHz	16QAM	38175	75RB#0	VH	NT	-8.15	-0.003120	±2.5	PASS
Band38	20MHz	QPSK	37850	100RB#0	VN	NT	6.47	0.002508	±2.5	PASS
Band38	20MHz	QPSK	37850	100RB#0	VL	NT	-16.97	-0.006578	±2.5	PASS
Band38	20MHz	QPSK	37850	100RB#0	VH	NT	-16.31	-0.006322	±2.5	PASS
Band38	20MHz	16QAM	37850	100RB#0	VN	NT	-11.13	-0.004314	±2.5	PASS
Band38	20MHz	16QAM	37850	100RB#0	VL	NT	-7.28	-0.002822	±2.5	PASS
Band38	20MHz	16QAM	37850	100RB#0	VH	NT	-16.91	-0.006554	±2.5	PASS
Band38	20MHz	QPSK	38000	100RB#0	VN	NT	-13.80	-0.005318	±2.5	PASS
Band38	20MHz	QPSK	38000	100RB#0	VL	NT	-13.60	-0.005241	±2.5	PASS
Band38	20MHz	QPSK	38000	100RB#0	VH	NT	-15.74	-0.006066	±2.5	PASS
Band38	20MHz	16QAM	38000	100RB#0	VN	NT	10.94	0.004216	±2.5	PASS
Band38	20MHz	16QAM	38000	100RB#0	VL	NT	-12.92	-0.004979	±2.5	PASS
Band38	20MHz	16QAM	38000	100RB#0	VH	NT	5.87	0.002262	±2.5	PASS
Band38	20MHz	QPSK	38150	100RB#0	VN	NT	-14.05	-0.005383	±2.5	PASS
Band38	20MHz	QPSK	38150	100RB#0	VL	NT	-20.40	-0.007816	±2.5	PASS
Band38	20MHz	QPSK	38150	100RB#0	VH	NT	-10.07	-0.003858	±2.5	PASS
Band38	20MHz	16QAM	38150	100RB#0	VN	NT	-19.60	-0.007510	±2.5	PASS
Band38	20MHz	16QAM	38150	100RB#0	VL	NT	3.98	0.001525	±2.5	PASS
Band38	20MHz	16QAM	38150	100RB#0	VH	NT	-13.40	-0.005134	±2.5	PASS

Temperature										
Band	Bandwidth	Modulation	Channel	RB Configuration	Voltage [Vdc]	Temperature (°C)	Deviation (Hz)	Deviation (ppm)	Limit (ppm)	Verdict

Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.
 Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com



Hotline
400-003-0500
www.anbotek.com.cn



Band38	5MHz	QPSK	37775	25RB#0	NV	-30	12.03	0.004676	±2.5	PASS
Band38	5MHz	QPSK	37775	25RB#0	NV	-20	11.49	0.004466	±2.5	PASS
Band38	5MHz	QPSK	37775	25RB#0	NV	-10	12.46	0.004844	±2.5	PASS
Band38	5MHz	QPSK	37775	25RB#0	NV	0	16.15	0.006278	±2.5	PASS
Band38	5MHz	QPSK	37775	25RB#0	NV	10	-4.49	-0.001745	±2.5	PASS
Band38	5MHz	QPSK	37775	25RB#0	NV	20	13.43	0.005221	±2.5	PASS
Band38	5MHz	QPSK	37775	25RB#0	NV	30	16.71	0.006496	±2.5	PASS
Band38	5MHz	QPSK	37775	25RB#0	NV	40	14.65	0.005695	±2.5	PASS
Band38	5MHz	QPSK	37775	25RB#0	NV	50	10.46	0.004066	±2.5	PASS
Band38	5MHz	16QAM	37775	25RB#0	NV	-30	20.33	0.007903	±2.5	PASS
Band38	5MHz	16QAM	37775	25RB#0	NV	-20	24.81	0.009644	±2.5	PASS
Band38	5MHz	16QAM	37775	25RB#0	NV	-10	23.17	0.009007	±2.5	PASS
Band38	5MHz	16QAM	37775	25RB#0	NV	0	10.99	0.004272	±2.5	PASS
Band38	5MHz	16QAM	37775	25RB#0	NV	10	27.81	0.010810	±2.5	PASS
Band38	5MHz	16QAM	37775	25RB#0	NV	20	27.74	0.010783	±2.5	PASS
Band38	5MHz	16QAM	37775	25RB#0	NV	30	27.69	0.010764	±2.5	PASS
Band38	5MHz	16QAM	37775	25RB#0	NV	40	30.86	0.011996	±2.5	PASS
Band38	5MHz	16QAM	37775	25RB#0	NV	50	28.62	0.011125	±2.5	PASS
Band38	5MHz	QPSK	38000	25RB#0	NV	-30	15.28	0.005888	±2.5	PASS
Band38	5MHz	QPSK	38000	25RB#0	NV	-20	-3.45	-0.001329	±2.5	PASS
Band38	5MHz	QPSK	38000	25RB#0	NV	-10	16.38	0.006312	±2.5	PASS
Band38	5MHz	QPSK	38000	25RB#0	NV	0	20.21	0.007788	±2.5	PASS
Band38	5MHz	QPSK	38000	25RB#0	NV	10	12.07	0.004651	±2.5	PASS
Band38	5MHz	QPSK	38000	25RB#0	NV	20	18.17	0.007002	±2.5	PASS
Band38	5MHz	QPSK	38000	25RB#0	NV	30	6.29	0.002424	±2.5	PASS
Band38	5MHz	QPSK	38000	25RB#0	NV	40	21.50	0.008285	±2.5	PASS
Band38	5MHz	QPSK	38000	25RB#0	NV	50	19.50	0.007514	±2.5	PASS
Band38	5MHz	16QAM	38000	25RB#0	NV	-30	31.77	0.012243	±2.5	PASS
Band38	5MHz	16QAM	38000	25RB#0	NV	-20	36.32	0.013996	±2.5	PASS
Band38	5MHz	16QAM	38000	25RB#0	NV	-10	38.95	0.015010	±2.5	PASS
Band38	5MHz	16QAM	38000	25RB#0	NV	0	38.01	0.014647	±2.5	PASS
Band38	5MHz	16QAM	38000	25RB#0	NV	10	41.96	0.016170	±2.5	PASS
Band38	5MHz	16QAM	38000	25RB#0	NV	20	42.49	0.016374	±2.5	PASS
Band38	5MHz	16QAM	38000	25RB#0	NV	30	44.79	0.017260	±2.5	PASS
Band38	5MHz	16QAM	38000	25RB#0	NV	40	44.15	0.017013	±2.5	PASS
Band38	5MHz	16QAM	38000	25RB#0	NV	50	49.32	0.019006	±2.5	PASS
Band38	5MHz	QPSK	38225	25RB#0	NV	-30	-7.60	-0.002904	±2.5	PASS
Band38	5MHz	QPSK	38225	25RB#0	NV	-20	-20.08	-0.007671	±2.5	PASS
Band38	5MHz	QPSK	38225	25RB#0	NV	-10	-8.03	-0.003068	±2.5	PASS
Band38	5MHz	QPSK	38225	25RB#0	NV	0	-22.30	-0.008520	±2.5	PASS
Band38	5MHz	QPSK	38225	25RB#0	NV	10	-10.49	-0.004008	±2.5	PASS

Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community,
 Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.
 Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com



Hotline
 400-003-0500
 www.anbotek.com.cn



Band38	5MHz	QPSK	38225	25RB#0	NV	20	-22.04	-0.008420	±2.5	PASS
Band38	5MHz	QPSK	38225	25RB#0	NV	30	-25.98	-0.009926	±2.5	PASS
Band38	5MHz	QPSK	38225	25RB#0	NV	40	-31.23	-0.011931	±2.5	PASS
Band38	5MHz	QPSK	38225	25RB#0	NV	50	-27.21	-0.010395	±2.5	PASS
Band38	5MHz	16QAM	38225	25RB#0	NV	-30	-30.28	-0.011568	±2.5	PASS
Band38	5MHz	16QAM	38225	25RB#0	NV	-20	-30.54	-0.011668	±2.5	PASS
Band38	5MHz	16QAM	38225	25RB#0	NV	-10	-29.50	-0.011270	±2.5	PASS
Band38	5MHz	16QAM	38225	25RB#0	NV	0	-32.11	-0.012267	±2.5	PASS
Band38	5MHz	16QAM	38225	25RB#0	NV	10	-10.56	-0.004034	±2.5	PASS
Band38	5MHz	16QAM	38225	25RB#0	NV	20	-25.72	-0.009826	±2.5	PASS
Band38	5MHz	16QAM	38225	25RB#0	NV	30	-24.95	-0.009532	±2.5	PASS
Band38	5MHz	16QAM	38225	25RB#0	NV	40	-21.41	-0.008180	±2.5	PASS
Band38	5MHz	16QAM	38225	25RB#0	NV	50	-22.90	-0.008749	±2.5	PASS
Band38	10MHz	QPSK	37800	50RB#0	NV	-30	-18.44	-0.007161	±2.5	PASS
Band38	10MHz	QPSK	37800	50RB#0	NV	-20	-9.81	-0.003810	±2.5	PASS
Band38	10MHz	QPSK	37800	50RB#0	NV	-10	-8.67	-0.003367	±2.5	PASS
Band38	10MHz	QPSK	37800	50RB#0	NV	0	-14.63	-0.005682	±2.5	PASS
Band38	10MHz	QPSK	37800	50RB#0	NV	10	-6.07	-0.002357	±2.5	PASS
Band38	10MHz	QPSK	37800	50RB#0	NV	20	-14.61	-0.005674	±2.5	PASS
Band38	10MHz	QPSK	37800	50RB#0	NV	30	9.84	0.003821	±2.5	PASS
Band38	10MHz	QPSK	37800	50RB#0	NV	40	-11.42	-0.004435	±2.5	PASS
Band38	10MHz	QPSK	37800	50RB#0	NV	50	-10.21	-0.003965	±2.5	PASS
Band38	10MHz	16QAM	37800	50RB#0	NV	-30	-10.10	-0.003922	±2.5	PASS
Band38	10MHz	16QAM	37800	50RB#0	NV	-20	6.57	0.002551	±2.5	PASS
Band38	10MHz	16QAM	37800	50RB#0	NV	-10	-18.17	-0.007056	±2.5	PASS
Band38	10MHz	16QAM	37800	50RB#0	NV	0	-16.08	-0.006245	±2.5	PASS
Band38	10MHz	16QAM	37800	50RB#0	NV	10	-12.65	-0.004913	±2.5	PASS
Band38	10MHz	16QAM	37800	50RB#0	NV	20	-1.65	-0.000641	±2.5	PASS
Band38	10MHz	16QAM	37800	50RB#0	NV	30	-9.08	-0.003526	±2.5	PASS
Band38	10MHz	16QAM	37800	50RB#0	NV	40	-16.52	-0.006416	±2.5	PASS
Band38	10MHz	16QAM	37800	50RB#0	NV	50	-14.08	-0.005468	±2.5	PASS
Band38	10MHz	QPSK	38000	50RB#0	NV	-30	-18.10	-0.006975	±2.5	PASS
Band38	10MHz	QPSK	38000	50RB#0	NV	-20	-4.56	-0.001757	±2.5	PASS
Band38	10MHz	QPSK	38000	50RB#0	NV	-10	-29.81	-0.011487	±2.5	PASS
Band38	10MHz	QPSK	38000	50RB#0	NV	0	-20.80	-0.008015	±2.5	PASS
Band38	10MHz	QPSK	38000	50RB#0	NV	10	-22.23	-0.008566	±2.5	PASS
Band38	10MHz	QPSK	38000	50RB#0	NV	20	-25.19	-0.009707	±2.5	PASS
Band38	10MHz	QPSK	38000	50RB#0	NV	30	-16.57	-0.006385	±2.5	PASS
Band38	10MHz	QPSK	38000	50RB#0	NV	40	-9.41	-0.003626	±2.5	PASS
Band38	10MHz	QPSK	38000	50RB#0	NV	50	-20.53	-0.007911	±2.5	PASS
Band38	10MHz	16QAM	38000	50RB#0	NV	-30	-19.23	-0.007410	±2.5	PASS

Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community,
 Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.
 Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com



Hotline
 400-003-0500
 www.anbotek.com.cn



Band38	10MHz	16QAM	38000	50RB#0	NV	-20	-11.07	-0.004266	±2.5	PASS
Band38	10MHz	16QAM	38000	50RB#0	NV	-10	7.21	0.002778	±2.5	PASS
Band38	10MHz	16QAM	38000	50RB#0	NV	0	-18.11	-0.006979	±2.5	PASS
Band38	10MHz	16QAM	38000	50RB#0	NV	10	-19.81	-0.007634	±2.5	PASS
Band38	10MHz	16QAM	38000	50RB#0	NV	20	-14.32	-0.005518	±2.5	PASS
Band38	10MHz	16QAM	38000	50RB#0	NV	30	-17.81	-0.006863	±2.5	PASS
Band38	10MHz	16QAM	38000	50RB#0	NV	40	-26.69	-0.010285	±2.5	PASS
Band38	10MHz	16QAM	38000	50RB#0	NV	50	-18.70	-0.007206	±2.5	PASS
Band38	10MHz	QPSK	38200	50RB#0	NV	-30	-11.40	-0.004359	±2.5	PASS
Band38	10MHz	QPSK	38200	50RB#0	NV	-20	-19.13	-0.007315	±2.5	PASS
Band38	10MHz	QPSK	38200	50RB#0	NV	-10	-21.50	-0.008222	±2.5	PASS
Band38	10MHz	QPSK	38200	50RB#0	NV	0	-30.20	-0.011549	±2.5	PASS
Band38	10MHz	QPSK	38200	50RB#0	NV	10	-22.29	-0.008524	±2.5	PASS
Band38	10MHz	QPSK	38200	50RB#0	NV	20	-25.28	-0.009667	±2.5	PASS
Band38	10MHz	QPSK	38200	50RB#0	NV	30	-15.55	-0.005946	±2.5	PASS
Band38	10MHz	QPSK	38200	50RB#0	NV	40	-19.04	-0.007281	±2.5	PASS
Band38	10MHz	QPSK	38200	50RB#0	NV	50	-10.79	-0.004126	±2.5	PASS
Band38	10MHz	16QAM	38200	50RB#0	NV	-30	-17.34	-0.006631	±2.5	PASS
Band38	10MHz	16QAM	38200	50RB#0	NV	-20	-16.12	-0.006164	±2.5	PASS
Band38	10MHz	16QAM	38200	50RB#0	NV	-10	-19.70	-0.007533	±2.5	PASS
Band38	10MHz	16QAM	38200	50RB#0	NV	0	-20.31	-0.007767	±2.5	PASS
Band38	10MHz	16QAM	38200	50RB#0	NV	10	-17.70	-0.006769	±2.5	PASS
Band38	10MHz	16QAM	38200	50RB#0	NV	20	-12.03	-0.004600	±2.5	PASS
Band38	10MHz	16QAM	38200	50RB#0	NV	30	-28.50	-0.010899	±2.5	PASS
Band38	10MHz	16QAM	38200	50RB#0	NV	40	-14.72	-0.005629	±2.5	PASS
Band38	10MHz	16QAM	38200	50RB#0	NV	50	-12.70	-0.004857	±2.5	PASS
Band38	15MHz	QPSK	37825	75RB#0	NV	-30	-12.55	-0.004869	±2.5	PASS
Band38	15MHz	QPSK	37825	75RB#0	NV	-20	-13.59	-0.005273	±2.5	PASS
Band38	15MHz	QPSK	37825	75RB#0	NV	-10	-9.46	-0.003670	±2.5	PASS
Band38	15MHz	QPSK	37825	75RB#0	NV	0	-7.12	-0.002762	±2.5	PASS
Band38	15MHz	QPSK	37825	75RB#0	NV	10	-18.74	-0.007271	±2.5	PASS
Band38	15MHz	QPSK	37825	75RB#0	NV	20	7.64	0.002964	±2.5	PASS
Band38	15MHz	QPSK	37825	75RB#0	NV	30	-15.75	-0.006111	±2.5	PASS
Band38	15MHz	QPSK	37825	75RB#0	NV	40	15.89	0.006165	±2.5	PASS
Band38	15MHz	QPSK	37825	75RB#0	NV	50	-18.47	-0.007166	±2.5	PASS
Band38	15MHz	16QAM	37825	75RB#0	NV	-30	4.19	0.001626	±2.5	PASS
Band38	15MHz	16QAM	37825	75RB#0	NV	-20	-10.06	-0.003903	±2.5	PASS
Band38	15MHz	16QAM	37825	75RB#0	NV	-10	-9.14	-0.003546	±2.5	PASS
Band38	15MHz	16QAM	37825	75RB#0	NV	0	-11.74	-0.004555	±2.5	PASS
Band38	15MHz	16QAM	37825	75RB#0	NV	10	-16.88	-0.006549	±2.5	PASS
Band38	15MHz	16QAM	37825	75RB#0	NV	20	-16.32	-0.006332	±2.5	PASS

Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community,
 Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.
 Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com



Hotline
 400-003-0500
 www.anbotek.com.cn



Band38	15MHz	16QAM	37825	75RB#0	NV	30	-9.83	-0.003814	±2.5	PASS
Band38	15MHz	16QAM	37825	75RB#0	NV	40	-5.79	-0.002246	±2.5	PASS
Band38	15MHz	16QAM	37825	75RB#0	NV	50	-13.66	-0.005300	±2.5	PASS
Band38	15MHz	QPSK	38000	75RB#0	NV	-30	-13.25	-0.005106	±2.5	PASS
Band38	15MHz	QPSK	38000	75RB#0	NV	-20	-15.02	-0.005788	±2.5	PASS
Band38	15MHz	QPSK	38000	75RB#0	NV	-10	-8.38	-0.003229	±2.5	PASS
Band38	15MHz	QPSK	38000	75RB#0	NV	0	-15.13	-0.005830	±2.5	PASS
Band38	15MHz	QPSK	38000	75RB#0	NV	10	11.94	0.004601	±2.5	PASS
Band38	15MHz	QPSK	38000	75RB#0	NV	20	-6.42	-0.002474	±2.5	PASS
Band38	15MHz	QPSK	38000	75RB#0	NV	30	-19.18	-0.007391	±2.5	PASS
Band38	15MHz	QPSK	38000	75RB#0	NV	40	-21.90	-0.008439	±2.5	PASS
Band38	15MHz	QPSK	38000	75RB#0	NV	50	-16.82	-0.006482	±2.5	PASS
Band38	15MHz	16QAM	38000	75RB#0	NV	-30	-7.25	-0.002794	±2.5	PASS
Band38	15MHz	16QAM	38000	75RB#0	NV	-20	-15.09	-0.005815	±2.5	PASS
Band38	15MHz	16QAM	38000	75RB#0	NV	-10	-14.58	-0.005618	±2.5	PASS
Band38	15MHz	16QAM	38000	75RB#0	NV	0	-20.59	-0.007934	±2.5	PASS
Band38	15MHz	16QAM	38000	75RB#0	NV	10	-17.04	-0.006566	±2.5	PASS
Band38	15MHz	16QAM	38000	75RB#0	NV	20	-14.05	-0.005414	±2.5	PASS
Band38	15MHz	16QAM	38000	75RB#0	NV	30	-18.71	-0.007210	±2.5	PASS
Band38	15MHz	16QAM	38000	75RB#0	NV	40	10.67	0.004112	±2.5	PASS
Band38	15MHz	16QAM	38000	75RB#0	NV	50	-9.26	-0.003568	±2.5	PASS
Band38	15MHz	QPSK	38175	75RB#0	NV	-30	-18.07	-0.006917	±2.5	PASS
Band38	15MHz	QPSK	38175	75RB#0	NV	-20	-24.02	-0.009194	±2.5	PASS
Band38	15MHz	QPSK	38175	75RB#0	NV	-10	-21.54	-0.008245	±2.5	PASS
Band38	15MHz	QPSK	38175	75RB#0	NV	0	-8.31	-0.003181	±2.5	PASS
Band38	15MHz	QPSK	38175	75RB#0	NV	10	-24.18	-0.009256	±2.5	PASS
Band38	15MHz	QPSK	38175	75RB#0	NV	20	-23.27	-0.008907	±2.5	PASS
Band38	15MHz	QPSK	38175	75RB#0	NV	30	-7.88	-0.003016	±2.5	PASS
Band38	15MHz	QPSK	38175	75RB#0	NV	40	-23.56	-0.009018	±2.5	PASS
Band38	15MHz	QPSK	38175	75RB#0	NV	50	-14.96	-0.005726	±2.5	PASS
Band38	15MHz	16QAM	38175	75RB#0	NV	-30	-3.45	-0.001321	±2.5	PASS
Band38	15MHz	16QAM	38175	75RB#0	NV	-20	-14.05	-0.005378	±2.5	PASS
Band38	15MHz	16QAM	38175	75RB#0	NV	-10	-18.78	-0.007189	±2.5	PASS
Band38	15MHz	16QAM	38175	75RB#0	NV	0	-18.61	-0.007123	±2.5	PASS
Band38	15MHz	16QAM	38175	75RB#0	NV	10	-16.91	-0.006473	±2.5	PASS
Band38	15MHz	16QAM	38175	75RB#0	NV	20	-12.93	-0.004949	±2.5	PASS
Band38	15MHz	16QAM	38175	75RB#0	NV	30	-24.65	-0.009435	±2.5	PASS
Band38	15MHz	16QAM	38175	75RB#0	NV	40	-14.93	-0.005715	±2.5	PASS
Band38	15MHz	16QAM	38175	75RB#0	NV	50	-18.02	-0.006898	±2.5	PASS
Band38	20MHz	QPSK	37850	100RB#0	NV	-30	-19.77	-0.007663	±2.5	PASS
Band38	20MHz	QPSK	37850	100RB#0	NV	-20	-12.59	-0.004880	±2.5	PASS

Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community,
 Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.
 Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com



Hotline
 400-003-0500
 www.anbotek.com.cn



Band38	20MHz	QPSK	37850	100RB#0	NV	-10	-18.54	-0.007186	±2.5	PASS
Band38	20MHz	QPSK	37850	100RB#0	NV	0	-10.11	-0.003919	±2.5	PASS
Band38	20MHz	QPSK	37850	100RB#0	NV	10	-28.07	-0.010880	±2.5	PASS
Band38	20MHz	QPSK	37850	100RB#0	NV	20	-12.73	-0.004934	±2.5	PASS
Band38	20MHz	QPSK	37850	100RB#0	NV	30	-13.03	-0.005050	±2.5	PASS
Band38	20MHz	QPSK	37850	100RB#0	NV	40	-8.97	-0.003477	±2.5	PASS
Band38	20MHz	QPSK	37850	100RB#0	NV	50	-7.52	-0.002915	±2.5	PASS
Band38	20MHz	16QAM	37850	100RB#0	NV	-30	-15.78	-0.006116	±2.5	PASS
Band38	20MHz	16QAM	37850	100RB#0	NV	-20	-16.26	-0.006302	±2.5	PASS
Band38	20MHz	16QAM	37850	100RB#0	NV	-10	-5.97	-0.002314	±2.5	PASS
Band38	20MHz	16QAM	37850	100RB#0	NV	0	-13.49	-0.005229	±2.5	PASS
Band38	20MHz	16QAM	37850	100RB#0	NV	10	-16.51	-0.006399	±2.5	PASS
Band38	20MHz	16QAM	37850	100RB#0	NV	20	-5.18	-0.002008	±2.5	PASS
Band38	20MHz	16QAM	37850	100RB#0	NV	30	-19.91	-0.007717	±2.5	PASS
Band38	20MHz	16QAM	37850	100RB#0	NV	40	-19.77	-0.007663	±2.5	PASS
Band38	20MHz	16QAM	37850	100RB#0	NV	50	-4.68	-0.001814	±2.5	PASS
Band38	20MHz	QPSK	38000	100RB#0	NV	-30	-8.80	-0.003391	±2.5	PASS
Band38	20MHz	QPSK	38000	100RB#0	NV	-20	-12.04	-0.004640	±2.5	PASS
Band38	20MHz	QPSK	38000	100RB#0	NV	-10	-16.15	-0.006224	±2.5	PASS
Band38	20MHz	QPSK	38000	100RB#0	NV	0	-13.72	-0.005287	±2.5	PASS
Band38	20MHz	QPSK	38000	100RB#0	NV	10	-5.28	-0.002035	±2.5	PASS
Band38	20MHz	QPSK	38000	100RB#0	NV	20	-13.36	-0.005148	±2.5	PASS
Band38	20MHz	QPSK	38000	100RB#0	NV	30	-15.76	-0.006073	±2.5	PASS
Band38	20MHz	QPSK	38000	100RB#0	NV	40	-2.52	-0.000971	±2.5	PASS
Band38	20MHz	QPSK	38000	100RB#0	NV	50	-6.48	-0.002497	±2.5	PASS
Band38	20MHz	16QAM	38000	100RB#0	NV	-30	-14.19	-0.005468	±2.5	PASS
Band38	20MHz	16QAM	38000	100RB#0	NV	-20	-21.90	-0.008439	±2.5	PASS
Band38	20MHz	16QAM	38000	100RB#0	NV	-10	-10.50	-0.004046	±2.5	PASS
Band38	20MHz	16QAM	38000	100RB#0	NV	0	-12.86	-0.004956	±2.5	PASS
Band38	20MHz	16QAM	38000	100RB#0	NV	10	-14.28	-0.005503	±2.5	PASS
Band38	20MHz	16QAM	38000	100RB#0	NV	20	-13.42	-0.005171	±2.5	PASS
Band38	20MHz	16QAM	38000	100RB#0	NV	30	5.62	0.002166	±2.5	PASS
Band38	20MHz	16QAM	38000	100RB#0	NV	40	-8.48	-0.003268	±2.5	PASS
Band38	20MHz	16QAM	38000	100RB#0	NV	50	-12.75	-0.004913	±2.5	PASS
Band38	20MHz	QPSK	38150	100RB#0	NV	-30	-21.00	-0.008046	±2.5	PASS
Band38	20MHz	QPSK	38150	100RB#0	NV	-20	-20.71	-0.007935	±2.5	PASS
Band38	20MHz	QPSK	38150	100RB#0	NV	-10	-18.75	-0.007184	±2.5	PASS
Band38	20MHz	QPSK	38150	100RB#0	NV	0	-9.43	-0.003613	±2.5	PASS
Band38	20MHz	QPSK	38150	100RB#0	NV	10	-15.74	-0.006031	±2.5	PASS
Band38	20MHz	QPSK	38150	100RB#0	NV	20	-19.63	-0.007521	±2.5	PASS
Band38	20MHz	QPSK	38150	100RB#0	NV	30	-11.12	-0.004261	±2.5	PASS

Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community,
 Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.
 Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com



Hotline
 400-003-0500
 www.anbotek.com.cn



Band38	20MHz	QPSK	38150	100RB#0	NV	40	-21.76	-0.008337	±2.5	PASS
Band38	20MHz	QPSK	38150	100RB#0	NV	50	-20.30	-0.007778	±2.5	PASS
Band38	20MHz	16QAM	38150	100RB#0	NV	-30	-28.25	-0.010824	±2.5	PASS
Band38	20MHz	16QAM	38150	100RB#0	NV	-20	-17.17	-0.006579	±2.5	PASS
Band38	20MHz	16QAM	38150	100RB#0	NV	-10	-5.66	-0.002169	±2.5	PASS
Band38	20MHz	16QAM	38150	100RB#0	NV	0	-24.20	-0.009272	±2.5	PASS
Band38	20MHz	16QAM	38150	100RB#0	NV	10	-8.23	-0.003153	±2.5	PASS
Band38	20MHz	16QAM	38150	100RB#0	NV	20	-16.64	-0.006375	±2.5	PASS
Band38	20MHz	16QAM	38150	100RB#0	NV	30	-17.04	-0.006529	±2.5	PASS
Band38	20MHz	16QAM	38150	100RB#0	NV	40	-21.33	-0.008172	±2.5	PASS
Band38	20MHz	16QAM	38150	100RB#0	NV	50	-15.08	-0.005778	±2.5	PASS

---END---

