






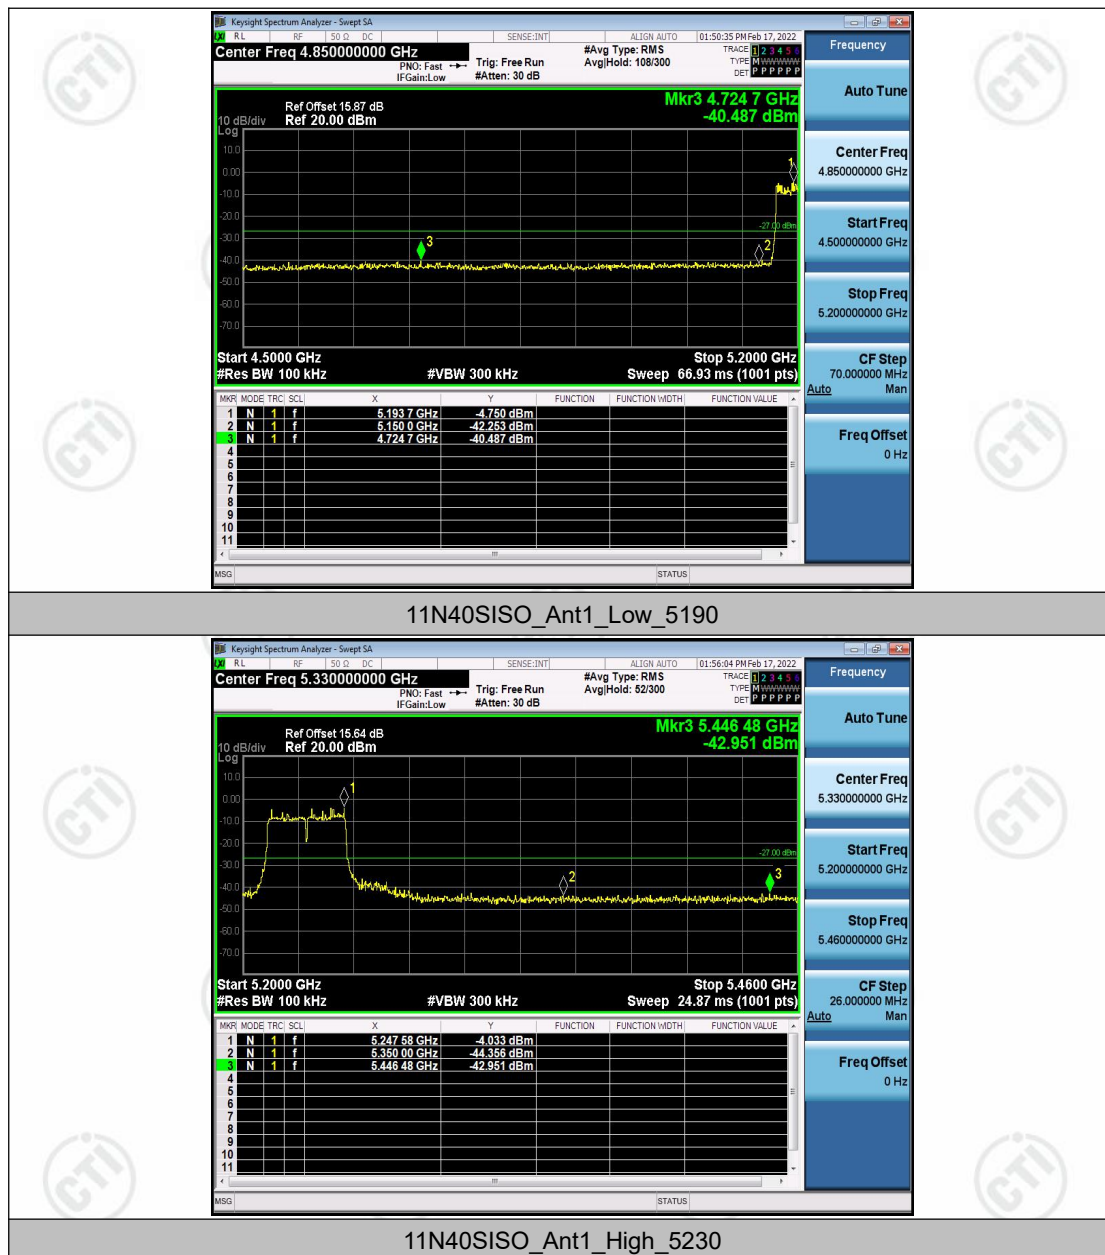


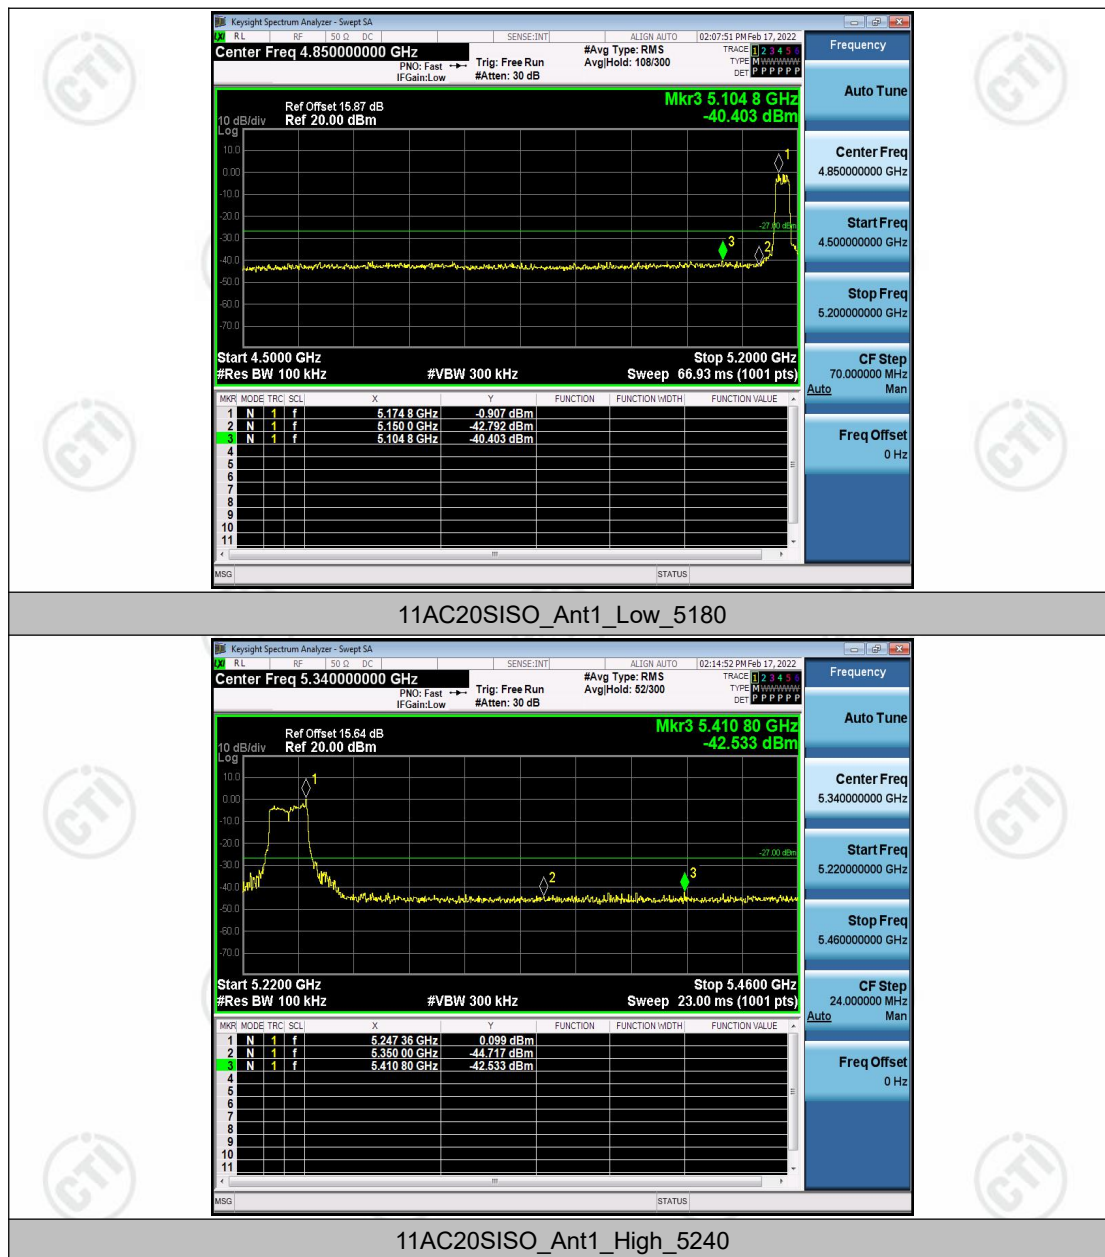


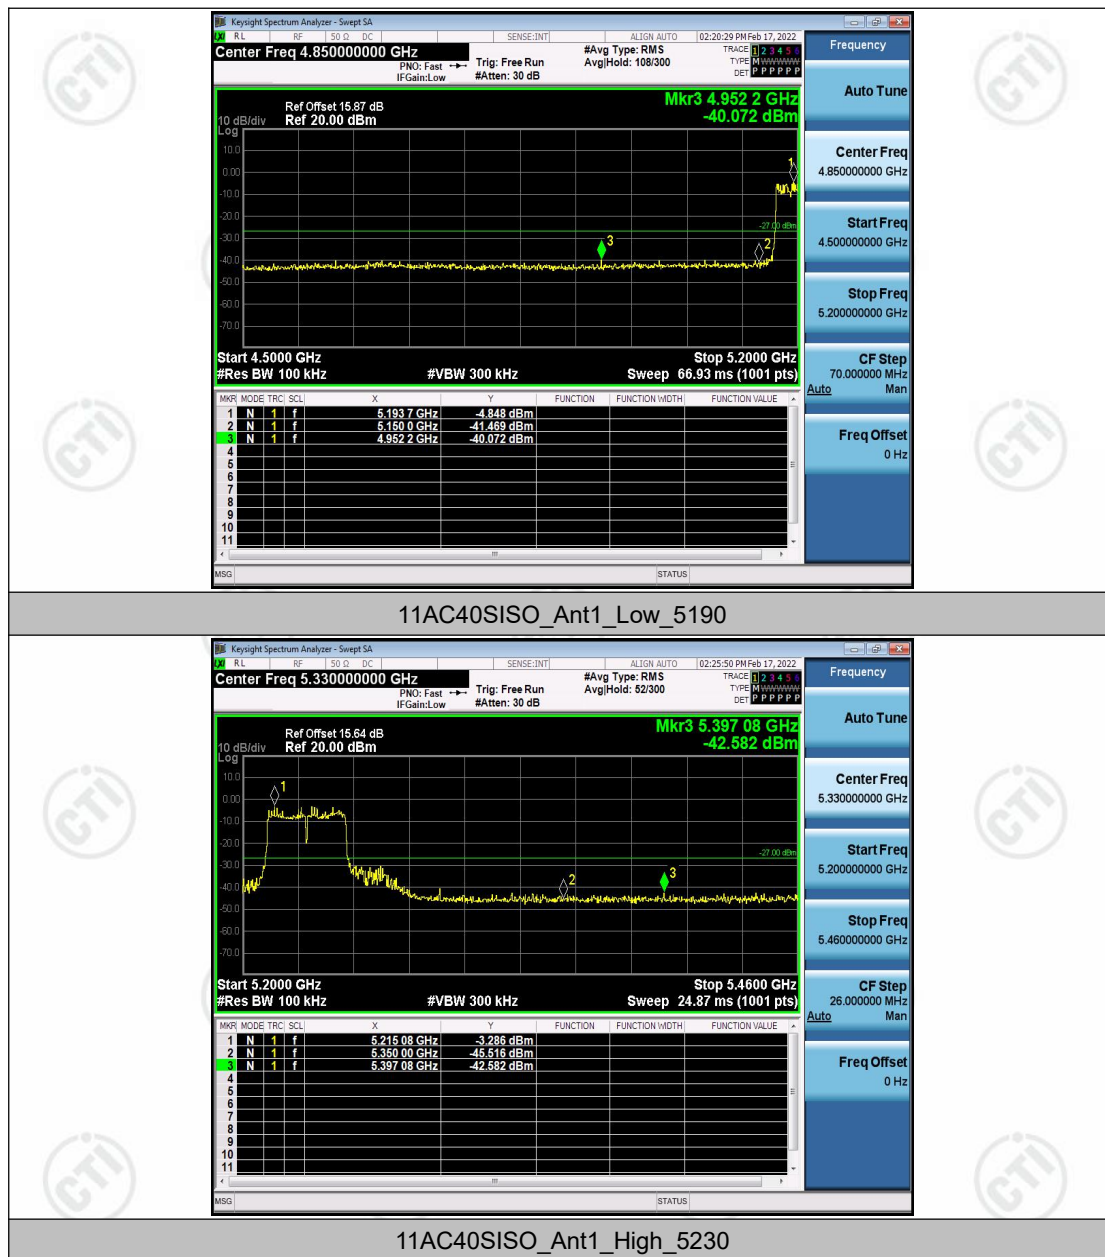


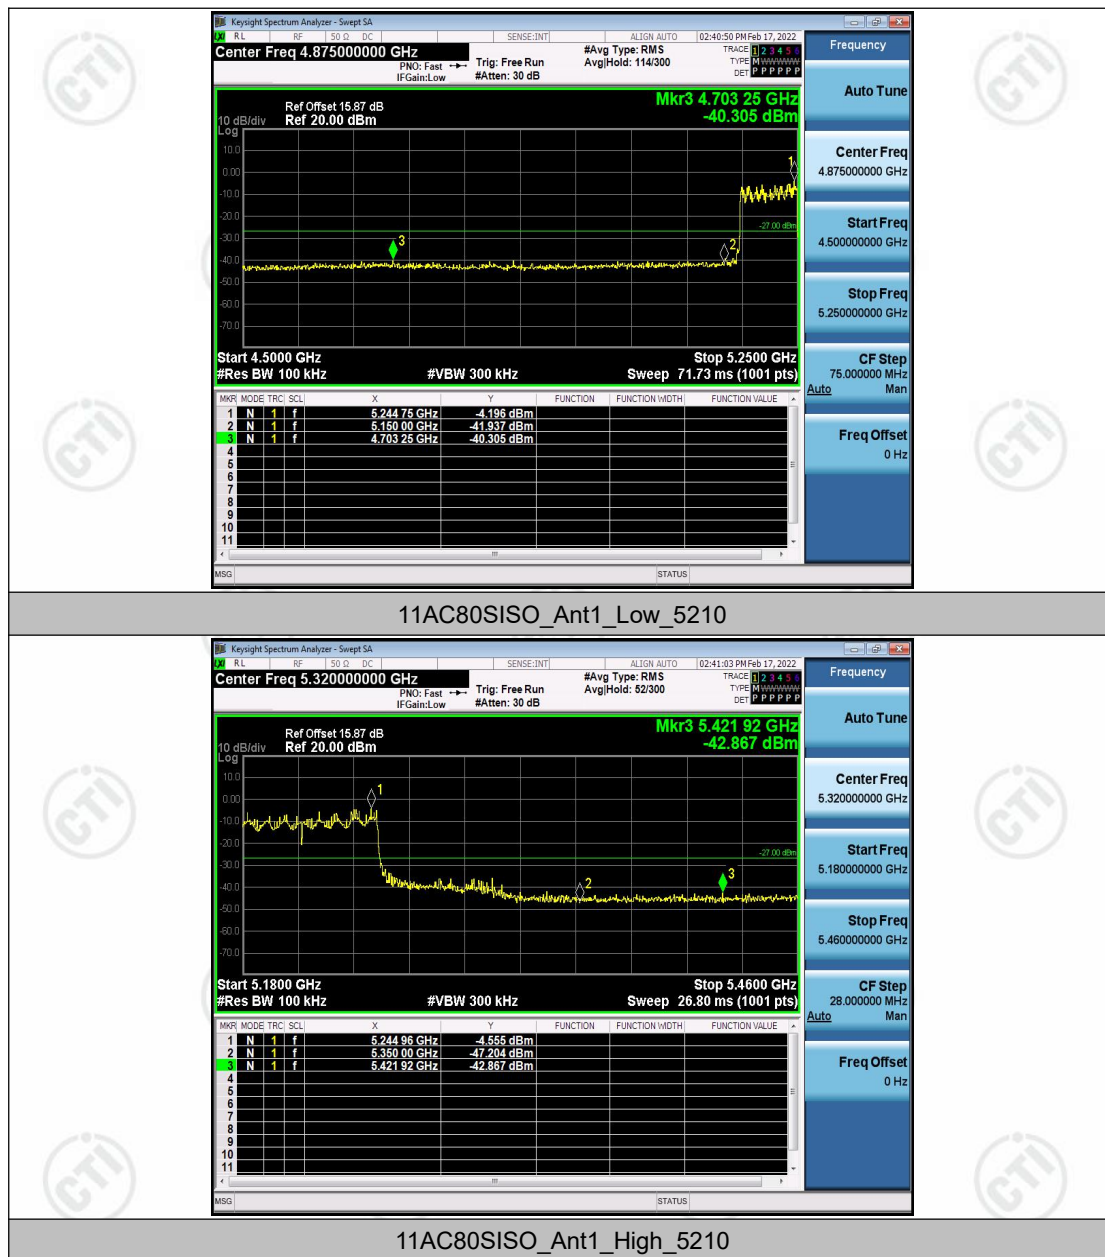


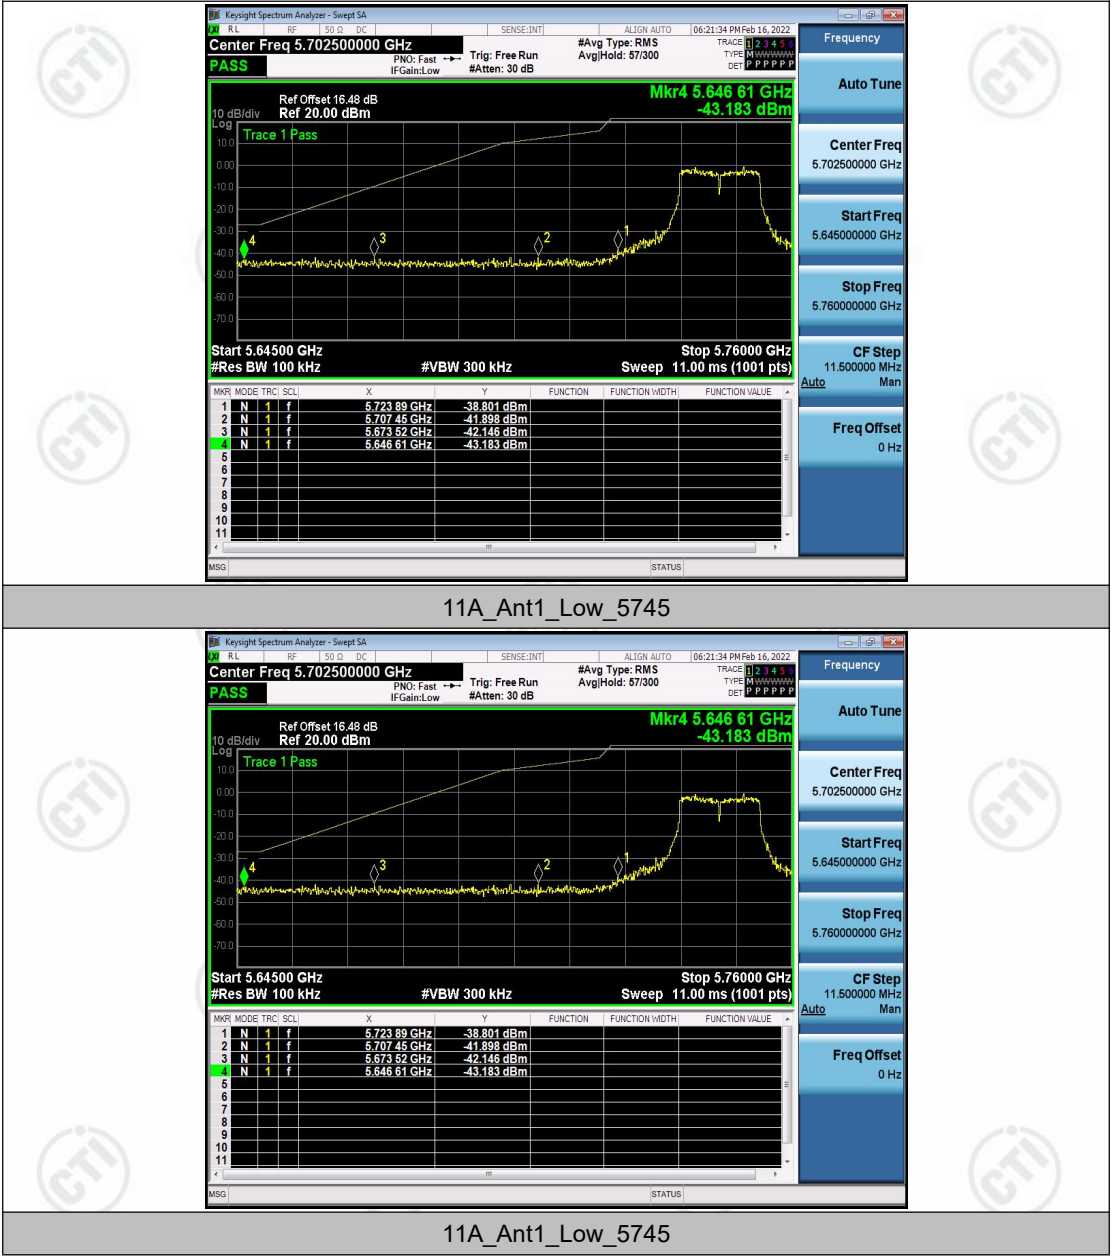


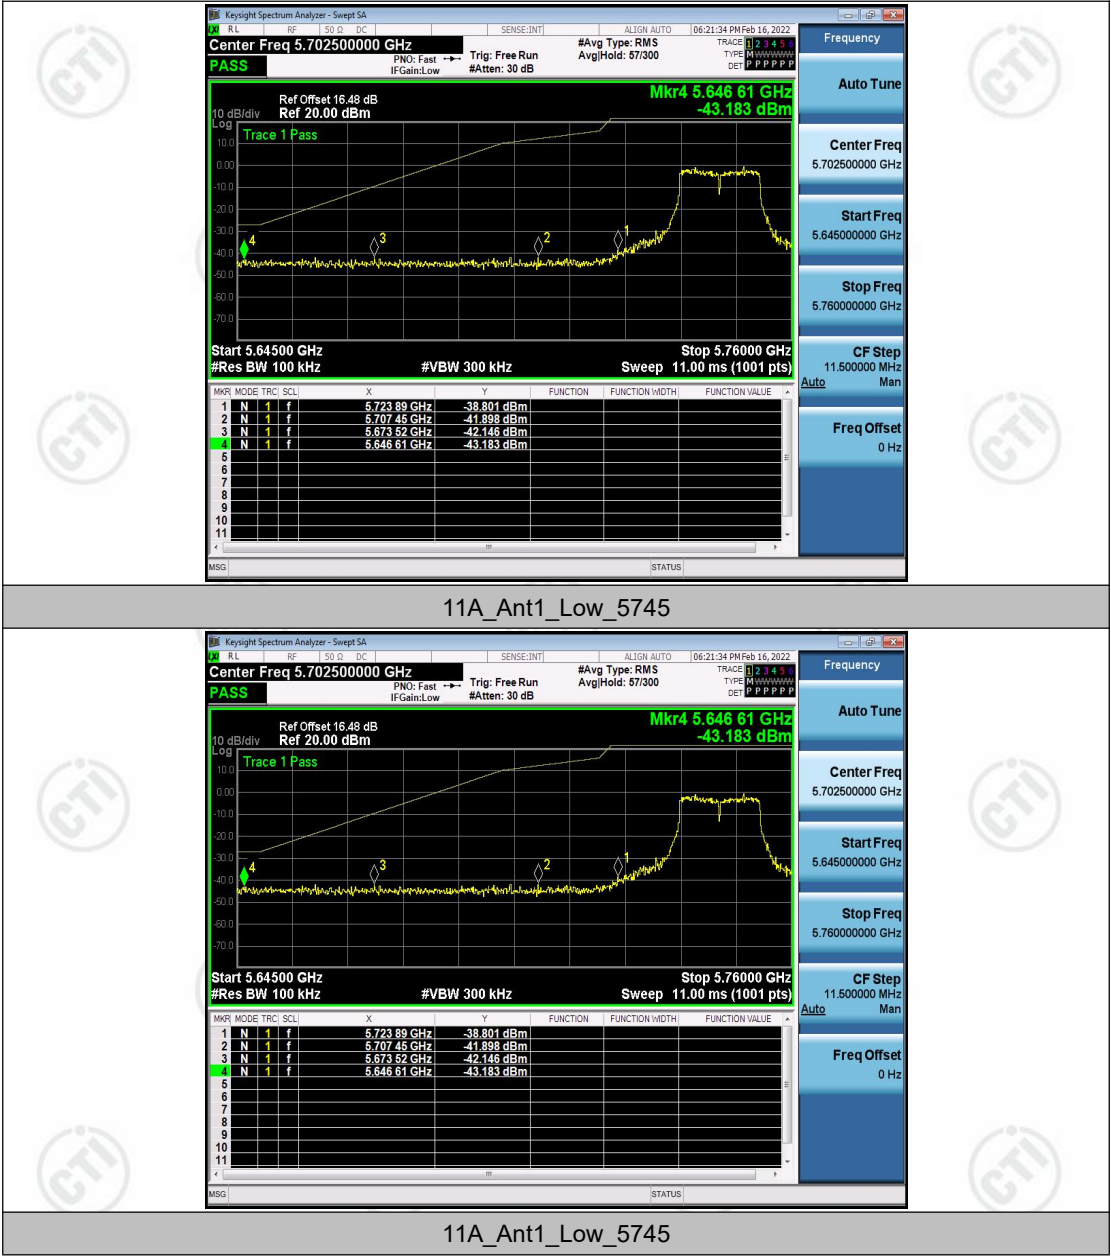


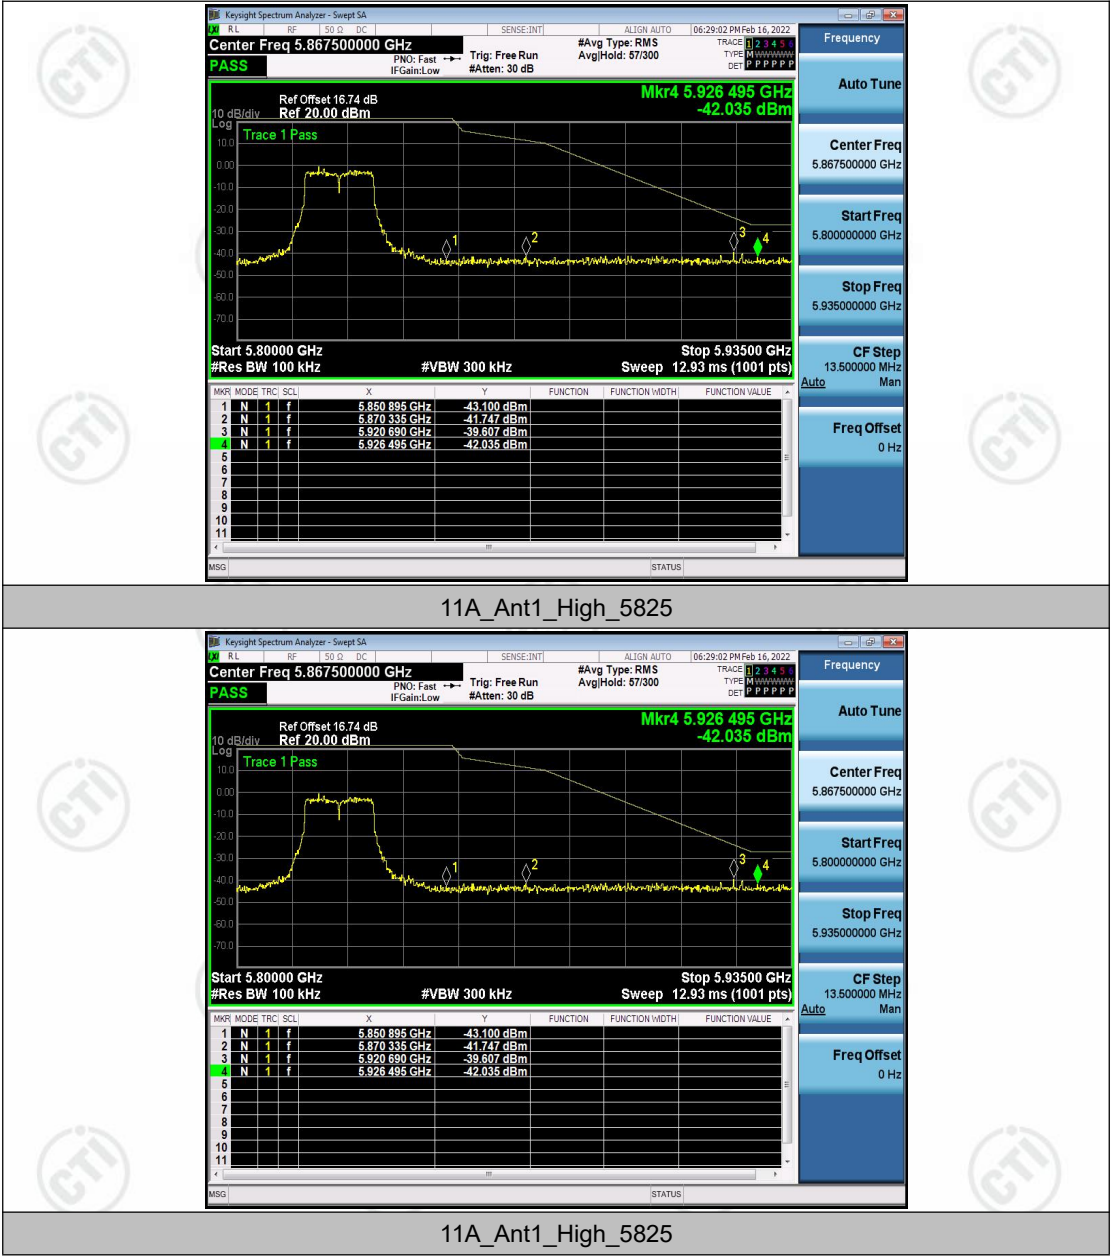


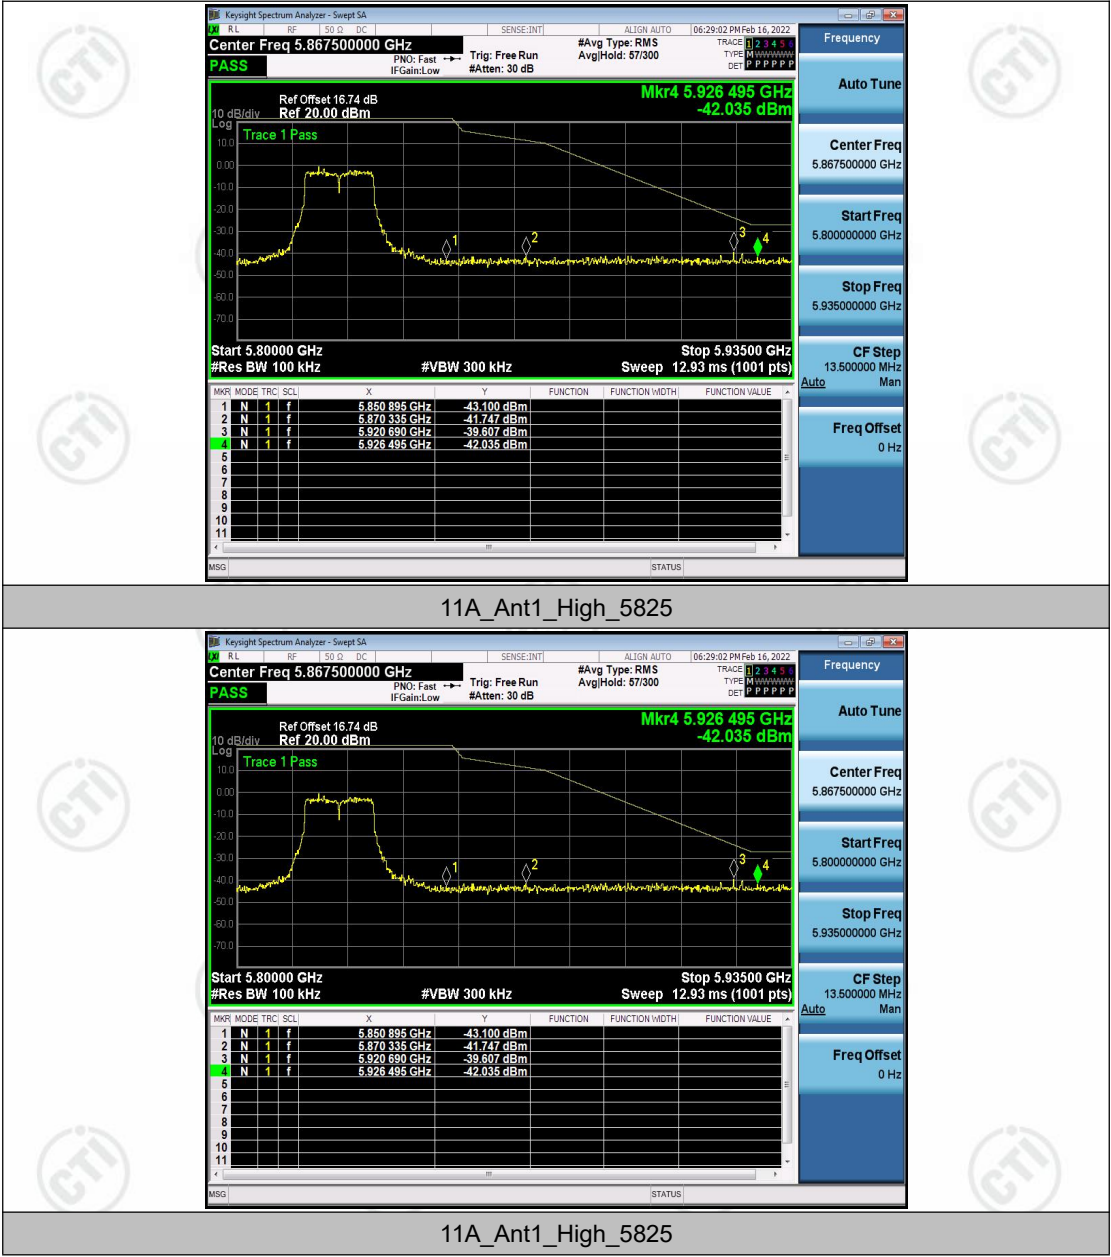


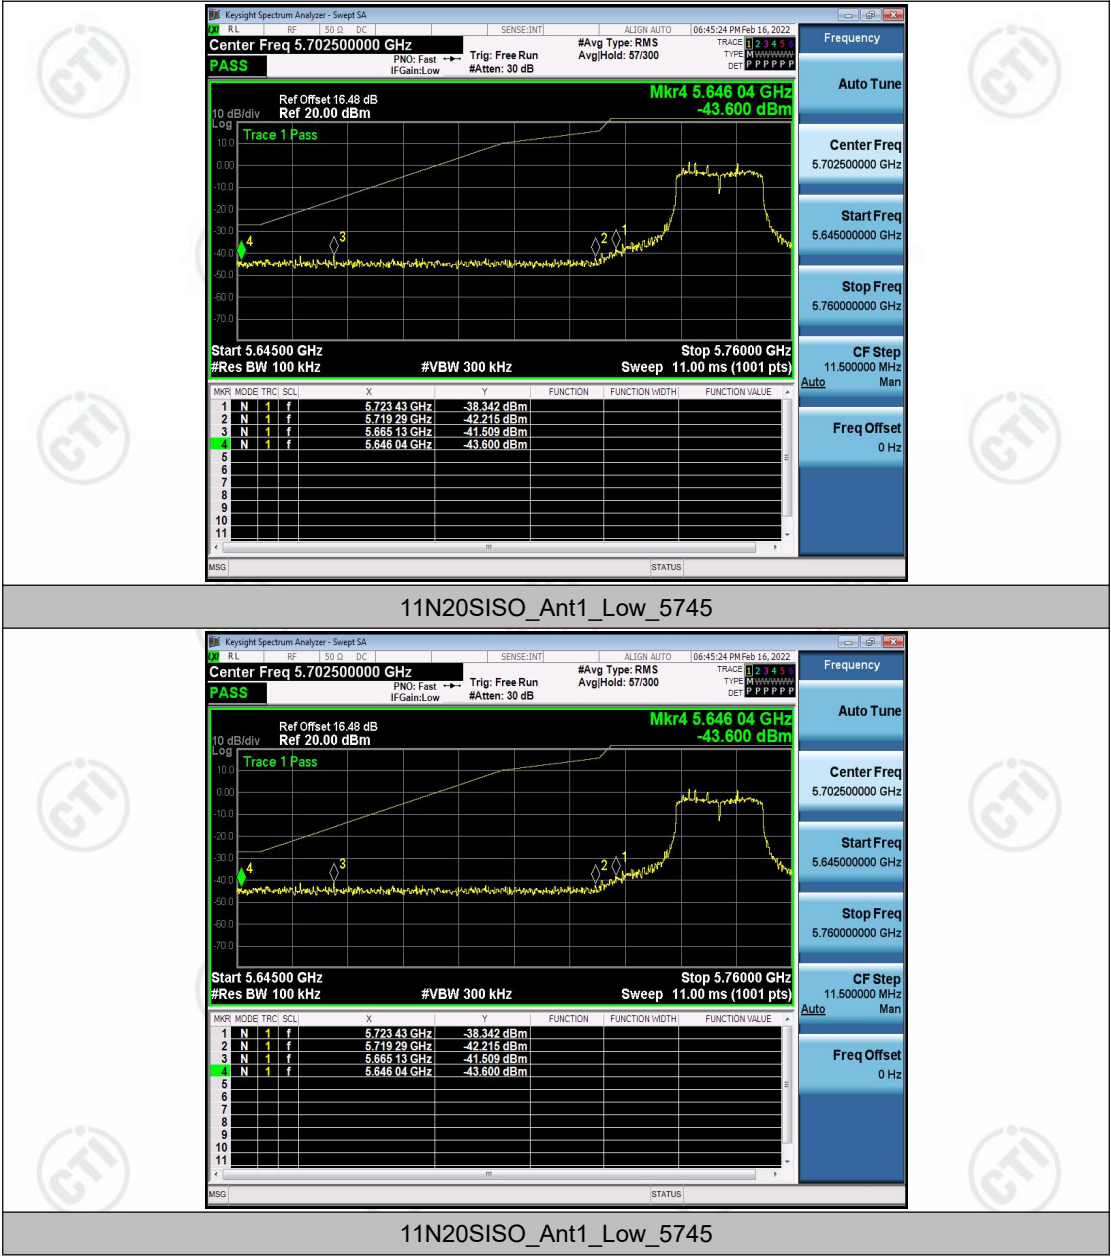


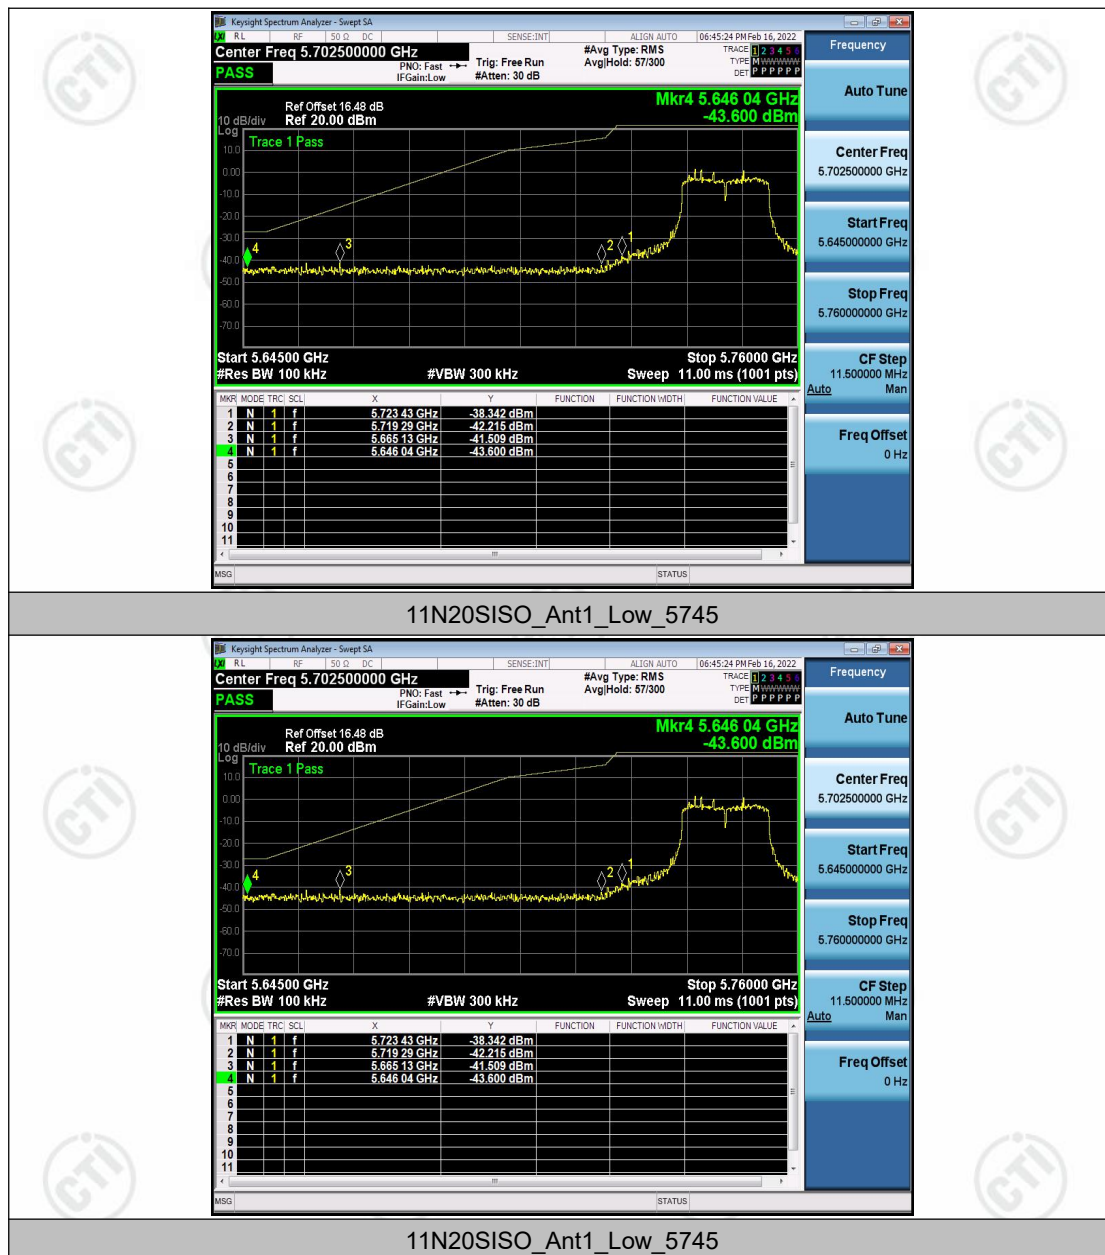


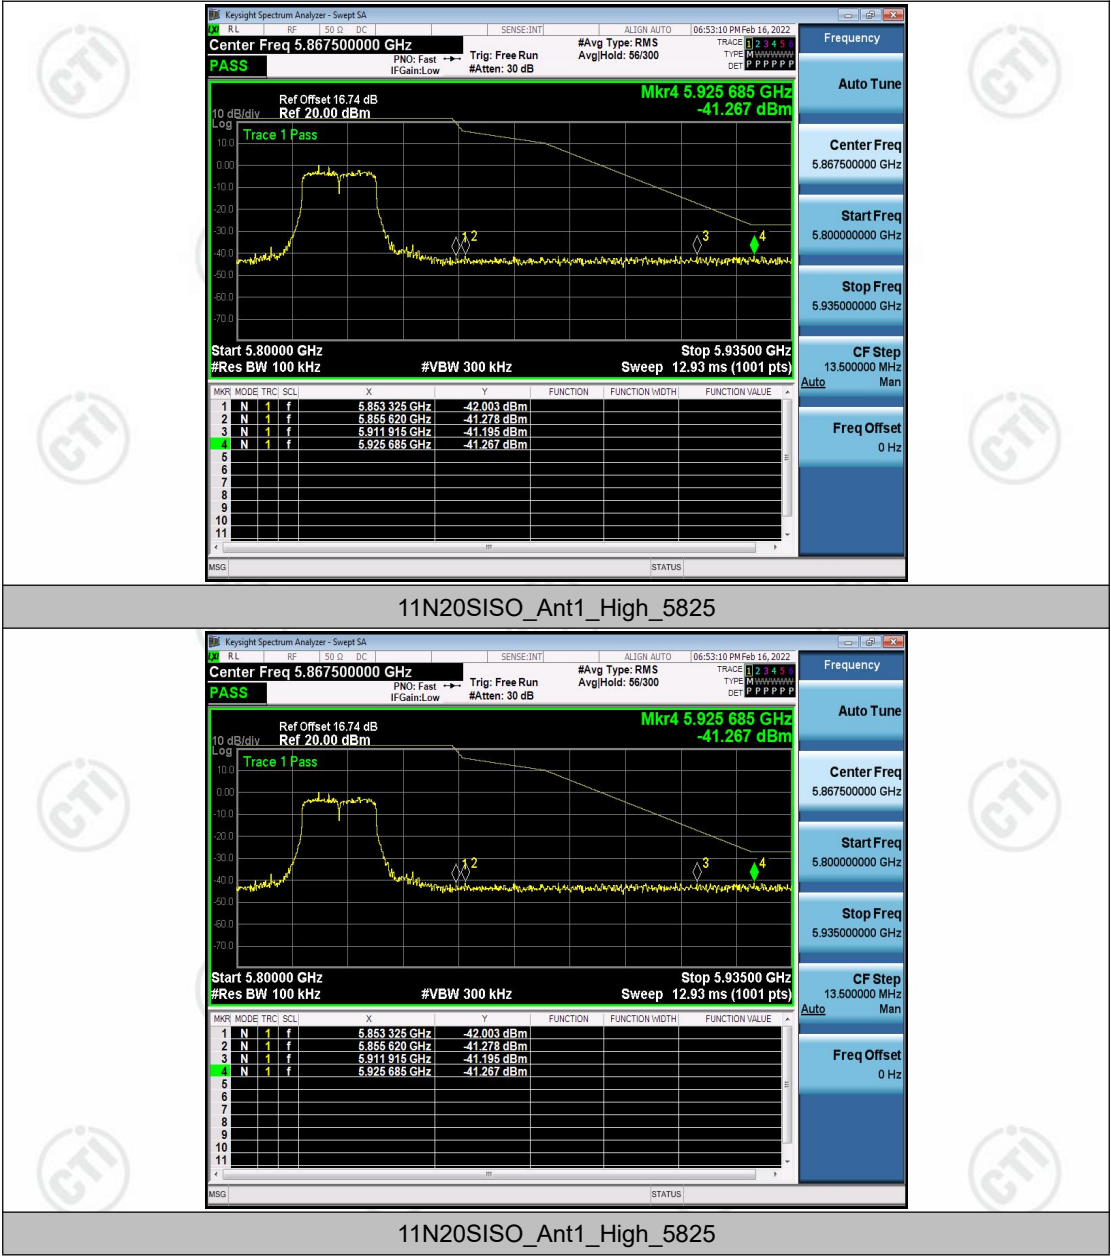


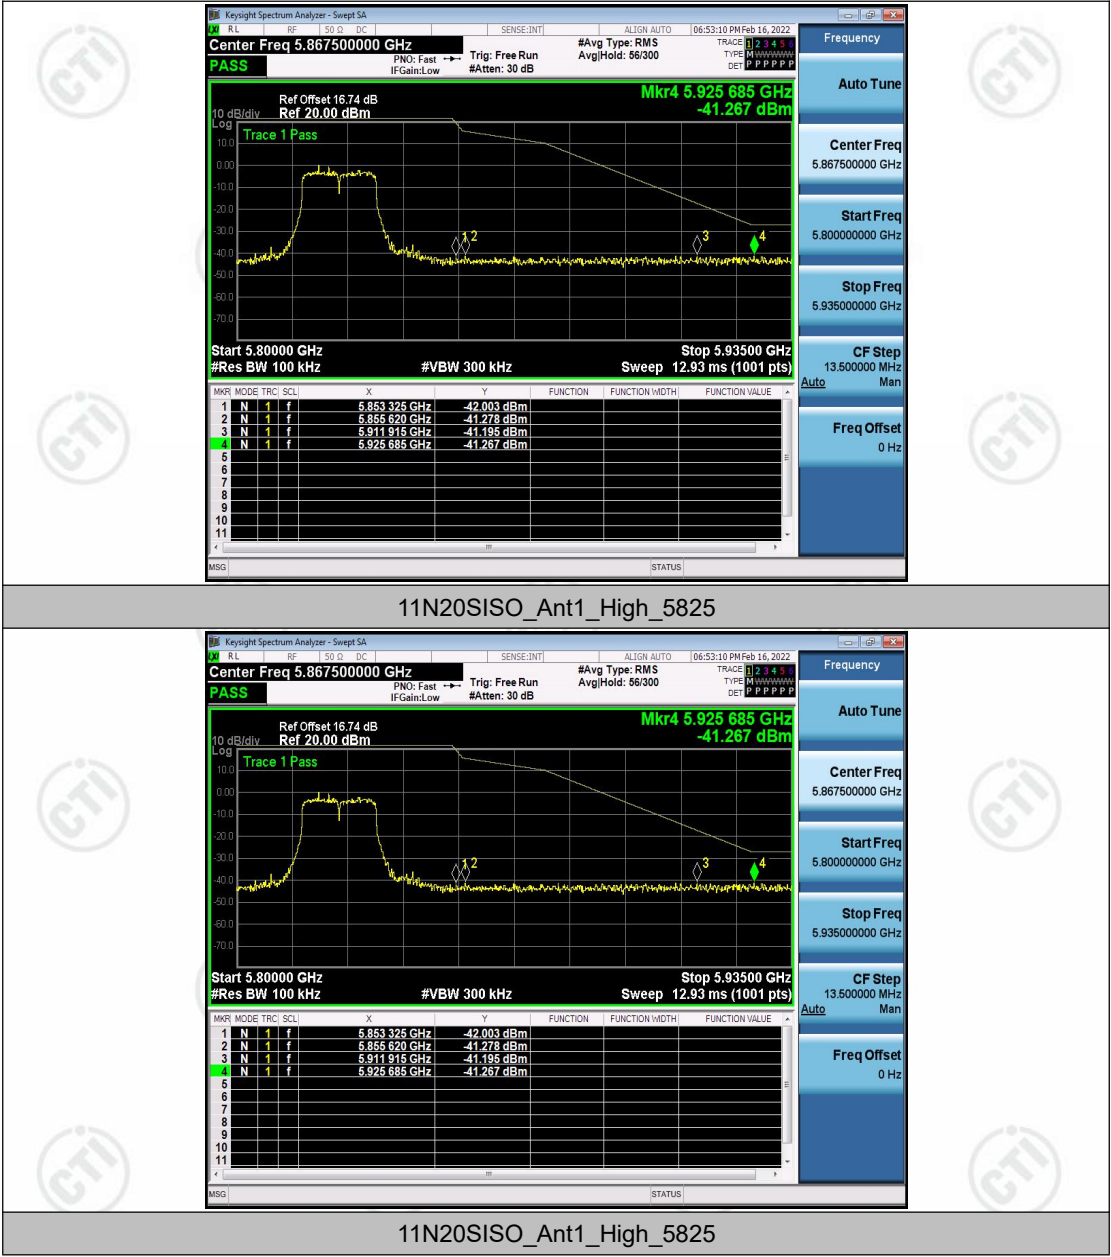


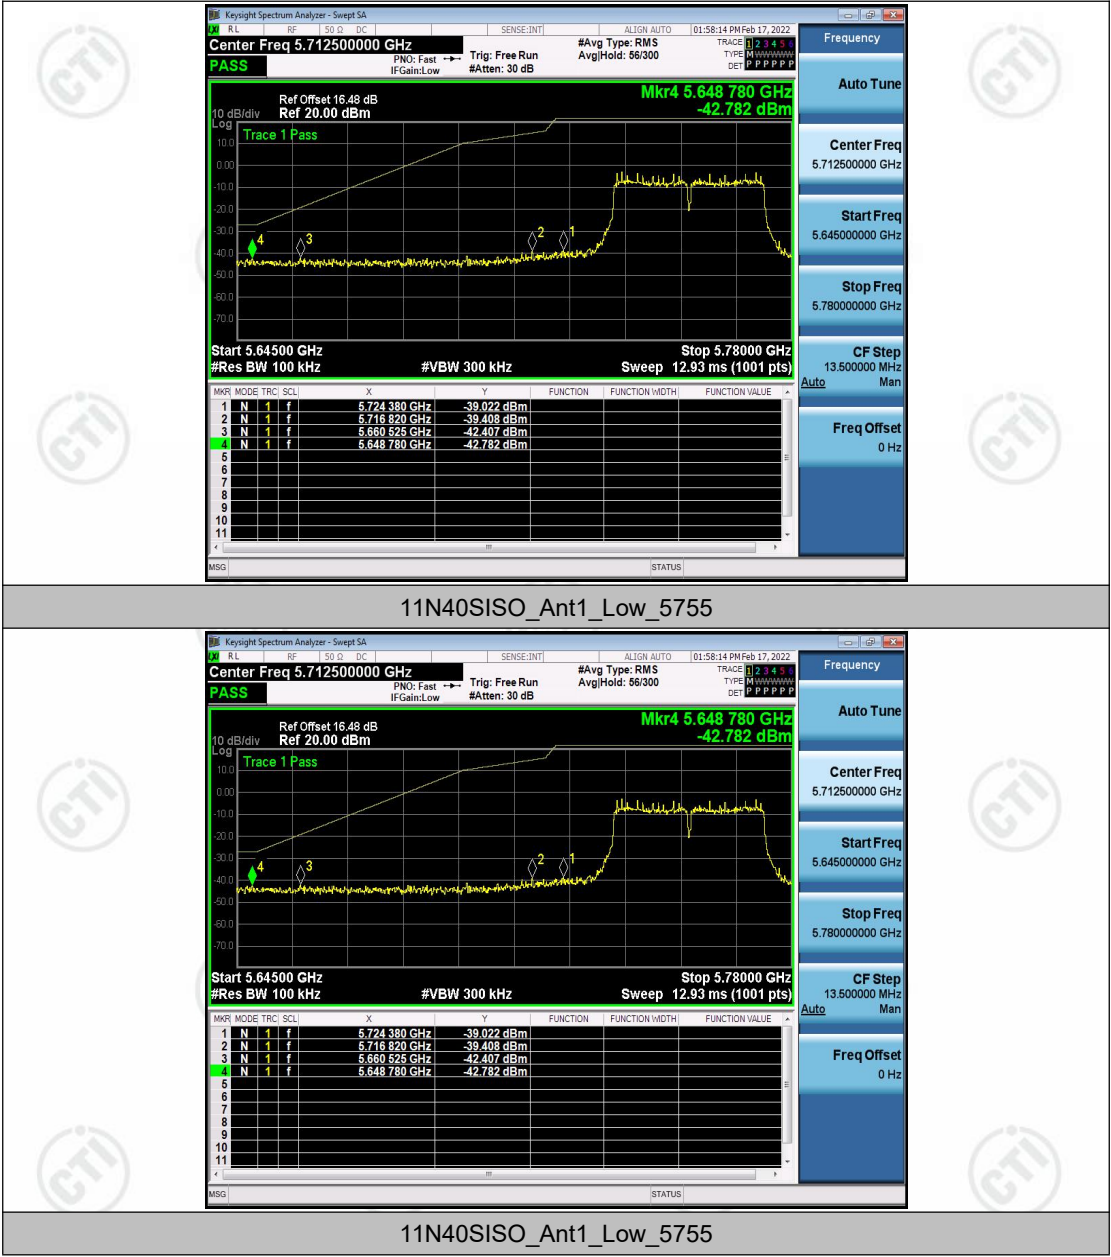


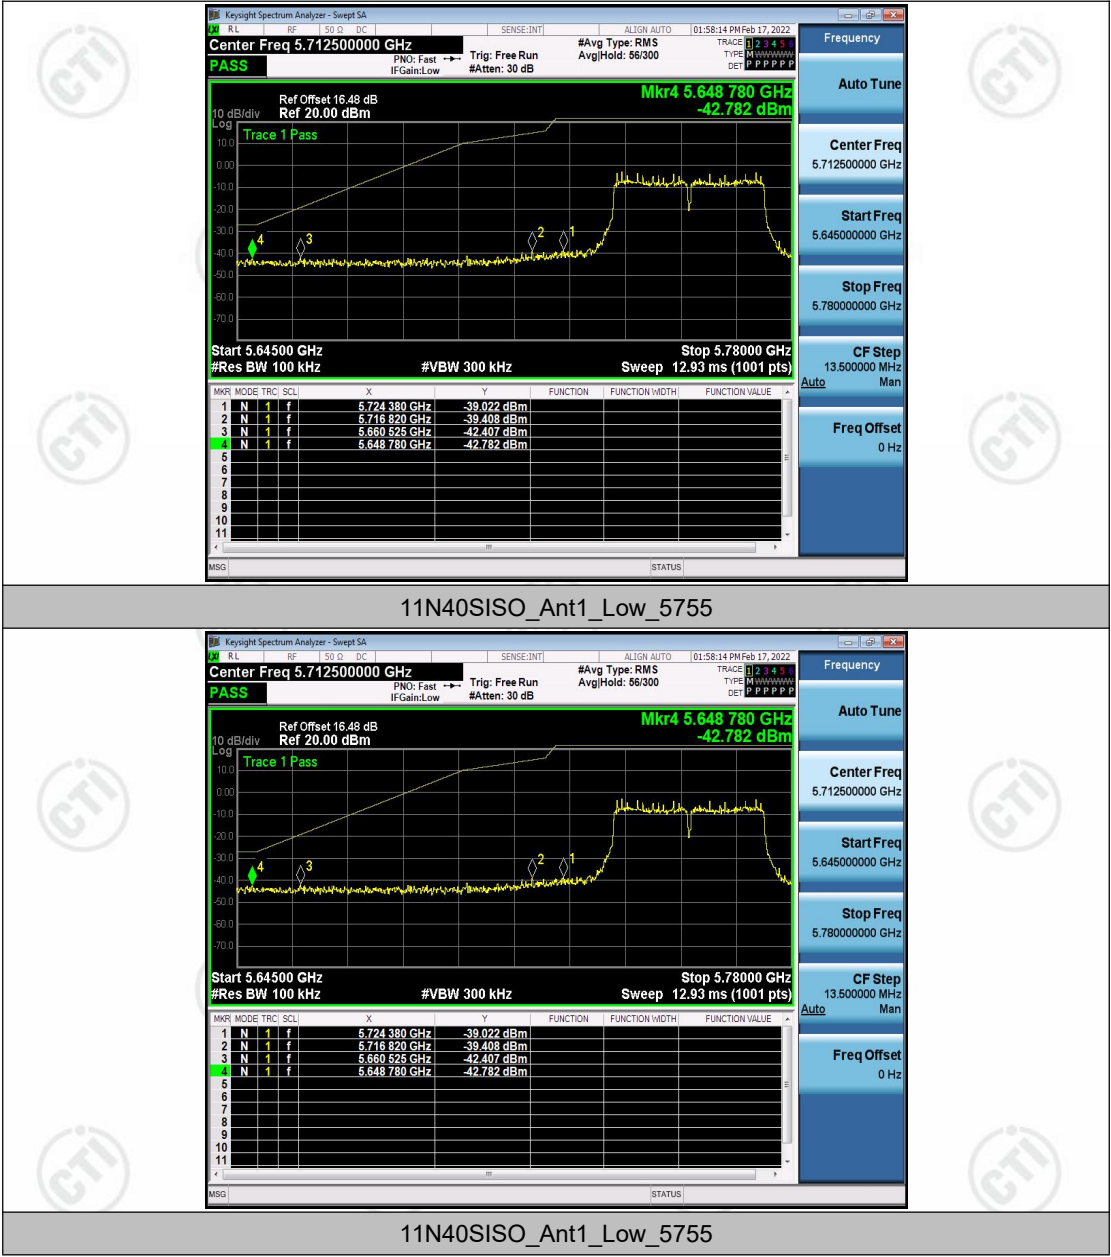


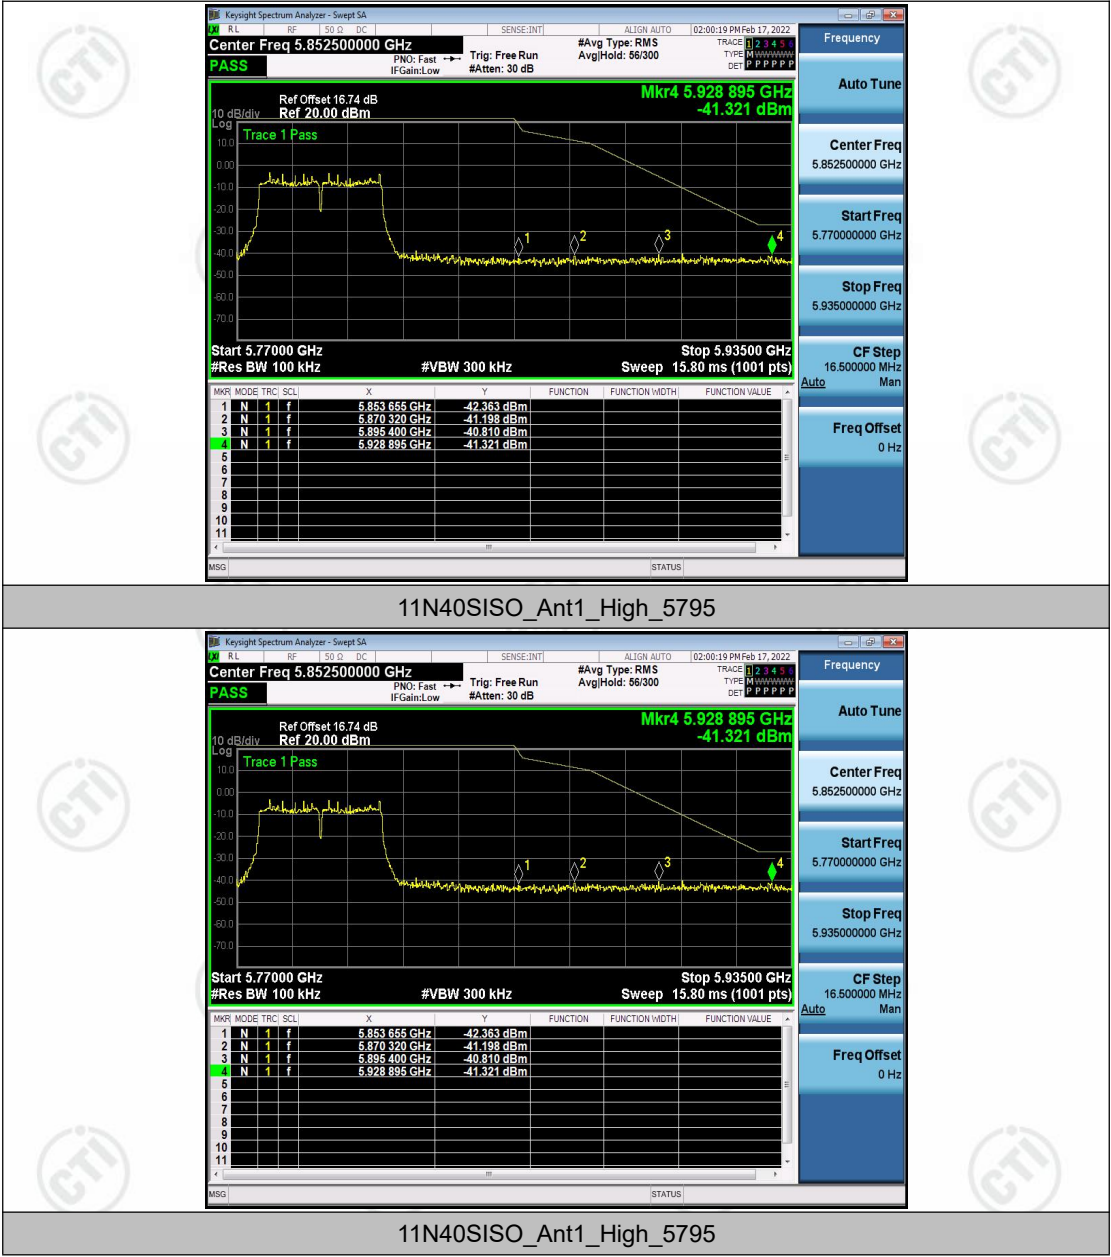


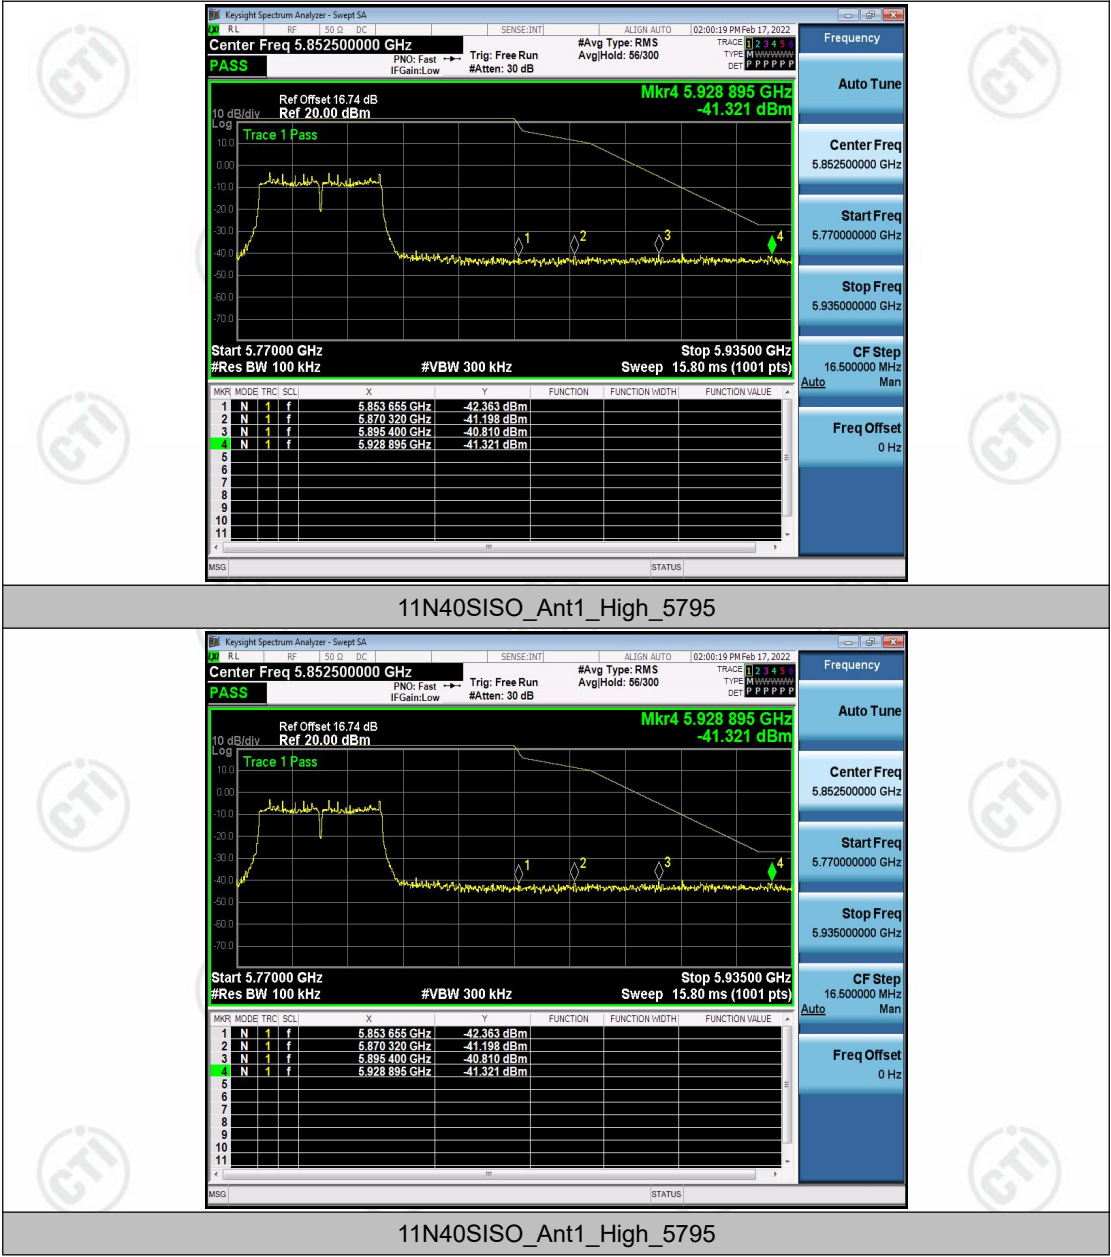


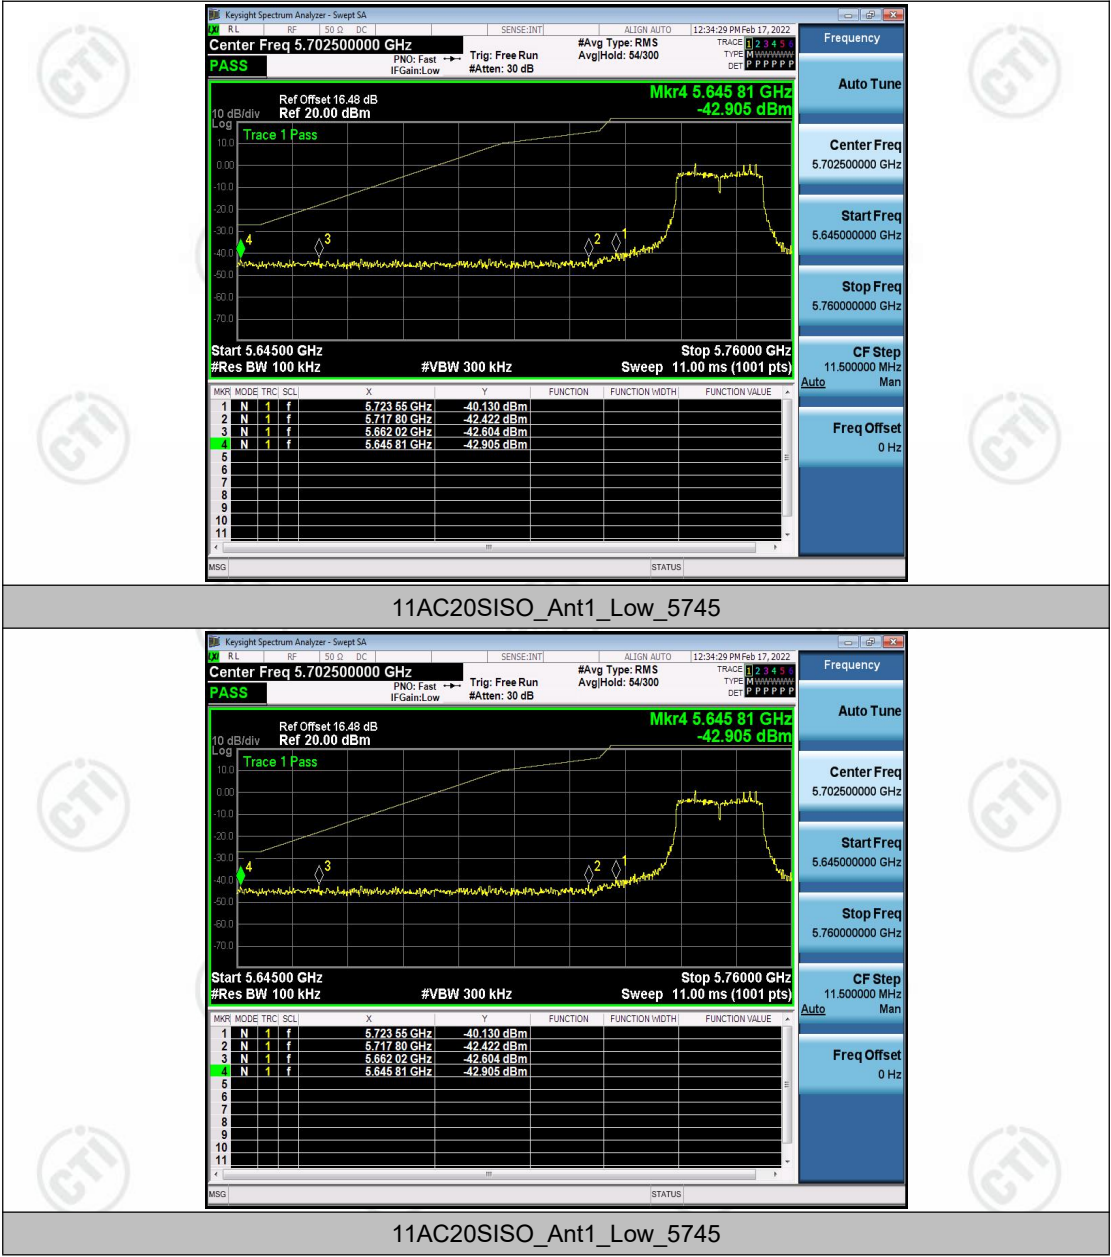


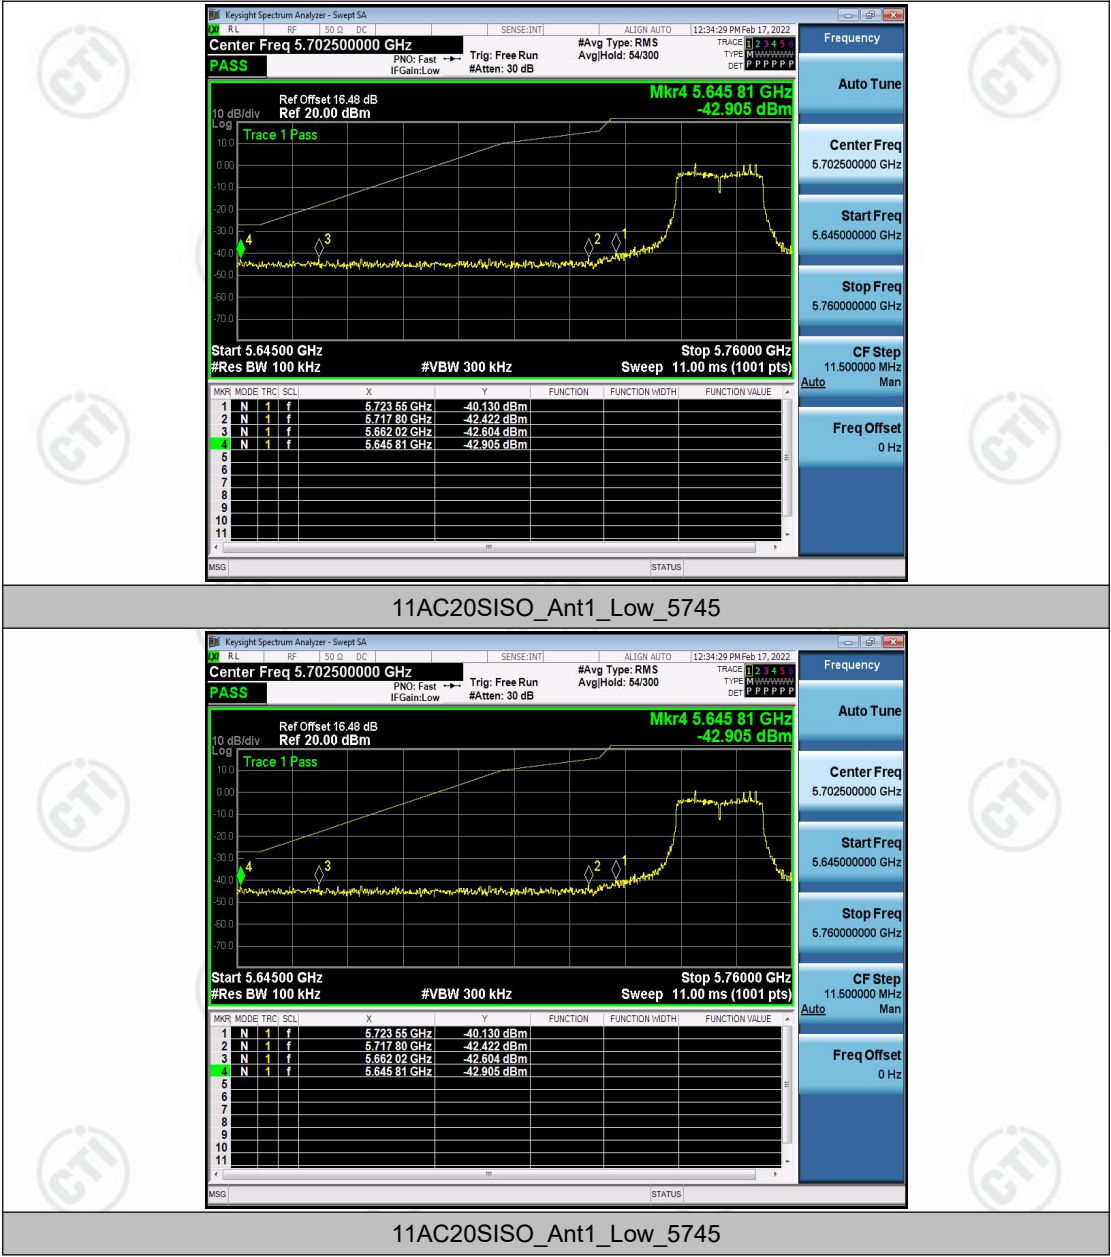


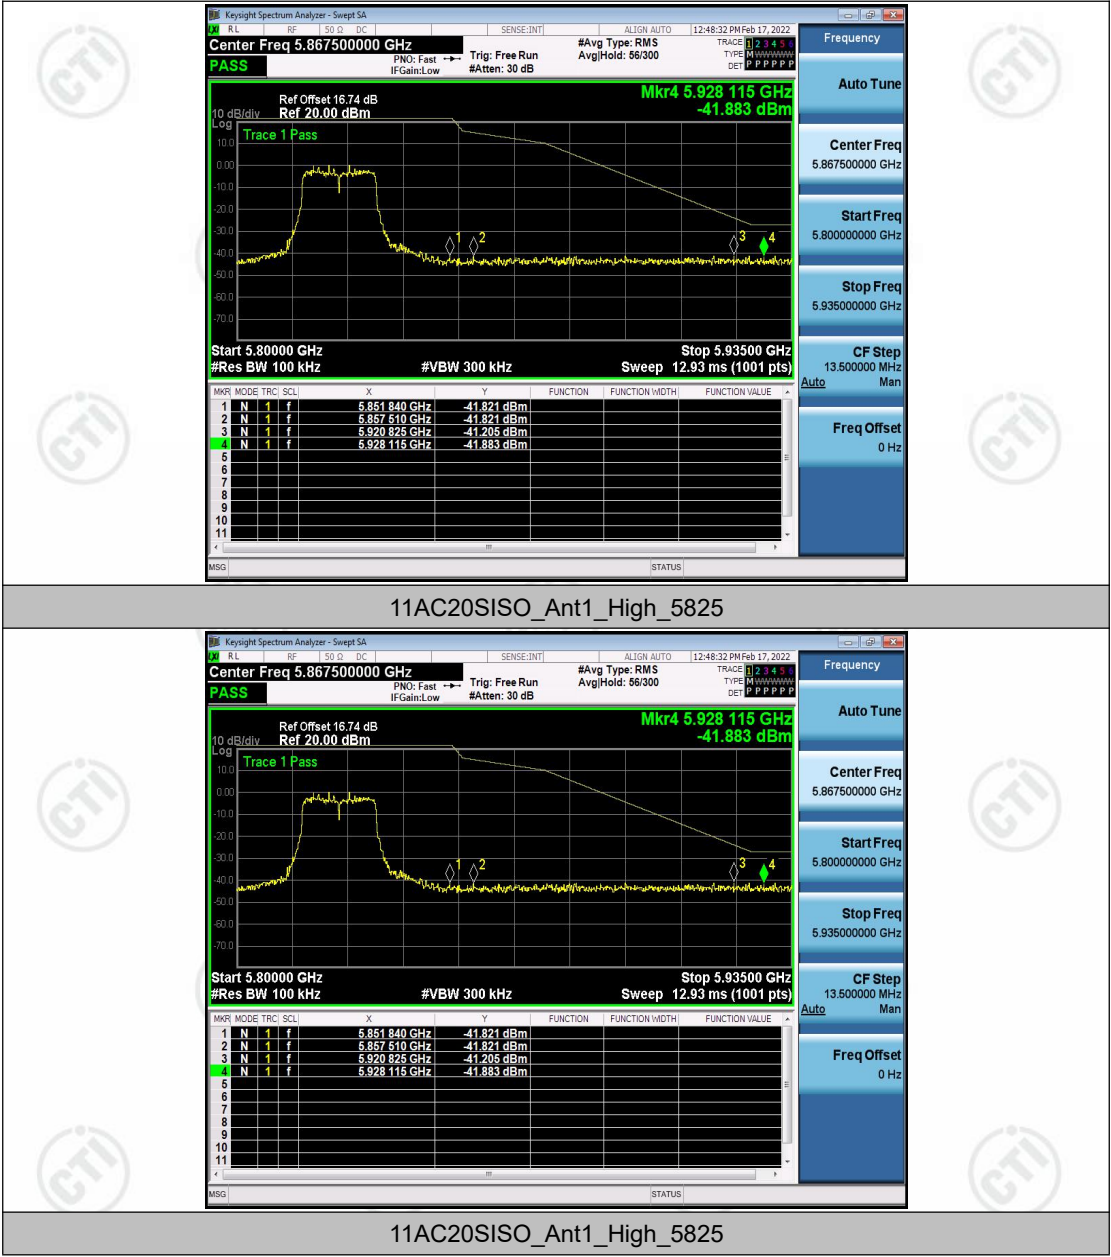


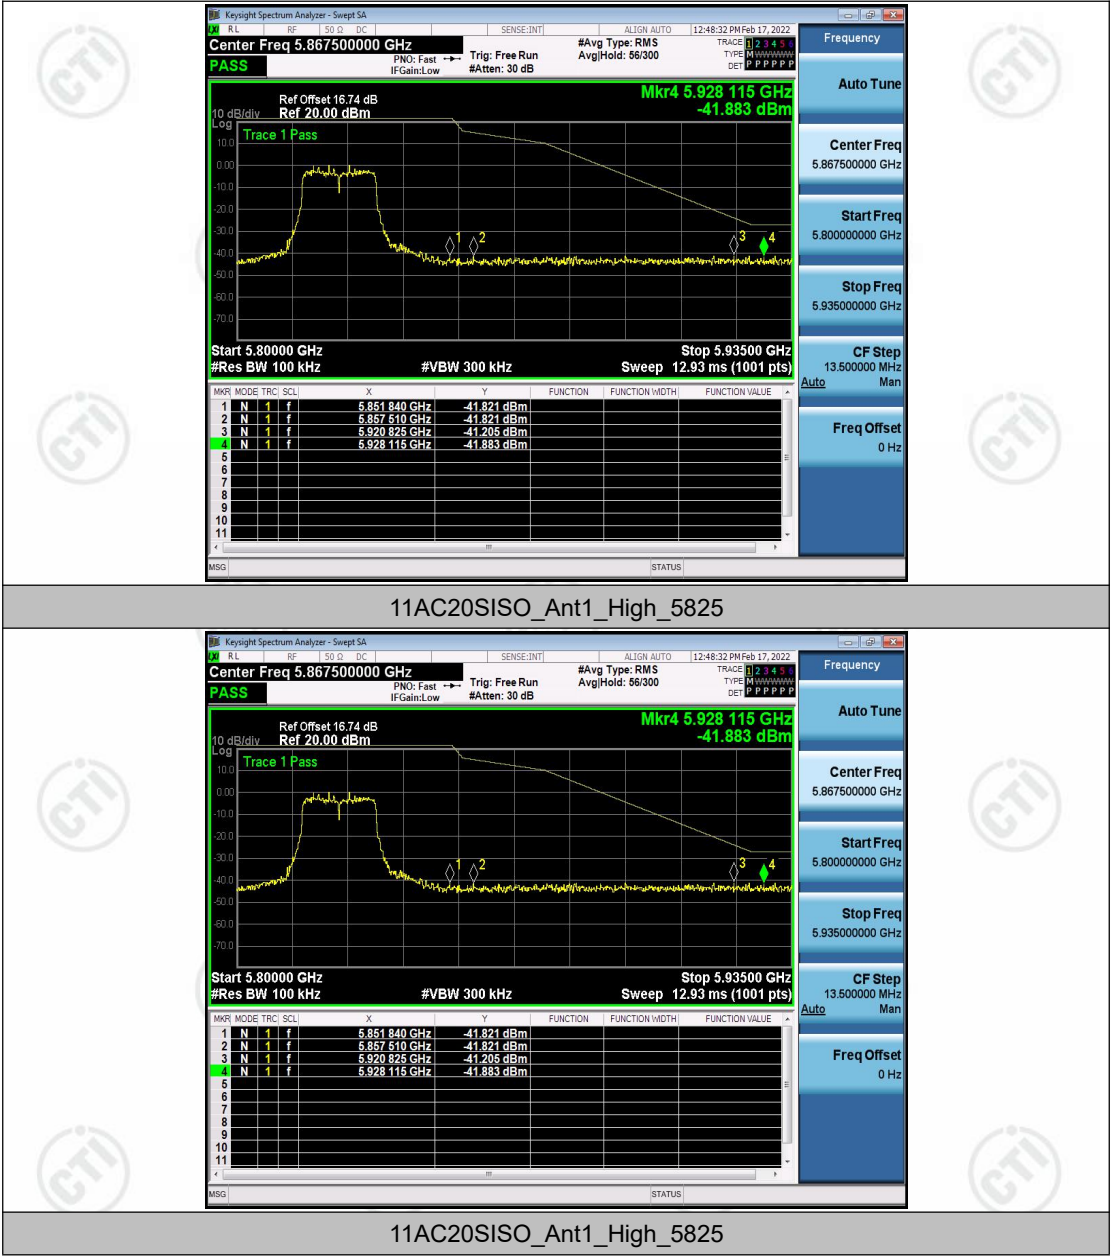


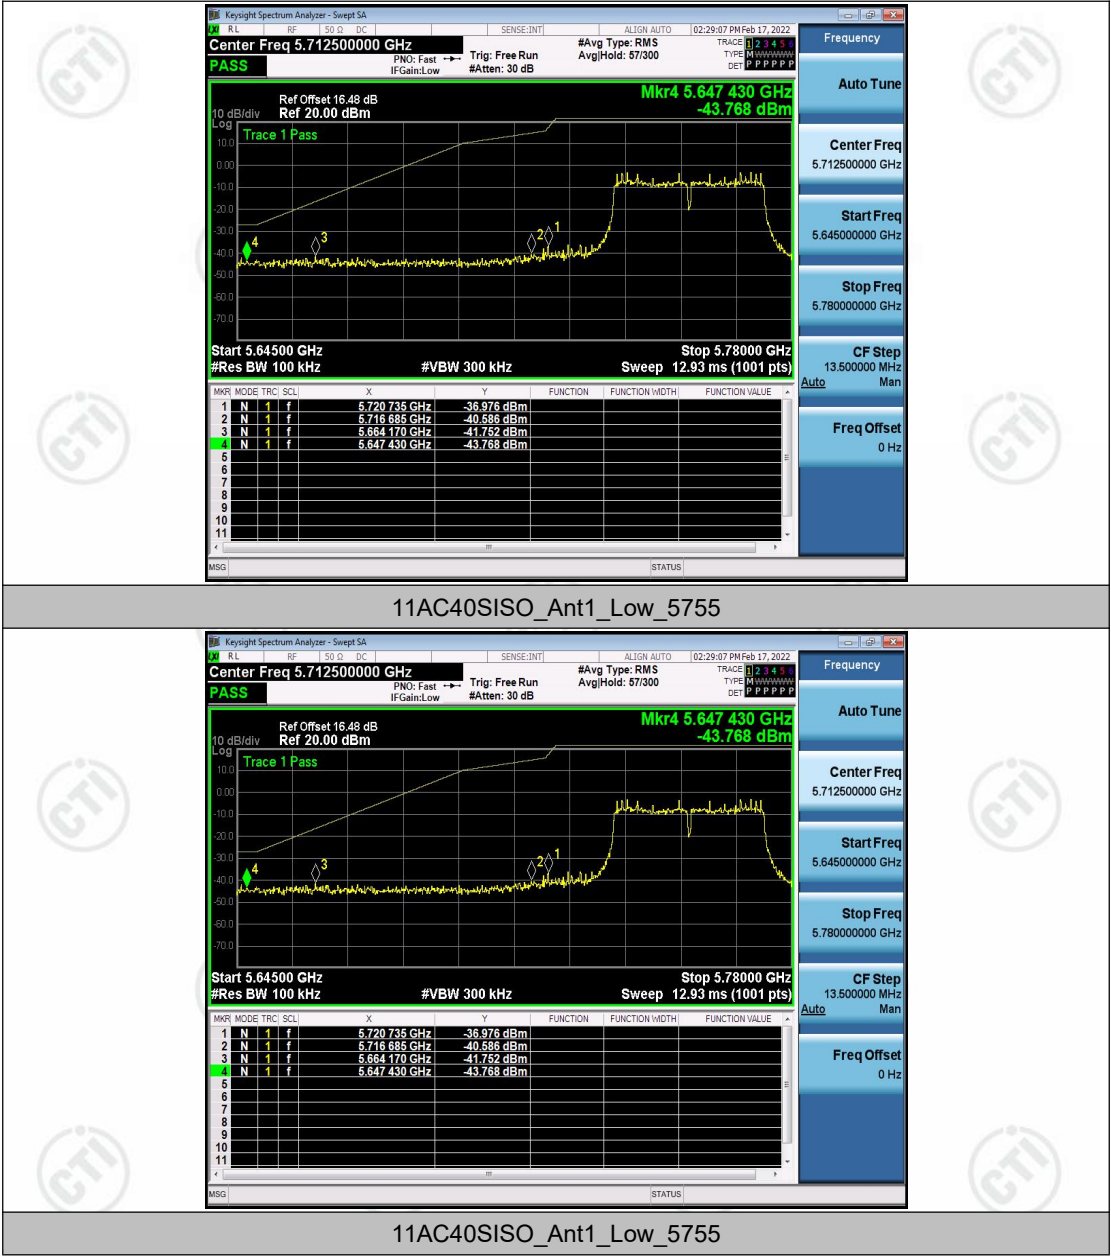


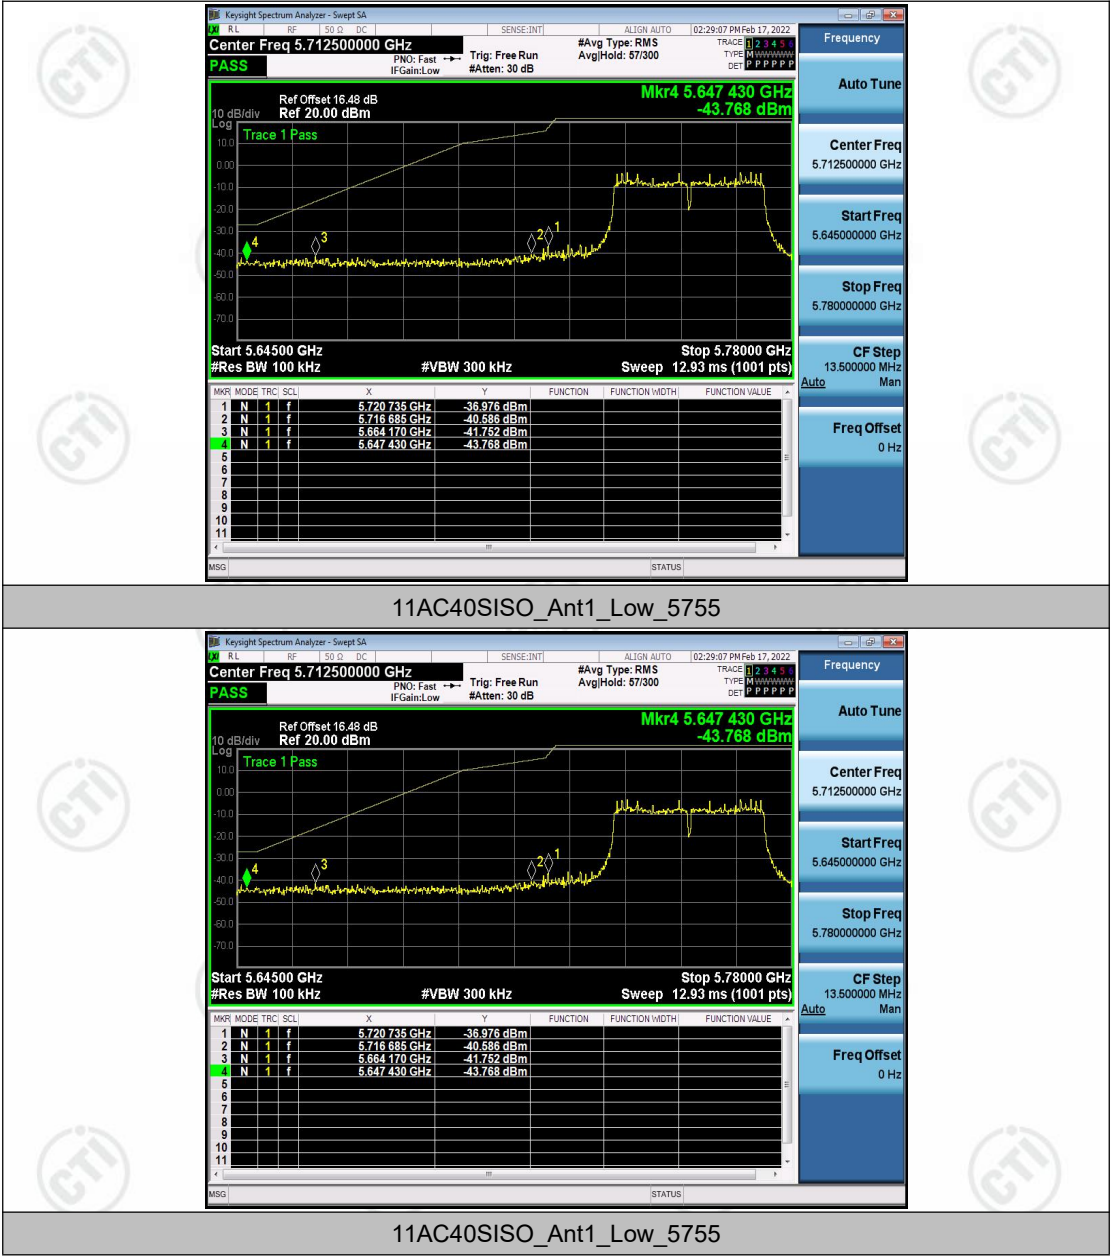


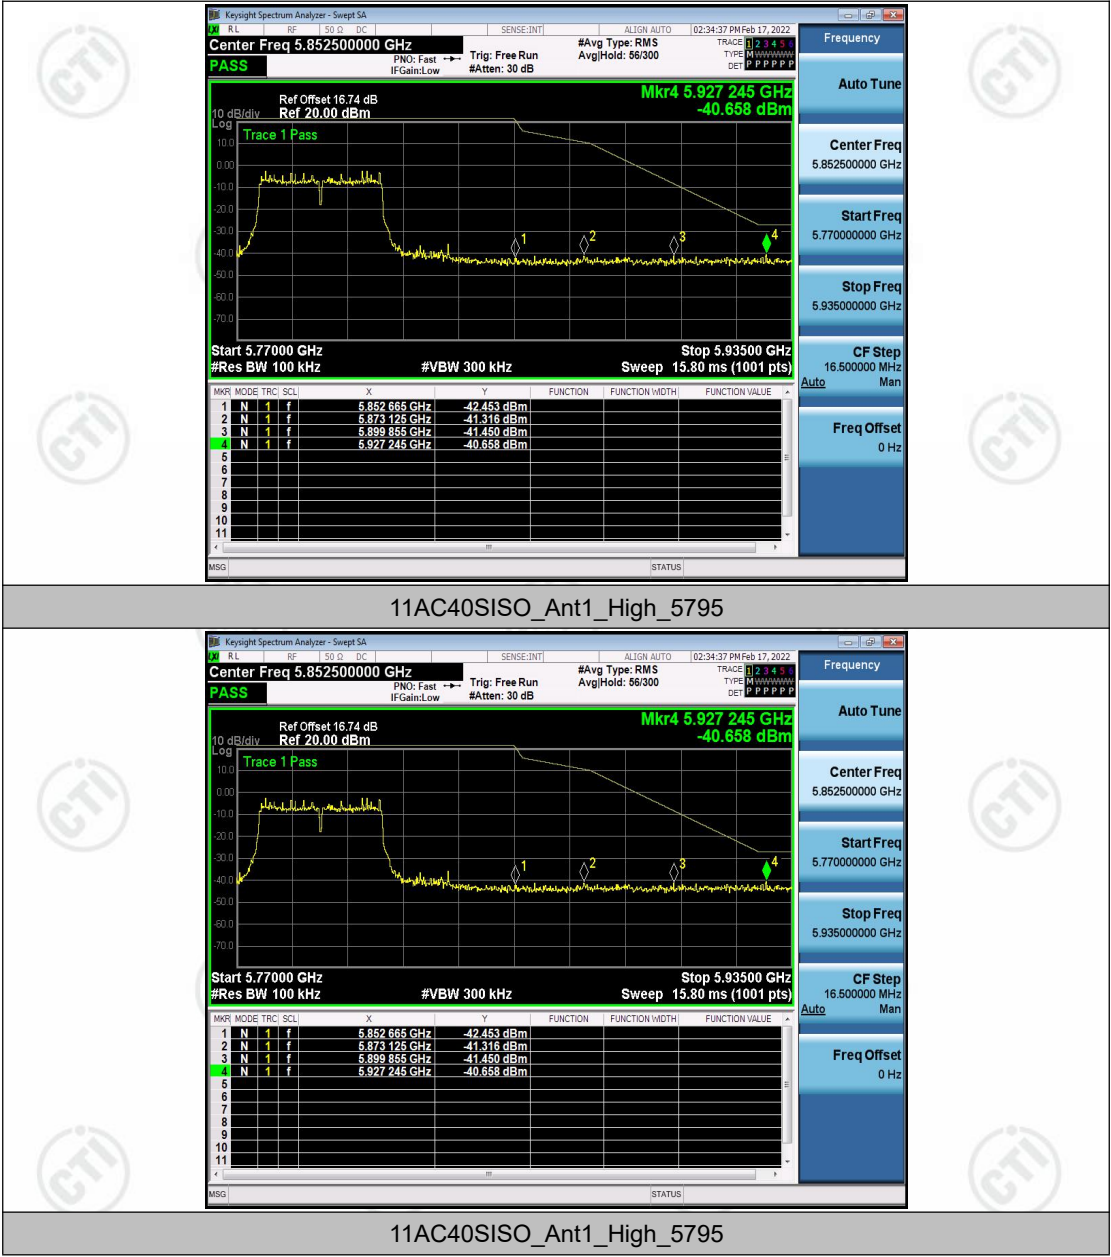


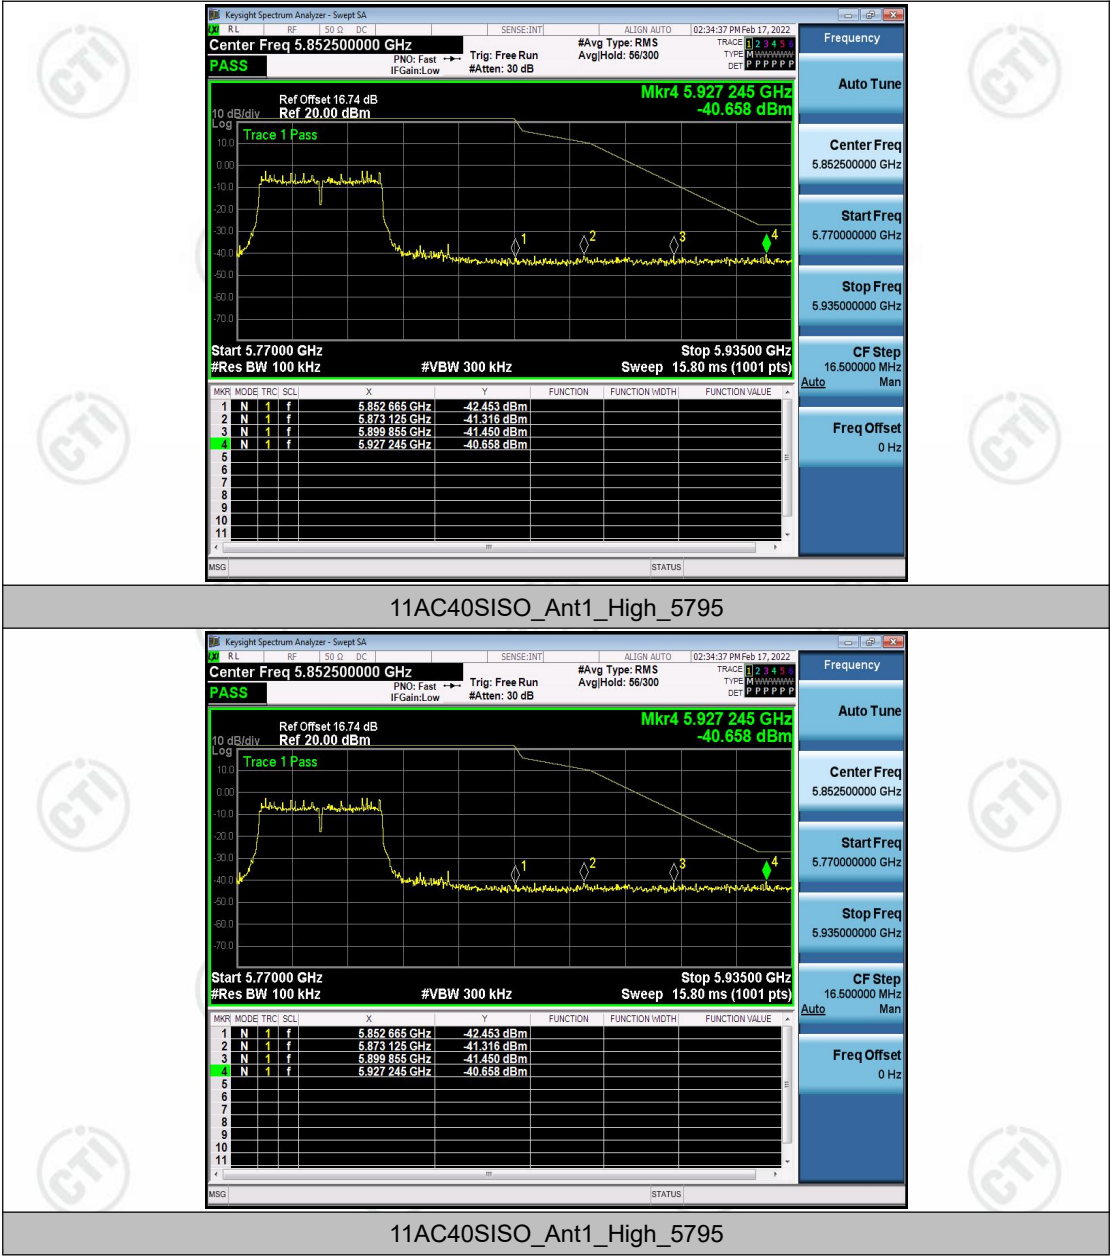

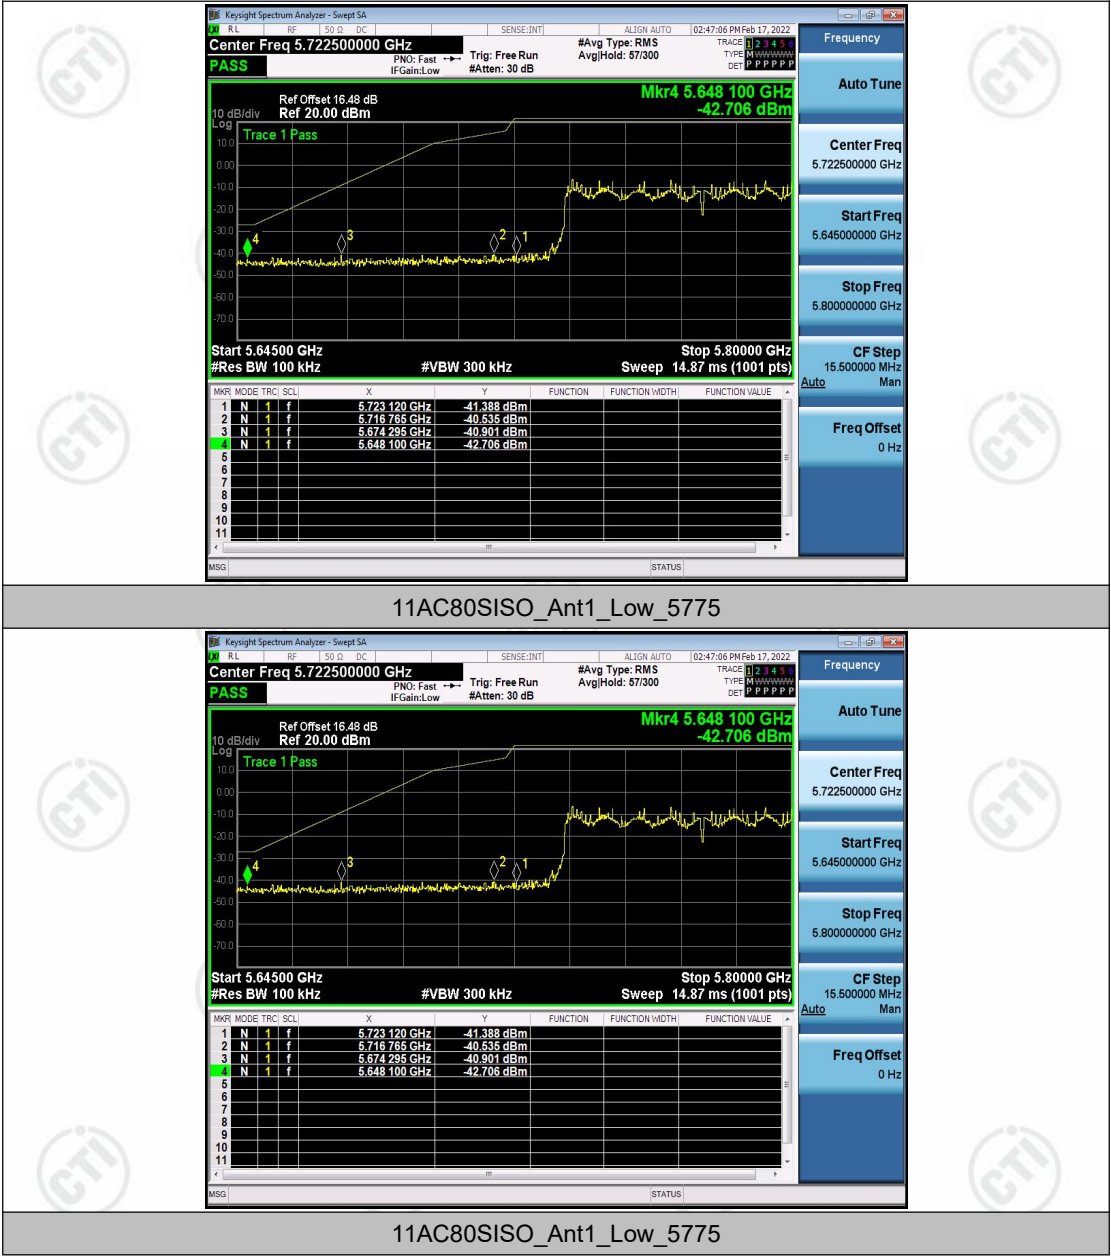

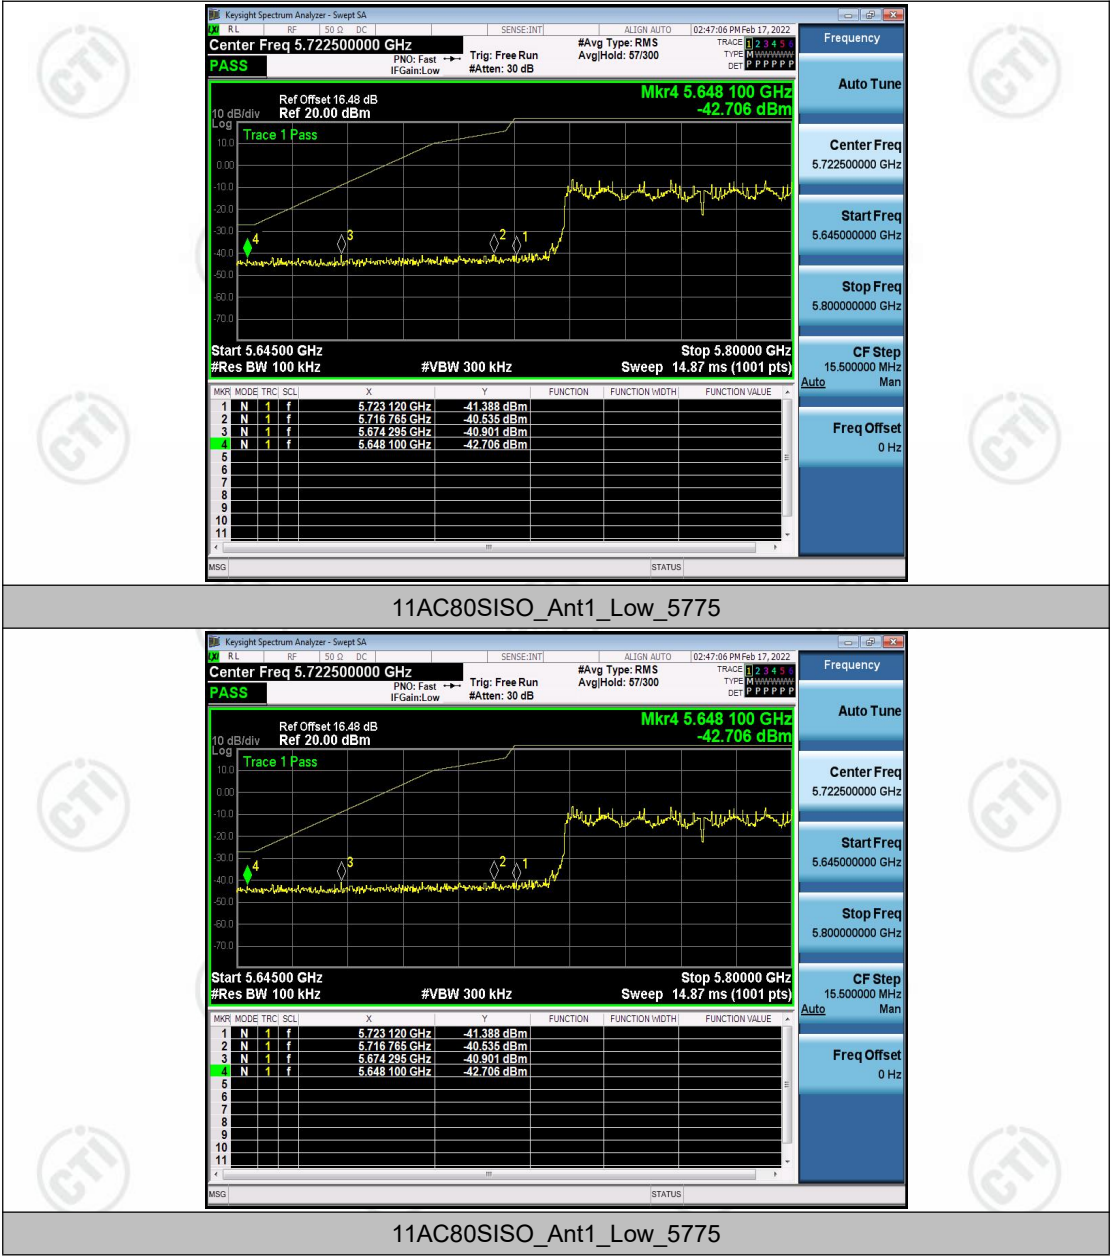

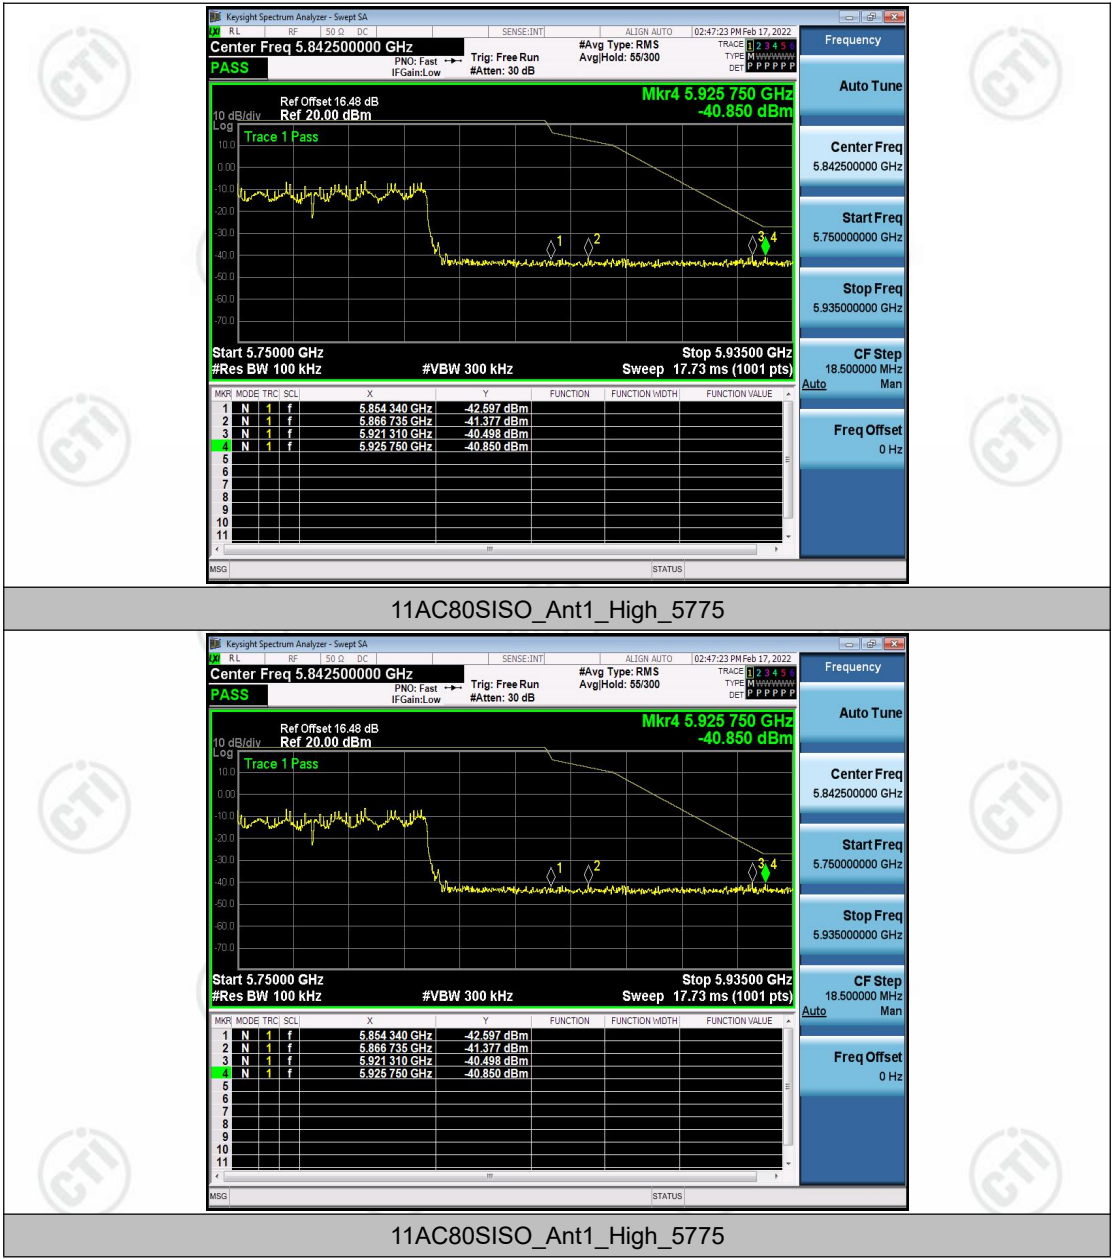

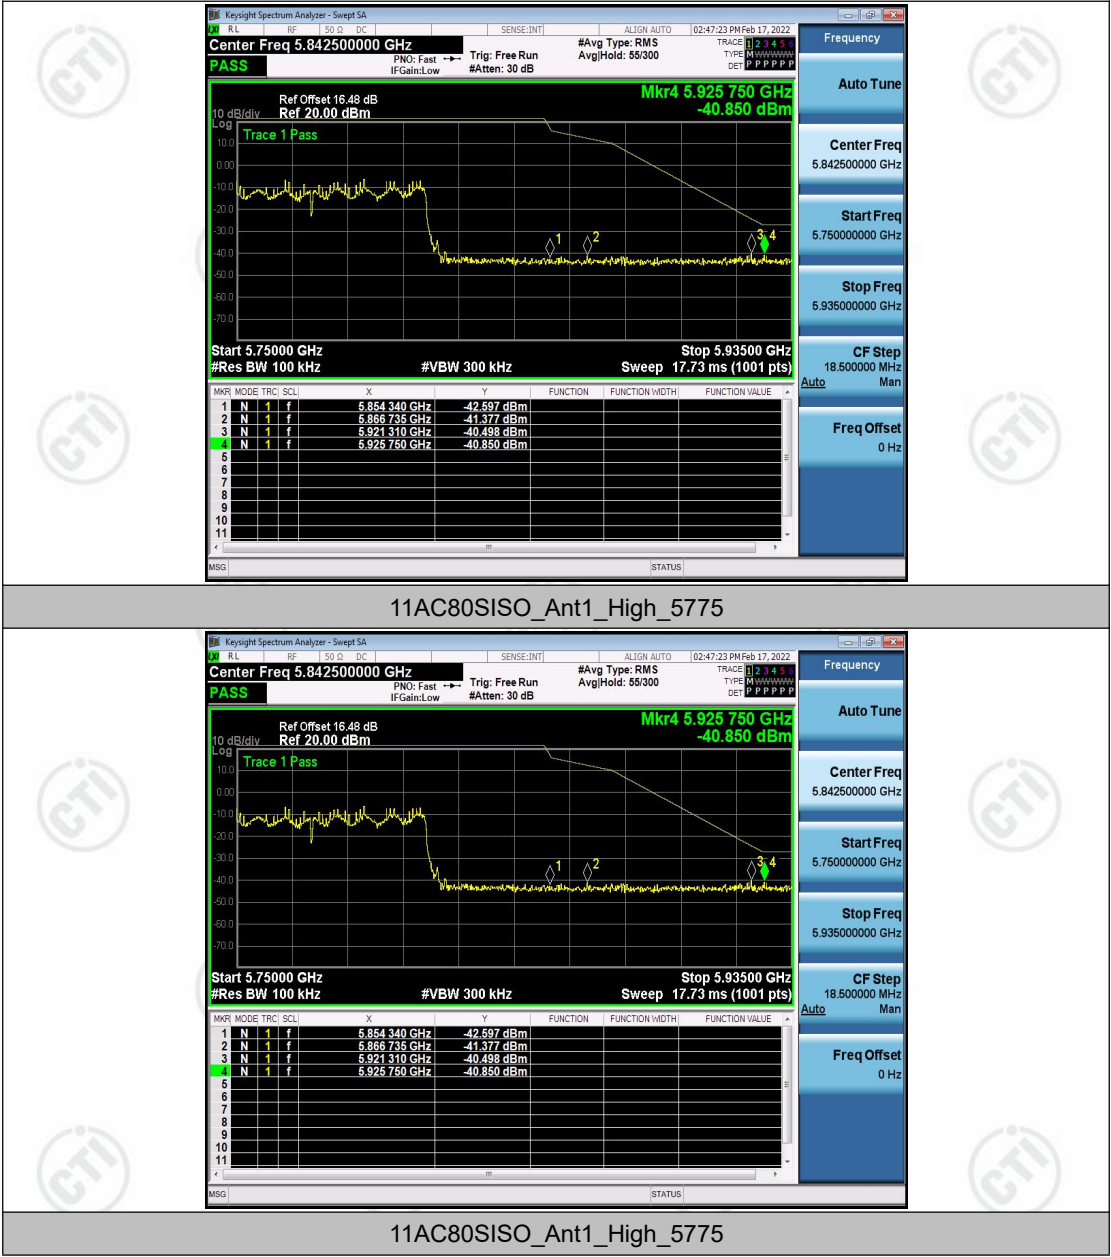

Appendix F: Conducted Spurious Emission

Test Result

Test Mode	Antenna	Channel	FreqRange [MHz]	Max. Fre [MHz]	Max. Level [dBm]	Limit [dBm]	Verdict
11A	Ant1	5180	30~5140	30~5140	-38.648	<=-27	PASS
			5360~40000	5360~40000	-33.971	<=-27	PASS
		5200	30~5140	30~5140	-40.913	<=-27	PASS
			5360~40000	5360~40000	-33.905	<=-27	PASS
		5240	30~5140	30~5140	-41.441	<=-27	PASS
			5360~40000	5360~40000	-34.047	<=-27	PASS
		5745	30~5650	30~5650	-39.863	<=-27	PASS
			5925~40000	5925~40000	-32.957	<=-27	PASS
		5785	30~5650	30~5650	-40.538	<=-27	PASS
			5925~40000	5925~40000	-33.147	<=-27	PASS
		5825	30~5650	30~5650	-33.589	<=-27	PASS
			5925~40000	5925~40000	-32.709	<=-27	PASS
11N20 SISO	Ant1	5180	30~5140	30~5140	-36.016	<=-27	PASS
			5360~40000	5360~40000	-34.186	<=-27	PASS
		5200	30~5140	30~5140	-40.186	<=-27	PASS
			5360~40000	5360~40000	-34.305	<=-27	PASS
		5240	30~5140	30~5140	-41.655	<=-27	PASS
			5360~40000	5360~40000	-33.725	<=-27	PASS
		5745	30~5650	30~5650	-39.507	<=-27	PASS
			5925~40000	5925~40000	-33.374	<=-27	PASS
		5785	30~5650	30~5650	-33.663	<=-27	PASS
			5925~40000	5925~40000	-32.418	<=-27	PASS
		5825	30~5650	30~5650	-39.945	<=-27	PASS
			5925~40000	5925~40000	-32.466	<=-27	PASS
11N40 SISO	Ant1	5190	30~5140	30~5140	-40.731	<=-27	PASS
			5360~40000	5360~40000	-33.145	<=-27	PASS
		5230	30~5140	30~5140	-41.246	<=-27	PASS
			5360~40000	5360~40000	-33.098	<=-27	PASS
		5755	30~5650	30~5650	-40.019	<=-27	PASS
			5925~40000	5925~40000	-33.069	<=-27	PASS
		5795	30~5650	30~5650	-40.455	<=-27	PASS
			5925~40000	5925~40000	-31.936	<=-27	PASS
11AC2	Ant1	5180	30~5140	30~5140	-40.487	<=-27	PASS

0SISO			5360~40000	5360~40000	-33.362	<=-27	PASS
		5200	30~5140	30~5140	-41.447	<=-27	PASS
			5360~40000	5360~40000	-34.079	<=-27	PASS
		5240	30~5140	30~5140	-41.711	<=-27	PASS
			5360~40000	5360~40000	-33.808	<=-27	PASS
		5745	30~5650	30~5650	-40.06	<=-27	PASS
			5925~40000	5925~40000	-33.319	<=-27	PASS
		5785	30~5650	30~5650	-39.019	<=-27	PASS
			5925~40000	5925~40000	-32.906	<=-27	PASS
		5825	30~5650	30~5650	-39.605	<=-27	PASS
			5925~40000	5925~40000	-32.491	<=-27	PASS
11AC4 0SISO	Ant1	5190	30~5140	30~5140	-40.352	<=-27	PASS
			5360~40000	5360~40000	-33.797	<=-27	PASS
		5230	30~5140	30~5140	-40.892	<=-27	PASS
			5360~40000	5360~40000	-34.469	<=-27	PASS
		5755	30~5650	30~5650	-40.356	<=-27	PASS
			5925~40000	5925~40000	-32.907	<=-27	PASS
		5795	30~5650	30~5650	-40.094	<=-27	PASS
			5925~40000	5925~40000	-32.76	<=-27	PASS
11AC8 0SISO	Ant1	5210	30~5140	30~5140	-38.142	<=-27	PASS
			5360~40000	5360~40000	-33.37	<=-27	PASS
		5775	30~5650	30~5650	-40.416	<=-27	PASS
			5925~40000	5925~40000	-32.899	<=-27	PASS

Test Graphs

