




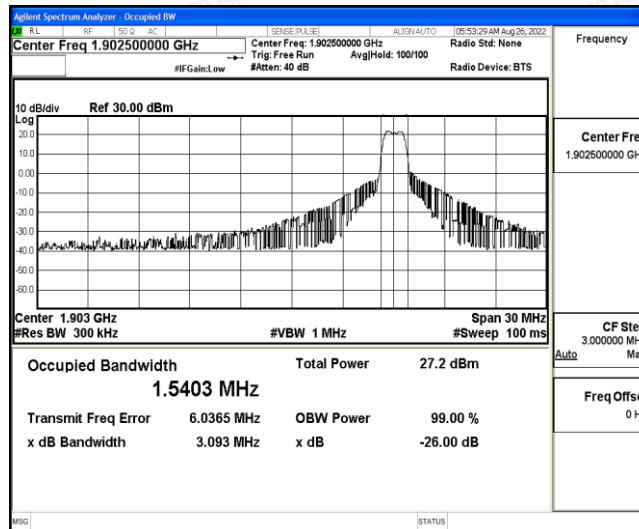

Band2-15MHz-16QAM-19125-6-0-High-1.5403-3.093-PASS

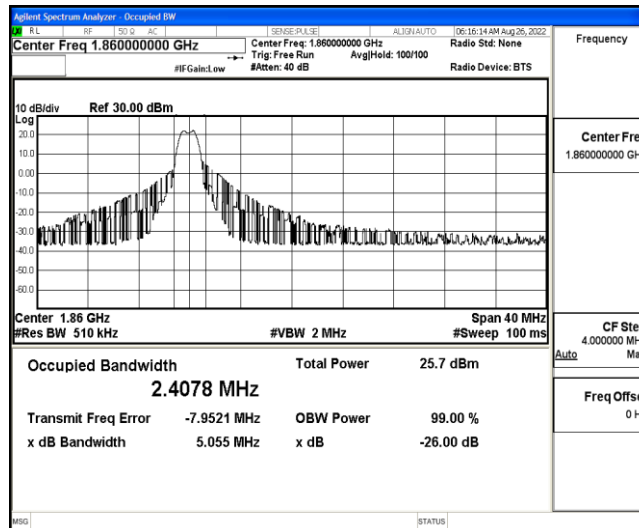

Band2-20MHz-QPSK-18700-6-0-Low-2.4078-5.055-PASS

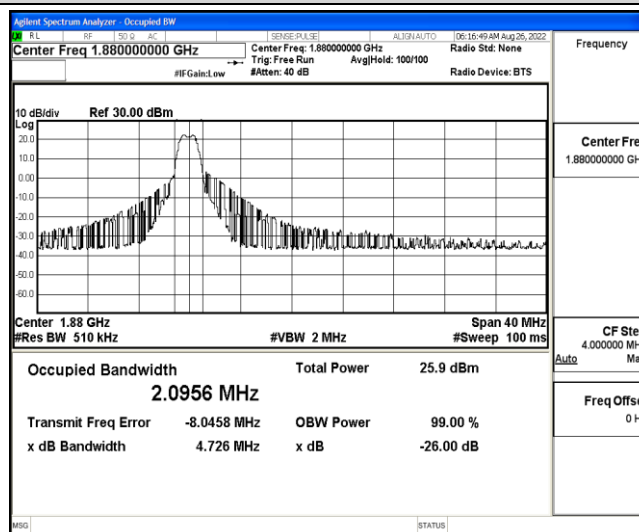

Band2-20MHz-QPSK-18900-6-0-Low-2.0956-4.726-PASS




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity

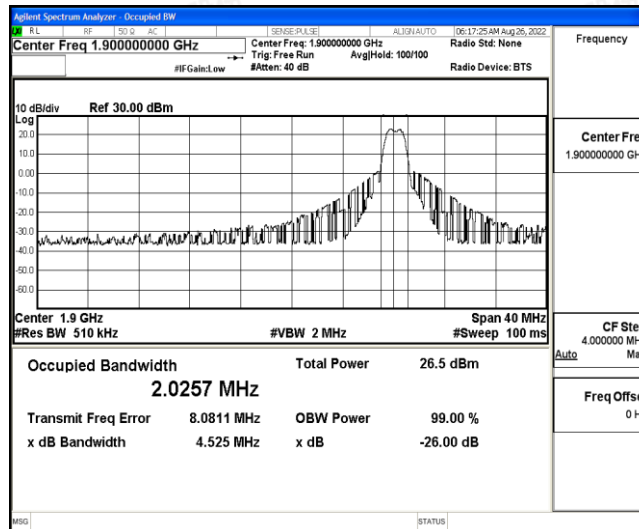

Band2-20MHz-QPSK-19100-6-0-High-2.0257-4.525-PASS

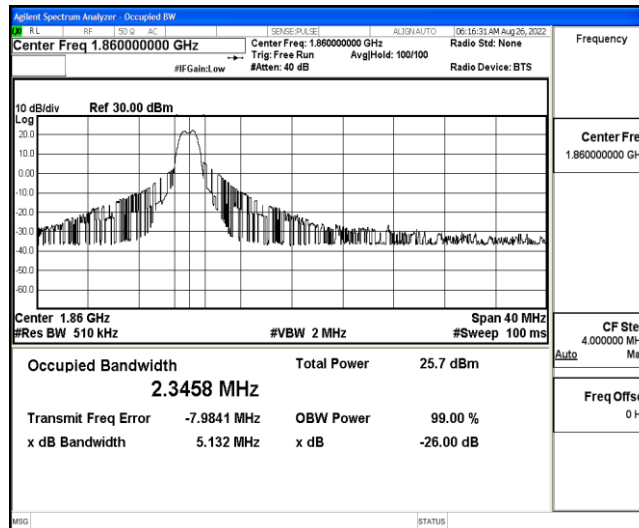

Band2-20MHz-16QAM-18700-6-0-Low-2.3458-5.132-PASS

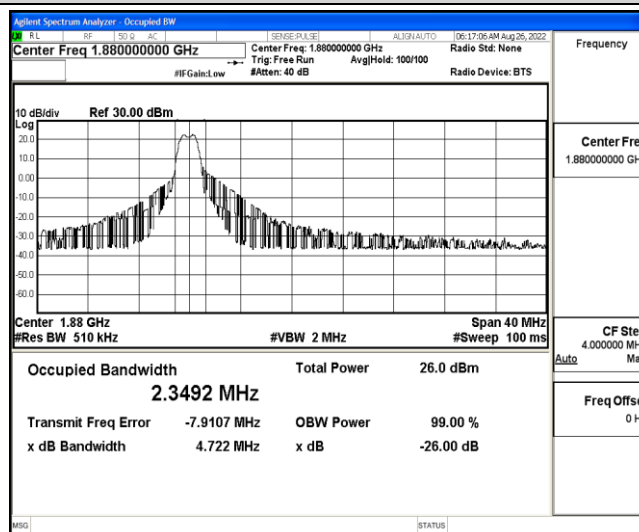

Band2-20MHz-16QAM-18900-6-0-Low-2.3492-4.722-PASS




Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

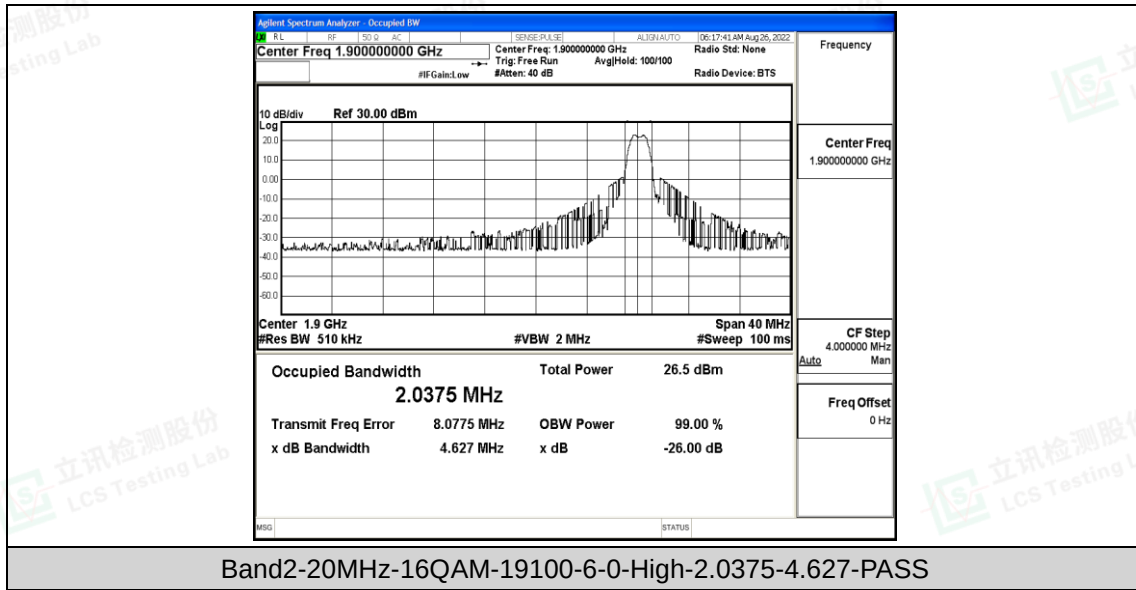



C.4 Band Edge for M1

Test Result

Band	Bandwidth	Channel	Modulation	RB Size	RB Start	NB Index	Result(dBm)	Verdict
Band2	1.4MHz	18607	QPSK	6	0	Low	-35.75	PASS
Band2	1.4MHz	19193	QPSK	6	0	High	-34.30	PASS
Band2	1.4MHz	18607	16QAM	6	0	Low	-33.15	PASS
Band2	1.4MHz	19193	16QAM	6	0	High	-32.57	PASS
Band2	3MHz	18615	QPSK	6	0	Low	-35.61	PASS
Band2	3MHz	19185	QPSK	6	0	High	-34.98	PASS
Band2	3MHz	18615	16QAM	6	0	Low	-37.23	PASS
Band2	3MHz	19185	16QAM	6	0	High	-32.86	PASS
Band2	5MHz	18625	QPSK	6	0	Low	-32.81	PASS
Band2	5MHz	19175	QPSK	6	0	High	-29.93	PASS
Band2	5MHz	18625	16QAM	6	0	Low	-31.45	PASS
Band2	5MHz	19175	16QAM	6	0	High	-30.75	PASS
Band2	10MHz	18650	QPSK	6	0	Low	-29.46	PASS
Band2	10MHz	19150	QPSK	6	0	High	-27.54	PASS
Band2	10MHz	18650	16QAM	6	0	Low	-29.86	PASS
Band2	10MHz	19150	16QAM	6	0	High	-29.29	PASS
Band2	15MHz	18675	QPSK	6	0	Low	-27.75	PASS
Band2	15MHz	19125	QPSK	6	0	High	-26.96	PASS
Band2	15MHz	18675	16QAM	6	0	Low	-25.87	PASS
Band2	15MHz	19125	16QAM	6	0	High	-25.34	PASS
Band2	20MHz	18700	QPSK	6	0	Low	-31.51	PASS
Band2	20MHz	19100	QPSK	6	0	High	-31.06	PASS
Band2	20MHz	18700	16QAM	6	0	Low	-32.11	PASS
Band2	20MHz	19100	16QAM	6	0	High	-29.54	PASS



Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



Test Graphs

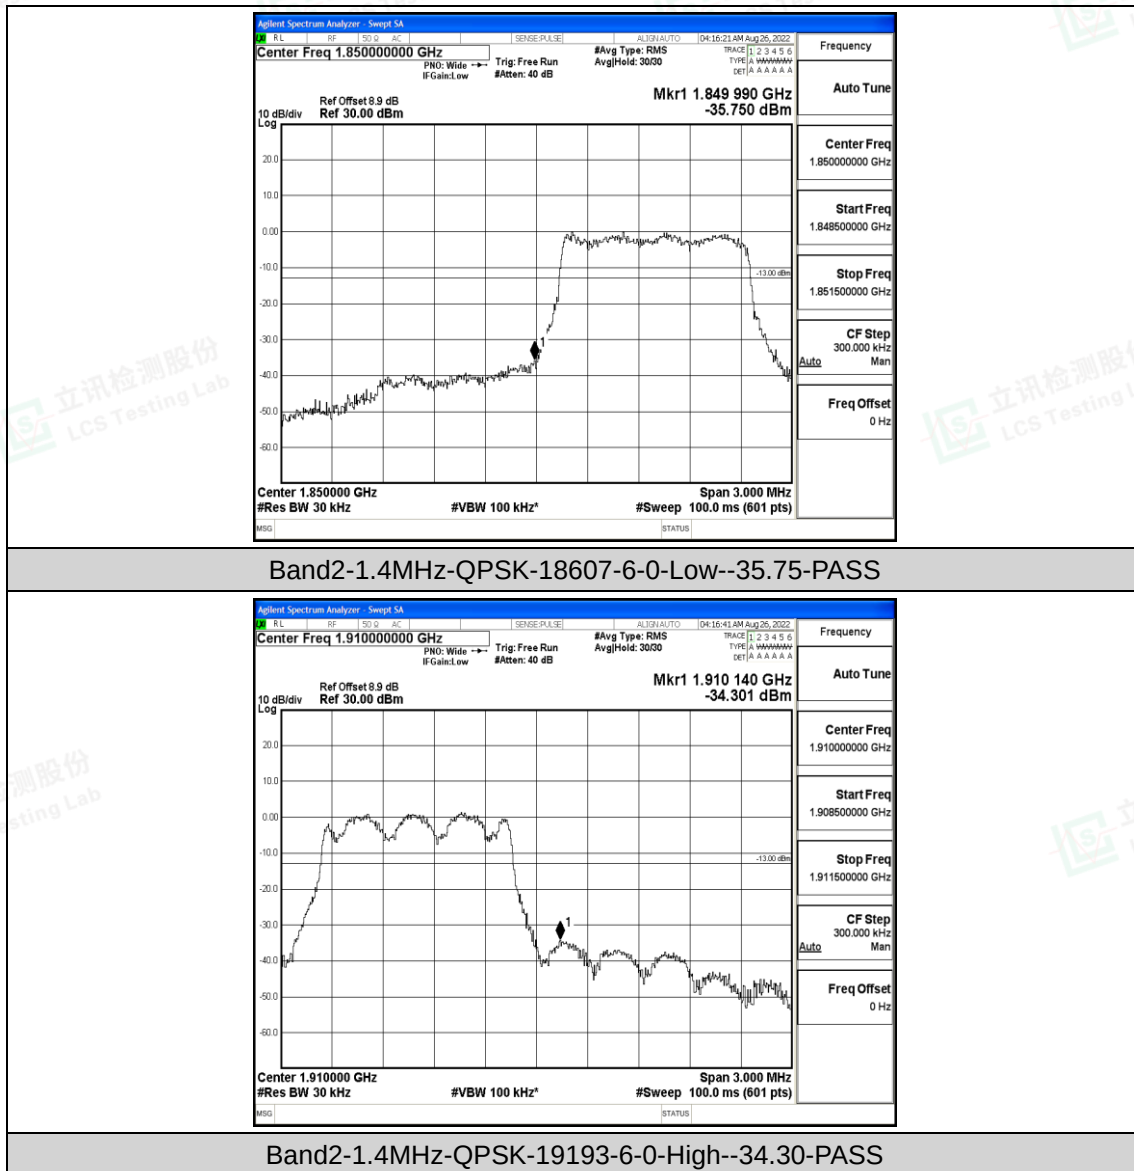


Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity

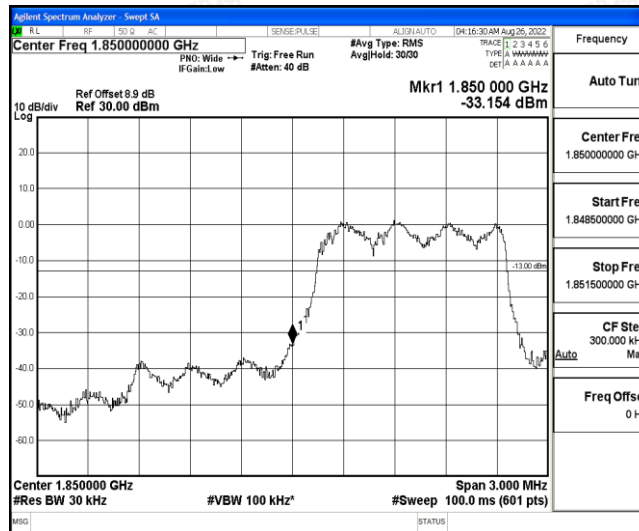

Band2-1.4MHz-16QAM-18607-6-0-Low--33.15-PASS

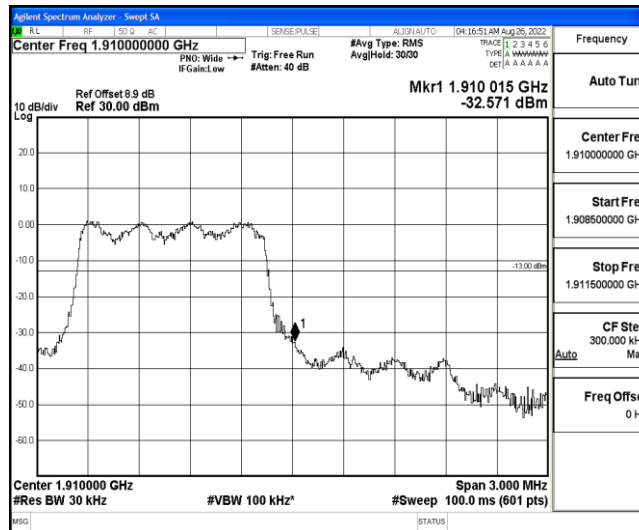

Band2-1.4MHz-16QAM-19193-6-0-High--32.57-PASS

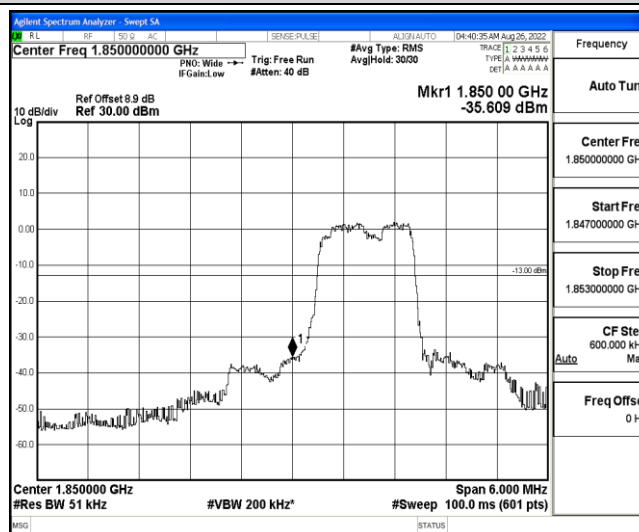

Band2-3MHz-QPSK-18615-6-0-Low--35.61-PASS




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity

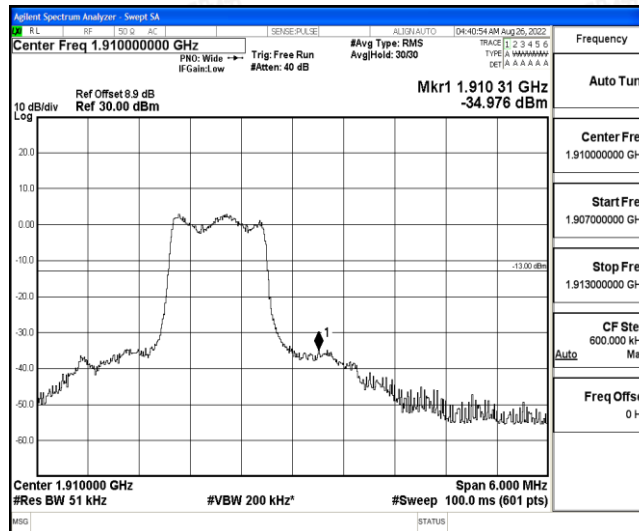

Band2-3MHz-QPSK-19185-6-0-High--34.98-PASS

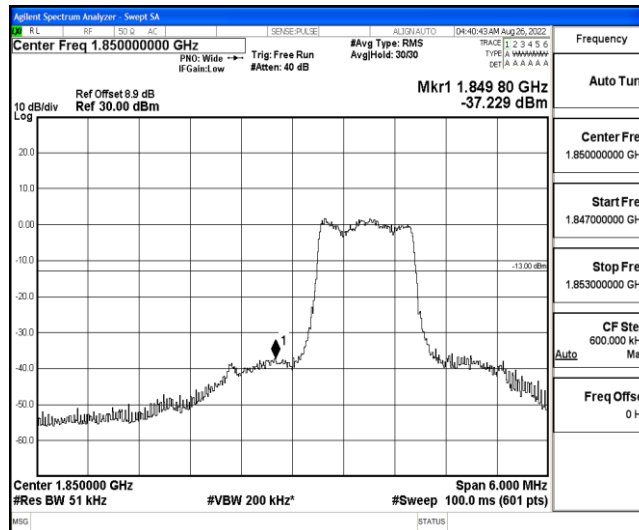

Band2-3MHz-16QAM-18615-6-0-Low--37.23-PASS

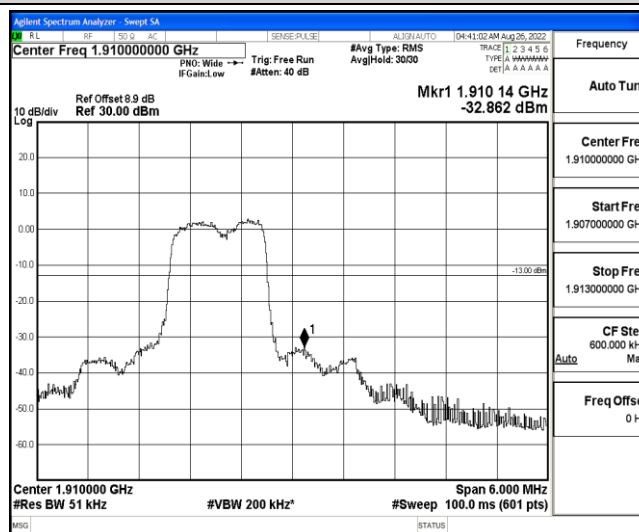

Band2-3MHz-16QAM-19185-6-0-High--32.86-PASS




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity

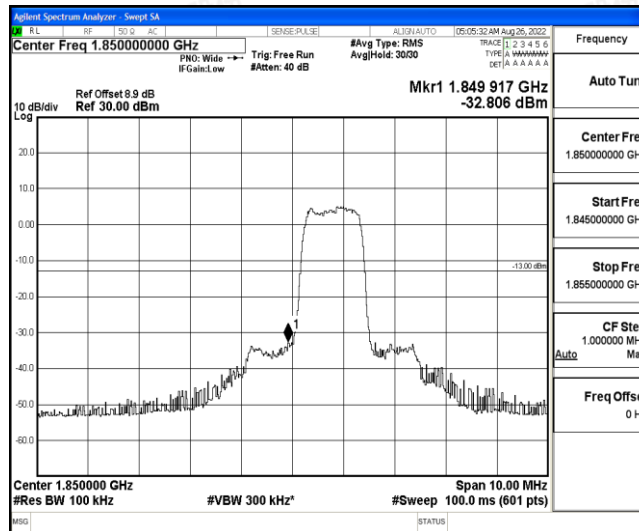

Band2-5MHz-QPSK-18625-6-0-Low--32.81-PASS

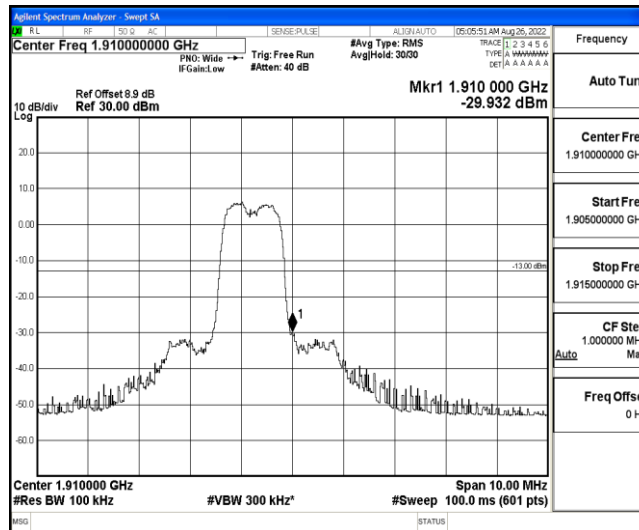

Band2-5MHz-QPSK-19175-6-0-High--29.93-PASS

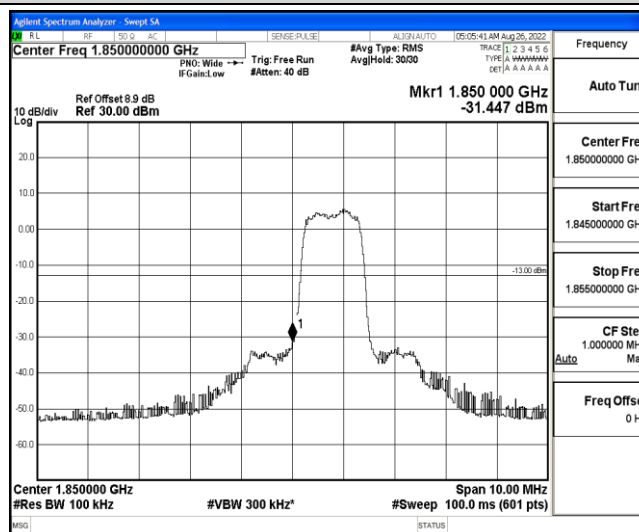

Band2-5MHz-16QAM-18625-6-0-Low--31.45-PASS




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity

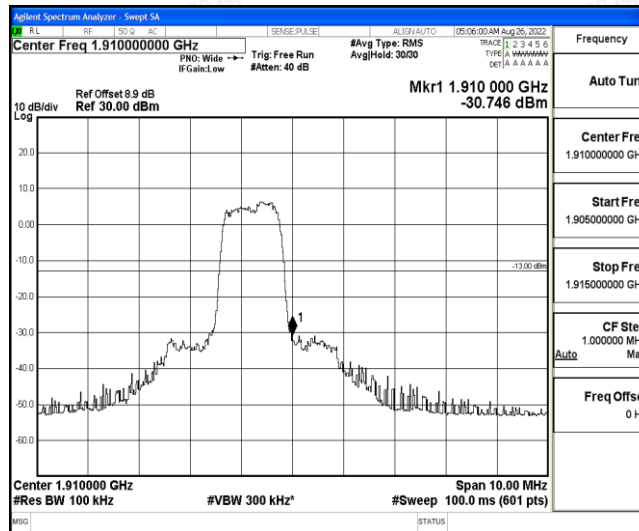

Band2-5MHz-16QAM-19175-6-0-High--30.75-PASS

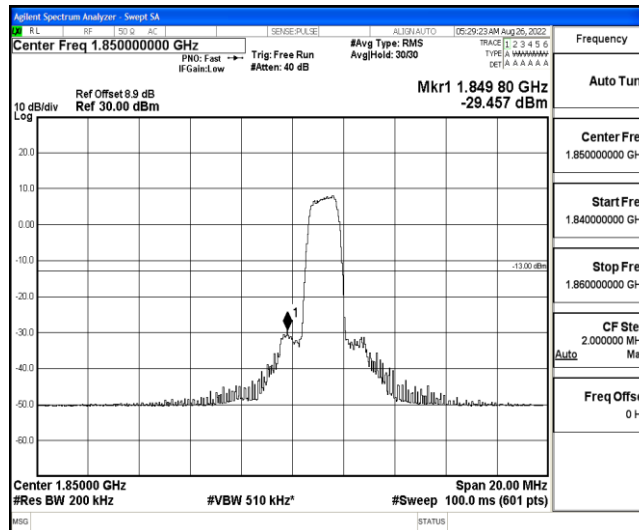


Band2-10MHz-QPSK-18650-6-0-Low--29.46-PASS

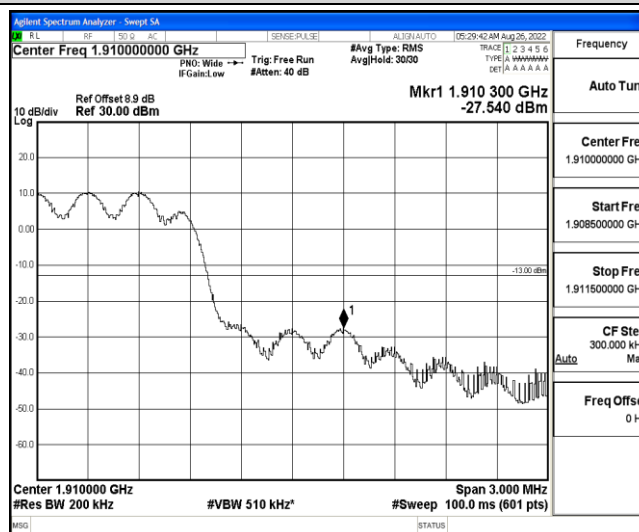


Band2-10MHz-QPSK-19150-6-0-High--27.54-PASS




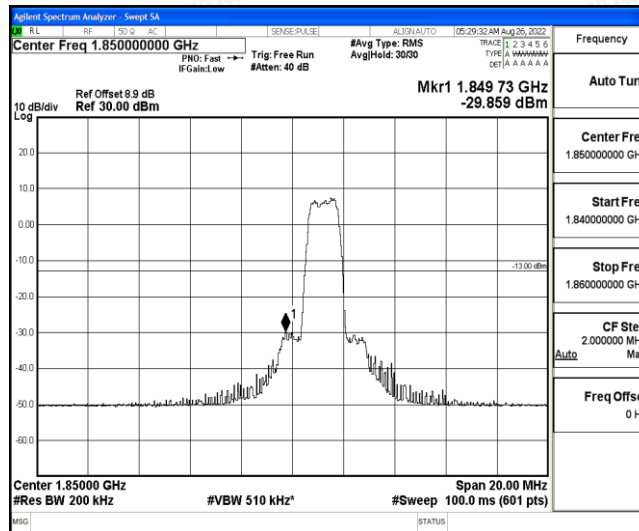

Band2-10MHz-16QAM-18650-6-0-Low--29.86-PASS

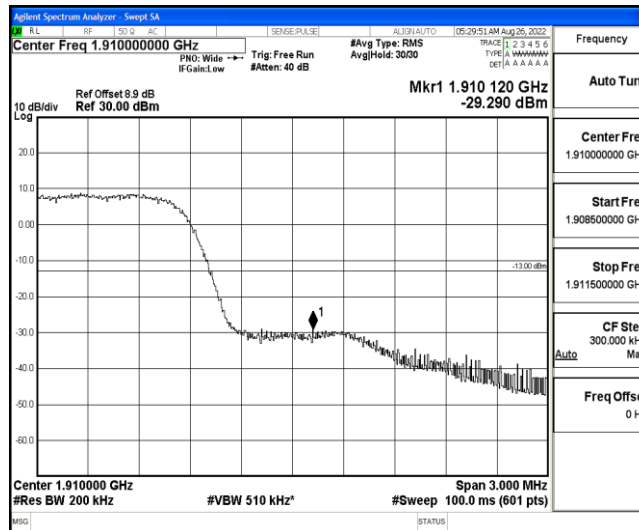


Band2-10MHz-16QAM-19150-6-0-High--29.29-PASS

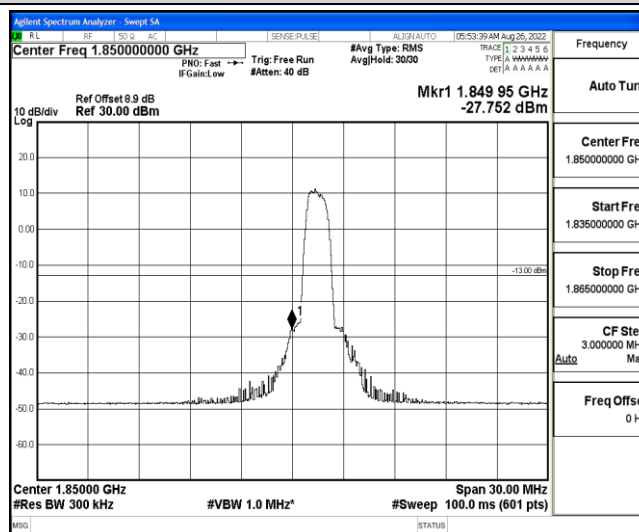


Band2-15MHz-QPSK-18675-6-0-Low--27.75-PASS




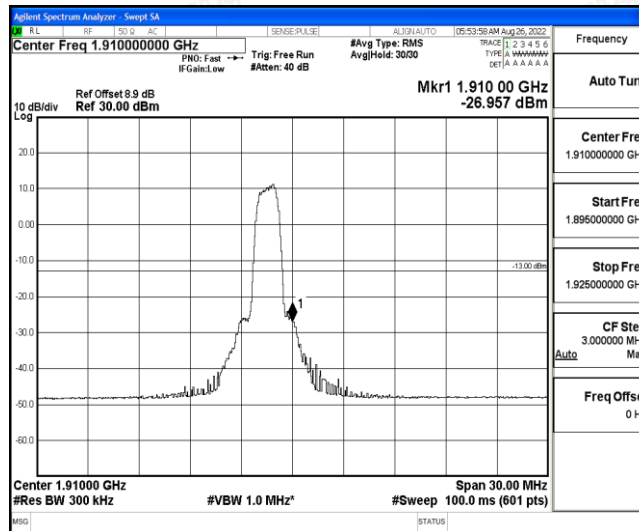

Band2-15MHz-QPSK-19125-6-0-High--26.96-PASS

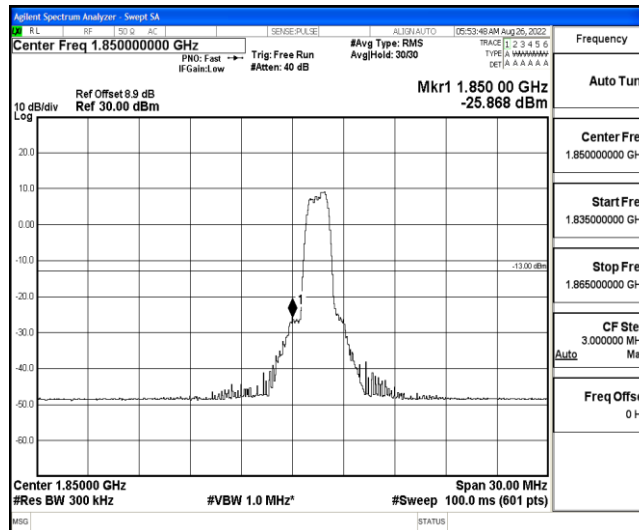

Band2-15MHz-16QAM-18675-6-0-Low--25.87-PASS

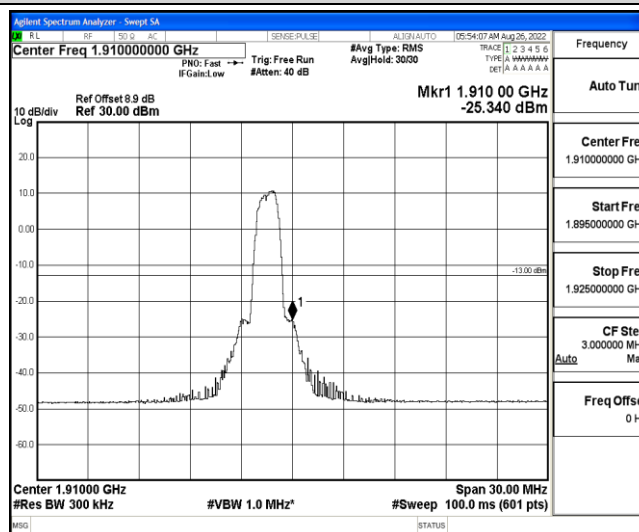

Band2-15MHz-16QAM-19125-6-0-High--25.34-PASS




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity

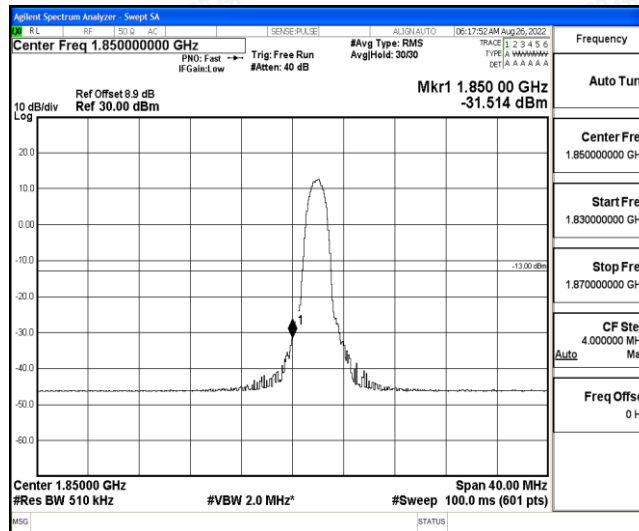

Band2-20MHz-QPSK-18700-6-0-Low--31.51-PASS

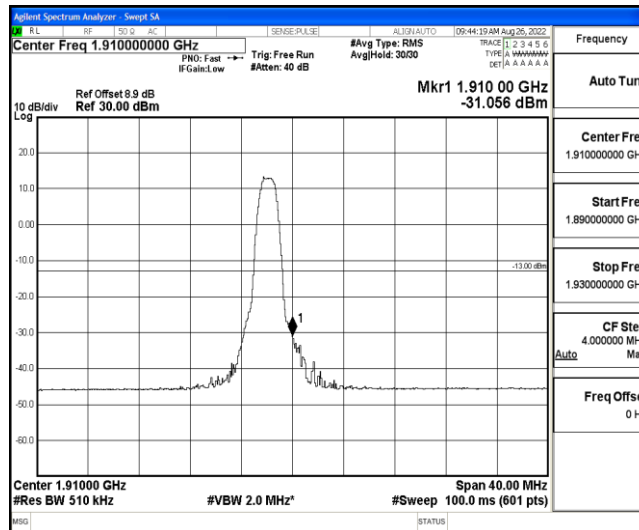

Band2-20MHz-QPSK-19100-6-0-High--31.06-PASS

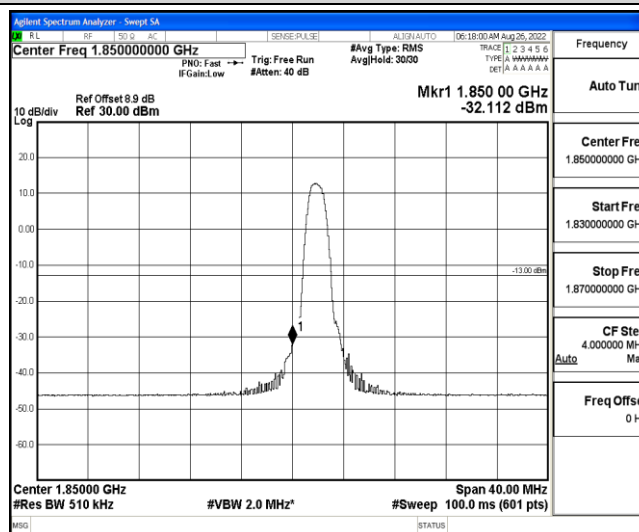

Band2-20MHz-16QAM-18700-6-0-Low--32.11-PASS




Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

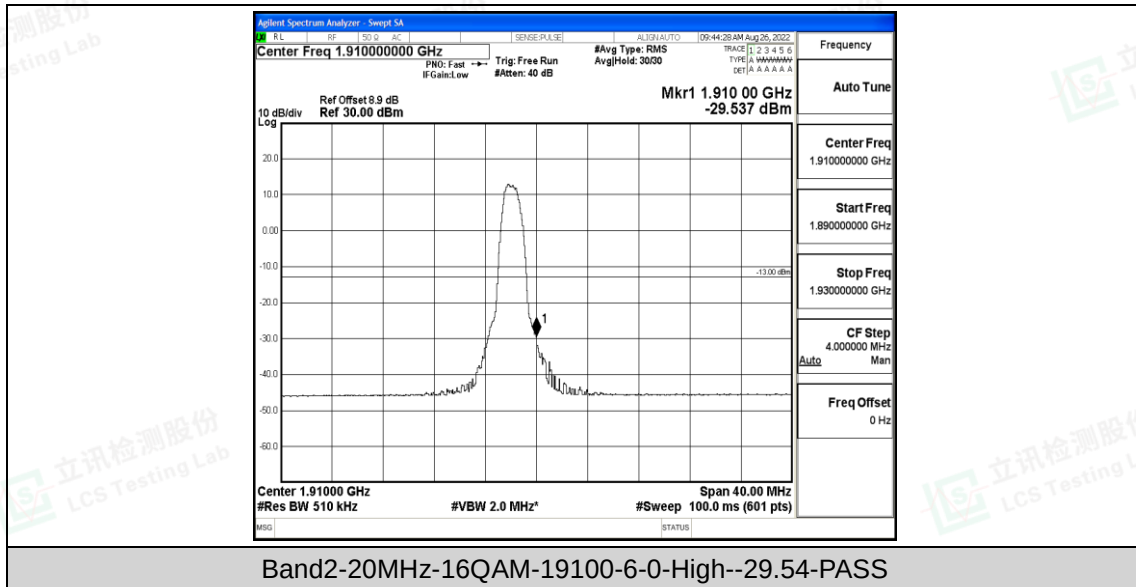



C.5 Conducted Spurious Emission for M1

Test Result

Band	Bandwidth h	Channel	Modulation	RB Size	RB Start	NB Index	Start Freq	Stop Freq	Result (dBm)	Verdict
Band 2	1.4MHz	18607	QPSK	1	0	Low	30	1000	-35.3	PASS
Band 2	1.4MHz	18607	QPSK	1	0	Low	1000	5000	-38.55	PASS
Band 2	1.4MHz	18607	QPSK	1	0	Low	5000	12000	-57.45	PASS
Band 2	1.4MHz	18607	QPSK	1	0	Low	12000	26500	-42.81	PASS
Band 2	1.4MHz	18900	QPSK	1	0	Middle	30	1000	-35.24	PASS
Band 2	1.4MHz	18900	QPSK	1	0	Middle	1000	5000	-39.6	PASS
Band 2	1.4MHz	18900	QPSK	1	0	Middle	5000	12000	-57.58	PASS
Band 2	1.4MHz	18900	QPSK	1	0	Middle	12000	26500	-42.71	PASS
Band 2	1.4MHz	19193	QPSK	1	0	High	30	1000	-34.44	PASS
Band 2	1.4MHz	19193	QPSK	1	0	High	1000	5000	-39.54	PASS
Band 2	1.4MHz	19193	QPSK	1	0	High	5000	12000	-55.51	PASS
Band 2	1.4MHz	19193	QPSK	1	0	High	12000	26500	-42.74	PASS
Band 2	1.4MHz	18607	16QAM	1	0	Low	30	1000	-35.65	PASS
Band 2	1.4MHz	18607	16QAM	1	0	Low	1000	5000	-39.23	PASS
Band 2	1.4MHz	18607	16QAM	1	0	Low	5000	12000	-57.48	PASS
Band 2	1.4MHz	18607	16QAM	1	0	Low	12000	26500	-42.76	PASS
Band 2	1.4MHz	18900	16QAM	1	0	Middle	30	1000	-34.85	PASS



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



Band 2	1.4MHz	18900	16QAM	1	0	Middle	1000	5000	-39.4	PASS
Band 2	1.4MHz	18900	16QAM	1	0	Middle	5000	12000	-56.4	PASS
Band 2	1.4MHz	18900	16QAM	1	0	Middle	12000	26500	-42.63	PASS
Band 2	1.4MHz	19193	16QAM	1	0	High	30	1000	-35.64	PASS
Band 2	1.4MHz	19193	16QAM	1	0	High	1000	5000	-39.55	PASS
Band 2	1.4MHz	19193	16QAM	1	0	High	5000	12000	-57.63	PASS
Band 2	1.4MHz	19193	16QAM	1	0	High	12000	26500	-42.57	PASS
Band 2	3MHz	18615	QPSK	1	0	Low	30	1000	-35.44	PASS
Band 2	3MHz	18615	QPSK	1	0	Low	1000	5000	-41.83	PASS
Band 2	3MHz	18615	QPSK	1	0	Low	5000	12000	-55.81	PASS
Band 2	3MHz	18615	QPSK	1	0	Low	12000	26500	-42.75	PASS
Band 2	3MHz	18900	QPSK	1	0	Middle	30	1000	-35.61	PASS
Band 2	3MHz	18900	QPSK	1	0	Middle	1000	5000	-38.93	PASS
Band 2	3MHz	18900	QPSK	1	0	Middle	5000	12000	-57.29	PASS
Band 2	3MHz	18900	QPSK	1	0	Middle	12000	26500	-42.56	PASS
Band 2	3MHz	19185	QPSK	1	0	High	30	1000	-35.44	PASS
Band 2	3MHz	19185	QPSK	1	0	High	1000	5000	-39.3	PASS
Band 2	3MHz	19185	QPSK	1	0	High	5000	12000	-54.99	PASS
Band 2	3MHz	19185	QPSK	1	0	High	12000	26500	-42.84	PASS
Band 2	3MHz	18615	16QAM	1	0	Low	30	1000	-34.17	PASS
Band	3MHz	18615	16QAM	1	0	Low	1000	5000	-39.35	PASS



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



2										
Band 2	3MHz	18615	16QAM	1	0	Low	5000	12000	-57.56	PASS
Band 2	3MHz	18615	16QAM	1	0	Low	12000	26500	-42.61	PASS
Band 2	3MHz	18900	16QAM	1	0	Middle	30	1000	-35.79	PASS
Band 2	3MHz	18900	16QAM	1	0	Middle	1000	5000	-39.5	PASS
Band 2	3MHz	18900	16QAM	1	0	Middle	5000	12000	-56.91	PASS
Band 2	3MHz	18900	16QAM	1	0	Middle	12000	26500	-42.65	PASS
Band 2	3MHz	19185	16QAM	1	0	High	30	1000	-35.5	PASS
Band 2	3MHz	19185	16QAM	1	0	High	1000	5000	-39.93	PASS
Band 2	3MHz	19185	16QAM	1	0	High	5000	12000	-56.56	PASS
Band 2	3MHz	19185	16QAM	1	0	High	12000	26500	-42.67	PASS
Band 2	5MHz	18625	QPSK	1	0	Low	30	1000	-35.09	PASS
Band 2	5MHz	18625	QPSK	1	0	Low	1000	5000	-38.62	PASS
Band 2	5MHz	18625	QPSK	1	0	Low	5000	12000	-56.38	PASS
Band 2	5MHz	18625	QPSK	1	0	Low	12000	26500	-42.58	PASS
Band 2	5MHz	18900	QPSK	1	0	Middle	30	1000	-35.59	PASS
Band 2	5MHz	18900	QPSK	1	0	Middle	1000	5000	-39.06	PASS
Band 2	5MHz	18900	QPSK	1	0	Middle	5000	12000	-57.5	PASS
Band 2	5MHz	18900	QPSK	1	0	Middle	12000	26500	-42.72	PASS
Band 2	5MHz	19175	QPSK	1	0	High	30	1000	-35.91	PASS
Band 2	5MHz	19175	QPSK	1	0	High	1000	5000	-39.6	PASS



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



Band 2	5MHz	19175	QPSK	1	0	High	5000	12000	-57.38	PASS
Band 2	5MHz	19175	QPSK	1	0	High	12000	26500	-42.5	PASS
Band 2	5MHz	18625	16QAM	1	0	Low	30	1000	-35.85	PASS
Band 2	5MHz	18625	16QAM	1	0	Low	1000	5000	-38.55	PASS
Band 2	5MHz	18625	16QAM	1	0	Low	5000	12000	-55.16	PASS
Band 2	5MHz	18625	16QAM	1	0	Low	12000	26500	-42.7	PASS
Band 2	5MHz	18900	16QAM	1	0	Middle	30	1000	-35.33	PASS
Band 2	5MHz	18900	16QAM	1	0	Middle	1000	5000	-38.67	PASS
Band 2	5MHz	18900	16QAM	1	0	Middle	5000	12000	-57.26	PASS
Band 2	5MHz	18900	16QAM	1	0	Middle	12000	26500	-42.66	PASS
Band 2	5MHz	19175	16QAM	1	0	High	30	1000	-35.99	PASS
Band 2	5MHz	19175	16QAM	1	0	High	1000	5000	-39.56	PASS
Band 2	5MHz	19175	16QAM	1	0	High	5000	12000	-57.31	PASS
Band 2	5MHz	19175	16QAM	1	0	High	12000	26500	-42.56	PASS
Band 2	10MHz	18650	QPSK	1	0	Low	30	1000	-34.87	PASS
Band 2	10MHz	18650	QPSK	1	0	Low	1000	5000	-40.07	PASS
Band 2	10MHz	18650	QPSK	1	0	Low	5000	12000	-57.49	PASS
Band 2	10MHz	18650	QPSK	1	0	Low	12000	26500	-42.71	PASS
Band 2	10MHz	18900	QPSK	1	0	Middle	30	1000	-35.02	PASS
Band 2	10MHz	18900	QPSK	1	0	Middle	1000	5000	-39.25	PASS
Band	10MHz	18900	QPSK	1	0	Middle	5000	12000	-57.49	PASS



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



2						e				
Band 2	10MHz	18900	QPSK	1	0	Middle	12000	26500	-42.56	PASS
Band 2	10MHz	19150	QPSK	1	0	High	30	1000	-35.31	PASS
Band 2	10MHz	19150	QPSK	1	0	High	1000	5000	-39.1	PASS
Band 2	10MHz	19150	QPSK	1	0	High	5000	12000	-57.25	PASS
Band 2	10MHz	19150	QPSK	1	0	High	12000	26500	-42.72	PASS
Band 2	10MHz	18650	16QAM	1	0	Low	30	1000	-35.83	PASS
Band 2	10MHz	18650	16QAM	1	0	Low	1000	5000	-38.64	PASS
Band 2	10MHz	18650	16QAM	1	0	Low	5000	12000	-57.19	PASS
Band 2	10MHz	18650	16QAM	1	0	Low	12000	26500	-42.67	PASS
Band 2	10MHz	18900	16QAM	1	0	Middle	30	1000	-35.26	PASS
Band 2	10MHz	18900	16QAM	1	0	Middle	1000	5000	-38.97	PASS
Band 2	10MHz	18900	16QAM	1	0	Middle	5000	12000	-56.22	PASS
Band 2	10MHz	18900	16QAM	1	0	Middle	12000	26500	-42.65	PASS
Band 2	10MHz	19150	16QAM	1	0	High	30	1000	-35.52	PASS
Band 2	10MHz	19150	16QAM	1	0	High	1000	5000	-40.17	PASS
Band 2	10MHz	19150	16QAM	1	0	High	5000	12000	-57.37	PASS
Band 2	10MHz	19150	16QAM	1	0	High	12000	26500	-42.81	PASS
Band 2	15MHz	18675	QPSK	1	0	Low	30	1000	-34.94	PASS
Band 2	15MHz	18675	QPSK	1	0	Low	1000	5000	-41.7	PASS
Band 2	15MHz	18675	QPSK	1	0	Low	5000	12000	-57.17	PASS



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



Band 2	15MHz	18675	QPSK	1	0	Low	12000	26500	-42.33	PASS
Band 2	15MHz	18900	QPSK	1	0	Middle	30	1000	-35.14	PASS
Band 2	15MHz	18900	QPSK	1	0	Middle	1000	5000	-39.12	PASS
Band 2	15MHz	18900	QPSK	1	0	Middle	5000	12000	-57.53	PASS
Band 2	15MHz	18900	QPSK	1	0	Middle	12000	26500	-42.74	PASS
Band 2	15MHz	19125	QPSK	1	0	High	30	1000	-34.22	PASS
Band 2	15MHz	19125	QPSK	1	0	High	1000	5000	-39.22	PASS
Band 2	15MHz	19125	QPSK	1	0	High	5000	12000	-57.58	PASS
Band 2	15MHz	19125	QPSK	1	0	High	12000	26500	-42.73	PASS
Band 2	15MHz	18675	16QAM	1	0	Low	30	1000	-35.51	PASS
Band 2	15MHz	18675	16QAM	1	0	Low	1000	5000	-39.03	PASS
Band 2	15MHz	18675	16QAM	1	0	Low	5000	12000	-57.49	PASS
Band 2	15MHz	18675	16QAM	1	0	Low	12000	26500	-42.67	PASS
Band 2	15MHz	18900	16QAM	1	0	Middle	30	1000	-34.76	PASS
Band 2	15MHz	18900	16QAM	1	0	Middle	1000	5000	-38.76	PASS
Band 2	15MHz	18900	16QAM	1	0	Middle	5000	12000	-57.46	PASS
Band 2	15MHz	18900	16QAM	1	0	Middle	12000	26500	-42.79	PASS
Band 2	15MHz	19125	16QAM	1	0	High	30	1000	-35.54	PASS
Band 2	15MHz	19125	16QAM	1	0	High	1000	5000	-39.37	PASS
Band 2	15MHz	19125	16QAM	1	0	High	5000	12000	-57.5	PASS
Band	15MHz	19125	16QAM	1	0	High	1200	26500	-42.72	PASS



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



2							0			
Band 2	20MHz	18700	QPSK	1	0	Low	30	1000	-35.77	PASS
Band 2	20MHz	18700	QPSK	1	0	Low	1000	5000	-38.72	PASS
Band 2	20MHz	18700	QPSK	1	0	Low	5000	12000	-55.29	PASS
Band 2	20MHz	18700	QPSK	1	0	Low	12000	26500	-42.74	PASS
Band 2	20MHz	18900	QPSK	1	0	Middle	30	1000	-35.44	PASS
Band 2	20MHz	18900	QPSK	1	0	Middle	1000	5000	-39.31	PASS
Band 2	20MHz	18900	QPSK	1	0	Middle	5000	12000	-57.46	PASS
Band 2	20MHz	18900	QPSK	1	0	Middle	12000	26500	-42.7	PASS
Band 2	20MHz	19100	QPSK	1	0	High	30	1000	-34.8	PASS
Band 2	20MHz	19100	QPSK	1	0	High	1000	5000	-39.17	PASS
Band 2	20MHz	19100	QPSK	1	0	High	5000	12000	-57.46	PASS
Band 2	20MHz	19100	QPSK	1	0	High	12000	26500	-42.72	PASS
Band 2	20MHz	18700	16QAM	1	0	Low	30	1000	-35.27	PASS
Band 2	20MHz	18700	16QAM	1	0	Low	1000	5000	-39.06	PASS
Band 2	20MHz	18700	16QAM	1	0	Low	5000	12000	-57.45	PASS
Band 2	20MHz	18700	16QAM	1	0	Low	12000	26500	-42.71	PASS
Band 2	20MHz	18900	16QAM	1	0	Middle	30	1000	-35.38	PASS
Band 2	20MHz	18900	16QAM	1	0	Middle	1000	5000	-38.55	PASS
Band 2	20MHz	18900	16QAM	1	0	Middle	5000	12000	-57.43	PASS
Band 2	20MHz	18900	16QAM	1	0	Middle	12000	26500	-42.76	PASS



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China


Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity




Band 2	20MHz	19100	16QAM	1	0	High	30	1000	-35.53	PASS
Band 2	20MHz	19100	16QAM	1	0	High	1000	5000	-39.25	PASS
Band 2	20MHz	19100	16QAM	1	0	High	5000	12000	-57.6	PASS
Band 2	20MHz	19100	16QAM	1	0	High	12000	26500	-42.64	PASS

Test Graphs

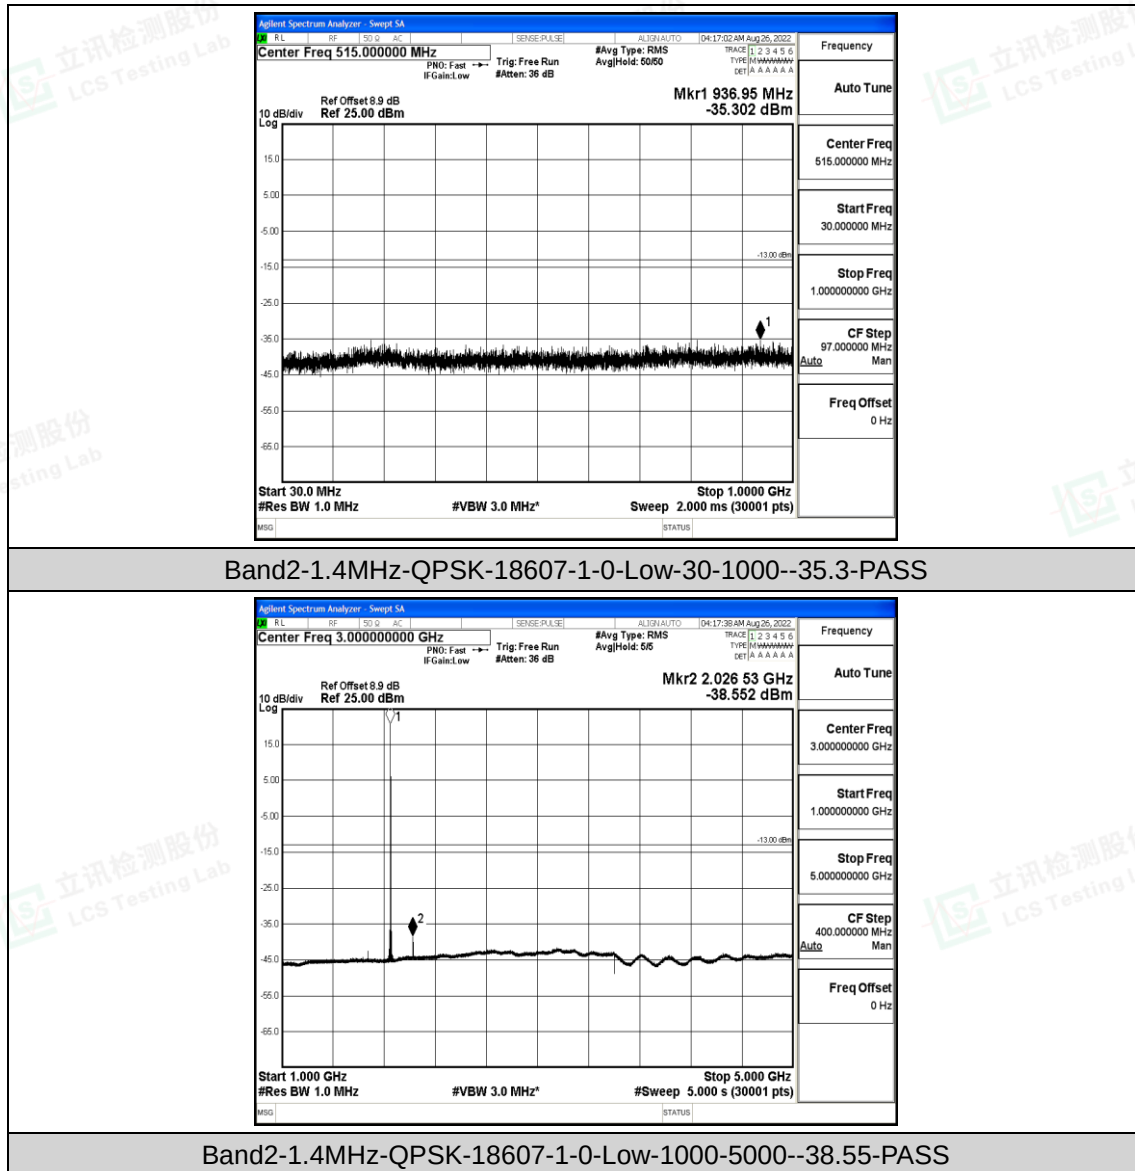


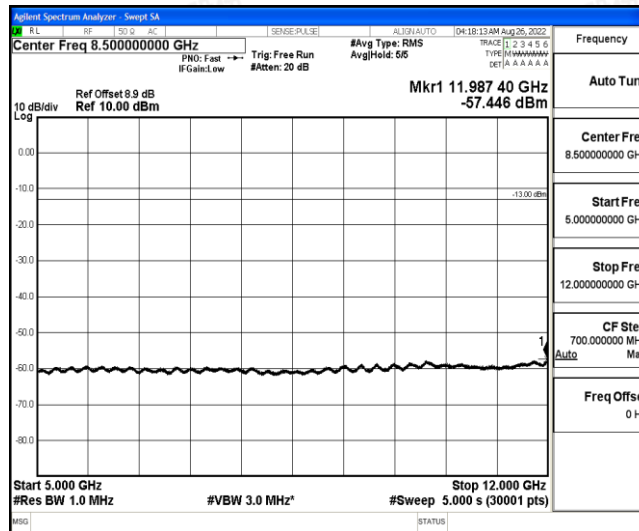

Band2-1.4MHz-QPSK-18607-1-0-Low-5000-12000--57.45-PASS

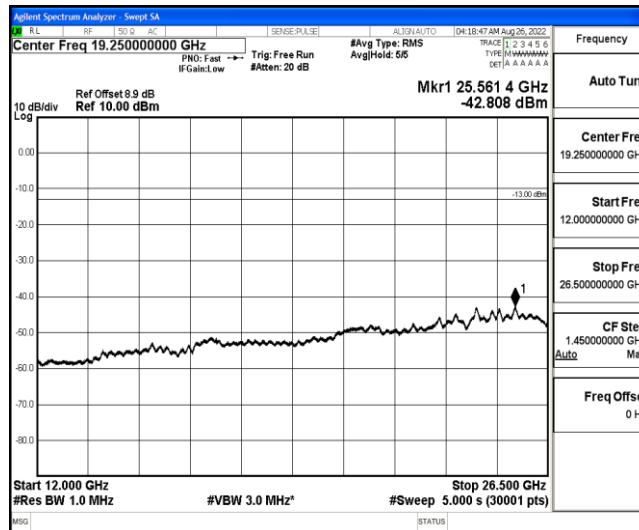

Band2-1.4MHz-QPSK-18607-1-0-Low-12000-26500--42.81-PASS

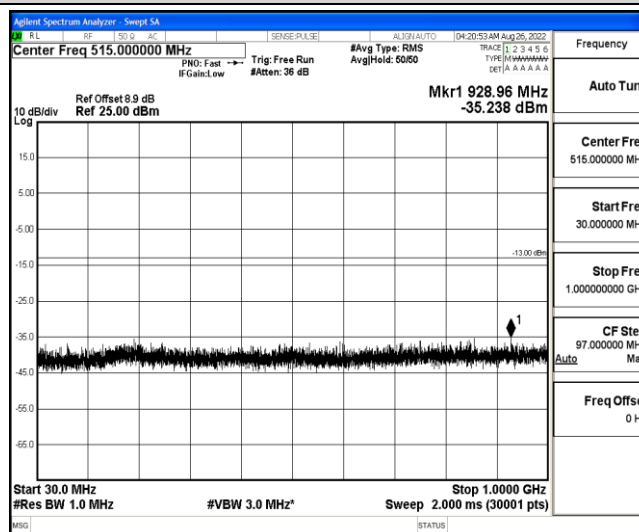

Band2-1.4MHz-QPSK-18900-1-0-Low-30-1000--35.24-PASS




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity

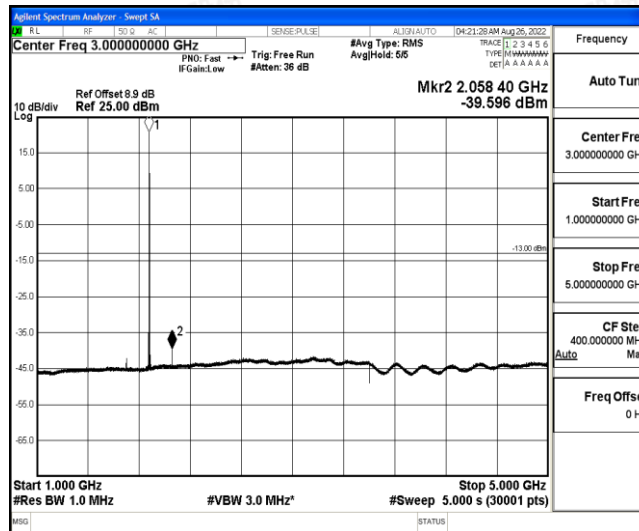

Band2-1.4MHz-QPSK-18900-1-0-Low-1000-5000--39.6-PASS

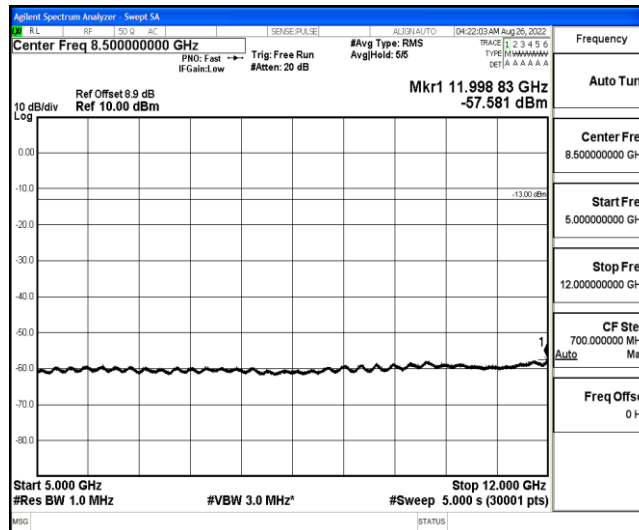


Band2-1.4MHz-QPSK-18900-1-0-Low-5000-12000--57.58-PASS

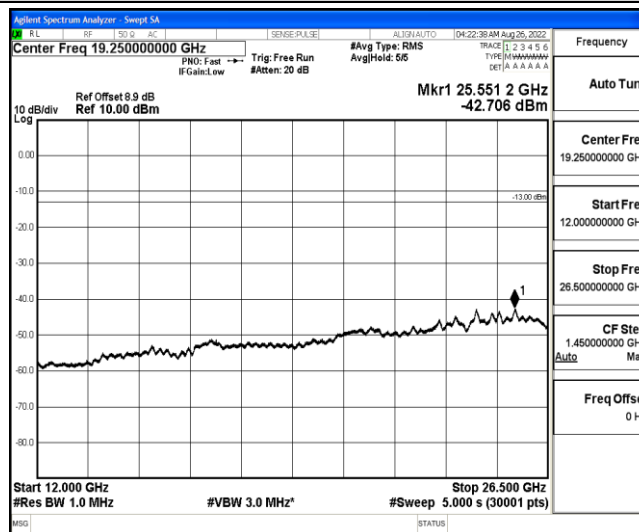


Band2-1.4MHz-QPSK-18900-1-0-Low-12000-26500--42.71-PASS




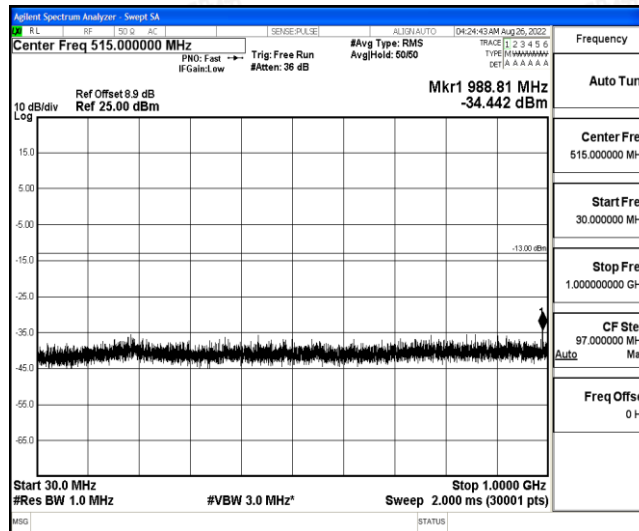

Band2-1.4MHz-QPSK-19193-1-0-High-30-1000--34.44-PASS

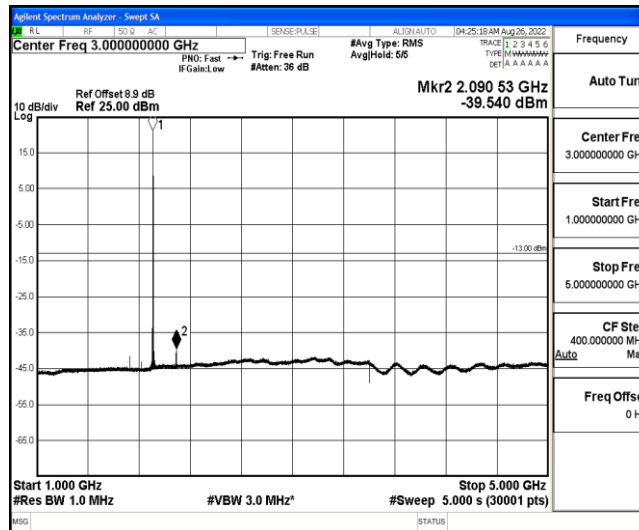

Band2-1.4MHz-QPSK-19193-1-0-High-1000-5000--39.54-PASS

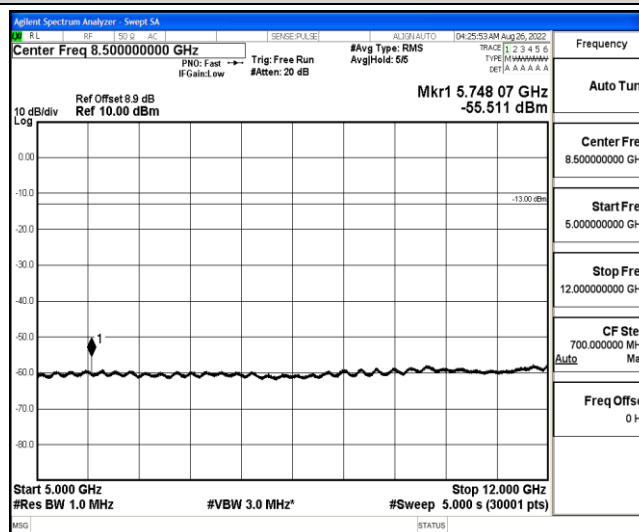

Band2-1.4MHz-QPSK-19193-1-0-High-5000-12000--55.51-PASS




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity

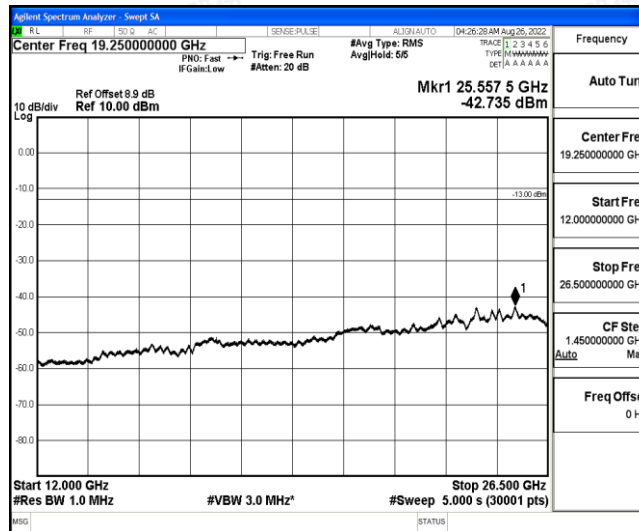

Band2-1.4MHz-QPSK-19193-1-0-High-12000-26500--42.74-PASS

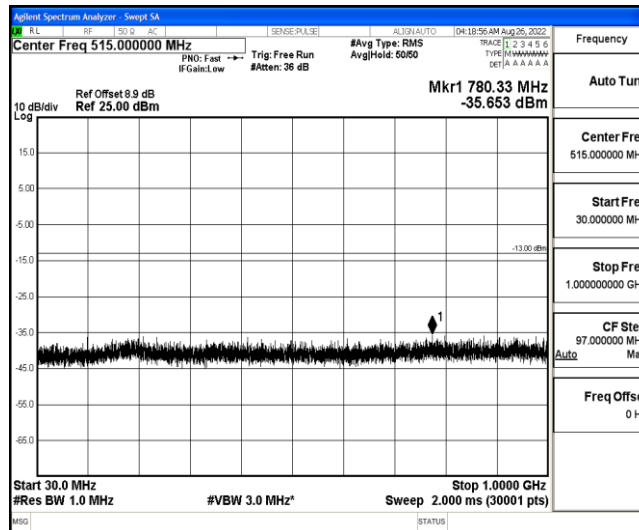

Band2-1.4MHz-16QAM-18607-1-0-Low-30-1000--35.65-PASS

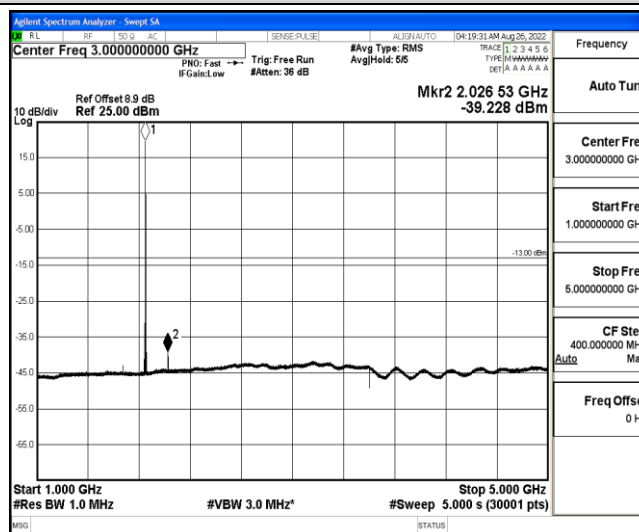

Band2-1.4MHz-16QAM-18607-1-0-Low-1000-5000--39.23-PASS




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity

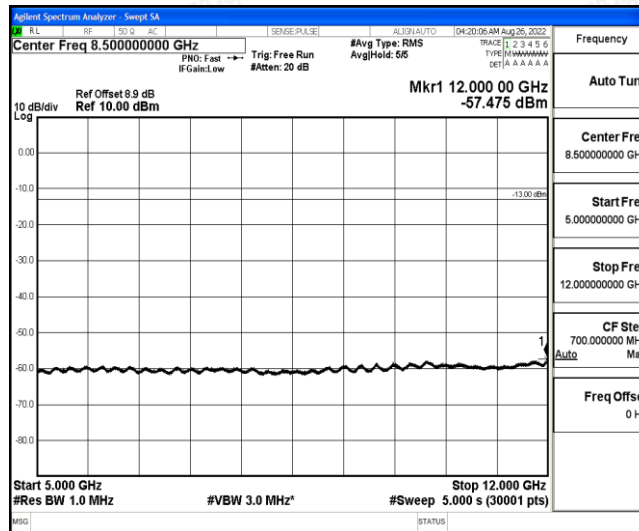

Band2-1.4MHz-16QAM-18607-1-0-Low-5000-12000--57.48-PASS

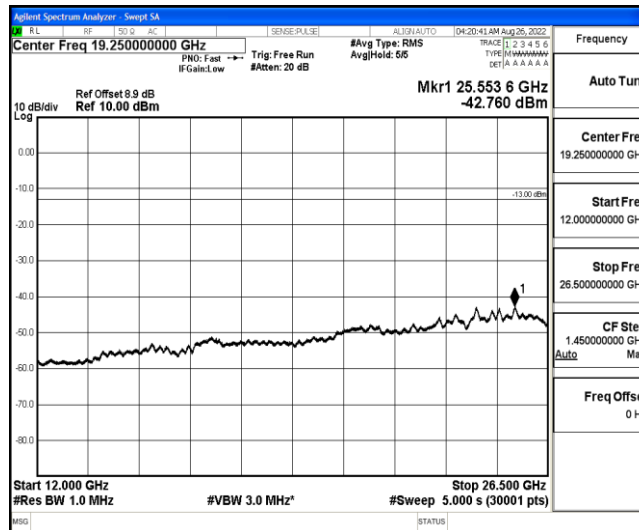

Band2-1.4MHz-16QAM-18607-1-0-Low-12000-26500--42.76-PASS

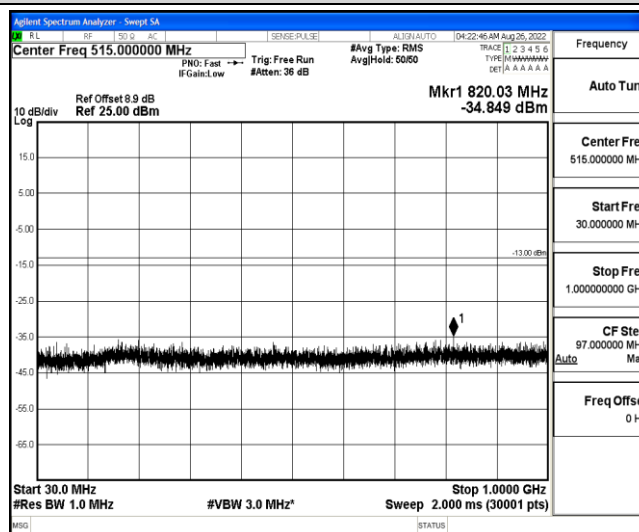

Band2-1.4MHz-16QAM-18900-1-0-Low-30-1000--34.85-PASS




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity

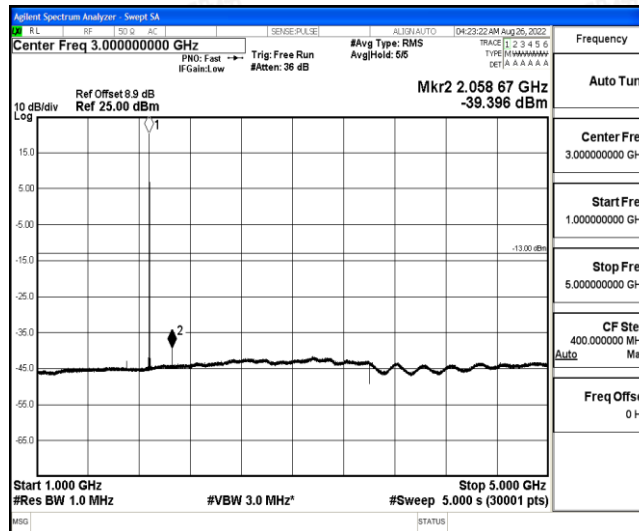

Band2-1.4MHz-16QAM-18900-1-0-Low-1000-5000--39.4-PASS

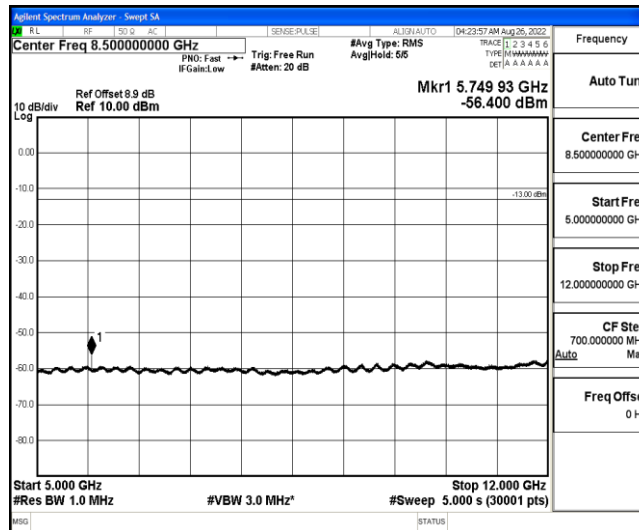


Band2-1.4MHz-16QAM-18900-1-0-Low-5000-12000--56.4-PASS

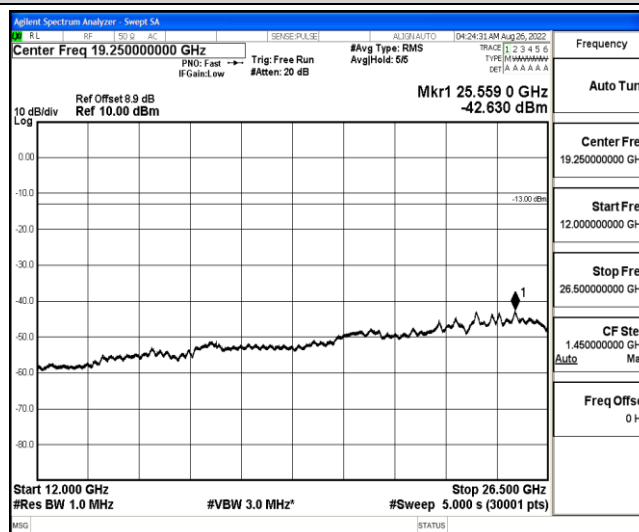


Band2-1.4MHz-16QAM-18900-1-0-Low-12000-26500--42.63-PASS




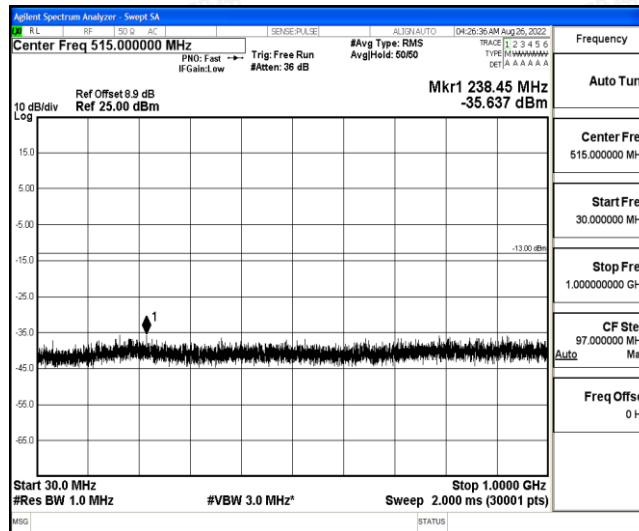

Band2-1.4MHz-16QAM-19193-1-0-High-30-1000--35.64-PASS

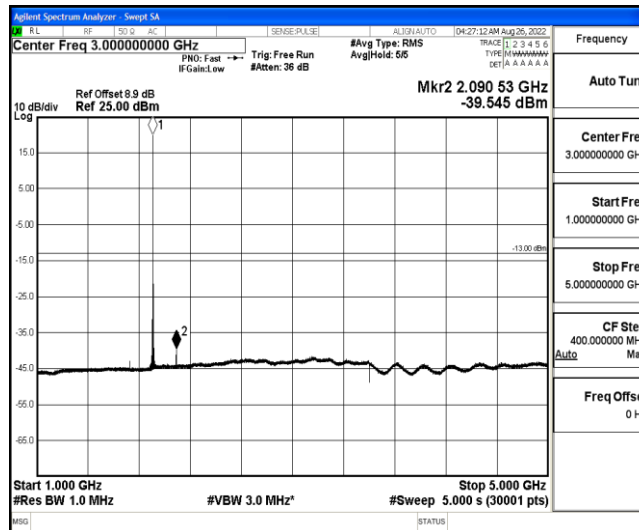

Band2-1.4MHz-16QAM-19193-1-0-High-1000-5000--39.55-PASS

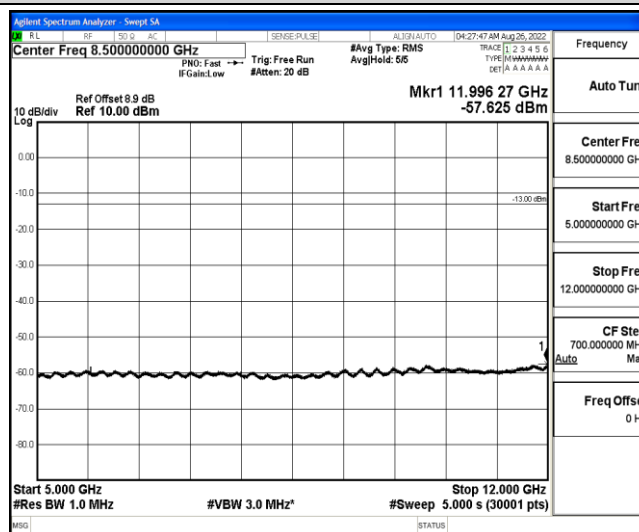

Band2-1.4MHz-16QAM-19193-1-0-High-5000-12000--57.63-PASS




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity

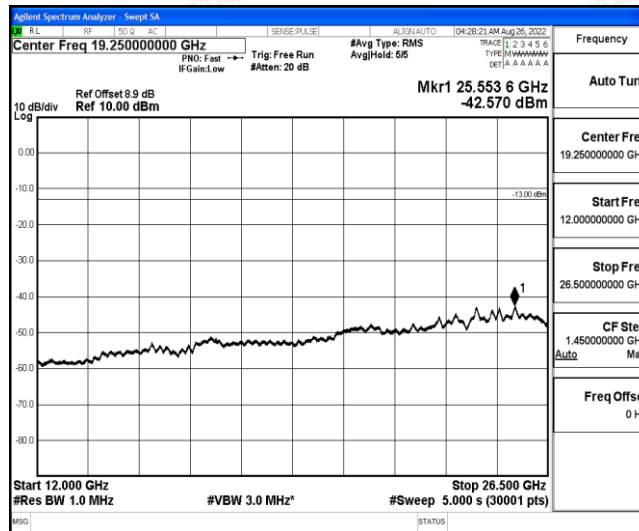

Band2-1.4MHz-16QAM-19193-1-0-High-12000-26500--42.57-PASS

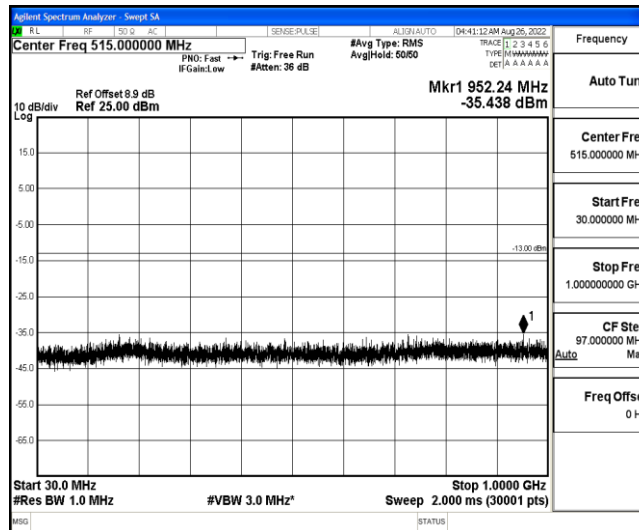


Band2-3MHz-QPSK-18615-1-0-Low-30-1000--35.44-PASS

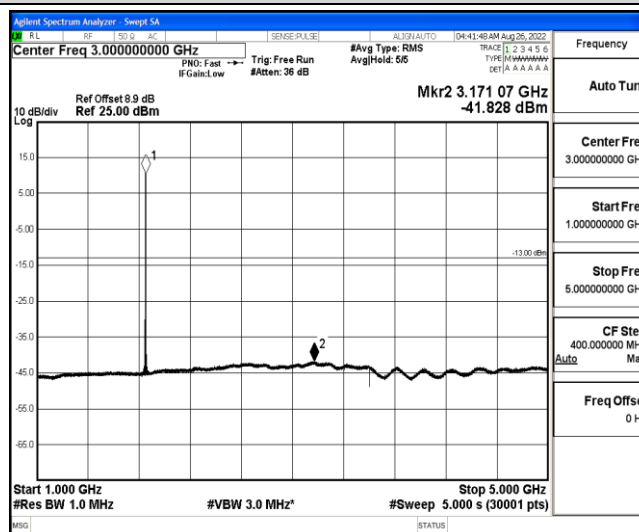


Band2-3MHz-QPSK-18615-1-0-Low-1000-5000--41.83-PASS




Shenzhen LCS Compliance Testing Laboratory Ltd.
Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China
Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com
Scan code to check authenticity

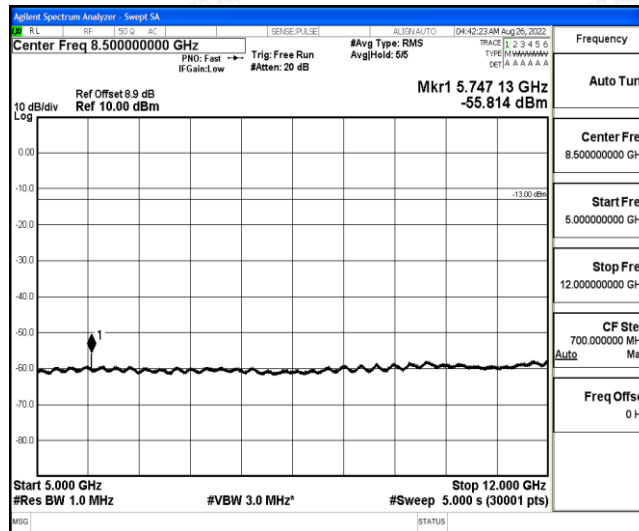

Band2-3MHz-QPSK-18615-1-0-Low-5000-12000--55.81-PASS

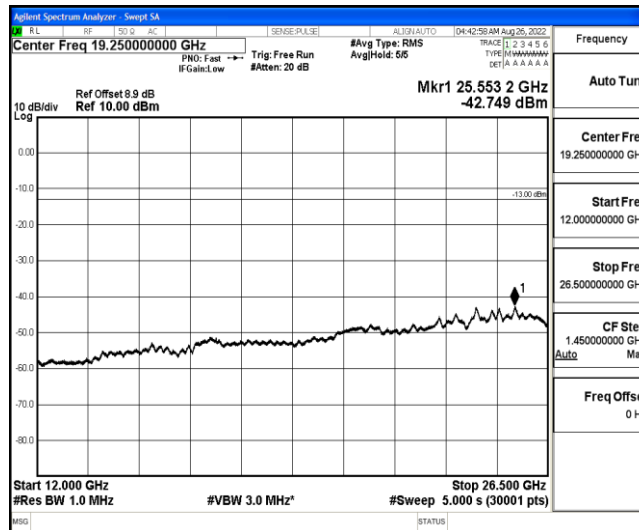

Band2-3MHz-QPSK-18615-1-0-Low-12000-26500--42.75-PASS

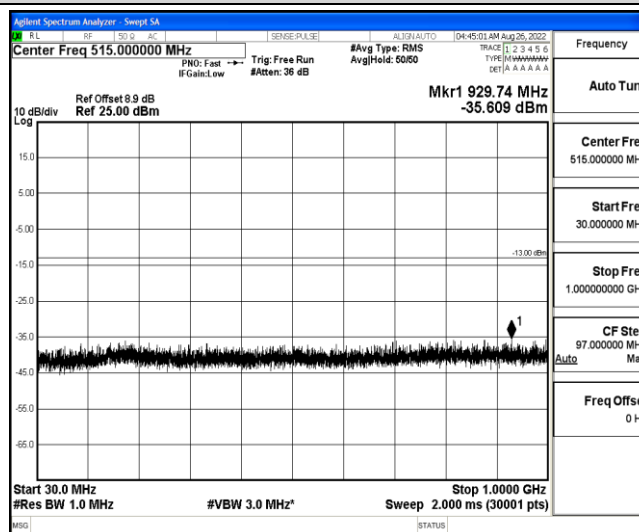

Band2-3MHz-QPSK-18900-1-0-Low-30-1000--35.61-PASS




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity

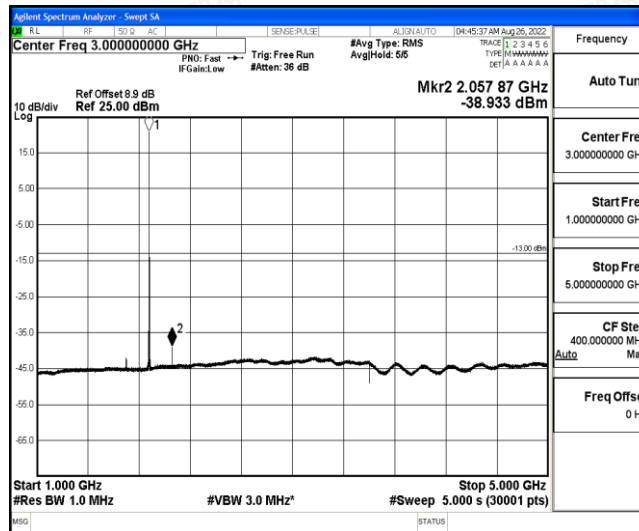

Band2-3MHz-QPSK-18900-1-0-Low-1000-5000--38.93-PASS

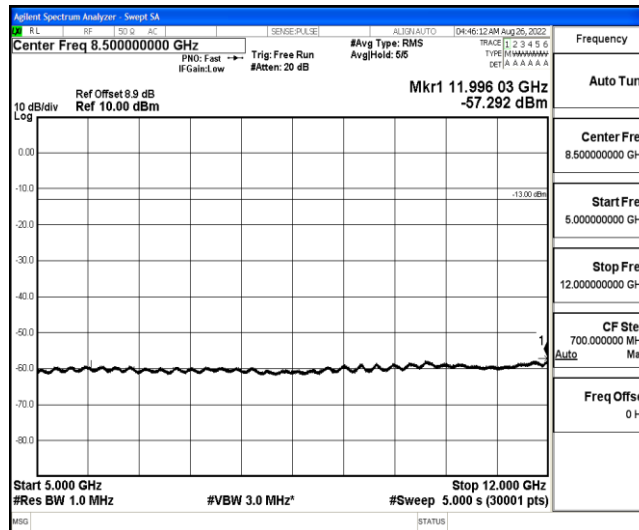

Band2-3MHz-QPSK-18900-1-0-Low-5000-12000--57.29-PASS

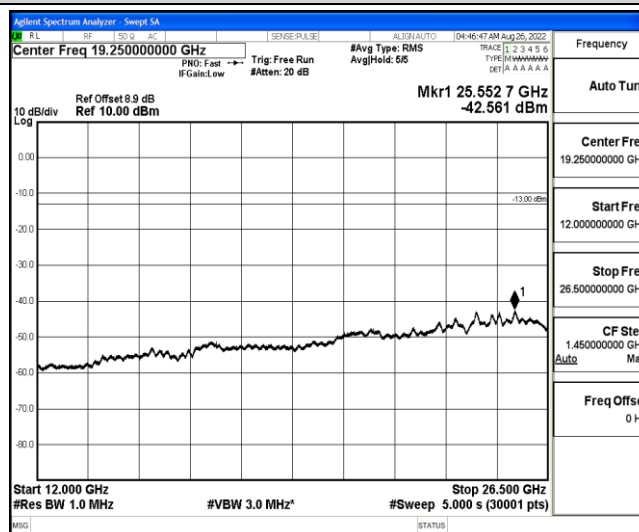

Band2-3MHz-QPSK-18900-1-0-Low-12000-26500--42.56-PASS

