




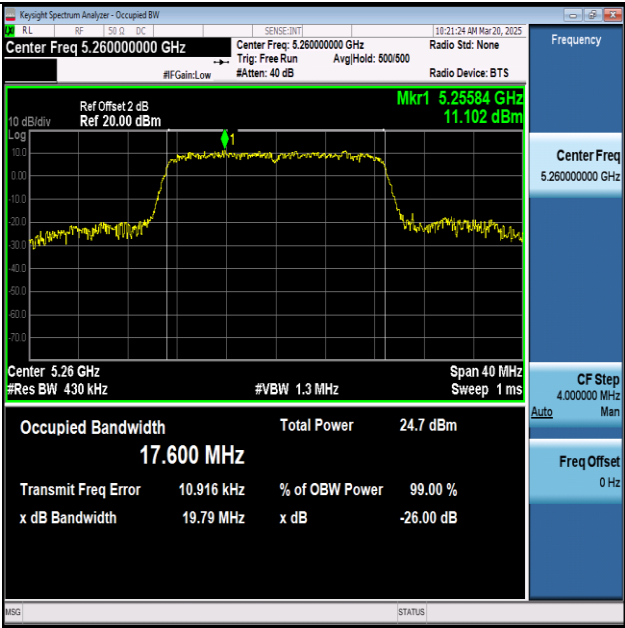


11AC20SISO-Ant1-5260

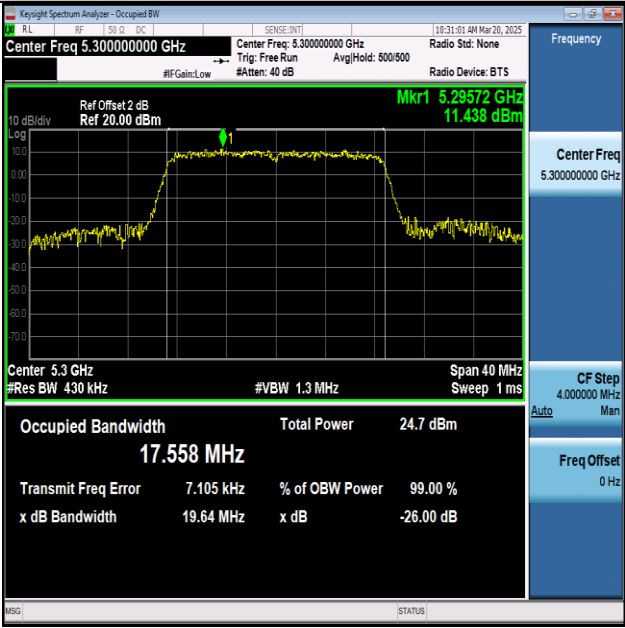


11AC20SISO-Ant1-5300

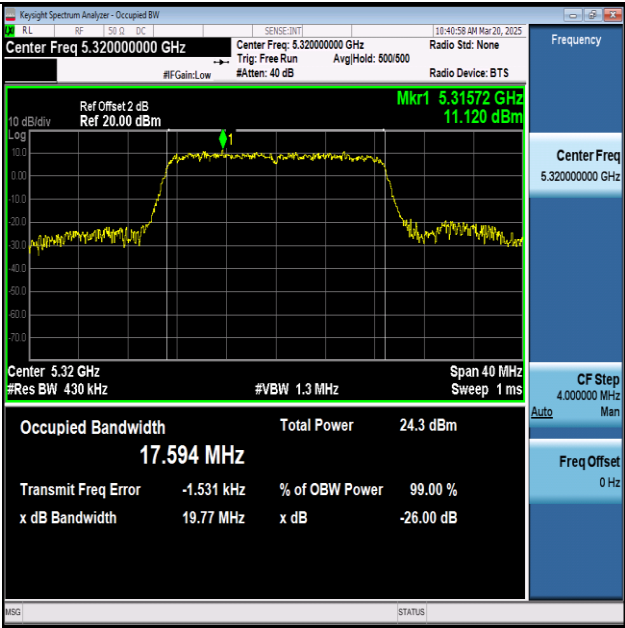


11AC20SISO-Ant1-5320

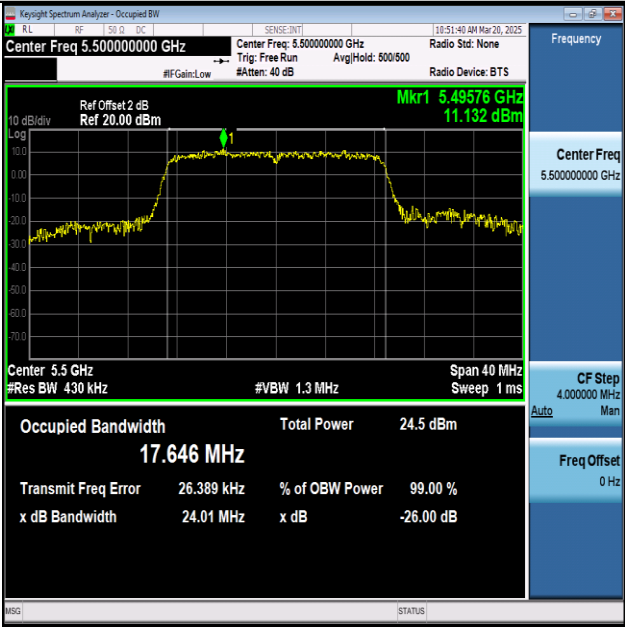


11AC20SISO-Ant1-5500

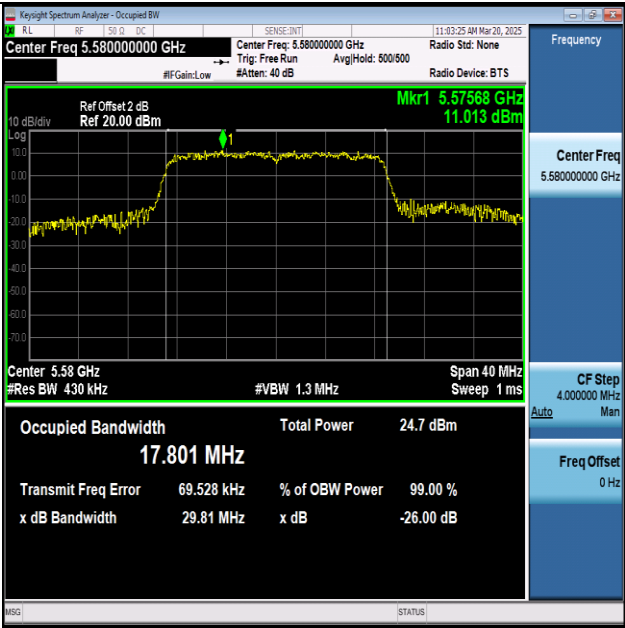


11AC20SISO-Ant1-5580

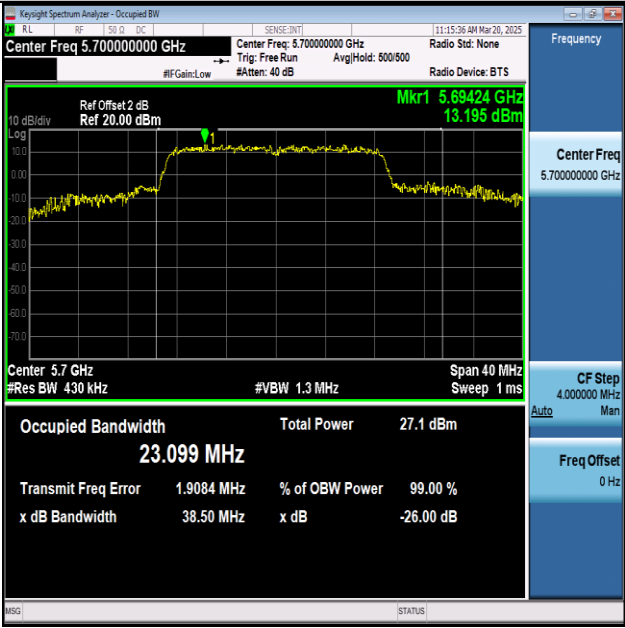


11AC20SISO-Ant1-5700

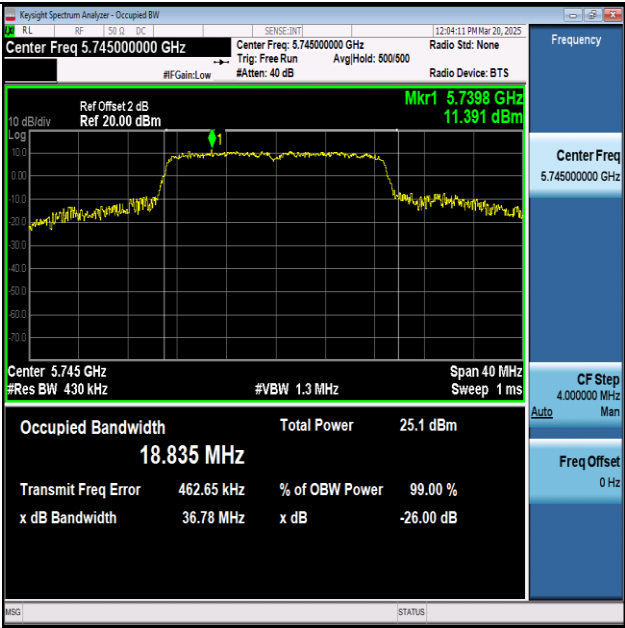


11AC20SISO-Ant1-5745

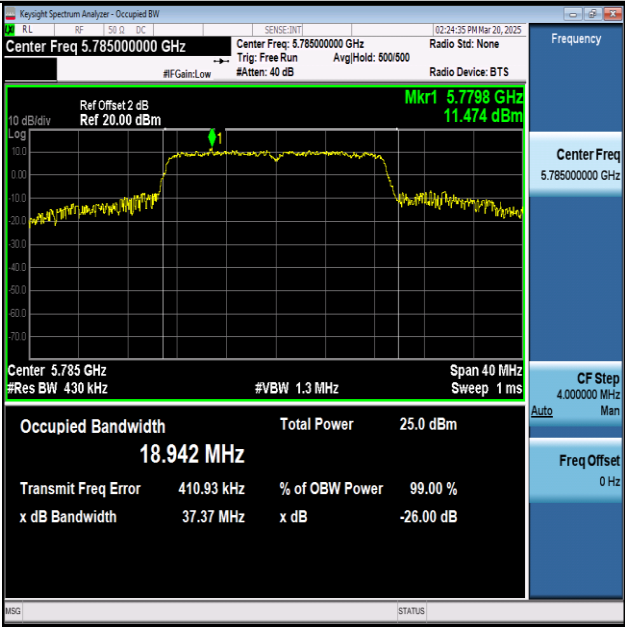


11AC20SISO-Ant1-5785

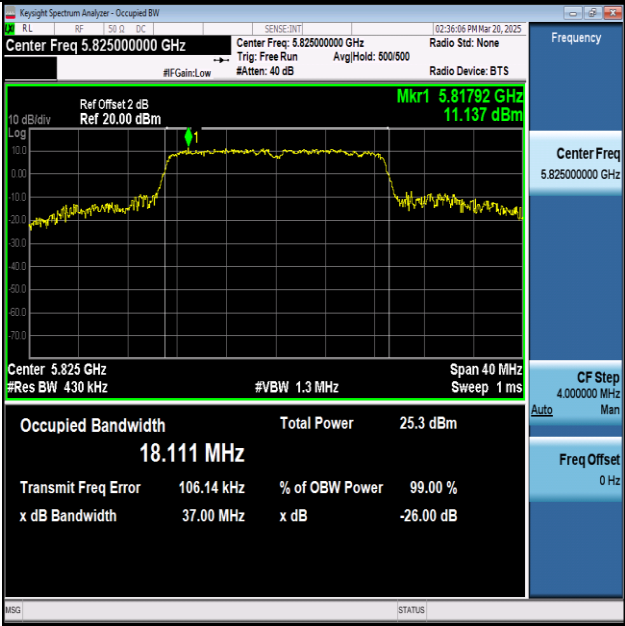


11AC20SISO-Ant1-5825

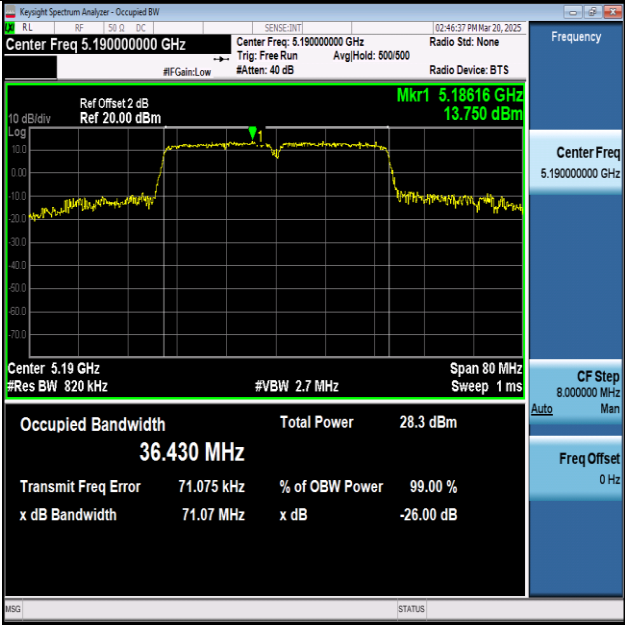


11AC40SISO-Ant1-5190

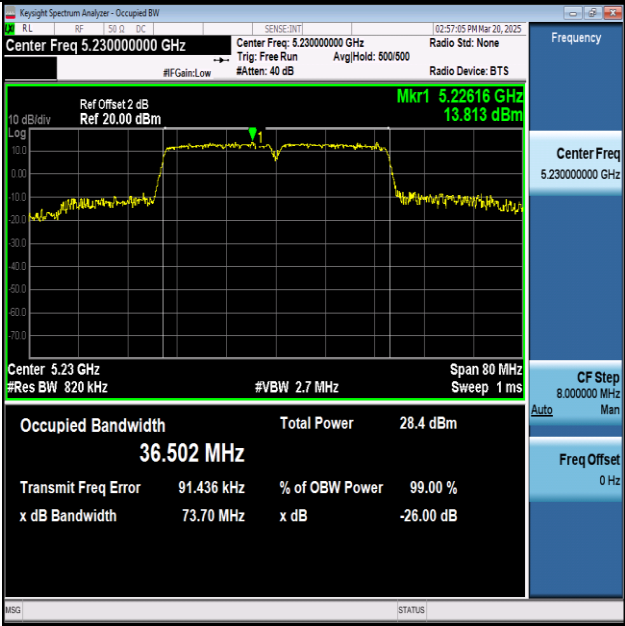


11AC40SISO-Ant1-5230

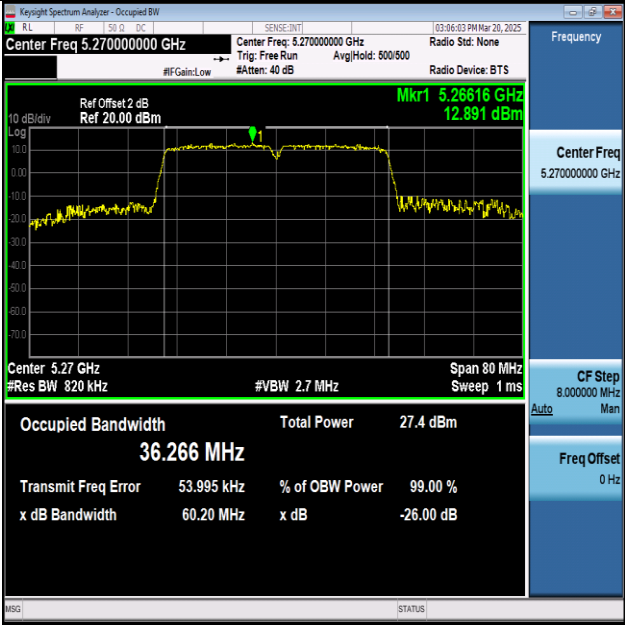


11AC40SISO-Ant1-5270

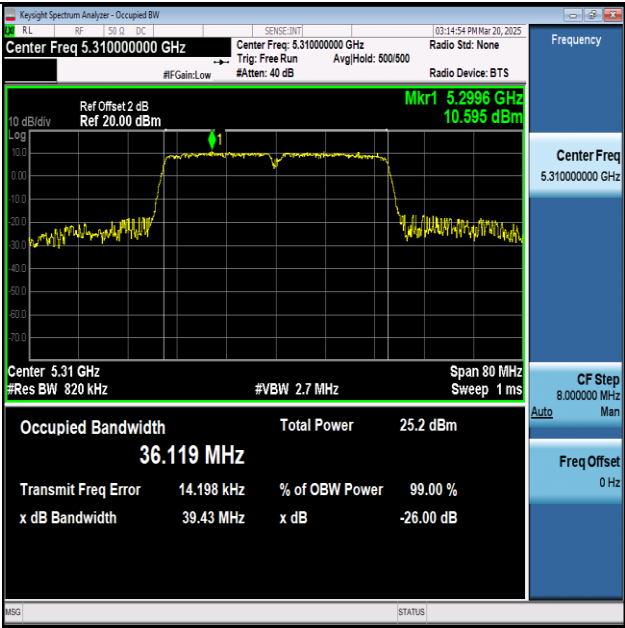


11AC40SISO-Ant1-5310

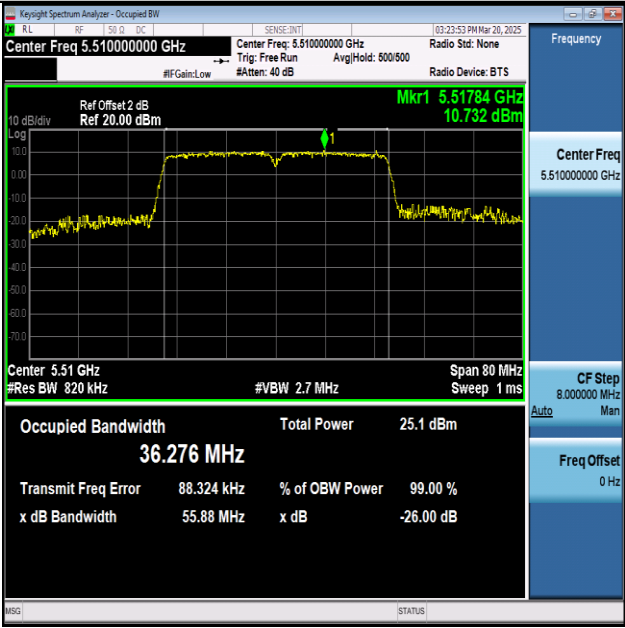


11AC40SISO-Ant1-5510

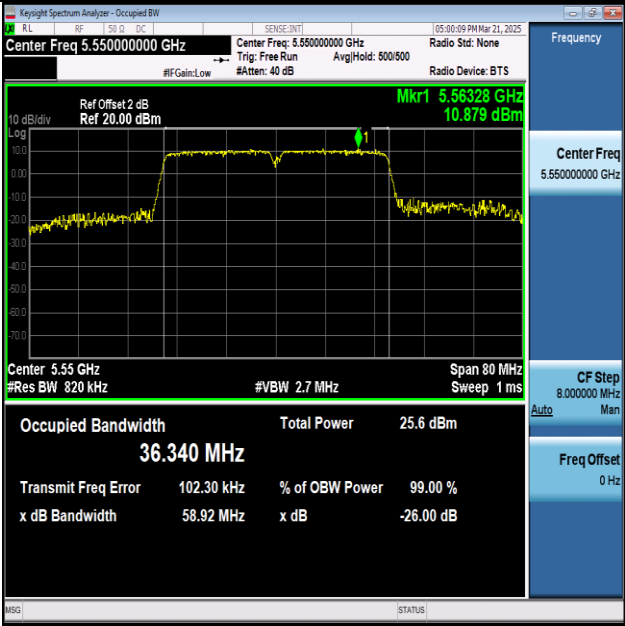


11AC40SISO-Ant1-5550

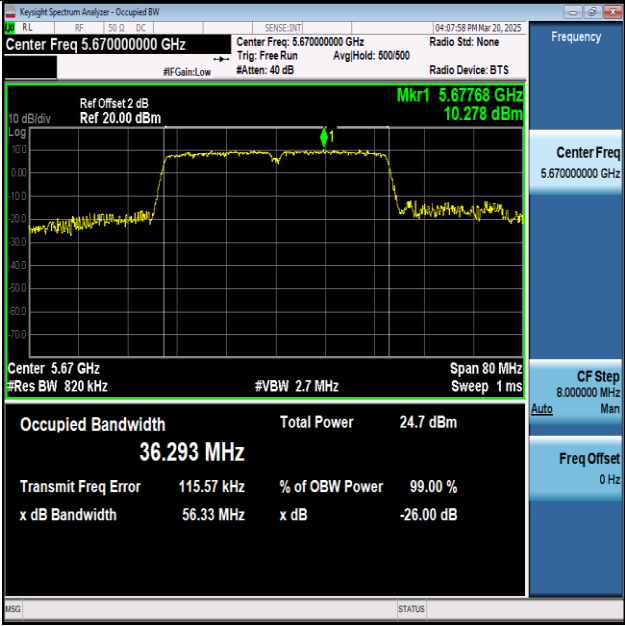


11AC40SISO-Ant1-5670

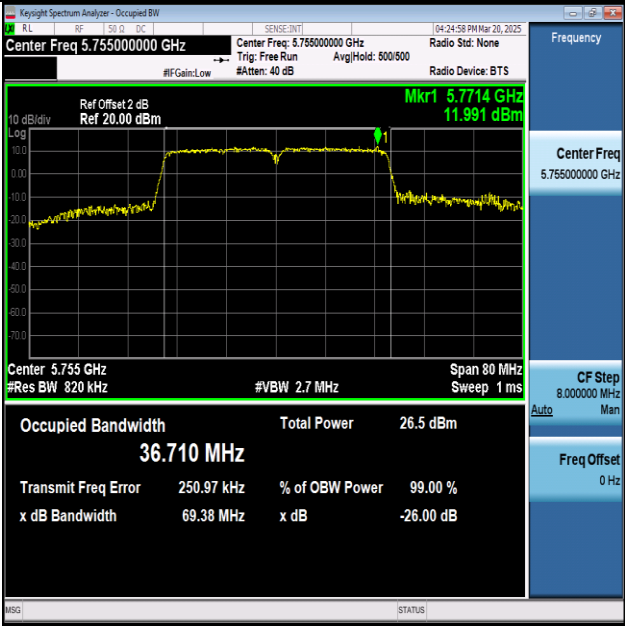


11AC40SISO-Ant1-5755

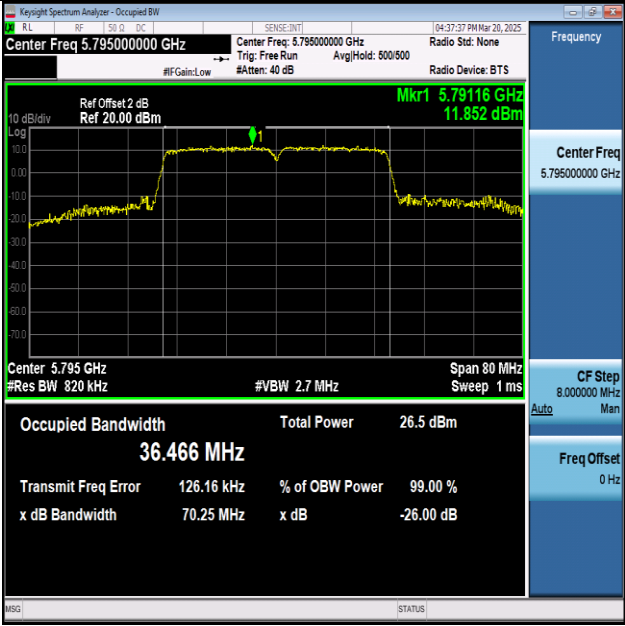


11AC40SISO-Ant1-5795

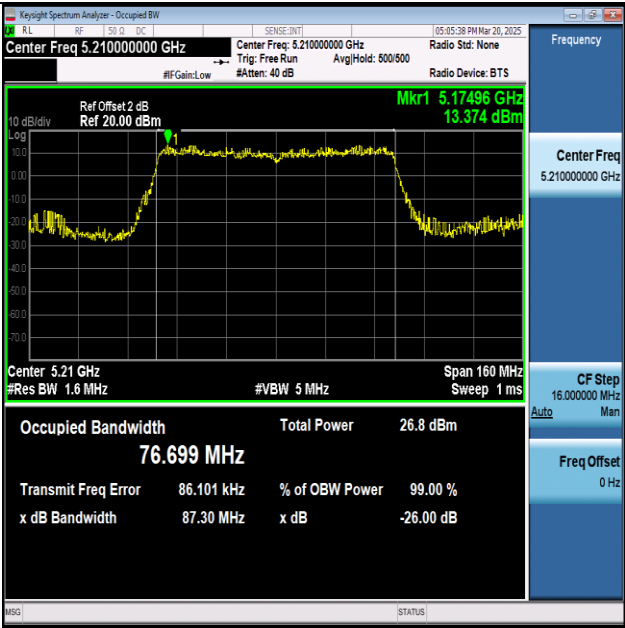


11AC80SISO-Ant1-5210

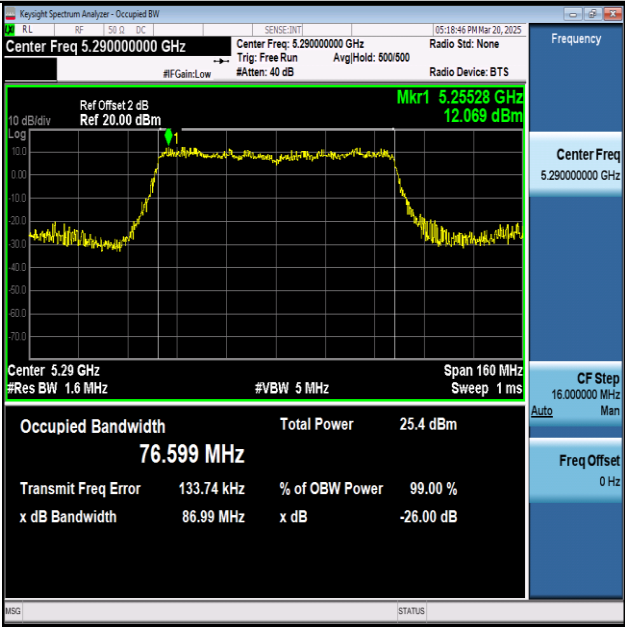


11AC80SISO-Ant1-5290

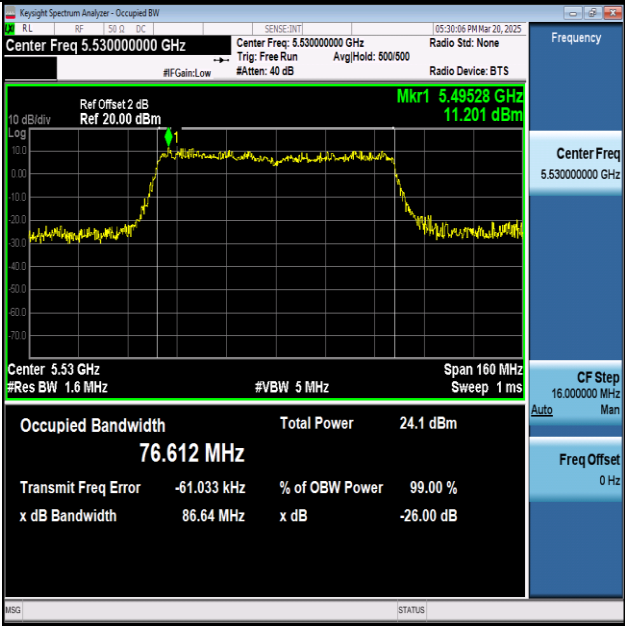


11AC80SISO-Ant1-5530

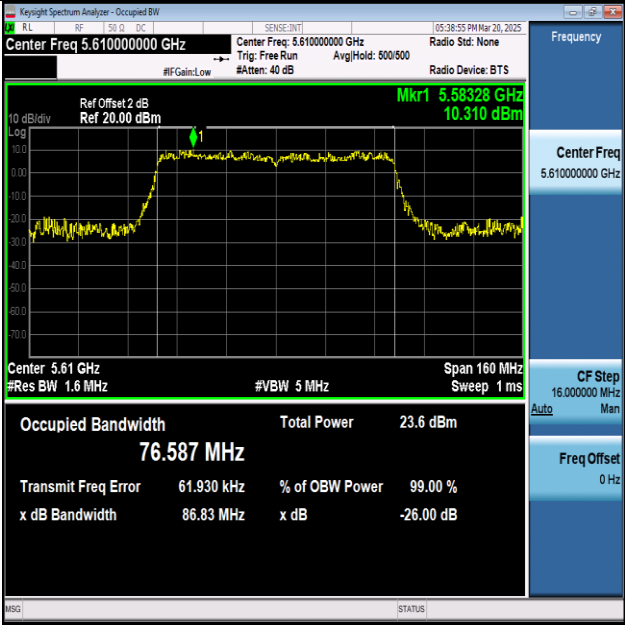


11AC80SISO-Ant1-5610

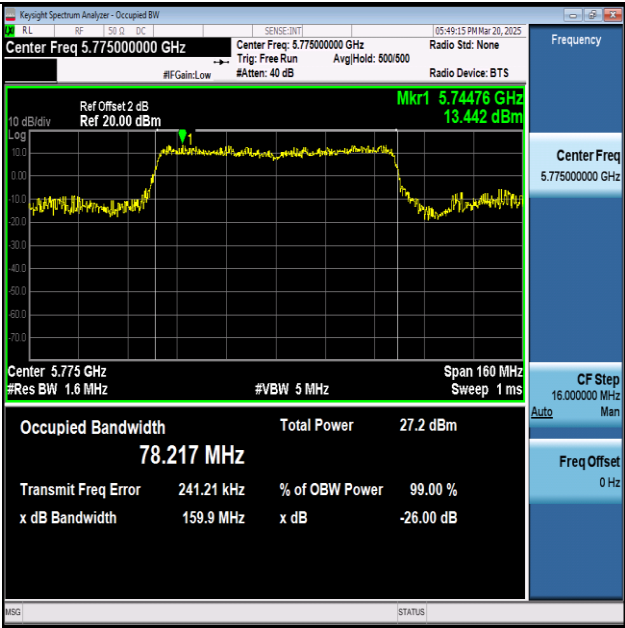


11AC80SISO-Ant1-5775

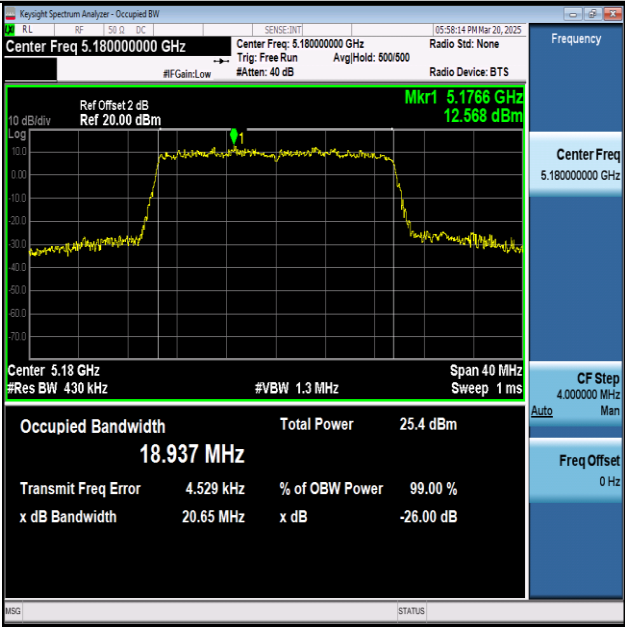


11AX20SISO-Ant1-5180

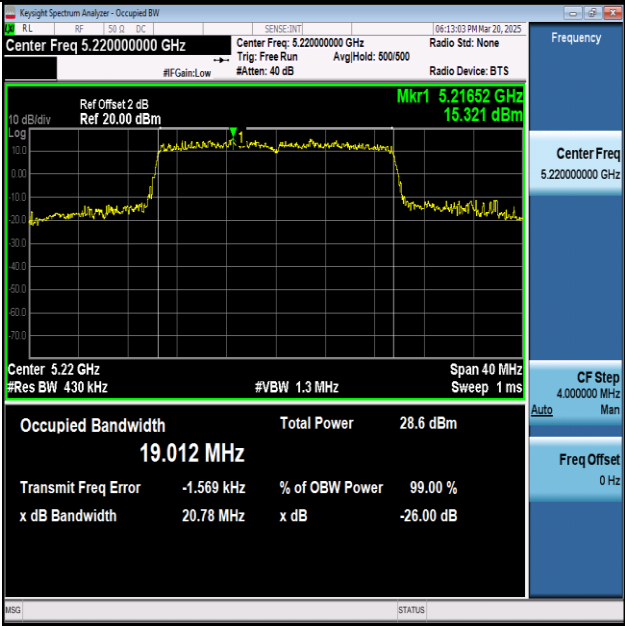


11AX20SISO-Ant1-5220

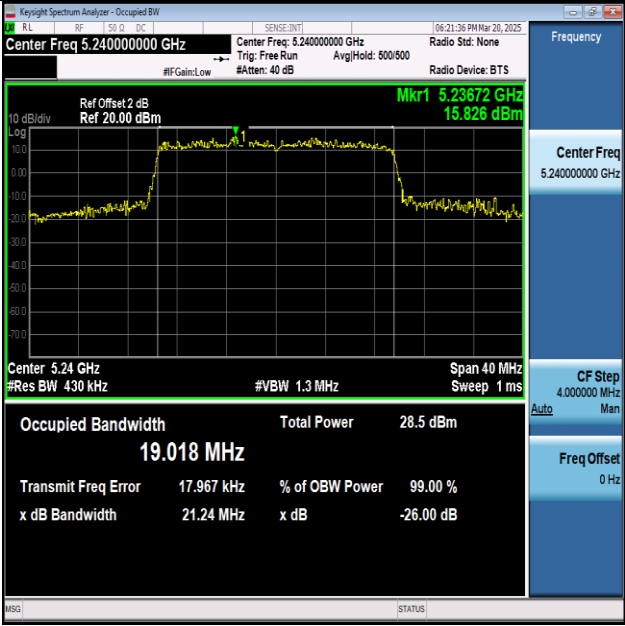


11AX20SISO-Ant1-5240

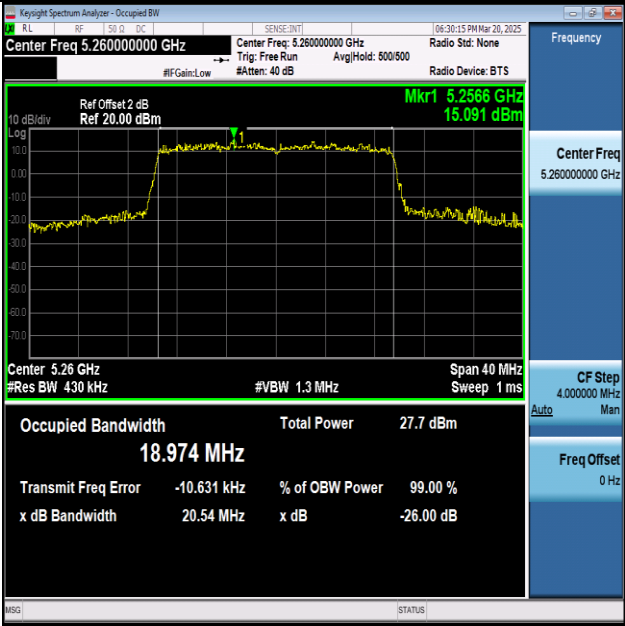


11AX20SISO-Ant1-5260

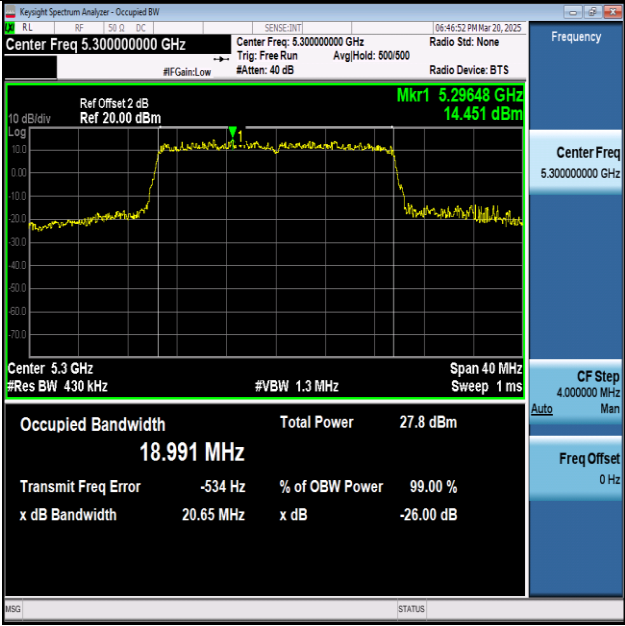


11AX20SISO-Ant1-5300

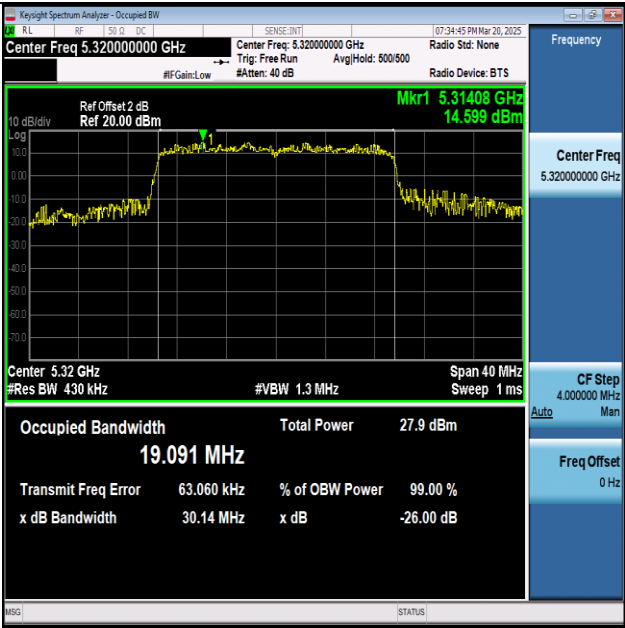


11AX20SISO-Ant1-5320

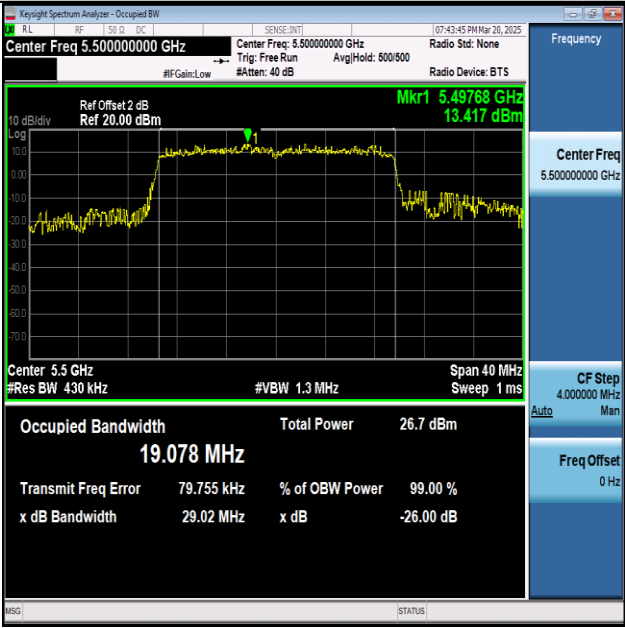


11AX20SISO-Ant1-5500

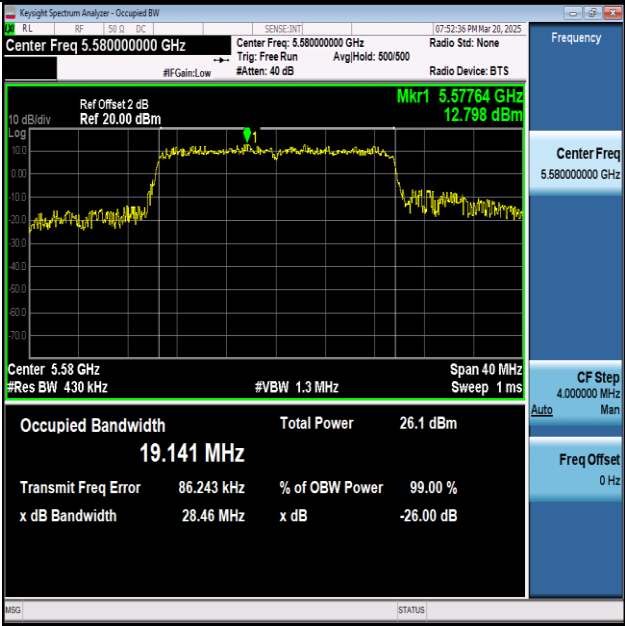


11AX20SISO-Ant1-5580

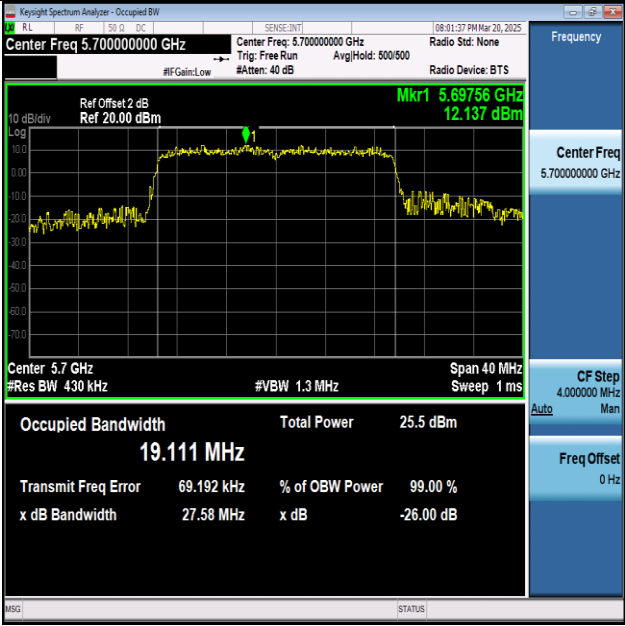


11AX20SISO-Ant1-5700

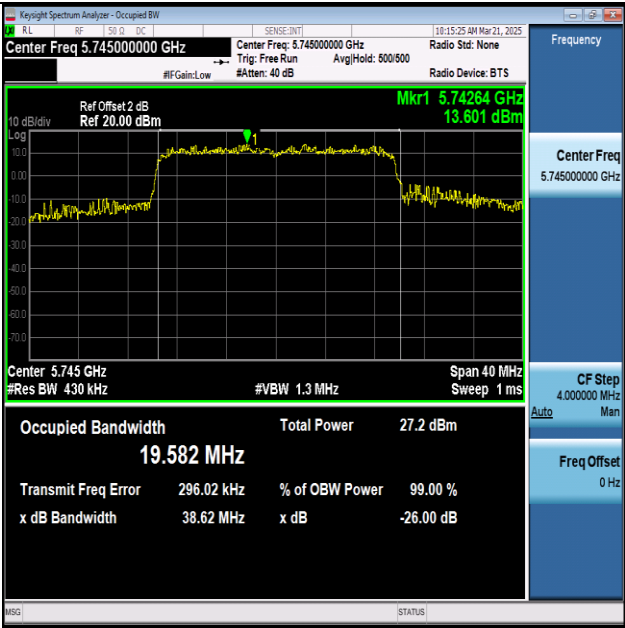


11AX20SISO-Ant1-5745

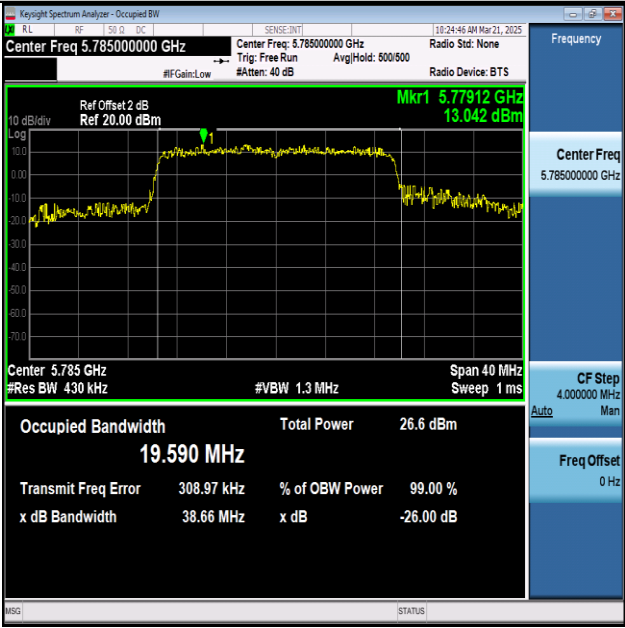


11AX20SISO-Ant1-5785

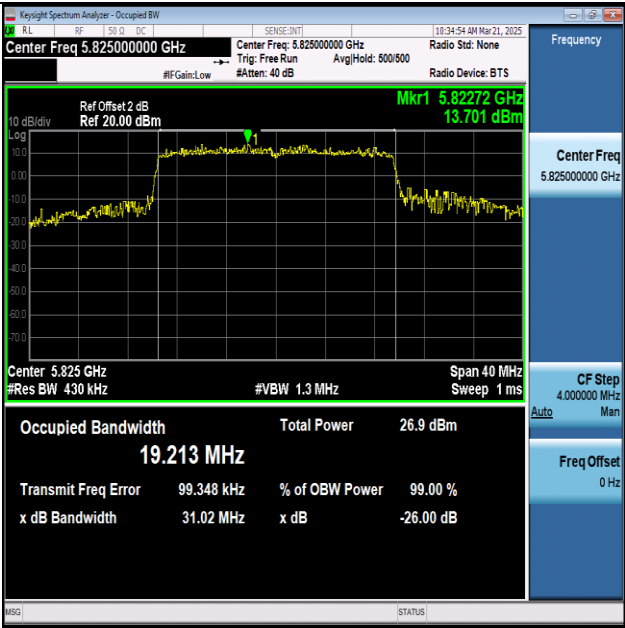


11AX20SISO-Ant1-5825

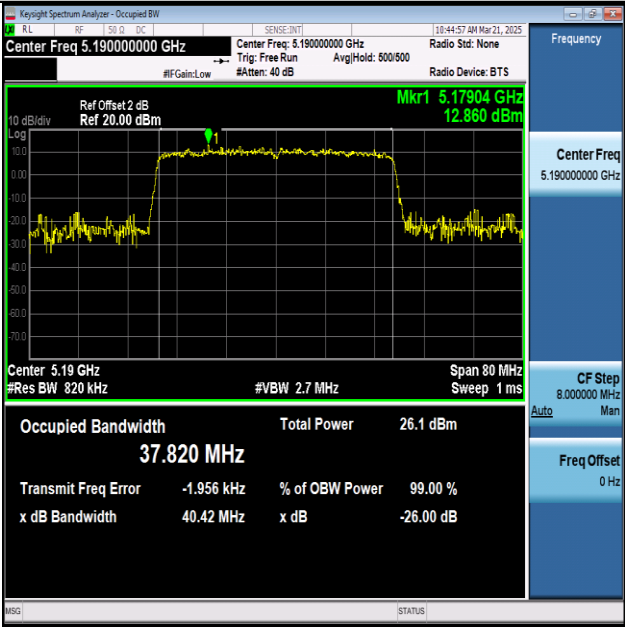


11AX40SISO-Ant1-5190

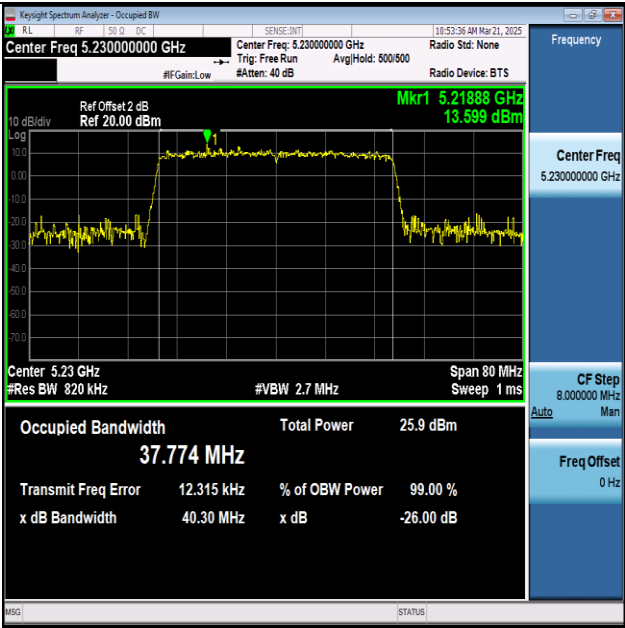


11AX40SISO-Ant1-5230

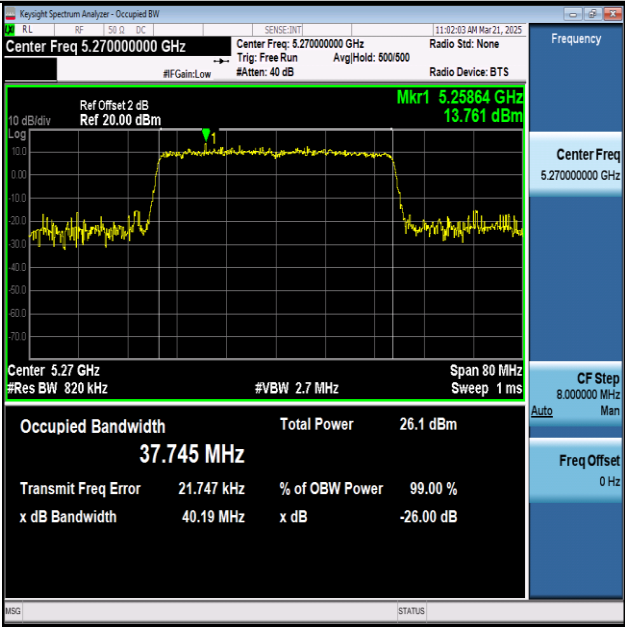


11AX40SISO-Ant1-5270

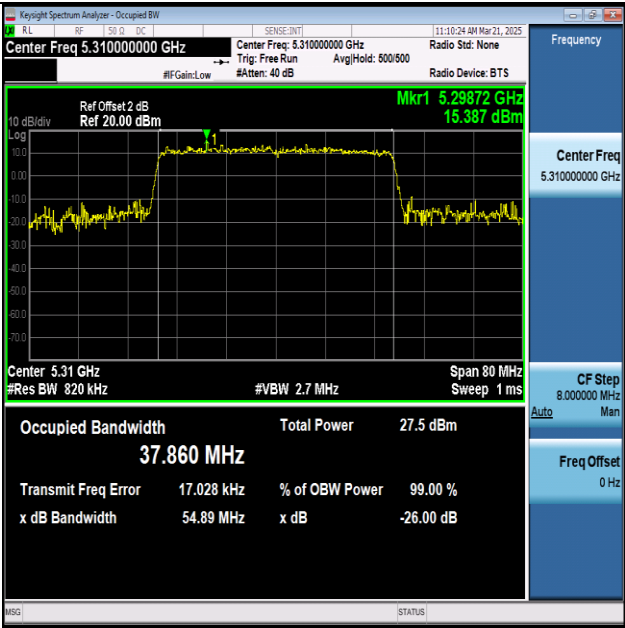


11AX40SISO-Ant1-5310

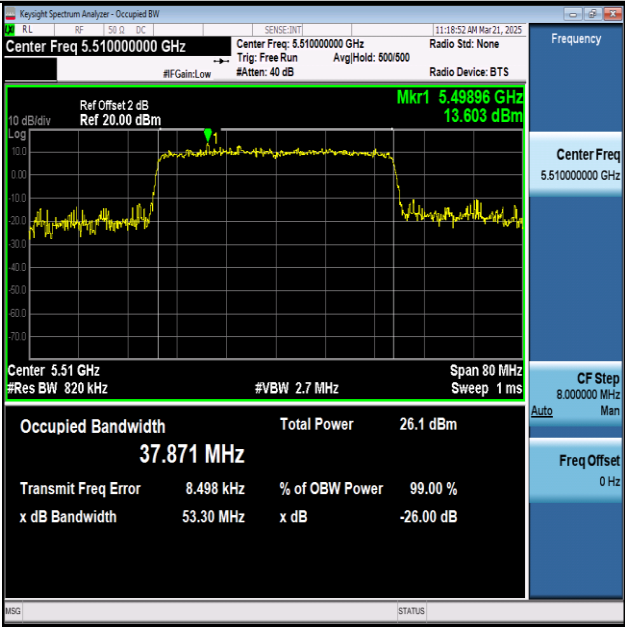


11AX40SISO-Ant1-5510

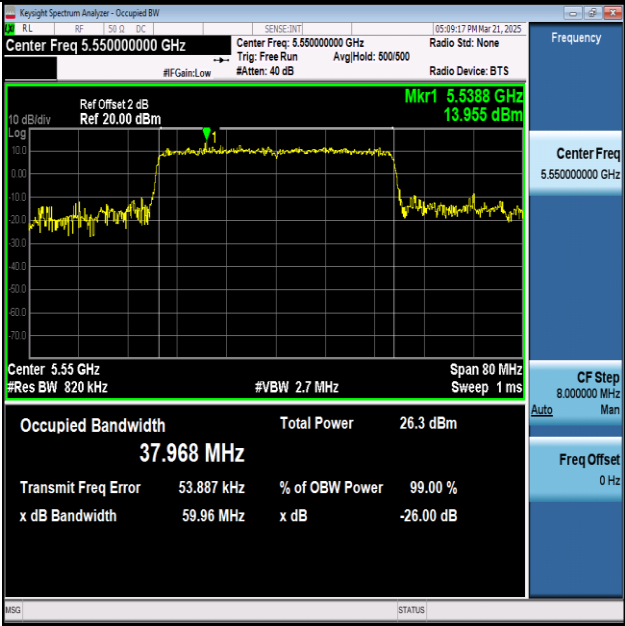


11AX40SISO-Ant1-5550

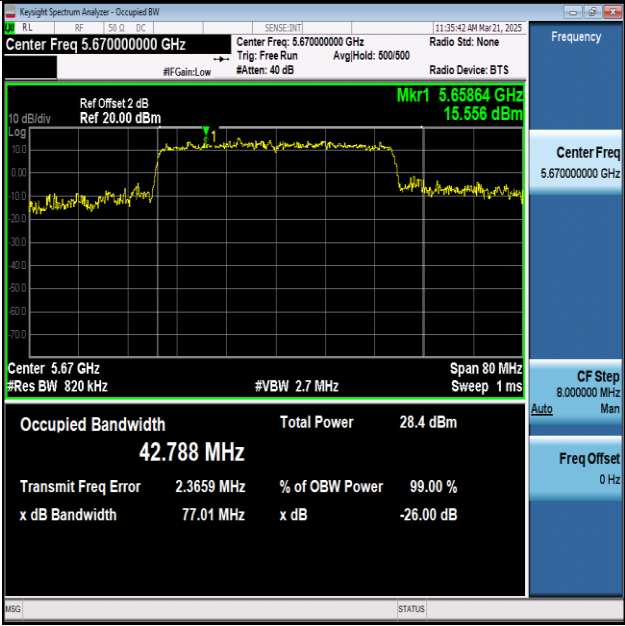


11AX40SISO-Ant1-5670

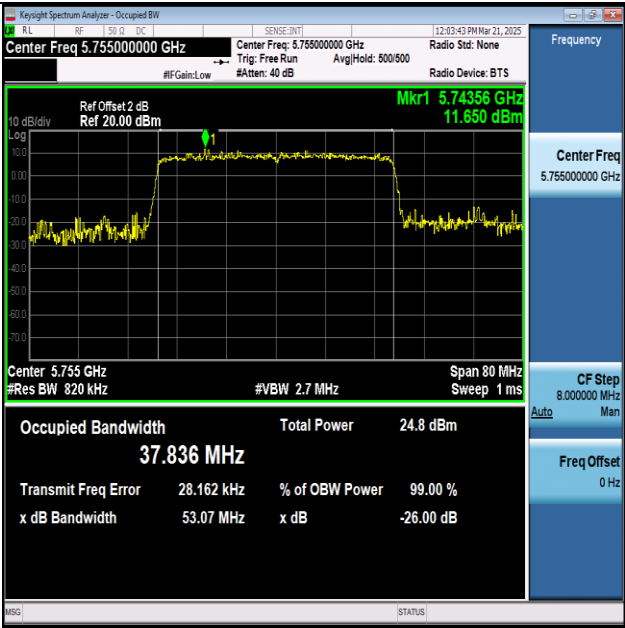


11AX40SISO-Ant1-5755

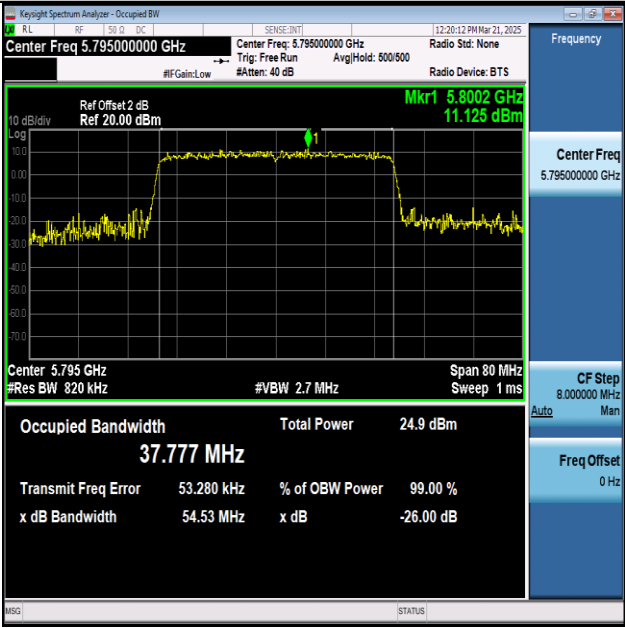


11AX40SISO-Ant1-5795

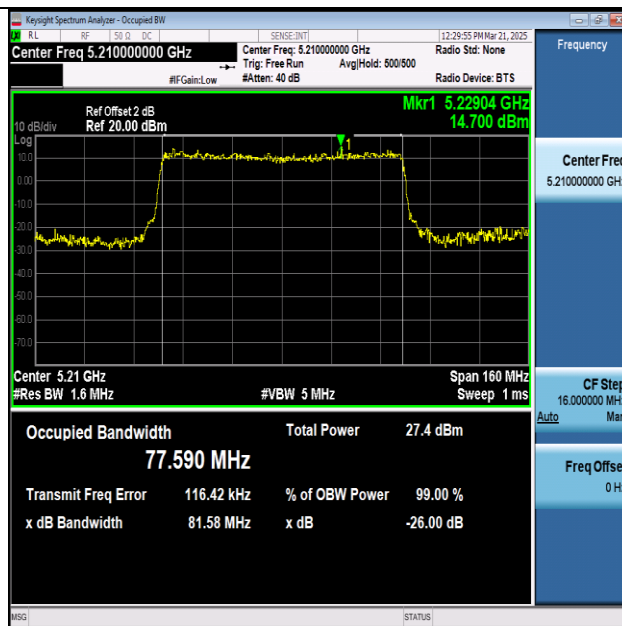


11AX80SISO-Ant1-5210

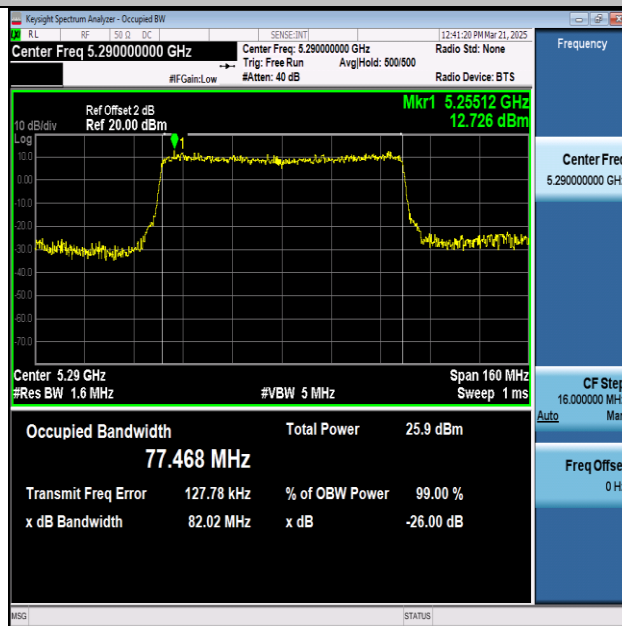


11AX80SISO-Ant1-5290

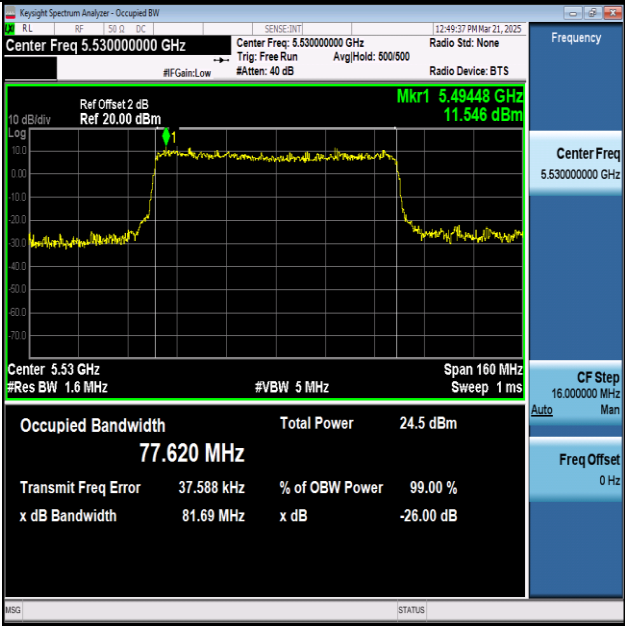

11AX80SISO-Ant1-5530

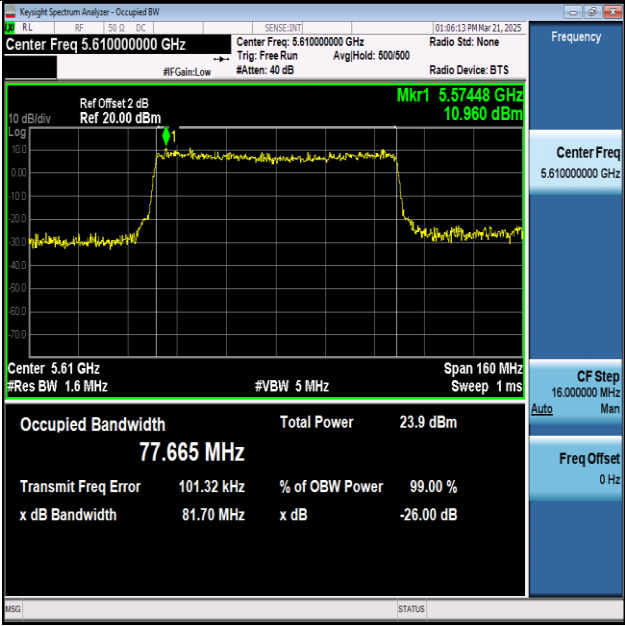

11AX80SISO-Ant1-5610

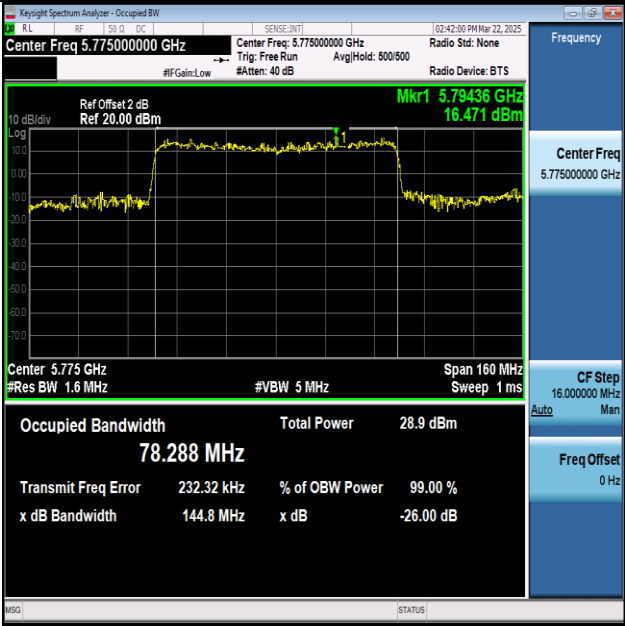


11AX80SISO-Ant1-5775


Appendix C: 6dB Emission Bandwidth

TestMode	Antenna	Frequency[MHz]	6db EBW [MHz]	FL[MHz]	FH[MHz]	Limit[MHz]	Verdict
11A	Ant1	5745	16.080	5737.080	5753.160	0.5	PASS
11A	Ant1	5785	15.640	5777.120	5792.760	0.5	PASS
11A	Ant1	5825	16.000	5817.120	5833.120	0.5	PASS
11N20SISO	Ant1	5745	16.880	5736.480	5753.360	0.5	PASS
11N20SISO	Ant1	5785	17.480	5776.280	5793.760	0.5	PASS
11N20SISO	Ant1	5825	17.200	5816.560	5833.760	0.5	PASS
11N40SISO	Ant1	5755	35.520	5737.240	5772.760	0.5	PASS
11N40SISO	Ant1	5795	34.800	5777.720	5812.520	0.5	PASS
11AC20SISO	Ant1	5745	17.080	5736.480	5753.560	0.5	PASS
11AC20SISO	Ant1	5785	17.000	5776.480	5793.480	0.5	PASS
11AC20SISO	Ant1	5825	17.160	5816.240	5833.400	0.5	PASS
11AC40SISO	Ant1	5755	36.320	5736.840	5773.160	0.5	PASS
11AC40SISO	Ant1	5795	34.880	5777.880	5812.760	0.5	PASS
11AC80SISO	Ant1	5775	75.200	5737.560	5812.760	0.5	PASS
11AX20SISO	Ant1	5745	18.880	5735.560	5754.440	0.5	PASS
11AX20SISO	Ant1	5785	18.720	5775.640	5794.360	0.5	PASS
11AX20SISO	Ant1	5825	18.920	5815.520	5834.440	0.5	PASS
11AX40SISO	Ant1	5755	37.840	5736.120	5773.960	0.5	PASS
11AX40SISO	Ant1	5795	37.520	5776.200	5813.720	0.5	PASS
11AX80SISO	Ant1	5775	77.440	5736.280	5813.720	0.5	PASS


Note: We have evaluated SISO, MIMO mode, shown in the report is the worst data.

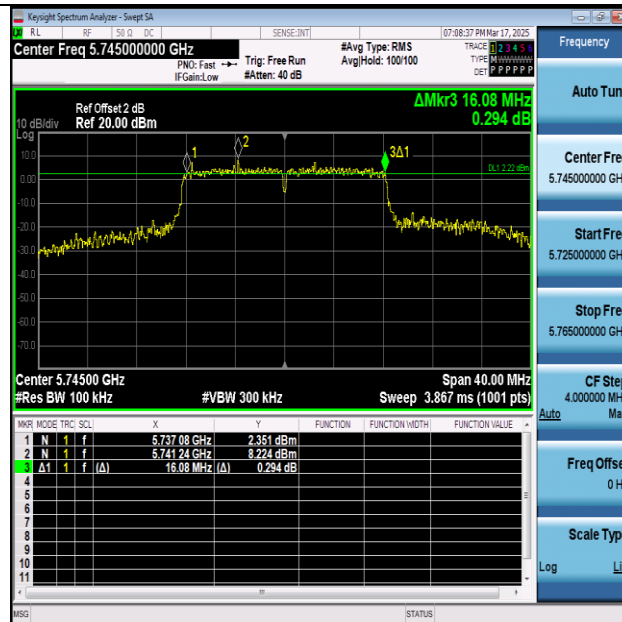


11A-Ant1-5745-PASS

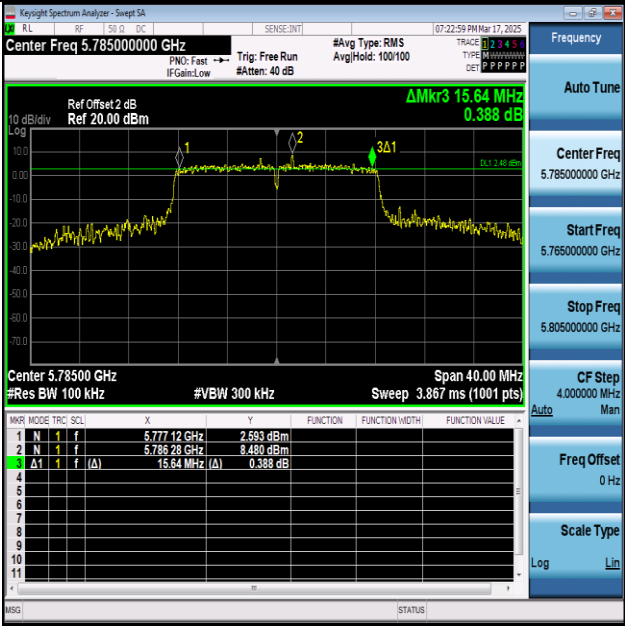


11A-Ant1-5785-PASS

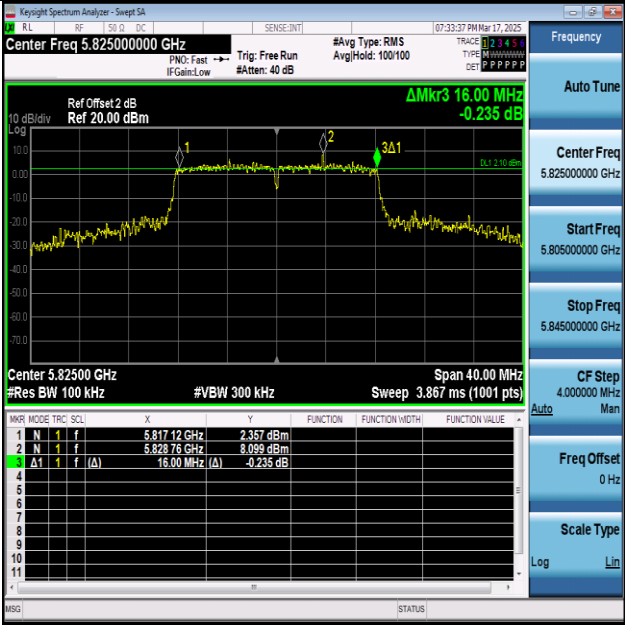


11A-Ant1-5825-PASS

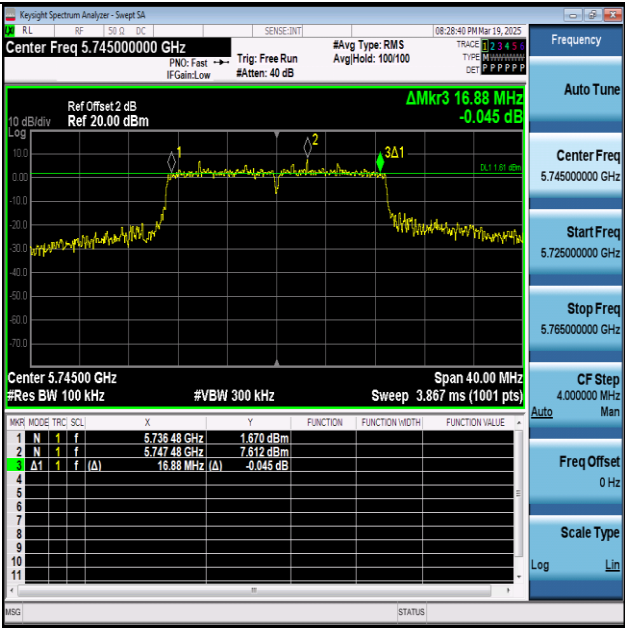


11N20SISO-Ant1-5745-PASS

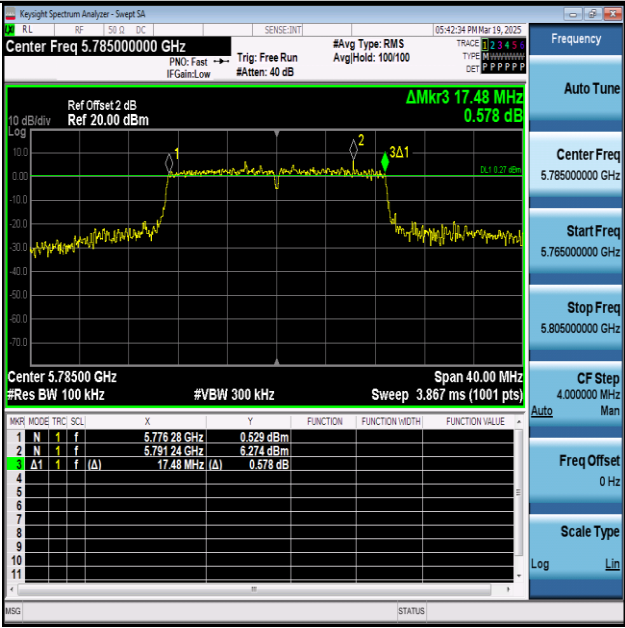


11N20SISO-Ant1-5785-PASS

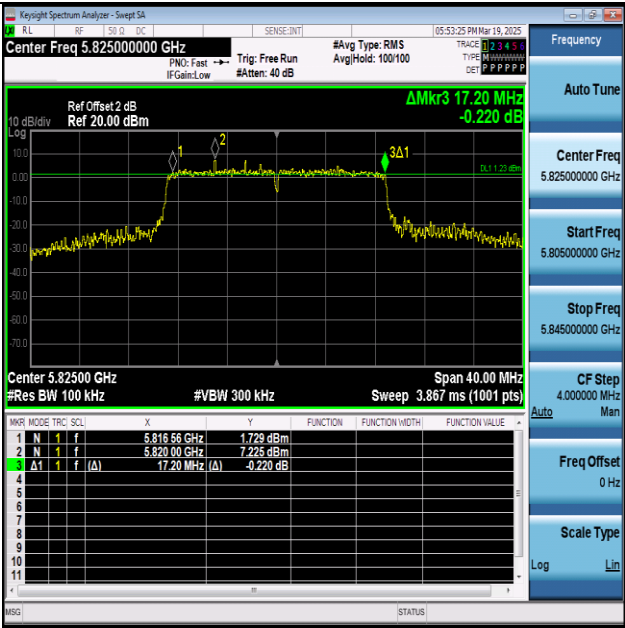


11N20SISO-Ant1-5825-PASS

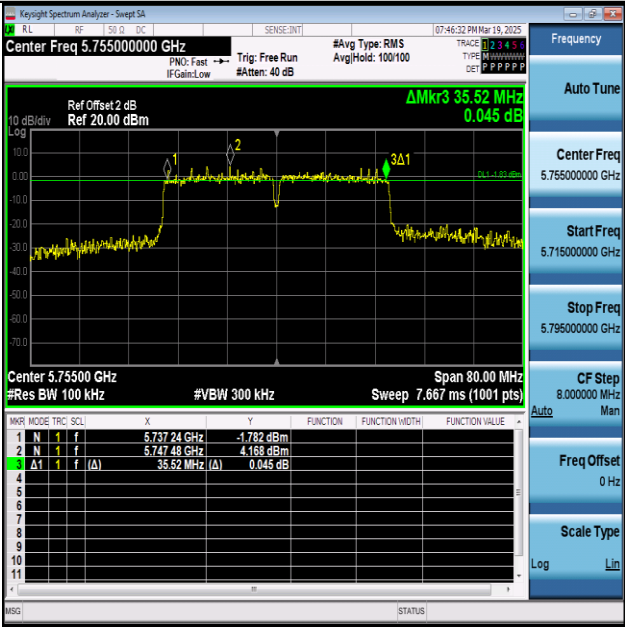


11N40SISO-Ant1-5755-PASS

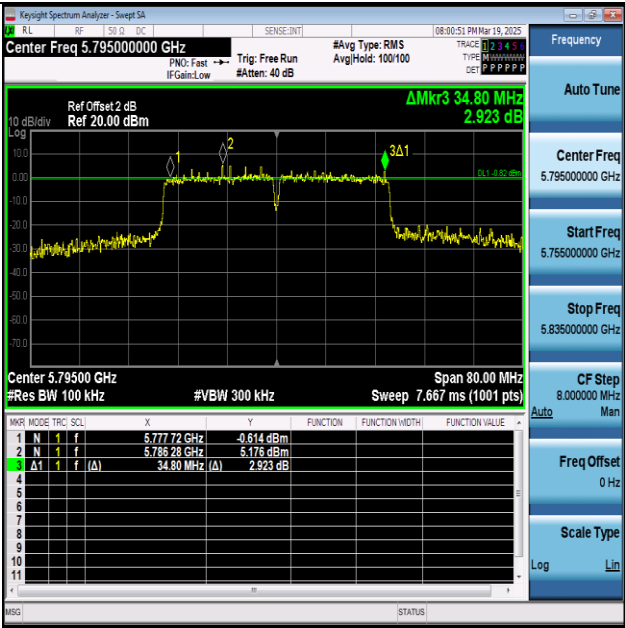


11N40SISO-Ant1-5795-PASS

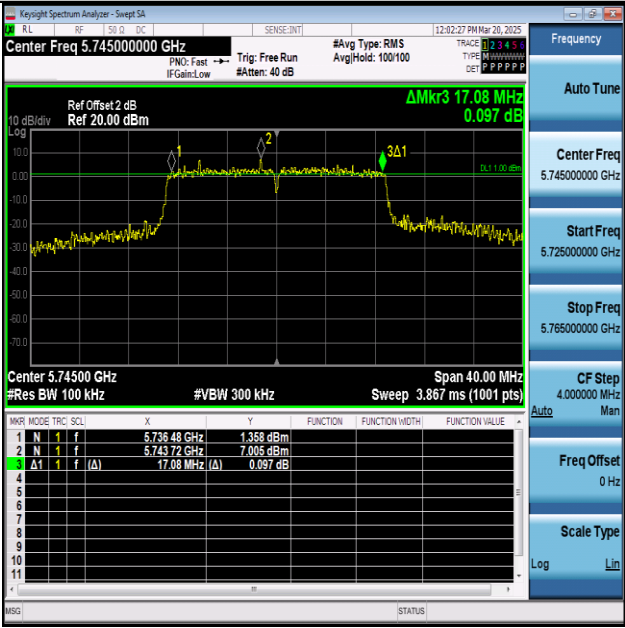


11AC20SISO-Ant1-5745-PASS

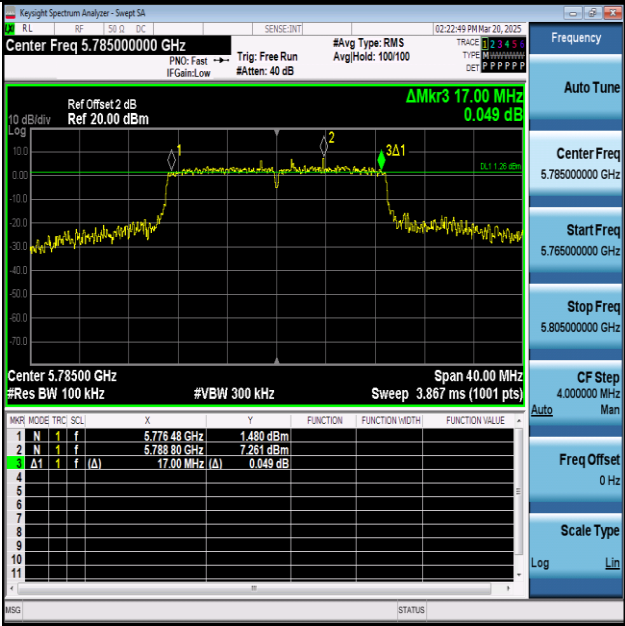


11AC20SISO-Ant1-5785-PASS

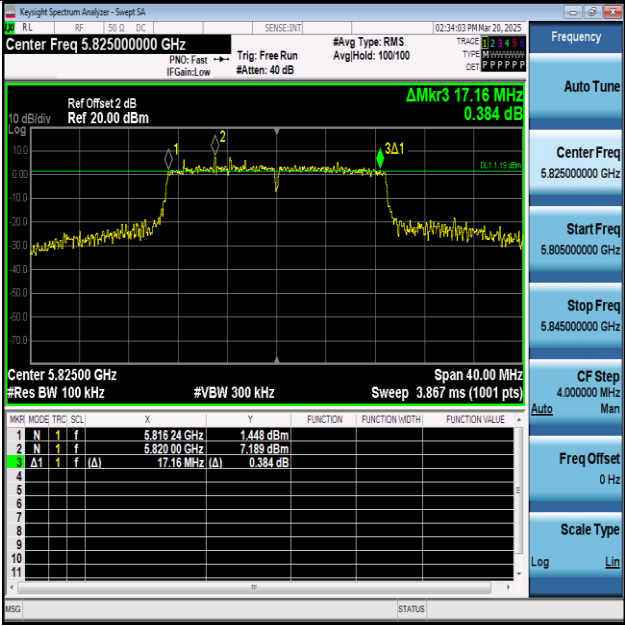

11AC20SISO-Ant1-5825-PASS

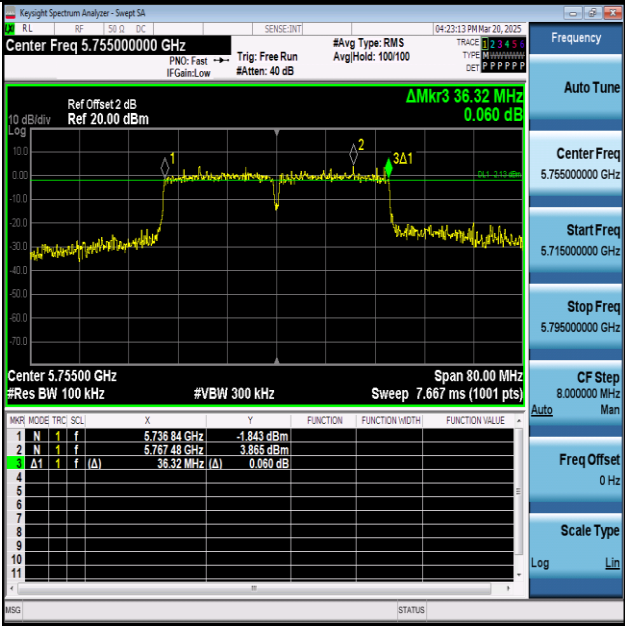

11AC40SISO-Ant1-5755-PASS

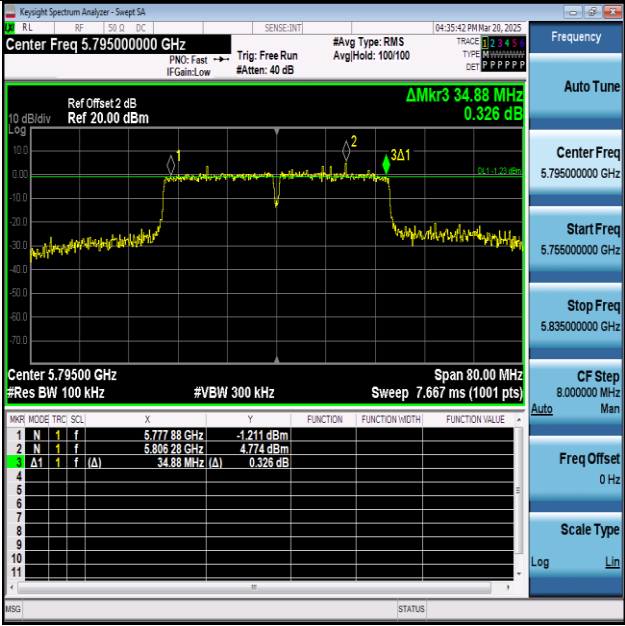

11AC40SISO-Ant1-5795-PASS