




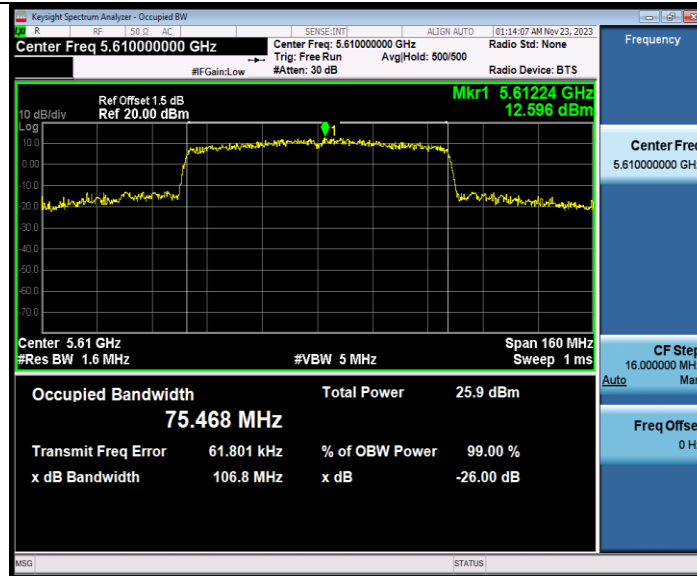


11AC80_5775

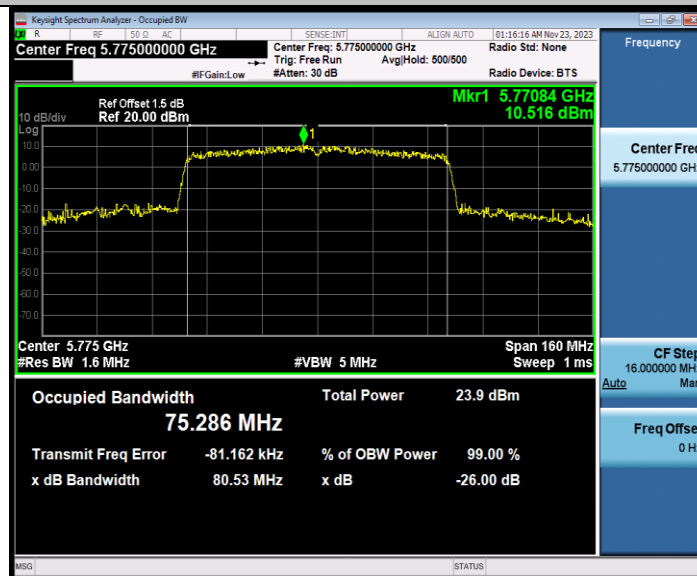


11AX20_5180

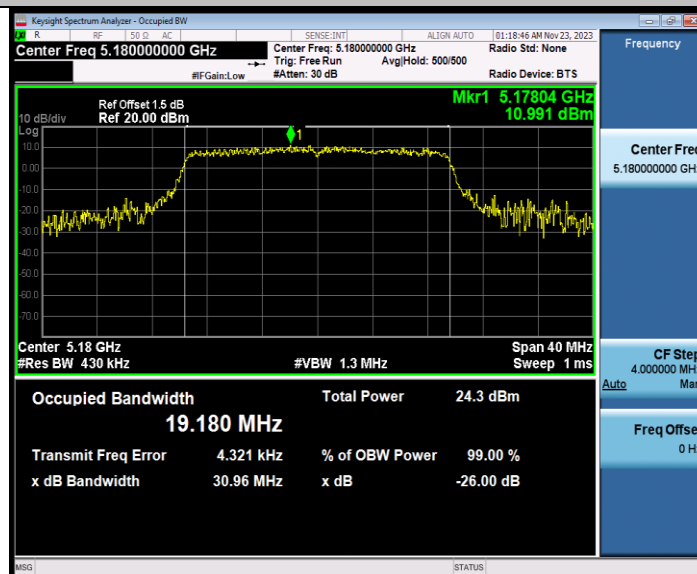


11AX20_5200

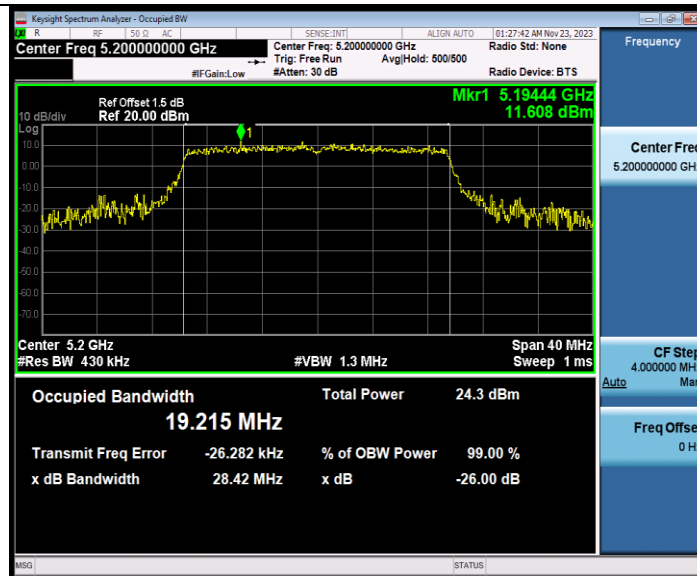


11AX20_5240

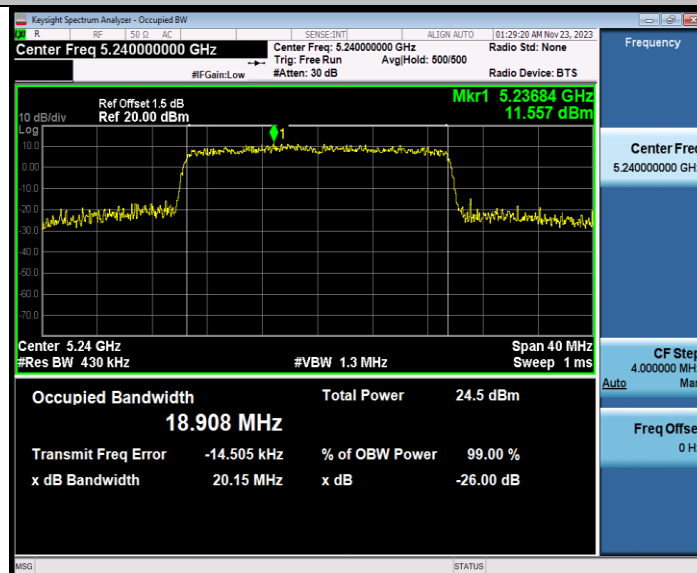


11AX20_5260

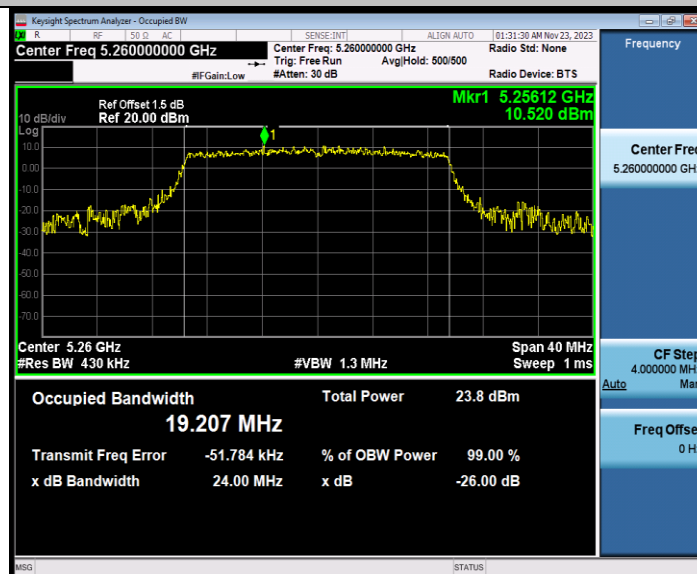


11AX20_5280

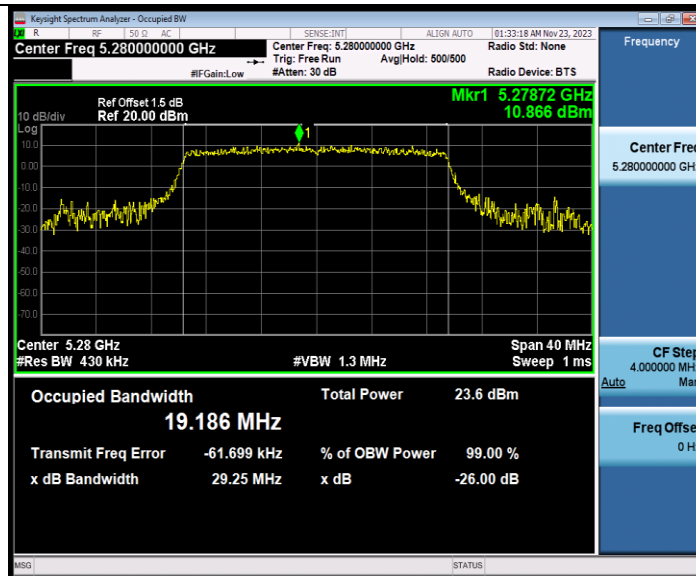


11AX20_5320

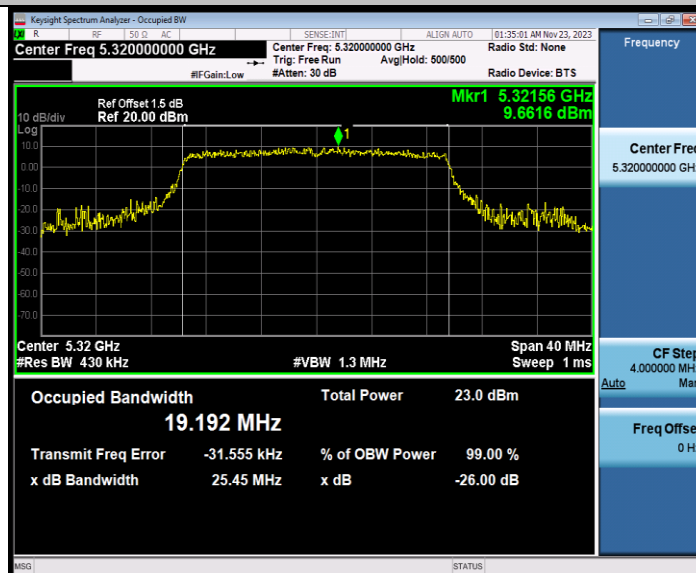


11AX20_5500

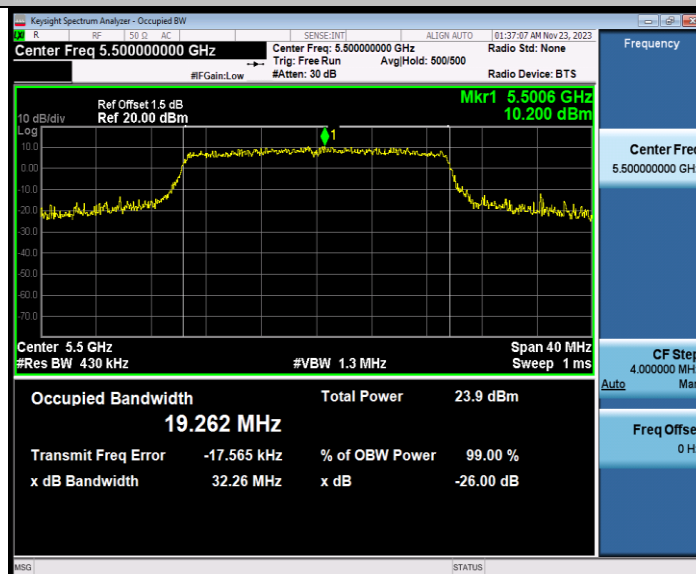


11AX20_5580

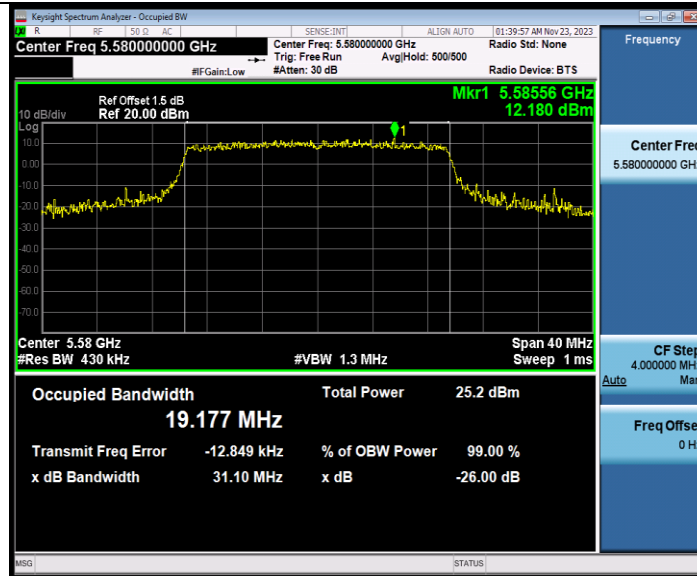

11AX20_5700

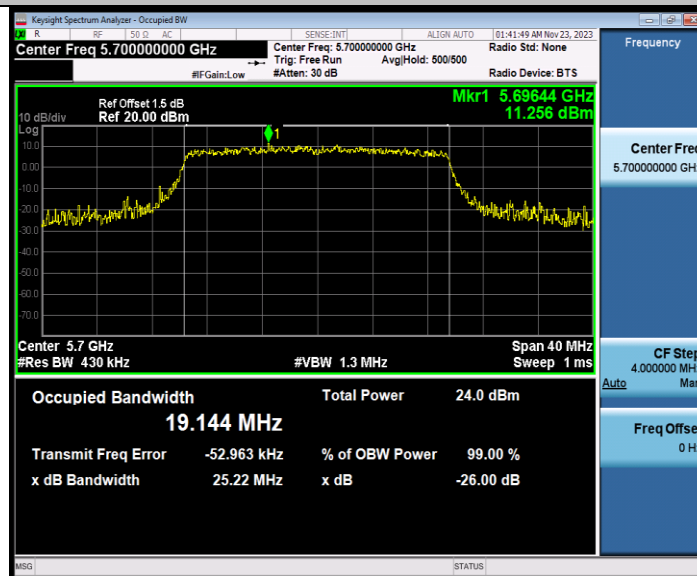


11AX20_5745

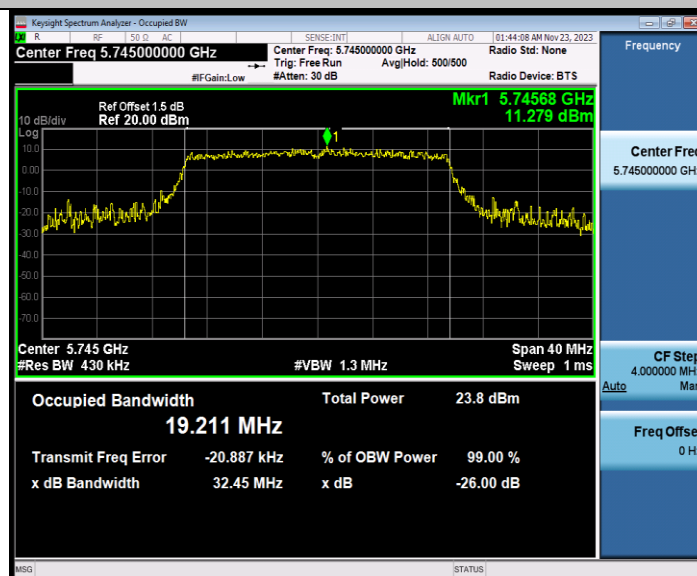


11AX20_5785




11AX20_5825

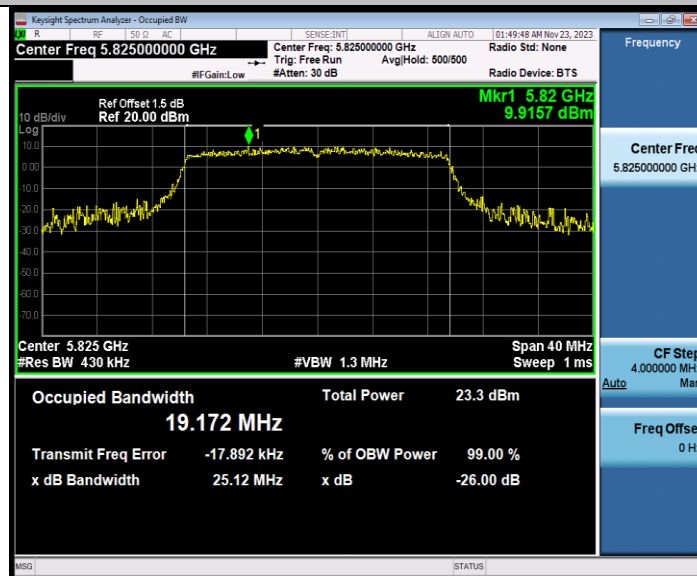


11AX40_5190

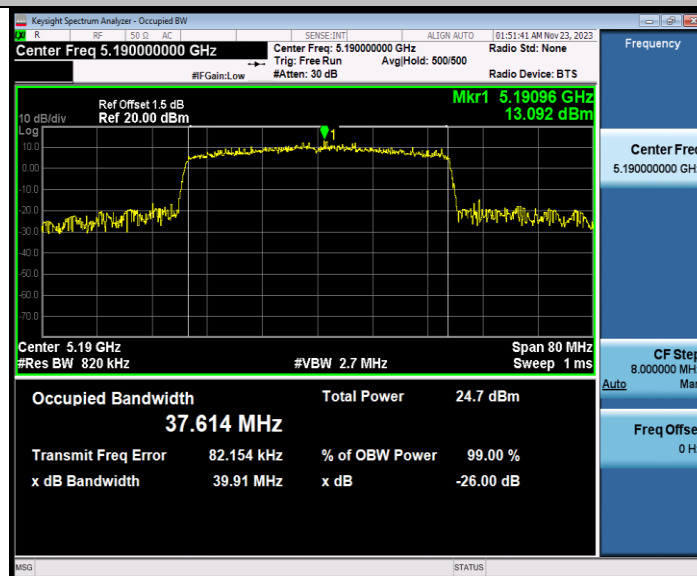


11AX40_5230

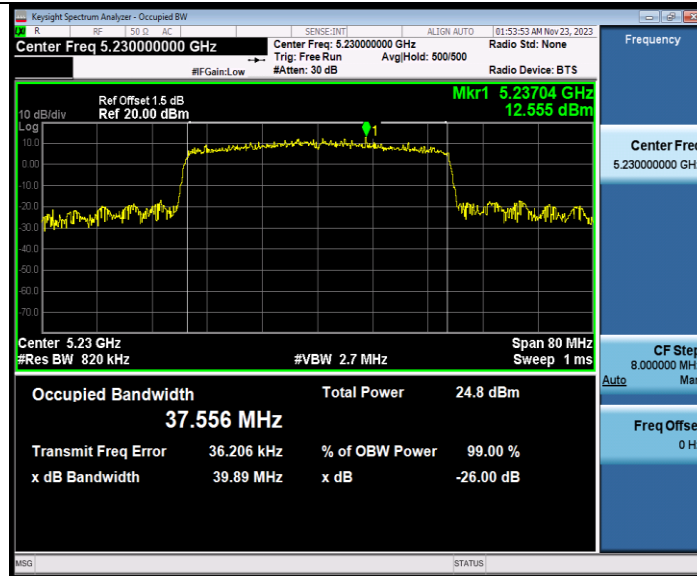


11AX40_5270

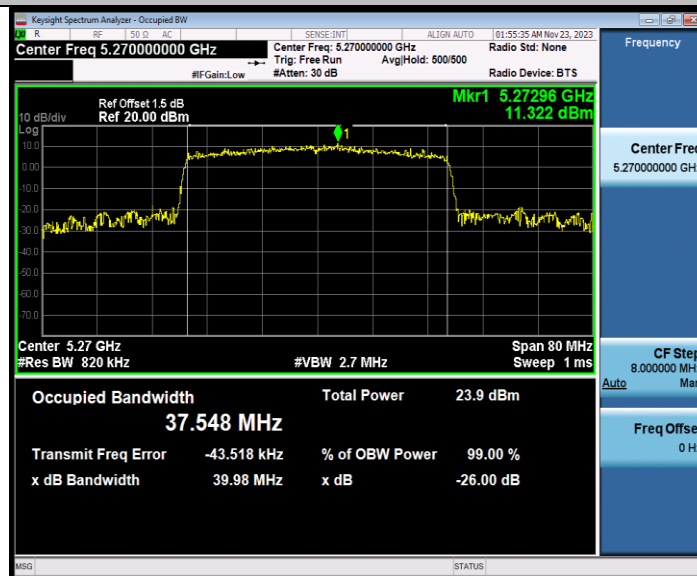


11AX40_5310

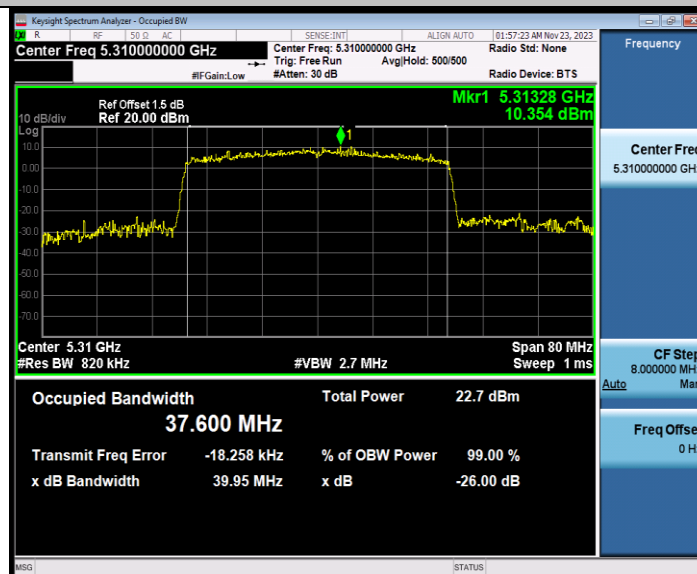


11AX40_5510

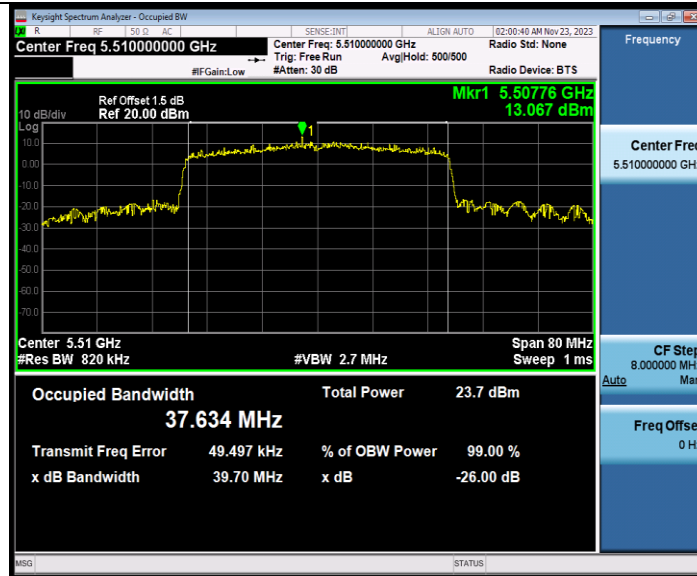


11AX40_5550

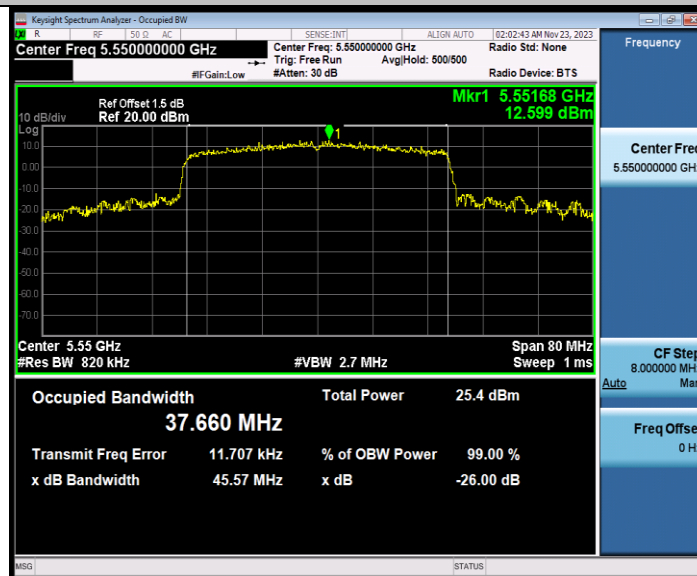


11AX40_5670

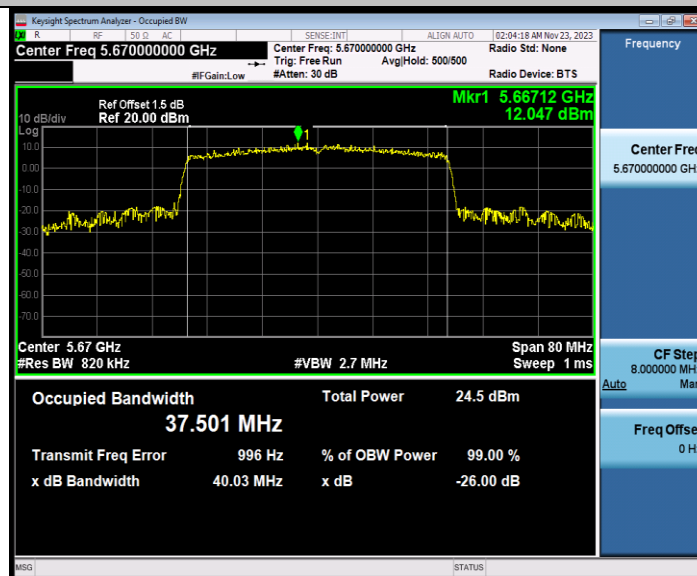


11AX40_5755

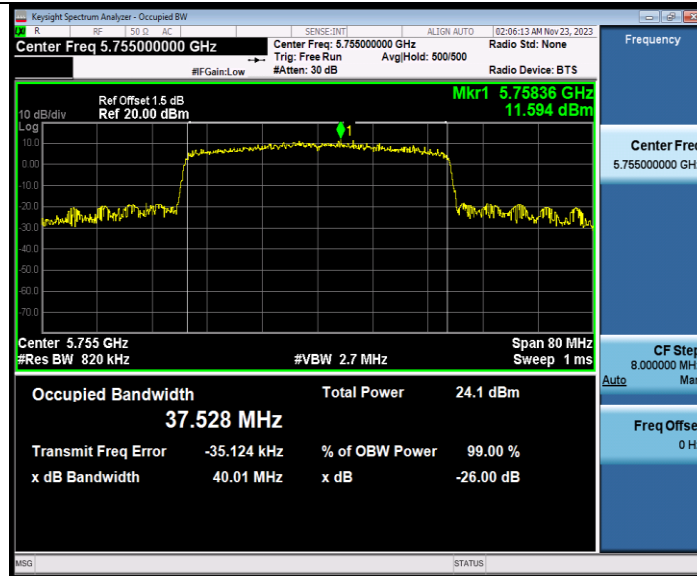


11AX40_5795

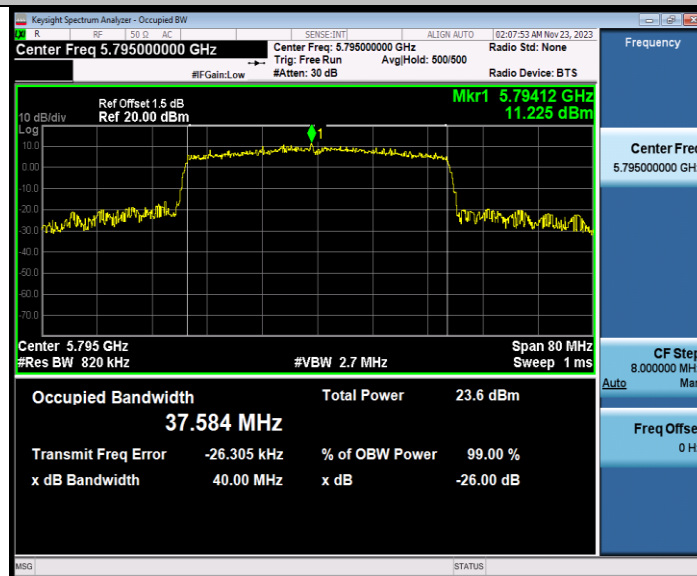

11AX80_5210

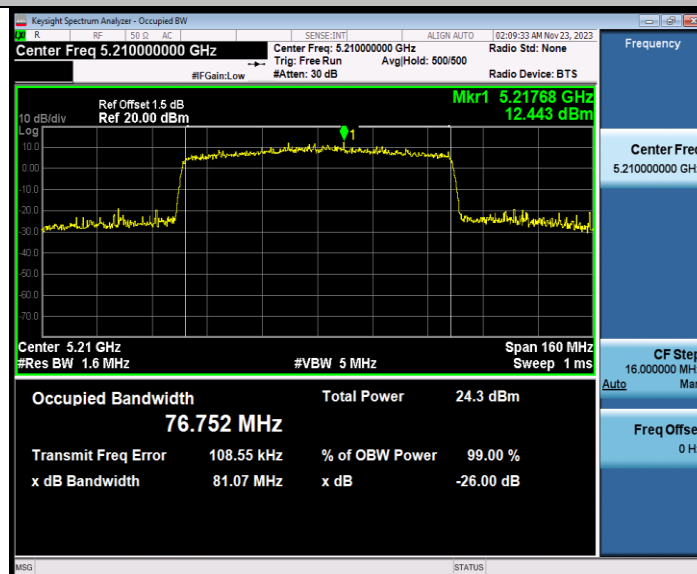


11AX80_5290

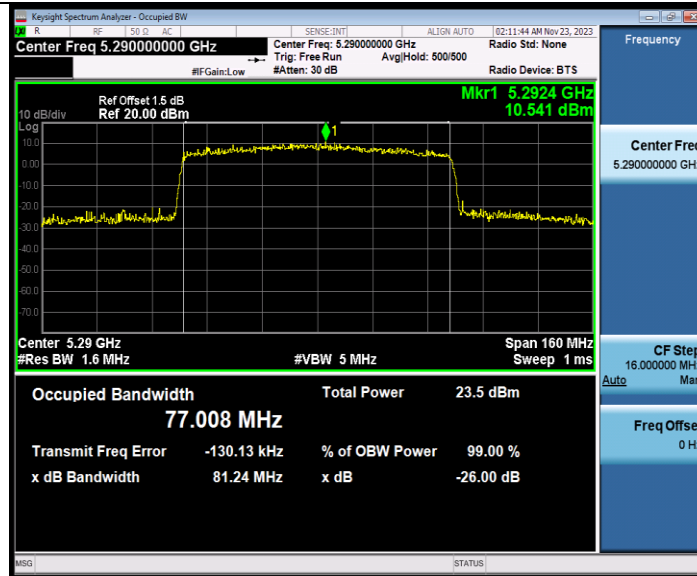


11AX80_5530



11AX80_5610

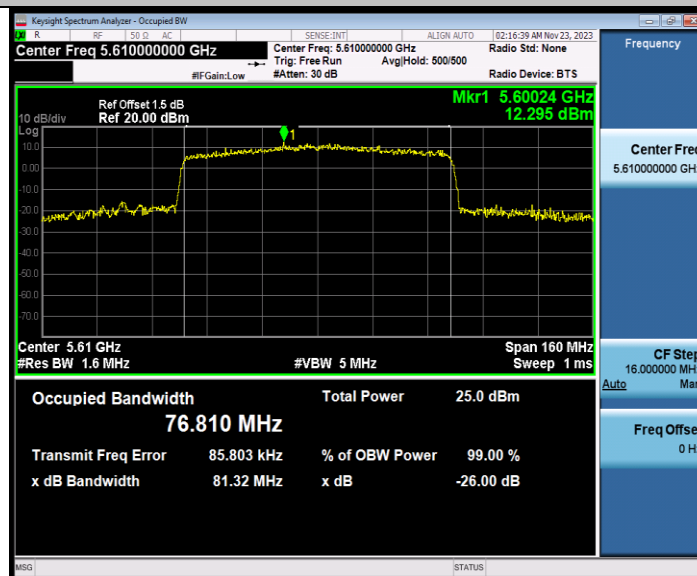


11AX80_5775

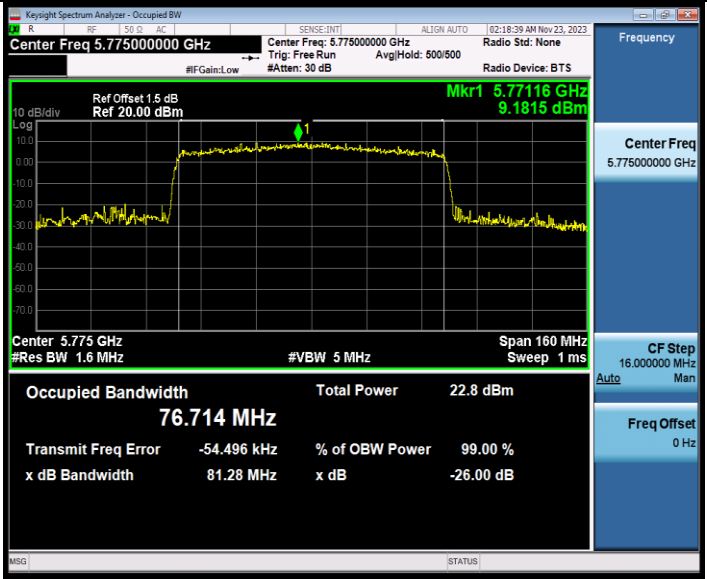


Appendix C: 6dB Emission Bandwidth


TestMode	Antenna	Frequency[MHz]	6db EBW [MHz]	FL[MHz]	FH[MHz]	Limit[MHz]	Verdict
11A	Ant2	5745	16.320	5736.800	5753.120	0.5	PASS
11A	Ant2	5785	16.320	5776.800	5793.120	0.5	PASS
11A	Ant1	5825	16.320	5816.800	5833.120	0.5	PASS
11N20	Ant2	5745	15.760	5737.080	5752.840	0.5	PASS
11N20	Ant1	5785	17.520	5776.200	5793.720	0.5	PASS
11N20	Ant1	5825	17.160	5816.200	5833.360	0.5	PASS
11N40	Ant2	5755	34.960	5737.480	5772.440	0.5	PASS
11N40	Ant1+2	5795	32.640	5779.880	5812.520	0.5	PASS
11AC20	Ant1+2	5745	17.520	5736.200	5753.720	0.5	PASS
11AC20	Ant2	5785	16.400	5776.440	5792.840	0.5	PASS
11AC20	Ant1+2	5825	15.320	5817.400	5832.720	0.5	PASS
11AC40	Ant2	5755	35.040	5737.480	5772.520	0.5	PASS
11AC40	Ant1+2	5795	33.840	5777.400	5811.240	0.5	PASS
11AC80	Ant2	5775	75.200	5737.400	5812.600	0.5	PASS
11AX20	Ant1+2	5745	17.800	5736.040	5753.840	0.5	PASS
11AX20	Ant1	5785	18.120	5775.720	5793.840	0.5	PASS
11AX20	Ant1	5825	17.240	5816.640	5833.880	0.5	PASS
11AX40	Ant1+2	5755	35.200	5737.320	5772.520	0.5	PASS
11AX40	Ant1+2	5795	35.040	5777.400	5812.440	0.5	PASS
11AX80	Ant1+2	5775	73.760	5738.680	5812.440	0.5	PASS

Note: We have evaluated SISO, MIMO mode, shown in the report is the worst data.

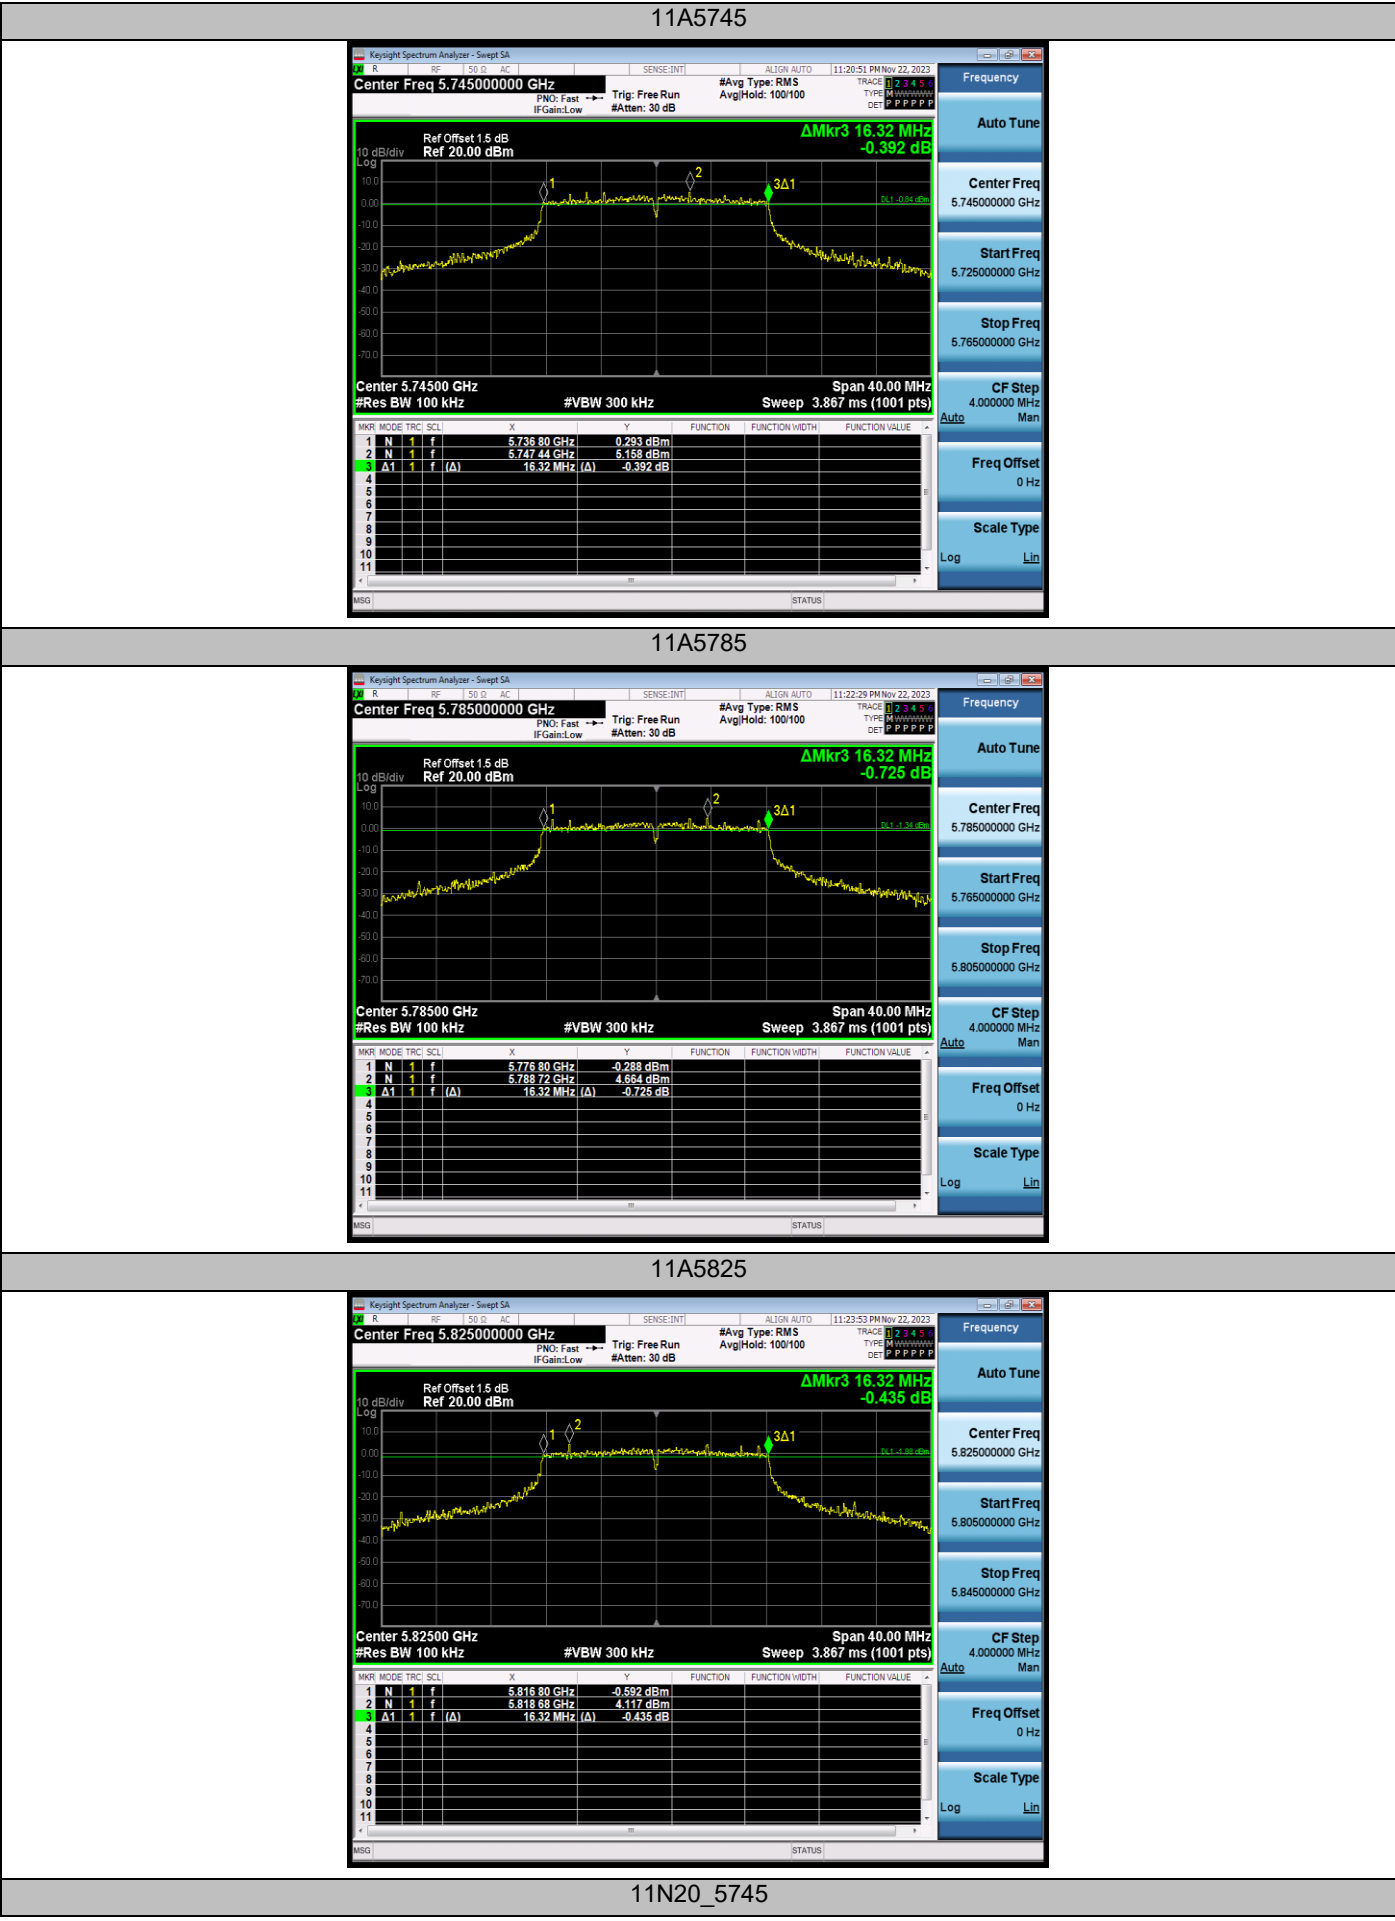

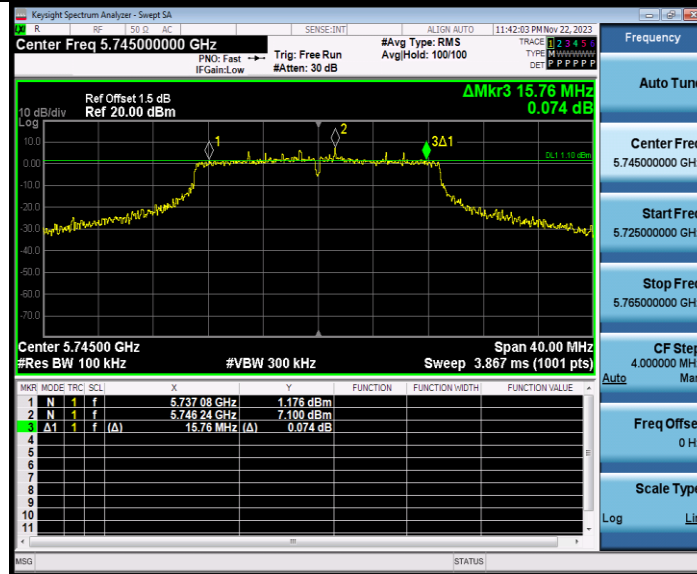


11N20_5785

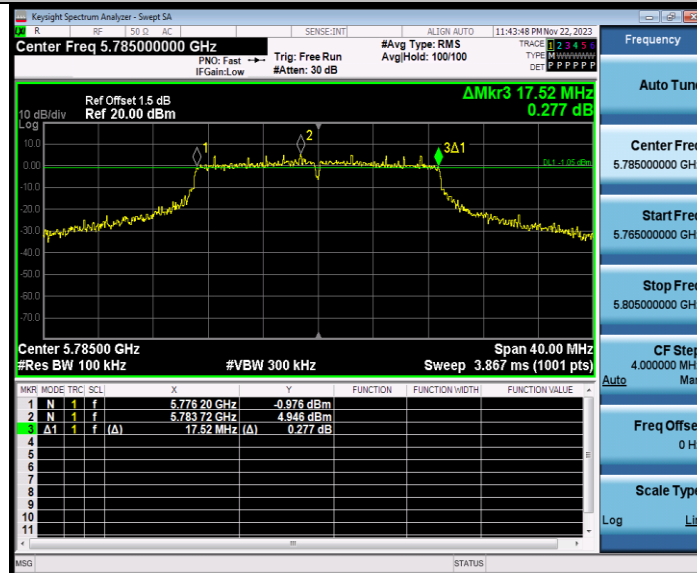


11N20_5825



11N40_5755

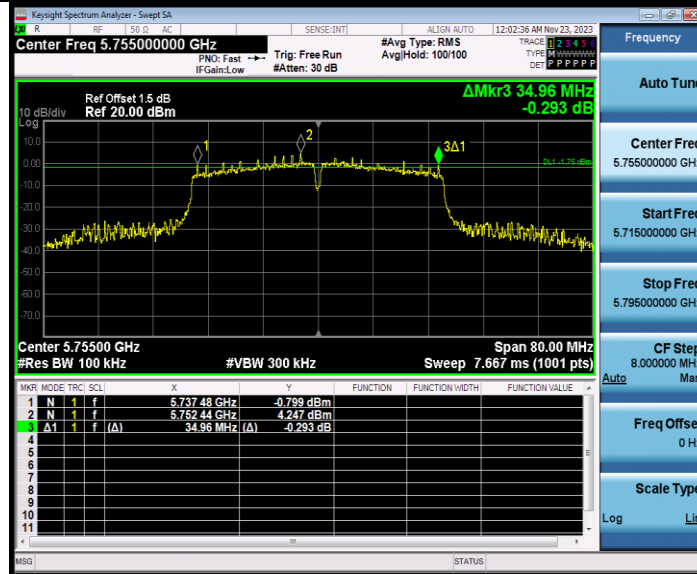


11N40_5795

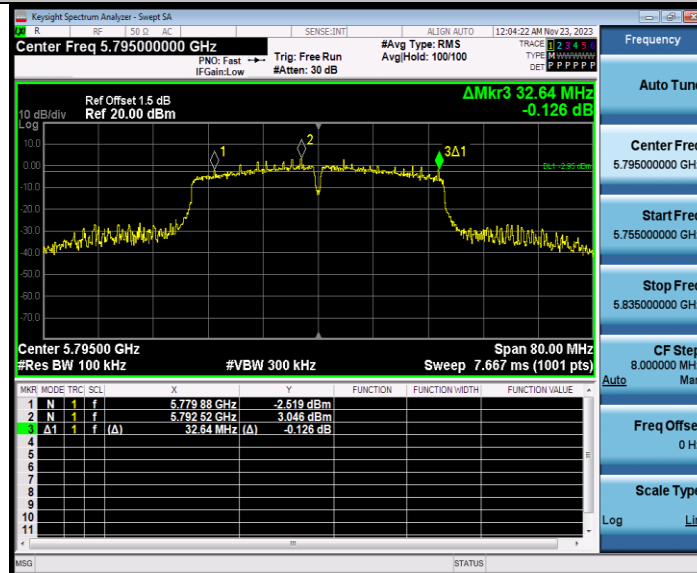


11AC20_5745




11AC20_5785

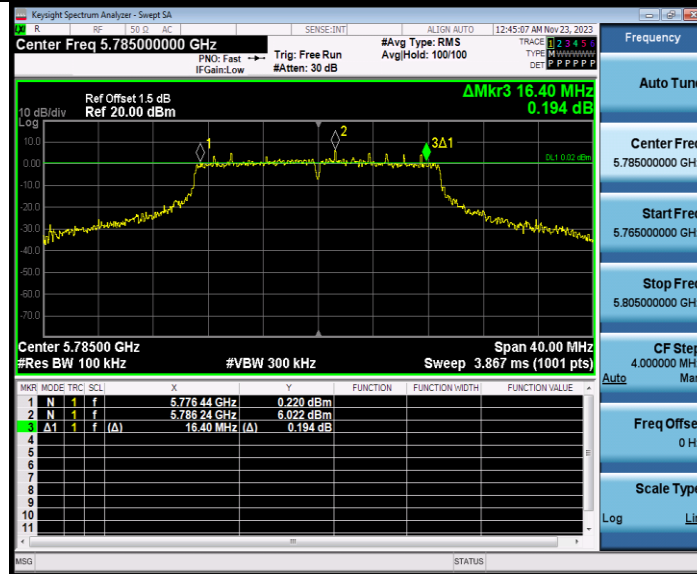


11AC20_5825

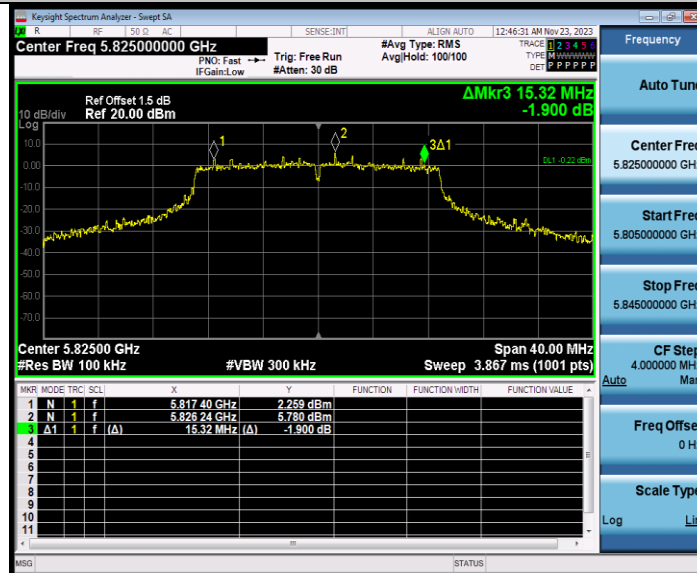


11AC40_5755

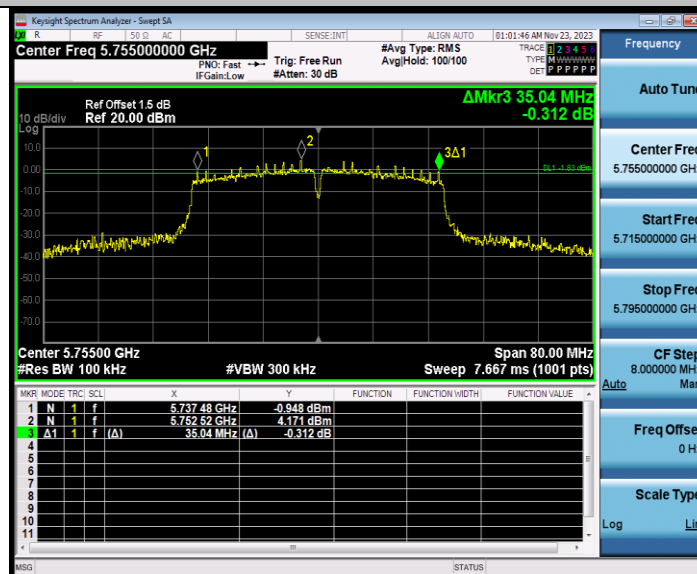


11AC40_5795

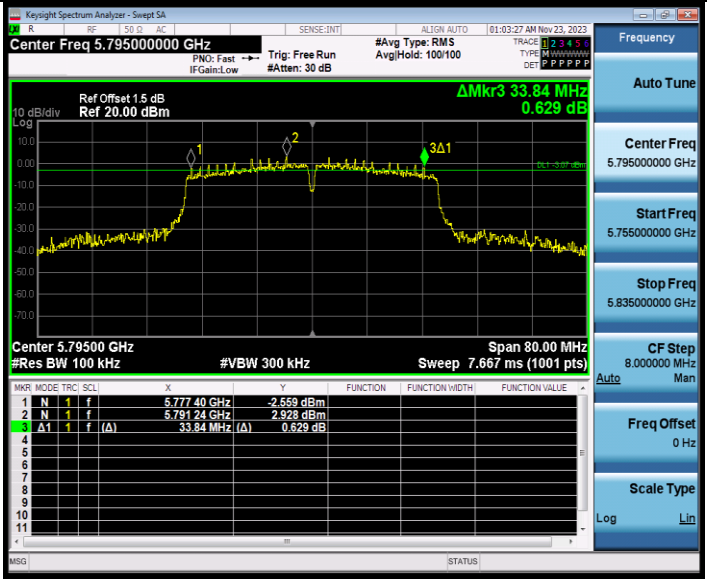


11AC80_5775

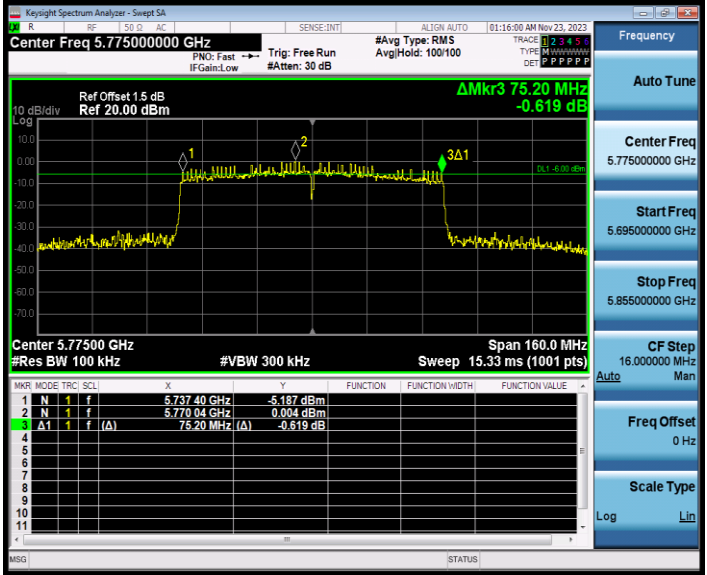


11AX20_5745

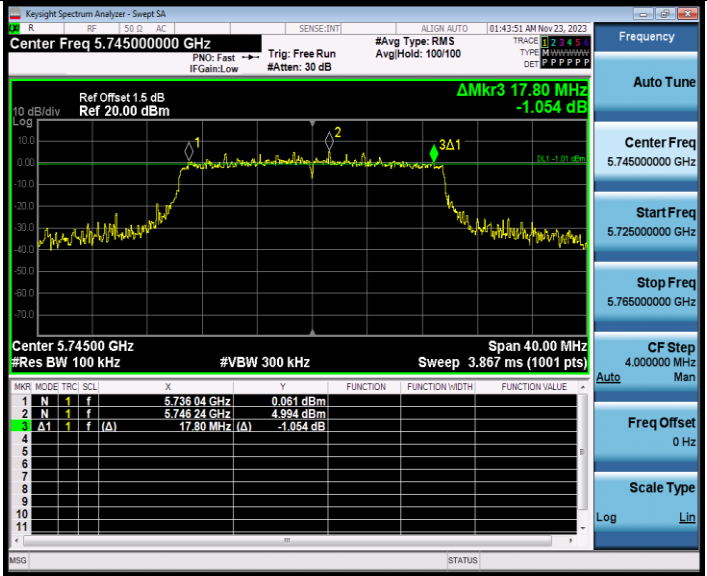


11AX20_5785

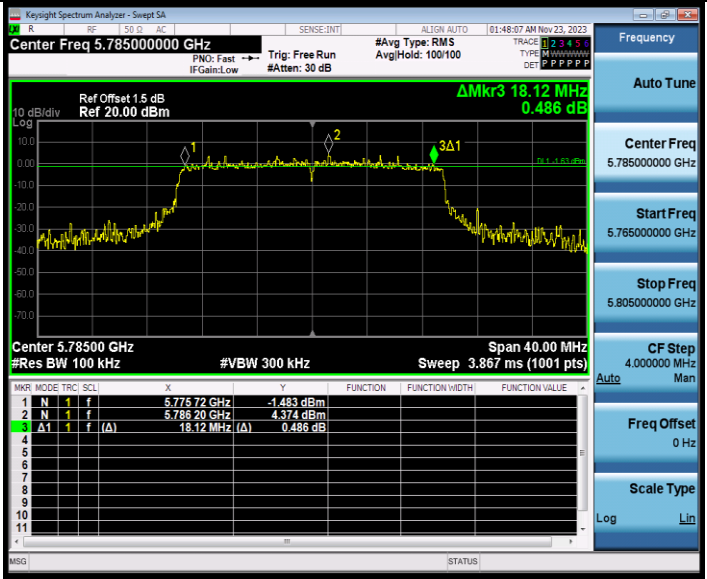


11AX20_5825

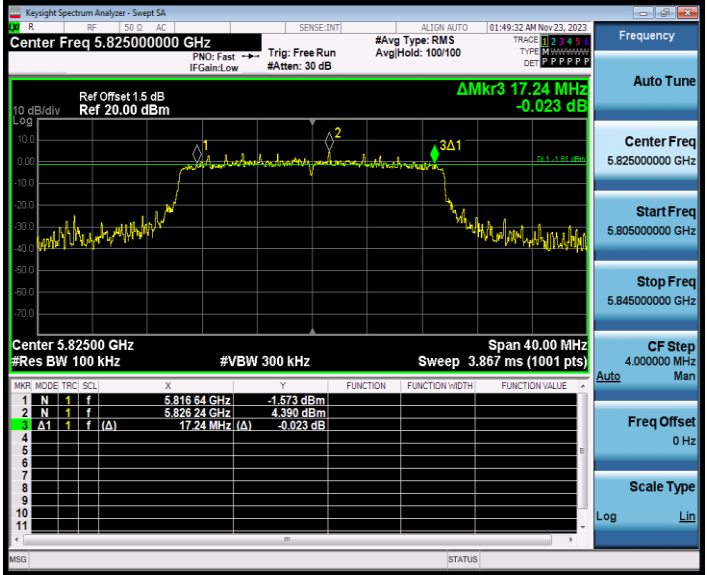


11AX40_5755

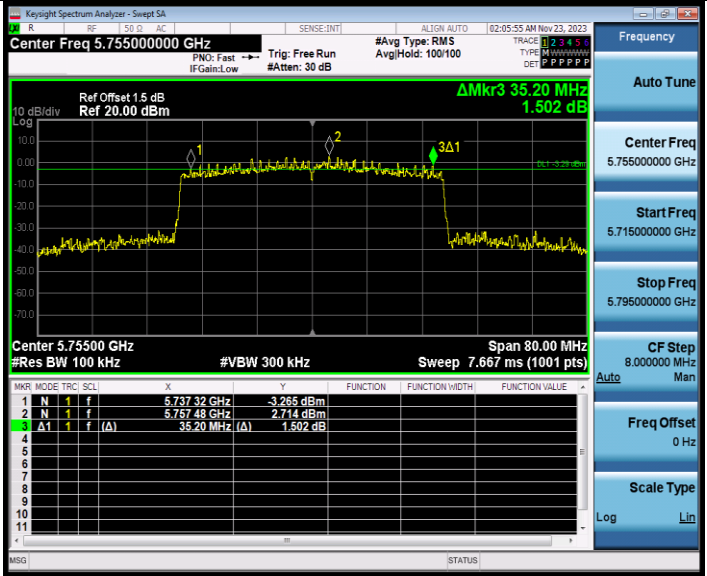

11AX40_5795

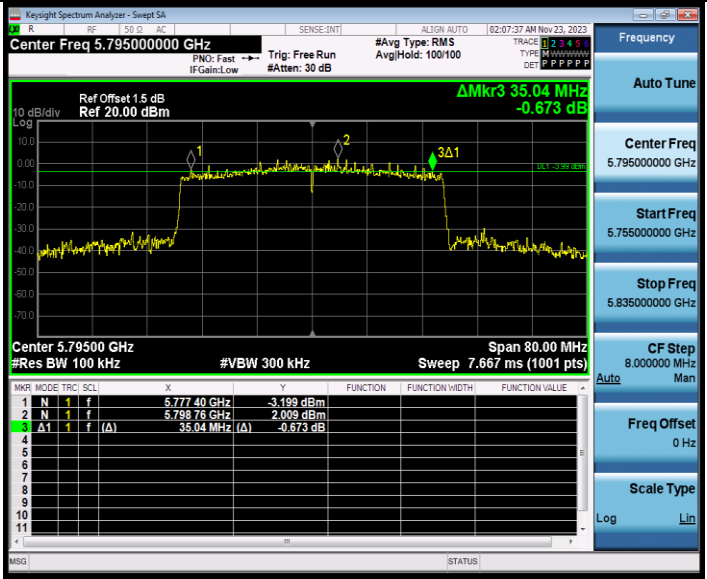

11AX80_5775

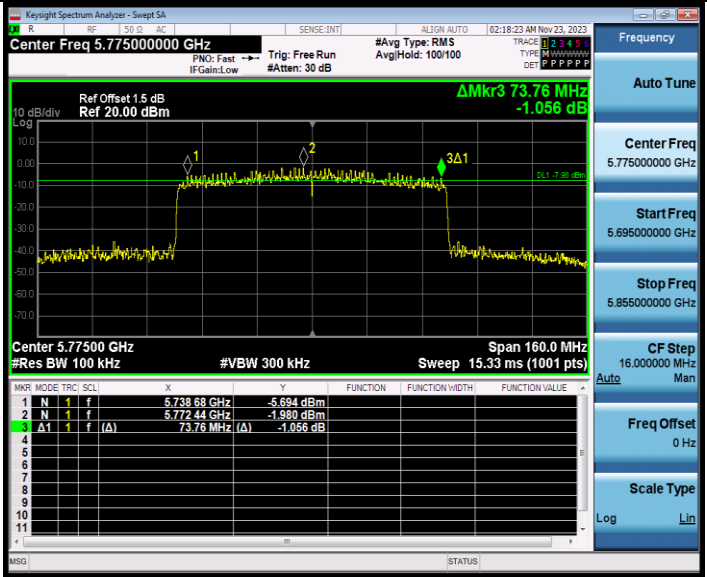

Appendix D: Duty cycle

TestMode	Antenna	Frequency[MHz]	Transmission Duration [ms]	Transmission Period [ms]	Duty Cycle [%]
11A	Ant2	5180	1.39	1.78	78.09
11A	Ant2	5200	1.39	1.77	78.53
11A	Ant2	5240	1.39	1.77	78.53
11A	Ant2	5260	1.39	1.77	78.53
11A	Ant2	5280	1.39	1.77	78.53
11A	Ant2	5320	1.39	1.77	78.53
11A	Ant1	5500	1.40	1.78	78.65
11A	Ant1	5580	1.39	1.78	78.09
11A	Ant2	5700	1.39	1.78	78.09
11A	Ant2	5745	1.39	1.77	78.53
11A	Ant2	5785	1.39	1.78	78.09
11A	Ant1	5825	1.40	1.77	79.10
11N20	Ant1	5180	1.30	1.68	77.38
11N20	Ant1	5200	1.30	1.69	76.92
11N20	Ant1	5240	1.30	1.67	77.84
11N20	Ant1	5260	1.30	1.69	76.92
11N20	Ant2	5280	1.30	1.69	76.92
11N20	Ant1+2	5320	1.30	1.67	77.84
11N20	Ant1	5500	1.30	1.69	76.92
11N20	Ant1	5580	1.30	1.69	76.92
11N20	Ant1+2	5700	1.30	1.69	76.92
11N20	Ant2	5745	1.30	1.68	77.38
11N20	Ant1	5785	1.30	1.69	76.92
11N20	Ant1	5825	1.30	1.69	76.92
11N40	Ant1+2	5190	0.64	1.03	62.14
11N40	Ant1+2	5230	0.65	1.03	63.11
11N40	Ant12	5270	0.65	1.03	63.11
11N40	Ant1+2	5310	0.65	1.03	63.11
11N40	Ant1	5510	0.65	1.04	62.50
11N40	Ant1	5550	0.65	1.06	61.32
11N40	Ant1+2	5670	0.65	1.04	62.50
11N40	Ant2	5755	0.65	1.03	63.11
11N40	Ant1+2	5795	0.65	1.04	62.50
11AC20	Ant1	5180	0.68	1.07	63.55
11AC20	Ant1+2	5200	0.68	1.06	64.15
11AC20	Ant1+2	5240	0.68	1.06	64.15
11AC20	Ant1+2	5260	0.68	1.06	64.15
11AC20	Ant1	5280	0.68	1.07	63.55
11AC20	Ant1	5320	0.68	1.07	63.55
11AC20	Ant1	5500	0.68	1.07	63.55
11AC20	Ant1	5580	0.68	1.06	64.15
11AC20	Ant2	5700	0.68	1.06	64.15
11AC20	Ant1+2	5745	0.68	1.13	60.18
11AC20	Ant2	5785	0.68	1.07	63.55
11AC20	Ant1+2	5825	0.68	1.07	63.55
11AC40	Ant1+2	5190	0.35	0.73	47.95
11AC40	Ant2	5230	0.35	0.74	47.30

11AC40	Ant1+2	5270	0.35	0.74	47.30
11AC40	Ant1+2	5310	0.35	0.73	47.95
11AC40	Ant1	5510	0.35	0.74	47.30
11AC40	Ant1	5550	0.35	0.73	47.95
11AC40	Ant2	5670	0.35	0.74	47.30
11AC40	Ant2	5755	0.35	0.74	47.30
11AC40	Ant1+2	5795	0.35	0.74	47.30
11AC80	Ant1	5210	0.19	0.57	33.33
11AC80	Ant1	5290	0.19	0.58	32.76
11AC80	Ant1	5530	0.19	0.58	32.76
11AC80	Ant1	5610	0.18	0.57	31.58
11AC80	Ant2	5775	0.19	0.57	33.33
11AX20	Ant1	5180	0.56	0.94	59.57
11AX20	Ant1	5200	0.56	0.95	58.95
11AX20	Ant2	5240	0.56	0.95	58.95
11AX20	Ant1+2	5260	0.56	0.94	59.57
11AX20	Ant1+2	5280	0.55	0.94	58.51
11AX20	Ant1+2	5320	0.56	0.94	59.57
11AX20	Ant1	5500	0.55	0.94	58.51
11AX20	Ant1	5580	0.56	0.94	59.57
11AX20	Ant2	5700	0.56	0.94	59.57
11AX20	Ant1+2	5745	0.56	0.92	60.87
11AX20	Ant1	5785	0.55	0.94	58.51
11AX20	Ant1	5825	0.56	0.92	60.87
11AX40	Ant1+2	5190	0.32	0.71	45.07
11AX40	Ant2	5230	0.32	0.71	45.07
11AX40	Ant2	5270	0.32	0.71	45.07
11AX40	Ant2	5310	0.32	0.70	45.71
11AX40	Ant1	5510	0.32	0.71	45.07
11AX40	Ant1	5550	0.32	0.70	45.71
11AX40	Ant1	5670	0.32	0.71	45.07
11AX40	Ant1+2	5755	0.32	0.71	45.07
11AX40	Ant1+2	5795	0.32	0.71	45.07
11AX80	Ant1	5210	0.19	0.43	44.19
11AX80	Ant1	5290	0.20	0.44	45.45
11AX80	Ant1	5530	0.19	0.44	43.18
11AX80	Ant1	5610	0.20	0.44	45.45
11AX80	Ant1+2	5775	0.19	0.45	42.22

Note: We have evaluated SISO, MIMO mode, shown in the report is the worst data.

