



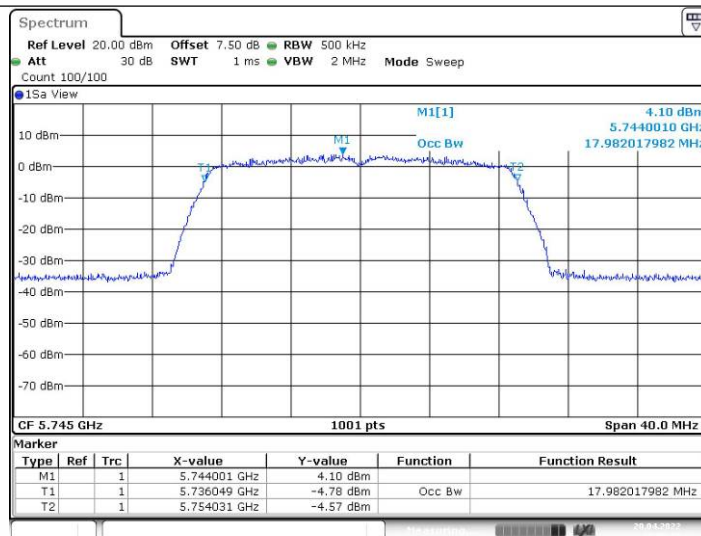


Date: 20 APR 2022 19:00:29

11AC20SISO_Ant2_5745

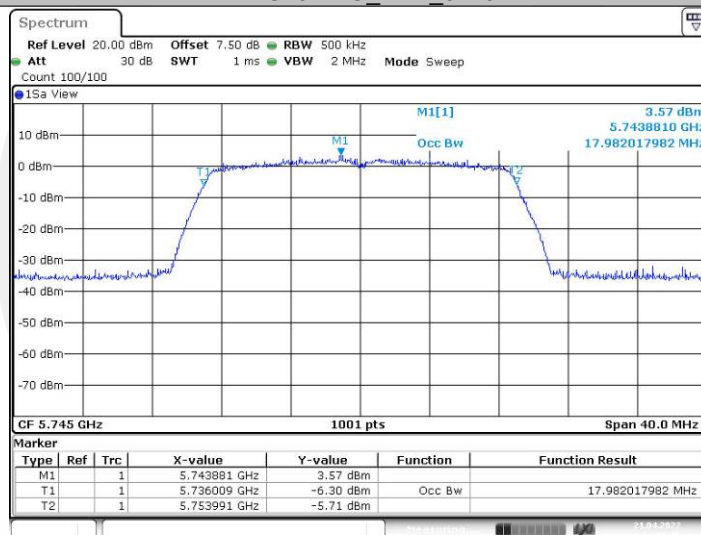


Date: 21 APR 2022 16:37:32

11AC20SISO_Ant1_5785

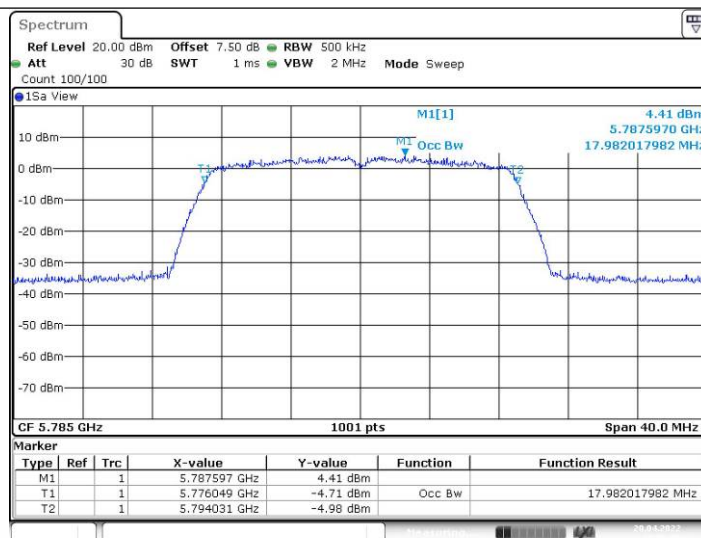


Date: 20 APR 2022 19:09:06

11AC20SISO_Ant2_5785

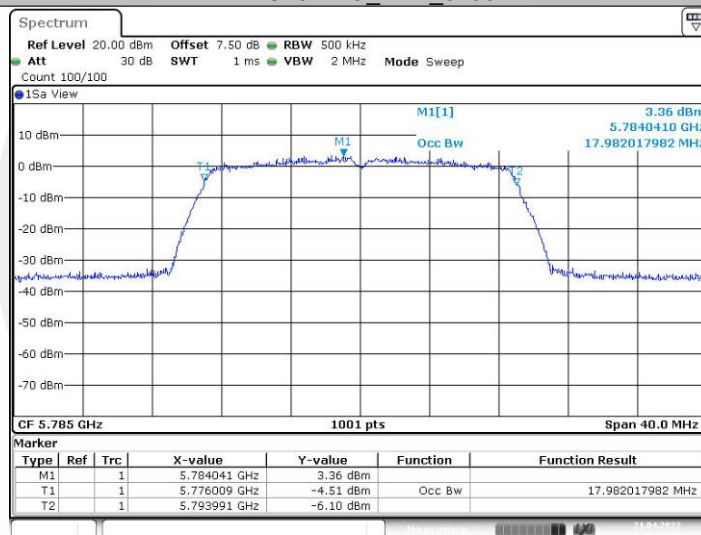


Date: 21 APR 2022 16:44:20

11AC20SISO_Ant1_5825

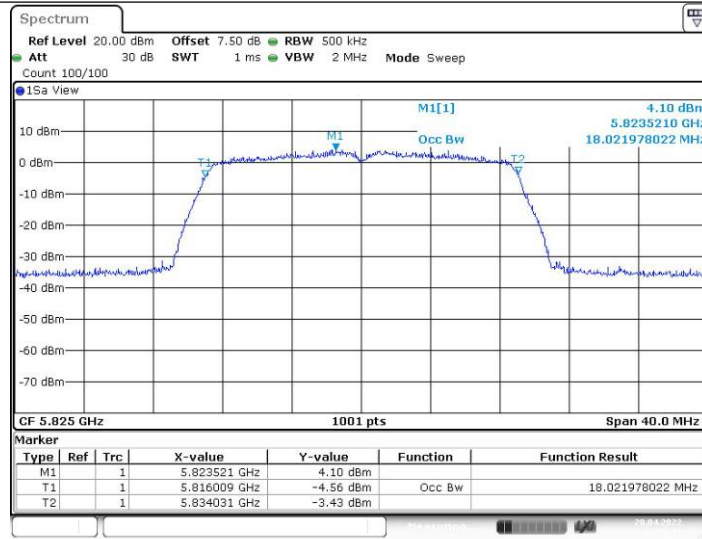


Date: 20 APR 2022 19:19:22

11AC20SISO_Ant2_5825

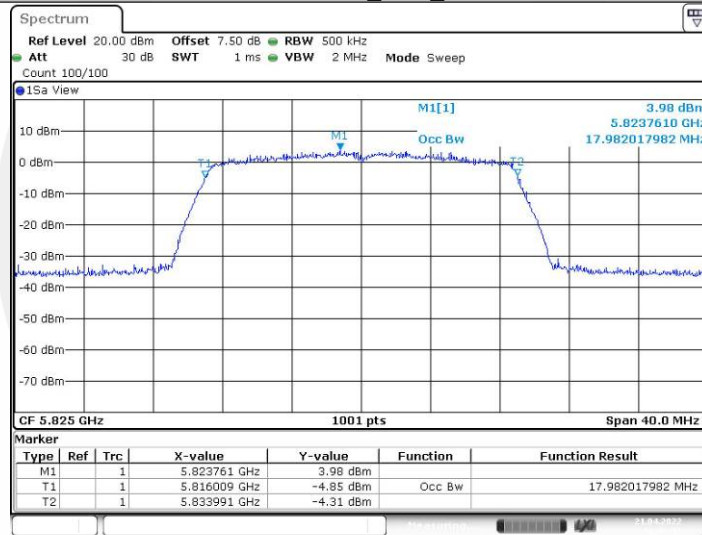


Date: 21 APR 2022 16:49:53

11AC40SISO_Ant1_5190

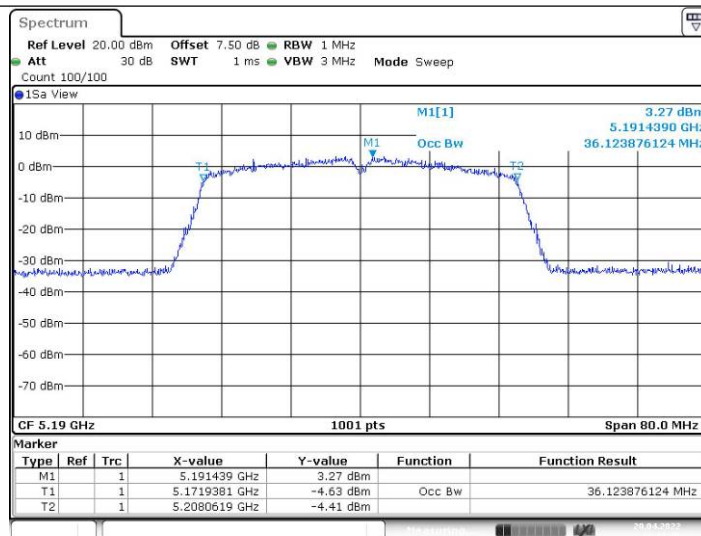


Date: 20 APR 2022 19:31:27

11AC40SISO_Ant2_5190

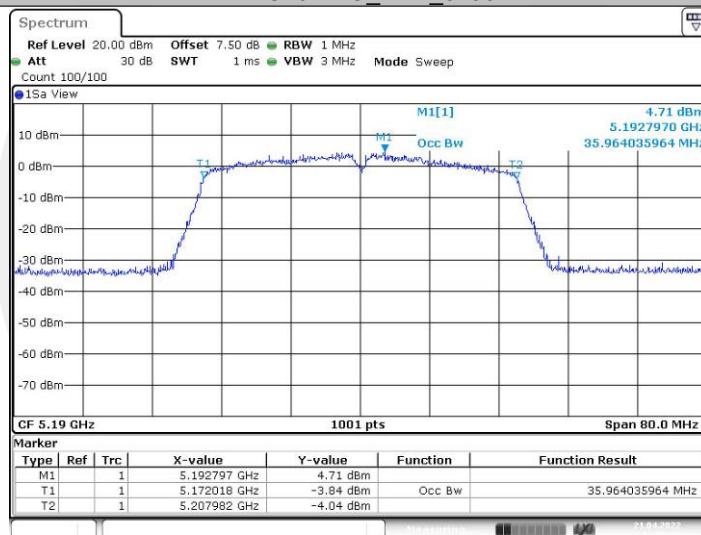

Date: 21 APR 2022 16:58:59

11AC40SISO_Ant1_5230

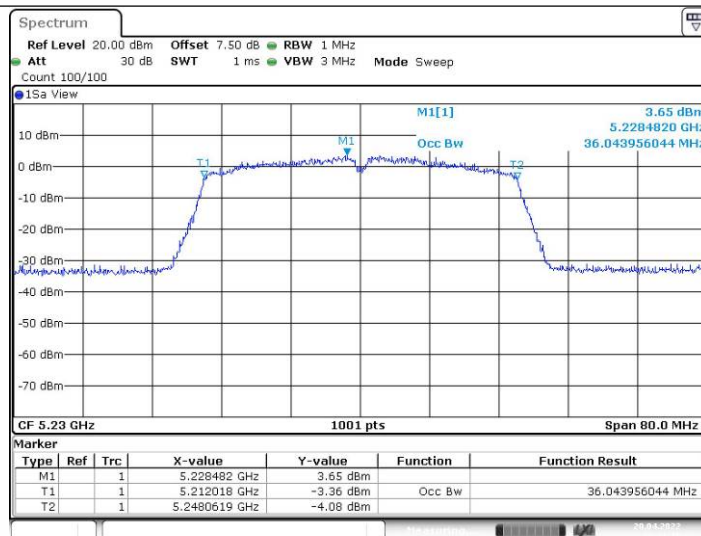


Date: 20 APR 2022 19:41:11

11AC40SISO_Ant2_5230



Date: 21 APR 2022 17:06:50

11AC40SISO_Ant1_5755

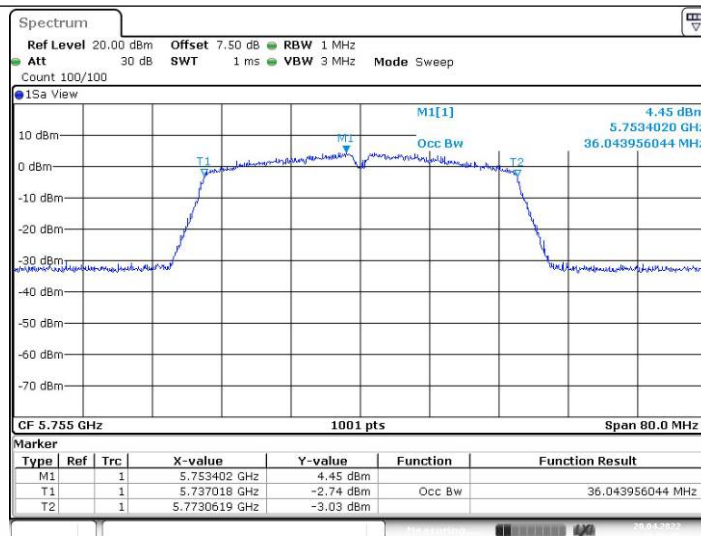


Date: 20 APR 2022 19:50:02

11AC40SISO_Ant2_5755




Date: 21 APR 2022 17:14:28

11AC40SISO_Ant1_5795

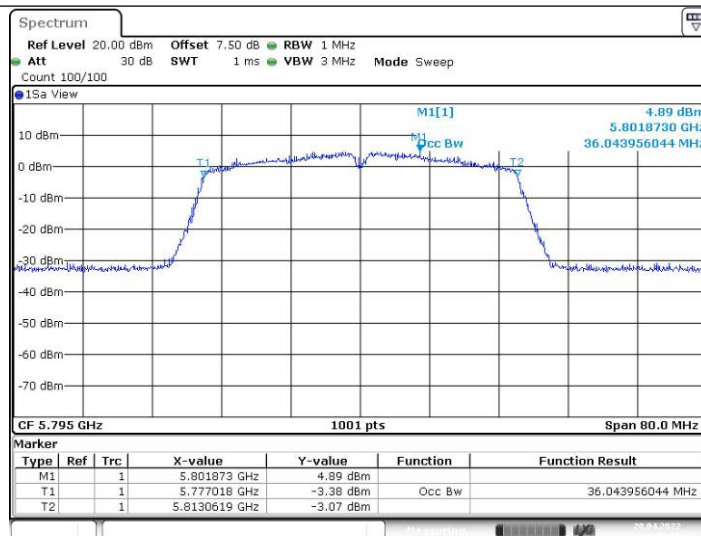


Date: 20 APR 2022 19:57:09

11AC40SISO_Ant2_5795

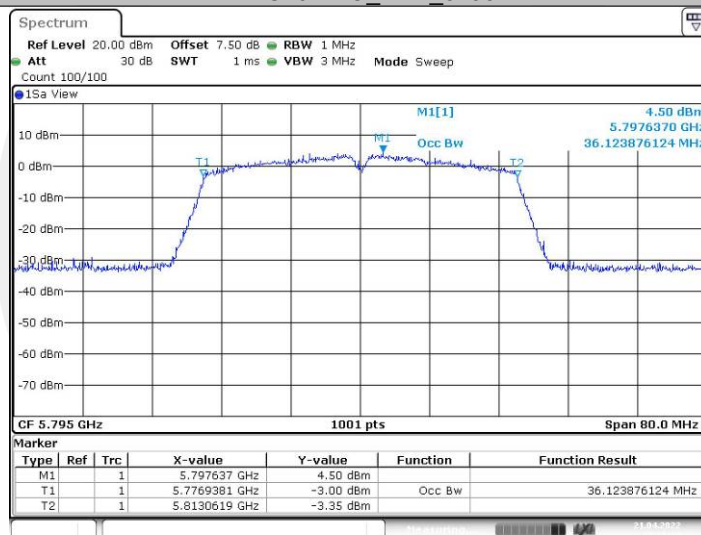


Date: 21 APR 2022 17:21:34

11AC80SISO_Ant1_5210

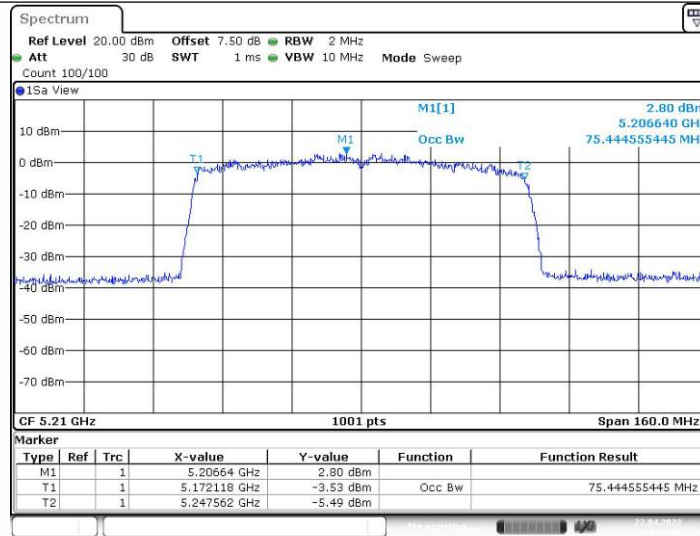


Date: 22 APR 2022 14:41:02

11AC80SISO_Ant2_5210

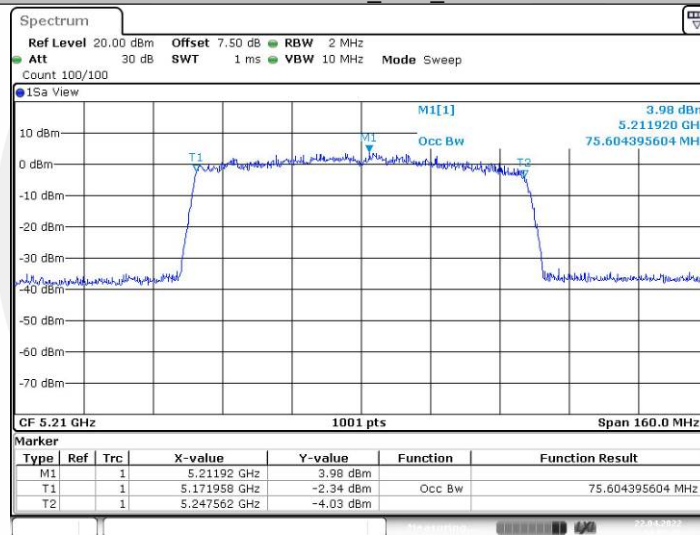


Date: 22 APR 2022 14:02:25

11AC80SISO_Ant1_5775

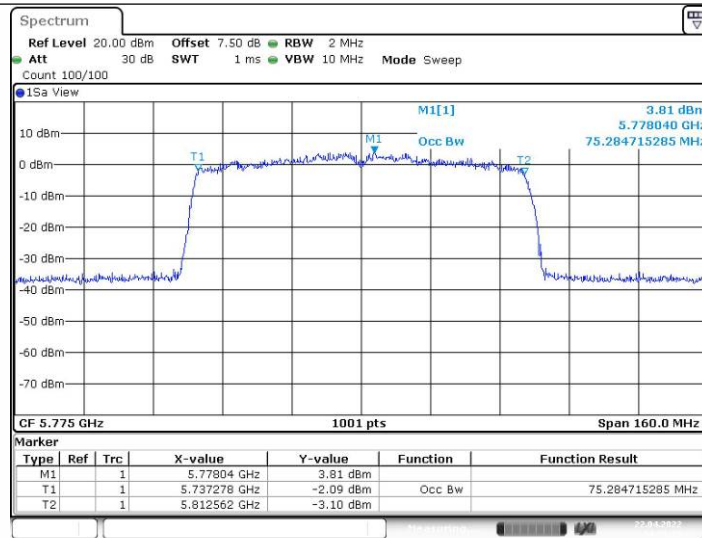


Date: 22 APR 2022 14:51:21

11AC80SISO_Ant2_5775

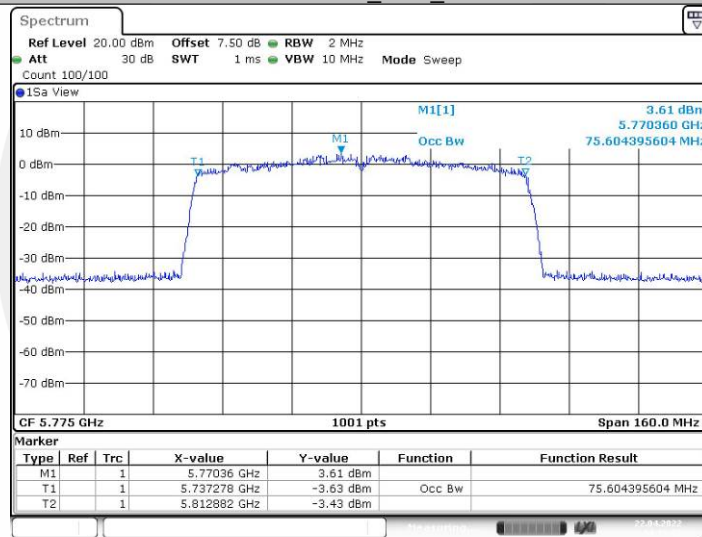


Date: 22 APR 2022 14:13:06

11AX20SISO_Ant1_5180

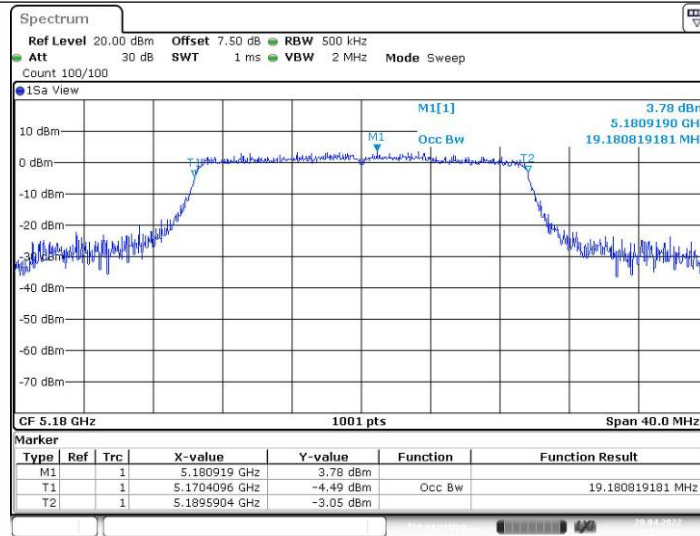


Date: 20 APR 2022 20:04:03

11AX20SISO_Ant2_5180

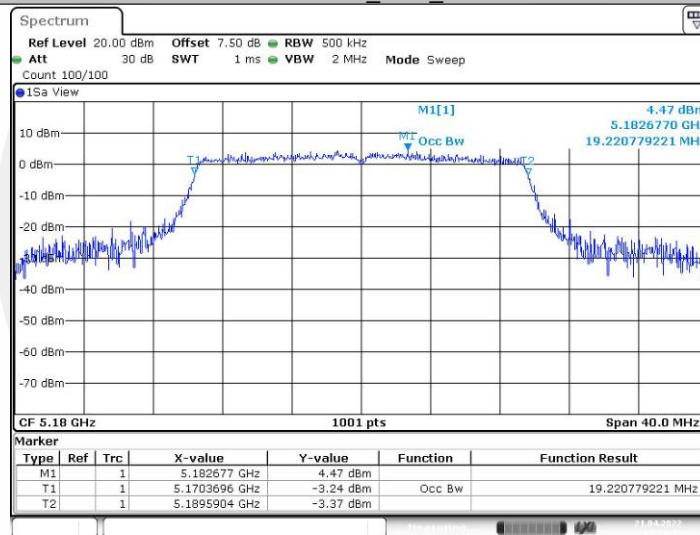


Date: 21 APR 2022 17:28:45

11AX20SISO_Ant1_5220

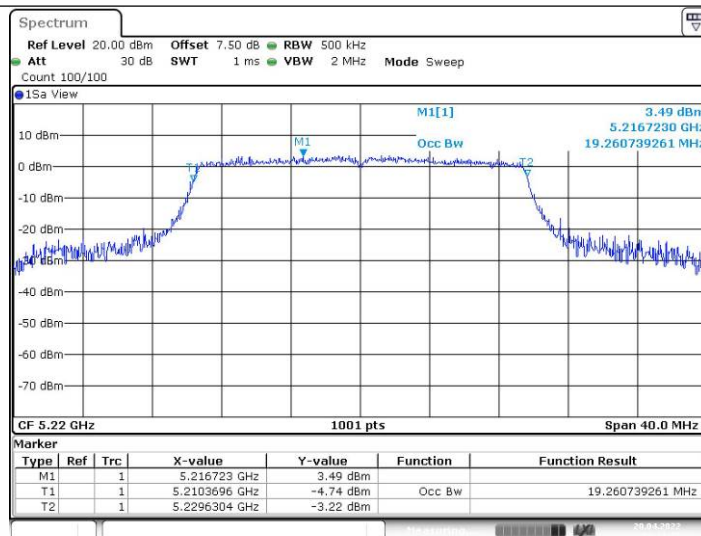


Date: 20 APR 2022 20:11:27

11AX20SISO_Ant2_5220

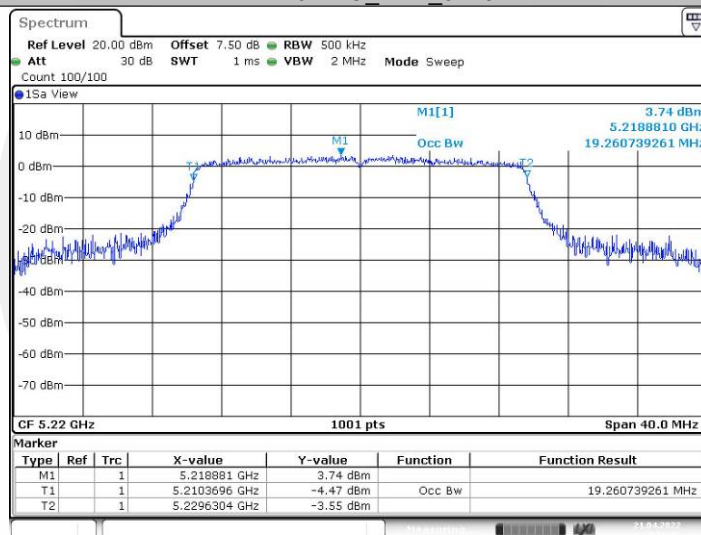


Date: 21 APR 2022 17:36:42

11AX20SISO_Ant1_5240

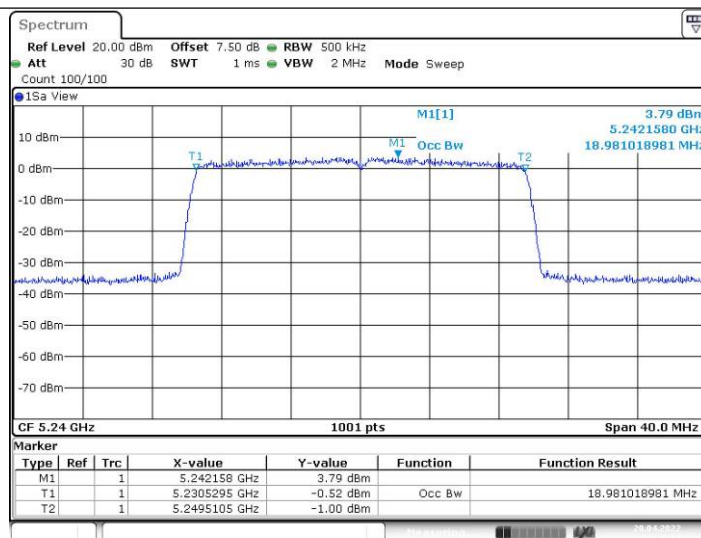


Date: 20 APR 2022 20:16:54

11AX20SISO_Ant2_5240

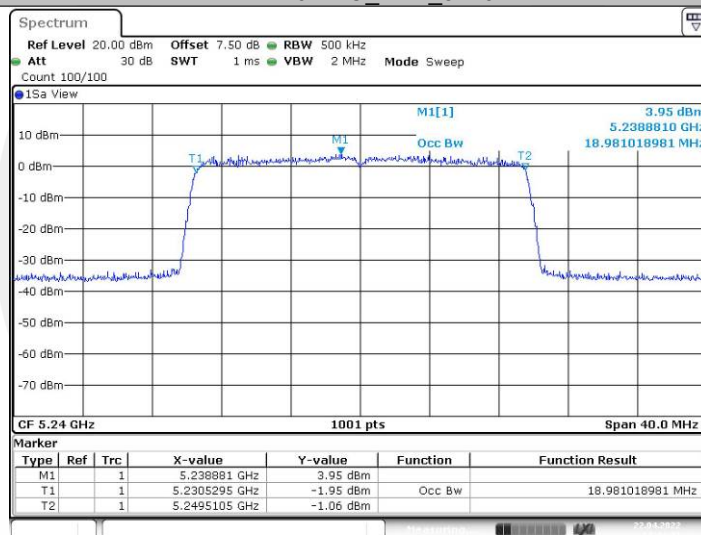


Date: 22 APR 2022 11:44:41

11AX20SISO_Ant1_5745

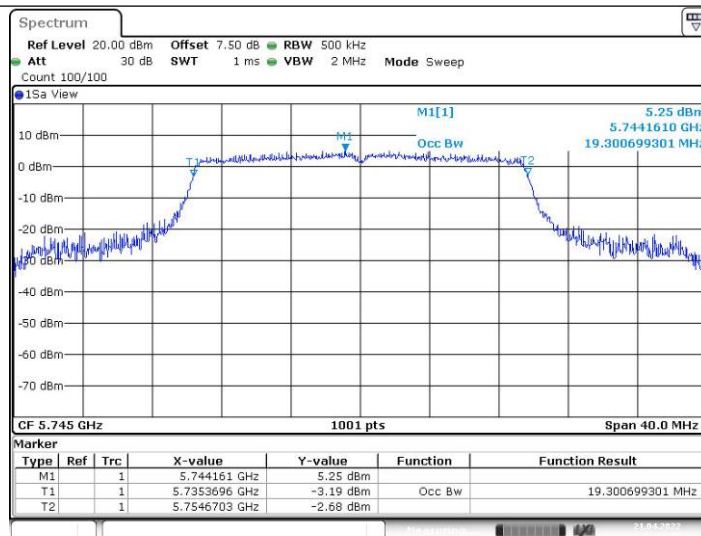


Date: 21 APR 2022 13:20:30

11AX20SISO_Ant2_5745

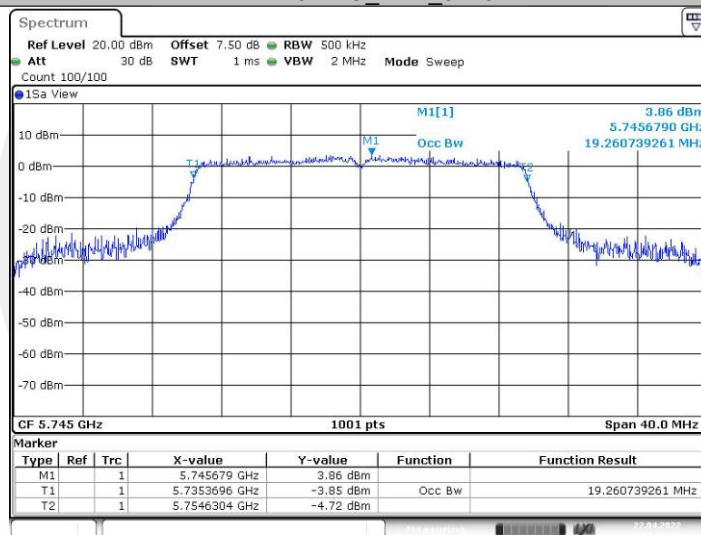


Date: 22 APR 2022 11:53:56

11AX20SISO_Ant1_5785

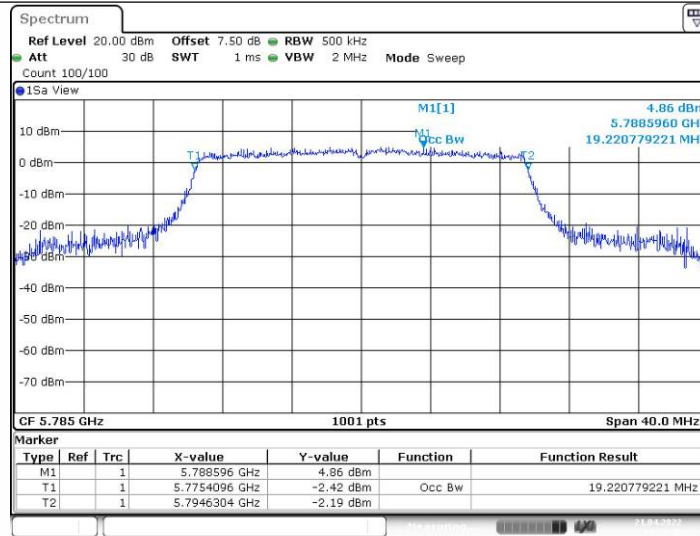


Date: 21 APR 2022 13:28:38

11AX20SISO_Ant2_5785

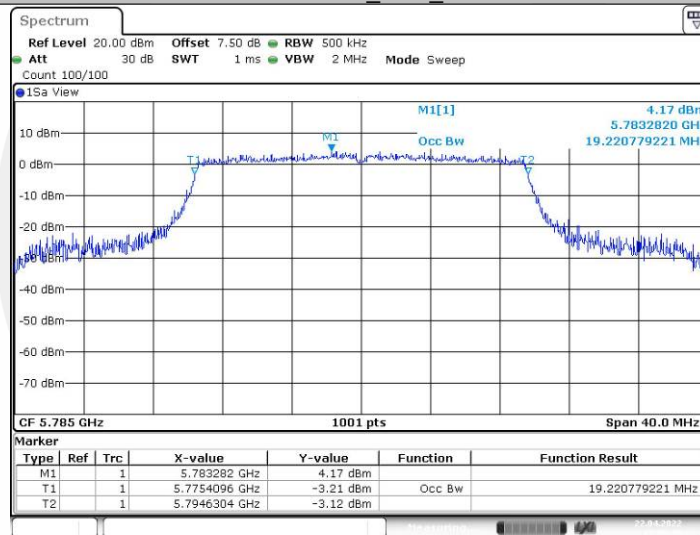


Date: 22 APR 2022 12:00:40

11AX20SISO_Ant1_5825

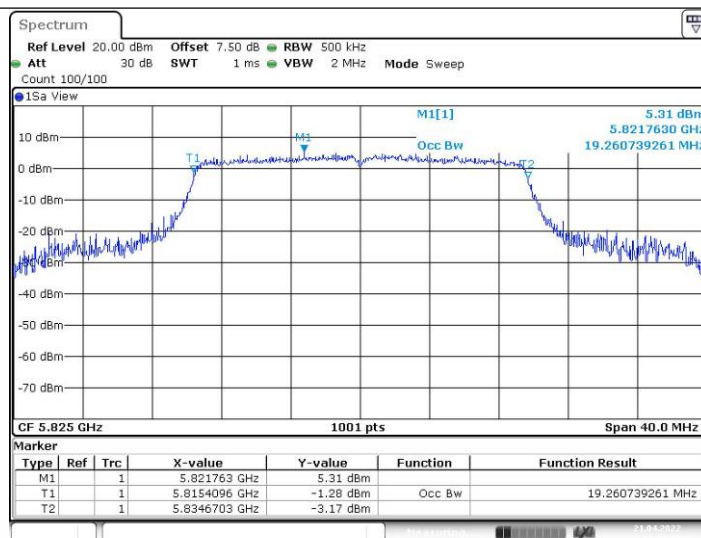


Date: 21 APR 2022 13:34:21

11AX20SISO_Ant2_5825

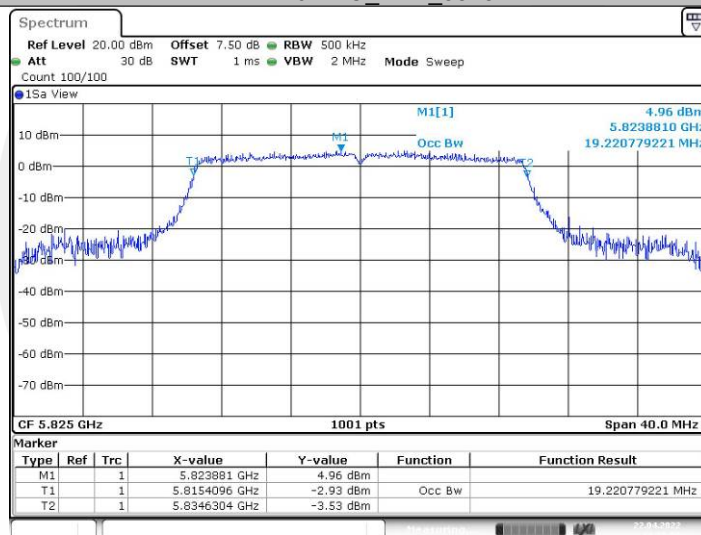


Date: 22 APR 2022 13:17:56

11AX40SISO_Ant1_5190

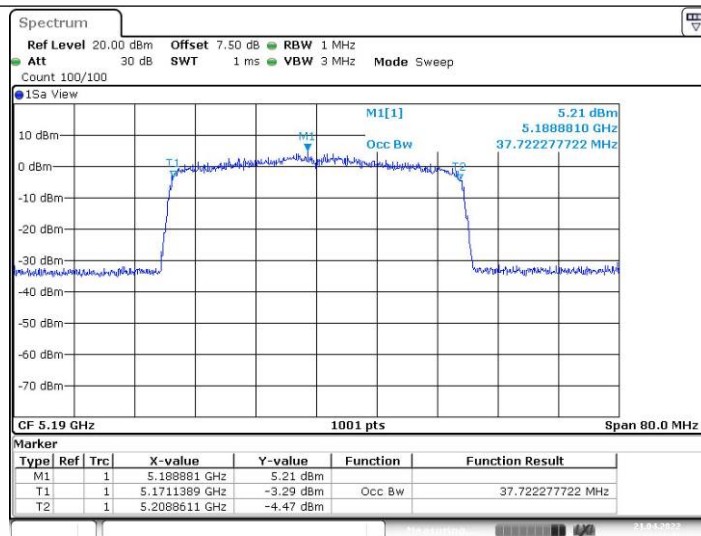


Date: 21 APR 2022 13:41:45

11AX40SISO_Ant2_5190

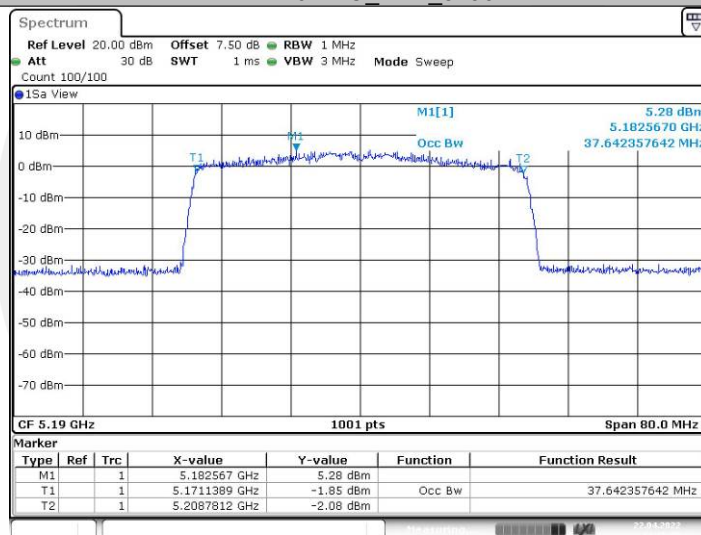


Date: 22 APR 2022 13:25:09


11AX40SISO_Ant1_5230

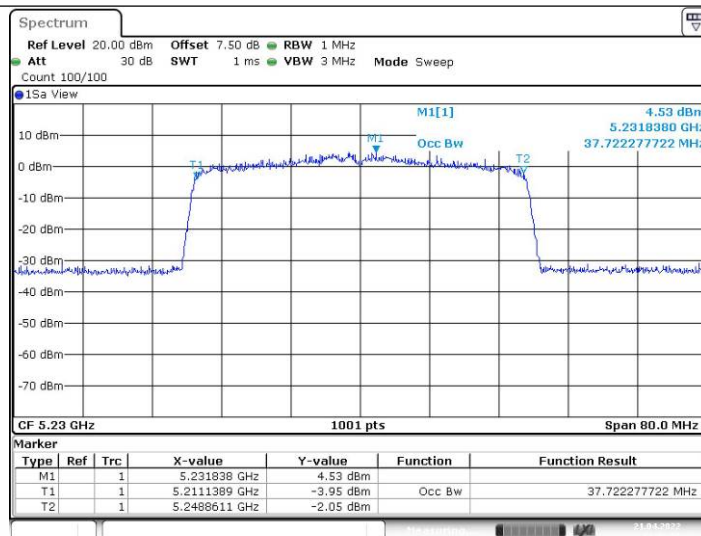

11AX40SISO_Ant2_5230

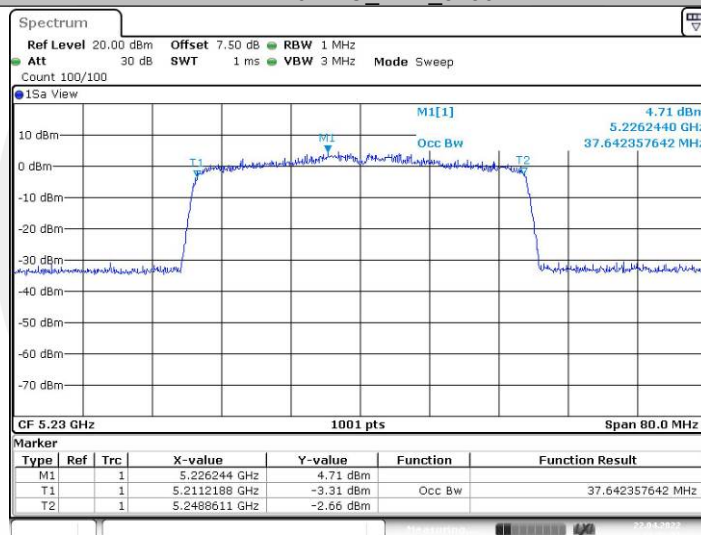


11AX40SISO_Ant1_5755

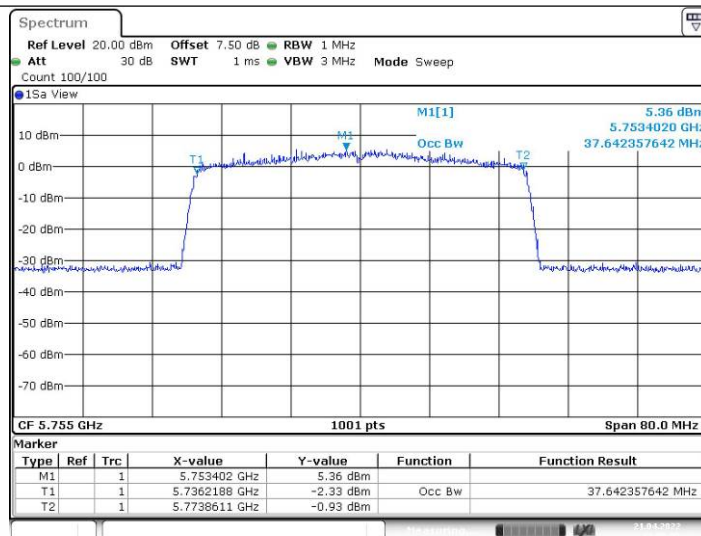


Date: 21 APR 2022 13:57:55

11AX40SISO_Ant2_5755

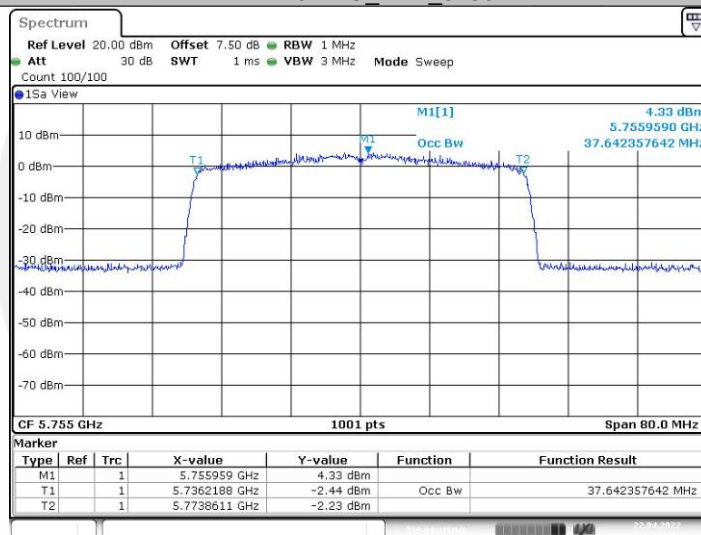


Date: 22 APR 2022 13:41:43

11AX40SISO_Ant1_5795

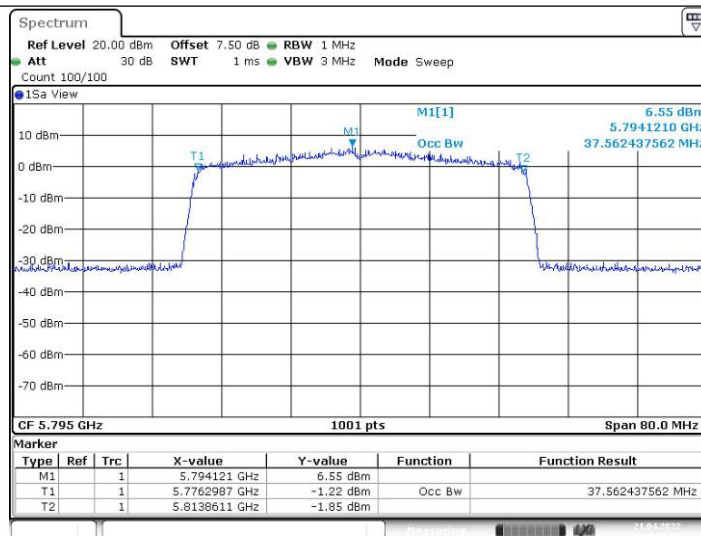


Date: 21 APR 2022 14:04:55

11AX40SISO_Ant2_5795

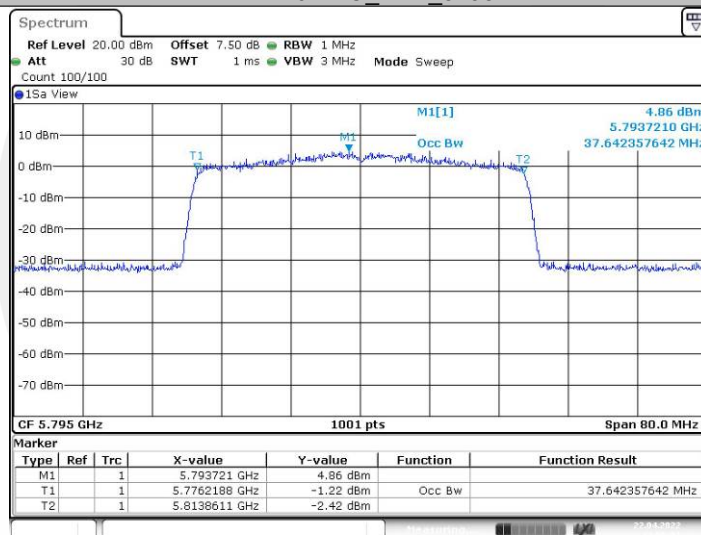


Date: 22 APR 2022 13:55:52

11AX80SISO_Ant1_5210

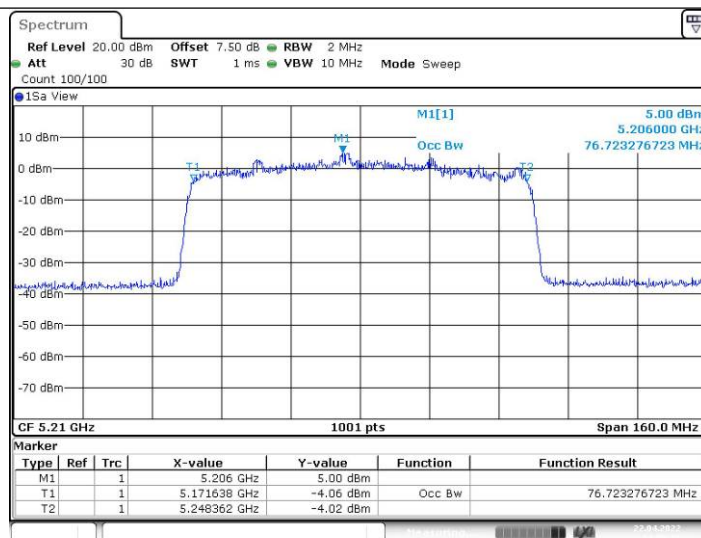


Date: 22 APR 2022 14:59:17

11AX80SISO_Ant2_5210

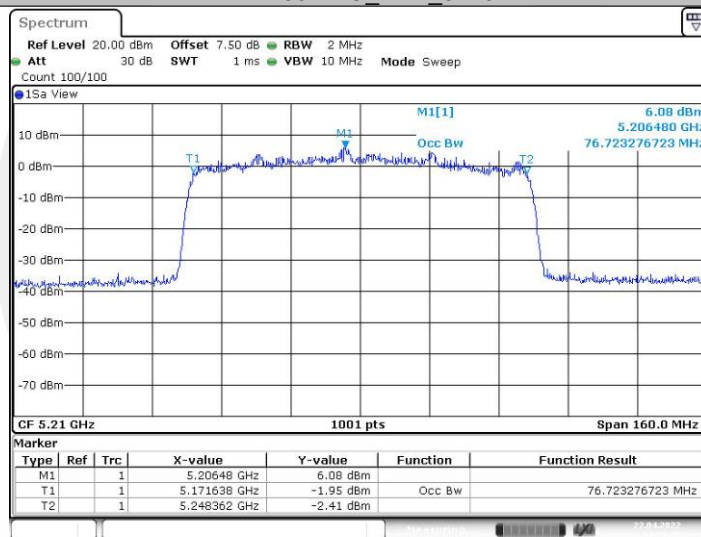


Date: 22 APR 2022 14:21:35

11AX80SISO_Ant1_5775

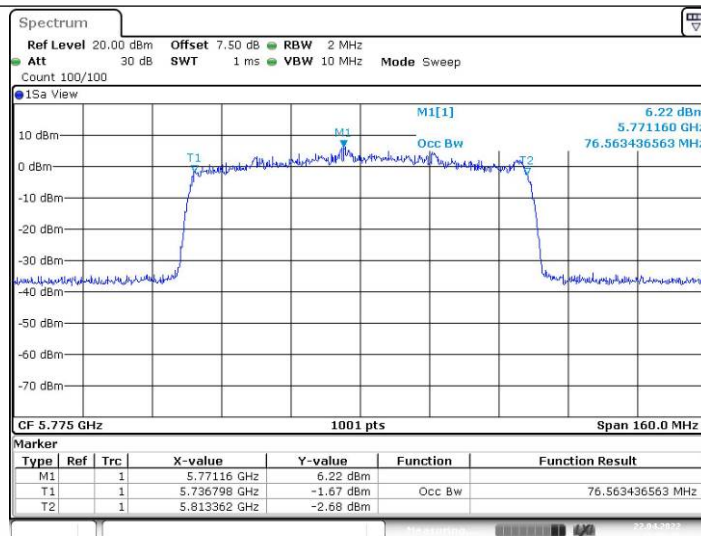

Date: 22 APR 2022 15:09:38

11AX80SISO_Ant2_5775

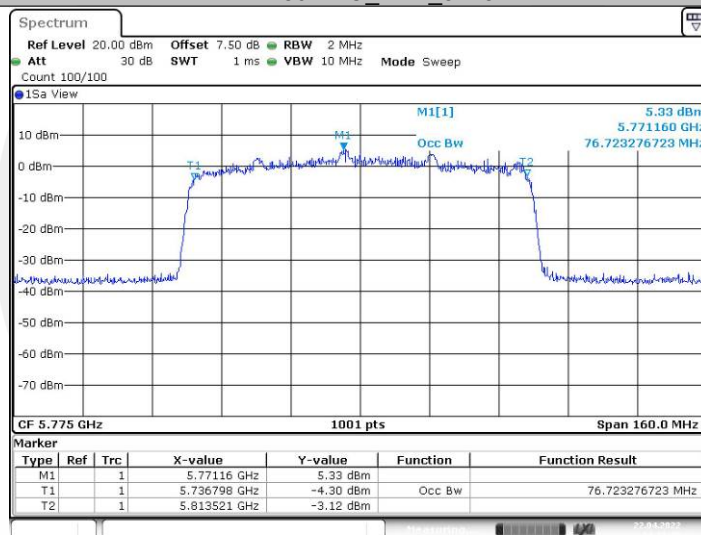


Date: 22 APR 2022 14:31:31

6dB bandwidth


TestMode	Antenna	Frequency[MHz]	6db EBW [MHz]	FL[MHz]	FH[MHz]	Limit[MHz]	Verdict
11A	Ant1	5745	16.36	5736.84	5753.20	0.5	PASS
	Ant2	5745	16.40	5736.80	5753.20	0.5	PASS
	Ant1	5785	16.32	5776.88	5793.20	0.5	PASS
	Ant2	5785	16.32	5776.84	5793.16	0.5	PASS
	Ant1	5825	16.36	5816.84	5833.20	0.5	PASS
	Ant2	5825	16.40	5816.80	5833.20	0.5	PASS
11N20SISO	Ant1	5745	16.96	5736.56	5753.52	0.5	PASS
	Ant2	5745	17.16	5736.52	5753.68	0.5	PASS
	Ant1	5785	17.28	5776.52	5793.80	0.5	PASS
	Ant2	5785	17.56	5776.24	5793.80	0.5	PASS
	Ant1	5825	17.52	5816.28	5833.80	0.5	PASS
	Ant2	5825	17.28	5816.24	5833.52	0.5	PASS
11N40SISO	Ant1	5755	35.12	5737.48	5772.60	0.5	PASS
	Ant2	5755	35.04	5737.48	5772.52	0.5	PASS
	Ant1	5795	35.04	5777.56	5812.60	0.5	PASS
	Ant2	5795	35.04	5777.56	5812.60	0.5	PASS
11AC20SISO	Ant1	5745	17.36	5736.44	5753.80	0.5	PASS
	Ant2	5745	17.28	5736.52	5753.80	0.5	PASS
	Ant1	5785	17.28	5776.56	5793.84	0.5	PASS
	Ant2	5785	17.60	5776.20	5793.80	0.5	PASS
	Ant1	5825	16.88	5816.88	5833.76	0.5	PASS
	Ant2	5825	17.48	5816.32	5833.80	0.5	PASS
11AC40SISO	Ant1	5755	35.12	5737.48	5772.60	0.5	PASS
	Ant2	5755	35.04	5737.48	5772.52	0.5	PASS
	Ant1	5795	35.04	5777.56	5812.60	0.5	PASS
	Ant2	5795	35.12	5777.48	5812.60	0.5	PASS
11AC80SISO	Ant1	5775	75.20	5737.40	5812.60	0.5	PASS
	Ant2	5775	75.20	5737.40	5812.60	0.5	PASS
11AX20SISO	Ant1	5745	18.92	5735.56	5754.48	0.5	PASS
	Ant2	5745	19.00	5735.52	5754.52	0.5	PASS
	Ant1	5785	19.00	5775.52	5794.52	0.5	PASS
	Ant2	5785	19.00	5775.52	5794.52	0.5	PASS
	Ant1	5825	18.92	5815.52	5834.44	0.5	PASS
	Ant2	5825	19.00	5815.52	5834.52	0.5	PASS
11AX40SISO	Ant1	5755	35.12	5737.48	5772.60	0.5	PASS
	Ant2	5755	35.92	5737.48	5773.40	0.5	PASS
	Ant1	5795	35.12	5777.48	5812.60	0.5	PASS
	Ant2	5795	35.12	5777.48	5812.60	0.5	PASS
11AX80SISO	Ant1	5775	75.20	5737.40	5812.60	0.5	PASS
	Ant2	5775	75.20	5737.40	5812.60	0.5	PASS

11A_Ant1_5745

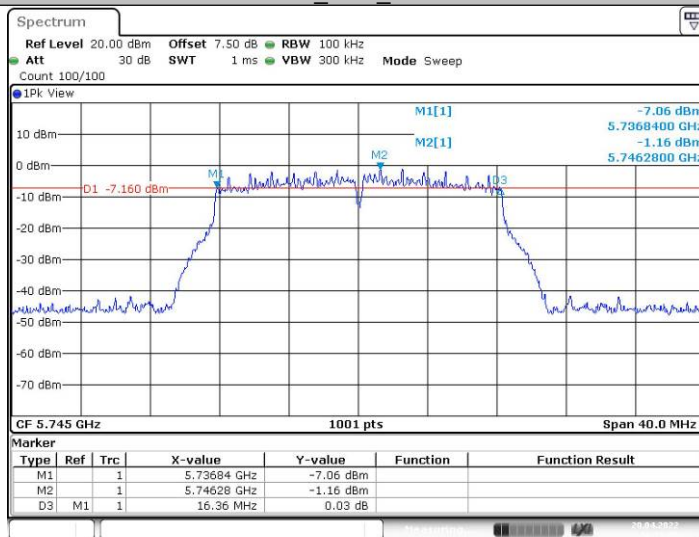


Date: 20 APR 2022 16:26:06

11A_Ant2_5745

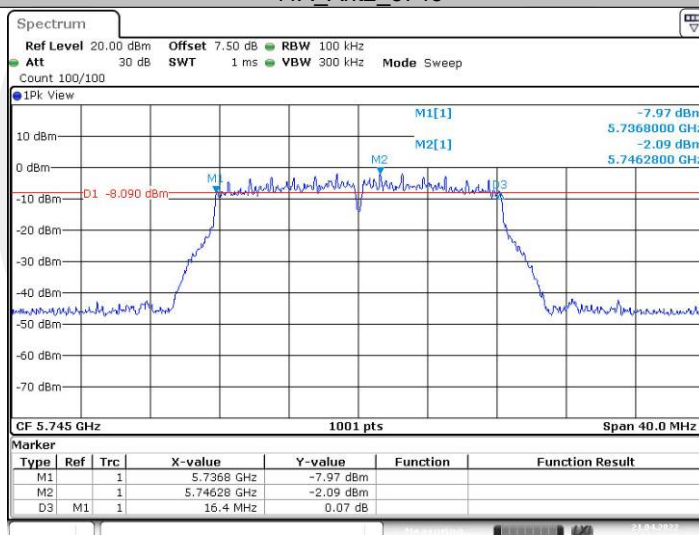


Date: 21 APR 2022 14:40:23

11A_Ant1_5785

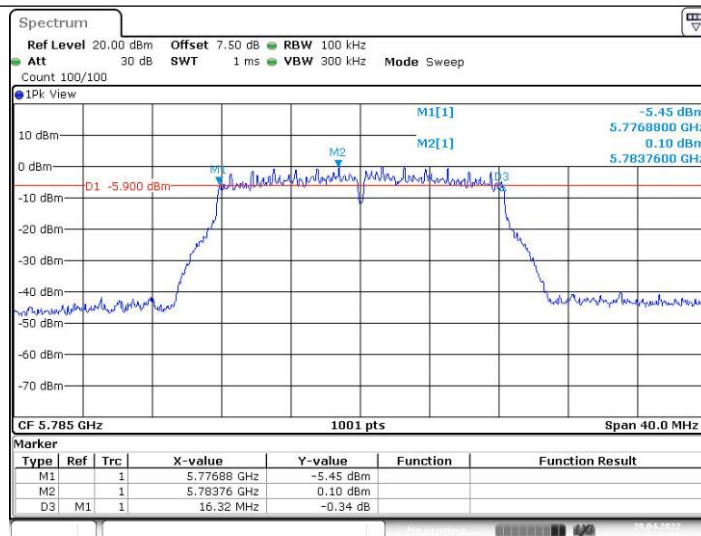


Date: 20 APR 2022 16:35:55

11A_Ant2_5785

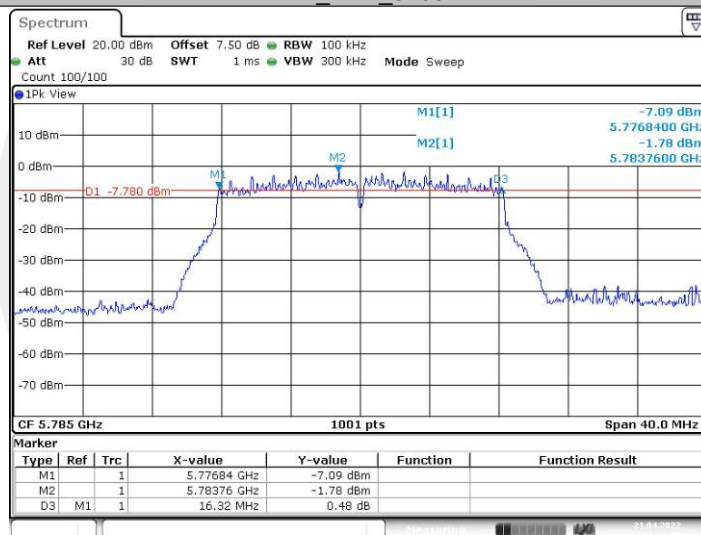


Date: 21 APR 2022 14:47:32

11A_Ant1_5825

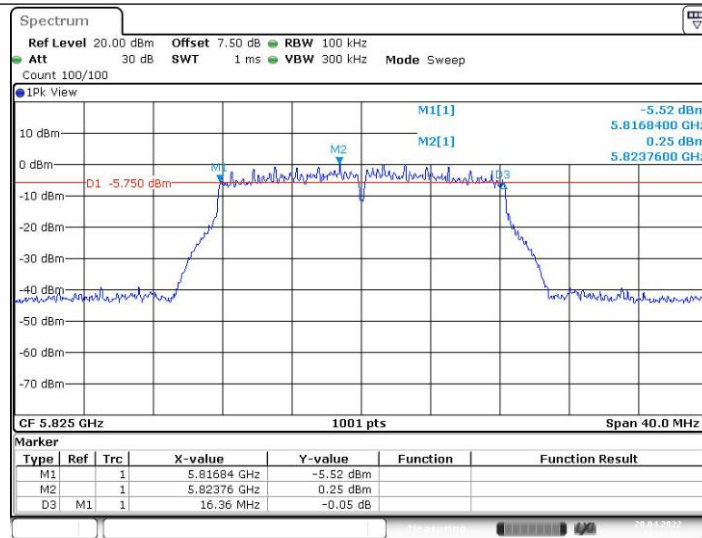


Date: 20 APR 2022 16:43:54

11A_Ant2_5825

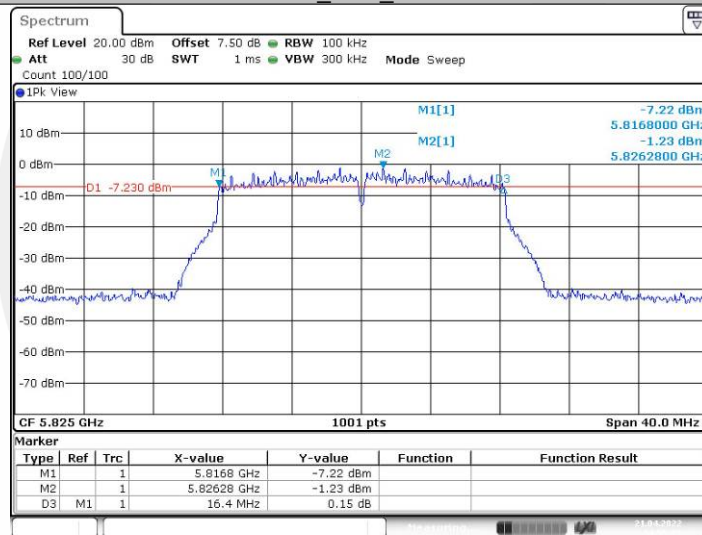


Date: 21 APR 2022 14:55:04

11N20SISO_Ant1_5745

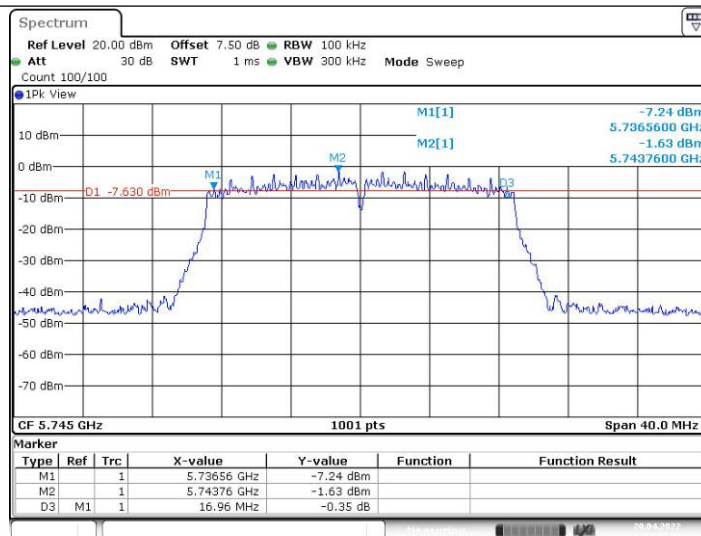


Date: 20 APR 2022 17:15:23

11N20SISO_Ant2_5745

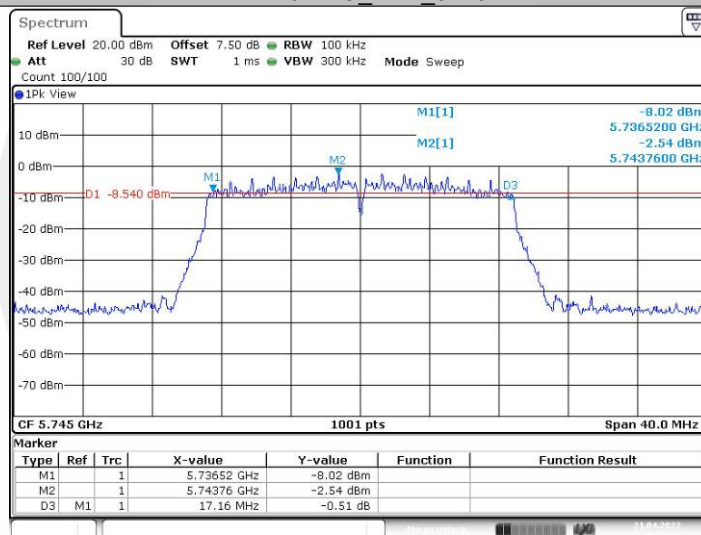


Date: 21 APR 2022 15:27:02

11N20SISO_Ant1_5785

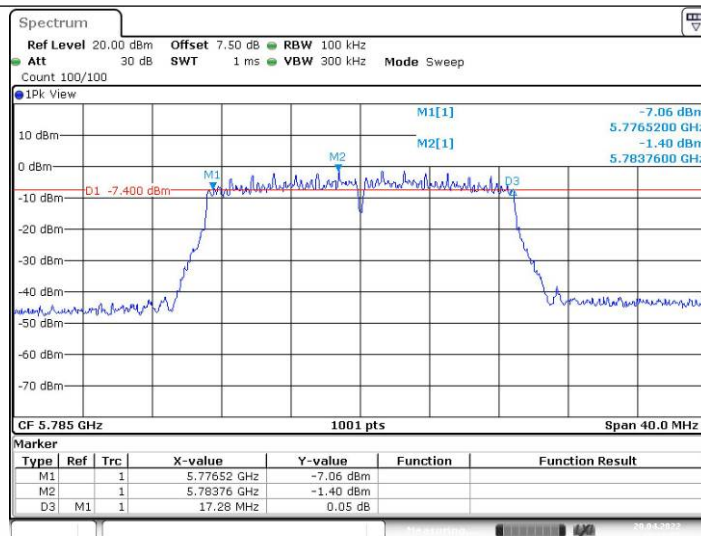


Date: 20 APR 2022 17:22:37

11N20SISO_Ant2_5785

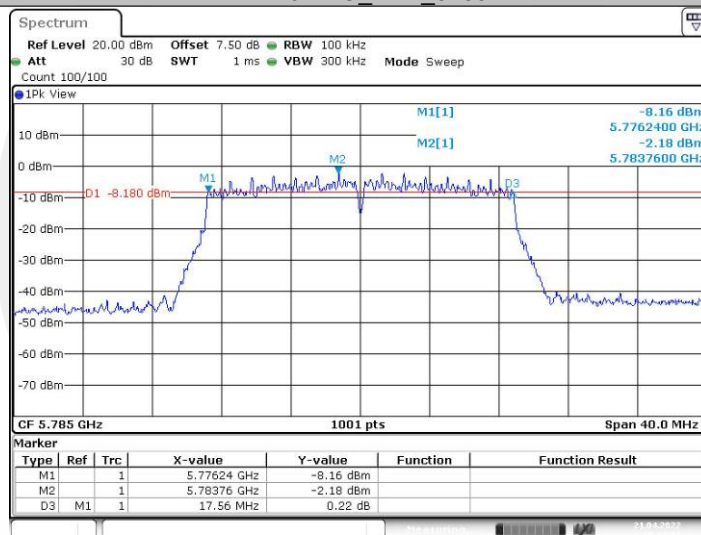


Date: 21 APR 2022 15:34:01

11N20SISO_Ant1_5825

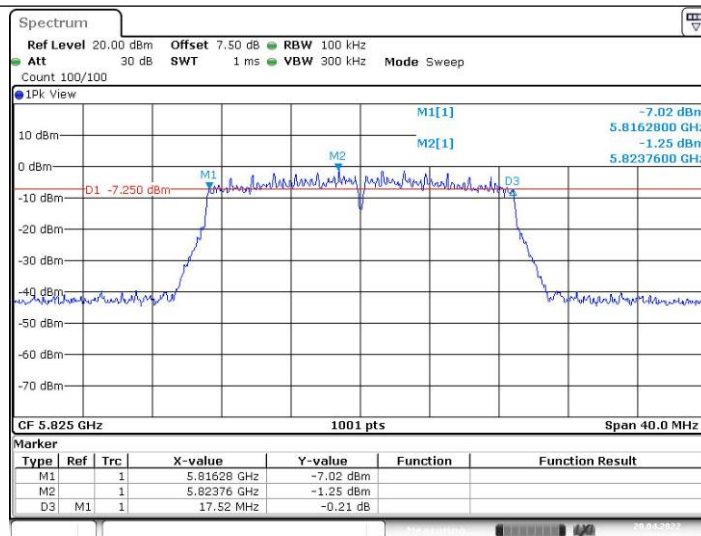


Date: 20 APR 2022 17:30:00

11N20SISO_Ant2_5825

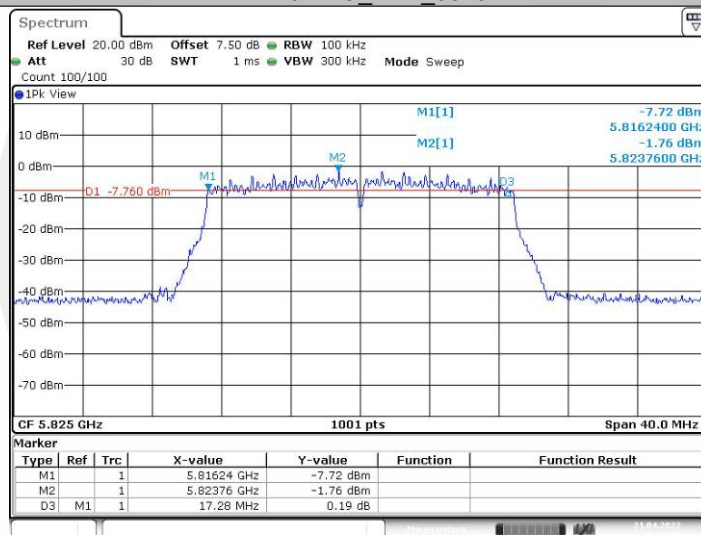


Date: 21 APR 2022 15:39:35

11N40SISO_Ant1_5755

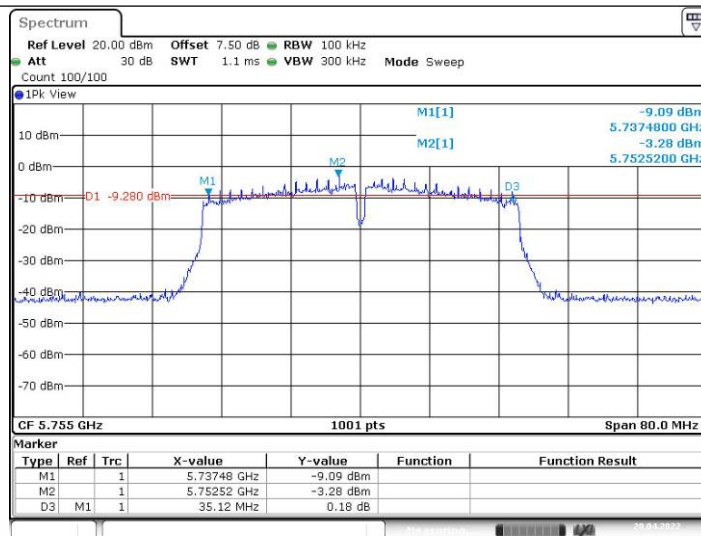


Date: 20 APR 2022 18:19:27

11N40SISO_Ant2_5755

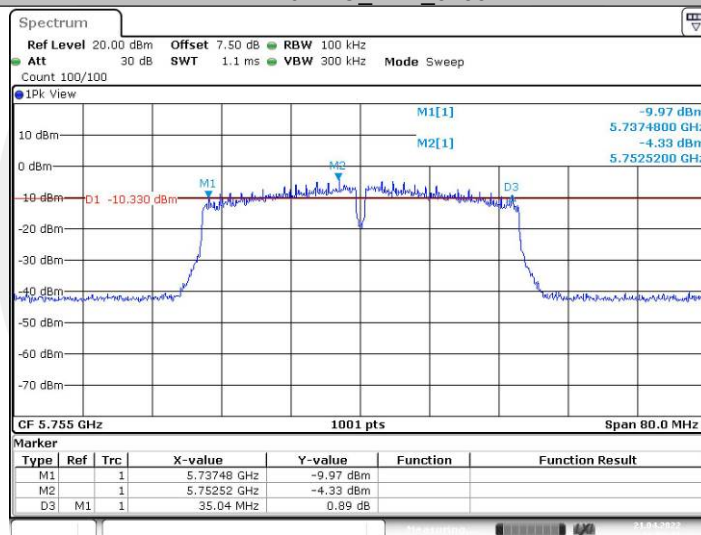


Date: 21 APR 2022 16:03:21

11N40SISO_Ant1_5795

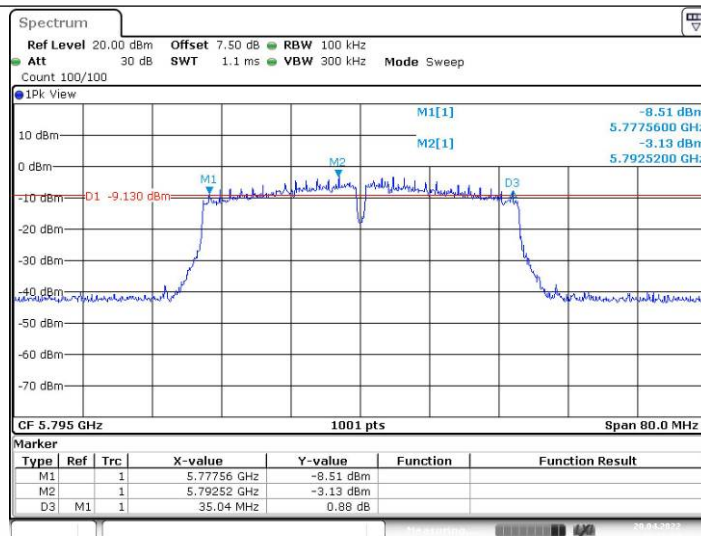


Date: 20 APR 2022 18:26:34

11N40SISO_Ant2_5795

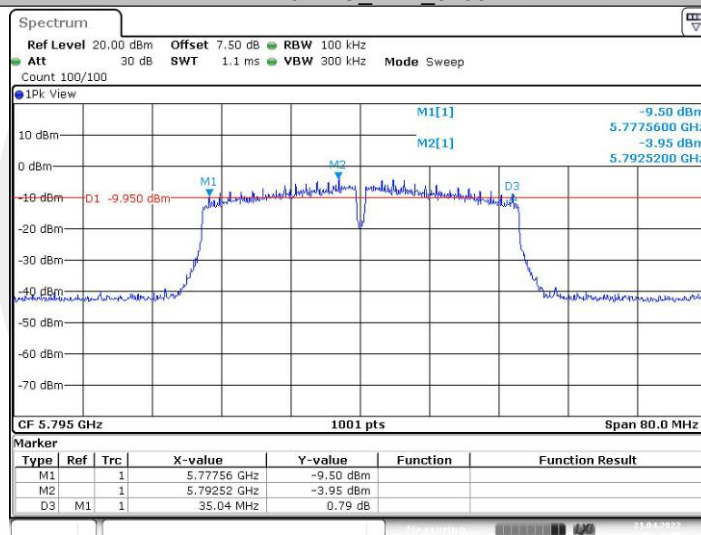


Date: 21 APR 2022 16:10:06

11AC20SISO_Ant1_5745

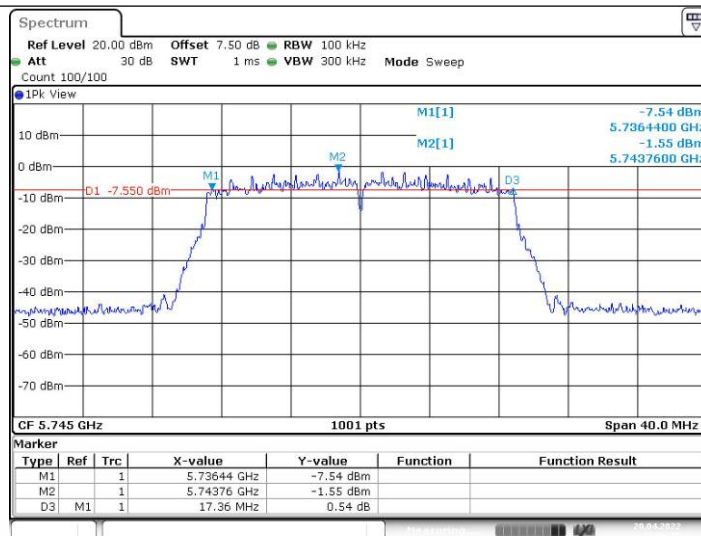


Date: 20 APR 2022 19:00:11

11AC20SISO_Ant2_5745

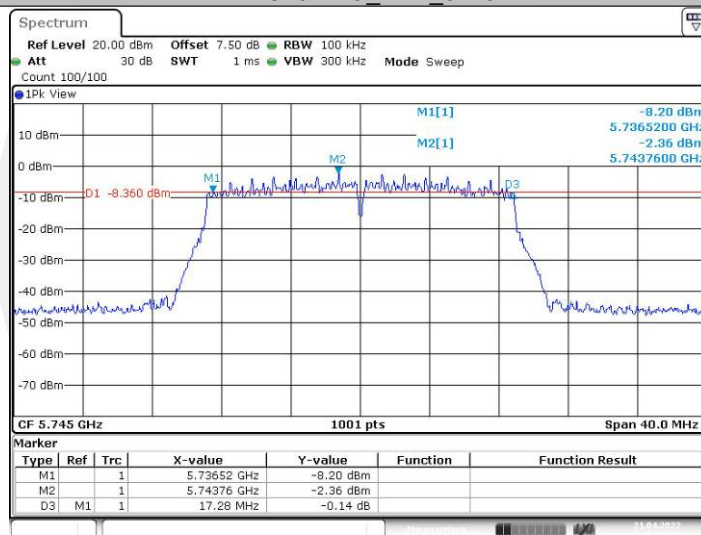


Date: 21 APR 2022 16:37:14

11AC20SISO_Ant1_5785

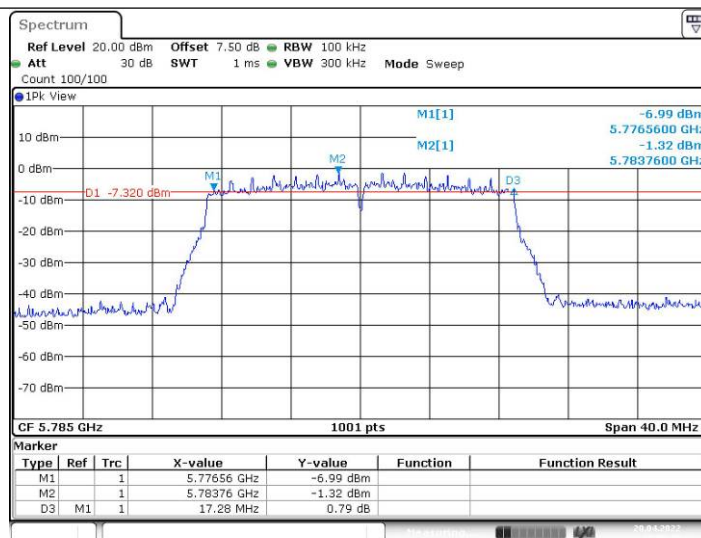


Date: 20 APR 2022 19:08:48

11AC20SISO_Ant2_5785

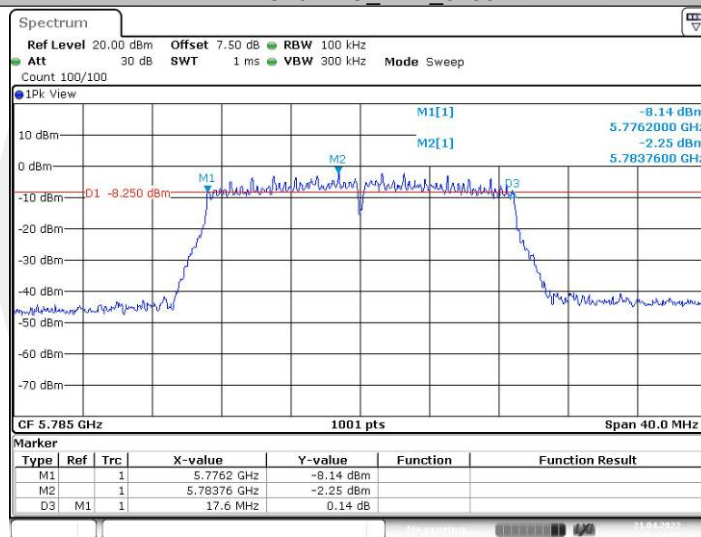


Date: 21 APR 2022 16:44:02

11AC20SISO_Ant1_5825

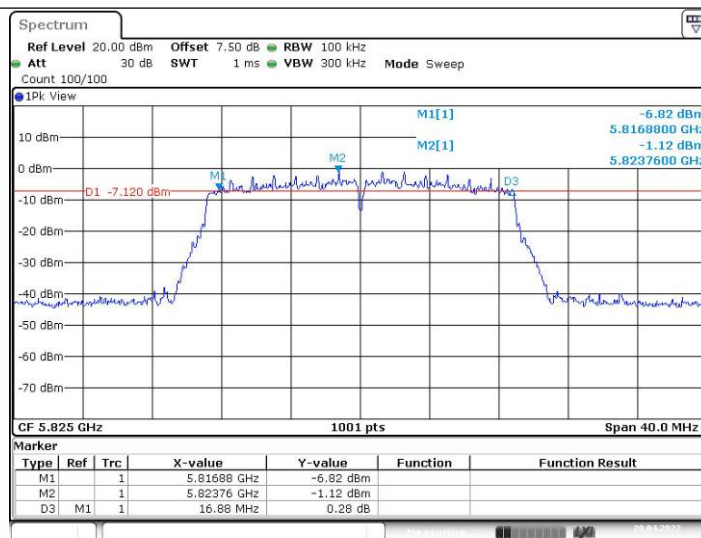


Date: 20 APR 2022 19:19:04

11AC20SISO_Ant2_5825

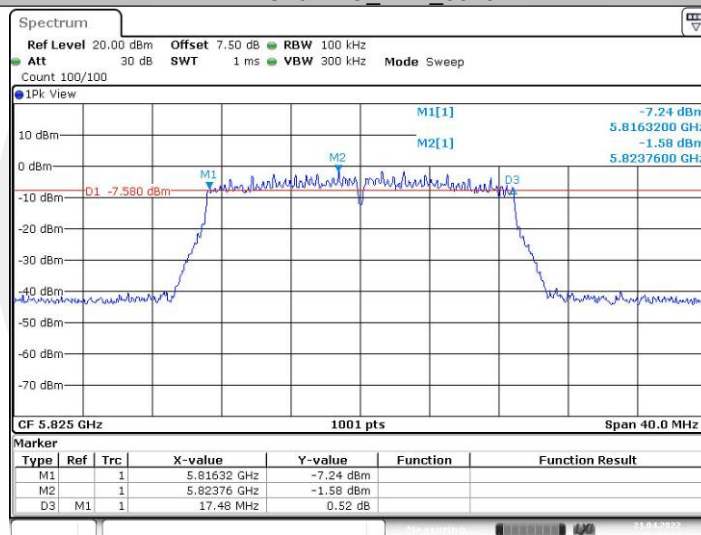


Date: 21 APR 2022 16:49:35

11AC40SISO_Ant1_5755

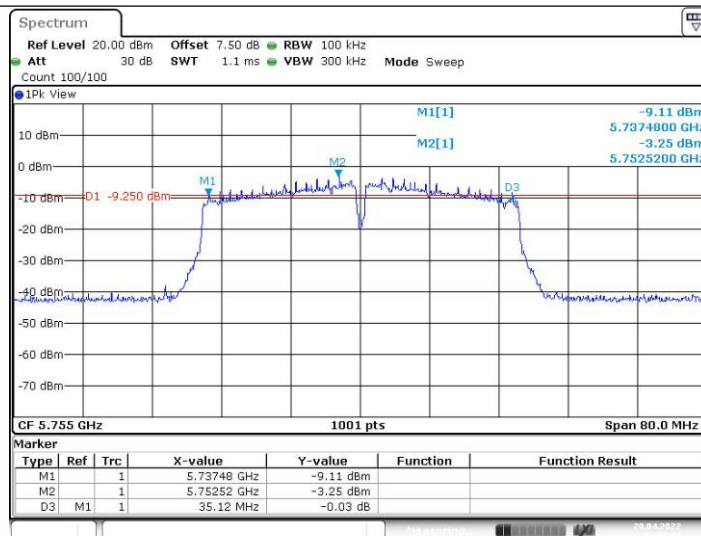

Date: 20 APR 2022 19:49:44

11AC40SISO_Ant2_5755

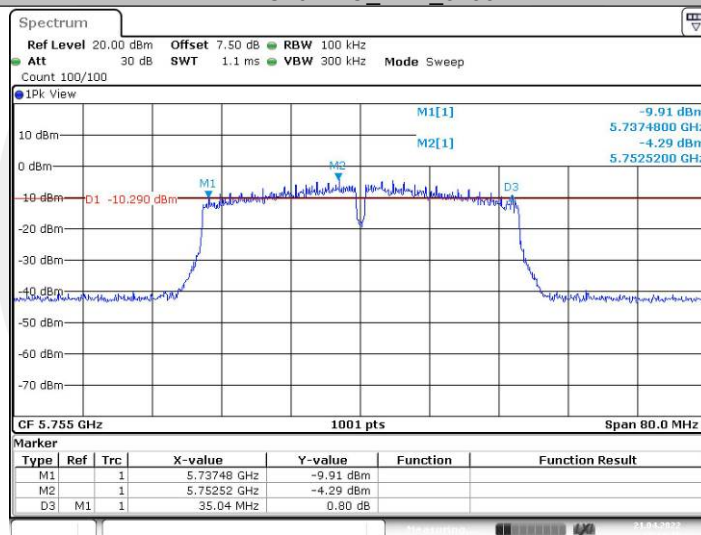

Date: 21 APR 2022 17:14:10

11AC40SISO_Ant1_5795