

Appendix Test Data

Report No.:	1812C60258612504-01	Test Sample No.:	1-2-2
Start Test Date:	2026-5-13	Finish Test Date:	2026-5-25
Test Engineer:	Pearl Ao	Auditor:	Justin Feng
Temperature:	24.5°C	Relative Humidity:	64%
Pressure:	101kPa		



Appendix A1: 26dB Bandwidth

Test Result

Test Mode	Antenna	Frequency[MHz]	26db EBW [MHz]	FL[MHz]	FH[MHz]	Limit[MHz]	Verdict
11A	Ant1	5180	27.280	5166.080	5193.360	---	---
11A	Ant1	5220	27.000	5206.000	5233.000	---	---
11A	Ant1	5240	28.080	5226.000	5254.080	---	---
11A	Ant1	5745	27.680	5730.280	5757.960	---	---
11A	Ant1	5785	25.080	5772.320	5797.400	---	---
11A	Ant1	5825	27.400	5811.160	5838.560	---	---
11N20SISO	Ant1	5180	27.360	5166.040	5193.400	---	---
11N20SISO	Ant1	5220	28.400	5205.280	5233.680	---	---
11N20SISO	Ant1	5240	28.440	5225.520	5253.960	---	---
11N20SISO	Ant1	5745	27.120	5731.000	5758.120	---	---
11N20SISO	Ant1	5785	29.120	5770.200	5799.320	---	---
11N20SISO	Ant1	5825	27.840	5811.280	5839.120	---	---
11N40SISO	Ant1	5190	49.280	5166.080	5215.360	---	---
11N40SISO	Ant1	5230	46.800	5207.040	5253.840	---	---
11N40SISO	Ant1	5755	47.760	5730.360	5778.120	---	---
11N40SISO	Ant1	5795	48.720	5770.360	5819.080	---	---
11AC20SISO	Ant1	5180	26.840	5166.600	5193.440	---	---
11AC20SISO	Ant1	5220	27.240	5206.320	5233.560	---	---
11AC20SISO	Ant1	5240	27.000	5226.480	5253.480	---	---
11AC20SISO	Ant1	5745	28.480	5731.000	5759.480	---	---
11AC20SISO	Ant1	5785	28.120	5770.720	5798.840	---	---
11AC20SISO	Ant1	5825	29.840	5809.840	5839.680	---	---
11AC40SISO	Ant1	5190	48.320	5165.520	5213.840	---	---
11AC40SISO	Ant1	5230	47.440	5206.080	5253.520	---	---

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com


11AC40SISO	Ant1	5755	48.880	5729.560	5778.440	---	---
11AC40SISO	Ant1	5795	50.000	5769.640	5819.640	---	---
11AC80SISO	Ant1	5210	88.640	5165.680	5254.320	---	---
11AC80SISO	Ant1	5775	89.120	5730.680	5819.800	---	---

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

Test Graphs

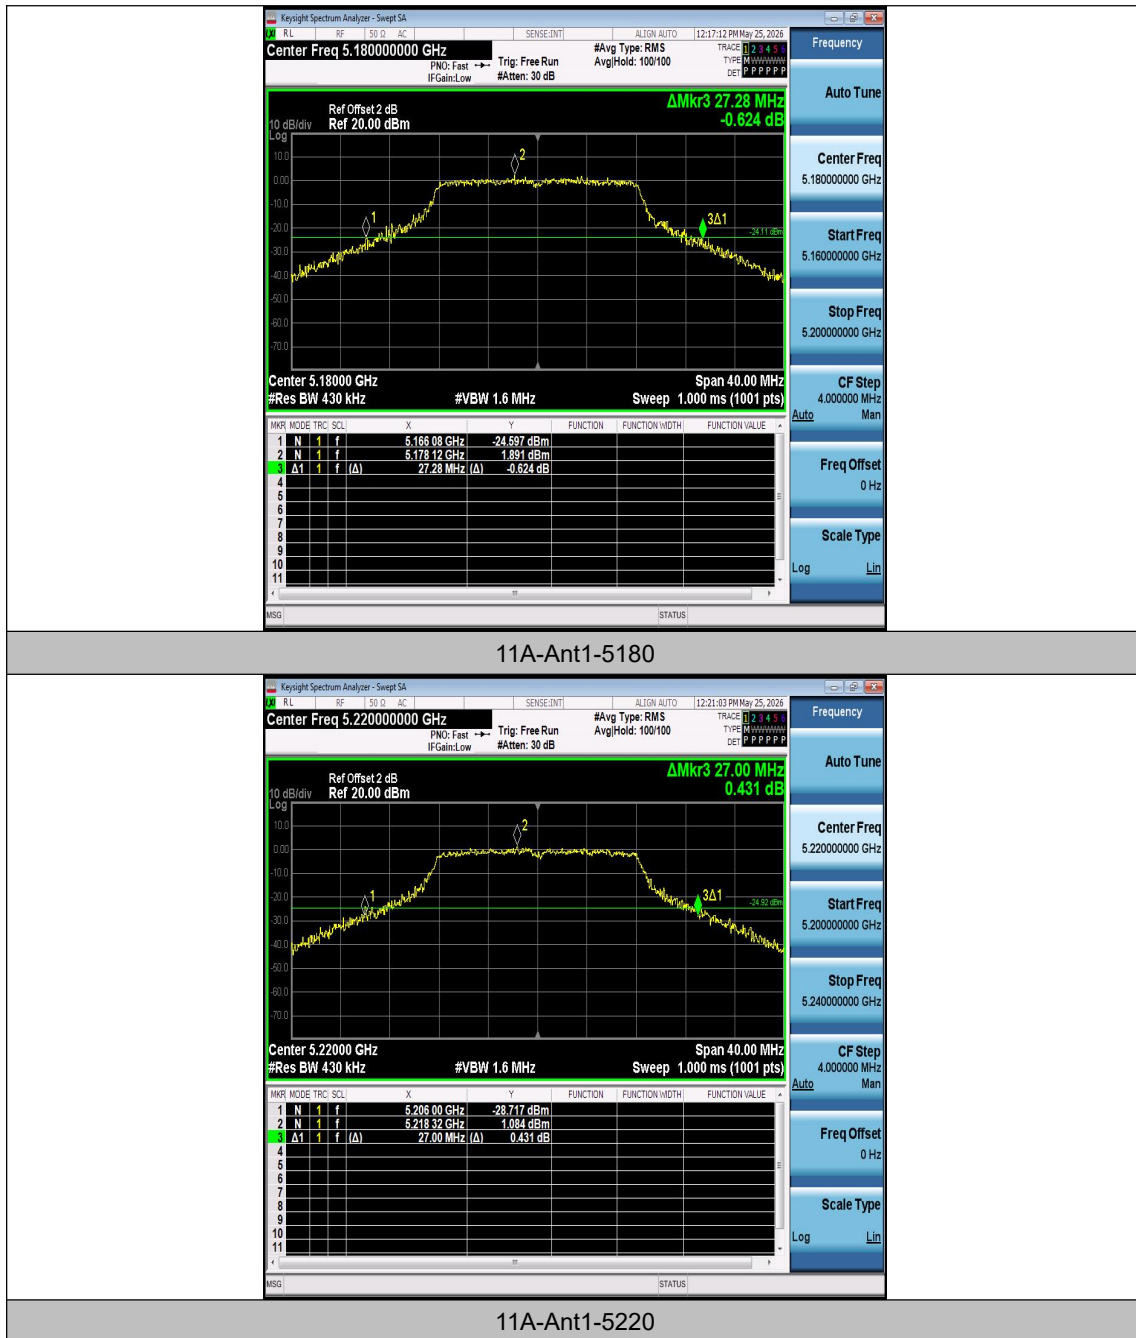

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com



11A-Ant1-5240



11A-Ant1-5745

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com



11A-Ant1-5785



11A-Ant1-5825



Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com



Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

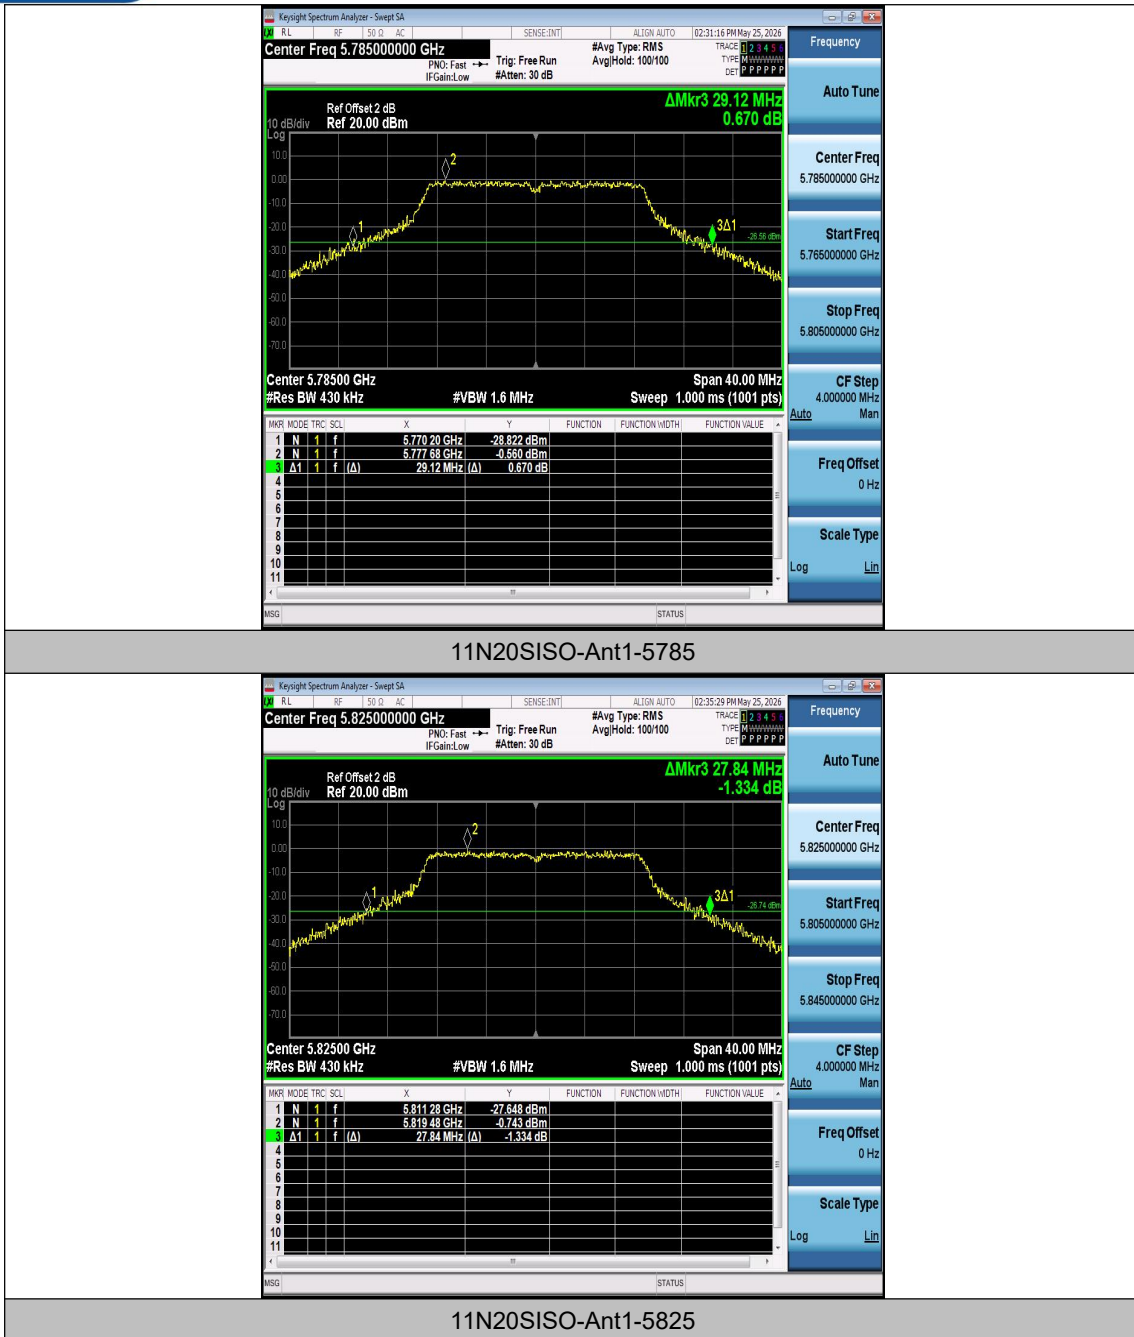


Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com



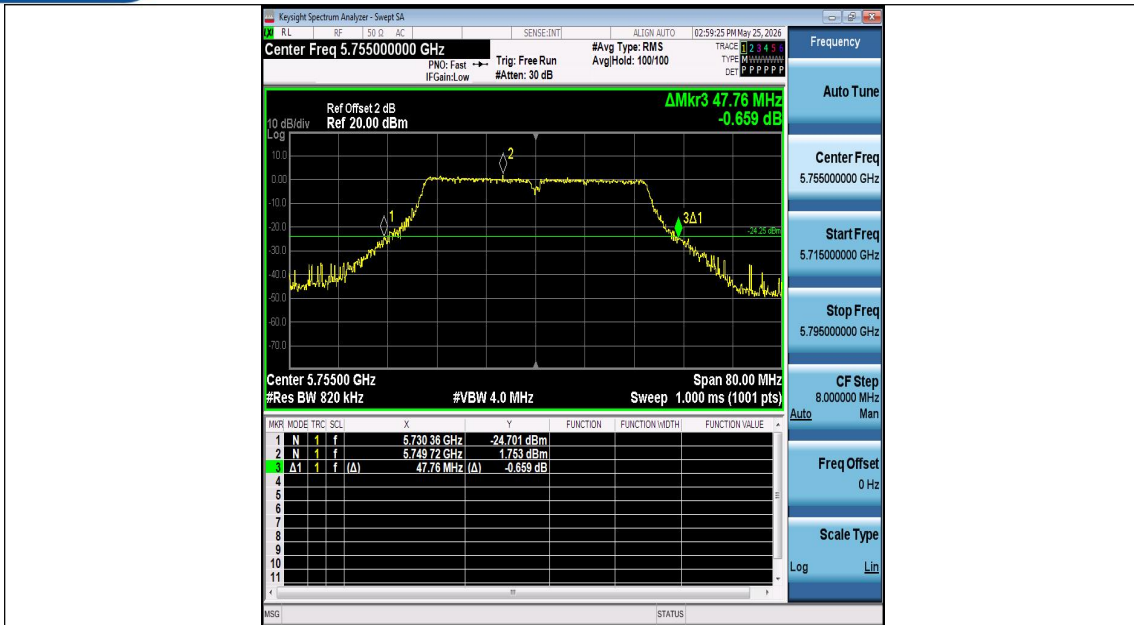

11N40SISO-Ant1-5755



11N40SISO-Ant1-5795



11AC20SISO-Ant1-5180



11AC20SISO-Ant1-5220



Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com



Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com



Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com



Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

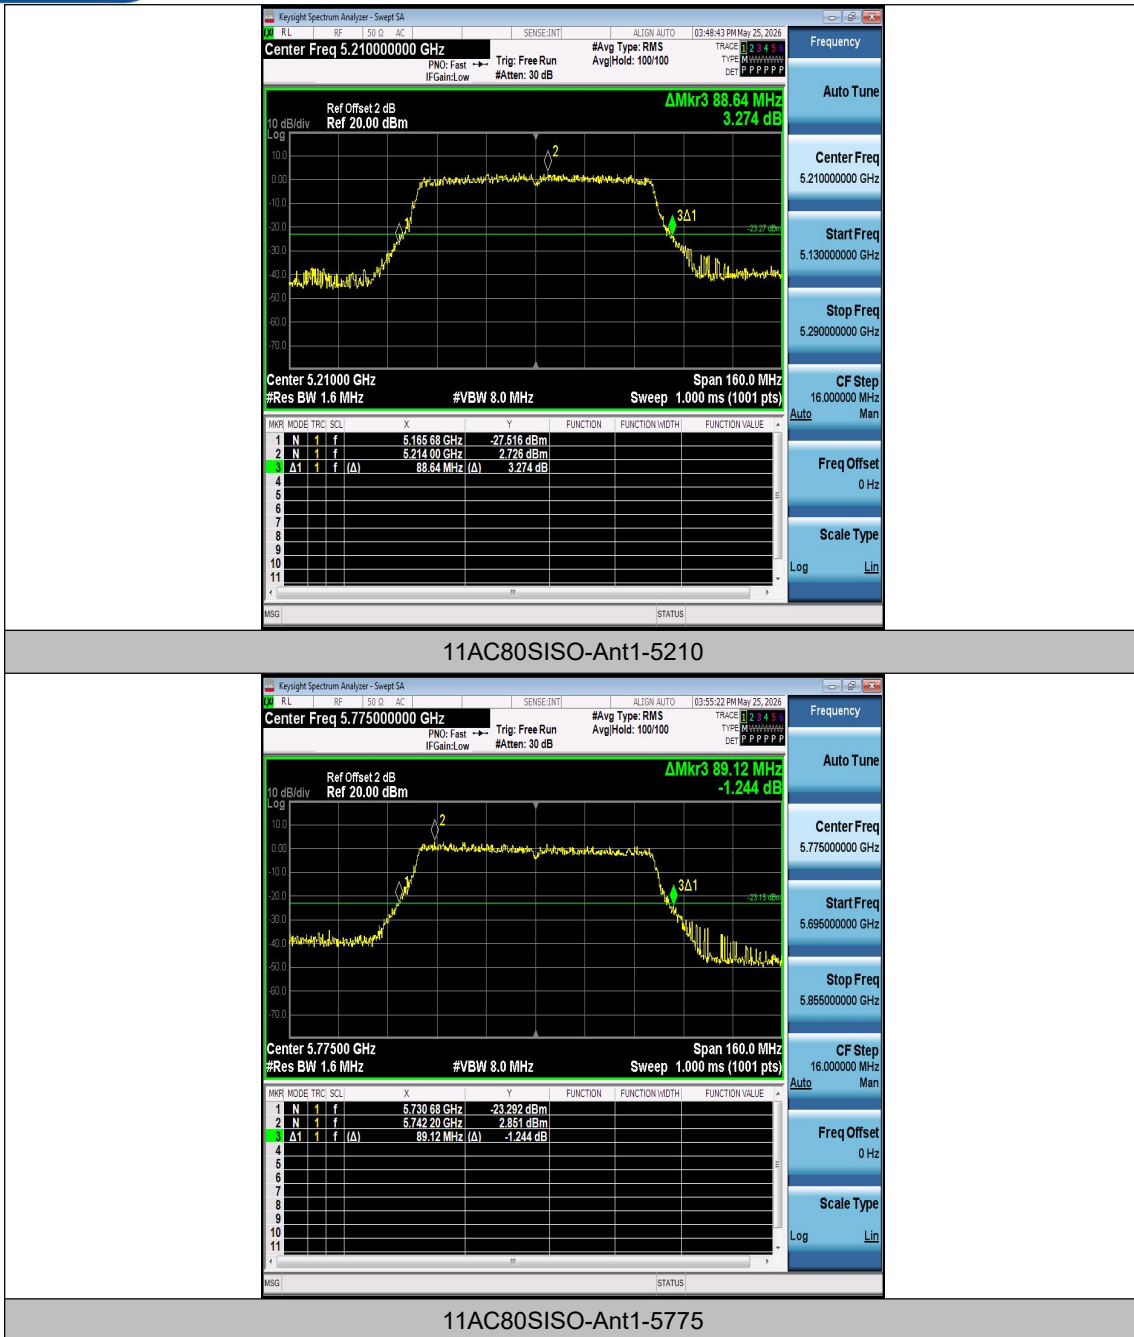

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

Appendix A2: 99% Occupied Bandwidth

Test Result

Test Mode	Antenna	Frequency[MHz]	OCB [MHz]	FL[MHz]	FH[MHz]	Limit[MHz]	Verdict
11A	Ant1	5180	17.471	5171.2522	5188.7232	---	---
11A	Ant1	5220	17.508	5211.2282	5228.7362	---	---
11A	Ant1	5240	17.446	5231.2930	5248.7390	---	---
11A	Ant1	5745	17.488	5736.1741	5753.6621	---	---
11A	Ant1	5785	17.724	5776.0065	5793.7305	---	---
11A	Ant1	5825	17.696	5816.0308	5833.7268	---	---
11N20SISO	Ant1	5180	18.586	5170.6552	5189.2412	---	---
11N20SISO	Ant1	5220	18.512	5210.7458	5229.2578	---	---
11N20SISO	Ant1	5240	18.604	5230.6452	5249.2492	---	---
11N20SISO	Ant1	5745	18.872	5735.4651	5754.3371	---	---
11N20SISO	Ant1	5785	18.783	5775.5555	5794.3385	---	---
11N20SISO	Ant1	5825	18.652	5815.6539	5834.3059	---	---
11N40SISO	Ant1	5190	36.919	5171.5221	5208.4411	---	---
11N40SISO	Ant1	5230	36.851	5211.6193	5248.4703	---	---
11N40SISO	Ant1	5755	37.287	5736.2983	5773.5853	---	---
11N40SISO	Ant1	5795	37.170	5776.3713	5813.5413	---	---
11AC20SISO	Ant1	5180	18.526	5170.7069	5189.2329	---	---
11AC20SISO	Ant1	5220	18.522	5210.7527	5229.2747	---	---
11AC20SISO	Ant1	5240	18.627	5230.6597	5249.2867	---	---
11AC20SISO	Ant1	5745	18.695	5735.5966	5754.2916	---	---
11AC20SISO	Ant1	5785	18.721	5775.5625	5794.2835	---	---
11AC20SISO	Ant1	5825	18.740	5815.5825	5834.3225	---	---
11AC40SISO	Ant1	5190	36.765	5171.6024	5208.3674	---	---
11AC40SISO	Ant1	5230	36.947	5211.6247	5248.5717	---	---
11AC40SISO	Ant1	5755	37.225	5736.3024	5773.5274	---	---
11AC40SISO	Ant1	5795	37.299	5776.2863	5813.5853	---	---
11AC80SISO	Ant1	5210	76.412	5171.9467	5248.3587	---	---
11AC80SISO	Ant1	5775	76.672	5736.4829	5813.1549	---	---


Test Graphs




Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

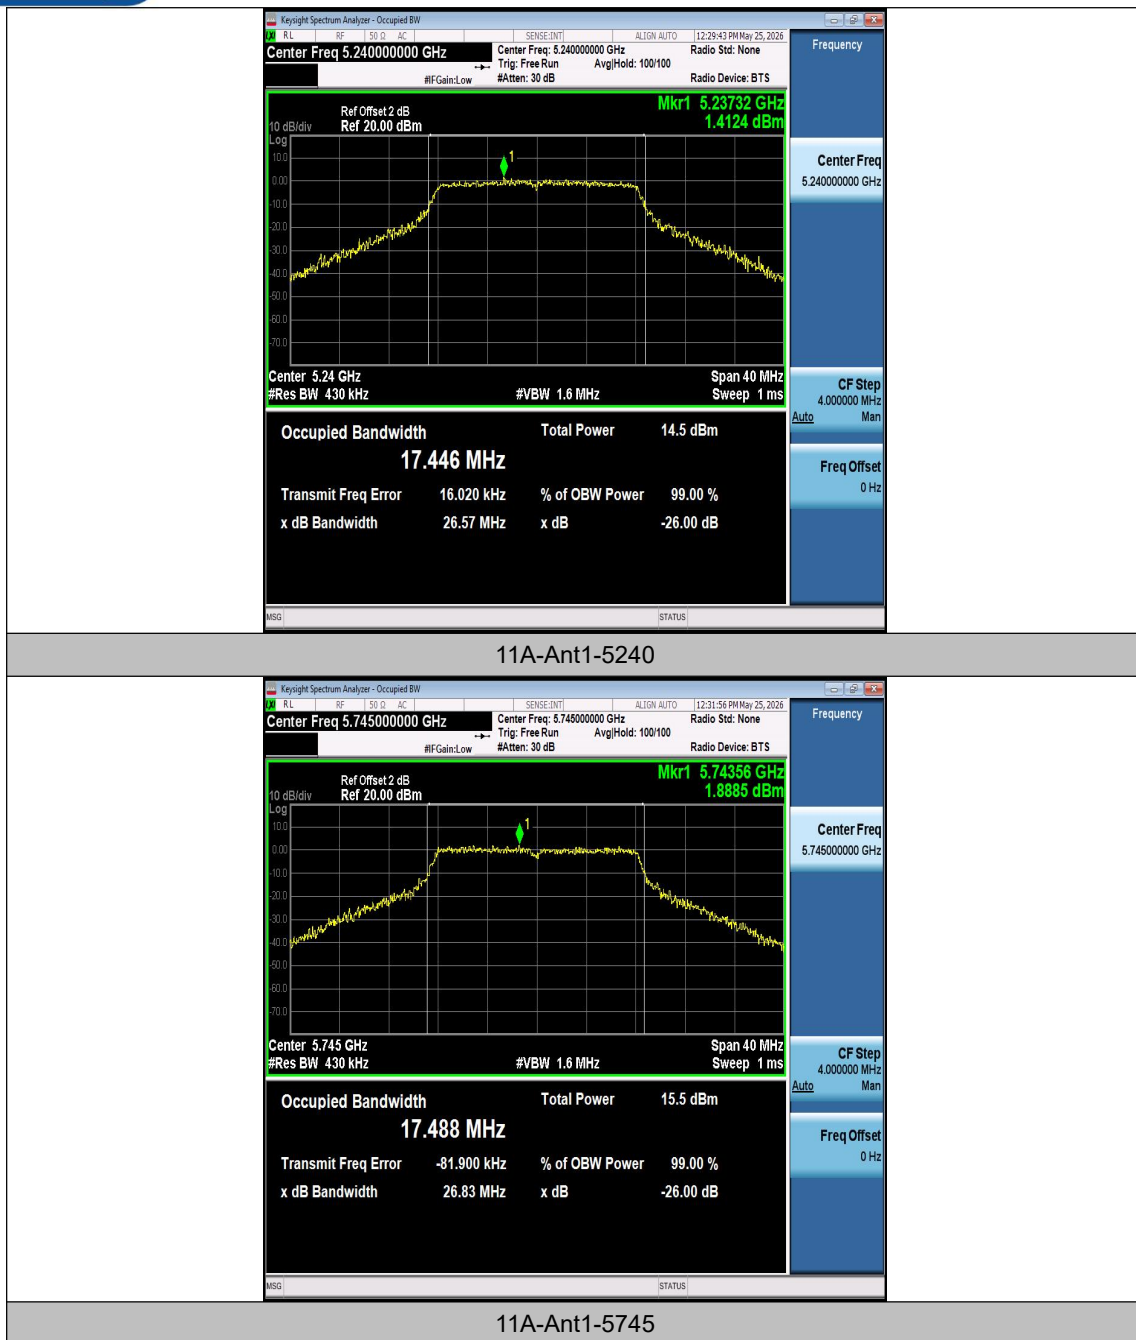

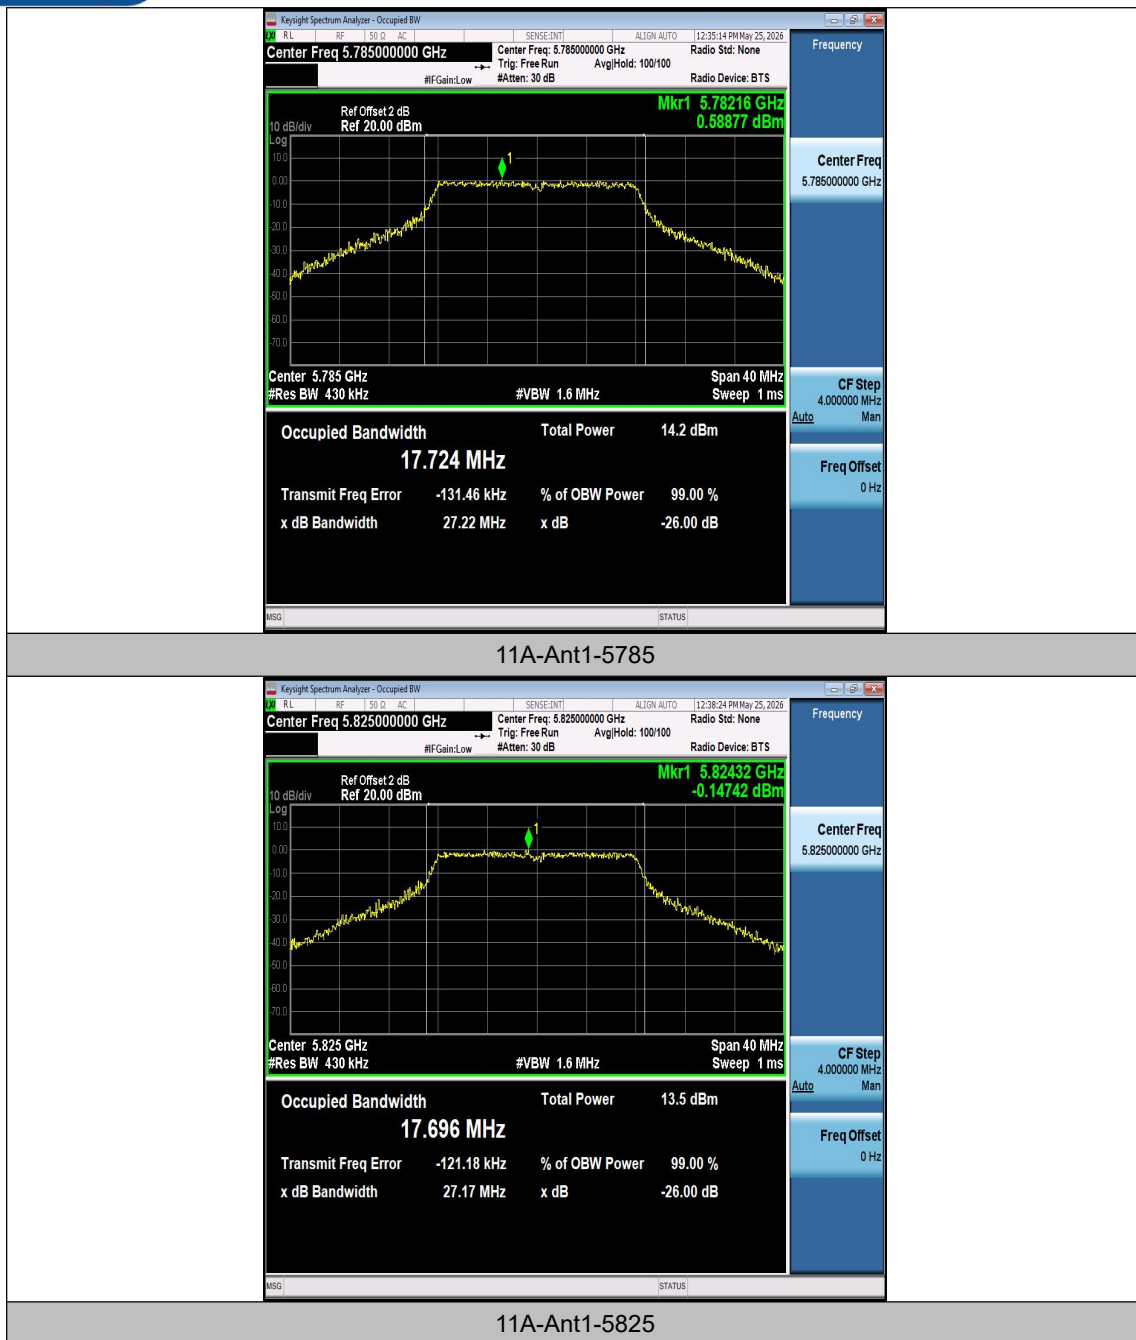

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com



Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com