



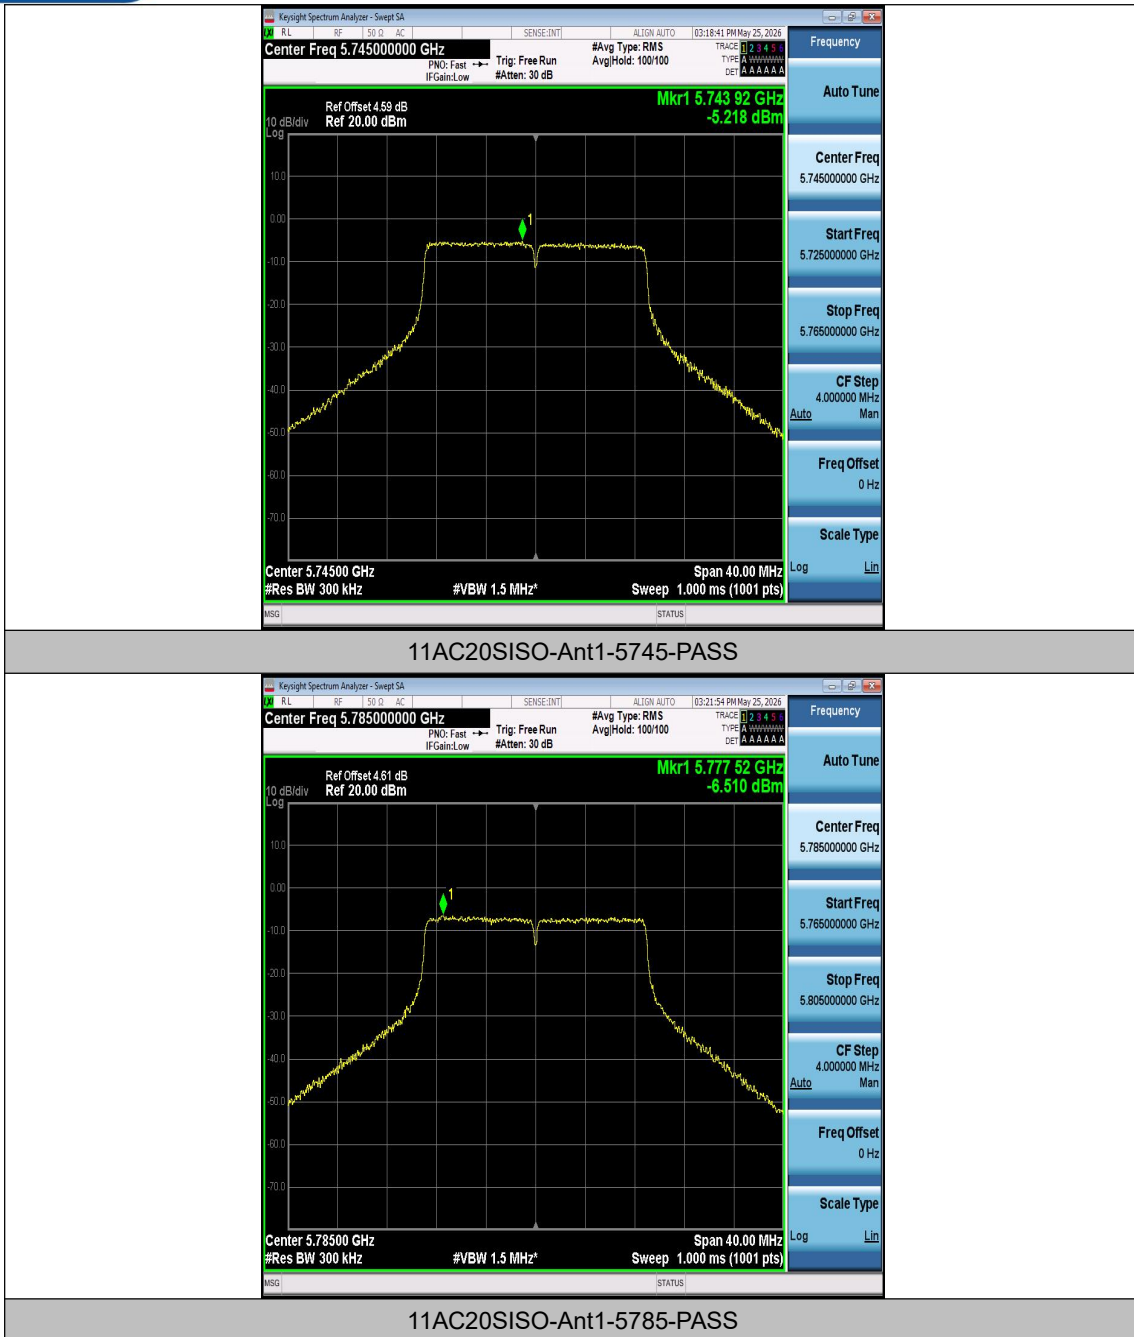

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

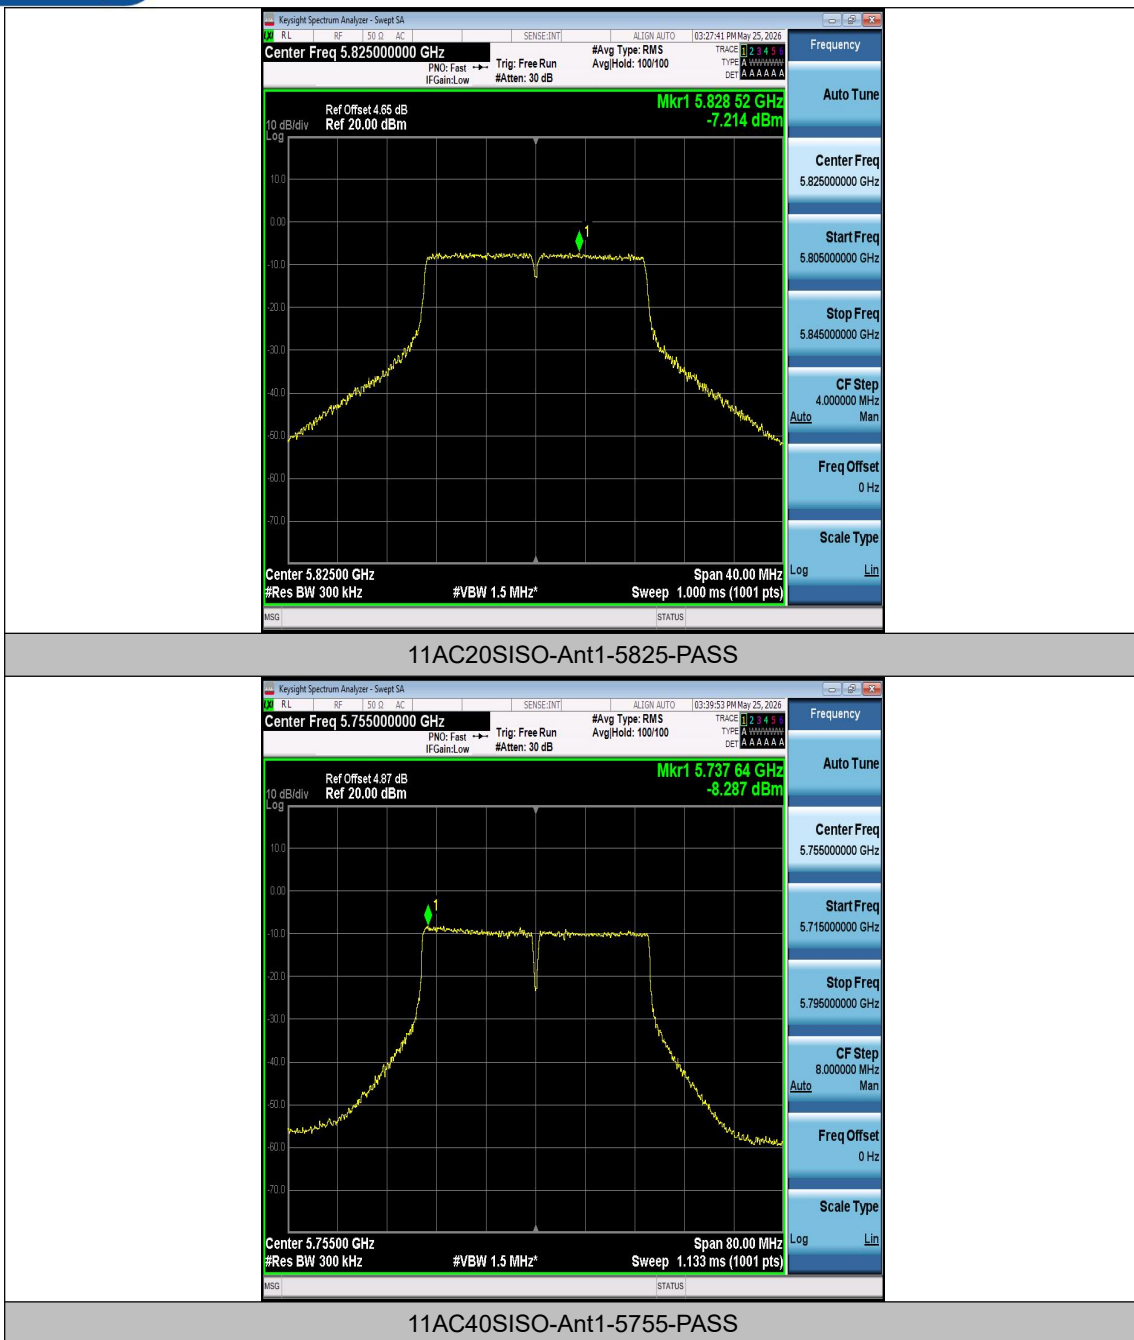

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

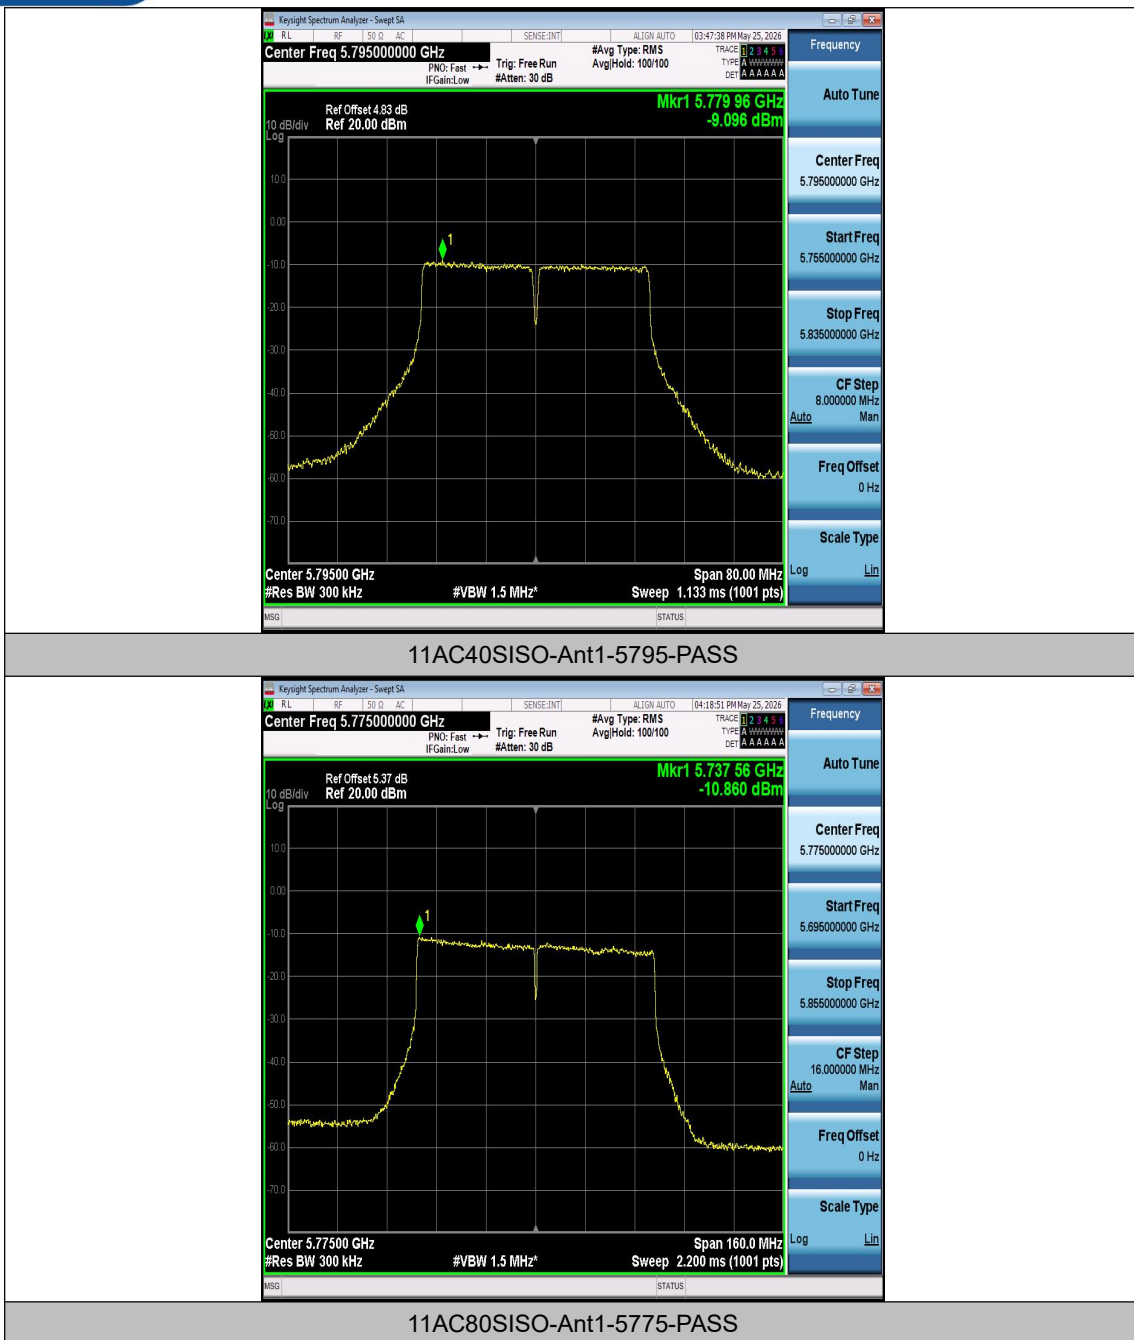

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

Appendix E: Band edge measurements

Test Result B1/2/3

Test Mode	Antenna	ChName	Frequency[MHz]	Result[dBm]	Limit[dBm]	Verdict
11A	Ant1	Low	5180	-44.24	≤-27	PASS
11A	Ant1	High	5240	-47.91	≤-27	PASS
11N20SISO	Ant1	Low	5180	-43.98	≤-27	PASS
11N20SISO	Ant1	High	5240	-47.3	≤-27	PASS
11N40SISO	Ant1	Low	5190	-41.68	≤-27	PASS
11N40SISO	Ant1	High	5230	-48.06	≤-27	PASS
11AC20SISO	Ant1	Low	5180	-44.08	≤-27	PASS
11AC20SISO	Ant1	High	5240	-47.96	≤-27	PASS
11AC40SISO	Ant1	Low	5190	-43.55	≤-27	PASS
11AC40SISO	Ant1	High	5230	-47.99	≤-27	PASS
11AC80SISO	Ant1	High	5210	-47.35	≤-27	PASS
11AC80SISO	Ant1	Low	5210	-41.52	≤-27	PASS

Note: The margin plus the antenna gain also meets the limit.

Test Result B4

Test Mode	Antenna	Ch. Name	Frequency[MHz]	FreqRange [MHz]	Result [dBm]	Limit [dBm]	Verdict
11A	Ant1	Low	5745	5720~5725	-34.71	≤21.85	PASS
11A	Ant1	Low	5745	5700~5720	-37.07	≤15.59	PASS
11A	Ant1	Low	5745	5650~5700	-49.2	≤-26.45	PASS
11A	Ant1	Low	5745	5760~5650	-48.61	≤-27	PASS
11A	Ant1	High	5825	5850~5855	-46.14	≤16.65	PASS
11A	Ant1	High	5825	5855~5875	-48.08	≤10.17	PASS
11A	Ant1	High	5825	5875~5925	-49.4	≤-26.51	PASS
11A	Ant1	High	5825	5925~5935	-48.61	≤-27	PASS
11N20SI SO	Ant1	Low	5745	5720~5725	-36.44	≤19.49	PASS
11N20SI SO	Ant1	Low	5745	5700~5720	-45.78	≤10.09	PASS
11N20SI SO	Ant1	Low	5745	5650~5700	-47.03	≤-26.87	PASS
11N20SI SO	Ant1	Low	5745	5760~5650	-49.36	≤-27	PASS
11N20SI	Ant1	High	5825	5850~5855	-46.4	≤15.73	PASS

SO							
11N20SI SO	Ant1	High	5825	5855~5875	-48.37	≤10.02	PASS
11N20SI SO	Ant1	High	5825	5875~5925	-48.65	≤-26.81	PASS
11N20SI SO	Ant1	High	5825	5925~5935	-49.09	≤-27	PASS
11N40SI SO	Ant1	Low	5755	5720~5725	-34.35	≤16.66	PASS
11N40SI SO	Ant1	Low	5755	5700~5720	-34.22	≤15.58	PASS
11N40SI SO	Ant1	Low	5755	5650~5700	-49.28	≤-26.70	PASS
11N40SI SO	Ant1	Low	5755	5780~5650	-49.48	≤-27	PASS
11N40SI SO	Ant1	High	5795	5850~5855	-49.03	≤15.66	PASS
11N40SI SO	Ant1	High	5795	5855~5875	-49.56	≤10.11	PASS
11N40SI SO	Ant1	High	5795	5875~5925	-49.96	≤-26.46	PASS
11N40SI SO	Ant1	High	5795	5925~5935	-48.91	≤-27	PASS
11AC20S ISO	Ant1	Low	5745	5720~5725	-39.69	≤15.82	PASS
11AC20S ISO	Ant1	Low	5745	5700~5720	-45.68	≤10.41	PASS
11AC20S ISO	Ant1	Low	5745	5650~5700	-47.34	≤-25.34	PASS
11AC20S ISO	Ant1	Low	5745	5760~5650	-48.63	≤-27	PASS
11AC20S ISO	Ant1	High	5825	5850~5855	-47.39	≤15.73	PASS
11AC20S ISO	Ant1	High	5825	5855~5875	-47.96	≤10.06	PASS
11AC20S ISO	Ant1	High	5825	5875~5925	-50.21	≤-26.91	PASS
11AC20S ISO	Ant1	High	5825	5925~5935	-49.36	≤-27	PASS
11AC40S ISO	Ant1	Low	5755	5720~5725	-33.87	≤18.51	PASS
11AC40S ISO	Ant1	Low	5755	5700~5720	-35.2	≤15.16	PASS

Shenzhen Anbotek Compliance Laboratory Limited


Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

11AC40S ISO	Ant1	Low	5755	5650~5700	-50.67	≤-26.70	PASS
11AC40S ISO	Ant1	Low	5755	5780~5650	-48.09	≤-27	PASS
11AC40S ISO	Ant1	High	5795	5850~5855	-47.97	≤16.79	PASS
11AC40S ISO	Ant1	High	5795	5855~5875	-49.16	≤10.53	PASS
11AC40S ISO	Ant1	High	5795	5875~5925	-49.39	≤-26.46	PASS
11AC40S ISO	Ant1	High	5795	5925~5935	-48.03	≤-27	PASS
11AC80S ISO	Ant1	Low	5775	5720~5725	-41.15	≤16.00	PASS
11AC80S ISO	Ant1	Low	5775	5700~5720	-39.51	≤10.14	PASS
11AC80S ISO	Ant1	Low	5775	5650~5700	-48.34	≤-26.46	PASS
11AC80S ISO	Ant1	Low	5775	5800~5650	-49.05	≤-27	PASS
11AC80S ISO	Ant1	High	5775	5850~5855	-47.16	≤17.10	PASS
11AC80S ISO	Ant1	High	5775	5855~5875	-42.63	≤12.06	PASS
11AC80S ISO	Ant1	High	5775	5875~5925	-50.55	≤-26.73	PASS
11AC80S ISO	Ant1	High	5775	5925~5935	-48.84	≤-27	PASS

Note: The margin plus the antenna gain also meets the limit.


Test Graphs B1/2/3

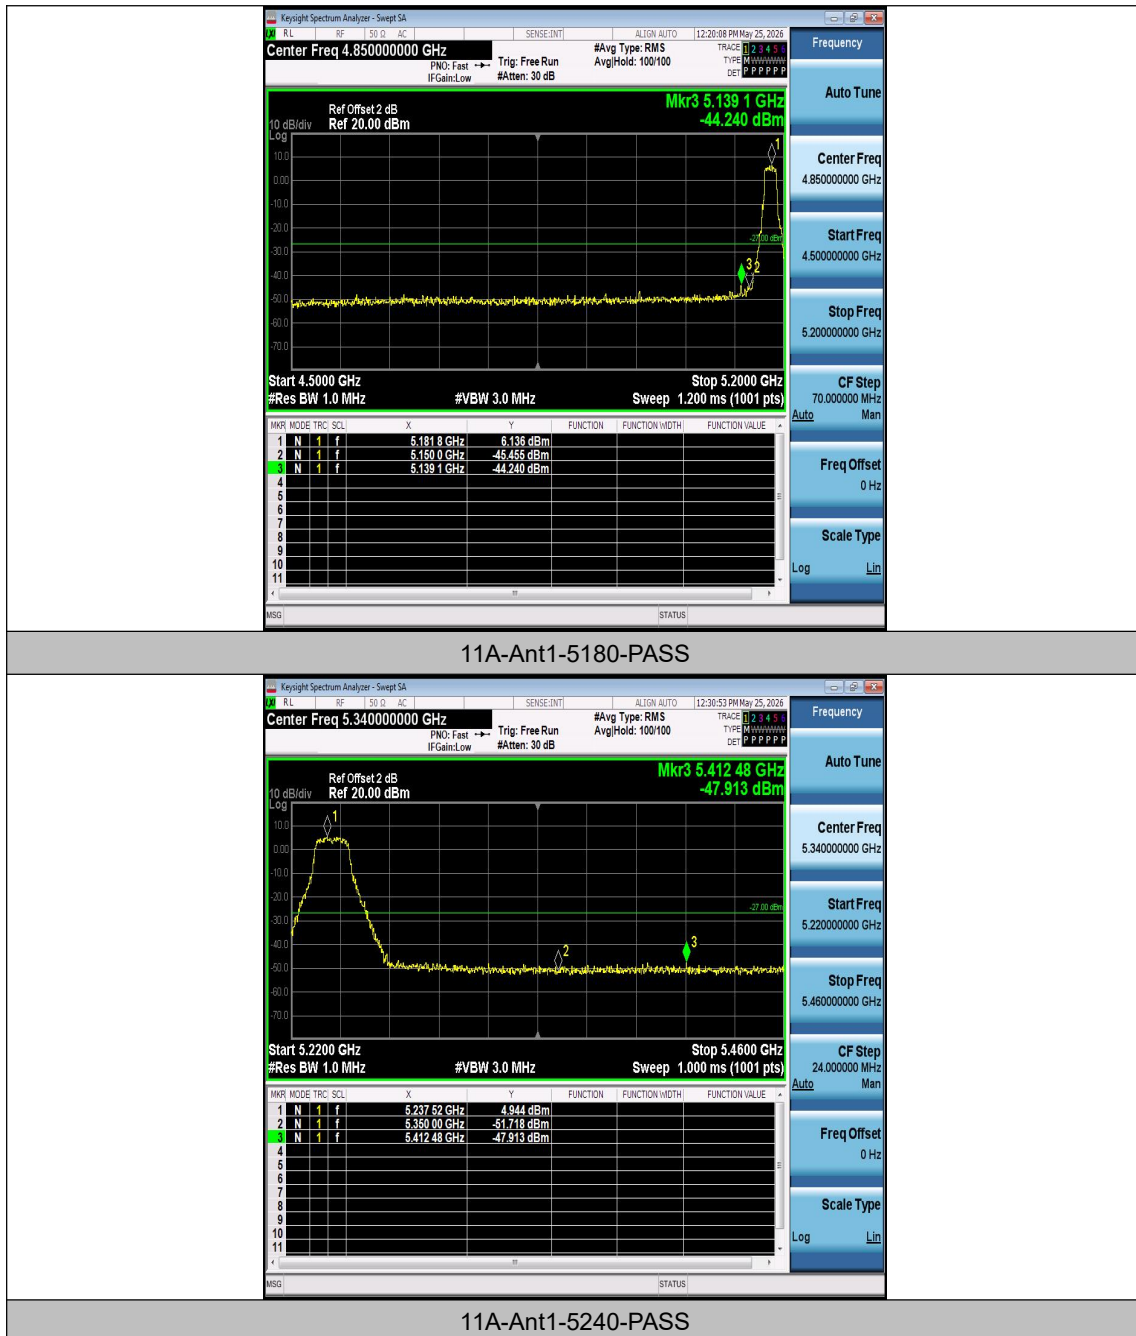


Shenzhen Anbotek Compliance Laboratory Limited


Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

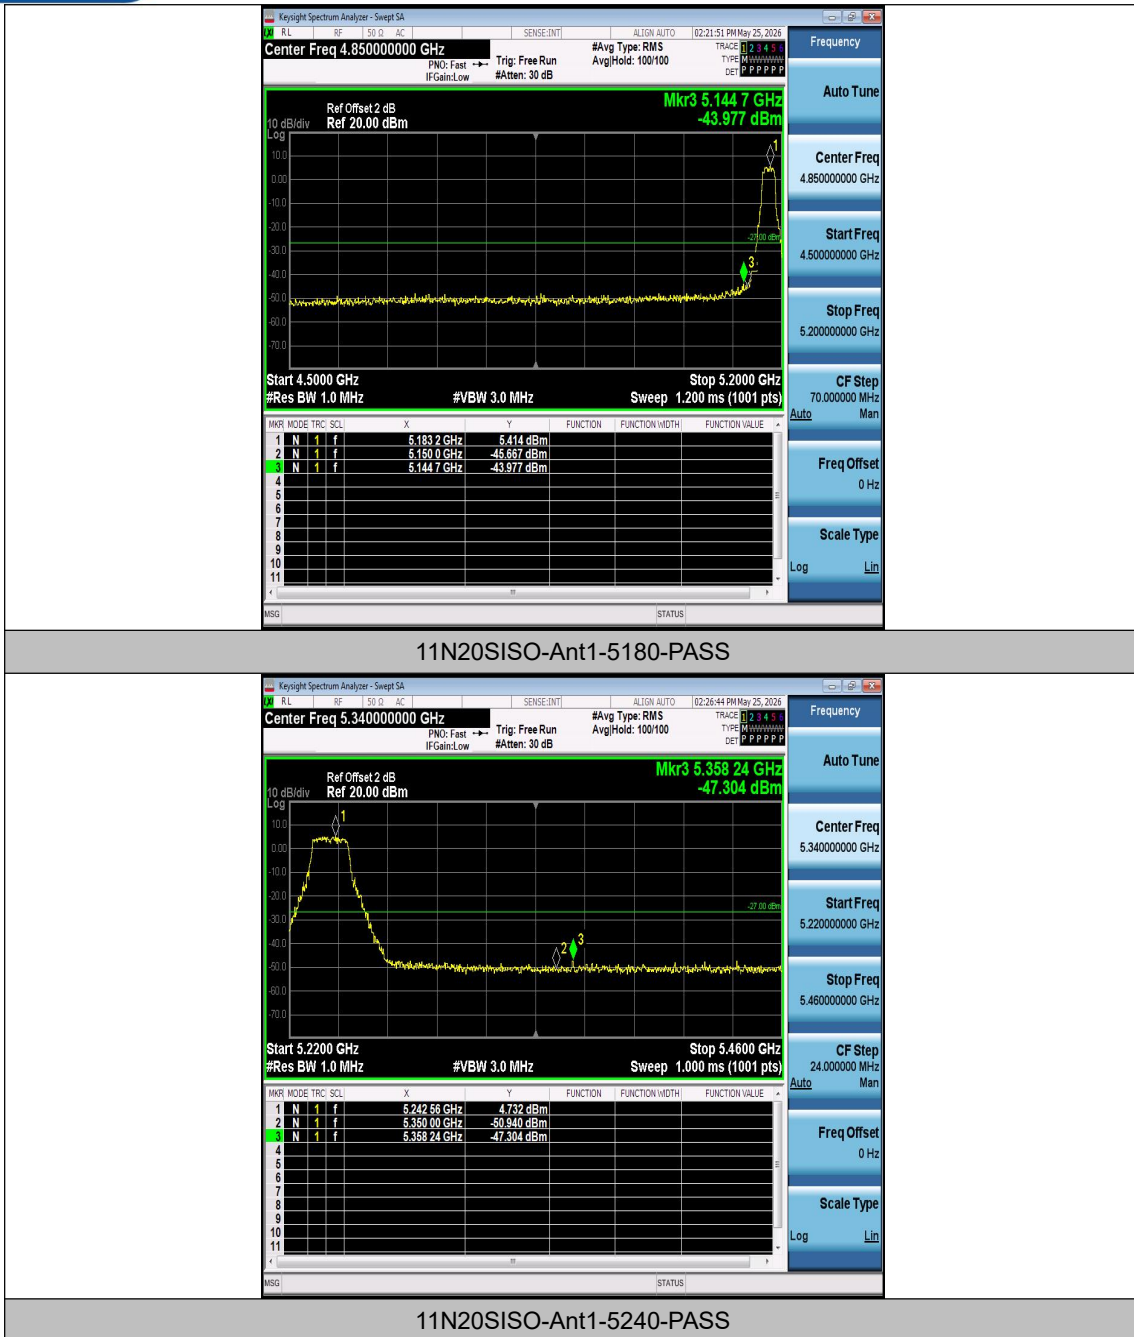


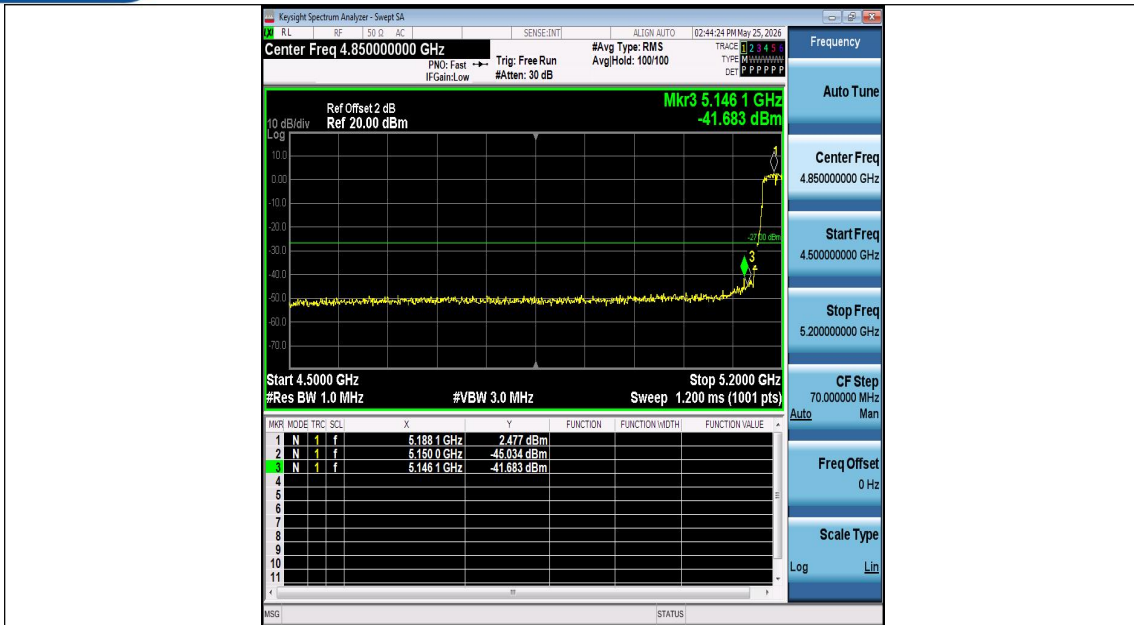

11N40SISO-Ant1-5190-PASS

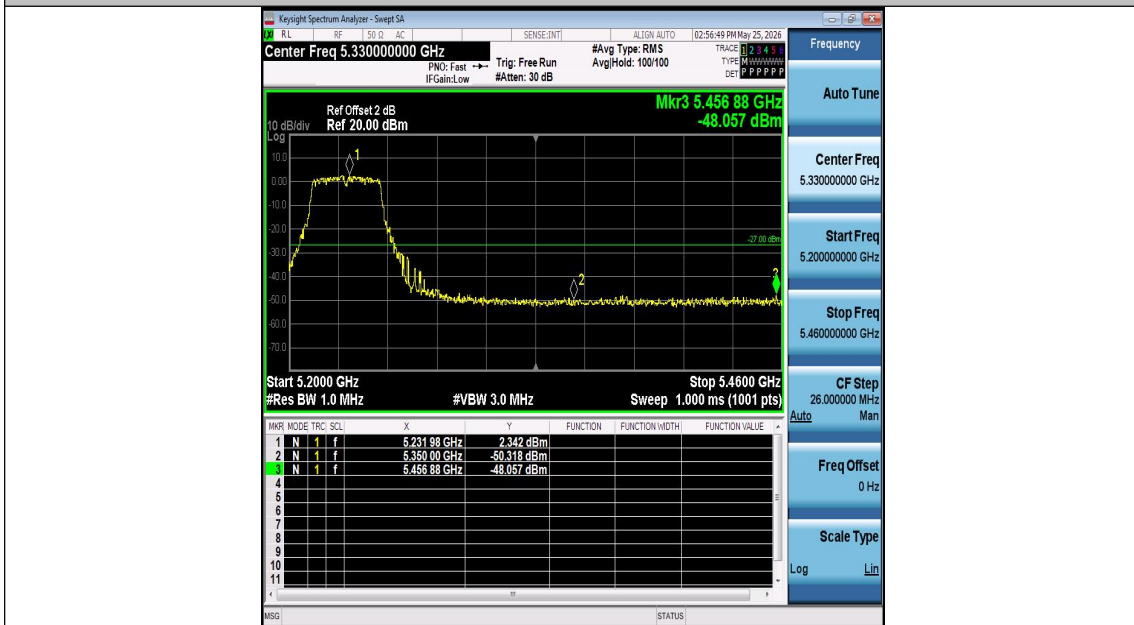


11N40SISO-Ant1-5230-PASS

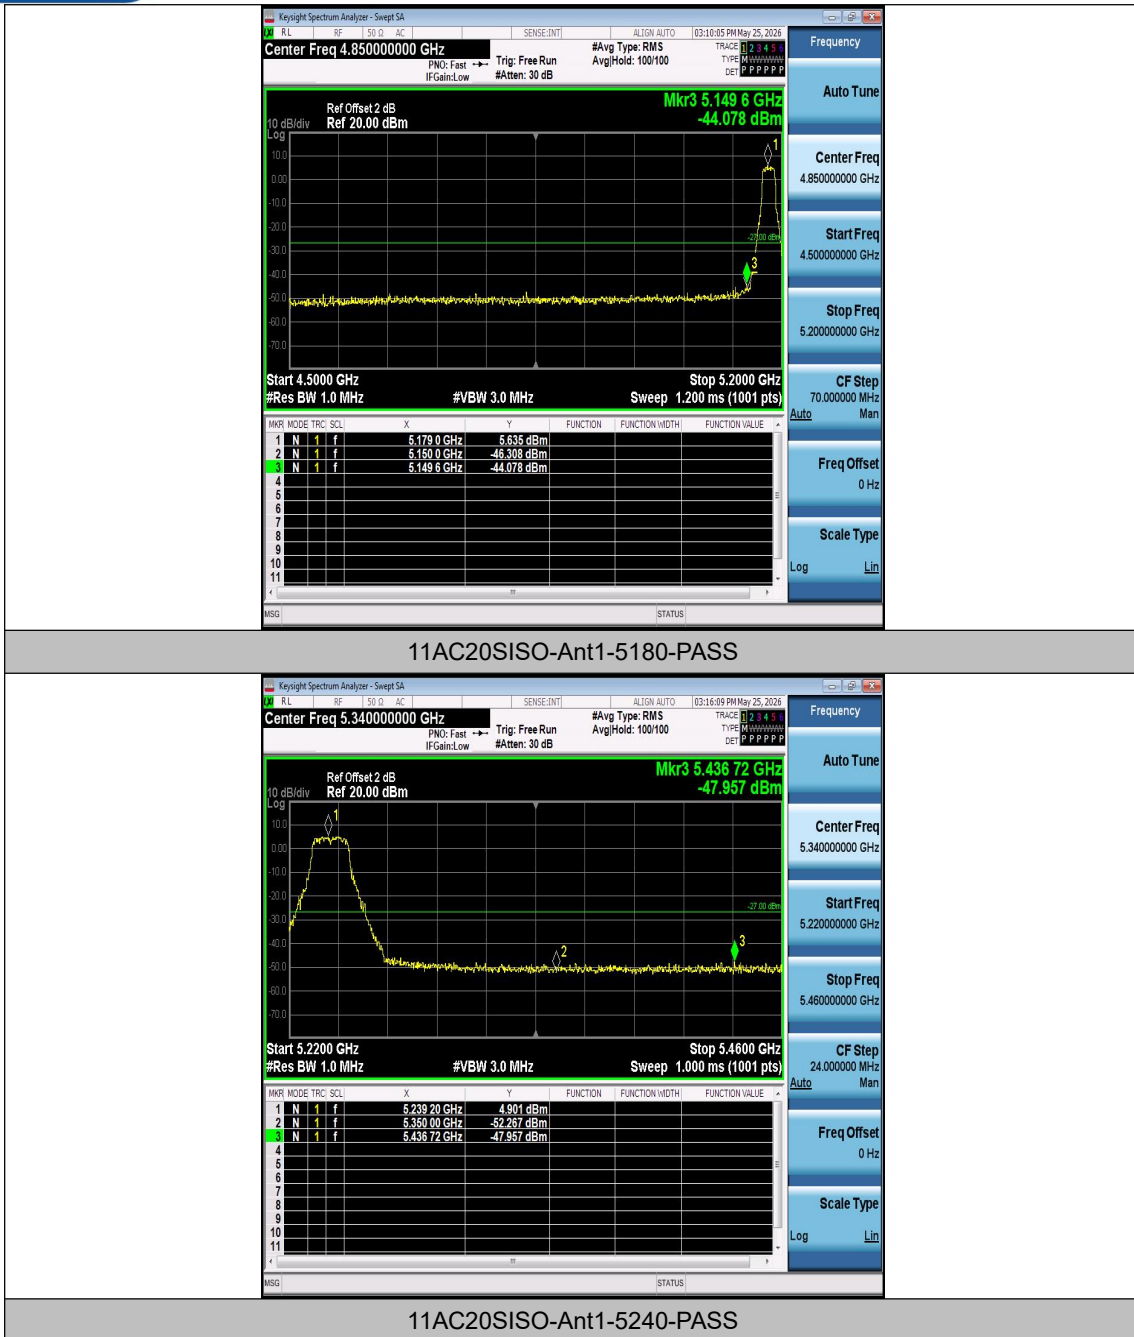

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

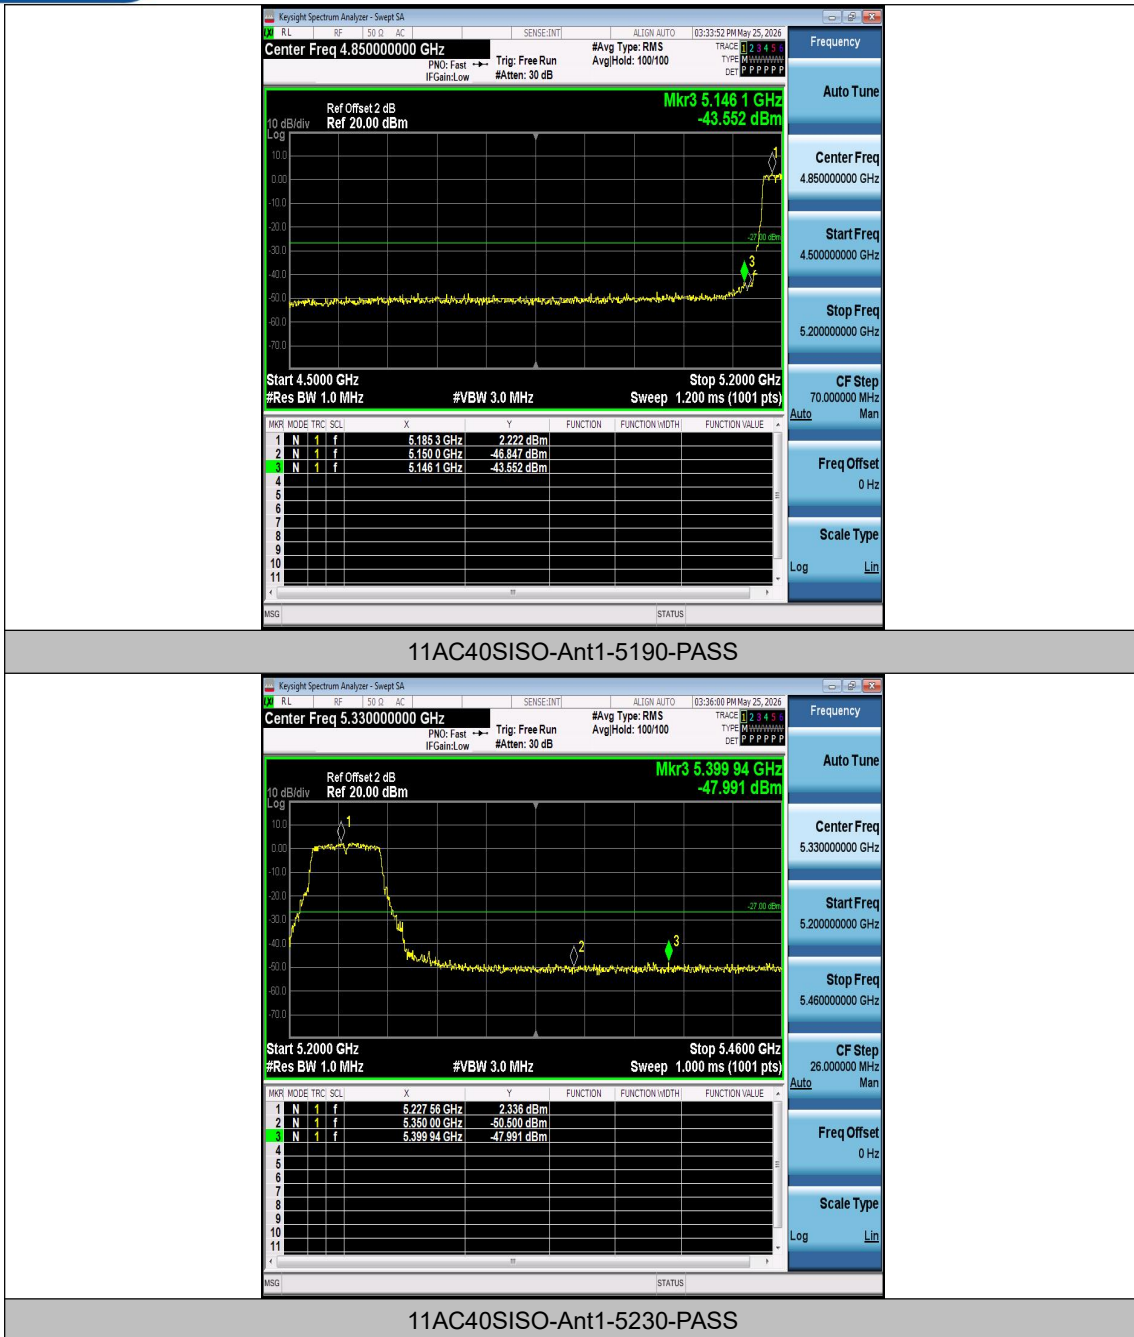

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

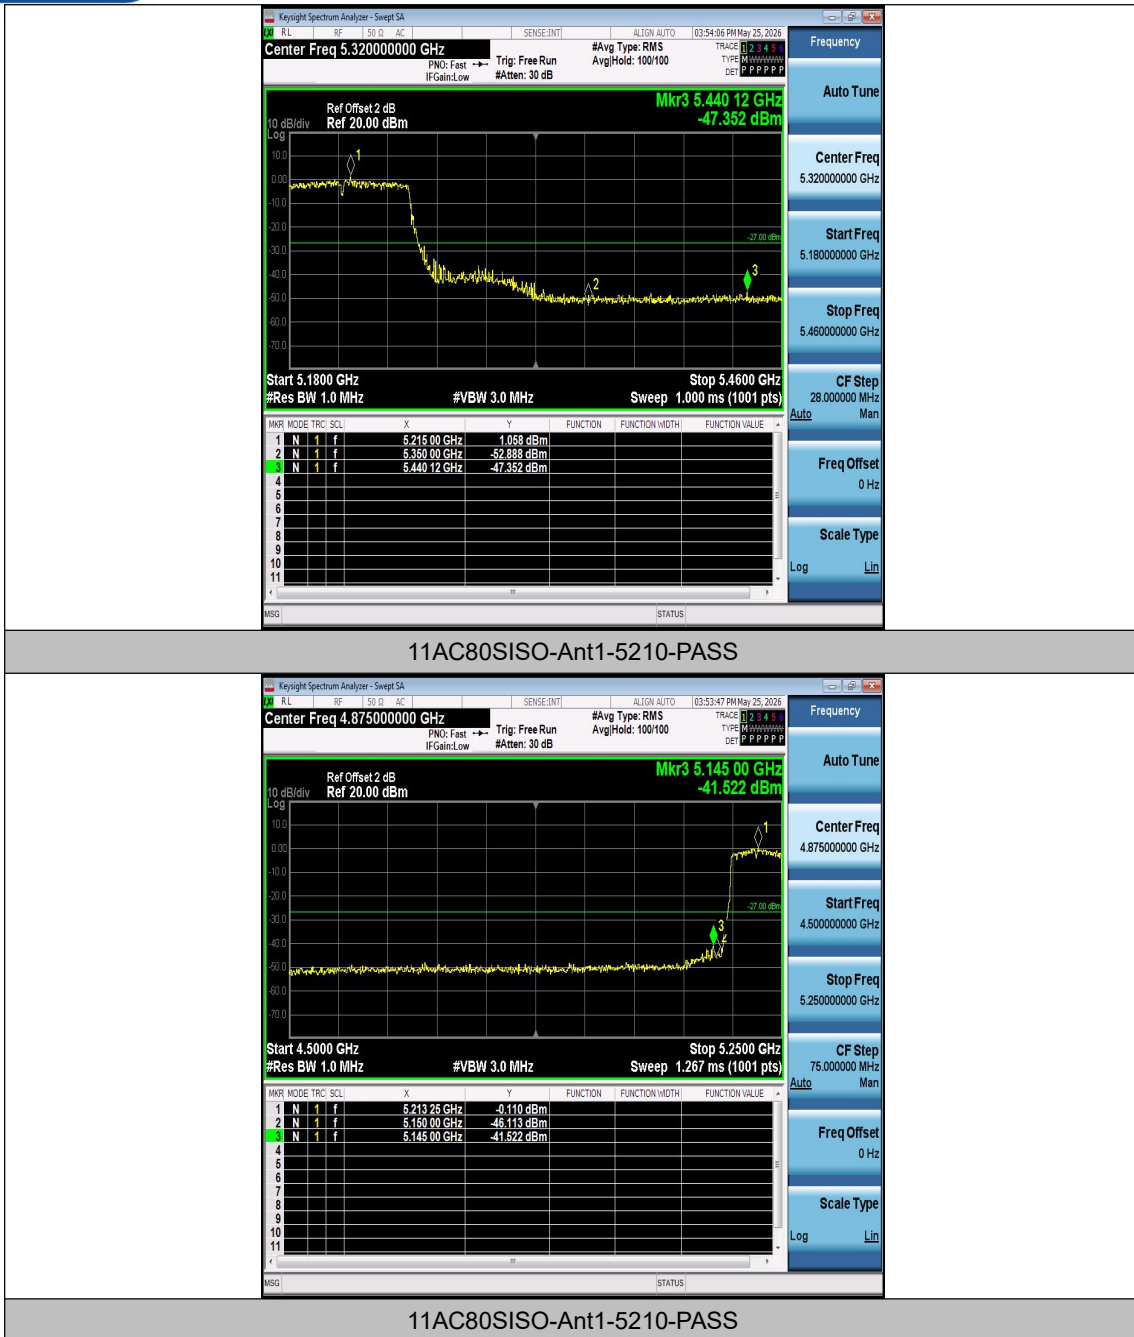


Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

Test Graphs B4

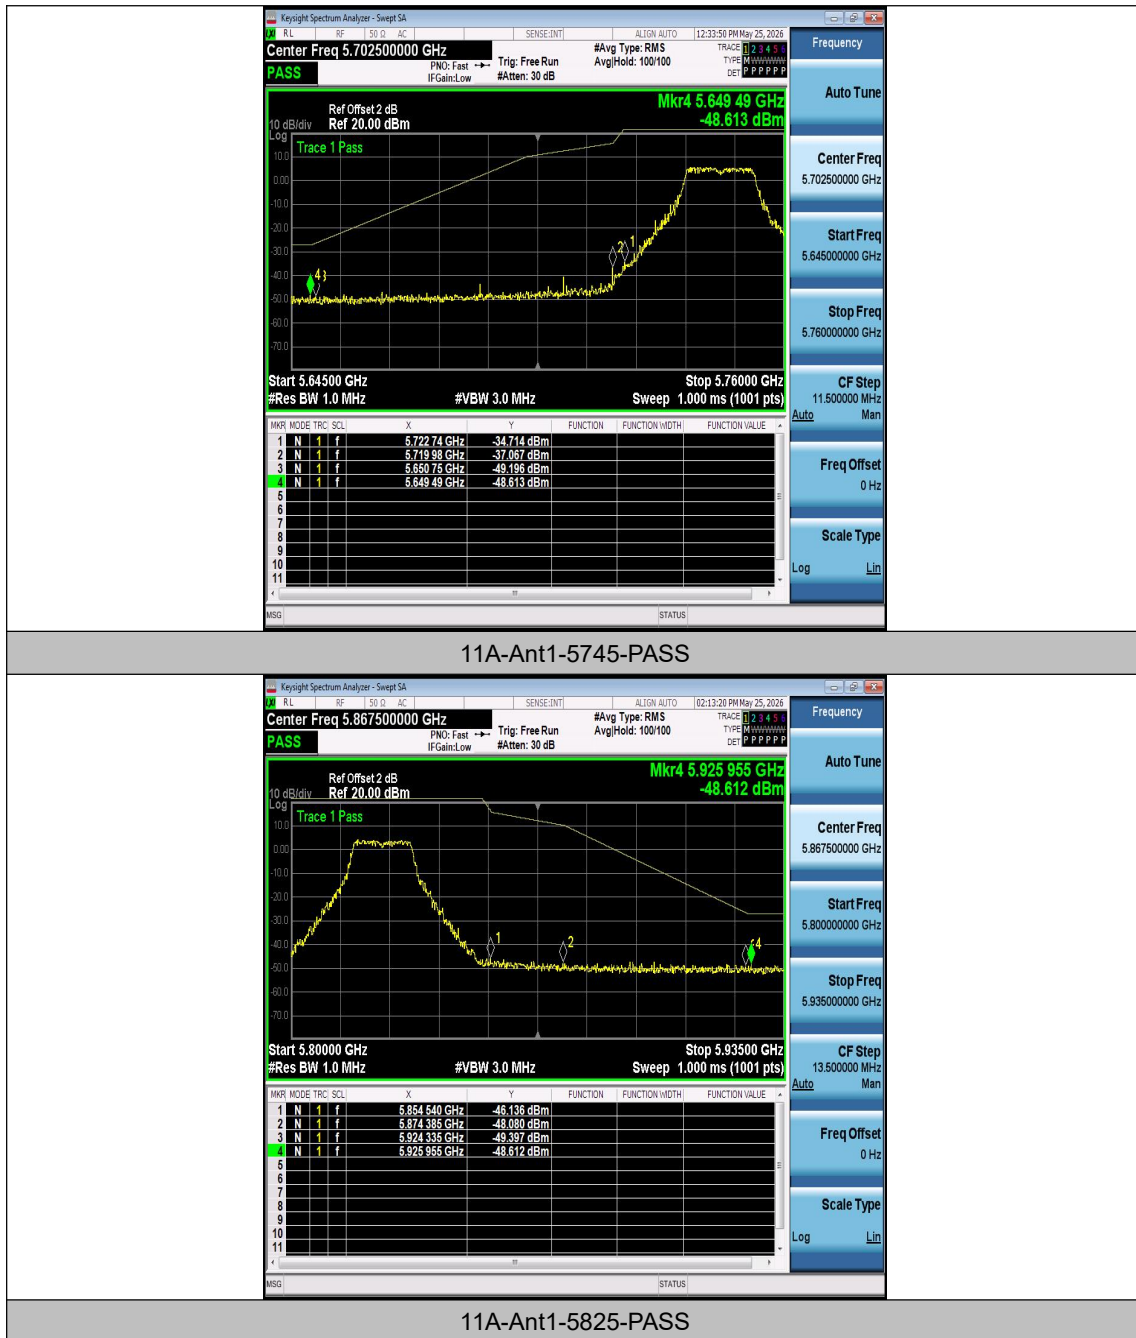

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com




11N20SISO-Ant1-5745-PASS



11N20SISO-Ant1-5825-PASS



11N40SISO-Ant1-5755-PASS

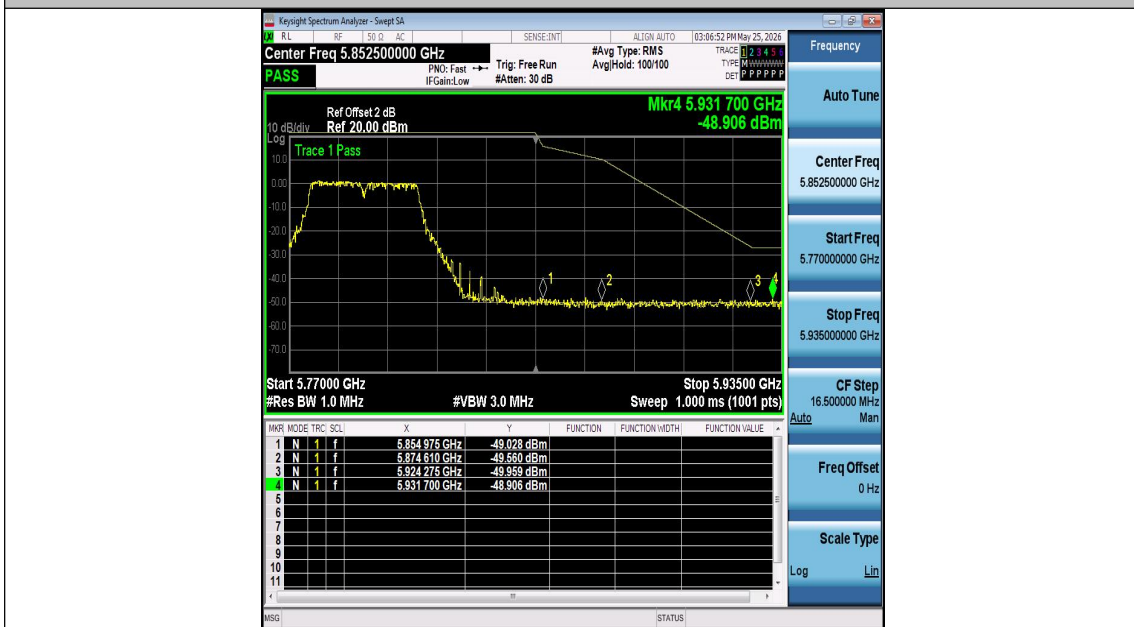


11N40SISO-Ant1-5795-PASS




11AC20SISO-Ant1-5745-PASS



11AC20SISO-Ant1-5825-PASS

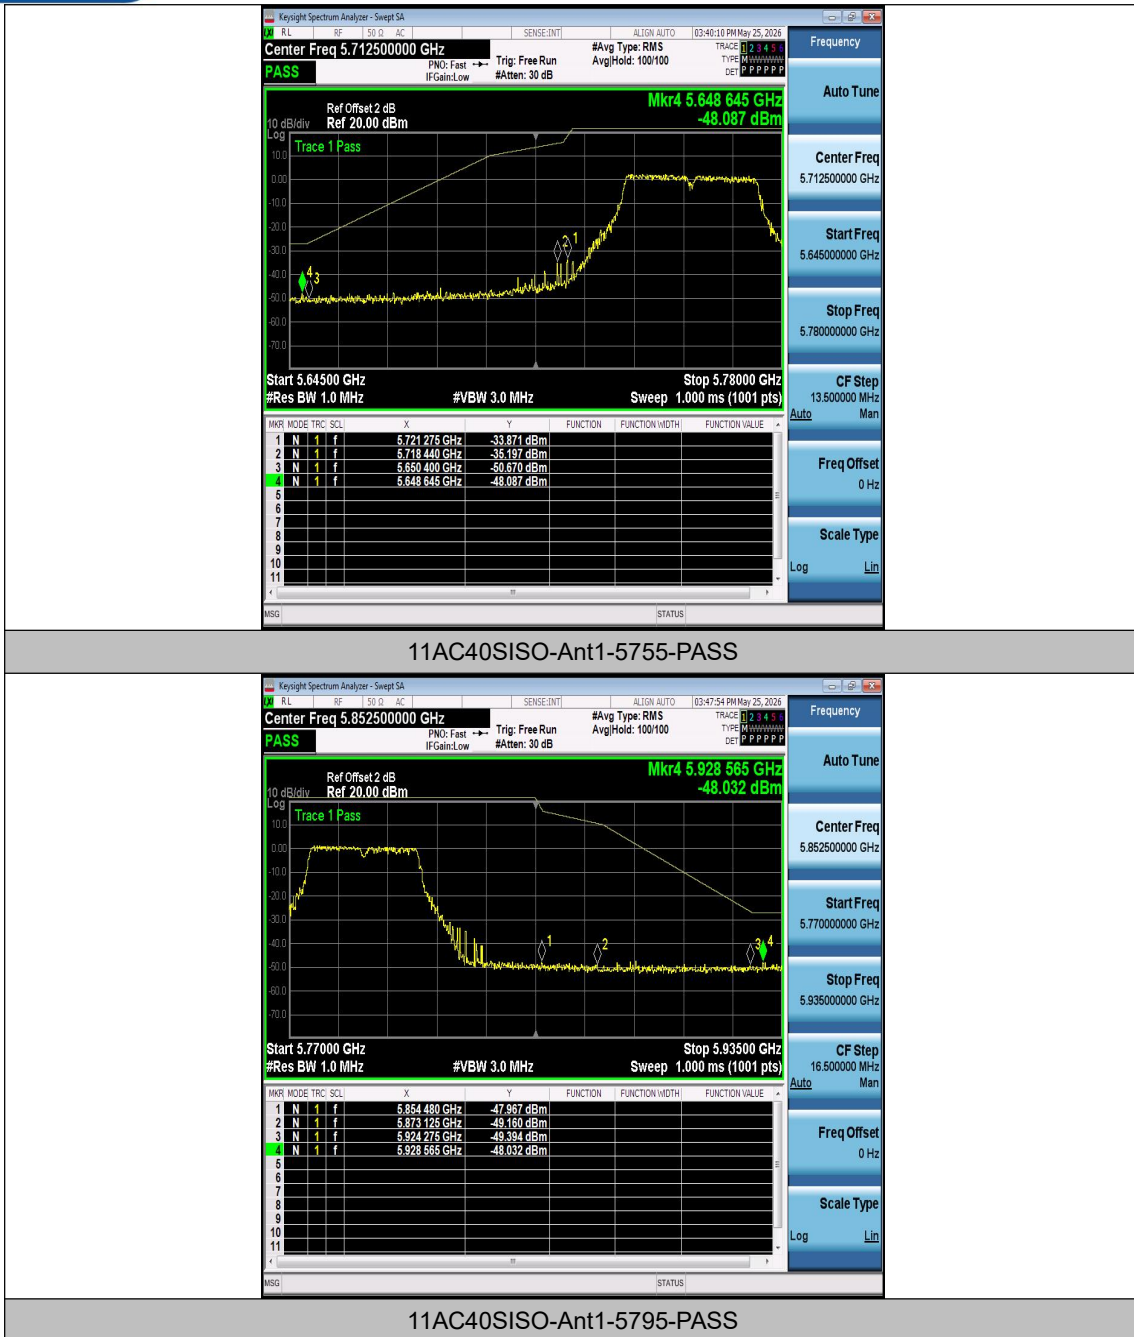

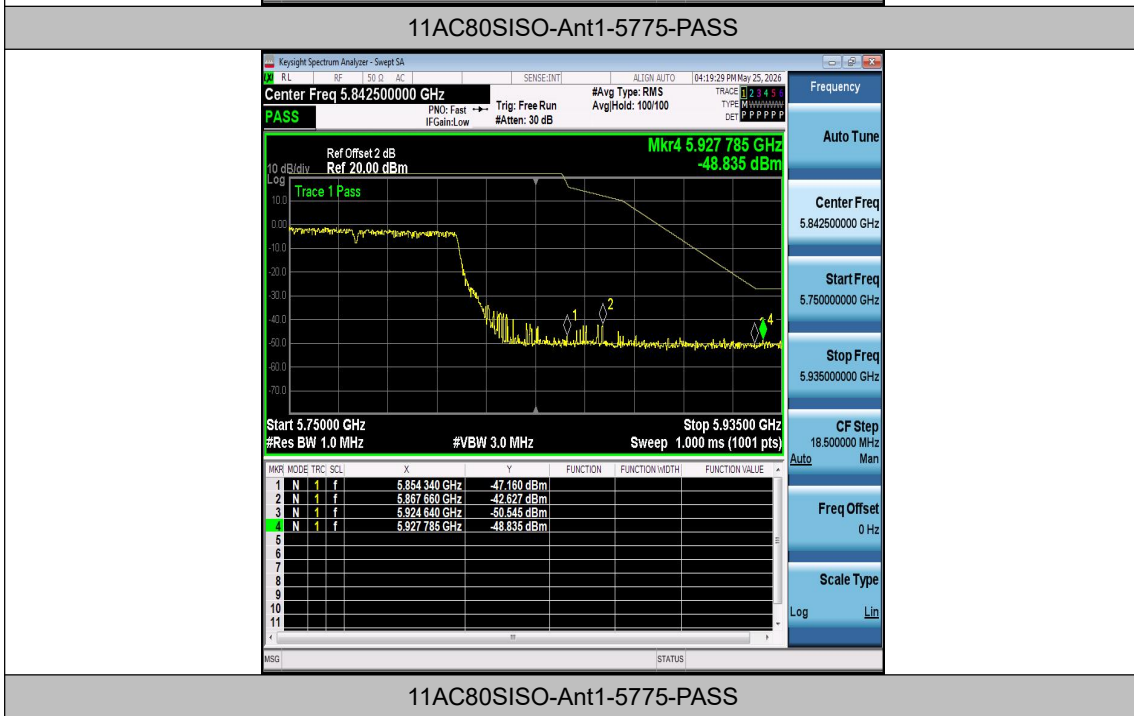

---END---