

Appendix Test Data

Report No.:	1812C60258612503-01	Test Sample No.:	1-2-2
Start Test Date:	2026-5-13	Finish Test Date:	2026-5-25
Test Engineer:	Pearl Ao	Auditor:	Justin Feng
Temperature:	24.5°C	Relative Humidity:	64%
Pressure:	101kPa		



Appendix A: 6dB Bandwidth

Test Result

Test Mode	Antenna	Frequency[MHz]	6dB BW [MHz]	FL[MHz]	FH[MHz]	Limit[MHz]	Verdict
11B	Ant1	2412	9.280	2407.400	2416.680	0.5	PASS
11B	Ant1	2437	9.280	2432.400	2441.680	0.5	PASS
11B	Ant1	2462	9.280	2457.400	2466.680	0.5	PASS
11G	Ant1	2412	16.440	2403.800	2420.240	0.5	PASS
11G	Ant1	2437	16.400	2428.840	2445.240	0.5	PASS
11G	Ant1	2462	16.280	2453.880	2470.160	0.5	PASS
11N20SISO	Ant1	2412	17.560	2403.200	2420.760	0.5	PASS
11N20SISO	Ant1	2437	17.560	2428.240	2445.800	0.5	PASS
11N20SISO	Ant1	2462	17.480	2453.320	2470.800	0.5	PASS
11N40SISO	Ant1	2422	35.680	2404.160	2439.840	0.5	PASS
11N40SISO	Ant1	2437	35.920	2419.080	2455.000	0.5	PASS
11N40SISO	Ant1	2452	36.000	2434.000	2470.000	0.5	PASS

Test Graphs



Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com



Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

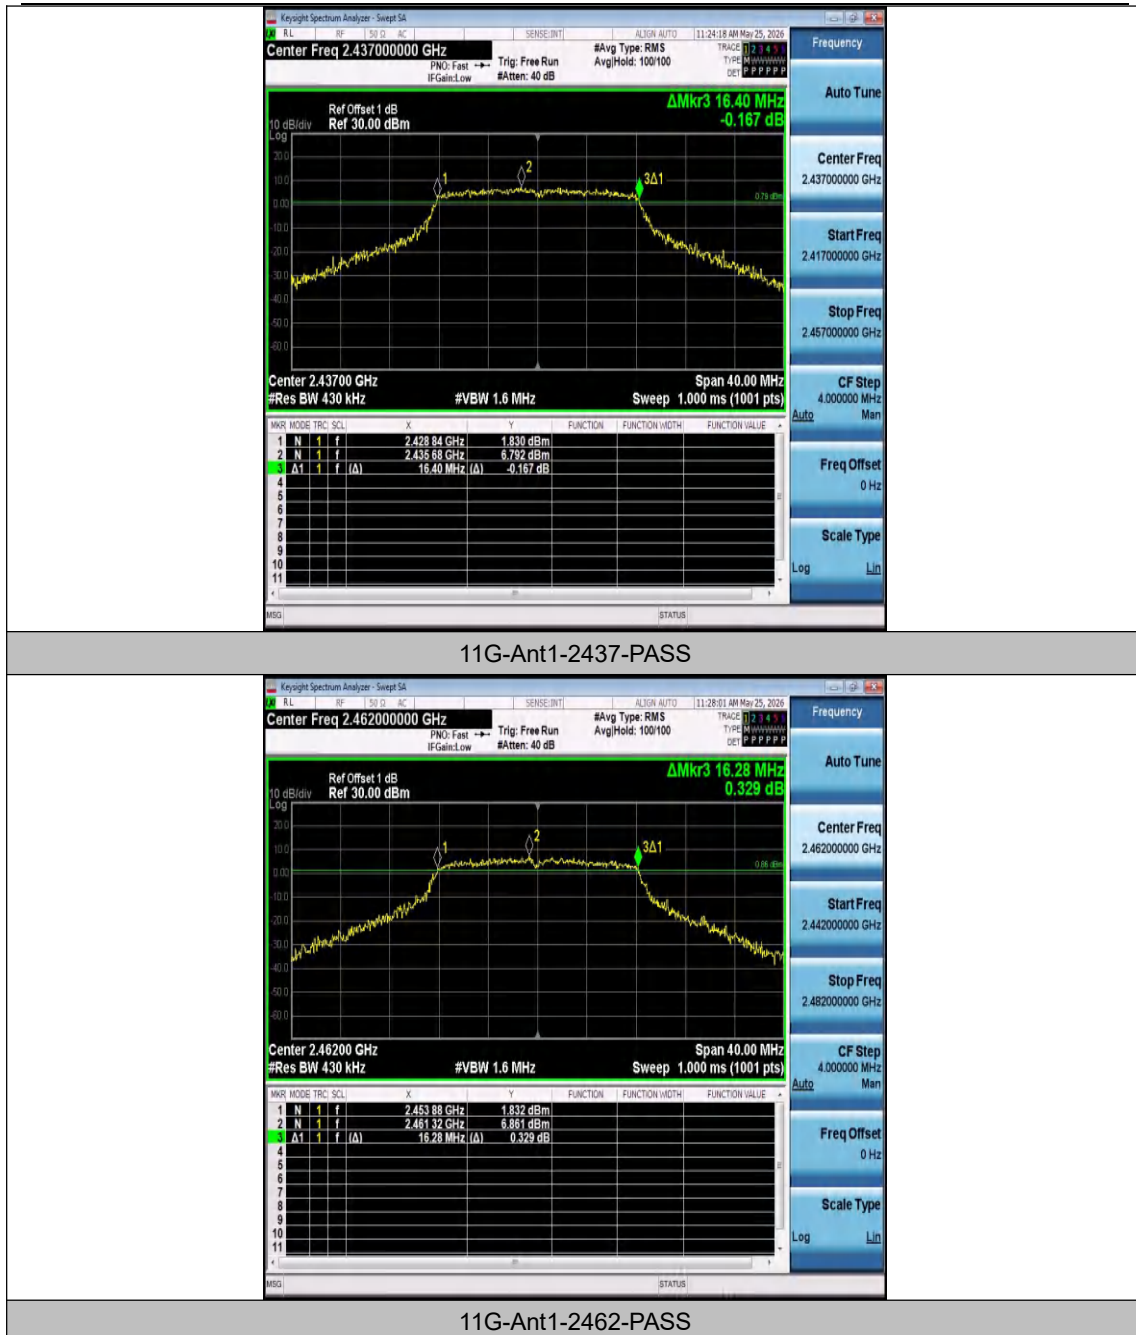





Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

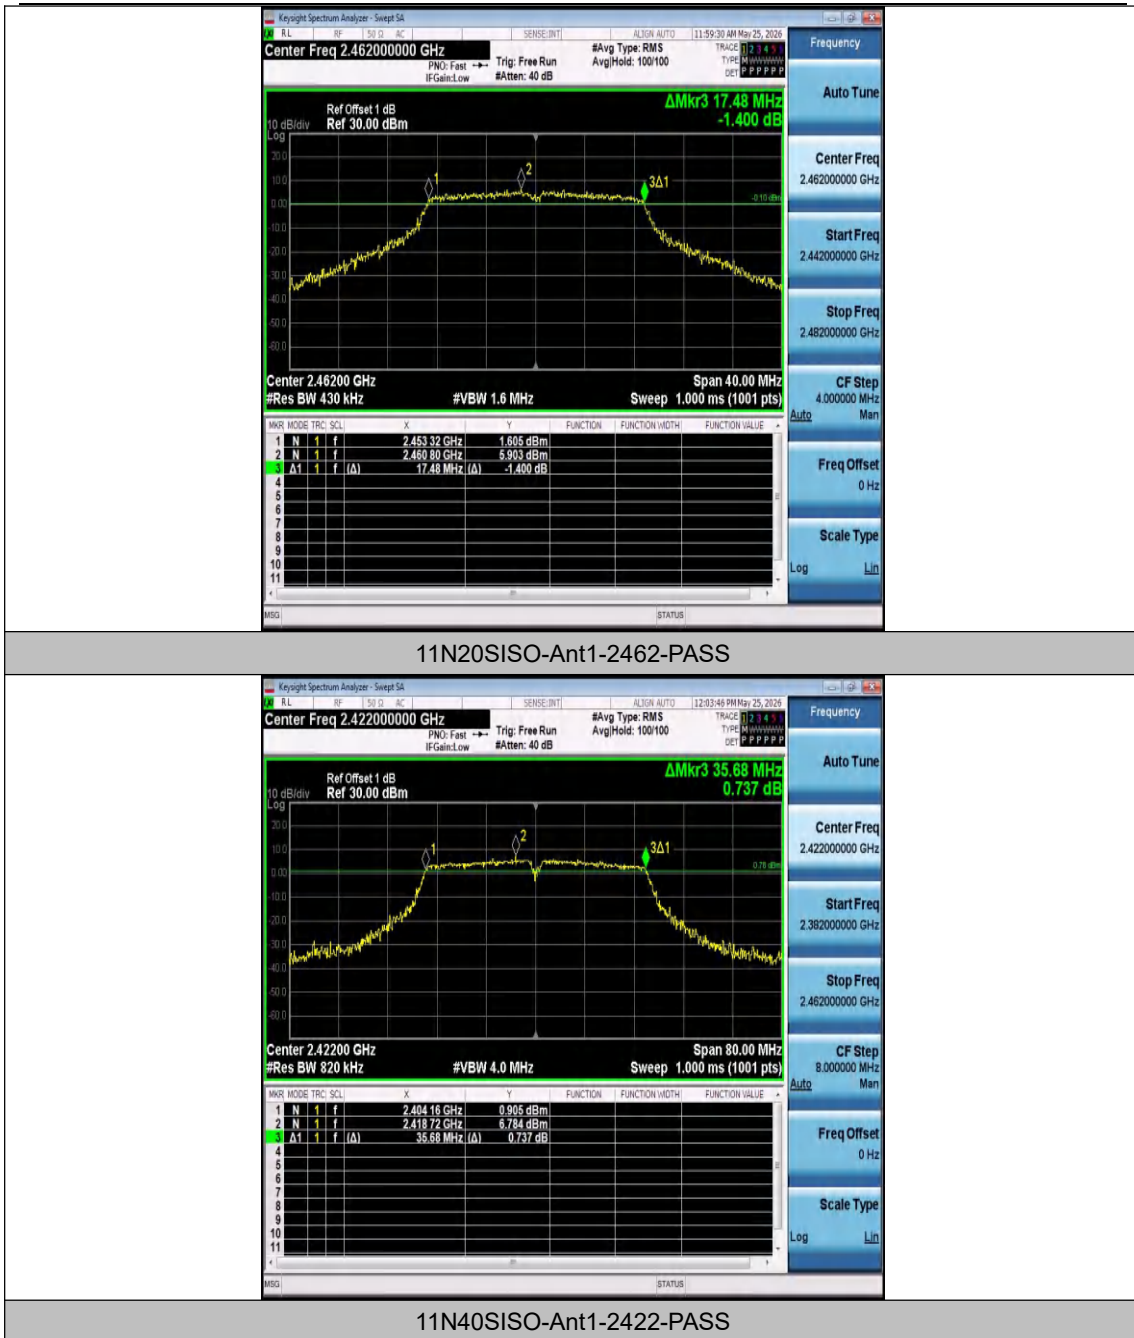

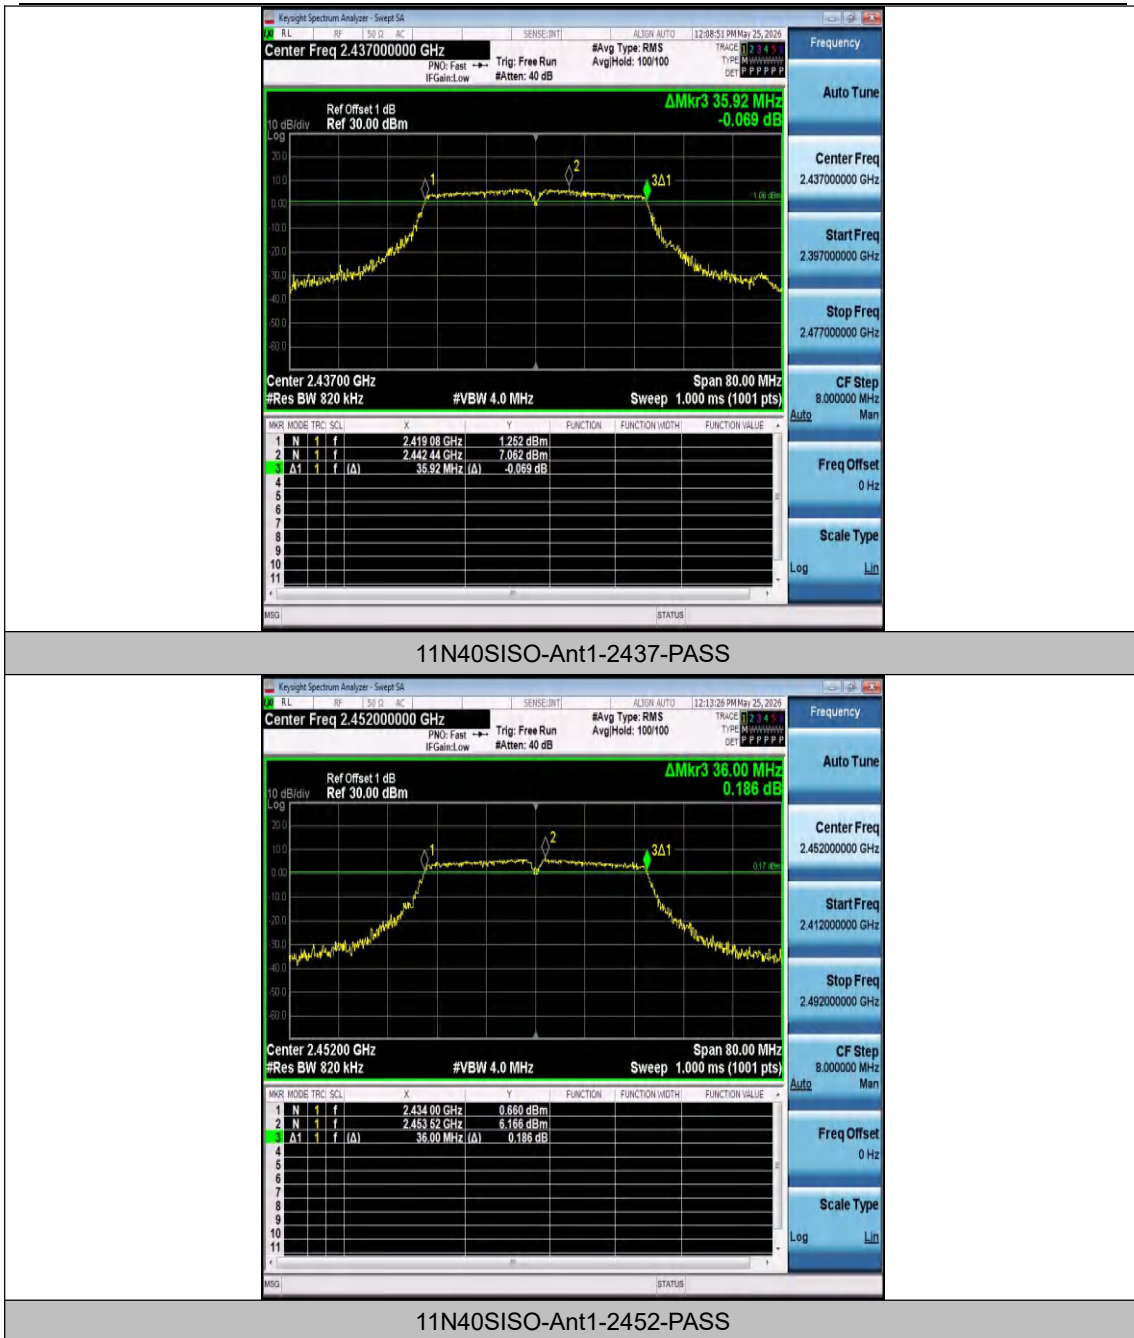

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

Appendix B: 99% Occupied Bandwidth

Test Result

Test Mode	Antenna	Channel Frequency[MHz]	OCB [MHz]	FL[MHz]	FH[MHz]	Limit[MHz]	Verdict
11B	Ant1	2412	13.195	2405.4512	2418.6462	---	---
11B	Ant1	2437	13.152	2430.4711	2443.6231	---	---
11B	Ant1	2462	13.166	2455.4688	2468.6348	---	---
11G	Ant1	2412	17.372	2403.3265	2420.6985	---	---
11G	Ant1	2437	17.359	2428.2953	2445.6543	---	---
11G	Ant1	2462	17.430	2453.2332	2470.6632	---	---
11N20SISO	Ant1	2412	18.452	2402.7660	2421.2180	---	---
11N20SISO	Ant1	2437	18.485	2427.7656	2446.2506	---	---
11N20SISO	Ant1	2462	18.489	2452.7363	2471.2253	---	---
11N40SISO	Ant1	2422	36.739	2403.6745	2440.4135	---	---
11N40SISO	Ant1	2437	36.740	2418.6161	2455.3561	---	---
11N40SISO	Ant1	2452	36.683	2433.6728	2470.3558	---	---

Test Graphs

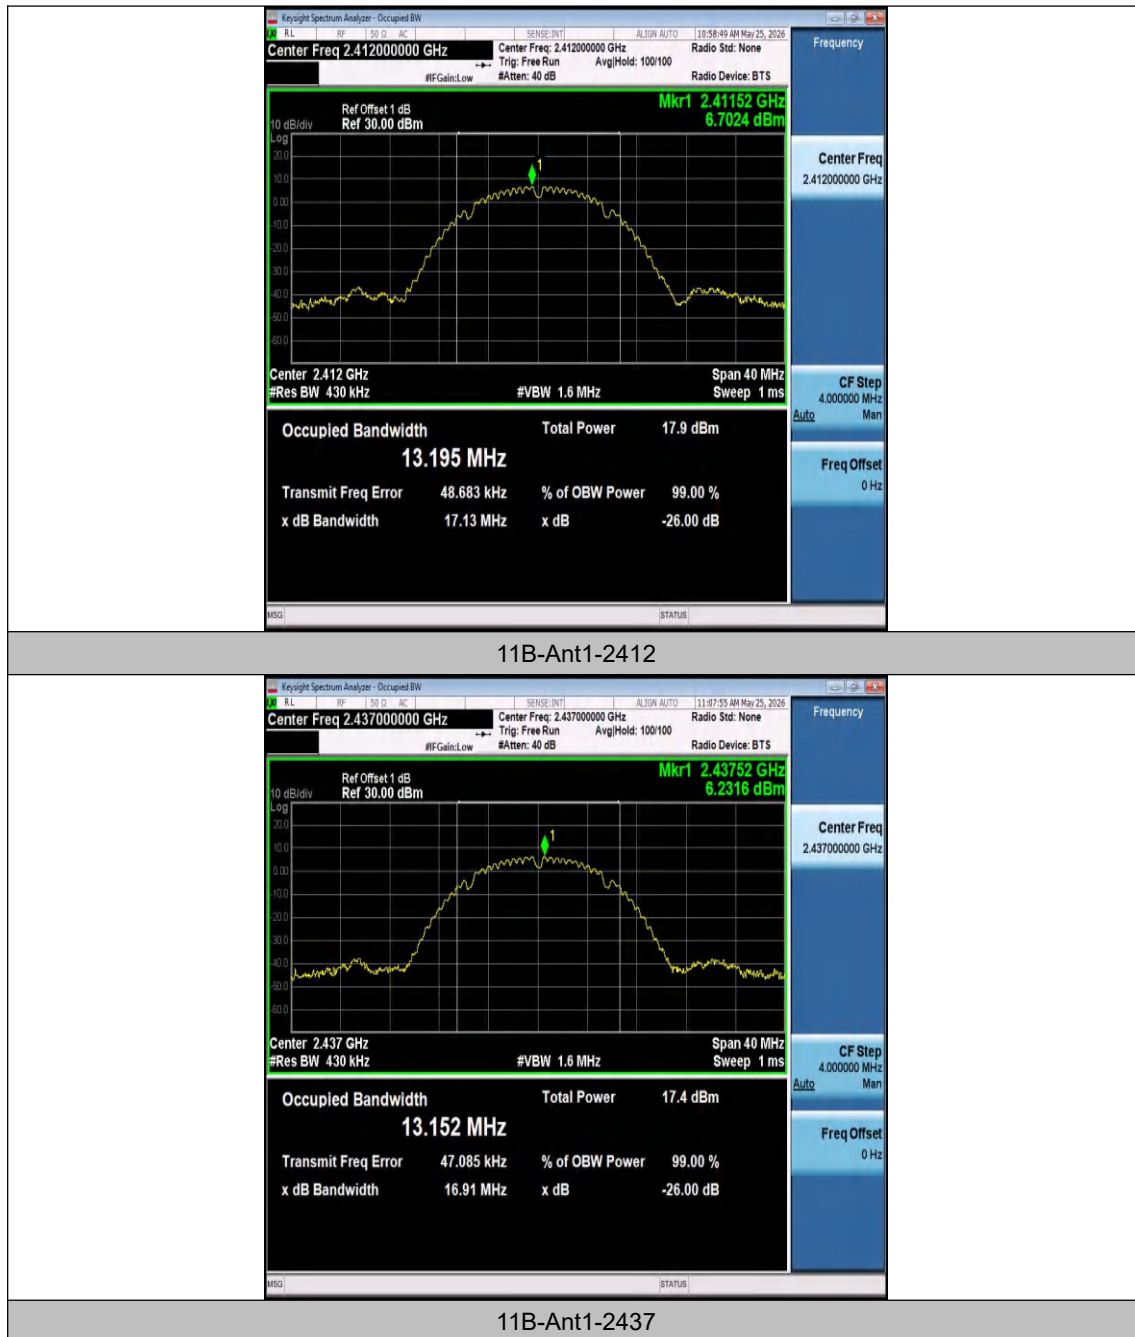

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com



Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com



Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com



Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com



Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com



Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com


Appendix C: Maximum conducted output power

Test Result Average

Test Mode	Antenna	Frequency [MHz]	Average power [dBm]	Duty Cycle [%]	DC Factor [dB]	Result [dBm]	Limit [dBm]	Verdict
11B	Ant1	2412	14.93	98.79	0.05	14.98	≤30.0 0	PASS
11B	Ant1	2437	14.39	97.92	0.09	14.48	≤30.0 0	PASS
11B	Ant1	2462	13.78	97.99	0.09	13.87	≤30.0 0	PASS
11G	Ant1	2412	13.58	92.69	0.33	13.91	≤30.0 0	PASS
11G	Ant1	2437	13.90	92.69	0.33	14.23	≤30.0 0	PASS
11G	Ant1	2462	13.59	93.98	0.27	13.86	≤30.0 0	PASS
11N20SI SO	Ant1	2412	13.77	89.15	0.50	14.27	≤30.0 0	PASS
11N20SI SO	Ant1	2437	13.21	89.57	0.48	13.69	≤30.0 0	PASS
11N20SI SO	Ant1	2462	12.79	91.75	0.37	13.16	≤30.0 0	PASS
11N40SI SO	Ant1	2422	12.43	86.11	0.65	13.08	≤30.0 0	PASS
11N40SI SO	Ant1	2437	13.17	84.55	0.73	13.90	≤30.0 0	PASS
11N40SI SO	Ant1	2452	12.65	84.55	0.73	13.38	≤30.0 0	PASS

Note: The Duty Cycle Factor($10 \cdot \log(1/D)$) and cable loss are compensated in the graph.


Test Graphs Average

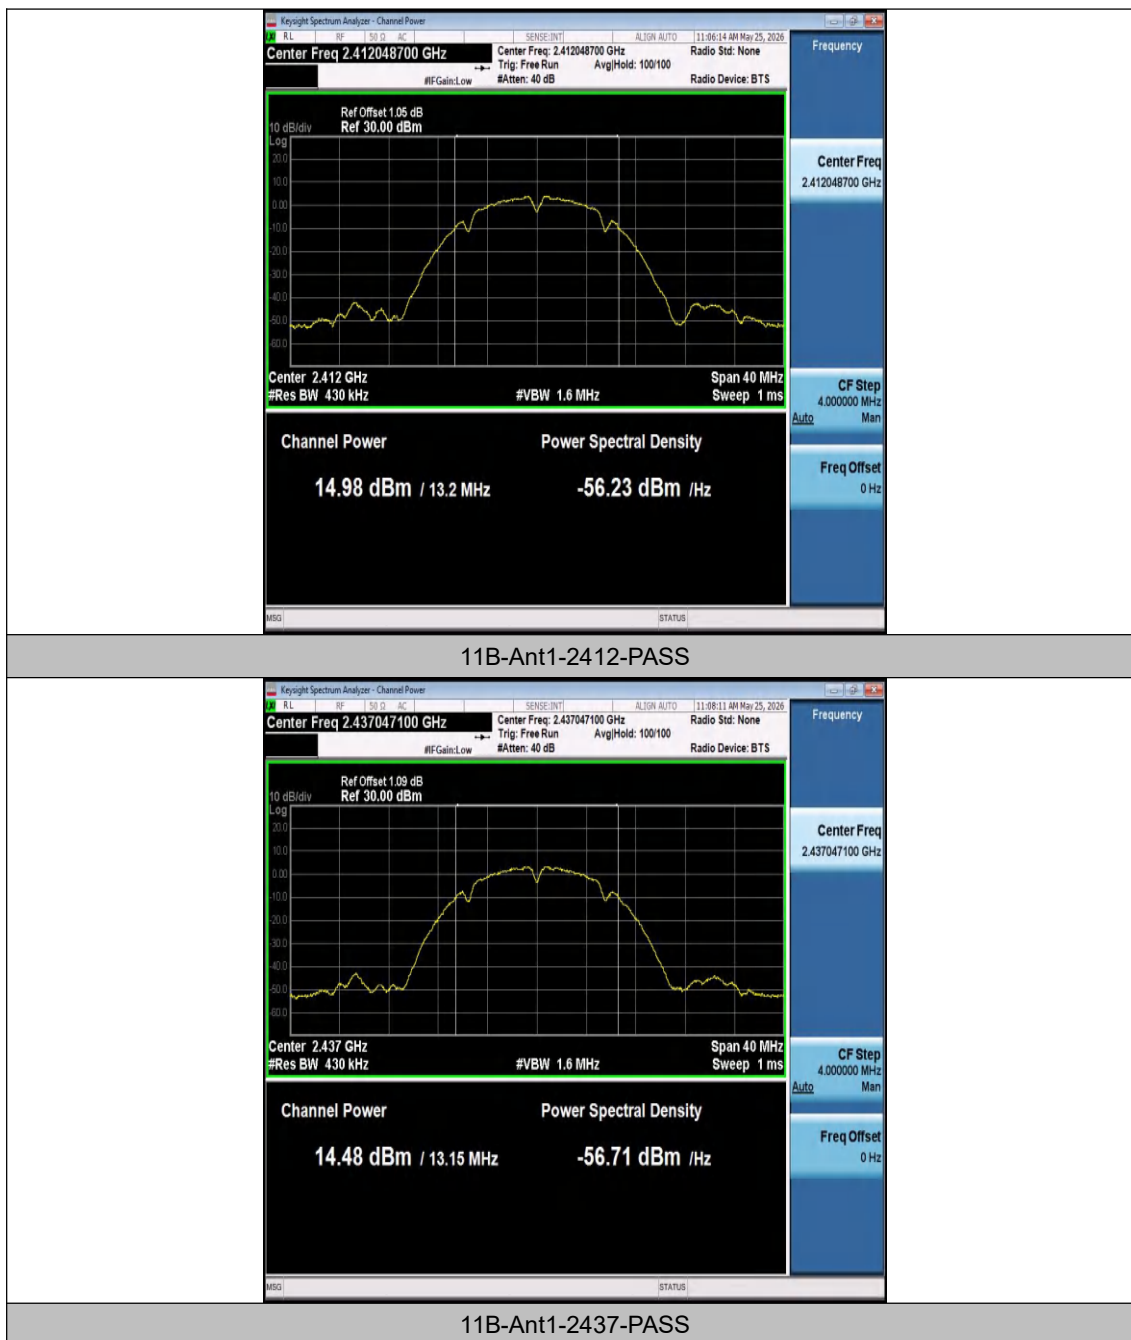

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

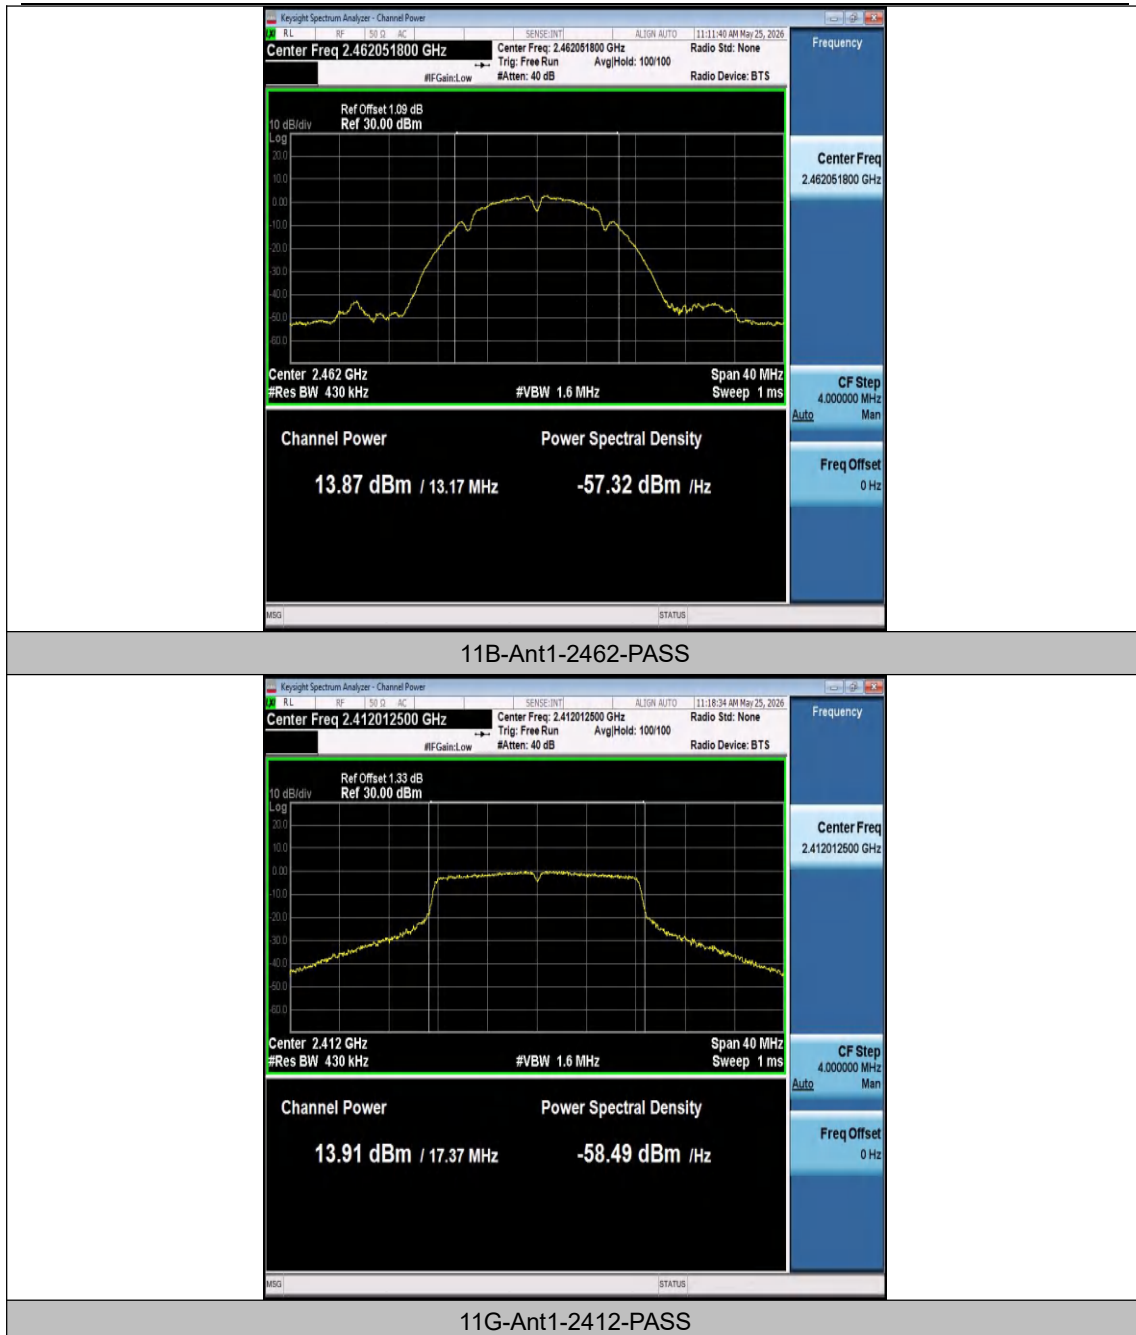

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

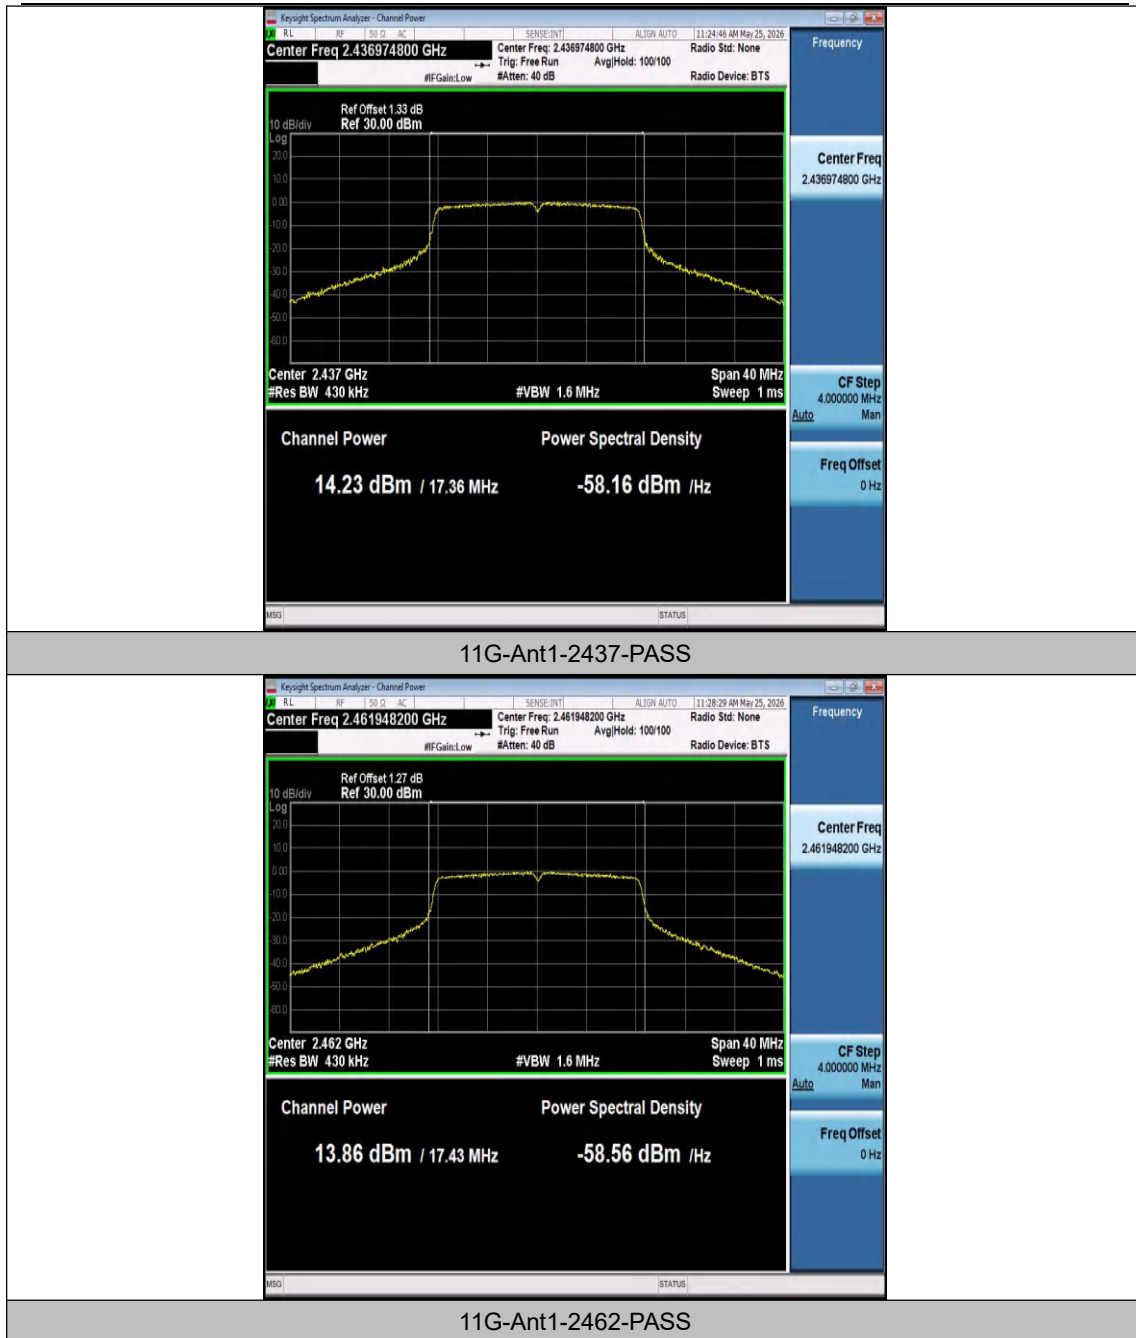


Shenzhen Anbotech Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotech.com E-mail: service@anbotech.com

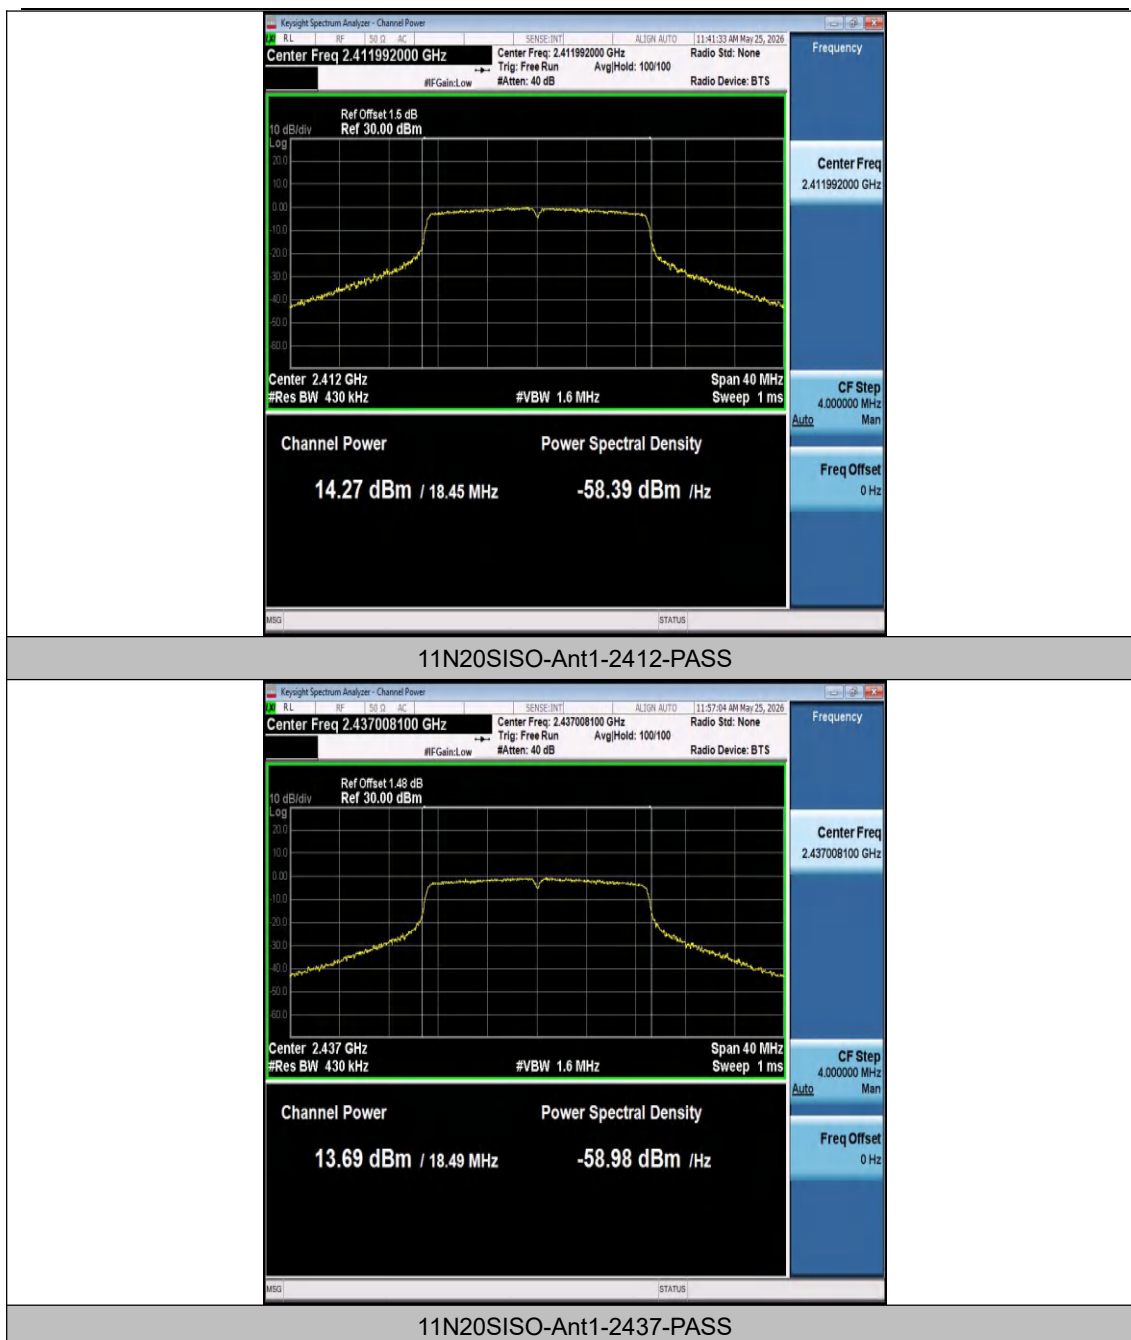


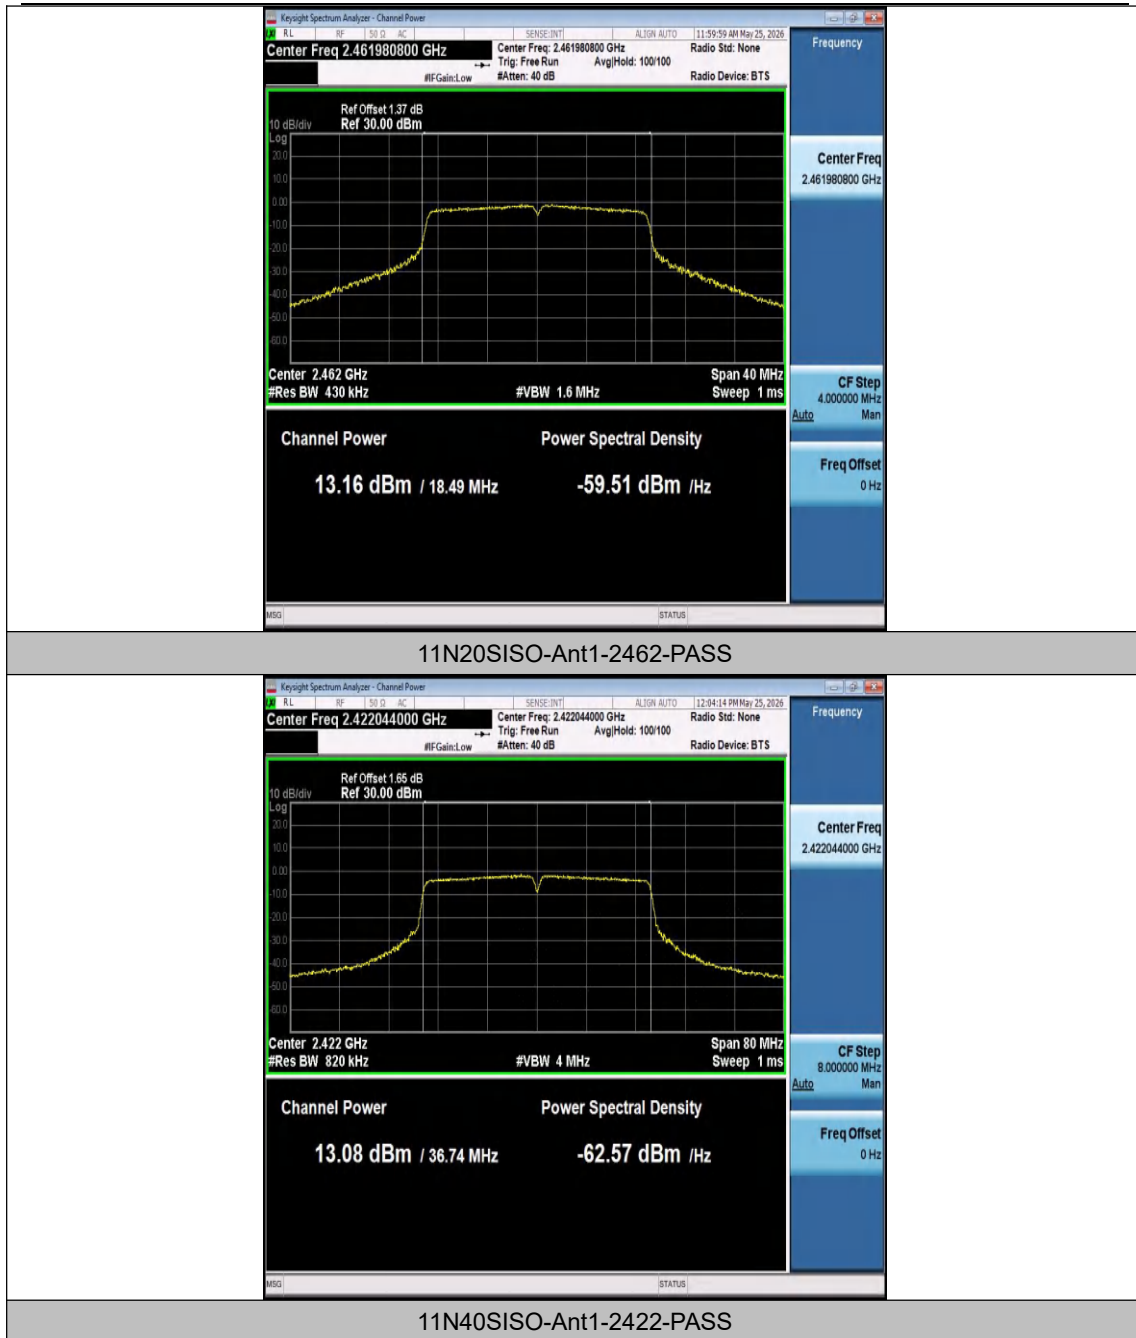

Shenzhen Anbotech Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotech.com E-mail: service@anbotech.com

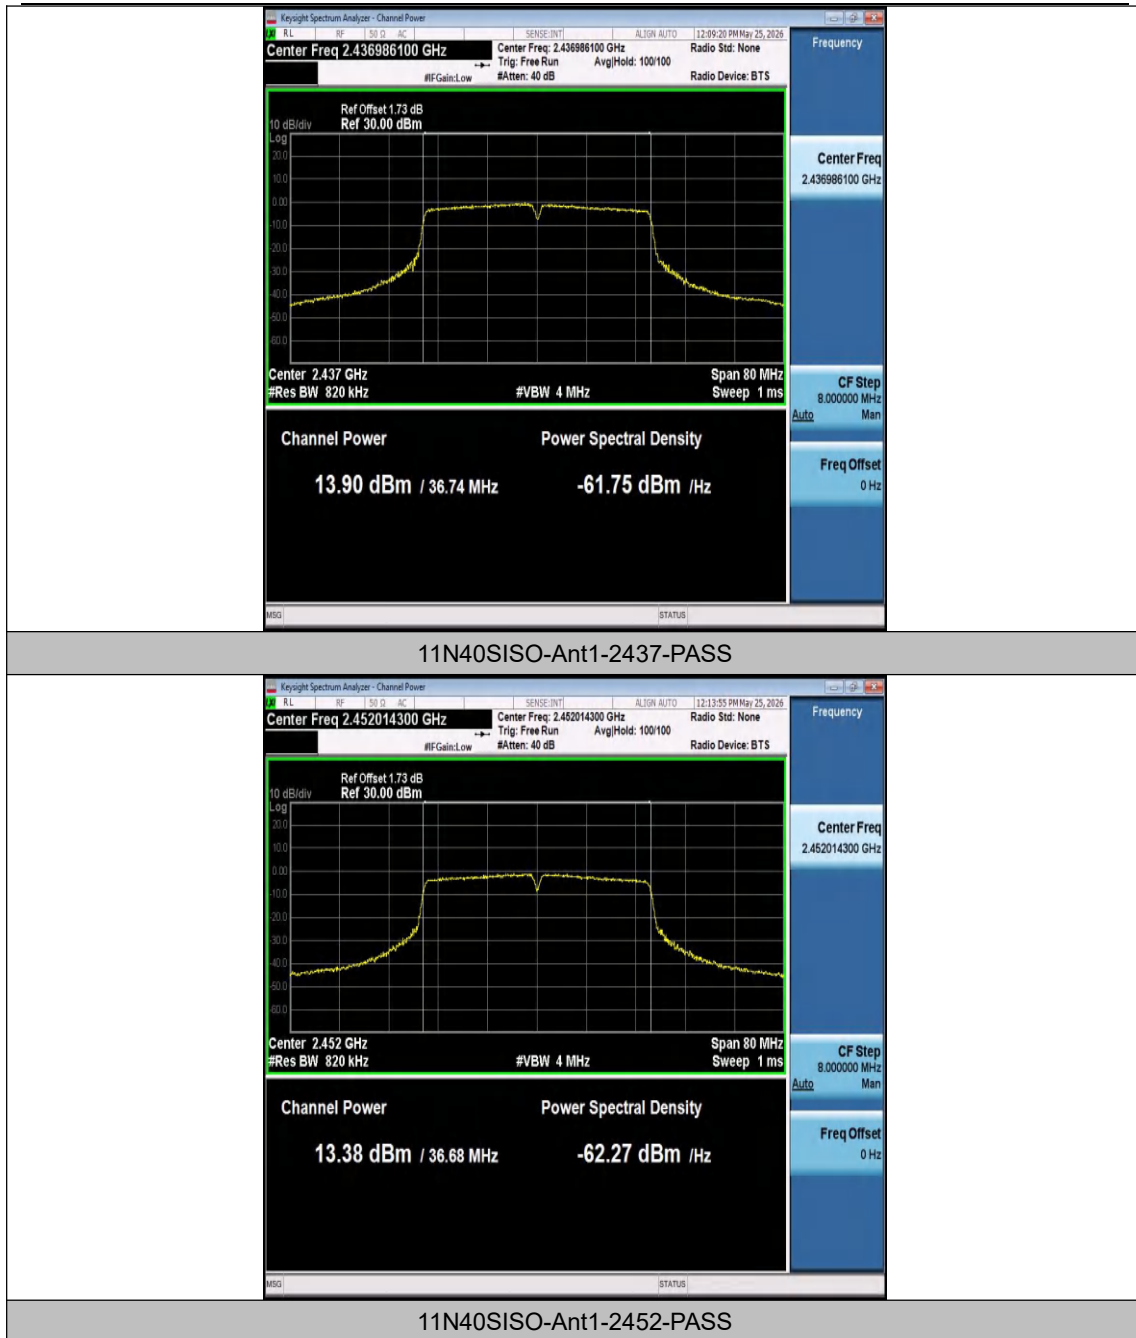

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

Appendix D: Maximum power spectral density


Test Result

Test Mode	Antenna	Frequency [MHz]	Result[dBm/30kHz]	Limit[dBm/3kHz]	Verdict
11B	Ant1	2412	-7.00	≤8.00	PASS
11B	Ant1	2437	-7.39	≤8.00	PASS
11B	Ant1	2462	-7.60	≤8.00	PASS
11G	Ant1	2412	-9.99	≤8.00	PASS
11G	Ant1	2437	-9.49	≤8.00	PASS
11G	Ant1	2462	-10.24	≤8.00	PASS
11N20SIS O	Ant1	2412	-10.03	≤8.00	PASS
11N20SIS O	Ant1	2437	-9.95	≤8.00	PASS
11N20SIS O	Ant1	2462	-11.04	≤8.00	PASS
11N40SIS O	Ant1	2422	-13.74	≤8.00	PASS
11N40SIS O	Ant1	2437	-12.84	≤8.00	PASS
11N40SIS O	Ant1	2452	-13.22	≤8.00	PASS

Note:

1. The Duty Cycle Factor($10 \cdot \log(1/D)$) and cable loss are compensated in the graph.


Test Graphs

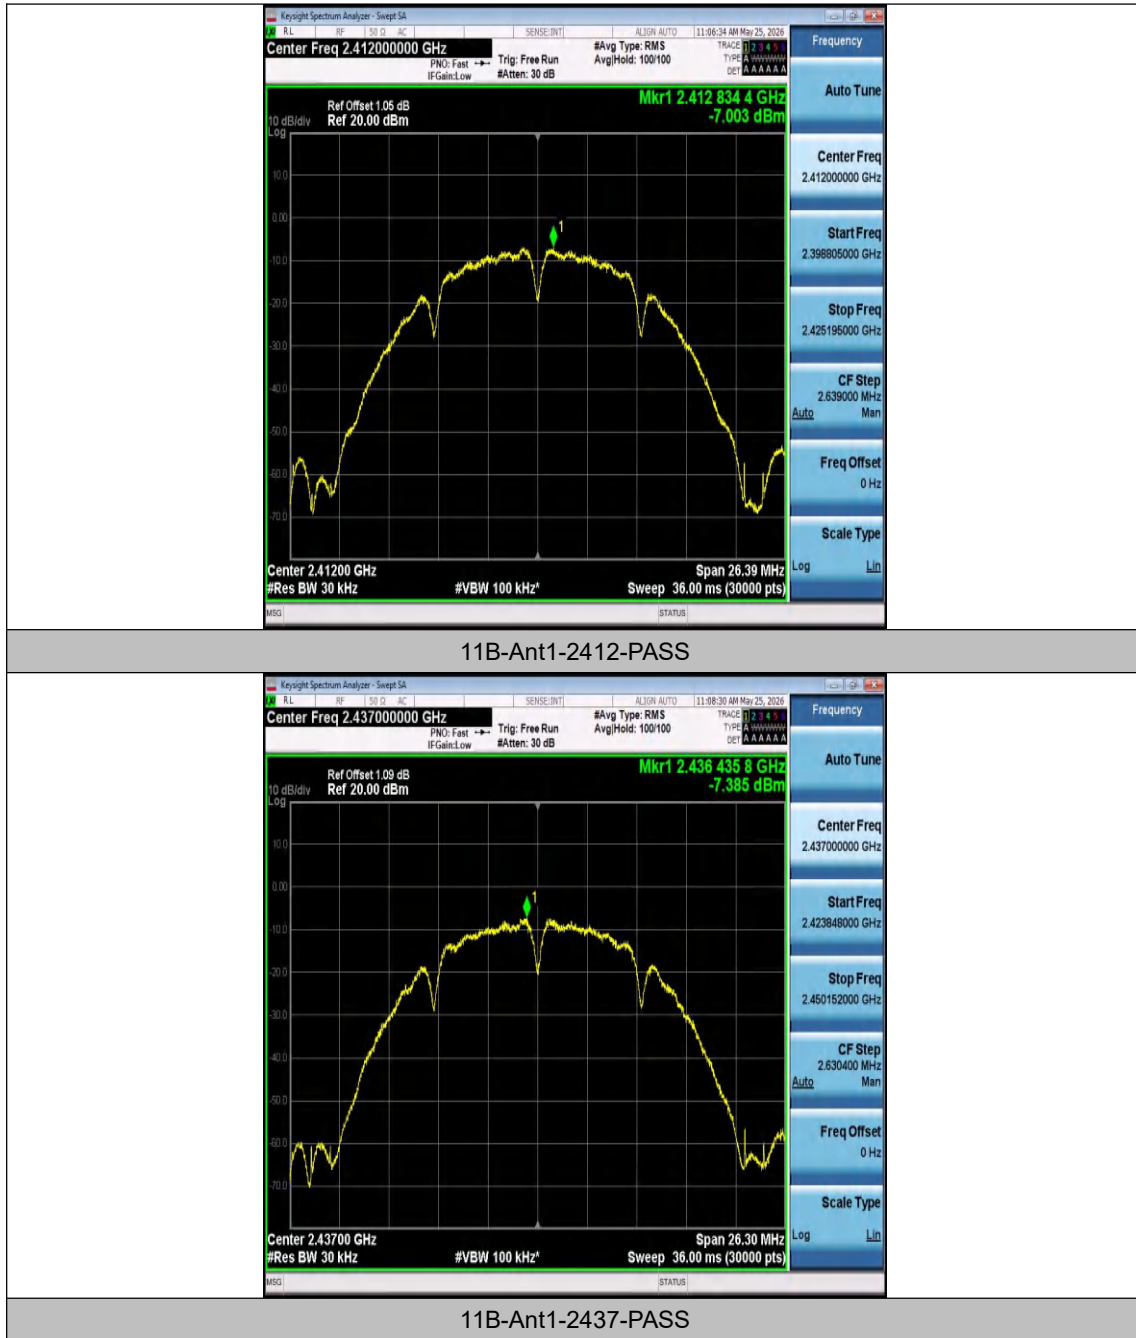

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

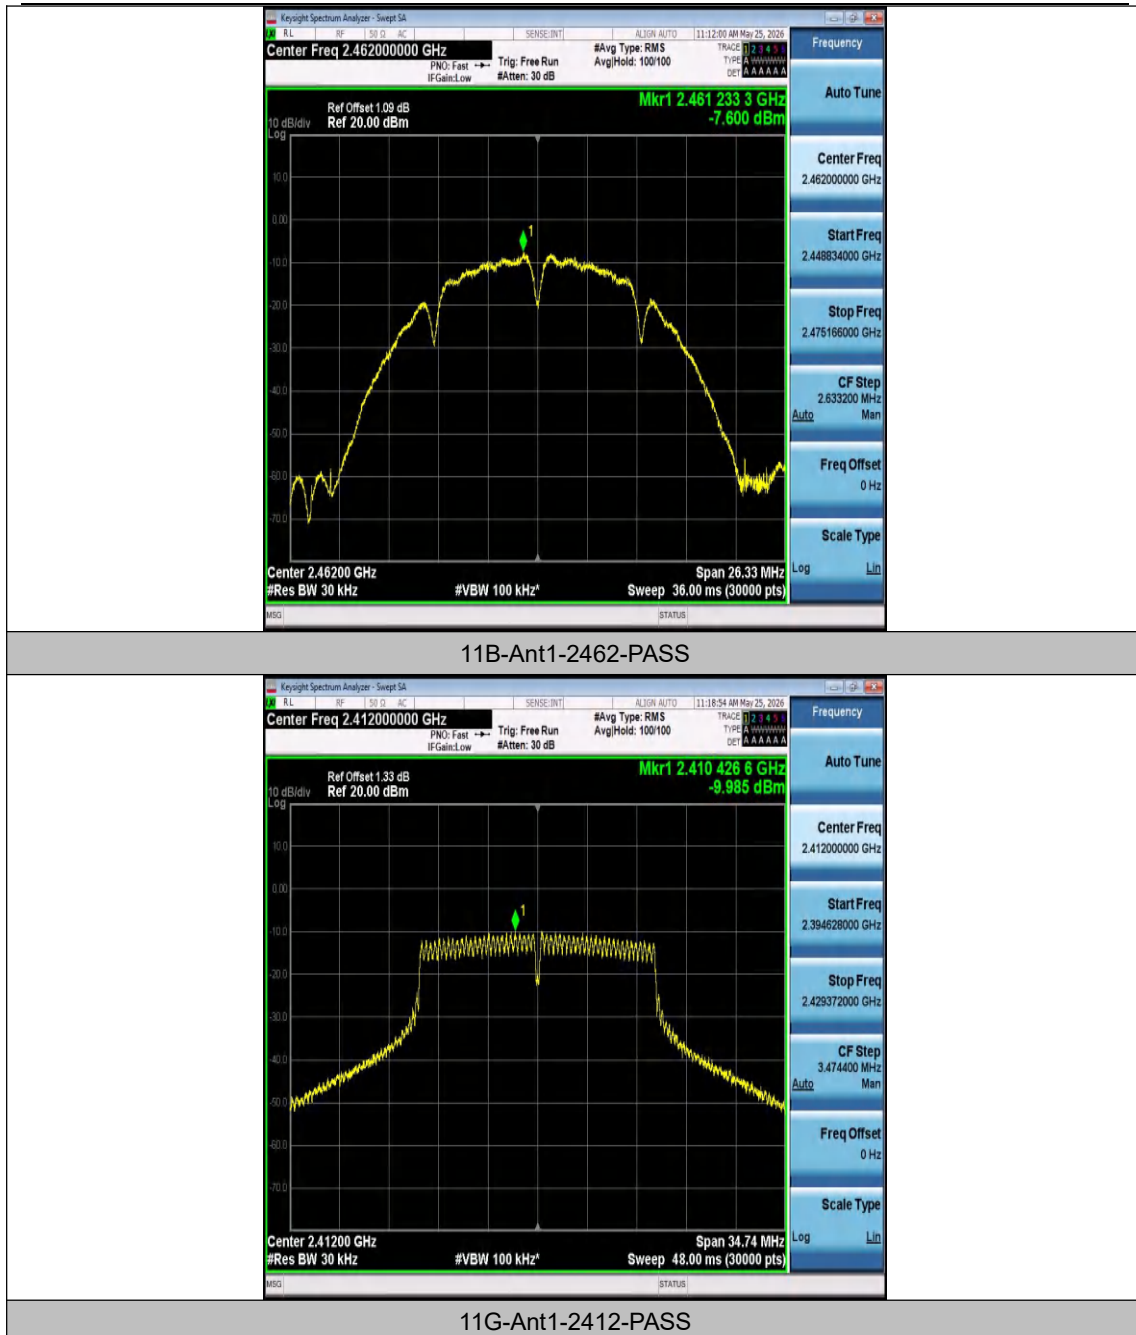

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

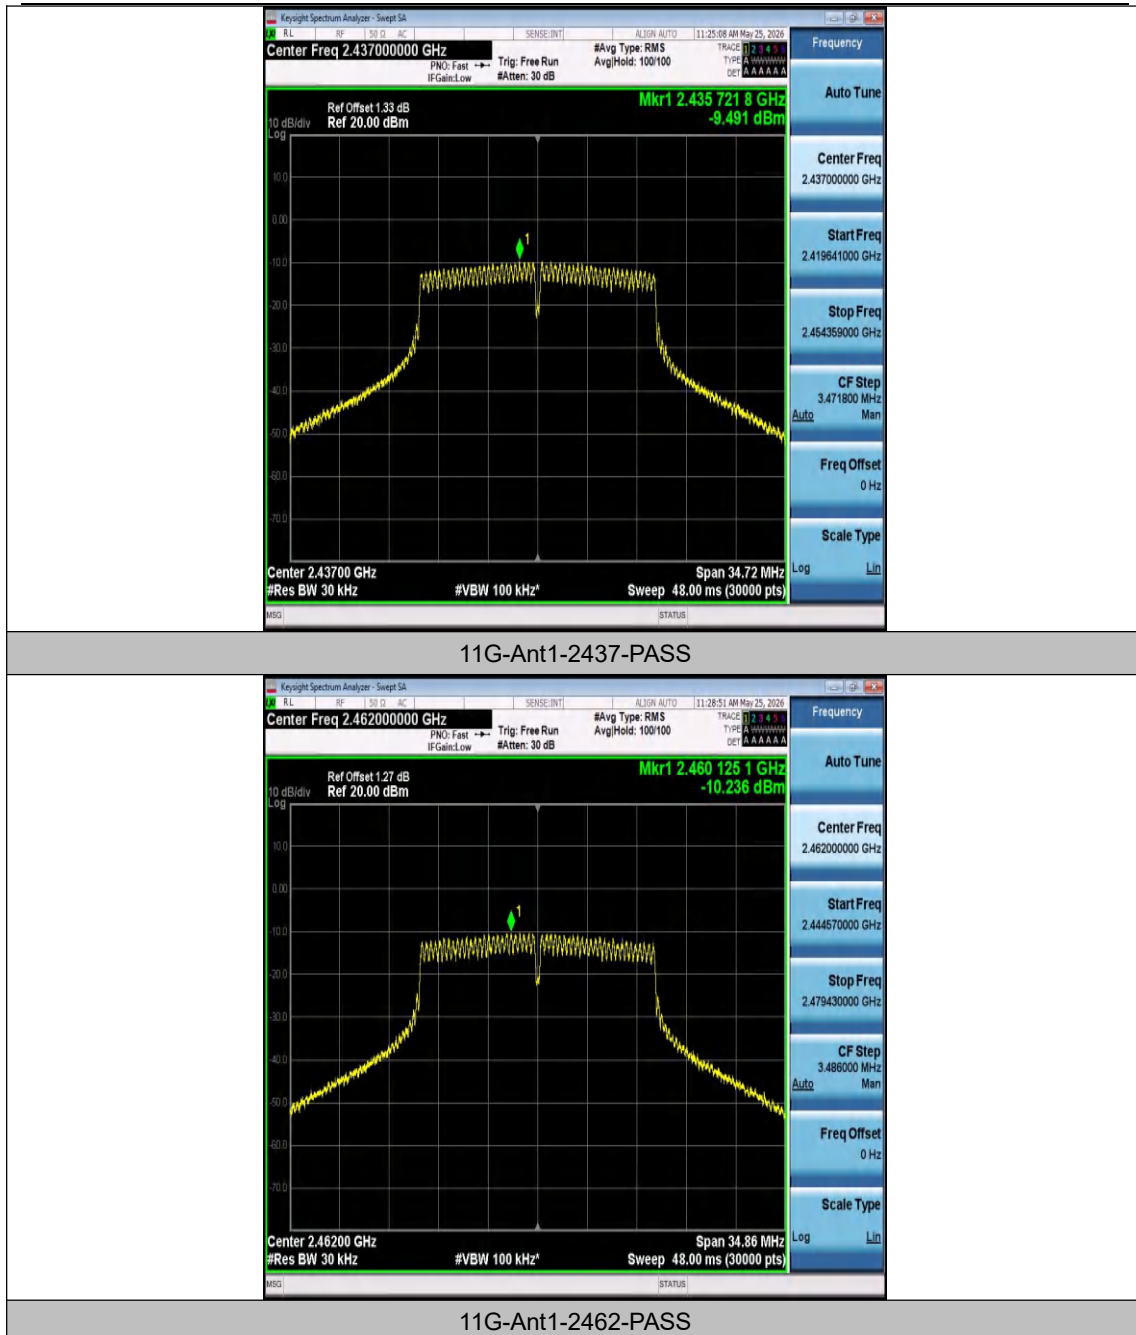

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

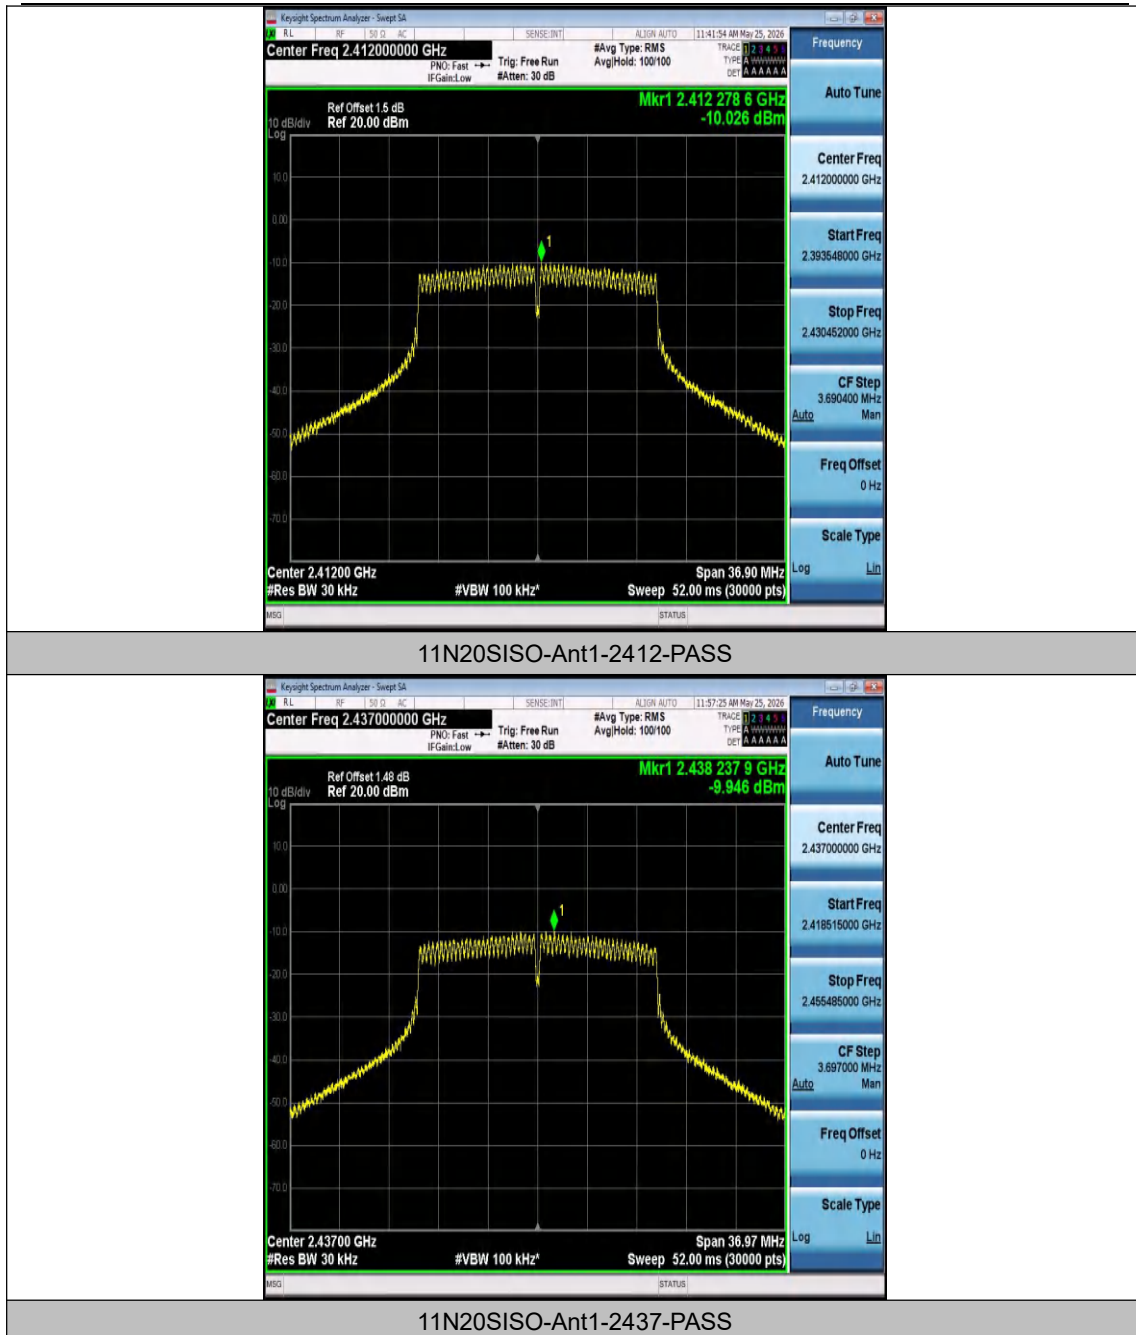

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

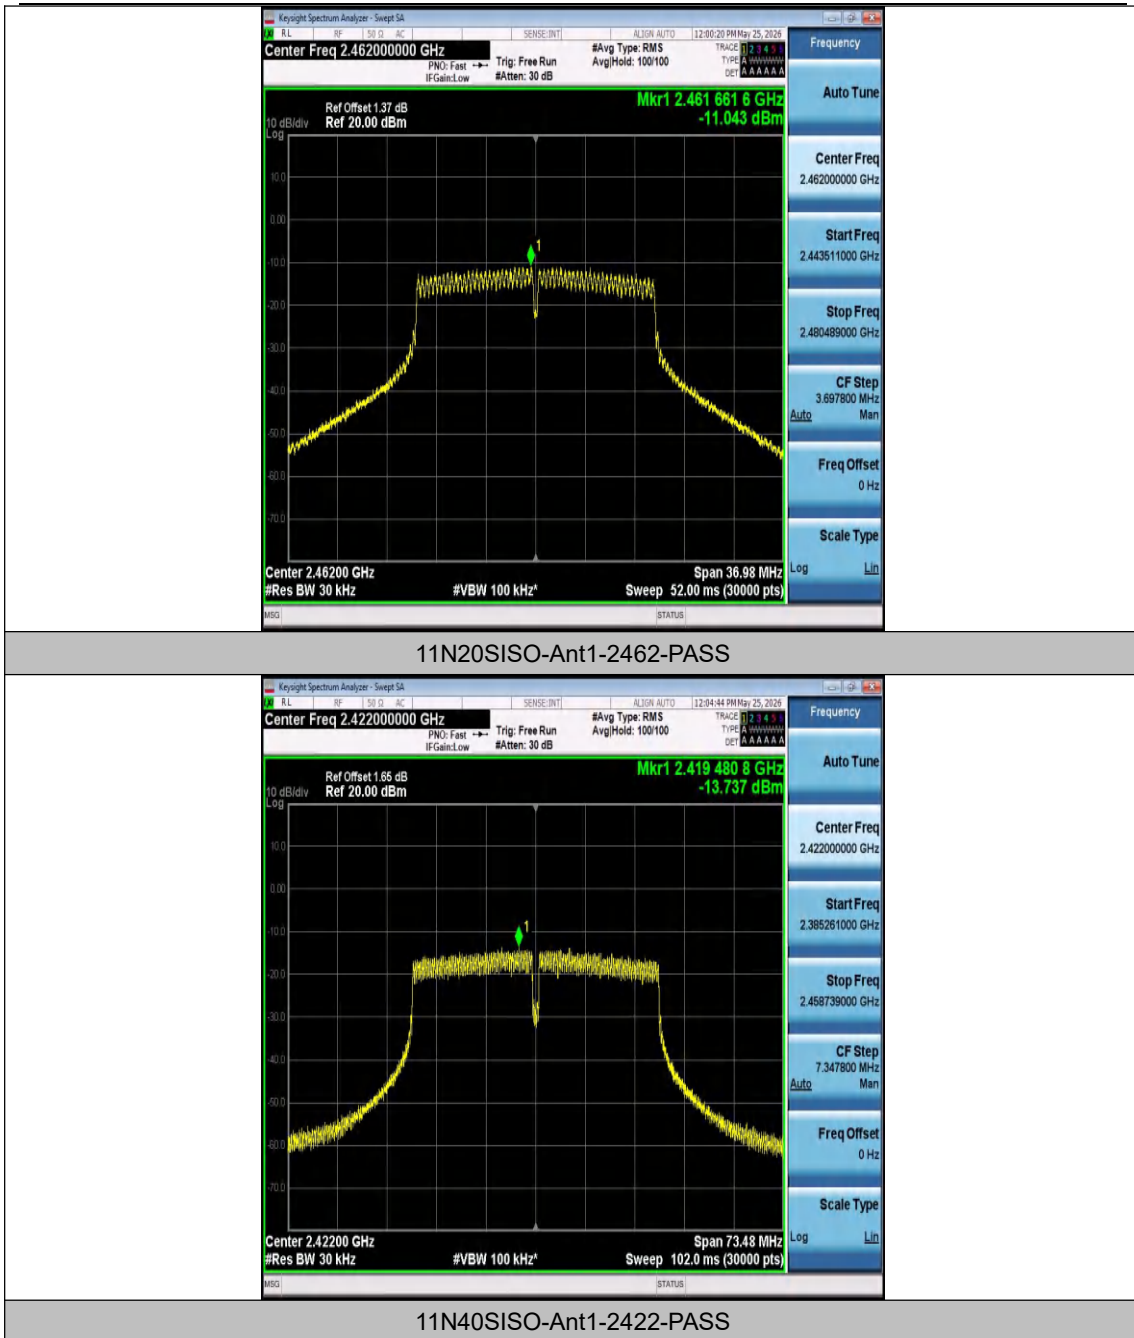

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

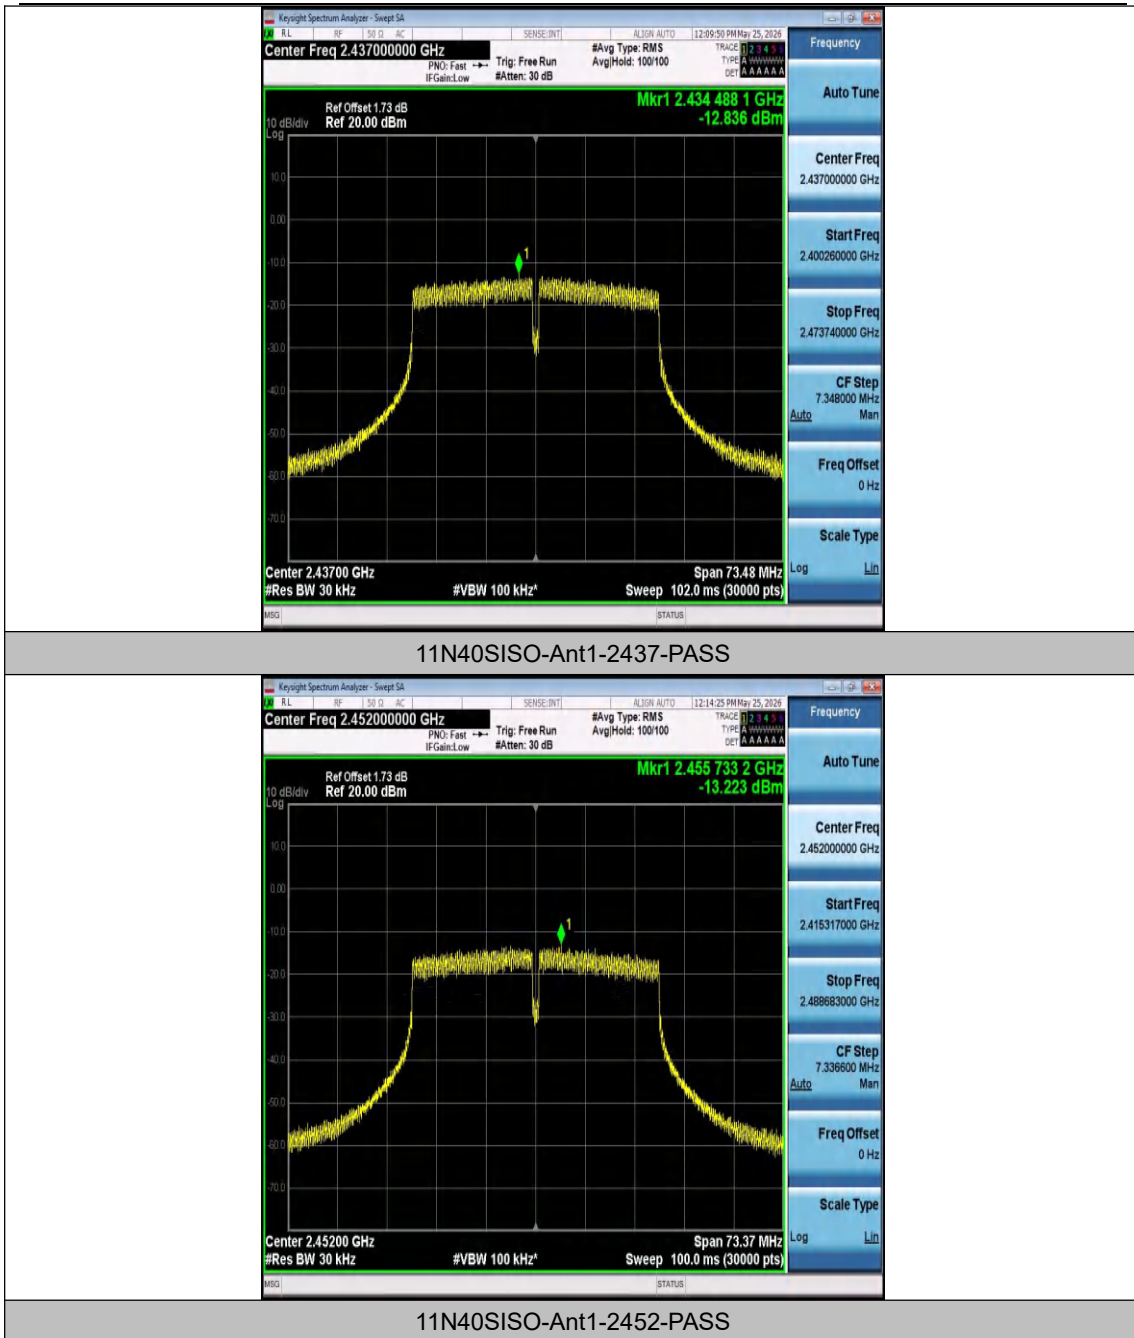

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

Appendix E: Conducted Band edge

Test Result

Test Mode	Antenna	Ch. Name	Frequency[MHz]	Ref. Level[dBm]	Result[dBm]	Limit[dBm]	Verdict
11B	Ant1	Low	2412	5.47	-40.21	≤-24.53	PASS
11B	Ant1	High	2462	4.73	-53.5	≤-25.27	PASS
11G	Ant1	Low	2412	3.50	-27.38	≤-26.5	PASS
11G	Ant1	High	2462	2.78	-45.47	≤-27.22	PASS
11N20SISO	Ant1	Low	2412	2.97	-27.14	≤-27.03	PASS
11N20SISO	Ant1	High	2462	2.00	-42.8	≤-28	PASS
11N40SISO	Ant1	Low	2422	-0.29	-31.39	≤-30.29	PASS
11N40SISO	Ant1	High	2452	-0.27	-39.09	≤-30.27	PASS


Test Graphs

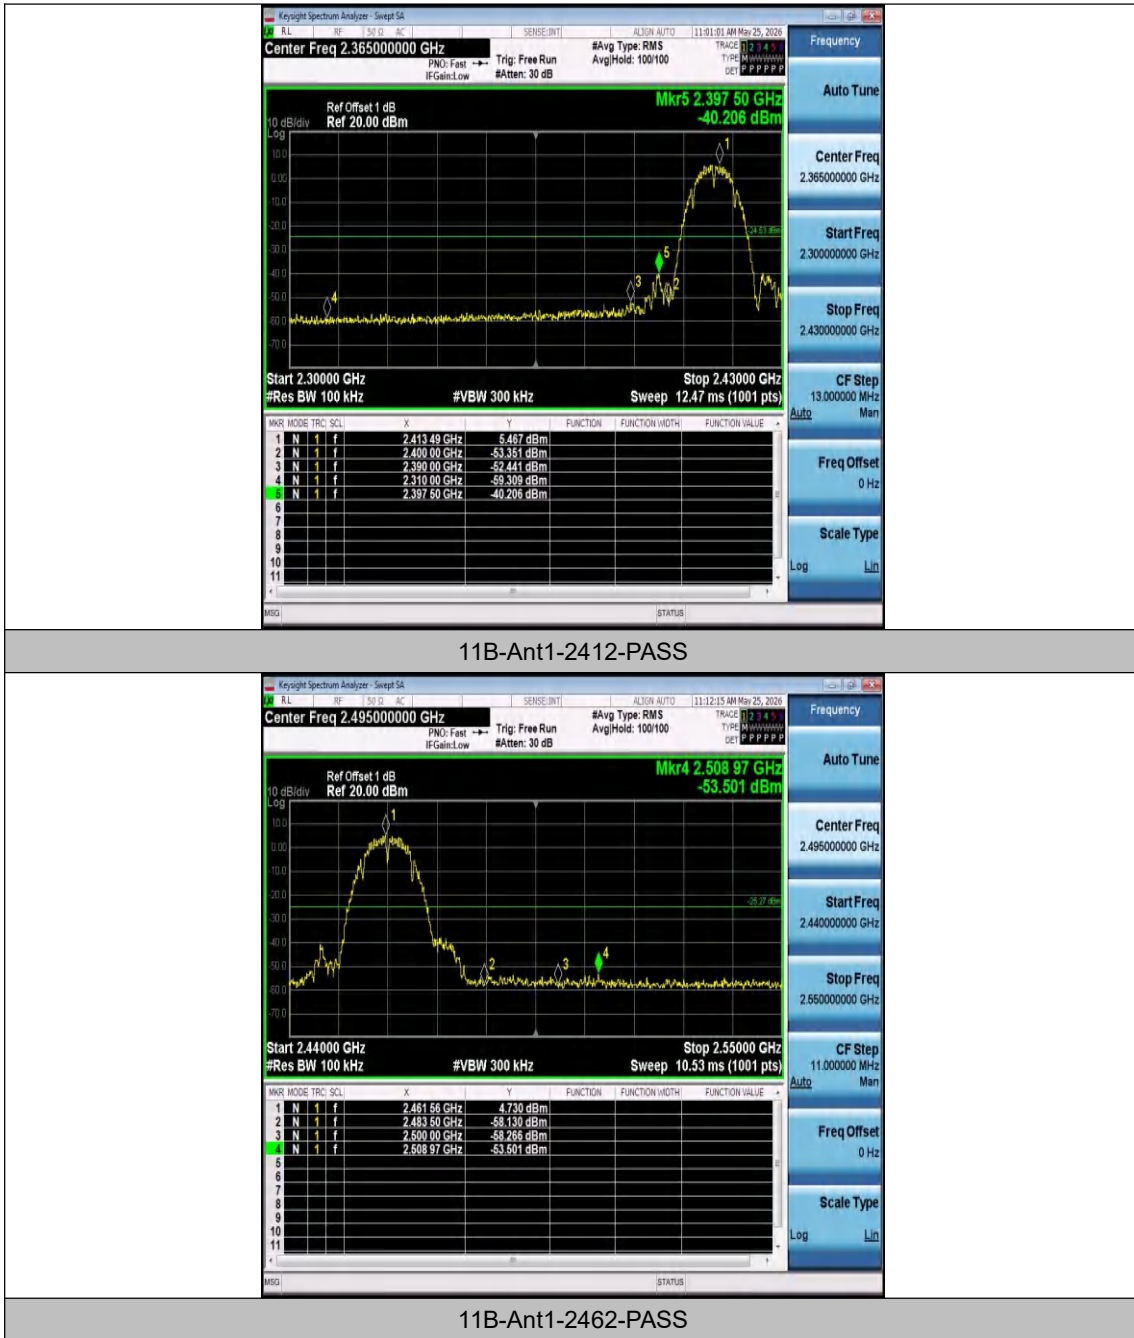


Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

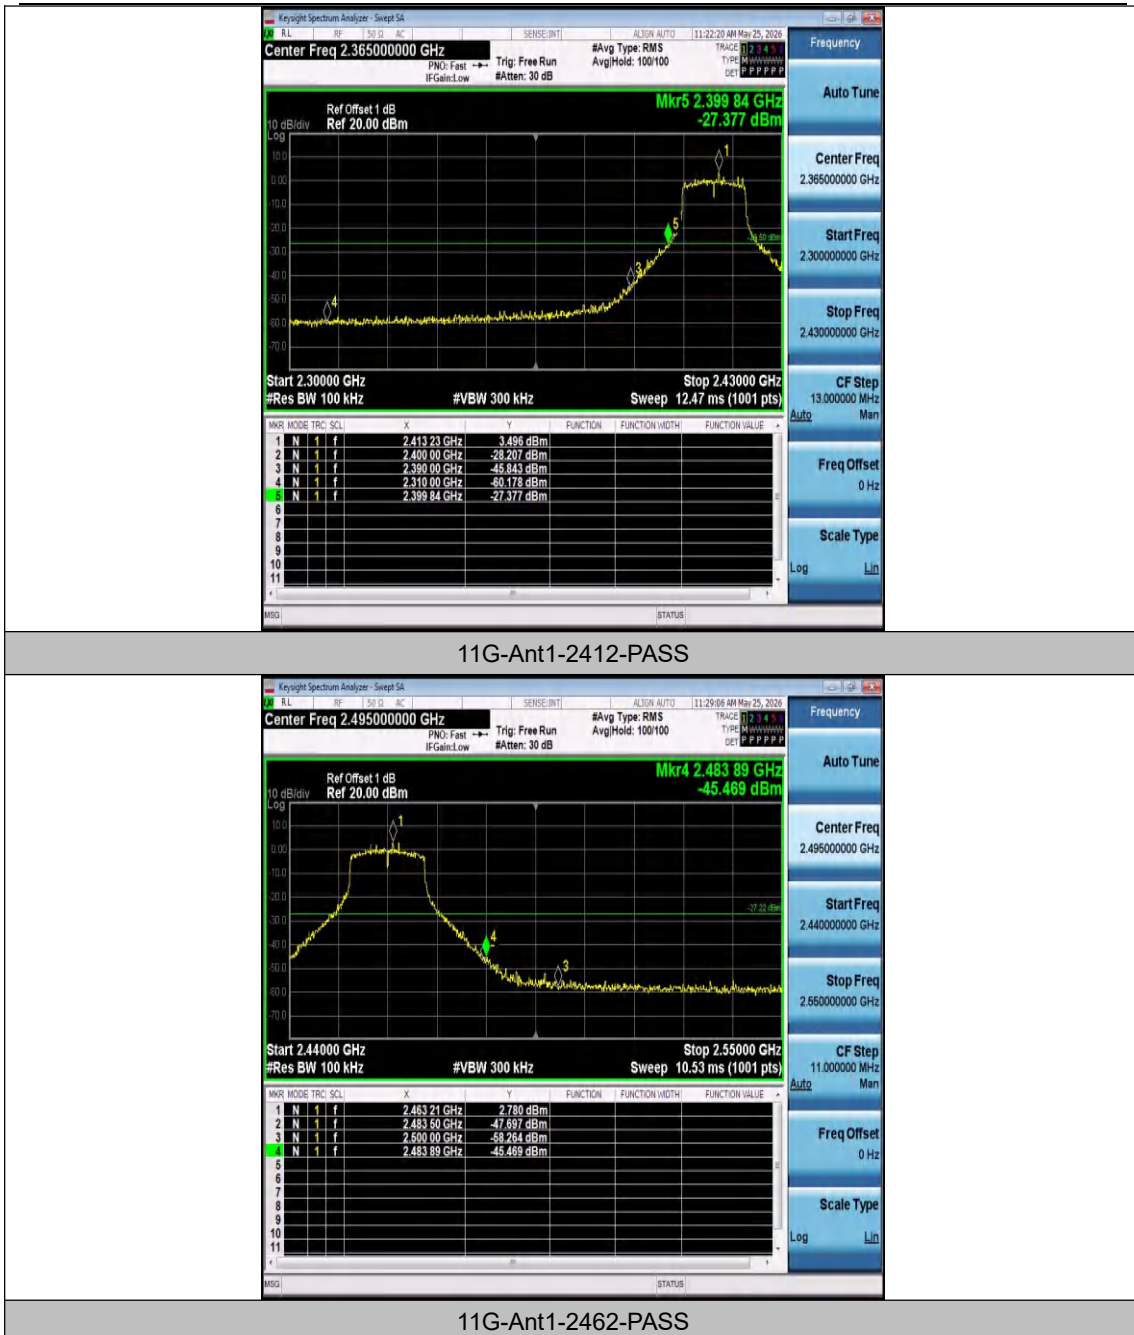

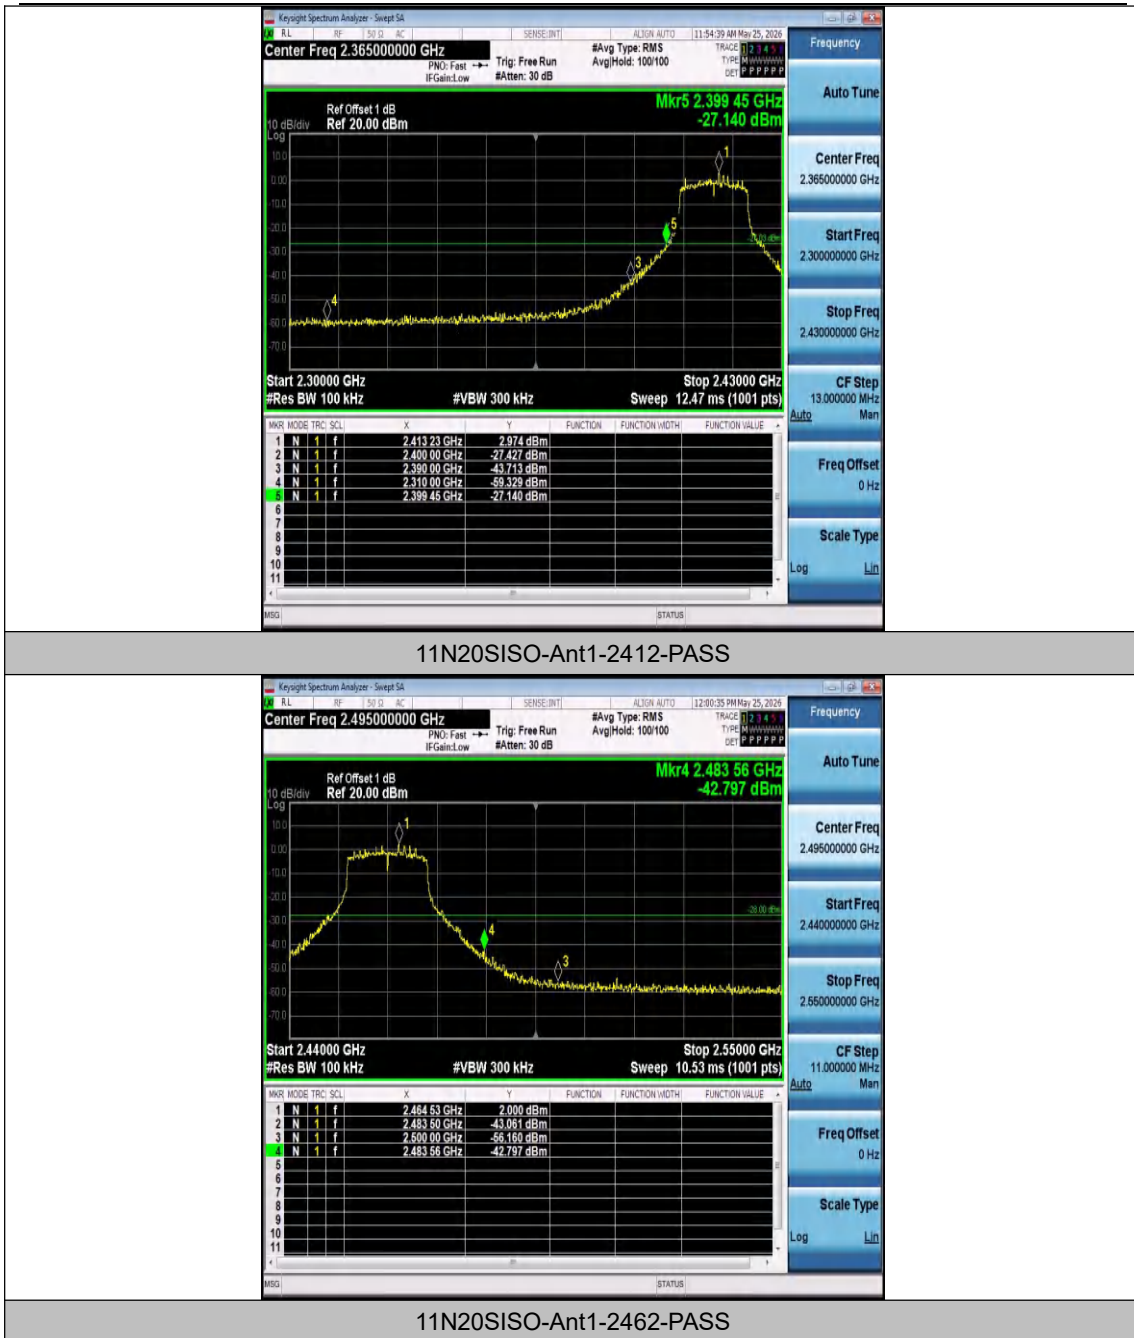

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com



Appendix F: Conducted Spurious Emission

Test Result

Test Mode	Antenna	Frequency[MHz]	Freq. Range [Mhz]	Ref. Level [dBm]	Result [dBm]	Limit [dBm]	Verdict
11B	Ant1	2412	0~Reference	6.46	6.46	---	PASS
11B	Ant1	2412	30~1000	6.46	-43.39	≤-23.54	PASS
11B	Ant1	2412	1000~26500	6.46	-43.62	≤-23.54	PASS
11B	Ant1	2437	0~Reference	5.15	5.15	---	PASS
11B	Ant1	2437	30~1000	5.15	-47.91	≤-24.85	PASS
11B	Ant1	2437	1000~26500	5.15	-42.8	≤-24.85	PASS
11B	Ant1	2462	0~Reference	5.30	5.30	---	PASS
11B	Ant1	2462	30~1000	5.30	-51.85	≤-24.7	PASS
11B	Ant1	2462	1000~26500	5.30	-41.8	≤-24.7	PASS
11G	Ant1	2412	0~Reference	2.39	2.39	---	PASS
11G	Ant1	2412	30~1000	2.39	-39.41	≤-27.61	PASS
11G	Ant1	2412	1000~26500	2.39	-48.63	≤-27.61	PASS
11G	Ant1	2437	0~Reference	2.74	2.74	---	PASS
11G	Ant1	2437	30~1000	2.74	-55.93	≤-27.26	PASS
11G	Ant1	2437	1000~26500	2.74	-48.56	≤-27.26	PASS
11G	Ant1	2462	0~Reference	2.64	2.64	---	PASS
11G	Ant1	2462	30~1000	2.64	-56.64	≤-27.36	PASS
11G	Ant1	2462	1000~26500	2.64	-48.76	≤-27.36	PASS
11N20SISO	Ant1	2412	0~Reference	1.74	1.74	---	PASS
11N20SISO	Ant1	2412	30~1000	1.74	-58.59	≤-28.26	PASS
11N20SISO	Ant1	2412	1000~26500	1.74	-39.2	≤-28.26	PASS
11N20SISO	Ant1	2437	0~Reference	3.43	3.43	---	PASS
11N20SISO	Ant1	2437	30~1000	3.43	-59.55	≤-26.57	PASS
11N20SISO	Ant1	2437	1000~26500	3.43	-37.6	≤-26.57	PASS
11N20SISO	Ant1	2462	0~Reference	1.79	1.79	---	PASS
11N20SISO	Ant1	2462	30~1000	1.79	-59.29	≤-28.21	PASS
11N20SISO	Ant1	2462	1000~26500	1.79	-38.36	≤-28.21	PASS
11N40SISO	Ant1	2422	0~Reference	-0.36	-0.36	---	PASS
11N40SISO	Ant1	2422	30~1000	-0.36	-59.31	≤-30.36	PASS
11N40SISO	Ant1	2422	1000~26500	-0.36	-41.92	≤-30.36	PASS
11N40SISO	Ant1	2437	0~Reference	0.10	0.10	---	PASS
11N40SISO	Ant1	2437	30~1000	0.10	-58.68	≤-29.9	PASS
11N40SISO	Ant1	2437	1000~26500	0.10	-46.43	≤-29.9	PASS
11N40SISO	Ant1	2452	0~Reference	-0.51	-0.51	---	PASS
11N40SISO	Ant1	2452	30~1000	-0.51	-59.32	≤-30.51	PASS
11N40SISO	Ant1	2452	1000~26500	-0.51	-48.39	≤-30.51	PASS


Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

Remark:Regarding the spurious emissions from 30MHz to 26.5GHz, the cable loss have been set in the 'Input Correction' of the Spectrum Analyzer during the test.


Test Graphs

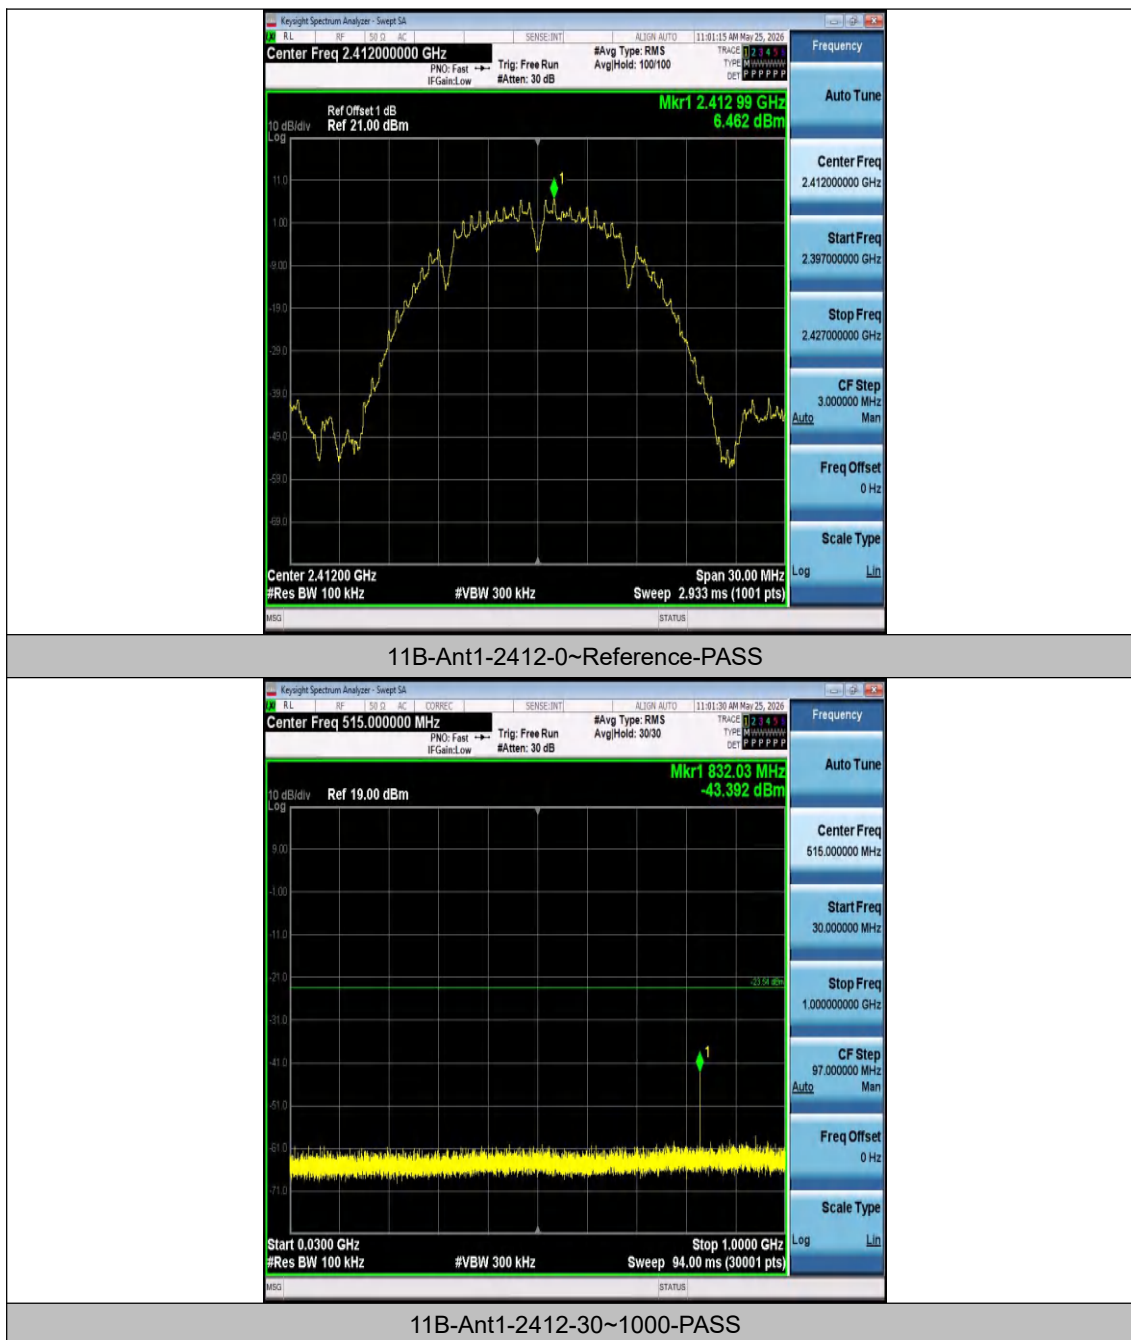

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

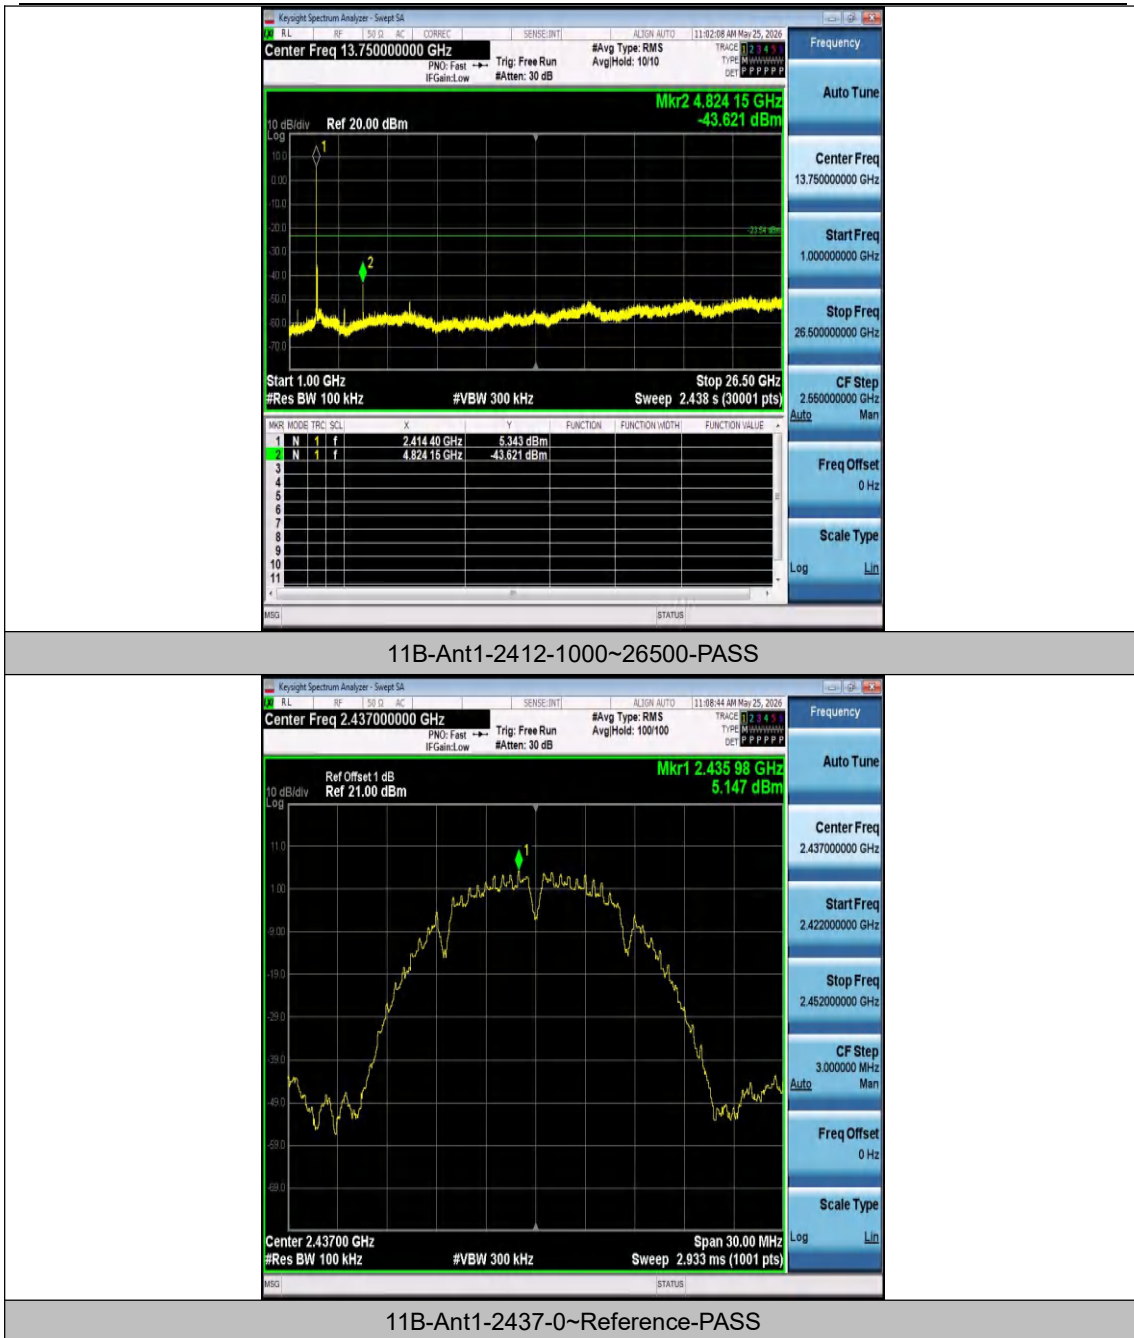

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

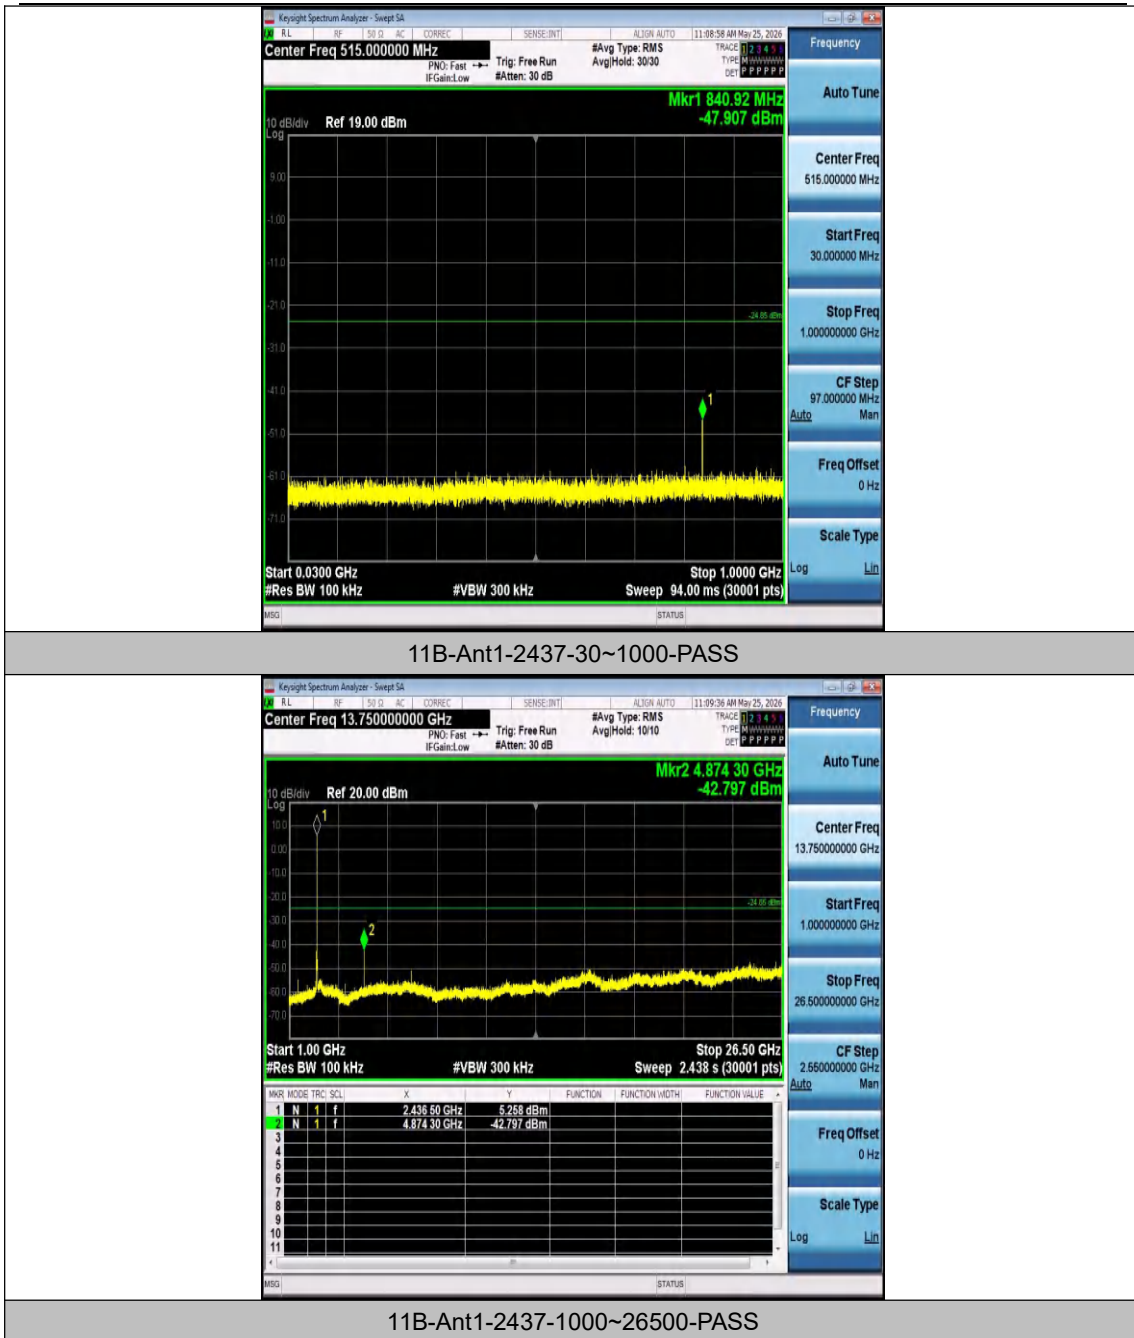

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

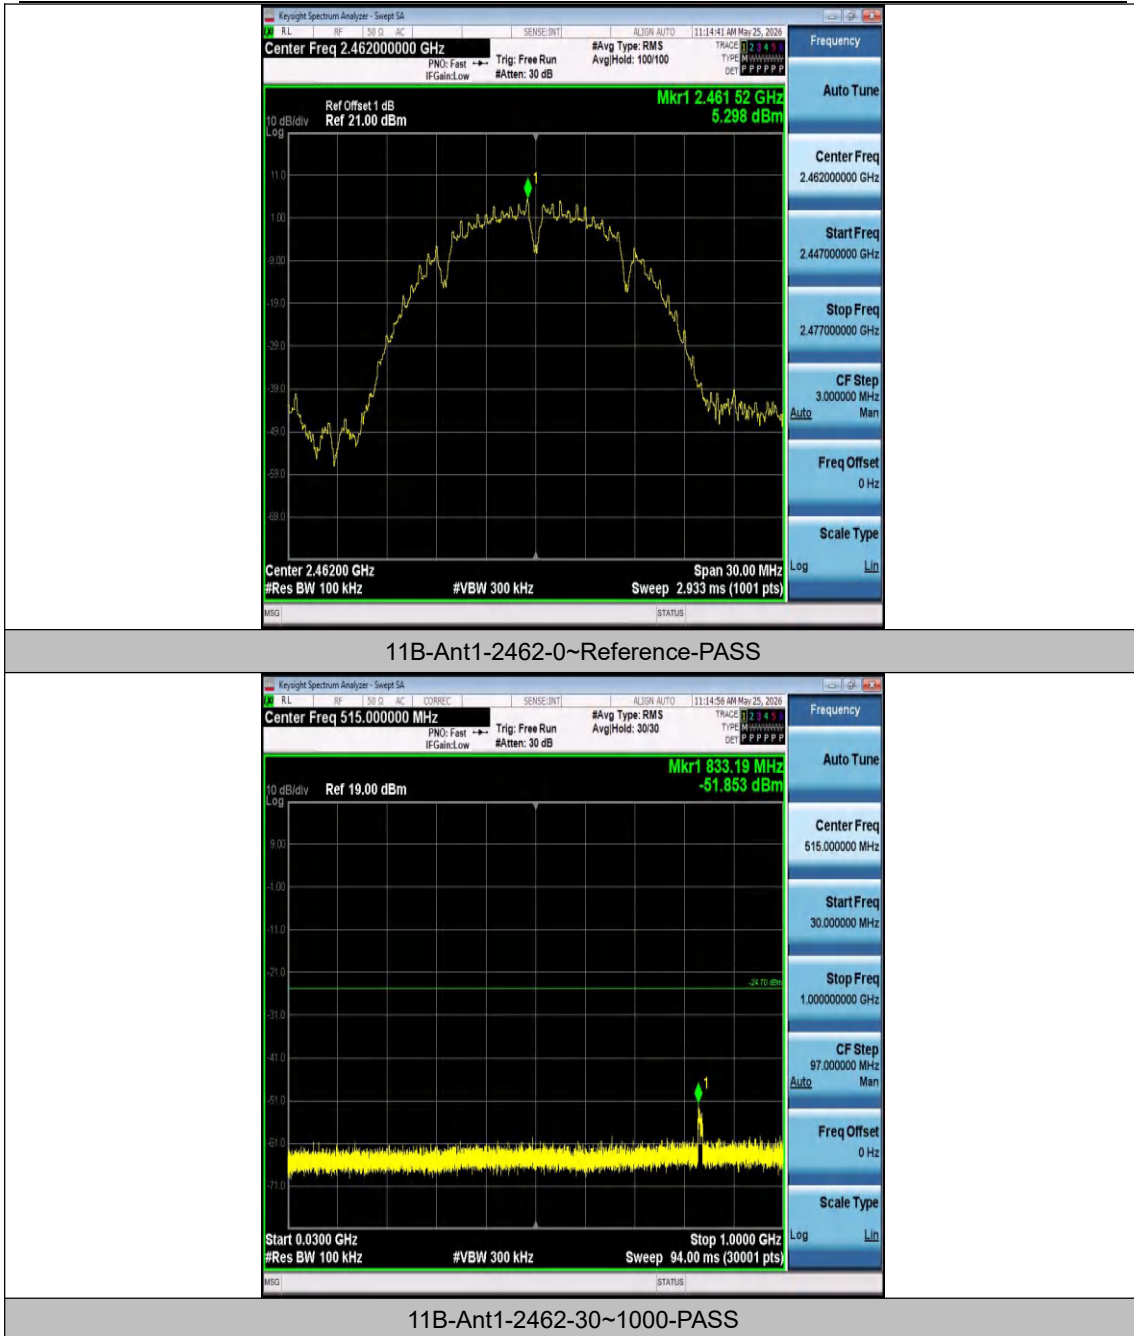

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

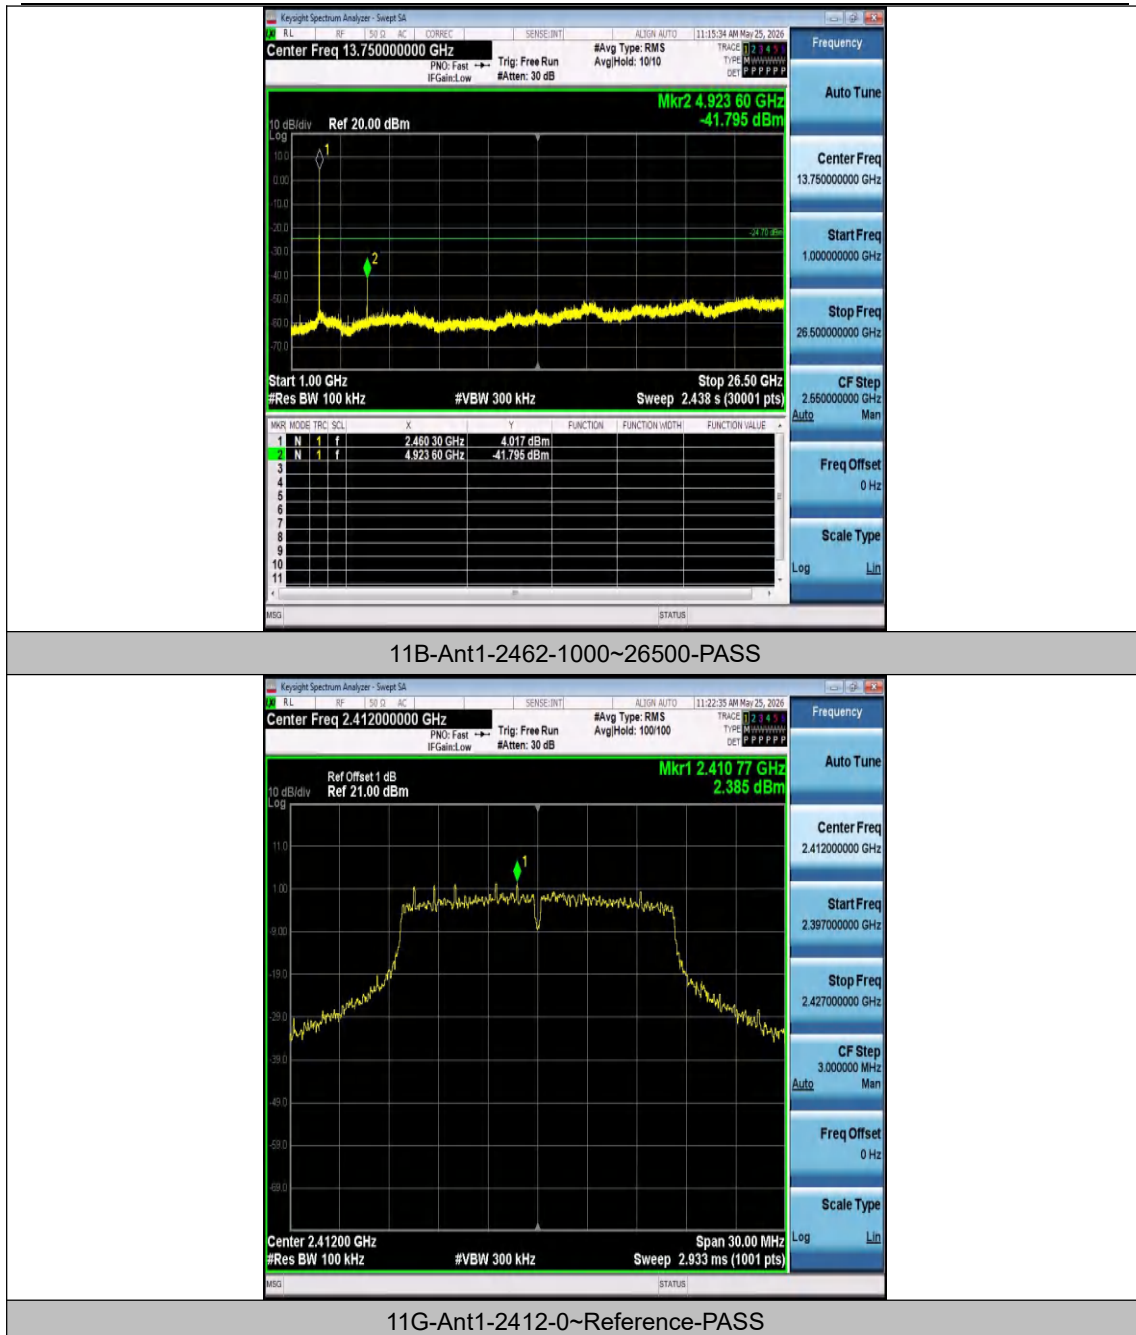

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

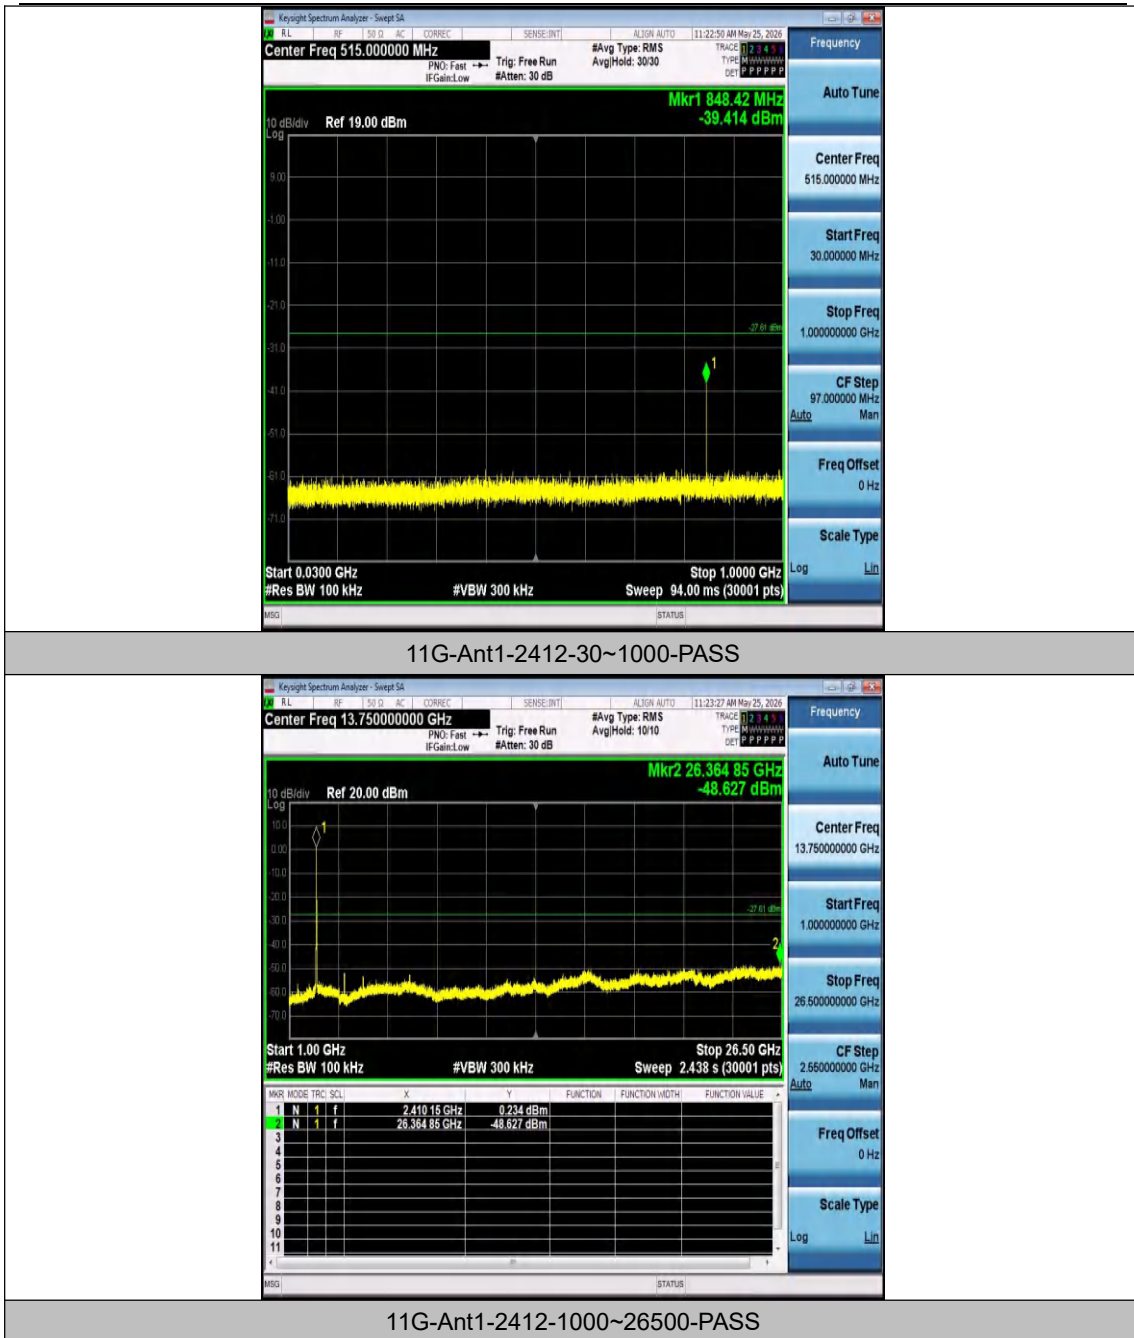

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

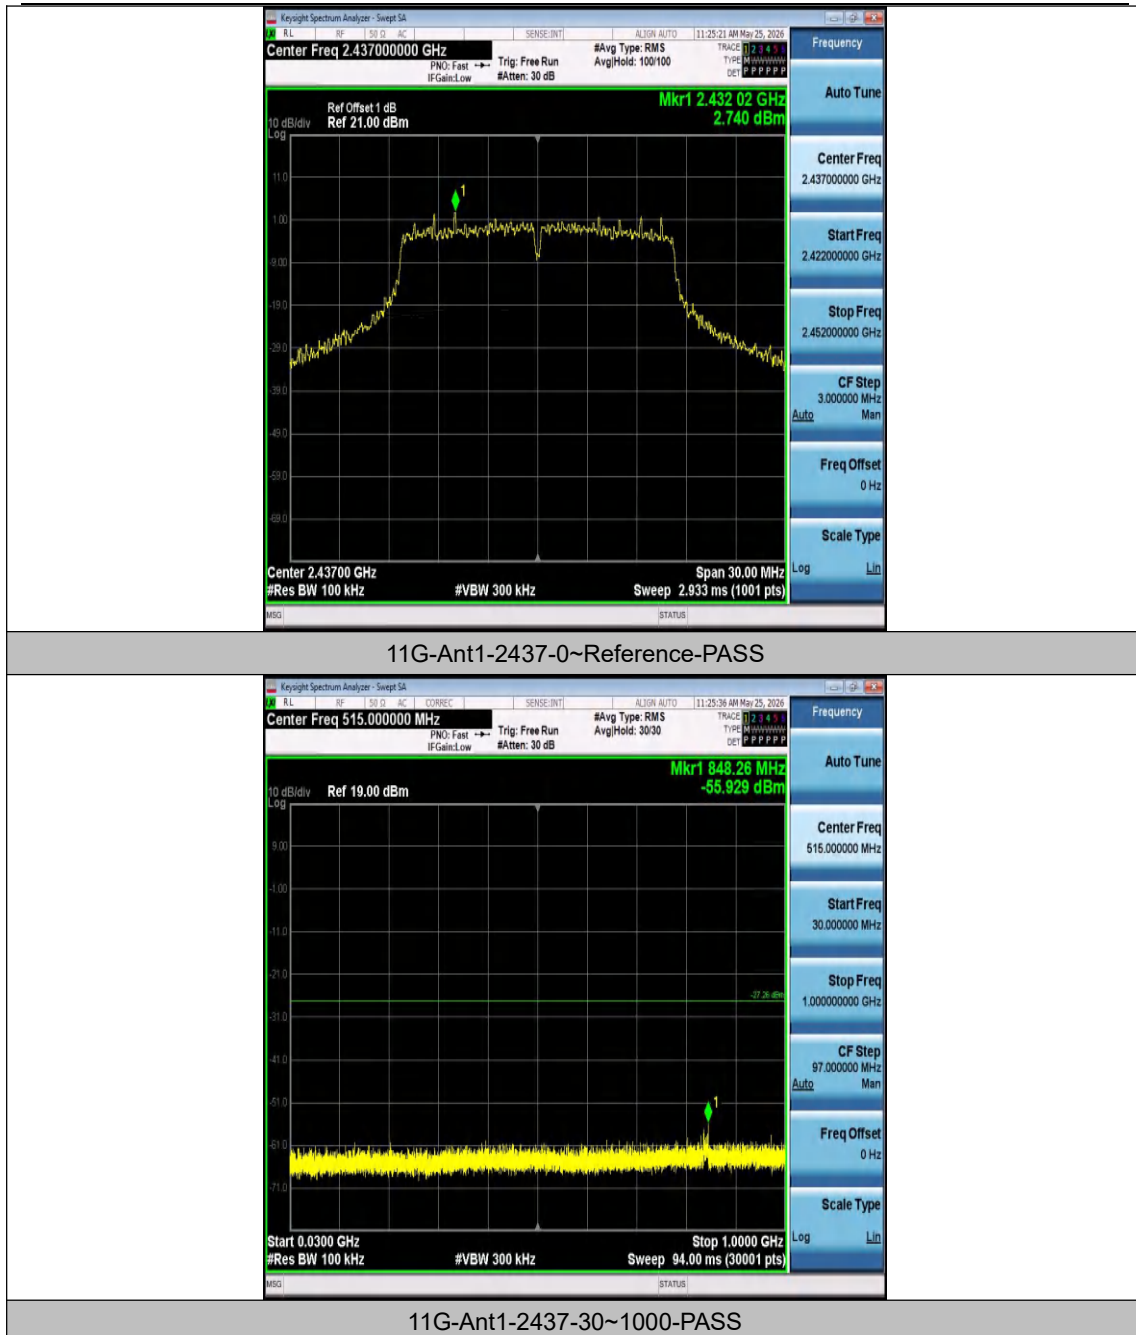

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

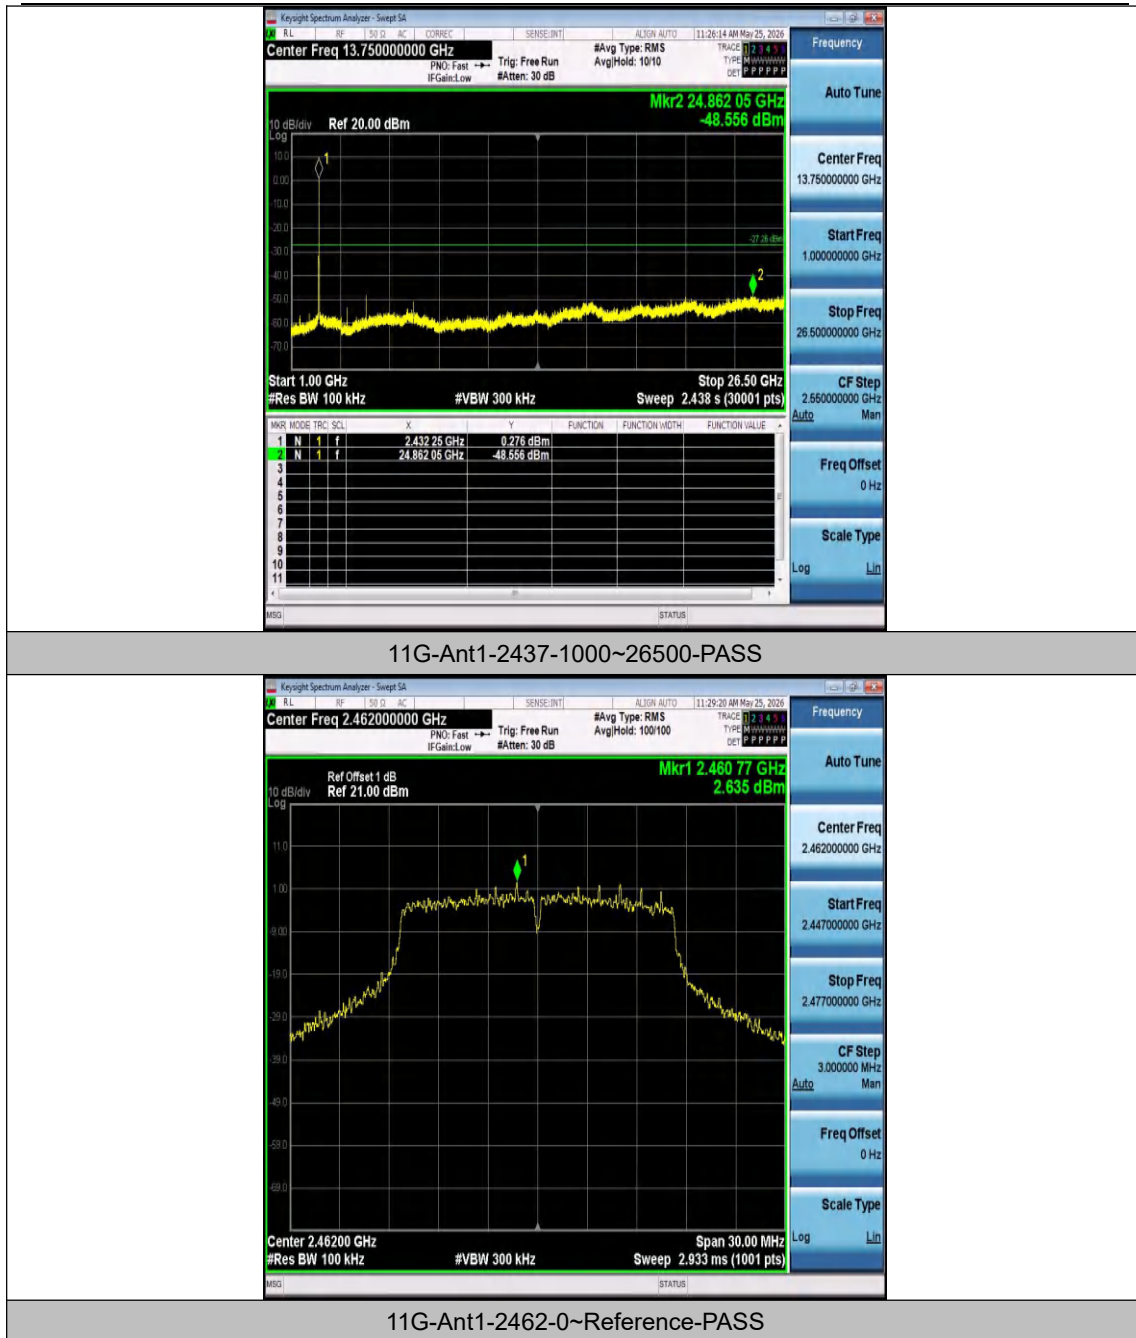

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

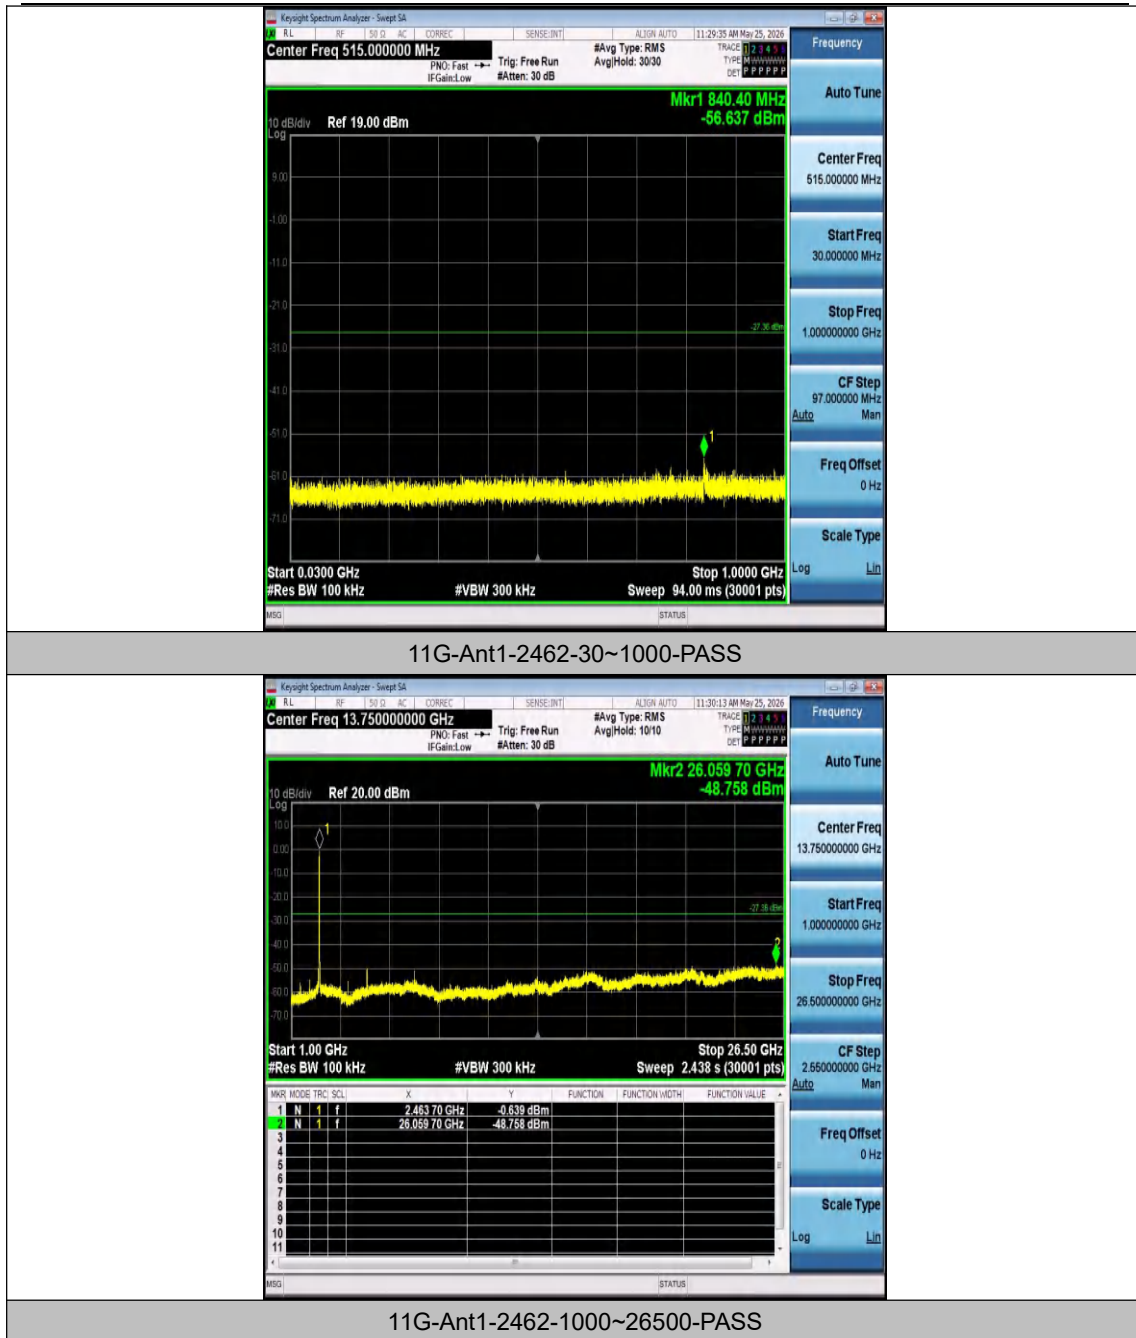

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

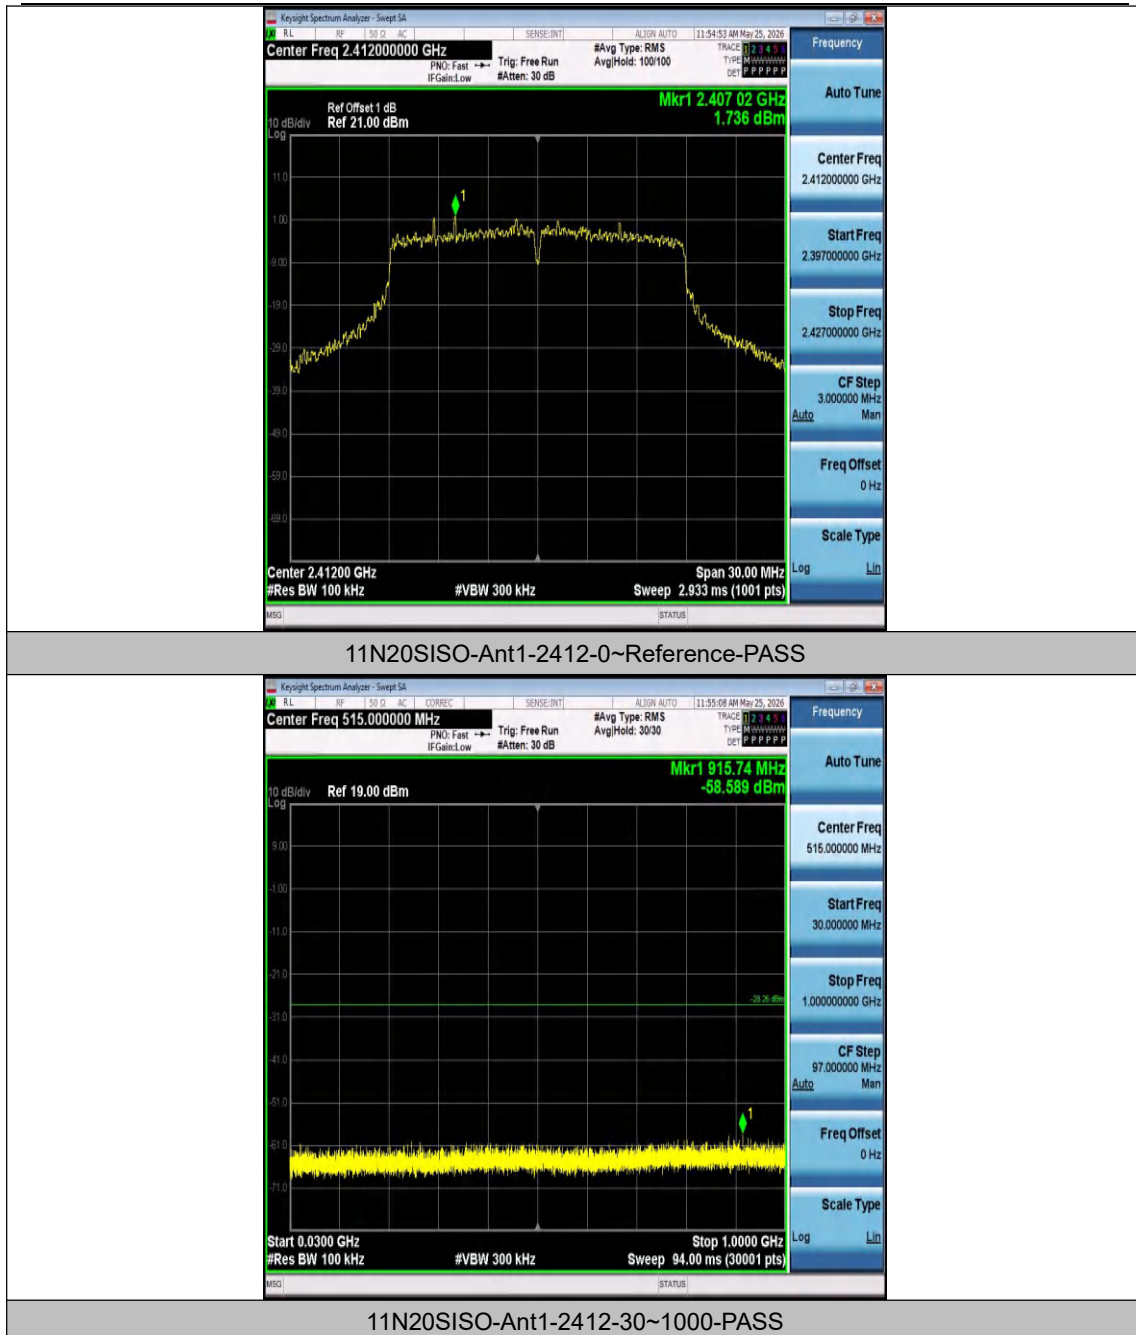

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

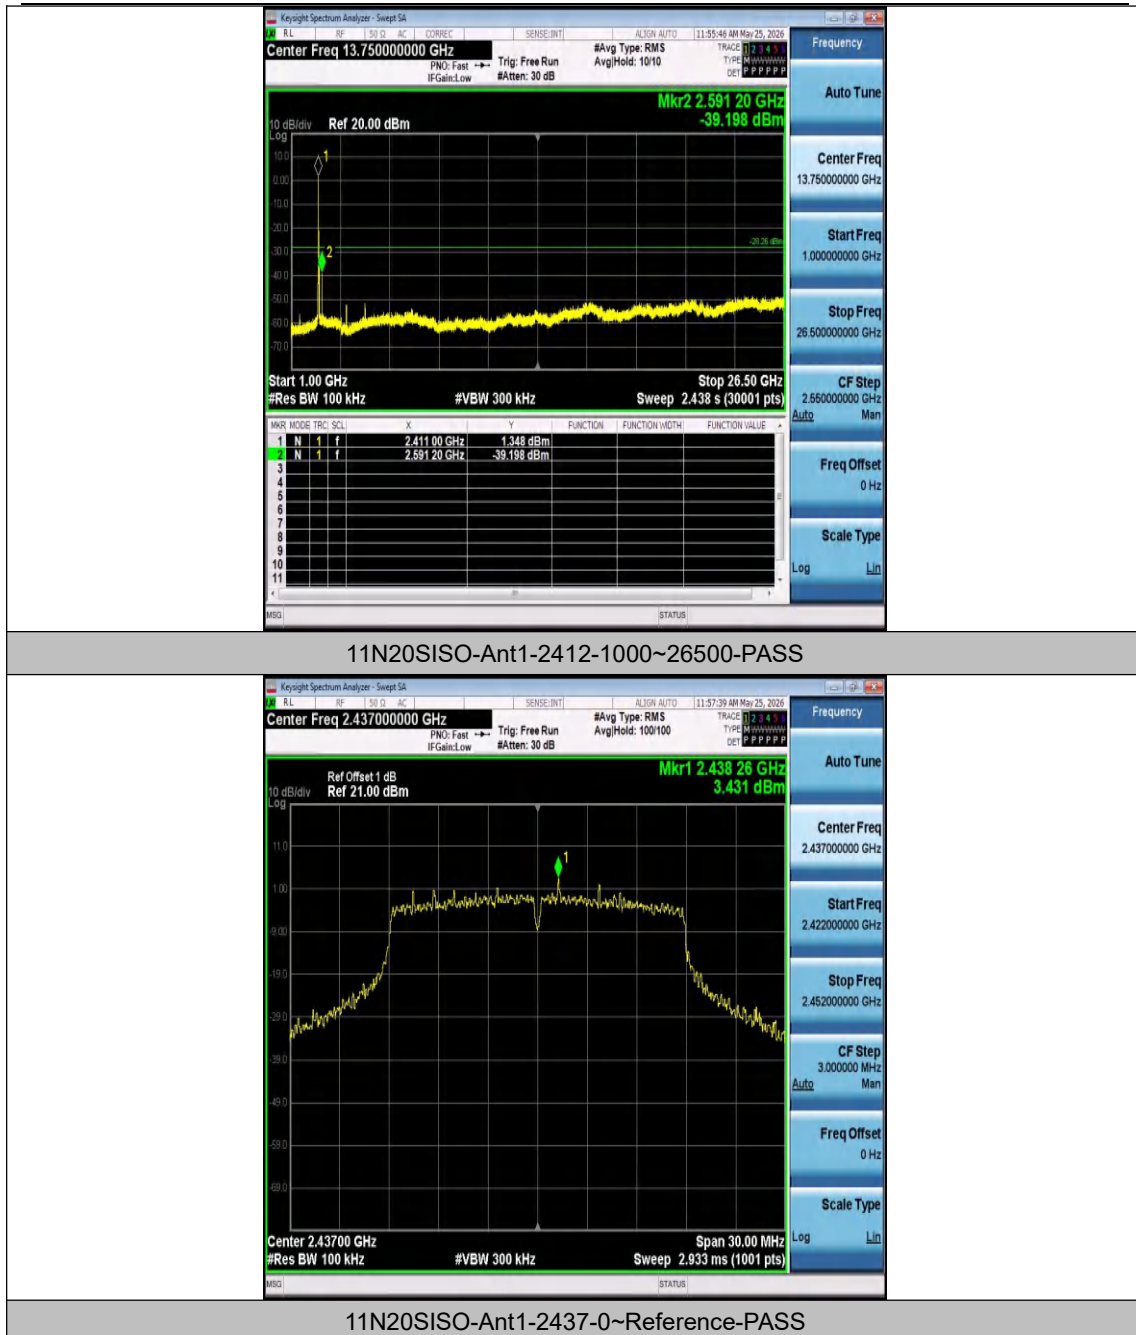

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

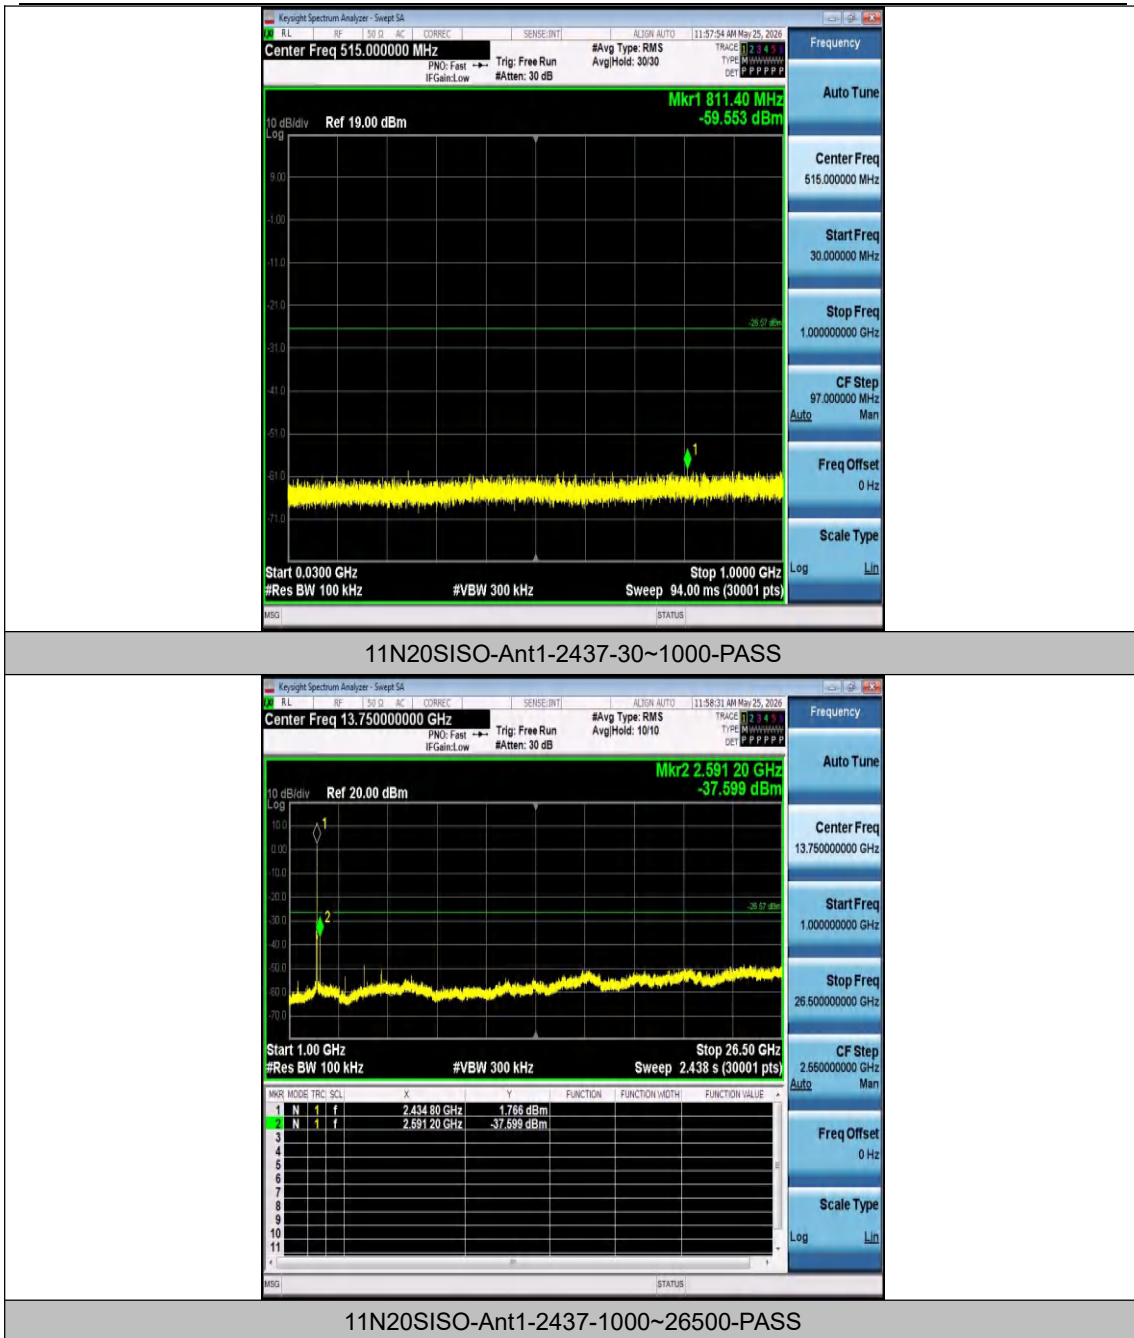

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

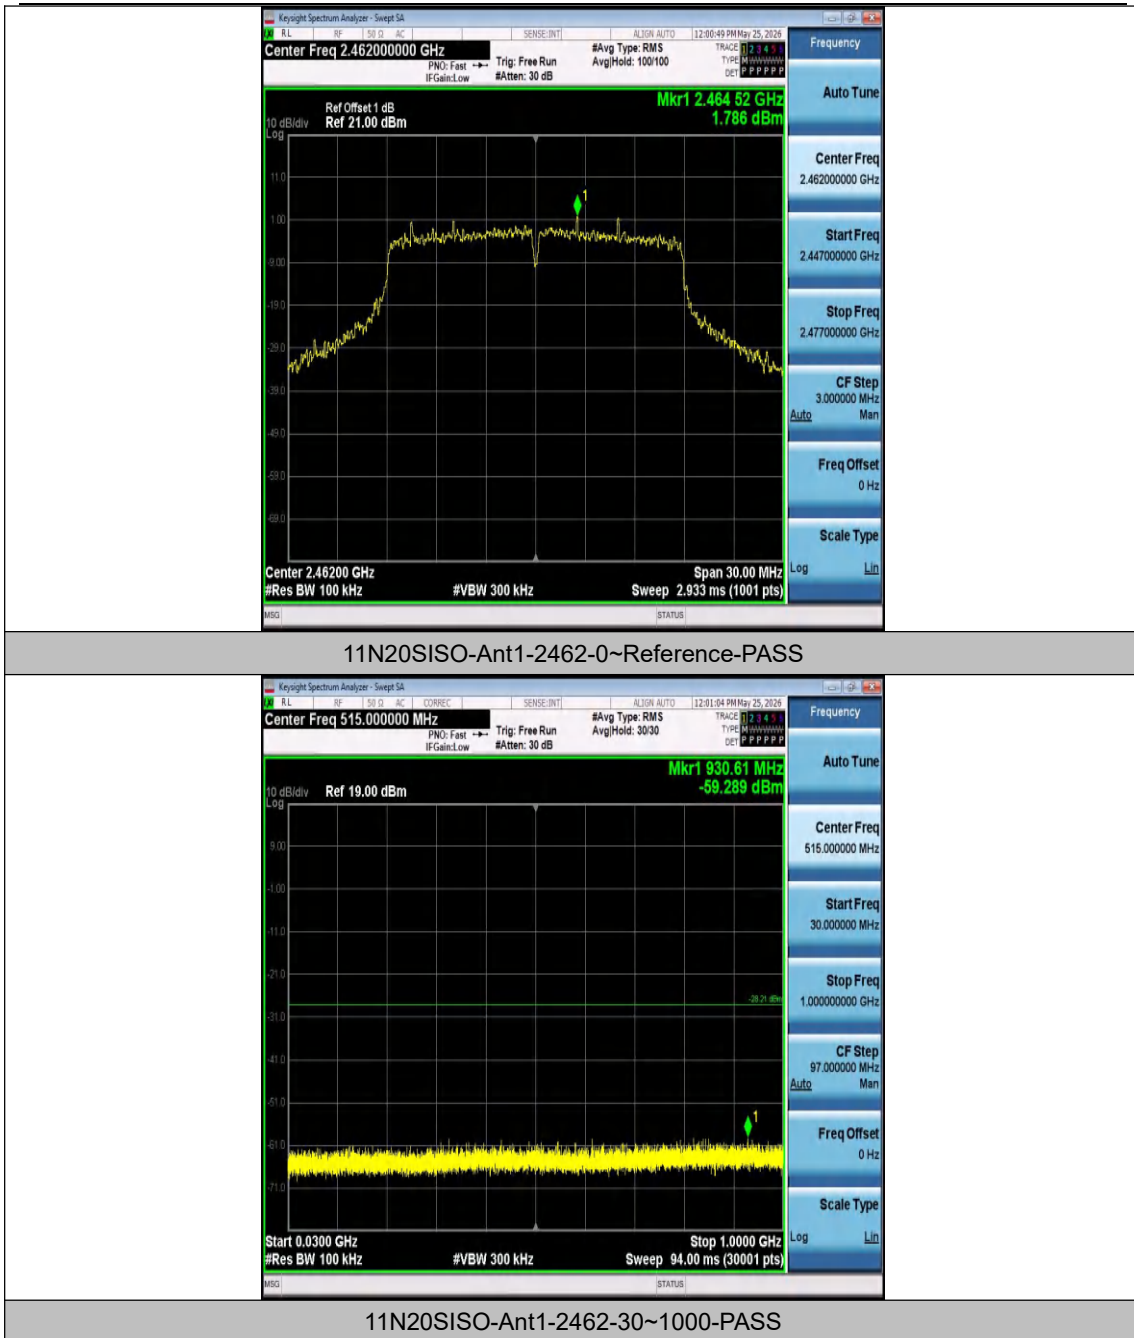


Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

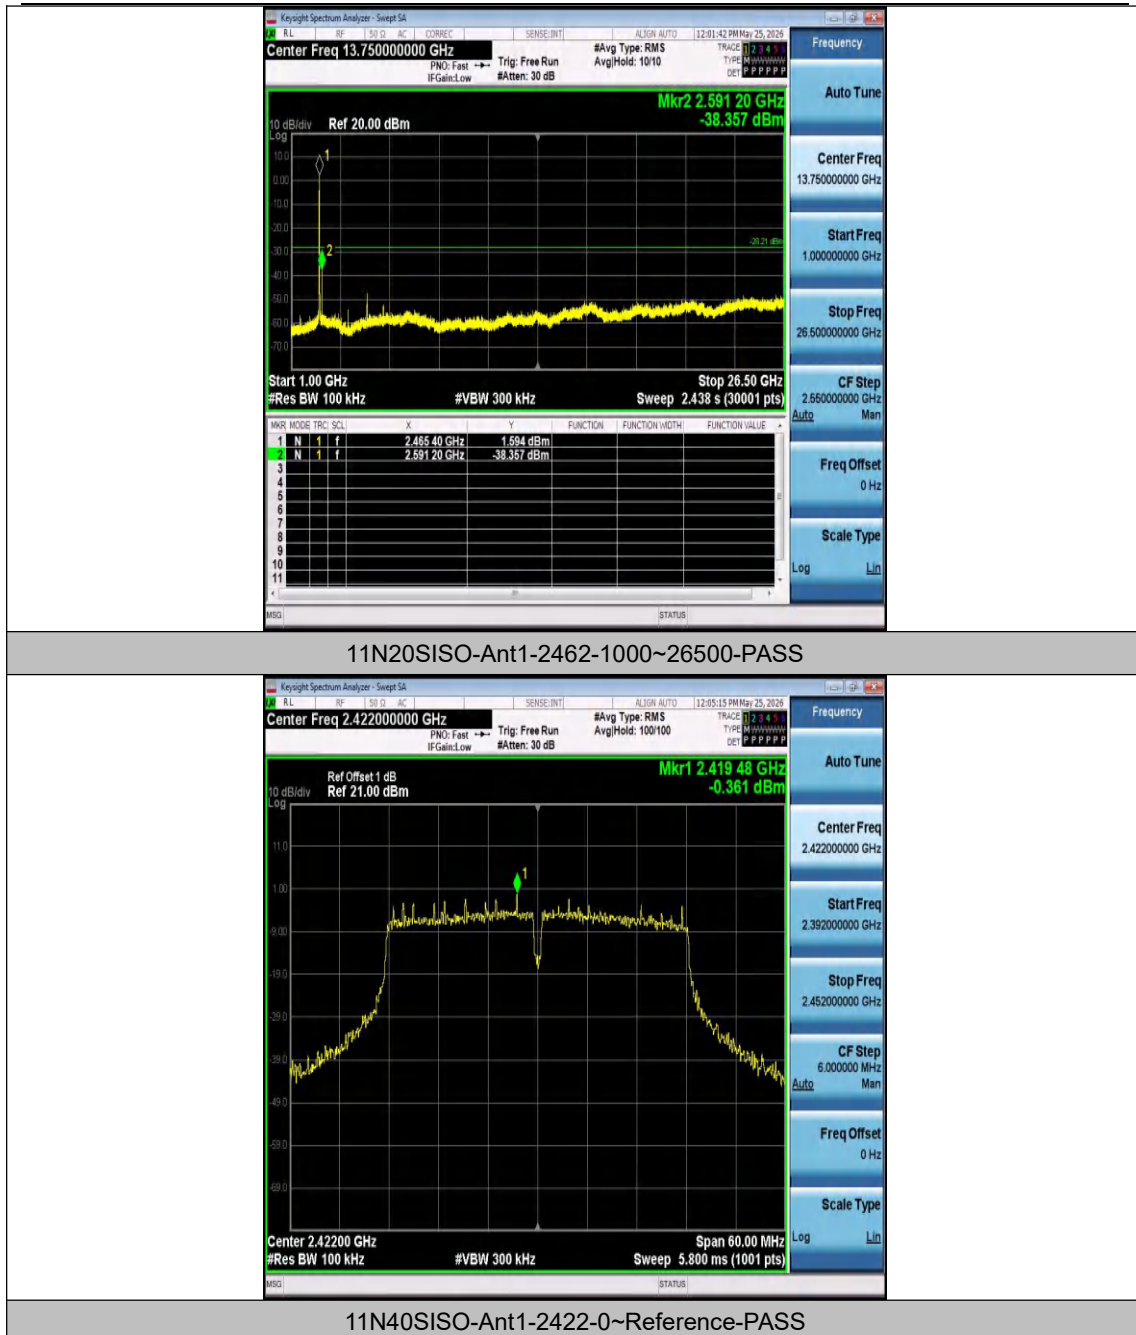


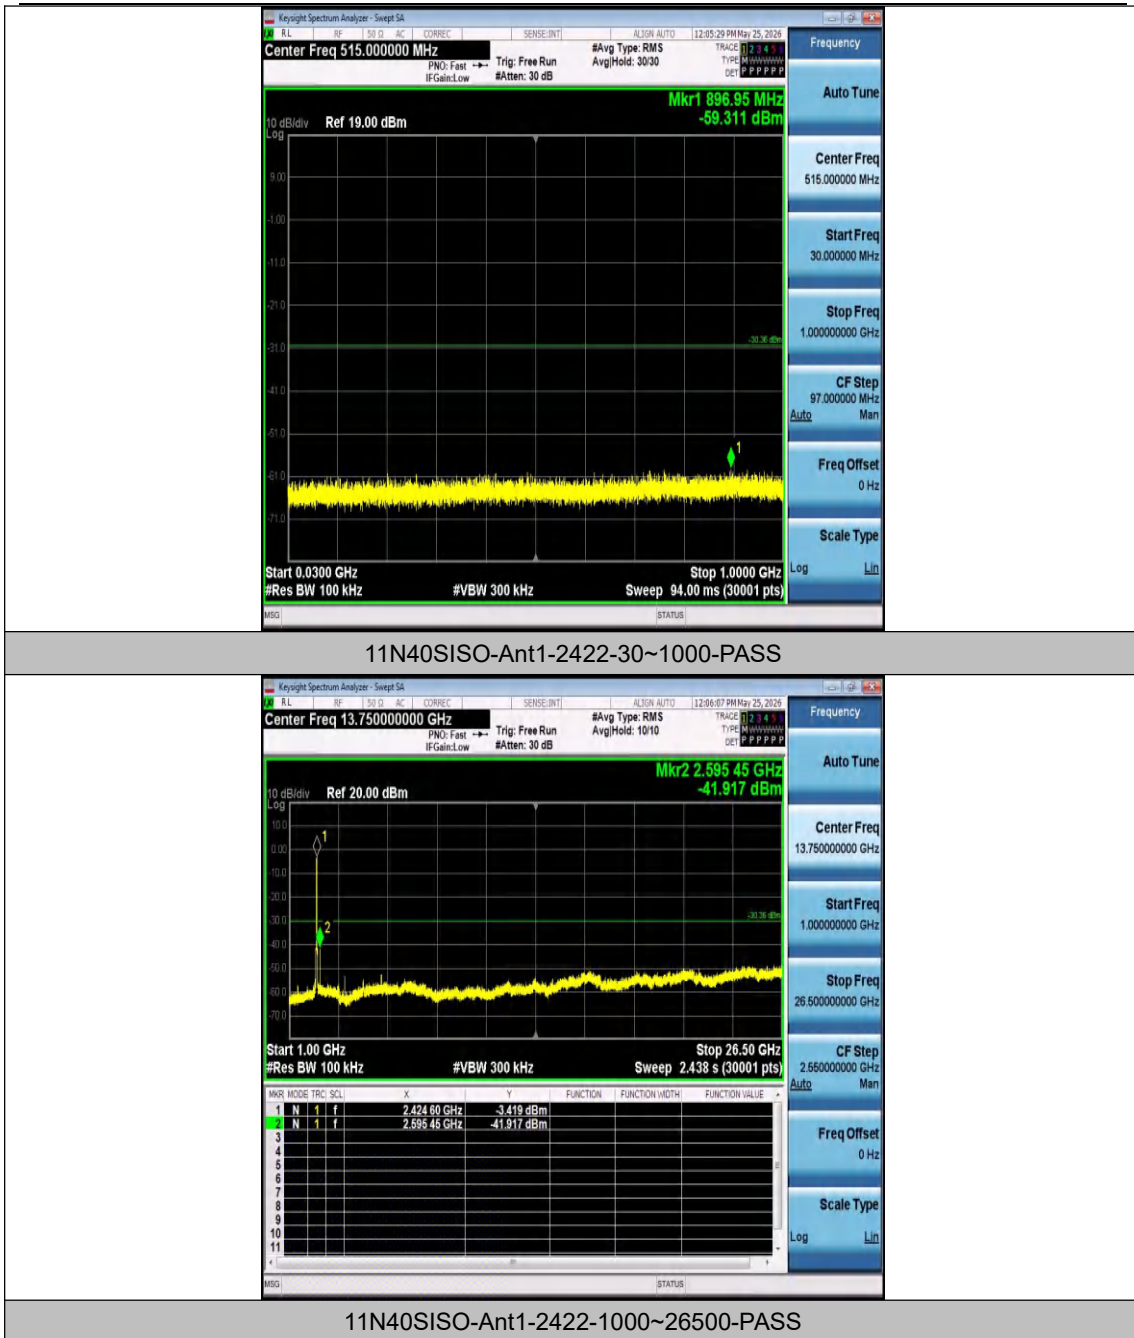

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

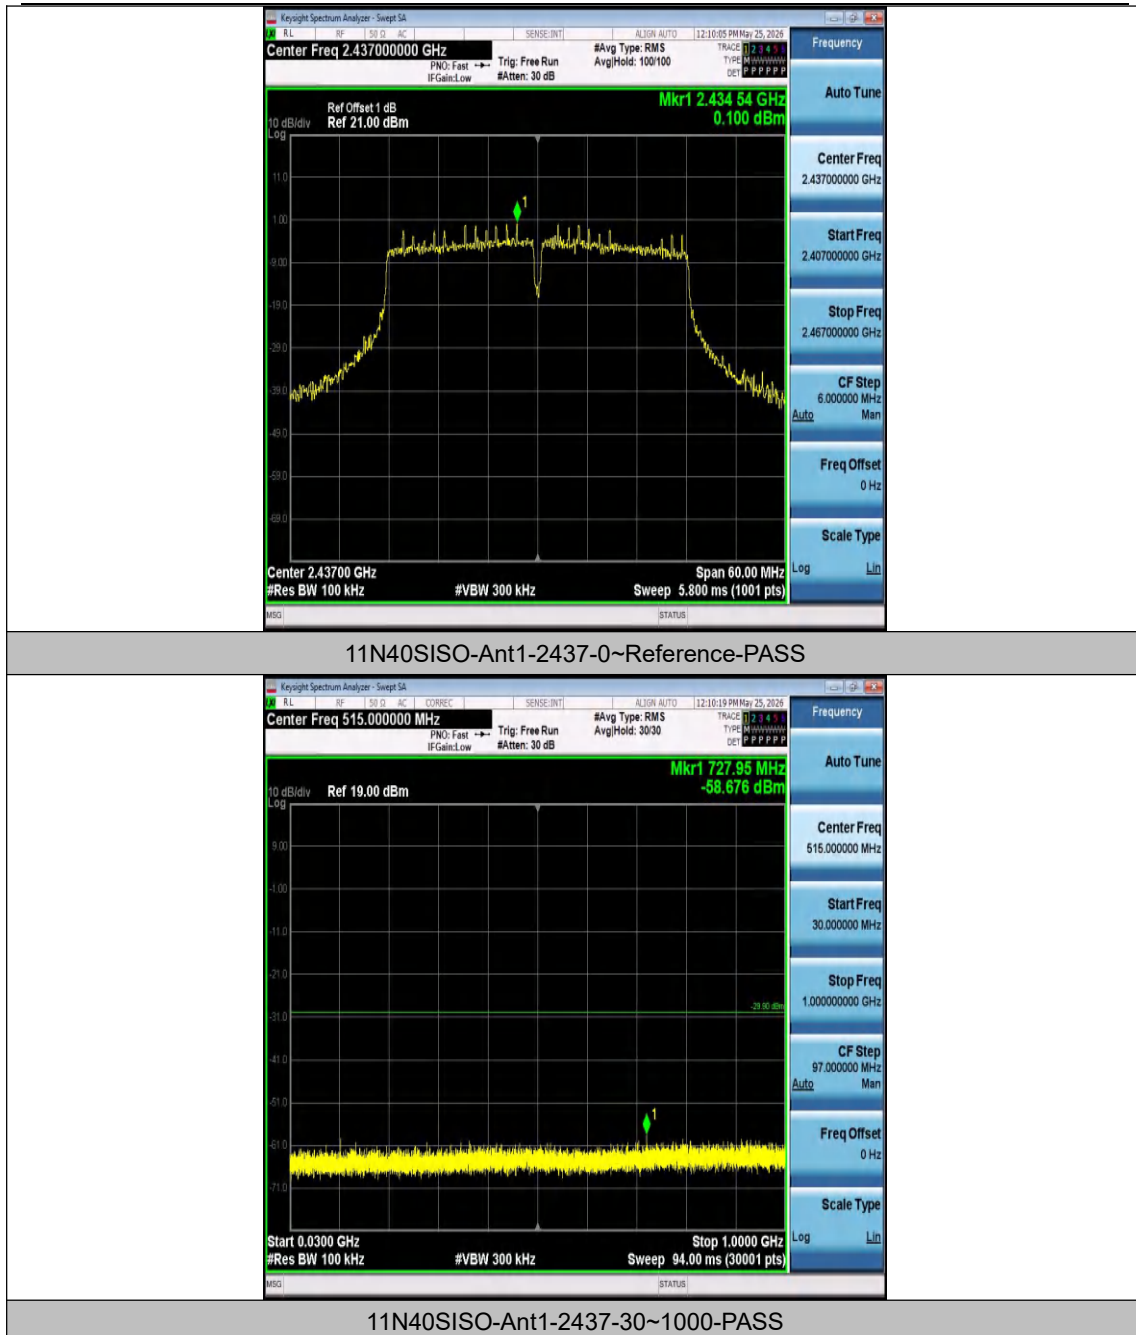

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

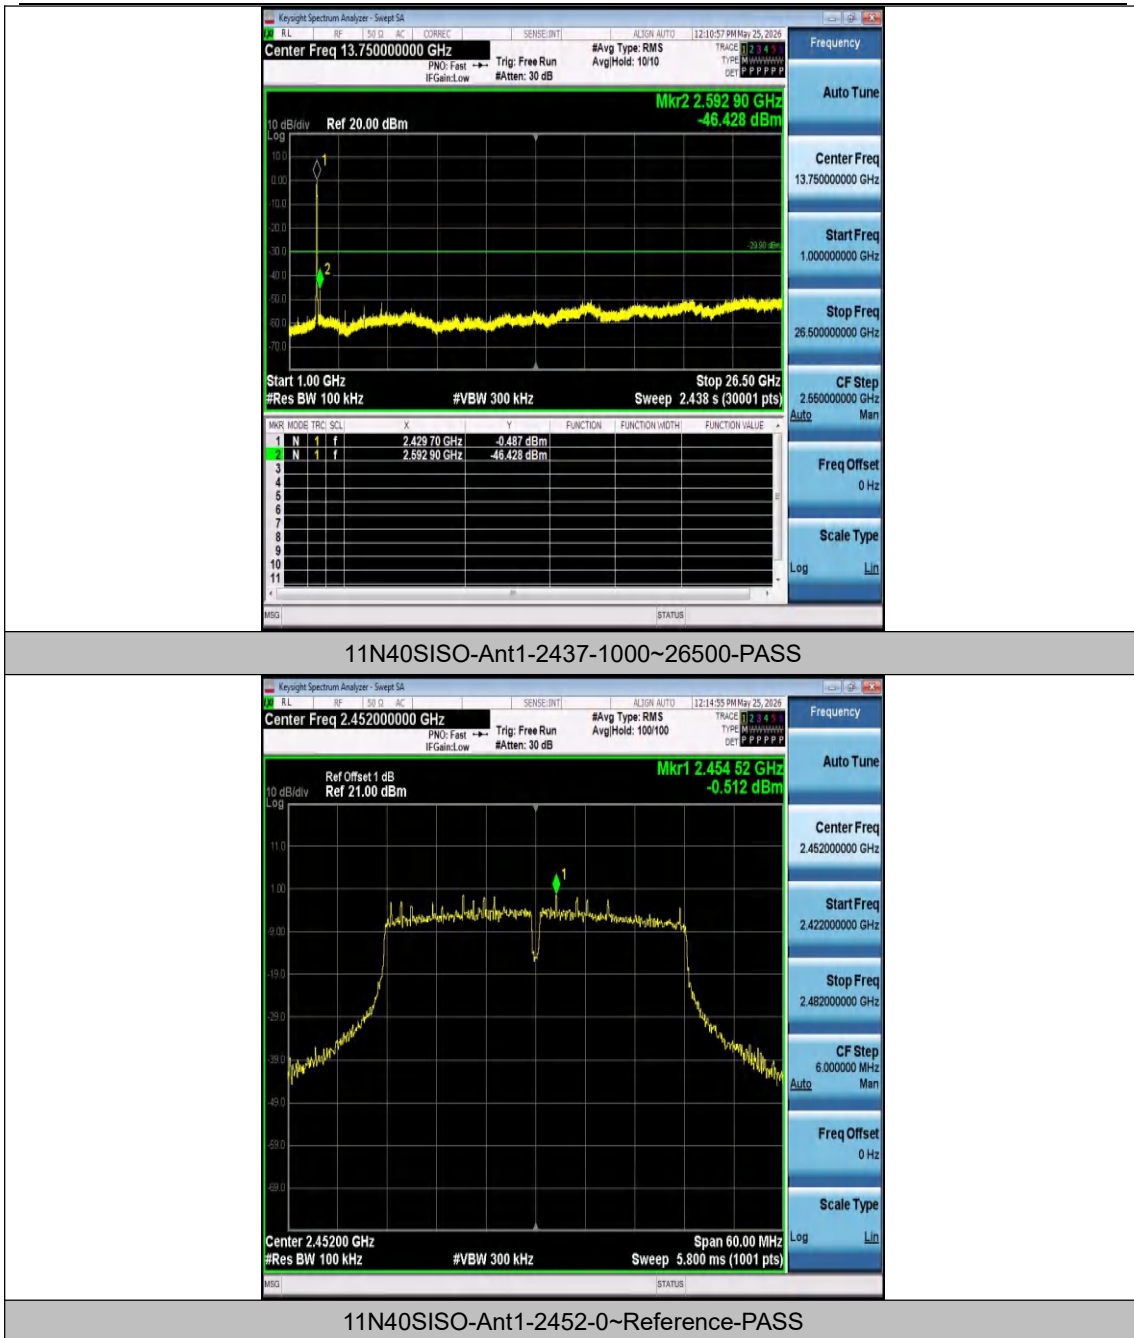

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

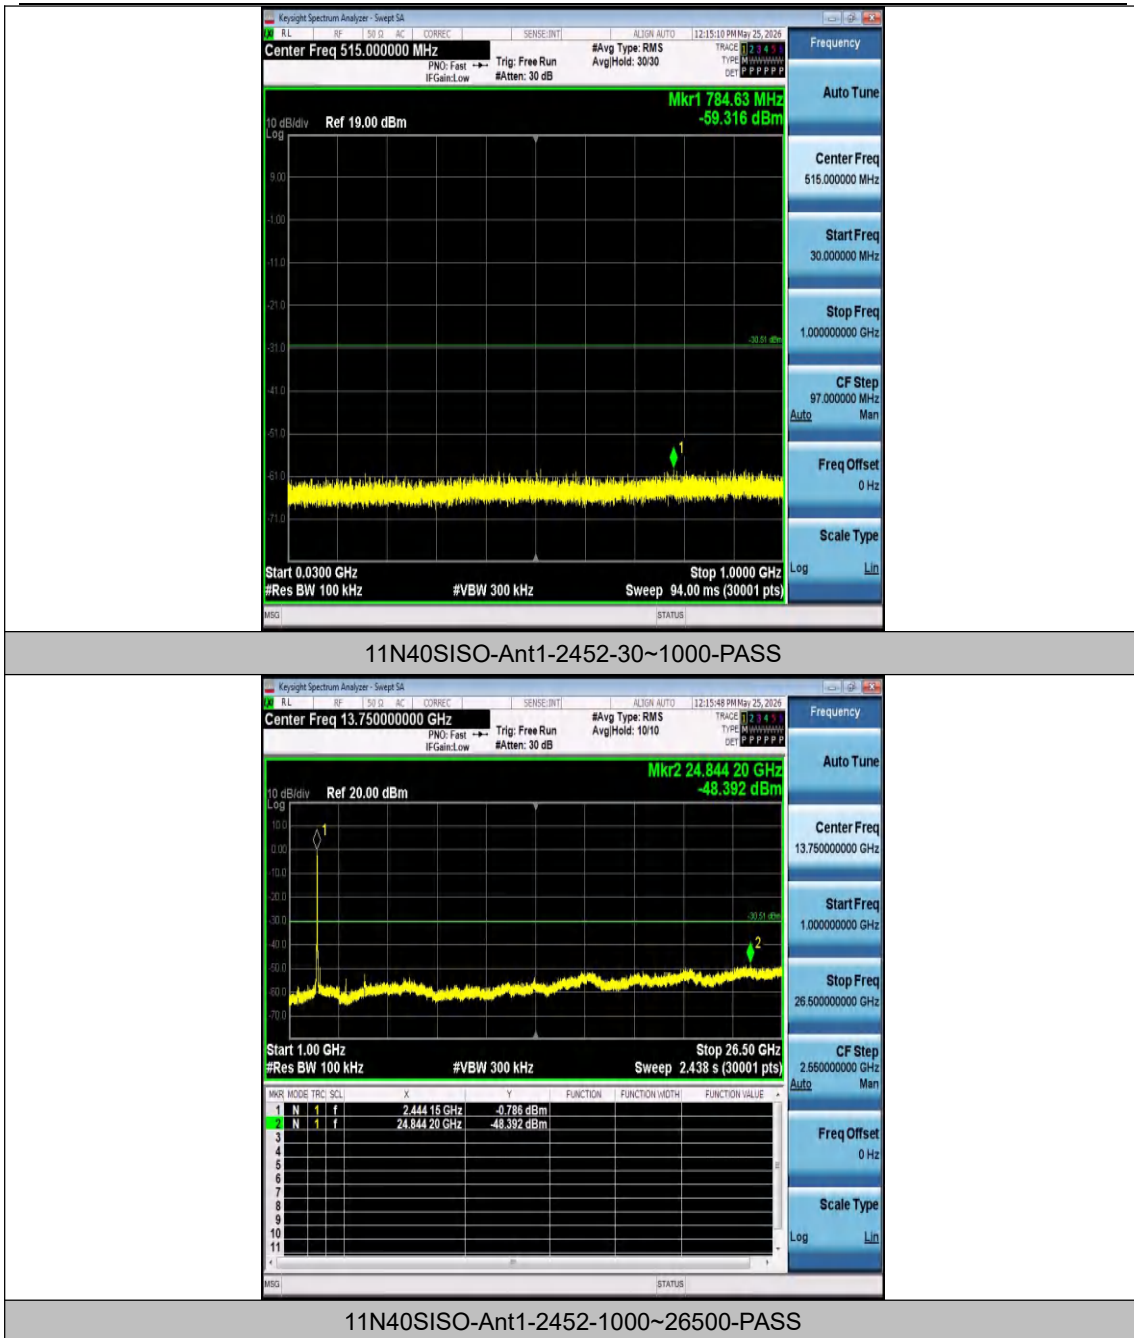

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com


Appendix G: Duty Cycle

Test Result

Test Mode	Antenna	Frequency[MHz]	Transmission Duration [ms]	Transmission Period [ms]	Duty Cycle [%]	Factor
11B	Ant1	2412	12.20	12.35	98.79	0.05
11B	Ant1	2437	12.22	12.48	97.92	0.09
11B	Ant1	2462	12.20	12.45	97.99	0.09
11G	Ant1	2412	2.03	2.19	92.69	0.33
11G	Ant1	2437	2.03	2.19	92.69	0.33
11G	Ant1	2462	2.03	2.16	93.98	0.27
11N20SISO	Ant1	2412	1.89	2.12	89.15	0.50
11N20SISO	Ant1	2437	1.89	2.11	89.57	0.48
11N20SISO	Ant1	2462	1.89	2.06	91.75	0.37
11N40SISO	Ant1	2422	0.93	1.08	86.11	0.65
11N40SISO	Ant1	2437	0.93	1.10	84.55	0.73
11N40SISO	Ant1	2452	0.93	1.10	84.55	0.73

Test Graphs

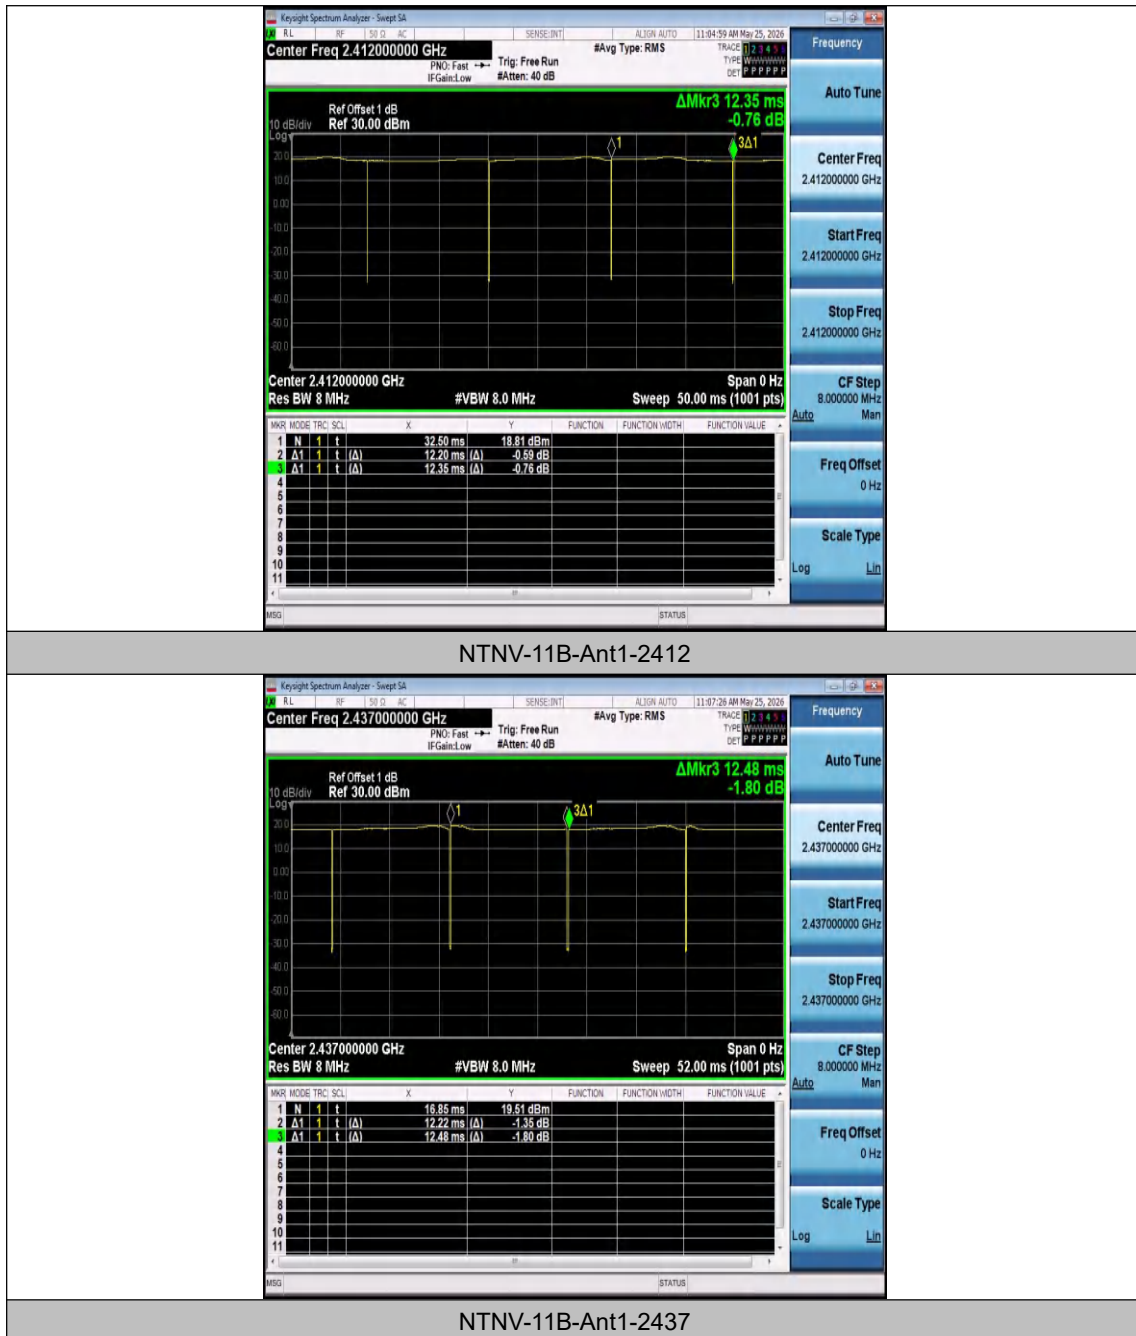


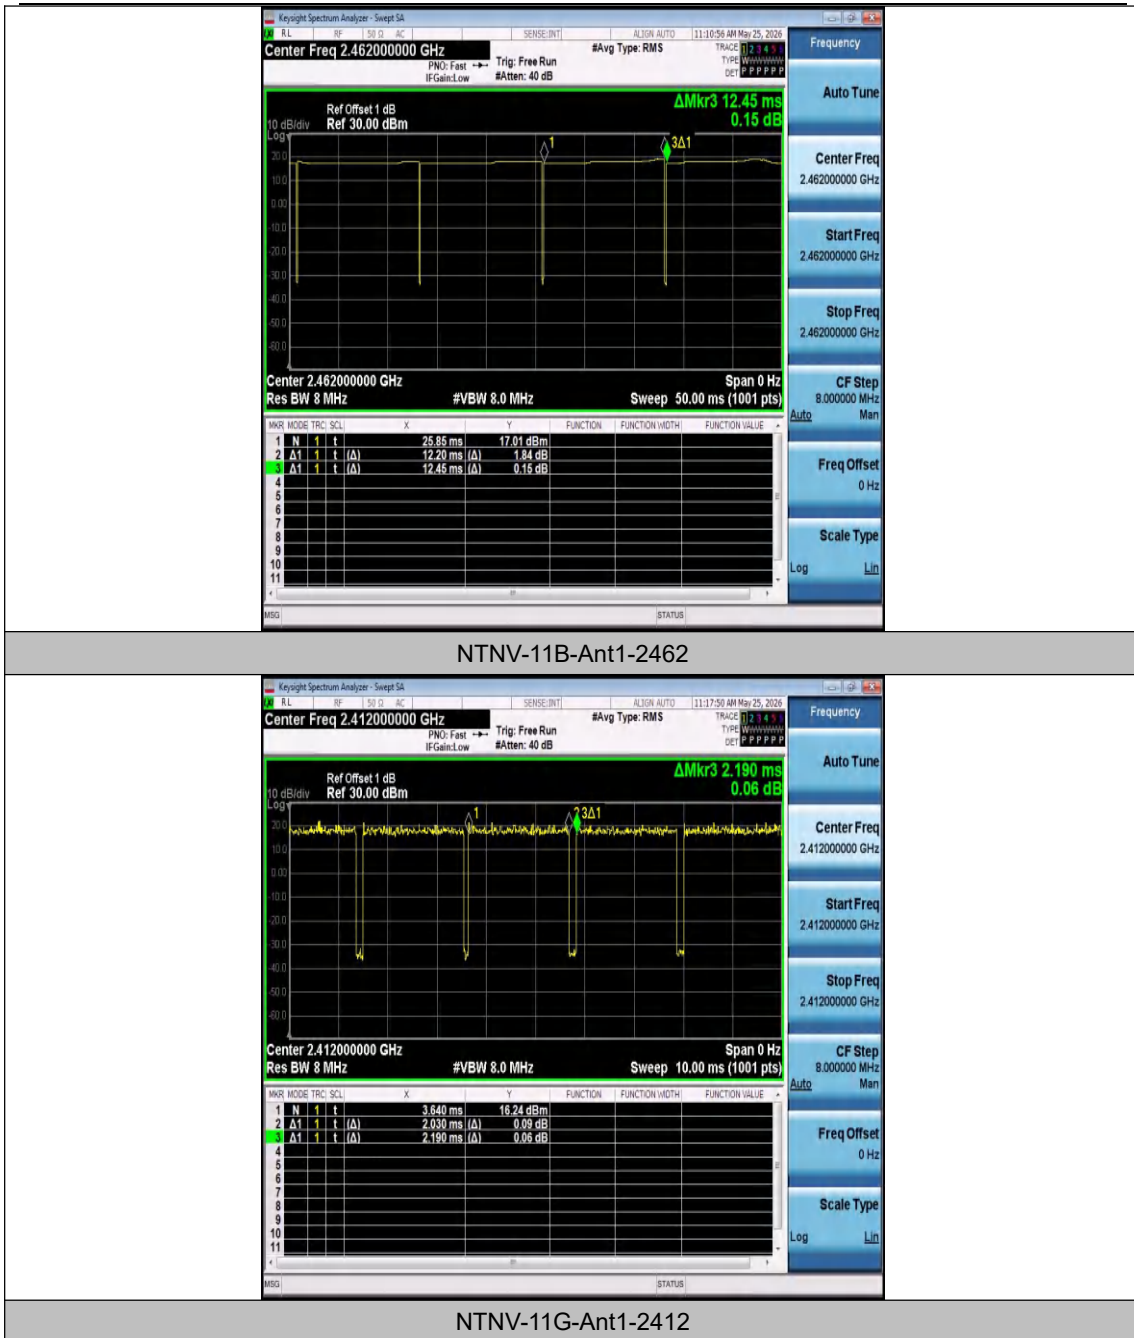


Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

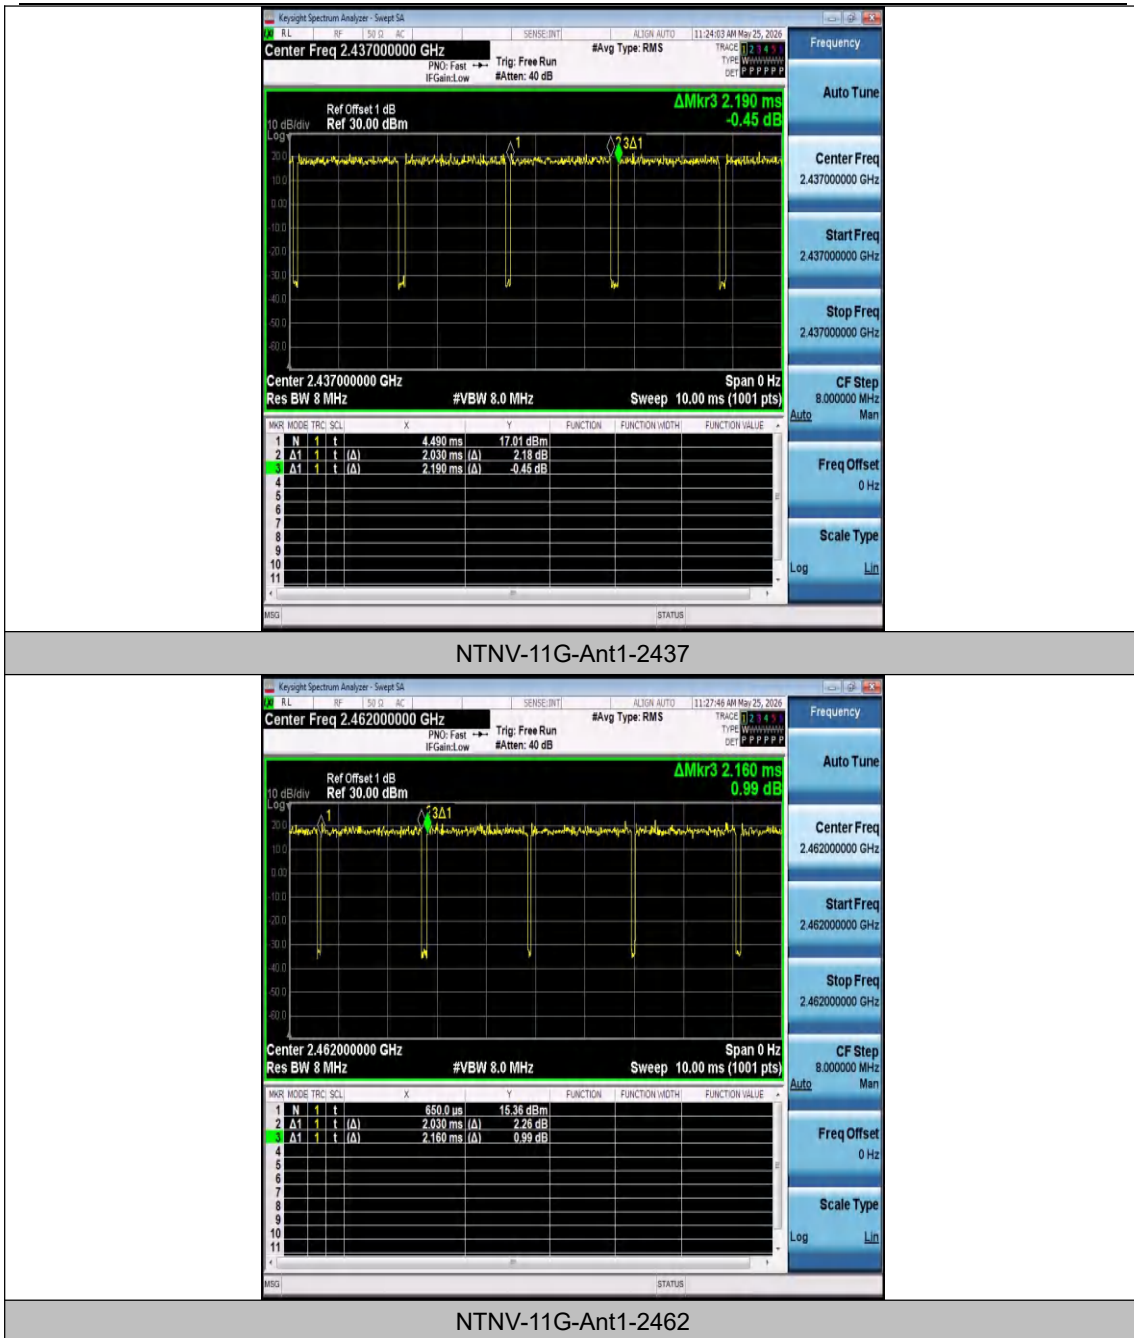


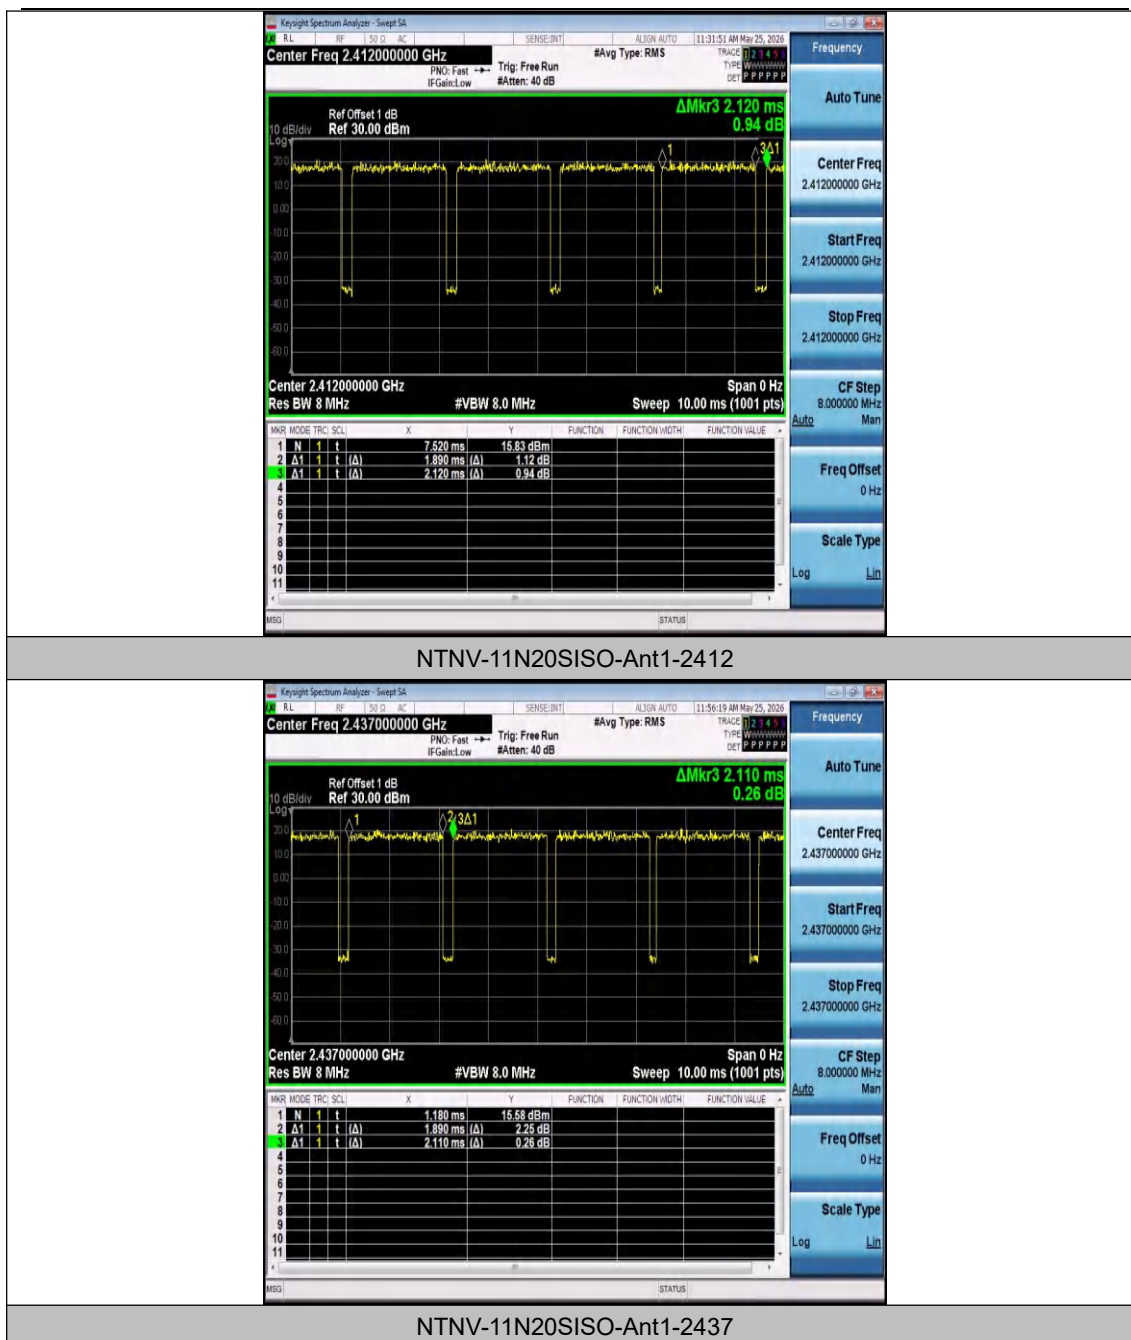

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

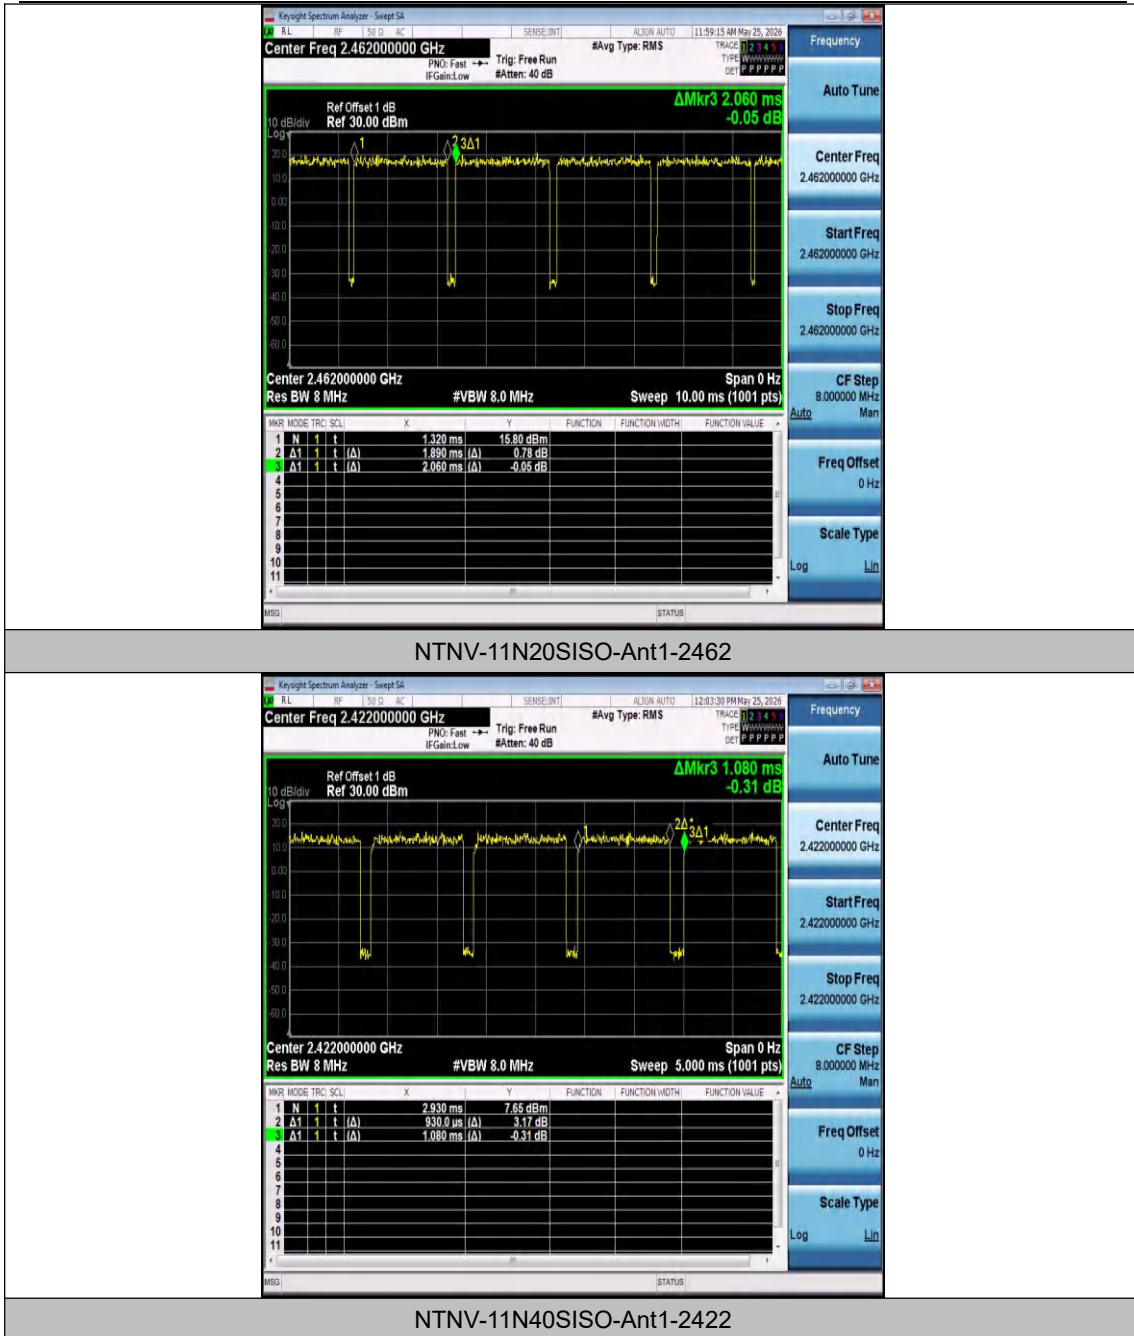

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

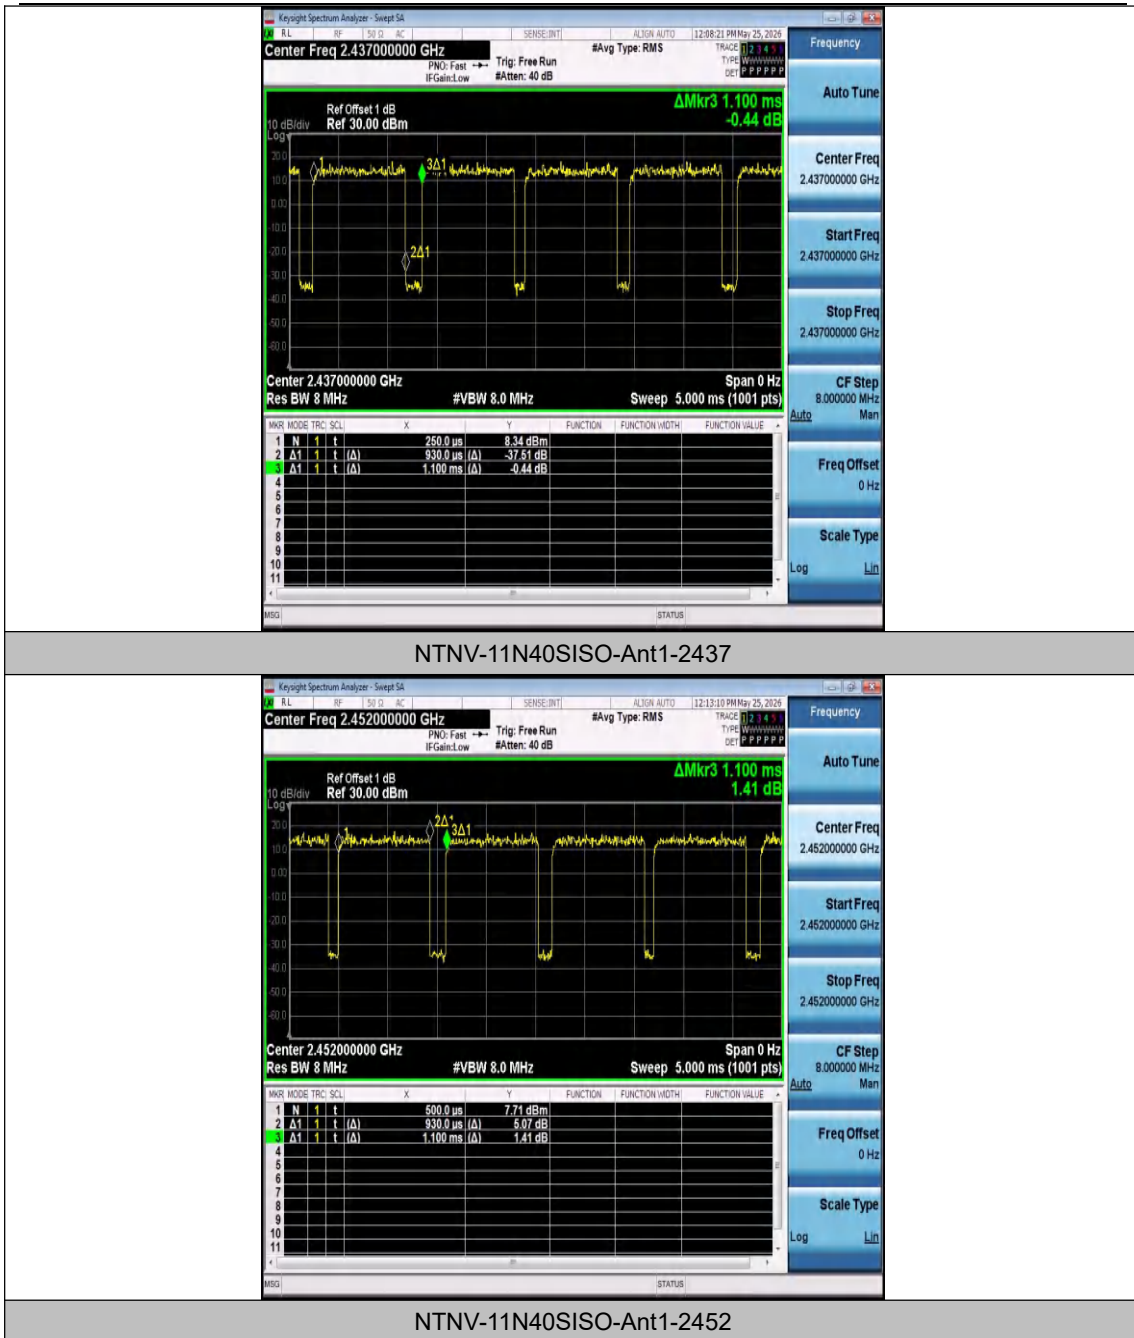

---End---