


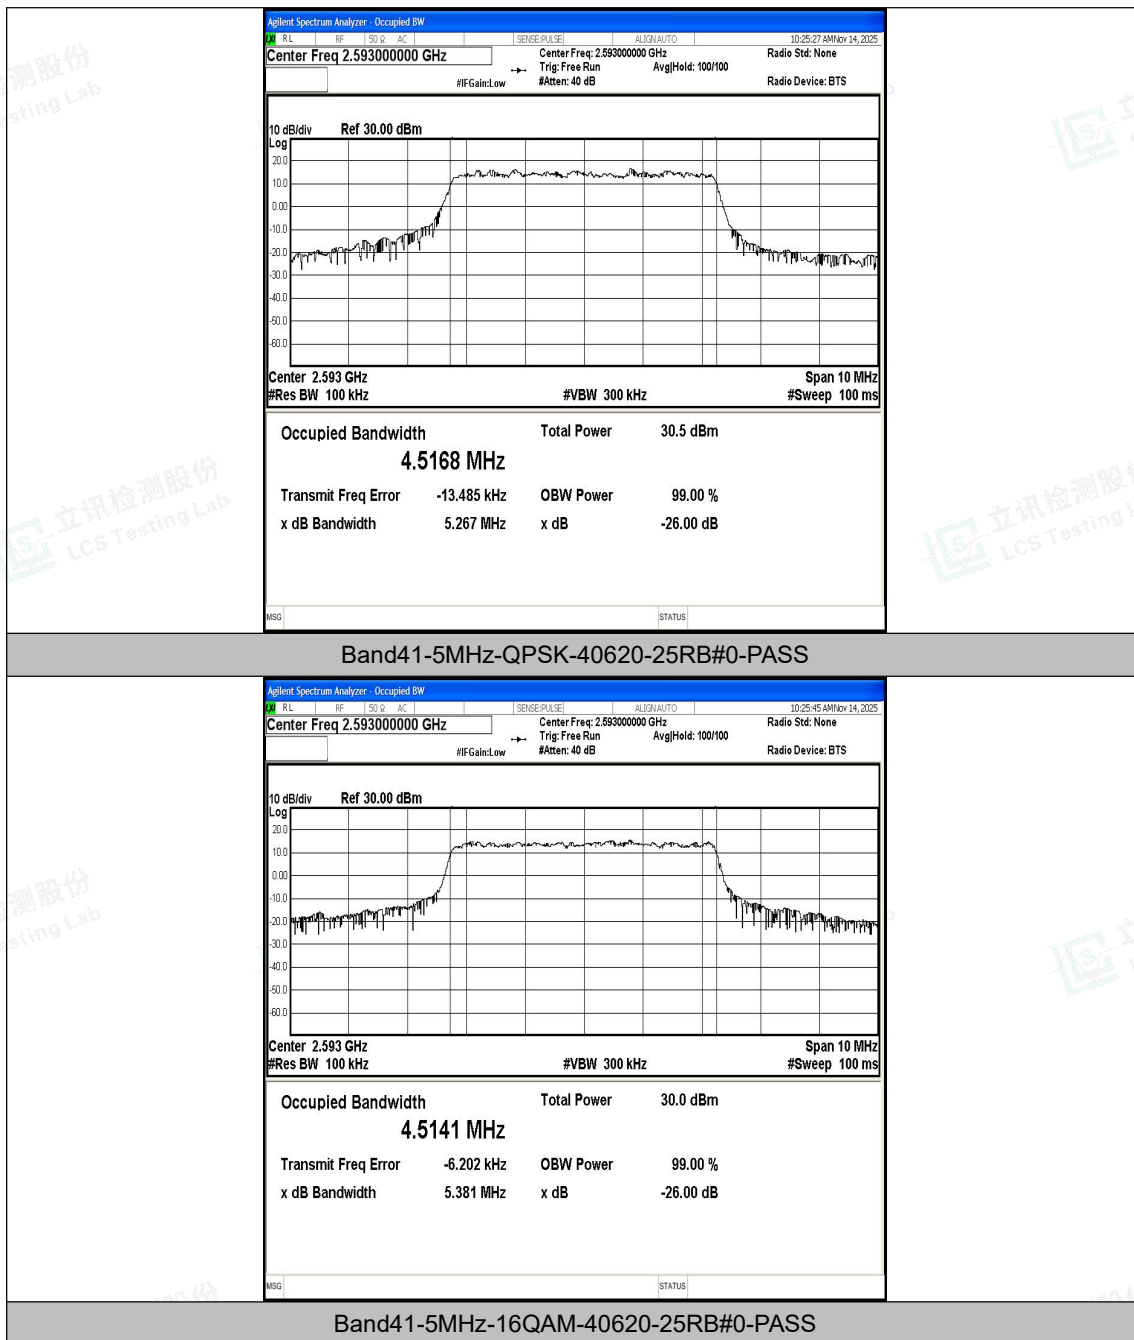


Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

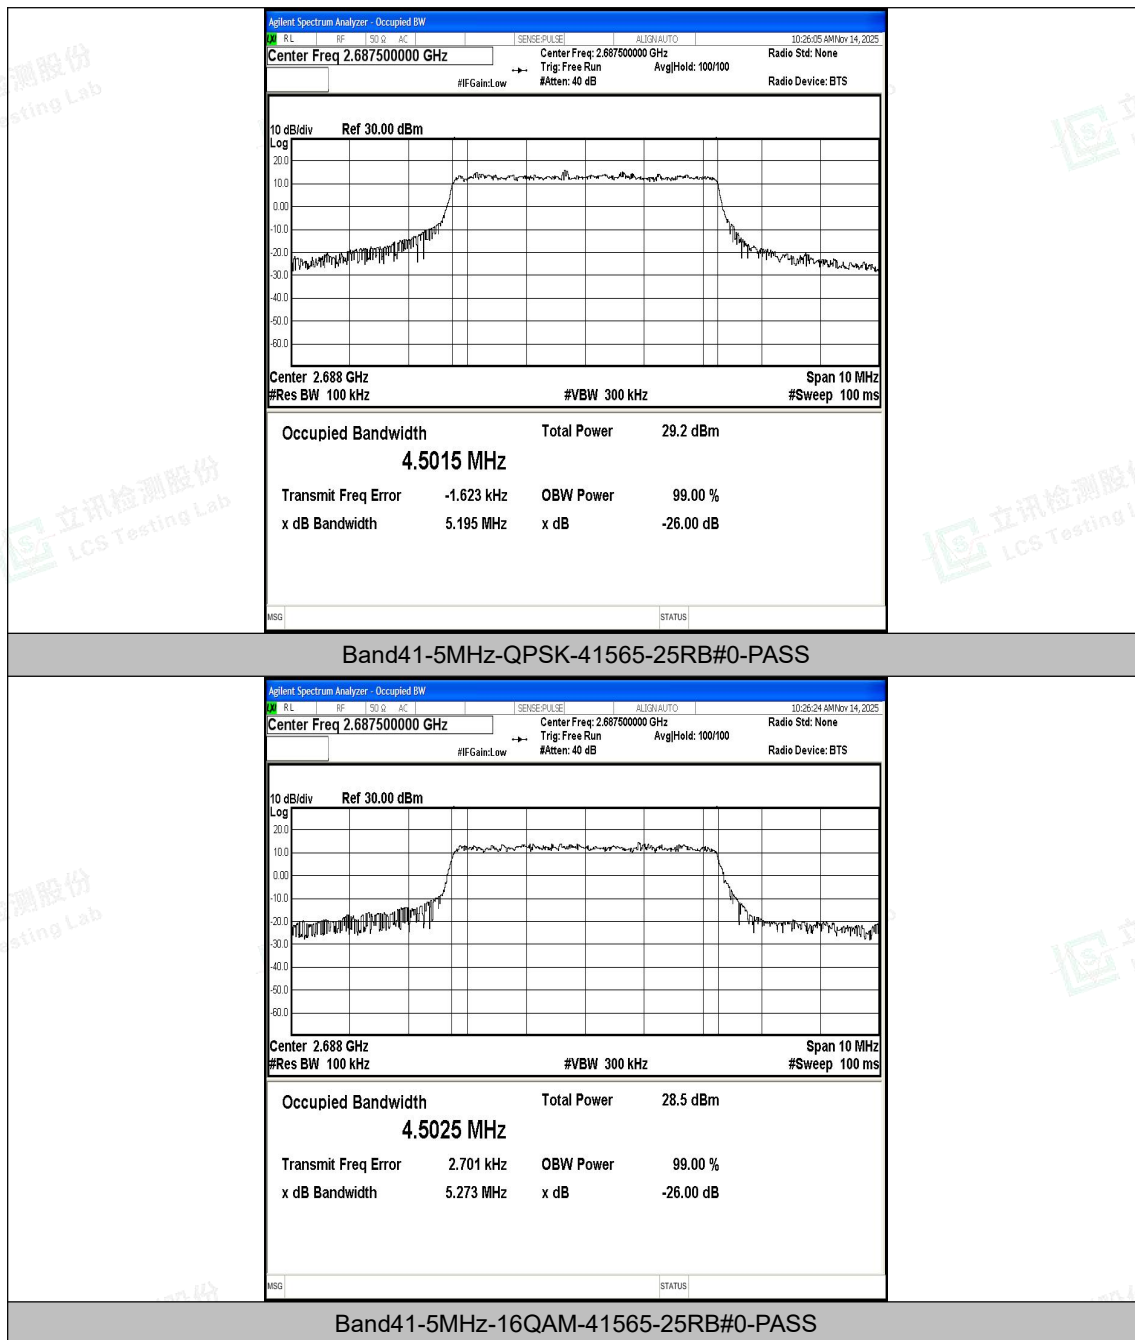


Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

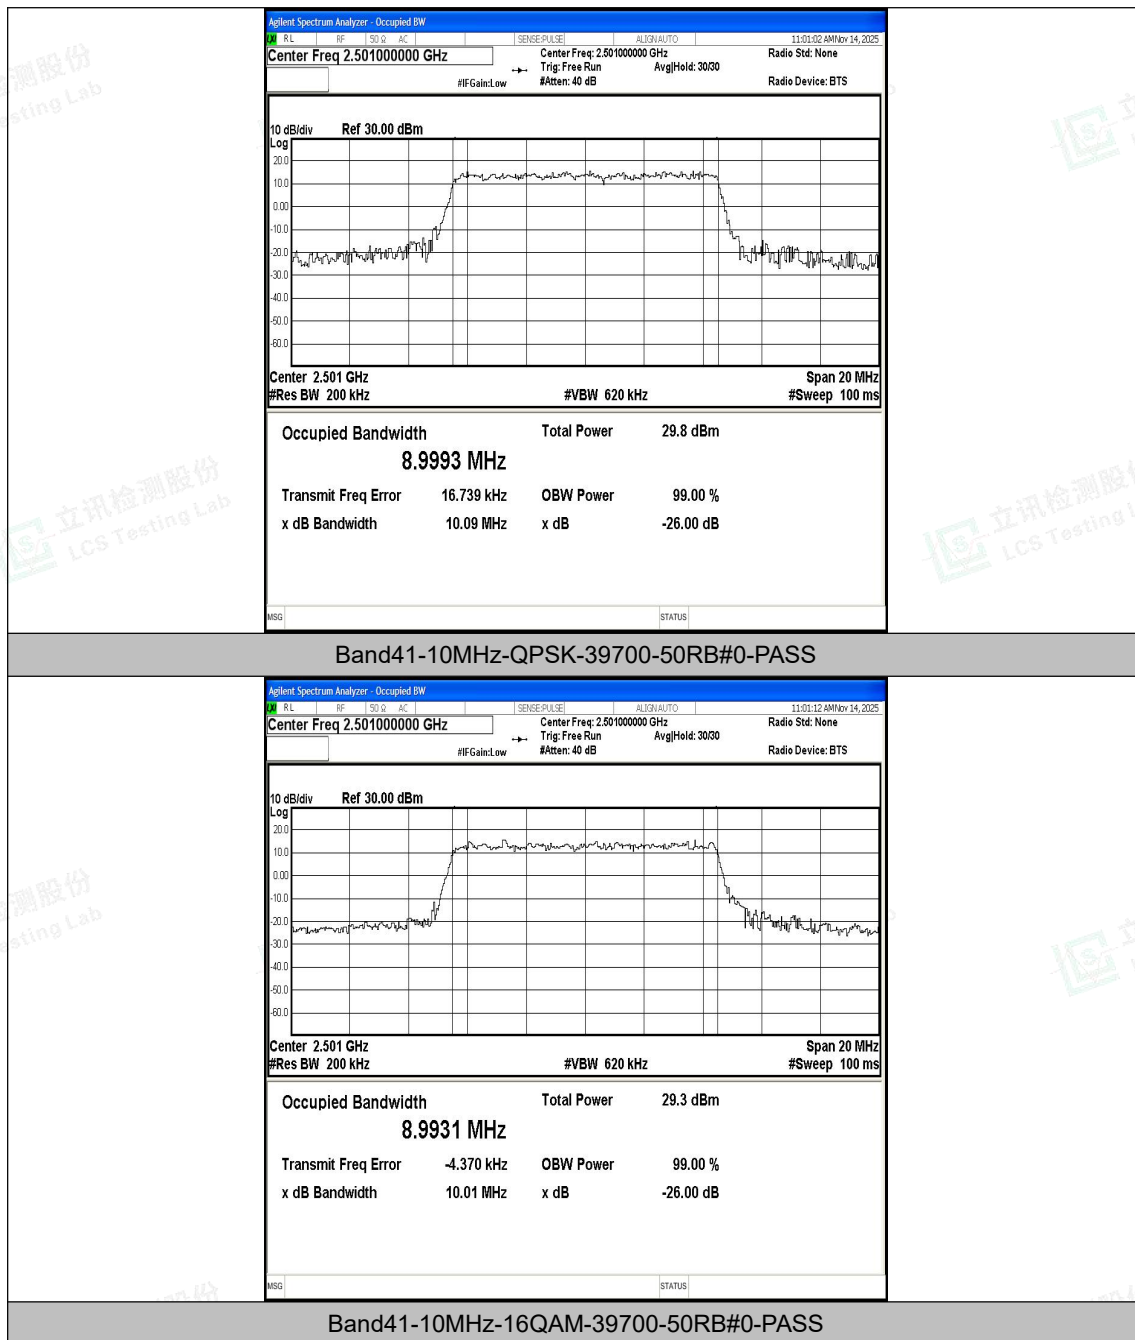


Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

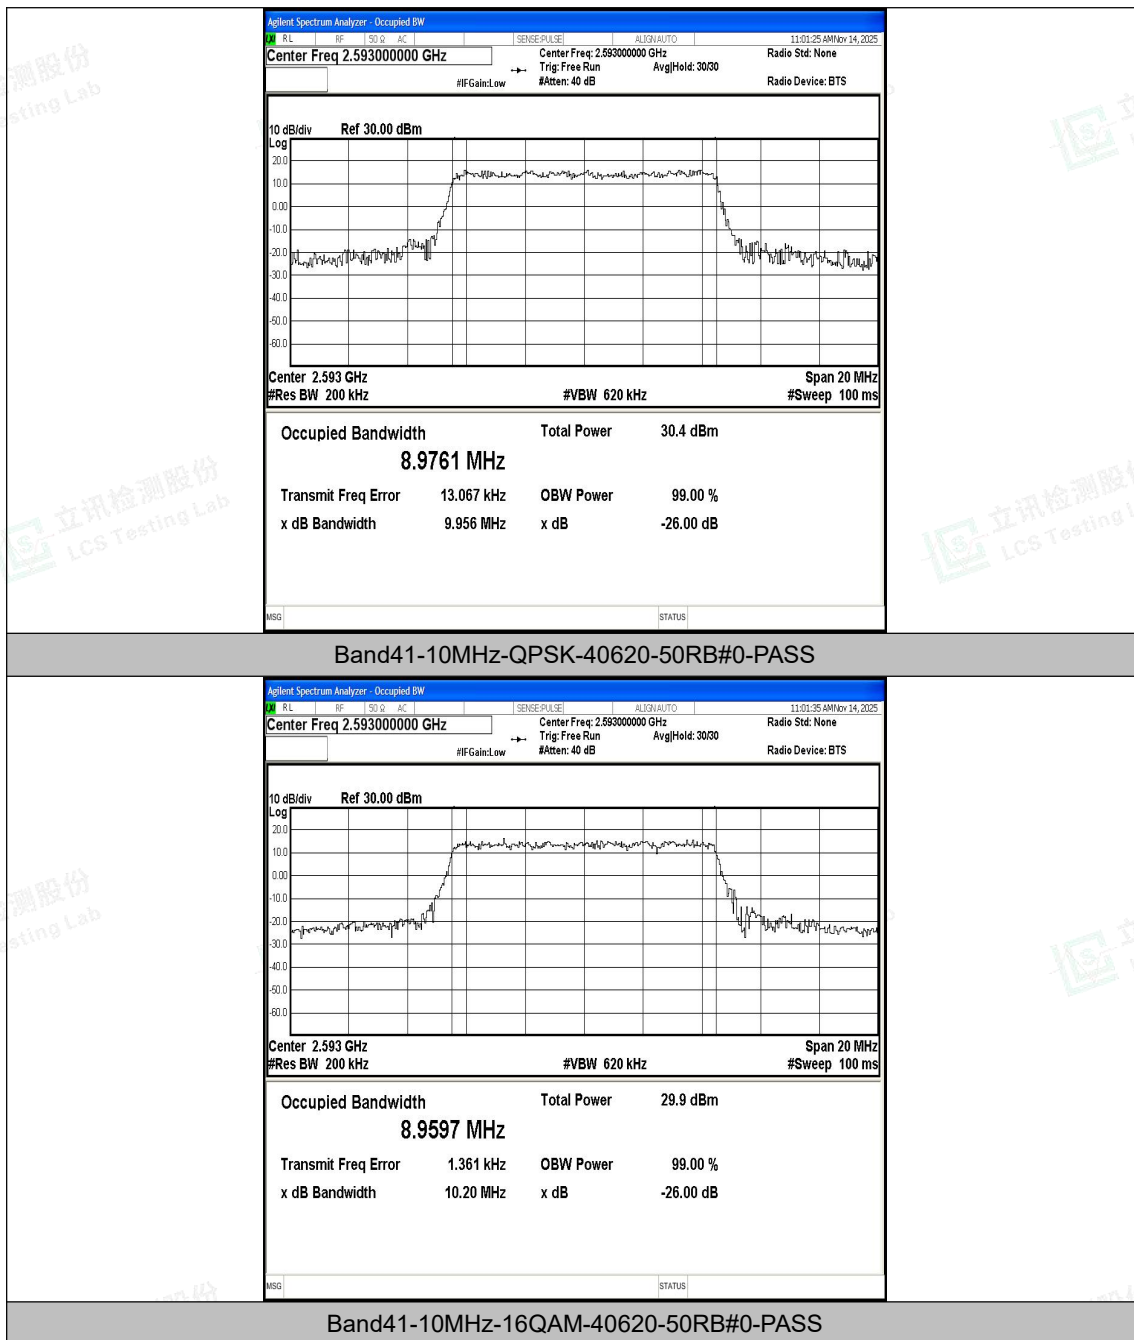


Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

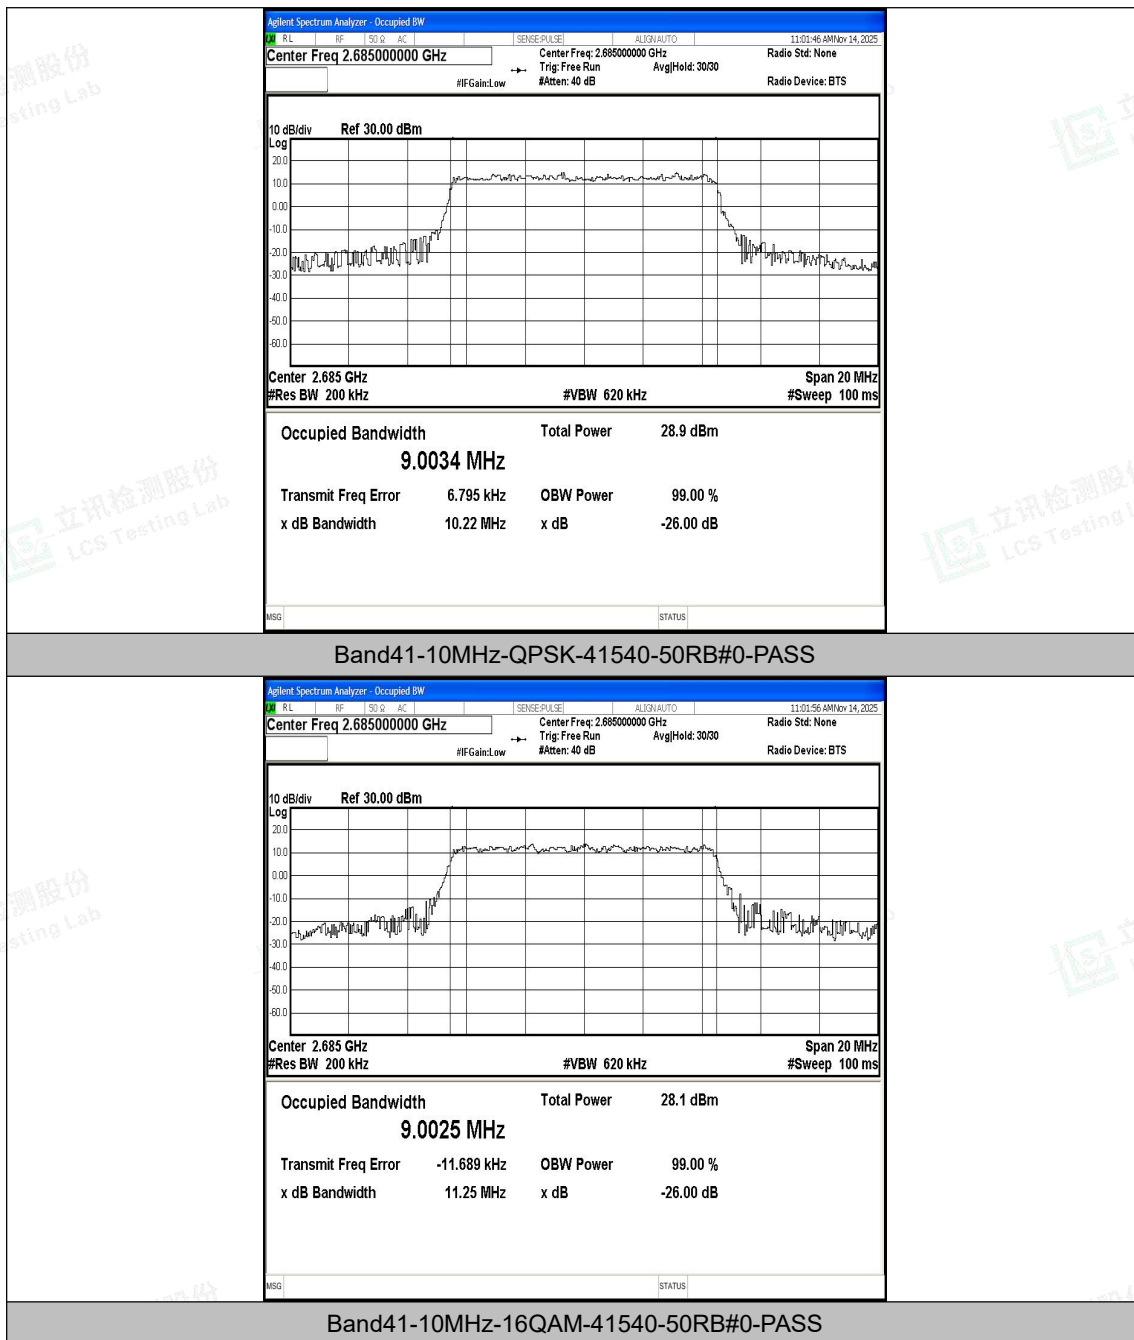


Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

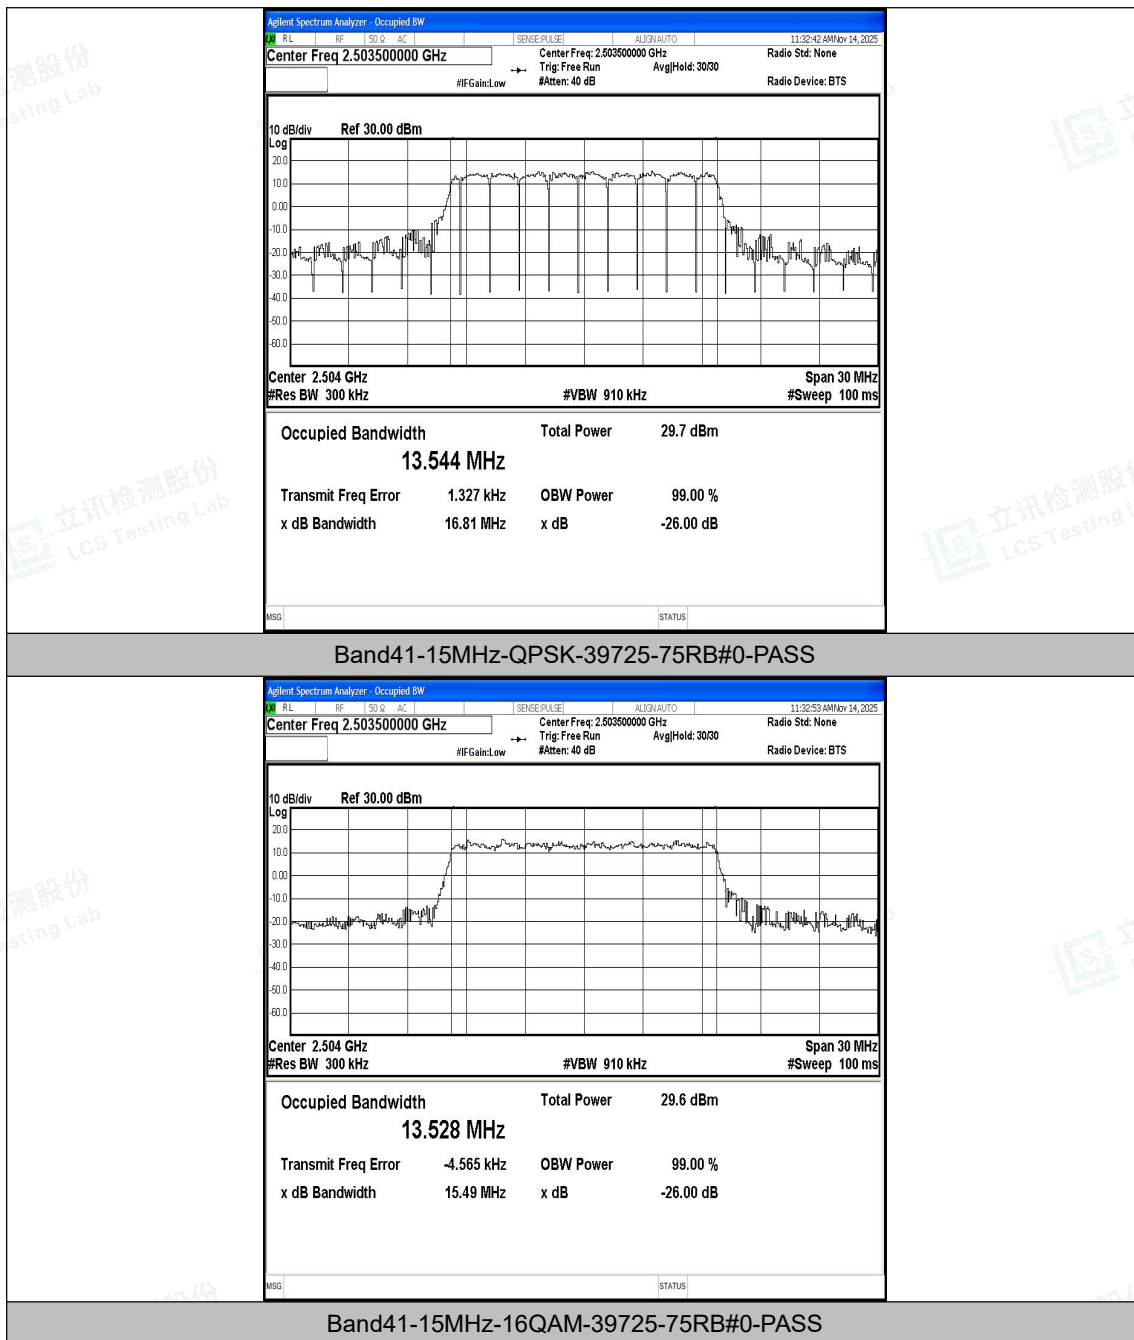


Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

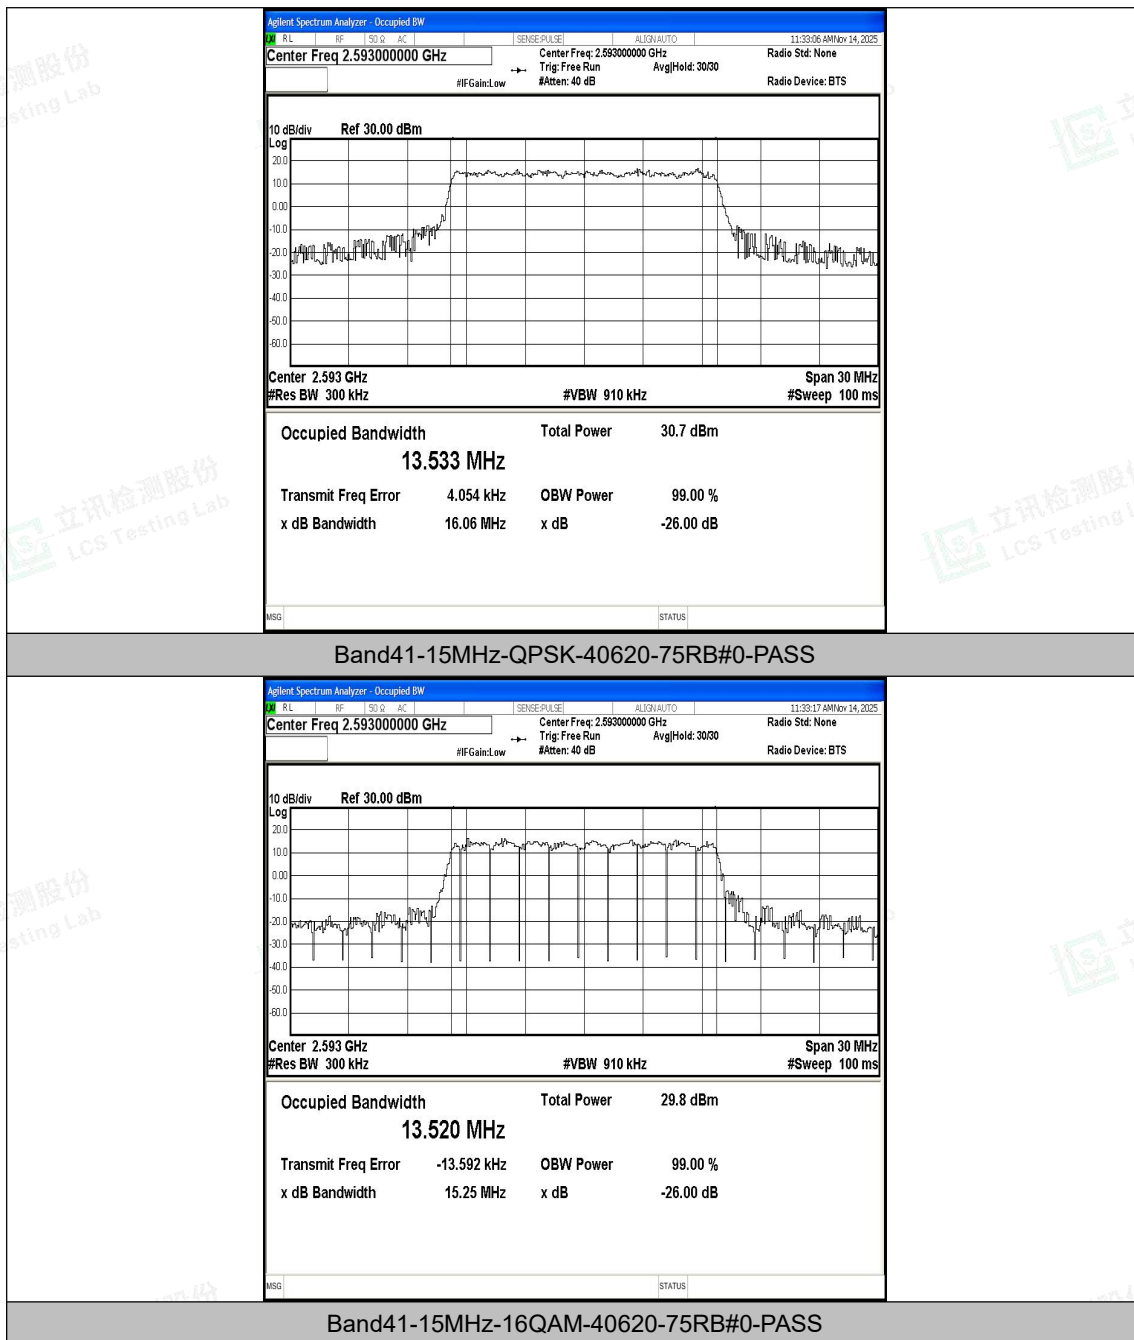


Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

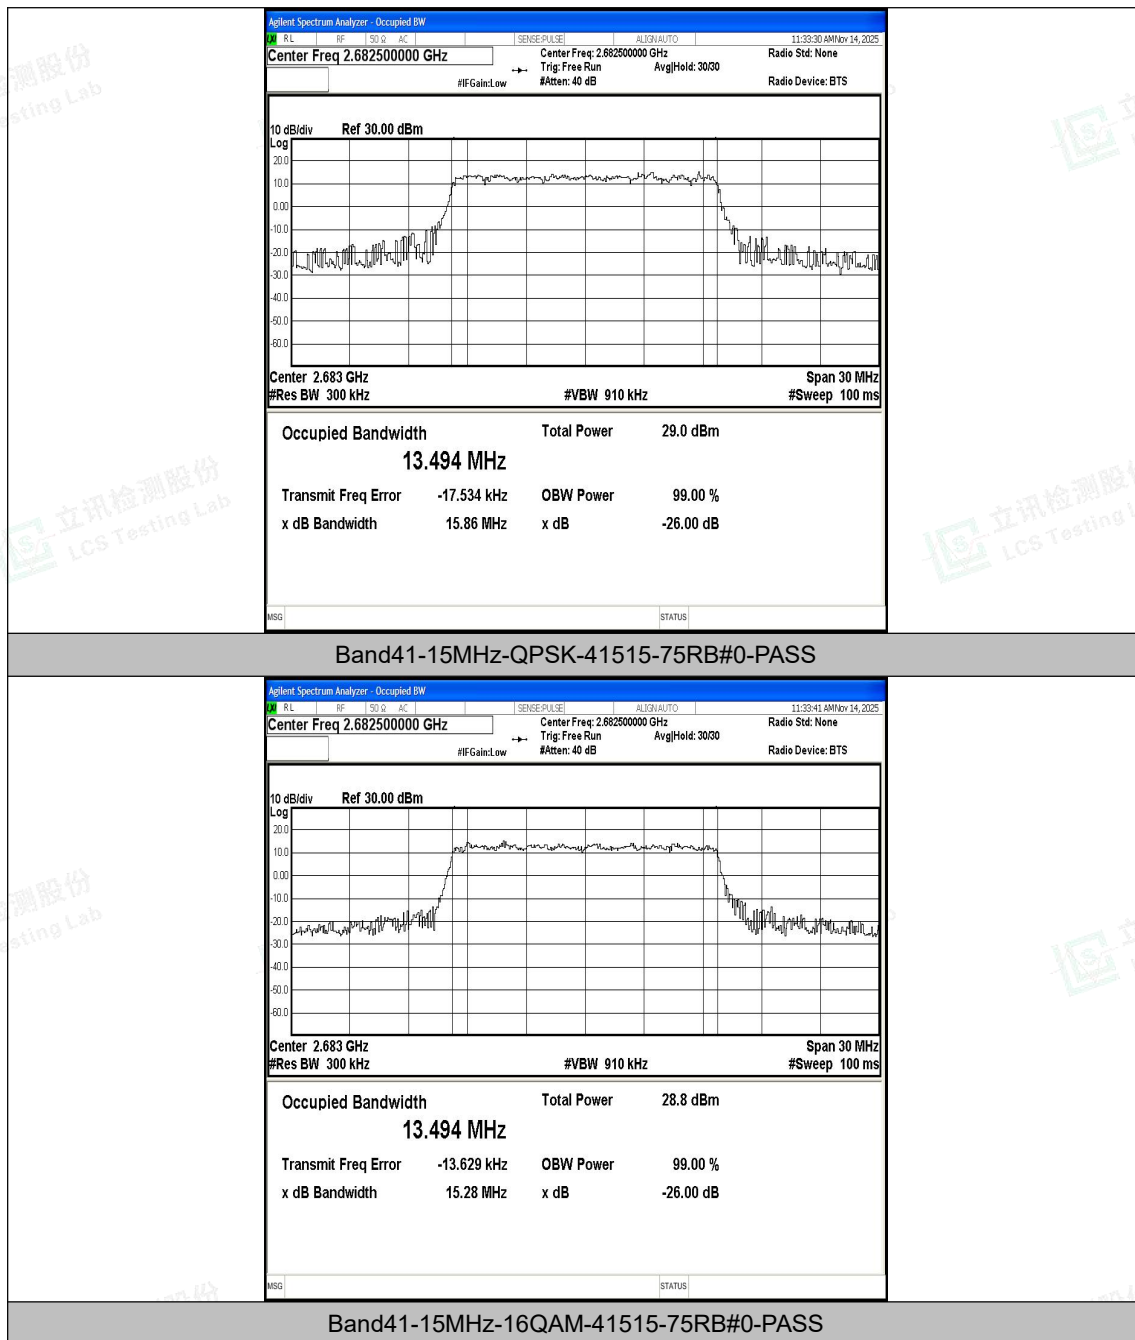


Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

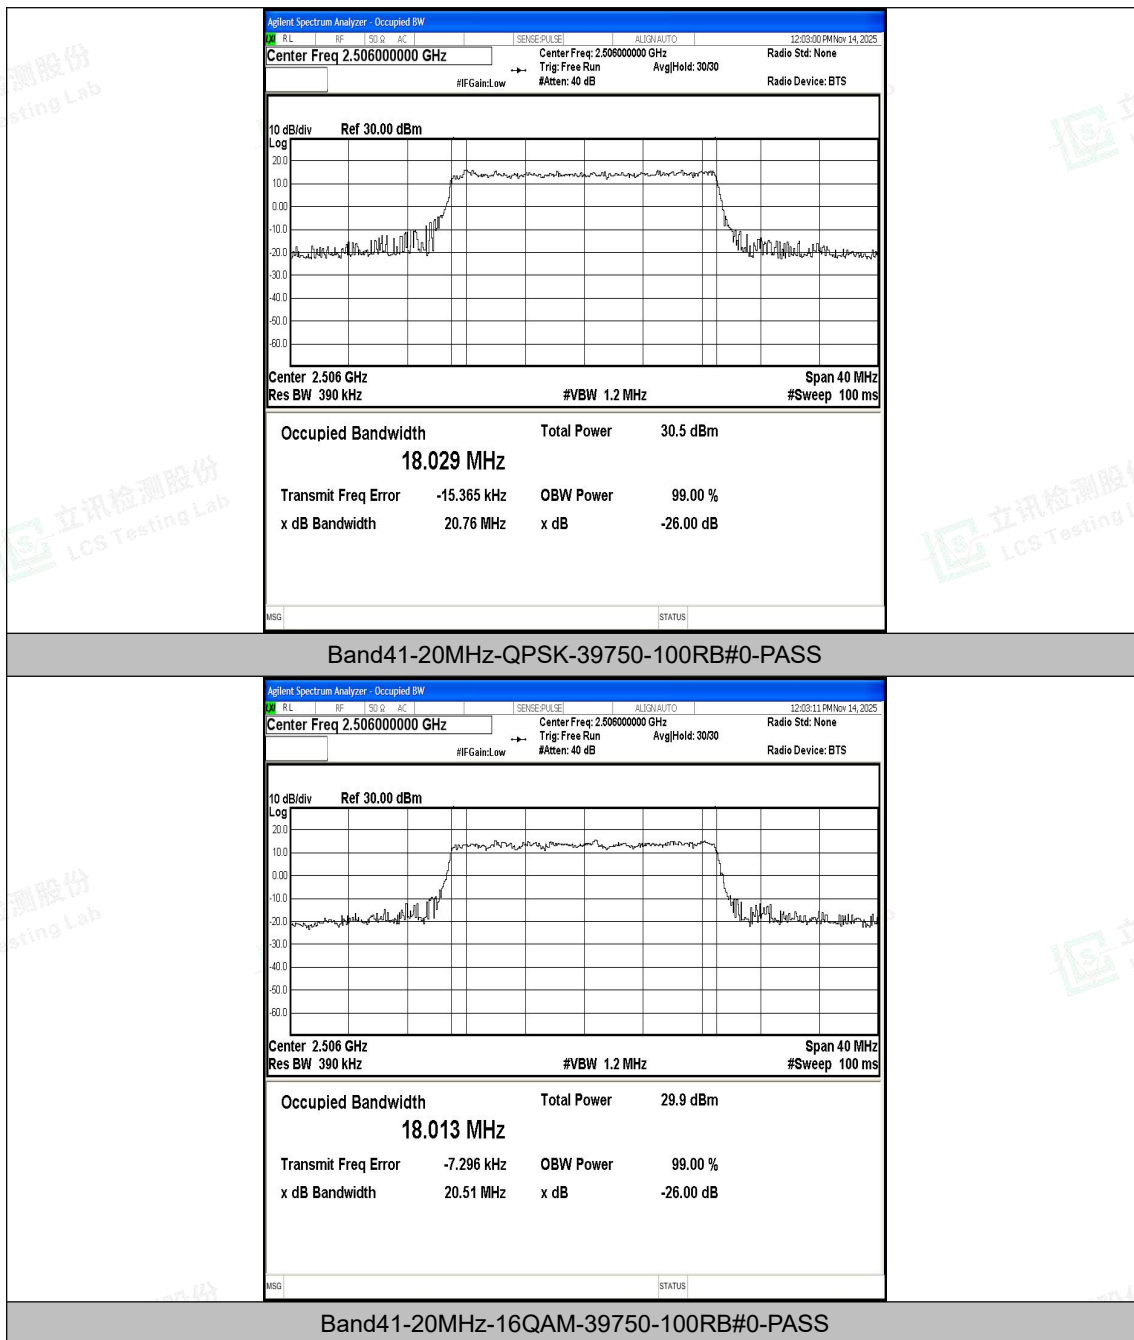



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

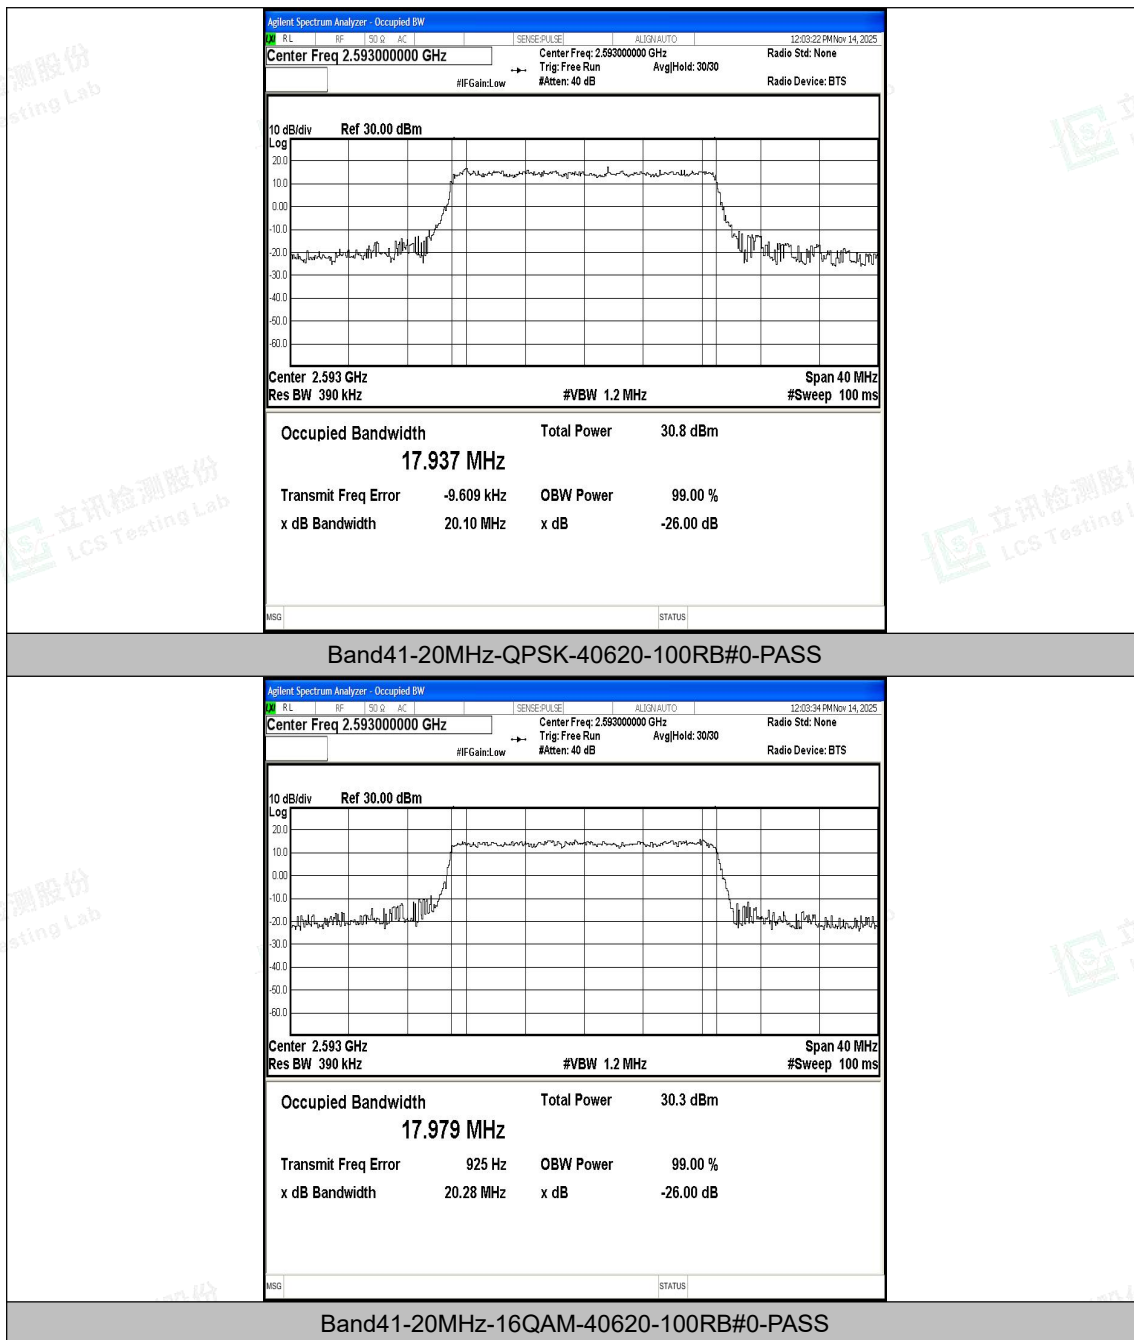

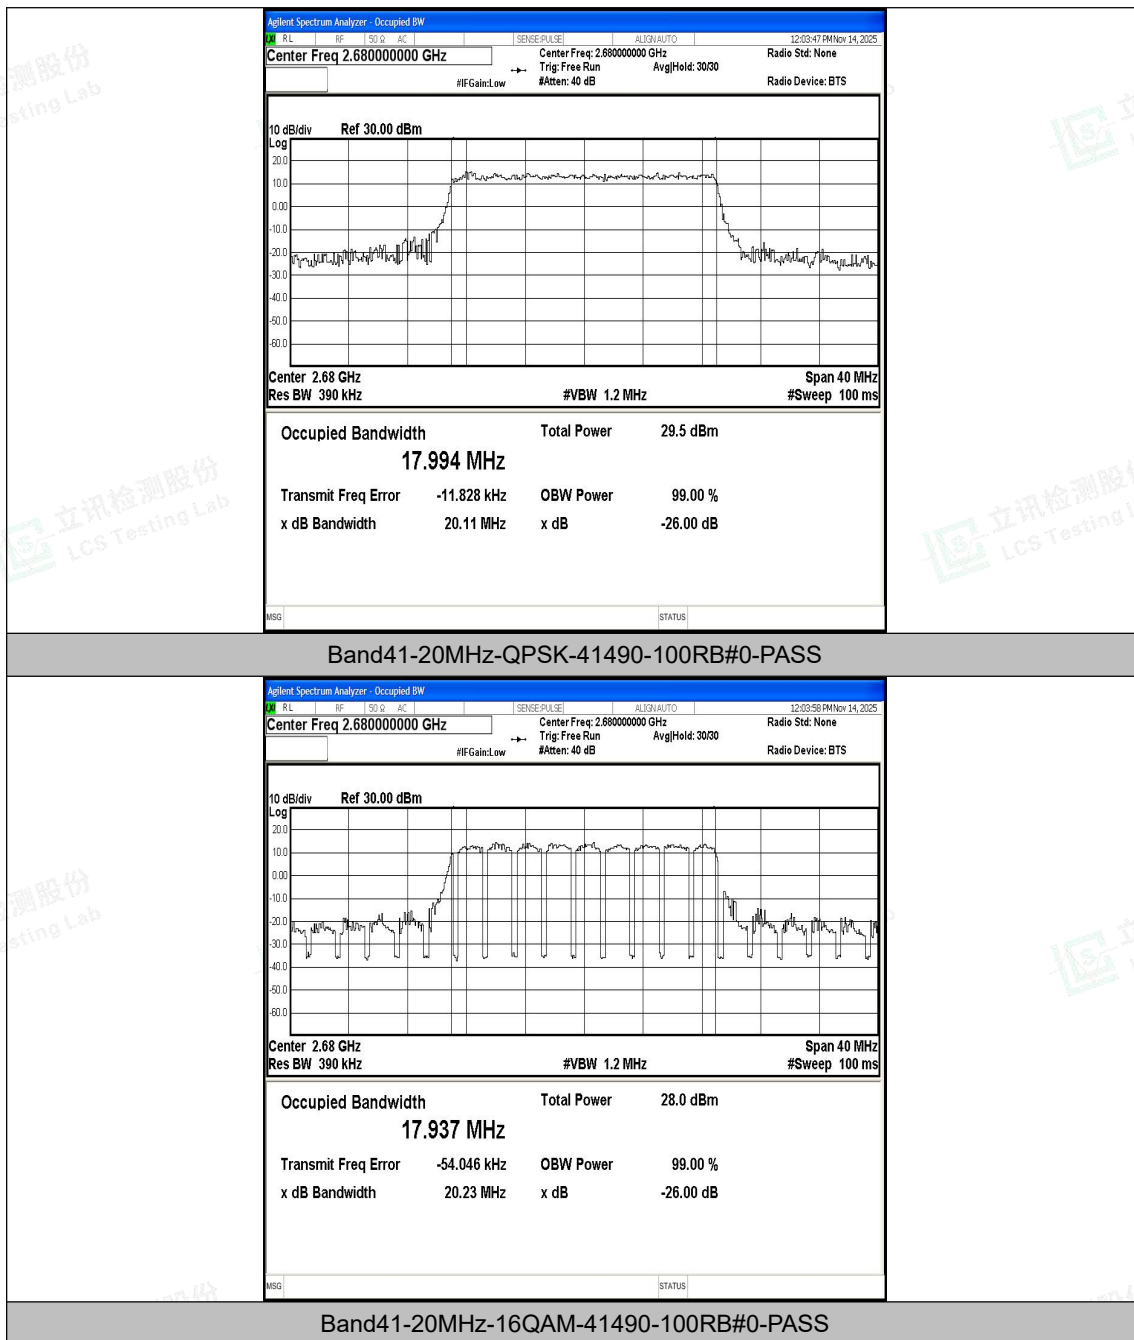

Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



G.4 Band Edge

Test Result


Band	Bandwidth	Modulation	Channel	RB Configuration	Peak Frequency	Result(dBm)	Verdict
Band41	5MHz	QPSK	39675	25RB#0	2490.42	-41.38	PASS
Band41	5MHz	16QAM	39675	25RB#0	2489.70	-41.59	PASS
Band41	5MHz	QPSK	41565	25RB#0	2698.04	-40.09	PASS
Band41	5MHz	16QAM	41565	25RB#0	2696.13	-40.35	PASS
Band41	10MHz	QPSK	39700	50RB#0	2489.76	-35.84	PASS
Band41	10MHz	16QAM	39700	50RB#0	2490.45	-35.69	PASS
Band41	10MHz	QPSK	41540	50RB#0	2700.23	-36.76	PASS
Band41	10MHz	16QAM	41540	50RB#0	2701.18	-37.15	PASS
Band41	15MHz	QPSK	39725	75RB#0	2489.38	-34.70	PASS
Band41	15MHz	16QAM	39725	75RB#0	2489.52	-34.74	PASS
Band41	15MHz	QPSK	41515	75RB#0	2707.38	-35.64	PASS
Band41	15MHz	16QAM	41515	75RB#0	2708.08	-35.73	PASS
Band41	20MHz	QPSK	39750	100RB#0	2489.65	-33.01	PASS
Band41	20MHz	16QAM	39750	100RB#0	2488.22	-32.69	PASS
Band41	20MHz	QPSK	41490	100RB#0	2711.67	-33.84	PASS
Band41	20MHz	16QAM	41490	100RB#0	2712.26	-34.37	PASS




Shenzhen LCS Compliance Testing Laboratory Ltd.
Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China
Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com
Scan code to check authenticity



Test Graphs

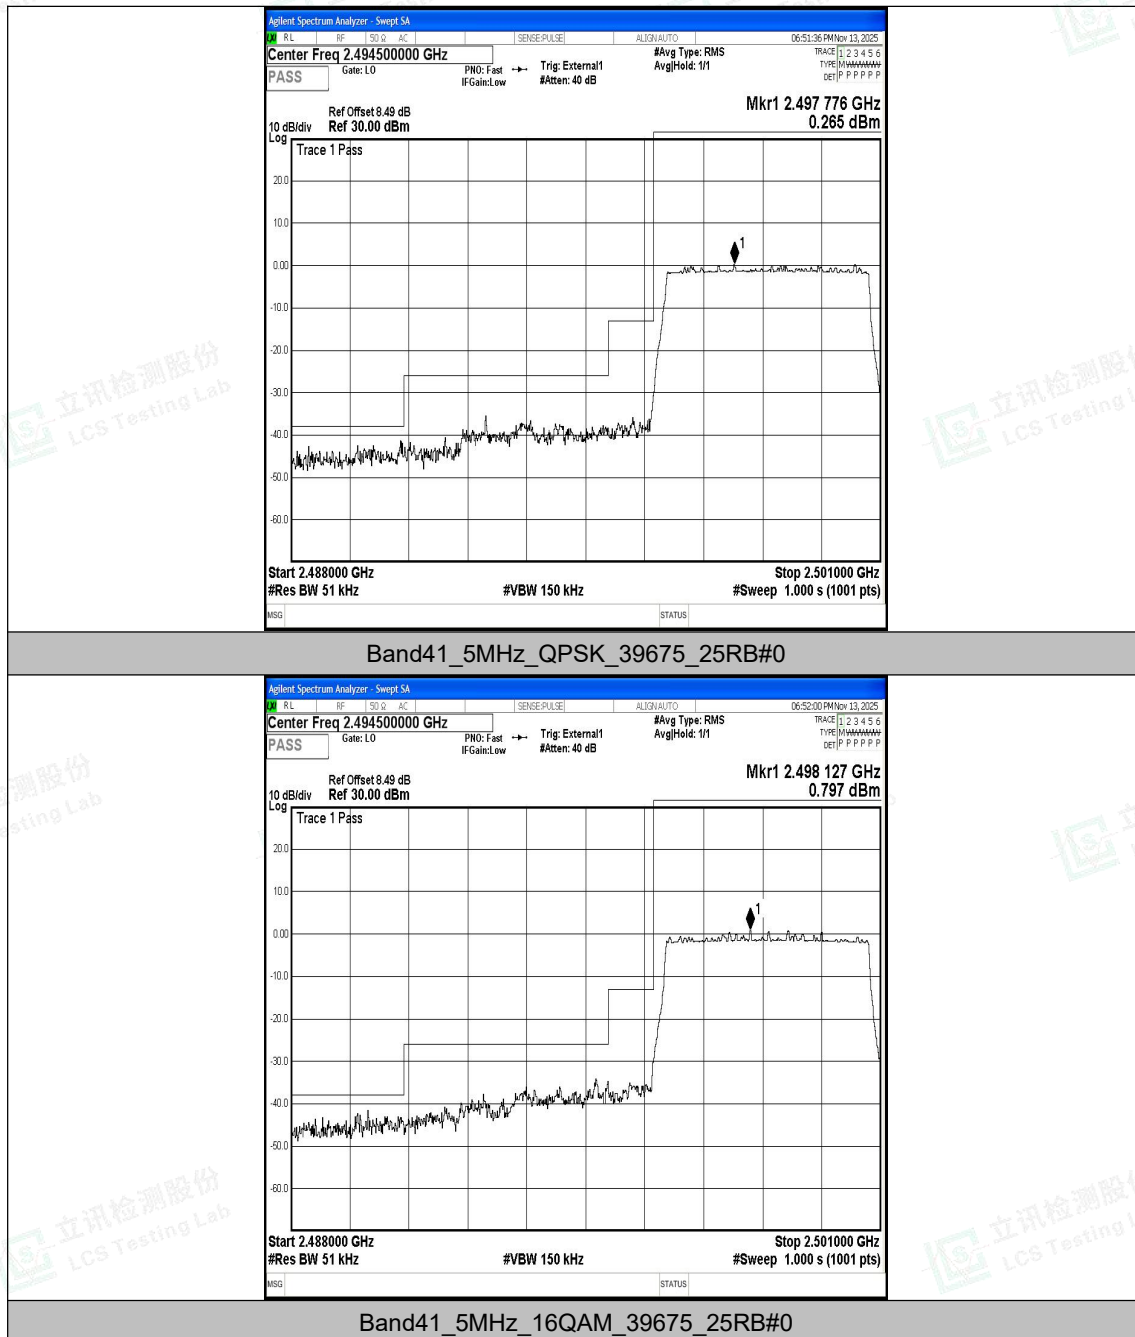

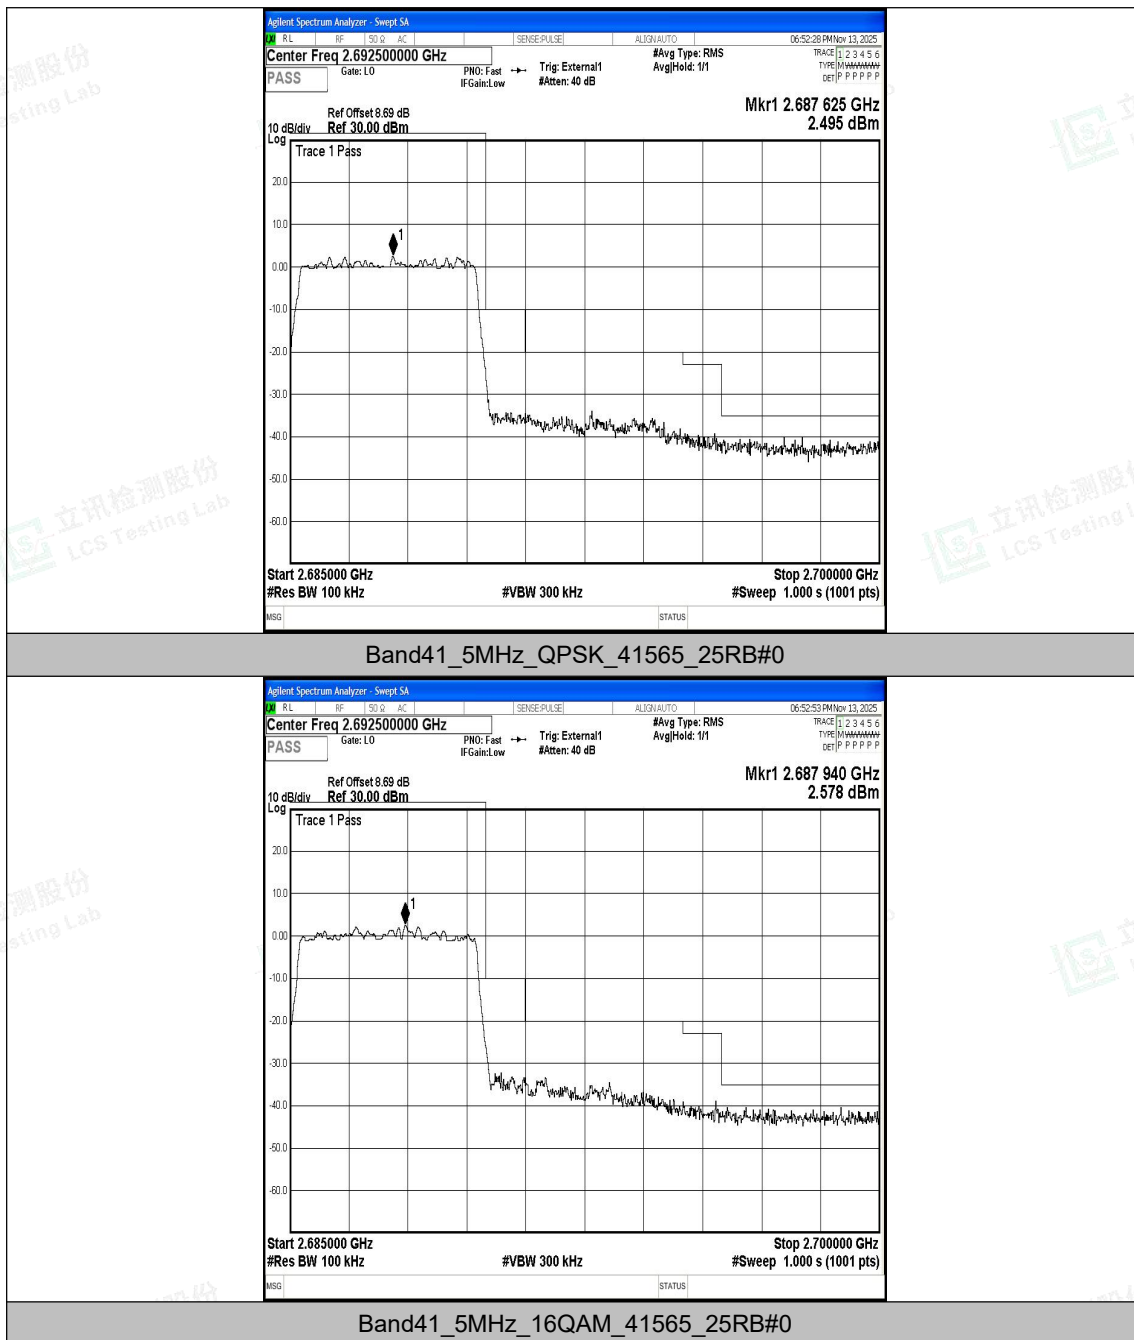

Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity




Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

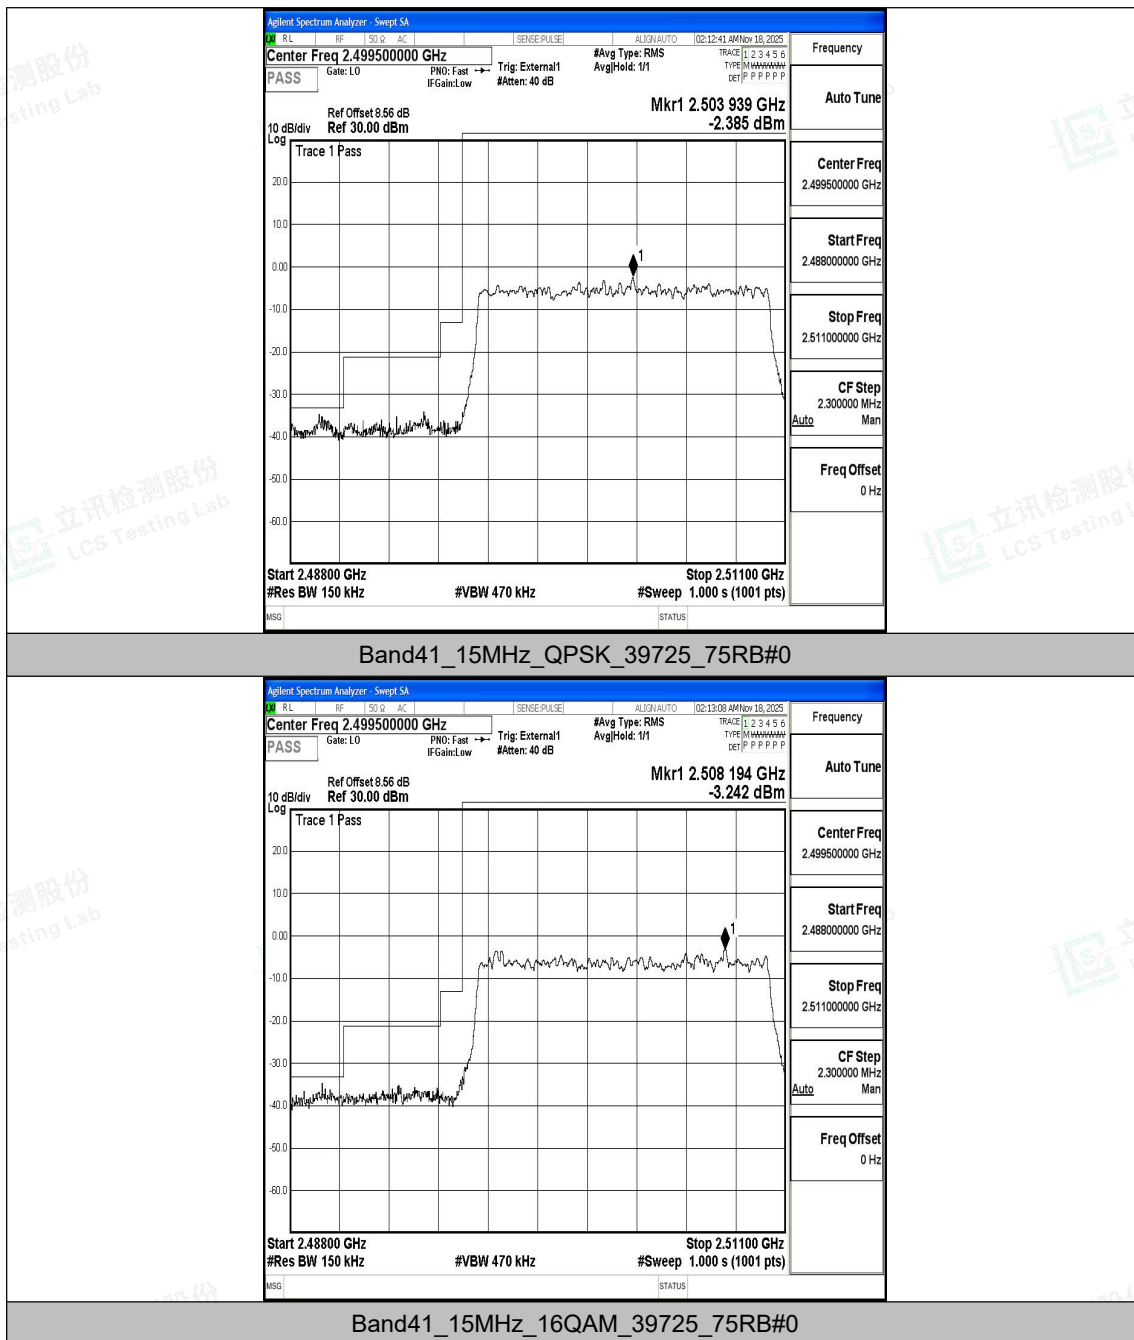





Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

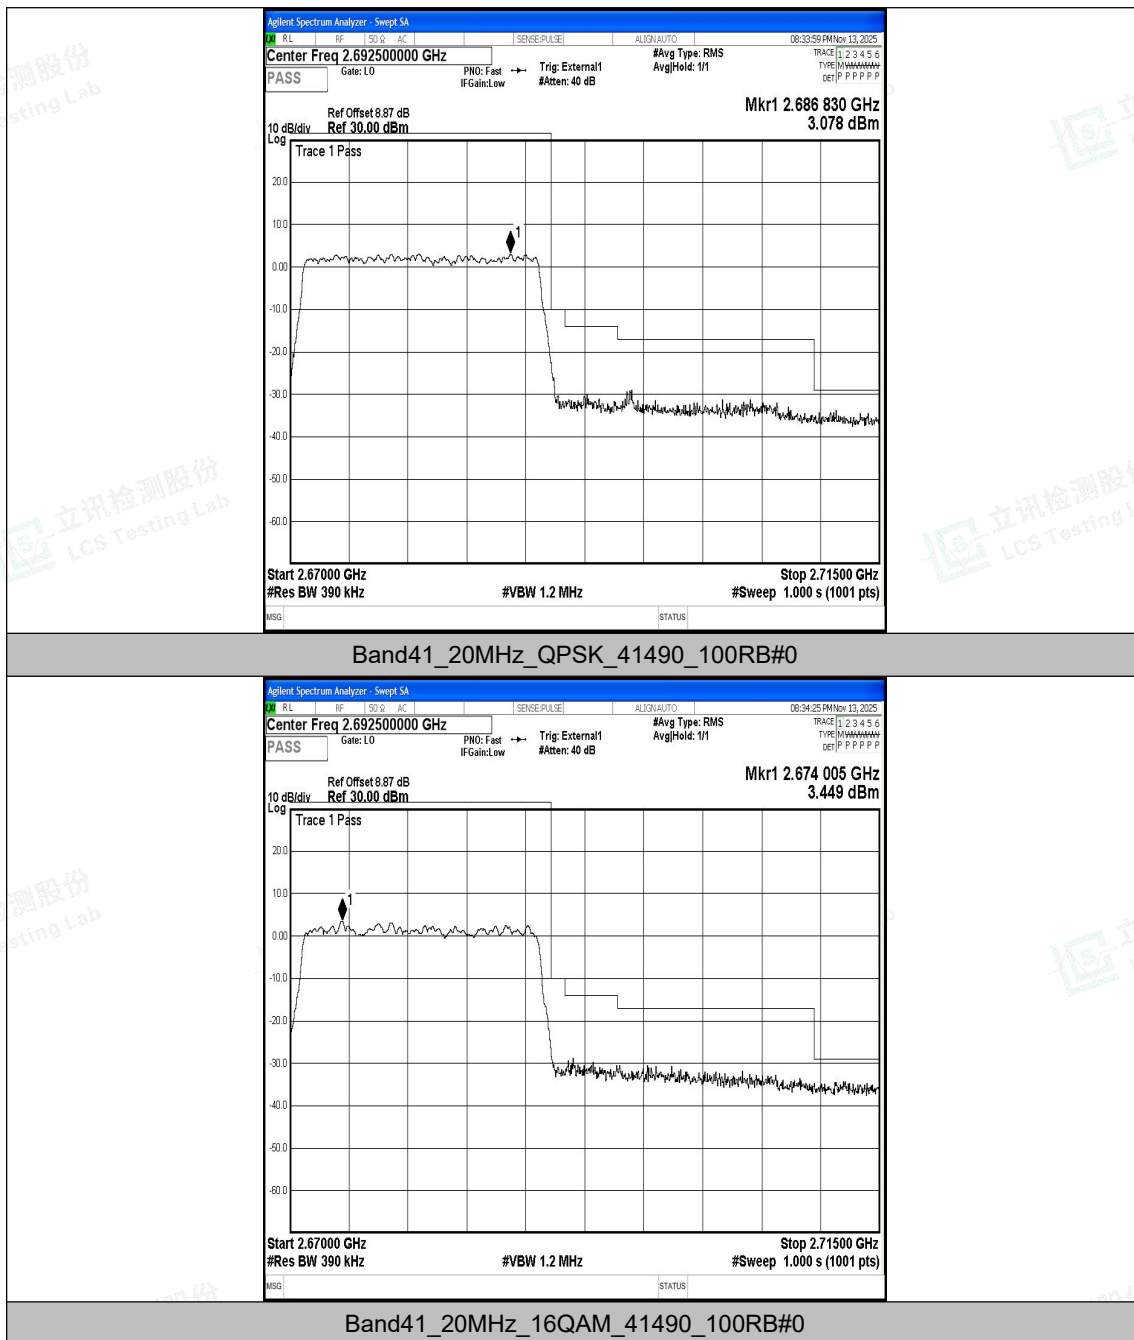

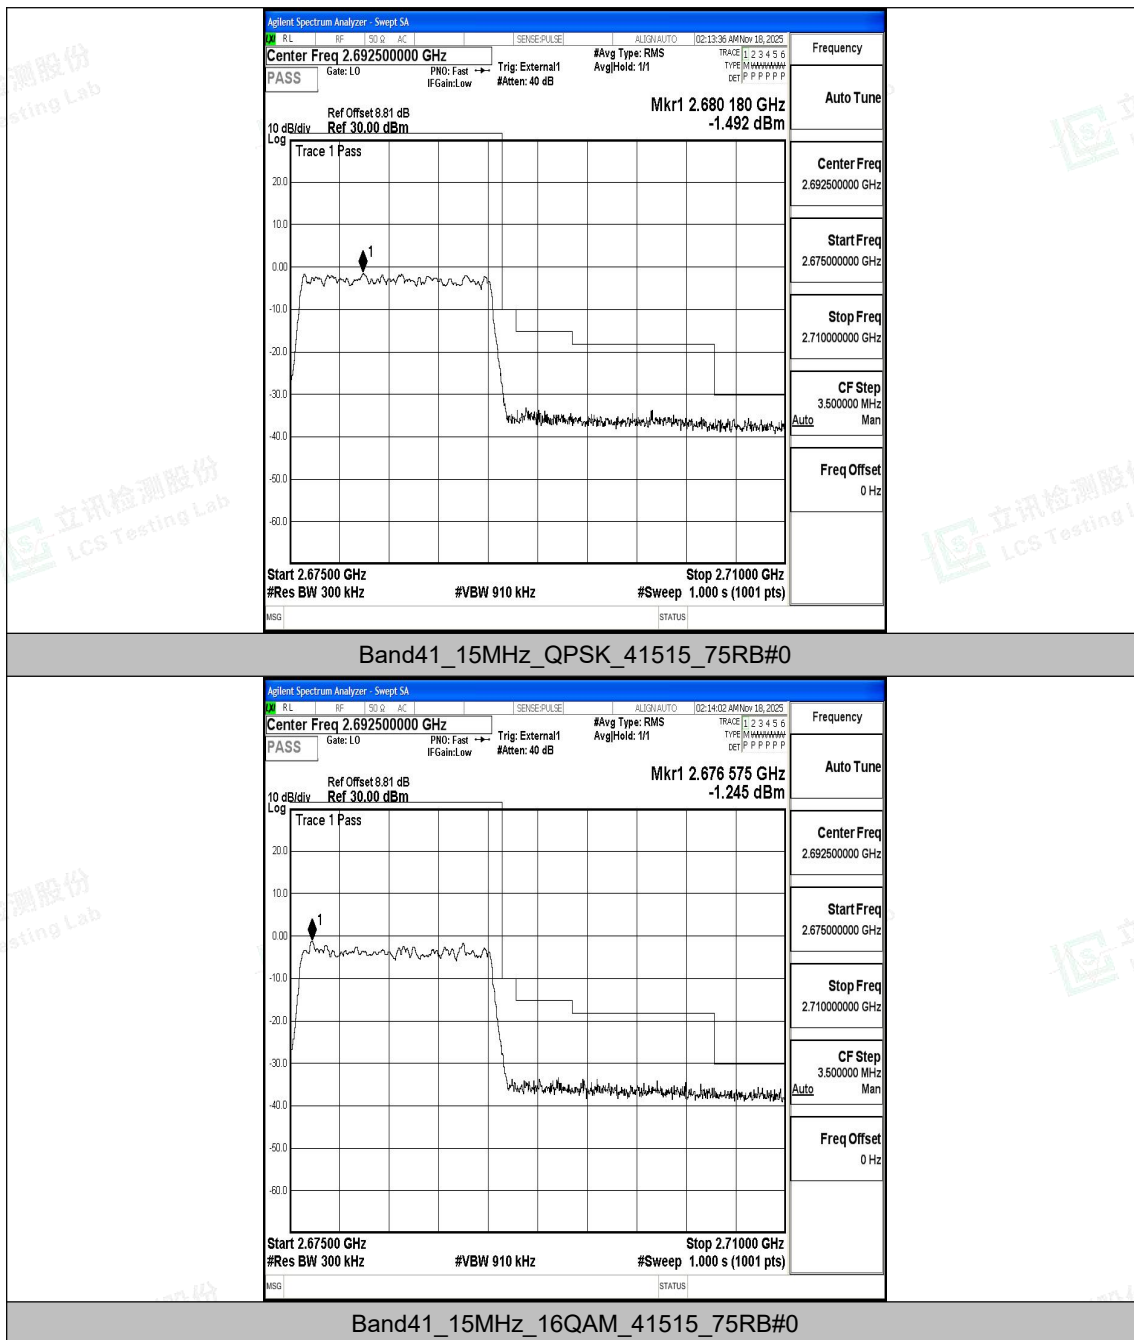



G.5 Conducted Spurious Emission

Test Result

Band	Bandwidth	Modulation	Channel	RB Configuration	Frequency Range	Result (dBm)	Verdict
Band41	5MHz	QPSK	39675	1RB#0	0.009~0.15	-64.43	PASS
Band41	5MHz	QPSK	39675	1RB#0	0.15~30	-63.79	PASS
Band41	5MHz	QPSK	39675	1RB#0	30~1000	-52.68	PASS
Band41	5MHz	QPSK	39675	1RB#0	1000~20000	-27.95	PASS
Band41	5MHz	QPSK	39675	1RB#0	20000~27000	-36.09	PASS
Band41	5MHz	16QAM	39675	1RB#0	0.009~0.15	-66.06	PASS
Band41	5MHz	16QAM	39675	1RB#0	0.15~30	-59.14	PASS
Band41	5MHz	16QAM	39675	1RB#0	30~1000	-53.06	PASS
Band41	5MHz	16QAM	39675	1RB#0	1000~20000	-27.49	PASS
Band41	5MHz	16QAM	39675	1RB#0	20000~27000	-36.40	PASS
Band41	5MHz	QPSK	40620	1RB#0	0.009~0.15	-65.22	PASS
Band41	5MHz	QPSK	40620	1RB#0	0.15~30	-49.99	PASS
Band41	5MHz	QPSK	40620	1RB#0	30~1000	-52.75	PASS
Band41	5MHz	16QAM	40620	1RB#0	1000~20000	-28.43	PASS
Band41	5MHz	16QAM	40620	1RB#0	20000~27000	-35.83	PASS
Band41	5MHz	QPSK	41565	1RB#0	0.009~0.15	-64.65	PASS
Band41	5MHz	QPSK	41565	1RB#0	0.15~30	-62.92	PASS
Band41	5MHz	QPSK	41565	1RB#0	30~1000	-52.88	PASS
Band41	5MHz	QPSK	41565	1RB#0	1000~20000	-27.80	PASS
Band41	5MHz	QPSK	41565	1RB#0	20000~27000	-35.29	PASS
Band41	5MHz	16QAM	41565	1RB#0	0.009~0.15	-65.77	PASS
Band41	5MHz	16QAM	41565	1RB#0	0.15~30	-64.05	PASS
Band41	5MHz	16QAM	41565	1RB#0	30~1000	-52.96	PASS
Band41	5MHz	16QAM	41565	1RB#0	1000~20000	-28.01	PASS
Band41	5MHz	16QAM	41565	1RB#0	20000~27000	-36.33	PASS
Band41	10MHz	QPSK	39700	1RB#0	0.009~0.15	-65.10	PASS
Band41	10MHz	QPSK	39700	1RB#0	0.15~30	-64.45	PASS
Band41	10MHz	QPSK	39700	1RB#0	30~1000	-53.37	PASS
Band41	10MHz	QPSK	39700	1RB#0	1000~20000	-28.48	PASS
Band41	10MHz	QPSK	39700	1RB#0	20000~27000	-35.75	PASS
Band41	10MHz	16QAM	39700	1RB#0	0.009~0.15	-64.57	PASS
Band41	10MHz	16QAM	39700	1RB#0	0.15~30	-64.02	PASS
Band41	10MHz	16QAM	39700	1RB#0	30~1000	-52.93	PASS
Band41	10MHz	16QAM	39700	1RB#0	1000~20000	-27.86	PASS
Band41	10MHz	16QAM	39700	1RB#0	20000~27000	-36.16	PASS



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



Band41	10MHz	QPSK	40620	1RB#0	0.009~0.15	-66.47	PASS
Band41	10MHz	QPSK	40620	1RB#0	0.15~30	-48.37	PASS
Band41	10MHz	QPSK	40620	1RB#0	30~1000	-52.59	PASS
Band41	10MHz	QPSK	40620	1RB#0	1000~20000	-27.83	PASS
Band41	10MHz	QPSK	40620	1RB#0	20000~27000	-35.86	PASS
Band41	10MHz	16QAM	40620	1RB#0	0.009~0.15	-67.94	PASS
Band41	10MHz	16QAM	40620	1RB#0	0.15~30	-47.31	PASS
Band41	10MHz	16QAM	40620	1RB#0	30~1000	-52.96	PASS
Band41	10MHz	16QAM	40620	1RB#0	1000~20000	-27.82	PASS
Band41	10MHz	16QAM	40620	1RB#0	20000~27000	-36.44	PASS
Band41	10MHz	QPSK	41540	1RB#0	0.009~0.15	-65.67	PASS
Band41	10MHz	QPSK	41540	1RB#0	0.15~30	-63.17	PASS
Band41	10MHz	QPSK	41540	1RB#0	30~1000	-51.96	PASS
Band41	10MHz	QPSK	41540	1RB#0	1000~20000	-28.65	PASS
Band41	10MHz	QPSK	41540	1RB#0	20000~27000	-36.26	PASS
Band41	10MHz	16QAM	41540	1RB#0	0.009~0.15	-64.49	PASS
Band41	10MHz	16QAM	41540	1RB#0	0.15~30	-60.55	PASS
Band41	10MHz	16QAM	41540	1RB#0	30~1000	-52.65	PASS
Band41	10MHz	16QAM	41540	1RB#0	1000~20000	-28.60	PASS
Band41	10MHz	16QAM	41540	1RB#0	20000~27000	-36.29	PASS
Band41	15MHz	QPSK	39725	1RB#0	0.009~0.15	-62.46	PASS
Band41	15MHz	QPSK	39725	1RB#0	0.15~30	-63.95	PASS
Band41	15MHz	QPSK	39725	1RB#0	30~1000	-51.91	PASS
Band41	15MHz	QPSK	39725	1RB#0	1000~20000	-28.08	PASS
Band41	15MHz	QPSK	39725	1RB#0	20000~27000	-36.20	PASS
Band41	15MHz	16QAM	39725	1RB#0	0.009~0.15	-65.30	PASS
Band41	15MHz	16QAM	39725	1RB#0	0.15~30	-66.18	PASS
Band41	15MHz	16QAM	39725	1RB#0	30~1000	-52.59	PASS
Band41	15MHz	16QAM	39725	1RB#0	1000~20000	-28.23	PASS
Band41	15MHz	16QAM	39725	1RB#0	20000~27000	-35.95	PASS
Band41	15MHz	QPSK	40620	1RB#0	0.009~0.15	-65.45	PASS
Band41	15MHz	QPSK	40620	1RB#0	0.15~30	-49.31	PASS
Band41	15MHz	QPSK	40620	1RB#0	30~1000	-52.61	PASS
Band41	15MHz	QPSK	40620	1RB#0	1000~20000	-28.25	PASS
Band41	15MHz	QPSK	40620	1RB#0	20000~27000	-36.06	PASS
Band41	15MHz	16QAM	40620	1RB#0	0.009~0.15	-63.25	PASS
Band41	15MHz	16QAM	40620	1RB#0	0.15~30	-48.49	PASS
Band41	15MHz	16QAM	40620	1RB#0	30~1000	-52.43	PASS
Band41	15MHz	16QAM	40620	1RB#0	1000~20000	-28.69	PASS
Band41	15MHz	16QAM	40620	1RB#0	20000~27000	-36.39	PASS
Band41	15MHz	QPSK	41515	1RB#0	0.009~0.15	-62.67	PASS



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



Band41	15MHz	QPSK	41515	1RB#0	0.15~30	-63.24	PASS
Band41	15MHz	QPSK	41515	1RB#0	30~1000	-52.59	PASS
Band41	15MHz	QPSK	41515	1RB#0	1000~20000	-27.89	PASS
Band41	15MHz	QPSK	41515	1RB#0	20000~27000	-35.24	PASS
Band41	15MHz	16QAM	41515	1RB#0	0.009~0.15	-65.78	PASS
Band41	15MHz	16QAM	41515	1RB#0	0.15~30	-64.09	PASS
Band41	15MHz	16QAM	41515	1RB#0	30~1000	-52.97	PASS
Band41	15MHz	16QAM	41515	1RB#0	1000~20000	-27.55	PASS
Band41	15MHz	16QAM	41515	1RB#0	20000~27000	-35.40	PASS
Band41	20MHz	QPSK	39750	1RB#0	0.009~0.15	-64.40	PASS
Band41	20MHz	QPSK	39750	1RB#0	0.15~30	-63.49	PASS
Band41	20MHz	QPSK	39750	1RB#0	30~1000	-51.95	PASS
Band41	20MHz	QPSK	39750	1RB#0	1000~20000	-27.39	PASS
Band41	20MHz	QPSK	39750	1RB#0	20000~27000	-36.56	PASS
Band41	20MHz	16QAM	39750	1RB#0	0.009~0.15	-64.38	PASS
Band41	20MHz	16QAM	39750	1RB#0	0.15~30	-63.05	PASS
Band41	20MHz	16QAM	39750	1RB#0	30~1000	-52.73	PASS
Band41	20MHz	16QAM	39750	1RB#0	1000~20000	-27.46	PASS
Band41	20MHz	16QAM	39750	1RB#0	20000~27000	-36.31	PASS
Band41	20MHz	QPSK	40620	1RB#0	0.009~0.15	-66.12	PASS
Band41	20MHz	QPSK	40620	1RB#0	0.15~30	-50.68	PASS
Band41	20MHz	QPSK	40620	1RB#0	30~1000	-53.18	PASS
Band41	20MHz	QPSK	40620	1RB#0	1000~20000	-27.70	PASS
Band41	20MHz	QPSK	40620	1RB#0	20000~27000	-35.58	PASS
Band41	20MHz	16QAM	40620	1RB#0	0.009~0.15	-65.64	PASS
Band41	20MHz	16QAM	40620	1RB#0	0.15~30	-48.24	PASS
Band41	20MHz	16QAM	40620	1RB#0	30~1000	-53.40	PASS
Band41	20MHz	16QAM	40620	1RB#0	1000~20000	-27.87	PASS
Band41	20MHz	16QAM	40620	1RB#0	20000~27000	-36.07	PASS
Band41	20MHz	QPSK	41490	1RB#0	0.009~0.15	-66.32	PASS
Band41	20MHz	QPSK	41490	1RB#0	0.15~30	-62.81	PASS
Band41	20MHz	QPSK	41490	1RB#0	30~1000	-52.64	PASS
Band41	20MHz	QPSK	41490	1RB#0	1000~20000	-28.38	PASS
Band41	20MHz	QPSK	41490	1RB#0	20000~27000	-36.29	PASS
Band41	20MHz	16QAM	41490	1RB#0	0.009~0.15	-64.08	PASS
Band41	20MHz	16QAM	41490	1RB#0	0.15~30	-64.95	PASS
Band41	20MHz	16QAM	41490	1RB#0	30~1000	-53.54	PASS
Band41	20MHz	16QAM	41490	1RB#0	1000~20000	-28.42	PASS
Band41	20MHz	16QAM	41490	1RB#0	20000~27000	-35.72	PASS
Band41	5MHz	QPSK	40620	1RB#0	1000~20000	-28.45	PASS
Band41	5MHz	QPSK	40620	1RB#0	20000~27000	-36.12	PASS



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China


Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity




Band41	5MHz	16QAM	40620	1RB#0	0.009~0.15	-67.36	PASS
Band41	5MHz	16QAM	40620	1RB#0	0.15~30	-46.01	PASS
Band41	5MHz	16QAM	40620	1RB#0	30~1000	-50.62	PASS


Test Graphs

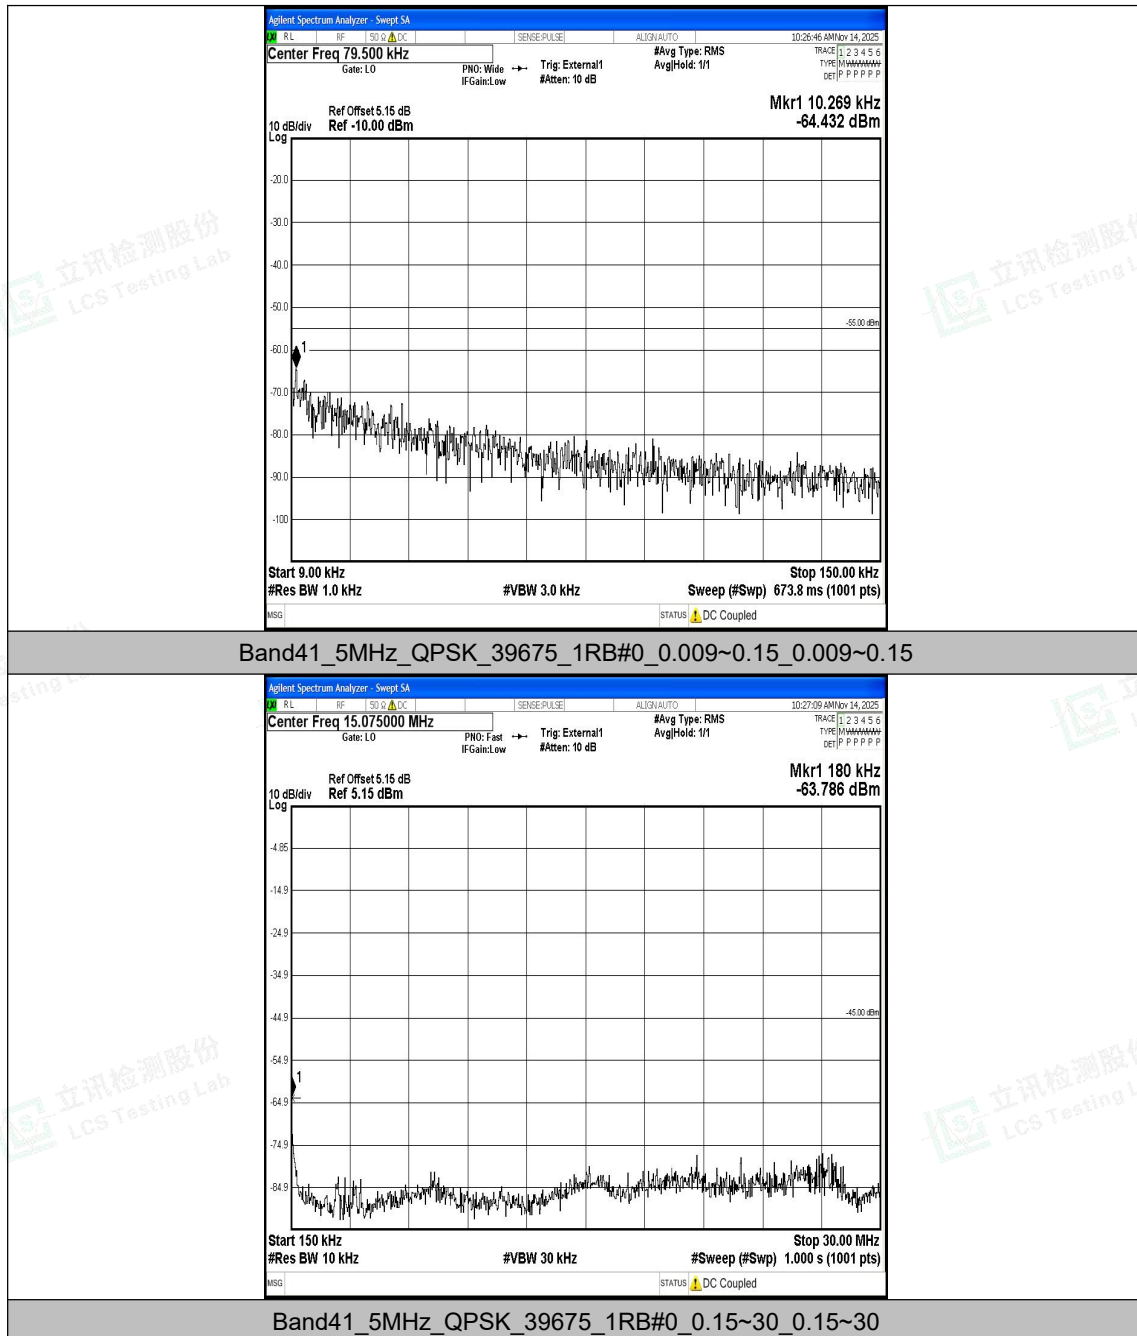

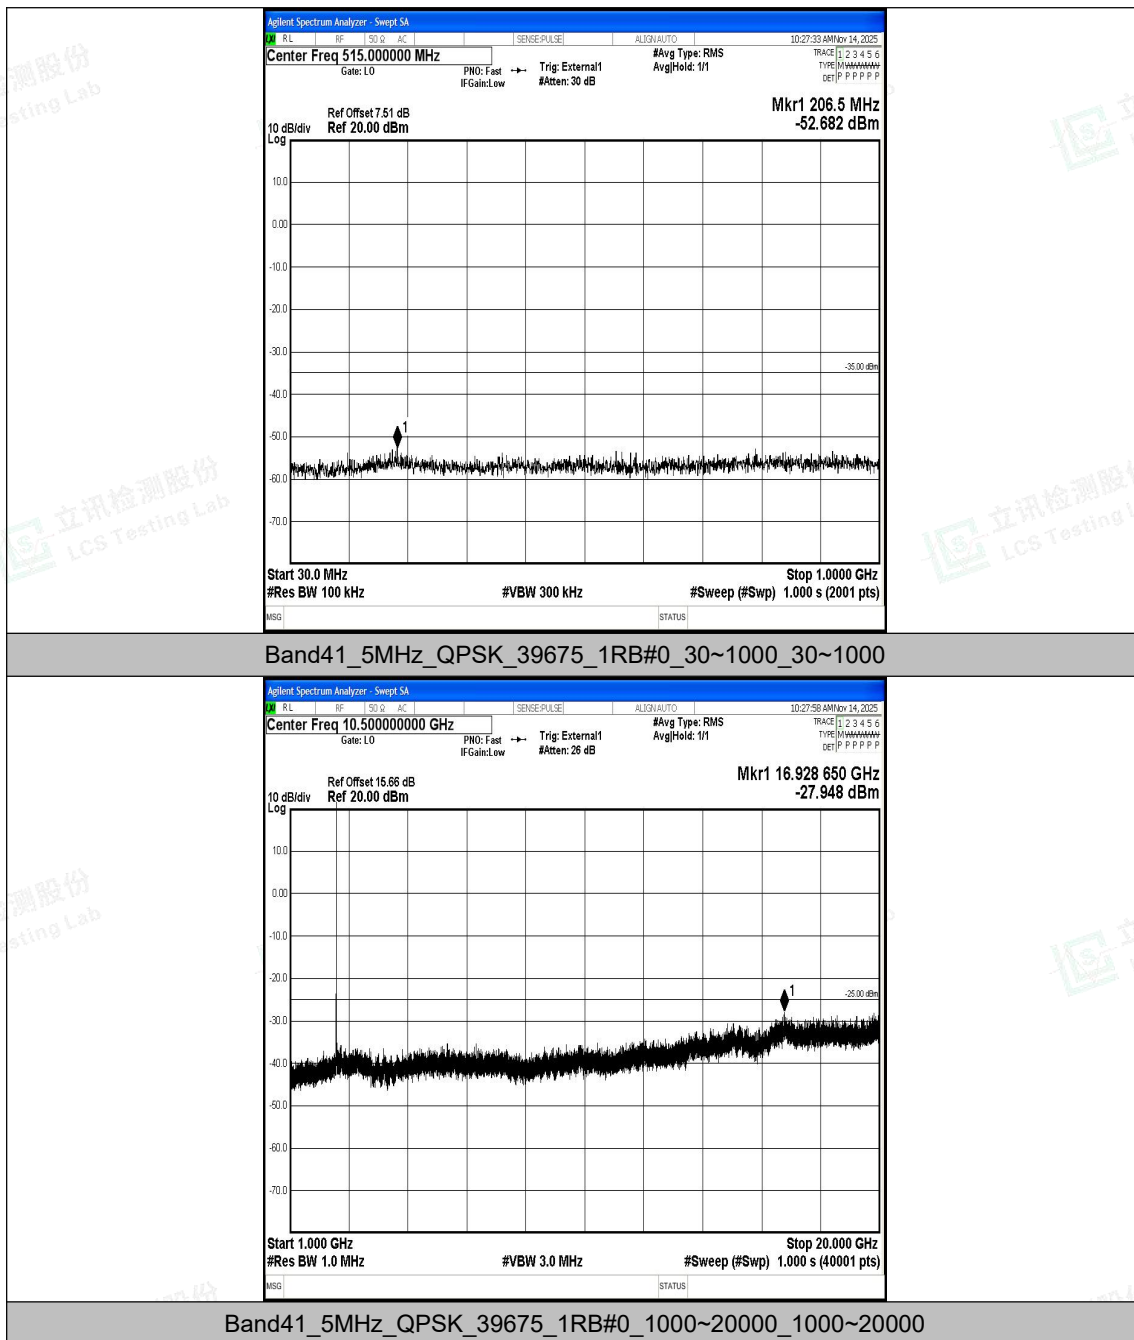

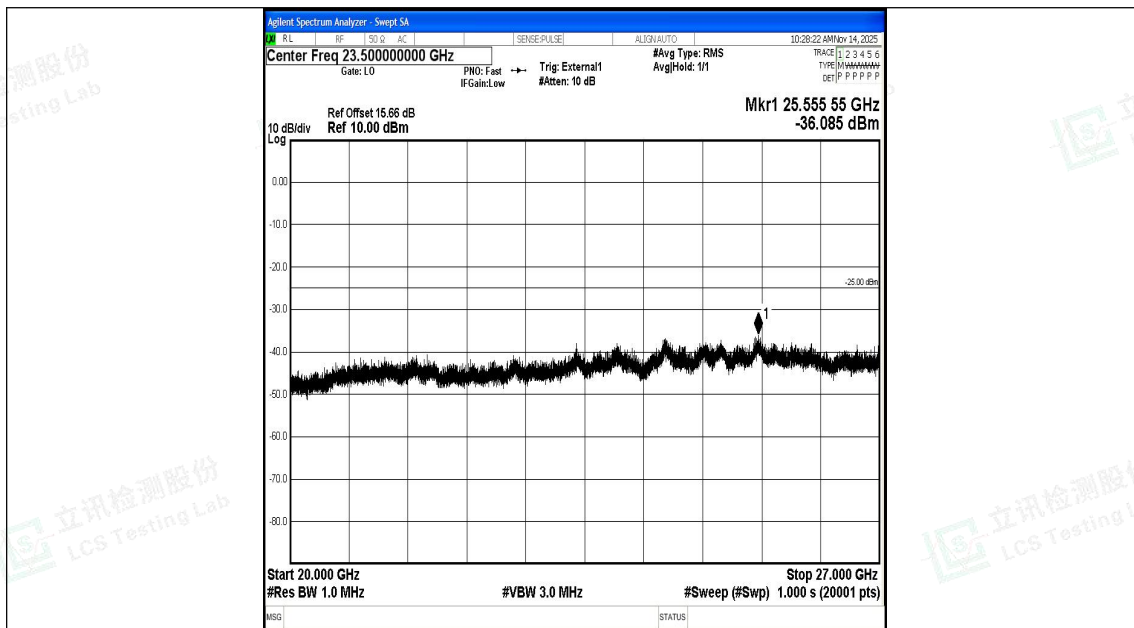

Band41_5MHz_QPSK_39675_1RB#0_20000~27000_20000~27000

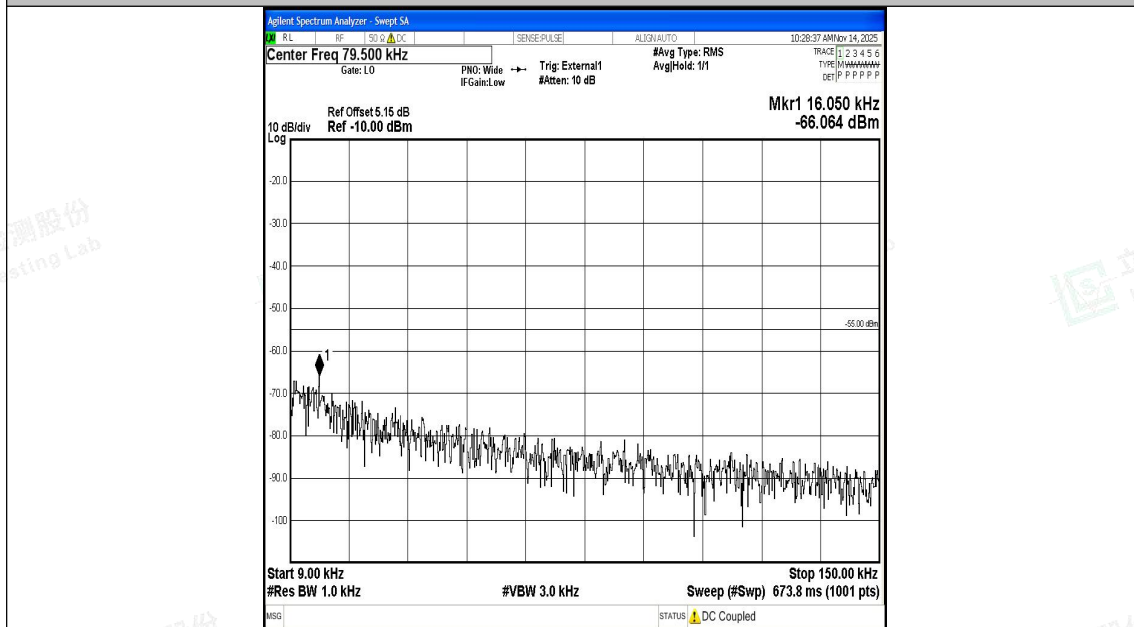

Band41_5MHz_16QAM_39675_1RB#0_0.009~0.15_0.009~0.15



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity