



Appendix Q: Test Data for E-UTRA Band 41

Product Name: SFO1

Test Model: SFO1

Environmental Conditions

Temperature:	23.8° C
Relative Humidity:	52.1%
ATM Pressure:	100.0 kPa
Test Engineer:	Paddi Chen
Supervised by:	Nick Peng





Q.1 Conducted Output Power Data

Test Result

Band	Bandwidth	Modulation	Channel	RB Configuration	Result(dBm)	Verdict
Band41	5MHz	QPSK	39675	1RB#0	21.53	PASS
Band41	5MHz	16QAM	39675	1RB#0	21.12	PASS
Band41	5MHz	QPSK	39675	1RB#12	21.53	PASS
Band41	5MHz	16QAM	39675	1RB#12	21.31	PASS
Band41	5MHz	QPSK	39675	1RB#24	21.43	PASS
Band41	5MHz	16QAM	39675	1RB#24	21.09	PASS
Band41	5MHz	QPSK	39675	12RB#0	20.58	PASS
Band41	5MHz	16QAM	39675	12RB#0	19.78	PASS
Band41	5MHz	QPSK	39675	12RB#6	20.61	PASS
Band41	5MHz	16QAM	39675	12RB#6	19.80	PASS
Band41	5MHz	QPSK	39675	12RB#13	20.81	PASS
Band41	5MHz	16QAM	39675	12RB#13	20.04	PASS
Band41	5MHz	QPSK	39675	25RB#0	20.81	PASS
Band41	5MHz	16QAM	39675	25RB#0	20.20	PASS
Band41	5MHz	QPSK	40620	1RB#0	21.27	PASS
Band41	5MHz	16QAM	40620	1RB#0	20.78	PASS
Band41	5MHz	QPSK	40620	1RB#12	21.37	PASS
Band41	5MHz	16QAM	40620	1RB#12	20.99	PASS
Band41	5MHz	QPSK	40620	1RB#24	21.52	PASS
Band41	5MHz	16QAM	40620	1RB#24	21.10	PASS
Band41	5MHz	QPSK	40620	12RB#0	20.43	PASS
Band41	5MHz	16QAM	40620	12RB#0	19.67	PASS
Band41	5MHz	QPSK	40620	12RB#6	20.47	PASS
Band41	5MHz	16QAM	40620	12RB#6	19.69	PASS
Band41	5MHz	QPSK	40620	12RB#13	20.45	PASS
Band41	5MHz	16QAM	40620	12RB#13	19.75	PASS
Band41	5MHz	QPSK	40620	25RB#0	20.45	PASS
Band41	5MHz	16QAM	40620	25RB#0	19.80	PASS
Band41	5MHz	QPSK	41565	1RB#0	21.41	PASS
Band41	5MHz	16QAM	41565	1RB#0	20.99	PASS
Band41	5MHz	QPSK	41565	1RB#12	21.44	PASS
Band41	5MHz	16QAM	41565	1RB#12	21.38	PASS
Band41	5MHz	QPSK	41565	1RB#24	21.55	PASS
Band41	5MHz	16QAM	41565	1RB#24	21.00	PASS
Band41	5MHz	QPSK	41565	12RB#0	20.66	PASS
Band41	5MHz	16QAM	41565	12RB#0	19.78	PASS





Band41	5MHz	QPSK	41565	12RB#6	20.50	PASS
Band41	5MHz	16QAM	41565	12RB#6	19.73	PASS
Band41	5MHz	QPSK	41565	12RB#13	20.62	PASS
Band41	5MHz	16QAM	41565	12RB#13	19.80	PASS
Band41	5MHz	QPSK	41565	25RB#0	20.50	PASS
Band41	5MHz	16QAM	41565	25RB#0	19.90	PASS
Band41	10MHz	QPSK	39700	1RB#0	22.39	PASS
Band41	10MHz	16QAM	39700	1RB#0	22.08	PASS
Band41	10MHz	QPSK	39700	1RB#24	22.49	PASS
Band41	10MHz	16QAM	39700	1RB#24	22.13	PASS
Band41	10MHz	QPSK	39700	1RB#49	22.65	PASS
Band41	10MHz	16QAM	39700	1RB#49	22.38	PASS
Band41	10MHz	QPSK	39700	25RB#0	21.40	PASS
Band41	10MHz	16QAM	39700	25RB#0	20.69	PASS
Band41	10MHz	QPSK	39700	25RB#12	21.37	PASS
Band41	10MHz	16QAM	39700	25RB#12	20.69	PASS
Band41	10MHz	QPSK	39700	25RB#25	21.47	PASS
Band41	10MHz	16QAM	39700	25RB#25	20.77	PASS
Band41	10MHz	QPSK	39700	50RB#0	21.41	PASS
Band41	10MHz	16QAM	39700	50RB#0	20.79	PASS
Band41	10MHz	QPSK	40620	1RB#0	21.56	PASS
Band41	10MHz	16QAM	40620	1RB#0	21.30	PASS
Band41	10MHz	QPSK	40620	1RB#24	21.73	PASS
Band41	10MHz	16QAM	40620	1RB#24	21.33	PASS
Band41	10MHz	QPSK	40620	1RB#49	21.57	PASS
Band41	10MHz	16QAM	40620	1RB#49	20.87	PASS
Band41	10MHz	QPSK	40620	25RB#0	20.46	PASS
Band41	10MHz	16QAM	40620	25RB#0	19.66	PASS
Band41	10MHz	QPSK	40620	25RB#12	20.35	PASS
Band41	10MHz	16QAM	40620	25RB#12	19.61	PASS
Band41	10MHz	QPSK	40620	25RB#25	20.65	PASS
Band41	10MHz	16QAM	40620	25RB#25	19.82	PASS
Band41	10MHz	QPSK	40620	50RB#0	20.47	PASS
Band41	10MHz	16QAM	40620	50RB#0	19.75	PASS
Band41	10MHz	QPSK	41540	1RB#0	21.66	PASS
Band41	10MHz	16QAM	41540	1RB#0	21.40	PASS
Band41	10MHz	QPSK	41540	1RB#24	21.81	PASS
Band41	10MHz	16QAM	41540	1RB#24	21.46	PASS
Band41	10MHz	QPSK	41540	1RB#49	21.84	PASS
Band41	10MHz	16QAM	41540	1RB#49	21.48	PASS
Band41	10MHz	QPSK	41540	25RB#0	20.62	PASS
Band41	10MHz	16QAM	41540	25RB#0	19.71	PASS





Band41	10MHz	QPSK	41540	25RB#12	20.44	PASS
Band41	10MHz	16QAM	41540	25RB#12	19.71	PASS
Band41	10MHz	QPSK	41540	25RB#25	20.52	PASS
Band41	10MHz	16QAM	41540	25RB#25	19.78	PASS
Band41	10MHz	QPSK	41540	50RB#0	20.48	PASS
Band41	10MHz	16QAM	41540	50RB#0	19.70	PASS
Band41	15MHz	QPSK	39725	1RB#0	22.02	PASS
Band41	15MHz	16QAM	39725	1RB#0	21.33	PASS
Band41	15MHz	QPSK	39725	1RB#38	22.00	PASS
Band41	15MHz	16QAM	39725	1RB#38	21.48	PASS
Band41	15MHz	QPSK	39725	1RB#74	22.35	PASS
Band41	15MHz	16QAM	39725	1RB#74	21.72	PASS
Band41	15MHz	QPSK	39725	38RB#0	21.23	PASS
Band41	15MHz	16QAM	39725	38RB#0	21.22	PASS
Band41	15MHz	QPSK	39725	38RB#18	21.22	PASS
Band41	15MHz	16QAM	39725	38RB#18	21.21	PASS
Band41	15MHz	QPSK	39725	38RB#37	21.54	PASS
Band41	15MHz	16QAM	39725	38RB#37	21.53	PASS
Band41	15MHz	QPSK	39725	75RB#0	21.53	PASS
Band41	15MHz	16QAM	39725	75RB#0	20.83	PASS
Band41	15MHz	QPSK	40620	1RB#0	21.57	PASS
Band41	15MHz	16QAM	40620	1RB#0	21.20	PASS
Band41	15MHz	QPSK	40620	1RB#38	21.74	PASS
Band41	15MHz	16QAM	40620	1RB#38	21.41	PASS
Band41	15MHz	QPSK	40620	1RB#74	22.07	PASS
Band41	15MHz	16QAM	40620	1RB#74	21.63	PASS
Band41	15MHz	QPSK	40620	38RB#0	20.70	PASS
Band41	15MHz	16QAM	40620	38RB#0	20.70	PASS
Band41	15MHz	QPSK	40620	38RB#18	20.43	PASS
Band41	15MHz	16QAM	40620	38RB#18	20.43	PASS
Band41	15MHz	QPSK	40620	38RB#37	20.43	PASS
Band41	15MHz	16QAM	40620	38RB#37	20.43	PASS
Band41	15MHz	QPSK	40620	75RB#0	20.43	PASS
Band41	15MHz	16QAM	40620	75RB#0	19.80	PASS
Band41	15MHz	QPSK	41515	1RB#0	21.60	PASS
Band41	15MHz	16QAM	41515	1RB#0	21.27	PASS
Band41	15MHz	QPSK	41515	1RB#38	21.68	PASS
Band41	15MHz	16QAM	41515	1RB#38	21.40	PASS
Band41	15MHz	QPSK	41515	1RB#74	21.78	PASS
Band41	15MHz	16QAM	41515	1RB#74	21.44	PASS
Band41	15MHz	QPSK	41515	38RB#0	20.66	PASS
Band41	15MHz	16QAM	41515	38RB#0	20.66	PASS





Band41	15MHz	QPSK	41515	38RB#18	20.66	PASS
Band41	15MHz	16QAM	41515	38RB#18	20.66	PASS
Band41	15MHz	QPSK	41515	38RB#37	20.66	PASS
Band41	15MHz	16QAM	41515	38RB#37	20.66	PASS
Band41	15MHz	QPSK	41515	75RB#0	20.66	PASS
Band41	15MHz	16QAM	41515	75RB#0	19.96	PASS
Band41	20MHz	QPSK	39750	1RB#0	22.00	PASS
Band41	20MHz	16QAM	39750	1RB#0	21.43	PASS
Band41	20MHz	QPSK	39750	1RB#49	22.26	PASS
Band41	20MHz	16QAM	39750	1RB#49	21.53	PASS
Band41	20MHz	QPSK	39750	1RB#99	22.61	PASS
Band41	20MHz	16QAM	39750	1RB#99	22.00	PASS
Band41	20MHz	QPSK	39750	50RB#0	21.51	PASS
Band41	20MHz	16QAM	39750	50RB#0	20.88	PASS
Band41	20MHz	QPSK	39750	50RB#25	21.51	PASS
Band41	20MHz	16QAM	39750	50RB#25	20.88	PASS
Band41	20MHz	QPSK	39750	50RB#50	21.85	PASS
Band41	20MHz	16QAM	39750	50RB#50	21.25	PASS
Band41	20MHz	QPSK	39750	100RB#0	21.61	PASS
Band41	20MHz	16QAM	39750	100RB#0	20.98	PASS
Band41	20MHz	QPSK	40620	1RB#0	21.23	PASS
Band41	20MHz	16QAM	40620	1RB#0	20.95	PASS
Band41	20MHz	QPSK	40620	1RB#49	21.35	PASS
Band41	20MHz	16QAM	40620	1RB#49	21.23	PASS
Band41	20MHz	QPSK	40620	1RB#99	21.80	PASS
Band41	20MHz	16QAM	40620	1RB#99	21.55	PASS
Band41	20MHz	QPSK	40620	50RB#0	20.57	PASS
Band41	20MHz	16QAM	40620	50RB#0	19.96	PASS
Band41	20MHz	QPSK	40620	50RB#25	20.61	PASS
Band41	20MHz	16QAM	40620	50RB#25	19.96	PASS
Band41	20MHz	QPSK	40620	50RB#50	20.98	PASS
Band41	20MHz	16QAM	40620	50RB#50	20.28	PASS
Band41	20MHz	QPSK	40620	100RB#0	20.74	PASS
Band41	20MHz	16QAM	40620	100RB#0	20.00	PASS
Band41	20MHz	QPSK	41490	1RB#0	21.21	PASS
Band41	20MHz	16QAM	41490	1RB#0	21.15	PASS
Band41	20MHz	QPSK	41490	1RB#49	21.31	PASS
Band41	20MHz	16QAM	41490	1RB#49	21.33	PASS
Band41	20MHz	QPSK	41490	1RB#99	21.52	PASS
Band41	20MHz	16QAM	41490	1RB#99	21.48	PASS
Band41	20MHz	QPSK	41490	50RB#0	20.52	PASS
Band41	20MHz	16QAM	41490	50RB#0	19.76	PASS





Band41	20MHz	QPSK	41490	50RB#25	20.54	PASS
Band41	20MHz	16QAM	41490	50RB#25	19.77	PASS
Band41	20MHz	QPSK	41490	50RB#50	20.73	PASS
Band41	20MHz	16QAM	41490	50RB#50	20.04	PASS
Band41	20MHz	QPSK	41490	100RB#0	20.55	PASS
Band41	20MHz	16QAM	41490	100RB#0	19.75	PASS





Q.2 Peak-to-Average Ratio(CCDF)

Test Result

Band	Bandwidth	Modulation	Channel	RB Configuration	Result(dB)	Limit(dB)	Verdict
Band41	5MHz	QPSK	39675	1RB#0	8.17	13	PASS
Band41	5MHz	16QAM	39675	1RB#0	8.58	13	PASS
Band41	5MHz	QPSK	39675	25RB#0	9.01	13	PASS
Band41	5MHz	16QAM	39675	25RB#0	9.85	13	PASS
Band41	5MHz	QPSK	40620	1RB#0	8.78	13	PASS
Band41	5MHz	16QAM	40620	1RB#0	9.34	13	PASS
Band41	5MHz	QPSK	40620	25RB#0	9.21	13	PASS
Band41	5MHz	16QAM	40620	25RB#0	9.94	13	PASS
Band41	5MHz	QPSK	41565	1RB#0	8.38	13	PASS
Band41	5MHz	16QAM	41565	1RB#0	8.86	13	PASS
Band41	5MHz	QPSK	41565	25RB#0	9.28	13	PASS
Band41	5MHz	16QAM	41565	25RB#0	9.80	13	PASS
Band41	10MHz	QPSK	39700	1RB#0	8.61	13	PASS
Band41	10MHz	16QAM	39700	1RB#0	8.45	13	PASS
Band41	10MHz	QPSK	39700	50RB#0	9.02	13	PASS
Band41	10MHz	16QAM	39700	50RB#0	9.55	13	PASS
Band41	10MHz	QPSK	40620	1RB#0	9.07	13	PASS
Band41	10MHz	16QAM	40620	1RB#0	9.49	13	PASS
Band41	10MHz	QPSK	40620	50RB#0	9.16	13	PASS
Band41	10MHz	16QAM	40620	50RB#0	9.93	13	PASS
Band41	10MHz	QPSK	41540	1RB#0	8.58	13	PASS
Band41	10MHz	16QAM	41540	1RB#0	8.81	13	PASS
Band41	10MHz	QPSK	41540	50RB#0	9.17	13	PASS
Band41	10MHz	16QAM	41540	50RB#0	9.92	13	PASS
Band41	15MHz	QPSK	39725	1RB#0	7.70	13	PASS
Band41	15MHz	16QAM	39725	1RB#0	8.03	13	PASS
Band41	15MHz	QPSK	39725	75RB#0	9.60	13	PASS
Band41	15MHz	16QAM	39725	75RB#0	9.93	13	PASS
Band41	15MHz	QPSK	40620	1RB#0	8.52	13	PASS
Band41	15MHz	16QAM	40620	1RB#0	9.07	13	PASS
Band41	15MHz	QPSK	40620	75RB#0	9.60	13	PASS
Band41	15MHz	16QAM	40620	75RB#0	10.00	13	PASS
Band41	15MHz	QPSK	41515	1RB#0	8.48	13	PASS
Band41	15MHz	16QAM	41515	1RB#0	9.05	13	PASS
Band41	15MHz	QPSK	41515	75RB#0	9.42	13	PASS
Band41	15MHz	16QAM	41515	75RB#0	10.12	13	PASS



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity




Band41	20MHz	QPSK	39750	1RB#0	8.04	13	PASS
Band41	20MHz	16QAM	39750	1RB#0	8.49	13	PASS
Band41	20MHz	QPSK	39750	100RB#0	9.28	13	PASS
Band41	20MHz	16QAM	39750	100RB#0	9.49	13	PASS
Band41	20MHz	QPSK	40620	1RB#0	8.39	13	PASS
Band41	20MHz	16QAM	40620	1RB#0	8.81	13	PASS
Band41	20MHz	QPSK	40620	100RB#0	9.23	13	PASS
Band41	20MHz	16QAM	40620	100RB#0	9.89	13	PASS
Band41	20MHz	QPSK	41490	1RB#0	8.07	13	PASS
Band41	20MHz	16QAM	41490	1RB#0	8.50	13	PASS
Band41	20MHz	QPSK	41490	100RB#0	9.30	13	PASS
Band41	20MHz	16QAM	41490	100RB#0	9.73	13	PASS





Test Graphs

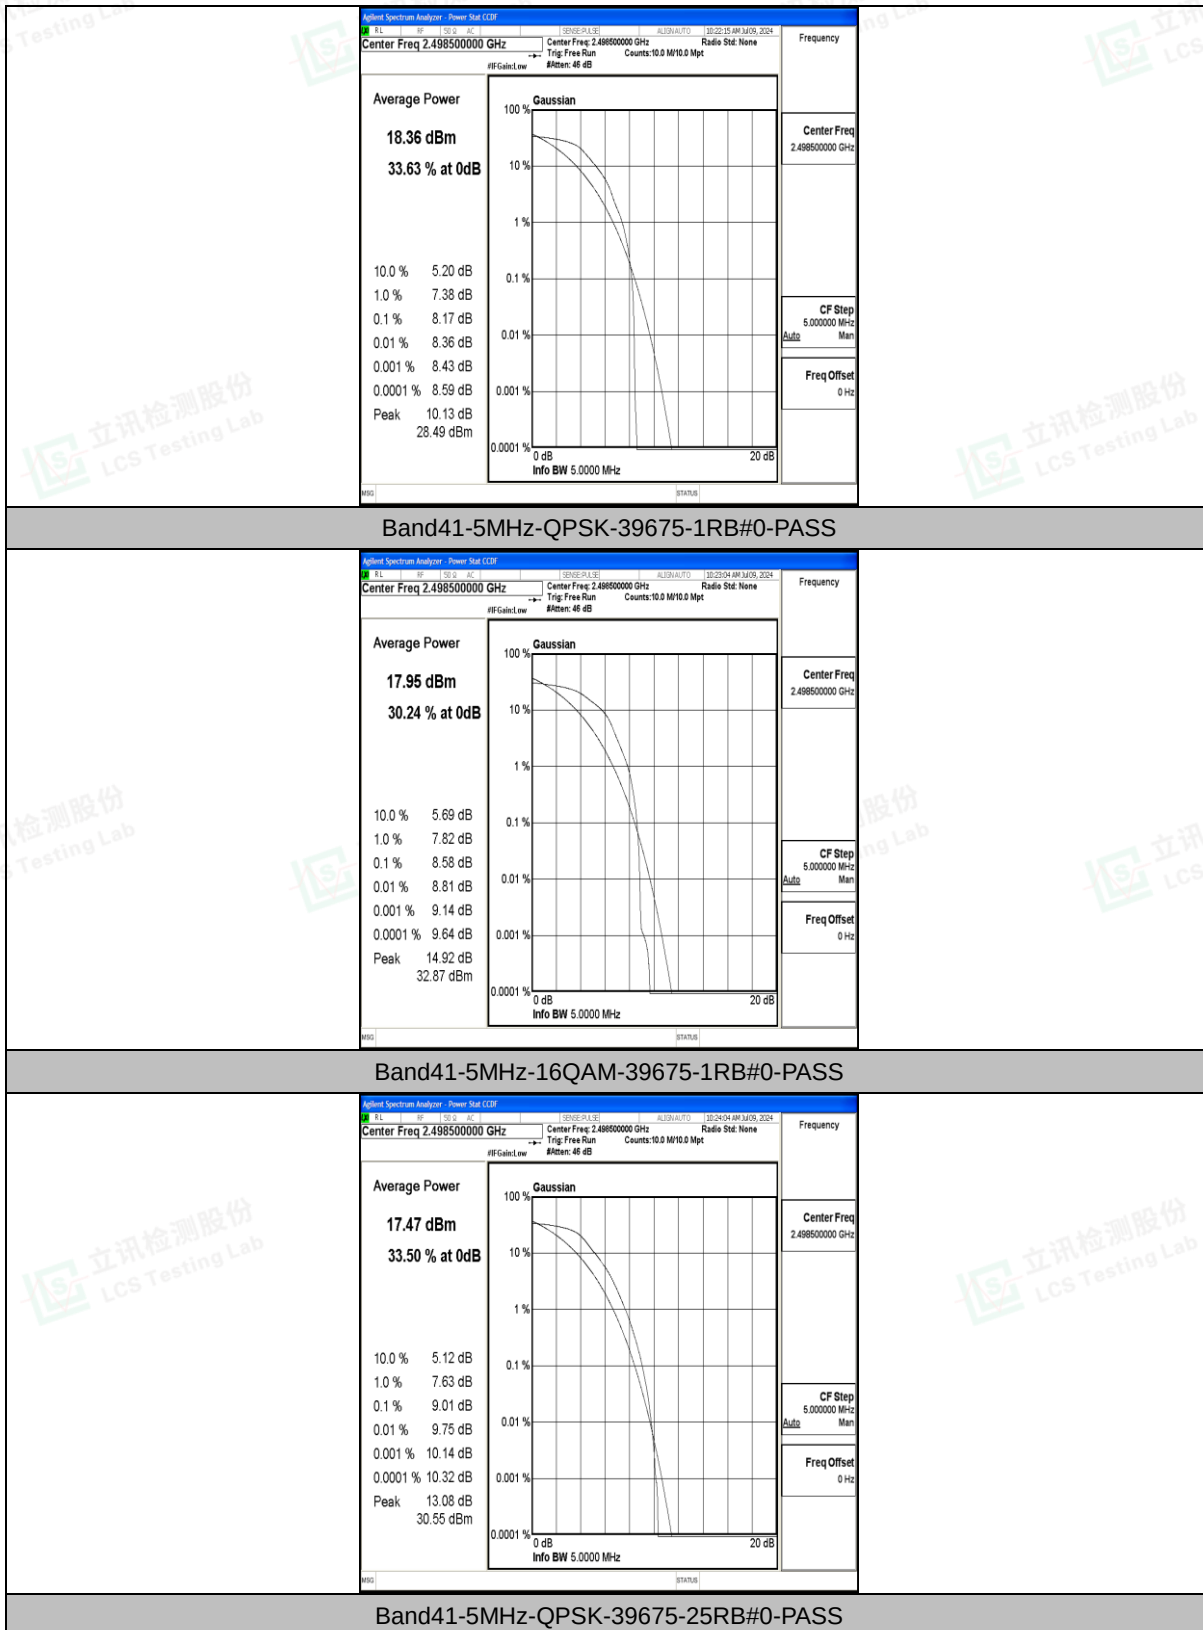


Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

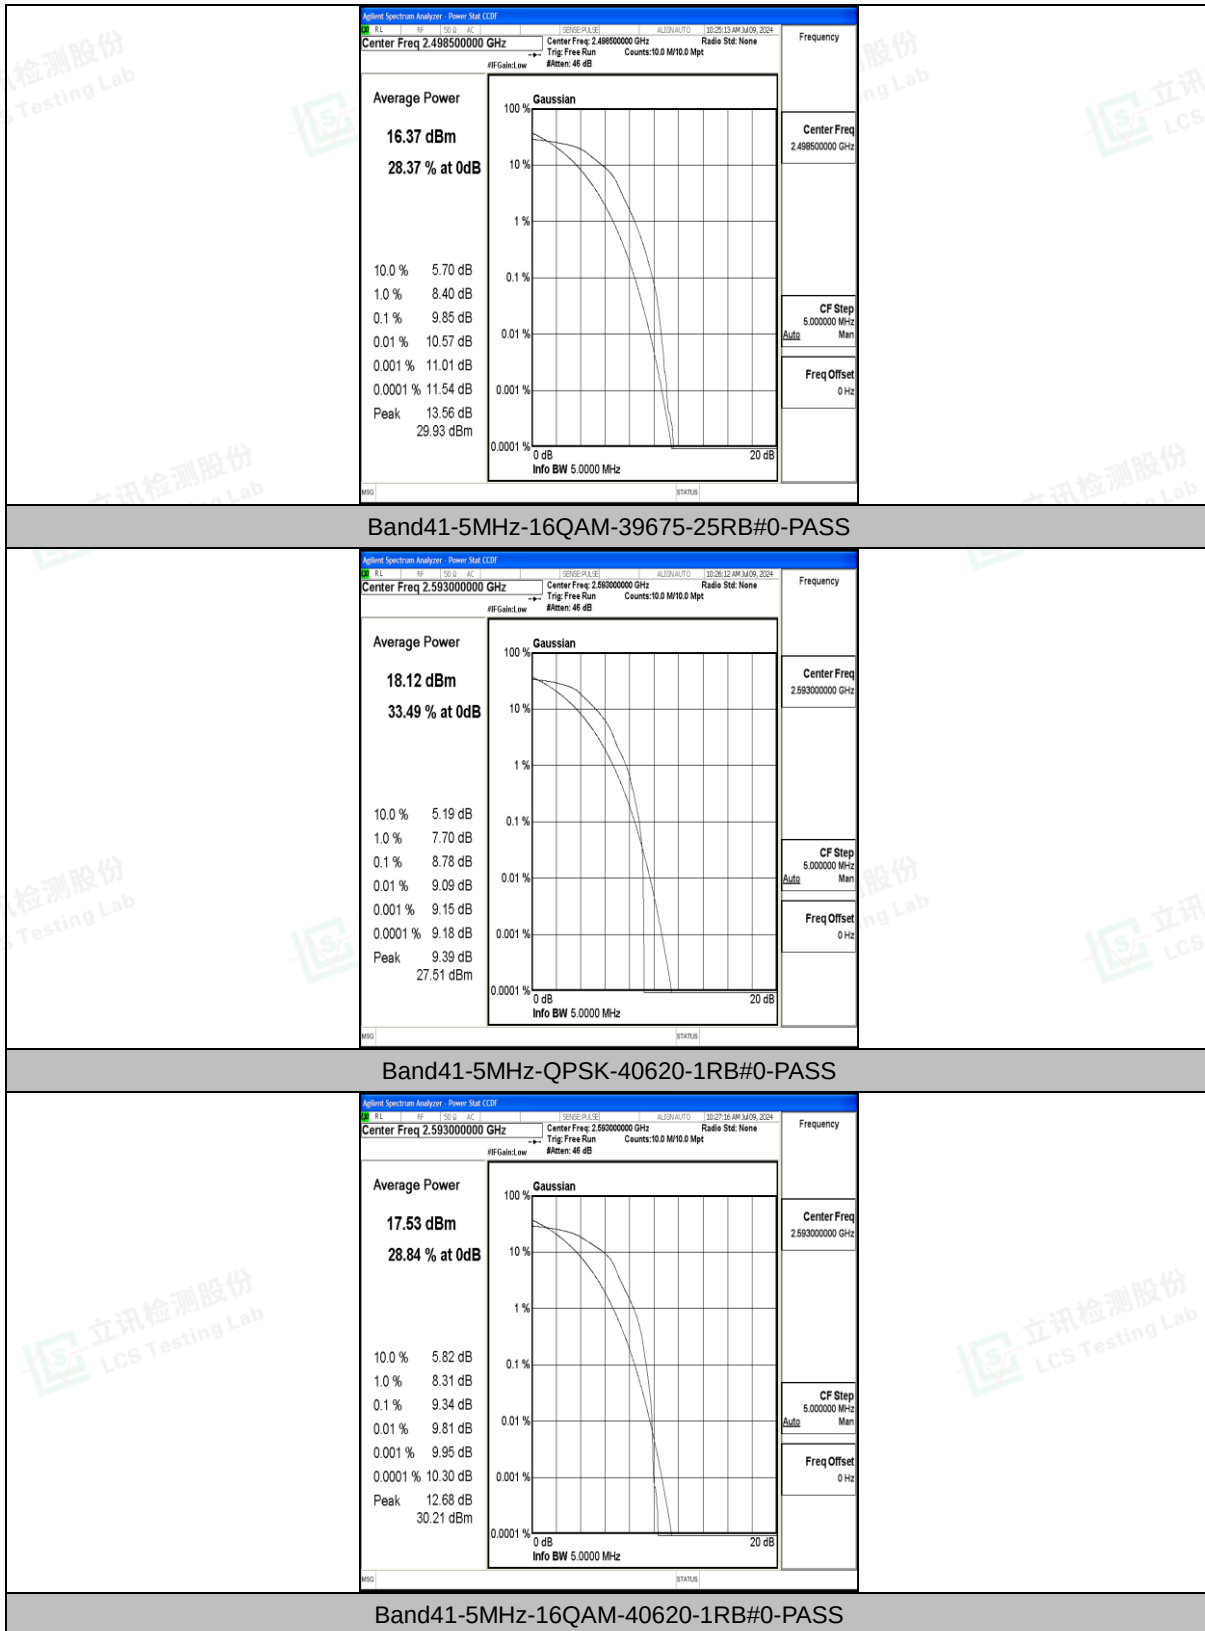


Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

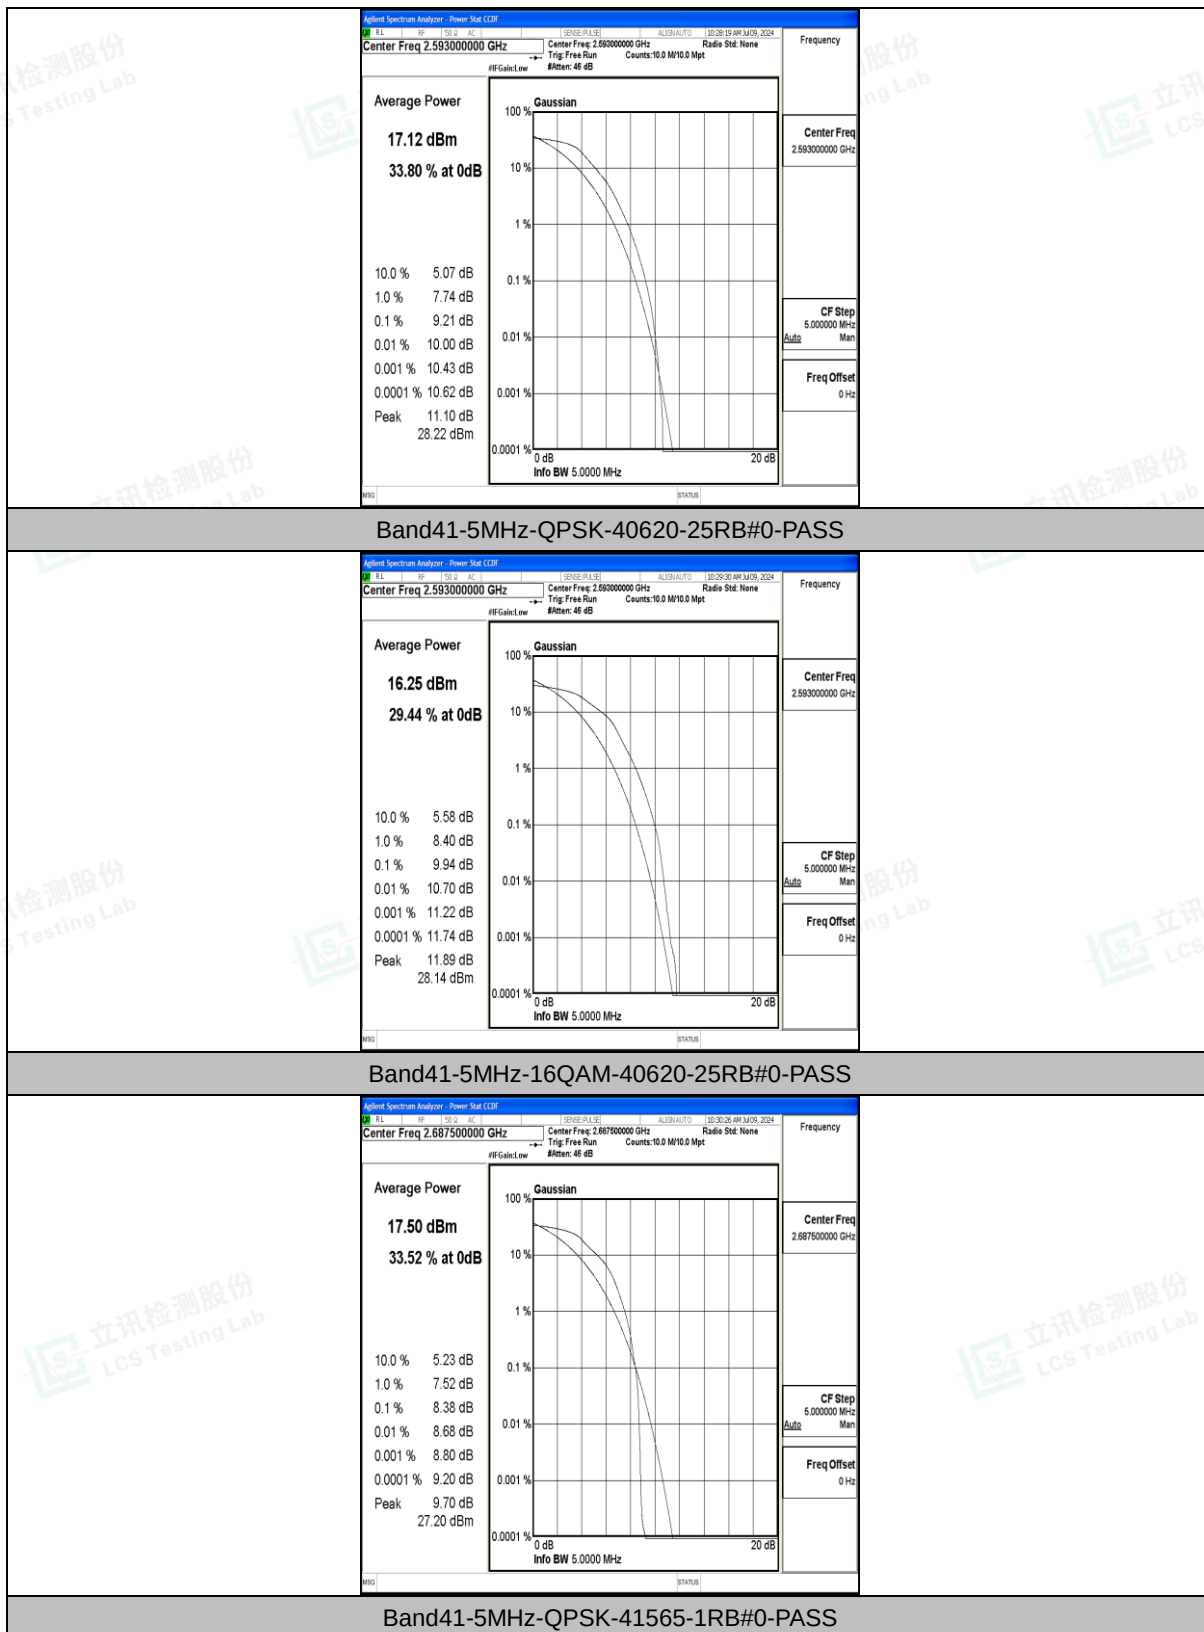


Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

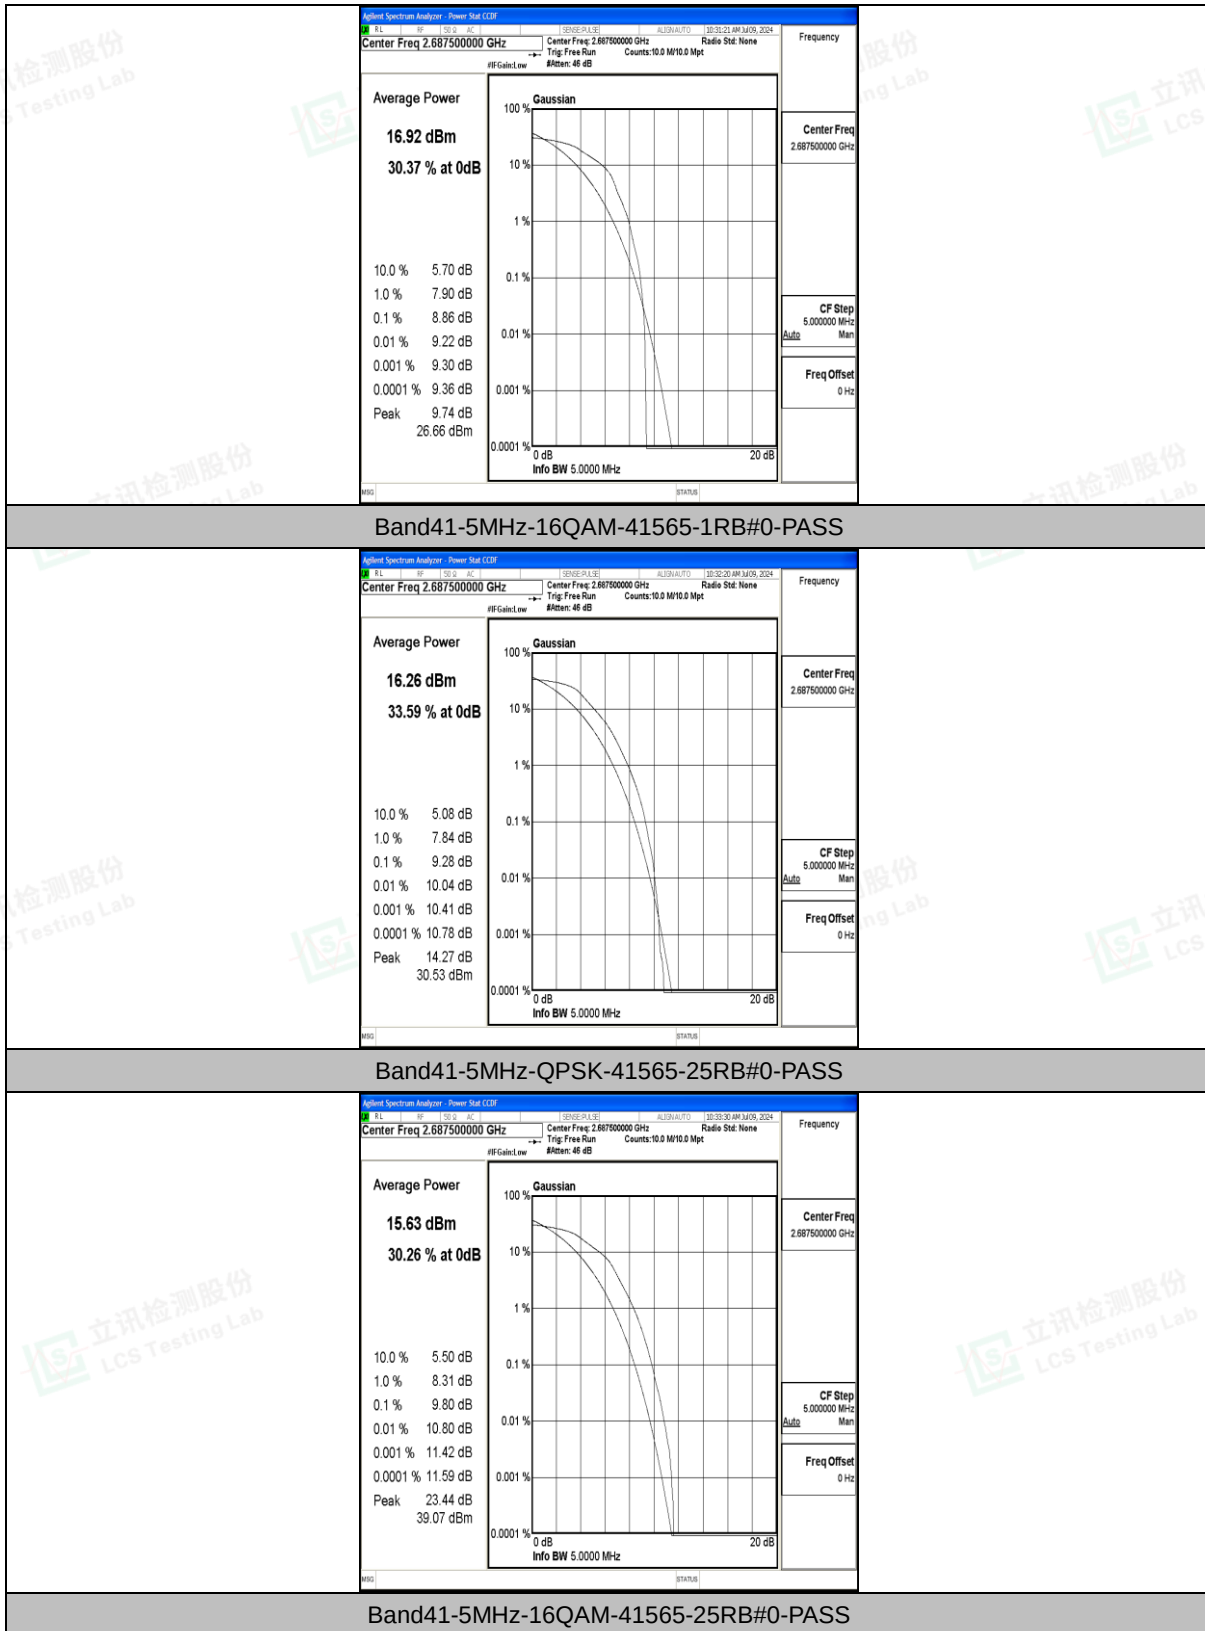

Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity




Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

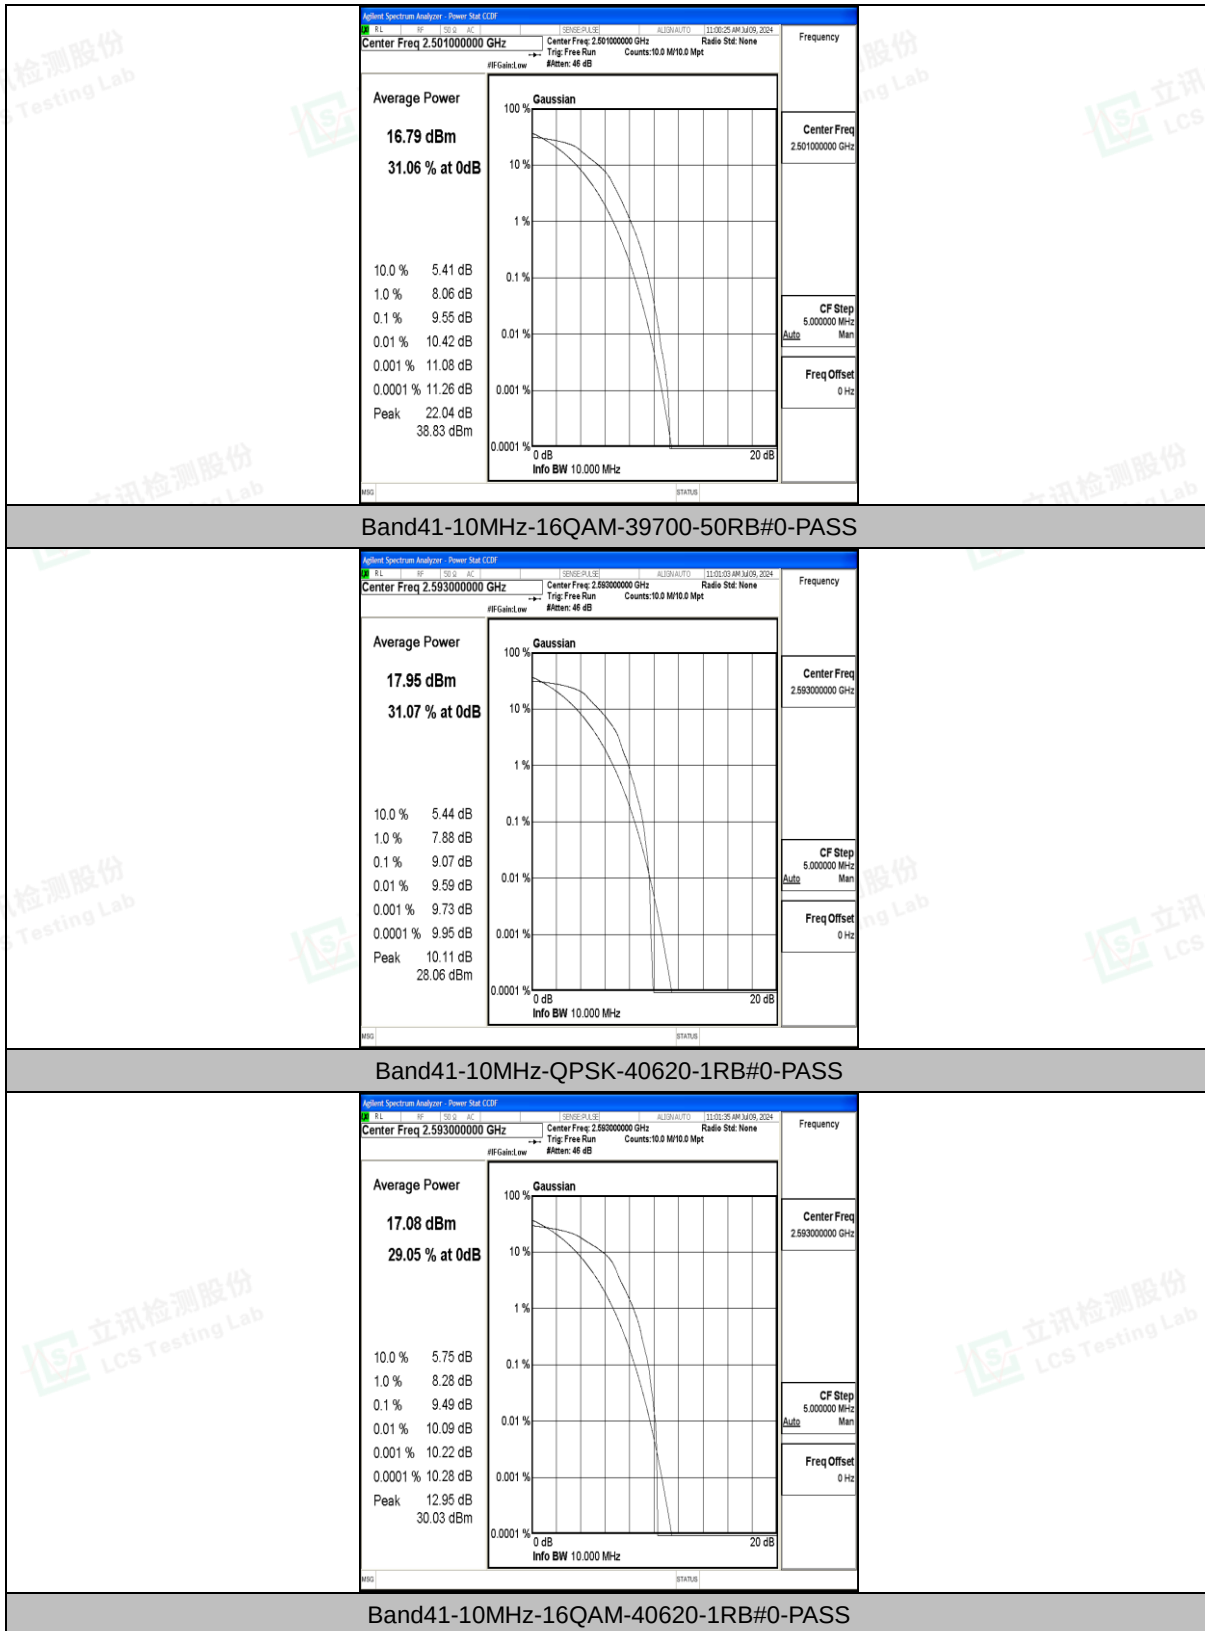


Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

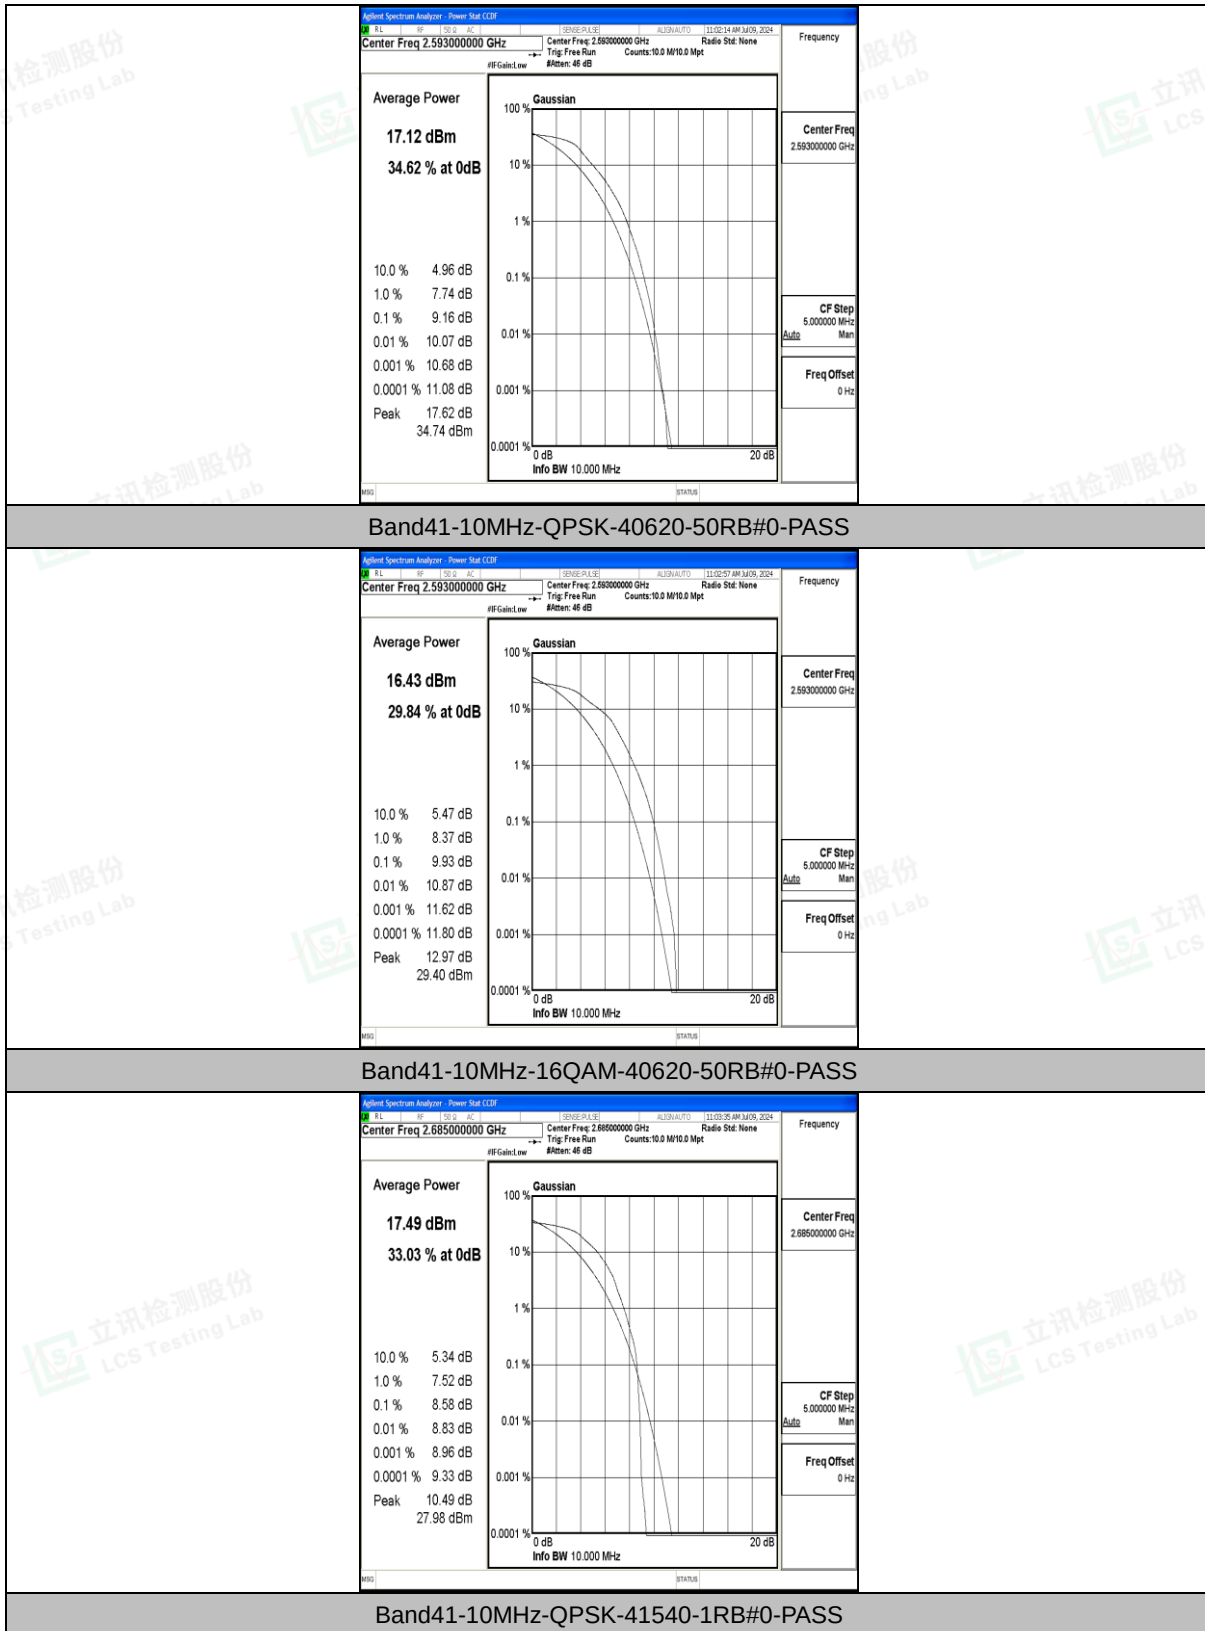


Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

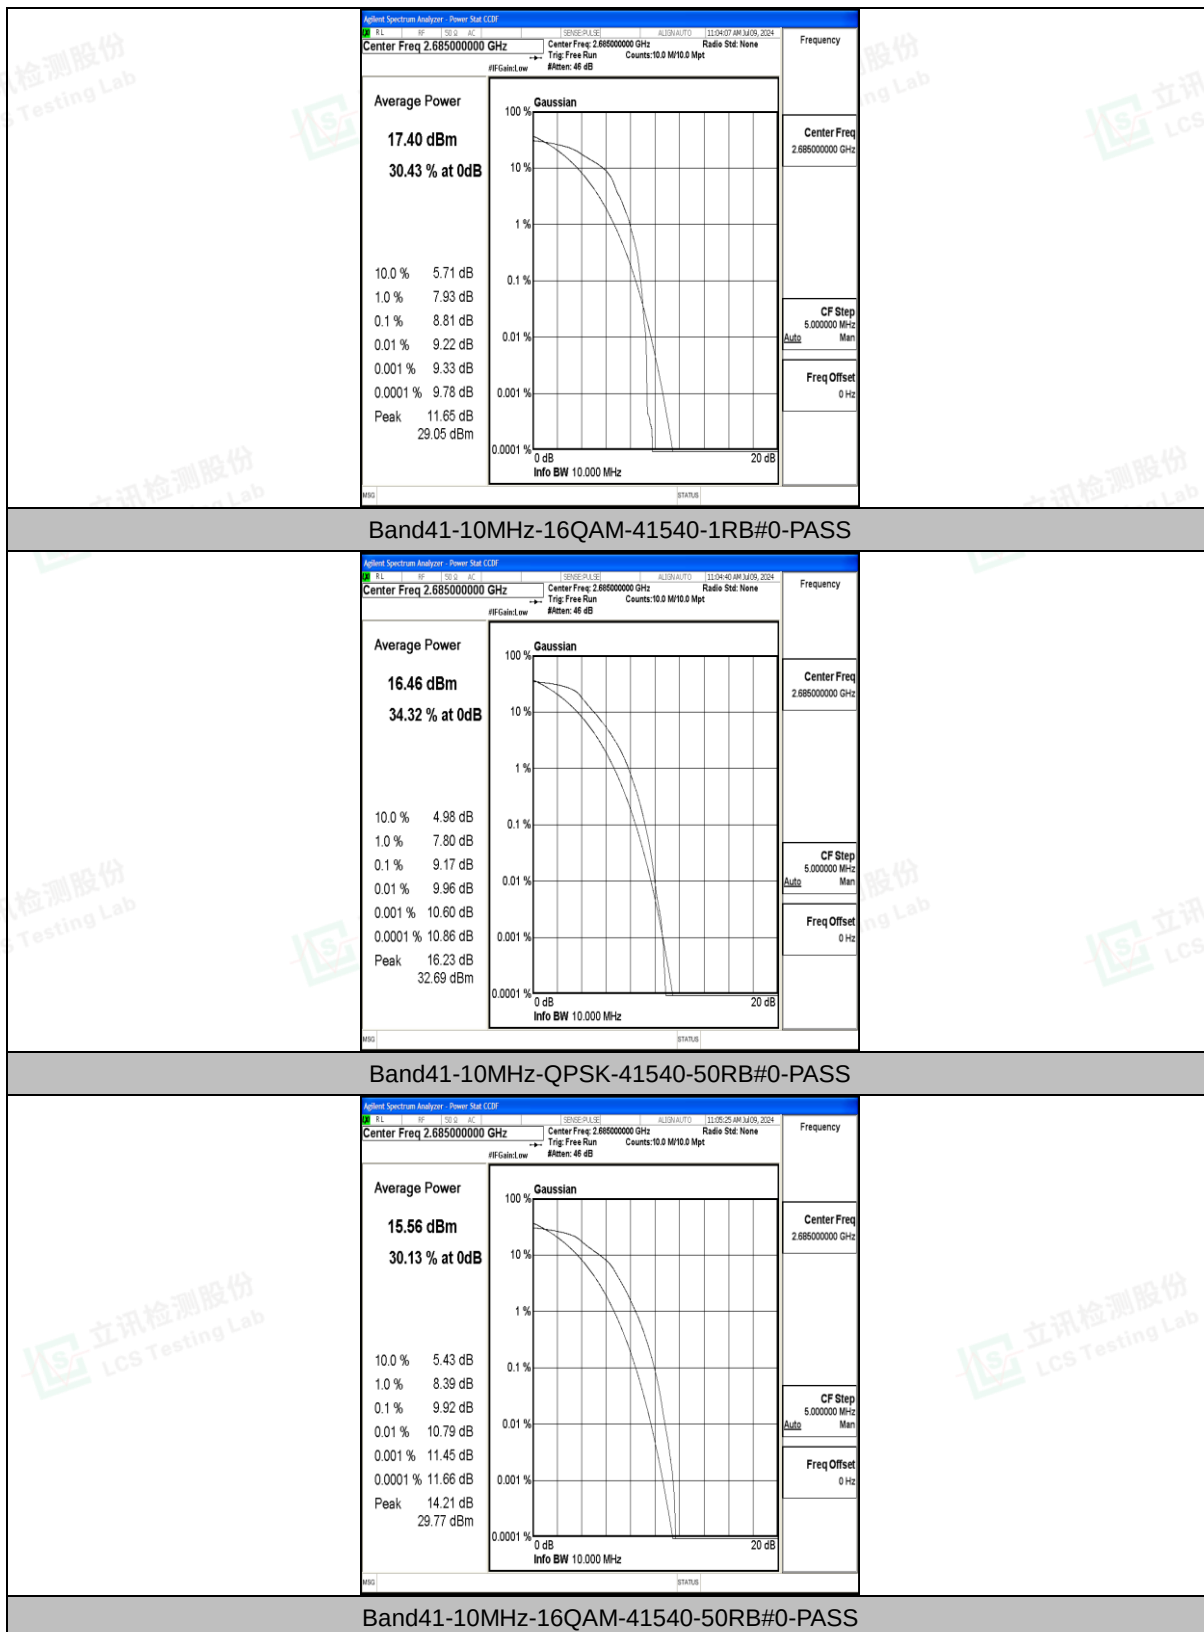


Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

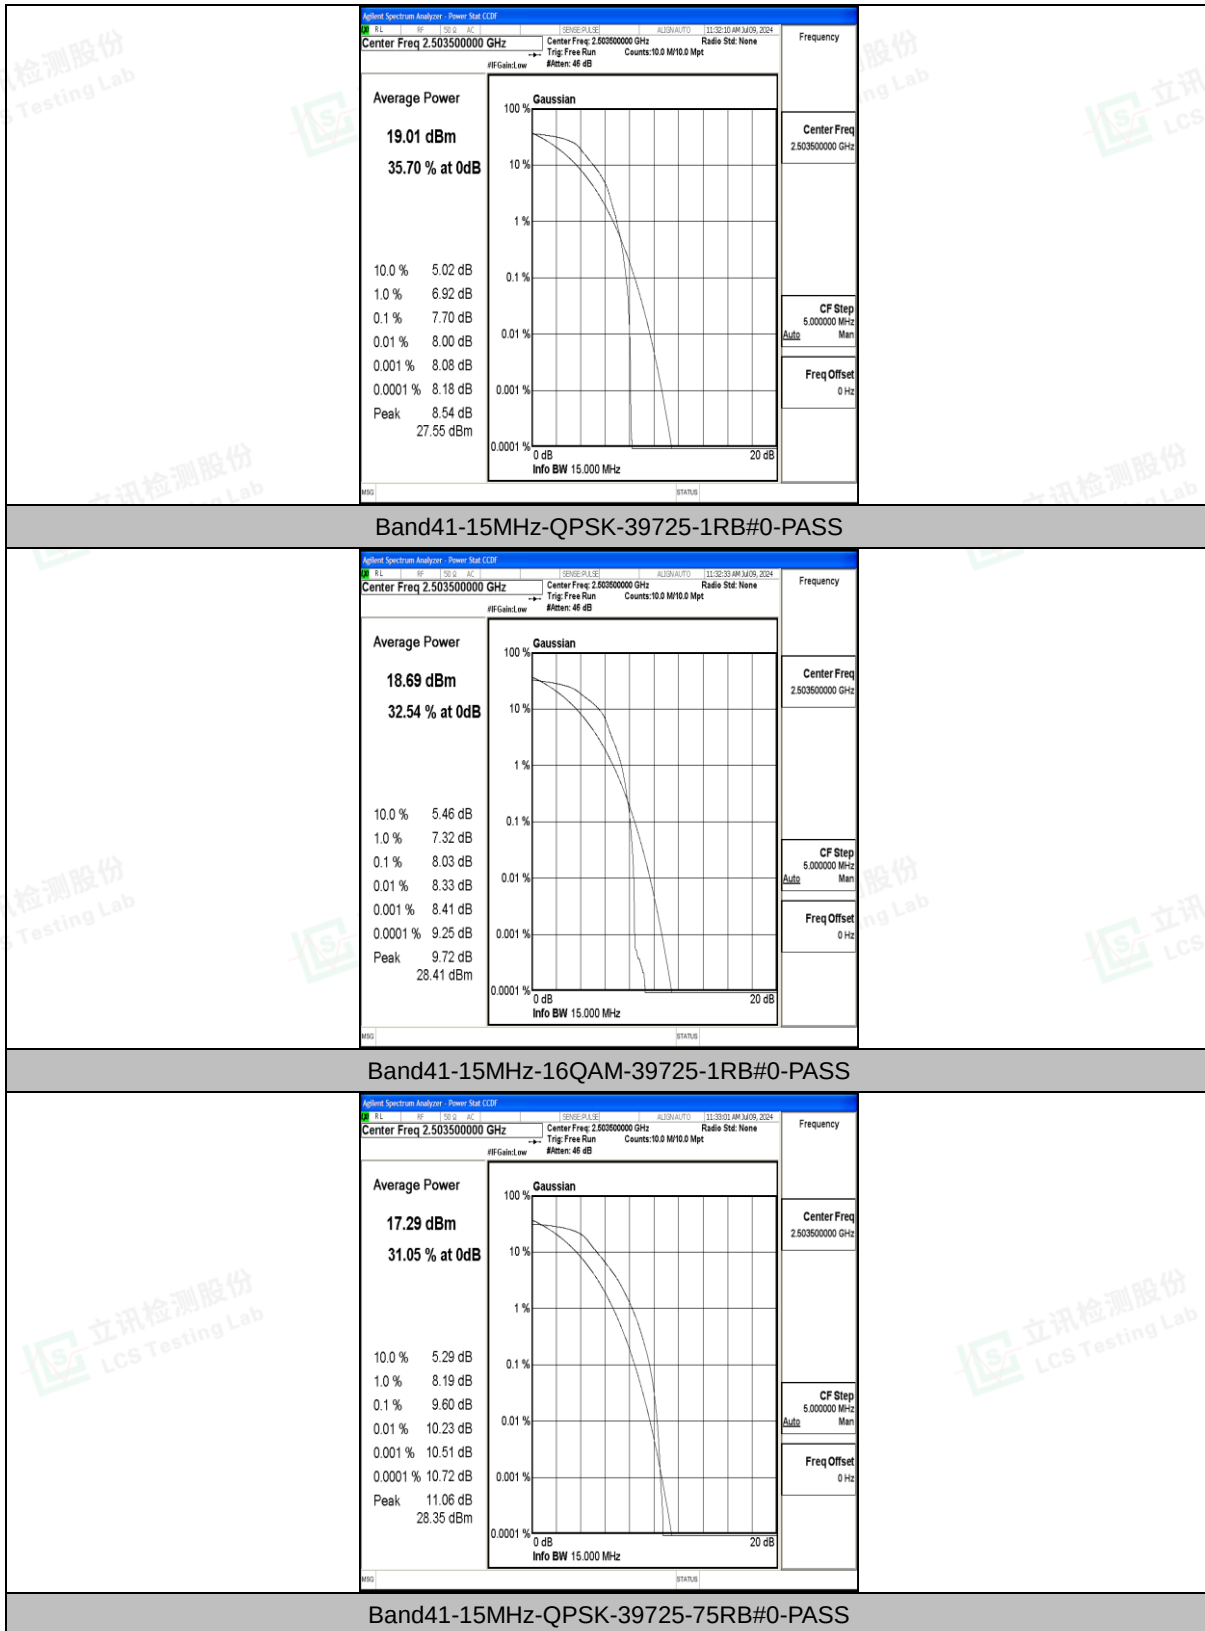


Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

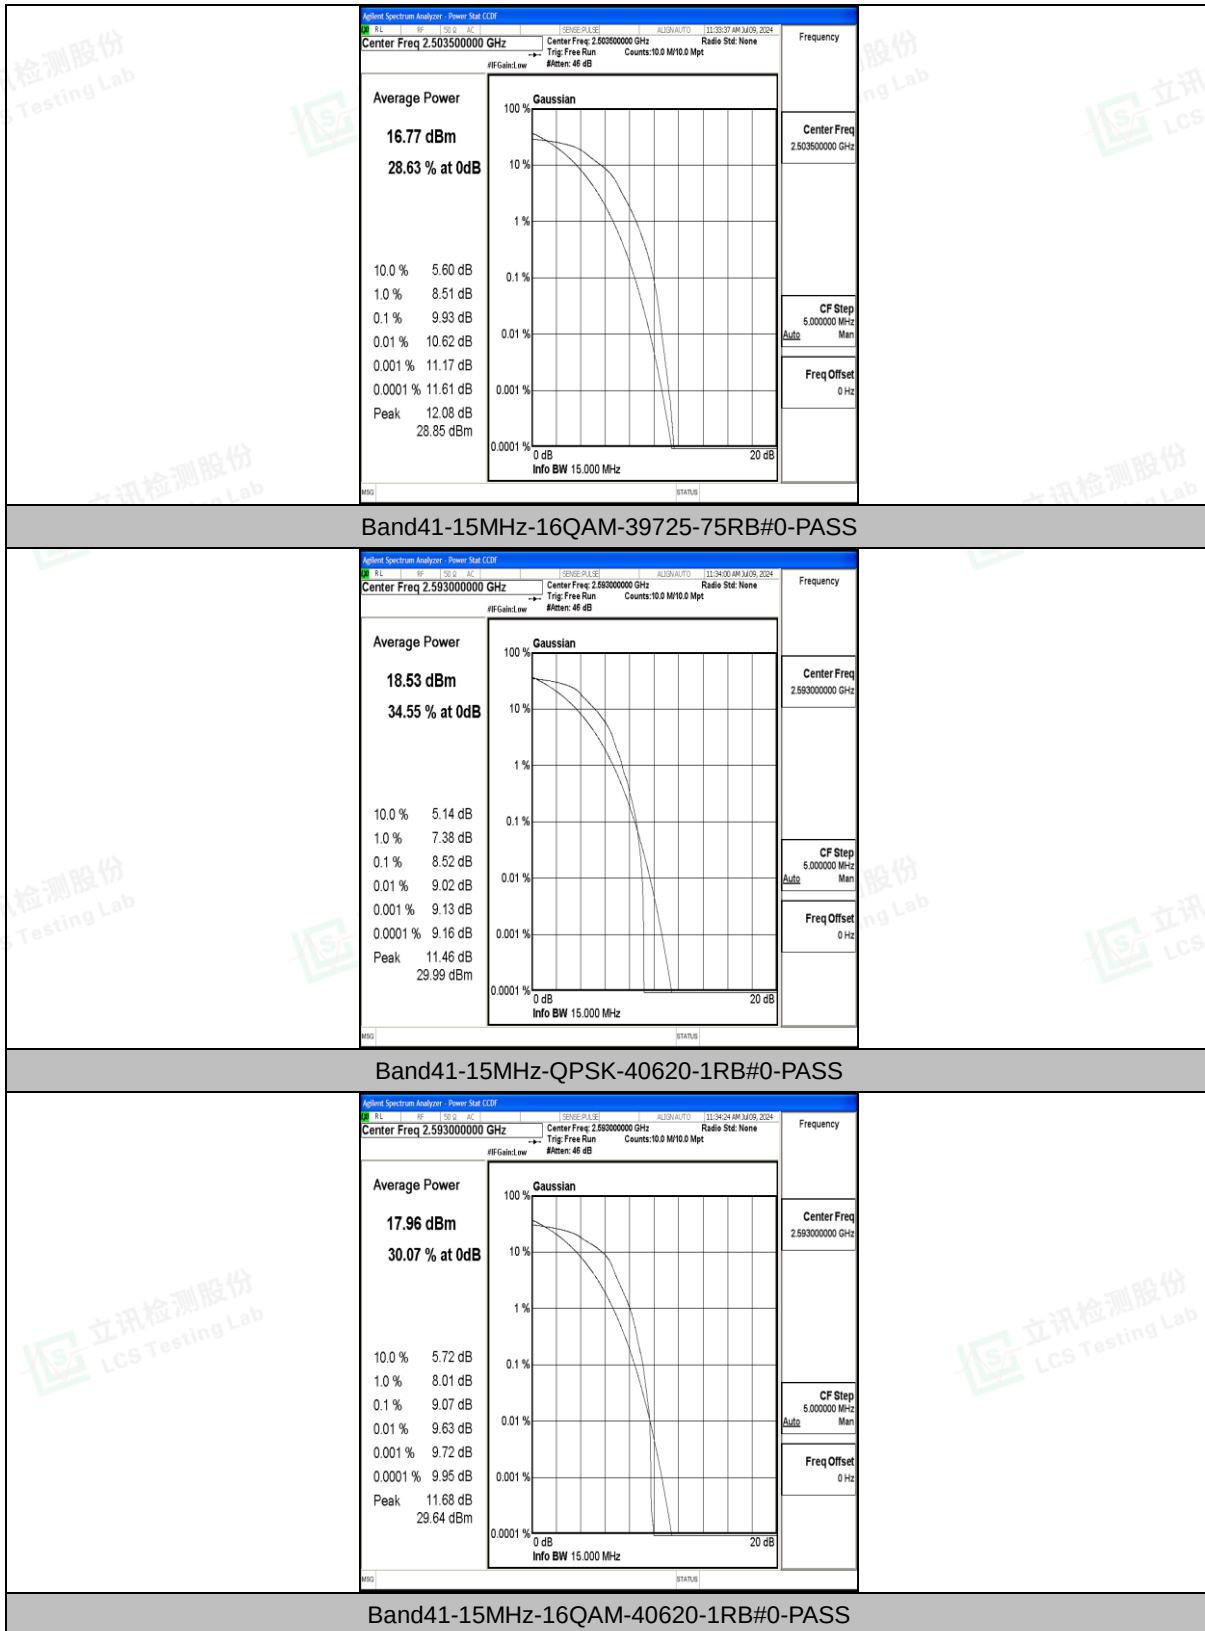


Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

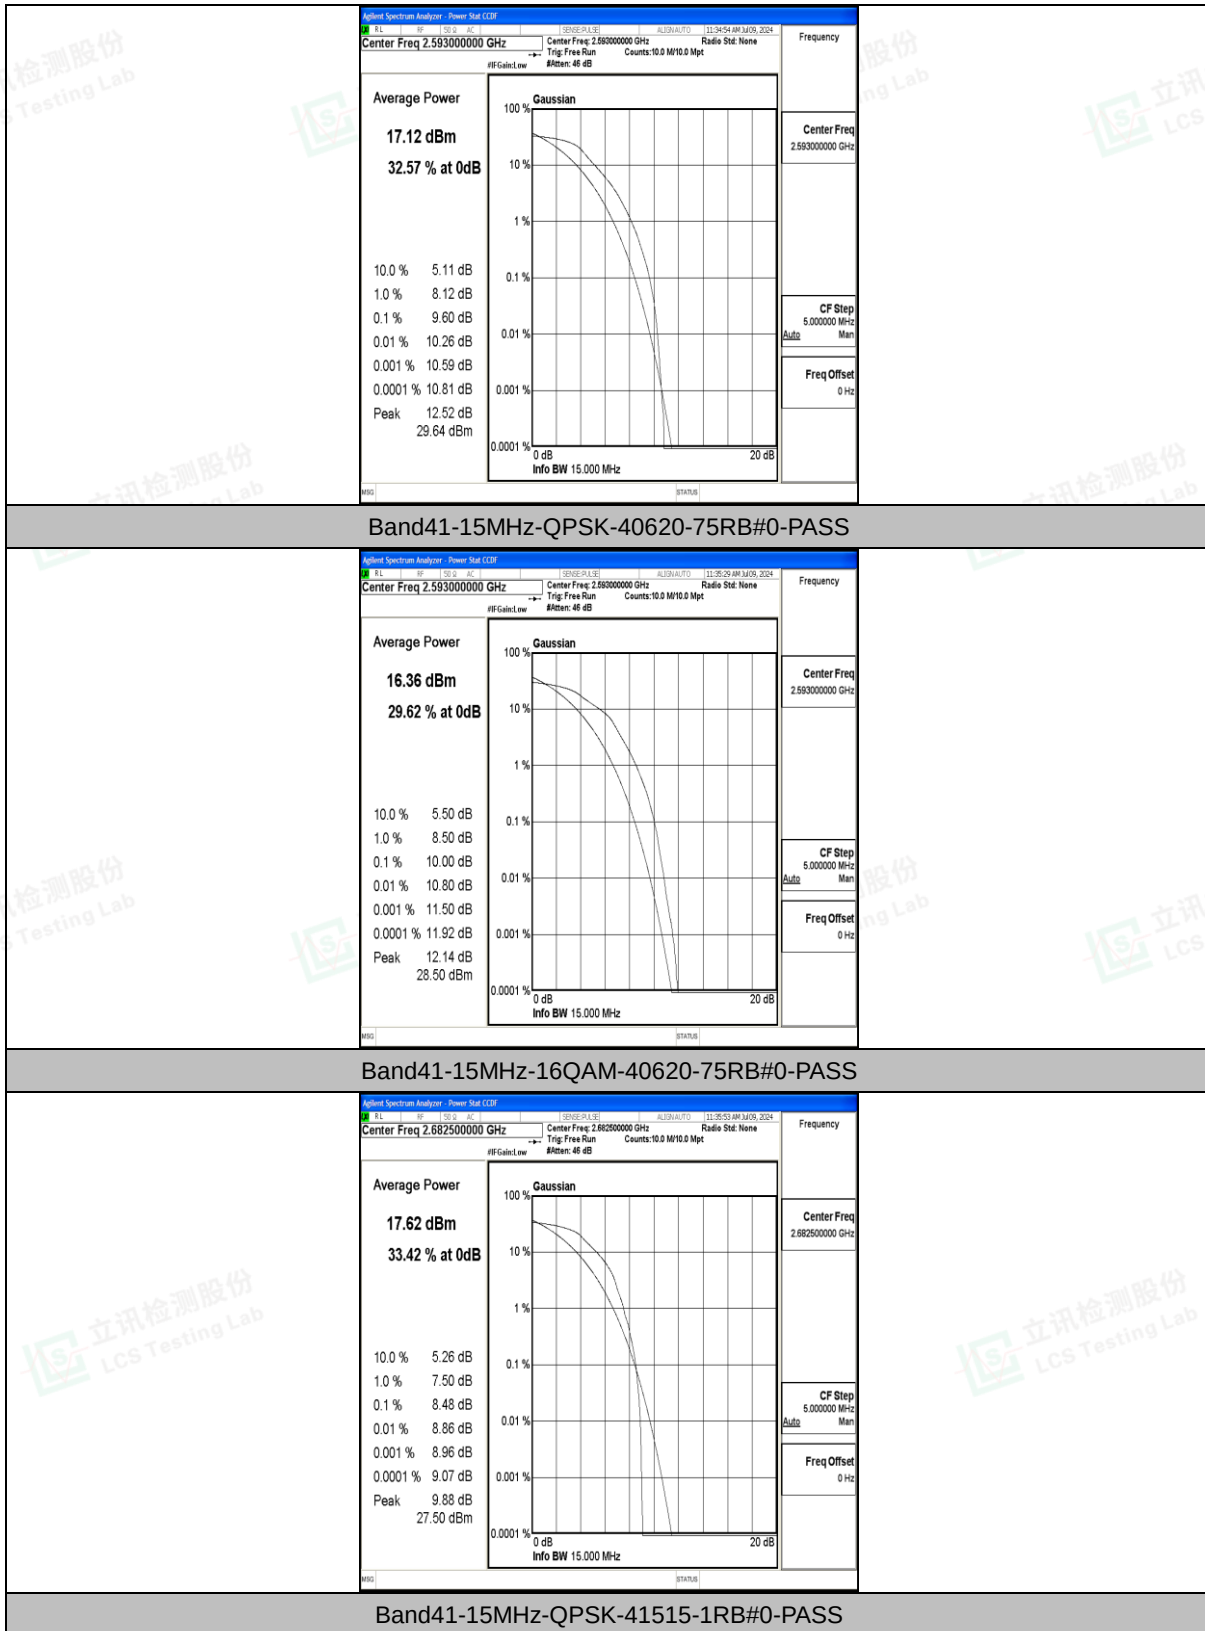

Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity




Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

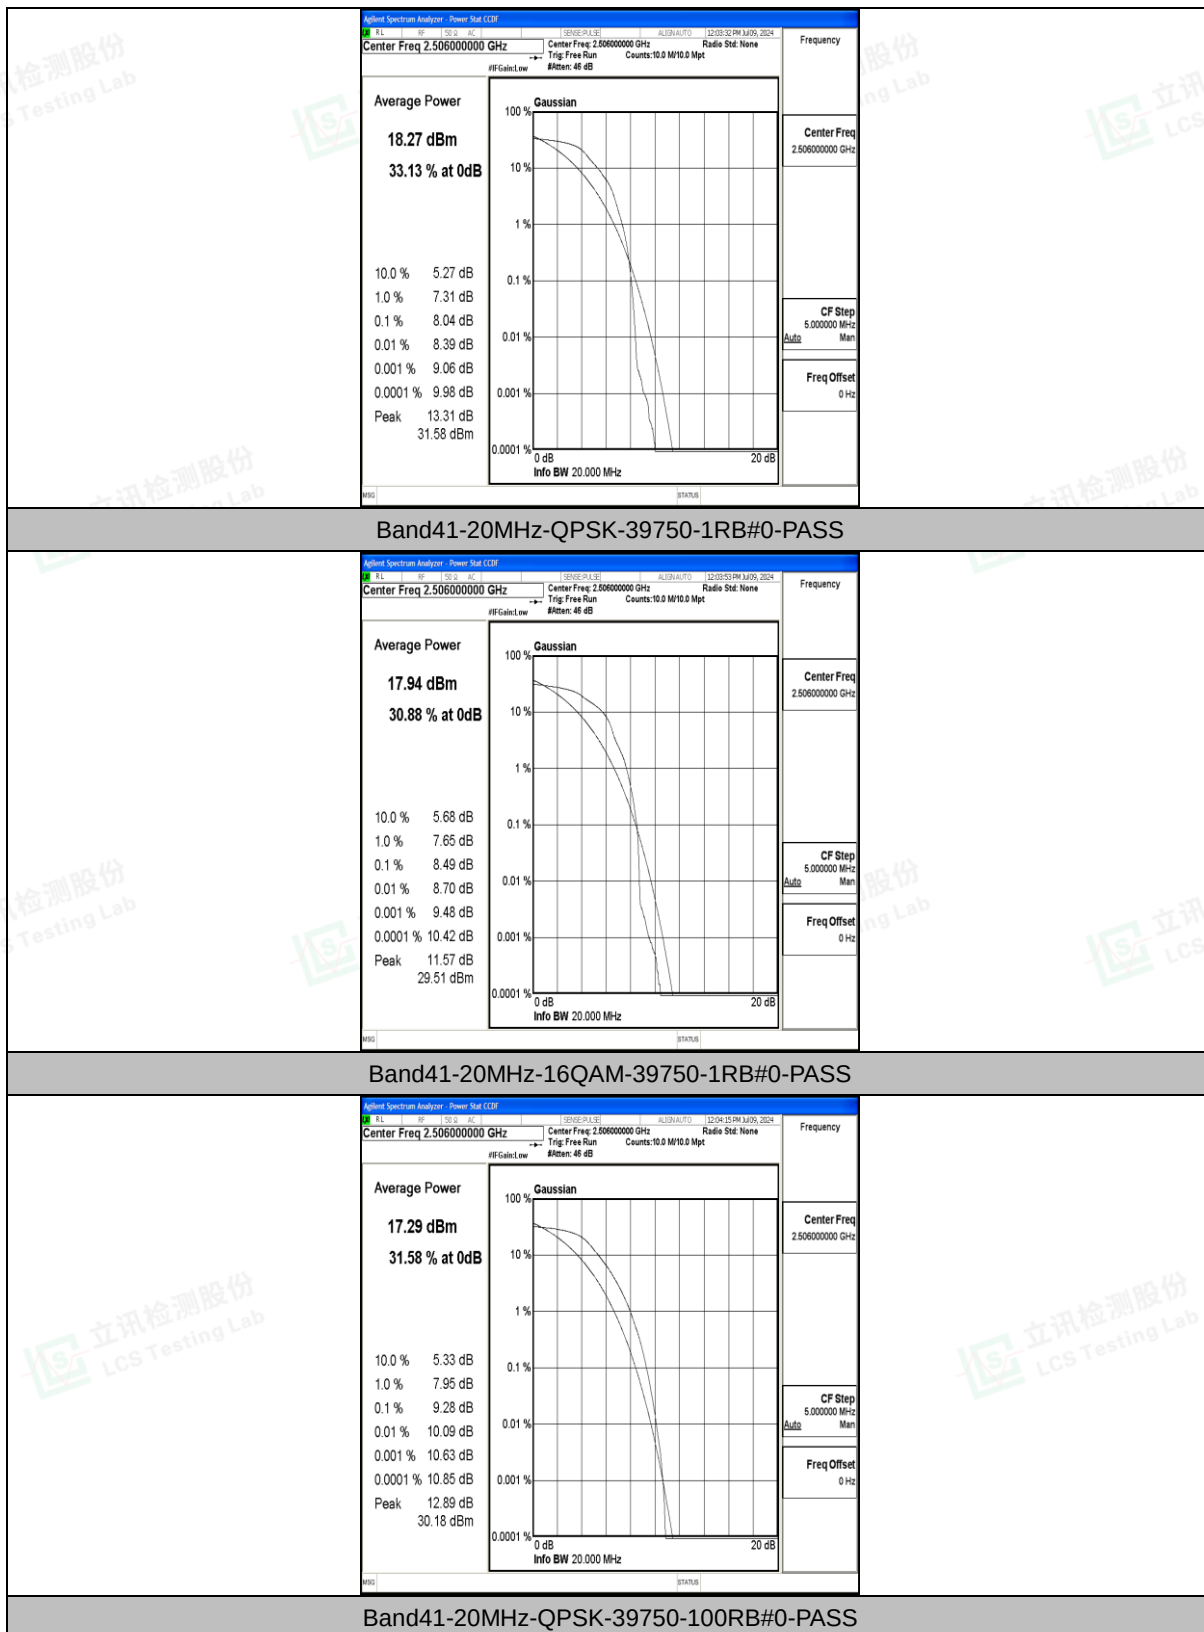


Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity

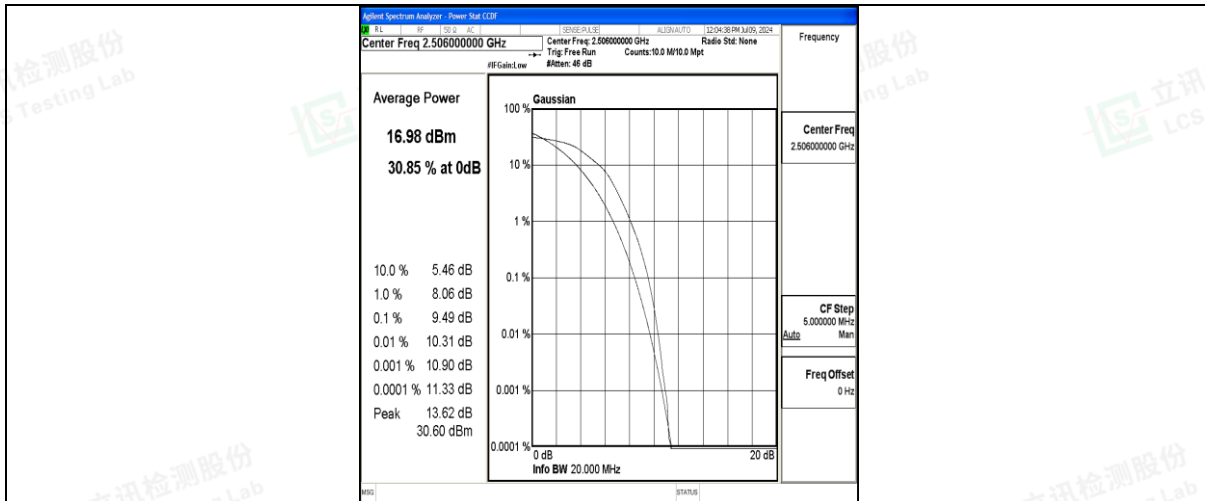

Band41-20MHz-16QAM-39750-100RB#0-PASS

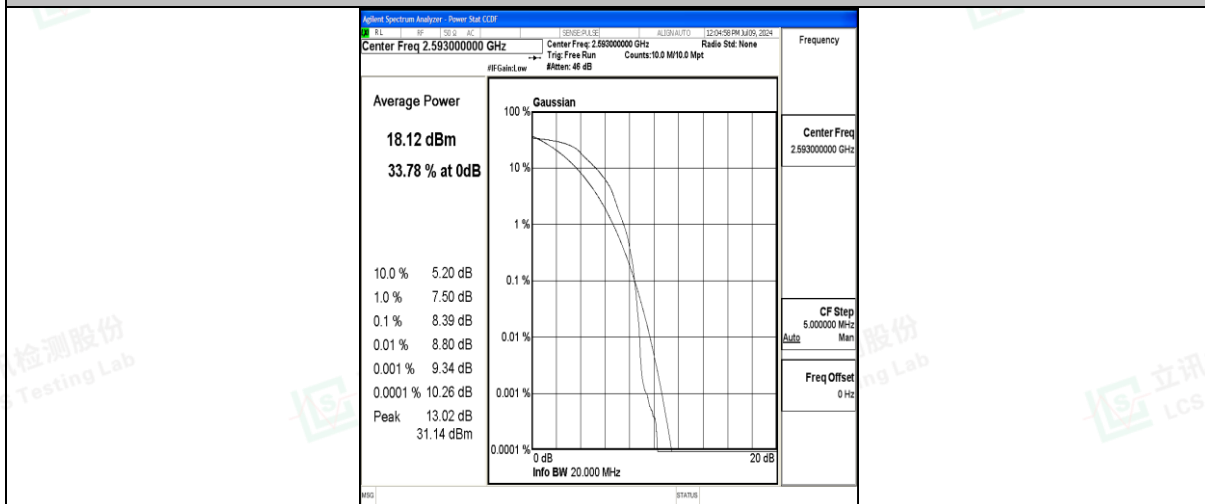

Band41-20MHz-QPSK-40620-1RB#0-PASS

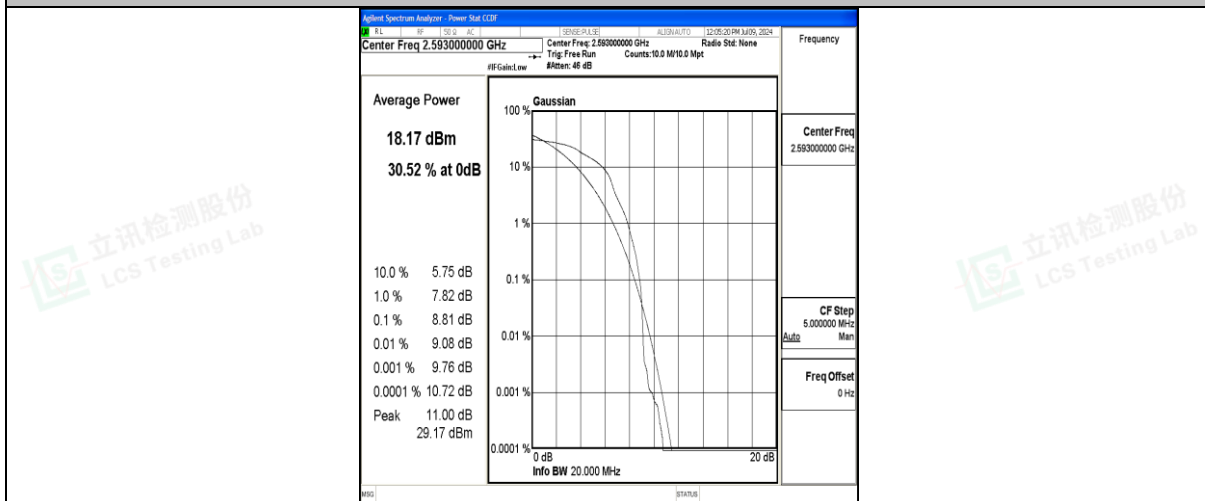

Band41-20MHz-16QAM-40620-1RB#0-PASS




Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

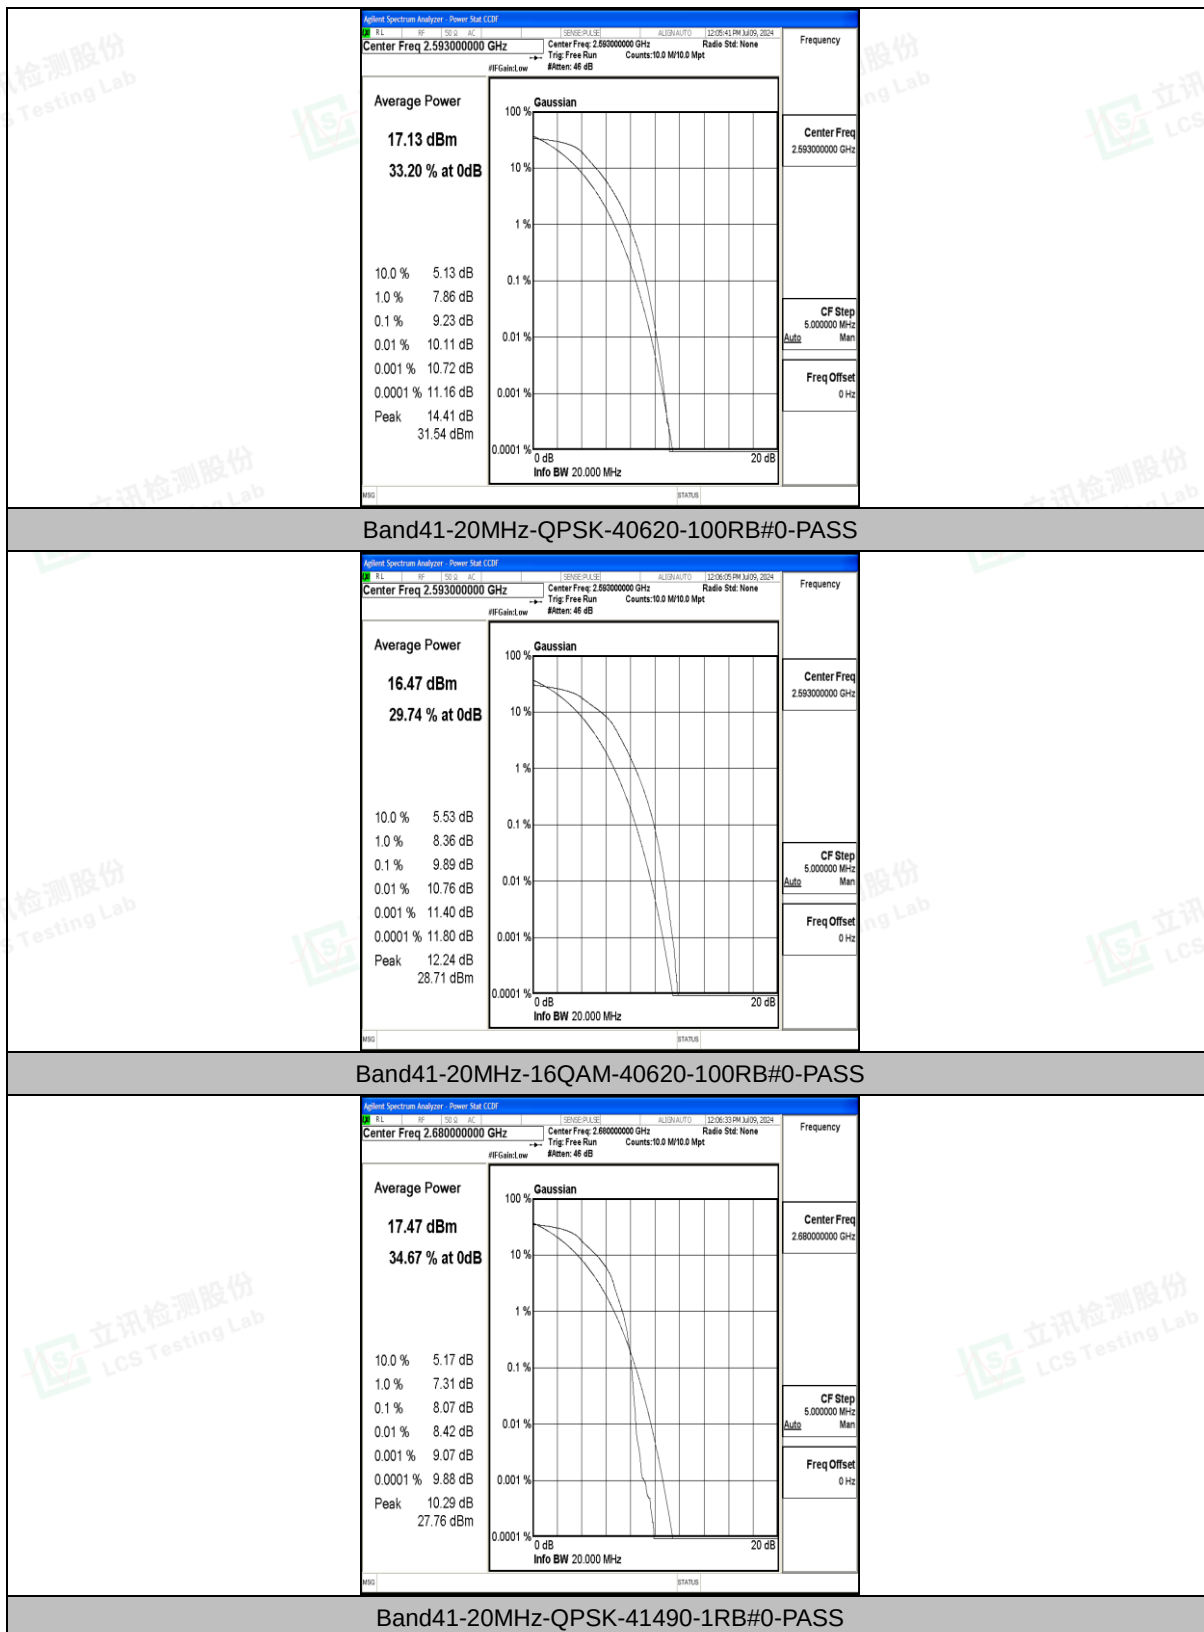


Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

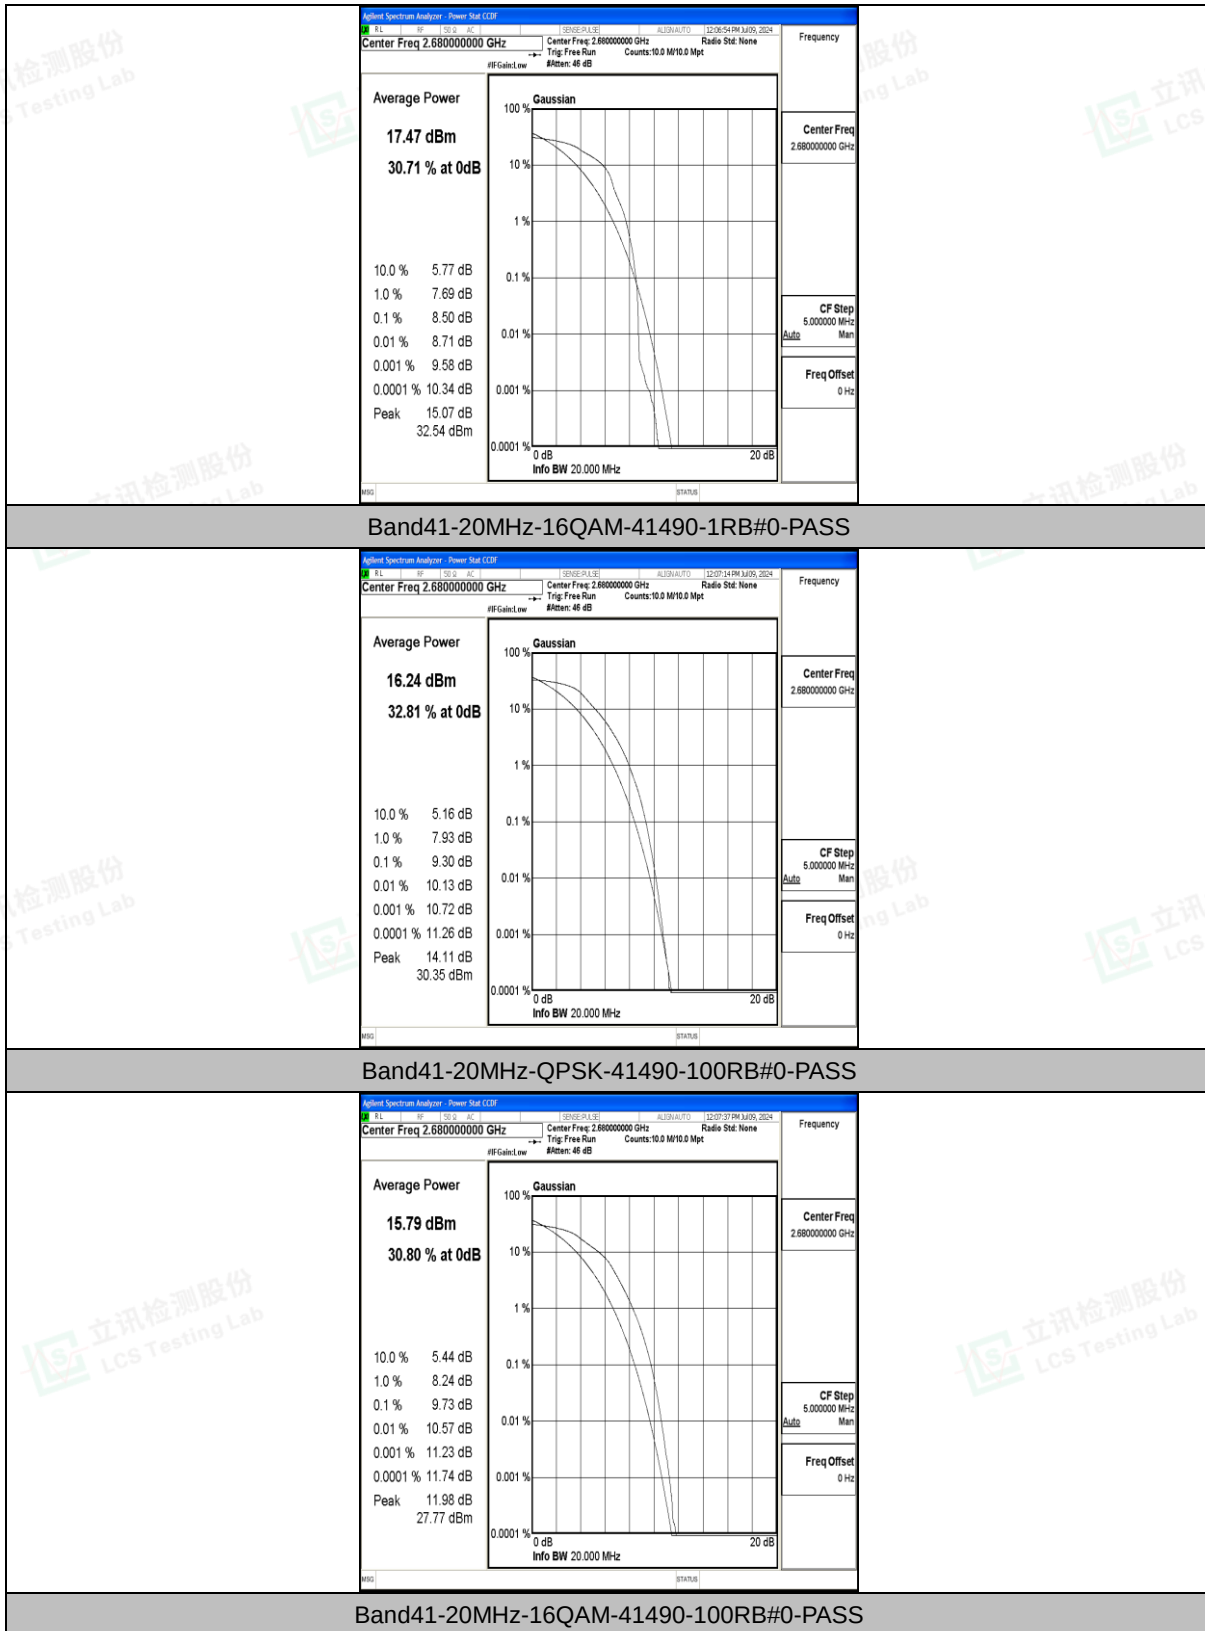

Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



Q.3 26dB Bandwidth and Occupied Bandwidth

Test Result

Band	Bandwidth	Modulation	Channel	RB Configuration	Occupied Bandwidth (MHz)	26dB Bandwidth (MHz)	Verdict
Band41	5MHz	QPSK	39675	25RB#0	4.5112	5.280	PASS
Band41	5MHz	16QAM	39675	25RB#0	4.5120	5.261	PASS
Band41	5MHz	QPSK	40620	25RB#0	4.5088	5.118	PASS
Band41	5MHz	16QAM	40620	25RB#0	4.5041	5.418	PASS
Band41	5MHz	QPSK	41565	25RB#0	4.4932	5.260	PASS
Band41	5MHz	16QAM	41565	25RB#0	4.5029	5.271	PASS
Band41	10MHz	QPSK	39700	50RB#0	9.0080	10.12	PASS
Band41	10MHz	16QAM	39700	50RB#0	8.9793	10.21	PASS
Band41	10MHz	QPSK	40620	50RB#0	9.0000	10.11	PASS
Band41	10MHz	16QAM	40620	50RB#0	9.0054	10.09	PASS
Band41	10MHz	QPSK	41540	50RB#0	9.0420	10.09	PASS
Band41	10MHz	16QAM	41540	50RB#0	9.0318	11.21	PASS
Band41	15MHz	QPSK	39725	75RB#0	13.524	16.29	PASS
Band41	15MHz	16QAM	39725	75RB#0	13.511	15.41	PASS
Band41	15MHz	QPSK	40620	75RB#0	13.517	15.74	PASS
Band41	15MHz	16QAM	40620	75RB#0	13.471	15.14	PASS
Band41	15MHz	QPSK	41515	75RB#0	13.497	15.56	PASS
Band41	15MHz	16QAM	41515	75RB#0	13.445	15.04	PASS
Band41	20MHz	QPSK	39750	100RB#0	18.040	20.65	PASS
Band41	20MHz	16QAM	39750	100RB#0	18.023	20.24	PASS
Band41	20MHz	QPSK	40620	100RB#0	17.999	20.40	PASS
Band41	20MHz	16QAM	40620	100RB#0	17.992	20.26	PASS
Band41	20MHz	QPSK	41490	100RB#0	18.008	20.06	PASS
Band41	20MHz	16QAM	41490	100RB#0	17.990	20.21	PASS





Test Graphs



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity

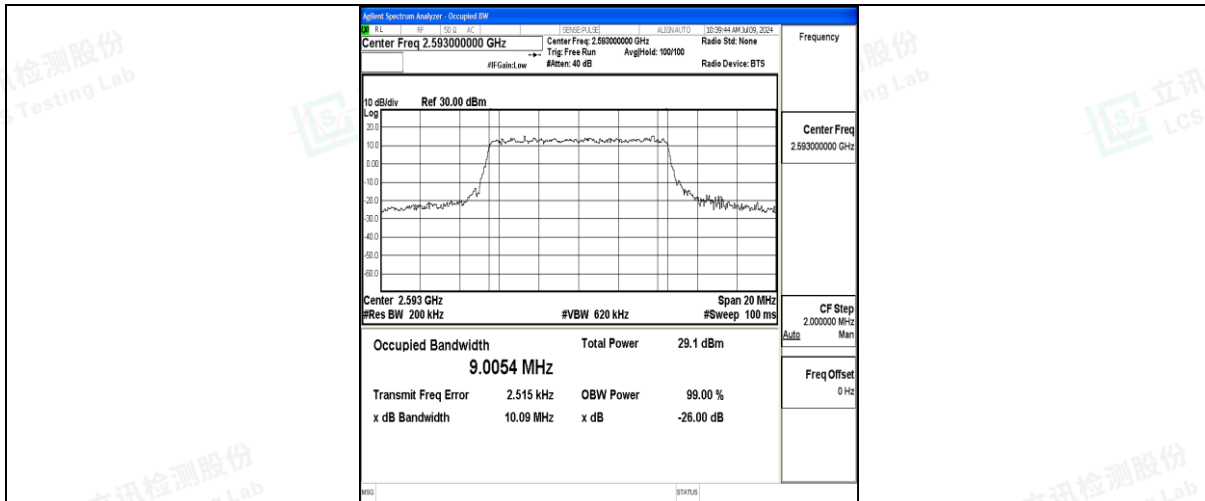

Band41-10MHz-16QAM-40620-50RB#0-PASS

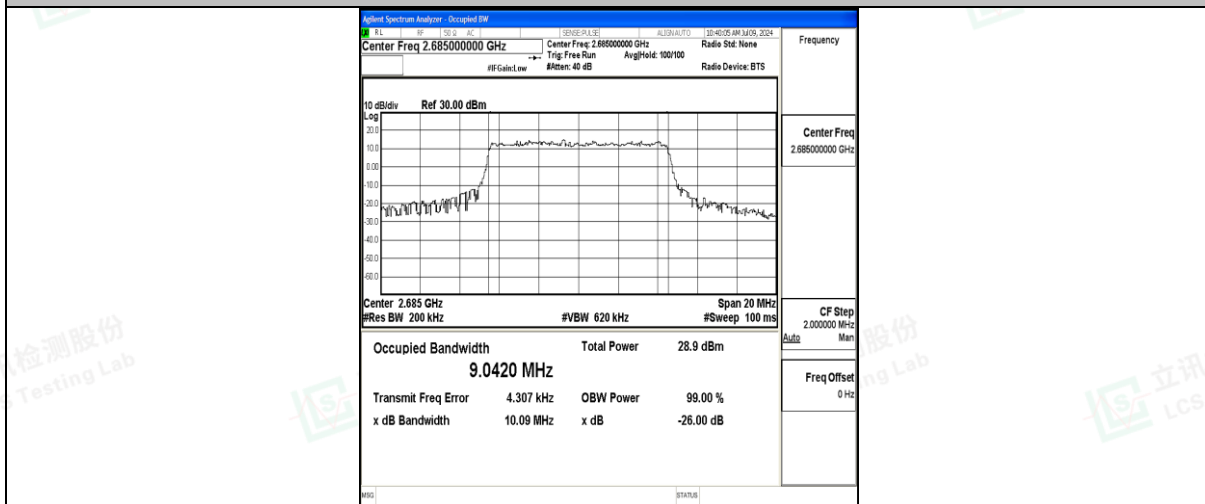

Band41-10MHz-QPSK-41540-50RB#0-PASS

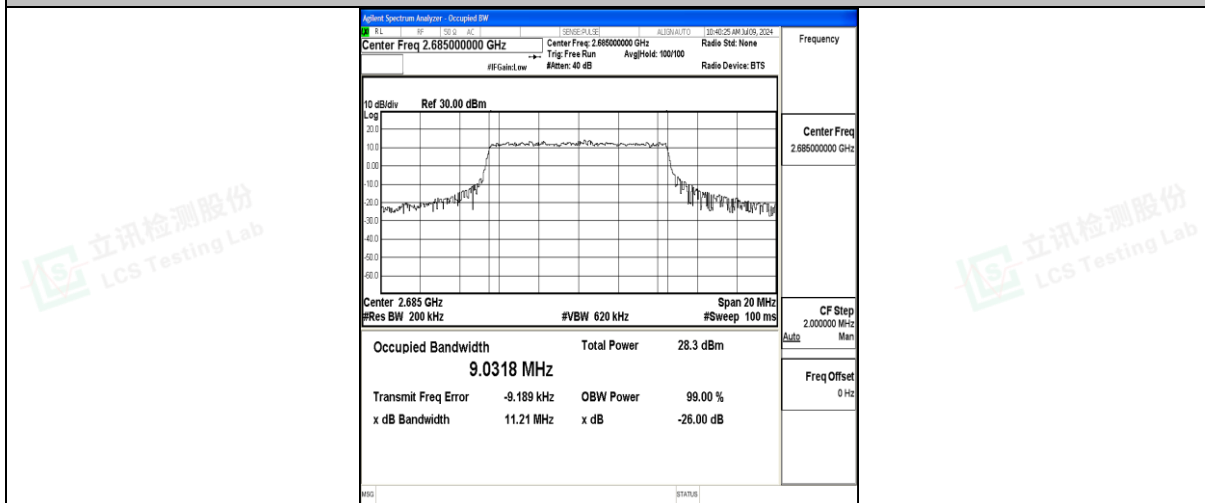

Band41-10MHz-16QAM-41540-50RB#0-PASS



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity






Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

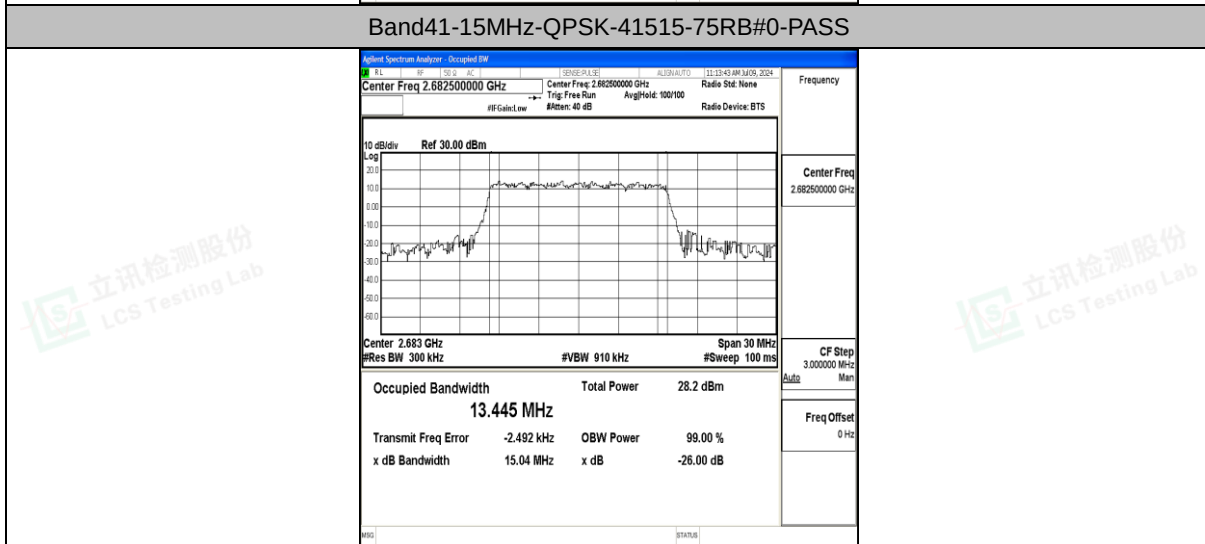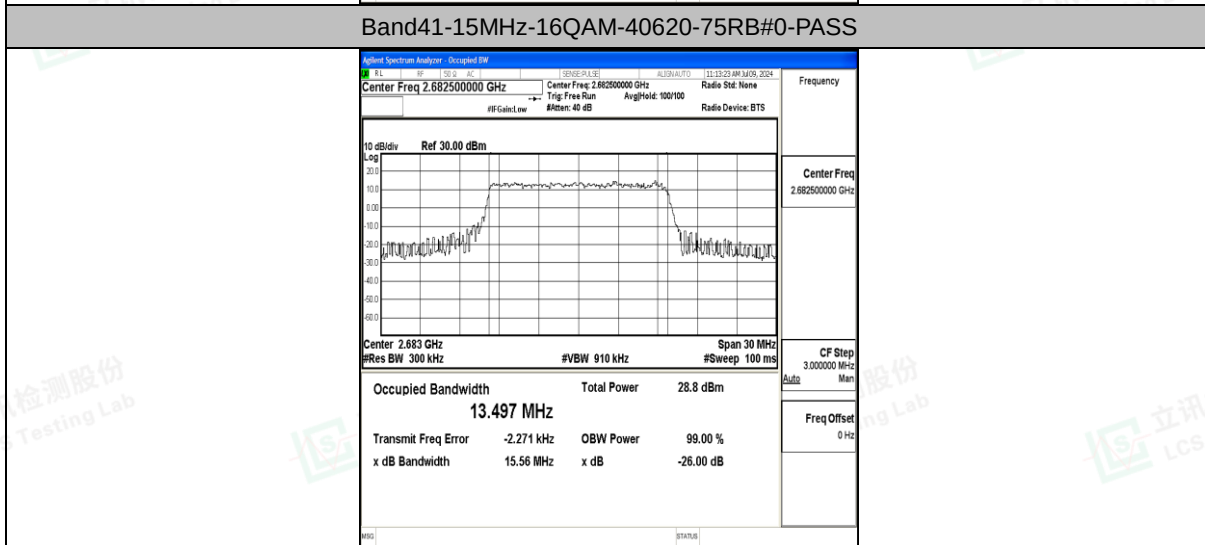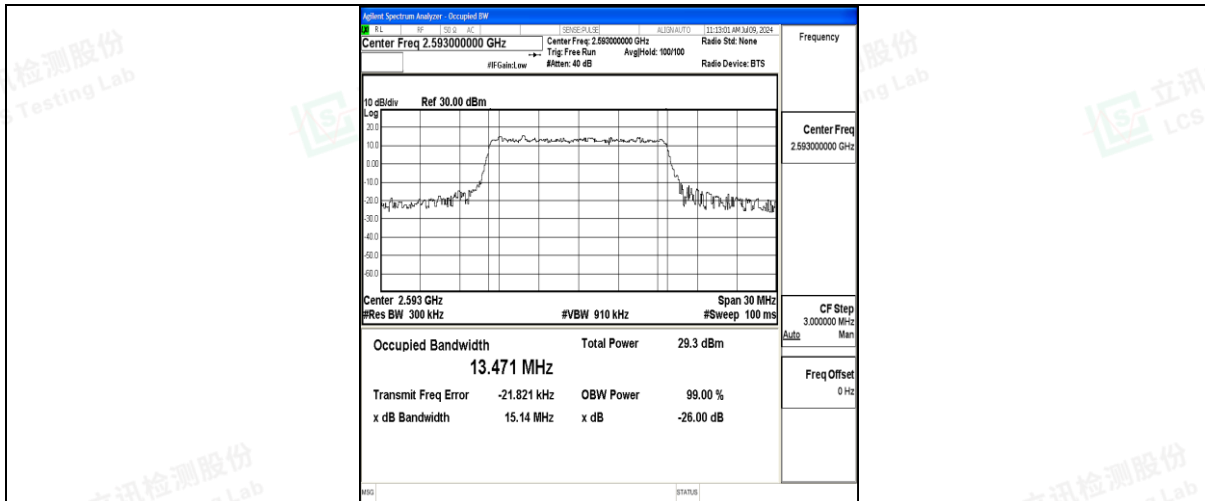


Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity

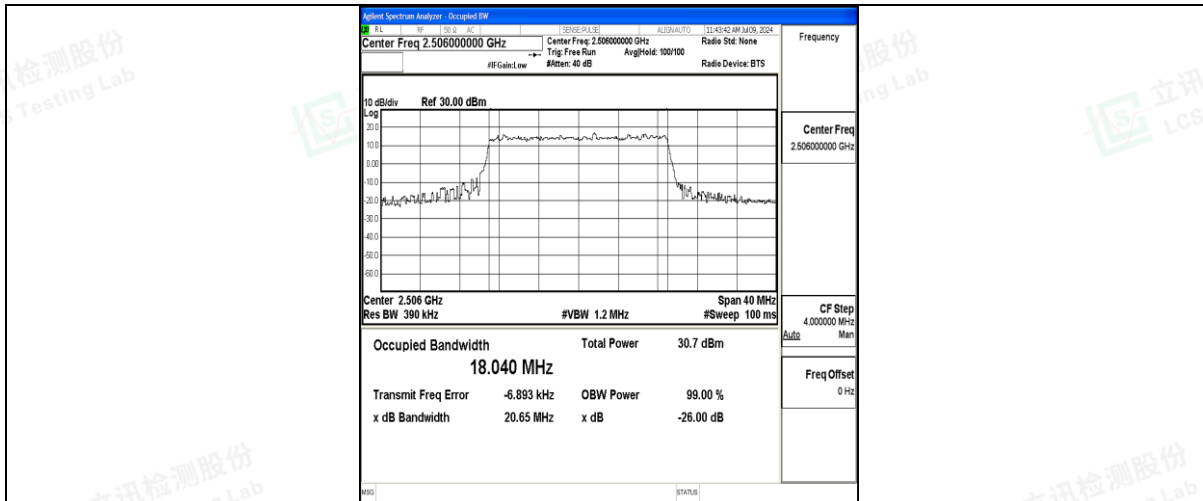

Band41-20MHz-QPSK-39750-100RB#0-PASS



Band41-20MHz-16QAM-39750-100RB#0-PASS

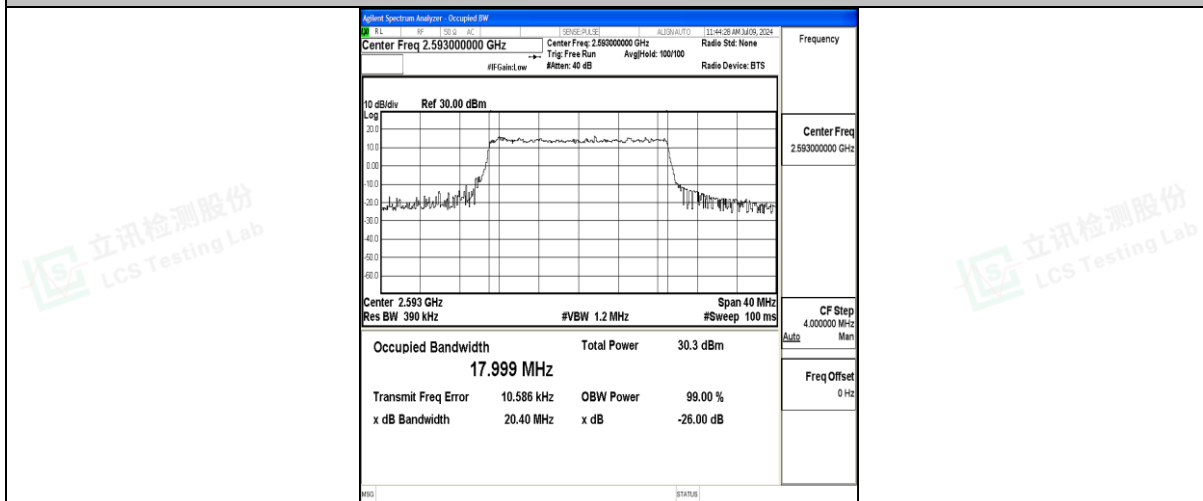

Band41-20MHz-QPSK-40620-100RB#0-PASS




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity

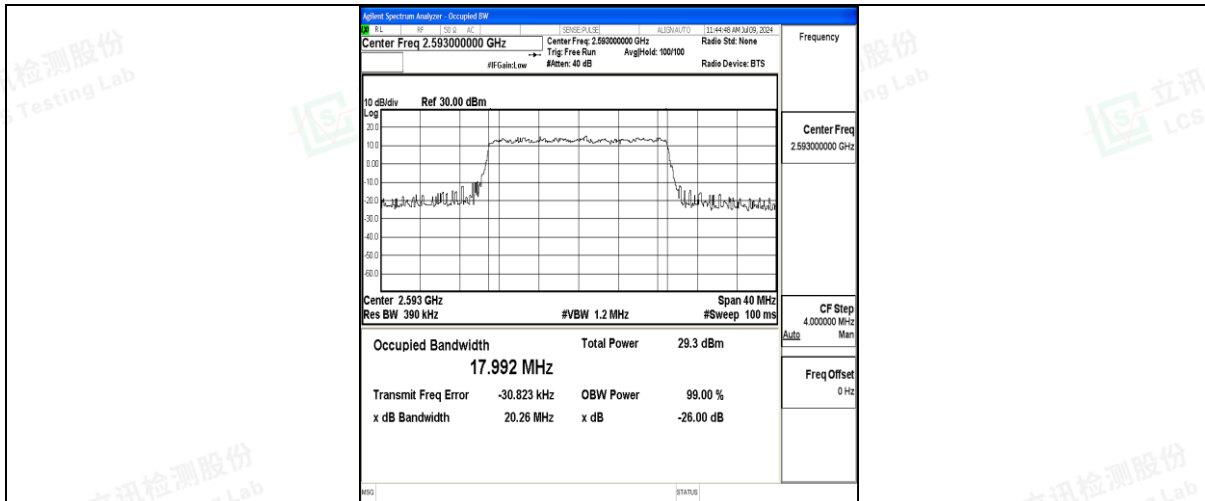

Band41-20MHz-16QAM-40620-100RB#0-PASS

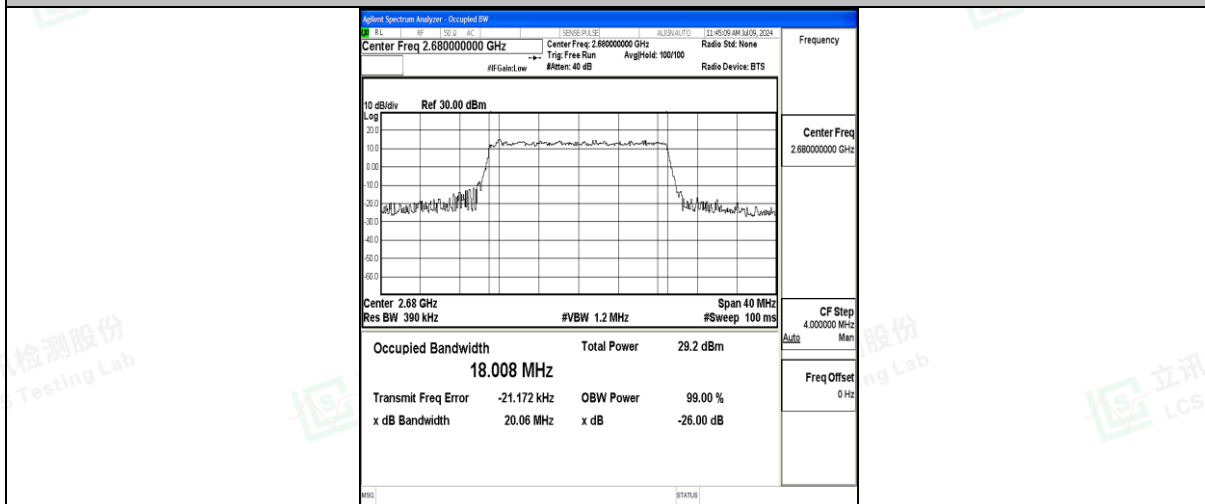

Band41-20MHz-QPSK-41490-100RB#0-PASS

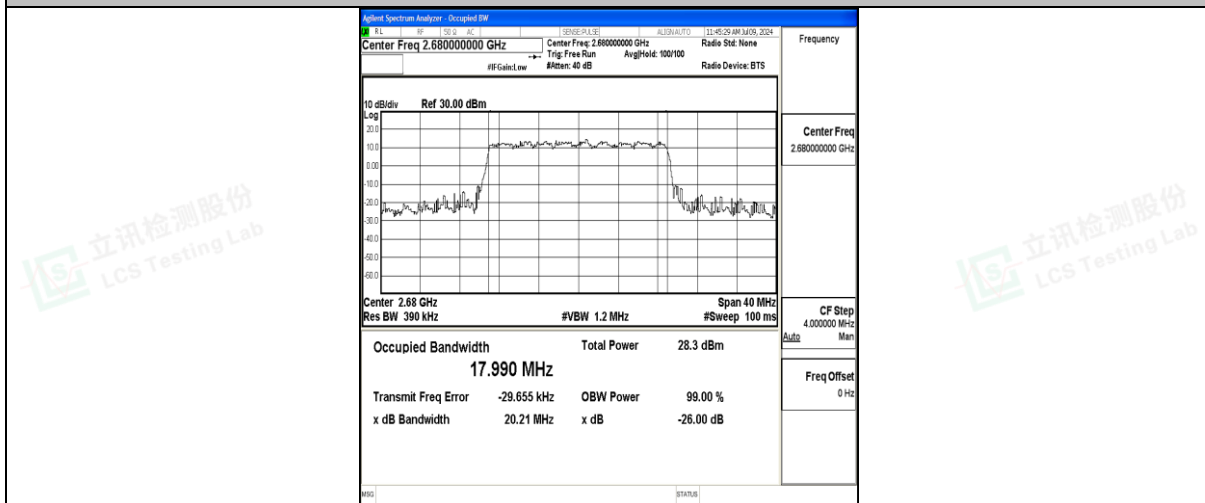

Band41-20MHz-16QAM-41490-100RB#0-PASS



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity