



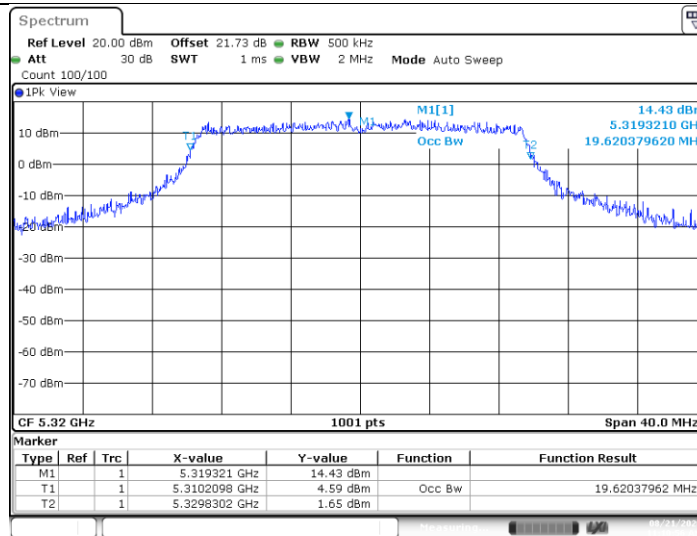


Date: 21.AUG.2026 11:10:56

11AX20SISO_Ant1_5500

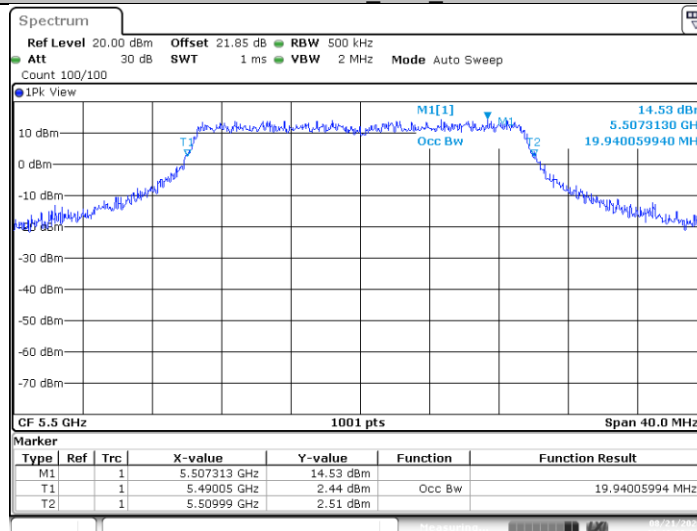


Date: 21.AUG.2026 11:13:02

11AX20SISO_Ant1_5580

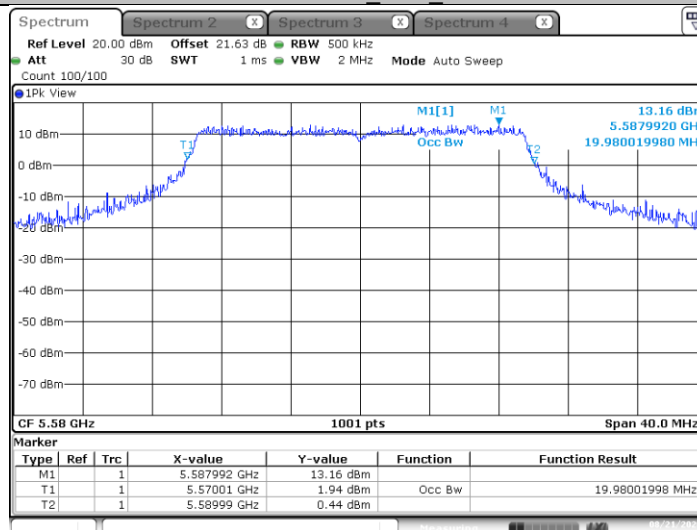


Date: 21.AUG.2026 11:26:57

11AX20SISO_Ant1_5700

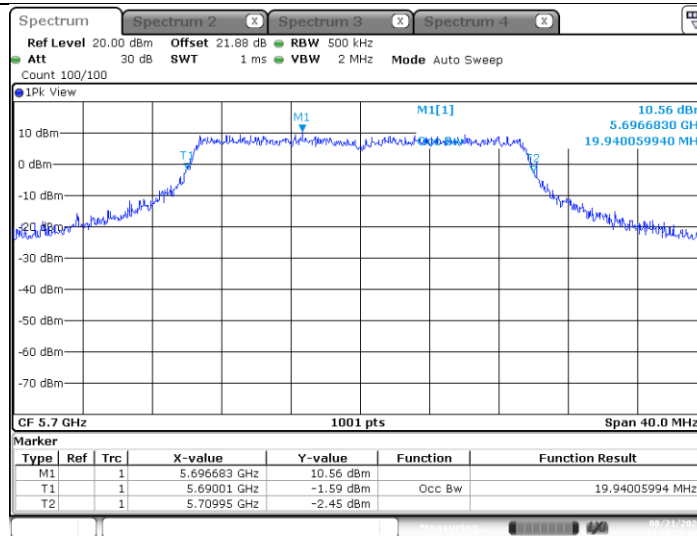


Date: 21.AUG.2026 11:28:26

11AX20SISO_Ant1_5745

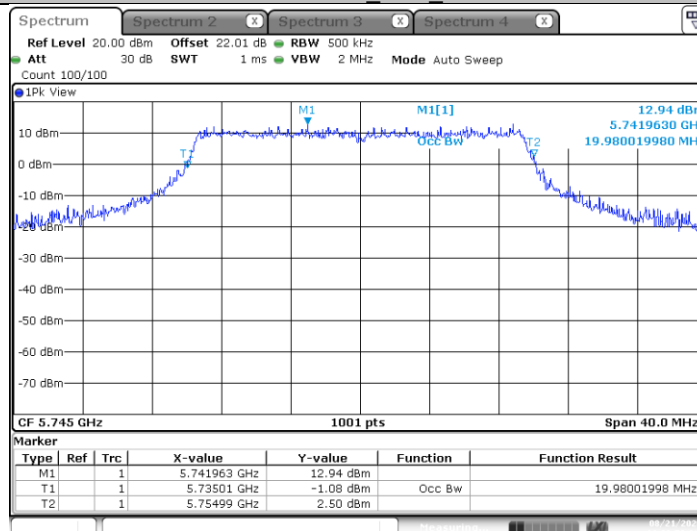


Date: 21.AUG.2026 11:30:52

11AX20SISO_Ant1_5785

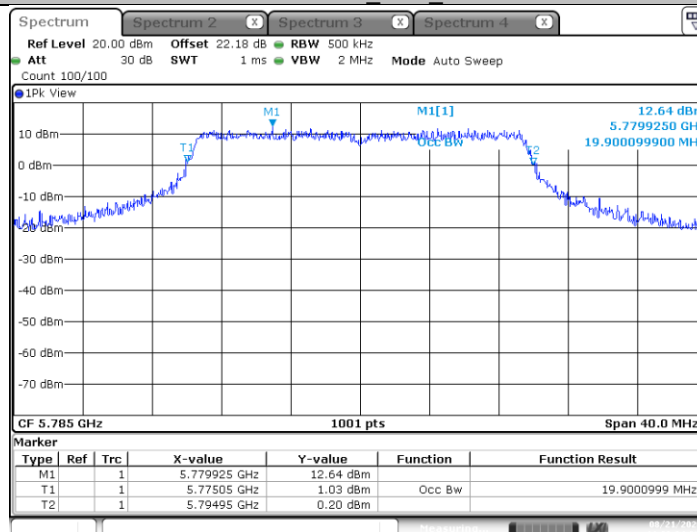


Date: 21.AUG.2026 11:32:34

11AX20SISO_Ant1_5825

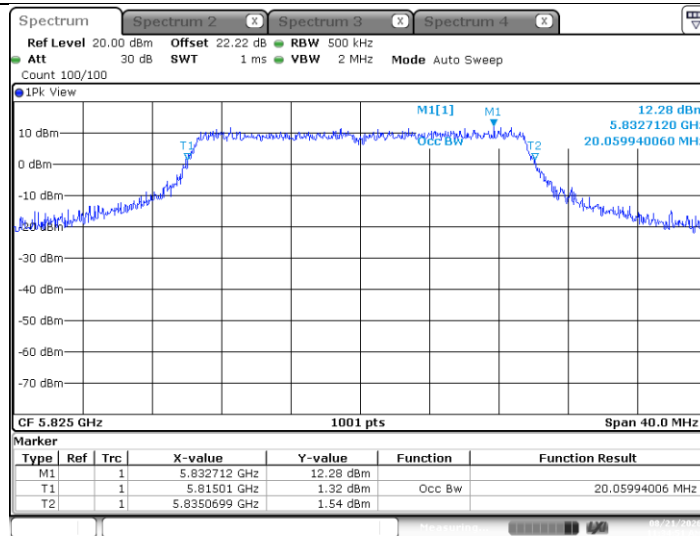


Date: 21.AUG.2026 11:34:52

11AX40SISO_Ant1_5190

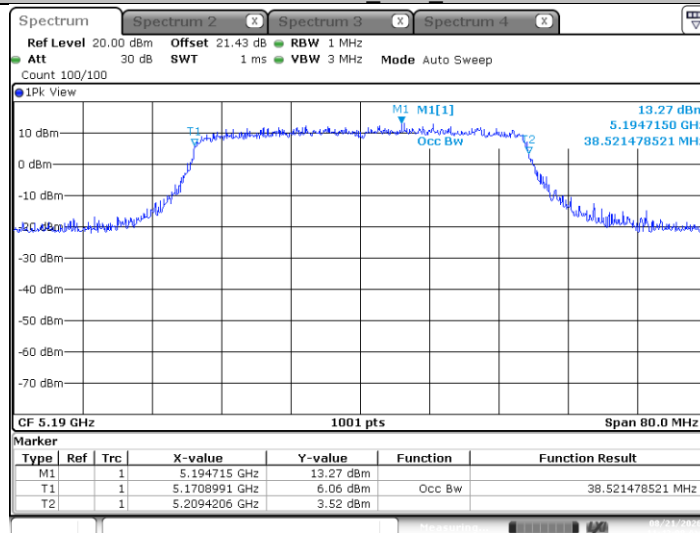


Date: 21.AUG.2026 11:42:09

11AX40SISO_Ant1_5230

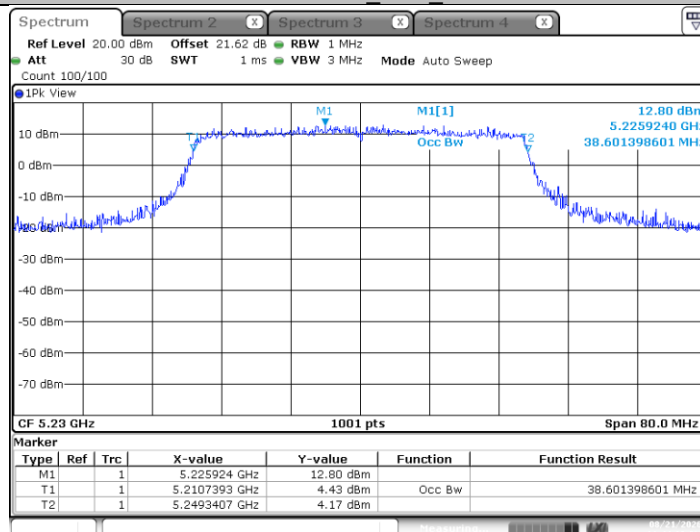


Date: 21.AUG.2026 11:44:10

11AX40SISO_Ant1_5270

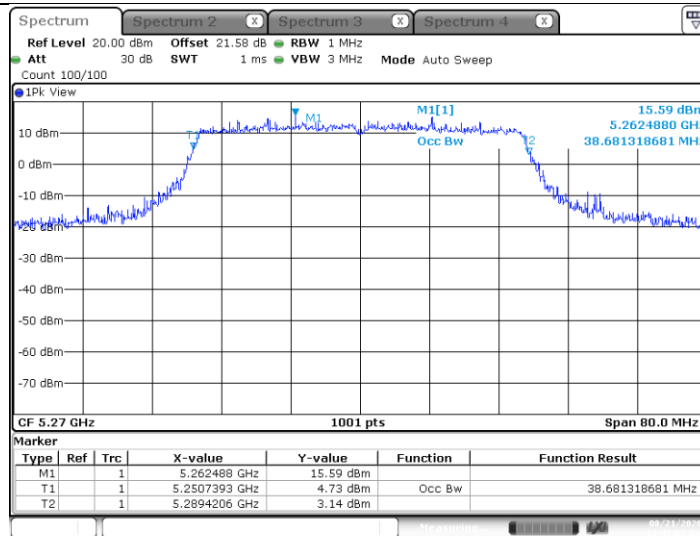


Date: 21.AUG.2026 11:47:03

11AX40SISO_Ant1_5310

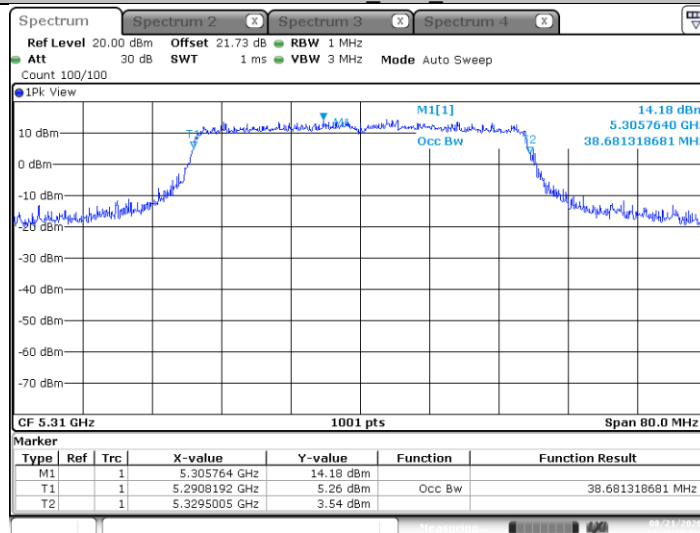


Date: 21.AUG.2026 11:48:40

11AX40SISO_Ant1_5510

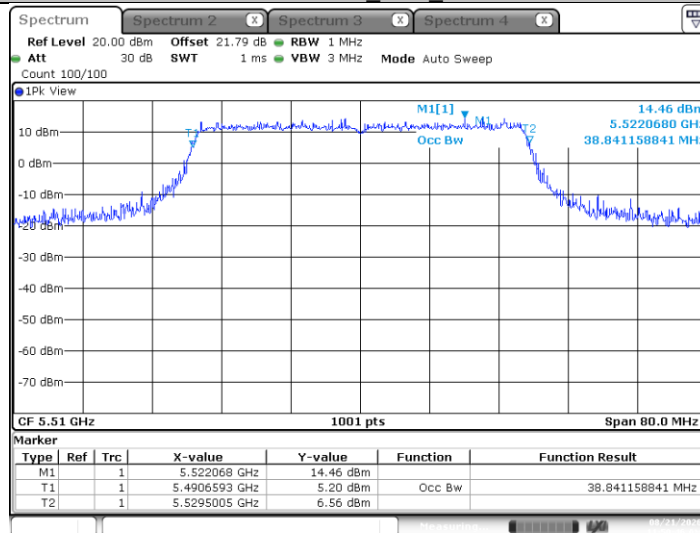


Date: 21.AUG.2026 11:50:47


11AX40SISO_Ant1_5550

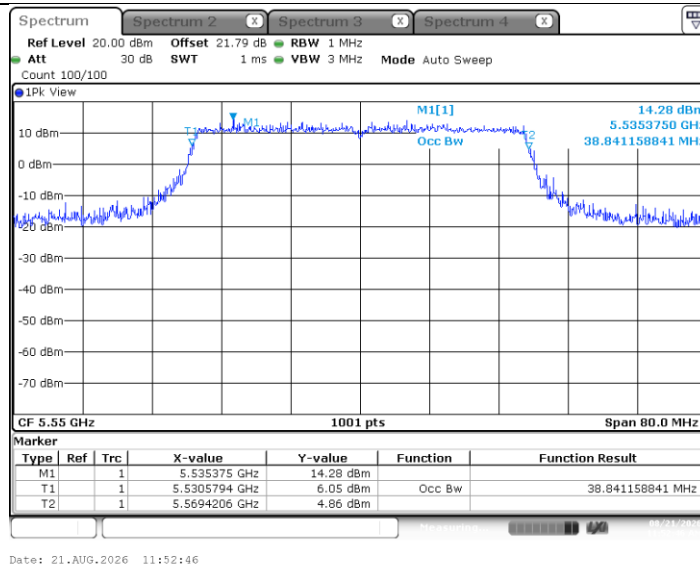


11AX40SISO_Ant1_5670

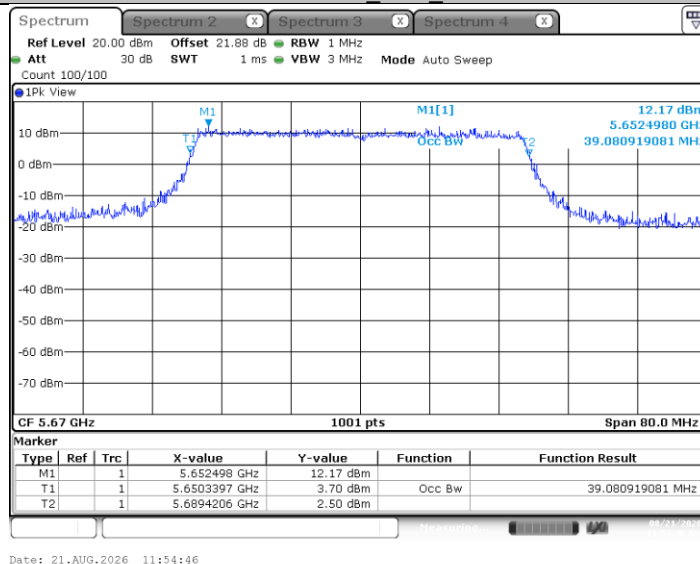

11AX40SISO_Ant1_5755

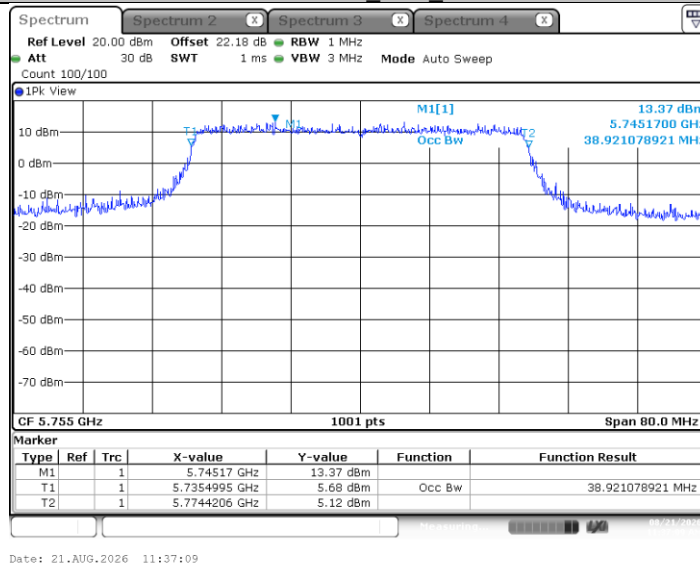

11AX40SISO_Ant1_5795

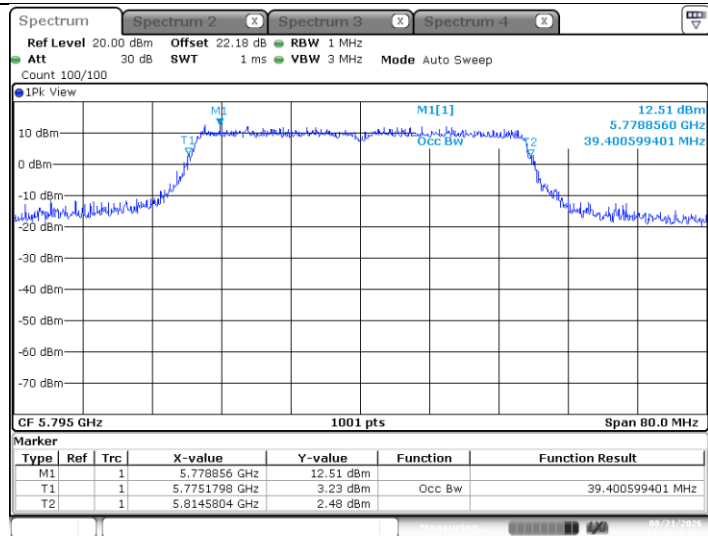

Date: 21.AUG.2026 11:39:31


Appendix A.3: Test Results of 6dB Bandwidth

Test Result


TestMode	Antenna	Channel	6db EBW [MHz]	FL[MHz]	FH[MHz]	Limit[MHz]	Verdict
11A	Ant1	5745	16.56	5736.72	5753.28	0.5	PASS
		5785	16.36	5776.80	5793.16	0.5	PASS
		5825	16.40	5816.80	5833.20	0.5	PASS
11AC20SISO	Ant1	5745	17.64	5736.16	5753.80	0.5	PASS
		5785	17.60	5776.16	5793.76	0.5	PASS
		5825	17.60	5816.20	5833.80	0.5	PASS
11AC40SISO	Ant1	5755	36.32	5736.84	5773.16	0.5	PASS
		5795	36.32	5776.84	5813.16	0.5	PASS
11AX20SISO	Ant1	5745	18.92	5735.48	5754.40	0.5	PASS
		5785	18.88	5775.48	5794.36	0.5	PASS
		5825	19.00	5815.48	5834.48	0.5	PASS
11AX40SISO	Ant1	5755	38.08	5735.96	5774.04	0.5	PASS
		5795	38.16	5775.88	5814.04	0.5	PASS

Test Graphs


11A_Ant1_5745

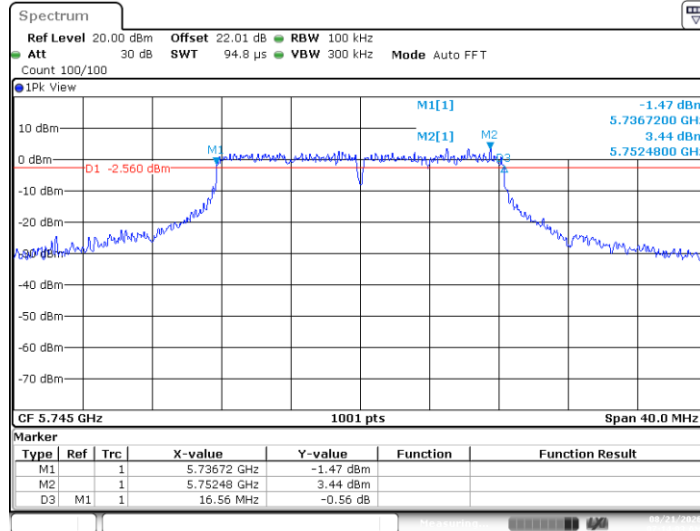


11A_Ant1_5785

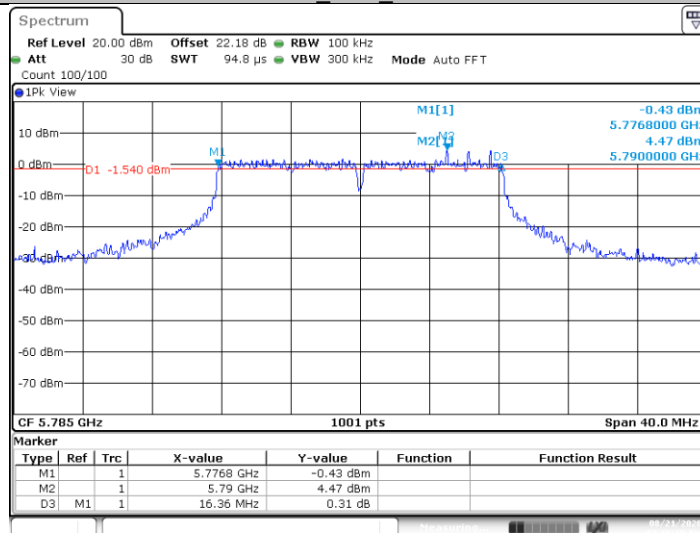


11A_Ant1_5825

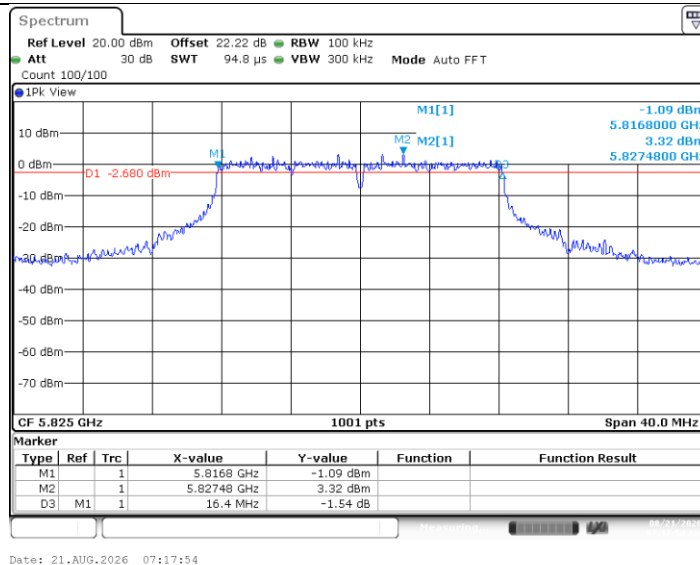


11AC20SISO_Ant1_5745

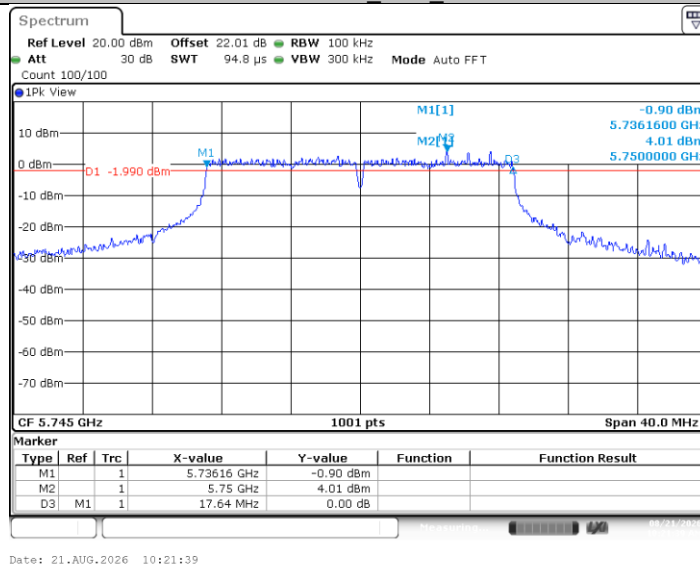


11AC20SISO_Ant1_5785

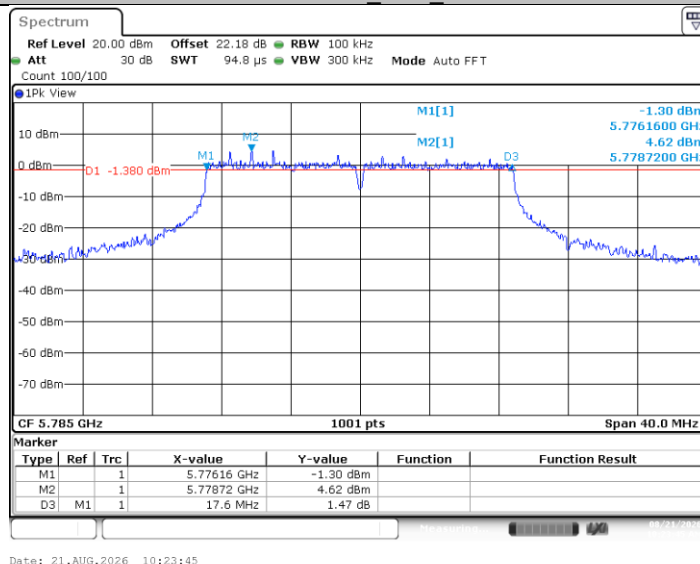


11AC20SISO_Ant1_5825

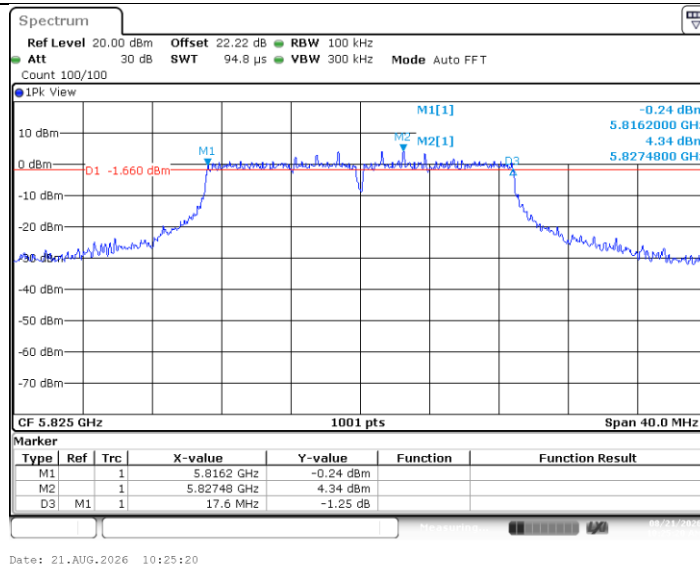


11AC40SISO_Ant1_5755

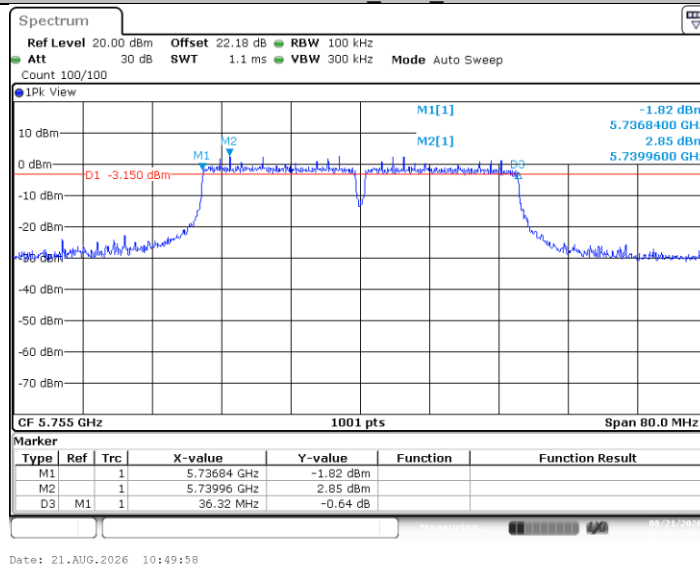

11AC40SISO_Ant1_5795

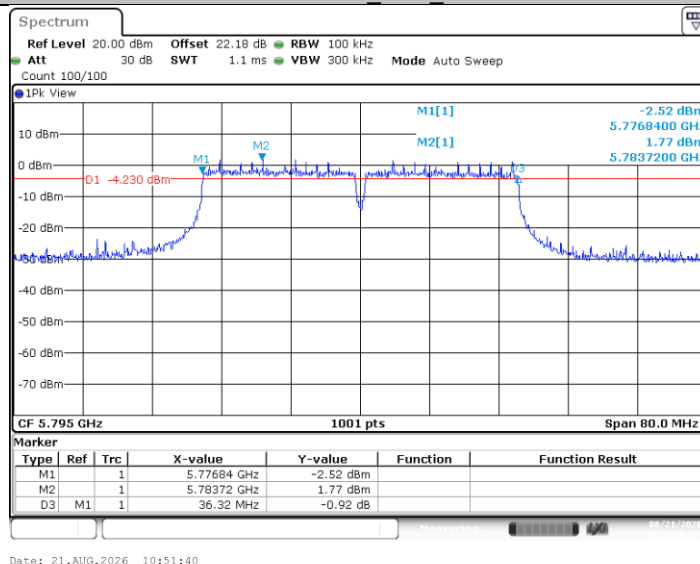


11AX20SISO_Ant1_5745

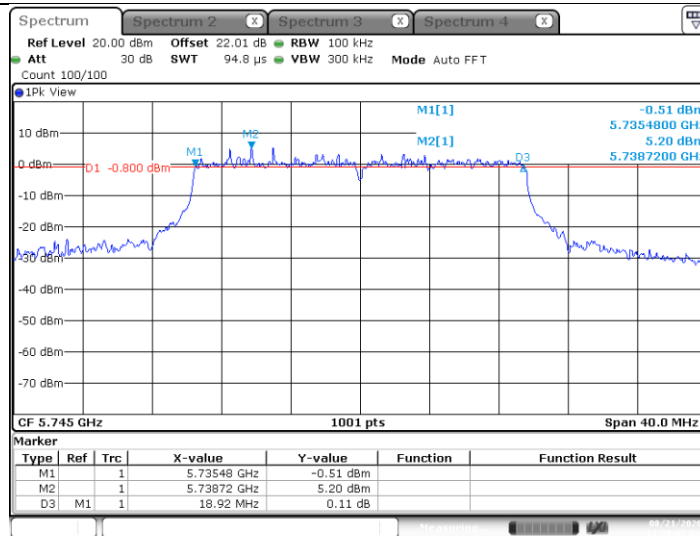


Date: 21.AUG.2026 11:30:43

11AX20SISO_Ant1_5785

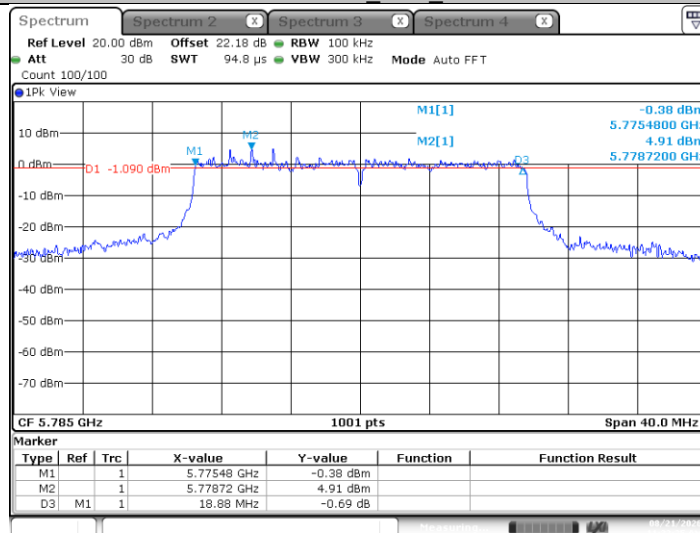


Date: 21.AUG.2026 11:32:25

11AX20SISO_Ant1_5825

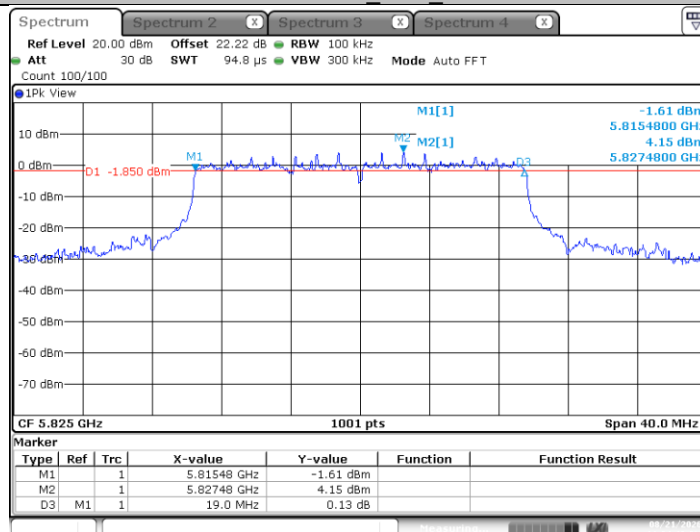


Date: 21.AUG.2026 11:34:43

11AX40SISO_Ant1_5755

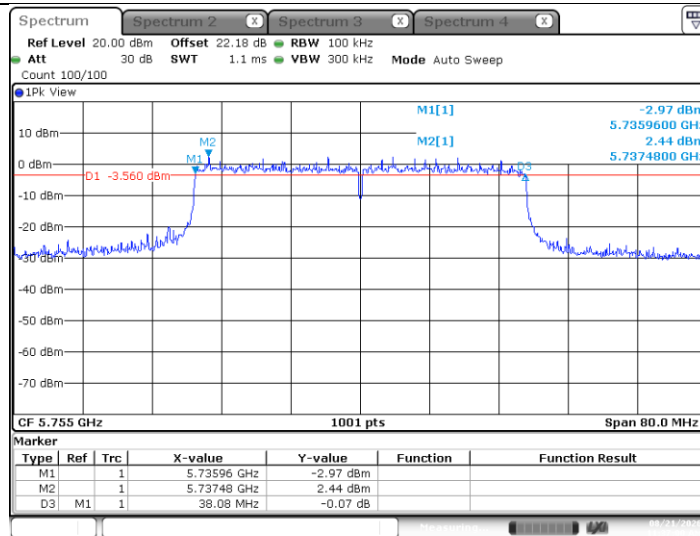

11AX40SISO Ant1_5795

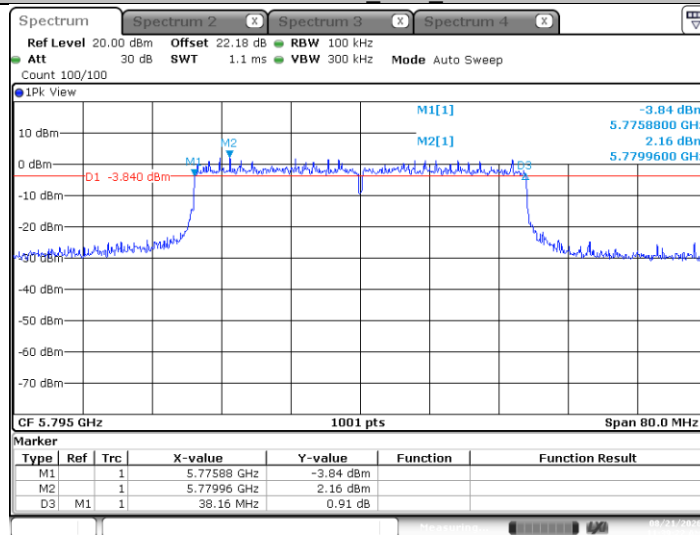

Appendix A.4: Test Results of Maximum Output Power

Test Result

TestMode	Antenna	Channel	Result[dBm]	Limit[dBm]	Verdict
11A	Ant1	5180	13.74	≤23.98	PASS
		5200	15.08	≤23.98	PASS
		5240	15.94	≤23.98	PASS
		5260	15.98	≤23.98	PASS
		5280	16.41	≤23.98	PASS
		5320	17.26	≤23.98	PASS
		5500	17.31	≤23.98	PASS
		5580	16.45	≤23.98	PASS
		5700	14.64	≤23.98	PASS
		5745	16.16	≤30	PASS
		5785	15.53	≤30	PASS
11N20SISO	Ant1	5825	15.23	≤30	PASS
		5180	13.29	≤23.98	PASS
		5200	14.72	≤23.98	PASS
		5240	14.72	≤23.98	PASS
		5260	15.68	≤23.98	PASS
		5280	15.99	≤23.98	PASS
		5320	16.88	≤23.98	PASS
		5500	16.36	≤23.98	PASS
		5580	16.30	≤23.98	PASS
		5700	13.37	≤23.98	PASS
		5745	15.92	≤30	PASS
11N40SISO	Ant1	5785	15.32	≤30	PASS
		5825	15.02	≤30	PASS
		5190	13.47	≤23.98	PASS
		5230	15.29	≤23.98	PASS
		5270	15.64	≤23.98	PASS
		5310	16.58	≤23.98	PASS
		5510	16.00	≤23.98	PASS
		5550	15.62	≤23.98	PASS
		5670	14.03	≤23.98	PASS
		5755	15.77	≤30	PASS
		5795	15.11	≤30	PASS
11AC20SISO	Ant1	5180	13.22	≤23.98	PASS
		5200	14.71	≤23.98	PASS
		5240	14.67	≤23.98	PASS
		5260	14.78	≤23.98	PASS
		5280	15.91	≤23.98	PASS
		5320	16.05	≤23.98	PASS
		5500	17.15	≤23.98	PASS
		5580	16.29	≤23.98	PASS
		5700	12.58	≤23.98	PASS
		5745	15.92	≤30	PASS
		5785	14.52	≤30	PASS
11AC40SISO	Ant1	5825	15.13	≤30	PASS
		5190	13.46	≤23.98	PASS
		5230	15.16	≤23.98	PASS
		5270	14.82	≤23.98	PASS
		5310	15.70	≤23.98	PASS
		5510	16.93	≤23.98	PASS
		5550	16.30	≤23.98	PASS
		5670	13.83	≤23.98	PASS
		5755	15.76	≤30	PASS
		5795	15.09	≤30	PASS
11AX20SISO	Ant1	5180	13.55	≤23.98	PASS
		5200	14.28	≤23.98	PASS
		5240	15.07	≤23.98	PASS

		5260	15.27	≤23.98	PASS
		5280	15.61	≤23.98	PASS
		5320	16.37	≤23.98	PASS
		5500	16.58	≤23.98	PASS
		5580	15.94	≤23.98	PASS
		5700	13.05	≤23.98	PASS
		5745	15.49	≤30	PASS
		5785	15.36	≤30	PASS
		5825	15.10	≤30	PASS
11AX40SISO	Ant1	5190	14.39	≤23.98	PASS
		5230	15.35	≤23.98	PASS
		5270	15.79	≤23.98	PASS
		5310	16.08	≤23.98	PASS
		5510	16.58	≤23.98	PASS
		5550	16.01	≤23.98	PASS
		5670	14.60	≤23.98	PASS
		5755	15.50	≤30	PASS
		5795	15.24	≤30	PASS

Note: The Duty Cycle Factor is compensated in the test data.

Appendix A.5: Test Results of Conducted Power Spectral Density

Test Result

TestMode	Antenna	Channel	Result [dBm/MHz]	Limit[dBm/MHz]	Verdict
11A	Ant1	5180	6.17	≤11.00	PASS
		5200	6.65	≤11.00	PASS
		5240	7.00	≤11.00	PASS
		5260	7.70	≤11.00	PASS
		5280	7.84	≤11.00	PASS
		5320	8.88	≤11.00	PASS
		5500	8.36	≤11.00	PASS
		5580	7.40	≤11.00	PASS
		5700	5.35	≤11.00	PASS
		5745	3.67	≤30	PASS
		5785	2.98	≤30	PASS
		5825	3.10	≤30	PASS
11N20SISO	Ant1	5180	4.68	≤11	PASS
		5200	5.51	≤11	PASS
		5240	6.33	≤11	PASS
		5260	6.32	≤11	PASS
		5280	6.37	≤11	PASS
		5320	7.68	≤11	PASS
		5500	7.36	≤11	PASS
		5580	6.05	≤11	PASS
		5700	2.77	≤11	PASS
		5745	2.30	≤30	PASS
		5785	1.73	≤30	PASS
		5825	1.55	≤30	PASS
11N40SISO	Ant1	5190	2.16	≤11.00	PASS
		5230	3.50	≤11.00	PASS
		5270	3.44	≤11.00	PASS
		5310	4.32	≤11.00	PASS
		5510	4.14	≤11.00	PASS
		5550	3.76	≤11.00	PASS
		5670	0.78	≤11.00	PASS
		5755	-0.42	≤30	PASS
		5795	-1.06	≤30	PASS
11AC20SISO	Ant1	5180	4.41	≤11	PASS
		5200	5.71	≤11	PASS
		5240	6.47	≤11	PASS
		5260	6.31	≤11	PASS
		5280	6.48	≤11	PASS
		5320	7.70	≤11	PASS
		5500	7.44	≤11	PASS
		5580	6.15	≤11	PASS
		5700	2.86	≤11	PASS
		5745	2.74	≤30	PASS
		5785	1.96	≤30	PASS
		5825	1.91	≤30	PASS
11AC40SISO	Ant1	5190	2.24	≤11.00	PASS
		5230	2.94	≤11.00	PASS
		5270	3.53	≤11.00	PASS
		5310	4.01	≤11.00	PASS
		5510	4.27	≤11.00	PASS
		5550	3.70	≤11.00	PASS
		5670	0.81	≤11.00	PASS
		5755	-0.34	≤30	PASS
		5795	-0.75	≤30	PASS
11AX20SISO	Ant1	5180	4.76	≤11	PASS
		5200	5.44	≤11	PASS
		5240	6.37	≤11	PASS

		5260	6.39	≤11	PASS
		5280	6.66	≤11	PASS
		5320	7.34	≤11	PASS
		5500	7.11	≤11	PASS
		5580	6.43	≤11	PASS
		5700	2.86	≤11	PASS
		5745	3.00	≤30	PASS
		5785	2.40	≤30	PASS
		5825	1.88	≤30	PASS
11AX40SISO	Ant1	5190	2.72	≤11.00	PASS
		5230	3.77	≤11.00	PASS
		5270	3.68	≤11.00	PASS
		5310	3.94	≤11.00	PASS
		5510	4.34	≤11.00	PASS
		5550	3.79	≤11.00	PASS
		5670	1.94	≤11.00	PASS
		5755	-0.07	≤30	PASS
		5795	-0.58	≤30	PASS


Note:

1) The Result is dBm/300kHz in the band 5.725-5.85 GHz and the correction factor is 2.22dB, when the correction factor is applied to the 5.8GHz frequency, the calculated maximum PSD data is less than 6dBm/500kHz.

2) The Duty Cycle Factor and RBW Factor is compensated in the graph.


Test Graphs

11A_Ant1_5180

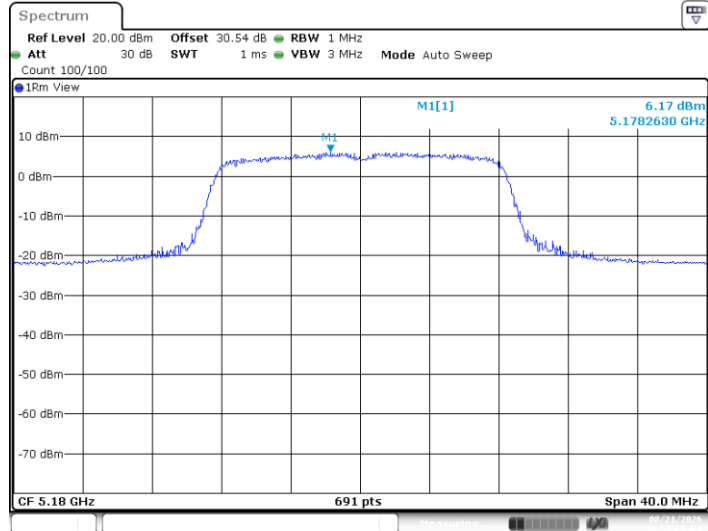


Date: 21.AUG.2026 06:54:24

11A_Ant1_5200

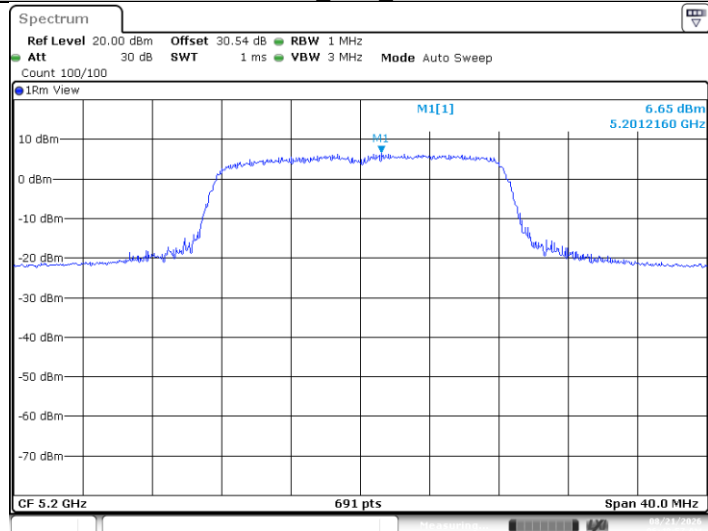


Date: 21.AUG.2026 06:48:57


11A_Ant1_5240

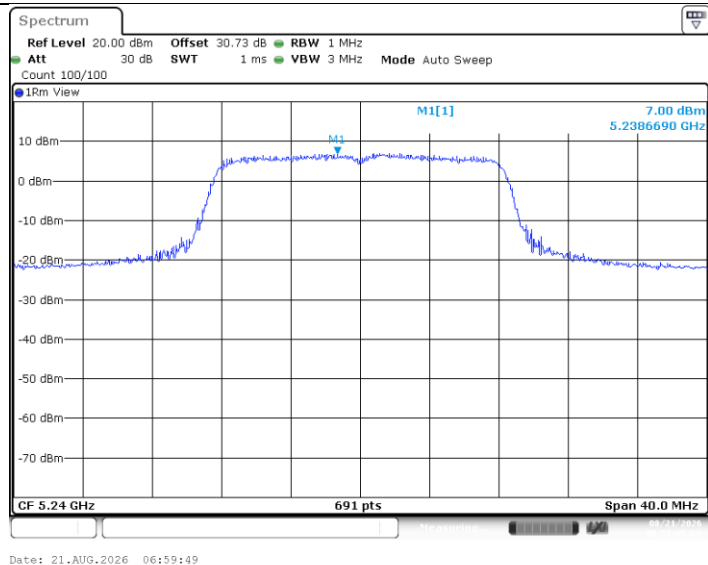


11A_Ant1_5260

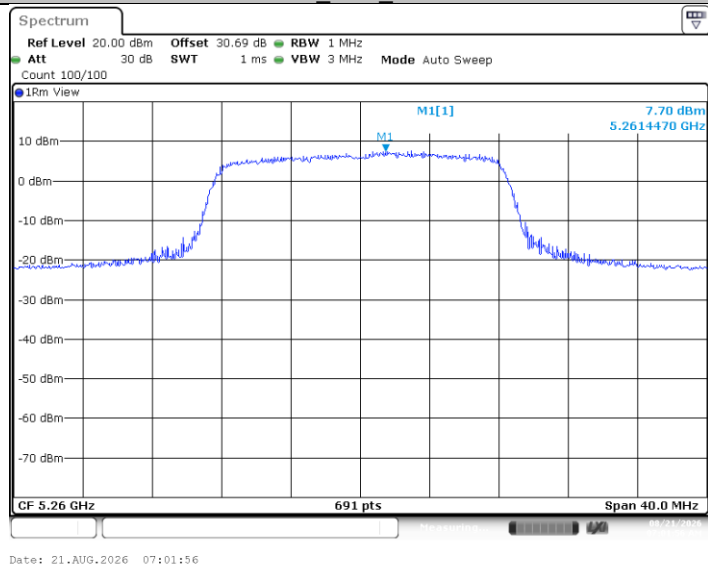


11A_Ant1_5280

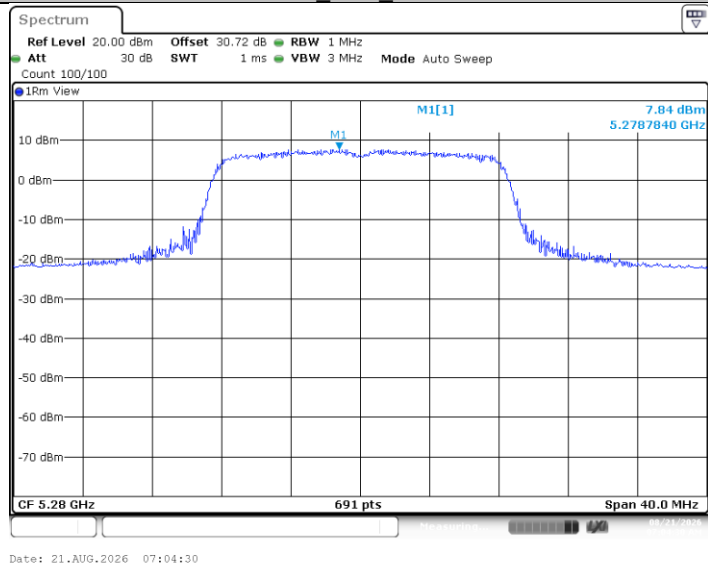


11A_Ant1_5320

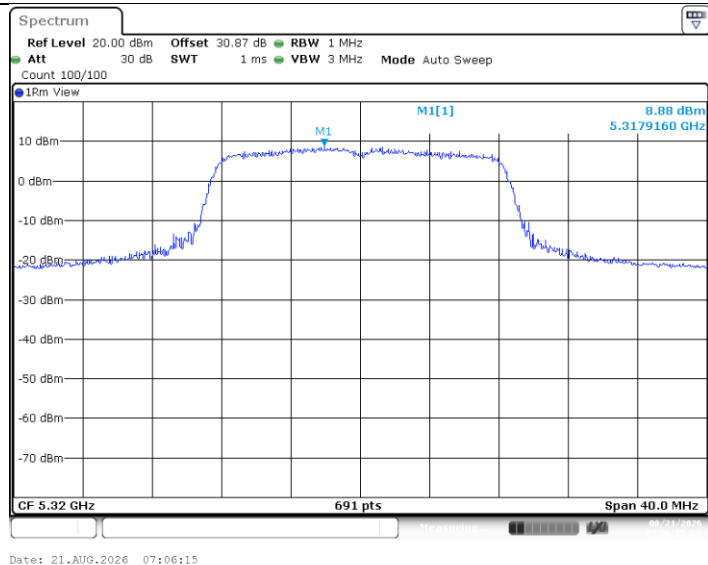


11A_Ant1_5500

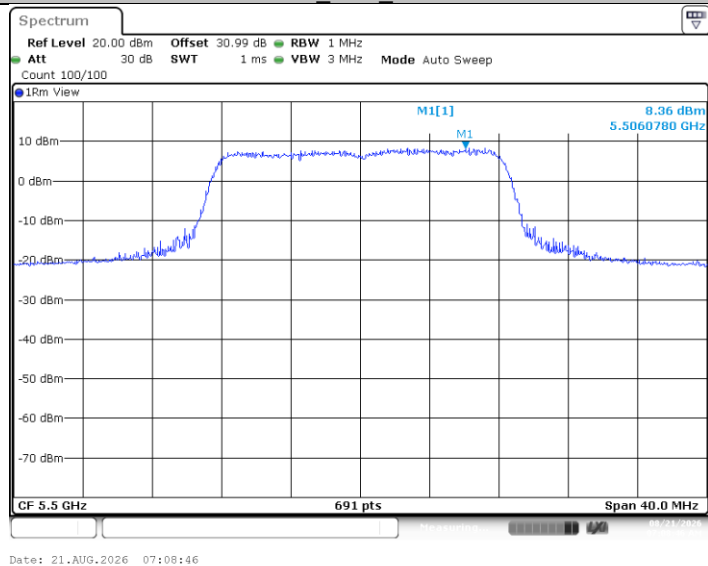


11A_Ant1_5580

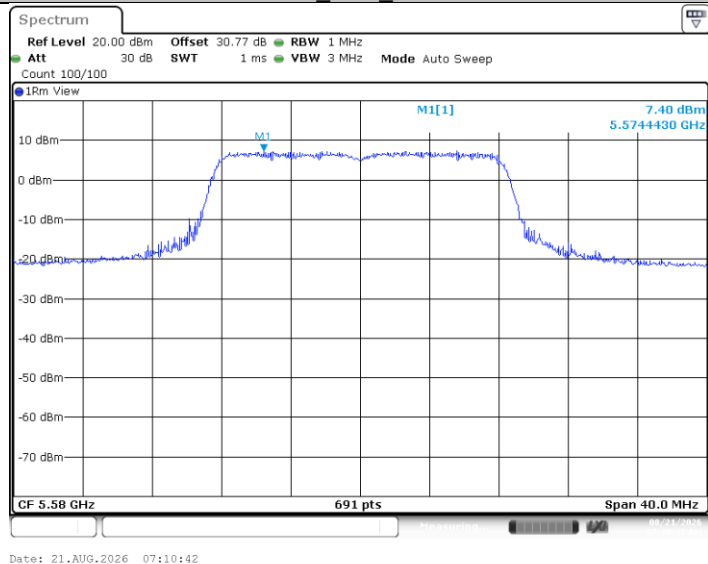


11A_Ant1_5700

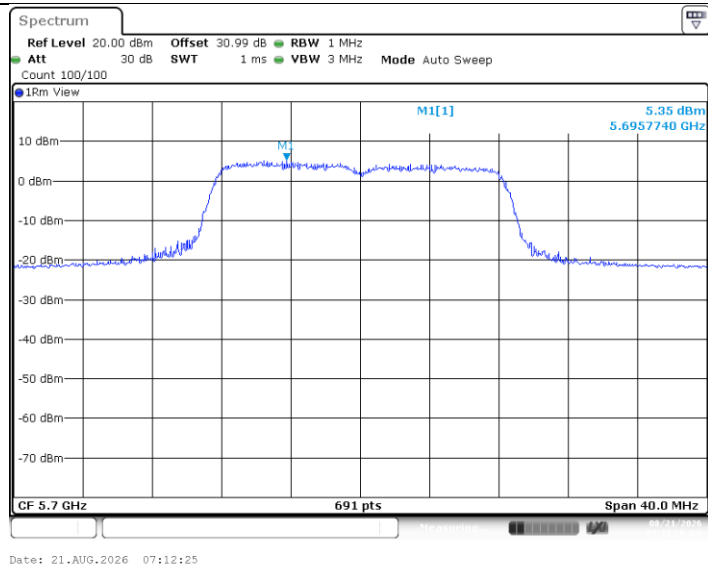


11A_Ant1_5745

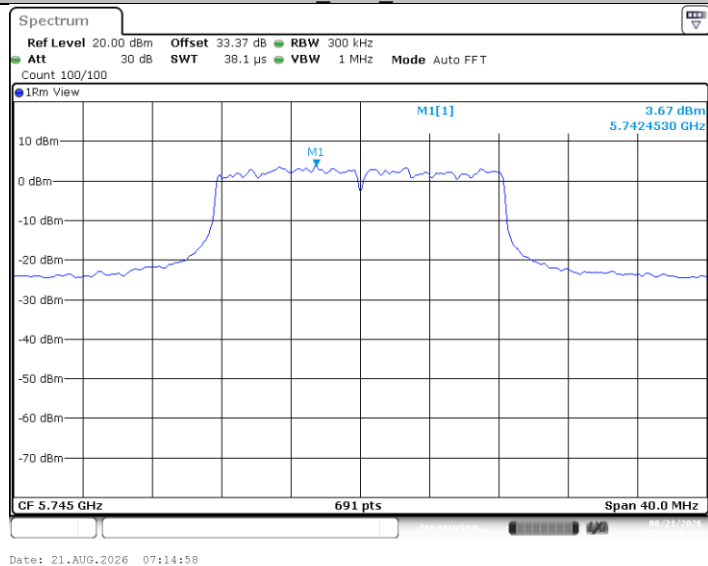


11A_Ant1_5785

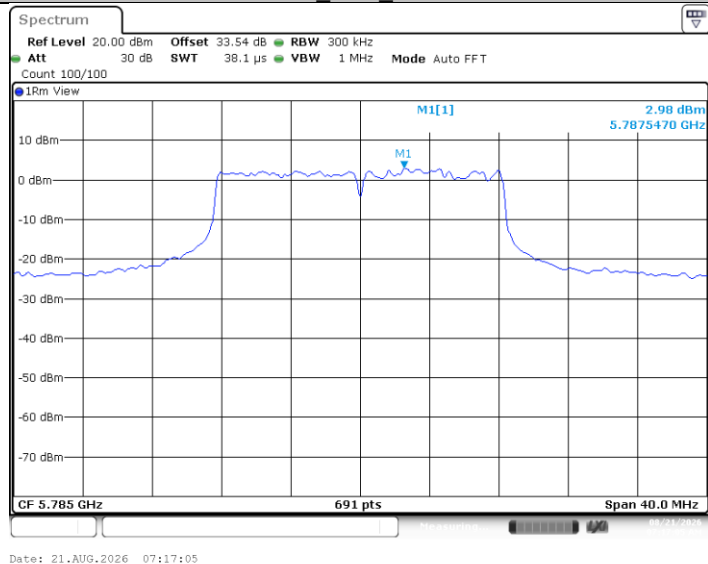


11A_Ant1_5825

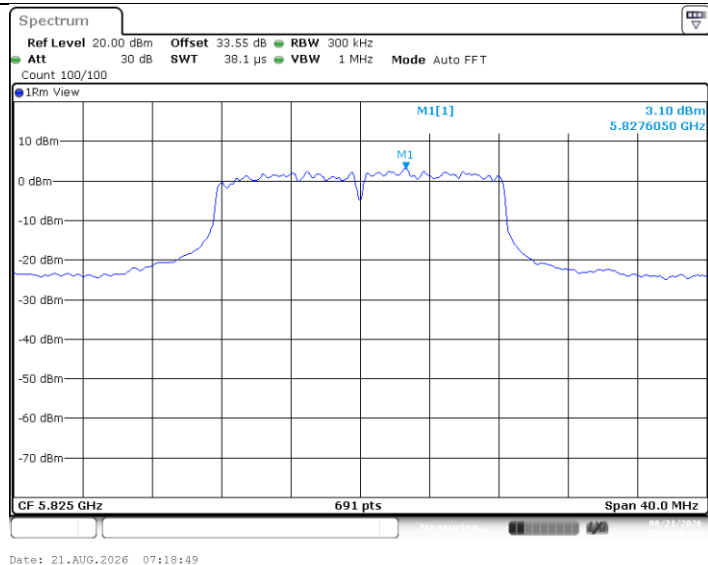


11N20SISO Ant1 5180

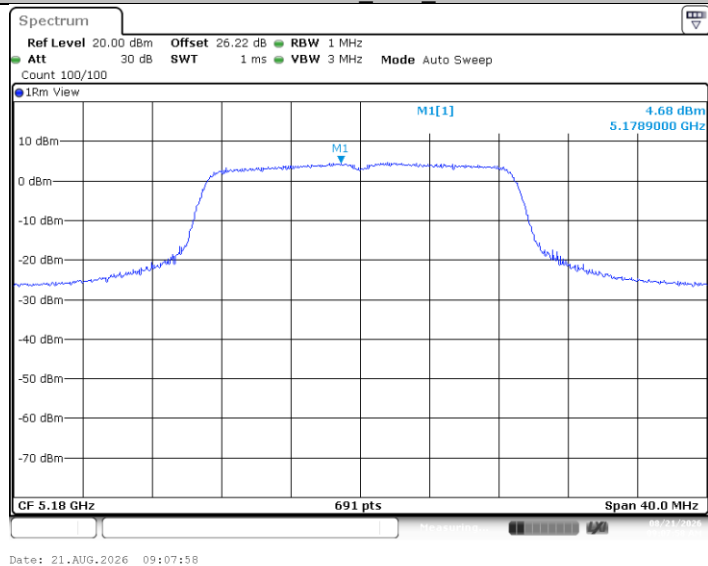


11N20SISO Ant1 5200

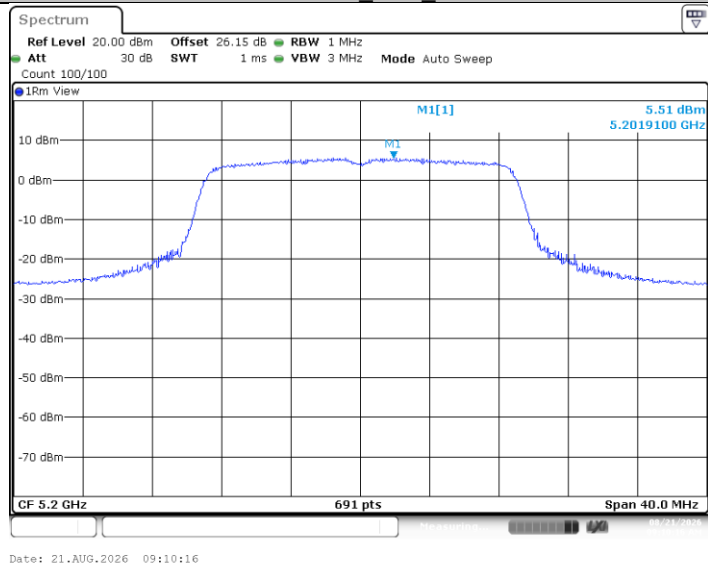


11N20SISO Ant1 5240

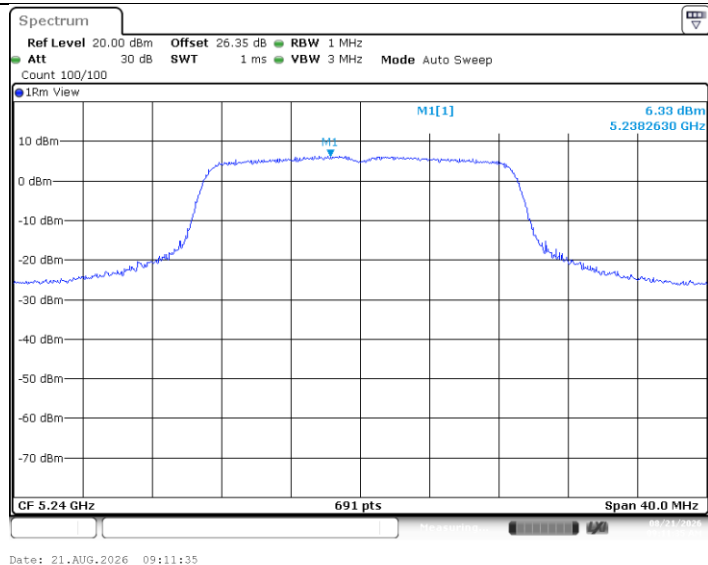


11N20SISO Ant1 5260

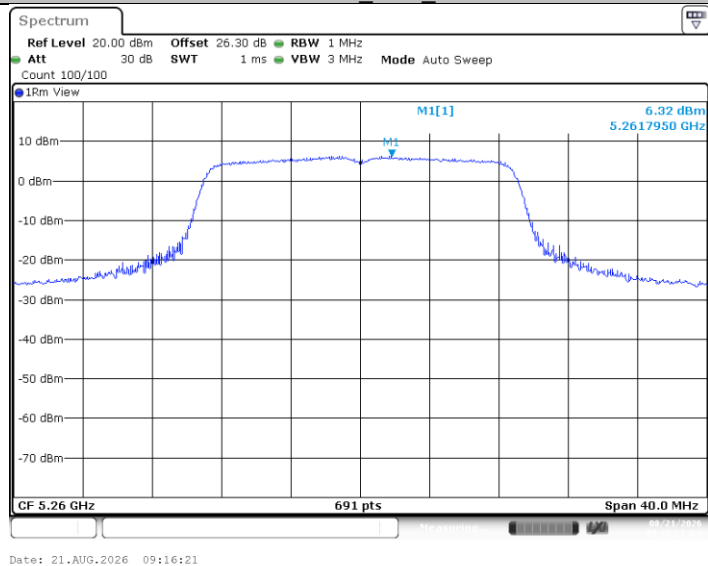


11N20SISO Ant1 5280

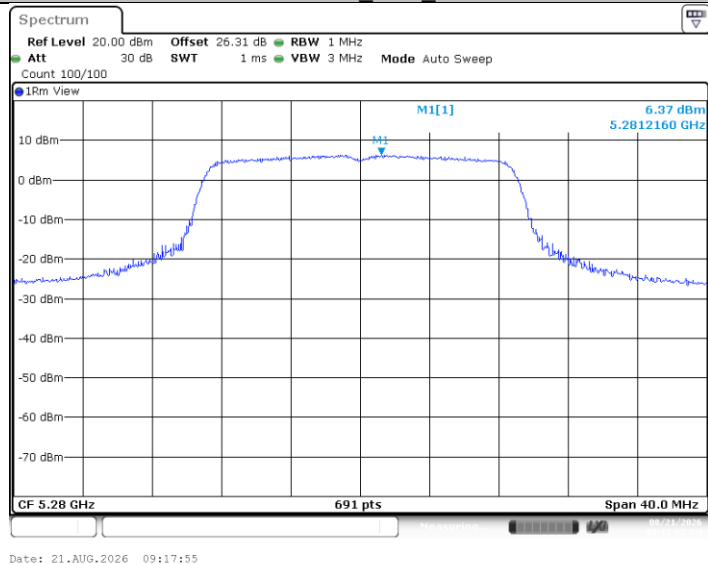


11N20SISO Ant1 5320

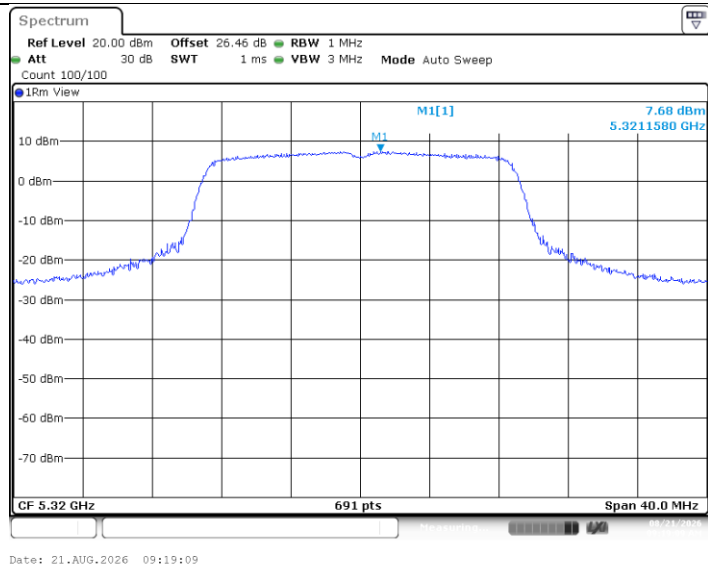


11N20SISO Ant1 5500

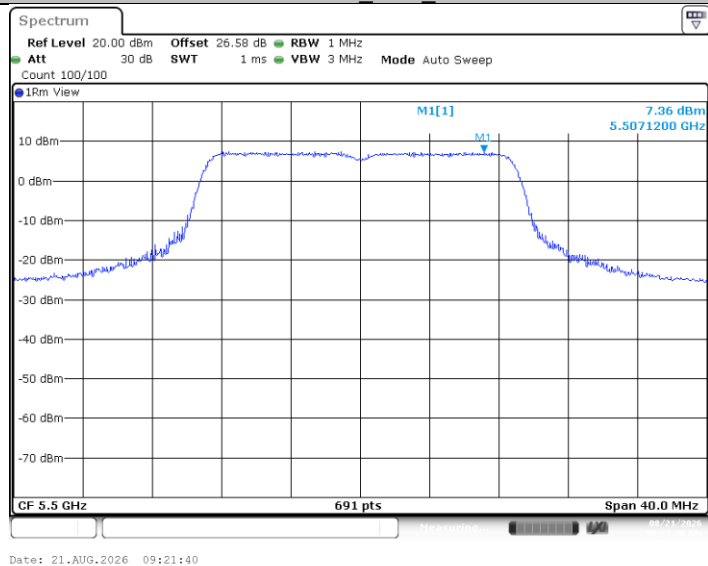


11N20SISO Ant1 5580

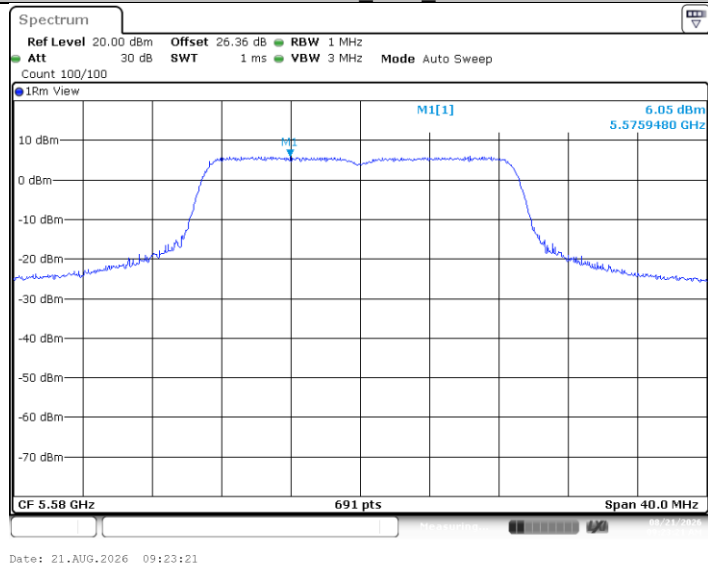


11N20SISO Ant1 5700

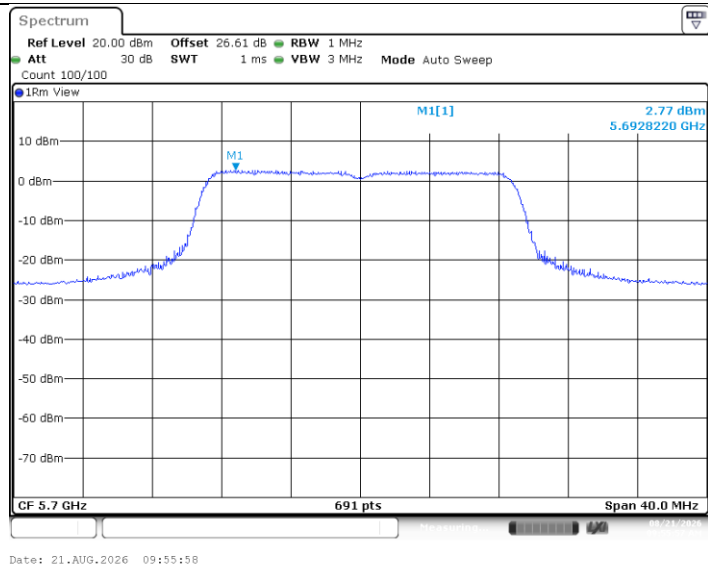


11N20SISO Ant1_5745

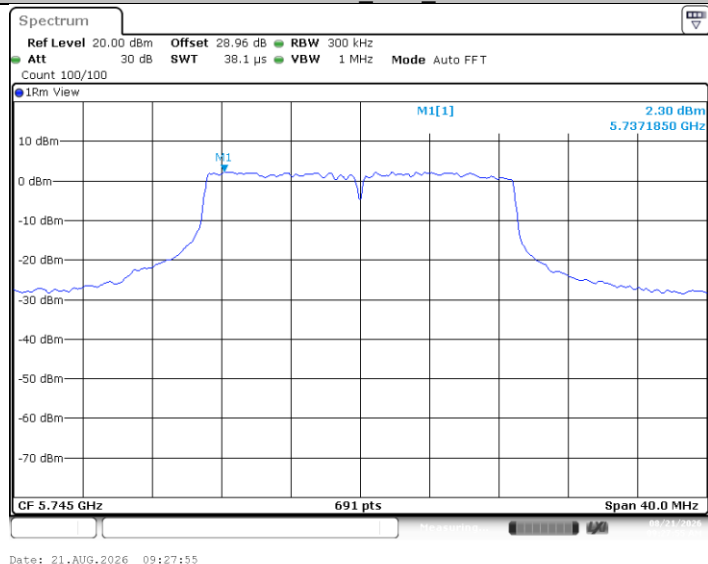


11N20SISO Ant1_5785

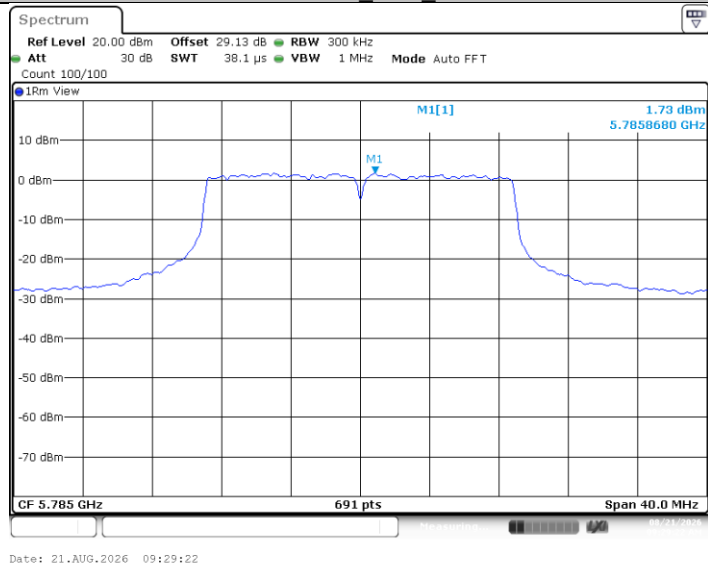


11N20SISO Ant1_5825

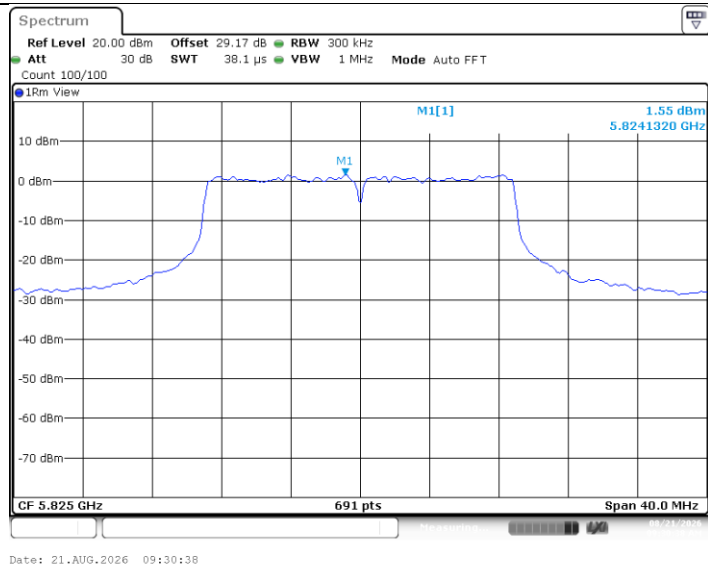


11N40SISO Ant1_5190

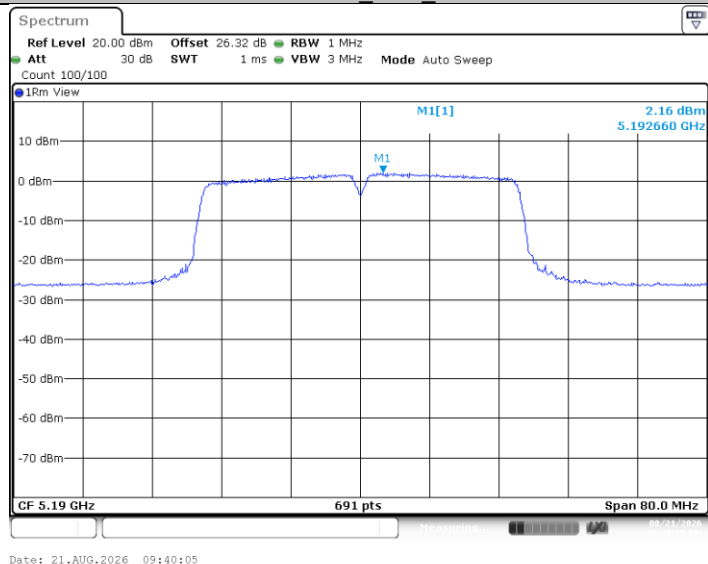


11N40SISO Ant1_5230

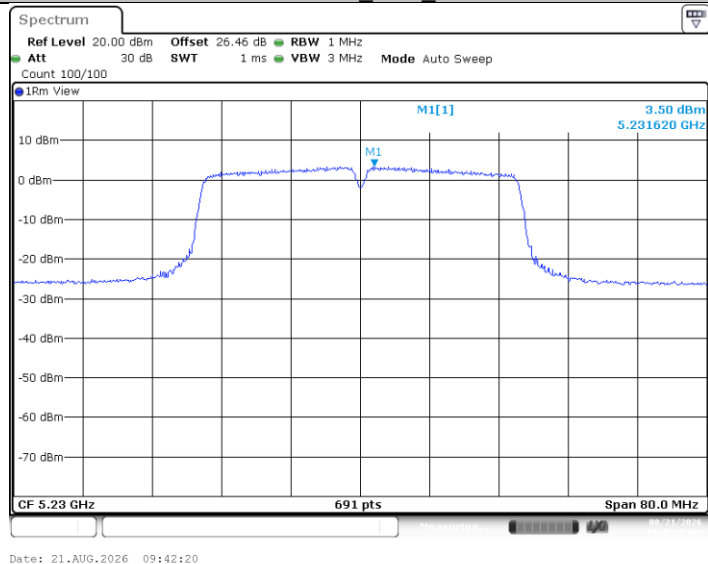


11N40SISO Ant1_5270

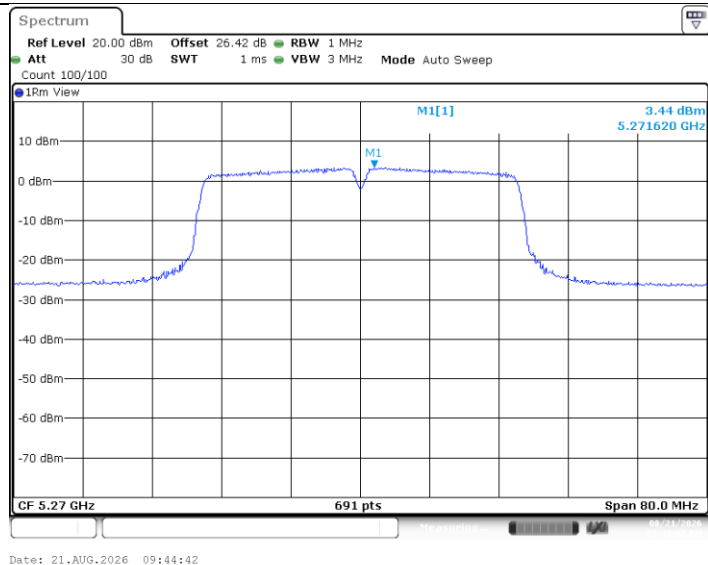


11N40SISO Ant1_5310

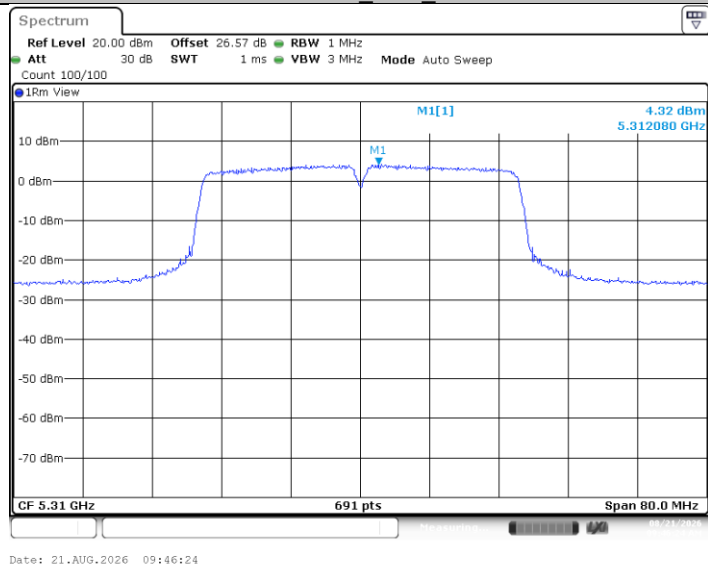


11N40SISO Ant1_5510

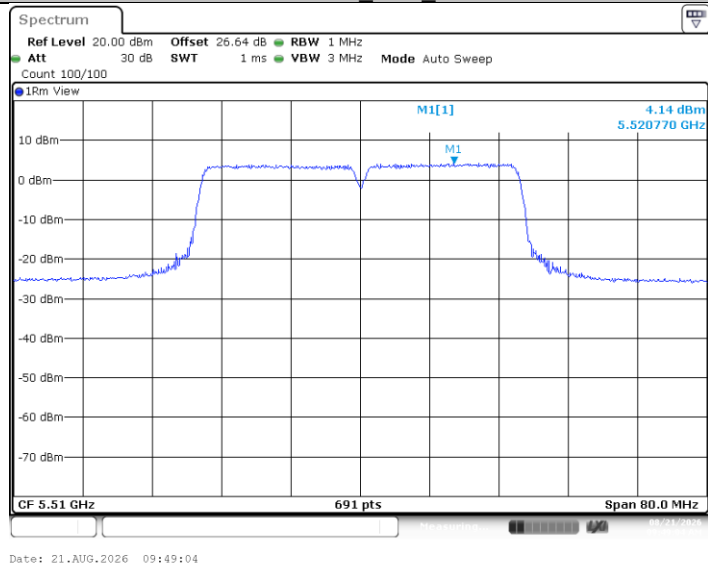


11N40SISO Ant1_5550

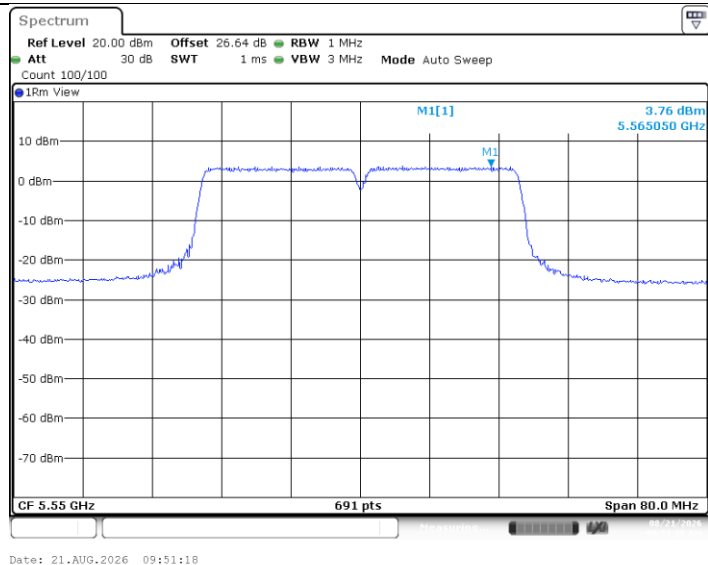


11N40SISO Ant1_5670

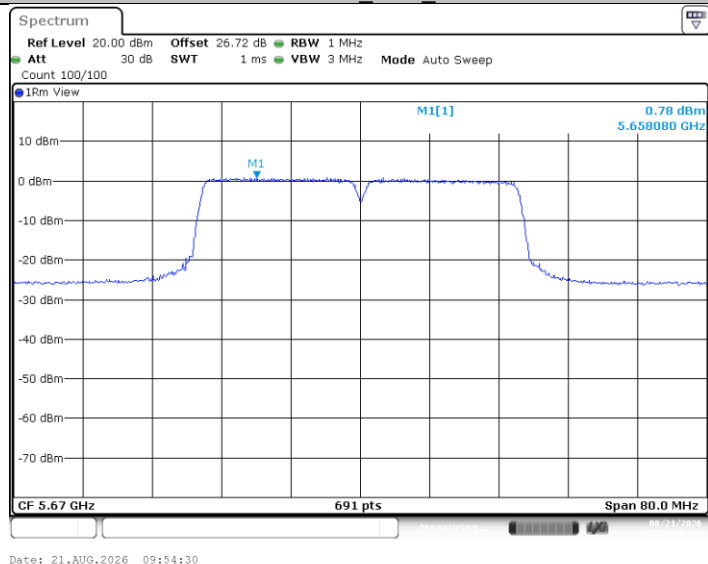


11N40SISO Ant1_5755

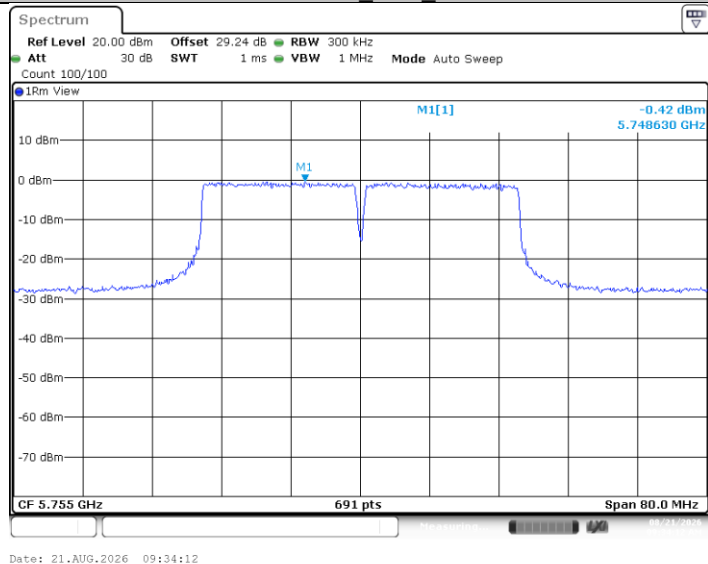


11N40SISO Ant1_5795

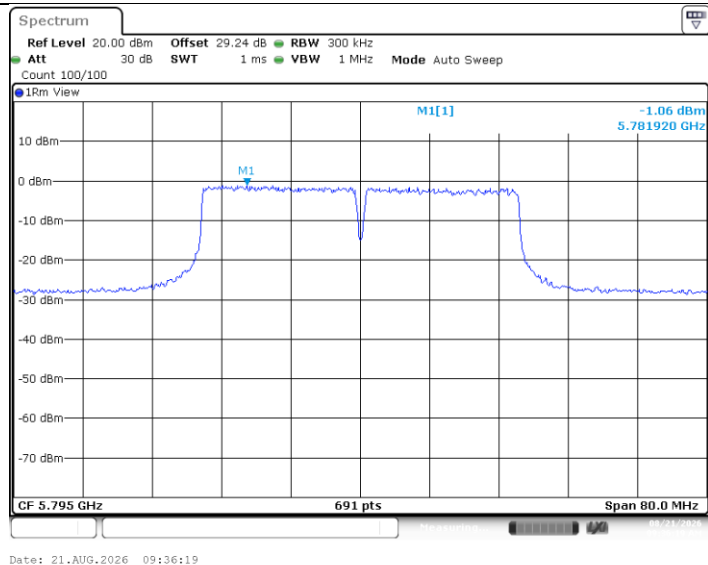


11AC20SISO_Ant1_5180

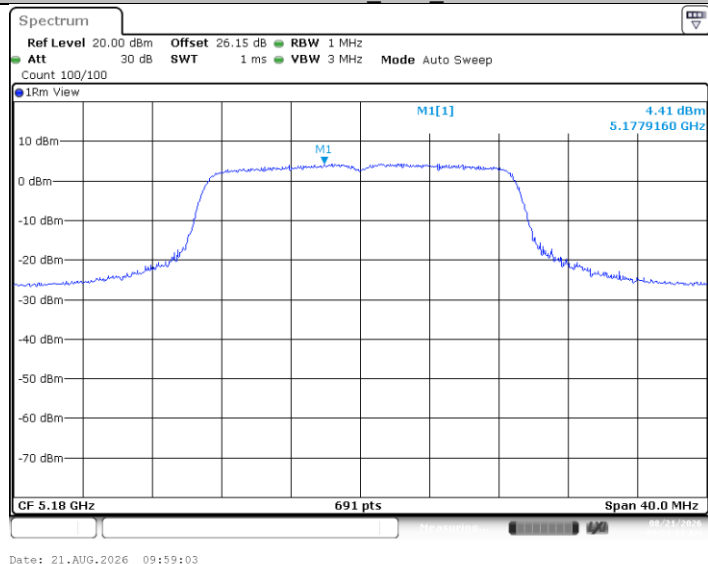


11AC20SISO_Ant1_5200

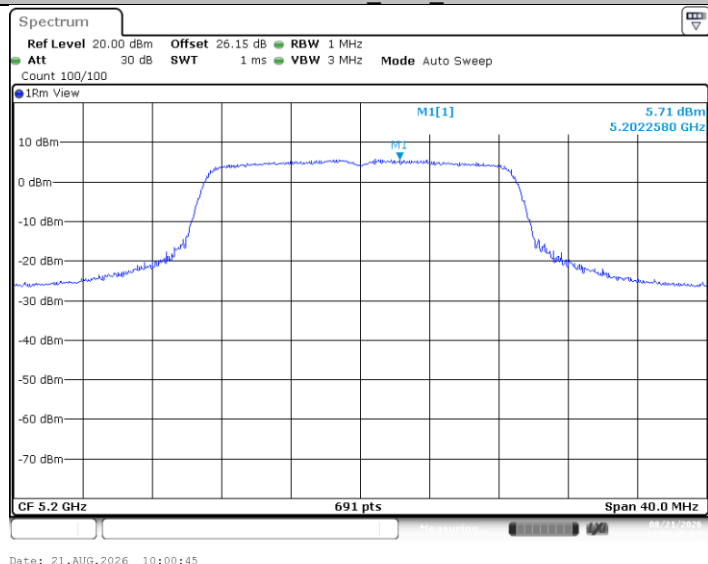


11AC20SISO_Ant1_5240

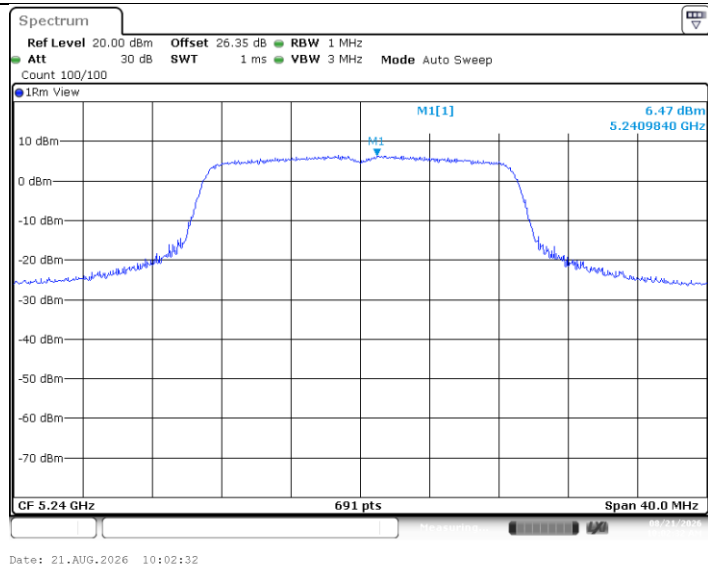


11AC20SISO_Ant1_5260

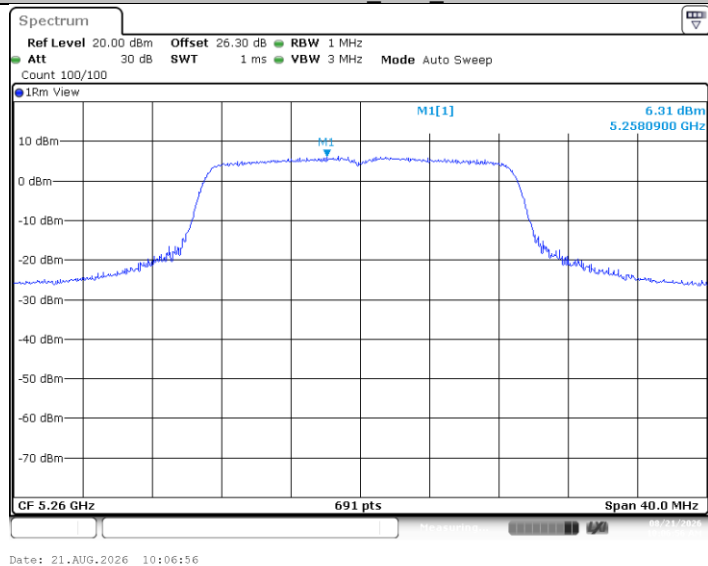

11AC20SISO_Ant1_5280

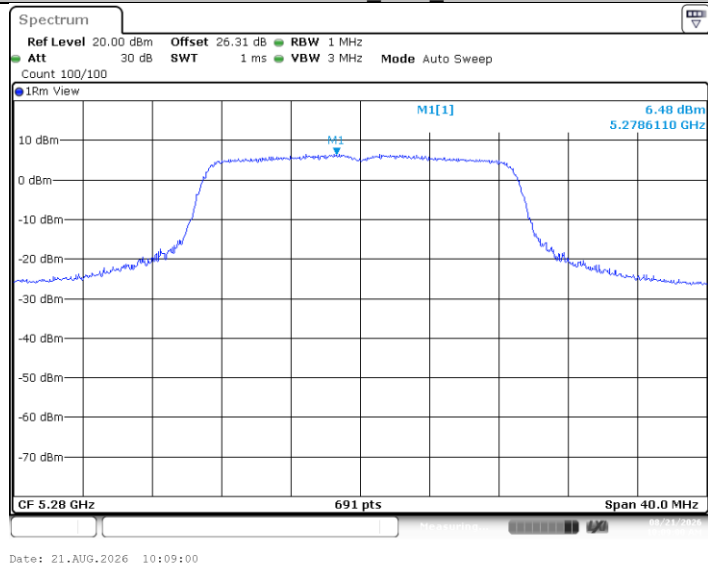


11AC20SISO_Ant1_5320

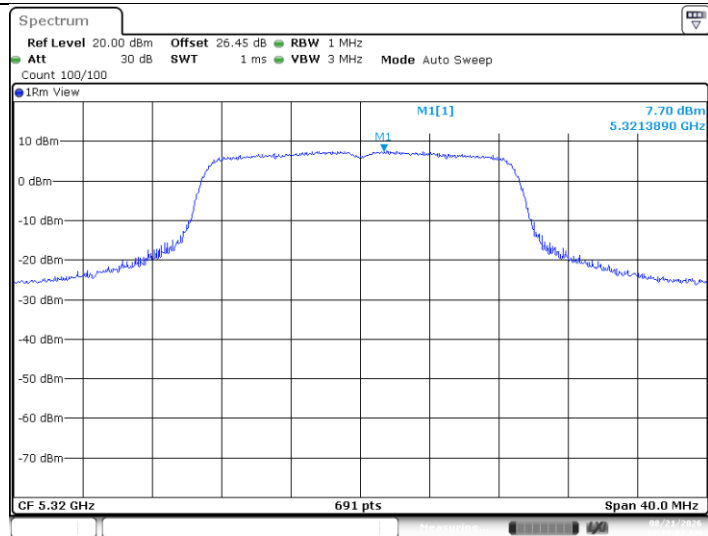


Date: 21.AUG.2026 10:11:07

11AC20SISO_Ant1_5500

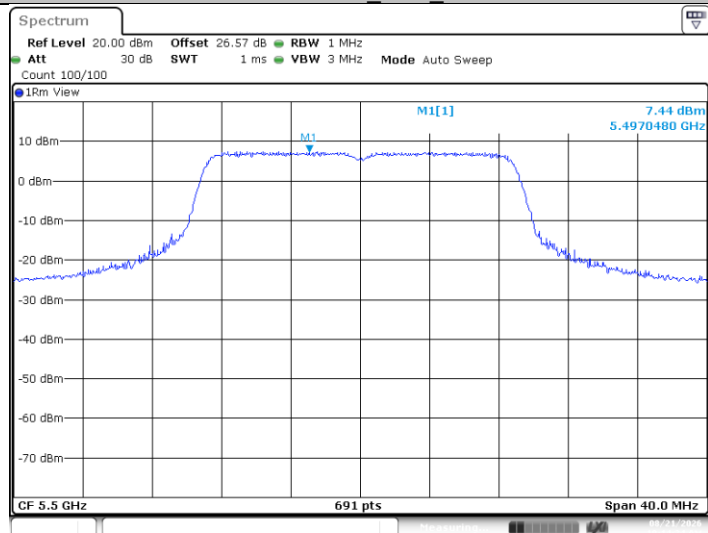


Date: 21.AUG.2026 10:14:34

11AC20SISO_Ant1_5580

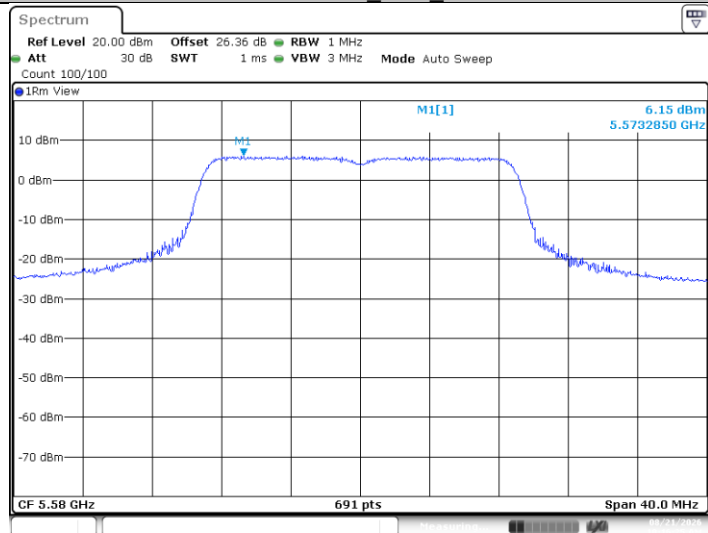


Date: 21.AUG.2026 10:16:25


11AC20SISO_Ant1_5700

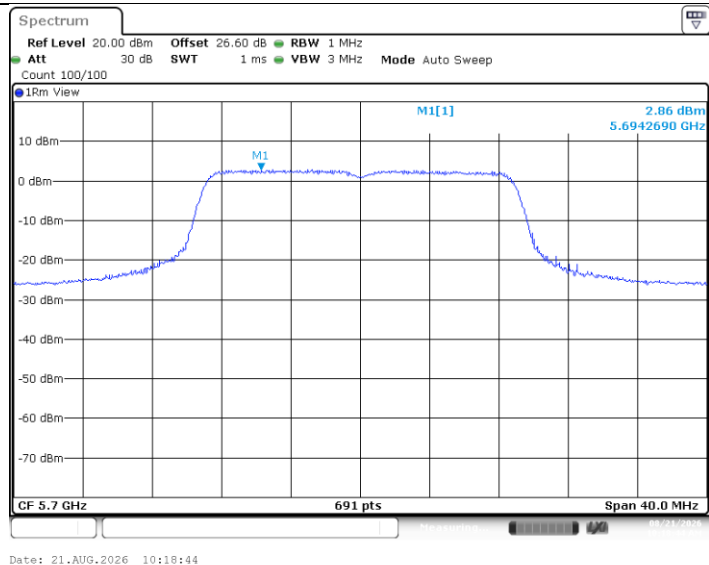


11AC20SISO_Ant1_5745

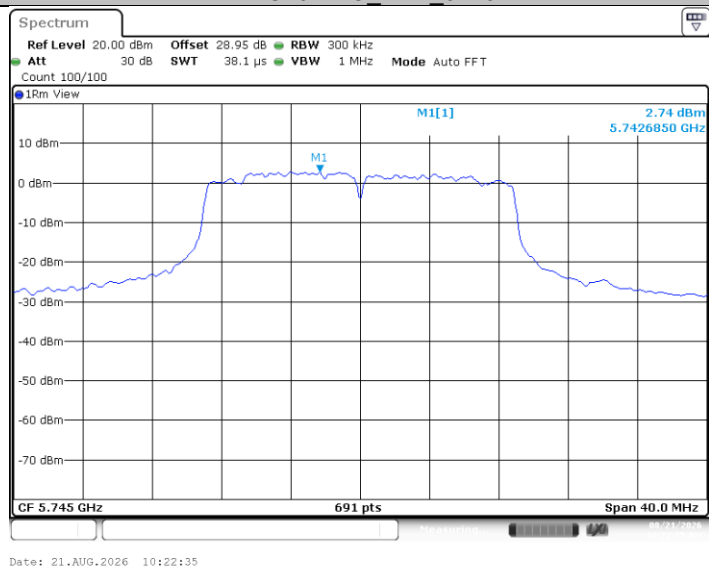


11AC20SISO_Ant1_5785

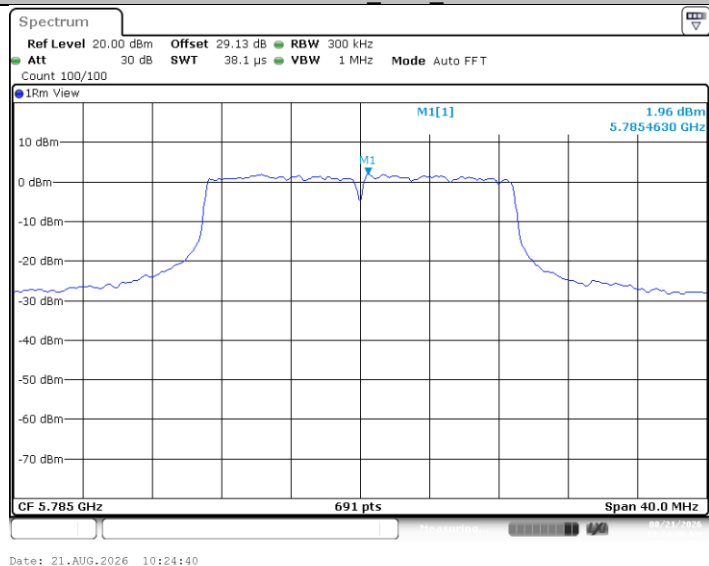


11AC20SISO_Ant1_5825

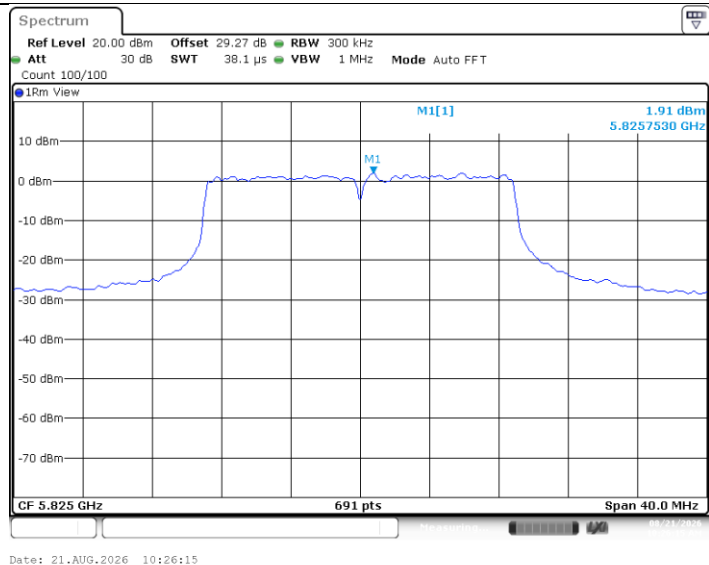


11AC40SISO_Ant1_5190

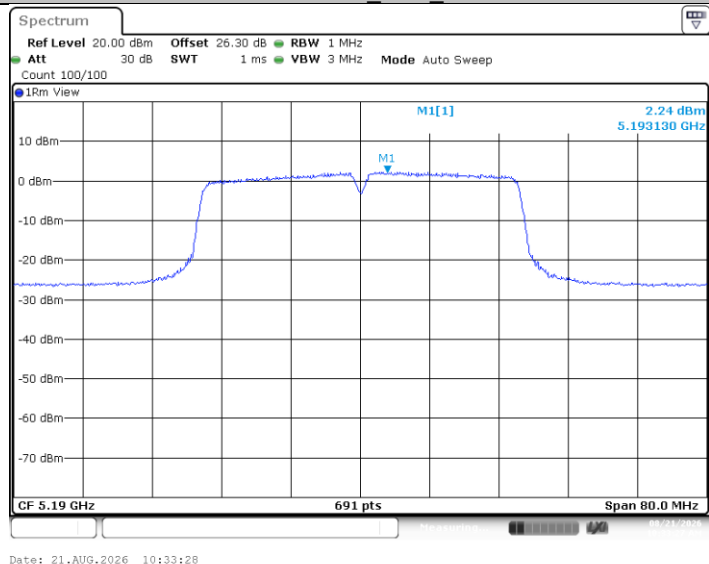


11AC40SISO_Ant1_5230

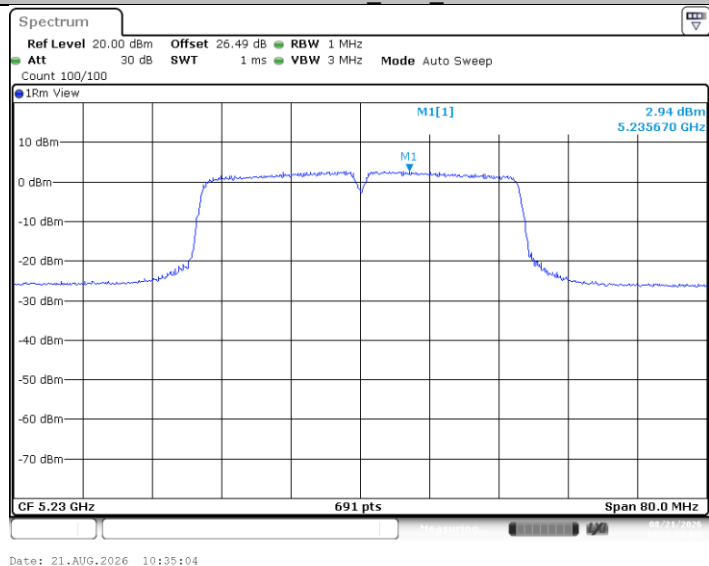


11AC40SISO_Ant1_5270

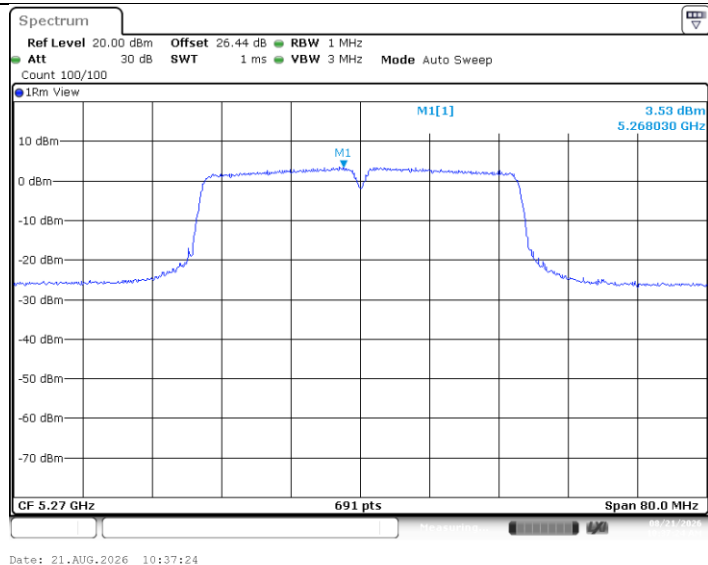


11AC40SISO_Ant1_5310

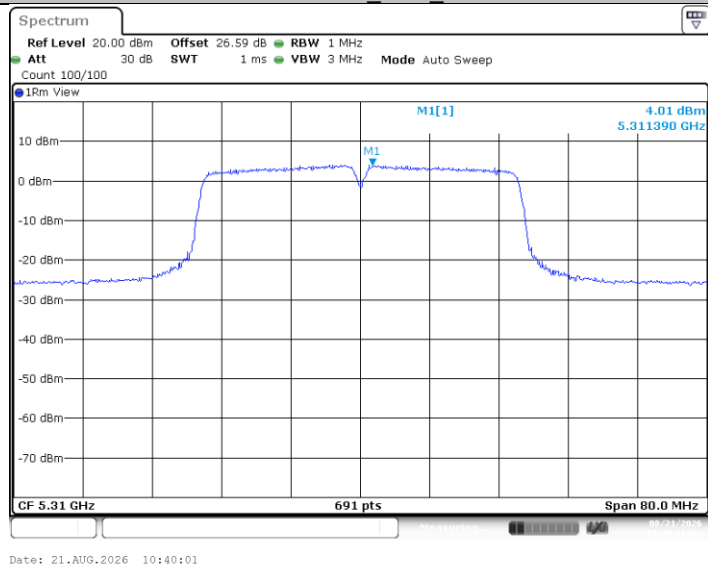


11AC40SISO_Ant1_5510

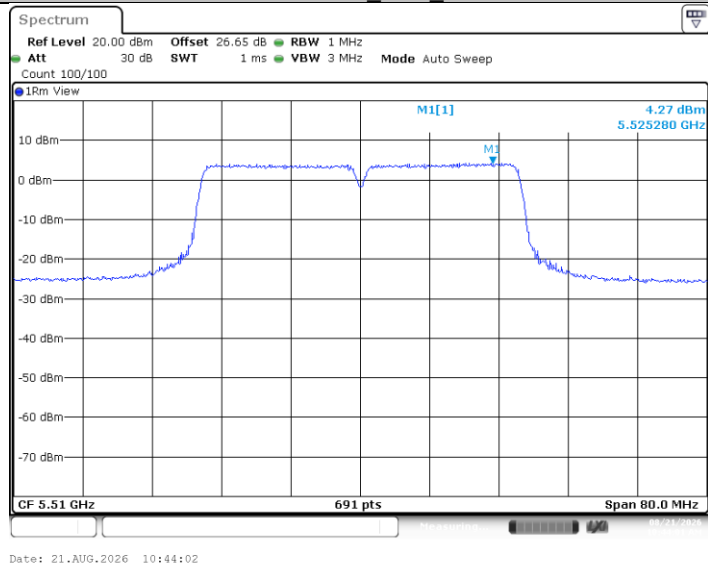


11AC40SISO_Ant1_5550

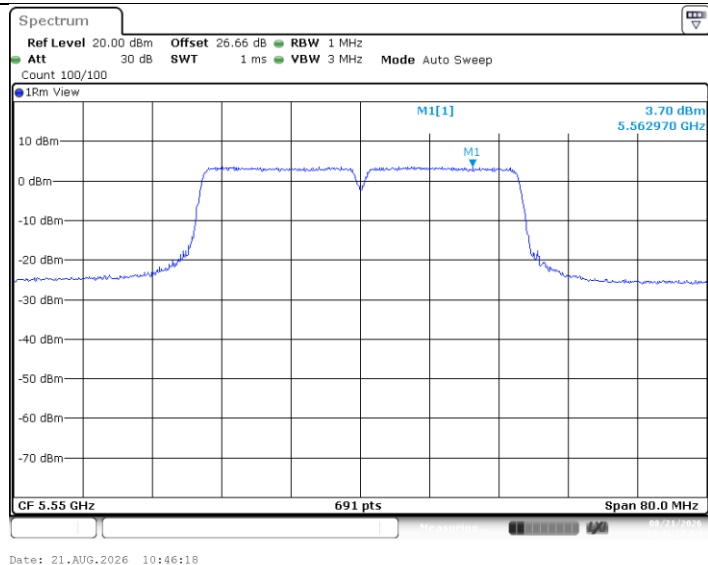


11AC40SISO_Ant1_5670

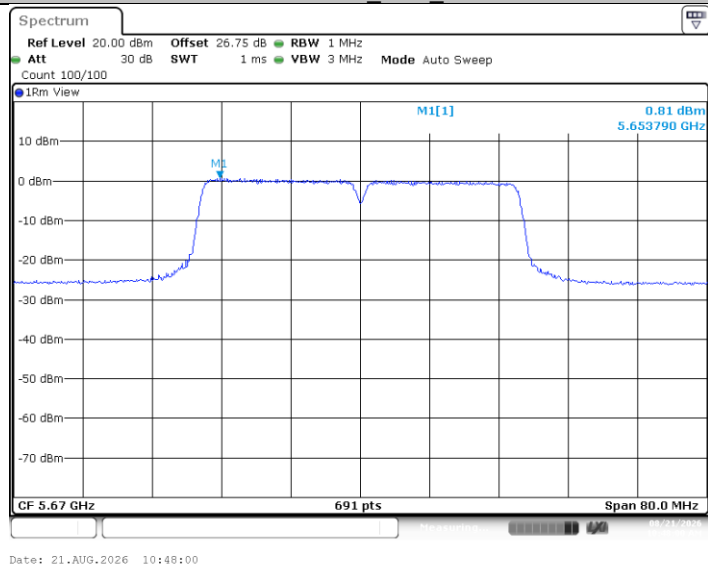


11AC40SISO_Ant1_5755

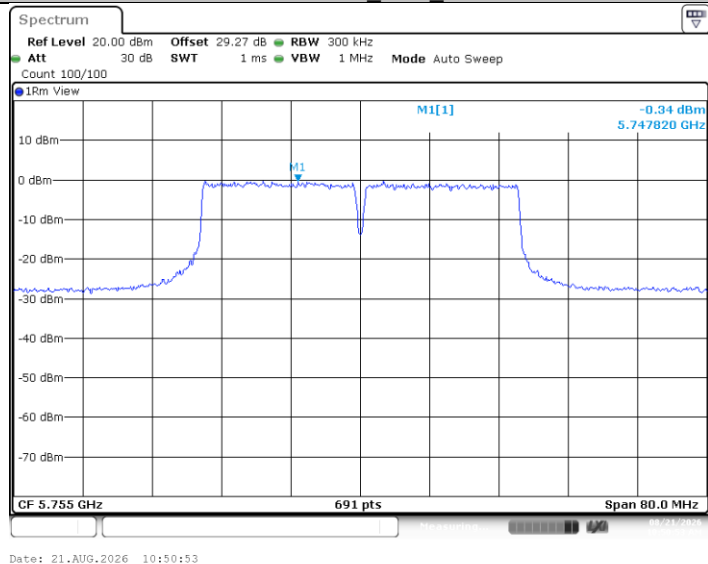


11AC40SISO_Ant1_5795

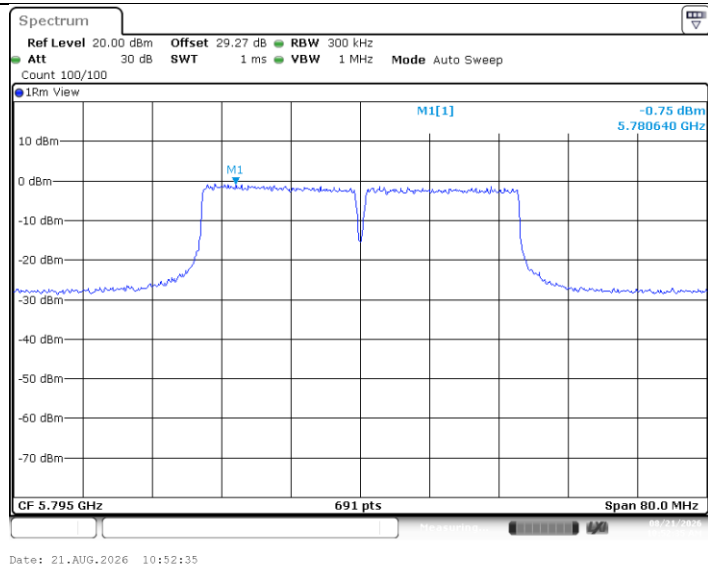


11AX20SISO_Ant1_5180

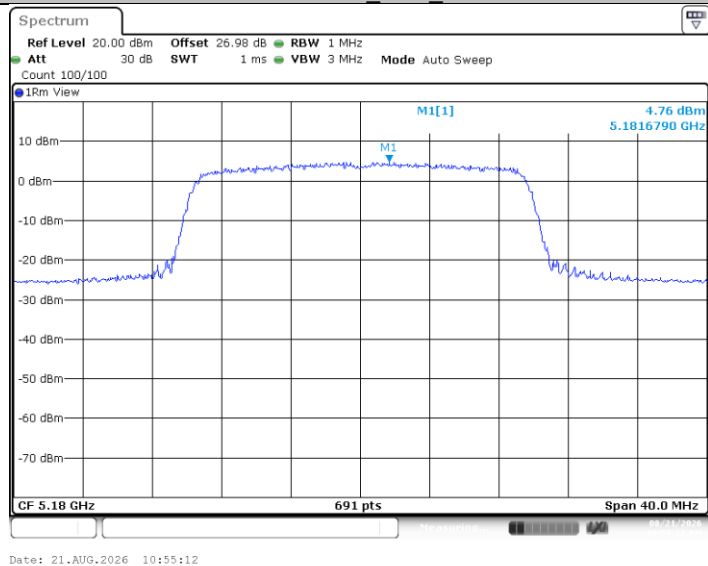


11AX20SISO_Ant1_5200

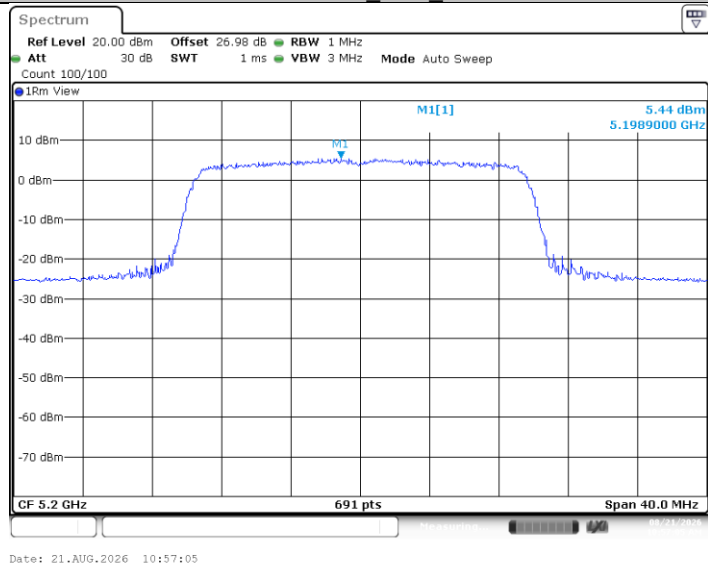


11AX20SISO_Ant1_5240

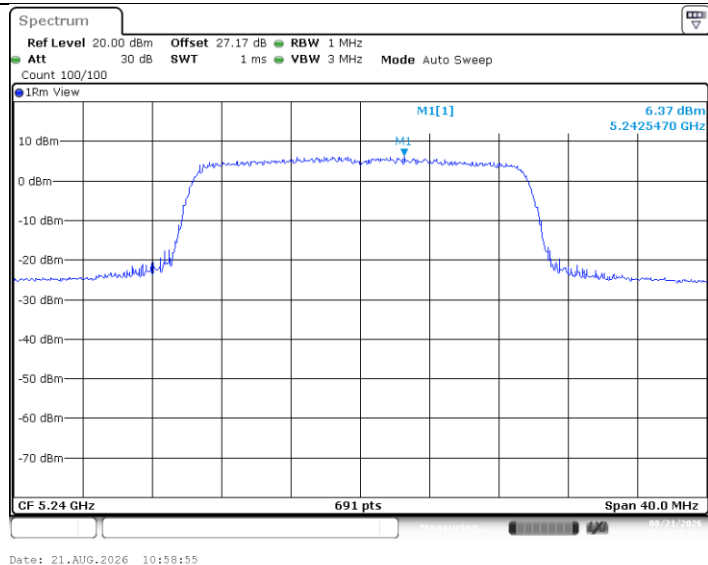


11AX20SISO_Ant1_5260

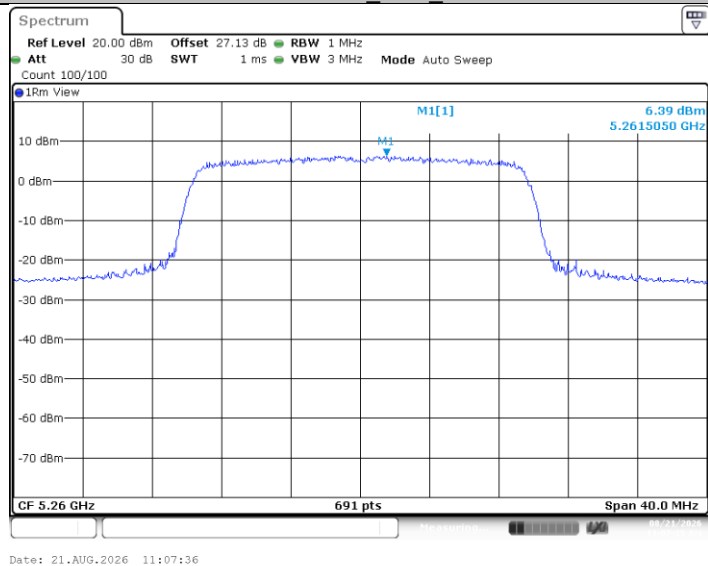


11AX20SISO_Ant1_5280

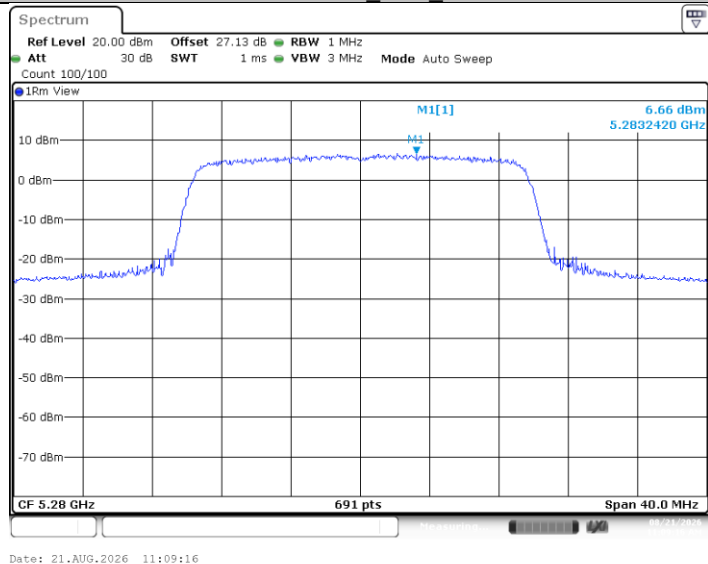


11AX20SISO_Ant1_5320

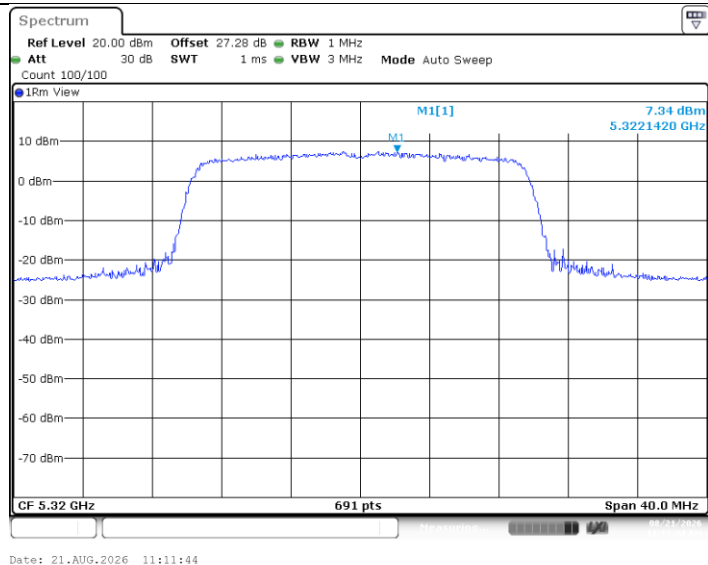


11AX20SISO_Ant1_5500

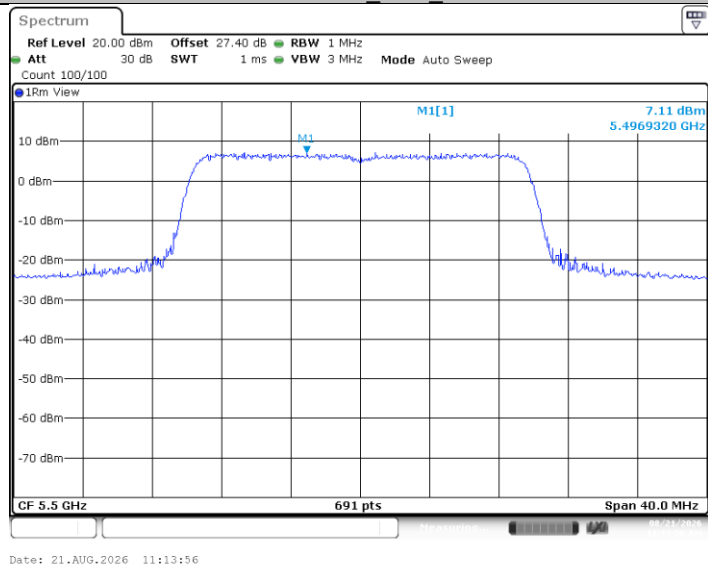


11AX20SISO_Ant1_5580

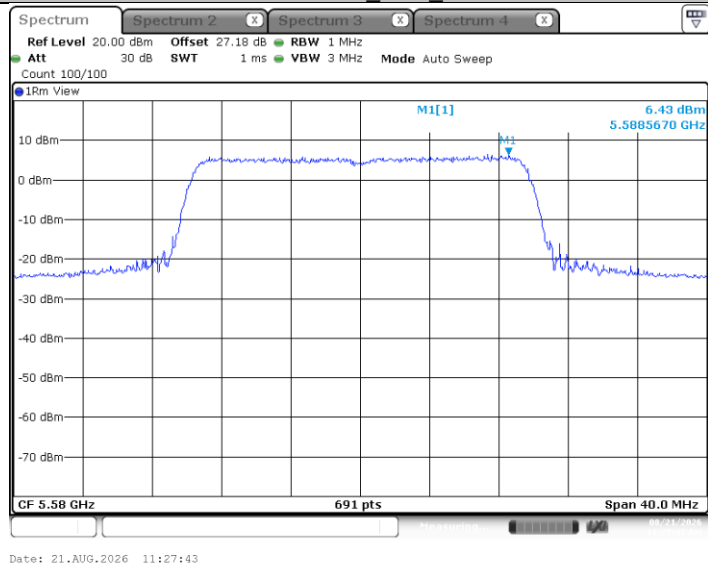


11AX20SISO_Ant1_5700

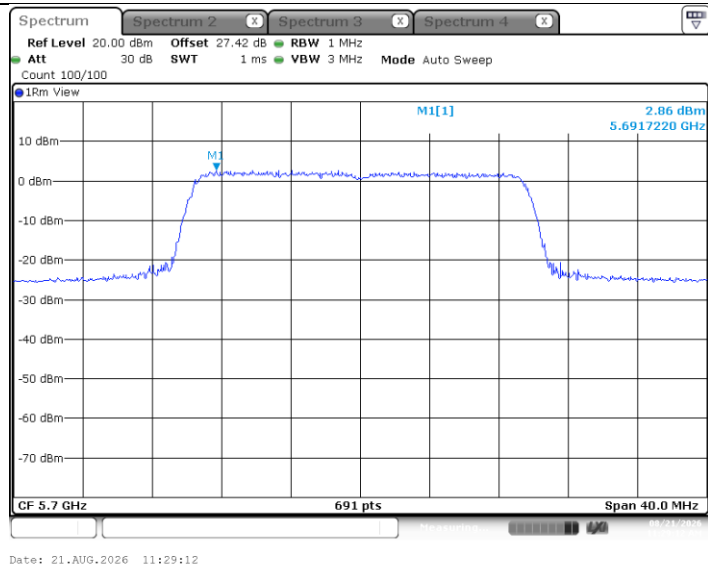


11AX20SISO_Ant1_5745

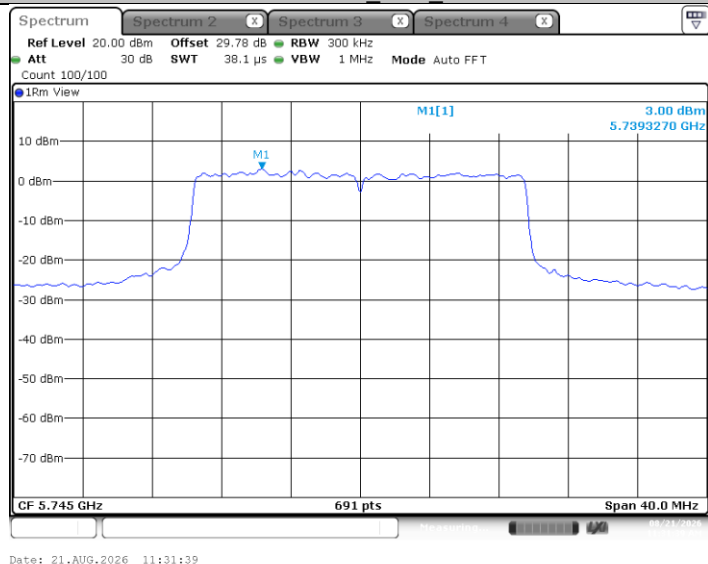


11AX20SISO_Ant1_5785

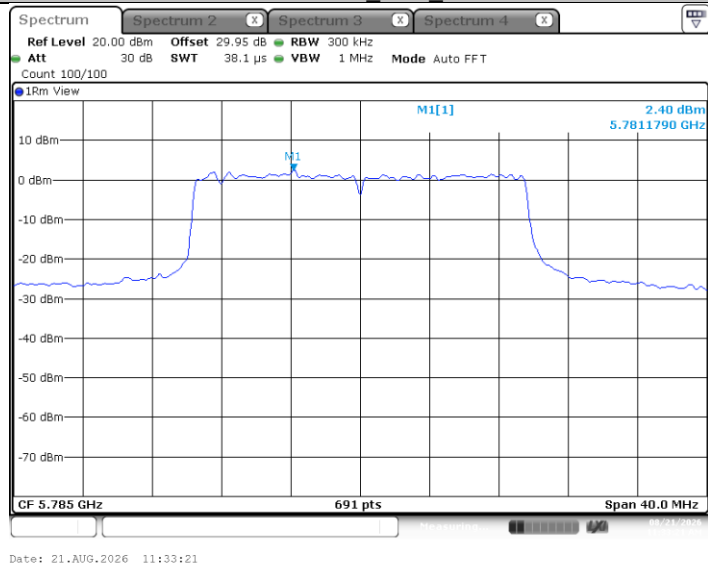


11AX20SISO_Ant1_5825

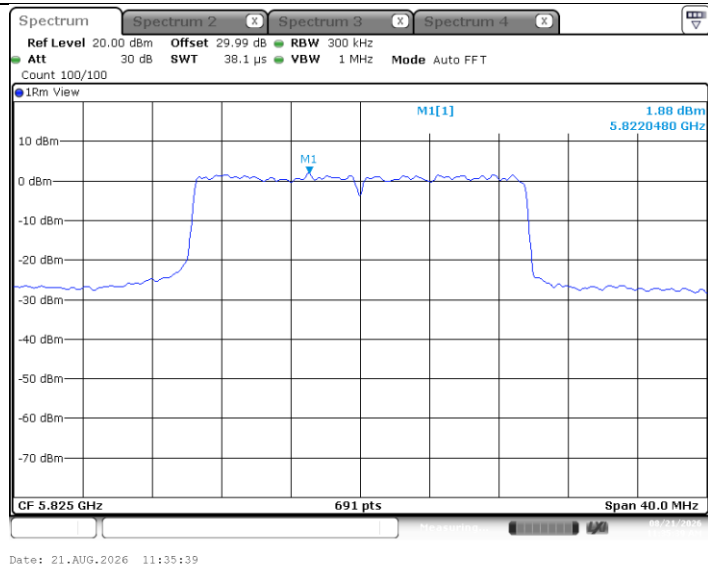


11AX40SISO_Ant1_5190

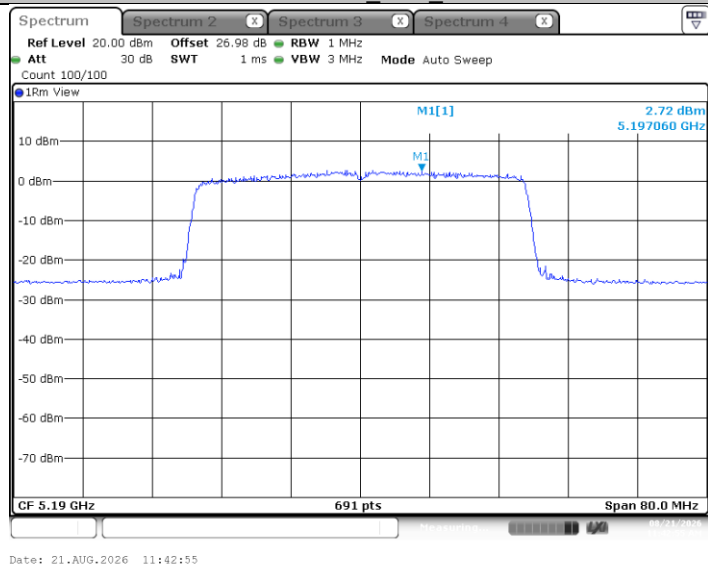


11AX40SISO_Ant1_5230

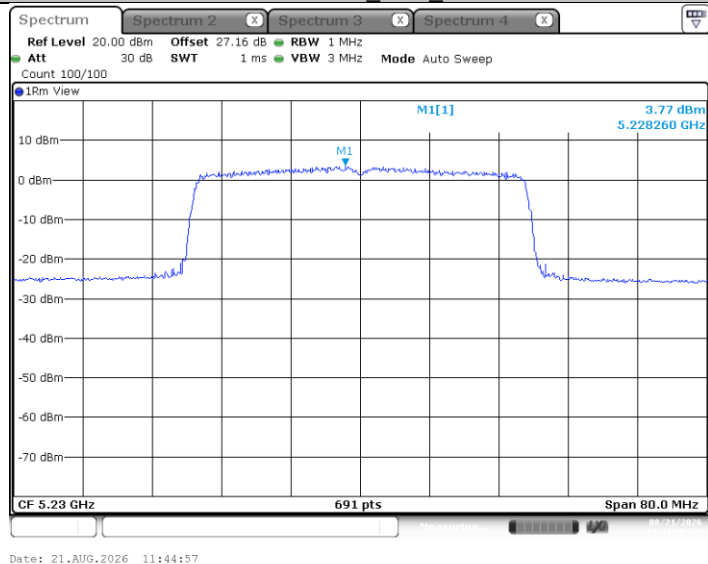


11AX40SISO_Ant1_5270

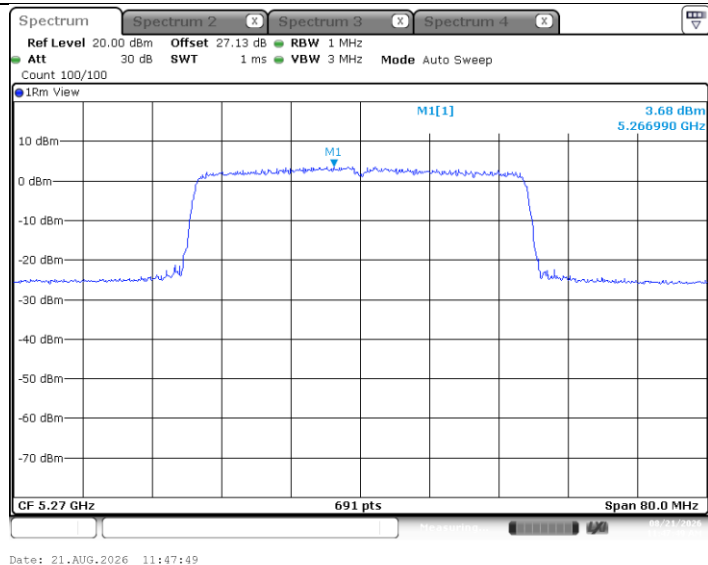

11AX40SISO_Ant1_5310

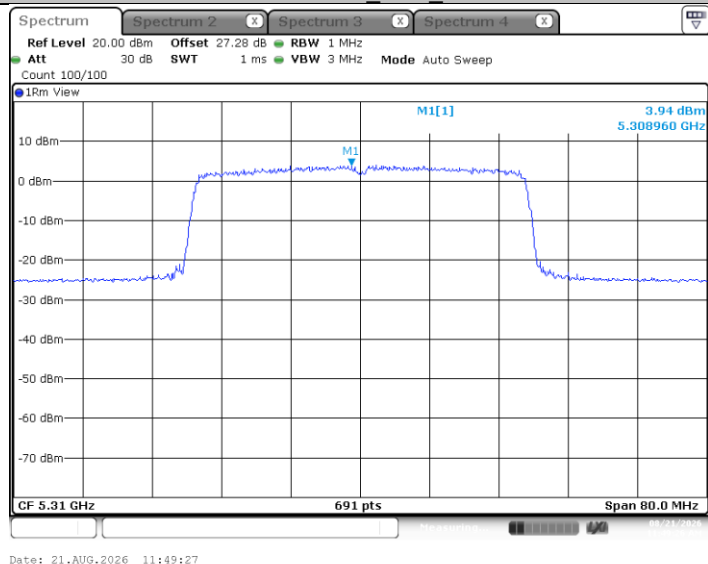

11AX40SISO_Ant1_5510

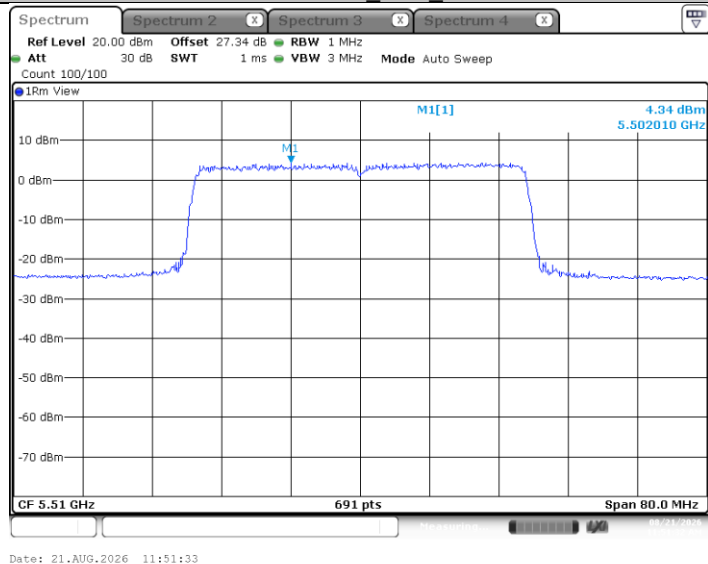

11AX40SISO_Ant1_5550