






Tx. Spurious NVNT 2-DH5 2402MHz Ant1 Emission

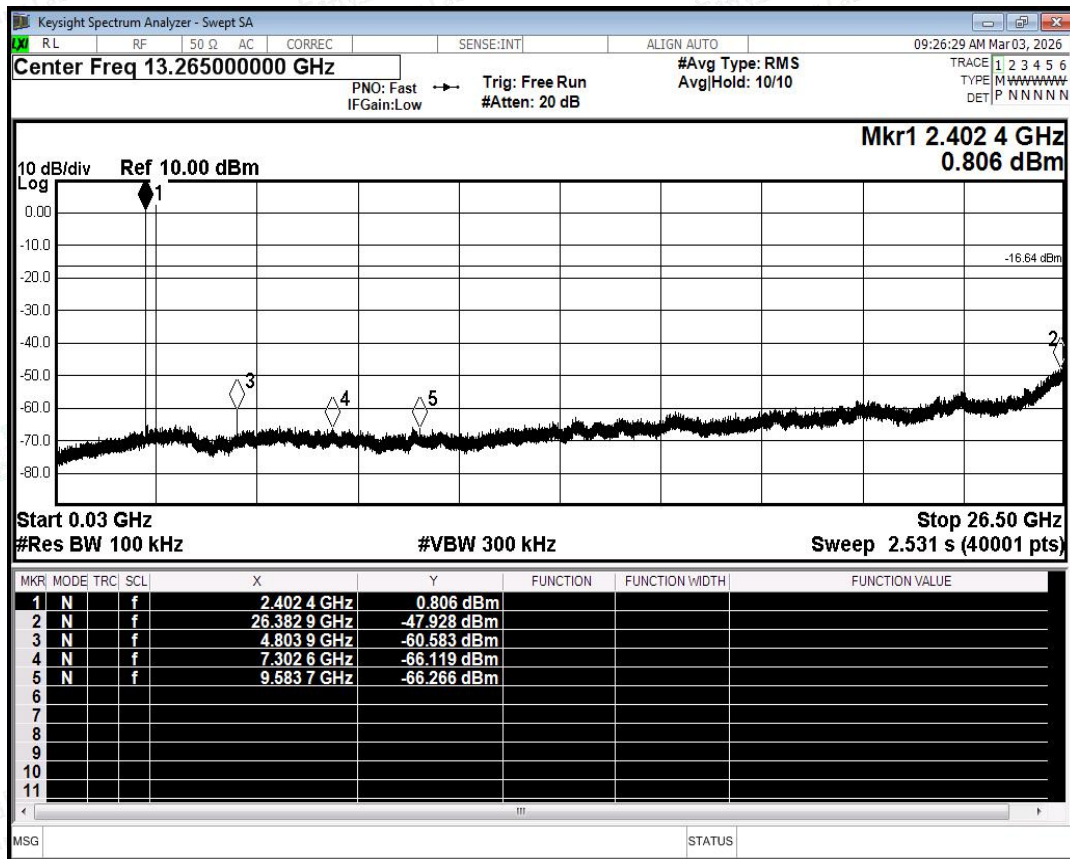

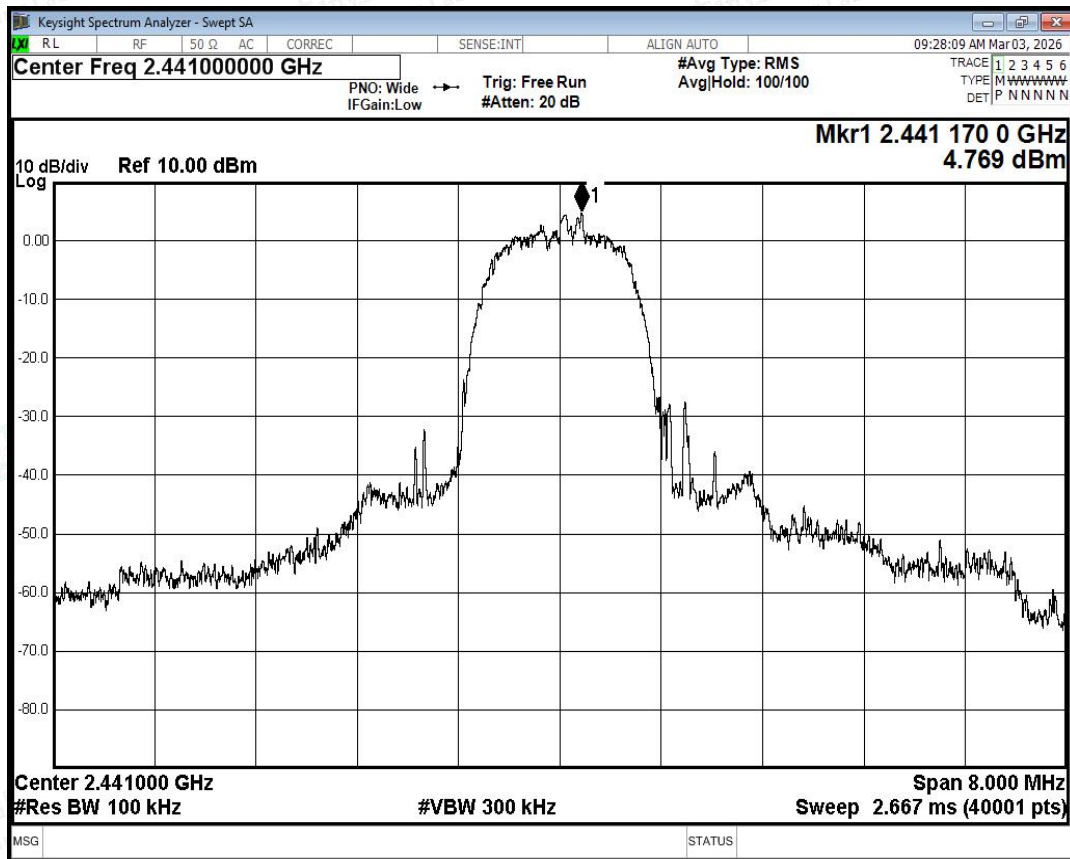

Tx. Spurious NVNT 2-DH5 2441MHz Ant1 Ref



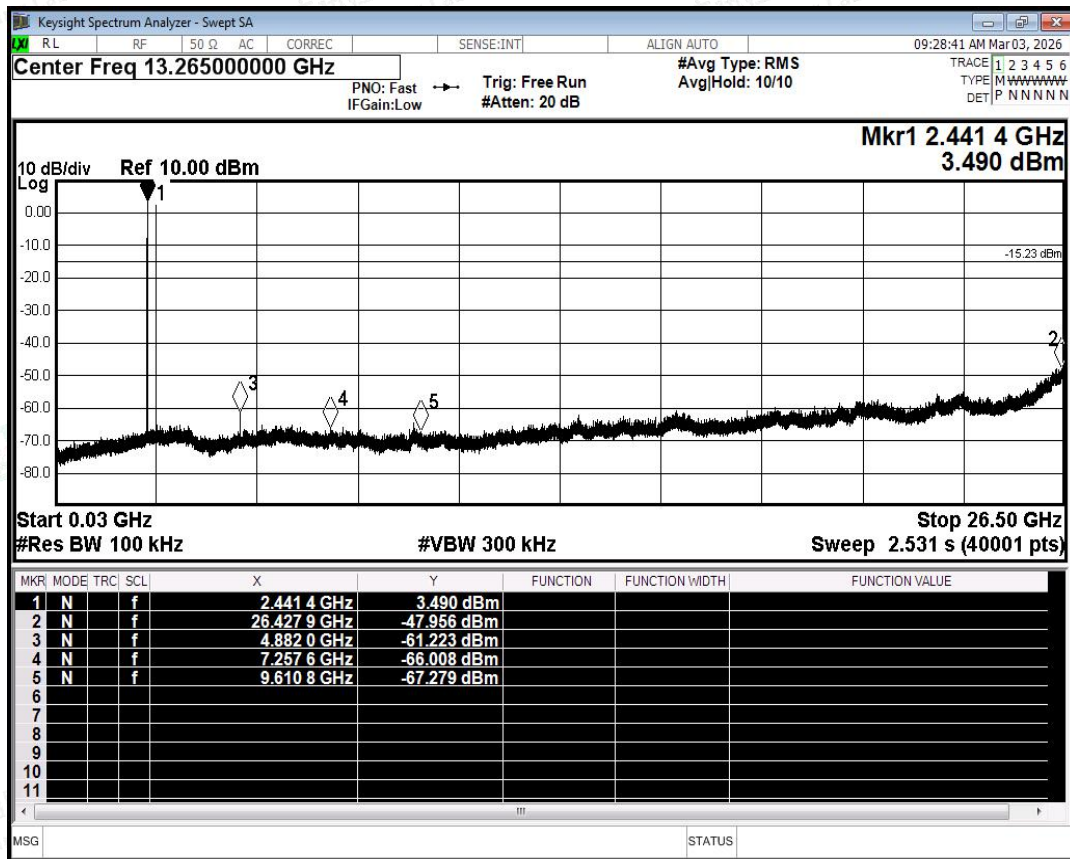

Tx. Spurious NVNT 2-DH5 2441MHz Ant1 Emission




Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

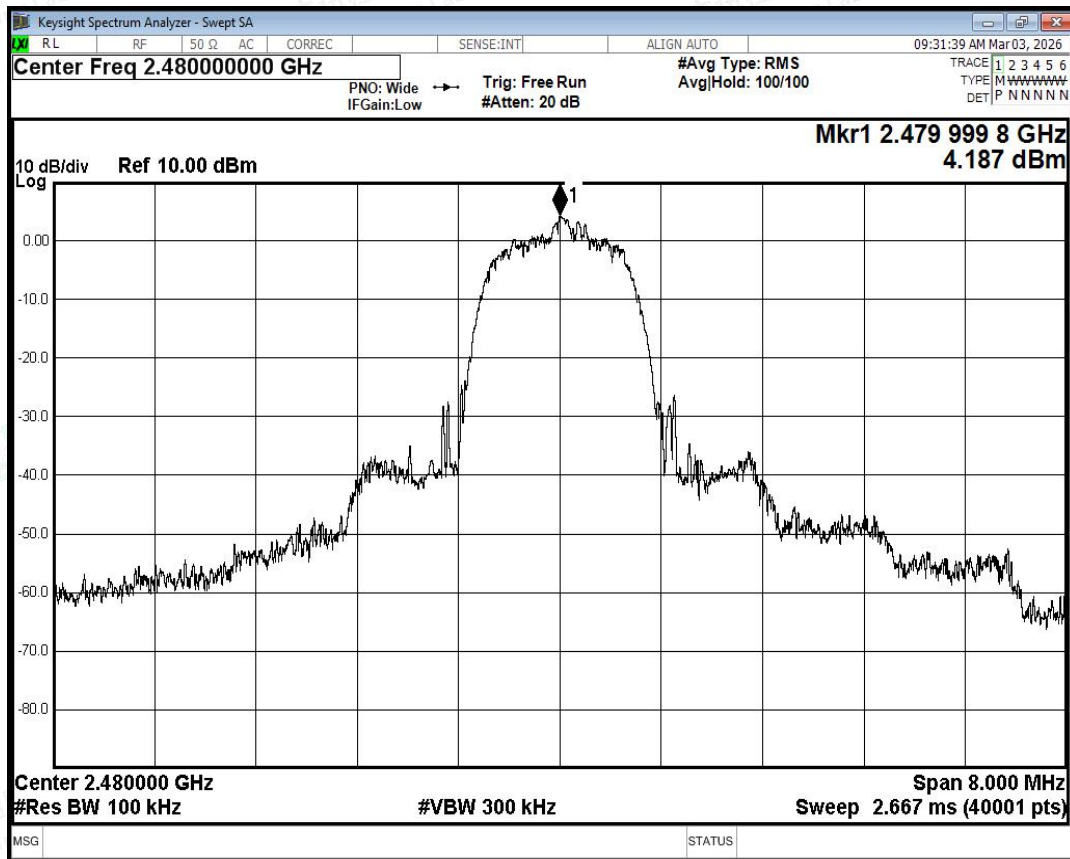

Tx. Spurious NVNT 2-DH5 2480MHz Ant1 Ref




Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China


Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

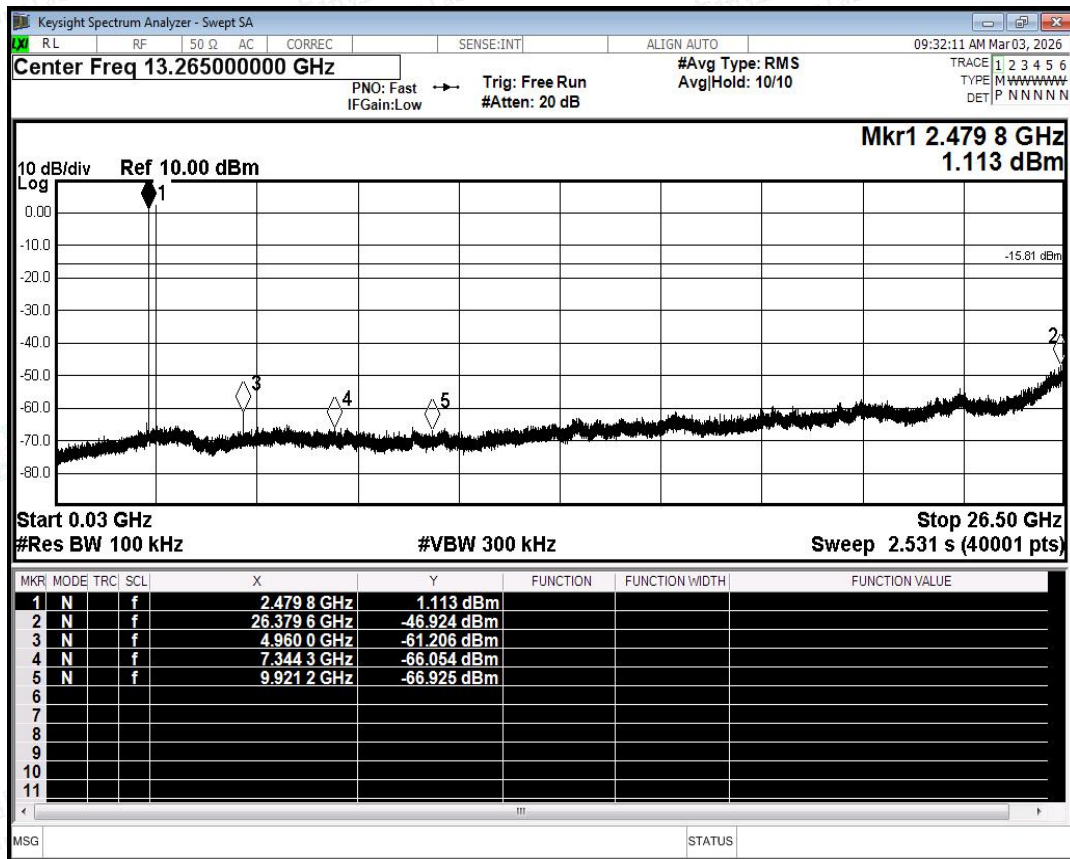

Tx. Spurious NVNT 2-DH5 2480MHz Ant1 Emission



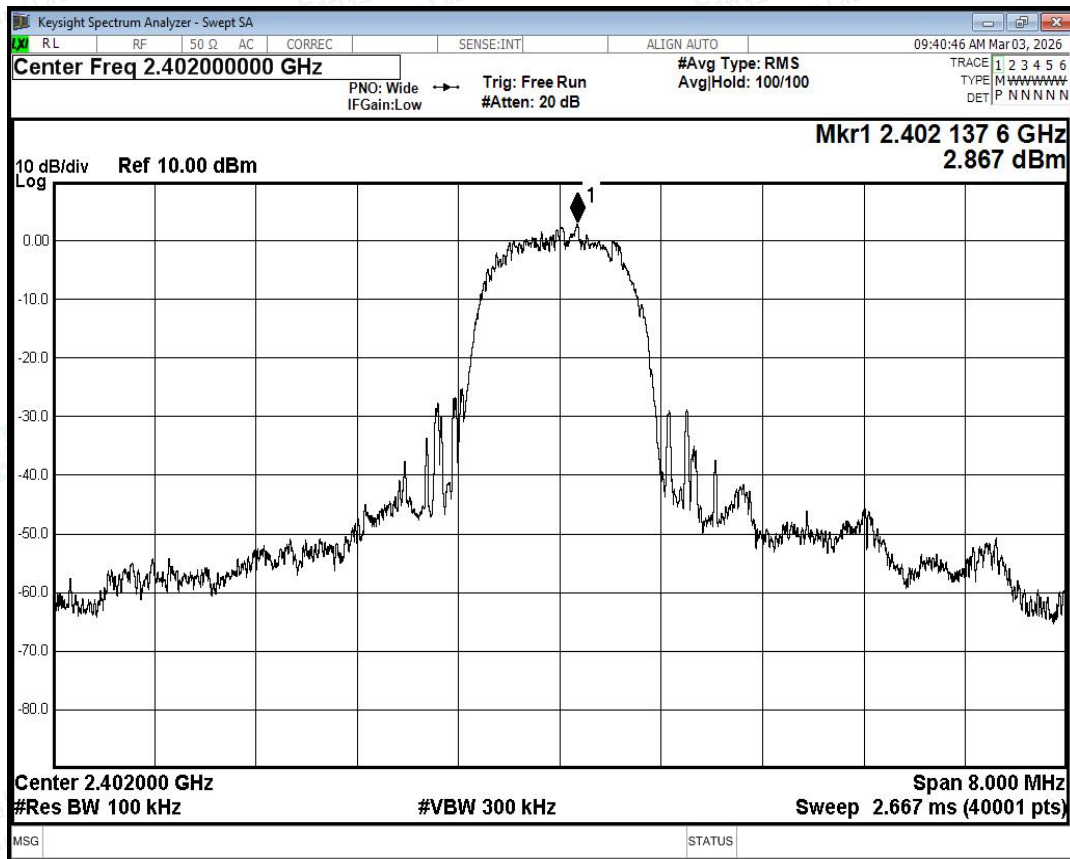

Tx. Spurious NVNT 3-DH5 2402MHz Ant1 Ref




Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China


Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

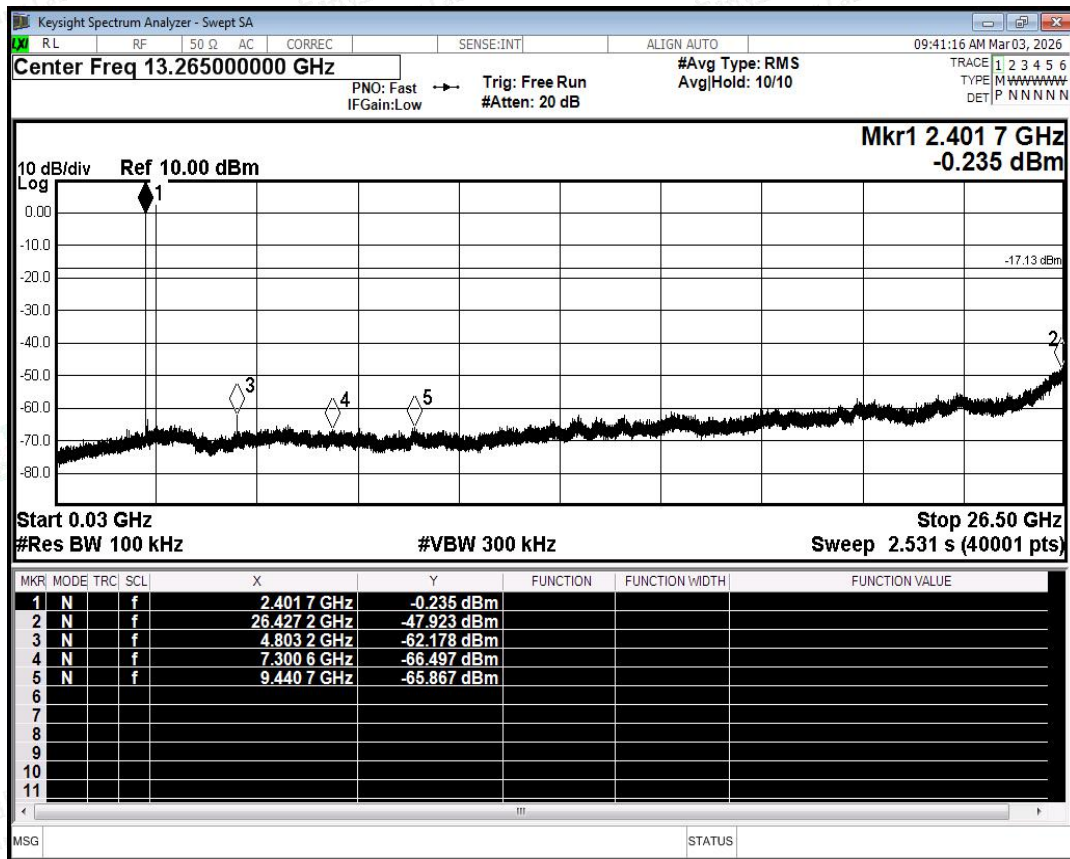

Tx. Spurious NVNT 3-DH5 2402MHz Ant1 Emission



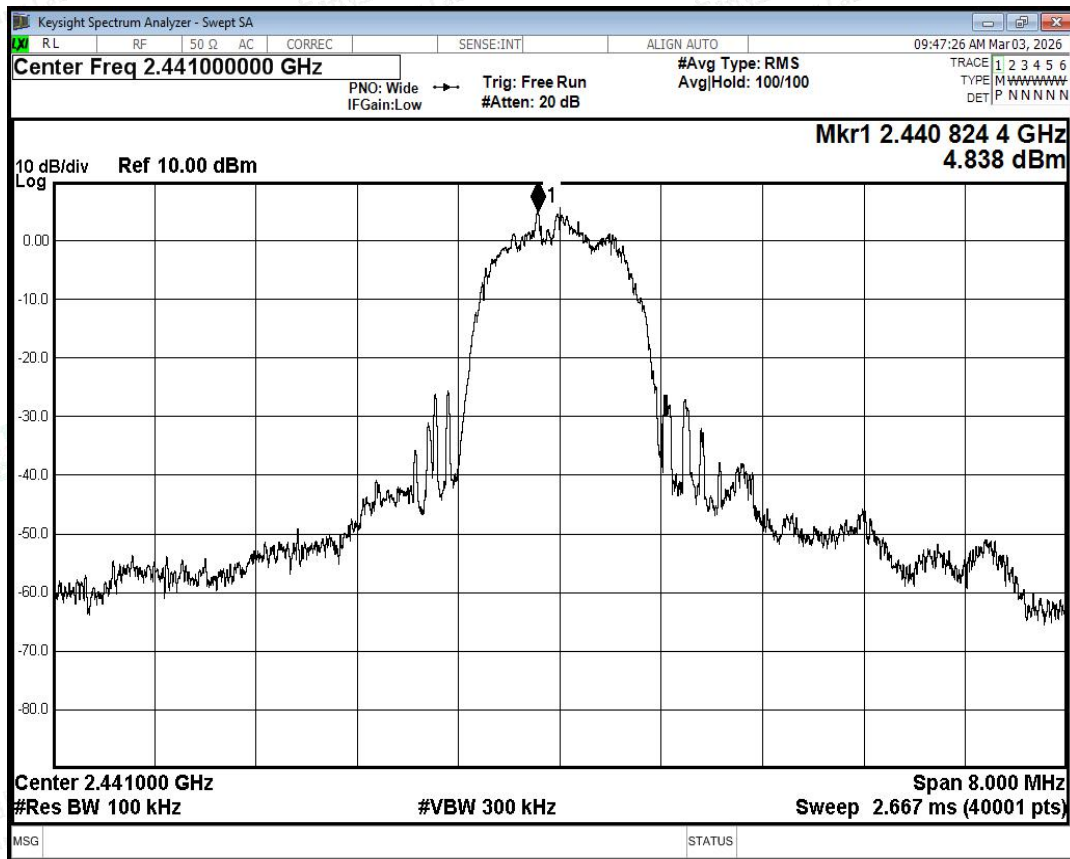

Tx. Spurious NVNT 3-DH5 2441MHz Ant1 Ref




Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

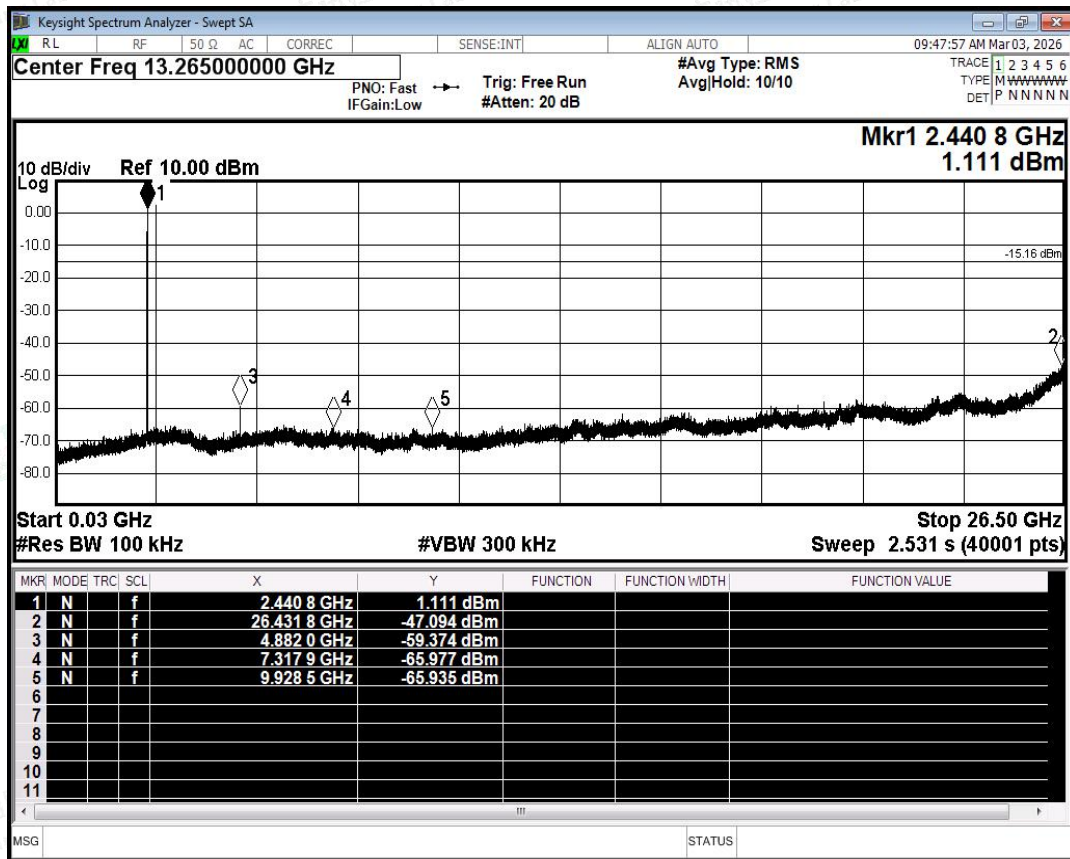

Tx. Spurious NVNT 3-DH5 2441MHz Ant1 Emission




Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China


Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

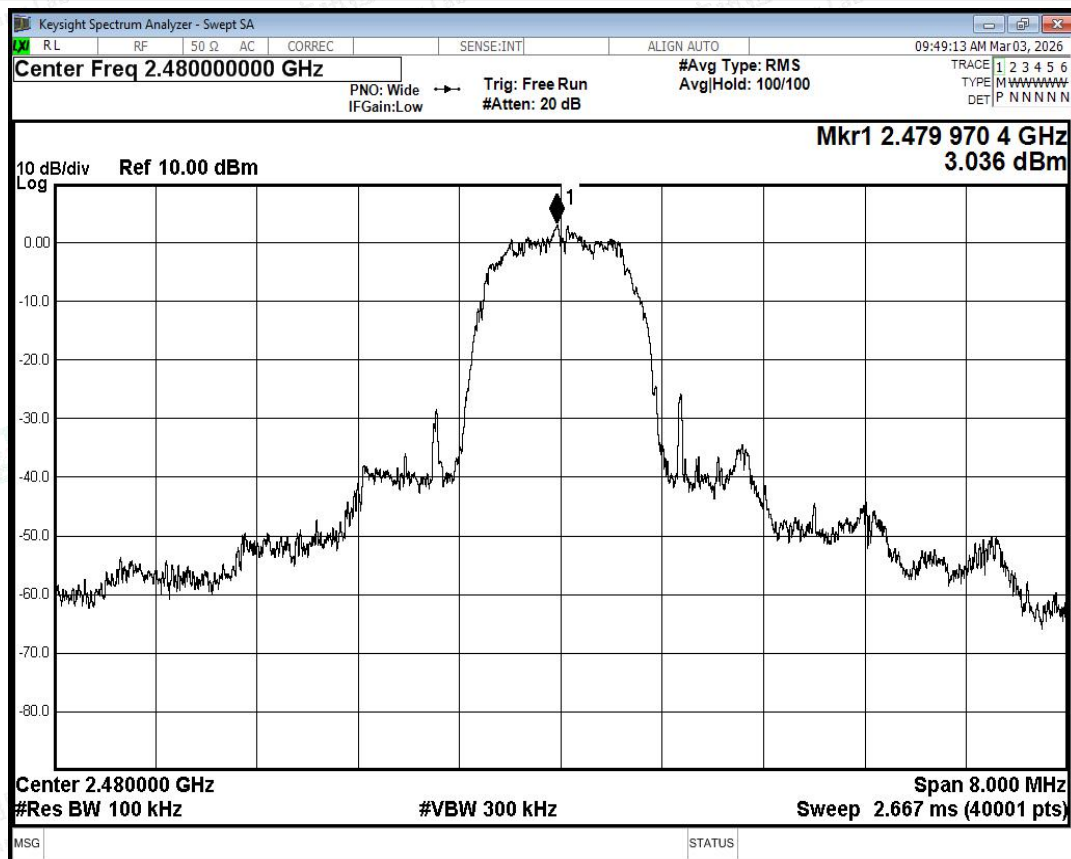

Tx. Spurious NVNT 3-DH5 2480MHz Ant1 Ref



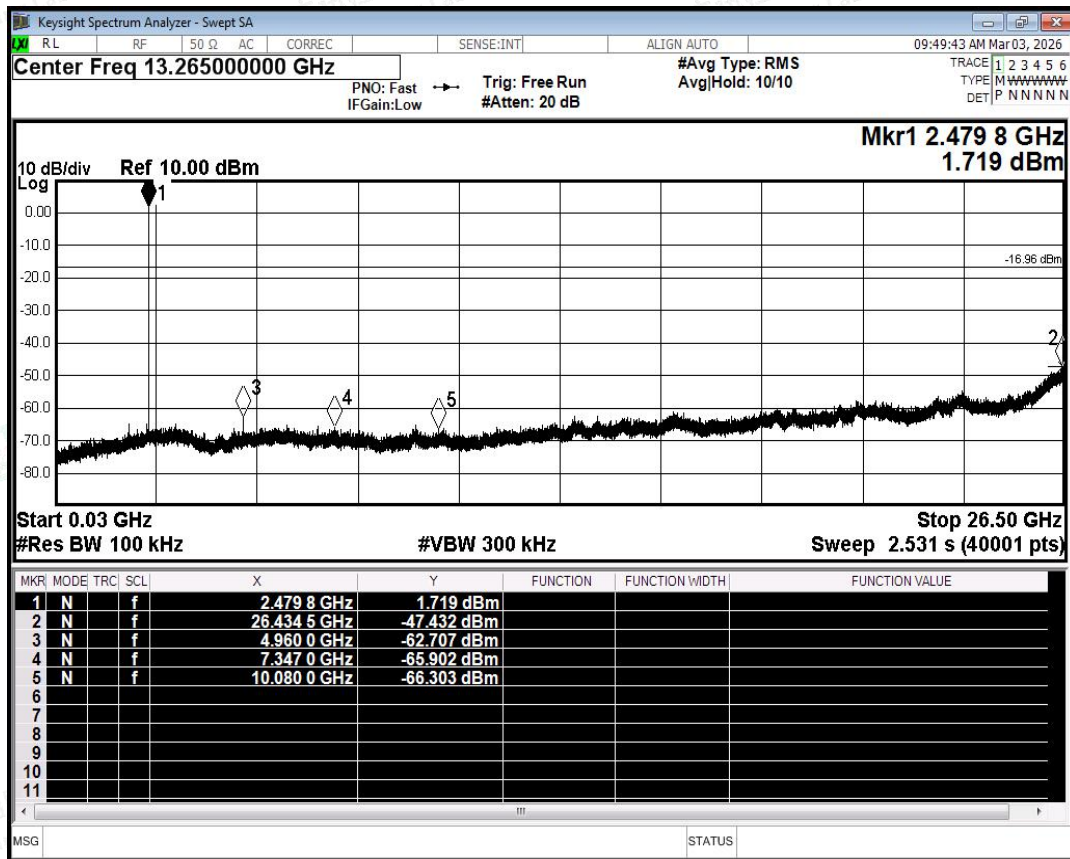

Tx. Spurious NVNT 3-DH5 2480MHz Ant1 Emission






A.8 Duty Cycle


Condition	Mode	Frequency (MHz)	Antenna	Duty Cycle (%)	Correction Factor (dB)	1/T (kHz)
NVNT	1-DH5	2402	Ant1	77.6	1.1	0.34
NVNT	1-DH5	2441	Ant1	77.6	1.1	0.34
NVNT	1-DH5	2480	Ant1	77.6	1.1	0.34
NVNT	2-DH5	2402	Ant1	77.36	1.11	0.34
NVNT	2-DH5	2441	Ant1	77.36	1.11	0.34
NVNT	2-DH5	2480	Ant1	77.36	1.11	0.34
NVNT	3-DH5	2402	Ant1	77.28	1.12	0.35
NVNT	3-DH5	2441	Ant1	77.36	1.11	0.34
NVNT	3-DH5	2480	Ant1	77.28	1.12	0.35



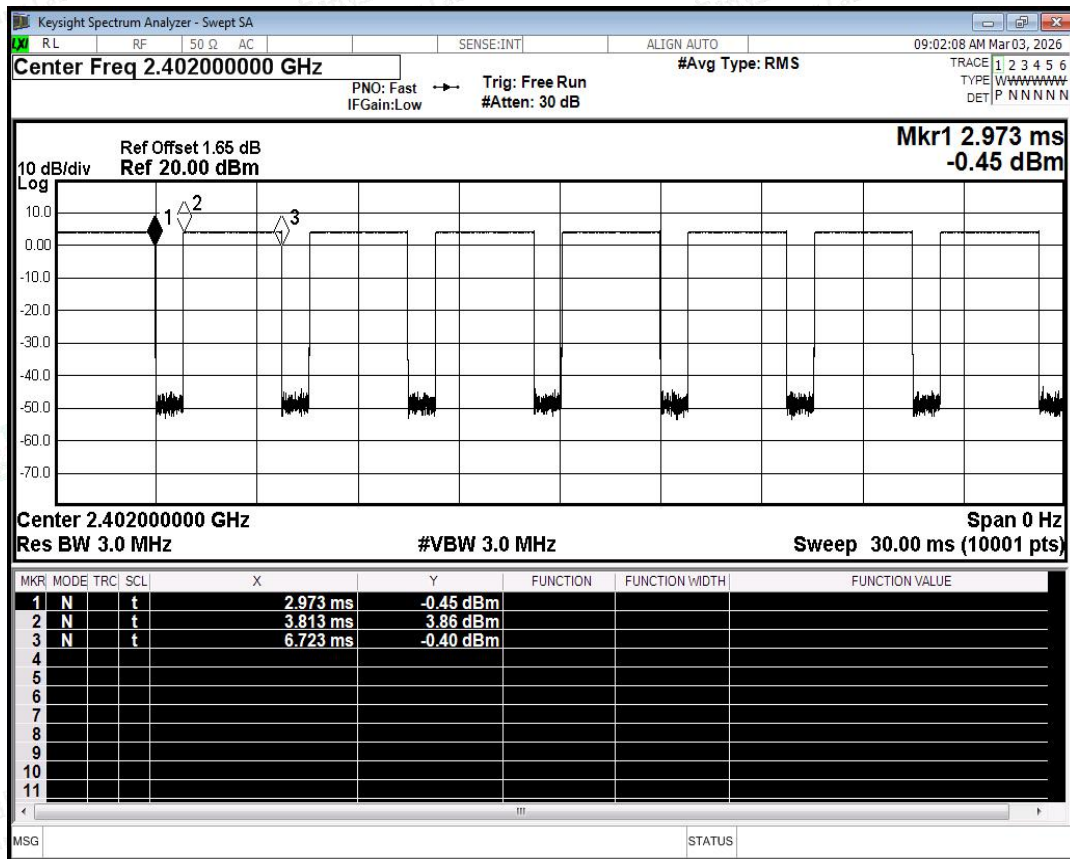


Duty Cycle NVNT 1-DH5 2402MHz Ant1



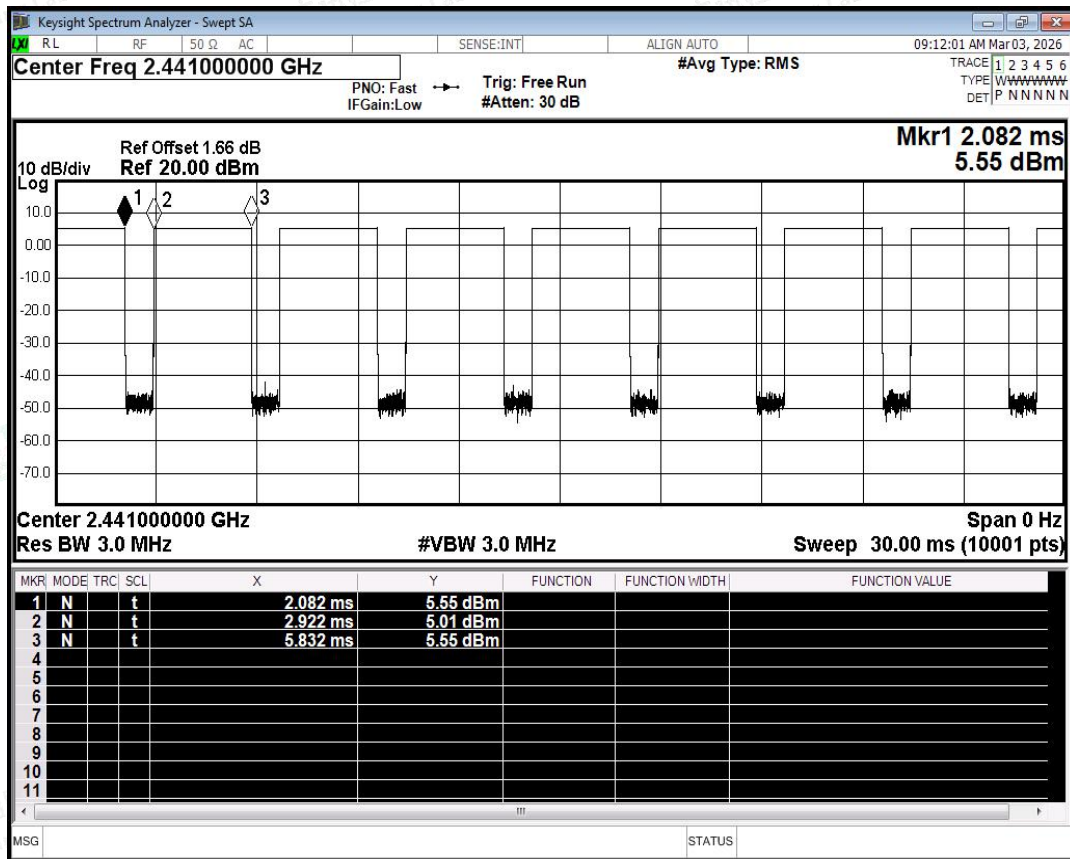


Duty Cycle NVNT 1-DH5 2441MHz Ant1



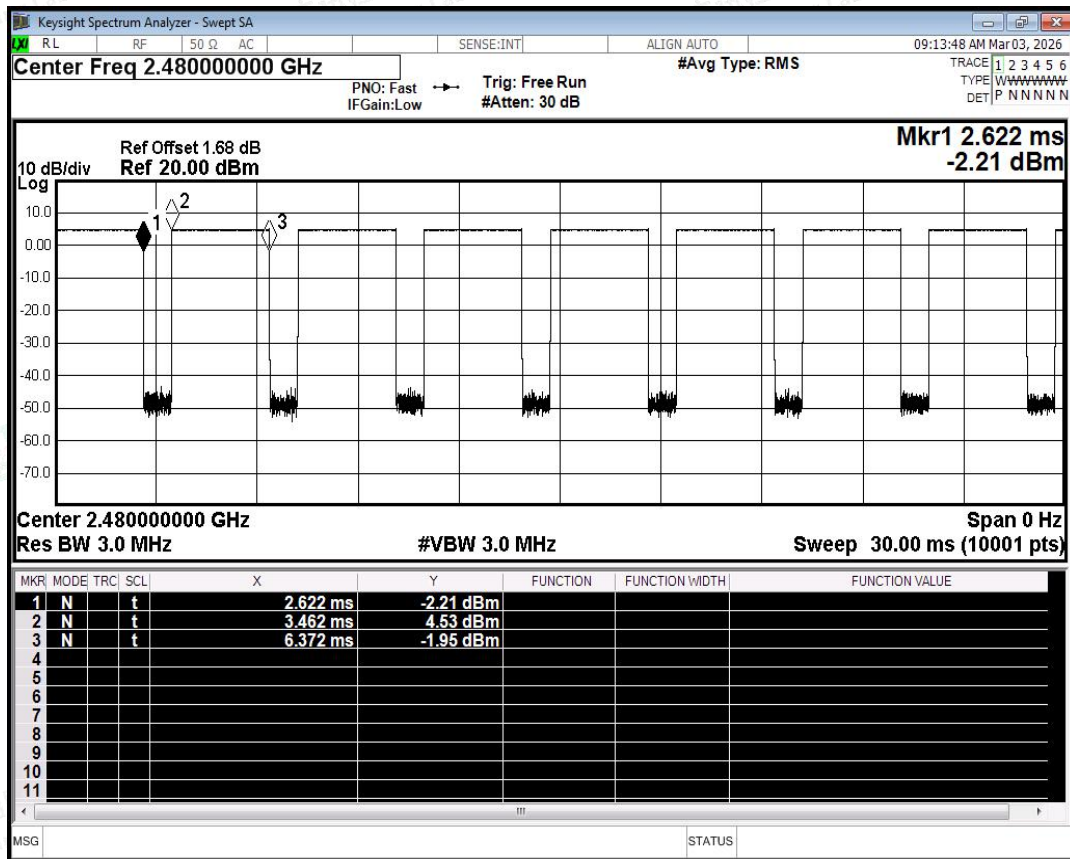


Duty Cycle NVNT 1-DH5 2480MHz Ant1



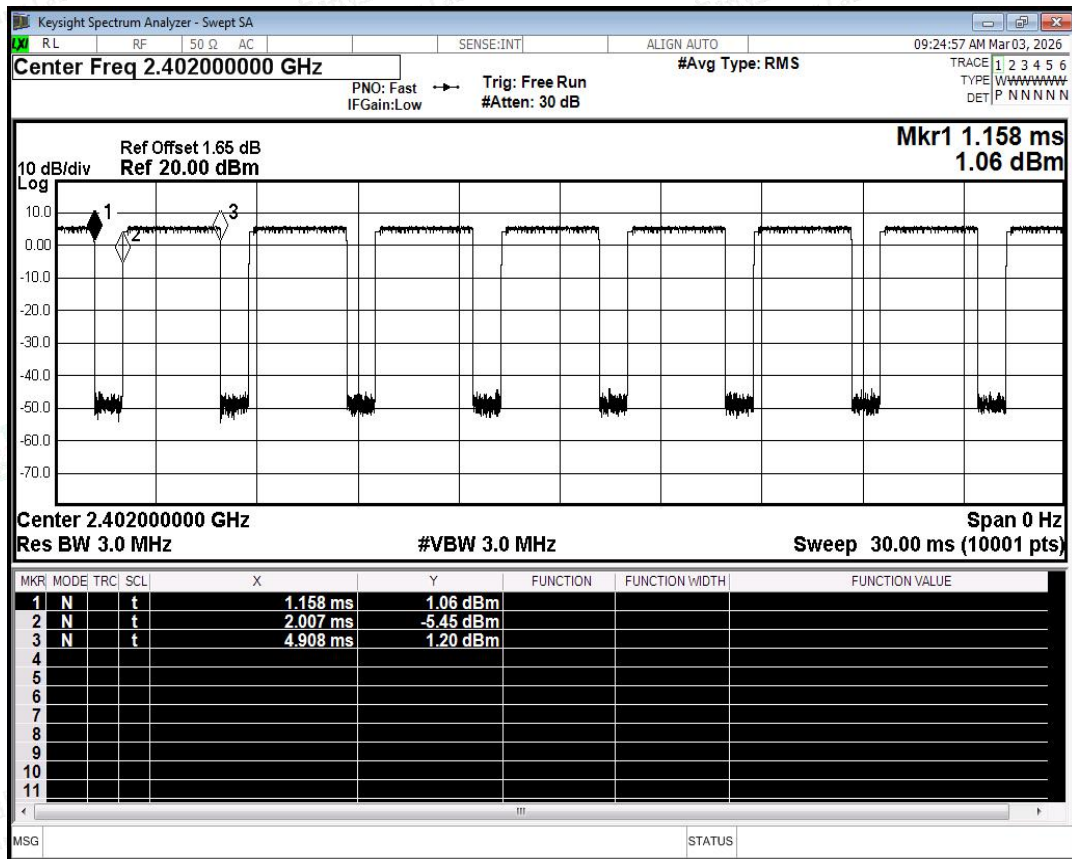


Duty Cycle NVNT 2-DH5 2402MHz Ant1



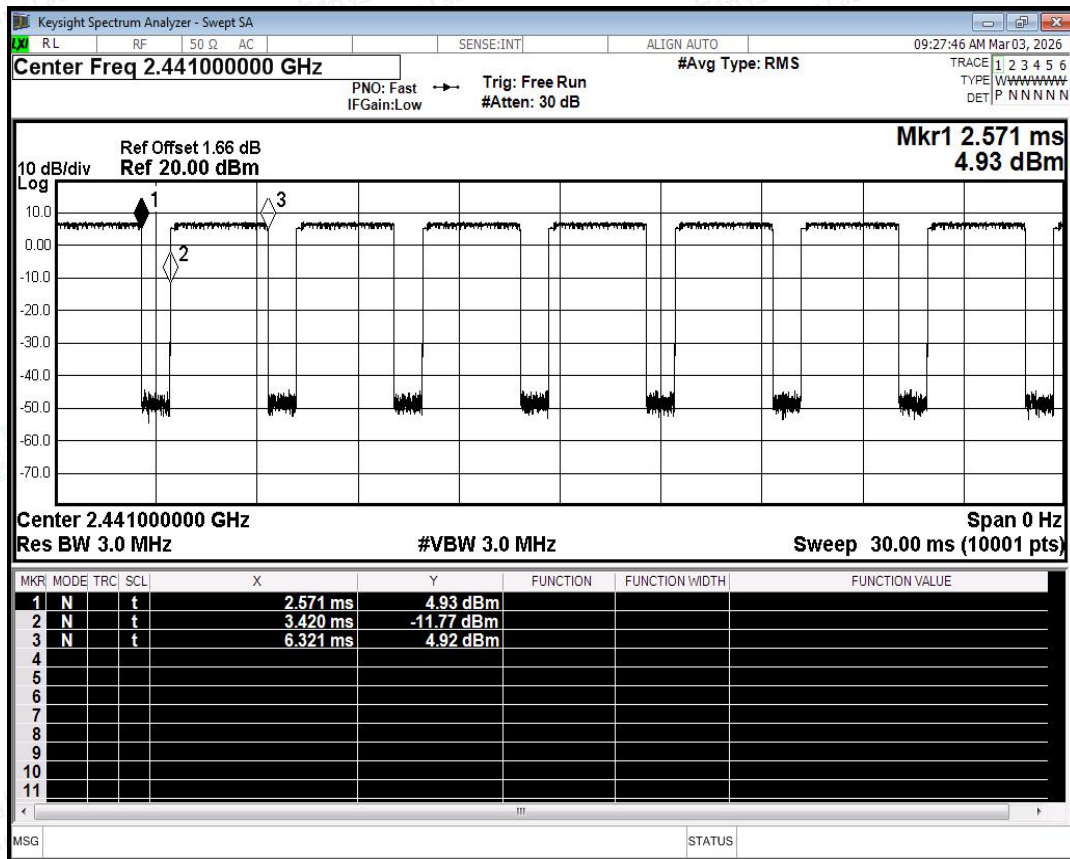


Duty Cycle NVNT 2-DH5 2441MHz Ant1



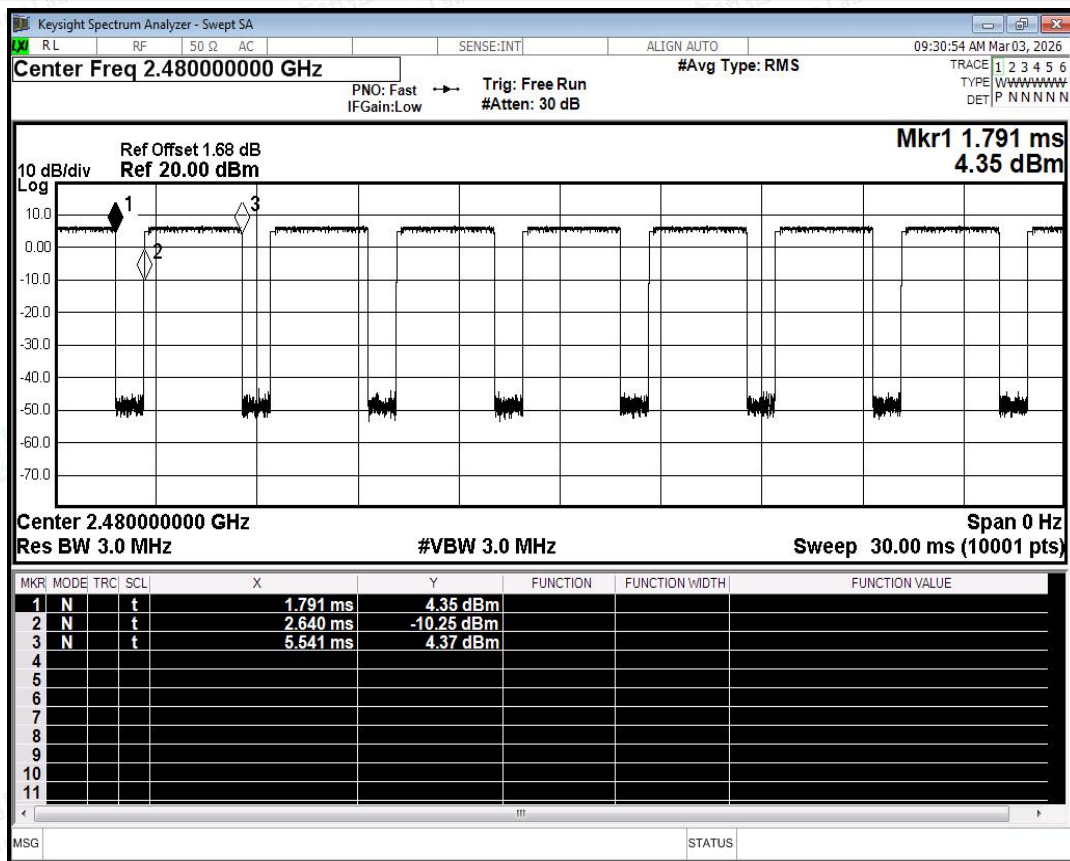

Duty Cycle NVNT 2-DH5 2480MHz Ant1



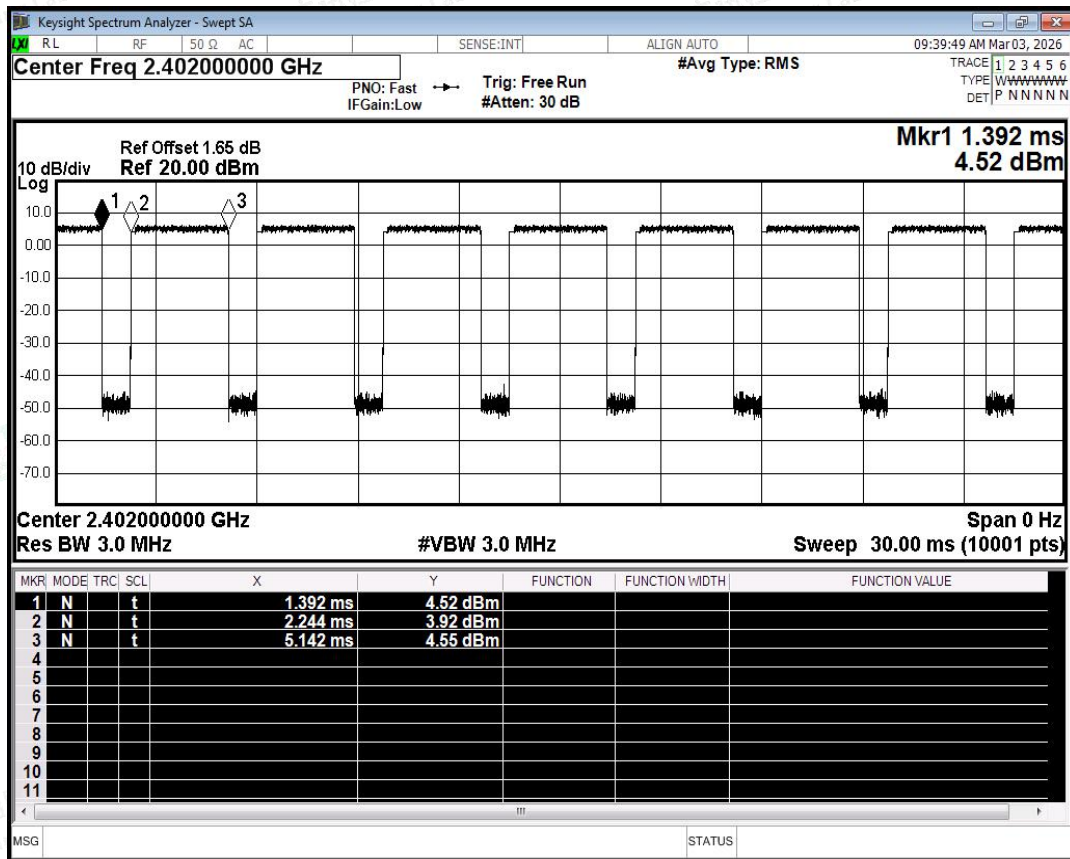

Duty Cycle NVNT 3-DH5 2402MHz Ant1




Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China


Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

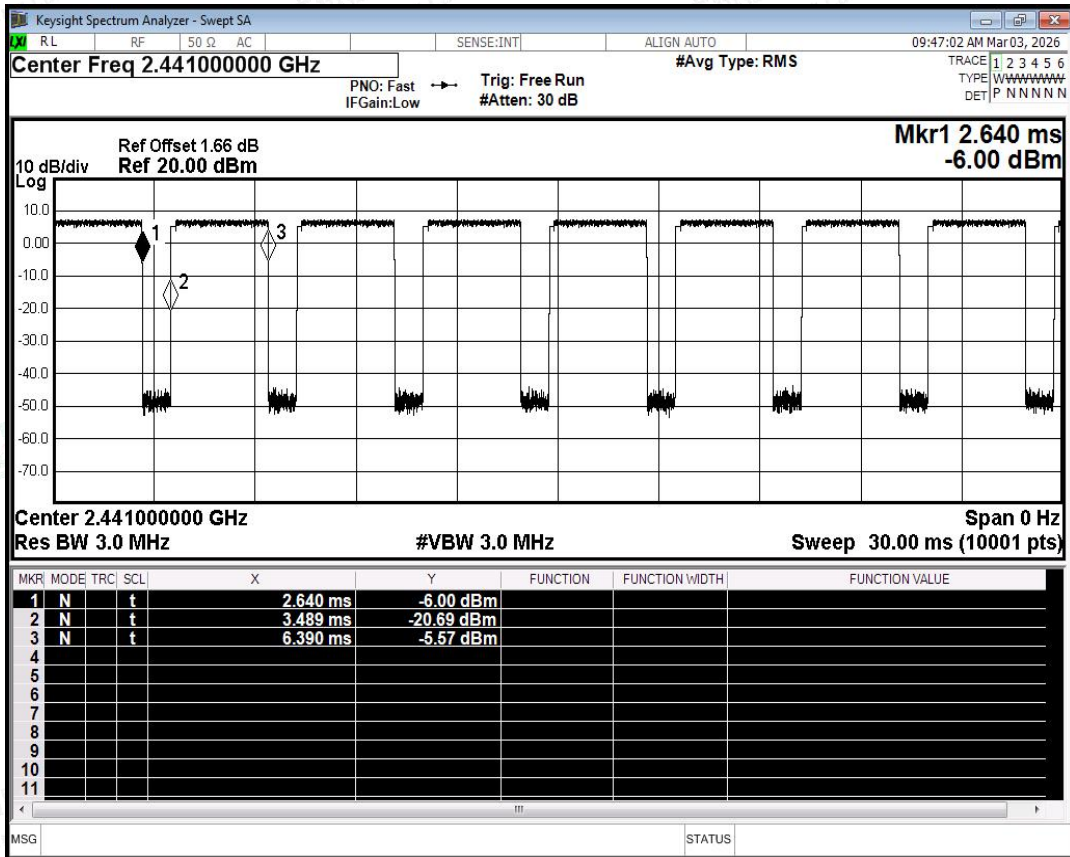

Duty Cycle NVNT 3-DH5 2441MHz Ant1



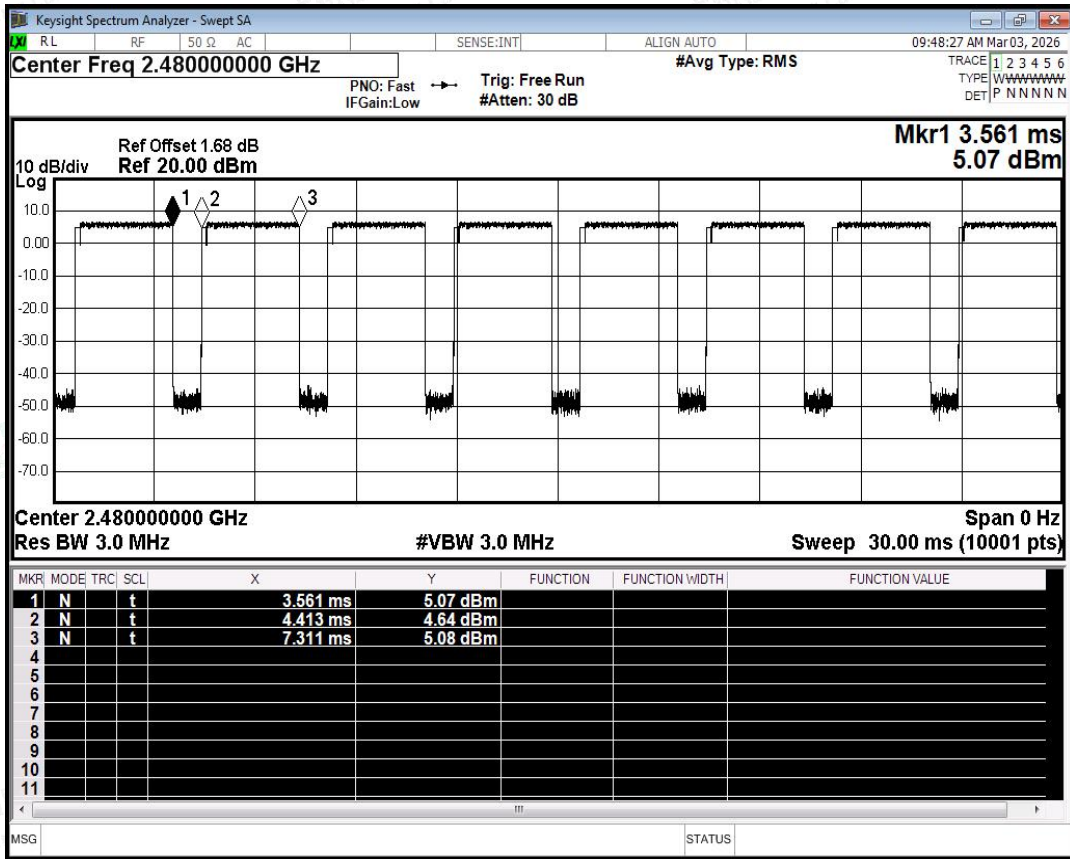

Duty Cycle NVNT 3-DH5 2480MHz Ant1




A.9 Restrict Band

Condition	Mode	Frequency (MHz)	Antenna	Hopping Mode	Spur Freq (MHz)	Power (dBm)	Gain (dBi)	E (dBuV/m)	Detector	Limit (dBuV/m)	Verdict
NVNT	1-DH5	2402	Ant1	No-Hopping	2310	-51.34	2.70	46.62	Peak	74	Pass
NVNT	1-DH5	2402	Ant1	No-Hopping	2310	-58.05	2.70	39.91	Average	54	Pass
NVNT	1-DH5	2402	Ant1	No-Hopping	2325.264	-47.65	2.70	50.31	Peak	74	Pass
NVNT	1-DH5	2402	Ant1	No-Hopping	2313.456	-57.89	2.70	40.07	Average	54	Pass
NVNT	1-DH5	2402	Ant1	No-Hopping	2390	-52.2	2.70	45.76	Peak	74	Pass
NVNT	1-DH5	2402	Ant1	No-Hopping	2390	-58.06	2.70	39.90	Average	54	Pass
NVNT	1-DH5	2480	Ant1	No-Hopping	2483.5	-49.12	2.70	48.84	Peak	74	Pass
NVNT	1-DH5	2480	Ant1	No-Hopping	2483.5	-54.01	2.70	43.95	Average	54	Pass
NVNT	1-DH5	2480	Ant1	No-Hopping	2485.672	-41.55	2.70	56.41	Peak	74	Pass
NVNT	1-DH5	2480	Ant1	No-Hopping	2483.512	-54.01	2.70	43.95	Average	54	Pass
NVNT	1-DH5	2480	Ant1	No-Hopping	2500	-49.15	2.70	48.81	Peak	74	Pass
NVNT	1-DH5	2480	Ant1	No-Hopping	2500	-57.95	2.70	40.01	Average	54	Pass
NVNT	2-DH5	2402	Ant1	No-Hopping	2310	-52.44	2.70	45.52	Peak	74	Pass
NVNT	2-DH5	2402	Ant1	No-Hopping	2310	-57.92	2.70	40.04	Average	54	Pass
NVNT	2-DH5	2402	Ant1	No-Hopping	2334.768	-47.53	2.70	50.43	Peak	74	Pass
NVNT	2-DH5	2402	Ant1	No-Hopping	2330.16	-57.91	2.70	40.05	Average	54	Pass
NVNT	2-DH5	2402	Ant1	No-Hopping	2390	-51.35	2.70	46.61	Peak	74	Pass
NVNT	2-DH5	2402	Ant1	No-Hopping	2390	-58.11	2.70	39.85	Average	54	Pass
NVNT	2-DH5	2480	Ant1	No-Hopping	2483.5	-41.22	2.70	56.74	Peak	74	Pass
NVNT	2-DH5	2480	Ant1	No-Hopping	2483.5	-50.49	2.70	47.47	Average	54	Pass
NVNT	2-DH5	2480	Ant1	No-Hopping	2483.704	-39.72	2.70	58.24	Peak	74	Pass
NVNT	2-DH5	2480	Ant1	No-Hopping	2483.512	-50.49	2.70	47.47	Average	54	Pass
NVNT	2-DH5	2480	Ant1	No-Hopping	2500	-50.78	2.70	47.18	Peak	74	Pass
NVNT	2-DH5	2480	Ant1	No-Hopping	2500	-57.94	2.70	40.02	Average	54	Pass
NVNT	3-DH5	2402	Ant1	No-Hopping	2310	-50.87	2.70	47.09	Peak	74	Pass
NVNT	3-DH5	2402	Ant1	No-Hopping	2310	-58.01	2.70	39.95	Average	54	Pass
NVNT	3-DH5	2402	Ant1	No-Hopping	2349.744	-47.96	2.70	50.00	Peak	74	Pass
NVNT	3-DH5	2402	Ant1	No-Hopping	2328.528	-57.87	2.70	40.09	Average	54	Pass
NVNT	3-DH5	2402	Ant1	No-Hopping	2390	-51.46	2.70	46.50	Peak	74	Pass
NVNT	3-DH5	2402	Ant1	No-Hopping	2390	-58.1	2.70	39.86	Average	54	Pass
NVNT	3-DH5	2480	Ant1	No-Hopping	2483.5	-40.42	2.70	57.54	Peak	74	Pass
NVNT	3-DH5	2480	Ant1	No-Hopping	2483.5	-50.09	2.70	47.87	Average	54	Pass
NVNT	3-DH5	2480	Ant1	No-Hopping	2483.536	-40.13	2.70	57.83	Peak	74	Pass
NVNT	3-DH5	2480	Ant1	No-Hopping	2483.512	-50.09	2.70	47.87	Average	54	Pass
NVNT	3-DH5	2480	Ant1	No-Hopping	2500	-49.45	2.70	48.51	Peak	74	Pass





NVNT	3-DH5	2480	Ant1	No-Hopping	2500	-57.96	2.70	40.00	Average	54	Pass
------	-------	------	------	------------	------	--------	------	-------	---------	----	------

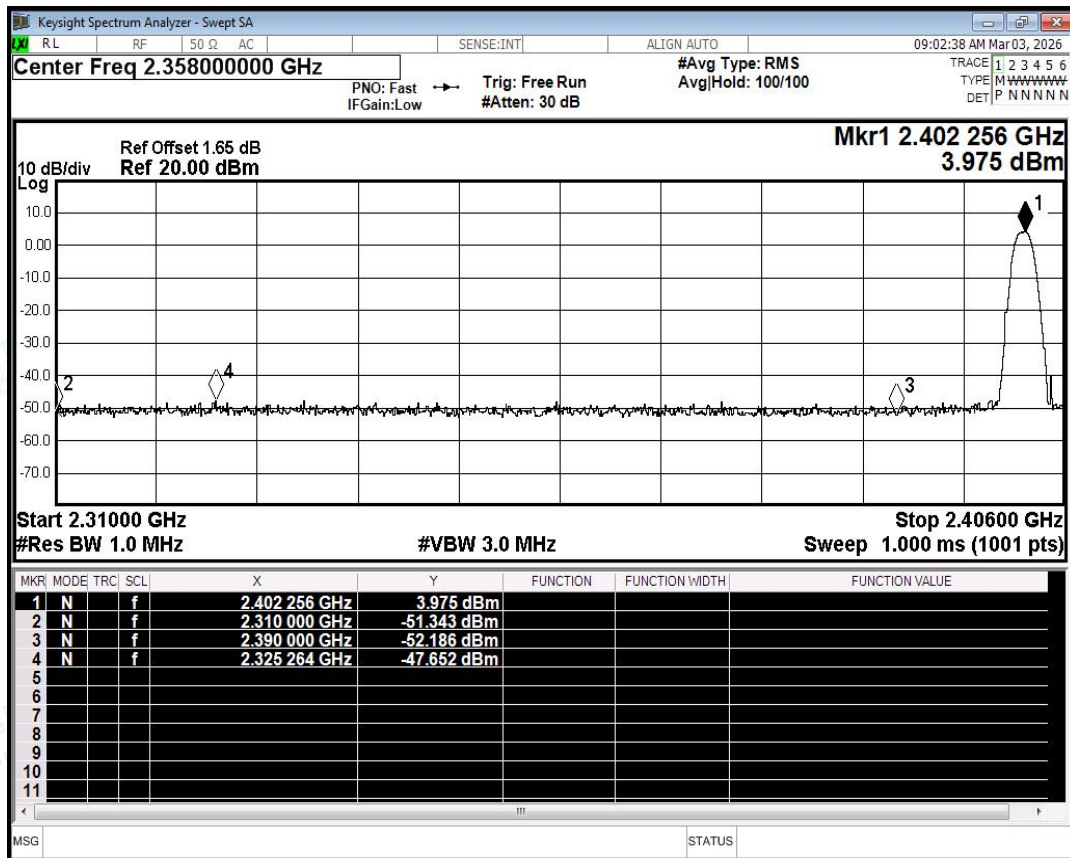

Restrict Band NVNT 1-DH5 2402MHz Ant1 No-Hopping Peak




Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

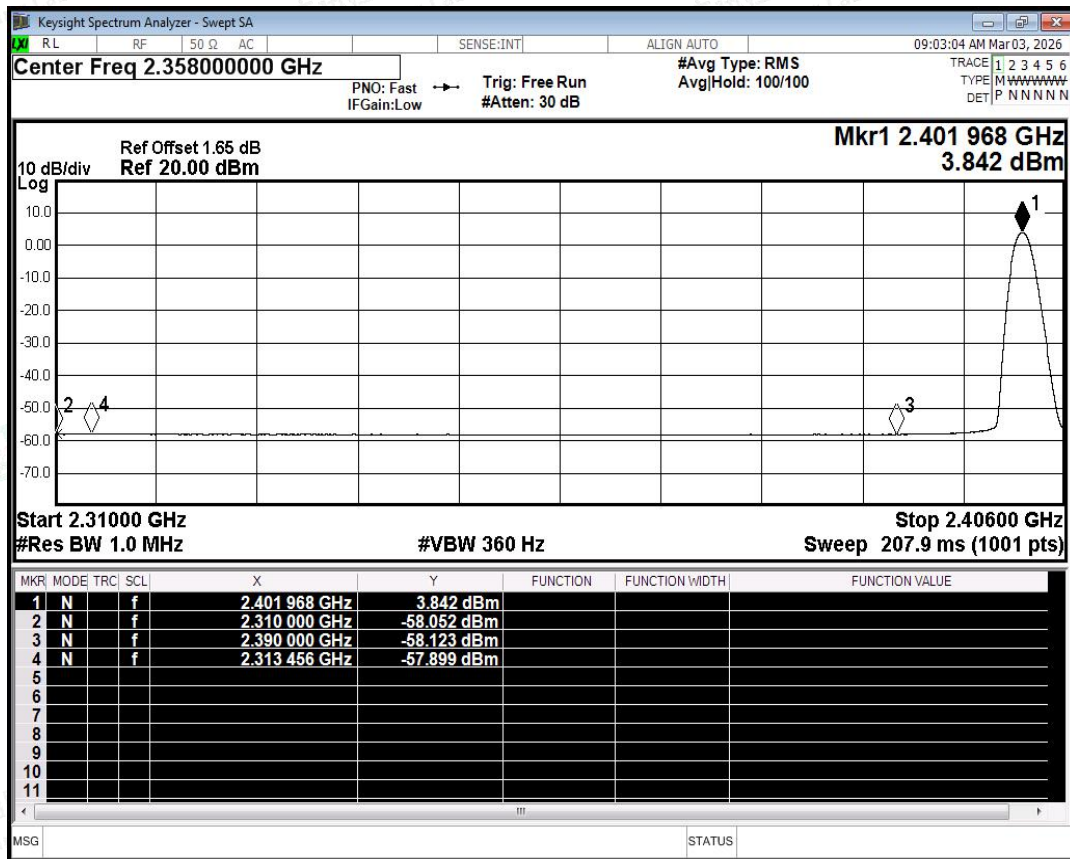

Restrict Band NVNT 1-DH5 2402MHz Ant1 No-Hopping Average




Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China


Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

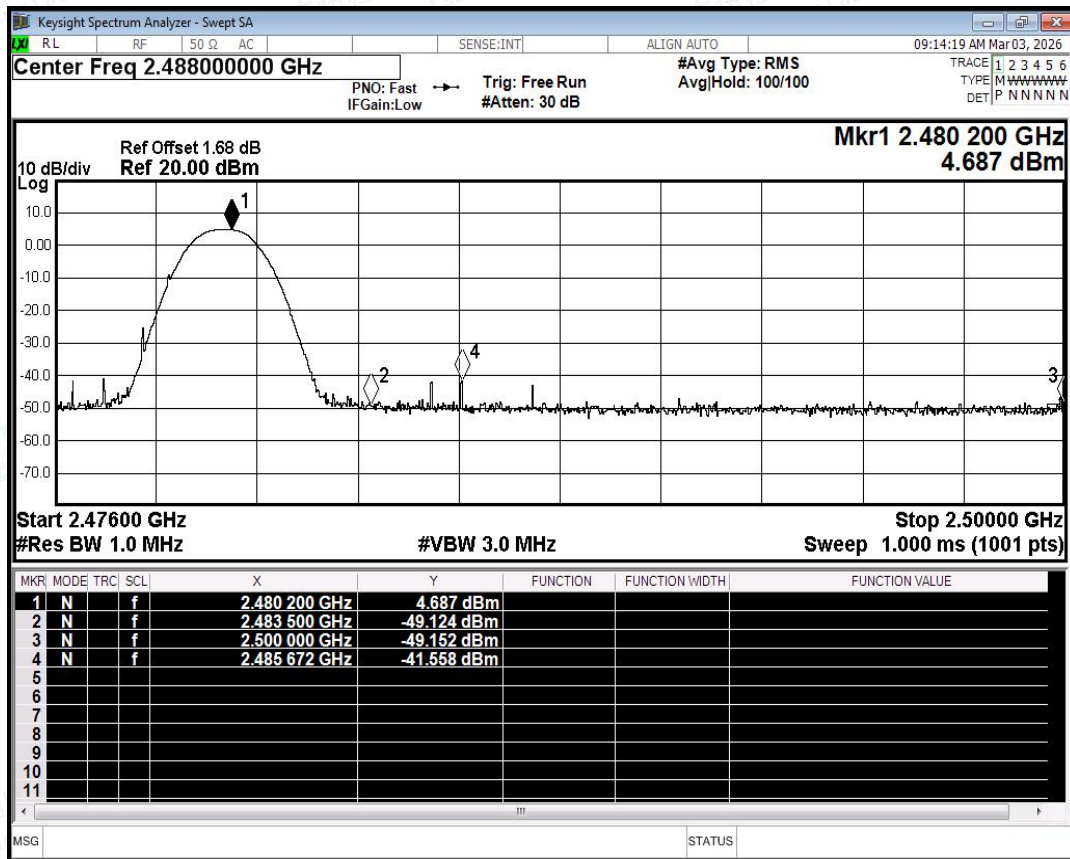

Restrict Band NVNT 1-DH5 2480MHz Ant1 No-Hopping Peak




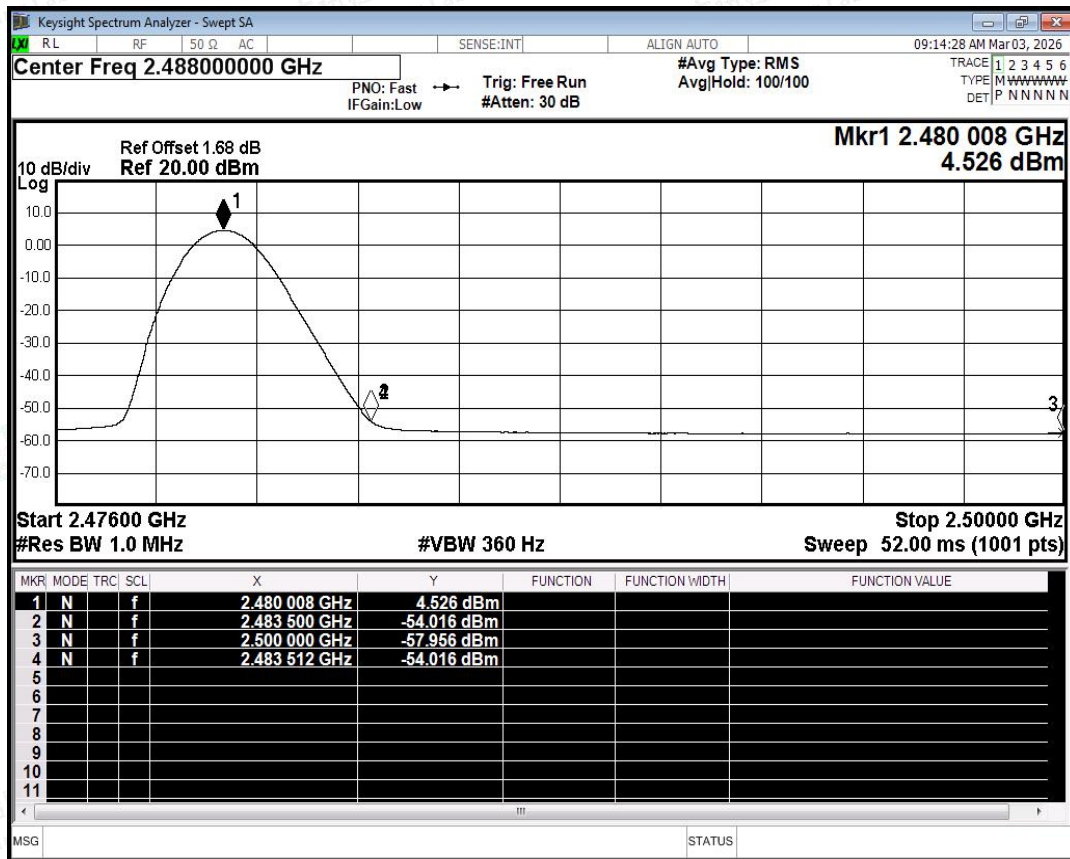

Restrict Band NVNT 1-DH5 2480MHz Ant1 No-Hopping Average



Shenzhen LCS Compliance Testing Laboratory Ltd.
Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China
Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com
Scan code to check authenticity

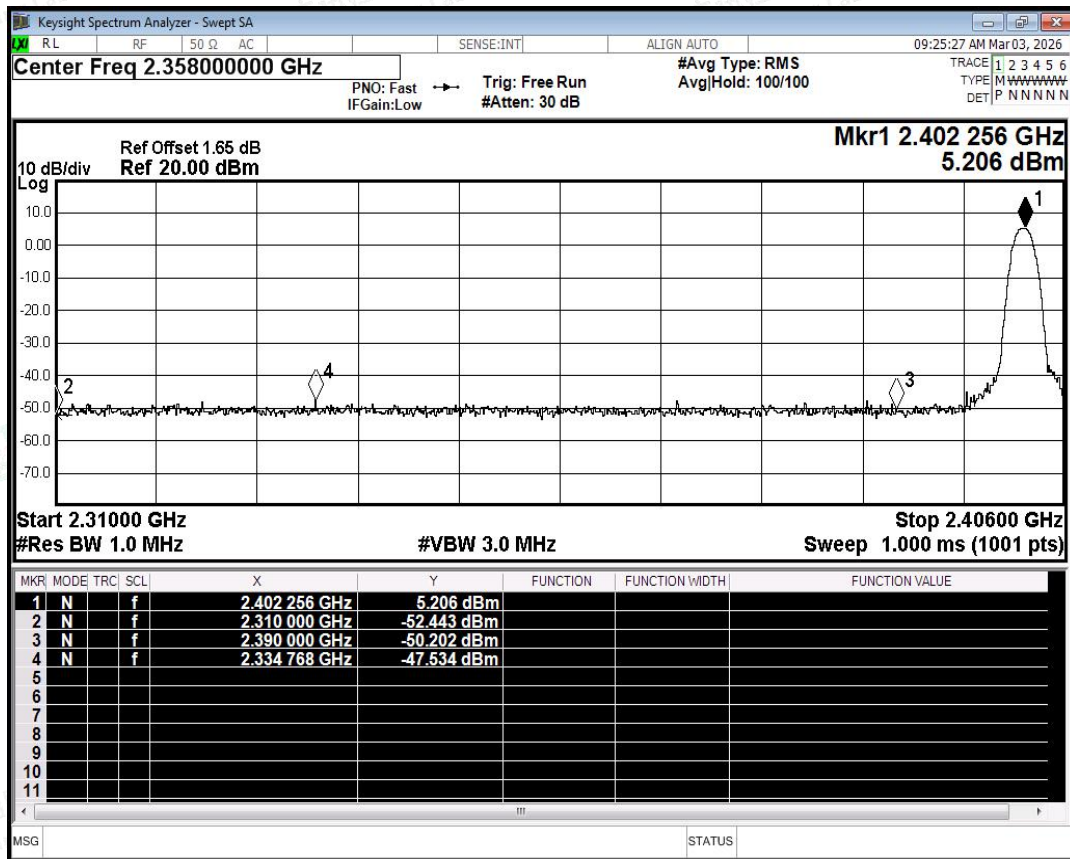

Restrict Band NVNT 2-DH5 2402MHz Ant1 No-Hopping Peak




Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China


Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

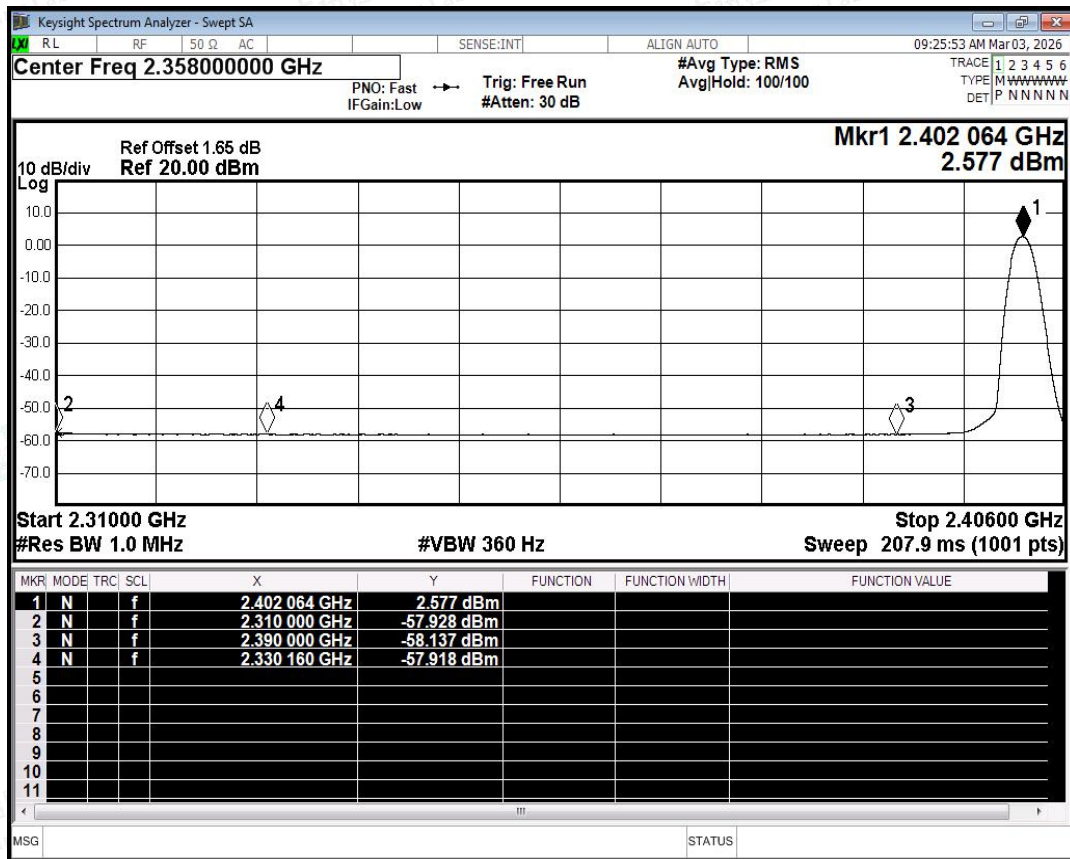


Restrict Band NVNT 2-DH5 2402MHz Ant1 No-Hopping Average



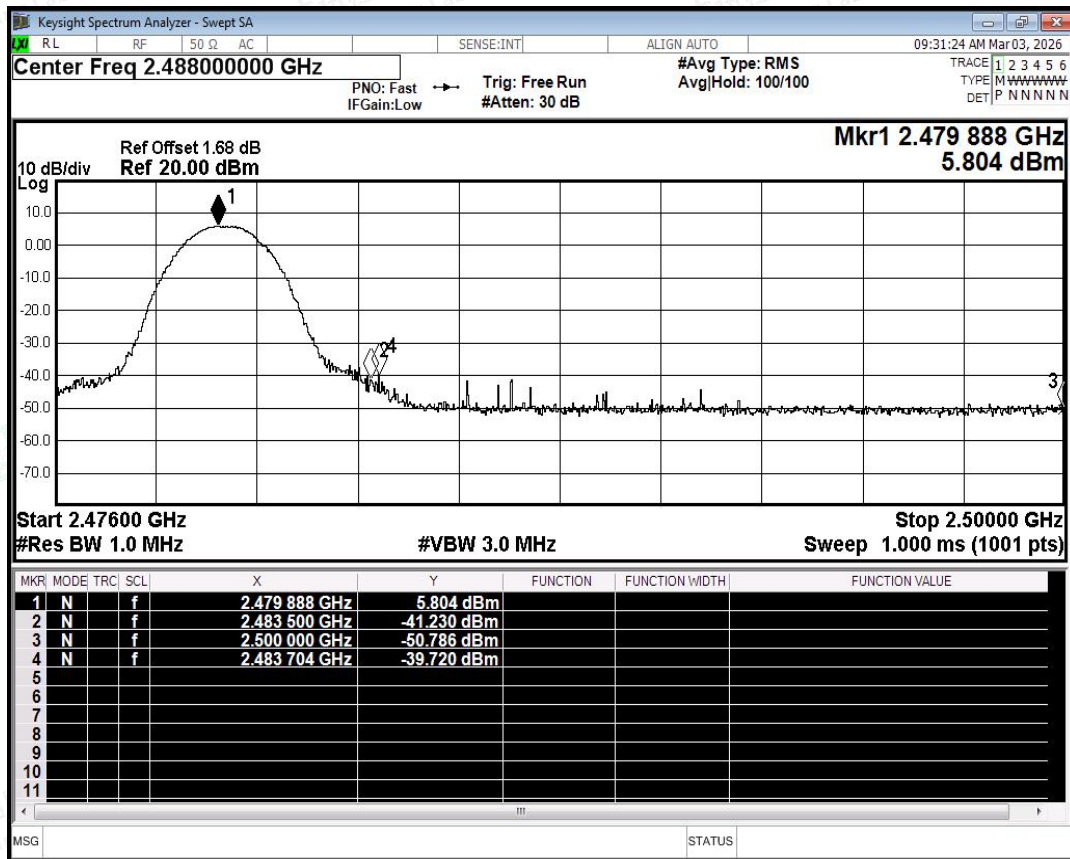


Restrict Band NVNT 2-DH5 2480MHz Ant1 No-Hopping Peak



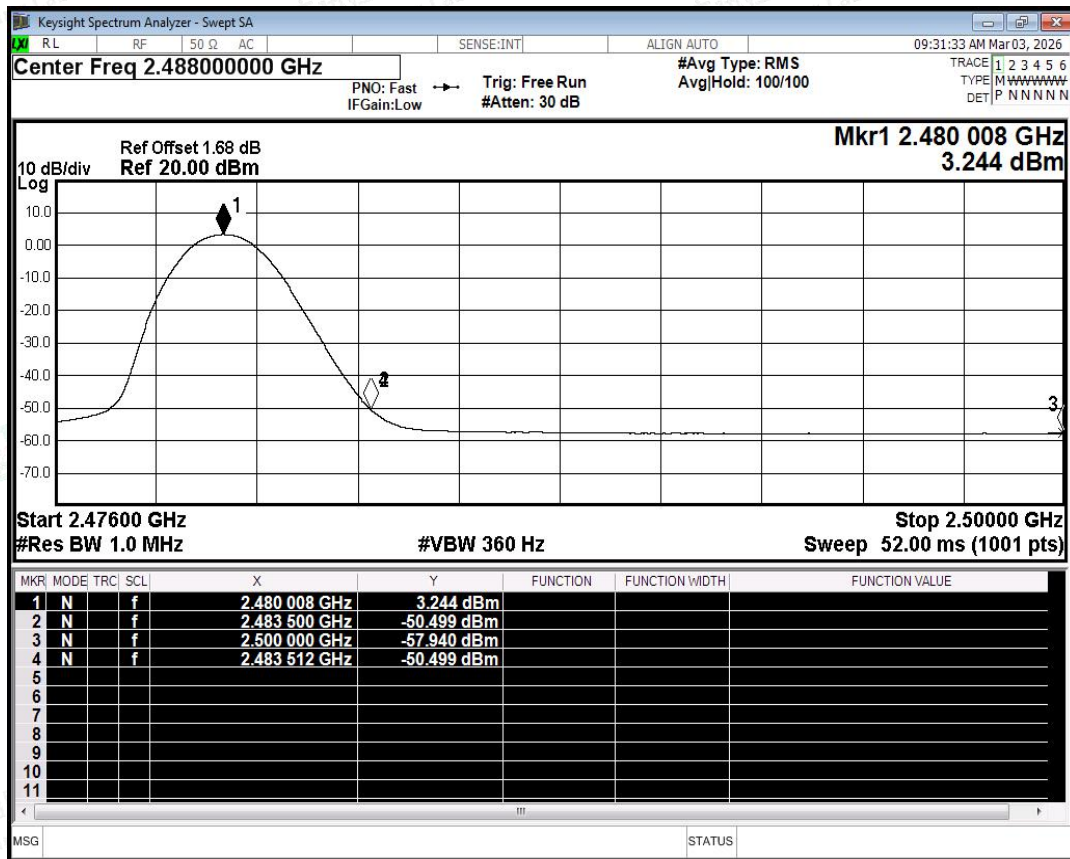

Restrict Band NVNT 2-DH5 2480MHz Ant1 No-Hopping Average



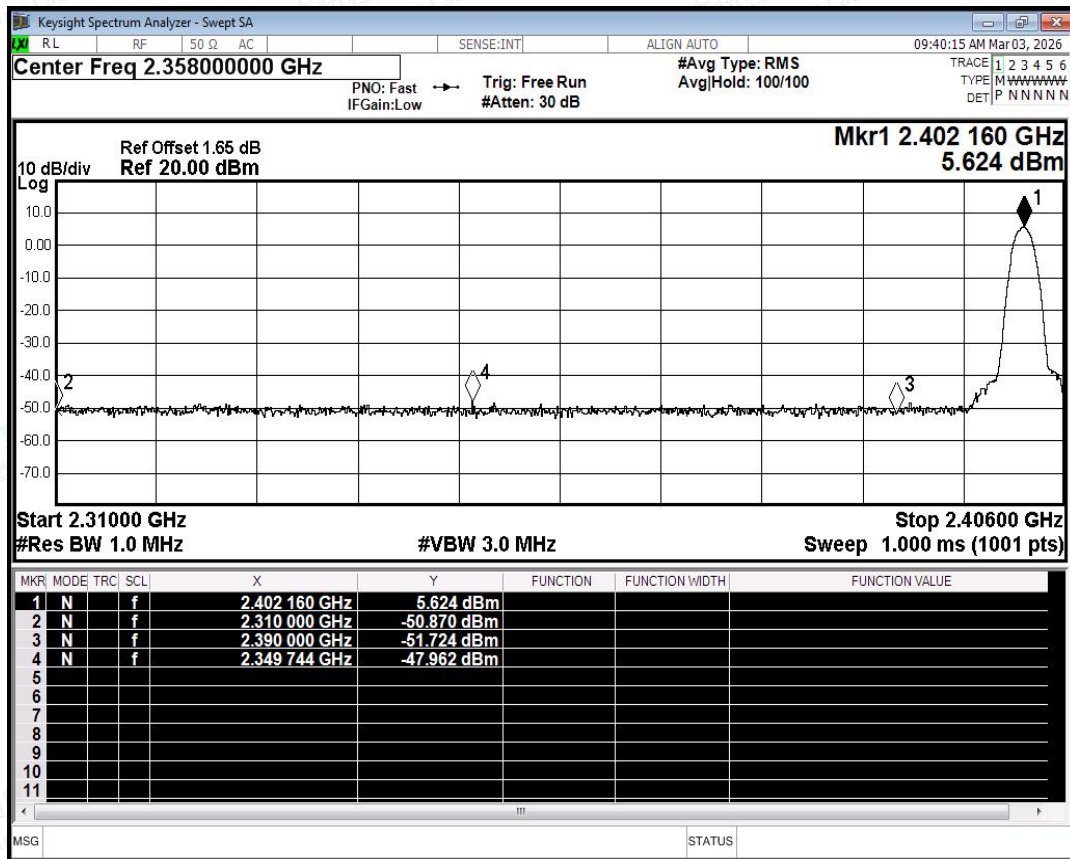

Restrict Band NVNT 3-DH5 2402MHz Ant1 No-Hopping Peak




Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

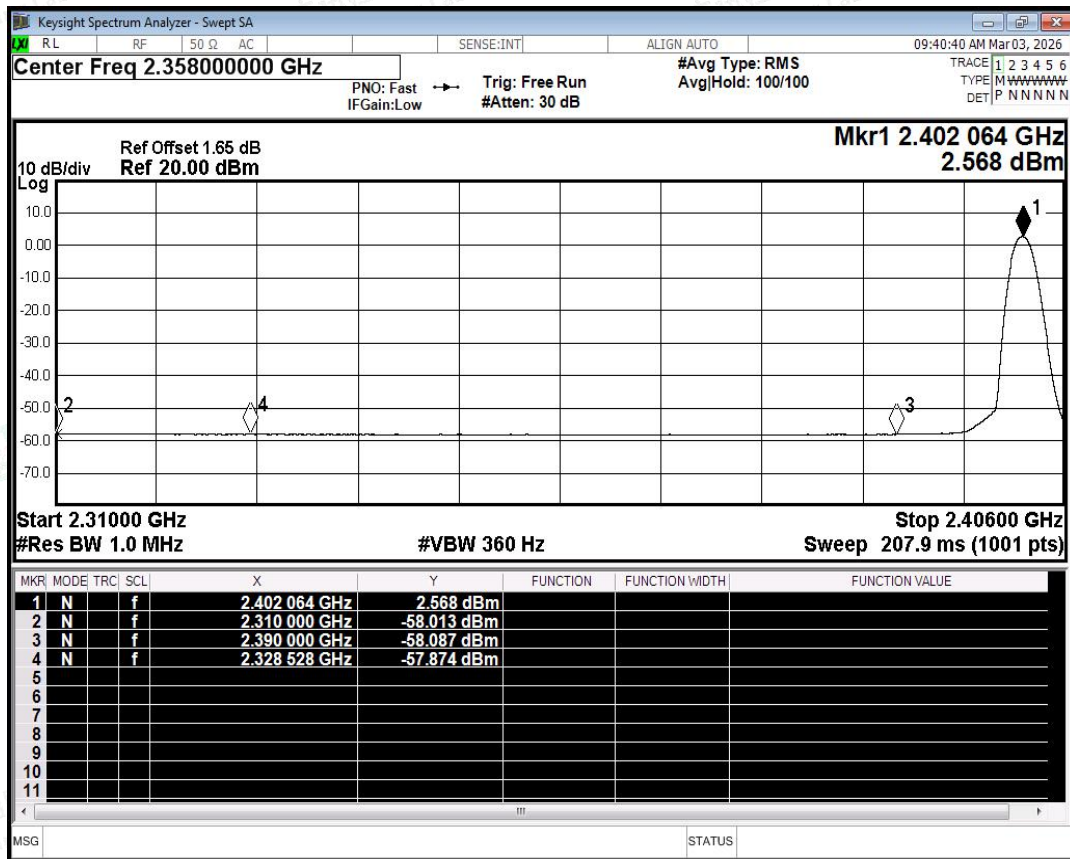

Restrict Band NVNT 3-DH5 2402MHz Ant1 No-Hopping Average




Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China


Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

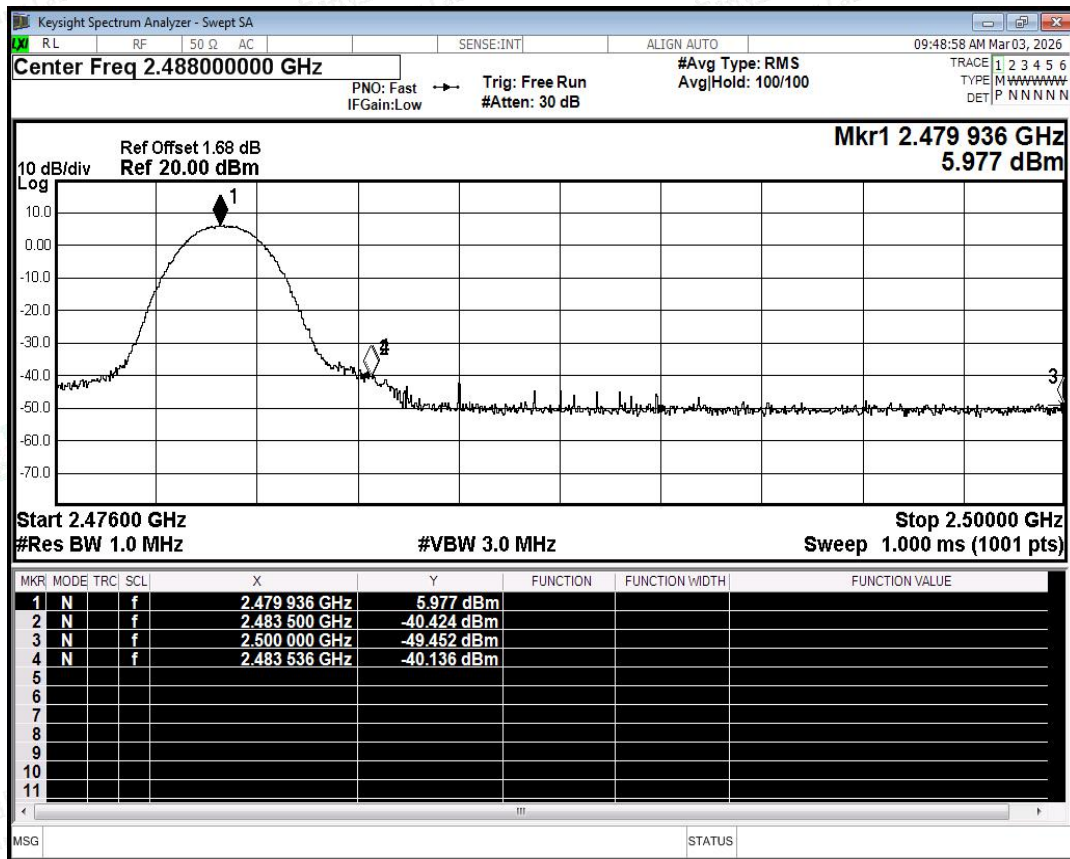

Restrict Band NVNT 3-DH5 2480MHz Ant1 No-Hopping Peak



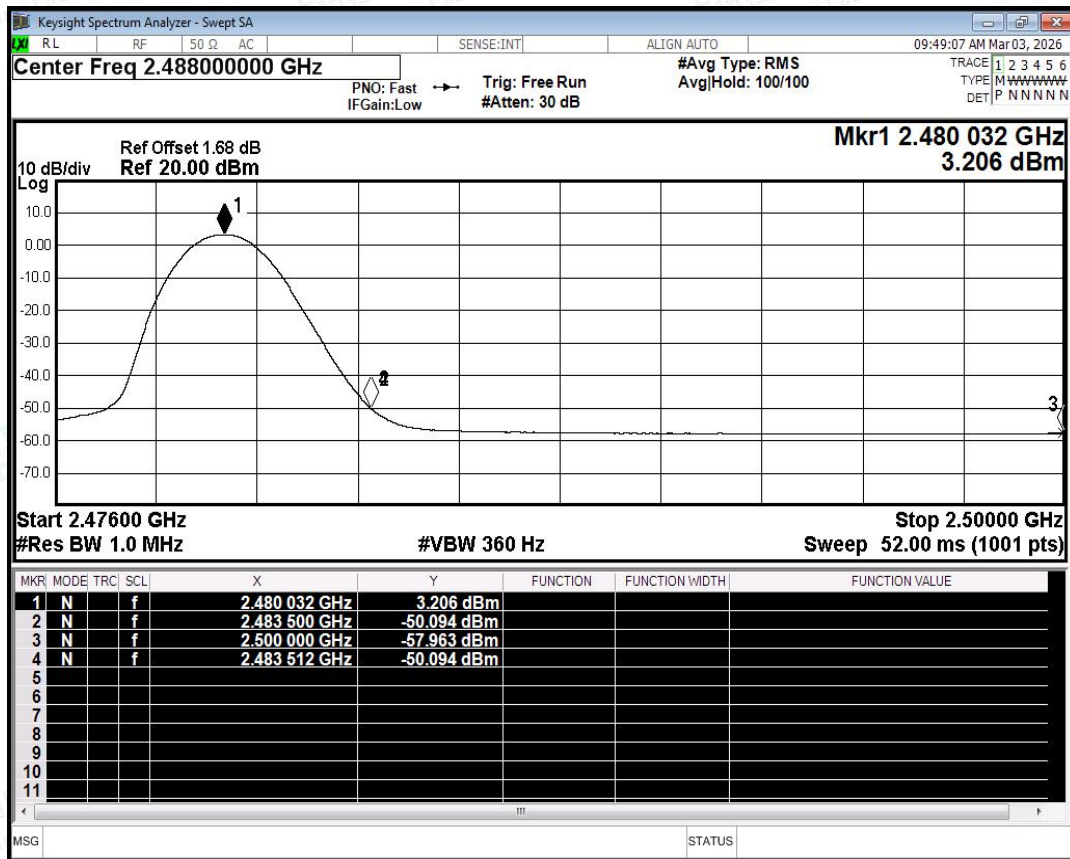

Restrict Band NVNT 3-DH5 2480MHz Ant1 No-Hopping Average



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity