


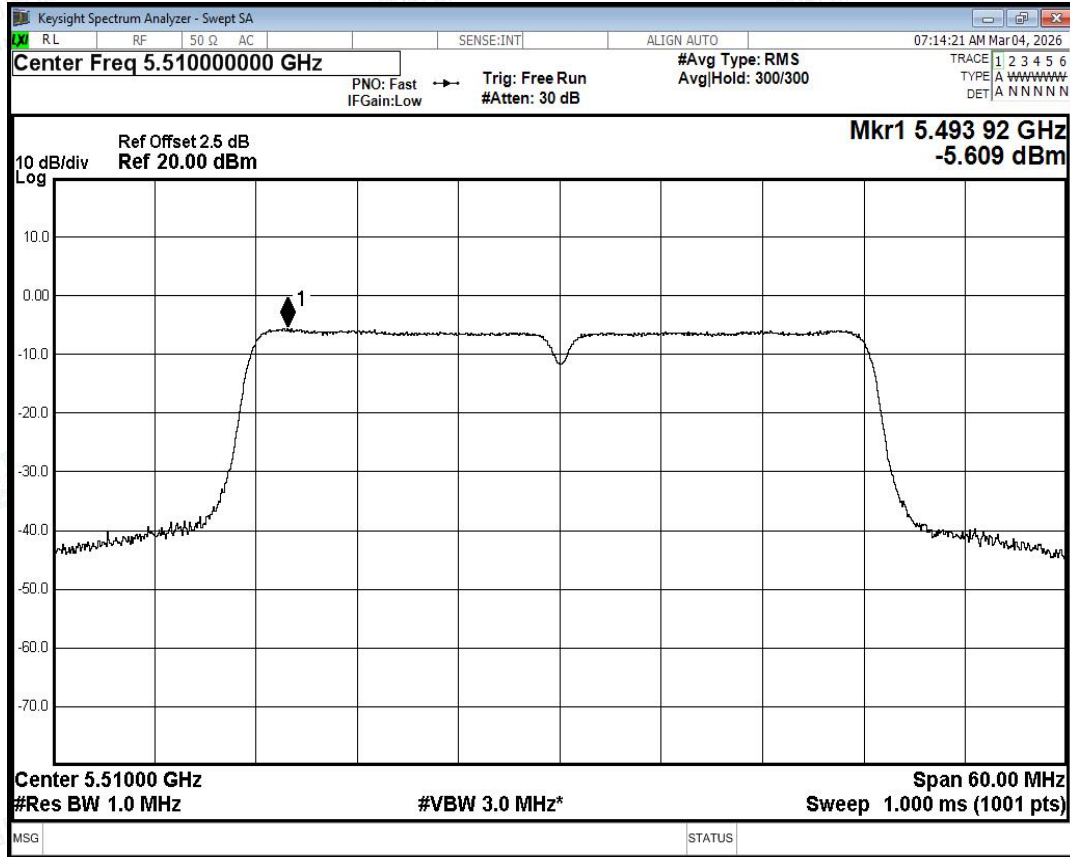


Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

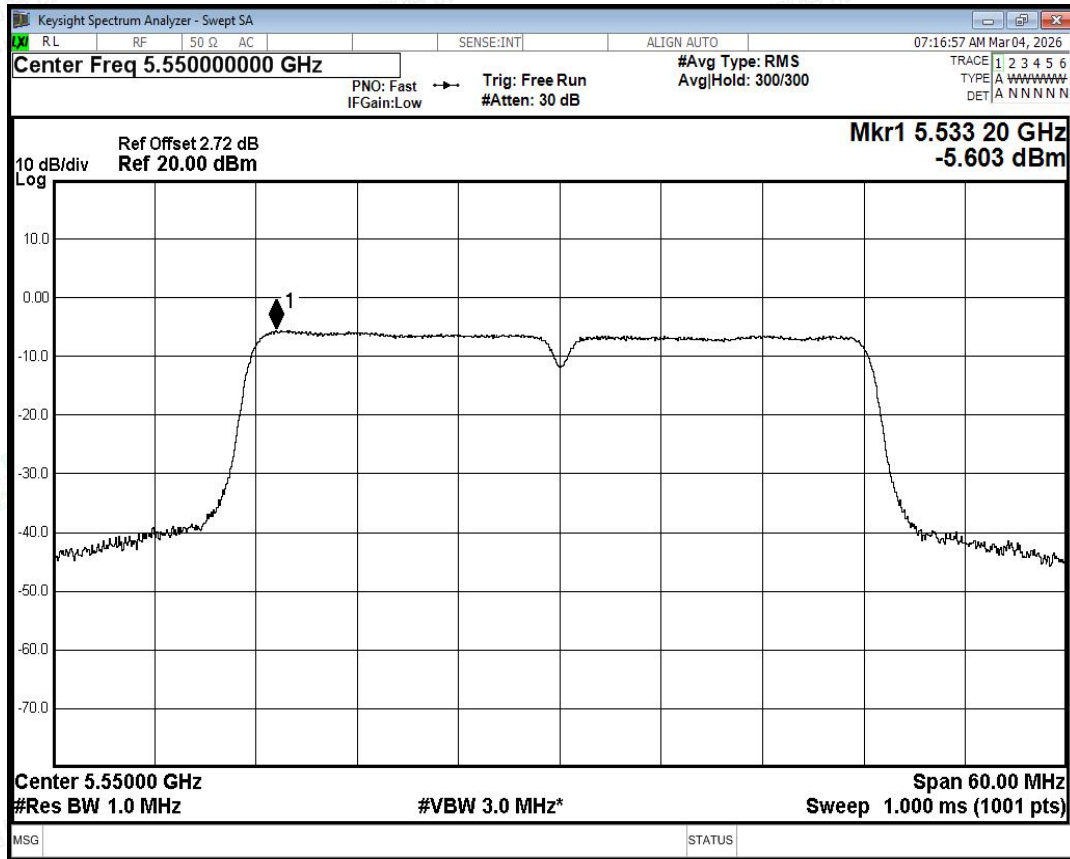



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

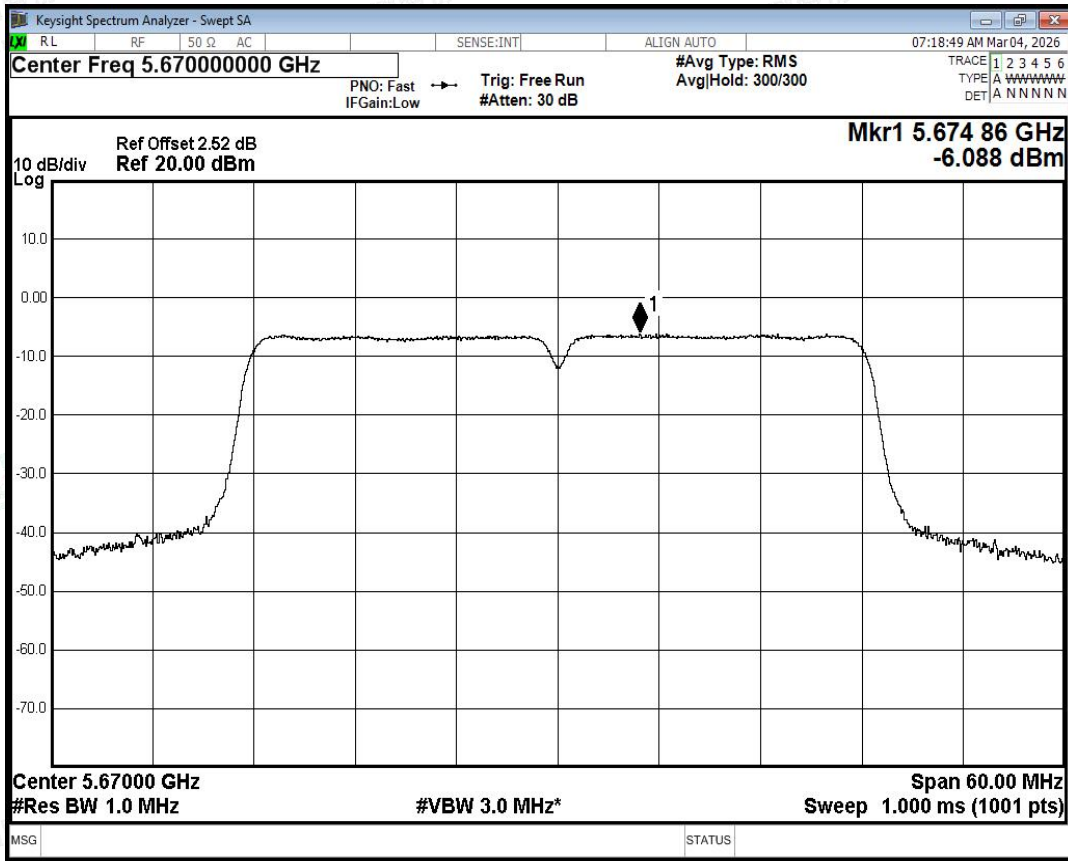

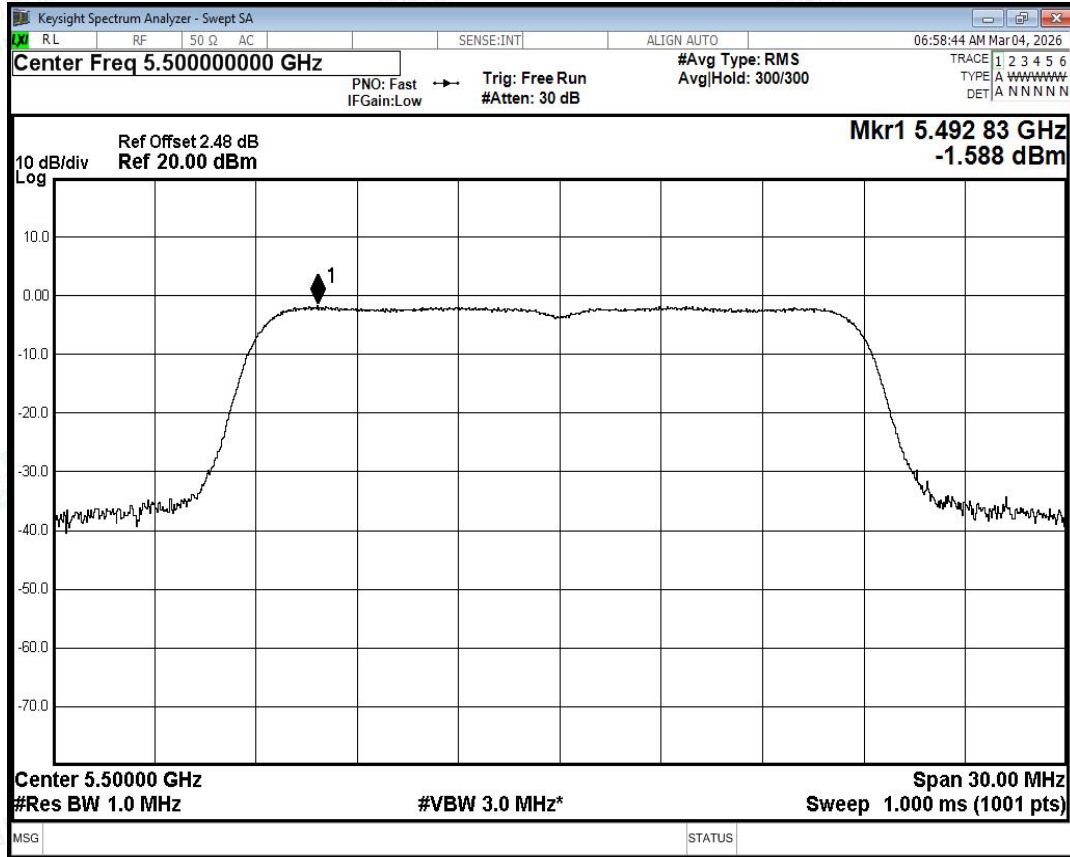


Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

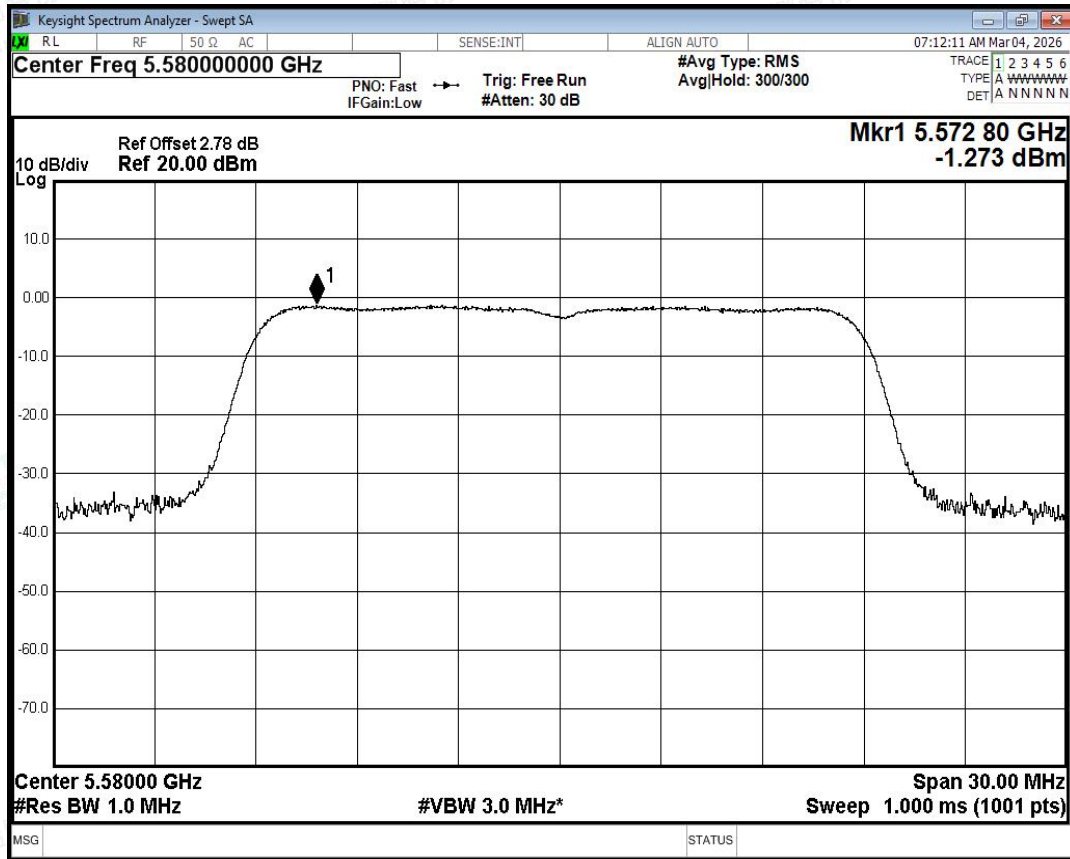


Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

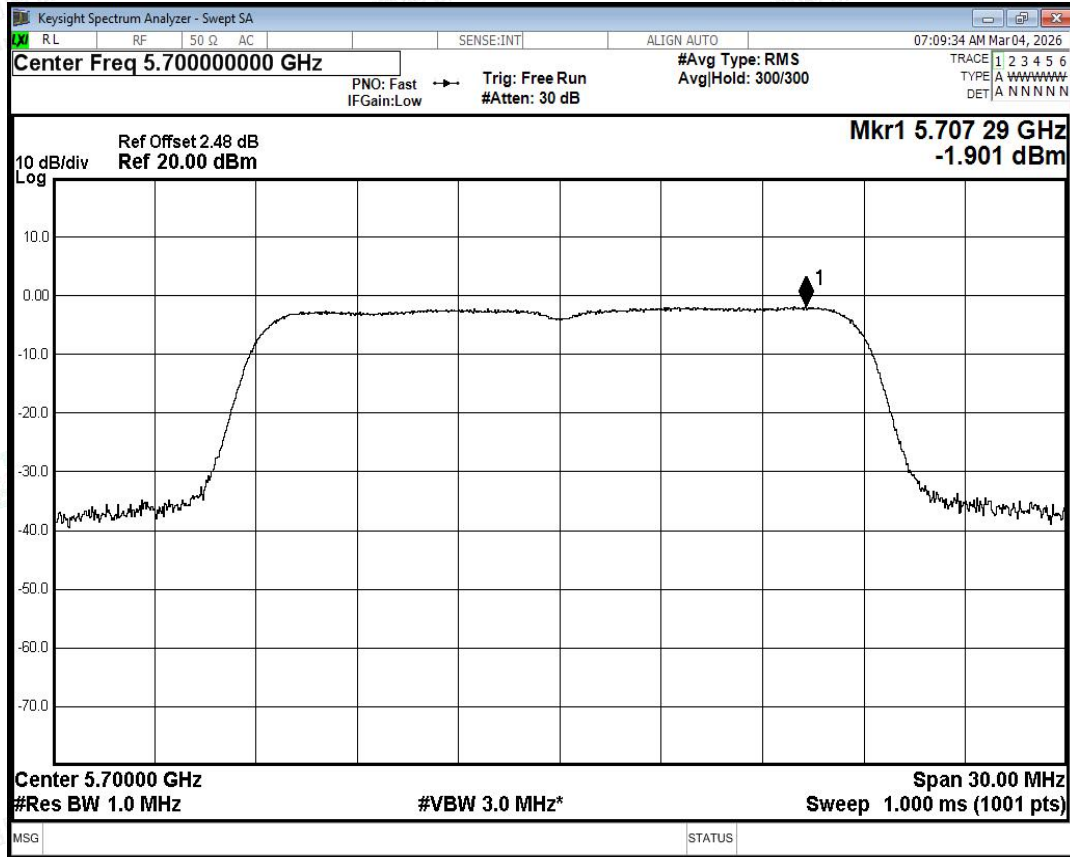


Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

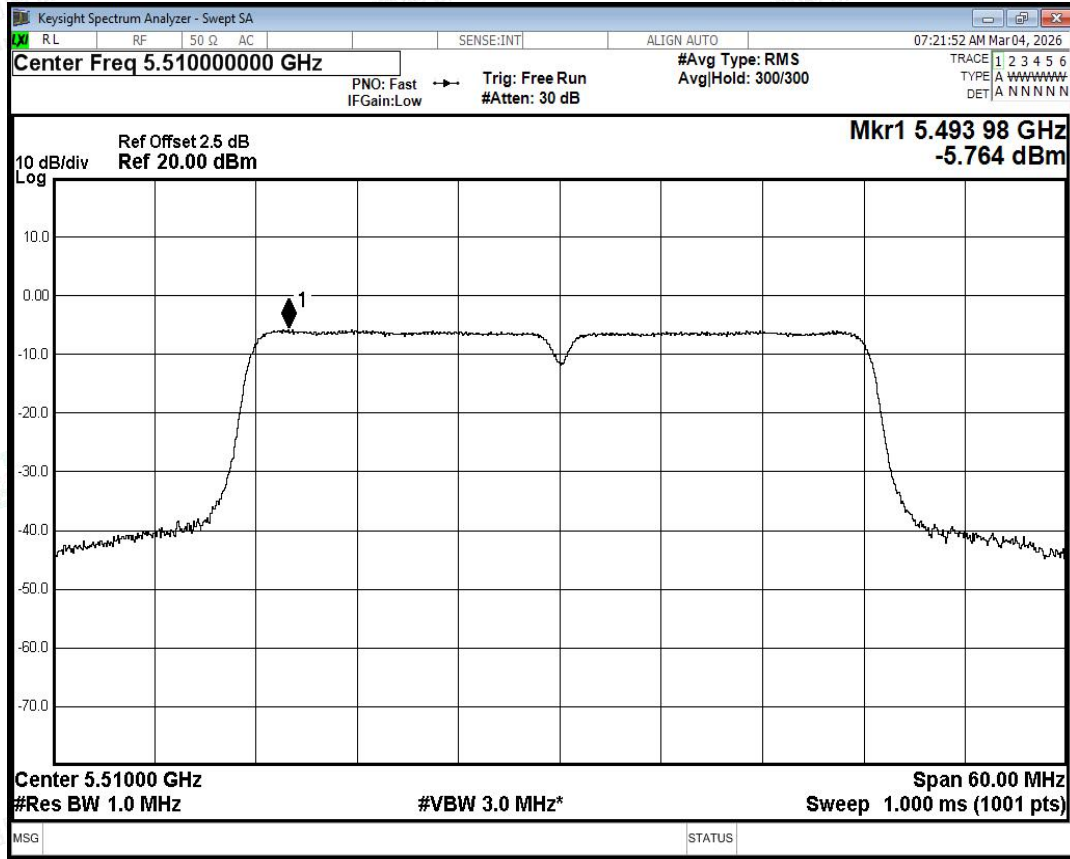


Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

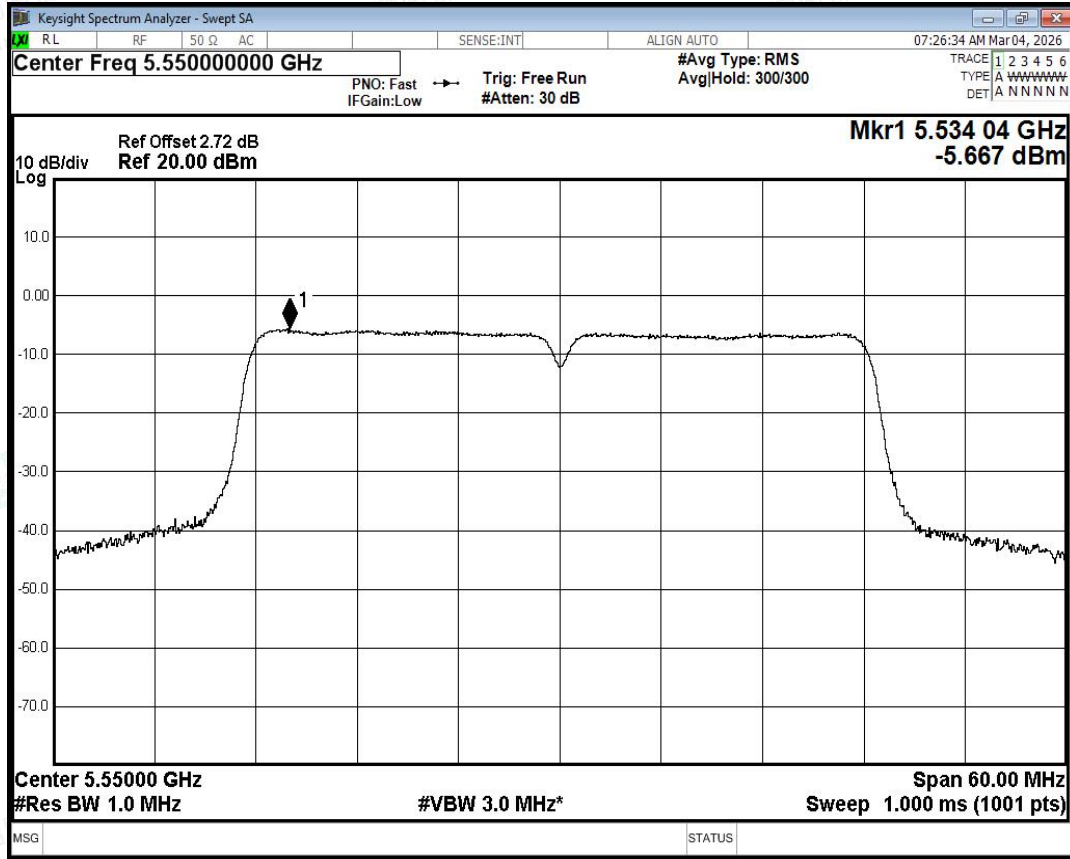


Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

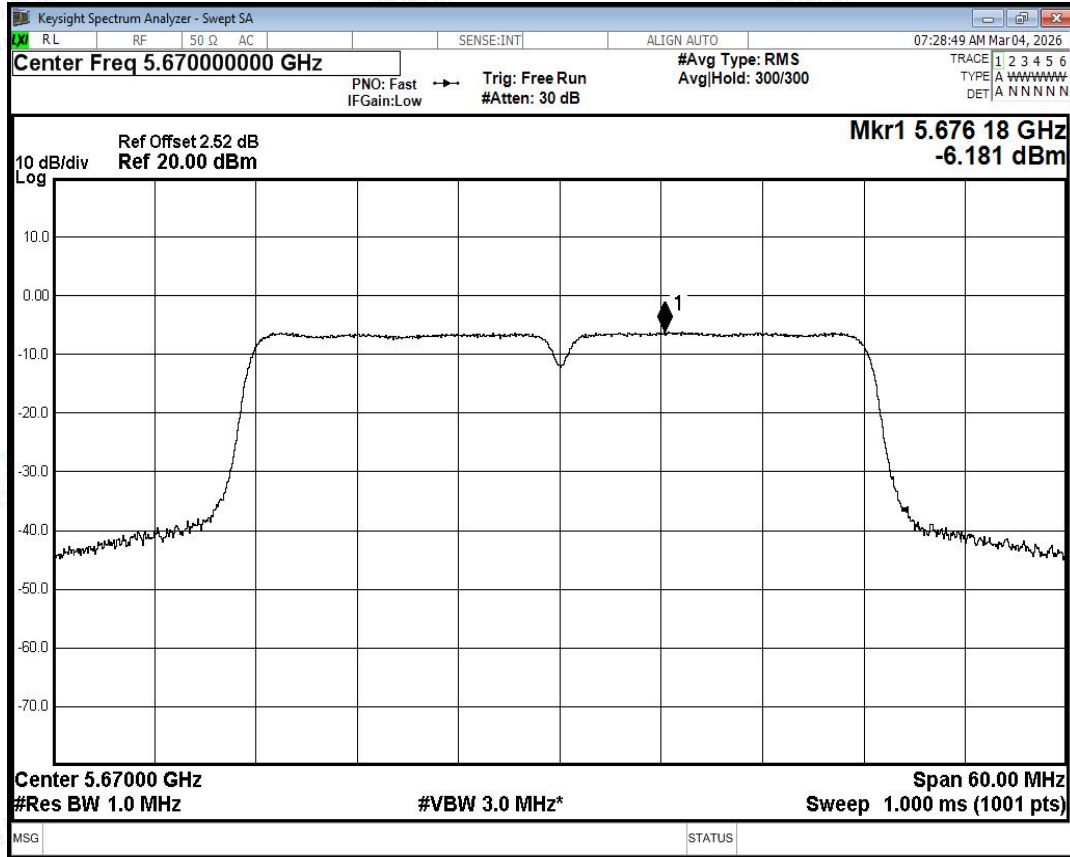

PSD NVNT ac40 5670MHz Ant1




Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

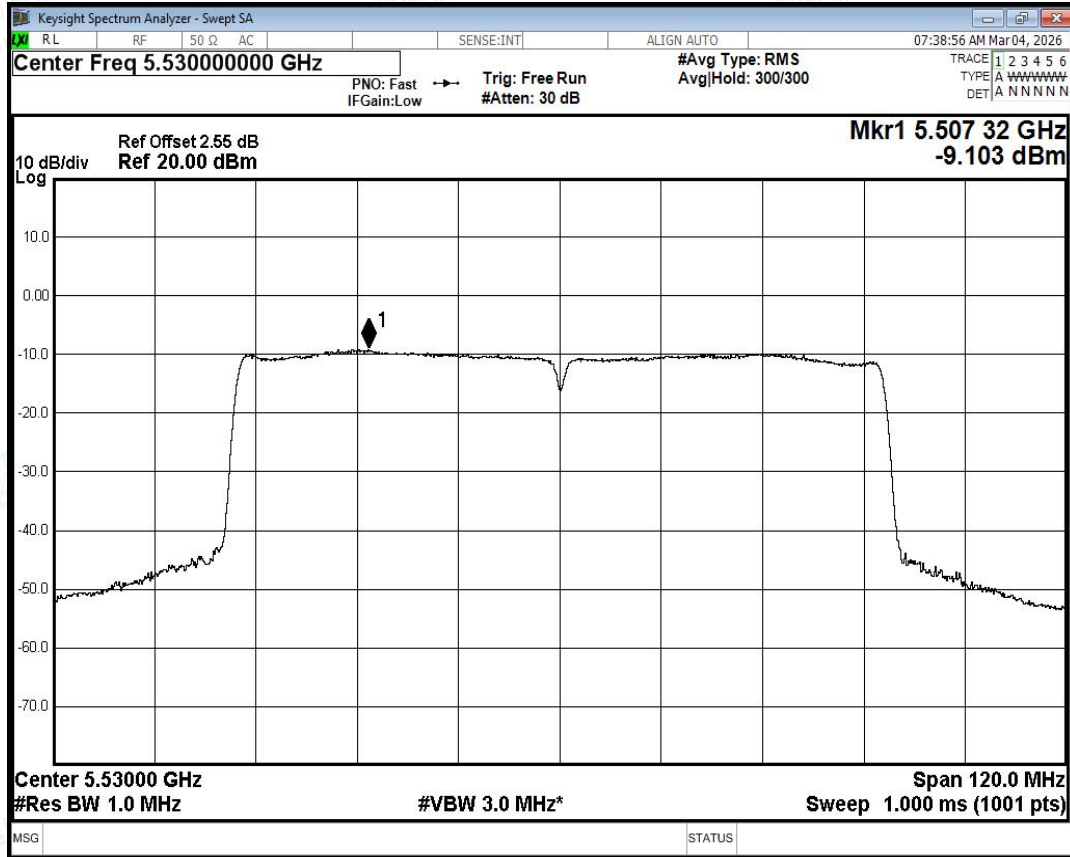

PSD NVNT ac80 5530MHz Ant1




Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

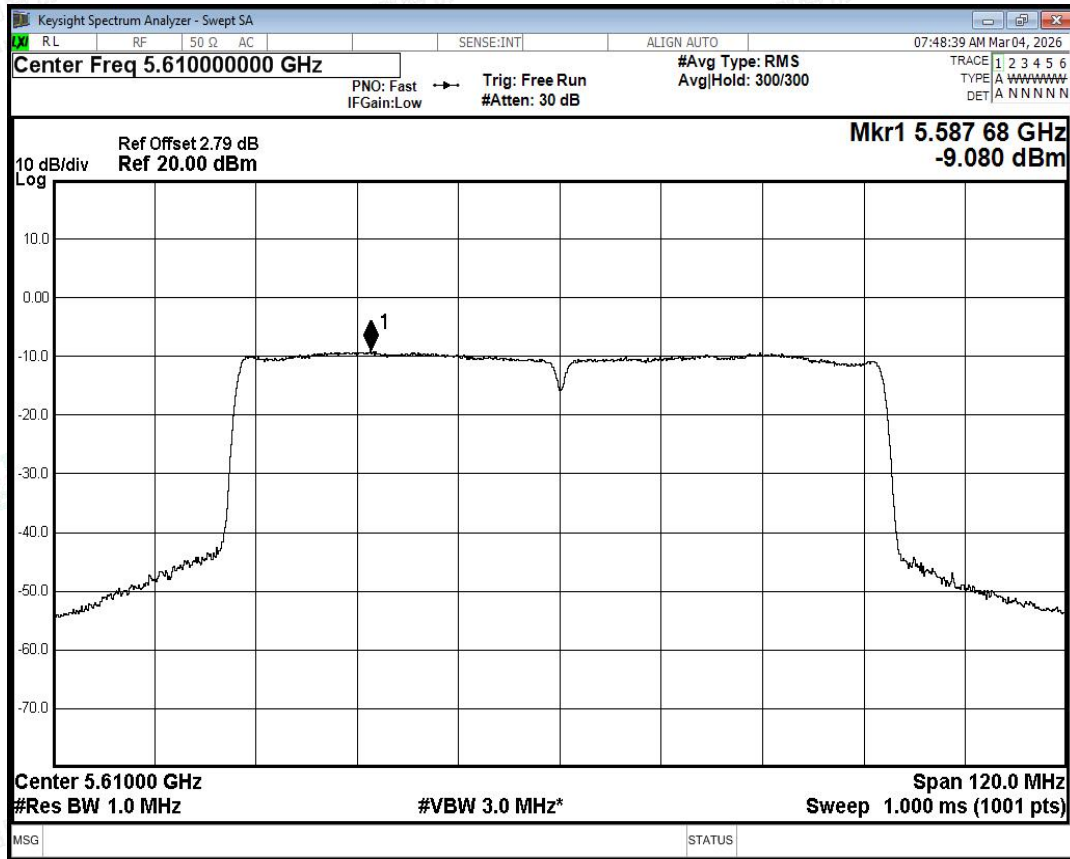

PSD NVNT ac80 5610MHz Ant1




Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

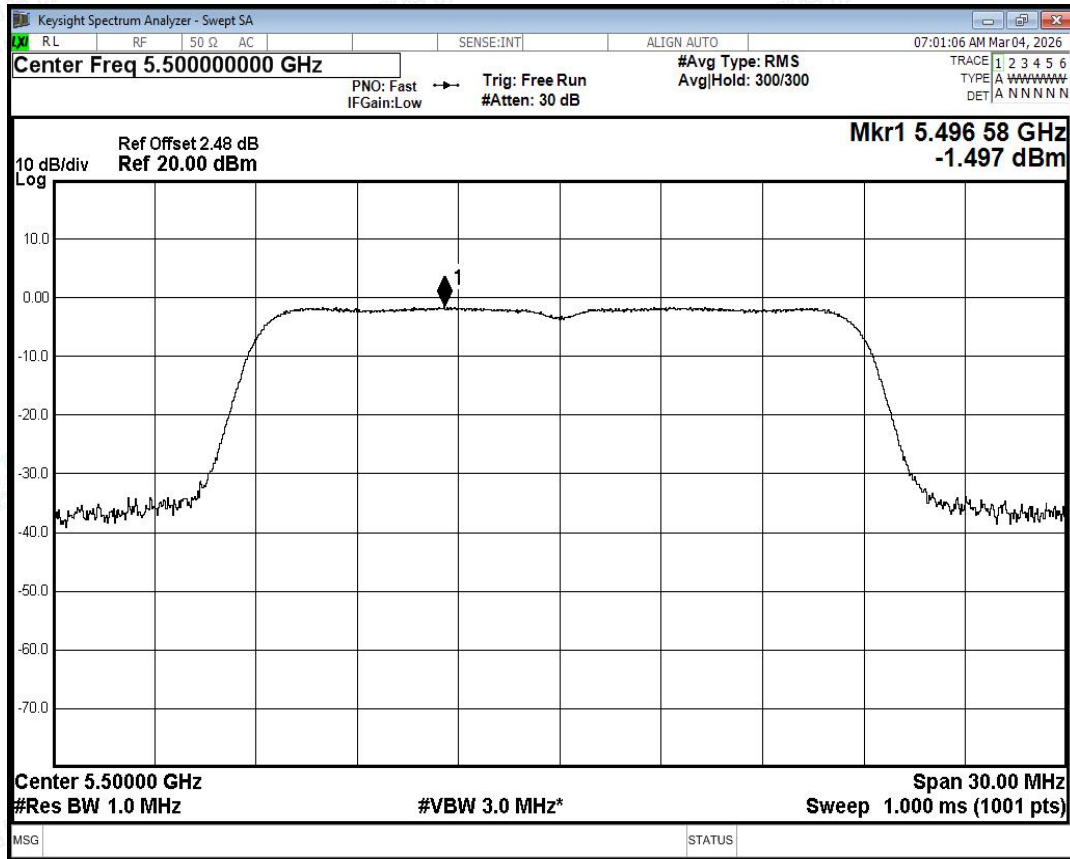


Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

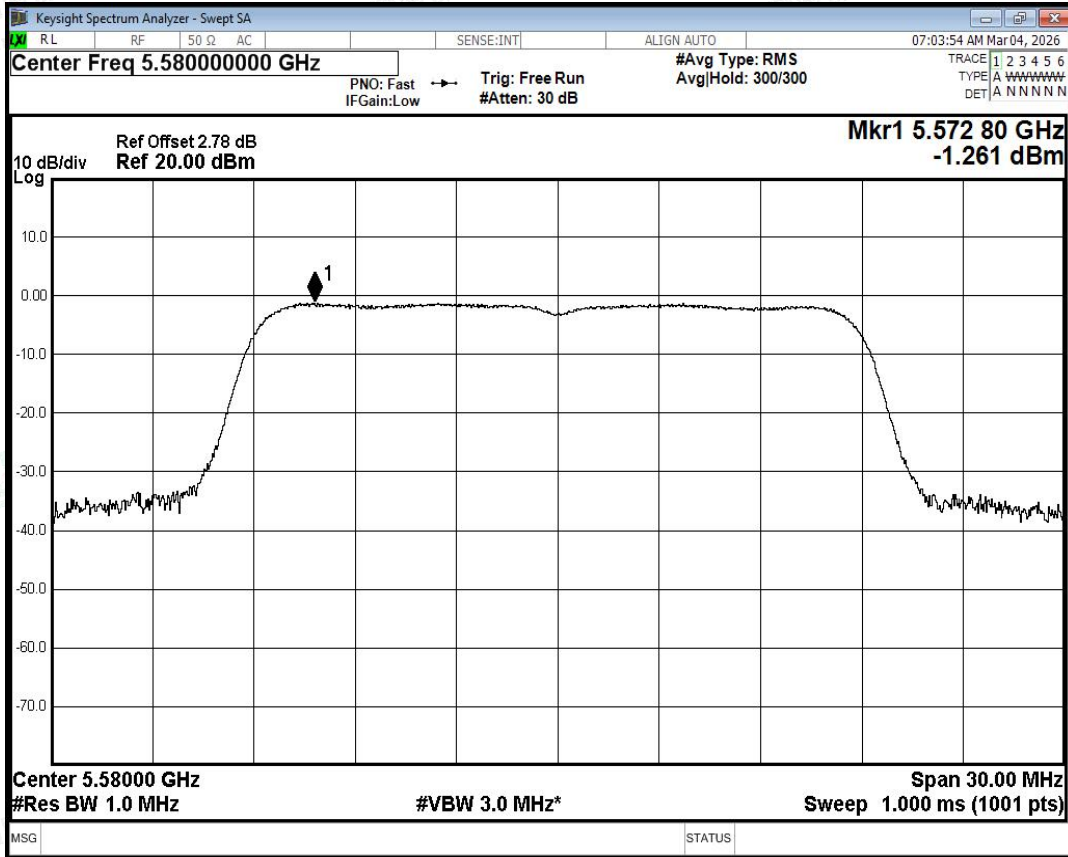


Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

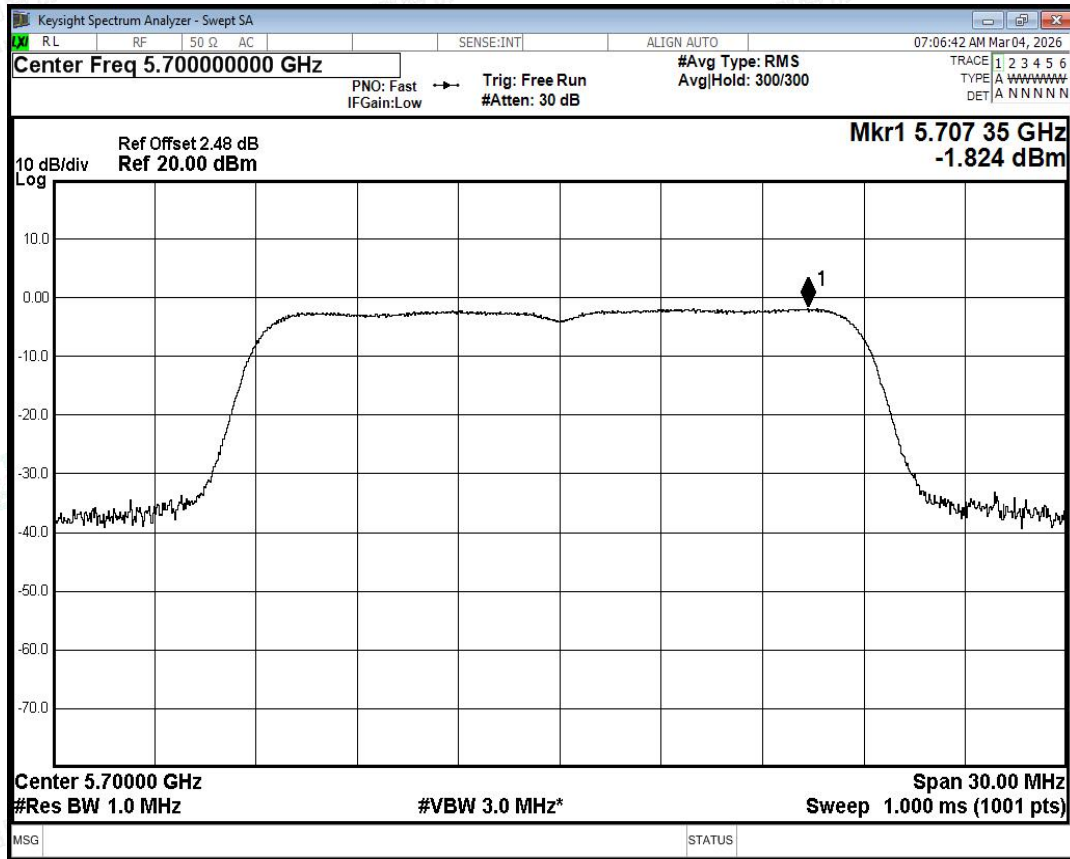


Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

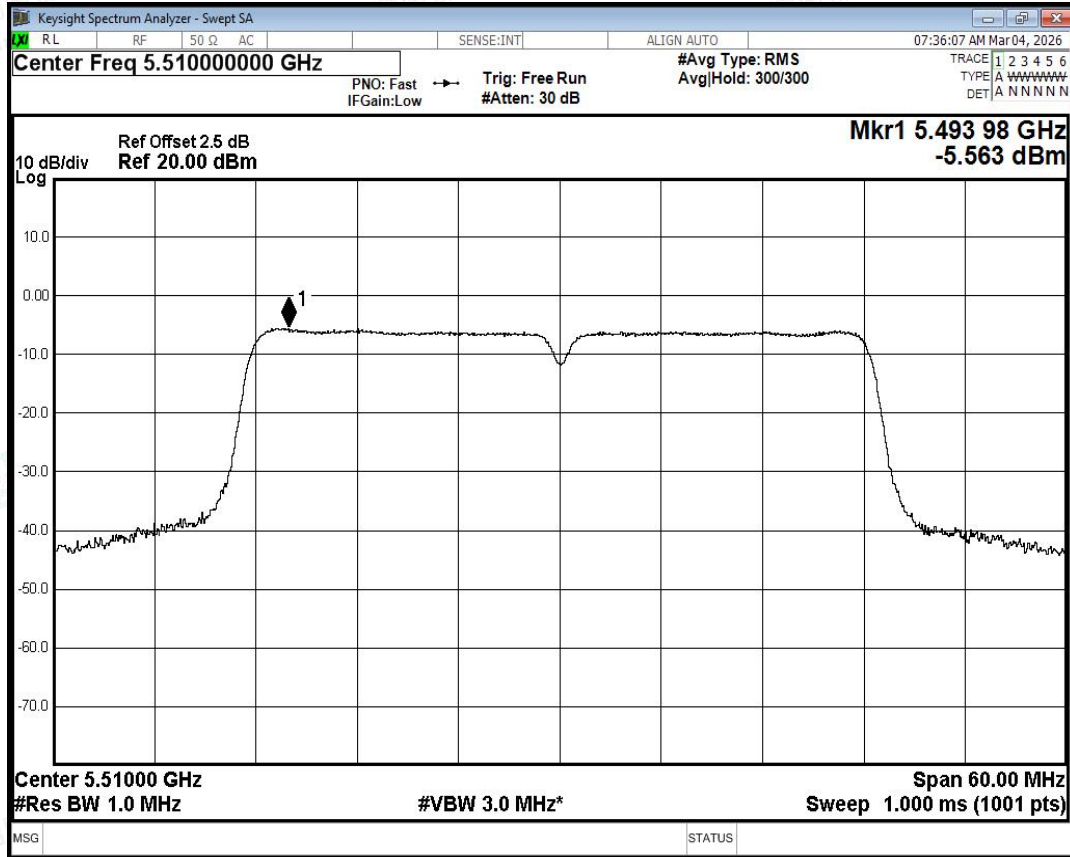


Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

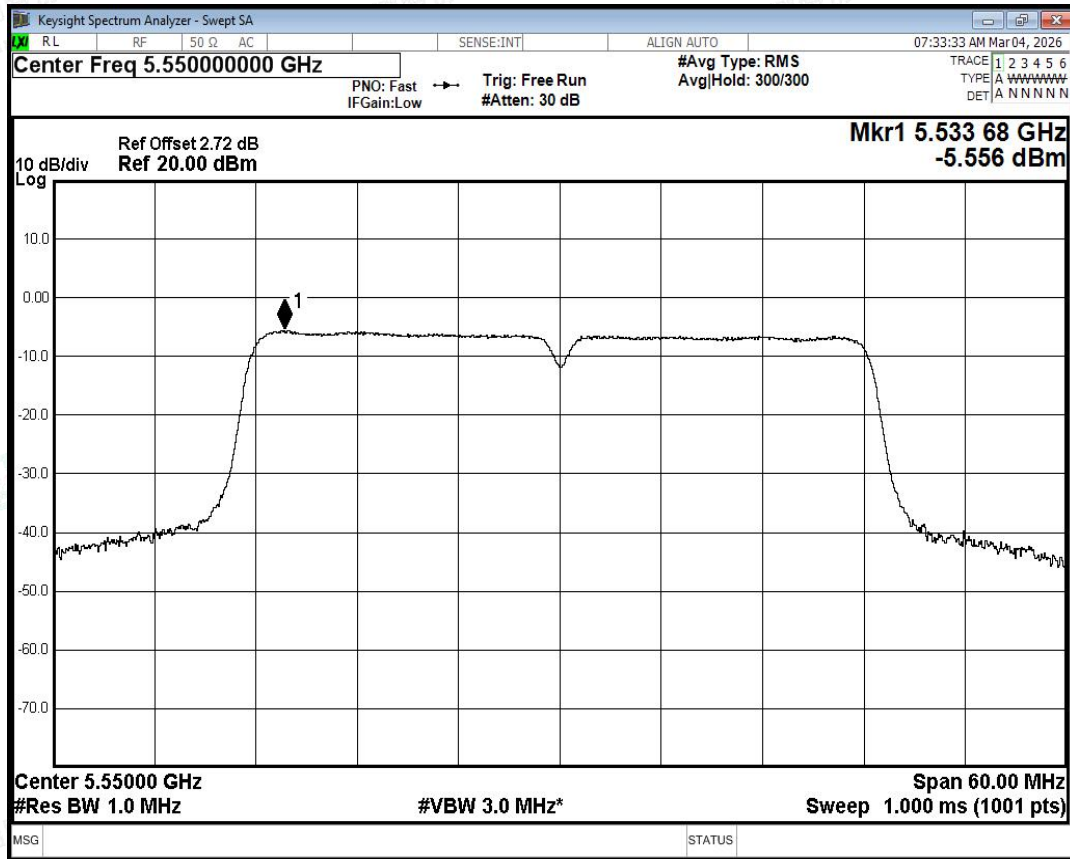


Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

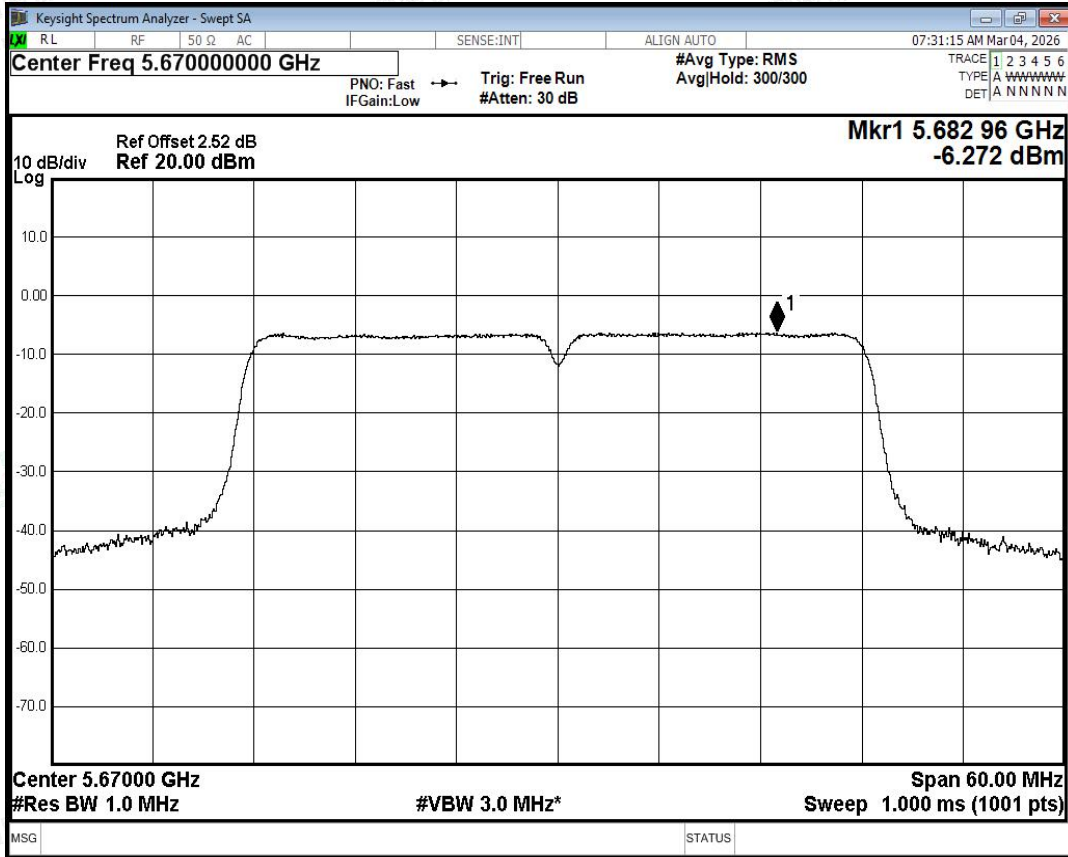


Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

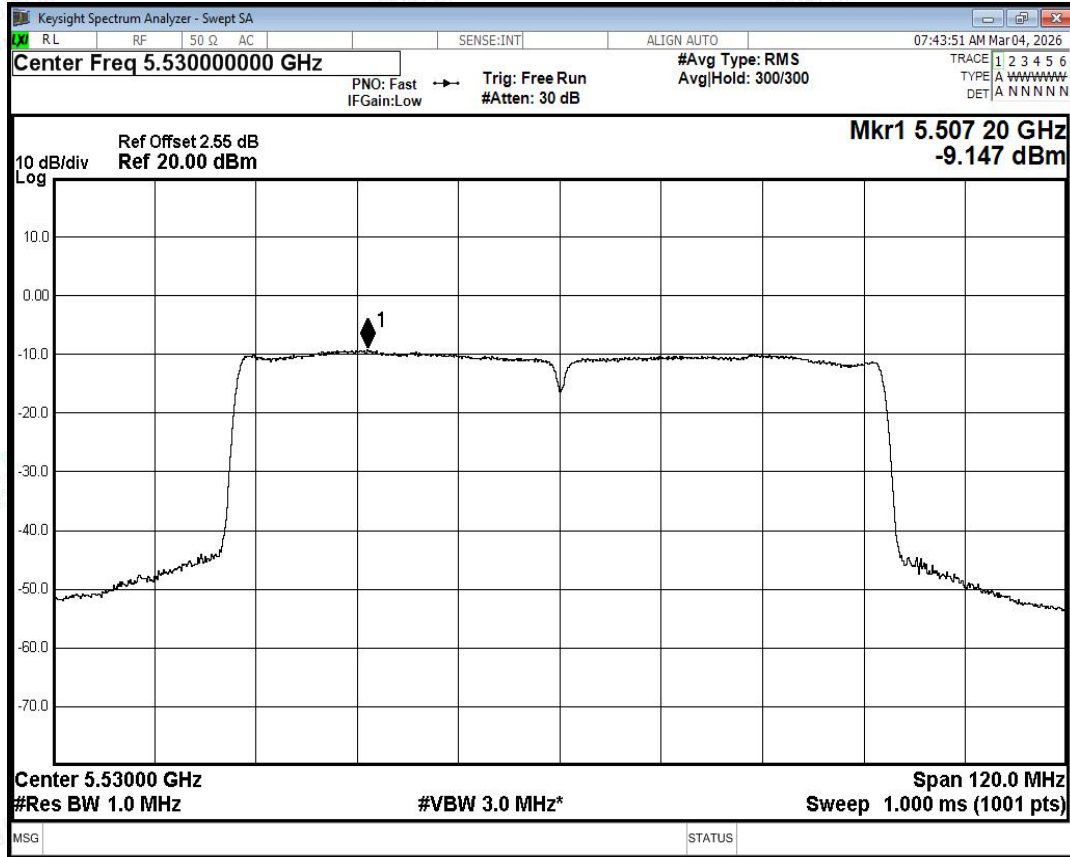

PSD NVNT ax80 5530MHz Ant1




Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

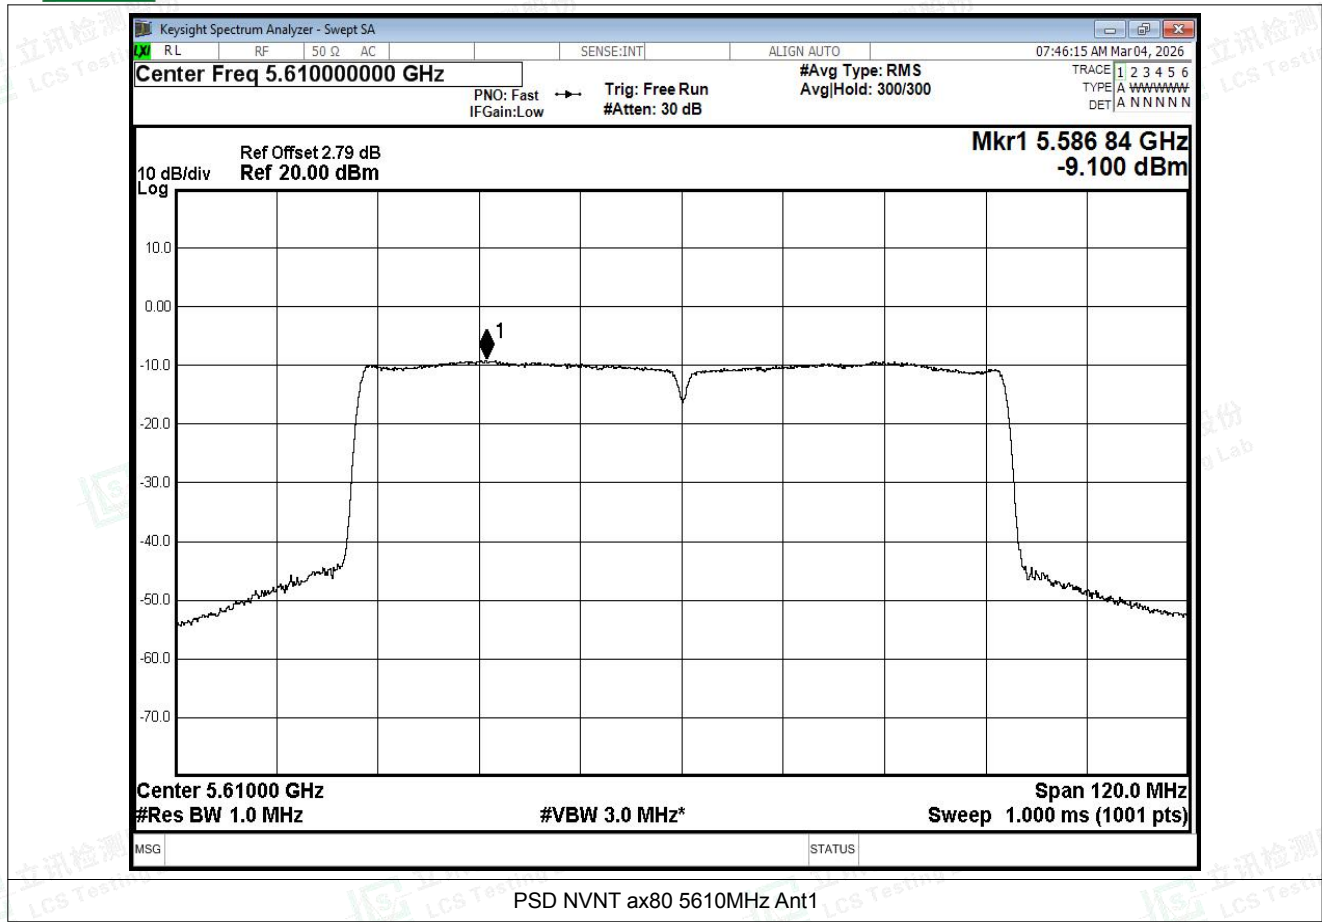

Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



F.4 Restrict Band

Condition	Mode	Frequency (MHz)	Antenna	Spur Freq (MHz)	Power (dBm)	Gain (dBi)	E (dBuV/m)	Detector	Limit (dBuV/m)	Verdict
NVNT	a	5500	Ant1	5460	-42.74	2.00	54.49	Peak	68.2	Pass
NVNT	a	5500	Ant1	5460	-53.9	2.00	43.33	Average	54	Pass
NVNT	a	5500	Ant1	5470	-37.09	2.00	60.14	Peak	68.2	Pass
NVNT	a	5500	Ant1	5470	-47.64	2.00	49.59	Average	54	Pass
NVNT	a	5500	Ant1	5470	-37.09	2.00	60.14	Peak	68.2	Pass
NVNT	a	5500	Ant1	5470	-47.64	2.00	49.59	Average	54	Pass
NVNT	a	5700	Ant1	5725	-32.71	2.00	64.52	Peak	68.2	Pass
NVNT	a	5700	Ant1	5725	-46.17	2.00	51.06	Average	54	Pass
NVNT	a	5700	Ant1	5725.2	-31.41	2.00	65.82	Peak	68.2	Pass
NVNT	a	5700	Ant1	5725	-46.17	2.00	51.06	Average	54	Pass
NVNT	a	5700	Ant1	5735	-43.99	2.00	53.24	Peak	68.2	Pass
NVNT	a	5700	Ant1	5735	-54.27	2.00	42.96	Average	54	Pass
NVNT	n20	5500	Ant1	5460	-44.64	2.00	52.59	Peak	68.2	Pass
NVNT	n20	5500	Ant1	5460	-53.78	2.00	43.45	Average	54	Pass
NVNT	n20	5500	Ant1	5468.6	-33.26	2.00	63.97	Peak	68.2	Pass
NVNT	n20	5500	Ant1	5469.8	-47.92	2.00	49.31	Average	54	Pass
NVNT	n20	5500	Ant1	5470	-38.35	2.00	58.88	Peak	68.2	Pass
NVNT	n20	5500	Ant1	5470	-47.93	2.00	49.30	Average	54	Pass
NVNT	n20	5700	Ant1	5725	-33.18	2.00	64.05	Peak	68.2	Pass
NVNT	n20	5700	Ant1	5725	-43.89	2.00	53.34	Average	54	Pass
NVNT	n20	5700	Ant1	5725.6	-29.39	2.00	67.84	Peak	68.2	Pass
NVNT	n20	5700	Ant1	5725	-43.89	2.00	53.34	Average	54	Pass
NVNT	n20	5700	Ant1	5735	-43.84	2.00	53.39	Peak	68.2	Pass
NVNT	n20	5700	Ant1	5735	-52.8	2.00	44.43	Average	54	Pass
NVNT	n40	5510	Ant1	5460	-41.65	2.00	55.58	Peak	68.2	Pass
NVNT	n40	5510	Ant1	5460	-50.45	2.00	46.78	Average	54	Pass
NVNT	n40	5510	Ant1	5468.4	-33.13	2.00	64.10	Peak	68.2	Pass
NVNT	n40	5510	Ant1	5469.6	-46.53	2.00	50.70	Average	54	Pass
NVNT	n40	5510	Ant1	5470	-34.33	2.00	62.90	Peak	68.2	Pass
NVNT	n40	5510	Ant1	5470	-46.73	2.00	50.50	Average	54	Pass
NVNT	n40	5670	Ant1	5725	-48.21	2.00	49.02	Peak	68.2	Pass
NVNT	n40	5670	Ant1	5725	-55.44	2.00	41.79	Average	54	Pass
NVNT	n40	5670	Ant1	5725.6	-47.25	2.00	49.98	Peak	68.2	Pass
NVNT	n40	5670	Ant1	5726.4	-55.28	2.00	41.95	Average	54	Pass
NVNT	n40	5670	Ant1	5735	-49.86	2.00	47.37	Peak	68.2	Pass
NVNT	n40	5670	Ant1	5735	-56.14	2.00	41.09	Average	54	Pass
NVNT	ac20	5500	Ant1	5460	-43.11	2.00	54.12	Peak	68.2	Pass



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



NVNT	ac20	5500	Ant1	5460	-53.7	2.00	43.53	Average	54	Pass
NVNT	ac20	5500	Ant1	5469.6	-33.98	2.00	63.25	Peak	68.2	Pass
NVNT	ac20	5500	Ant1	5469.6	-46.98	2.00	50.25	Average	54	Pass
NVNT	ac20	5500	Ant1	5470	-34.7	2.00	62.53	Peak	68.2	Pass
NVNT	ac20	5500	Ant1	5470	-47.27	2.00	49.96	Average	54	Pass
NVNT	ac20	5700	Ant1	5725	-33.75	2.00	63.48	Peak	68.2	Pass
NVNT	ac20	5700	Ant1	5725	-44.36	2.00	52.87	Average	54	Pass
NVNT	ac20	5700	Ant1	5725.8	-30.07	2.00	67.16	Peak	68.2	Pass
NVNT	ac20	5700	Ant1	5725	-44.36	2.00	52.87	Average	54	Pass
NVNT	ac20	5700	Ant1	5735	-40.46	2.00	56.77	Peak	68.2	Pass
NVNT	ac20	5700	Ant1	5735	-53.39	2.00	43.84	Average	54	Pass
NVNT	ac40	5510	Ant1	5460	-43.39	2.00	53.84	Peak	68.2	Pass
NVNT	ac40	5510	Ant1	5460	-51.02	2.00	46.21	Average	54	Pass
NVNT	ac40	5510	Ant1	5466.6	-34.83	2.00	62.40	Peak	68.2	Pass
NVNT	ac40	5510	Ant1	5470	-47.04	2.00	50.19	Average	54	Pass
NVNT	ac40	5510	Ant1	5470	-36.82	2.00	60.41	Peak	68.2	Pass
NVNT	ac40	5510	Ant1	5470	-47.04	2.00	50.19	Average	54	Pass
NVNT	ac40	5670	Ant1	5725	-49.51	2.00	47.72	Peak	68.2	Pass
NVNT	ac40	5670	Ant1	5725	-55.27	2.00	41.96	Average	54	Pass
NVNT	ac40	5670	Ant1	5726	-45.32	2.00	51.91	Peak	68.2	Pass
NVNT	ac40	5670	Ant1	5725	-55.27	2.00	41.96	Average	54	Pass
NVNT	ac40	5670	Ant1	5735	-47.98	2.00	49.25	Peak	68.2	Pass
NVNT	ac40	5670	Ant1	5735	-56.14	2.00	41.09	Average	54	Pass
NVNT	ac80	5530	Ant1	5460	-41.74	2.00	55.49	Peak	68.2	Pass
NVNT	ac80	5530	Ant1	5460	-48.66	2.00	48.57	Average	54	Pass
NVNT	ac80	5530	Ant1	5465	-39.69	2.00	57.54	Peak	68.2	Pass
NVNT	ac80	5530	Ant1	5465.2	-48.49	2.00	48.74	Average	54	Pass
NVNT	ac80	5530	Ant1	5470	-43.57	2.00	53.66	Peak	68.2	Pass
NVNT	ac80	5530	Ant1	5470	-49.02	2.00	48.21	Average	54	Pass
NVNT	ac80	5610	Ant1	5725	-48.3	2.00	48.93	Peak	68.2	Pass
NVNT	ac80	5610	Ant1	5725	-56.17	2.00	41.06	Average	54	Pass
NVNT	ac80	5610	Ant1	5730.49	-46.94	2.00	50.29	Peak	68.2	Pass
NVNT	ac80	5610	Ant1	5729.465	-55.82	2.00	41.41	Average	54	Pass
NVNT	ac80	5610	Ant1	5735	-50.92	2.00	46.31	Peak	68.2	Pass
NVNT	ac80	5610	Ant1	5735	-56.23	2.00	41.00	Average	54	Pass
NVNT	ax20	5500	Ant1	5460	-43.79	2.00	53.44	Peak	68.2	Pass
NVNT	ax20	5500	Ant1	5460	-53.69	2.00	43.54	Average	54	Pass
NVNT	ax20	5500	Ant1	5469.6	-35.57	2.00	61.66	Peak	68.2	Pass
NVNT	ax20	5500	Ant1	5469.8	-47.04	2.00	50.19	Average	54	Pass
NVNT	ax20	5500	Ant1	5470	-37.03	2.00	60.20	Peak	68.2	Pass
NVNT	ax20	5500	Ant1	5470	-47.3	2.00	49.93	Average	54	Pass



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



NVNT	ax20	5700	Ant1	5725	-33.58	2.00	63.65	Peak	68.2	Pass
NVNT	ax20	5700	Ant1	5725	-44.52	2.00	52.71	Average	54	Pass
NVNT	ax20	5700	Ant1	5726.4	-31.49	2.00	65.74	Peak	68.2	Pass
NVNT	ax20	5700	Ant1	5725	-44.52	2.00	52.71	Average	54	Pass
NVNT	ax20	5700	Ant1	5735	-44.84	2.00	52.39	Peak	68.2	Pass
NVNT	ax20	5700	Ant1	5735	-53.52	2.00	43.71	Average	54	Pass
NVNT	ax40	5510	Ant1	5460	-43.53	2.00	53.70	Peak	68.2	Pass
NVNT	ax40	5510	Ant1	5460	-51.99	2.00	45.24	Average	54	Pass
NVNT	ax40	5510	Ant1	5468.4	-35.77	2.00	61.46	Peak	68.2	Pass
NVNT	ax40	5510	Ant1	5470	-46.91	2.00	50.32	Average	54	Pass
NVNT	ax40	5510	Ant1	5470	-35.95	2.00	61.28	Peak	68.2	Pass
NVNT	ax40	5510	Ant1	5470	-46.91	2.00	50.32	Average	54	Pass
NVNT	ax40	5670	Ant1	5725	-48.44	2.00	48.79	Peak	68.2	Pass
NVNT	ax40	5670	Ant1	5725	-55.41	2.00	41.82	Average	54	Pass
NVNT	ax40	5670	Ant1	5728	-46.54	2.00	50.69	Peak	68.2	Pass
NVNT	ax40	5670	Ant1	5725.8	-55.17	2.00	42.06	Average	54	Pass
NVNT	ax40	5670	Ant1	5735	-50.15	2.00	47.08	Peak	68.2	Pass
NVNT	ax40	5670	Ant1	5735	-56.08	2.00	41.15	Average	54	Pass
NVNT	ax80	5530	Ant1	5460	-41.57	2.00	55.66	Peak	68.2	Pass
NVNT	ax80	5530	Ant1	5460	-48.73	2.00	48.50	Average	54	Pass
NVNT	ax80	5530	Ant1	5467.2	-38.2	2.00	59.03	Peak	68.2	Pass
NVNT	ax80	5530	Ant1	5465	-48.46	2.00	48.77	Average	54	Pass
NVNT	ax80	5530	Ant1	5470	-41.78	2.00	55.45	Peak	68.2	Pass
NVNT	ax80	5530	Ant1	5470	-49.22	2.00	48.01	Average	54	Pass
NVNT	ax80	5610	Ant1	5725	-50.11	2.00	47.12	Peak	68.2	Pass
NVNT	ax80	5610	Ant1	5725	-56.28	2.00	40.95	Average	54	Pass
NVNT	ax80	5610	Ant1	5725.365	-47.66	2.00	49.57	Peak	68.2	Pass
NVNT	ax80	5610	Ant1	5730.9	-55.88	2.00	41.35	Average	54	Pass
NVNT	ax80	5610	Ant1	5735	-49.64	2.00	47.59	Peak	68.2	Pass
NVNT	ax80	5610	Ant1	5735	-56.35	2.00	40.88	Average	54	Pass




Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

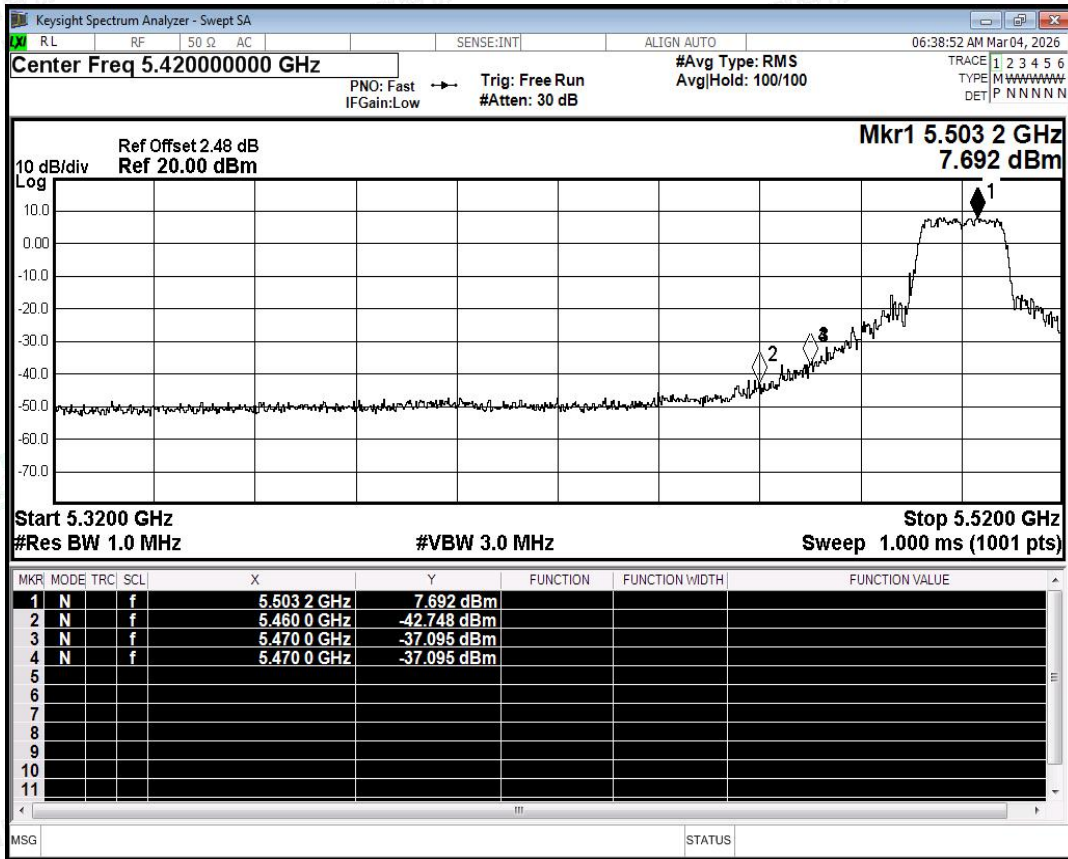

Restrict Band NVNT a 5500MHz Ant1 Peak




Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity

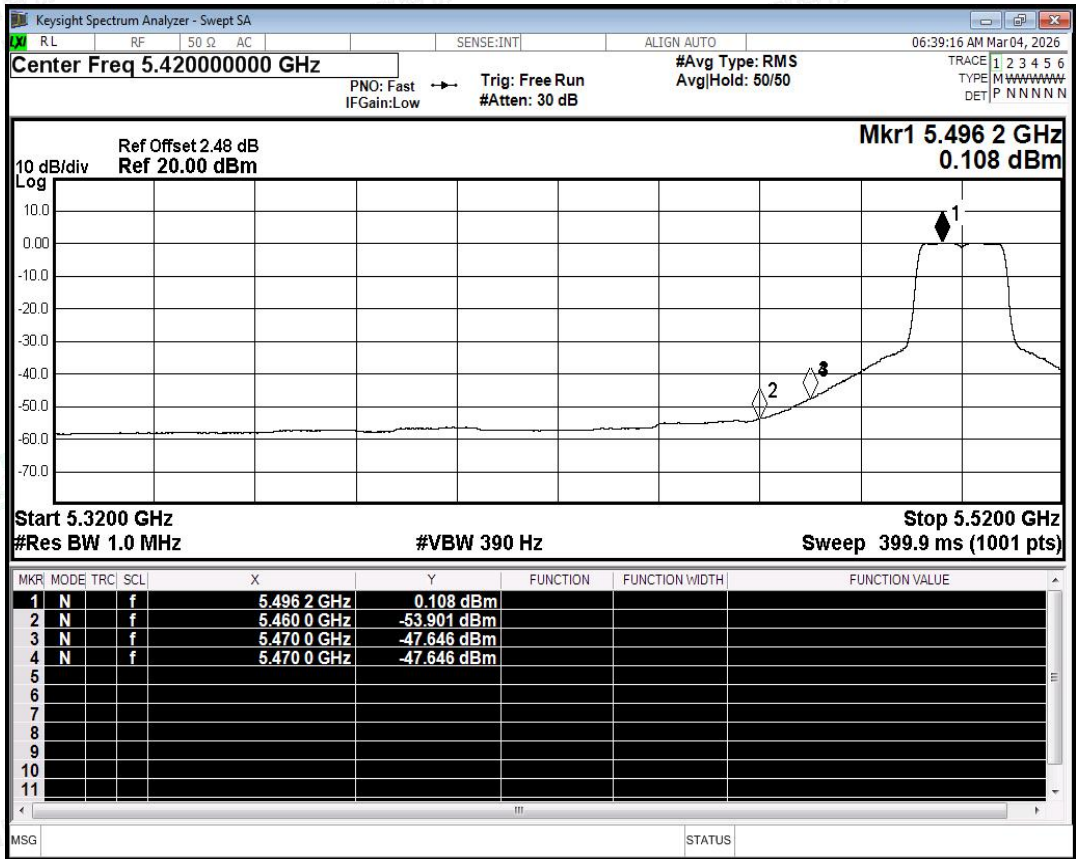

Restrict Band NVNT a 5500MHz Ant1 Average




Shenzhen LCS Compliance Testing Laboratory Ltd.
Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China
Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com
Scan code to check authenticity

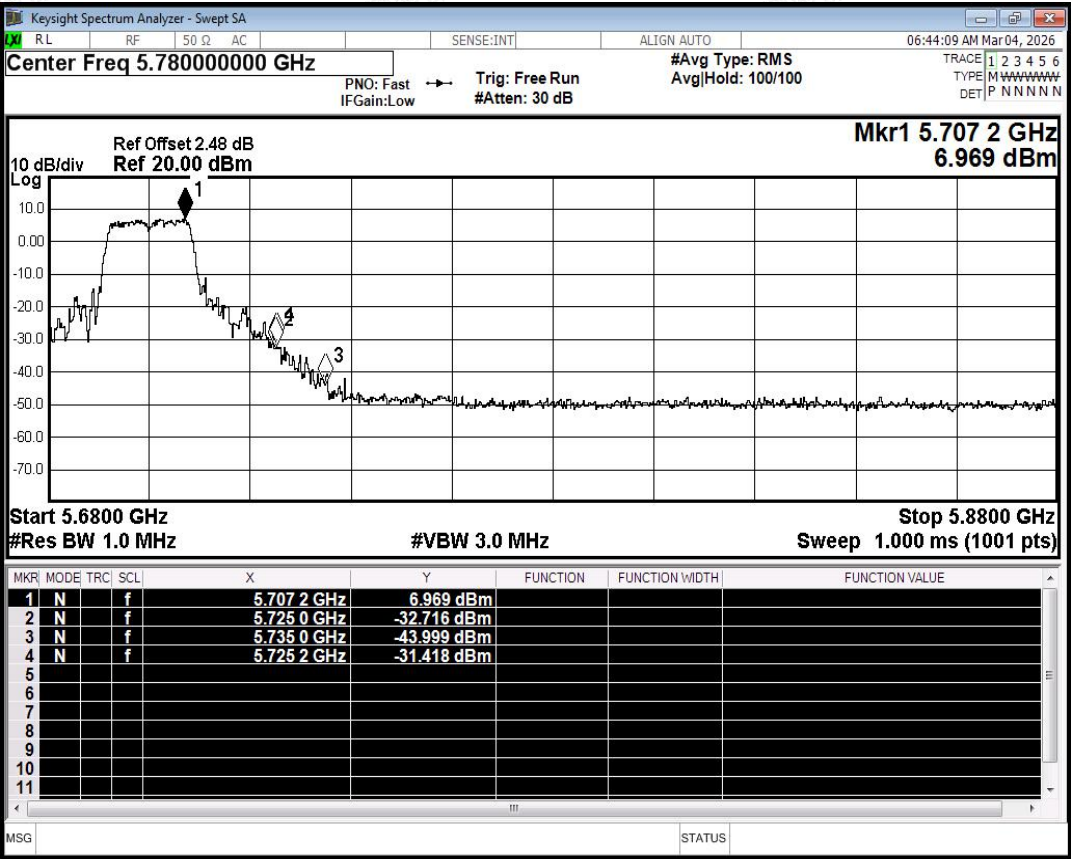

Restrict Band NVNT a 5700MHz Ant1 Peak



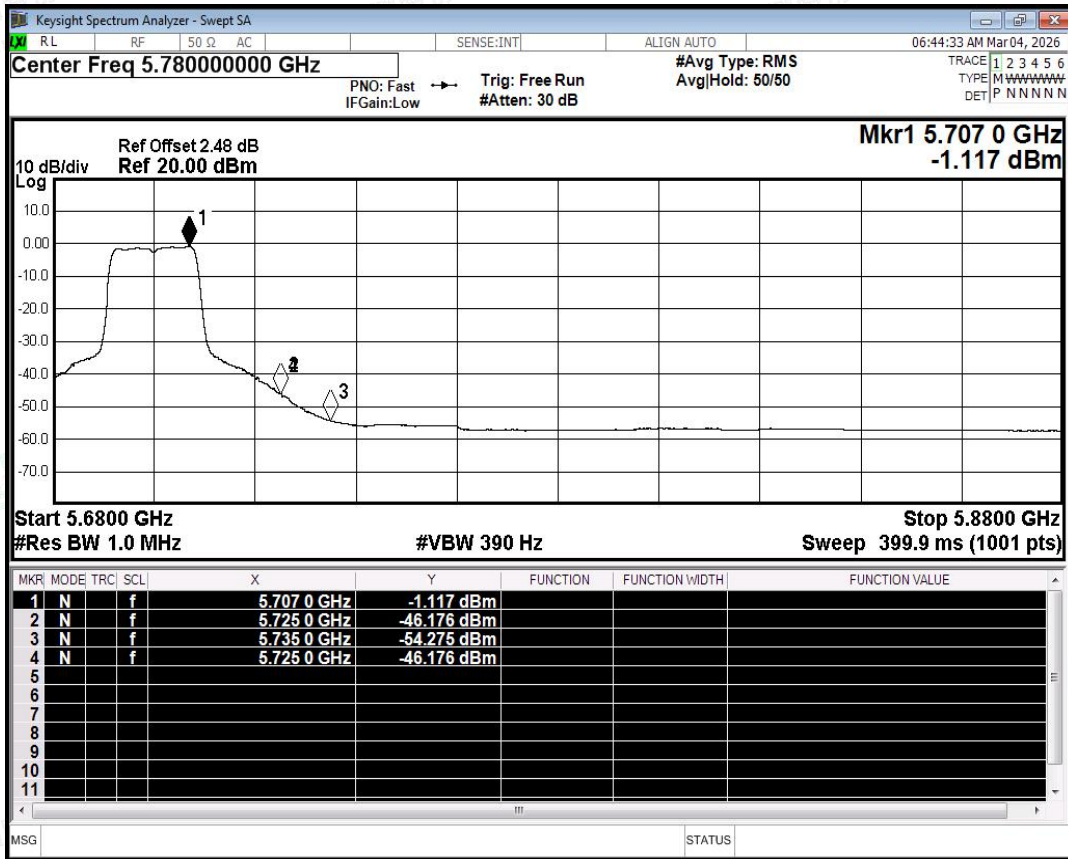

Restrict Band NVNT a 5700MHz Ant1 Average




Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

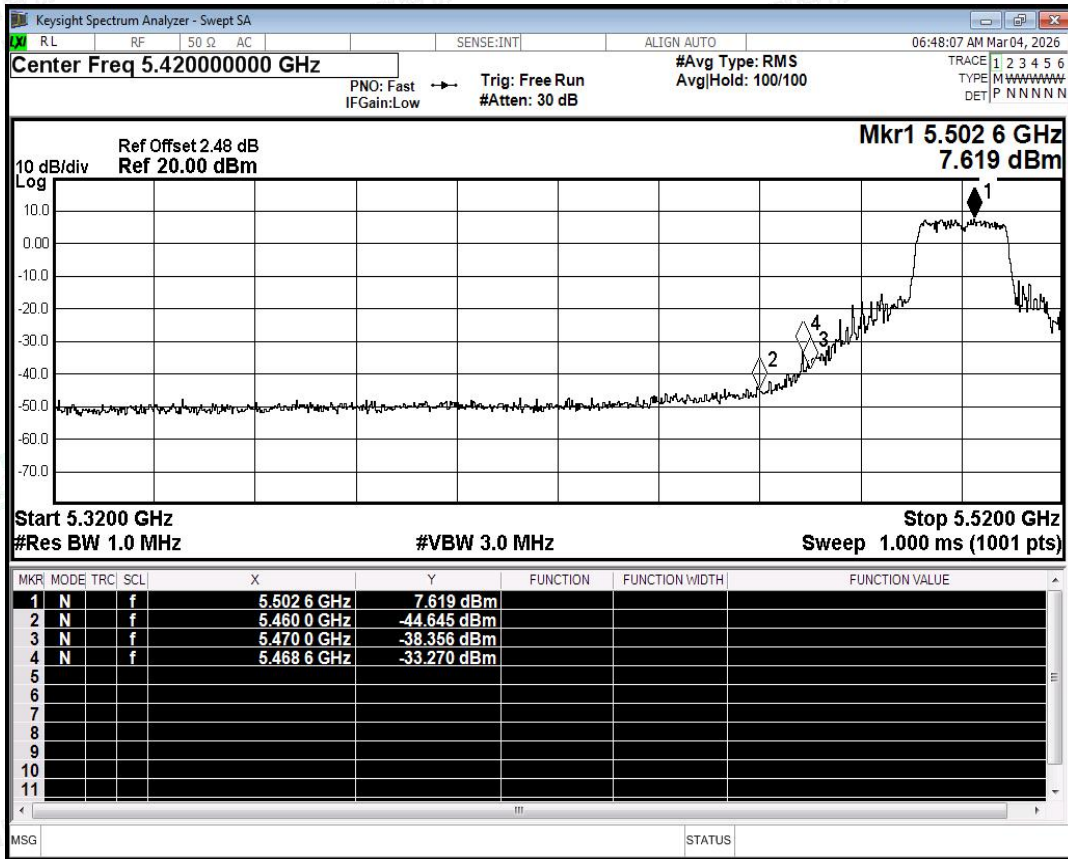

Restrict Band NVNT n20 5500MHz Ant1 Peak




Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

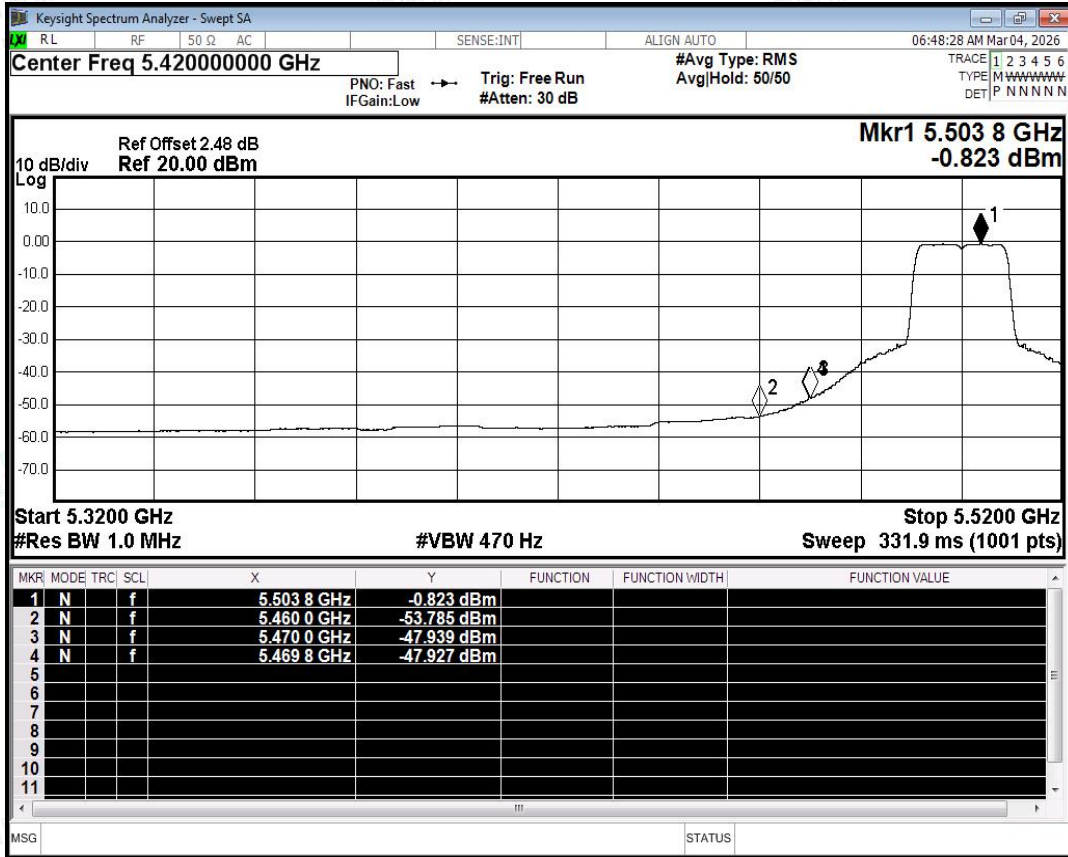

Restrict Band NVNT n20 5500MHz Ant1 Average




Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China


Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

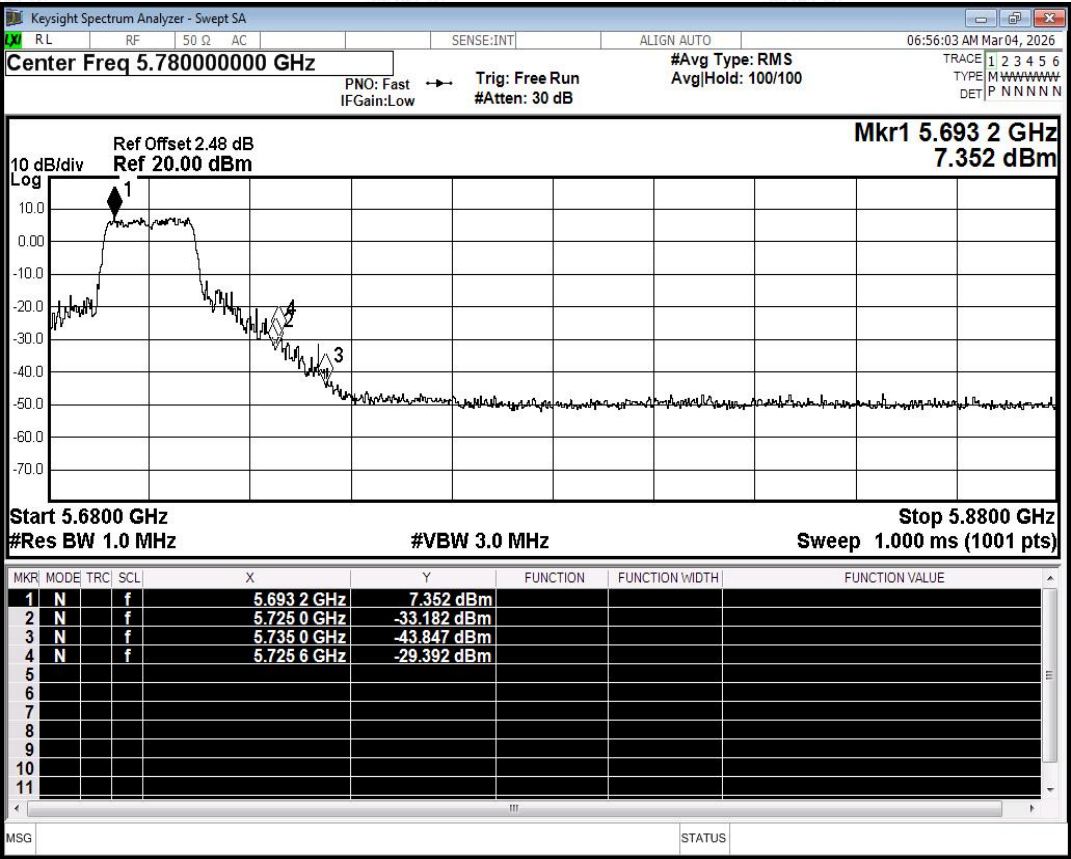

Restrict Band NVNT n20 5700MHz Ant1 Peak



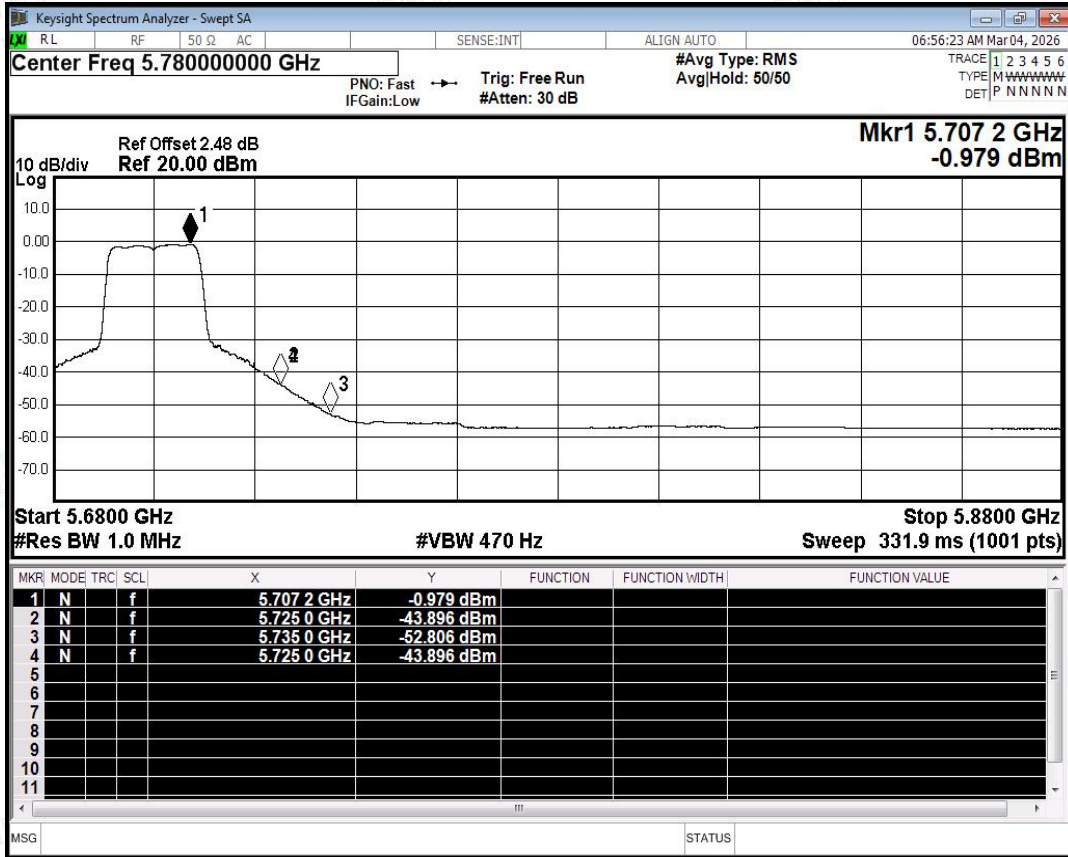

Restrict Band NVNT n20 5700MHz Ant1 Average




Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

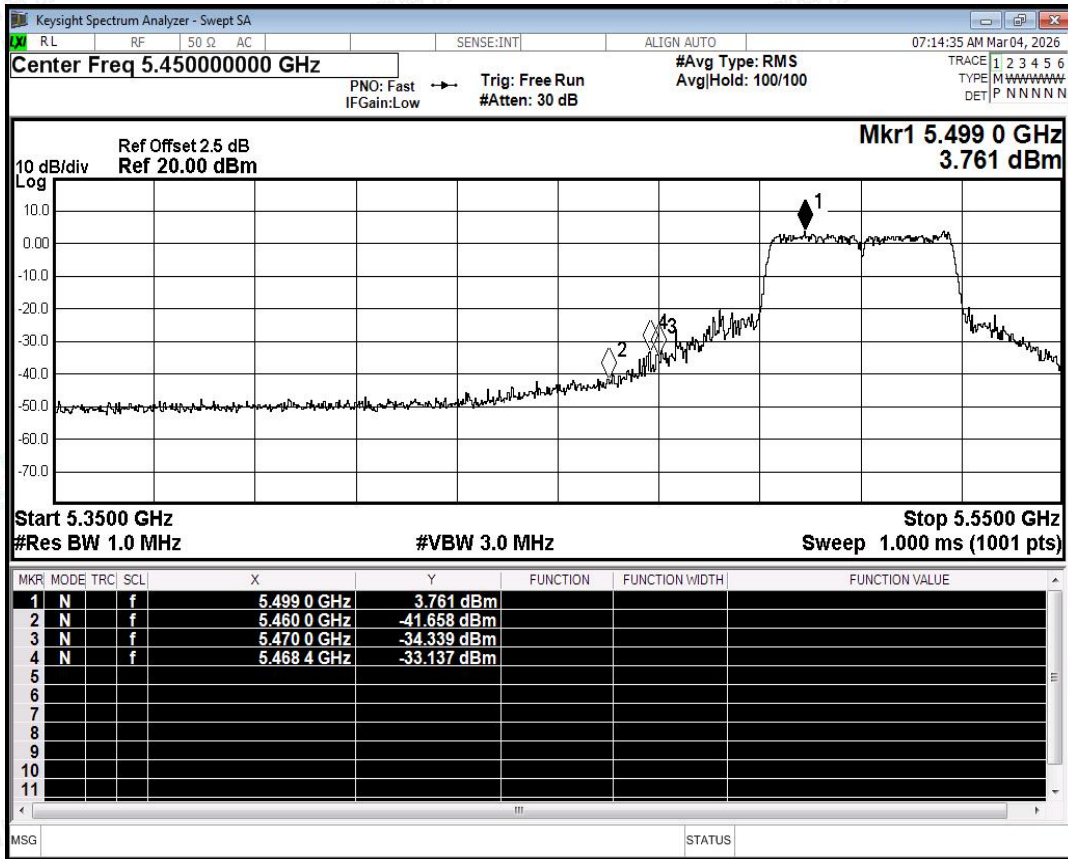

Restrict Band NVNT n40 5510MHz Ant1 Peak




Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

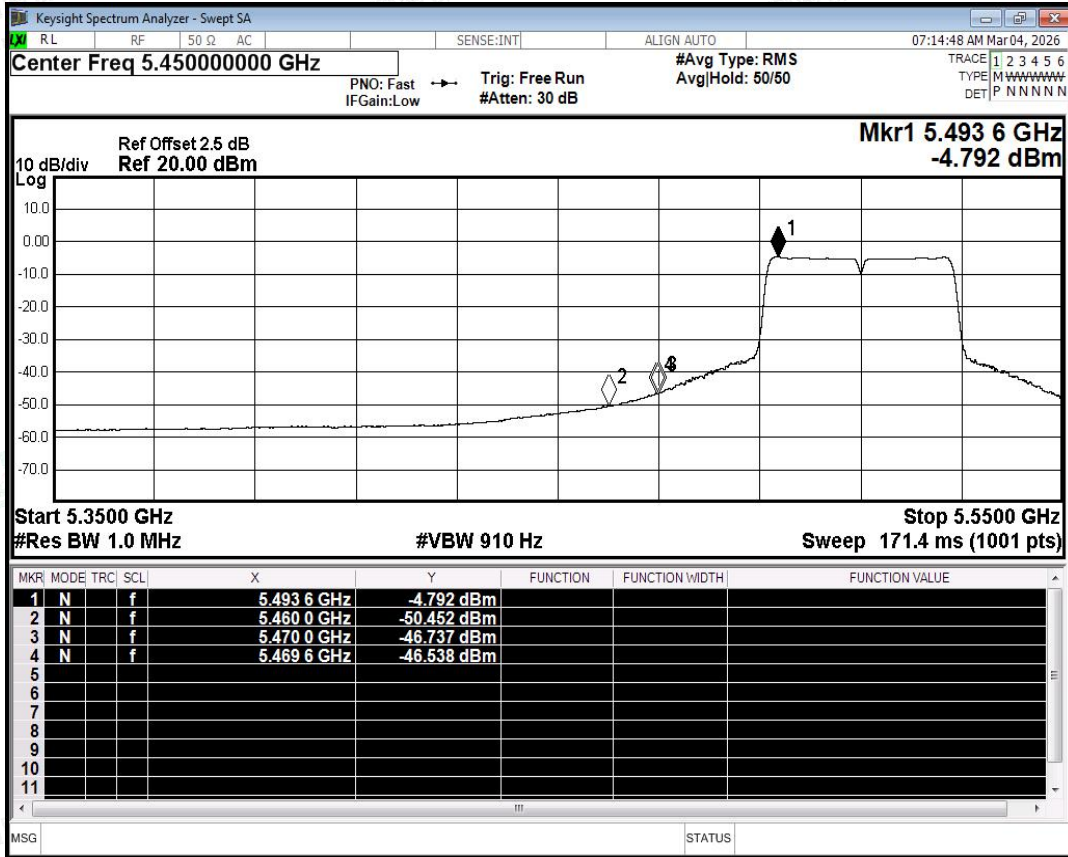

Restrict Band NVNT n40 5510MHz Ant1 Average




Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China


Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

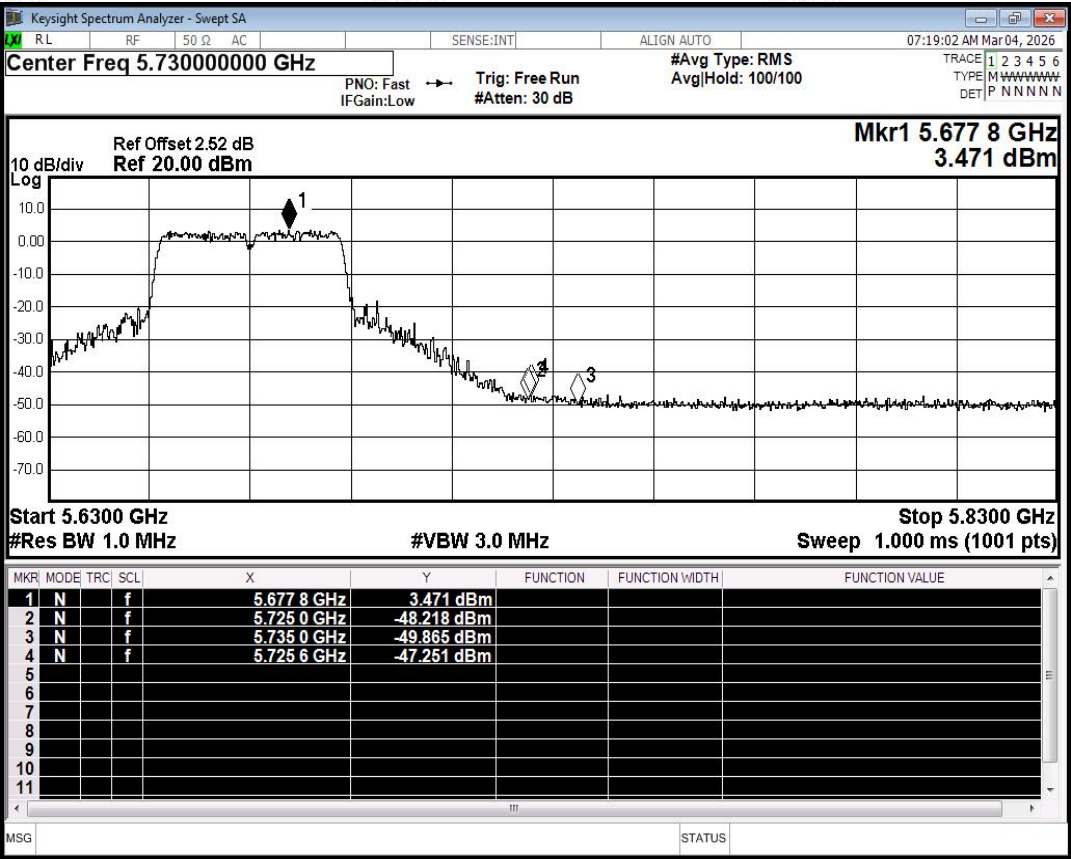

Restrict Band NVNT n40 5670MHz Ant1 Peak




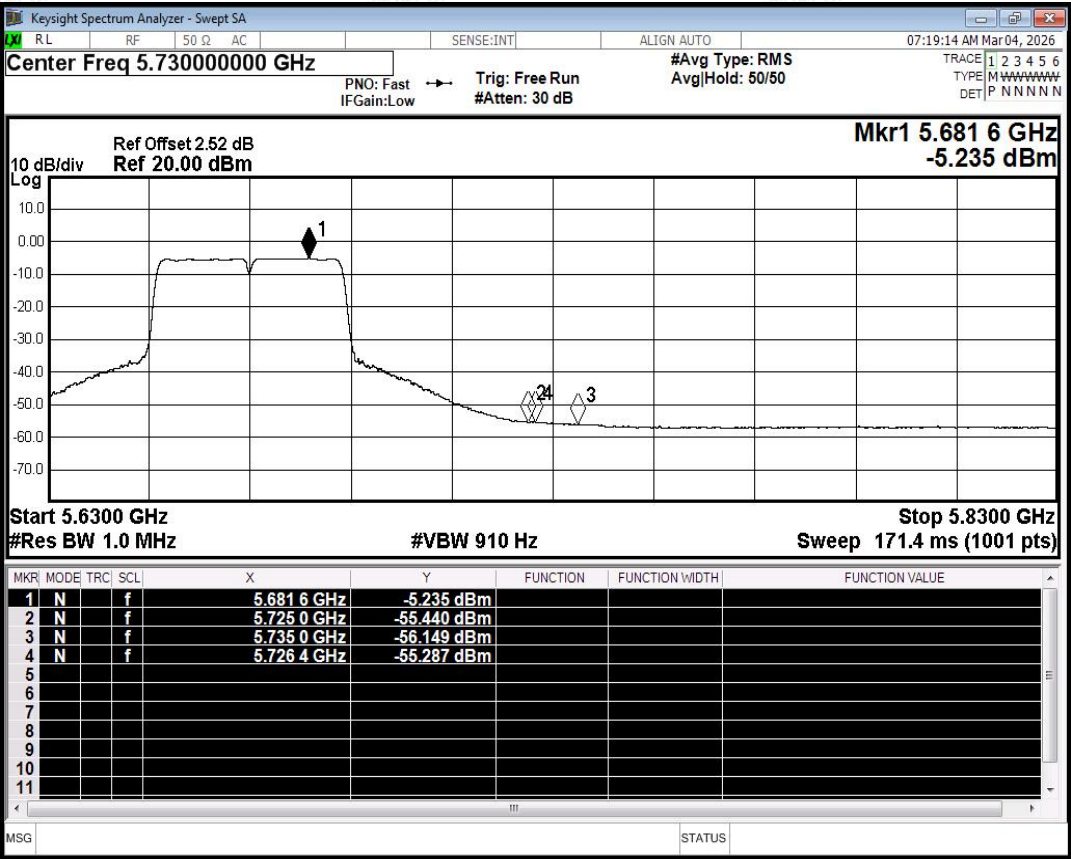

Restrict Band NVNT n40 5670MHz Ant1 Average




Shenzhen LCS Compliance Testing Laboratory Ltd.
Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China
Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com
Scan code to check authenticity

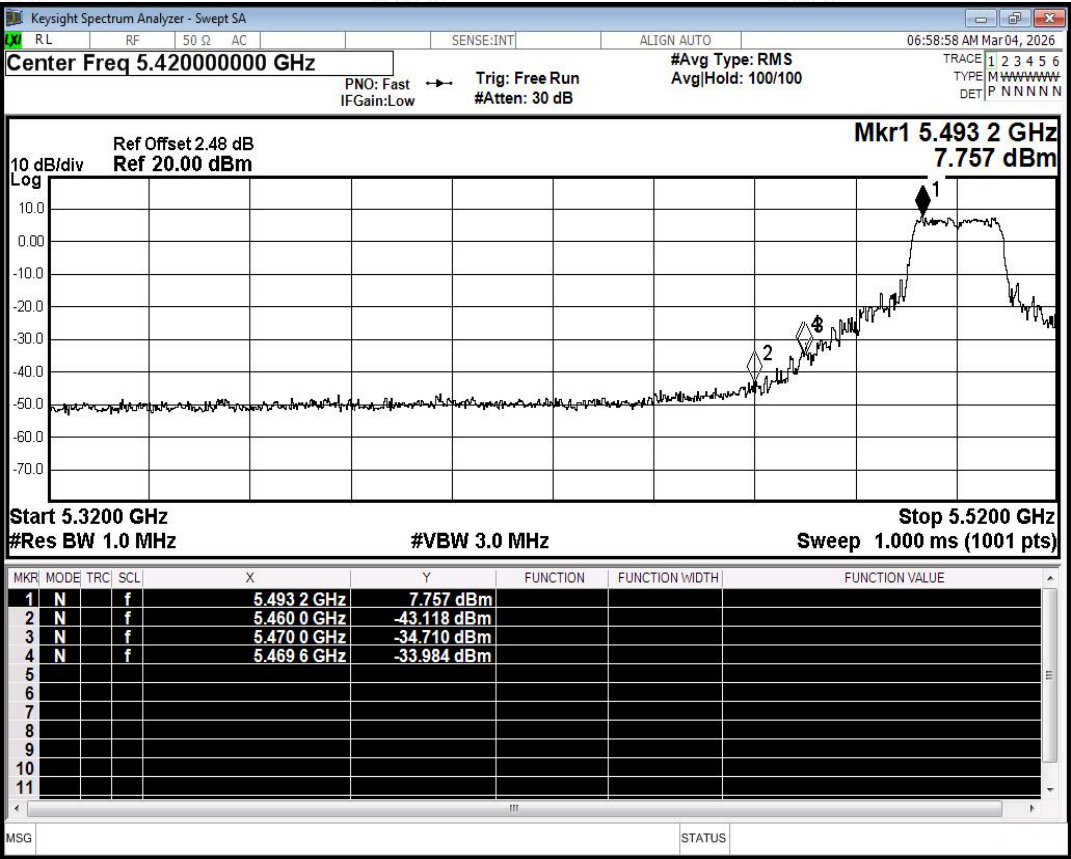

Restrict Band NVNT ac20 5500MHz Ant1 Peak




Shenzhen LCS Compliance Testing Laboratory Ltd.
Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China
Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com
Scan code to check authenticity

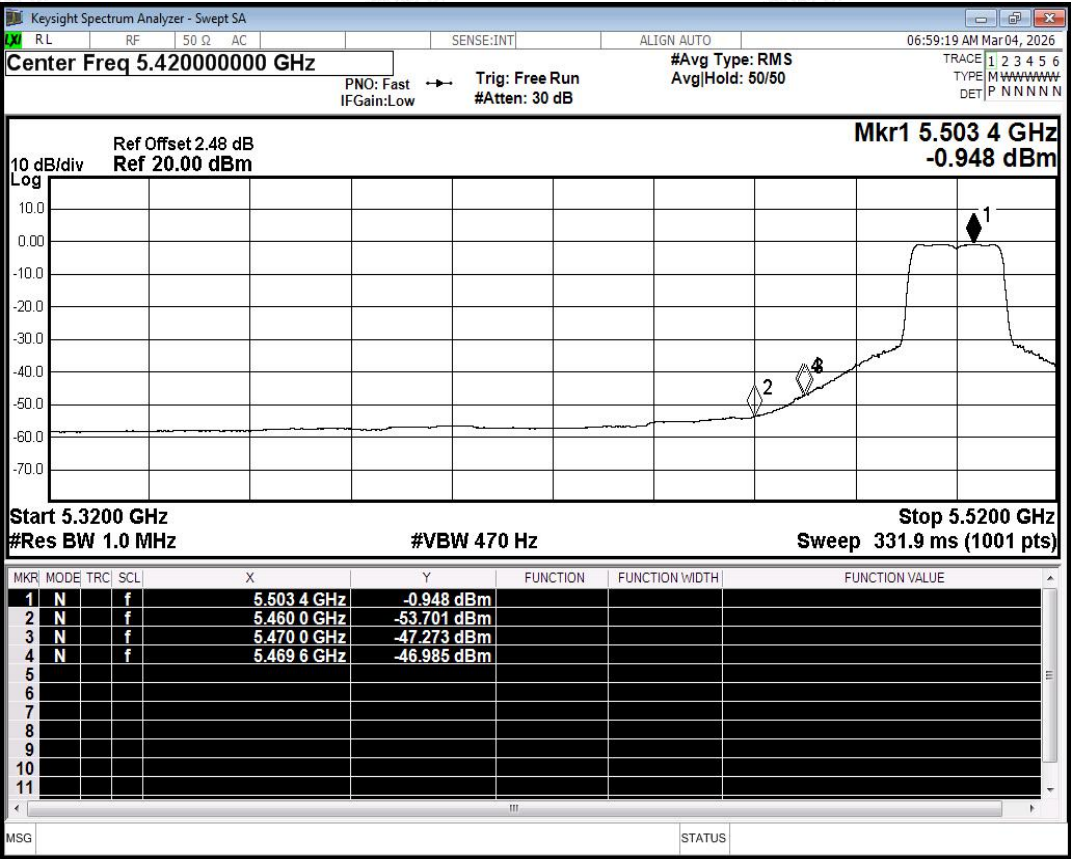

Restrict Band NVNT ac20 5500MHz Ant1 Average



Shenzhen LCS Compliance Testing Laboratory Ltd.
Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China
Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com
Scan code to check authenticity

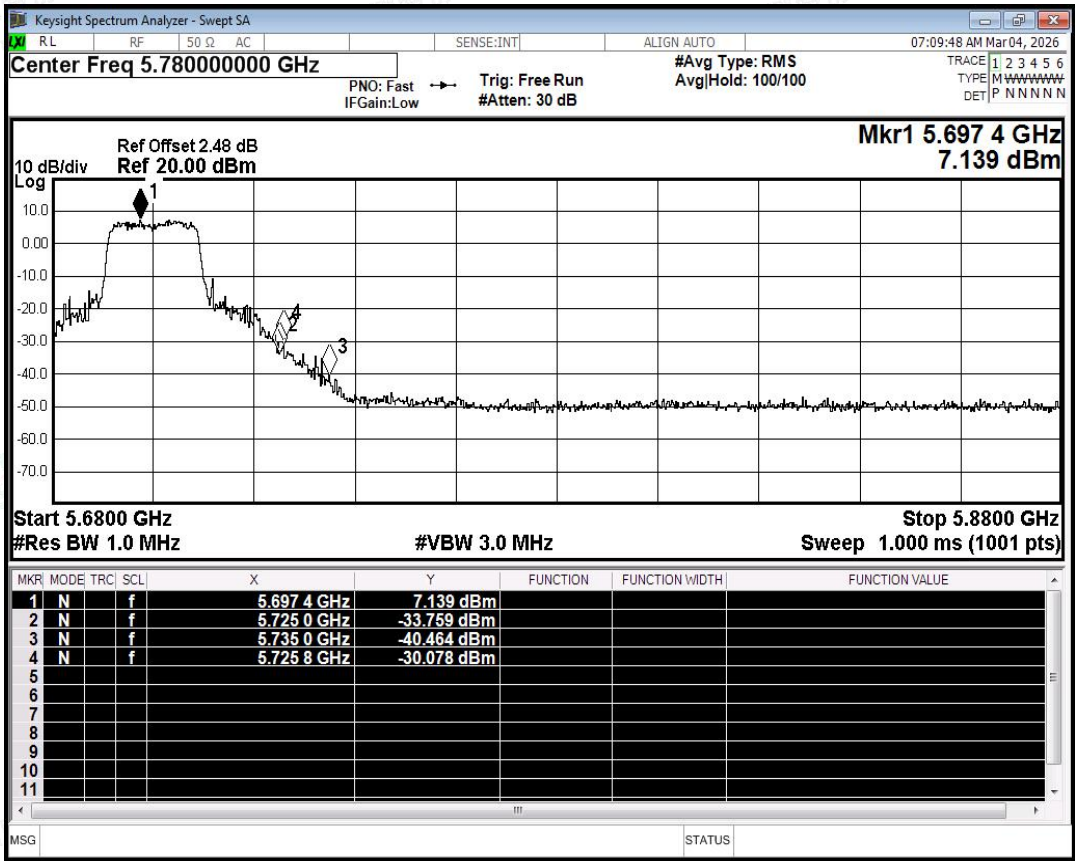

Restrict Band NVNT ac20 5700MHz Ant1 Peak



Shenzhen LCS Compliance Testing Laboratory Ltd.
Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China
Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com
Scan code to check authenticity