




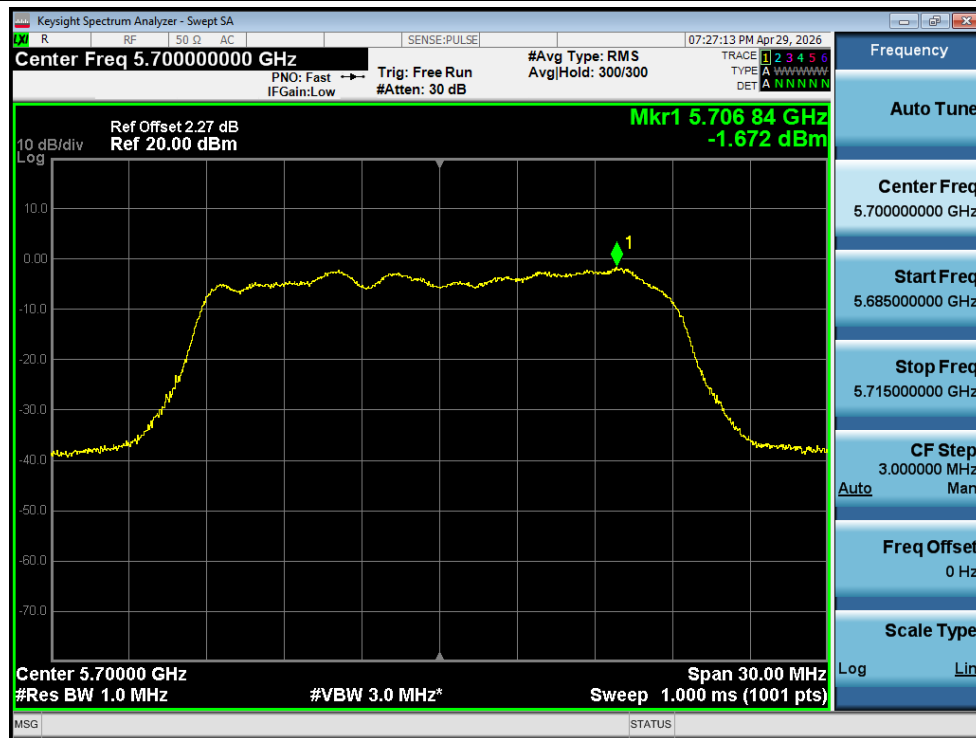

PSD NVNT ac20 5700MHz Ant1

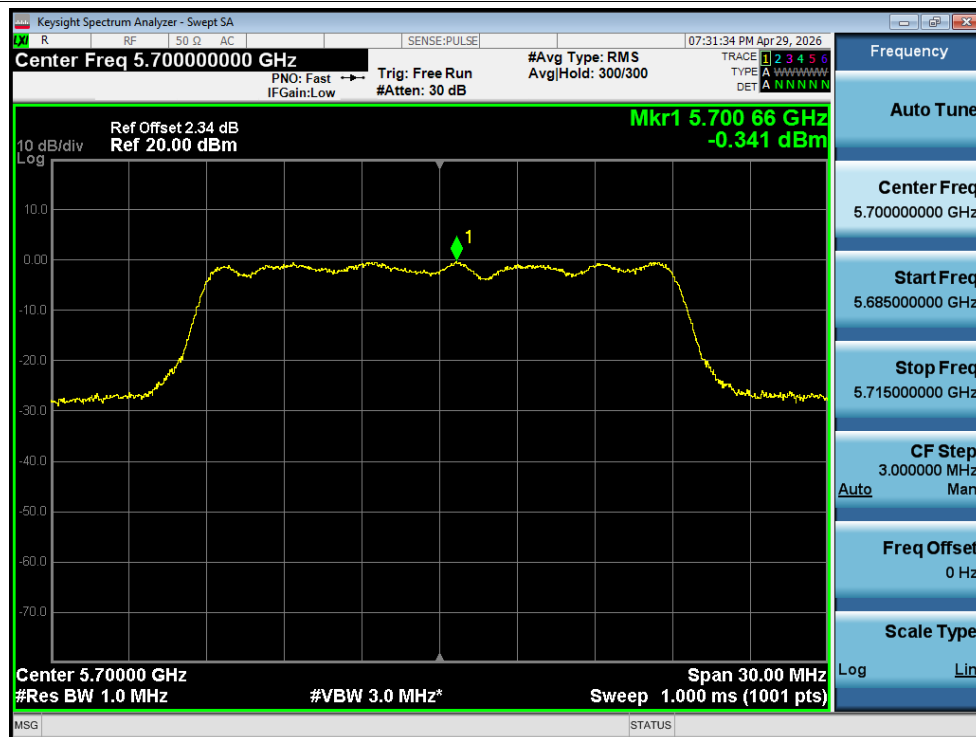


PSD NVNT ac20 5700MHz Ant2

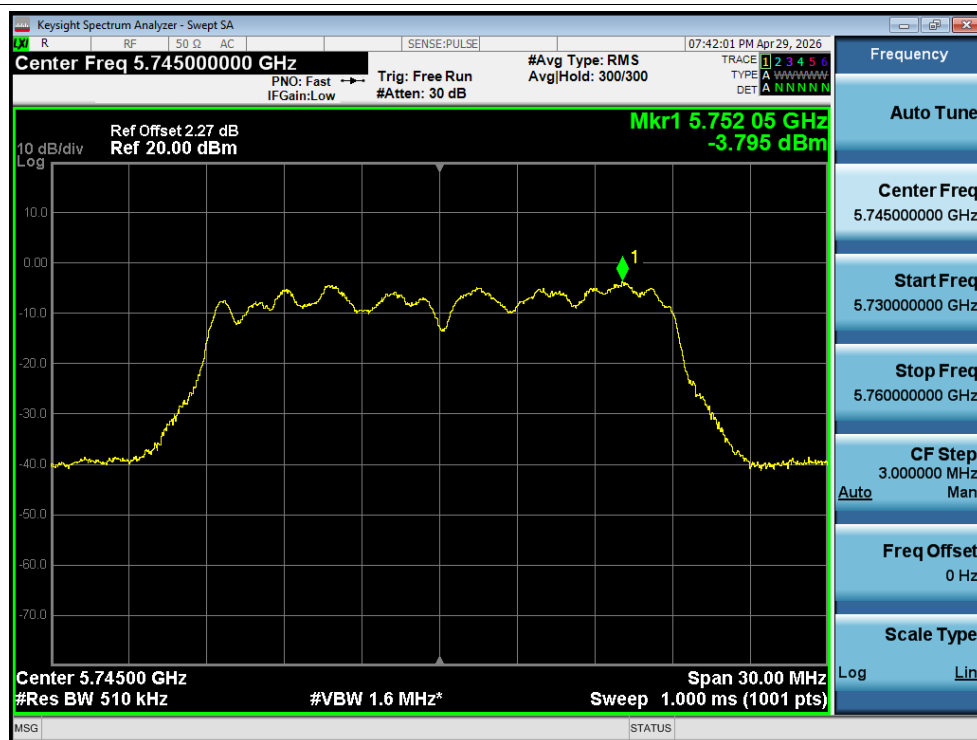

PSD NVNT ac20 5745MHz Ant1



PSD NVNT ac20 5745MHz Ant2

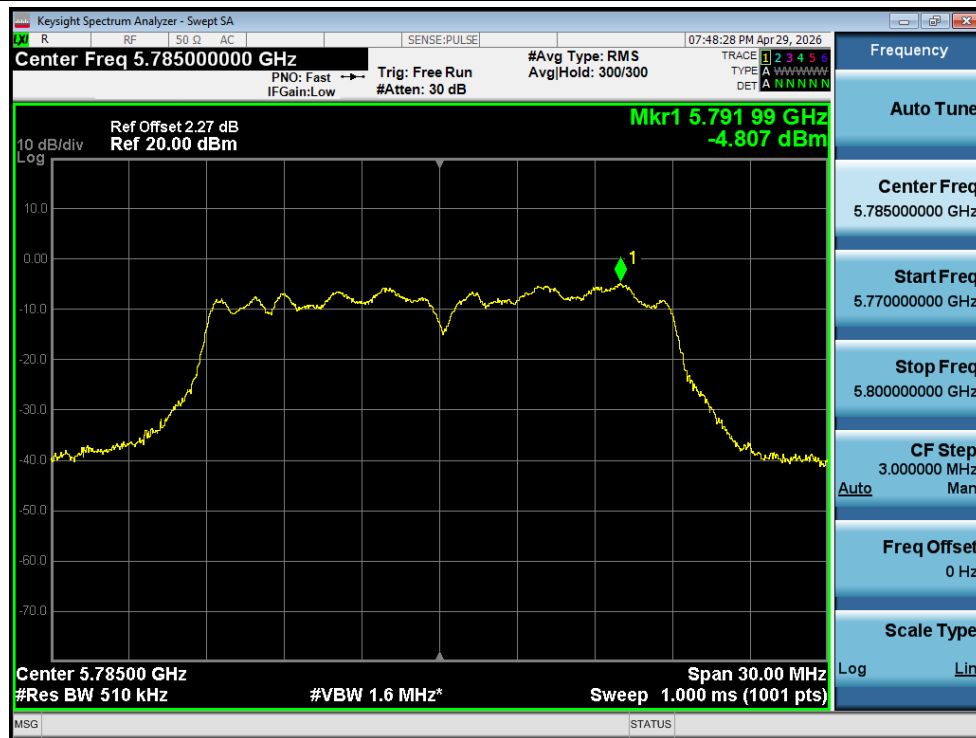


PSD NVNT ac20 5785MHz Ant1




PSD NVNT ac20 5785MHz Ant2



PSD NVNT ac20 5825MHz Ant1

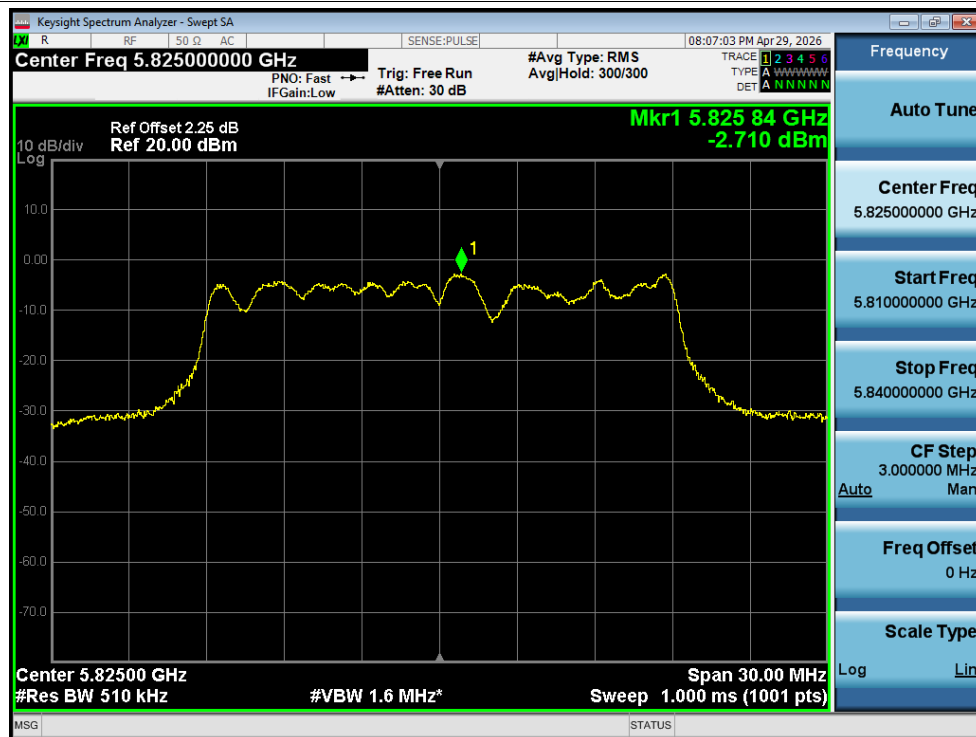

PSD NVNT ac20 5825MHz Ant2

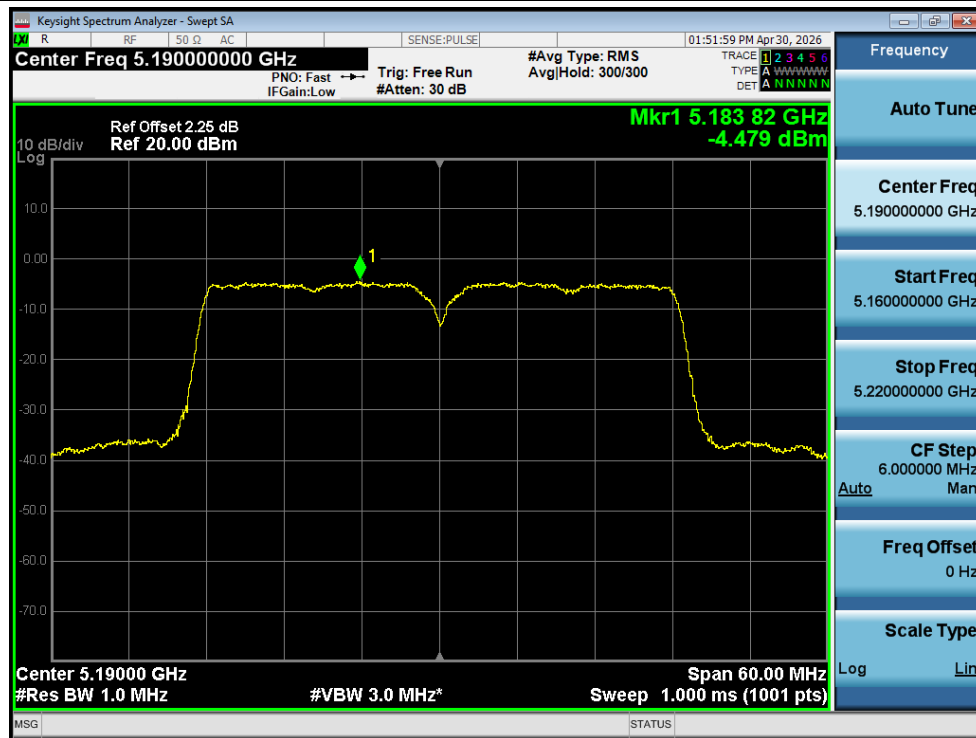


PSD NVNT ac40 5190MHz Ant1




PSD NVNT ac40 5190MHz Ant2




PSD NVNT ac40 5230MHz Ant1

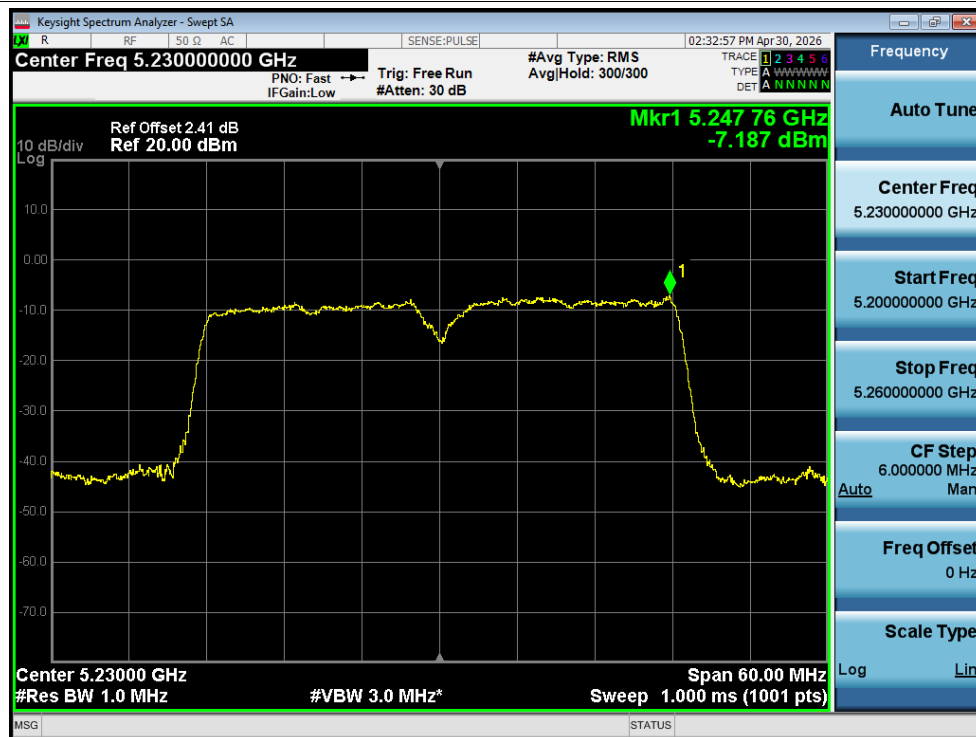

PSD NVNT ac40 5230MHz Ant2

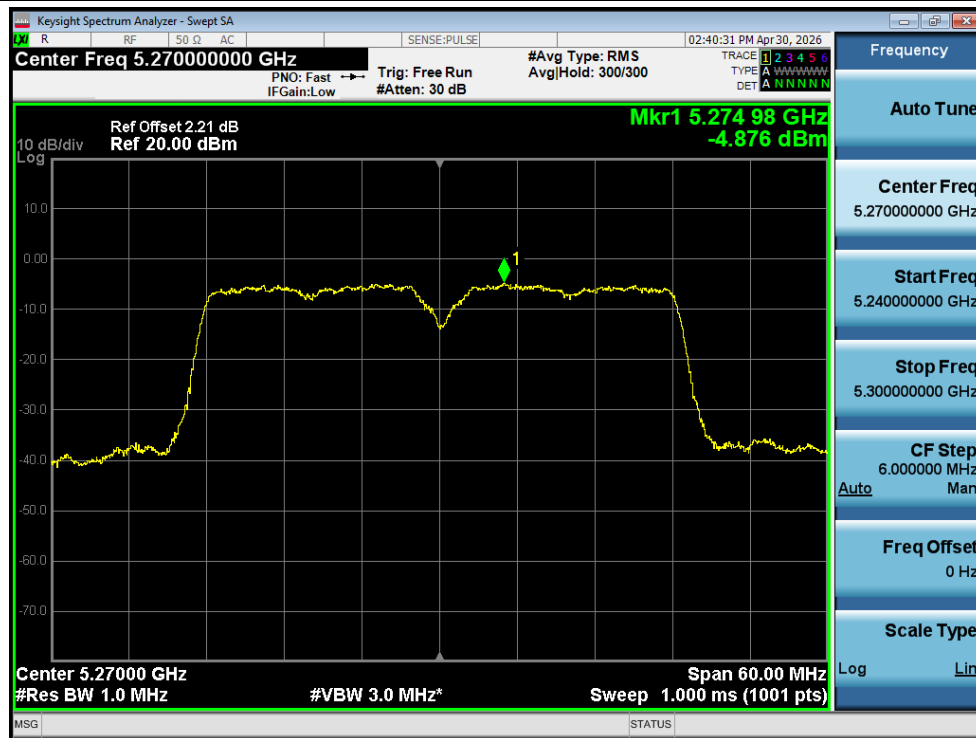


PSD NVNT ac40 5270MHz Ant1

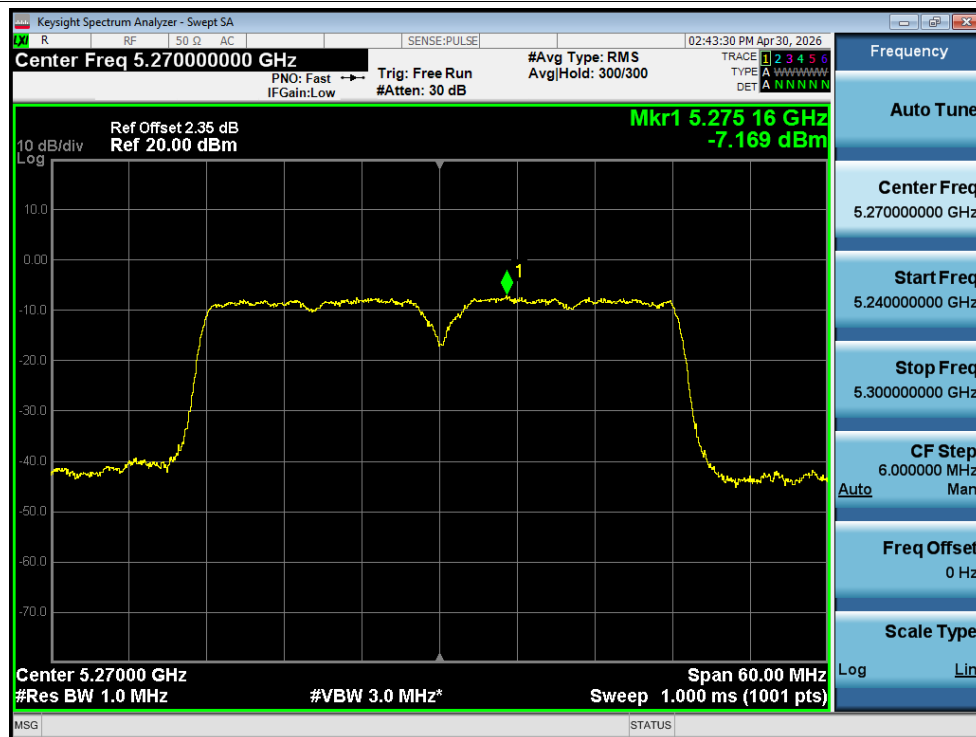


PSD NVNT ac40 5270MHz Ant2




PSD NVNT ac40 5310MHz Ant1

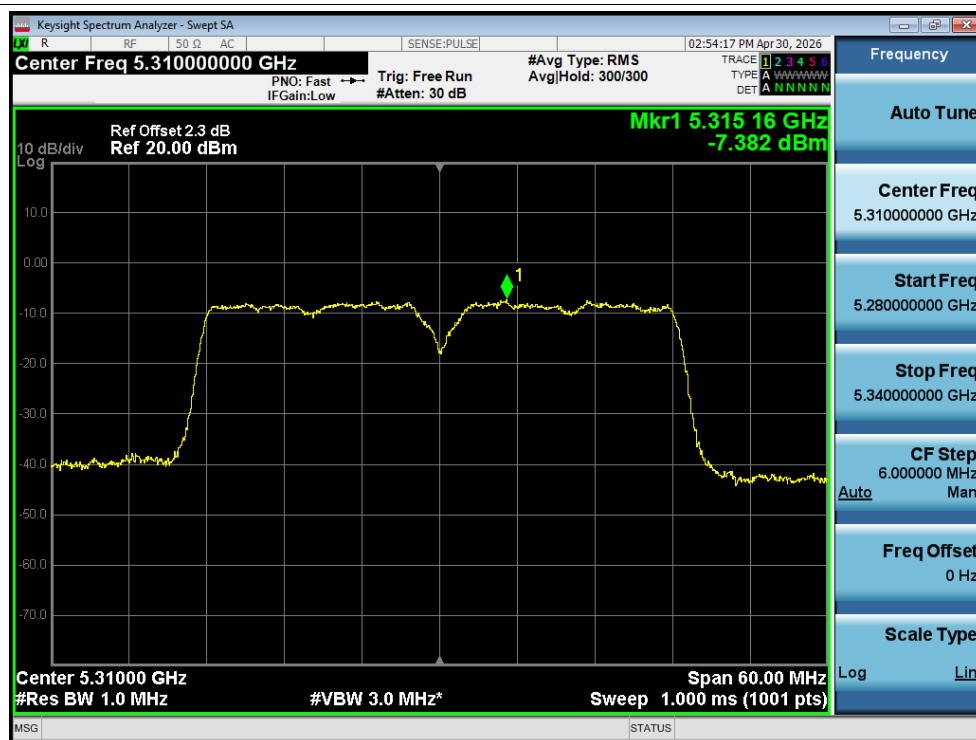

PSD NVNT ac40 5310MHz Ant2

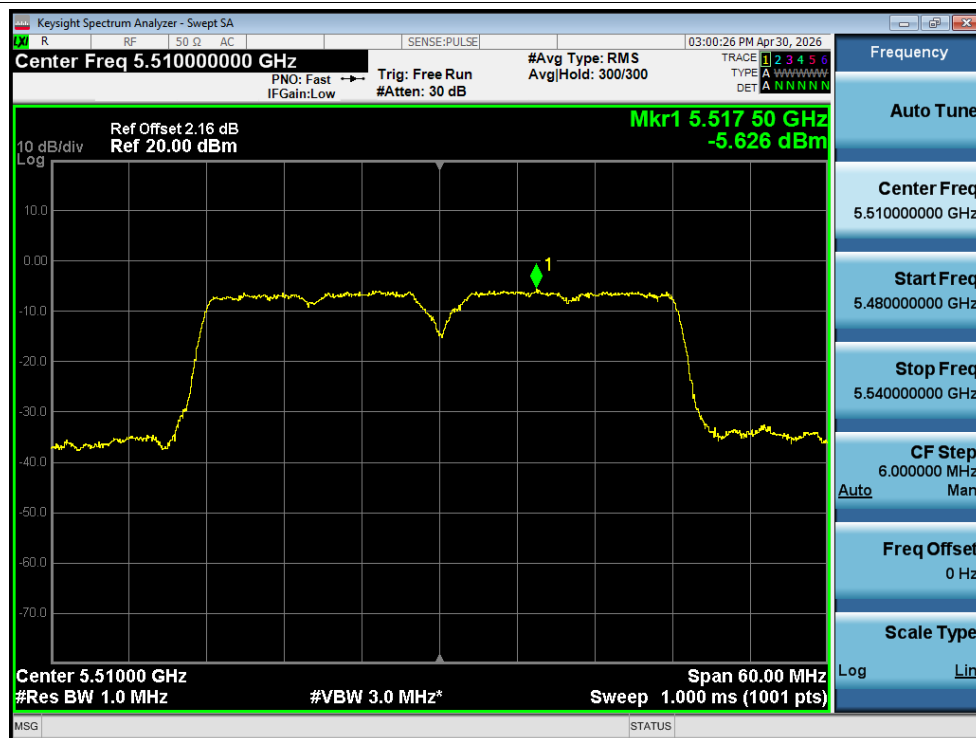


PSD NVNT ac40 5510MHz Ant1

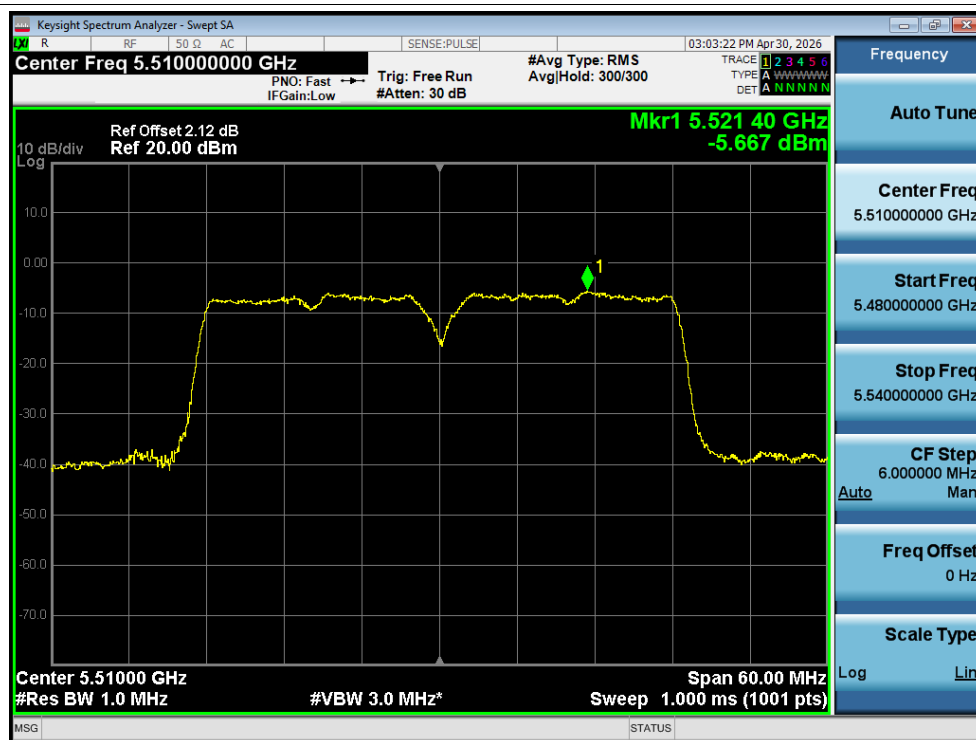

PSD NVNT ac40 5510MHz Ant2



PSD NVNT ac40 5590MHz Ant1

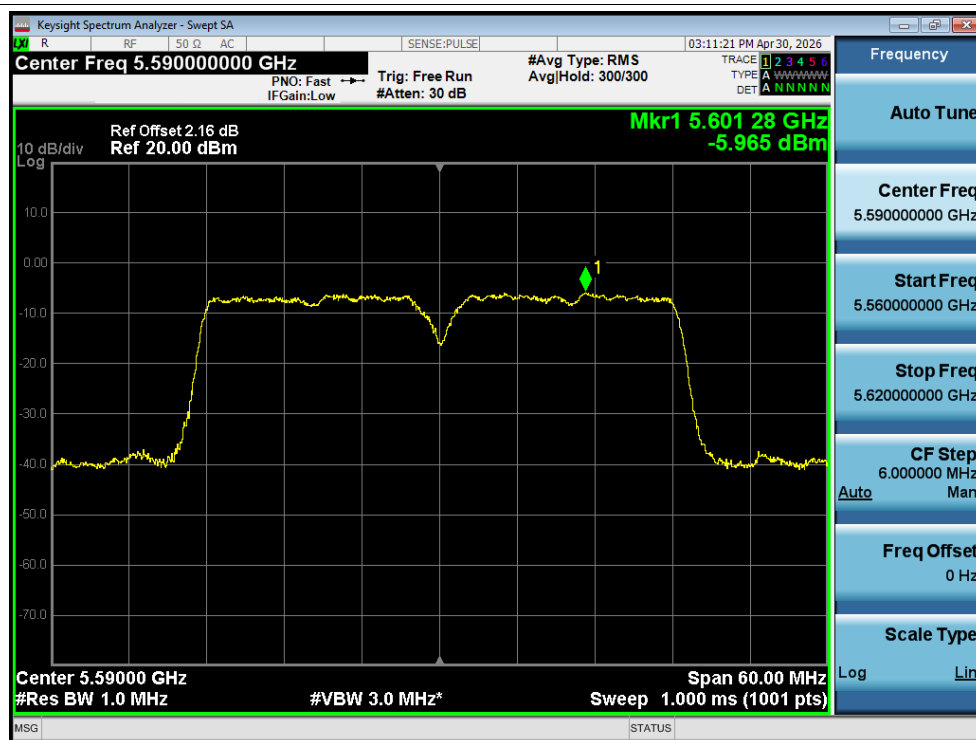


PSD NVNT ac40 5590MHz Ant2



PSD NVNT ac40 5670MHz Ant1




PSD NVNT ac40 5670MHz Ant2

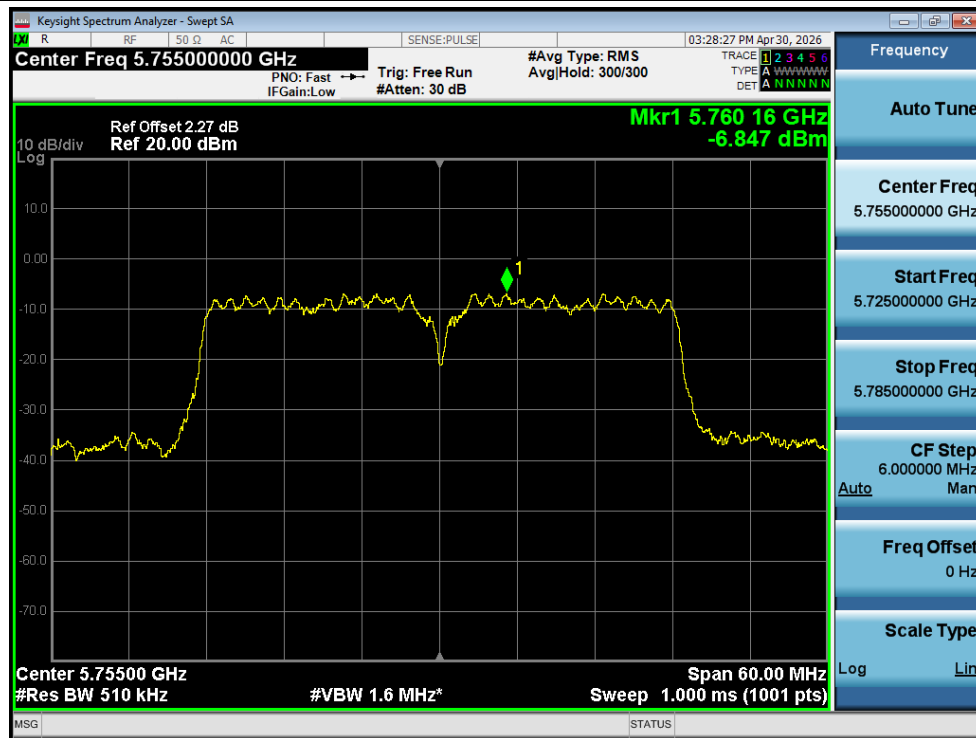


PSD NVNT ac40 5755MHz Ant1




PSD NVNT ac40 5755MHz Ant2

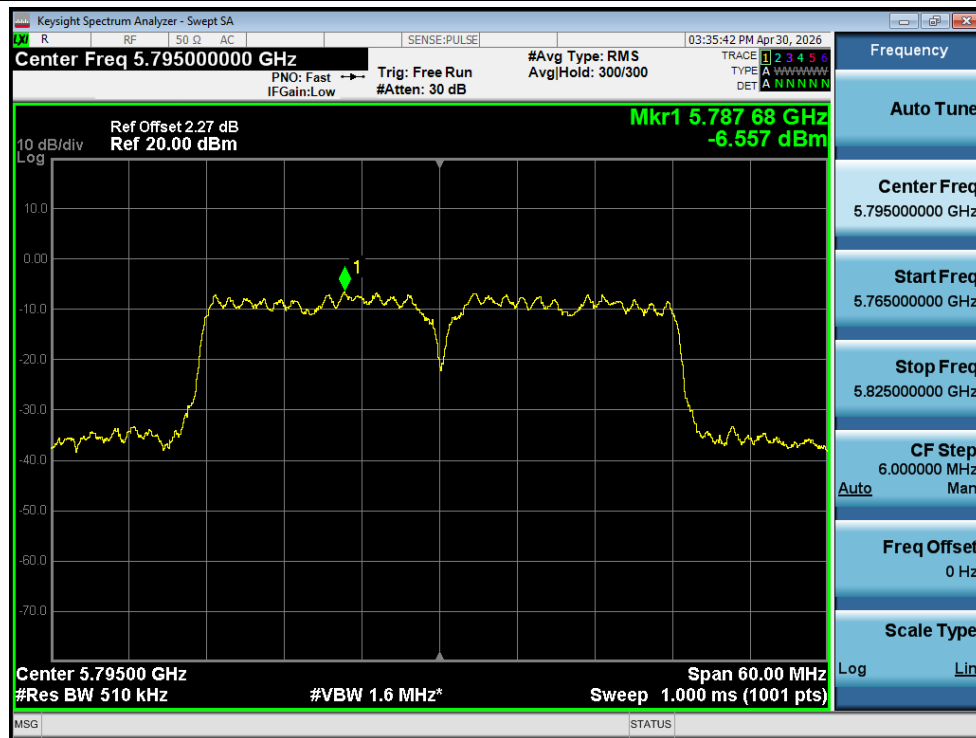

PSD NVNT ac40 5795MHz Ant1

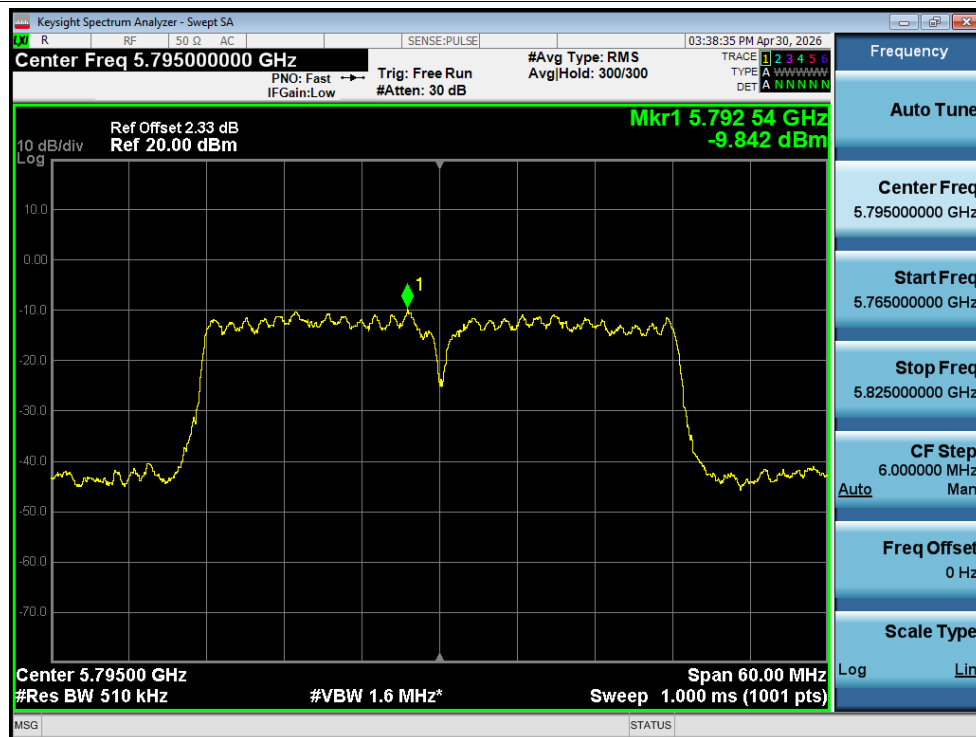


PSD NVNT ac40 5795MHz Ant2

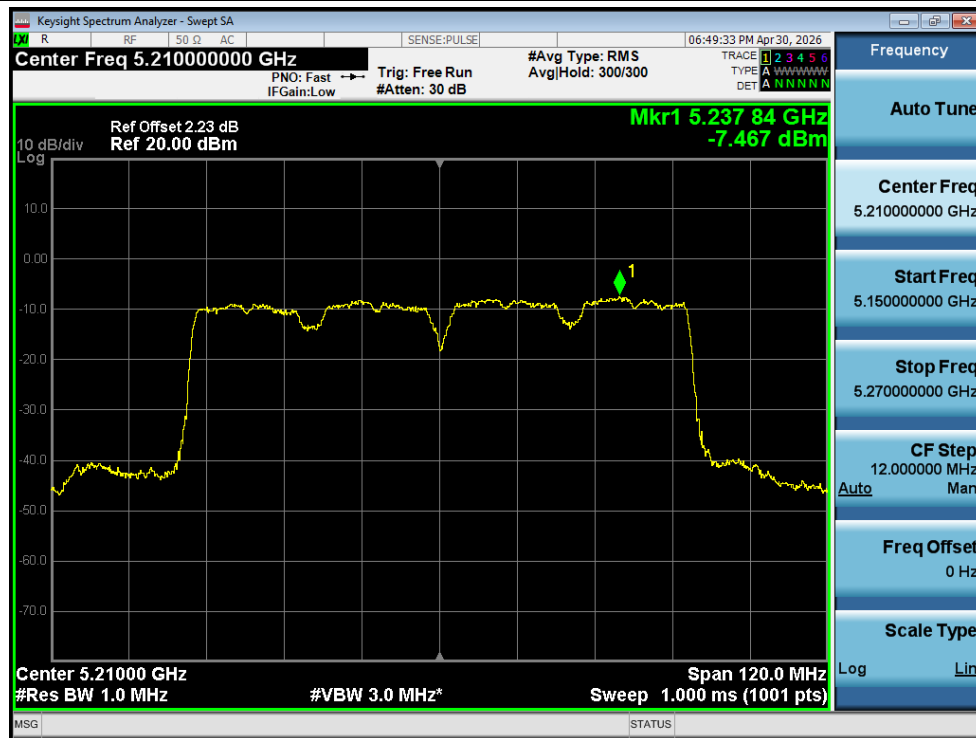

PSD NVNT ac80 5210MHz Ant1




PSD NVNT ac80 5210MHz Ant2

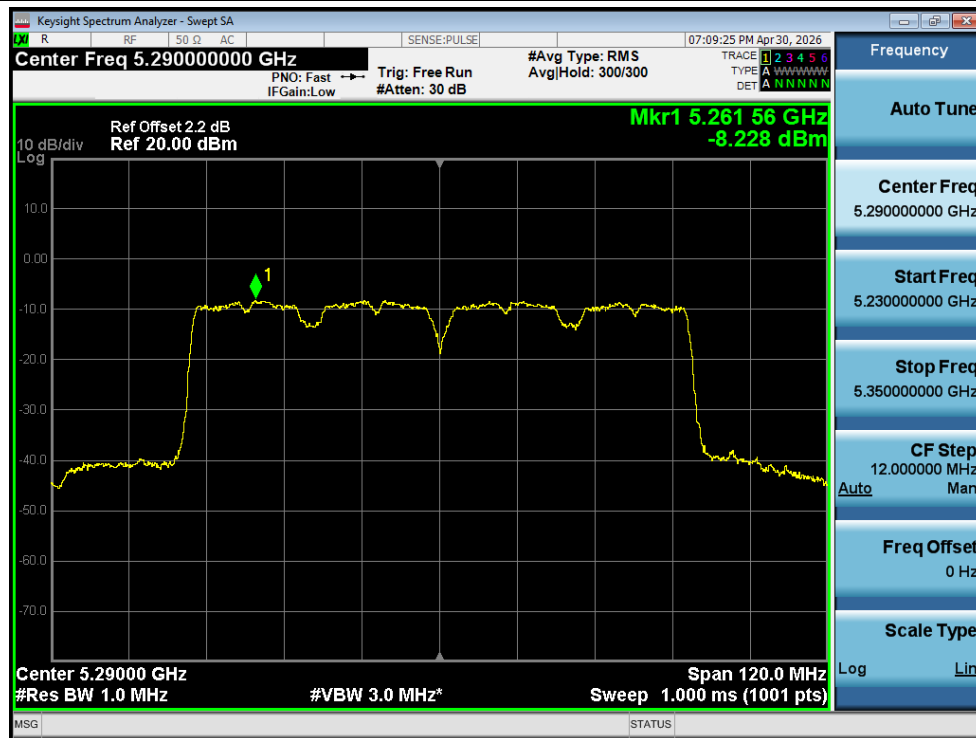

PSD NVNT ac80 5290MHz Ant1



PSD NVNT ac80 5290MHz Ant2

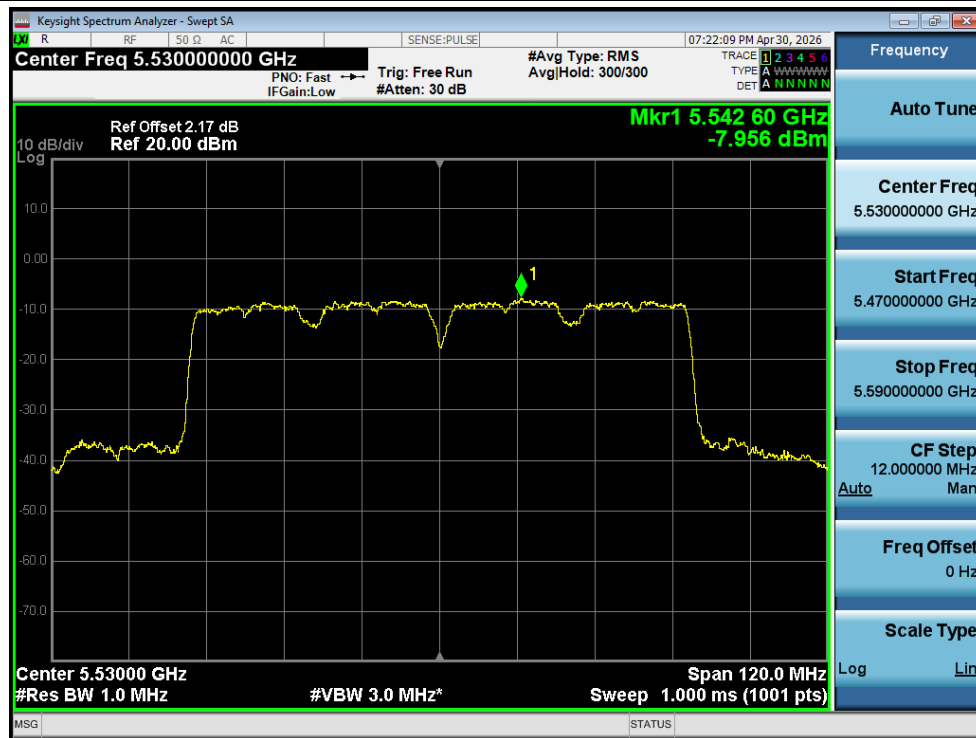

PSD NVNT ac80 5530MHz Ant1



PSD NVNT ac80 5530MHz Ant2




PSD NVNT ac80 5610MHz Ant1



PSD NVNT ac80 5610MHz Ant2



PSD NVNT ac80 5775MHz Ant1

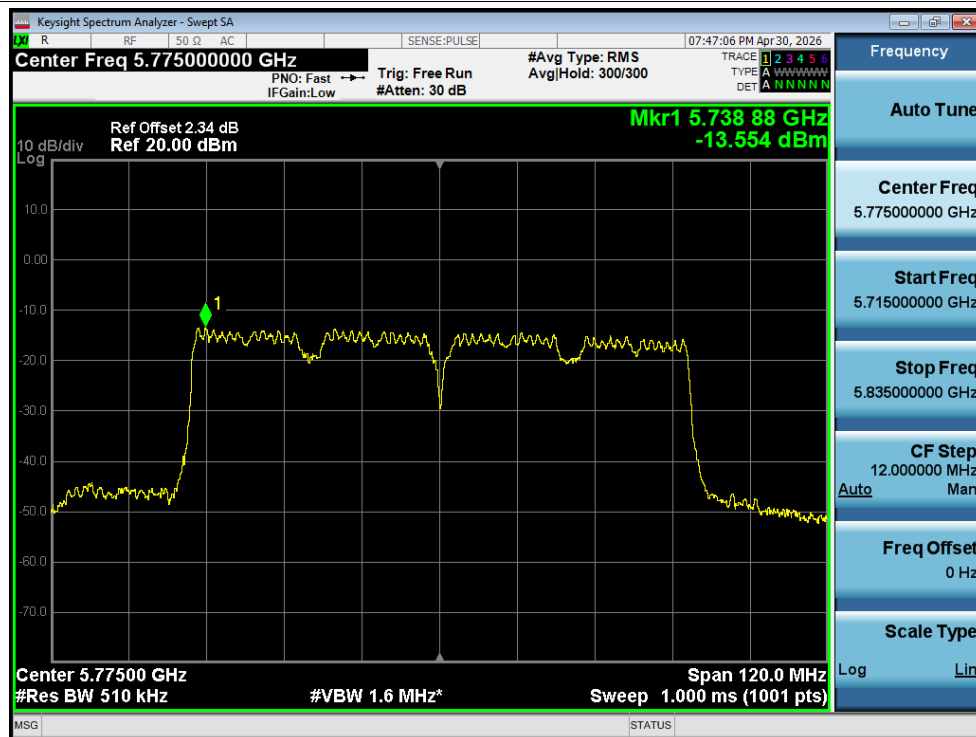


PSD NVNT ac80 5775MHz Ant2



PSD NVNT ax20 5180MHz Ant1




PSD NVNT ax20 5180MHz Ant2

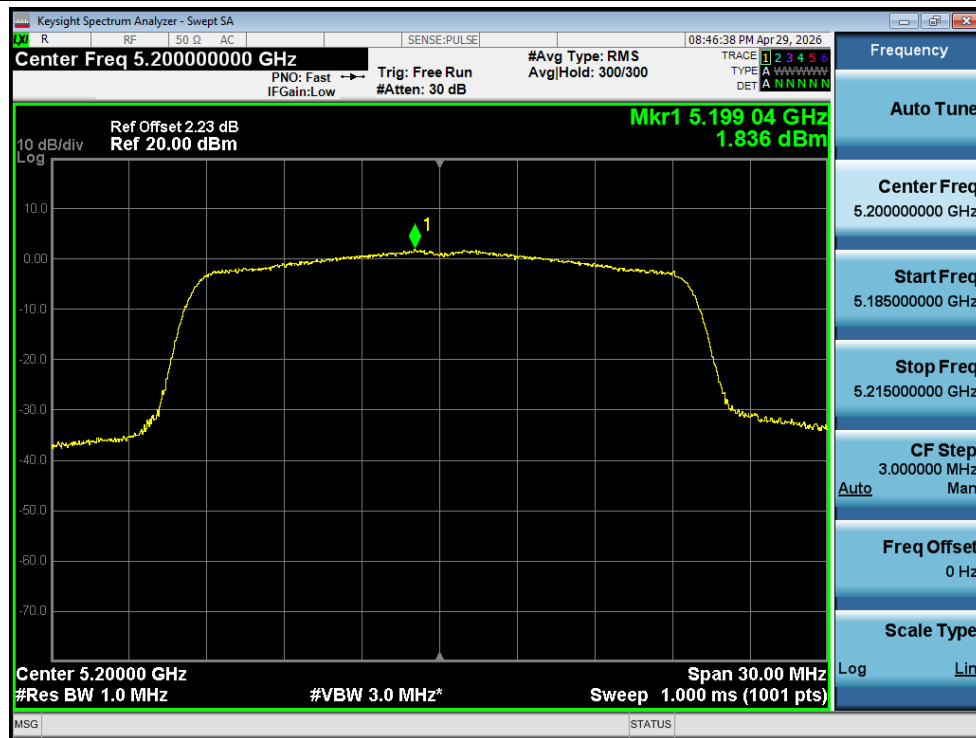

PSD NVNT ax20 5200MHz Ant1




PSD NVNT ax20 5200MHz Ant2

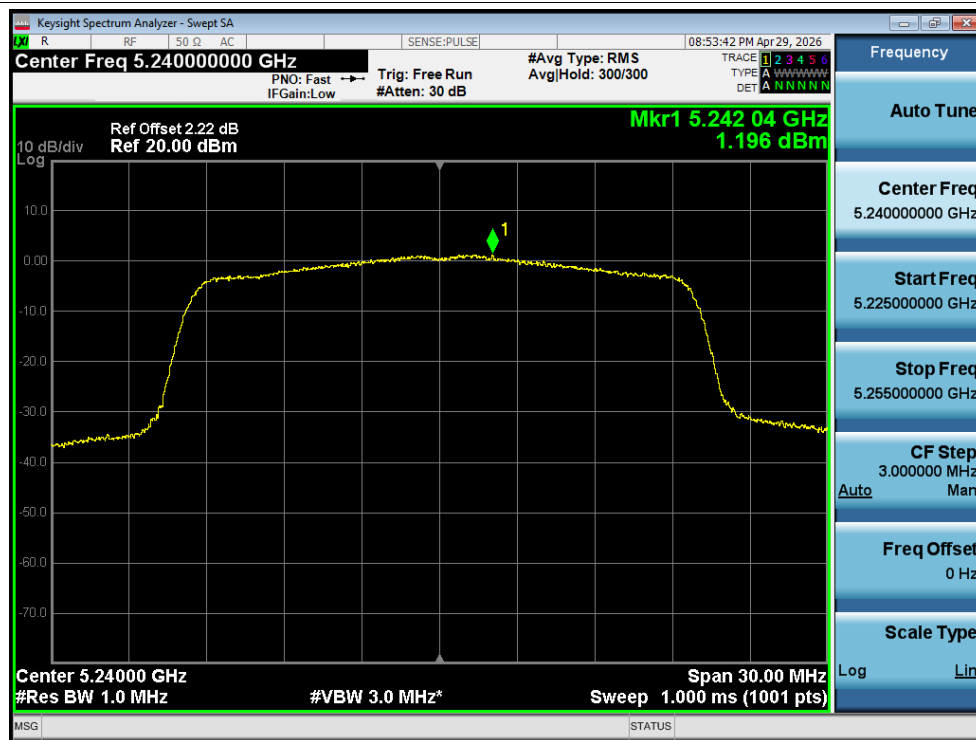

PSD NVNT ax20 5240MHz Ant1




PSD NVNT ax20 5240MHz Ant2

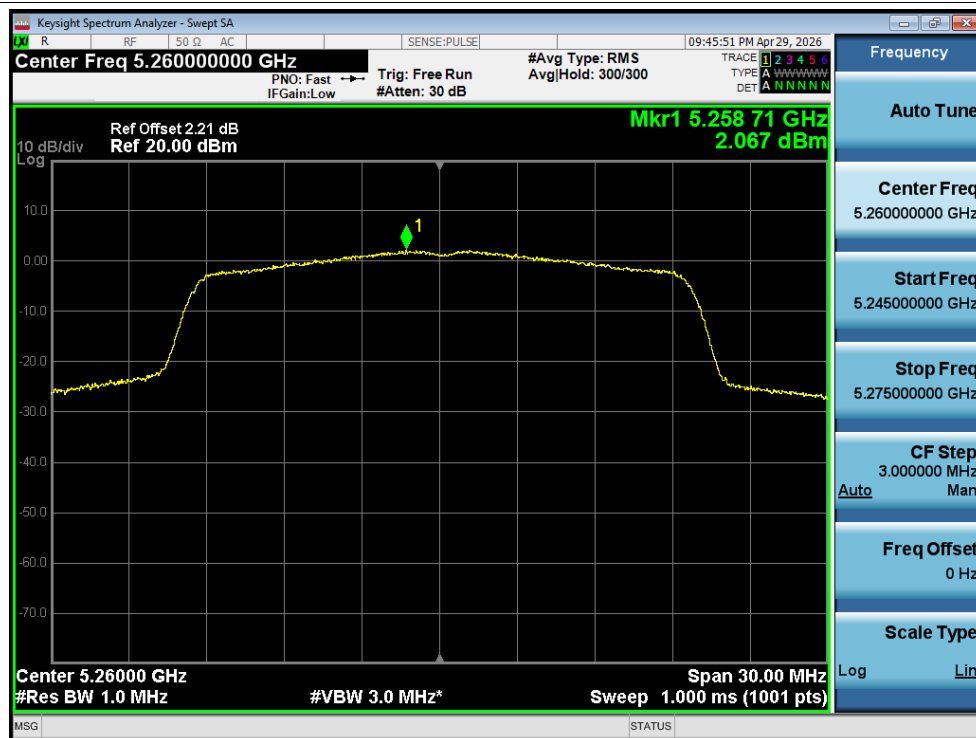

PSD NVNT ax20 5260MHz Ant1



PSD NVNT ax20 5260MHz Ant2

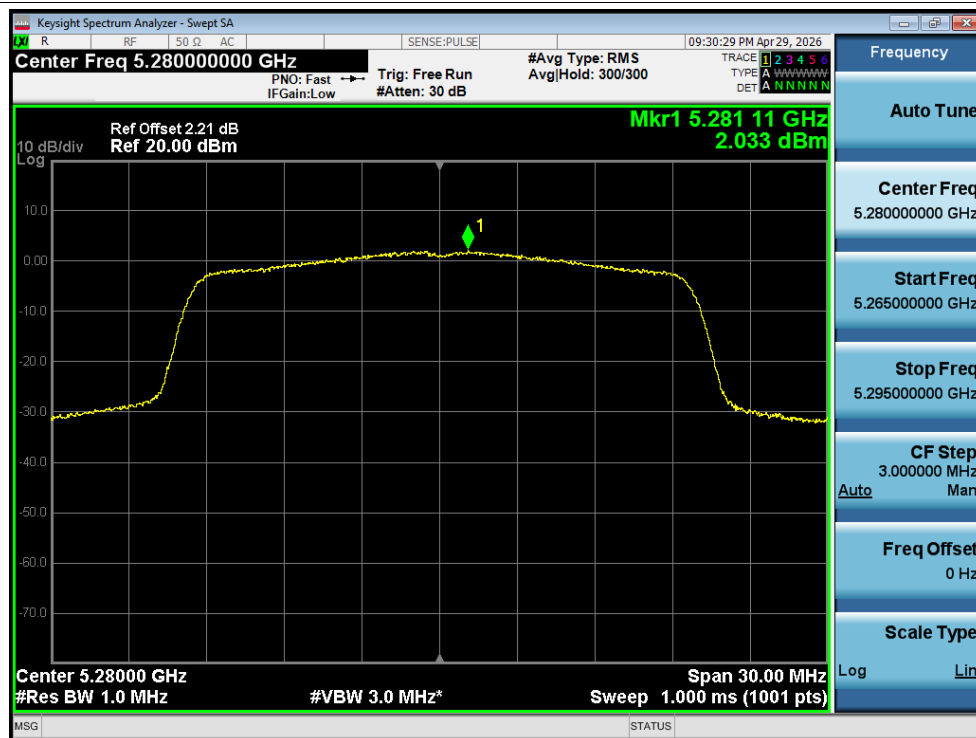

PSD NVNT ax20 5280MHz Ant1




PSD NVNT ax20 5280MHz Ant2



PSD NVNT ax20 5320MHz Ant1




PSD NVNT ax20 5320MHz Ant2

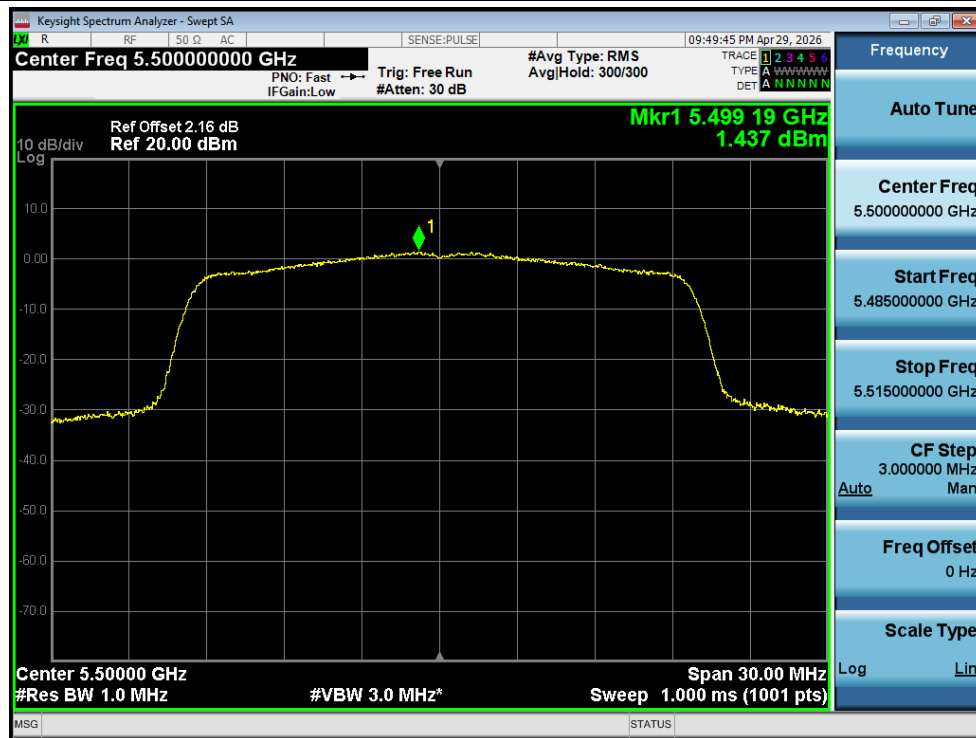

PSD NVNT ax20 5500MHz Ant1




PSD NVNT ax20 5500MHz Ant2

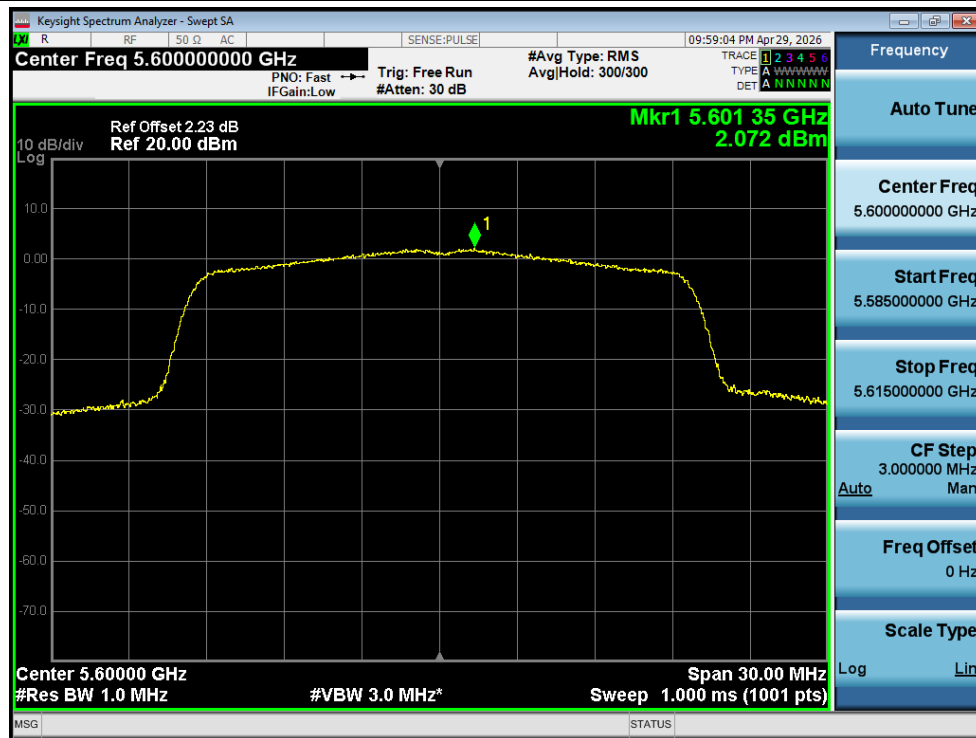

PSD NVNT ax20 5600MHz Ant1




PSD NVNT ax20 5600MHz Ant2

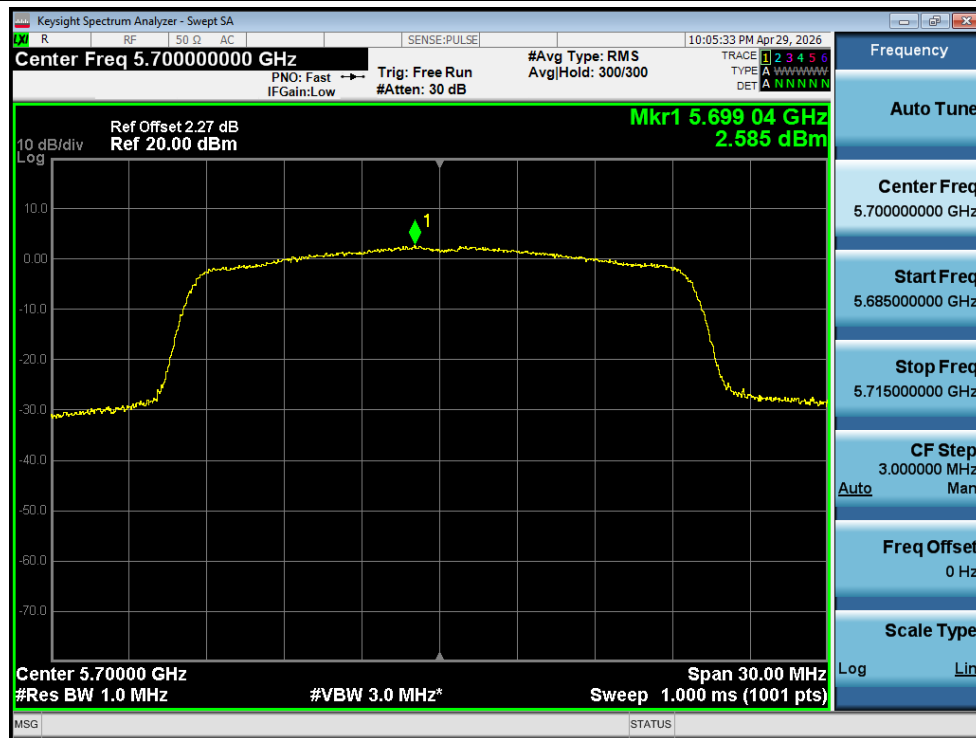

PSD NVNT ax20 5700MHz Ant1



PSD NVNT ax20 5700MHz Ant2

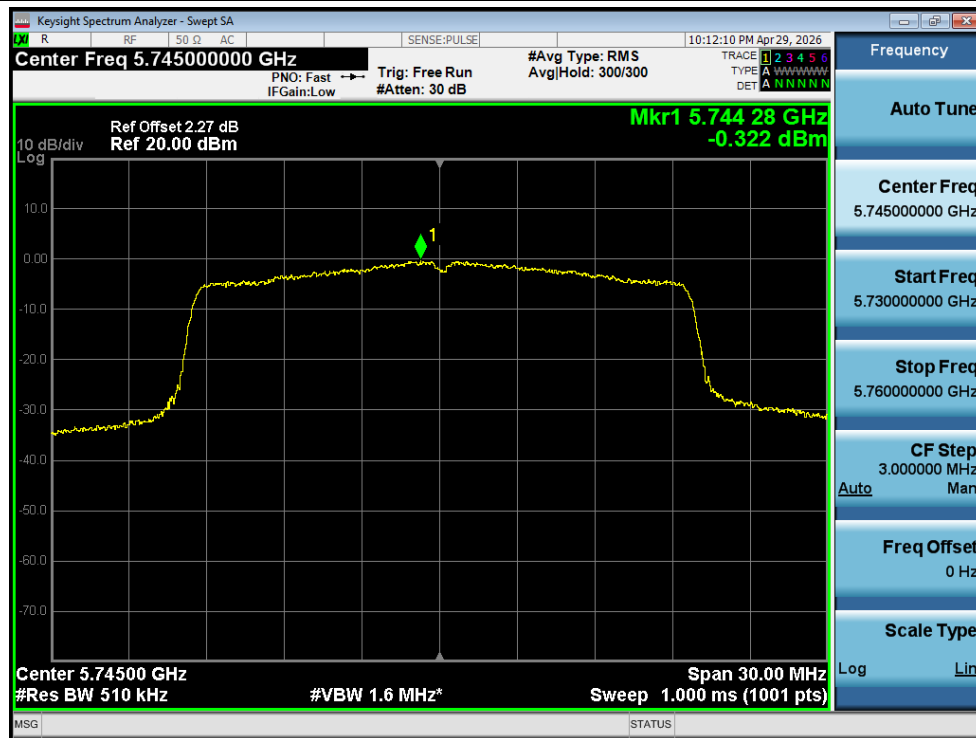


PSD NVNT ax20 5745MHz Ant1



PSD NVNT ax20 5745MHz Ant2




PSD NVNT ax20 5785MHz Ant1

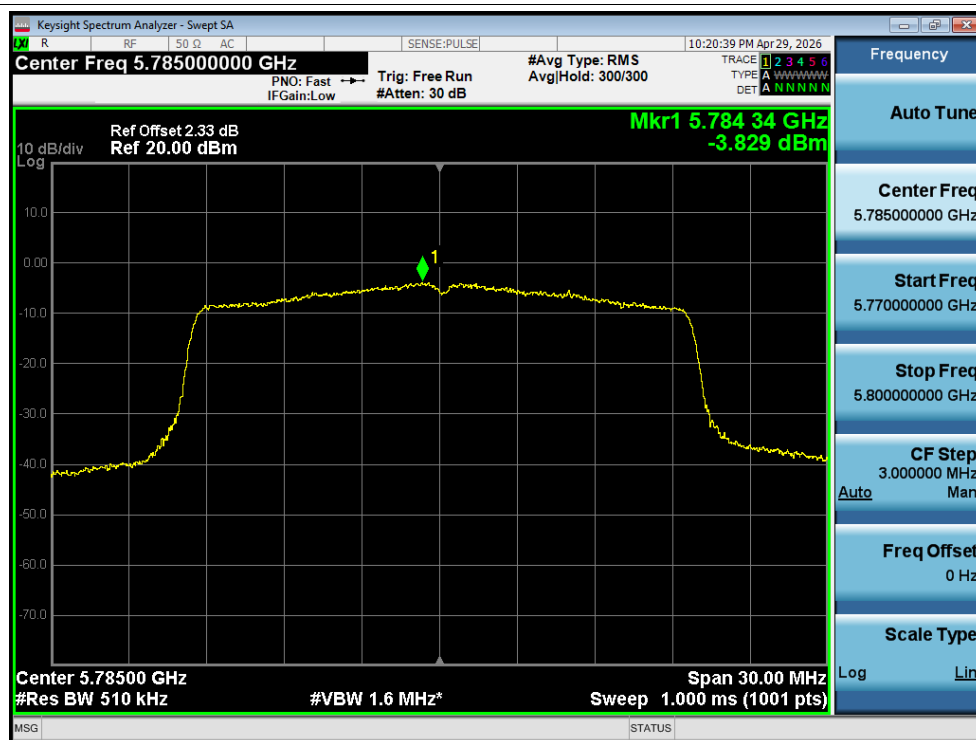

PSD NVNT ax20 5785MHz Ant2



PSD NVNT ax20 5825MHz Ant1

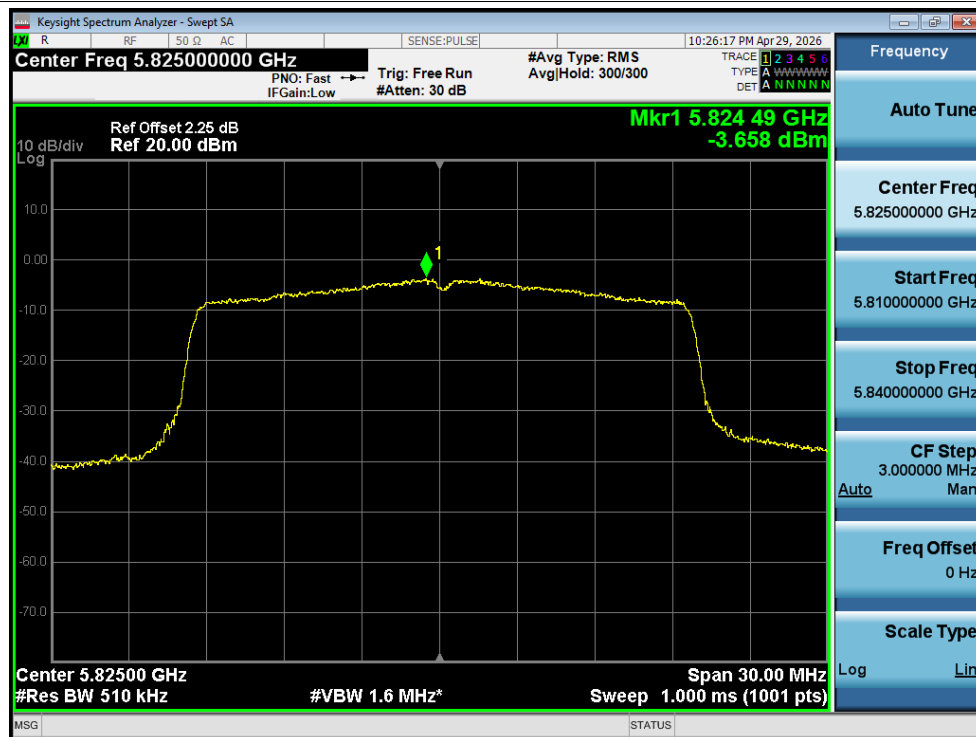

PSD NVNT ax20 5825MHz Ant2



PSD NVNT ax40 5190MHz Ant1



PSD NVNT ax40 5190MHz Ant2




PSD NVNT ax40 5230MHz Ant1



PSD NVNT ax40 5230MHz Ant2



PSD NVNT ax40 5270MHz Ant1

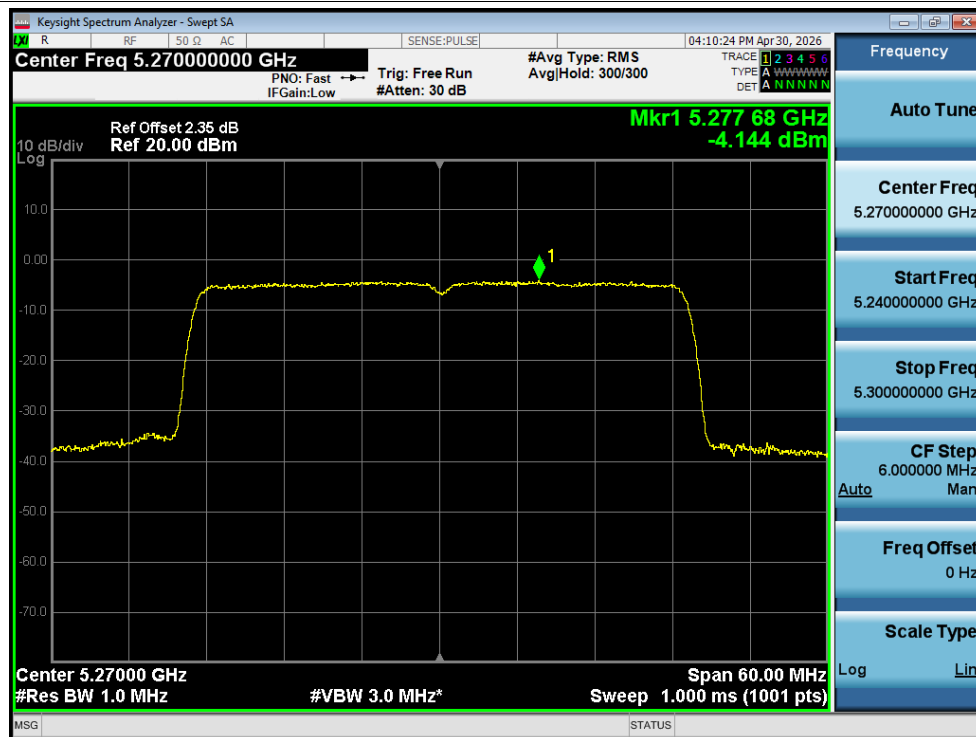

PSD NVNT ax40 5270MHz Ant2



PSD NVNT ax40 5310MHz Ant1



PSD NVNT ax40 5310MHz Ant2



PSD NVNT ax40 5510MHz Ant1



PSD NVNT ax40 5510MHz Ant2



PSD NVNT ax40 5590MHz Ant1




PSD NVNT ax40 5590MHz Ant2



PSD NVNT ax40 5670MHz Ant1



PSD NVNT ax40 5670MHz Ant2

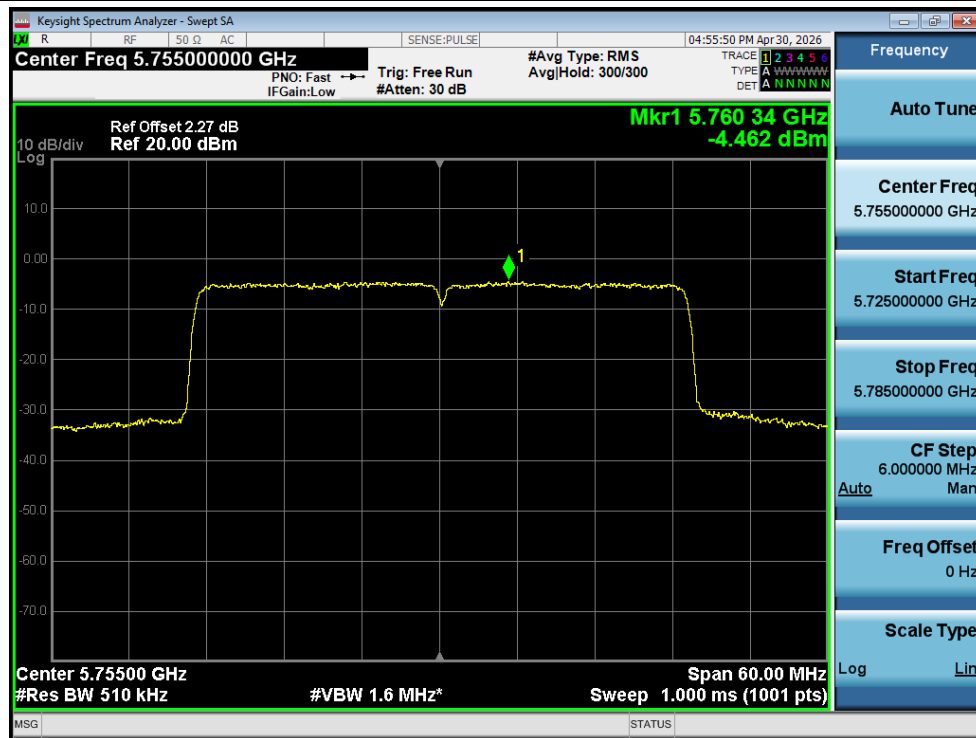


PSD NVNT ax40 5755MHz Ant1




PSD NVNT ax40 5755MHz Ant2



PSD NVNT ax40 5795MHz Ant1

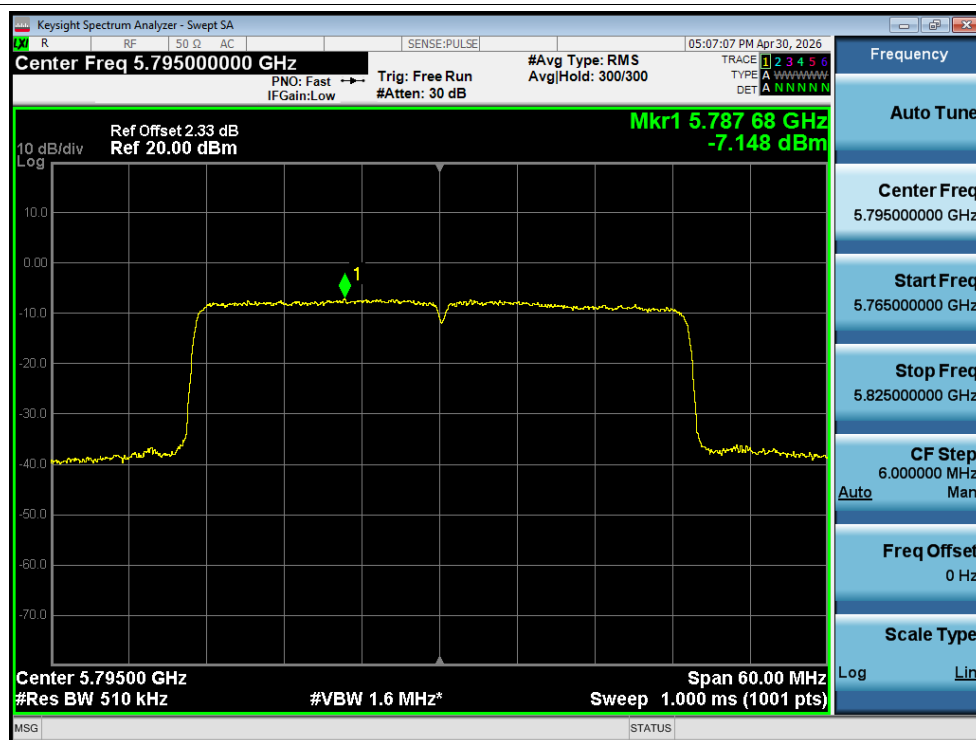

PSD NVNT ax40 5795MHz Ant2

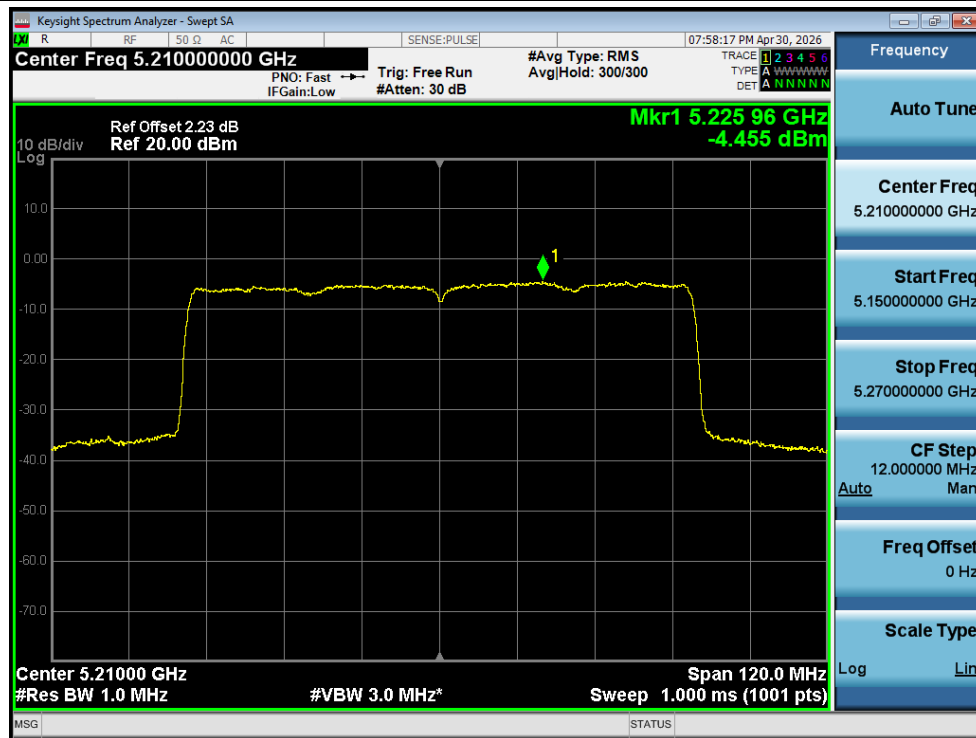

PSD NVNT ax80 5210MHz Ant1



PSD NVNT ax80 5210MHz Ant2



PSD NVNT ax80 5290MHz Ant1



PSD NVNT ax80 5290MHz Ant2



PSD NVNT ax80 5530MHz Ant1



PSD NVNT ax80 5530MHz Ant2



PSD NVNT ax80 5610MHz Ant1



PSD NVNT ax80 5610MHz Ant2



PSD NVNT ax80 5775MHz Ant1



PSD NVNT ax80 5775MHz Ant2

Frequency Stability

Condition	Mode	Frequency (MHz)	Antenna	Measured Frequency (MHz)	Frequency Error (Hz)	Deviation (ppm)	Limit (ppm)	Verdict
30C 9V	a	5180	Ant1	5180.06	60000	11.58	25	Pass
30C 20V	a	5180	Ant1	5180.06	60000	11.58	25	Pass
0C 20V	a	5180	Ant1	5180.06	60000	11.58	25	Pass
10C 20V	a	5180	Ant1	5180.08	80000	15.44	25	Pass
20C 20V	a	5180	Ant1	5180.06	60000	11.58	25	Pass
30C 9V	a	5200	Ant1	5200.06	60000	11.54	25	Pass
30C 20V	a	5200	Ant1	5200.06	60000	11.54	25	Pass
0C 20V	a	5200	Ant1	5200.06	60000	11.54	25	Pass
10C 20V	a	5200	Ant1	5200.06	60000	11.54	25	Pass
20C 20V	a	5200	Ant1	5200.06	60000	11.54	25	Pass
30C 9V	a	5240	Ant1	5240.04	40000	7.63	25	Pass
30C 20V	a	5240	Ant1	5240.06	60000	11.45	25	Pass
0C 20V	a	5240	Ant1	5240.06	60000	11.45	25	Pass
10C 20V	a	5240	Ant1	5240.06	60000	11.45	25	Pass
20C 20V	a	5240	Ant1	5240.06	60000	11.45	25	Pass
30C 9V	a	5260	Ant1	5260.06	60000	11.41	25	Pass
30C 20V	a	5260	Ant1	5260.06	60000	11.41	25	Pass
0C 20V	a	5260	Ant1	5260.04	40000	7.6	25	Pass
10C 20V	a	5260	Ant1	5260.04	40000	7.6	25	Pass
20C 20V	a	5260	Ant1	5260.06	60000	11.41	25	Pass
30C 9V	a	5280	Ant1	5280.04	40000	7.58	25	Pass
30C 20V	a	5280	Ant1	5280.06	60000	11.36	25	Pass
0C 20V	a	5280	Ant1	5280.04	40000	7.58	25	Pass
10C 20V	a	5280	Ant1	5280.06	60000	11.36	25	Pass
20C 20V	a	5280	Ant1	5280.06	60000	11.36	25	Pass
30C 9V	a	5320	Ant1	5320.04	40000	7.52	25	Pass
30C 20V	a	5320	Ant1	5320.06	60000	11.28	25	Pass
0C 20V	a	5320	Ant1	5320.04	40000	7.52	25	Pass
10C 20V	a	5320	Ant1	5320.06	60000	11.28	25	Pass
20C 20V	a	5320	Ant1	5320.06	60000	11.28	25	Pass
30C 9V	a	5500	Ant1	5500.06	60000	10.91	25	Pass
30C 20V	a	5500	Ant1	5500.06	60000	10.91	25	Pass
0C 20V	a	5500	Ant1	5500.06	60000	10.91	25	Pass
10C 20V	a	5500	Ant1	5500.06	60000	10.91	25	Pass
20C 20V	a	5500	Ant1	5500.06	60000	10.91	25	Pass
30C 9V	a	5600	Ant1	5600.04	40000	7.14	25	Pass
30C 20V	a	5600	Ant1	5600.06	60000	10.71	25	Pass
0C 20V	a	5600	Ant1	5600.04	40000	7.14	25	Pass
10C 20V	a	5600	Ant1	5600.06	60000	10.71	25	Pass
20C 20V	a	5600	Ant1	5600.06	60000	10.71	25	Pass

30C 9V	a	5700	Ant1	5700.06	60000	10.53	25	Pass
30C 20V	a	5700	Ant1	5700.08	80000	14.04	25	Pass
0C 20V	a	5700	Ant1	5700.06	60000	10.53	25	Pass
10C 20V	a	5700	Ant1	5700.06	60000	10.53	25	Pass
20C 20V	a	5700	Ant1	5700.06	60000	10.53	25	Pass
30C 9V	a	5745	Ant1	5745.04	40000	6.96	25	Pass
30C 20V	a	5745	Ant1	5745.06	60000	10.44	25	Pass
0C 20V	a	5745	Ant1	5745.06	60000	10.44	25	Pass
10C 20V	a	5745	Ant1	5745.08	80000	13.93	25	Pass
20C 20V	a	5745	Ant1	5745.06	60000	10.44	25	Pass
30C 9V	a	5785	Ant1	5785.06	60000	10.37	25	Pass
30C 20V	a	5785	Ant1	5785.04	40000	6.91	25	Pass
0C 20V	a	5785	Ant1	5785.06	60000	10.37	25	Pass
10C 20V	a	5785	Ant1	5785.06	60000	10.37	25	Pass
20C 20V	a	5785	Ant1	5785.06	60000	10.37	25	Pass
30C 9V	a	5825	Ant1	5825.06	60000	10.3	25	Pass
30C 20V	a	5825	Ant1	5825.04	40000	6.87	25	Pass
0C 20V	a	5825	Ant1	5825.06	60000	10.3	25	Pass
10C 20V	a	5825	Ant1	5825.06	60000	10.3	25	Pass
20C 20V	a	5825	Ant1	5825.06	60000	10.3	25	Pass
30C 9V	a	5180	Ant2	5180.06	60000	11.58	25	Pass
30C 20V	a	5180	Ant2	5180.06	60000	11.58	25	Pass
0C 20V	a	5180	Ant2	5180.04	40000	7.72	25	Pass
10C 20V	a	5180	Ant2	5180.04	40000	7.72	25	Pass
20C 20V	a	5180	Ant2	5180.06	60000	11.58	25	Pass
30C 9V	a	5200	Ant2	5200.04	40000	7.69	25	Pass
30C 20V	a	5200	Ant2	5200.06	60000	11.54	25	Pass
0C 20V	a	5200	Ant2	5200.06	60000	11.54	25	Pass
10C 20V	a	5200	Ant2	5200.06	60000	11.54	25	Pass
20C 20V	a	5200	Ant2	5200.06	60000	11.54	25	Pass
30C 9V	a	5240	Ant2	5240.06	60000	11.45	25	Pass
30C 20V	a	5240	Ant2	5240.04	40000	7.63	25	Pass
0C 20V	a	5240	Ant2	5240.06	60000	11.45	25	Pass
10C 20V	a	5240	Ant2	5240.06	60000	11.45	25	Pass
20C 20V	a	5240	Ant2	5240.06	60000	11.45	25	Pass
30C 9V	a	5260	Ant2	5260.06	60000	11.41	25	Pass
30C 20V	a	5260	Ant2	5260.06	60000	11.41	25	Pass
0C 20V	a	5260	Ant2	5260.06	60000	11.41	25	Pass
10C 20V	a	5260	Ant2	5260.06	60000	11.41	25	Pass
20C 20V	a	5260	Ant2	5260.06	60000	11.41	25	Pass
30C 9V	a	5280	Ant2	5280.06	60000	11.36	25	Pass
30C 20V	a	5280	Ant2	5280.04	40000	7.58	25	Pass
0C 20V	a	5280	Ant2	5280.06	60000	11.36	25	Pass
10C 20V	a	5280	Ant2	5280.04	40000	7.58	25	Pass

20C 20V	a	5280	Ant2	5280.04	40000	7.58	25	Pass
30C 9V	a	5320	Ant2	5320.06	60000	11.28	25	Pass
30C 20V	a	5320	Ant2	5320.06	60000	11.28	25	Pass
0C 20V	a	5320	Ant2	5320.02	20000	3.76	25	Pass
10C 20V	a	5320	Ant2	5320.04	40000	7.52	25	Pass
20C 20V	a	5320	Ant2	5320.06	60000	11.28	25	Pass
30C 9V	a	5500	Ant2	5500.04	40000	7.27	25	Pass
30C 20V	a	5500	Ant2	5500.08	80000	14.55	25	Pass
0C 20V	a	5500	Ant2	5500.08	80000	14.55	25	Pass
10C 20V	a	5500	Ant2	5500.06	60000	10.91	25	Pass
20C 20V	a	5500	Ant2	5500.06	60000	10.91	25	Pass
30C 9V	a	5600	Ant2	5600.06	60000	10.71	25	Pass
30C 20V	a	5600	Ant2	5600.04	40000	7.14	25	Pass
0C 20V	a	5600	Ant2	5600.04	40000	7.14	25	Pass
10C 20V	a	5600	Ant2	5600.08	80000	14.29	25	Pass
20C 20V	a	5600	Ant2	5600.08	80000	14.29	25	Pass
30C 9V	a	5700	Ant2	5700.06	60000	10.53	25	Pass
30C 20V	a	5700	Ant2	5700.06	60000	10.53	25	Pass
0C 20V	a	5700	Ant2	5700.06	60000	10.53	25	Pass
10C 20V	a	5700	Ant2	5700.04	40000	7.02	25	Pass
20C 20V	a	5700	Ant2	5700.06	60000	10.53	25	Pass
30C 9V	a	5745	Ant2	5745.06	60000	10.44	25	Pass
30C 20V	a	5745	Ant2	5745.08	80000	13.93	25	Pass
0C 20V	a	5745	Ant2	5745.06	60000	10.44	25	Pass
10C 20V	a	5745	Ant2	5745.06	60000	10.44	25	Pass
20C 20V	a	5745	Ant2	5745.06	60000	10.44	25	Pass
30C 9V	a	5785	Ant2	5785.04	40000	6.91	25	Pass
30C 20V	a	5785	Ant2	5785.06	60000	10.37	25	Pass
0C 20V	a	5785	Ant2	5785.06	60000	10.37	25	Pass
10C 20V	a	5785	Ant2	5785.06	60000	10.37	25	Pass
20C 20V	a	5785	Ant2	5785.04	40000	6.91	25	Pass
30C 9V	a	5825	Ant2	5825.06	60000	10.3	25	Pass
30C 20V	a	5825	Ant2	5825.06	60000	10.3	25	Pass
0C 20V	a	5825	Ant2	5825.06	60000	10.3	25	Pass
10C 20V	a	5825	Ant2	5825.06	60000	10.3	25	Pass
20C 20V	a	5825	Ant2	5825.06	60000	10.3	25	Pass
30C 9V	n20	5180	Ant1	5180.02	20000	3.86	25	Pass
30C 20V	n20	5180	Ant1	5180.06	60000	11.58	25	Pass
0C 20V	n20	5180	Ant1	5180.04	40000	7.72	25	Pass
10C 20V	n20	5180	Ant1	5180.06	60000	11.58	25	Pass
20C 20V	n20	5180	Ant1	5180.08	80000	15.44	25	Pass
30C 9V	n20	5200	Ant1	5200.06	60000	11.54	25	Pass
30C 20V	n20	5200	Ant1	5200.06	60000	11.54	25	Pass
0C 20V	n20	5200	Ant1	5200.08	80000	15.38	25	Pass

10C 20V	n20	5200	Ant1	5200.04	40000	7.69	25	Pass
20C 20V	n20	5200	Ant1	5200.06	60000	11.54	25	Pass
30C 9V	n20	5240	Ant1	5240.06	60000	11.45	25	Pass
30C 20V	n20	5240	Ant1	5240.04	40000	7.63	25	Pass
0C 20V	n20	5240	Ant1	5240.06	60000	11.45	25	Pass
10C 20V	n20	5240	Ant1	5240.08	80000	15.27	25	Pass
20C 20V	n20	5240	Ant1	5240.08	80000	15.27	25	Pass
30C 9V	n20	5260	Ant1	5260.04	40000	7.6	25	Pass
30C 20V	n20	5260	Ant1	5260.04	40000	7.6	25	Pass
0C 20V	n20	5260	Ant1	5260.04	40000	7.6	25	Pass
10C 20V	n20	5260	Ant1	5260.06	60000	11.41	25	Pass
20C 20V	n20	5260	Ant1	5260.08	80000	15.21	25	Pass
30C 9V	n20	5280	Ant1	5280.04	40000	7.58	25	Pass
30C 20V	n20	5280	Ant1	5280.06	60000	11.36	25	Pass
0C 20V	n20	5280	Ant1	5280.04	40000	7.58	25	Pass
10C 20V	n20	5280	Ant1	5280.04	40000	7.58	25	Pass
20C 20V	n20	5280	Ant1	5280.06	60000	11.36	25	Pass
30C 9V	n20	5320	Ant1	5320.06	60000	11.28	25	Pass
30C 20V	n20	5320	Ant1	5320.04	40000	7.52	25	Pass
0C 20V	n20	5320	Ant1	5320.06	60000	11.28	25	Pass
10C 20V	n20	5320	Ant1	5320.08	80000	15.04	25	Pass
20C 20V	n20	5320	Ant1	5320.06	60000	11.28	25	Pass
30C 9V	n20	5500	Ant1	5500.08	80000	14.55	25	Pass
30C 20V	n20	5500	Ant1	5500.1	100000	18.18	25	Pass
0C 20V	n20	5500	Ant1	5500.1	100000	18.18	25	Pass
10C 20V	n20	5500	Ant1	5500.1	100000	18.18	25	Pass
20C 20V	n20	5500	Ant1	5500.1	100000	18.18	25	Pass
30C 9V	n20	5600	Ant1	5600.06	60000	10.71	25	Pass
30C 20V	n20	5600	Ant1	5600.04	40000	7.14	25	Pass
0C 20V	n20	5600	Ant1	5600.06	60000	10.71	25	Pass
10C 20V	n20	5600	Ant1	5600.04	40000	7.14	25	Pass
20C 20V	n20	5600	Ant1	5600.06	60000	10.71	25	Pass
30C 9V	n20	5700	Ant1	5700.06	60000	10.53	25	Pass
30C 20V	n20	5700	Ant1	5700.08	80000	14.04	25	Pass
0C 20V	n20	5700	Ant1	5700.04	40000	7.02	25	Pass
10C 20V	n20	5700	Ant1	5700.06	60000	10.53	25	Pass
20C 20V	n20	5700	Ant1	5700.04	40000	7.02	25	Pass
30C 9V	n20	5745	Ant1	5745.08	80000	13.93	25	Pass
30C 20V	n20	5745	Ant1	5745.08	80000	13.93	25	Pass
0C 20V	n20	5745	Ant1	5745.04	40000	6.96	25	Pass
10C 20V	n20	5745	Ant1	5745.08	80000	13.93	25	Pass
20C 20V	n20	5745	Ant1	5745.04	40000	6.96	25	Pass
30C 9V	n20	5785	Ant1	5785.06	60000	10.37	25	Pass
30C 20V	n20	5785	Ant1	5785.06	60000	10.37	25	Pass

0C 20V	n20	5785	Ant1	5785.06	60000	10.37	25	Pass
10C 20V	n20	5785	Ant1	5785.08	80000	13.83	25	Pass
20C 20V	n20	5785	Ant1	5785.1	100000	17.29	25	Pass
30C 9V	n20	5825	Ant1	5825.04	40000	6.87	25	Pass
30C 20V	n20	5825	Ant1	5825.06	60000	10.3	25	Pass
0C 20V	n20	5825	Ant1	5825.06	60000	10.3	25	Pass
10C 20V	n20	5825	Ant1	5825.08	80000	13.73	25	Pass
20C 20V	n20	5825	Ant1	5825.04	40000	6.87	25	Pass
30C 9V	n20	5180	Ant2	5180.04	40000	7.72	25	Pass
30C 20V	n20	5180	Ant2	5180.06	60000	11.58	25	Pass
0C 20V	n20	5180	Ant2	5180.04	40000	7.72	25	Pass
10C 20V	n20	5180	Ant2	5180.04	40000	7.72	25	Pass
20C 20V	n20	5180	Ant2	5180.06	60000	11.58	25	Pass
30C 9V	n20	5200	Ant2	5200.04	40000	7.69	25	Pass
30C 20V	n20	5200	Ant2	5200.06	60000	11.54	25	Pass
0C 20V	n20	5200	Ant2	5200.06	60000	11.54	25	Pass
10C 20V	n20	5200	Ant2	5200.06	60000	11.54	25	Pass
20C 20V	n20	5200	Ant2	5200.06	60000	11.54	25	Pass
30C 9V	n20	5240	Ant2	5240.06	60000	11.45	25	Pass
30C 20V	n20	5240	Ant2	5240.04	40000	7.63	25	Pass
0C 20V	n20	5240	Ant2	5240.04	40000	7.63	25	Pass
10C 20V	n20	5240	Ant2	5240.02	20000	3.82	25	Pass
20C 20V	n20	5240	Ant2	5240.02	20000	3.82	25	Pass
30C 9V	n20	5260	Ant2	5260.06	60000	11.41	25	Pass
30C 20V	n20	5260	Ant2	5260.06	60000	11.41	25	Pass
0C 20V	n20	5260	Ant2	5260.08	80000	15.21	25	Pass
10C 20V	n20	5260	Ant2	5260.06	60000	11.41	25	Pass
20C 20V	n20	5260	Ant2	5260.04	40000	7.6	25	Pass
30C 9V	n20	5280	Ant2	5280.08	80000	15.15	25	Pass
30C 20V	n20	5280	Ant2	5280.06	60000	11.36	25	Pass
0C 20V	n20	5280	Ant2	5280.08	80000	15.15	25	Pass
10C 20V	n20	5280	Ant2	5280.08	80000	15.15	25	Pass
20C 20V	n20	5280	Ant2	5280.06	60000	11.36	25	Pass
30C 9V	n20	5320	Ant2	5320.06	60000	11.28	25	Pass
30C 20V	n20	5320	Ant2	5320.04	40000	7.52	25	Pass
0C 20V	n20	5320	Ant2	5320.06	60000	11.28	25	Pass
10C 20V	n20	5320	Ant2	5320.06	60000	11.28	25	Pass
20C 20V	n20	5320	Ant2	5320.08	80000	15.04	25	Pass
30C 9V	n20	5500	Ant2	5500.04	40000	7.27	25	Pass
30C 20V	n20	5500	Ant2	5500.06	60000	10.91	25	Pass
0C 20V	n20	5500	Ant2	5500.04	40000	7.27	25	Pass
10C 20V	n20	5500	Ant2	5500.06	60000	10.91	25	Pass
20C 20V	n20	5500	Ant2	5500.06	60000	10.91	25	Pass
30C 9V	n20	5600	Ant2	5600.08	80000	14.29	25	Pass

30C 20V	n20	5600	Ant2	5600.08	80000	14.29	25	Pass
0C 20V	n20	5600	Ant2	5600.06	60000	10.71	25	Pass
10C 20V	n20	5600	Ant2	5600.06	60000	10.71	25	Pass
20C 20V	n20	5600	Ant2	5600.06	60000	10.71	25	Pass
30C 9V	n20	5700	Ant2	5700.02	20000	3.51	25	Pass
30C 20V	n20	5700	Ant2	5700.04	40000	7.02	25	Pass
0C 20V	n20	5700	Ant2	5700.04	40000	7.02	25	Pass
10C 20V	n20	5700	Ant2	5700.04	40000	7.02	25	Pass
20C 20V	n20	5700	Ant2	5700.04	40000	7.02	25	Pass
30C 9V	n20	5745	Ant2	5745.04	40000	6.96	25	Pass
30C 20V	n20	5745	Ant2	5745.06	60000	10.44	25	Pass
0C 20V	n20	5745	Ant2	5745.06	60000	10.44	25	Pass
10C 20V	n20	5745	Ant2	5745.06	60000	10.44	25	Pass
20C 20V	n20	5745	Ant2	5745.06	60000	10.44	25	Pass
30C 9V	n20	5785	Ant2	5785.08	80000	13.83	25	Pass
30C 20V	n20	5785	Ant2	5785.08	80000	13.83	25	Pass
0C 20V	n20	5785	Ant2	5785.06	60000	10.37	25	Pass
10C 20V	n20	5785	Ant2	5785.06	60000	10.37	25	Pass
20C 20V	n20	5785	Ant2	5785.06	60000	10.37	25	Pass
30C 9V	n20	5825	Ant2	5825.04	40000	6.87	25	Pass
30C 20V	n20	5825	Ant2	5825.06	60000	10.3	25	Pass
0C 20V	n20	5825	Ant2	5825.06	60000	10.3	25	Pass
10C 20V	n20	5825	Ant2	5825.04	40000	6.87	25	Pass
20C 20V	n20	5825	Ant2	5825.04	40000	6.87	25	Pass
30C 9V	n40	5190	Ant1	5190.12	120000	23.12	25	Pass
30C 20V	n40	5190	Ant1	5190.08	80000	15.41	25	Pass
0C 20V	n40	5190	Ant1	5190.12	120000	23.12	25	Pass
10C 20V	n40	5190	Ant1	5190.08	80000	15.41	25	Pass
20C 20V	n40	5190	Ant1	5190.08	80000	15.41	25	Pass
30C 9V	n40	5230	Ant1	5230.12	120000	22.94	25	Pass
30C 20V	n40	5230	Ant1	5230.08	80000	15.3	25	Pass
0C 20V	n40	5230	Ant1	5230.08	80000	15.3	25	Pass
10C 20V	n40	5230	Ant1	5230.08	80000	15.3	25	Pass
20C 20V	n40	5230	Ant1	5230.08	80000	15.3	25	Pass
30C 9V	n40	5270	Ant1	5270.08	80000	15.18	25	Pass
30C 20V	n40	5270	Ant1	5270.08	80000	15.18	25	Pass
0C 20V	n40	5270	Ant1	5270.08	80000	15.18	25	Pass
10C 20V	n40	5270	Ant1	5270.08	80000	15.18	25	Pass
20C 20V	n40	5270	Ant1	5270.12	120000	22.77	25	Pass
30C 9V	n40	5310	Ant1	5310.08	80000	15.07	25	Pass
30C 20V	n40	5310	Ant1	5310.08	80000	15.07	25	Pass
0C 20V	n40	5310	Ant1	5310.08	80000	15.07	25	Pass
10C 20V	n40	5310	Ant1	5310.08	80000	15.07	25	Pass
20C 20V	n40	5310	Ant1	5310.08	80000	15.07	25	Pass

30C 9V	n40	5510	Ant1	5510.08	80000	14.52	25	Pass
30C 20V	n40	5510	Ant1	5510.12	120000	21.78	25	Pass
0C 20V	n40	5510	Ant1	5510.08	80000	14.52	25	Pass
10C 20V	n40	5510	Ant1	5510.12	120000	21.78	25	Pass
20C 20V	n40	5510	Ant1	5510.08	80000	14.52	25	Pass
30C 9V	n40	5590	Ant1	5590.08	80000	14.31	25	Pass
30C 20V	n40	5590	Ant1	5590.12	120000	21.47	25	Pass
0C 20V	n40	5590	Ant1	5590.12	120000	21.47	25	Pass
10C 20V	n40	5590	Ant1	5590.12	120000	21.47	25	Pass
20C 20V	n40	5590	Ant1	5590.12	120000	21.47	25	Pass
30C 9V	n40	5670	Ant1	5670.12	120000	21.16	25	Pass
30C 20V	n40	5670	Ant1	5670.12	120000	21.16	25	Pass
0C 20V	n40	5670	Ant1	5670.12	120000	21.16	25	Pass
10C 20V	n40	5670	Ant1	5670.16	160000	28.22	25	Pass
20C 20V	n40	5670	Ant1	5670.12	120000	21.16	25	Pass
NVNT	n40	5755	Ant1	5755.12	120000	20.85	25	Pass
20C 20V	n40	5755	Ant2	5755.12	120000	20.85	25	Pass
10C 20V	n40	5755	Ant2	5755.16	160000	27.8	25	Pass
0C 20V	n40	5755	Ant2	5755.12	120000	20.85	25	Pass
30C 20V	n40	5755	Ant2	5755.12	120000	20.85	25	Pass
30C 9V	n40	5755	Ant2	5755.16	160000	27.8	25	Pass
30C 9V	n40	5795	Ant1	5795.08	80000	13.81	25	Pass
30C 20V	n40	5795	Ant1	5795.12	120000	20.71	25	Pass
0C 20V	n40	5795	Ant1	5795.12	120000	20.71	25	Pass
10C 20V	n40	5795	Ant1	5795.12	120000	20.71	25	Pass
20C 20V	n40	5795	Ant1	5795.12	120000	20.71	25	Pass
30C 9V	n40	5190	Ant2	5190.08	80000	15.41	25	Pass
30C 20V	n40	5190	Ant2	5190.08	80000	15.41	25	Pass
0C 20V	n40	5190	Ant2	5190.08	80000	15.41	25	Pass
10C 20V	n40	5190	Ant2	5190.12	120000	23.12	25	Pass
20C 20V	n40	5190	Ant2	5190.08	80000	15.41	25	Pass
30C 9V	n40	5230	Ant2	5230.08	80000	15.3	25	Pass
30C 20V	n40	5230	Ant2	5230.12	120000	22.94	25	Pass
0C 20V	n40	5230	Ant2	5230.08	80000	15.3	25	Pass
10C 20V	n40	5230	Ant2	5230.08	80000	15.3	25	Pass
20C 20V	n40	5230	Ant2	5230.08	80000	15.3	25	Pass
30C 9V	n40	5270	Ant2	5270.08	80000	15.18	25	Pass
30C 20V	n40	5270	Ant2	5270.08	80000	15.18	25	Pass
0C 20V	n40	5270	Ant2	5270.08	80000	15.18	25	Pass
10C 20V	n40	5270	Ant2	5270.08	80000	15.18	25	Pass
20C 20V	n40	5270	Ant2	5270.08	80000	15.18	25	Pass
30C 9V	n40	5310	Ant2	5310.08	80000	15.07	25	Pass
30C 20V	n40	5310	Ant2	5310.08	80000	15.07	25	Pass
0C 20V	n40	5310	Ant2	5310.08	80000	15.07	25	Pass

10C 20V	n40	5310	Ant2	5310.08	80000	15.07	25	Pass
20C 20V	n40	5310	Ant2	5310.08	80000	15.07	25	Pass
30C 9V	n40	5510	Ant2	5510.12	120000	21.78	25	Pass
30C 20V	n40	5510	Ant2	5510.12	120000	21.78	25	Pass
0C 20V	n40	5510	Ant2	5510.16	160000	29.04	25	Pass
10C 20V	n40	5510	Ant2	5510.08	80000	14.52	25	Pass
20C 20V	n40	5510	Ant2	5510.12	120000	21.78	25	Pass
30C 9V	n40	5590	Ant2	5590.12	120000	21.47	25	Pass
30C 20V	n40	5590	Ant2	5590.12	120000	21.47	25	Pass
0C 20V	n40	5590	Ant2	5590.12	120000	21.47	25	Pass
10C 20V	n40	5590	Ant2	5590.16	160000	28.62	25	Pass
20C 20V	n40	5590	Ant2	5590.12	120000	21.47	25	Pass
30C 9V	n40	5670	Ant2	5670.12	120000	21.16	25	Pass
30C 20V	n40	5670	Ant2	5670.12	120000	21.16	25	Pass
0C 20V	n40	5670	Ant2	5670.16	160000	28.22	25	Pass
10C 20V	n40	5670	Ant2	5670.12	120000	21.16	25	Pass
20C 20V	n40	5670	Ant2	5670.12	120000	21.16	25	Pass
30C 9V	n40	5795	Ant2	5795.08	80000	13.81	25	Pass
30C 20V	n40	5795	Ant2	5795.12	120000	20.71	25	Pass
0C 20V	n40	5795	Ant2	5795.08	80000	13.81	25	Pass
10C 20V	n40	5795	Ant2	5795.12	120000	20.71	25	Pass
20C 20V	n40	5795	Ant2	5795.12	120000	20.71	25	Pass
30C 9V	ac20	5180	Ant1	5180.04	40000	7.72	25	Pass
30C 20V	ac20	5180	Ant1	5180.06	60000	11.58	25	Pass
0C 20V	ac20	5180	Ant1	5180.04	40000	7.72	25	Pass
10C 20V	ac20	5180	Ant1	5180.06	60000	11.58	25	Pass
20C 20V	ac20	5180	Ant1	5180.04	40000	7.72	25	Pass
30C 9V	ac20	5200	Ant1	5200.02	20000	3.85	25	Pass
30C 20V	ac20	5200	Ant1	5200.06	60000	11.54	25	Pass
0C 20V	ac20	5200	Ant1	5200.08	80000	15.38	25	Pass
10C 20V	ac20	5200	Ant1	5200.04	40000	7.69	25	Pass
20C 20V	ac20	5200	Ant1	5200.04	40000	7.69	25	Pass
30C 9V	ac20	5240	Ant1	5240.06	60000	11.45	25	Pass
30C 20V	ac20	5240	Ant1	5240.06	60000	11.45	25	Pass
0C 20V	ac20	5240	Ant1	5240.06	60000	11.45	25	Pass
10C 20V	ac20	5240	Ant1	5240.06	60000	11.45	25	Pass
20C 20V	ac20	5240	Ant1	5240.06	60000	11.45	25	Pass
30C 9V	ac20	5260	Ant1	5260.06	60000	11.41	25	Pass
30C 20V	ac20	5260	Ant1	5260.04	40000	7.6	25	Pass
0C 20V	ac20	5260	Ant1	5260.02	20000	3.8	25	Pass
10C 20V	ac20	5260	Ant1	5260.08	80000	15.21	25	Pass
20C 20V	ac20	5260	Ant1	5260.06	60000	11.41	25	Pass
30C 9V	ac20	5280	Ant1	5280.08	80000	15.15	25	Pass
30C 20V	ac20	5280	Ant1	5280.04	40000	7.58	25	Pass

0C 20V	ac20	5280	Ant1	5280.06	60000	11.36	25	Pass
10C 20V	ac20	5280	Ant1	5280.04	40000	7.58	25	Pass
20C 20V	ac20	5280	Ant1	5280.06	60000	11.36	25	Pass
30C 9V	ac20	5320	Ant1	5320.04	40000	7.52	25	Pass
30C 20V	ac20	5320	Ant1	5320.06	60000	11.28	25	Pass
0C 20V	ac20	5320	Ant1	5320.04	40000	7.52	25	Pass
10C 20V	ac20	5320	Ant1	5320.06	60000	11.28	25	Pass
20C 20V	ac20	5320	Ant1	5320.04	40000	7.52	25	Pass
30C 9V	ac20	5500	Ant1	5500.06	60000	10.91	25	Pass
30C 20V	ac20	5500	Ant1	5500.04	40000	7.27	25	Pass
0C 20V	ac20	5500	Ant1	5500.06	60000	10.91	25	Pass
10C 20V	ac20	5500	Ant1	5500.08	80000	14.55	25	Pass
20C 20V	ac20	5500	Ant1	5500.06	60000	10.91	25	Pass
30C 9V	ac20	5600	Ant1	5600.1	100000	17.86	25	Pass
30C 20V	ac20	5600	Ant1	5600.04	40000	7.14	25	Pass
0C 20V	ac20	5600	Ant1	5600.08	80000	14.29	25	Pass
10C 20V	ac20	5600	Ant1	5600.08	80000	14.29	25	Pass
20C 20V	ac20	5600	Ant1	5600.08	80000	14.29	25	Pass
30C 9V	ac20	5700	Ant1	5700.02	20000	3.51	25	Pass
30C 20V	ac20	5700	Ant1	5700.06	60000	10.53	25	Pass
0C 20V	ac20	5700	Ant1	5700.06	60000	10.53	25	Pass
10C 20V	ac20	5700	Ant1	5700.04	40000	7.02	25	Pass
20C 20V	ac20	5700	Ant1	5700.06	60000	10.53	25	Pass
30C 9V	ac20	5745	Ant1	5745.1	100000	17.41	25	Pass
30C 20V	ac20	5745	Ant1	5745.1	100000	17.41	25	Pass
0C 20V	ac20	5745	Ant1	5745.1	100000	17.41	25	Pass
10C 20V	ac20	5745	Ant1	5745.08	80000	13.93	25	Pass
20C 20V	ac20	5745	Ant1	5745.08	80000	13.93	25	Pass
30C 9V	ac20	5785	Ant1	5785.04	40000	6.91	25	Pass
30C 20V	ac20	5785	Ant1	5785.02	20000	3.46	25	Pass
0C 20V	ac20	5785	Ant1	5785.04	40000	6.91	25	Pass
10C 20V	ac20	5785	Ant1	5785.06	60000	10.37	25	Pass
20C 20V	ac20	5785	Ant1	5785.06	60000	10.37	25	Pass
30C 9V	ac20	5825	Ant1	5825.06	60000	10.3	25	Pass
30C 20V	ac20	5825	Ant1	5825.06	60000	10.3	25	Pass
0C 20V	ac20	5825	Ant1	5825.06	60000	10.3	25	Pass
10C 20V	ac20	5825	Ant1	5825.06	60000	10.3	25	Pass
20C 20V	ac20	5825	Ant1	5825.06	60000	10.3	25	Pass
30C 9V	ac20	5180	Ant2	5180.06	60000	11.58	25	Pass
30C 20V	ac20	5180	Ant2	5180.04	40000	7.72	25	Pass
0C 20V	ac20	5180	Ant2	5180.02	20000	3.86	25	Pass
10C 20V	ac20	5180	Ant2	5180.04	40000	7.72	25	Pass
20C 20V	ac20	5180	Ant2	5180.08	80000	15.44	25	Pass
30C 9V	ac20	5200	Ant2	5200.04	40000	7.69	25	Pass

30C 20V	ac20	5200	Ant2	5200.08	80000	15.38	25	Pass
0C 20V	ac20	5200	Ant2	5200.06	60000	11.54	25	Pass
10C 20V	ac20	5200	Ant2	5200.08	80000	15.38	25	Pass
20C 20V	ac20	5200	Ant2	5200.04	40000	7.69	25	Pass
30C 9V	ac20	5240	Ant2	5240.04	40000	7.63	25	Pass
30C 20V	ac20	5240	Ant2	5240.06	60000	11.45	25	Pass
0C 20V	ac20	5240	Ant2	5240.06	60000	11.45	25	Pass
10C 20V	ac20	5240	Ant2	5240.04	40000	7.63	25	Pass
20C 20V	ac20	5240	Ant2	5240.06	60000	11.45	25	Pass
30C 9V	ac20	5260	Ant2	5260.04	40000	7.6	25	Pass
30C 20V	ac20	5260	Ant2	5260.04	40000	7.6	25	Pass
0C 20V	ac20	5260	Ant2	5260.02	20000	3.8	25	Pass
10C 20V	ac20	5260	Ant2	5260.06	60000	11.41	25	Pass
20C 20V	ac20	5260	Ant2	5260.04	40000	7.6	25	Pass
30C 9V	ac20	5280	Ant2	5280.08	80000	15.15	25	Pass
30C 20V	ac20	5280	Ant2	5280.04	40000	7.58	25	Pass
0C 20V	ac20	5280	Ant2	5280.06	60000	11.36	25	Pass
10C 20V	ac20	5280	Ant2	5280.06	60000	11.36	25	Pass
20C 20V	ac20	5280	Ant2	5280.06	60000	11.36	25	Pass
30C 9V	ac20	5320	Ant2	5320.06	60000	11.28	25	Pass
30C 20V	ac20	5320	Ant2	5320.04	40000	7.52	25	Pass
0C 20V	ac20	5320	Ant2	5320.06	60000	11.28	25	Pass
10C 20V	ac20	5320	Ant2	5320.06	60000	11.28	25	Pass
20C 20V	ac20	5320	Ant2	5320.08	80000	15.04	25	Pass
30C 9V	ac20	5500	Ant2	5500.06	60000	10.91	25	Pass
30C 20V	ac20	5500	Ant2	5500.06	60000	10.91	25	Pass
0C 20V	ac20	5500	Ant2	5500.06	60000	10.91	25	Pass
10C 20V	ac20	5500	Ant2	5500.06	60000	10.91	25	Pass
20C 20V	ac20	5500	Ant2	5500.06	60000	10.91	25	Pass
30C 9V	ac20	5600	Ant2	5600.06	60000	10.71	25	Pass
30C 20V	ac20	5600	Ant2	5600.08	80000	14.29	25	Pass
0C 20V	ac20	5600	Ant2	5600.08	80000	14.29	25	Pass
10C 20V	ac20	5600	Ant2	5600.06	60000	10.71	25	Pass
20C 20V	ac20	5600	Ant2	5600.08	80000	14.29	25	Pass
30C 9V	ac20	5700	Ant2	5700.08	80000	14.04	25	Pass
30C 20V	ac20	5700	Ant2	5700.06	60000	10.53	25	Pass
0C 20V	ac20	5700	Ant2	5700.04	40000	7.02	25	Pass
10C 20V	ac20	5700	Ant2	5700.06	60000	10.53	25	Pass
20C 20V	ac20	5700	Ant2	5700.08	80000	14.04	25	Pass
30C 9V	ac20	5745	Ant2	5745.06	60000	10.44	25	Pass
30C 20V	ac20	5745	Ant2	5745.04	40000	6.96	25	Pass
0C 20V	ac20	5745	Ant2	5745.06	60000	10.44	25	Pass
10C 20V	ac20	5745	Ant2	5745.06	60000	10.44	25	Pass
20C 20V	ac20	5745	Ant2	5745.06	60000	10.44	25	Pass

30C 9V	ac20	5785	Ant2	5785.06	60000	10.37	25	Pass
30C 20V	ac20	5785	Ant2	5785.06	60000	10.37	25	Pass
0C 20V	ac20	5785	Ant2	5785.06	60000	10.37	25	Pass
10C 20V	ac20	5785	Ant2	5785.06	60000	10.37	25	Pass
20C 20V	ac20	5785	Ant2	5785.06	60000	10.37	25	Pass
30C 9V	ac20	5825	Ant2	5825.06	60000	10.3	25	Pass
30C 20V	ac20	5825	Ant2	5825.06	60000	10.3	25	Pass
0C 20V	ac20	5825	Ant2	5825.06	60000	10.3	25	Pass
10C 20V	ac20	5825	Ant2	5825.08	80000	13.73	25	Pass
20C 20V	ac20	5825	Ant2	5825.06	60000	10.3	25	Pass
30C 9V	ac40	5190	Ant1	5190.08	80000	15.41	25	Pass
30C 20V	ac40	5190	Ant1	5190.08	80000	15.41	25	Pass
0C 20V	ac40	5190	Ant1	5190.04	40000	7.71	25	Pass
10C 20V	ac40	5190	Ant1	5190.04	40000	7.71	25	Pass
20C 20V	ac40	5190	Ant1	5190.04	40000	7.71	25	Pass
30C 9V	ac40	5230	Ant1	5230.08	80000	15.3	25	Pass
30C 20V	ac40	5230	Ant1	5230.04	40000	7.65	25	Pass
0C 20V	ac40	5230	Ant1	5230.08	80000	15.3	25	Pass
10C 20V	ac40	5230	Ant1	5230.08	80000	15.3	25	Pass
20C 20V	ac40	5230	Ant1	5230.08	80000	15.3	25	Pass
30C 9V	ac40	5270	Ant1	5270.08	80000	15.18	25	Pass
30C 20V	ac40	5270	Ant1	5270.04	40000	7.59	25	Pass
0C 20V	ac40	5270	Ant1	5270.08	80000	15.18	25	Pass
10C 20V	ac40	5270	Ant1	5270.08	80000	15.18	25	Pass
20C 20V	ac40	5270	Ant1	5270.08	80000	15.18	25	Pass
30C 9V	ac40	5310	Ant1	5310.08	80000	15.07	25	Pass
30C 20V	ac40	5310	Ant1	5310.08	80000	15.07	25	Pass
0C 20V	ac40	5310	Ant1	5310.04	40000	7.53	25	Pass
10C 20V	ac40	5310	Ant1	5310.04	40000	7.53	25	Pass
20C 20V	ac40	5310	Ant1	5310.08	80000	15.07	25	Pass
30C 9V	ac40	5510	Ant1	5510.08	80000	14.52	25	Pass
30C 20V	ac40	5510	Ant1	5510.08	80000	14.52	25	Pass
0C 20V	ac40	5510	Ant1	5510.04	40000	7.26	25	Pass
10C 20V	ac40	5510	Ant1	5510.04	40000	7.26	25	Pass
20C 20V	ac40	5510	Ant1	5510.04	40000	7.26	25	Pass
30C 9V	ac40	5590	Ant1	5590.04	40000	7.16	25	Pass
30C 20V	ac40	5590	Ant1	5590.08	80000	14.31	25	Pass
0C 20V	ac40	5590	Ant1	5590.08	80000	14.31	25	Pass
10C 20V	ac40	5590	Ant1	5590.04	40000	7.16	25	Pass
20C 20V	ac40	5590	Ant1	5590.04	40000	7.16	25	Pass
30C 9V	ac40	5670	Ant1	5670.04	40000	7.05	25	Pass
30C 20V	ac40	5670	Ant1	5670.08	80000	14.11	25	Pass
0C 20V	ac40	5670	Ant1	5670.08	80000	14.11	25	Pass
10C 20V	ac40	5670	Ant1	5670.08	80000	14.11	25	Pass

20C 20V	ac40	5670	Ant1	5670.08	80000	14.11	25	Pass
30C 9V	ac40	5755	Ant1	5755.08	80000	13.9	25	Pass
30C 20V	ac40	5755	Ant1	5755.04	40000	6.95	25	Pass
0C 20V	ac40	5755	Ant1	5755.08	80000	13.9	25	Pass
10C 20V	ac40	5755	Ant1	5755.08	80000	13.9	25	Pass
20C 20V	ac40	5755	Ant1	5755.08	80000	13.9	25	Pass
30C 9V	ac40	5795	Ant1	5795.08	80000	13.81	25	Pass
30C 20V	ac40	5795	Ant1	5795.08	80000	13.81	25	Pass
0C 20V	ac40	5795	Ant1	5795.08	80000	13.81	25	Pass
10C 20V	ac40	5795	Ant1	5795.08	80000	13.81	25	Pass
20C 20V	ac40	5795	Ant1	5795.08	80000	13.81	25	Pass
30C 9V	ac40	5190	Ant2	5190.04	40000	7.71	25	Pass
30C 20V	ac40	5190	Ant2	5190.04	40000	7.71	25	Pass
0C 20V	ac40	5190	Ant2	5190.04	40000	7.71	25	Pass
10C 20V	ac40	5190	Ant2	5190.04	40000	7.71	25	Pass
20C 20V	ac40	5190	Ant2	5190.04	40000	7.71	25	Pass
30C 9V	ac40	5230	Ant2	5230.08	80000	15.3	25	Pass
30C 20V	ac40	5230	Ant2	5230.08	80000	15.3	25	Pass
0C 20V	ac40	5230	Ant2	5230.04	40000	7.65	25	Pass
10C 20V	ac40	5230	Ant2	5230.08	80000	15.3	25	Pass
20C 20V	ac40	5230	Ant2	5230.08	80000	15.3	25	Pass
30C 9V	ac40	5270	Ant2	5270.08	80000	15.18	25	Pass
30C 20V	ac40	5270	Ant2	5270.08	80000	15.18	25	Pass
0C 20V	ac40	5270	Ant2	5270.04	40000	7.59	25	Pass
10C 20V	ac40	5270	Ant2	5270.04	40000	7.59	25	Pass
20C 20V	ac40	5270	Ant2	5270.08	80000	15.18	25	Pass
30C 9V	ac40	5310	Ant2	5310.08	80000	15.07	25	Pass
30C 20V	ac40	5310	Ant2	5310.08	80000	15.07	25	Pass
0C 20V	ac40	5310	Ant2	5310.04	40000	7.53	25	Pass
10C 20V	ac40	5310	Ant2	5310.04	40000	7.53	25	Pass
20C 20V	ac40	5310	Ant2	5310.08	80000	15.07	25	Pass
30C 9V	ac40	5510	Ant2	5510.08	80000	14.52	25	Pass
30C 20V	ac40	5510	Ant2	5510.08	80000	14.52	25	Pass
0C 20V	ac40	5510	Ant2	5510.08	80000	14.52	25	Pass
10C 20V	ac40	5510	Ant2	5510.08	80000	14.52	25	Pass
20C 20V	ac40	5510	Ant2	5510.08	80000	14.52	25	Pass
30C 9V	ac40	5590	Ant2	5590.08	80000	14.31	25	Pass
30C 20V	ac40	5590	Ant2	5590.08	80000	14.31	25	Pass
0C 20V	ac40	5590	Ant2	5590.08	80000	14.31	25	Pass
10C 20V	ac40	5590	Ant2	5590.08	80000	14.31	25	Pass
20C 20V	ac40	5590	Ant2	5590.08	80000	14.31	25	Pass
30C 9V	ac40	5670	Ant2	5670.08	80000	14.11	25	Pass
30C 20V	ac40	5670	Ant2	5670.08	80000	14.11	25	Pass
0C 20V	ac40	5670	Ant2	5670.08	80000	14.11	25	Pass

10C 20V	ac40	5670	Ant2	5670.08	80000	14.11	25	Pass
20C 20V	ac40	5670	Ant2	5670.08	80000	14.11	25	Pass
30C 9V	ac40	5755	Ant2	5755.04	40000	6.95	25	Pass
30C 20V	ac40	5755	Ant2	5755.04	40000	6.95	25	Pass
0C 20V	ac40	5755	Ant2	5755.08	80000	13.9	25	Pass
10C 20V	ac40	5755	Ant2	5755.04	40000	6.95	25	Pass
20C 20V	ac40	5755	Ant2	5755.04	40000	6.95	25	Pass
30C 9V	ac40	5795	Ant2	5795	0	0	25	Pass
30C 20V	ac40	5795	Ant2	5795.04	40000	6.9	25	Pass
0C 20V	ac40	5795	Ant2	5795.08	80000	13.81	25	Pass
10C 20V	ac40	5795	Ant2	5795.04	40000	6.9	25	Pass
20C 20V	ac40	5795	Ant2	5795.08	80000	13.81	25	Pass
30C 9V	ac80	5210	Ant1	5210.08	80000	15.36	25	Pass
30C 20V	ac80	5210	Ant1	5210.08	80000	15.36	25	Pass
0C 20V	ac80	5210	Ant1	5210.08	80000	15.36	25	Pass
10C 20V	ac80	5210	Ant1	5210.08	80000	15.36	25	Pass
20C 20V	ac80	5210	Ant1	5210.08	80000	15.36	25	Pass
30C 9V	ac80	5290	Ant1	5290.08	80000	15.12	25	Pass
30C 20V	ac80	5290	Ant1	5290	0	0	25	Pass
0C 20V	ac80	5290	Ant1	5290	0	0	25	Pass
10C 20V	ac80	5290	Ant1	5290.08	80000	15.12	25	Pass
20C 20V	ac80	5290	Ant1	5290.16	160000	30.25	25	Pass
30C 9V	ac80	5530	Ant1	5530.08	80000	14.47	25	Pass
30C 20V	ac80	5530	Ant1	5530.08	80000	14.47	25	Pass
0C 20V	ac80	5530	Ant1	5530.08	80000	14.47	25	Pass
10C 20V	ac80	5530	Ant1	5530.08	80000	14.47	25	Pass
20C 20V	ac80	5530	Ant1	5530.08	80000	14.47	25	Pass
30C 9V	ac80	5610	Ant1	5610.08	80000	14.26	25	Pass
30C 20V	ac80	5610	Ant1	5610.08	80000	14.26	25	Pass
0C 20V	ac80	5610	Ant1	5610.08	80000	14.26	25	Pass
10C 20V	ac80	5610	Ant1	5610.08	80000	14.26	25	Pass
20C 20V	ac80	5610	Ant1	5610.08	80000	14.26	25	Pass
30C 9V	ac80	5775	Ant1	5775.08	80000	13.85	25	Pass
30C 20V	ac80	5775	Ant1	5775.08	80000	13.85	25	Pass
0C 20V	ac80	5775	Ant1	5775.08	80000	13.85	25	Pass
10C 20V	ac80	5775	Ant1	5775.08	80000	13.85	25	Pass
20C 20V	ac80	5775	Ant1	5775.08	80000	13.85	25	Pass
30C 9V	ac80	5210	Ant2	5210.08	80000	15.36	25	Pass
30C 20V	ac80	5210	Ant2	5210.08	80000	15.36	25	Pass
0C 20V	ac80	5210	Ant2	5210.08	80000	15.36	25	Pass
10C 20V	ac80	5210	Ant2	5210.08	80000	15.36	25	Pass
20C 20V	ac80	5210	Ant2	5210.08	80000	15.36	25	Pass
30C 9V	ac80	5290	Ant2	5290.08	80000	15.12	25	Pass
30C 20V	ac80	5290	Ant2	5290.08	80000	15.12	25	Pass

0C 20V	ac80	5290	Ant2	5290.08	80000	15.12	25	Pass
10C 20V	ac80	5290	Ant2	5290.08	80000	15.12	25	Pass
20C 20V	ac80	5290	Ant2	5290.08	80000	15.12	25	Pass
30C 9V	ac80	5530	Ant2	5530.08	80000	14.47	25	Pass
30C 20V	ac80	5530	Ant2	5530.08	80000	14.47	25	Pass
0C 20V	ac80	5530	Ant2	5530.08	80000	14.47	25	Pass
10C 20V	ac80	5530	Ant2	5530.08	80000	14.47	25	Pass
20C 20V	ac80	5530	Ant2	5530.08	80000	14.47	25	Pass
30C 9V	ac80	5610	Ant2	5610.08	80000	14.26	25	Pass
30C 20V	ac80	5610	Ant2	5610.08	80000	14.26	25	Pass
0C 20V	ac80	5610	Ant2	5610.08	80000	14.26	25	Pass
10C 20V	ac80	5610	Ant2	5610.08	80000	14.26	25	Pass
20C 20V	ac80	5610	Ant2	5610.08	80000	14.26	25	Pass
30C 9V	ac80	5775	Ant2	5775.08	80000	13.85	25	Pass
30C 20V	ac80	5775	Ant2	5775.08	80000	13.85	25	Pass
0C 20V	ac80	5775	Ant2	5775.08	80000	13.85	25	Pass
10C 20V	ac80	5775	Ant2	5775.08	80000	13.85	25	Pass
20C 20V	ac80	5775	Ant2	5775.08	80000	13.85	25	Pass
30C 9V	ax20	5180	Ant1	5180.08	80000	15.44	25	Pass
30C 20V	ax20	5180	Ant1	5180.1	100000	19.31	25	Pass
0C 20V	ax20	5180	Ant1	5180.08	80000	15.44	25	Pass
10C 20V	ax20	5180	Ant1	5180.08	80000	15.44	25	Pass
20C 20V	ax20	5180	Ant1	5180.08	80000	15.44	25	Pass
30C 9V	ax20	5200	Ant1	5200.08	80000	15.38	25	Pass
30C 20V	ax20	5200	Ant1	5200.08	80000	15.38	25	Pass
0C 20V	ax20	5200	Ant1	5200.08	80000	15.38	25	Pass
10C 20V	ax20	5200	Ant1	5200.08	80000	15.38	25	Pass
20C 20V	ax20	5200	Ant1	5200.08	80000	15.38	25	Pass
30C 9V	ax20	5240	Ant1	5240.08	80000	15.27	25	Pass
30C 20V	ax20	5240	Ant1	5240.08	80000	15.27	25	Pass
0C 20V	ax20	5240	Ant1	5240.08	80000	15.27	25	Pass
10C 20V	ax20	5240	Ant1	5240.08	80000	15.27	25	Pass
20C 20V	ax20	5240	Ant1	5240.06	60000	11.45	25	Pass
30C 9V	ax20	5260	Ant1	5260.08	80000	15.21	25	Pass
30C 20V	ax20	5260	Ant1	5260.06	60000	11.41	25	Pass
0C 20V	ax20	5260	Ant1	5260.08	80000	15.21	25	Pass
10C 20V	ax20	5260	Ant1	5260.08	80000	15.21	25	Pass
20C 20V	ax20	5260	Ant1	5260.08	80000	15.21	25	Pass
30C 9V	ax20	5280	Ant1	5280.08	80000	15.15	25	Pass
30C 20V	ax20	5280	Ant1	5280.08	80000	15.15	25	Pass
0C 20V	ax20	5280	Ant1	5280.08	80000	15.15	25	Pass
10C 20V	ax20	5280	Ant1	5280.06	60000	11.36	25	Pass
20C 20V	ax20	5280	Ant1	5280.08	80000	15.15	25	Pass
30C 9V	ax20	5320	Ant1	5320.08	80000	15.04	25	Pass

30C 20V	ax20	5320	Ant1	5320.08	80000	15.04	25	Pass
0C 20V	ax20	5320	Ant1	5320.08	80000	15.04	25	Pass
10C 20V	ax20	5320	Ant1	5320.08	80000	15.04	25	Pass
20C 20V	ax20	5320	Ant1	5320.08	80000	15.04	25	Pass
30C 9V	ax20	5500	Ant1	5500.08	80000	14.55	25	Pass
30C 20V	ax20	5500	Ant1	5500.1	100000	18.18	25	Pass
0C 20V	ax20	5500	Ant1	5500.1	100000	18.18	25	Pass
10C 20V	ax20	5500	Ant1	5500.08	80000	14.55	25	Pass
20C 20V	ax20	5500	Ant1	5500.08	80000	14.55	25	Pass
30C 9V	ax20	5600	Ant1	5600.08	80000	14.29	25	Pass
30C 20V	ax20	5600	Ant1	5600.08	80000	14.29	25	Pass
0C 20V	ax20	5600	Ant1	5600.08	80000	14.29	25	Pass
10C 20V	ax20	5600	Ant1	5600.08	80000	14.29	25	Pass
20C 20V	ax20	5600	Ant1	5600.08	80000	14.29	25	Pass
30C 9V	ax20	5700	Ant1	5700.08	80000	14.04	25	Pass
30C 20V	ax20	5700	Ant1	5700.08	80000	14.04	25	Pass
0C 20V	ax20	5700	Ant1	5700.08	80000	14.04	25	Pass
10C 20V	ax20	5700	Ant1	5700.08	80000	14.04	25	Pass
20C 20V	ax20	5700	Ant1	5700.1	100000	17.54	25	Pass
30C 9V	ax20	5745	Ant1	5745.08	80000	13.93	25	Pass
30C 20V	ax20	5745	Ant1	5745.1	100000	17.41	25	Pass
0C 20V	ax20	5745	Ant1	5745.08	80000	13.93	25	Pass
10C 20V	ax20	5745	Ant1	5745.08	80000	13.93	25	Pass
20C 20V	ax20	5745	Ant1	5745.08	80000	13.93	25	Pass
30C 9V	ax20	5785	Ant1	5785.1	100000	17.29	25	Pass
30C 20V	ax20	5785	Ant1	5785.08	80000	13.83	25	Pass
0C 20V	ax20	5785	Ant1	5785.08	80000	13.83	25	Pass
10C 20V	ax20	5785	Ant1	5785.08	80000	13.83	25	Pass
20C 20V	ax20	5785	Ant1	5785.08	80000	13.83	25	Pass
30C 9V	ax20	5825	Ant1	5825.1	100000	17.17	25	Pass
30C 20V	ax20	5825	Ant1	5825.08	80000	13.73	25	Pass
0C 20V	ax20	5825	Ant1	5825.06	60000	10.3	25	Pass
10C 20V	ax20	5825	Ant1	5825.08	80000	13.73	25	Pass
20C 20V	ax20	5825	Ant1	5825.1	100000	17.17	25	Pass
30C 9V	ax20	5180	Ant2	5180.1	100000	19.31	25	Pass
30C 20V	ax20	5180	Ant2	5180.08	80000	15.44	25	Pass
0C 20V	ax20	5180	Ant2	5180.1	100000	19.31	25	Pass
10C 20V	ax20	5180	Ant2	5180.08	80000	15.44	25	Pass
20C 20V	ax20	5180	Ant2	5180.08	80000	15.44	25	Pass
30C 9V	ax20	5200	Ant2	5200.08	80000	15.38	25	Pass
30C 20V	ax20	5200	Ant2	5200.08	80000	15.38	25	Pass
0C 20V	ax20	5200	Ant2	5200.08	80000	15.38	25	Pass
10C 20V	ax20	5200	Ant2	5200.08	80000	15.38	25	Pass
20C 20V	ax20	5200	Ant2	5200.08	80000	15.38	25	Pass

30C 9V	ax20	5240	Ant2	5240.1	100000	19.08	25	Pass
30C 20V	ax20	5240	Ant2	5240.08	80000	15.27	25	Pass
0C 20V	ax20	5240	Ant2	5240.1	100000	19.08	25	Pass
10C 20V	ax20	5240	Ant2	5240.08	80000	15.27	25	Pass
20C 20V	ax20	5240	Ant2	5240.08	80000	15.27	25	Pass
30C 9V	ax20	5260	Ant2	5260.06	60000	11.41	25	Pass
30C 20V	ax20	5260	Ant2	5260.08	80000	15.21	25	Pass
0C 20V	ax20	5260	Ant2	5260.06	60000	11.41	25	Pass
10C 20V	ax20	5260	Ant2	5260.08	80000	15.21	25	Pass
20C 20V	ax20	5260	Ant2	5260.08	80000	15.21	25	Pass
30C 9V	ax20	5280	Ant2	5280.08	80000	15.15	25	Pass
30C 20V	ax20	5280	Ant2	5280.08	80000	15.15	25	Pass
0C 20V	ax20	5280	Ant2	5280.08	80000	15.15	25	Pass
10C 20V	ax20	5280	Ant2	5280.08	80000	15.15	25	Pass
20C 20V	ax20	5280	Ant2	5280.1	100000	18.94	25	Pass
30C 9V	ax20	5320	Ant2	5320.06	60000	11.28	25	Pass
30C 20V	ax20	5320	Ant2	5320.08	80000	15.04	25	Pass
0C 20V	ax20	5320	Ant2	5320.08	80000	15.04	25	Pass
10C 20V	ax20	5320	Ant2	5320.08	80000	15.04	25	Pass
20C 20V	ax20	5320	Ant2	5320.08	80000	15.04	25	Pass
30C 9V	ax20	5500	Ant2	5500.08	80000	14.55	25	Pass
30C 20V	ax20	5500	Ant2	5500.1	100000	18.18	25	Pass
0C 20V	ax20	5500	Ant2	5500.14	140000	25.45	25	Pass
10C 20V	ax20	5500	Ant2	5500.08	80000	14.55	25	Pass
20C 20V	ax20	5500	Ant2	5500.1	100000	18.18	25	Pass
30C 9V	ax20	5600	Ant2	5600.08	80000	14.29	25	Pass
30C 20V	ax20	5600	Ant2	5600.08	80000	14.29	25	Pass
0C 20V	ax20	5600	Ant2	5600.08	80000	14.29	25	Pass
10C 20V	ax20	5600	Ant2	5600.08	80000	14.29	25	Pass
20C 20V	ax20	5600	Ant2	5600.08	80000	14.29	25	Pass
30C 9V	ax20	5700	Ant2	5700.08	80000	14.04	25	Pass
30C 20V	ax20	5700	Ant2	5700.08	80000	14.04	25	Pass
0C 20V	ax20	5700	Ant2	5700.08	80000	14.04	25	Pass
10C 20V	ax20	5700	Ant2	5700.08	80000	14.04	25	Pass
20C 20V	ax20	5700	Ant2	5700.08	80000	14.04	25	Pass
30C 9V	ax20	5745	Ant2	5745.12	120000	20.89	25	Pass
30C 20V	ax20	5745	Ant2	5745.12	120000	20.89	25	Pass
0C 20V	ax20	5745	Ant2	5745.1	100000	17.41	25	Pass
10C 20V	ax20	5745	Ant2	5745.08	80000	13.93	25	Pass
20C 20V	ax20	5745	Ant2	5745.12	120000	20.89	25	Pass
30C 9V	ax20	5785	Ant2	5785.1	100000	17.29	25	Pass
30C 20V	ax20	5785	Ant2	5785.1	100000	17.29	25	Pass
0C 20V	ax20	5785	Ant2	5785.06	60000	10.37	25	Pass
10C 20V	ax20	5785	Ant2	5785.08	80000	13.83	25	Pass