



Band2-3MHz-QPSK-18615-1RB#14



Band2-3MHz-QPSK-18615-15RB#0



Band2-3MHz-QPSK-19185-1RB#0

Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.
Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com




Hotline
400-003-0500
www.anbotek.com.cn





Band2-3MHz-QPSK-19185-1RB#14

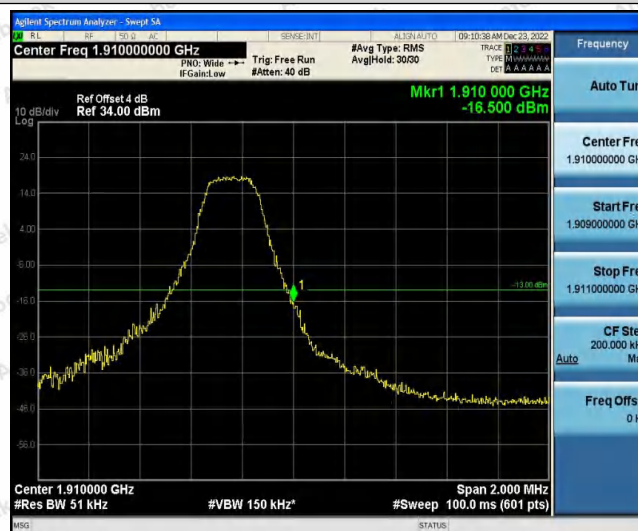

Band2-3MHz-QPSK-19185-15RB#0



Band2-3MHz-16QAM-18615-1RB#0


Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.
Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com



Hotline
400-003-0500
www.anbotek.com.cn



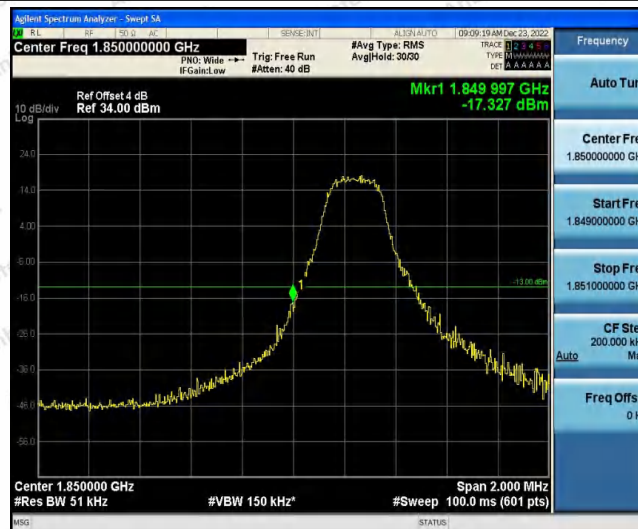

Band2-3MHz-16QAM-18615-1RB#14



Band2-3MHz-16QAM-18615-15RB#0



Band2-3MHz-16QAM-19185-1RB#0

Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.
Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com




Hotline
400-003-0500
www.anbotek.com.cn





Band2-3MHz-16QAM-19185-1RB#14

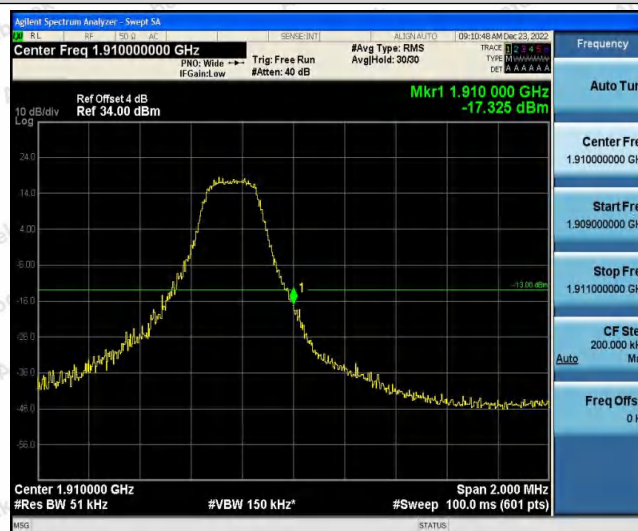

Band2-3MHz-16QAM-19185-15RB#0



Band2-5MHz-QPSK-18625-1RB#0

Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.
Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com



Hotline
400-003-0500
www.anbotek.com.cn





Band2-5MHz-QPSK-18625-1RB#24



Band2-5MHz-QPSK-18625-25RB#0



Band2-5MHz-QPSK-19175-1RB#0

Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.
Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com




Hotline
400-003-0500
www.anbotek.com.cn





Band2-5MHz-QPSK-19175-1RB#24

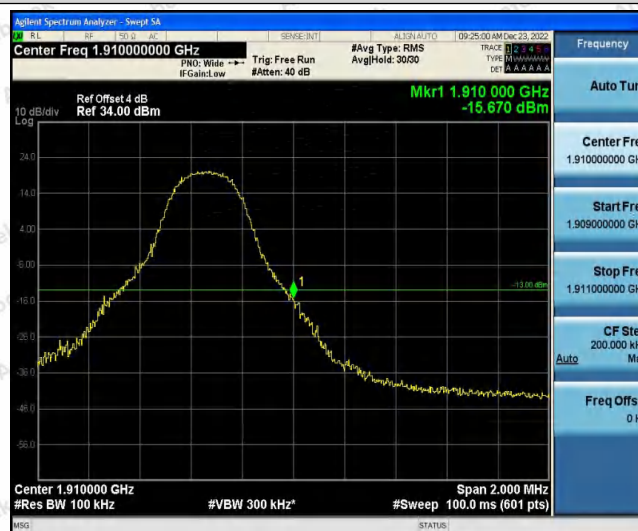

Band2-5MHz-QPSK-19175-25RB#0



Band2-5MHz-16QAM-18625-1RB#0


Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.
Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com



Hotline
400-003-0500
www.anbotek.com.cn



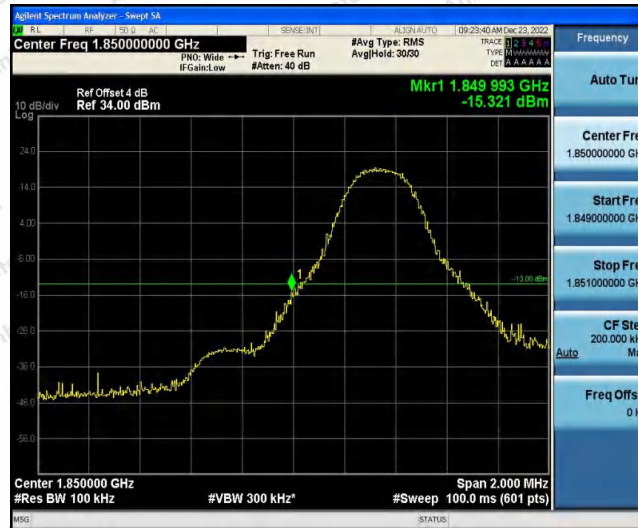

Band2-5MHz-16QAM-18625-1RB#24



Band2-5MHz-16QAM-18625-25RB#0



Band2-5MHz-16QAM-19175-1RB#0

Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.
Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com




Hotline
400-003-0500
www.anbotek.com.cn





Band2-5MHz-16QAM-19175-1RB#24

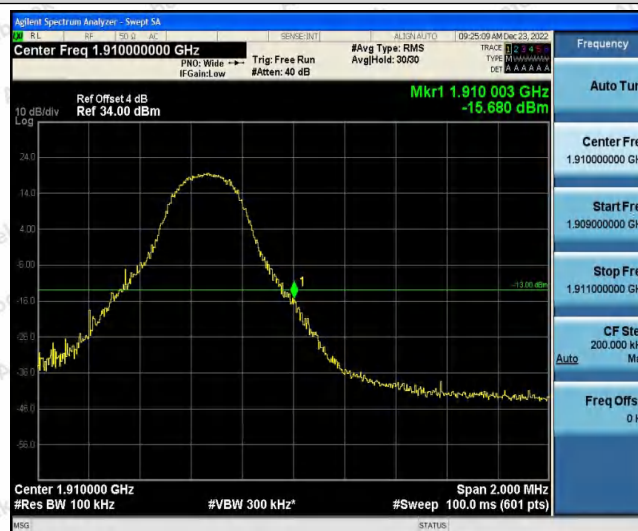

Band2-5MHz-16QAM-19175-25RB#0



Band2-10MHz-QPSK-18650-1RB#0

Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.
Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com



Hotline
400-003-0500
www.anbotek.com.cn





Band2-10MHz-QPSK-18650-1RB#49



Band2-10MHz-QPSK-18650-50RB#0



Band2-10MHz-QPSK-19150-1RB#0

Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.
Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com



Hotline
400-003-0500
www.anbotek.com.cn





Band2-10MHz-QPSK-19150-1RB#49



Band2-10MHz-QPSK-19150-50RB#0



Band2-10MHz-16QAM-18650-1RB#0

Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.
Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com



Hotline
400-003-0500
www.anbotek.com.cn





Band2-10MHz-16QAM-18650-1RB#49



Band2-10MHz-16QAM-18650-50RB#0



Band2-10MHz-16QAM-19150-1RB#0





Band2-10MHz-16QAM-19150-1RB#49



Band2-10MHz-16QAM-19150-50RB#0



Band2-15MHz-QPSK-18675-1RB#0





Band2-15MHz-QPSK-18675-1RB#74



Band2-15MHz-QPSK-18675-75RB#0



Band2-15MHz-QPSK-19125-1RB#0

Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.
Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com

Hotline 400-003-0500
www.anbotek.com.cn





Band2-15MHz-QPSK-19125-1RB#74



Band2-15MHz-QPSK-19125-75RB#0



Band2-15MHz-16QAM-18675-1RB#0

Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.
Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com




Hotline
400-003-0500
www.anbotek.com.cn





Band2-15MHz-16QAM-18675-1RB#74

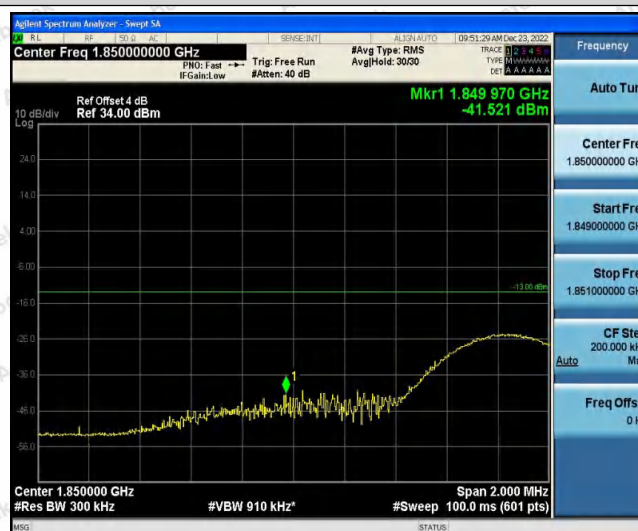

Band2-15MHz-16QAM-18675-75RB#0



Band2-15MHz-16QAM-19125-1RB#0

Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.
Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com



Hotline
400-003-0500
www.anbotek.com.cn





Band2-15MHz-16QAM-19125-1RB#74



Band2-15MHz-16QAM-19125-75RB#0



Band2-20MHz-QPSK-18700-1RB#0





Band2-20MHz-QPSK-18700-1RB#99



Band2-20MHz-QPSK-18700-100RB#0



Band2-20MHz-QPSK-19100-1RB#0


Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.
Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com



Hotline
400-003-0500
www.anbotek.com.cn



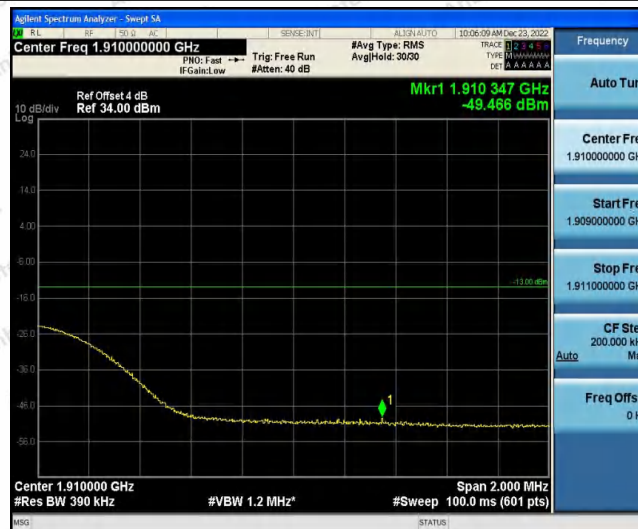

Band2-20MHz-QPSK-19100-1RB#99



Band2-20MHz-QPSK-19100-100RB#0



Band2-20MHz-16QAM-18700-1RB#0

Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community,
Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.
Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com



Hotline
400-003-0500
www.anbotek.com.cn





Band2-20MHz-16QAM-18700-1RB#99



Band2-20MHz-16QAM-18700-100RB#0



Band2-20MHz-16QAM-19100-1RB#0

Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.
Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com



Hotline
400-003-0500
www.anbotek.com.cn





Band2-20MHz-16QAM-19100-1RB#99



Band2-20MHz-16QAM-19100-100RB#0



Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community,
Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.
Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com



Hotline
400-003-0500
www.anbotek.com.cn



Appendix E: Conducted Spurious Emission

Test Result

Band	Bandwidth	Modulation	Channel	RB Configuration	Frequency Range	Result (dBm)	Verdict
Band2	1.4MHz	QPSK	18607	1RB#0	Range1:30~1000MHz	-56.62	PASS
Band2	1.4MHz	QPSK	18607	1RB#0	Range2:1000~20000MHz	-32.85	PASS
Band2	1.4MHz	QPSK	18900	1RB#0	Range1:30~1000MHz	-56.95	PASS
Band2	1.4MHz	QPSK	18900	1RB#0	Range2:1000~20000MHz	-33.03	PASS
Band2	1.4MHz	QPSK	19193	1RB#0	Range1:30~1000MHz	-56.25	PASS
Band2	1.4MHz	QPSK	19193	1RB#0	Range2:1000~20000MHz	-32.88	PASS
Band2	1.4MHz	16QAM	18607	1RB#0	Range1:30~1000MHz	-57.24	PASS
Band2	1.4MHz	16QAM	18607	1RB#0	Range2:1000~20000MHz	-33.04	PASS
Band2	1.4MHz	16QAM	18900	1RB#0	Range1:30~1000MHz	-56.71	PASS
Band2	1.4MHz	16QAM	18900	1RB#0	Range2:1000~20000MHz	-32.62	PASS
Band2	1.4MHz	16QAM	19193	1RB#0	Range1:30~1000MHz	-57.4	PASS
Band2	1.4MHz	16QAM	19193	1RB#0	Range2:1000~20000MHz	-33.49	PASS
Band2	3MHz	QPSK	18615	1RB#0	Range1:30~1000MHz	-56.32	PASS
Band2	3MHz	QPSK	18615	1RB#0	Range2:1000~20000MHz	-34	PASS
Band2	3MHz	QPSK	18900	1RB#0	Range1:30~1000MHz	-57.43	PASS
Band2	3MHz	QPSK	18900	1RB#0	Range2:1000~20000MHz	-33.24	PASS
Band2	3MHz	QPSK	19185	1RB#0	Range1:30~1000MHz	-56.94	PASS
Band2	3MHz	QPSK	19185	1RB#0	Range2:1000~20000MHz	-33.06	PASS

Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.
Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com



Hotline
400-003-0500
www.anbotek.com.cn



					20000MHz		
Band2	3MHz	16QAM	18615	1RB#0	Range1:30~1000MHz	-57.45	PASS
Band2	3MHz	16QAM	18615	1RB#0	Range2:1000~20000MHz	-33.26	PASS
Band2	3MHz	16QAM	18900	1RB#0	Range1:30~1000MHz	-57.03	PASS
Band2	3MHz	16QAM	18900	1RB#0	Range2:1000~20000MHz	-33.67	PASS
Band2	3MHz	16QAM	19185	1RB#0	Range1:30~1000MHz	-55.98	PASS
Band2	3MHz	16QAM	19185	1RB#0	Range2:1000~20000MHz	-32.91	PASS
Band2	5MHz	QPSK	18625	1RB#0	Range1:30~1000MHz	-57.11	PASS
Band2	5MHz	QPSK	18625	1RB#0	Range2:1000~20000MHz	-33.31	PASS
Band2	5MHz	QPSK	18900	1RB#0	Range1:30~1000MHz	-57.17	PASS
Band2	5MHz	QPSK	18900	1RB#0	Range2:1000~20000MHz	-33.33	PASS
Band2	5MHz	QPSK	19175	1RB#0	Range1:30~1000MHz	-56.12	PASS
Band2	5MHz	QPSK	19175	1RB#0	Range2:1000~20000MHz	-33.35	PASS
Band2	5MHz	16QAM	18625	1RB#0	Range1:30~1000MHz	-57.67	PASS
Band2	5MHz	16QAM	18625	1RB#0	Range2:1000~20000MHz	-32.94	PASS
Band2	5MHz	16QAM	18900	1RB#0	Range1:30~1000MHz	-57.2	PASS
Band2	5MHz	16QAM	18900	1RB#0	Range2:1000~20000MHz	-33.35	PASS
Band2	5MHz	16QAM	19175	1RB#0	Range1:30~1000MHz	-57.4	PASS
Band2	5MHz	16QAM	19175	1RB#0	Range2:1000~20000MHz	-33.51	PASS
Band2	10MHz	QPSK	18650	1RB#0	Range1:30~1000MHz	-56.98	PASS
Band2	10MHz	QPSK	18650	1RB#0	Range2:1000~20000MHz	-33.52	PASS
Band2	10MHz	QPSK	18900	1RB#0	Range1:30~1000MHz	-57.69	PASS

Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.
 Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com



Hotline

400-003-0500

www.anbotek.com.cn



Band2	10MHz	QPSK	18900	1RB#0	Range2:1000~20000MHz	-33.39	PASS
Band2	10MHz	QPSK	19150	1RB#0	Range1:30~1000MHz	-56.54	PASS
Band2	10MHz	QPSK	19150	1RB#0	Range2:1000~20000MHz	-32.81	PASS
Band2	10MHz	16QAM	18650	1RB#0	Range1:30~1000MHz	-56.47	PASS
Band2	10MHz	16QAM	18650	1RB#0	Range2:1000~20000MHz	-33.49	PASS
Band2	10MHz	16QAM	18900	1RB#0	Range1:30~1000MHz	-57.07	PASS
Band2	10MHz	16QAM	18900	1RB#0	Range2:1000~20000MHz	-32.87	PASS
Band2	10MHz	16QAM	19150	1RB#0	Range1:30~1000MHz	-56.74	PASS
Band2	10MHz	16QAM	19150	1RB#0	Range2:1000~20000MHz	-33.05	PASS
Band2	15MHz	QPSK	18675	1RB#0	Range1:30~1000MHz	-56.94	PASS
Band2	15MHz	QPSK	18675	1RB#0	Range2:1000~20000MHz	-33.08	PASS
Band2	15MHz	QPSK	18900	1RB#0	Range1:30~1000MHz	-57.52	PASS
Band2	15MHz	QPSK	18900	1RB#0	Range2:1000~20000MHz	-32.84	PASS
Band2	15MHz	QPSK	19125	1RB#0	Range1:30~1000MHz	-57.42	PASS
Band2	15MHz	QPSK	19125	1RB#0	Range2:1000~20000MHz	-33.18	PASS
Band2	15MHz	16QAM	18675	1RB#0	Range1:30~1000MHz	-57.45	PASS
Band2	15MHz	16QAM	18675	1RB#0	Range2:1000~20000MHz	-33.56	PASS
Band2	15MHz	16QAM	18900	1RB#0	Range1:30~1000MHz	-57.06	PASS
Band2	15MHz	16QAM	18900	1RB#0	Range2:1000~20000MHz	-33.25	PASS
Band2	15MHz	16QAM	19125	1RB#0	Range1:30~1000MHz	-55.98	PASS
Band2	15MHz	16QAM	19125	1RB#0	Range2:1000~20000MHz	-33.53	PASS
Band2	20MHz	QPSK	18700	1RB#0	Range1:30~1000MHz	-56.89	PASS

Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.
 Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com



Hotline
 400-003-0500
 www.anbotek.com.cn



					00MHz		
Band2	20MHz	QPSK	18700	1RB#0	Range2:1000~20000MHz	-33.13	PASS
Band2	20MHz	QPSK	18900	1RB#0	Range1:30~1000MHz	-56.67	PASS
Band2	20MHz	QPSK	18900	1RB#0	Range2:1000~20000MHz	-32.72	PASS
Band2	20MHz	QPSK	19100	1RB#0	Range1:30~1000MHz	-57.55	PASS
Band2	20MHz	QPSK	19100	1RB#0	Range2:1000~20000MHz	-33.23	PASS
Band2	20MHz	16QAM	18700	1RB#0	Range1:30~1000MHz	-57.59	PASS
Band2	20MHz	16QAM	18700	1RB#0	Range2:1000~20000MHz	-33.66	PASS
Band2	20MHz	16QAM	18900	1RB#0	Range1:30~1000MHz	-57.42	PASS
Band2	20MHz	16QAM	18900	1RB#0	Range2:1000~20000MHz	-33.29	PASS
Band2	20MHz	16QAM	19100	1RB#0	Range1:30~1000MHz	-57.12	PASS
Band2	20MHz	16QAM	19100	1RB#0	Range2:1000~20000MHz	-32.64	PASS

Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.
 Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com




Hotline
 400-003-0500
www.anbotek.com.cn




Test Graphs


Band2-1.4MHz-QPSK-18607-1RB#0-Range1:30~1000MHz

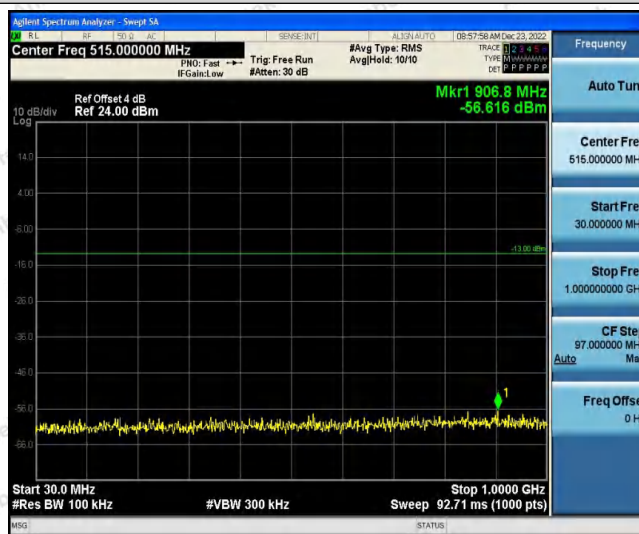

Band2-1.4MHz-QPSK-18607-1RB#0-Range2:1000~20000MHz

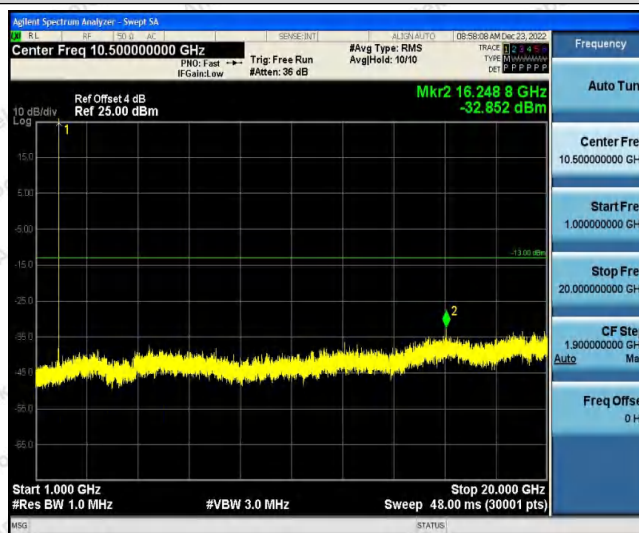

Band2-1.4MHz-QPSK-18900-1RB#0-Range1:30~1000MHz

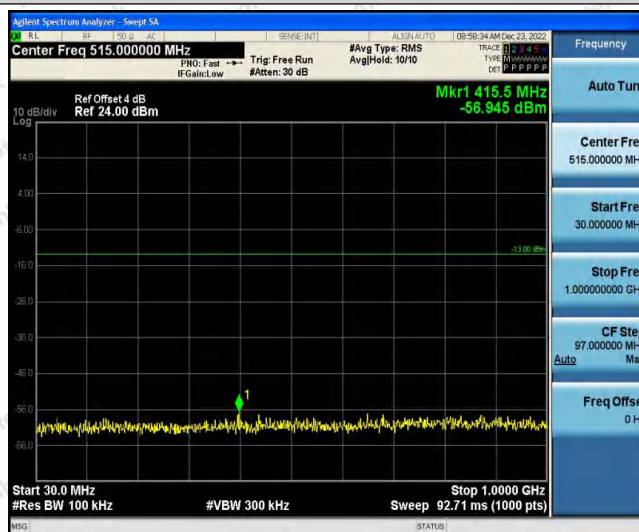

Shenzhen Anbotek Compliance Laboratory Limited


Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.
Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com




Hotline
400-003-0500
www.anbotek.com.cn




Band2-1.4MHz-QPSK-18900-1RB#0-Range2:1000~20000MHz

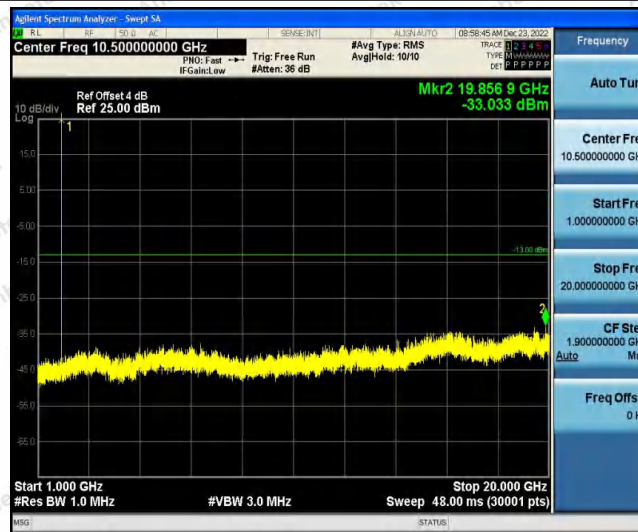

Band2-1.4MHz-QPSK-19193-1RB#0-Range1:30~1000MHz

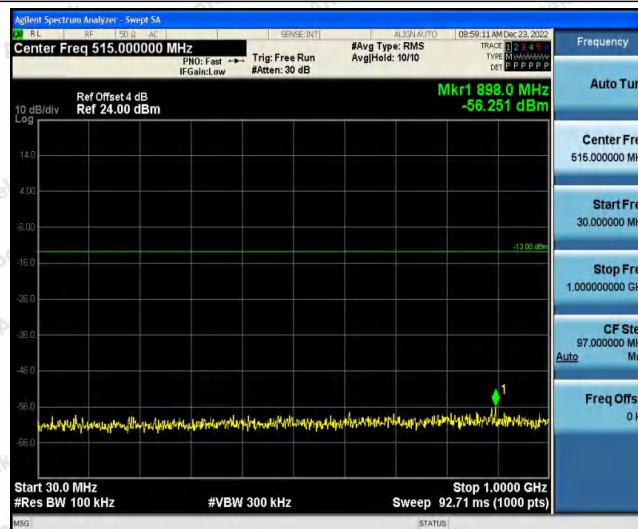

Band2-1.4MHz-QPSK-19193-1RB#0-Range2:1000~20000MHz

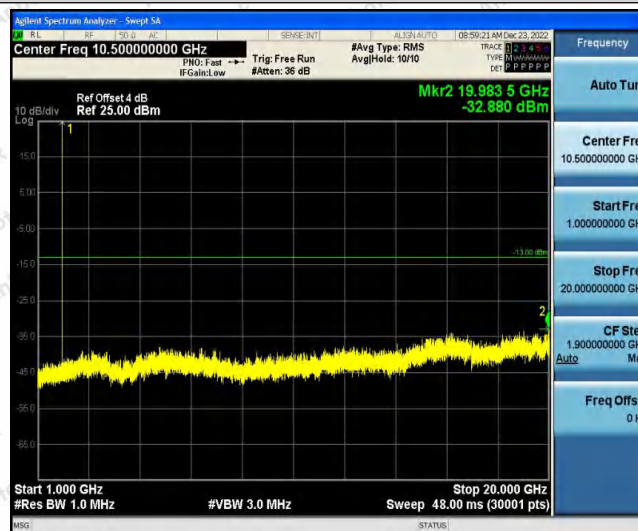

Band2-1.4MHz-16QAM-18607-1RB#0-Range1:30~1000MHz


Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community,
Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.
Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com




Hotline
400-003-0500
www.anbotek.com.cn




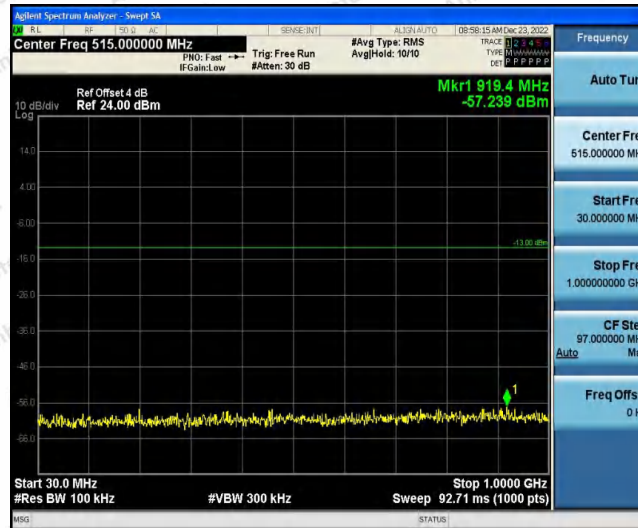

Band2-1.4MHz-16QAM-18607-1RB#0-Range2:1000~20000MHz

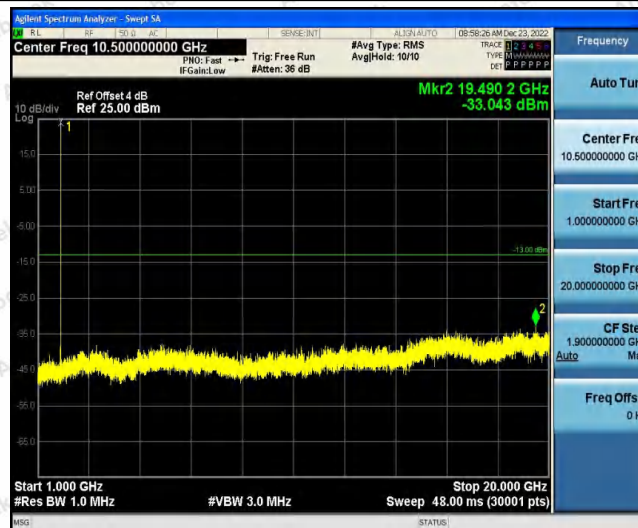

Band2-1.4MHz-16QAM-18900-1RB#0-Range1:30~1000MHz

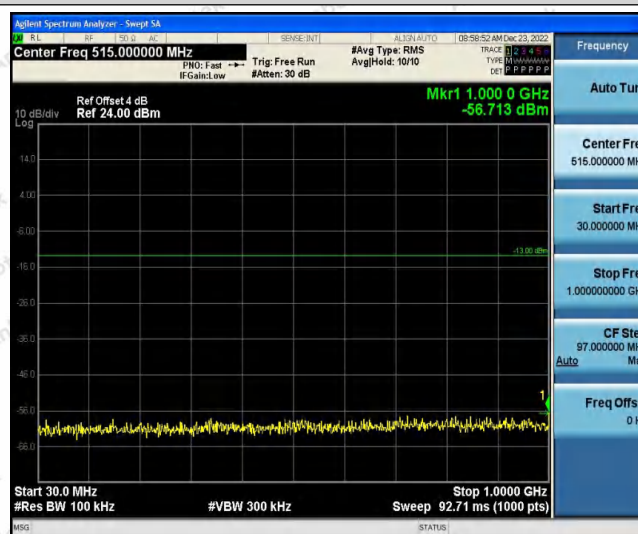

Band2-1.4MHz-16QAM-18900-1RB#0-Range2:1000~20000MHz


Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.
Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com




Hotline
400-003-0500
www.anbotek.com.cn




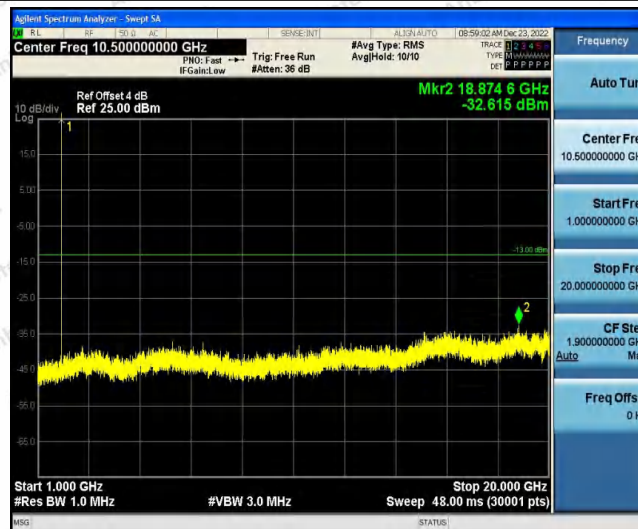

Band2-1.4MHz-16QAM-19193-1RB#0-Range1:30~1000MHz

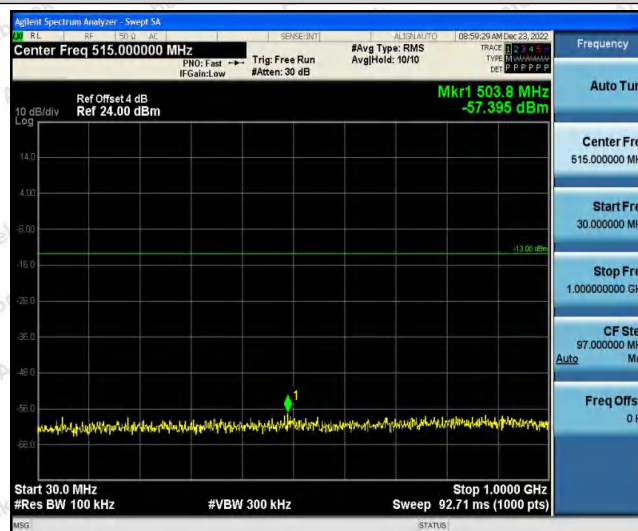

Band2-1.4MHz-16QAM-19193-1RB#0-Range2:1000~20000MHz

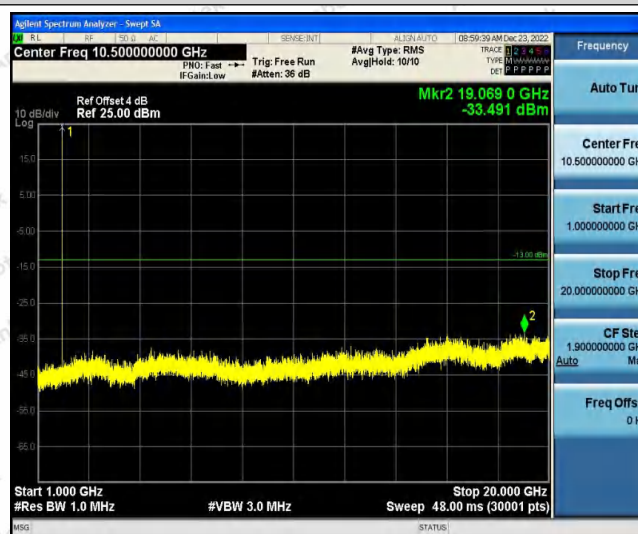

Band2-3MHz-QPSK-18615-1RB#0-Range1:30~1000MHz


Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.
Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com



Hotline
400-003-0500
www.anbotek.com.cn




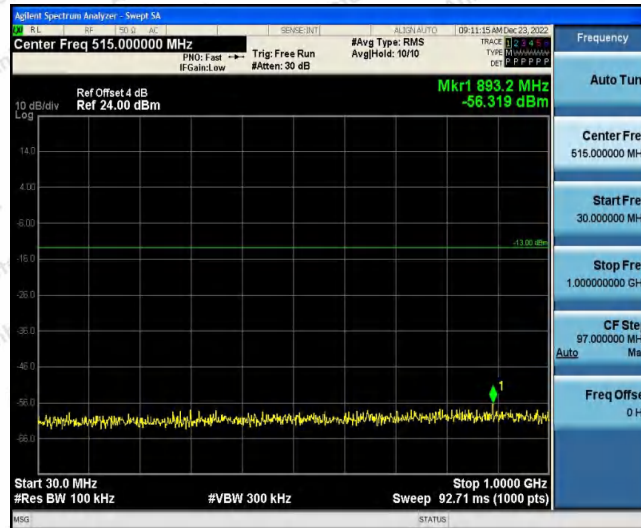

Band2-3MHz-QPSK-18615-1RB#0-Range2:1000~20000MHz



Band2-3MHz-QPSK-18900-1RB#0-Range1:30~1000MHz

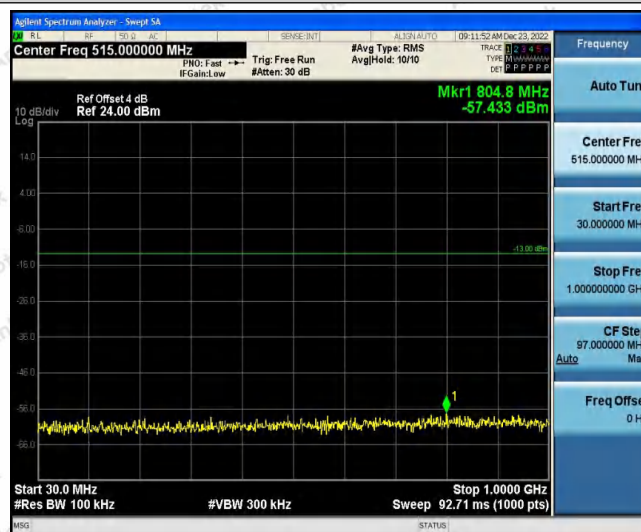


Band2-3MHz-QPSK-18900-1RB#0-Range2:1000~20000MHz






Band2-3MHz-QPSK-19185-1RB#0-Range1:30~1000MHz

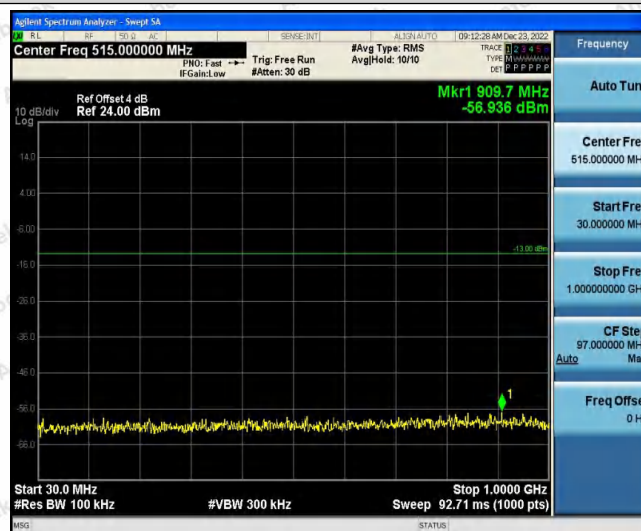

Band2-3MHz-QPSK-19185-1RB#0-Range2:1000~20000MHz

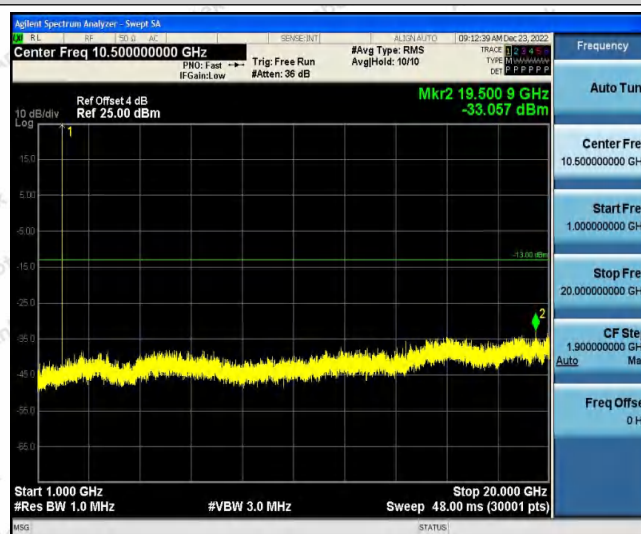

Band2-3MHz-16QAM-18615-1RB#0-Range1:30~1000MHz


Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.
Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com




Hotline
400-003-0500
www.anbotek.com.cn




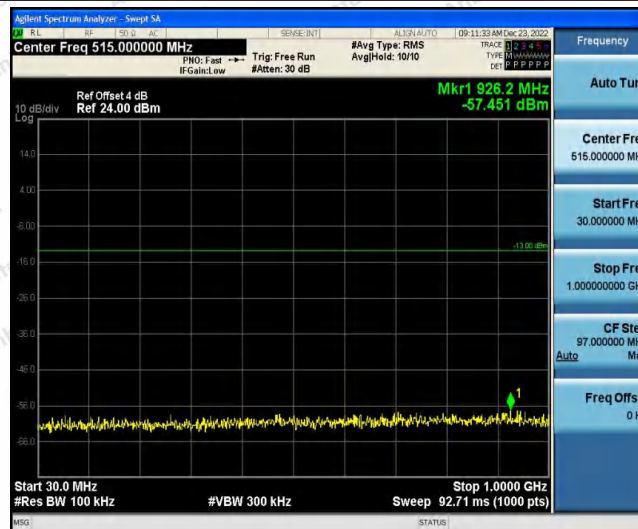

Band2-3MHz-16QAM-18615-1RB#0-Range2:1000~20000MHz

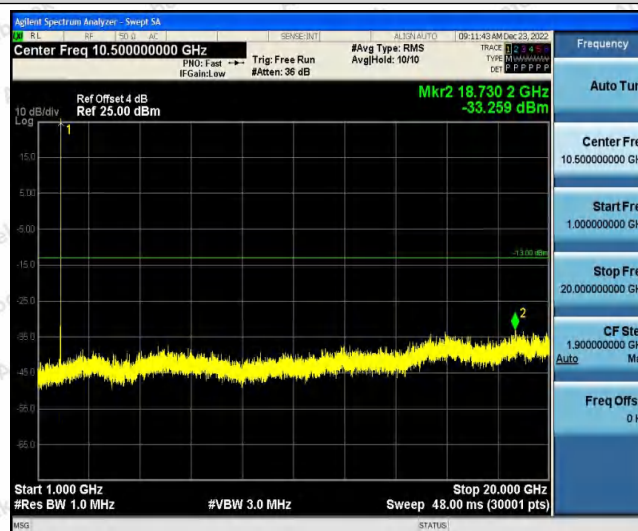

Band2-3MHz-16QAM-18900-1RB#0-Range1:30~1000MHz

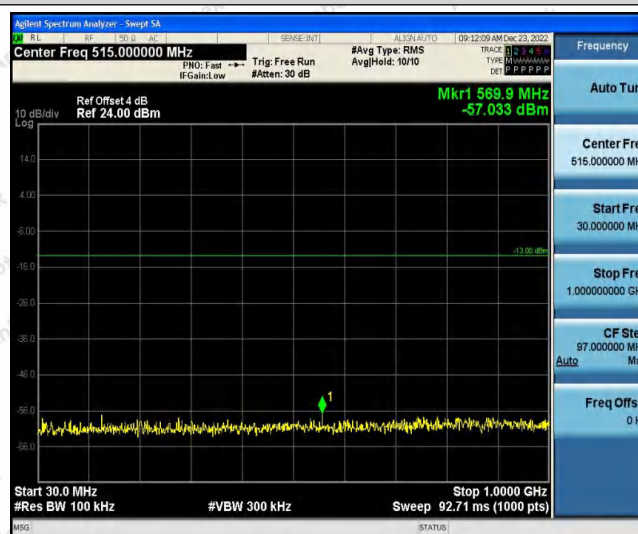


Band2-3MHz-16QAM-18900-1RB#0-Range2:1000~20000MHz






Band2-3MHz-16QAM-19185-1RB#0-Range1:30~1000MHz

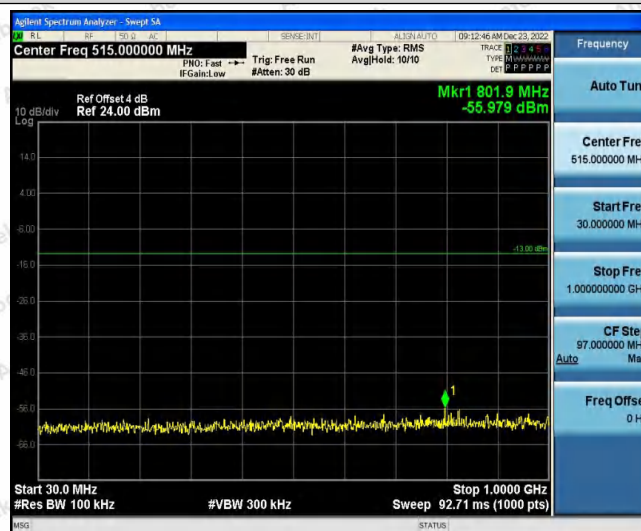

Band2-3MHz-16QAM-19185-1RB#0-Range2:1000~20000MHz

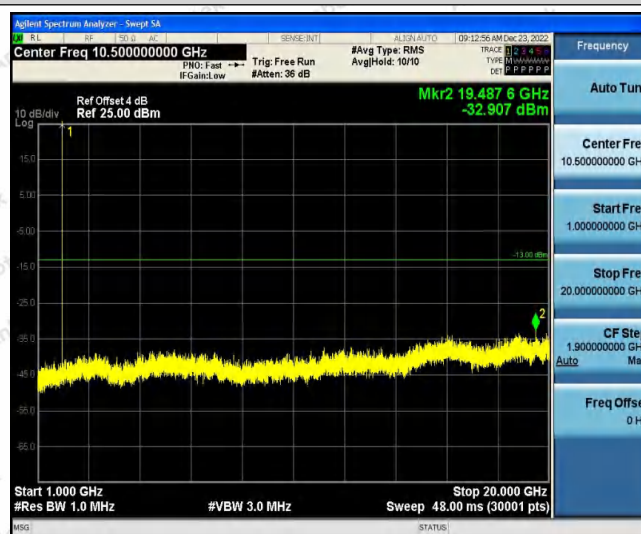

Band2-5MHz-QPSK-18625-1RB#0-Range1:30~1000MHz


Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.
Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com




Hotline
400-003-0500
www.anbotek.com.cn




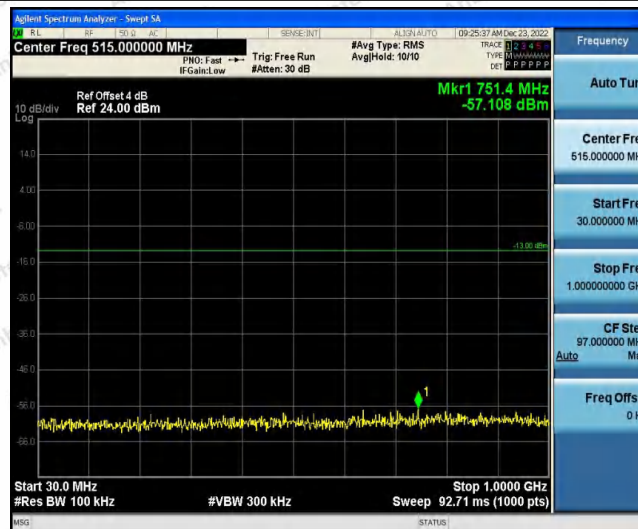

Band2-5MHz-QPSK-18625-1RB#0-Range2:1000~20000MHz

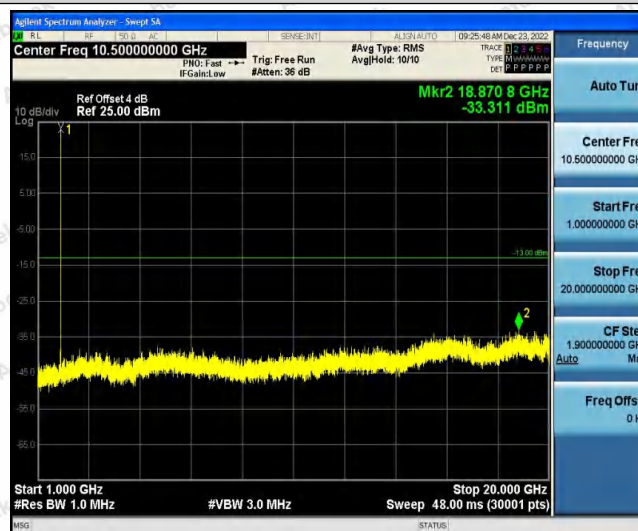

Band2-5MHz-QPSK-18900-1RB#0-Range1:30~1000MHz

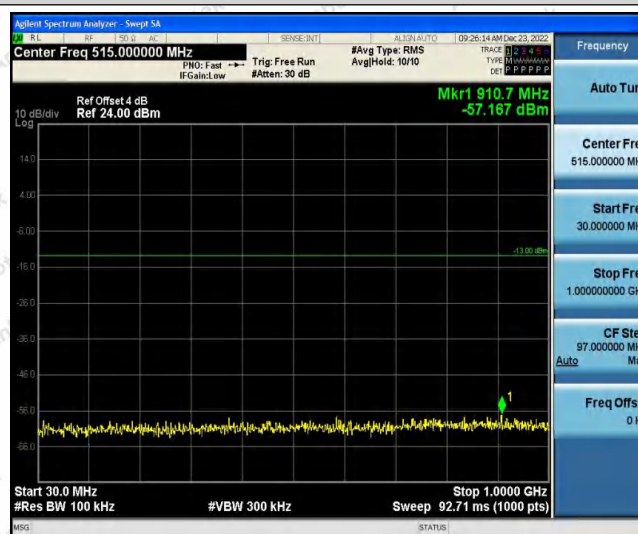

Band2-5MHz-QPSK-18900-1RB#0-Range2:1000~20000MHz


Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.
Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com




Hotline
400-003-0500
www.anbotek.com.cn




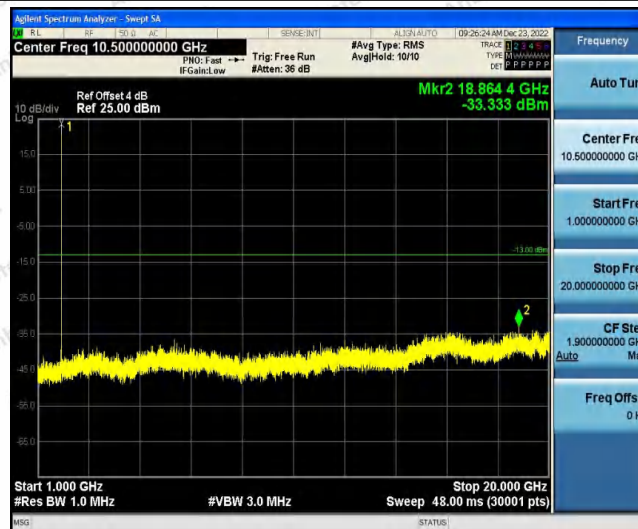

Band2-5MHz-QPSK-19175-1RB#0-Range1:30~1000MHz

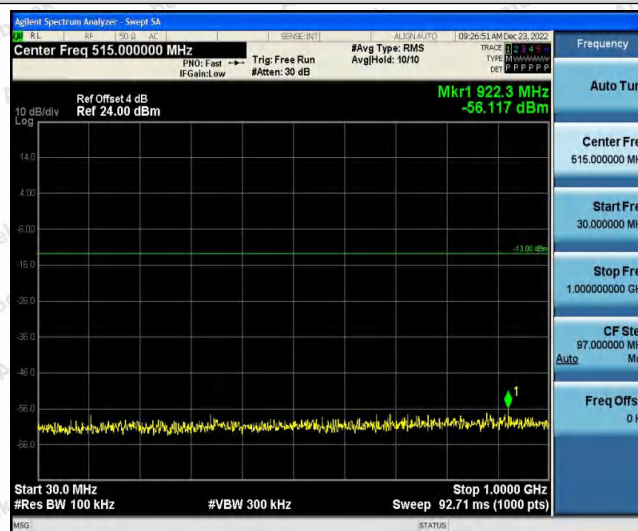

Band2-5MHz-QPSK-19175-1RB#0-Range2:1000~20000MHz

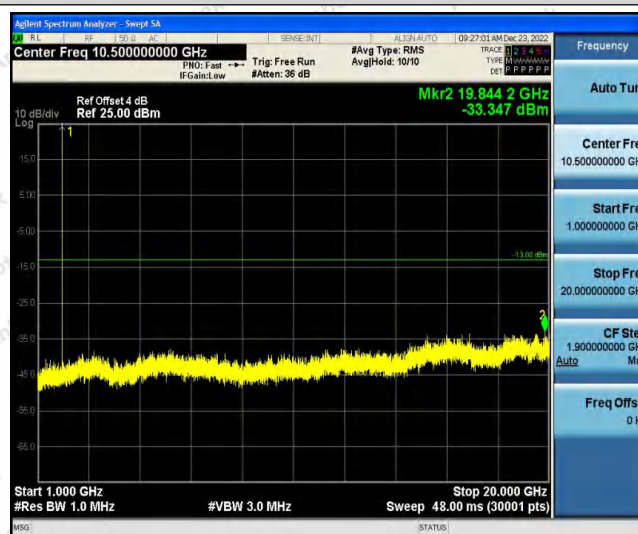

Band2-5MHz-16QAM-18625-1RB#0-Range1:30~1000MHz


Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.
Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com




Hotline
400-003-0500
www.anbotek.com.cn




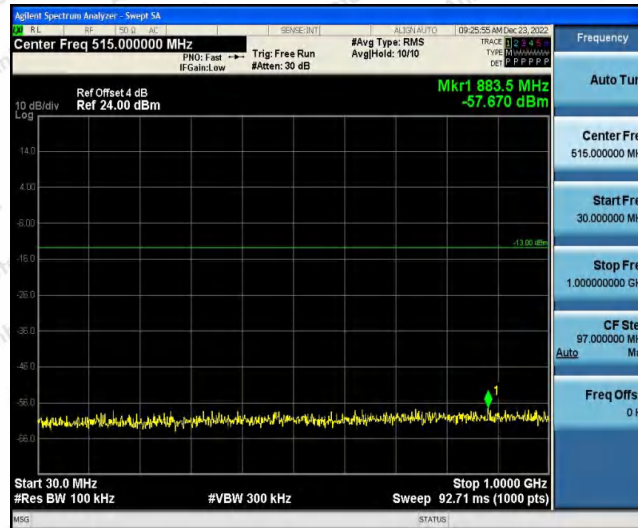

Band2-5MHz-16QAM-18625-1RB#0-Range2:1000~20000MHz

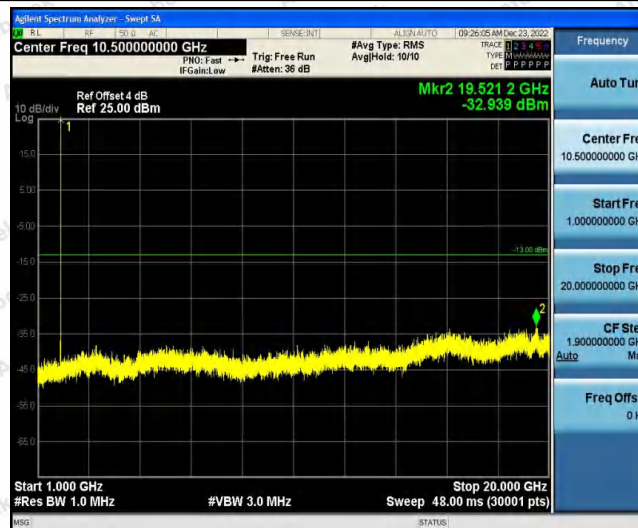


Band2-5MHz-16QAM-18900-1RB#0-Range1:30~1000MHz

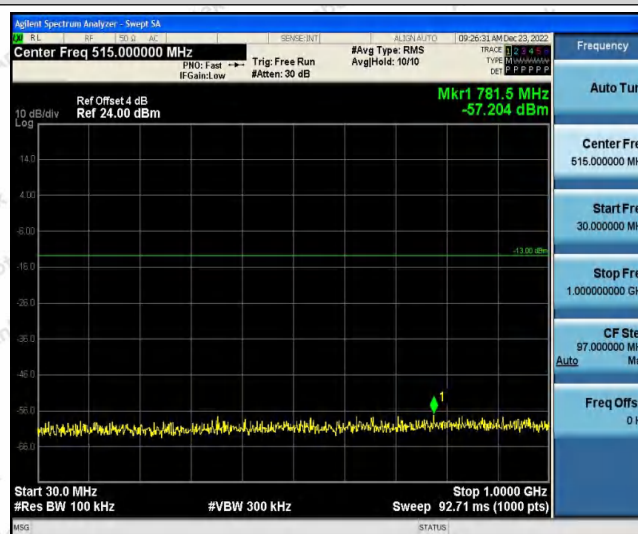


Band2-5MHz-16QAM-18900-1RB#0-Range2:1000~20000MHz




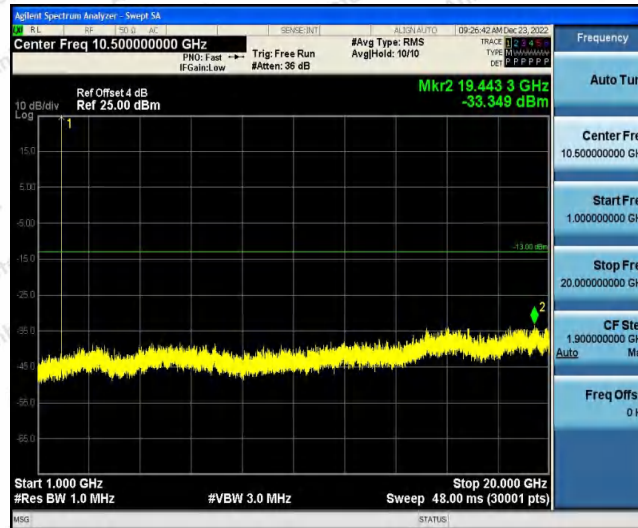

Band2-5MHz-16QAM-19175-1RB#0-Range1:30~1000MHz

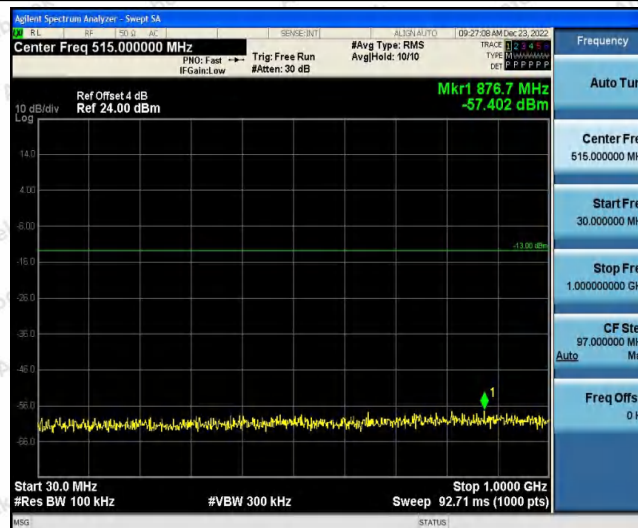

Band2-5MHz-16QAM-19175-1RB#0-Range2:1000~20000MHz

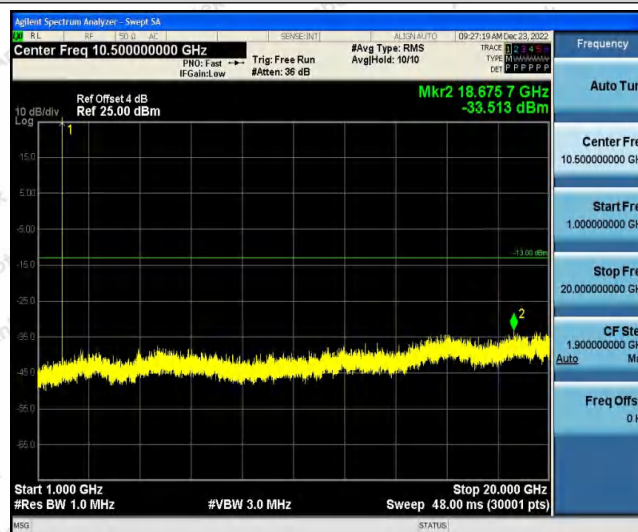

Band2-10MHz-QPSK-18650-1RB#0-Range1:30~1000MHz


Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.
Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com




Hotline
400-003-0500
www.anbotek.com.cn




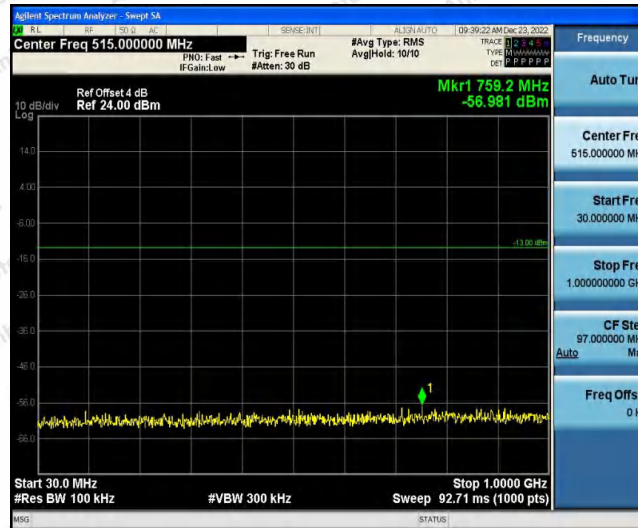

Band2-10MHz-QPSK-18650-1RB#0-Range2:1000~20000MHz

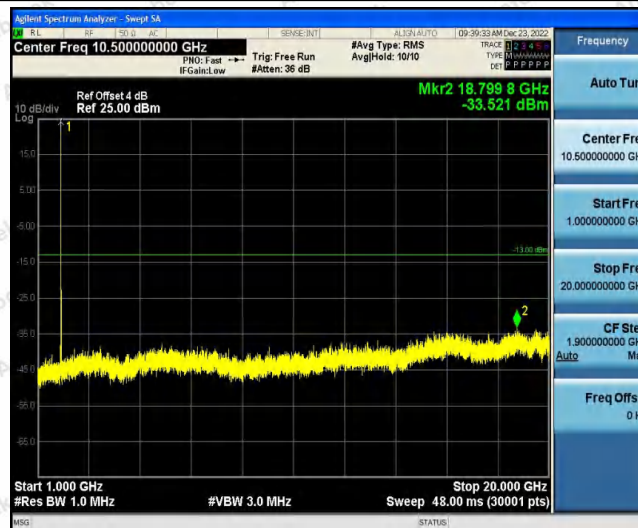


Band2-10MHz-QPSK-18900-1RB#0-Range1:30~1000MHz

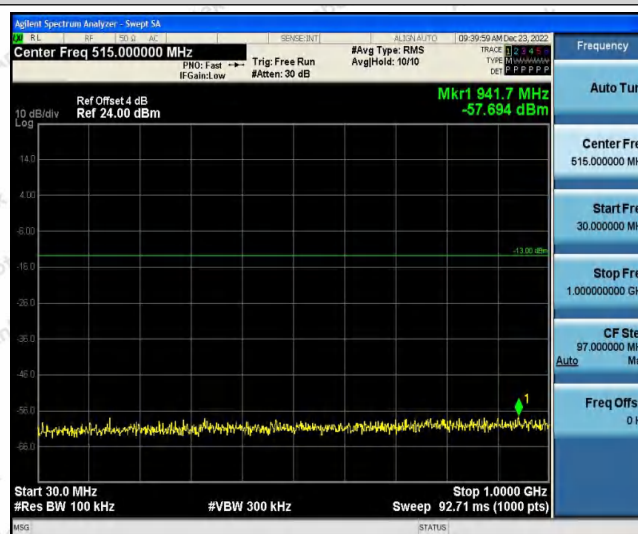


Band2-10MHz-QPSK-18900-1RB#0-Range2:1000~20000MHz




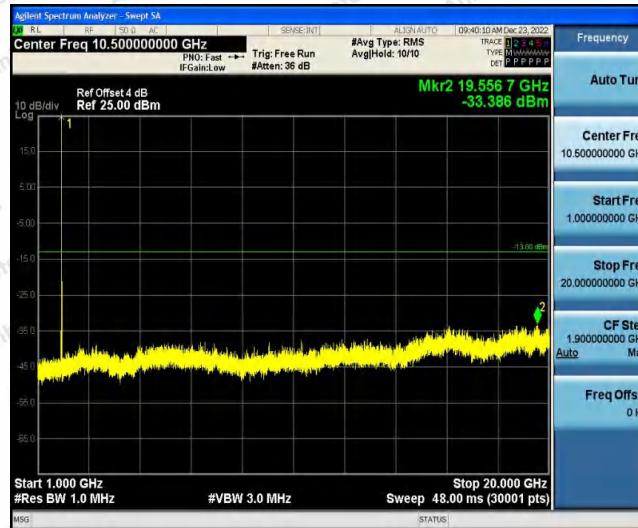

Band2-10MHz-QPSK-19150-1RB#0-Range1:30~1000MHz

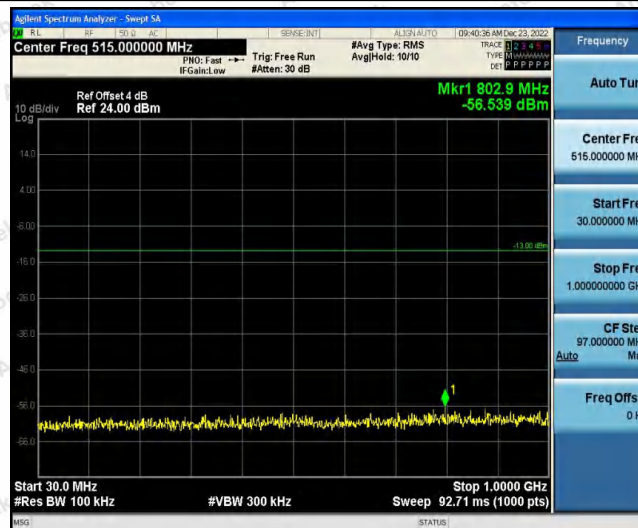

Band2-10MHz-QPSK-19150-1RB#0-Range2:1000~20000MHz

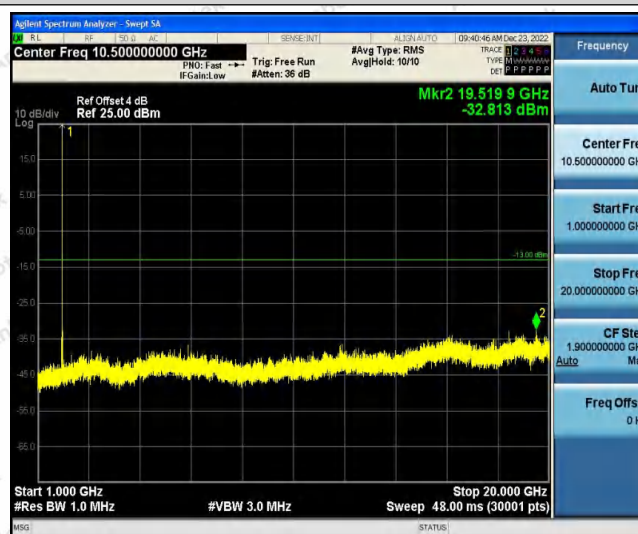

Band2-10MHz-16QAM-18650-1RB#0-Range1:30~1000MHz


Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.
Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com




Hotline
400-003-0500
www.anbotek.com.cn




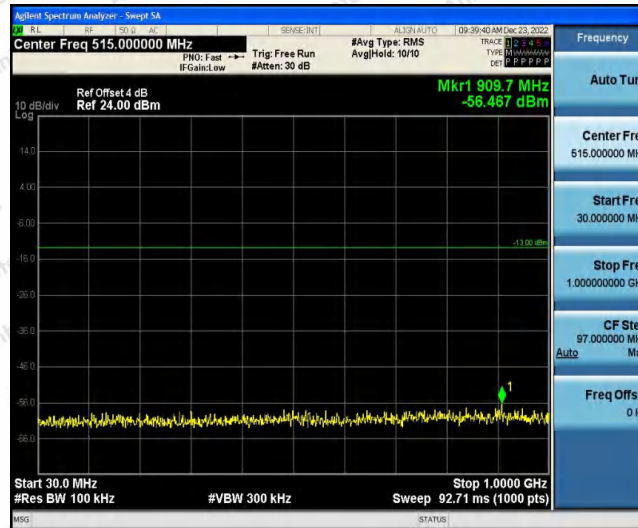

Band2-10MHz-16QAM-18650-1RB#0-Range2:1000~20000MHz

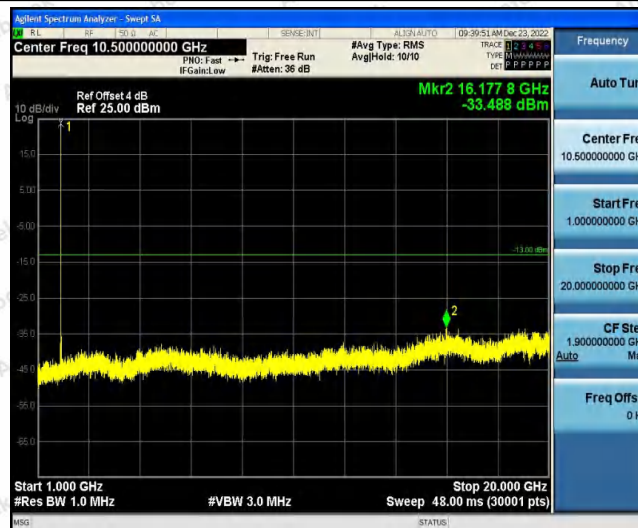

Band2-10MHz-16QAM-18900-1RB#0-Range1:30~1000MHz

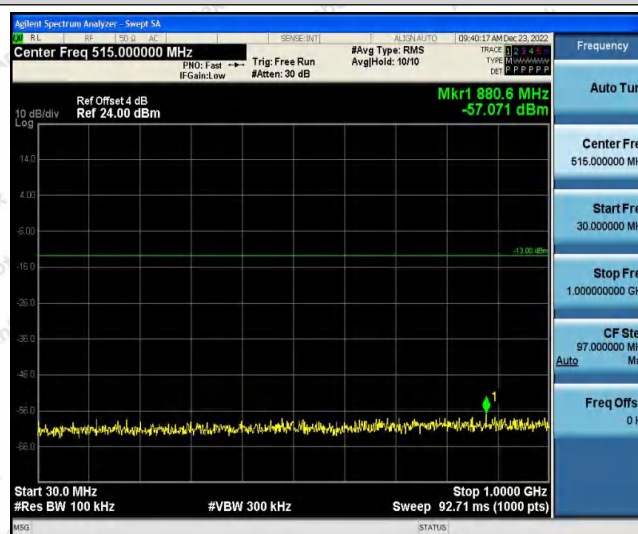


Band2-10MHz-16QAM-18900-1RB#0-Range2:1000~20000MHz

Shenzhen Anbotek Compliance Laboratory Limited


Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.
Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com

Hotline
400-003-0500
www.anbotek.com.cn




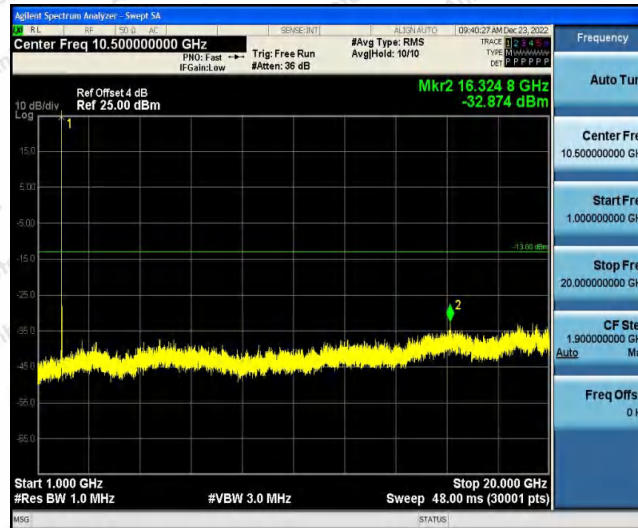

Band2-10MHz-16QAM-19150-1RB#0-Range1:30~1000MHz

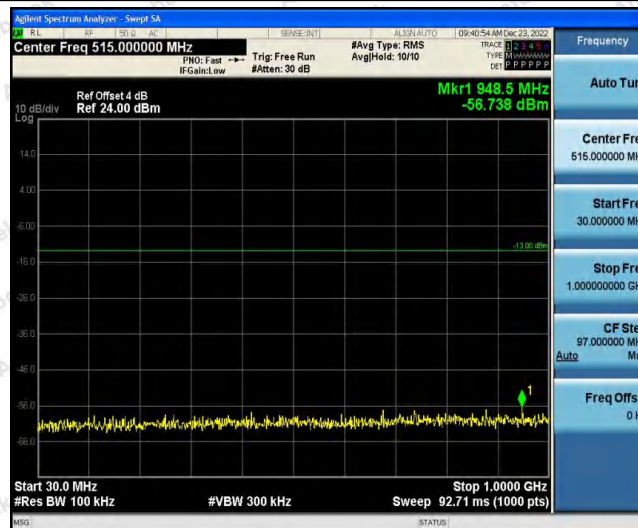

Band2-10MHz-16QAM-19150-1RB#0-Range2:1000~20000MHz

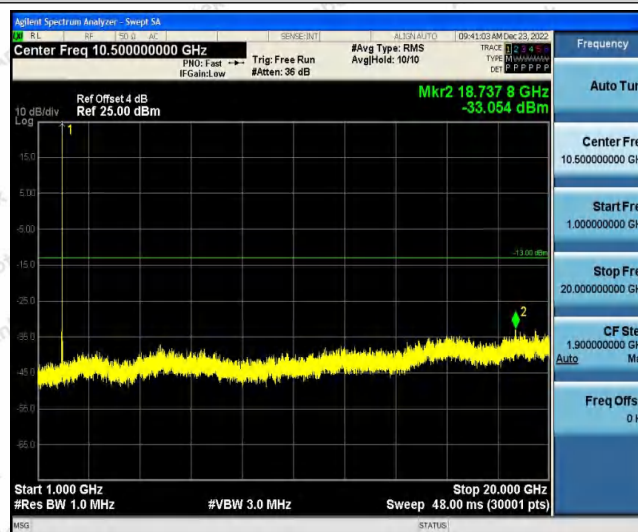

Band2-15MHz-QPSK-18675-1RB#0-Range1:30~1000MHz


Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.
Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com




Hotline
400-003-0500
www.anbotek.com.cn




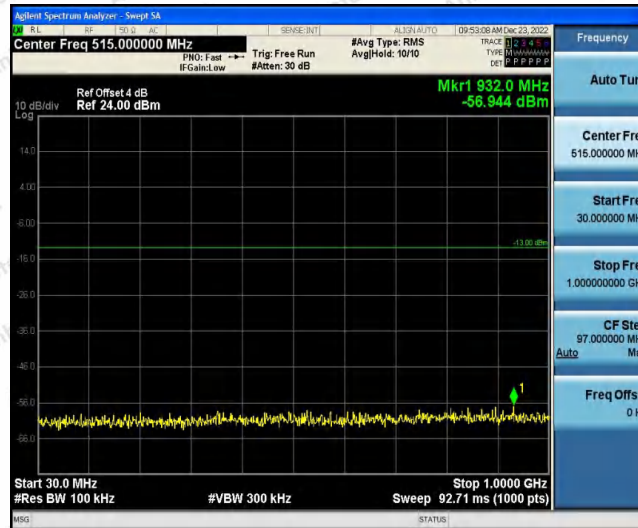

Band2-15MHz-QPSK-18675-1RB#0-Range2:1000~20000MHz

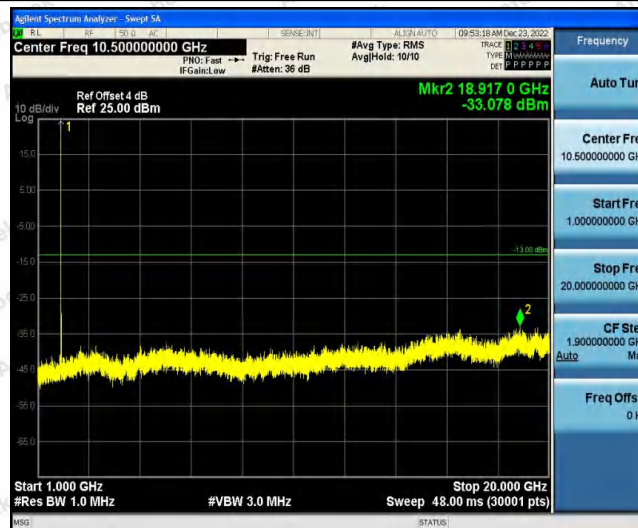


Band2-15MHz-QPSK-18900-1RB#0-Range1:30~1000MHz

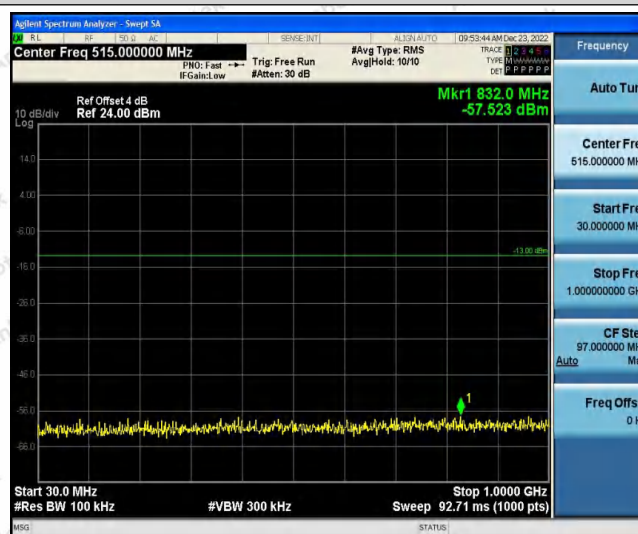


Band2-15MHz-QPSK-18900-1RB#0-Range2:1000~20000MHz




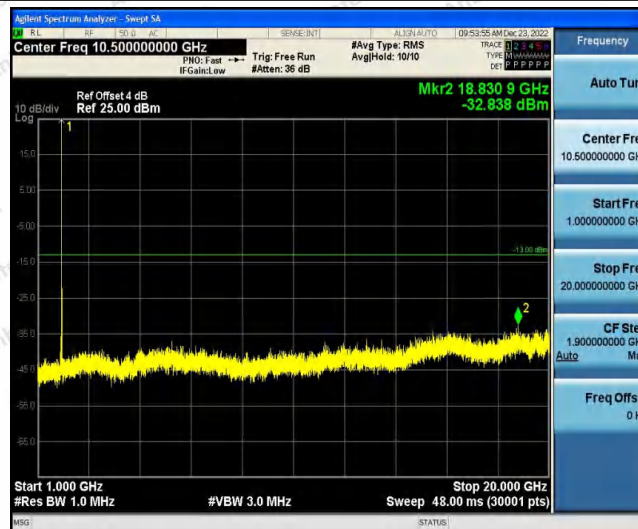

Band2-15MHz-QPSK-19125-1RB#0-Range1:30~1000MHz

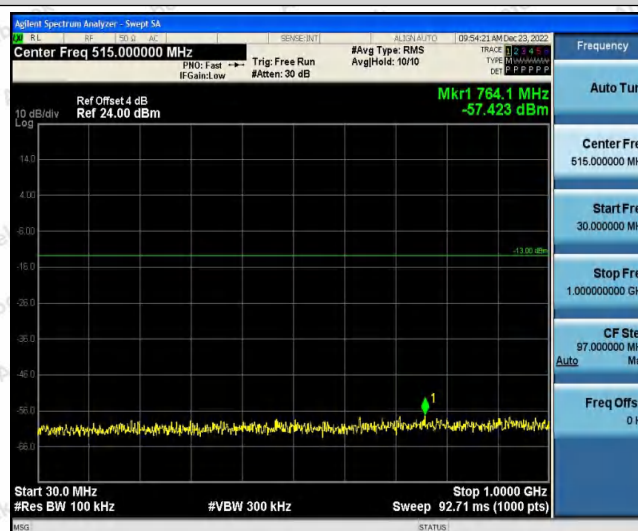


Band2-15MHz-QPSK-19125-1RB#0-Range2:1000~20000MHz

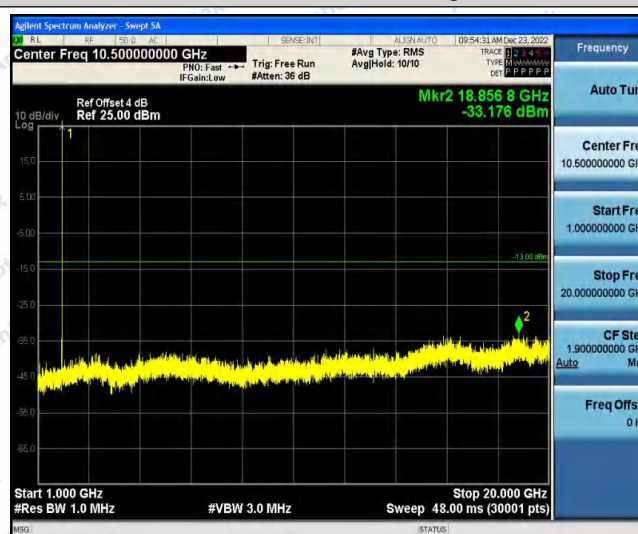


Band2-15MHz-16QAM-18675-1RB#0-Range1:30~1000MHz




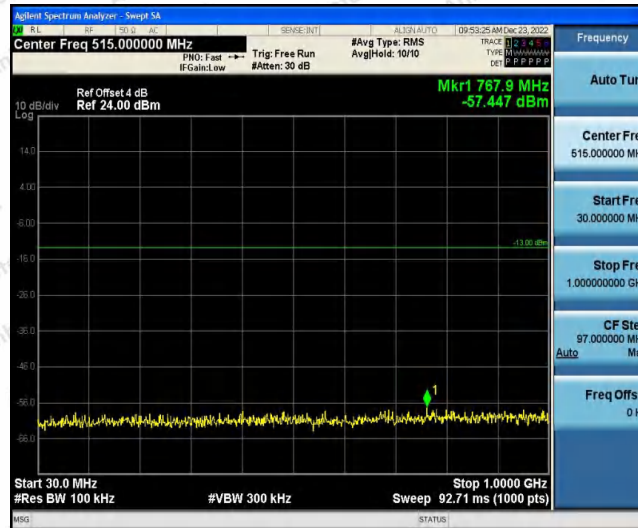

Band2-15MHz-16QAM-18675-1RB#0-Range2:1000~20000MHz

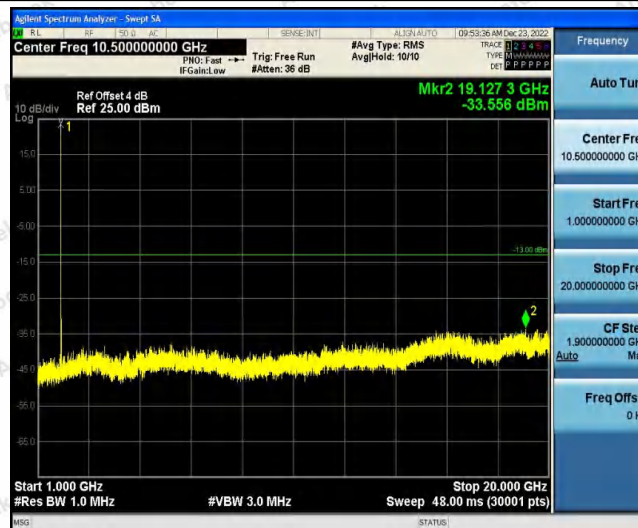

Band2-15MHz-16QAM-18900-1RB#0-Range1:30~1000MHz

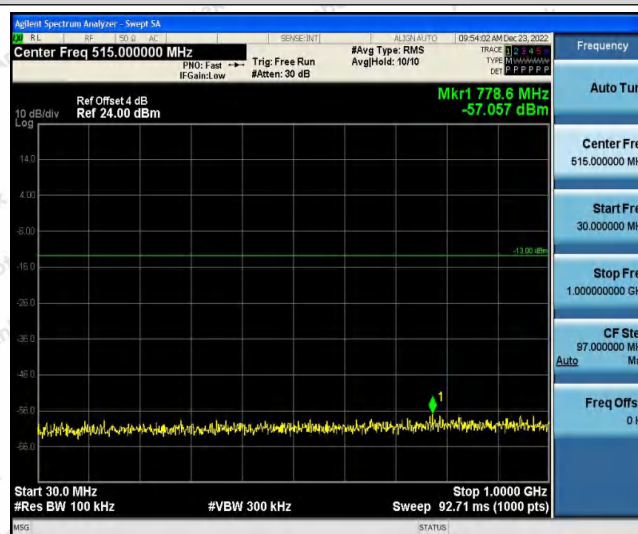

Band2-15MHz-16QAM-18900-1RB#0-Range2:1000~20000MHz


Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.
Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com




Hotline
400-003-0500
www.anbotek.com.cn




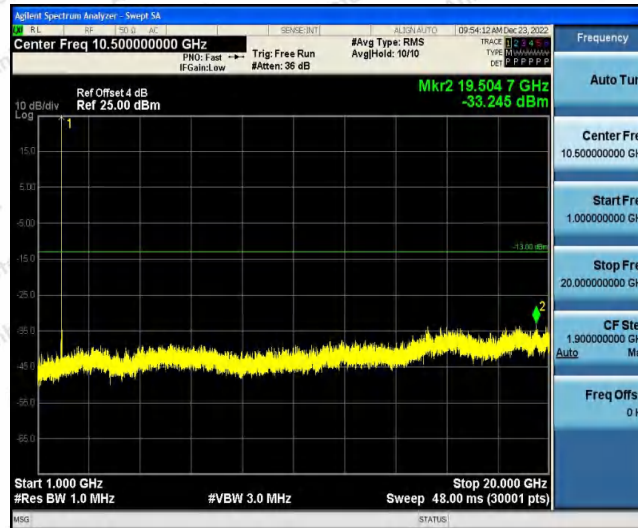

Band2-15MHz-16QAM-19125-1RB#0-Range1:30~1000MHz

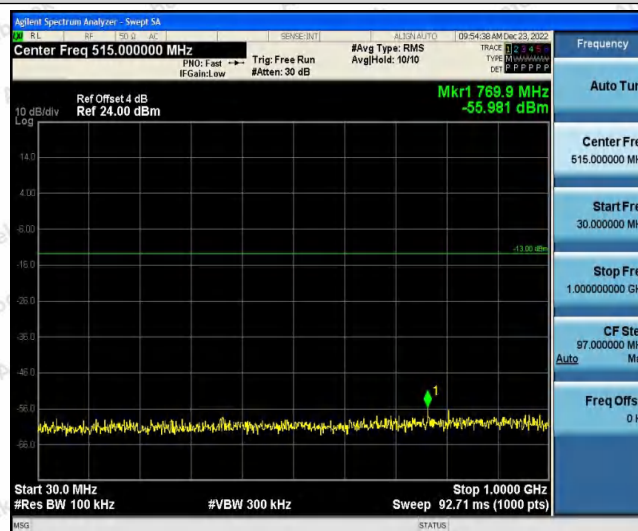

Band2-15MHz-16QAM-19125-1RB#0-Range2:1000~20000MHz

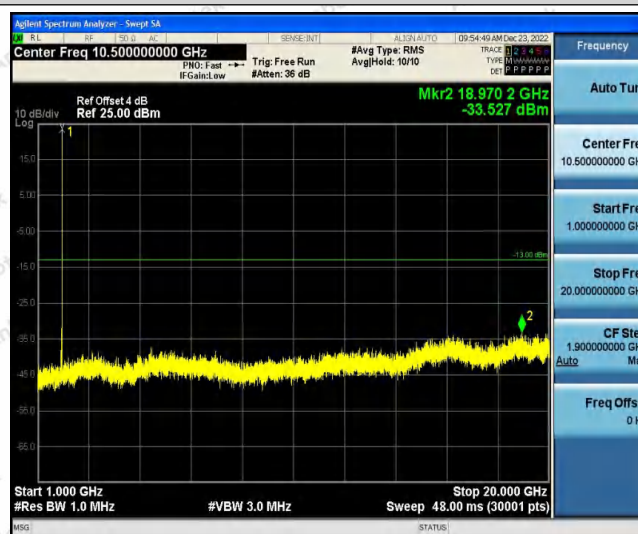

Band2-20MHz-QPSK-18700-1RB#0-Range1:30~1000MHz


Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.
Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com




Hotline
400-003-0500
www.anbotek.com.cn




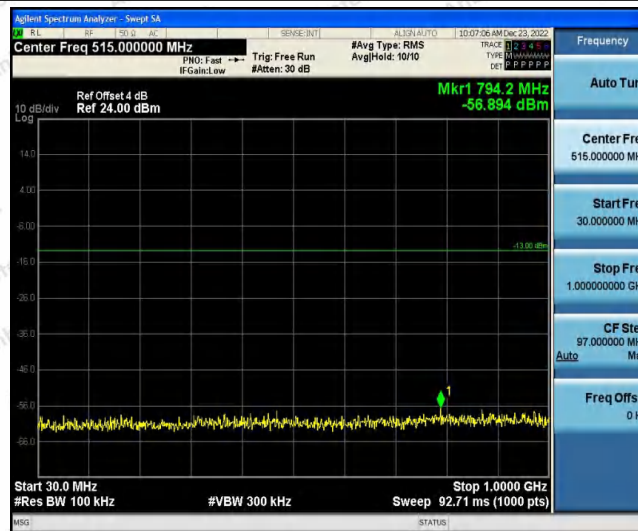

Band2-20MHz-QPSK-18700-1RB#0-Range2:1000~20000MHz

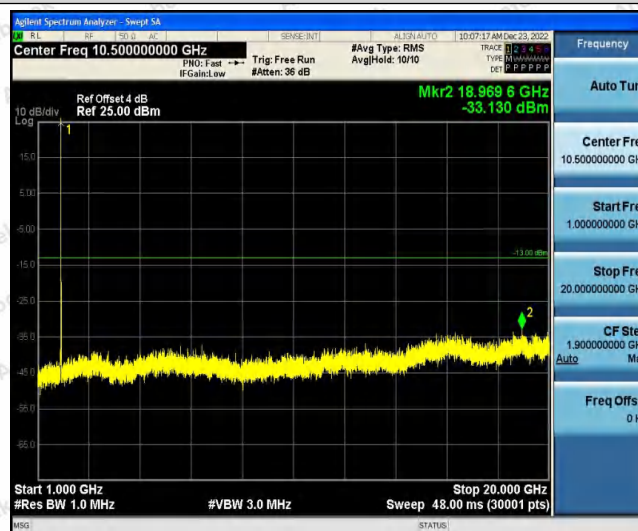


Band2-20MHz-QPSK-18900-1RB#0-Range1:30~1000MHz

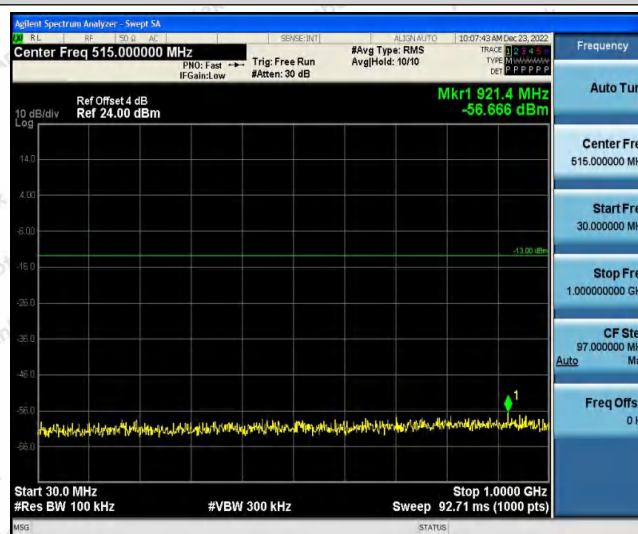


Band2-20MHz-QPSK-18900-1RB#0-Range2:1000~20000MHz




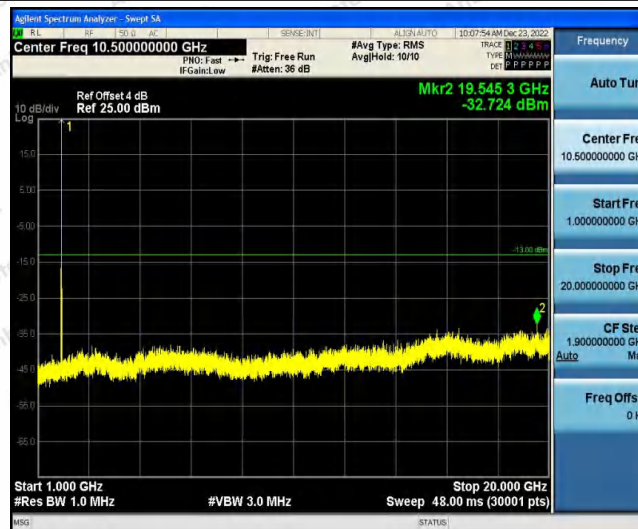

Band2-20MHz-QPSK-19100-1RB#0-Range1:30~1000MHz

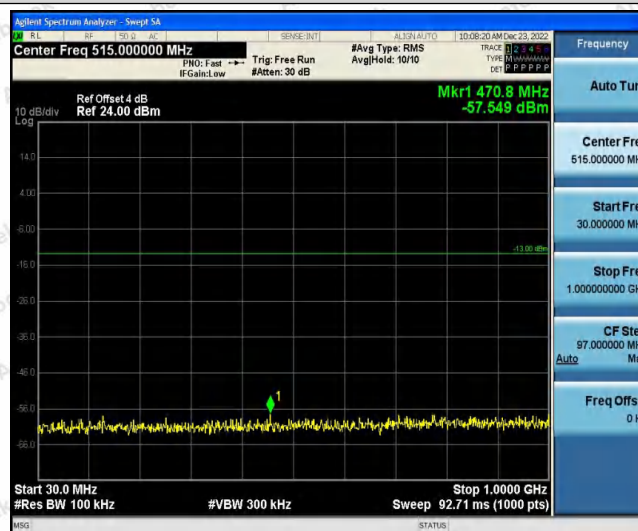

Band2-20MHz-QPSK-19100-1RB#0-Range2:1000~20000MHz

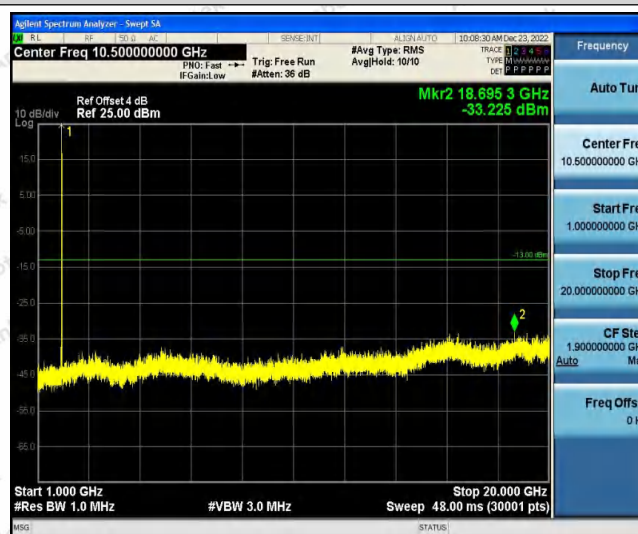

Band2-20MHz-16QAM-18700-1RB#0-Range1:30~1000MHz


Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.
Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com




Hotline
400-003-0500
www.anbotek.com.cn




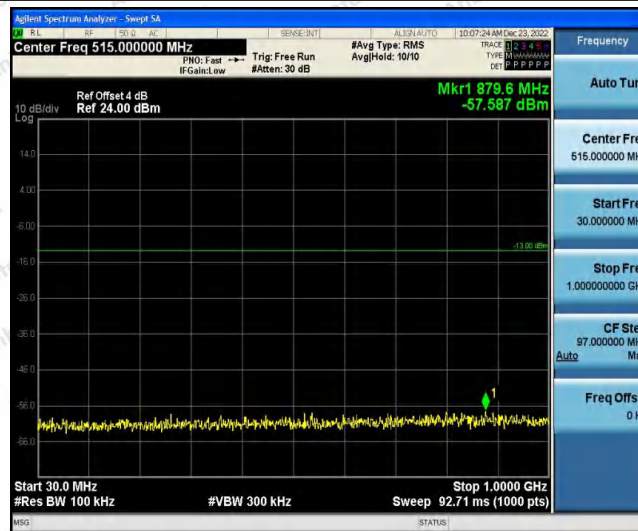

Band2-20MHz-16QAM-18700-1RB#0-Range2:1000~20000MHz

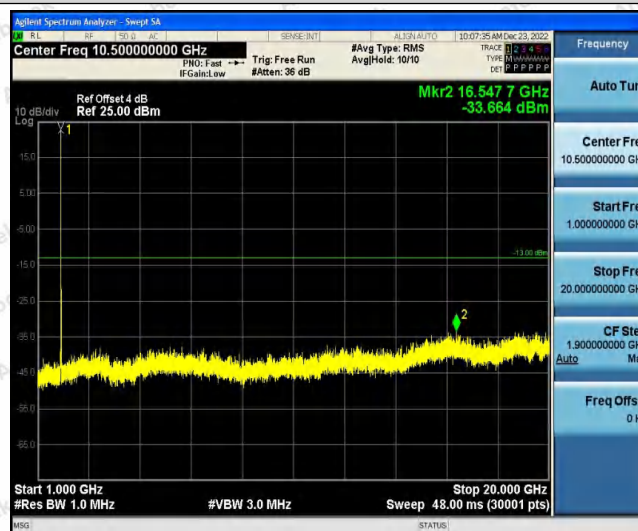

Band2-20MHz-16QAM-18900-1RB#0-Range1:30~1000MHz

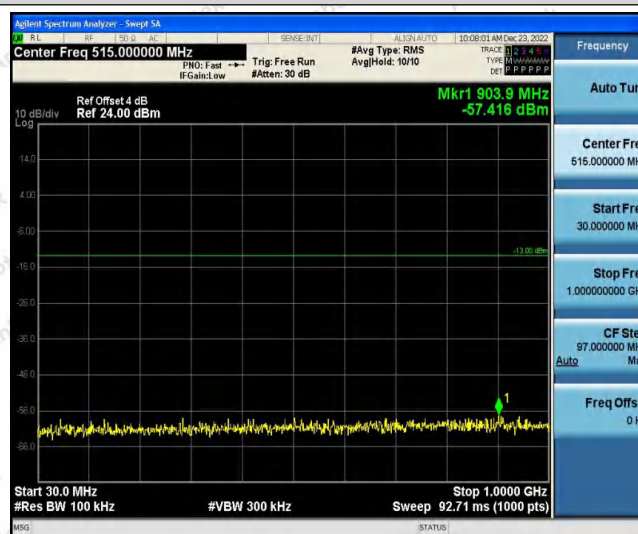

Band2-20MHz-16QAM-18900-1RB#0-Range2:1000~20000MHz


Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community,
Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.
Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com




Hotline
400-003-0500
www.anbotek.com.cn




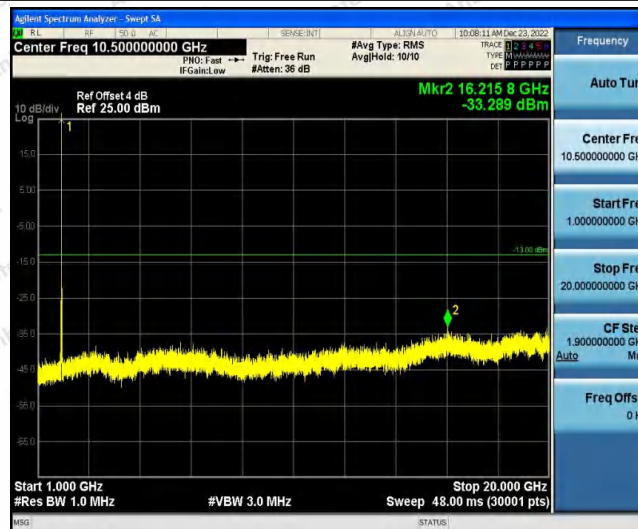

Band2-20MHz-16QAM-19100-1RB#0-Range1:30~1000MHz

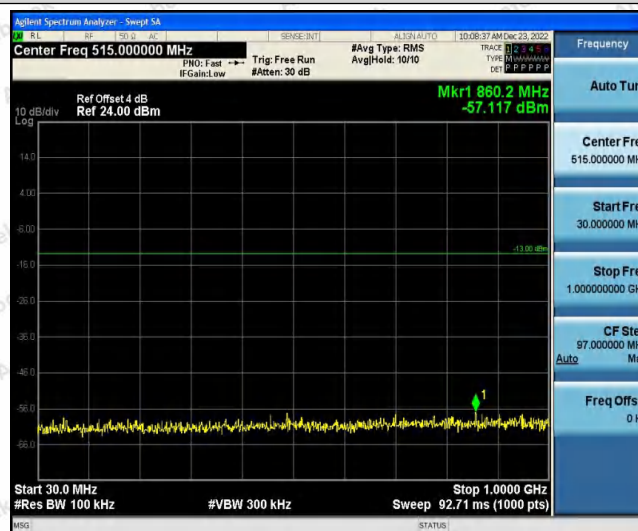

Band2-20MHz-16QAM-19100-1RB#0-Range2:1000~20000MHz

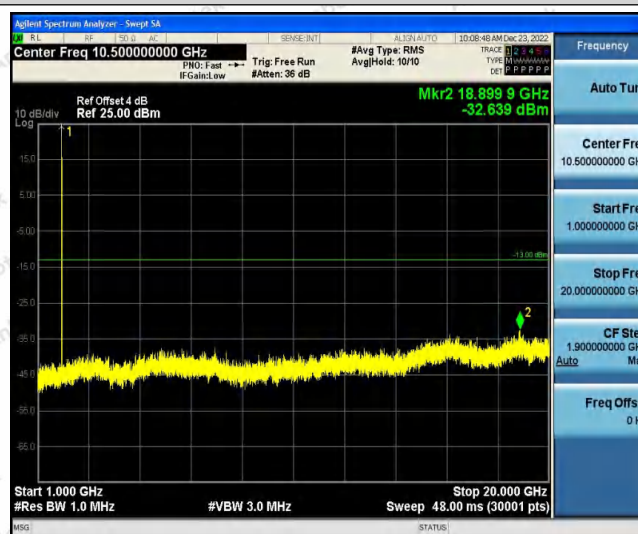

Appendix F: Frequency stability VS Voltage measurement

Test Result

Band	Bandwidth	Modulation	Channel	RB Configure	Voltage					
					Voltage [Vdc]	Temperature (°C)	Deviation (Hz)	Deviation (ppm)	Limit (ppm)	Verdict
Band2	1.4MHz	QPSK	18607	6RB#0	VL	NT	-6.84	-0.003696	±2.5	PASS
Band2	1.4MHz	QPSK	18607	6RB#0	VN	NT	-5.02	-0.002712	±2.5	PASS
Band2	1.4MHz	QPSK	18607	6RB#0	VH	NT	-5.78	-0.003123	±2.5	PASS
Band2	1.4MHz	QPSK	18900	6RB#0	VL	NT	-7.02	-0.003734	±2.5	PASS
Band2	1.4MHz	QPSK	18900	6RB#0	VN	NT	-4.81	-0.002559	±2.5	PASS
Band2	1.4MHz	QPSK	18900	6RB#0	VH	NT	-7.77	-0.004133	±2.5	PASS
Band2	1.4MHz	QPSK	19193	6RB#0	VL	NT	4.21	0.002205	±2.5	PASS
Band2	1.4MHz	QPSK	19193	6RB#0	VN	NT	-3.39	-0.001776	±2.5	PASS
Band2	1.4MHz	QPSK	19193	6RB#0	VH	NT	4.12	0.002158	±2.5	PASS
Band2	1.4MHz	16QAM	18607	6RB#0	VL	NT	-4.38	-0.002367	±2.5	PASS
Band2	1.4MHz	16QAM	18607	6RB#0	VN	NT	-4.45	-0.002404	±2.5	PASS
Band2	1.4MHz	16QAM	18607	6RB#0	VH	NT	-3.99	-0.002156	±2.5	PASS
Band2	1.4MHz	16QAM	18900	6RB#0	VL	NT	-4.42	-0.002351	±2.5	PASS
Band2	1.4MHz	16QAM	18900	6RB#0	VN	NT	-5.82	-0.003096	±2.5	PASS
Band2	1.4MHz	16QAM	18900	6RB#0	VH	NT	-8.07	-0.004293	±2.5	PASS
Band2	1.4MHz	16QAM	19193	6RB#0	VL	NT	3.86	0.002022	±2.5	PASS
Band2	1.4MHz	16QAM	19193	6RB#0	VN	NT	-3.65	-0.001912	±2.5	PASS
Band2	1.4MHz	16QAM	19193	6RB#0	VH	NT	-3.58	-0.001875	±2.5	PASS
Band2	3MHz	QPSK	18615	15RB#0	VL	NT	-6.62	-0.003575	±2.5	PASS
Band2	3MHz	QPSK	18615	15RB#0	VN	NT	-3.68	-0.001988	±2.5	PASS
Band2	3MHz	QPSK	18615	15RB#0	VH	NT	-5.54	-0.002992	±2.5	PASS
Band2	3MHz	QPSK	18900	15RB#0	VL	NT	-6.21	-0.003303	±2.5	PASS
Band2	3MHz	QPSK	18900	15RB#0	VN	NT	-7.28	-0.003872	±2.5	PASS
Band2	3MHz	QPSK	18900	15RB#0	VH	NT	-5.61	-0.002984	±2.5	PASS
Band2	3MHz	QPSK	19185	15RB#0	VL	NT	4.42	0.002316	±2.5	PASS
Band2	3MHz	QPSK	19185	15RB#0	VN	NT	-3.71	-0.001944	±2.5	PASS
Band2	3MHz	QPSK	19185	15RB#0	VH	NT	-4.48	-0.002347	±2.5	PASS
Band2	3MHz	16QAM	18615	15RB#0	VL	NT	-4.33	-0.002339	±2.5	PASS
Band2	3MHz	16QAM	18615	15RB#0	VN	NT	-4.33	-0.002339	±2.5	PASS
Band2	3MHz	16QAM	18615	15RB#0	VH	NT	-3.02	-0.001631	±2.5	PASS
Band2	3MHz	16QAM	18900	15RB#0	VL	NT	-6.09	-0.003239	±2.5	PASS
Band2	3MHz	16QAM	18900	15RB#0	VN	NT	-5.56	-0.002957	±2.5	PASS
Band2	3MHz	16QAM	18900	15RB#0	VH	NT	-11.12	-0.005915	±2.5	PASS



Band2	3MHz	16QAM	19185	15RB#0	VL	NT	7.02	0.003678	±2.5	PASS
Band2	3MHz	16QAM	19185	15RB#0	VN	NT	4.58	0.002400	±2.5	PASS
Band2	3MHz	16QAM	19185	15RB#0	VH	NT	3.52	0.001844	±2.5	PASS
Band2	5MHz	QPSK	18625	25RB#0	VL	NT	-5.48	-0.002958	±2.5	PASS
Band2	5MHz	QPSK	18625	25RB#0	VN	NT	-4.88	-0.002634	±2.5	PASS
Band2	5MHz	QPSK	18625	25RB#0	VH	NT	-4.19	-0.002262	±2.5	PASS
Band2	5MHz	QPSK	18900	25RB#0	VL	NT	-4.46	-0.002372	±2.5	PASS
Band2	5MHz	QPSK	18900	25RB#0	VN	NT	-8.64	-0.004596	±2.5	PASS
Band2	5MHz	QPSK	18900	25RB#0	VH	NT	-4.89	-0.002601	±2.5	PASS
Band2	5MHz	QPSK	19175	25RB#0	VL	NT	-6.05	-0.003172	±2.5	PASS
Band2	5MHz	QPSK	19175	25RB#0	VN	NT	3.23	0.001693	±2.5	PASS
Band2	5MHz	QPSK	19175	25RB#0	VH	NT	-4.72	-0.002474	±2.5	PASS
Band2	5MHz	16QAM	18625	25RB#0	VL	NT	-6.15	-0.003320	±2.5	PASS
Band2	5MHz	16QAM	18625	25RB#0	VN	NT	-4.55	-0.002456	±2.5	PASS
Band2	5MHz	16QAM	18625	25RB#0	VH	NT	-4.88	-0.002634	±2.5	PASS
Band2	5MHz	16QAM	18900	25RB#0	VL	NT	-5.31	-0.002824	±2.5	PASS
Band2	5MHz	16QAM	18900	25RB#0	VN	NT	-4.09	-0.002176	±2.5	PASS
Band2	5MHz	16QAM	18900	25RB#0	VH	NT	-3.39	-0.001803	±2.5	PASS
Band2	5MHz	16QAM	19175	25RB#0	VL	NT	5.24	0.002747	±2.5	PASS
Band2	5MHz	16QAM	19175	25RB#0	VN	NT	4.26	0.002233	±2.5	PASS
Band2	5MHz	16QAM	19175	25RB#0	VH	NT	-5.22	-0.002737	±2.5	PASS
Band2	10MHz	QPSK	18650	50RB#0	VL	NT	-5.28	-0.002846	±2.5	PASS
Band2	10MHz	QPSK	18650	50RB#0	VN	NT	-4.81	-0.002593	±2.5	PASS
Band2	10MHz	QPSK	18650	50RB#0	VH	NT	-7.61	-0.004102	±2.5	PASS
Band2	10MHz	QPSK	18900	50RB#0	VL	NT	-5.88	-0.003128	±2.5	PASS
Band2	10MHz	QPSK	18900	50RB#0	VN	NT	-8.88	-0.004723	±2.5	PASS
Band2	10MHz	QPSK	18900	50RB#0	VH	NT	-7.78	-0.004138	±2.5	PASS
Band2	10MHz	QPSK	19150	50RB#0	VL	NT	4.08	0.002142	±2.5	PASS
Band2	10MHz	QPSK	19150	50RB#0	VN	NT	4.91	0.002577	±2.5	PASS
Band2	10MHz	QPSK	19150	50RB#0	VH	NT	4.38	0.002299	±2.5	PASS
Band2	10MHz	16QAM	18650	50RB#0	VL	NT	-6.82	-0.003677	±2.5	PASS
Band2	10MHz	16QAM	18650	50RB#0	VN	NT	-4.69	-0.002528	±2.5	PASS
Band2	10MHz	16QAM	18650	50RB#0	VH	NT	-7.30	-0.003935	±2.5	PASS
Band2	10MHz	16QAM	18900	50RB#0	VL	NT	-7.62	-0.004053	±2.5	PASS
Band2	10MHz	16QAM	18900	50RB#0	VN	NT	-6.67	-0.003548	±2.5	PASS
Band2	10MHz	16QAM	18900	50RB#0	VH	NT	-7.21	-0.003835	±2.5	PASS
Band2	10MHz	16QAM	19150	50RB#0	VL	NT	3.81	0.002000	±2.5	PASS
Band2	10MHz	16QAM	19150	50RB#0	VN	NT	-3.16	-0.001659	±2.5	PASS
Band2	10MHz	16QAM	19150	50RB#0	VH	NT	5.69	0.002987	±2.5	PASS
Band2	15MHz	QPSK	18675	75RB#0	VL	NT	-6.75	-0.003634	±2.5	PASS
Band2	15MHz	QPSK	18675	75RB#0	VN	NT	-5.98	-0.003219	±2.5	PASS

Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community,
 Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.
 Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com



Hotline
 400-003-0500
 www.anbotek.com.cn



Band2	15MHz	QPSK	18675	75RB#0	VH	NT	-8.27	-0.004452	±2.5	PASS
Band2	15MHz	QPSK	18900	75RB#0	VL	NT	-7.93	-0.004218	±2.5	PASS
Band2	15MHz	QPSK	18900	75RB#0	VN	NT	-6.84	-0.003638	±2.5	PASS
Band2	15MHz	QPSK	18900	75RB#0	VH	NT	-6.44	-0.003426	±2.5	PASS
Band2	15MHz	QPSK	19125	75RB#0	VL	NT	-8.70	-0.004573	±2.5	PASS
Band2	15MHz	QPSK	19125	75RB#0	VN	NT	-10.03	-0.005272	±2.5	PASS
Band2	15MHz	QPSK	19125	75RB#0	VH	NT	-6.05	-0.003180	±2.5	PASS
Band2	15MHz	16QAM	18675	75RB#0	VL	NT	-5.99	-0.003225	±2.5	PASS
Band2	15MHz	16QAM	18675	75RB#0	VN	NT	-8.37	-0.004506	±2.5	PASS
Band2	15MHz	16QAM	18675	75RB#0	VH	NT	-5.68	-0.003058	±2.5	PASS
Band2	15MHz	16QAM	18900	75RB#0	VL	NT	-4.91	-0.002612	±2.5	PASS
Band2	15MHz	16QAM	18900	75RB#0	VN	NT	-7.74	-0.004117	±2.5	PASS
Band2	15MHz	16QAM	18900	75RB#0	VH	NT	-4.28	-0.002277	±2.5	PASS
Band2	15MHz	16QAM	19125	75RB#0	VL	NT	-6.34	-0.003332	±2.5	PASS
Band2	15MHz	16QAM	19125	75RB#0	VN	NT	-4.99	-0.002623	±2.5	PASS
Band2	15MHz	16QAM	19125	75RB#0	VH	NT	-10.50	-0.005519	±2.5	PASS
Band2	20MHz	QPSK	18700	100RB#0	VL	NT	3.33	0.001790	±2.5	PASS
Band2	20MHz	QPSK	18700	100RB#0	VN	NT	5.62	0.003022	±2.5	PASS
Band2	20MHz	QPSK	18700	100RB#0	VH	NT	3.66	0.001968	±2.5	PASS
Band2	20MHz	QPSK	18900	100RB#0	VL	NT	-6.15	-0.003271	±2.5	PASS
Band2	20MHz	QPSK	18900	100RB#0	VN	NT	-6.51	-0.003463	±2.5	PASS
Band2	20MHz	QPSK	18900	100RB#0	VH	NT	-5.22	-0.002777	±2.5	PASS
Band2	20MHz	QPSK	19100	100RB#0	VL	NT	-6.51	-0.003426	±2.5	PASS
Band2	20MHz	QPSK	19100	100RB#0	VN	NT	-6.29	-0.003311	±2.5	PASS
Band2	20MHz	QPSK	19100	100RB#0	VH	NT	-4.85	-0.002553	±2.5	PASS
Band2	20MHz	16QAM	18700	100RB#0	VL	NT	-3.35	-0.001801	±2.5	PASS
Band2	20MHz	16QAM	18700	100RB#0	VN	NT	-2.79	-0.001500	±2.5	PASS
Band2	20MHz	16QAM	18700	100RB#0	VH	NT	5.16	0.002774	±2.5	PASS
Band2	20MHz	16QAM	18900	100RB#0	VL	NT	-8.55	-0.004548	±2.5	PASS
Band2	20MHz	16QAM	18900	100RB#0	VN	NT	-8.30	-0.004415	±2.5	PASS
Band2	20MHz	16QAM	18900	100RB#0	VH	NT	-5.34	-0.002840	±2.5	PASS
Band2	20MHz	16QAM	19100	100RB#0	VL	NT	-7.88	-0.004147	±2.5	PASS
Band2	20MHz	16QAM	19100	100RB#0	VN	NT	-5.49	-0.002889	±2.5	PASS
Band2	20MHz	16QAM	19100	100RB#0	VH	NT	-7.97	-0.004195	±2.5	PASS



Appendix G: Frequency stability VS Temperature measurement

Test Result

Temperature										
Band	Bandwidth	Modulation	Channel	RB Configure	Voltage [Vdc]	Temperature (°C)	Deviation (Hz)	Deviation (ppm)	Limit (ppm)	Verdict
Band2	1.4MHz	QPSK	18607	6RB#0	NV	-30	2.36	0.001275	±2.5	PASS
Band2	1.4MHz	QPSK	18607	6RB#0	NV	-20	-6.35	-0.003431	±2.5	PASS
Band2	1.4MHz	QPSK	18607	6RB#0	NV	0	-6.88	-0.003718	±2.5	PASS
Band2	1.4MHz	QPSK	18607	6RB#0	NV	10	-5.16	-0.002788	±2.5	PASS
Band2	1.4MHz	QPSK	18607	6RB#0	NV	20	-4.13	-0.002232	±2.5	PASS
Band2	1.4MHz	QPSK	18900	6RB#0	NV	-30	-5.12	-0.002723	±2.5	PASS
Band2	1.4MHz	QPSK	18900	6RB#0	NV	-20	-5.75	-0.003059	±2.5	PASS
Band2	1.4MHz	QPSK	18900	6RB#0	NV	0	-9.43	-0.005016	±2.5	PASS
Band2	1.4MHz	QPSK	18900	6RB#0	NV	10	-5.39	-0.002867	±2.5	PASS
Band2	1.4MHz	QPSK	18900	6RB#0	NV	20	-6.84	-0.003638	±2.5	PASS
Band2	1.4MHz	QPSK	19193	6RB#0	NV	-30	3.48	0.001823	±2.5	PASS
Band2	1.4MHz	QPSK	19193	6RB#0	NV	-20	4.18	0.002189	±2.5	PASS
Band2	1.4MHz	QPSK	19193	6RB#0	NV	0	3.28	0.001718	±2.5	PASS
Band2	1.4MHz	QPSK	19193	6RB#0	NV	10	2.55	0.001336	±2.5	PASS
Band2	1.4MHz	QPSK	19193	6RB#0	NV	20	-3.12	-0.001634	±2.5	PASS
Band2	1.4MHz	16QAM	18607	6RB#0	NV	-30	-4.81	-0.002599	±2.5	PASS
Band2	1.4MHz	16QAM	18607	6RB#0	NV	-20	-4.71	-0.002545	±2.5	PASS
Band2	1.4MHz	16QAM	18607	6RB#0	NV	0	4.88	0.002637	±2.5	PASS
Band2	1.4MHz	16QAM	18607	6RB#0	NV	10	-7.18	-0.003880	±2.5	PASS
Band2	1.4MHz	16QAM	18607	6RB#0	NV	20	-3.50	-0.001891	±2.5	PASS
Band2	1.4MHz	16QAM	18900	6RB#0	NV	-30	-9.43	-0.005016	±2.5	PASS
Band2	1.4MHz	16QAM	18900	6RB#0	NV	-20	-6.97	-0.003707	±2.5	PASS
Band2	1.4MHz	16QAM	18900	6RB#0	NV	0	-5.26	-0.002798	±2.5	PASS
Band2	1.4MHz	16QAM	18900	6RB#0	NV	10	-10.73	-0.005707	±2.5	PASS
Band2	1.4MHz	16QAM	18900	6RB#0	NV	20	-9.06	-0.004819	±2.5	PASS
Band2	1.4MHz	16QAM	19193	6RB#0	NV	-30	-3.33	-0.001744	±2.5	PASS
Band2	1.4MHz	16QAM	19193	6RB#0	NV	-20	-4.08	-0.002137	±2.5	PASS
Band2	1.4MHz	16QAM	19193	6RB#0	NV	0	5.64	0.002954	±2.5	PASS
Band2	1.4MHz	16QAM	19193	6RB#0	NV	10	6.92	0.003624	±2.5	PASS
Band2	1.4MHz	16QAM	19193	6RB#0	NV	20	2.05	0.001074	±2.5	PASS
Band2	3MHz	QPSK	18615	15RB#0	NV	-30	-4.48	-0.002420	±2.5	PASS
Band2	3MHz	QPSK	18615	15RB#0	NV	-20	-4.48	-0.002420	±2.5	PASS
Band2	3MHz	QPSK	18615	15RB#0	NV	0	-5.15	-0.002782	±2.5	PASS
Band2	3MHz	QPSK	18615	15RB#0	NV	10	-4.98	-0.002690	±2.5	PASS



Band2	3MHz	QPSK	18615	15RB#0	NV	20	-7.11	-0.003840	±2.5	PASS
Band2	3MHz	QPSK	18900	15RB#0	NV	-30	-7.48	-0.003979	±2.5	PASS
Band2	3MHz	QPSK	18900	15RB#0	NV	-20	-5.46	-0.002904	±2.5	PASS
Band2	3MHz	QPSK	18900	15RB#0	NV	0	-7.71	-0.004101	±2.5	PASS
Band2	3MHz	QPSK	18900	15RB#0	NV	10	-6.45	-0.003431	±2.5	PASS
Band2	3MHz	QPSK	18900	15RB#0	NV	20	-5.84	-0.003106	±2.5	PASS
Band2	3MHz	QPSK	19185	15RB#0	NV	-30	-7.62	-0.003993	±2.5	PASS
Band2	3MHz	QPSK	19185	15RB#0	NV	-20	-3.36	-0.001761	±2.5	PASS
Band2	3MHz	QPSK	19185	15RB#0	NV	0	4.22	0.002211	±2.5	PASS
Band2	3MHz	QPSK	19185	15RB#0	NV	10	4.71	0.002468	±2.5	PASS
Band2	3MHz	QPSK	19185	15RB#0	NV	20	4.88	0.002557	±2.5	PASS
Band2	3MHz	16QAM	18615	15RB#0	NV	-30	-6.35	-0.003430	±2.5	PASS
Band2	3MHz	16QAM	18615	15RB#0	NV	-20	-3.55	-0.001917	±2.5	PASS
Band2	3MHz	16QAM	18615	15RB#0	NV	0	-5.69	-0.003073	±2.5	PASS
Band2	3MHz	16QAM	18615	15RB#0	NV	10	-4.15	-0.002241	±2.5	PASS
Band2	3MHz	16QAM	18615	15RB#0	NV	20	-3.33	-0.001799	±2.5	PASS
Band2	3MHz	16QAM	18900	15RB#0	NV	-30	-6.15	-0.003271	±2.5	PASS
Band2	3MHz	16QAM	18900	15RB#0	NV	-20	-6.07	-0.003229	±2.5	PASS
Band2	3MHz	16QAM	18900	15RB#0	NV	0	-7.35	-0.003910	±2.5	PASS
Band2	3MHz	16QAM	18900	15RB#0	NV	10	-5.05	-0.002686	±2.5	PASS
Band2	3MHz	16QAM	18900	15RB#0	NV	20	-6.14	-0.003266	±2.5	PASS
Band2	3MHz	16QAM	19185	15RB#0	NV	-30	-4.21	-0.002206	±2.5	PASS
Band2	3MHz	16QAM	19185	15RB#0	NV	-20	-5.44	-0.002850	±2.5	PASS
Band2	3MHz	16QAM	19185	15RB#0	NV	0	4.61	0.002416	±2.5	PASS
Band2	3MHz	16QAM	19185	15RB#0	NV	10	3.39	0.001776	±2.5	PASS
Band2	3MHz	16QAM	19185	15RB#0	NV	20	4.16	0.002180	±2.5	PASS
Band2	5MHz	QPSK	18625	25RB#0	NV	-30	-6.58	-0.003552	±2.5	PASS
Band2	5MHz	QPSK	18625	25RB#0	NV	-20	3.35	0.001808	±2.5	PASS
Band2	5MHz	QPSK	18625	25RB#0	NV	0	-3.02	-0.001630	±2.5	PASS
Band2	5MHz	QPSK	18625	25RB#0	NV	10	-3.68	-0.001987	±2.5	PASS
Band2	5MHz	QPSK	18625	25RB#0	NV	20	-5.68	-0.003066	±2.5	PASS
Band2	5MHz	QPSK	18900	25RB#0	NV	-30	-6.52	-0.003468	±2.5	PASS
Band2	5MHz	QPSK	18900	25RB#0	NV	-20	-6.44	-0.003426	±2.5	PASS
Band2	5MHz	QPSK	18900	25RB#0	NV	0	-5.62	-0.002989	±2.5	PASS
Band2	5MHz	QPSK	18900	25RB#0	NV	10	-6.11	-0.003250	±2.5	PASS
Band2	5MHz	QPSK	18900	25RB#0	NV	20	-5.98	-0.003181	±2.5	PASS
Band2	5MHz	QPSK	19175	25RB#0	NV	-30	-4.25	-0.002228	±2.5	PASS
Band2	5MHz	QPSK	19175	25RB#0	NV	-20	3.93	0.002060	±2.5	PASS
Band2	5MHz	QPSK	19175	25RB#0	NV	0	-4.53	-0.002375	±2.5	PASS
Band2	5MHz	QPSK	19175	25RB#0	NV	10	3.89	0.002039	±2.5	PASS
Band2	5MHz	QPSK	19175	25RB#0	NV	20	-6.22	-0.003261	±2.5	PASS

Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community,
 Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.
 Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com



Hotline
 400-003-0500
 www.anbotek.com.cn



Band2	5MHz	16QAM	18625	25RB#0	NV	-30	-4.29	-0.002316	±2.5	PASS
Band2	5MHz	16QAM	18625	25RB#0	NV	-20	-3.85	-0.002078	±2.5	PASS
Band2	5MHz	16QAM	18625	25RB#0	NV	0	-5.04	-0.002721	±2.5	PASS
Band2	5MHz	16QAM	18625	25RB#0	NV	10	-4.52	-0.002440	±2.5	PASS
Band2	5MHz	16QAM	18625	25RB#0	NV	20	-3.39	-0.001830	±2.5	PASS
Band2	5MHz	16QAM	18900	25RB#0	NV	-30	-7.28	-0.003872	±2.5	PASS
Band2	5MHz	16QAM	18900	25RB#0	NV	-20	-5.91	-0.003144	±2.5	PASS
Band2	5MHz	16QAM	18900	25RB#0	NV	0	-4.79	-0.002548	±2.5	PASS
Band2	5MHz	16QAM	18900	25RB#0	NV	10	-7.65	-0.004069	±2.5	PASS
Band2	5MHz	16QAM	18900	25RB#0	NV	20	-7.14	-0.003798	±2.5	PASS
Band2	5MHz	16QAM	19175	25RB#0	NV	-30	-3.99	-0.002092	±2.5	PASS
Band2	5MHz	16QAM	19175	25RB#0	NV	-20	4.32	0.002265	±2.5	PASS
Band2	5MHz	16QAM	19175	25RB#0	NV	0	-3.86	-0.002024	±2.5	PASS
Band2	5MHz	16QAM	19175	25RB#0	NV	10	-3.52	-0.001845	±2.5	PASS
Band2	5MHz	16QAM	19175	25RB#0	NV	20	-4.16	-0.002181	±2.5	PASS
Band2	10MHz	QPSK	18650	50RB#0	NV	-30	-5.82	-0.003137	±2.5	PASS
Band2	10MHz	QPSK	18650	50RB#0	NV	-20	-5.81	-0.003132	±2.5	PASS
Band2	10MHz	QPSK	18650	50RB#0	NV	0	-8.05	-0.004340	±2.5	PASS
Band2	10MHz	QPSK	18650	50RB#0	NV	10	-4.08	-0.002199	±2.5	PASS
Band2	10MHz	QPSK	18650	50RB#0	NV	20	-5.61	-0.003024	±2.5	PASS
Band2	10MHz	QPSK	18900	50RB#0	NV	-30	-6.79	-0.003612	±2.5	PASS
Band2	10MHz	QPSK	18900	50RB#0	NV	-20	-6.95	-0.003697	±2.5	PASS
Band2	10MHz	QPSK	18900	50RB#0	NV	0	-10.49	-0.005580	±2.5	PASS
Band2	10MHz	QPSK	18900	50RB#0	NV	10	-7.15	-0.003803	±2.5	PASS
Band2	10MHz	QPSK	18900	50RB#0	NV	20	-6.98	-0.003713	±2.5	PASS
Band2	10MHz	QPSK	19150	50RB#0	NV	-30	3.66	0.001921	±2.5	PASS
Band2	10MHz	QPSK	19150	50RB#0	NV	-20	4.39	0.002304	±2.5	PASS
Band2	10MHz	QPSK	19150	50RB#0	NV	0	4.81	0.002525	±2.5	PASS
Band2	10MHz	QPSK	19150	50RB#0	NV	10	4.02	0.002110	±2.5	PASS
Band2	10MHz	QPSK	19150	50RB#0	NV	20	2.83	0.001486	±2.5	PASS
Band2	10MHz	16QAM	18650	50RB#0	NV	-30	-6.27	-0.003380	±2.5	PASS
Band2	10MHz	16QAM	18650	50RB#0	NV	-20	-6.07	-0.003272	±2.5	PASS
Band2	10MHz	16QAM	18650	50RB#0	NV	0	-6.31	-0.003402	±2.5	PASS
Band2	10MHz	16QAM	18650	50RB#0	NV	10	-6.15	-0.003315	±2.5	PASS
Band2	10MHz	16QAM	18650	50RB#0	NV	20	-5.42	-0.002922	±2.5	PASS
Band2	10MHz	16QAM	18900	50RB#0	NV	-30	-8.01	-0.004261	±2.5	PASS
Band2	10MHz	16QAM	18900	50RB#0	NV	-20	-5.79	-0.003080	±2.5	PASS
Band2	10MHz	16QAM	18900	50RB#0	NV	0	-5.22	-0.002777	±2.5	PASS
Band2	10MHz	16QAM	18900	50RB#0	NV	10	-4.58	-0.002436	±2.5	PASS
Band2	10MHz	16QAM	18900	50RB#0	NV	20	-5.02	-0.002670	±2.5	PASS
Band2	10MHz	16QAM	19150	50RB#0	NV	-30	4.35	0.002283	±2.5	PASS

Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community,
 Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.
 Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com



Hotline
 400-003-0500
 www.anbotek.com.cn



Band2	10MHz	16QAM	19150	50RB#0	NV	-20	4.63	0.002430	±2.5	PASS
Band2	10MHz	16QAM	19150	50RB#0	NV	0	4.05	0.002126	±2.5	PASS
Band2	10MHz	16QAM	19150	50RB#0	NV	10	-5.71	-0.002997	±2.5	PASS
Band2	10MHz	16QAM	19150	50RB#0	NV	20	4.89	0.002567	±2.5	PASS
Band2	15MHz	QPSK	18675	75RB#0	NV	-30	-6.44	-0.003467	±2.5	PASS
Band2	15MHz	QPSK	18675	75RB#0	NV	-20	-7.54	-0.004059	±2.5	PASS
Band2	15MHz	QPSK	18675	75RB#0	NV	0	-5.72	-0.003079	±2.5	PASS
Band2	15MHz	QPSK	18675	75RB#0	NV	10	-10.29	-0.005540	±2.5	PASS
Band2	15MHz	QPSK	18675	75RB#0	NV	20	-5.42	-0.002918	±2.5	PASS
Band2	15MHz	QPSK	18900	75RB#0	NV	-30	-6.44	-0.003426	±2.5	PASS
Band2	15MHz	QPSK	18900	75RB#0	NV	-20	-7.38	-0.003926	±2.5	PASS
Band2	15MHz	QPSK	18900	75RB#0	NV	0	-6.84	-0.003638	±2.5	PASS
Band2	15MHz	QPSK	18900	75RB#0	NV	10	-7.01	-0.003729	±2.5	PASS
Band2	15MHz	QPSK	18900	75RB#0	NV	20	-4.65	-0.002473	±2.5	PASS
Band2	15MHz	QPSK	19125	75RB#0	NV	-30	-7.01	-0.003685	±2.5	PASS
Band2	15MHz	QPSK	19125	75RB#0	NV	-20	-6.31	-0.003317	±2.5	PASS
Band2	15MHz	QPSK	19125	75RB#0	NV	0	-10.94	-0.005750	±2.5	PASS
Band2	15MHz	QPSK	19125	75RB#0	NV	10	-8.41	-0.004420	±2.5	PASS
Band2	15MHz	QPSK	19125	75RB#0	NV	20	-7.91	-0.004158	±2.5	PASS
Band2	15MHz	16QAM	18675	75RB#0	NV	-30	-6.72	-0.003618	±2.5	PASS
Band2	15MHz	16QAM	18675	75RB#0	NV	-20	-8.34	-0.004490	±2.5	PASS
Band2	15MHz	16QAM	18675	75RB#0	NV	0	-7.94	-0.004275	±2.5	PASS
Band2	15MHz	16QAM	18675	75RB#0	NV	10	-6.44	-0.003467	±2.5	PASS
Band2	15MHz	16QAM	18675	75RB#0	NV	20	-6.14	-0.003306	±2.5	PASS
Band2	15MHz	16QAM	18900	75RB#0	NV	-30	-7.61	-0.004048	±2.5	PASS
Band2	15MHz	16QAM	18900	75RB#0	NV	-20	-8.85	-0.004707	±2.5	PASS
Band2	15MHz	16QAM	18900	75RB#0	NV	0	-6.75	-0.003590	±2.5	PASS
Band2	15MHz	16QAM	18900	75RB#0	NV	10	-7.58	-0.004032	±2.5	PASS
Band2	15MHz	16QAM	18900	75RB#0	NV	20	-7.32	-0.003894	±2.5	PASS
Band2	15MHz	16QAM	19125	75RB#0	NV	-30	-6.17	-0.003243	±2.5	PASS
Band2	15MHz	16QAM	19125	75RB#0	NV	-20	-6.71	-0.003527	±2.5	PASS
Band2	15MHz	16QAM	19125	75RB#0	NV	0	-5.19	-0.002728	±2.5	PASS
Band2	15MHz	16QAM	19125	75RB#0	NV	10	-5.46	-0.002870	±2.5	PASS
Band2	15MHz	16QAM	19125	75RB#0	NV	20	-5.02	-0.002639	±2.5	PASS
Band2	20MHz	QPSK	18700	100RB#0	NV	-30	3.39	0.001823	±2.5	PASS
Band2	20MHz	QPSK	18700	100RB#0	NV	-20	-5.18	-0.002785	±2.5	PASS
Band2	20MHz	QPSK	18700	100RB#0	NV	0	4.16	0.002237	±2.5	PASS
Band2	20MHz	QPSK	18700	100RB#0	NV	10	4.88	0.002624	±2.5	PASS
Band2	20MHz	QPSK	18700	100RB#0	NV	20	3.46	0.001860	±2.5	PASS
Band2	20MHz	QPSK	18900	100RB#0	NV	-30	-7.20	-0.003830	±2.5	PASS
Band2	20MHz	QPSK	18900	100RB#0	NV	-20	-6.48	-0.003447	±2.5	PASS

Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community,
 Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.
 Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com



Hotline
 400-003-0500
 www.anbotek.com.cn



Band2	20MHz	QPSK	18900	100RB#0	NV	0	-5.92	-0.003149	±2.5	PASS
Band2	20MHz	QPSK	18900	100RB#0	NV	10	-9.67	-0.005144	±2.5	PASS
Band2	20MHz	QPSK	18900	100RB#0	NV	20	-6.94	-0.003691	±2.5	PASS
Band2	20MHz	QPSK	19100	100RB#0	NV	-30	-5.59	-0.002942	±2.5	PASS
Band2	20MHz	QPSK	19100	100RB#0	NV	-20	-3.93	-0.002068	±2.5	PASS
Band2	20MHz	QPSK	19100	100RB#0	NV	0	-2.15	-0.001132	±2.5	PASS
Band2	20MHz	QPSK	19100	100RB#0	NV	10	-3.75	-0.001974	±2.5	PASS
Band2	20MHz	QPSK	19100	100RB#0	NV	20	-6.04	-0.003179	±2.5	PASS
Band2	20MHz	16QAM	18700	100RB#0	NV	-30	3.39	0.001823	±2.5	PASS
Band2	20MHz	16QAM	18700	100RB#0	NV	-20	-6.18	-0.003323	±2.5	PASS
Band2	20MHz	16QAM	18700	100RB#0	NV	0	-3.83	-0.002059	±2.5	PASS
Band2	20MHz	16QAM	18700	100RB#0	NV	10	4.78	0.002570	±2.5	PASS
Band2	20MHz	16QAM	18700	100RB#0	NV	20	-4.96	-0.002667	±2.5	PASS
Band2	20MHz	16QAM	18900	100RB#0	NV	-30	-7.44	-0.003957	±2.5	PASS
Band2	20MHz	16QAM	18900	100RB#0	NV	-20	-8.41	-0.004473	±2.5	PASS
Band2	20MHz	16QAM	18900	100RB#0	NV	0	-4.75	-0.002527	±2.5	PASS
Band2	20MHz	16QAM	18900	100RB#0	NV	10	-7.41	-0.003941	±2.5	PASS
Band2	20MHz	16QAM	18900	100RB#0	NV	20	-7.57	-0.004027	±2.5	PASS
Band2	20MHz	16QAM	19100	100RB#0	NV	-30	-5.42	-0.002853	±2.5	PASS
Band2	20MHz	16QAM	19100	100RB#0	NV	-20	-4.46	-0.002347	±2.5	PASS
Band2	20MHz	16QAM	19100	100RB#0	NV	0	-6.12	-0.003221	±2.5	PASS
Band2	20MHz	16QAM	19100	100RB#0	NV	10	-6.22	-0.003274	±2.5	PASS
Band2	20MHz	16QAM	19100	100RB#0	NV	20	-6.45	-0.003395	±2.5	PASS

---End---

