

Appendix Test Data

Report No.:	1812C50171412502-01	Test Sample No.:	1-2-2
Start Test Date:	2025-10-22	Finish Test Date:	2025-11-13
Test Engineer:	<i>Alex Peng</i>	Auditor:	<i>Justin Feng</i>
Temperature:	22.3℃	Relative Humidity:	45%
Pressure:	101kPa		



Appendix A1: 26dB Bandwidth

Test Result

Test Mode	Antenna	Frequency[MHz]	26db EBW [MHz]	FL[MHz]	FH[MHz]	Limit[MHz]	Verdict
11A	Ant1	5180	20.280	5169.840	5190.120	---	---
11A	Ant1	5220	20.240	5209.880	5230.120	---	---
11A	Ant1	5240	20.000	5230.040	5250.040	---	---
11A	Ant1	5260	20.120	5249.960	5270.080	---	---
11A	Ant1	5300	20.120	5289.920	5310.040	---	---
11A	Ant1	5320	20.280	5309.880	5330.160	---	---
11A	Ant1	5500	20.040	5490.080	5510.120	---	---
11A	Ant1	5580	20.080	5570.040	5590.120	---	---
11A	Ant1	5700	20.360	5689.840	5710.200	---	---
11A	Ant1	5745	20.440	5734.760	5755.200	---	---
11A	Ant1	5785	20.280	5774.920	5795.200	---	---
11A	Ant1	5825	20.280	5814.880	5835.160	---	---
11N20SISO	Ant1	5180	20.720	5169.640	5190.360	---	---
11N20SISO	Ant1	5220	20.520	5209.680	5230.200	---	---
11N20SISO	Ant1	5240	20.480	5229.760	5250.240	---	---
11N20SISO	Ant1	5260	20.600	5249.640	5270.240	---	---
11N20SISO	Ant1	5300	20.520	5289.760	5310.280	---	---
11N20SISO	Ant1	5320	20.600	5309.760	5330.360	---	---
11N20SISO	Ant1	5500	20.640	5489.640	5510.280	---	---
11N20SISO	Ant1	5580	20.440	5569.880	5590.320	---	---
11N20SISO	Ant1	5700	20.560	5689.720	5710.280	---	---
11N20SISO	Ant1	5745	20.520	5734.680	5755.200	---	---
11N20SISO	Ant1	5785	20.480	5774.840	5795.320	---	---
11N20SISO	Ant1	5825	20.280	5814.920	5835.200	---	---

Shenzhen Anbotech Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotech.com E-mail: service@anbotech.com

11N40SISO	Ant1	5190	41.280	5169.280	5210.560	---	---
11N40SISO	Ant1	5230	40.800	5209.520	5250.320	---	---
11N40SISO	Ant1	5270	41.360	5249.360	5290.720	---	---
11N40SISO	Ant1	5310	40.960	5289.600	5330.560	---	---
11N40SISO	Ant1	5510	40.960	5489.600	5530.560	---	---
11N40SISO	Ant1	5550	41.280	5529.520	5570.800	---	---
11N40SISO	Ant1	5670	41.440	5649.440	5690.880	---	---
11N40SISO	Ant1	5755	41.760	5734.040	5775.800	---	---
11N40SISO	Ant1	5795	41.440	5774.120	5815.560	---	---
11AC20SISO	Ant1	5180	20.640	5169.640	5190.280	---	---
11AC20SISO	Ant1	5220	20.520	5209.680	5230.200	---	---
11AC20SISO	Ant1	5240	20.480	5229.800	5250.280	---	---
11AC20SISO	Ant1	5260	20.400	5249.840	5270.240	---	---
11AC20SISO	Ant1	5300	20.360	5289.880	5310.240	---	---
11AC20SISO	Ant1	5320	20.560	5309.680	5330.240	---	---
11AC20SISO	Ant1	5500	20.280	5489.960	5510.240	---	---
11AC20SISO	Ant1	5580	20.360	5569.920	5590.280	---	---
11AC20SISO	Ant1	5700	20.520	5689.760	5710.280	---	---
11AC20SISO	Ant1	5745	20.400	5734.680	5755.080	---	---
11AC20SISO	Ant1	5785	20.560	5774.600	5795.160	---	---
11AC20SISO	Ant1	5825	20.560	5814.720	5835.280	---	---
11AC40SISO	Ant1	5190	41.200	5169.520	5210.720	---	---
11AC40SISO	Ant1	5230	41.360	5209.360	5250.720	---	---
11AC40SISO	Ant1	5270	41.200	5249.120	5290.320	---	---
11AC40SISO	Ant1	5310	41.200	5289.440	5330.640	---	---
11AC40SISO	Ant1	5510	41.040	5489.520	5530.560	---	---
11AC40SISO	Ant1	5550	40.960	5529.520	5570.480	---	---
11AC40SISO	Ant1	5670	41.280	5649.680	5690.960	---	---
11AC40SISO	Ant1	5755	41.280	5734.200	5775.480	---	---
11AC40SISO	Ant1	5795	40.480	5774.840	5815.320	---	---
11AC80SISO	Ant1	5210	82.080	5168.880	5250.960	---	---
11AC80SISO	Ant1	5290	82.080	5249.040	5331.120	---	---
11AC80SISO	Ant1	5530	82.240	5488.880	5571.120	---	---
11AC80SISO	Ant1	5775	81.760	5734.040	5815.800	---	---

Test Graphs



11A-Ant1-5180



11A-Ant1-5220


Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com



11A-Ant1-5240

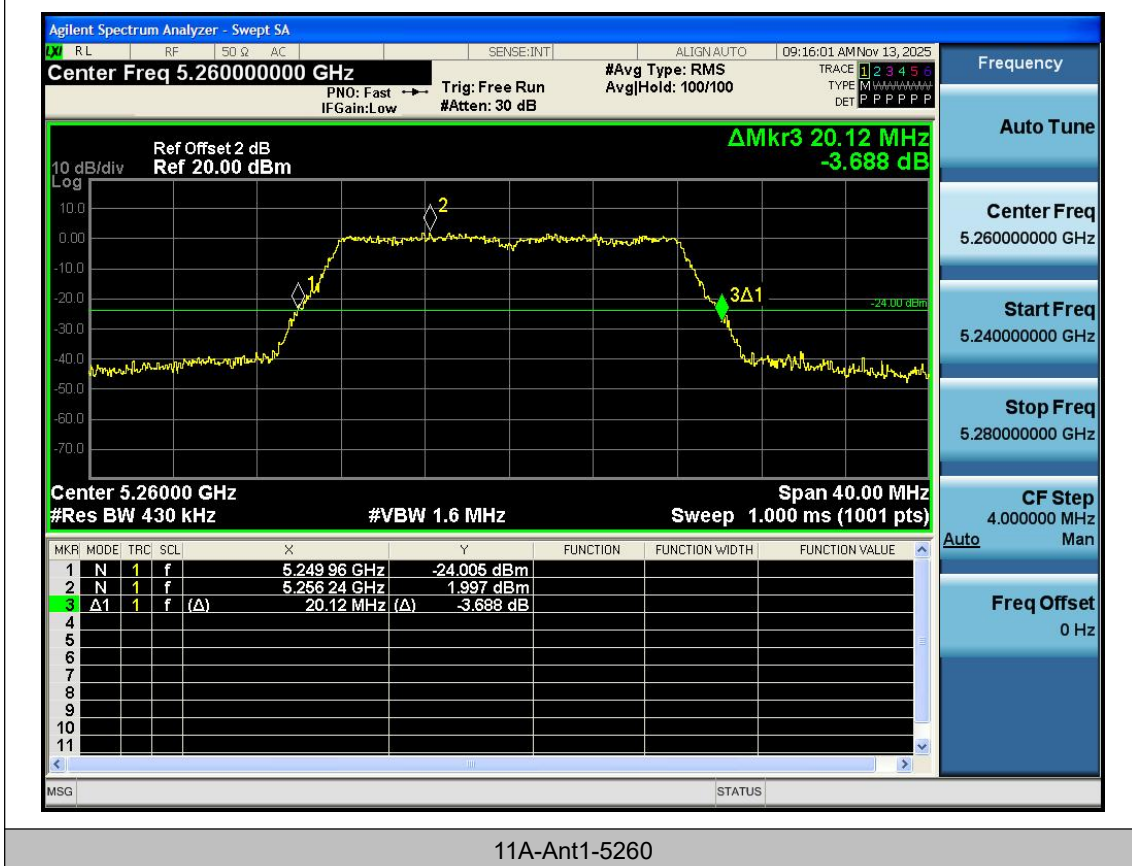

11A-Ant1-5260

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com



11A-Ant1-5300




11A-Ant1-5320

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

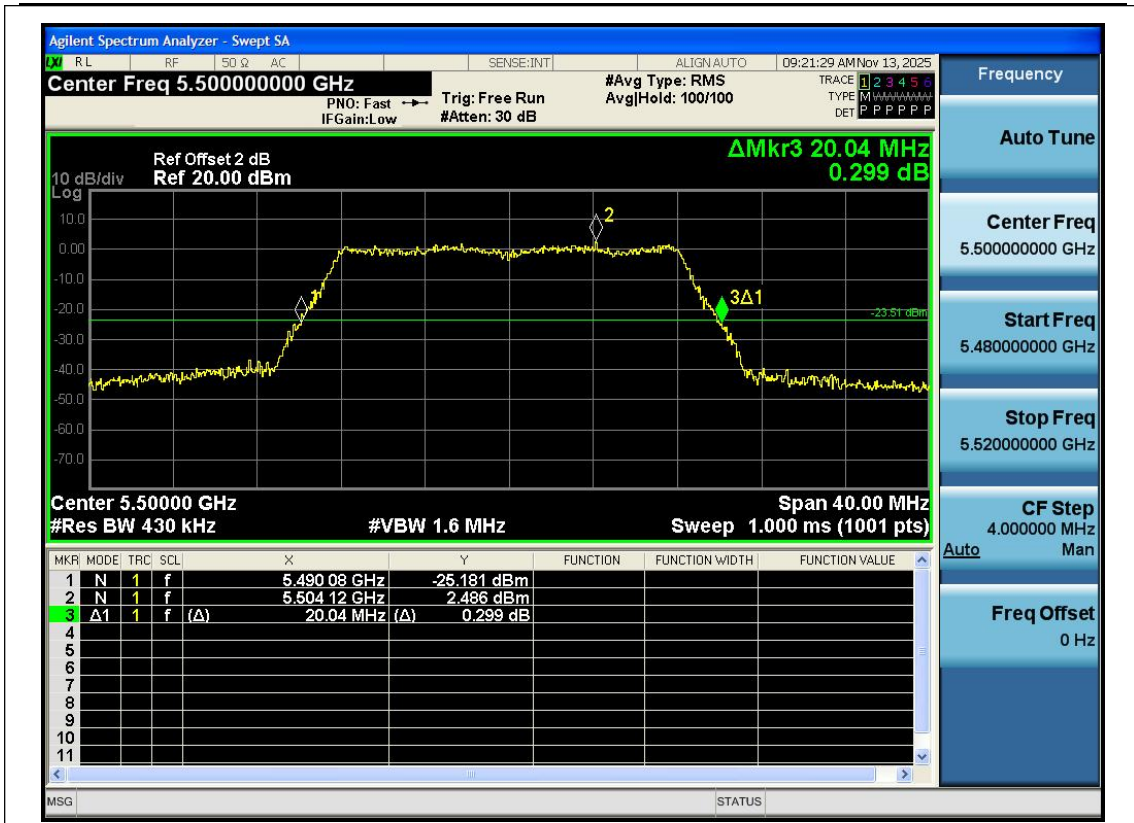

11A-Ant1-5500



11A-Ant1-5580

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com



11A-Ant1-5700



11A-Ant1-5745

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com



11A-Ant1-5785




11A-Ant1-5825

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

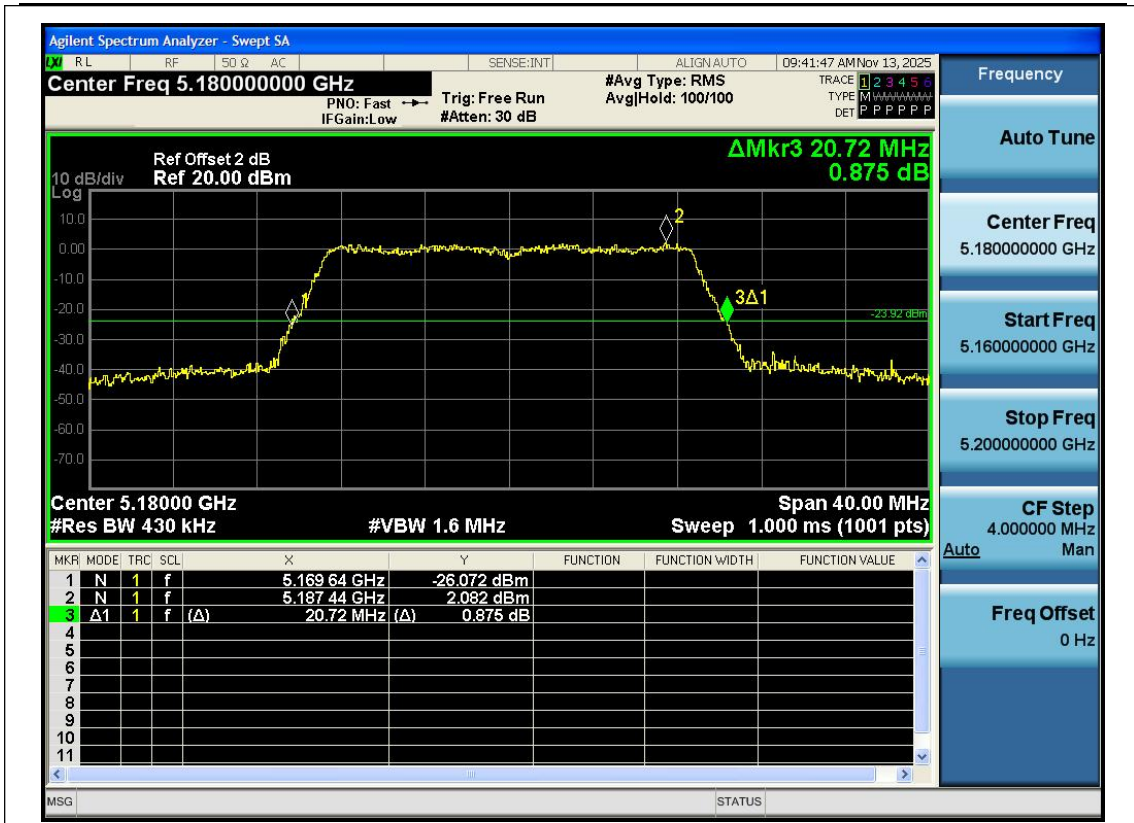

11N20SISO-Ant1-5180



11N20SISO-Ant1-5220

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com



11N20SISO-Ant1-5240



11N20SISO-Ant1-5260

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com



11N20SISO-Ant1-5300



11N20SISO-Ant1-5320


Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com



11N20SISO-Ant1-5500

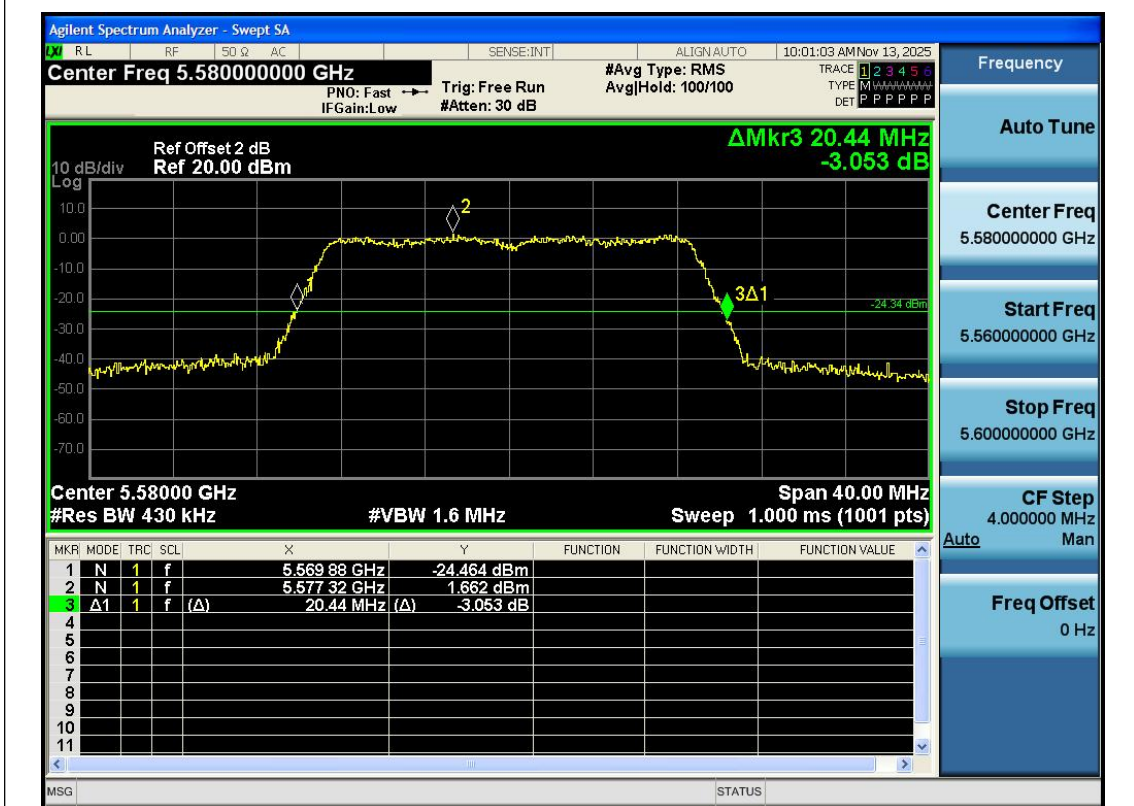


11N20SISO-Ant1-5580

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

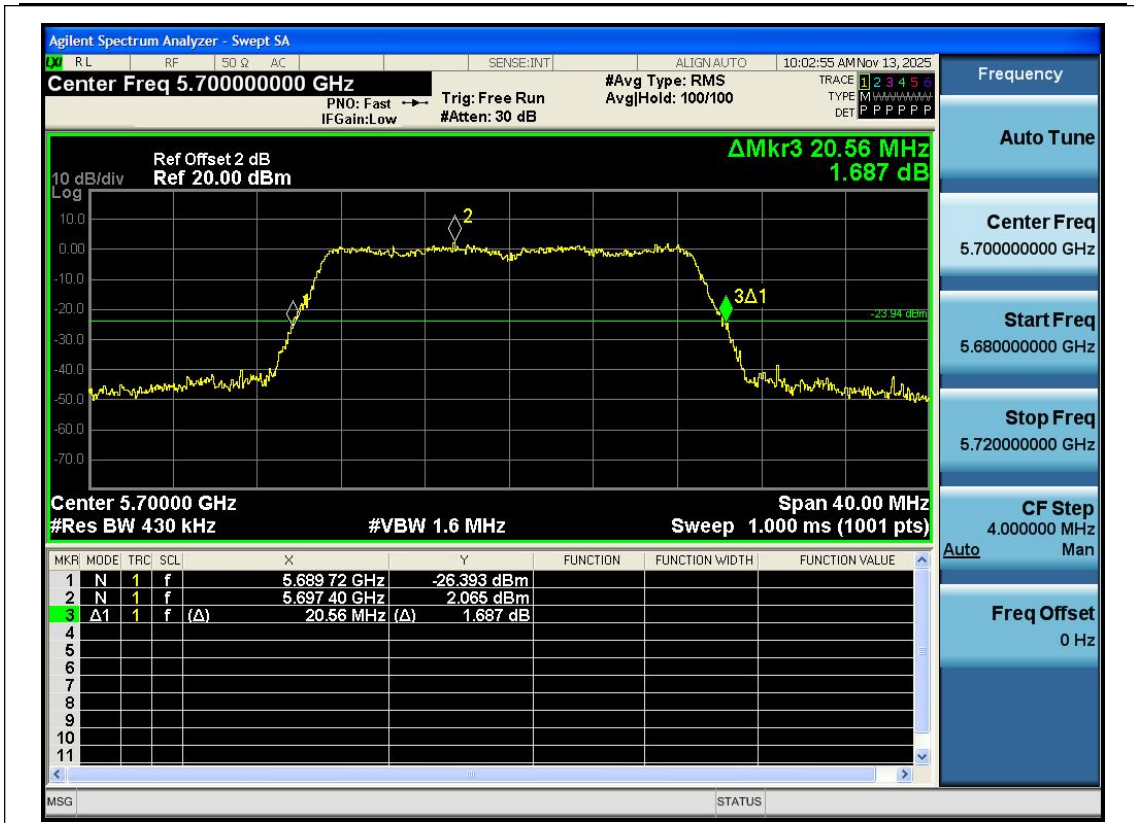

11N20SISO-Ant1-5700




11N20SISO-Ant1-5745

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

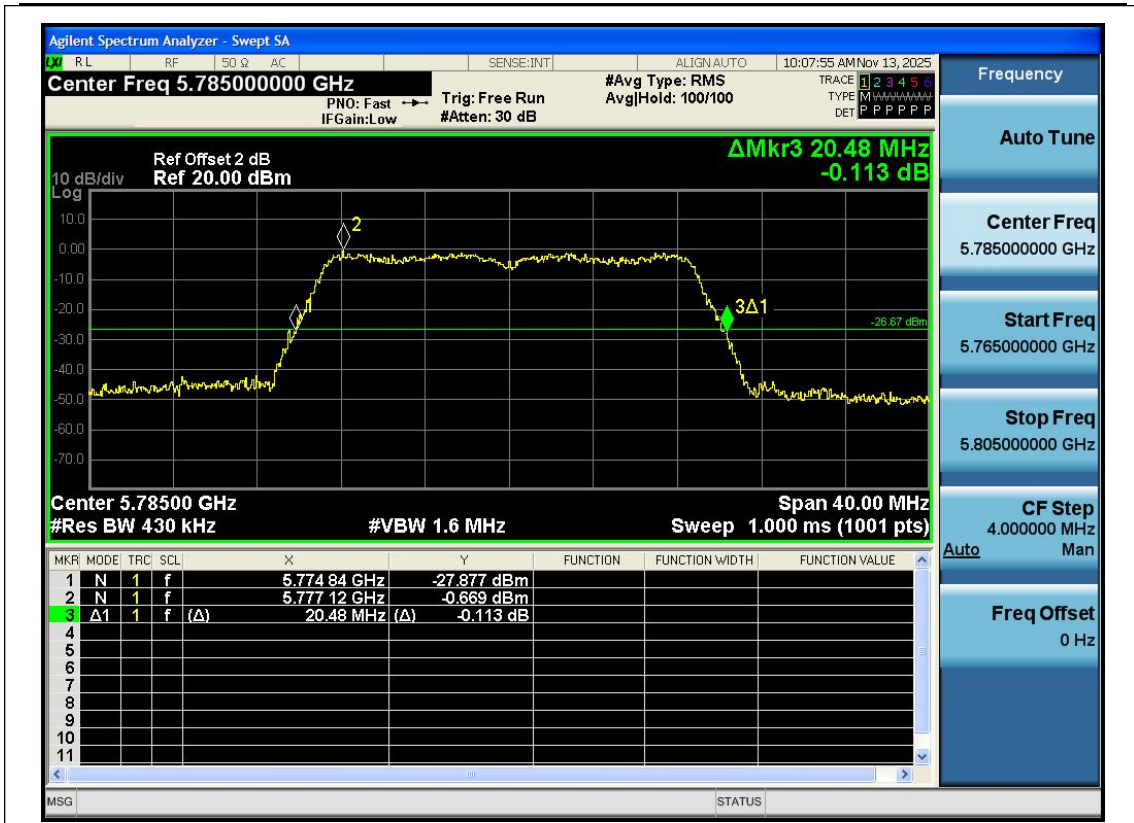

11N20SISO-Ant1-5785




11N20SISO-Ant1-5825

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

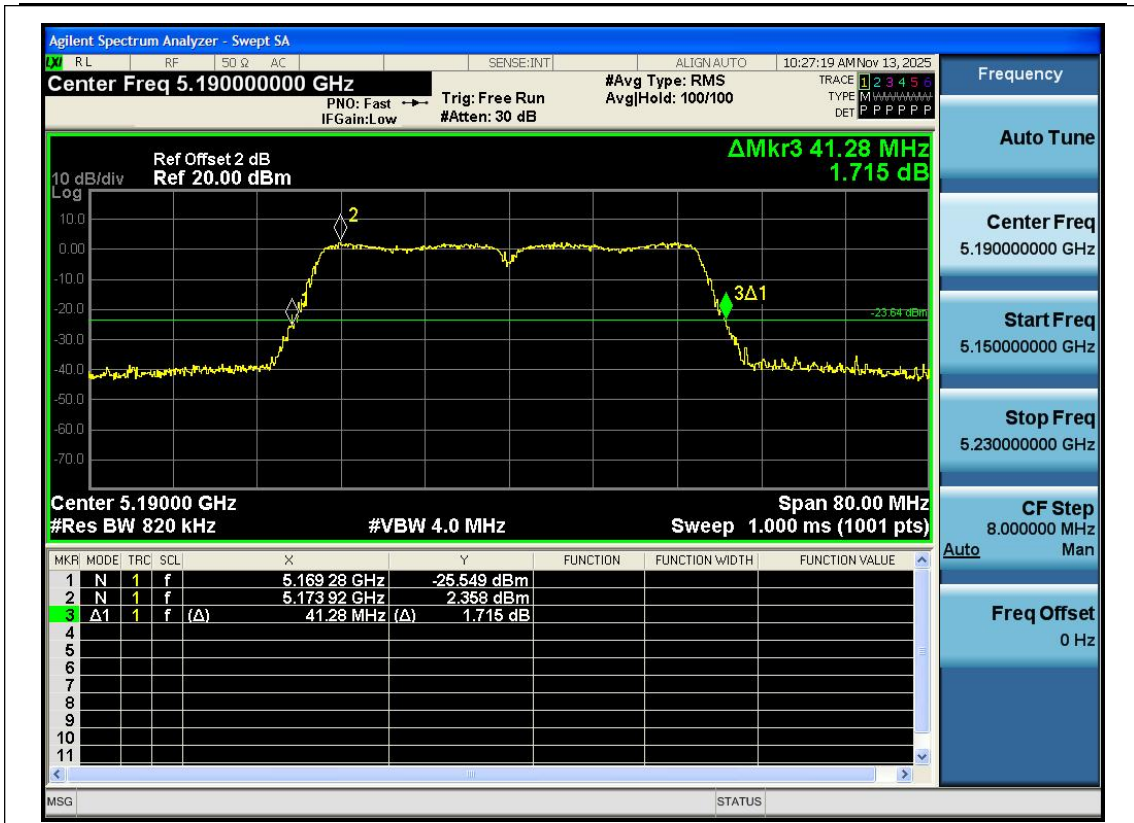

11N40SISO-Ant1-5190




11N40SISO-Ant1-5230


Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

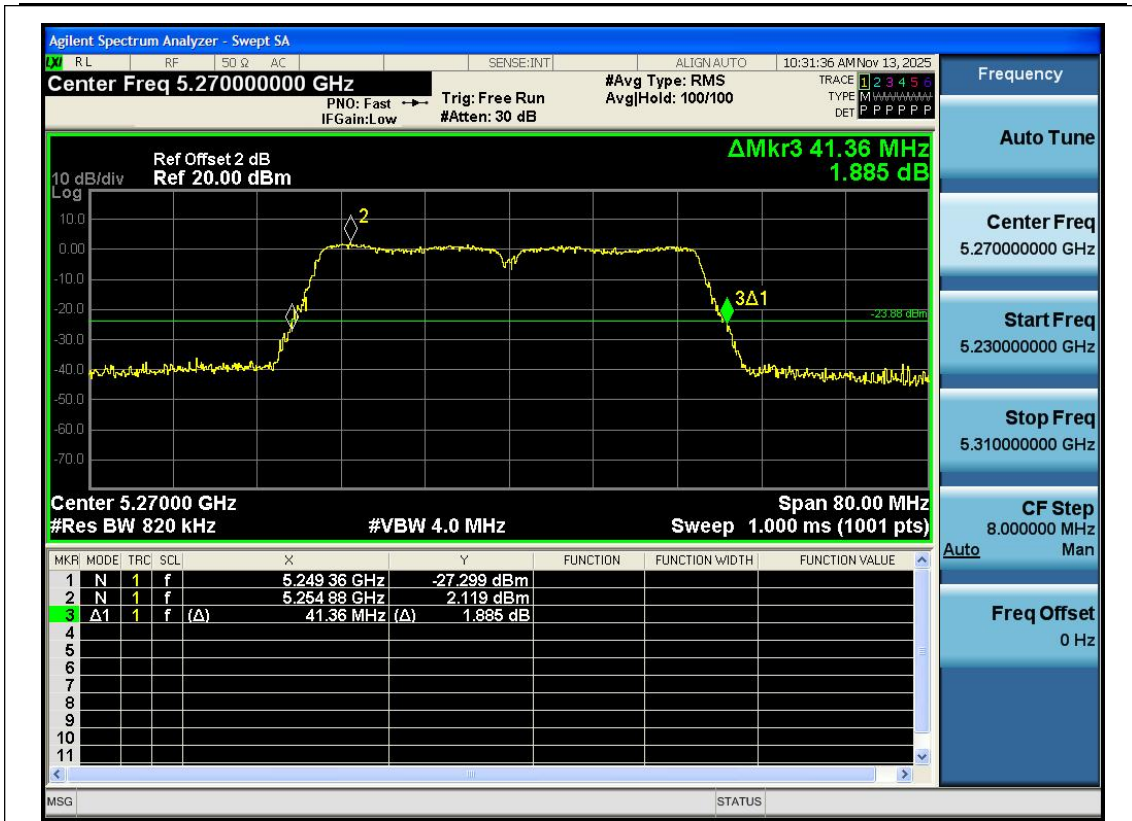

11N40SISO-Ant1-5270

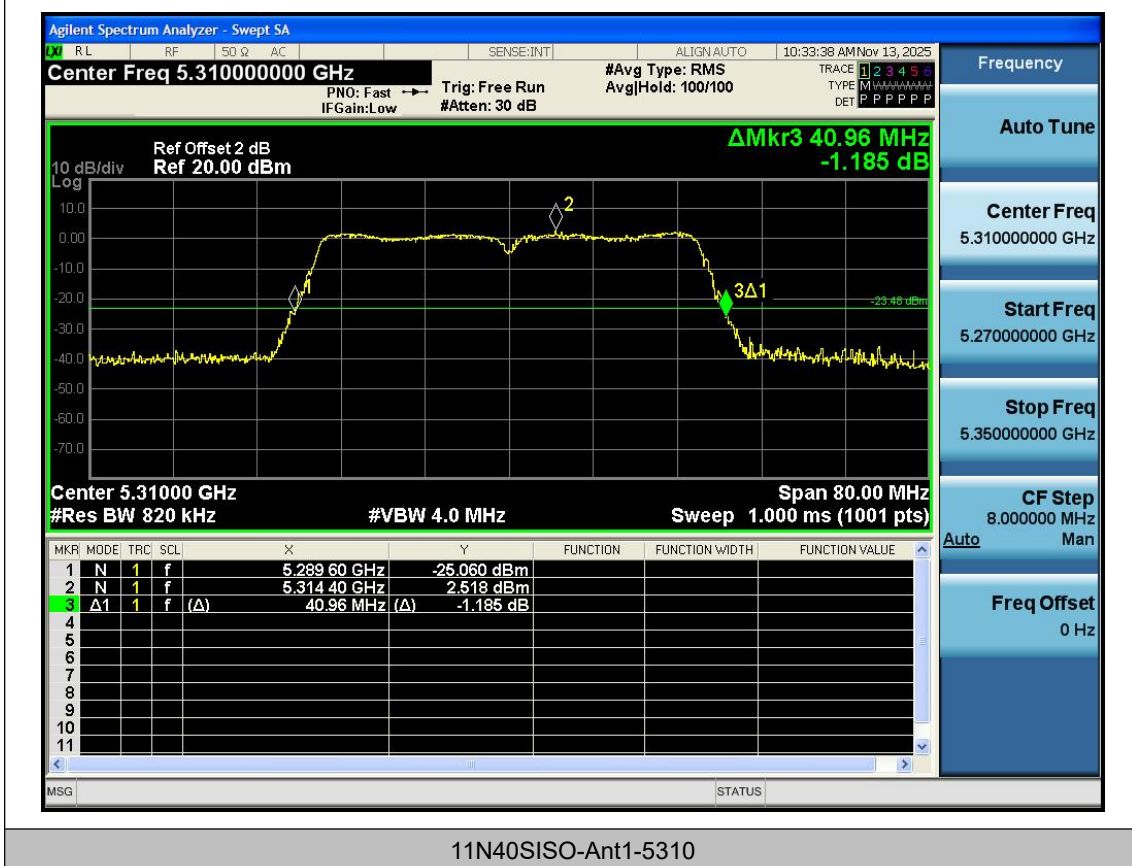


11N40SISO-Ant1-5310


Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

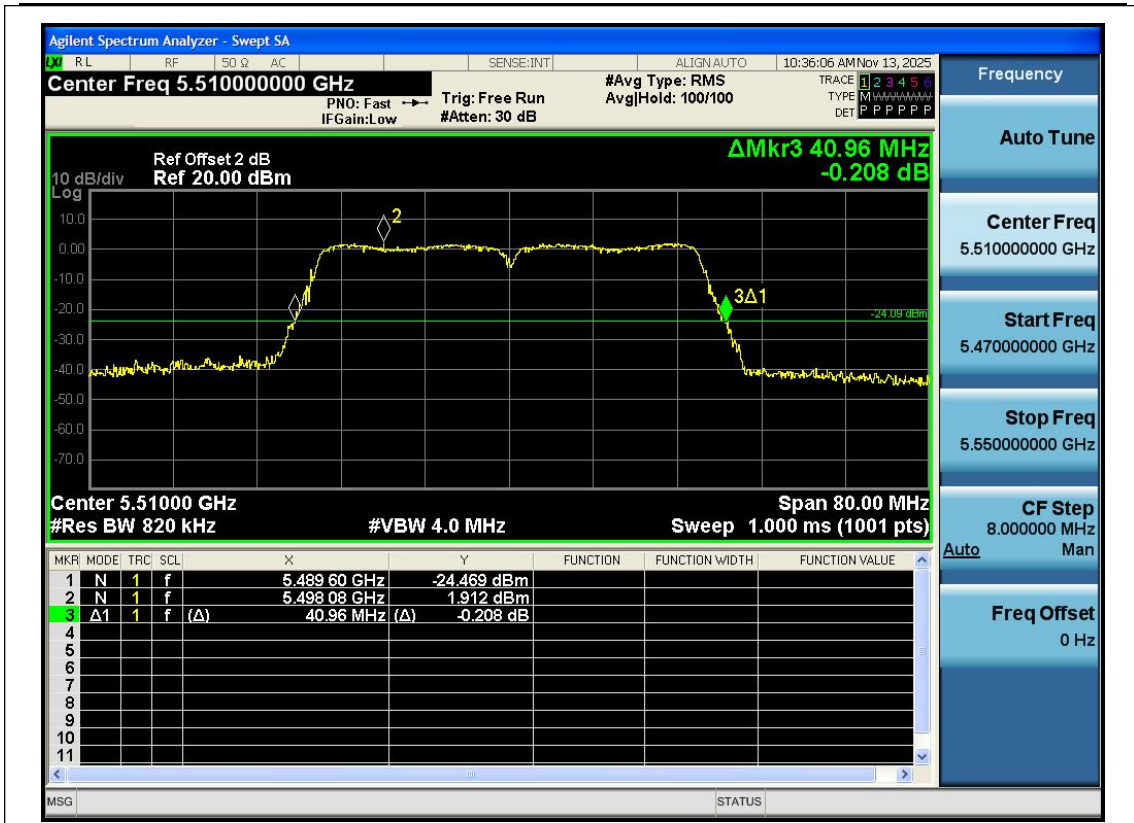

11N40SISO-Ant1-5510

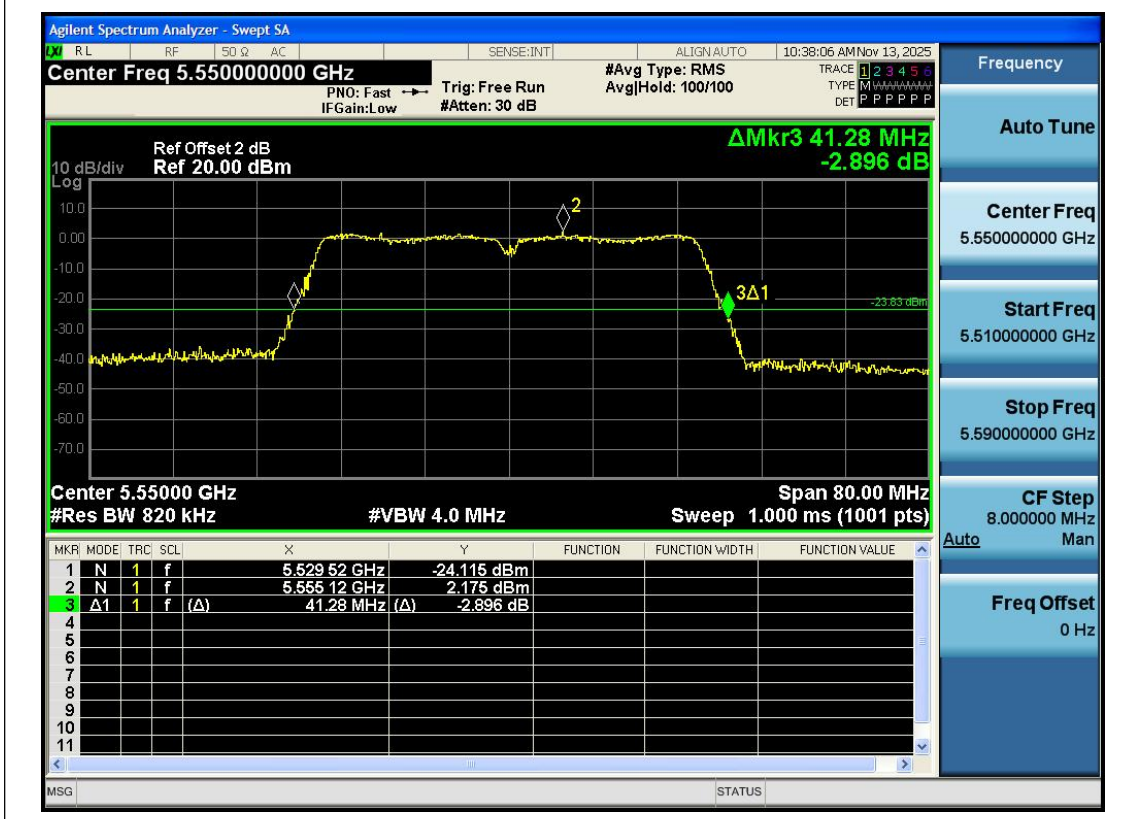


11N40SISO-Ant1-5550

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

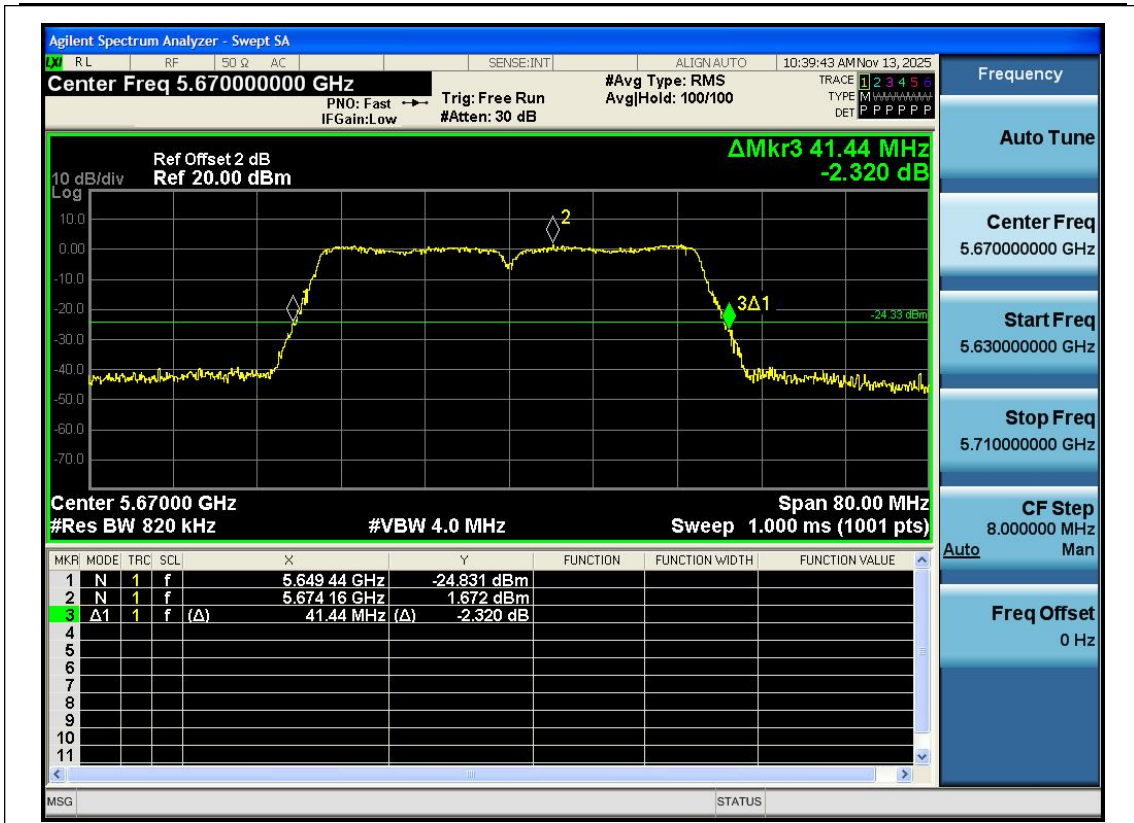

11N40SISO-Ant1-5670




11N40SISO-Ant1-5755

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

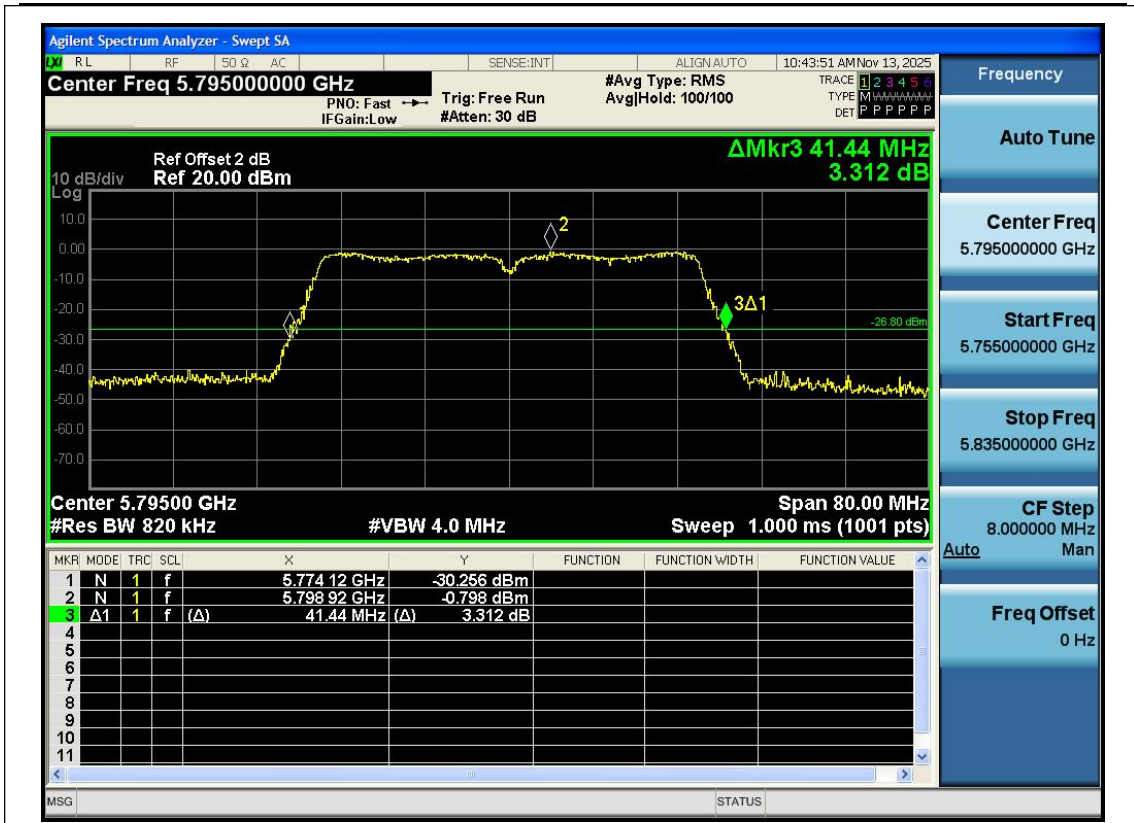

11N40SISO-Ant1-5795




11AC20SISO-Ant1-5180

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

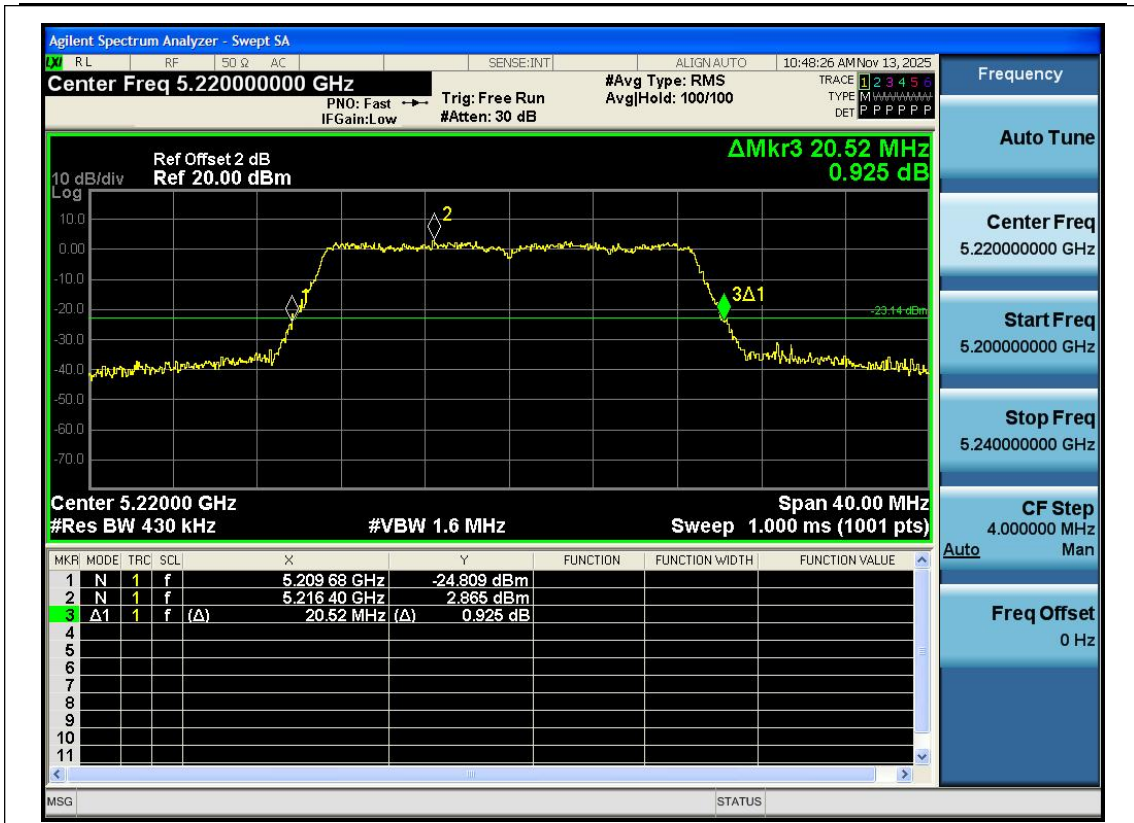

11AC20SISO-Ant1-5220



11AC20SISO-Ant1-5240

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com