



11N40SISO-Ant1-5190-PASS




11N40SISO-Ant1-5230-PASS


Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

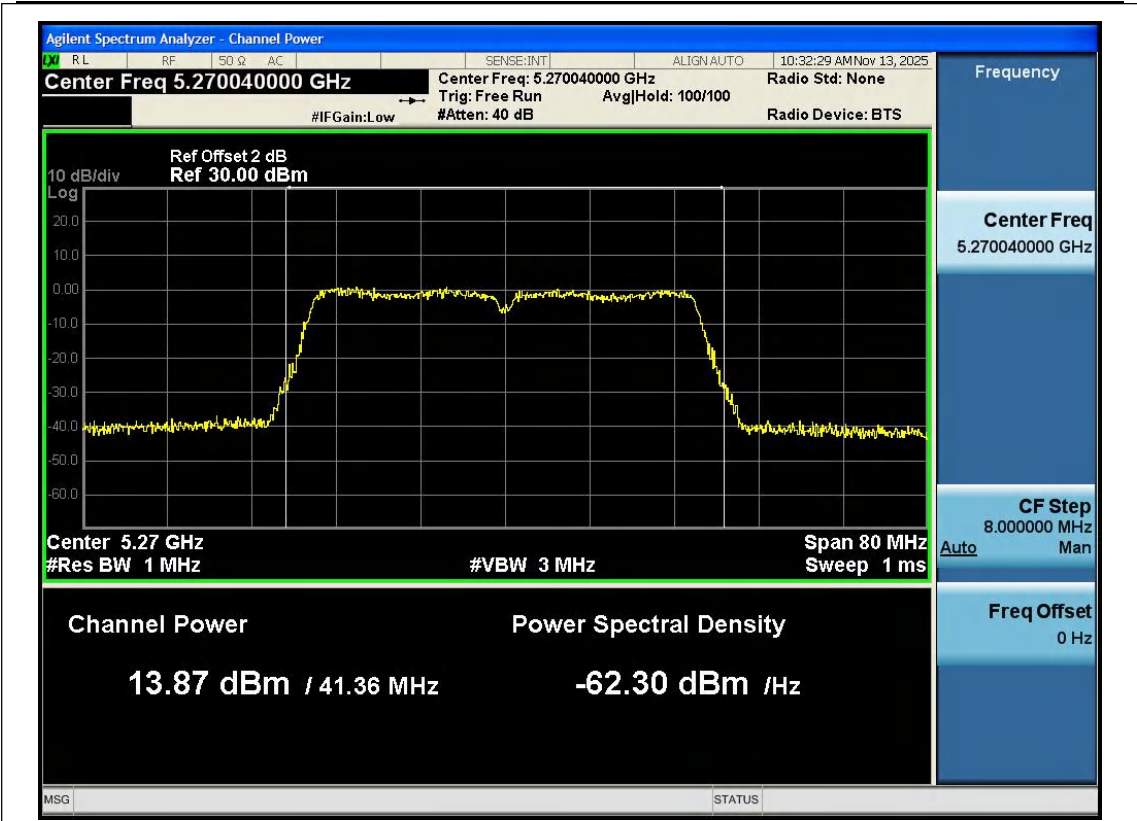

11N40SISO-Ant1-5270-PASS

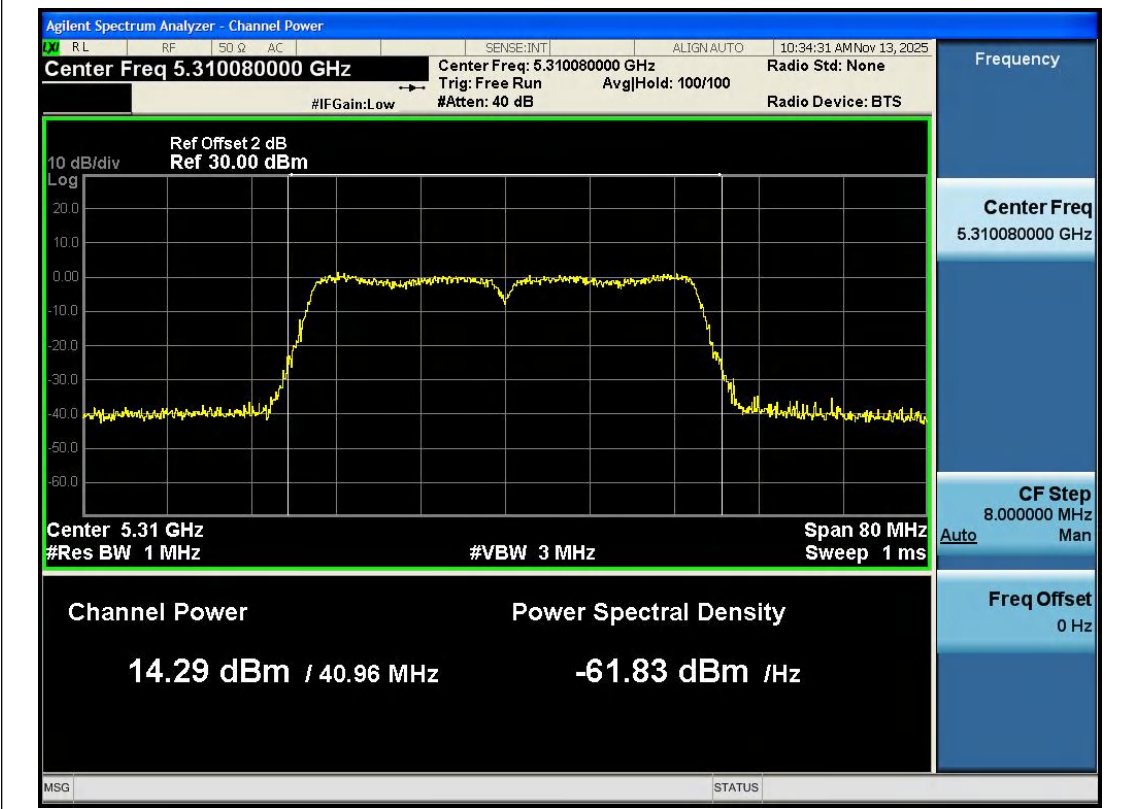


11N40SISO-Ant1-5310-PASS

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

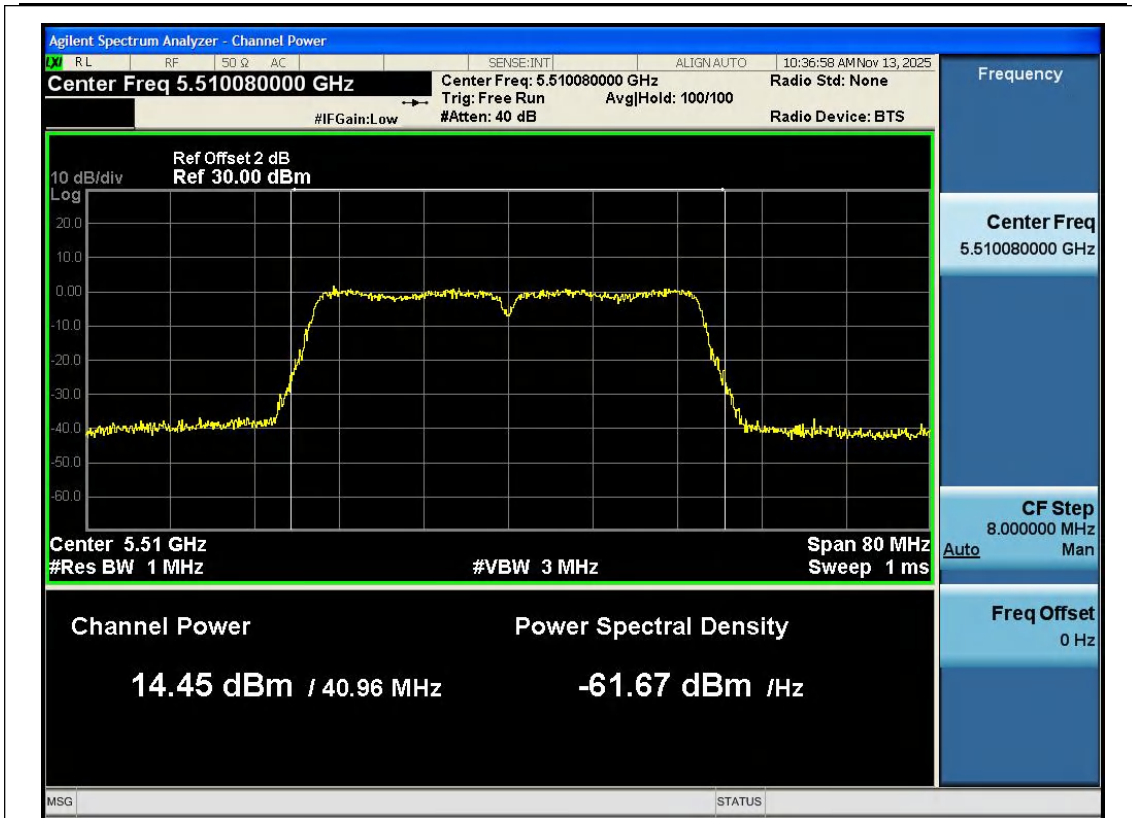

11N40SISO-Ant1-5510-PASS





11N40SISO-Ant1-5550-PASS

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

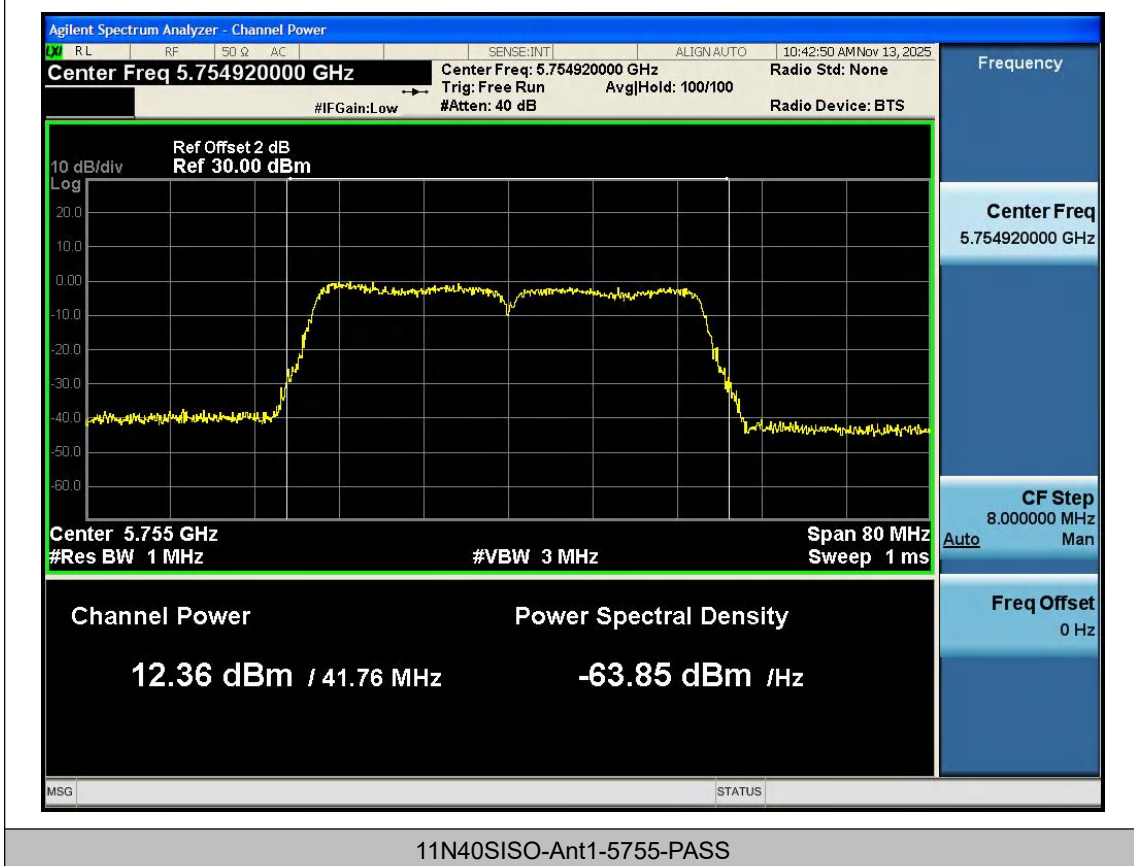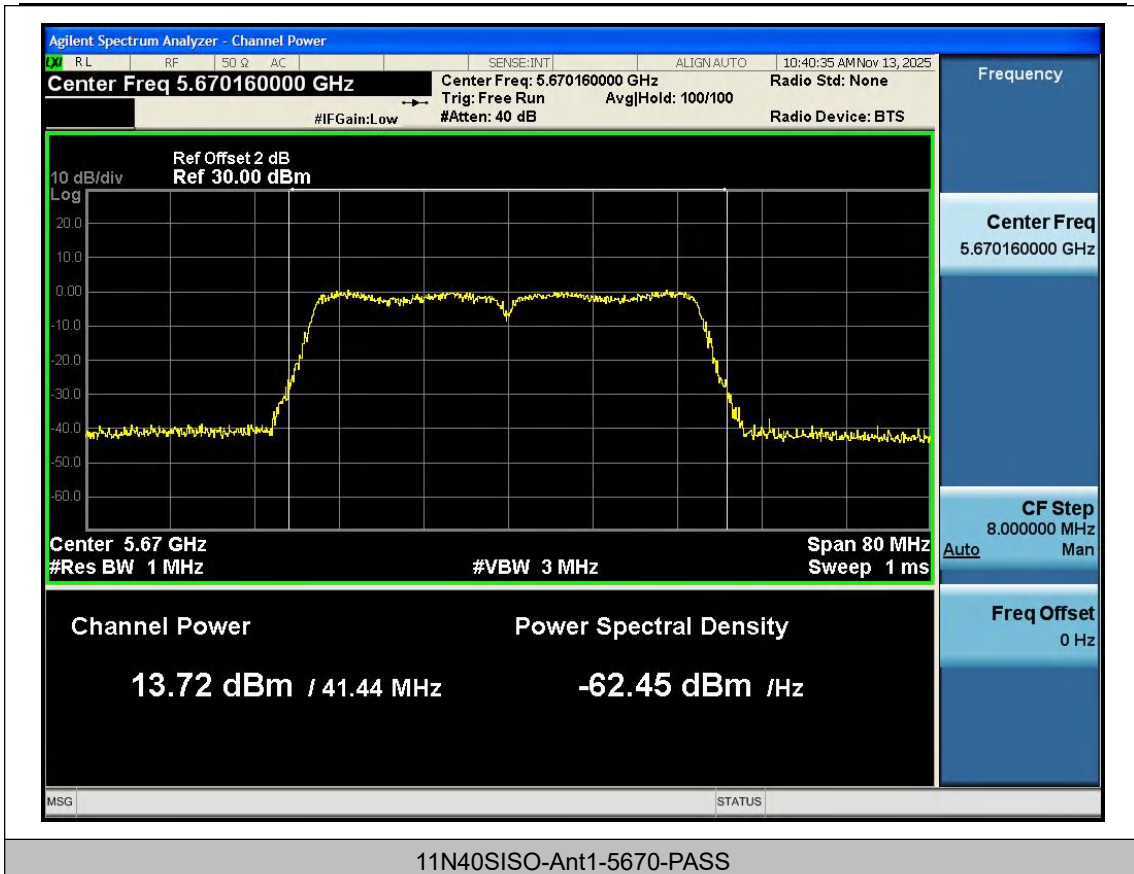

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

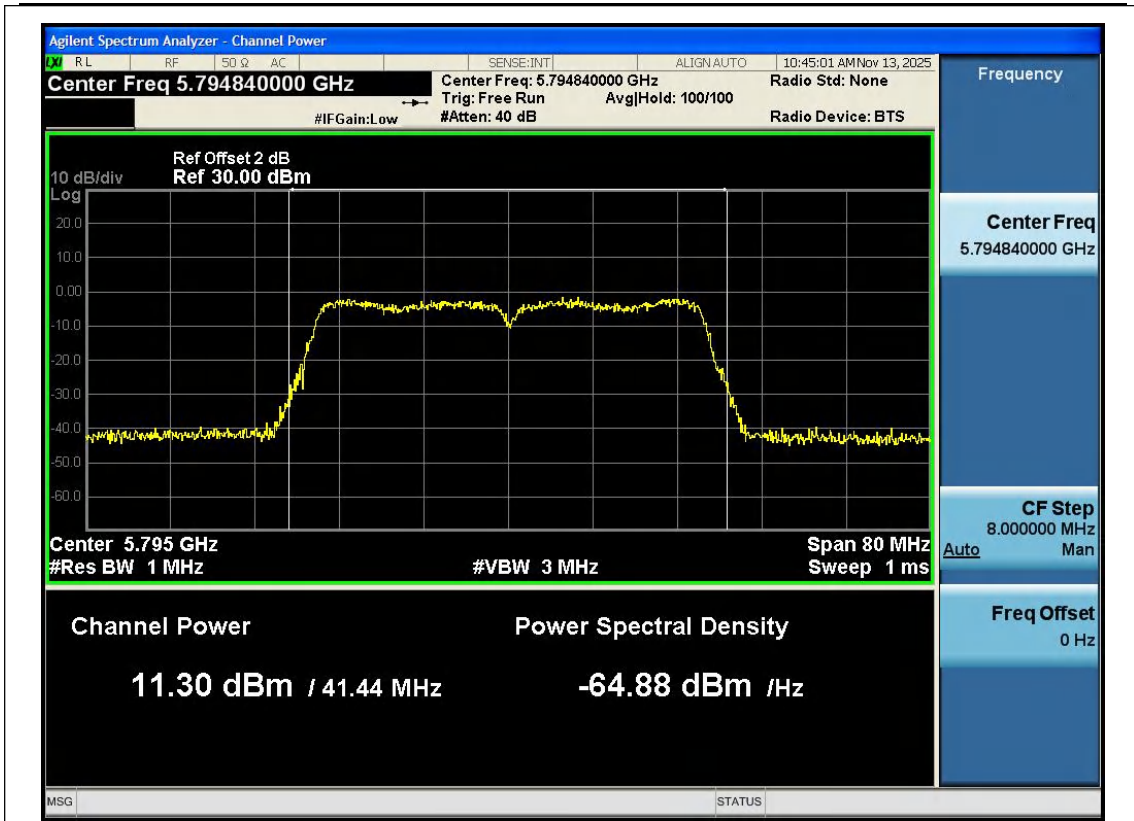

11N40SISO-Ant1-5795-PASS




11AC20SISO-Ant1-5180-PASS

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.



Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

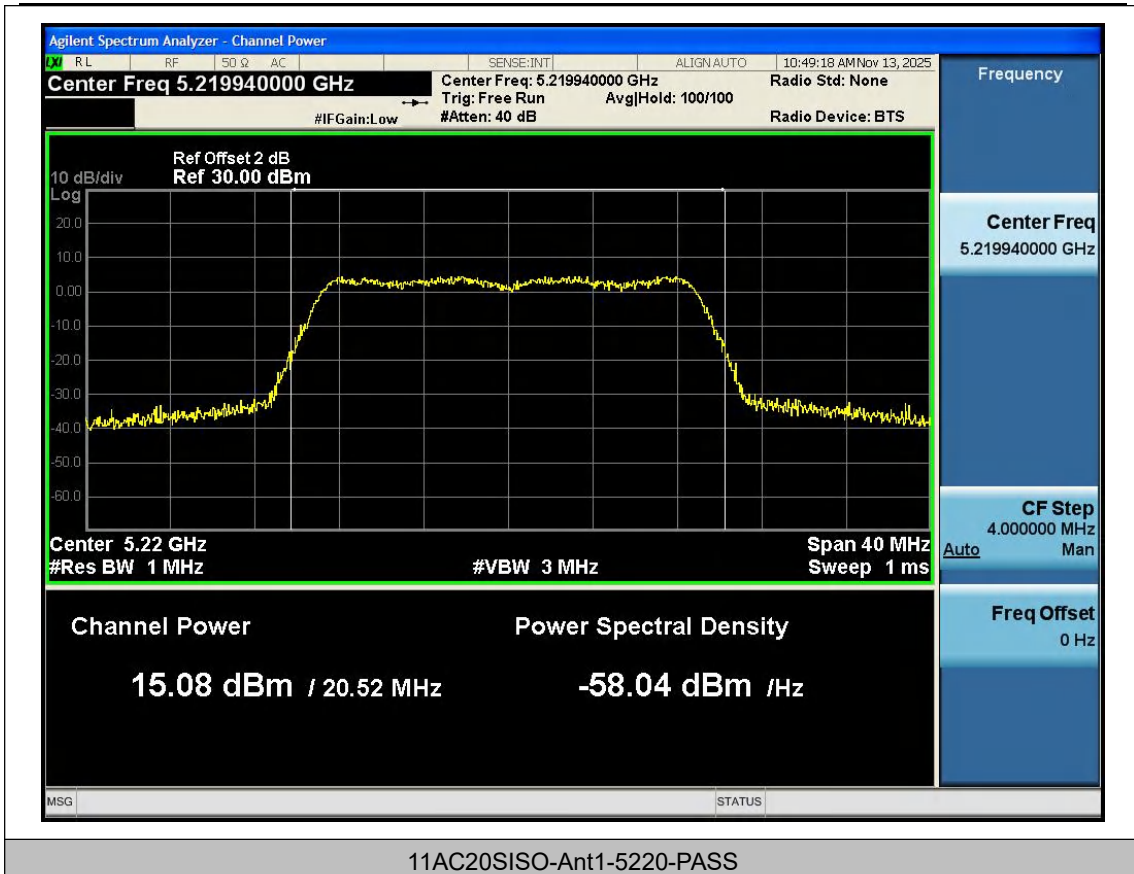

Shenzhen Anbotech Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotech.com E-mail: service@anbotech.com

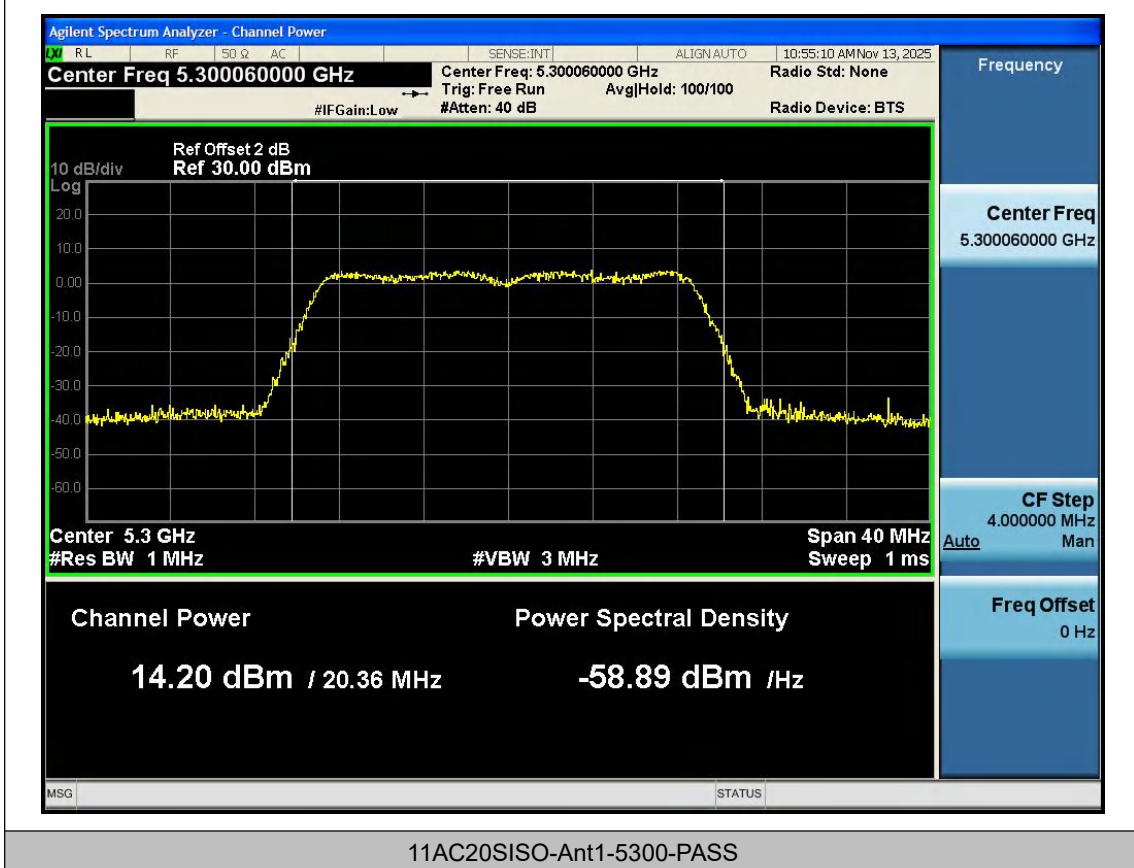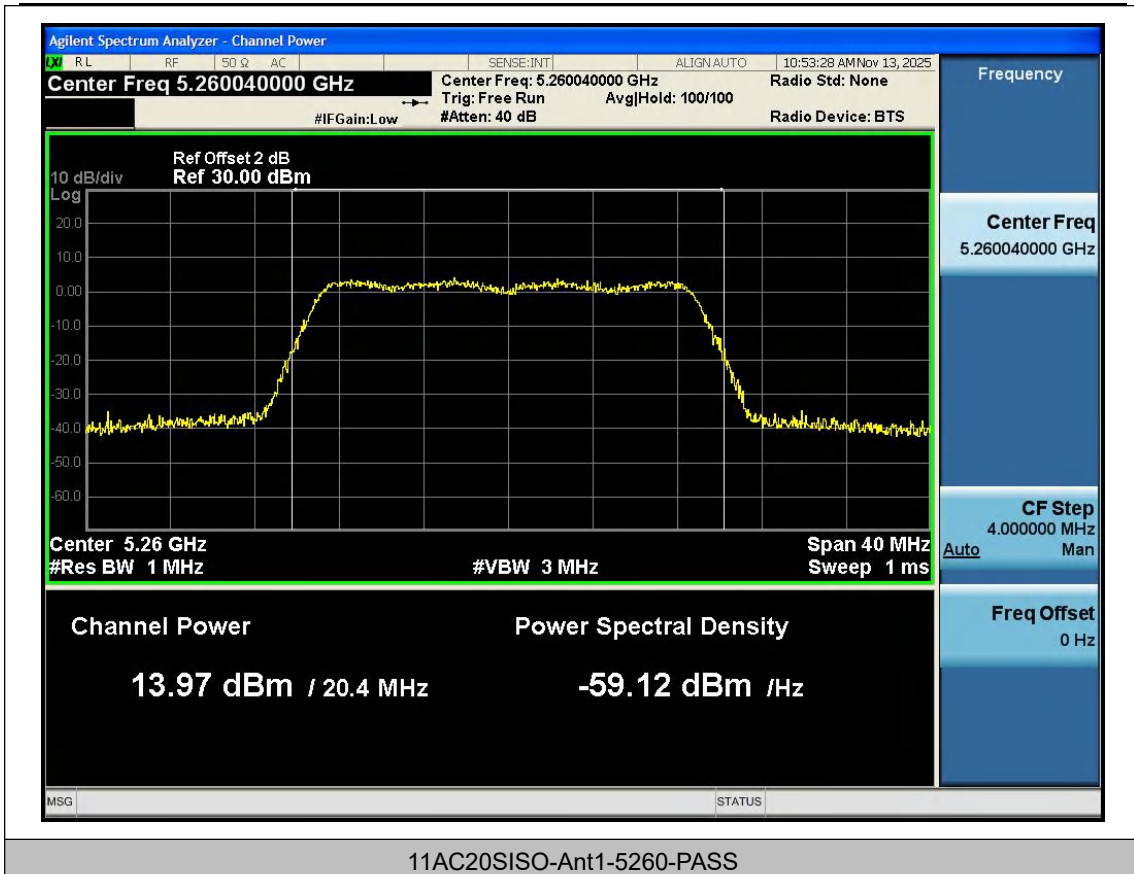

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

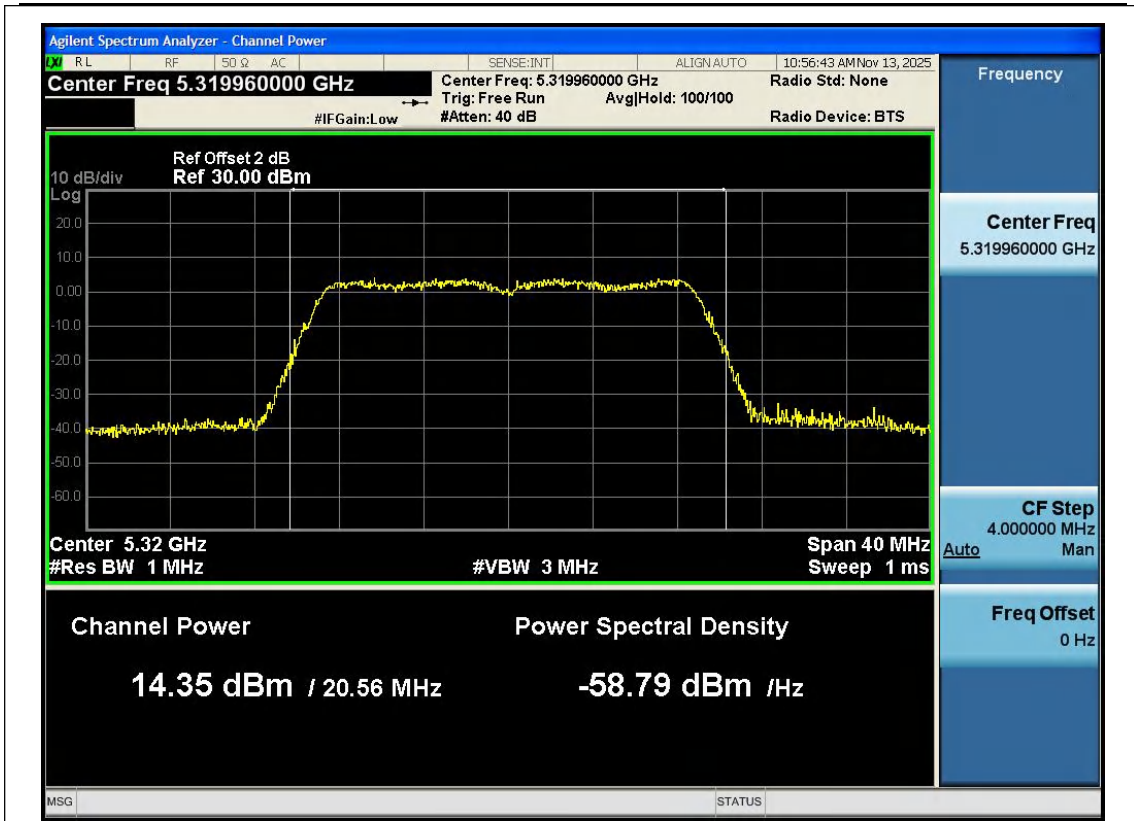

11AC20SISO-Ant1-5320-PASS



11AC20SISO-Ant1-5500-PASS

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com



11AC20SISO-Ant1-5580-PASS





11AC20SISO-Ant1-5700-PASS

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.



Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

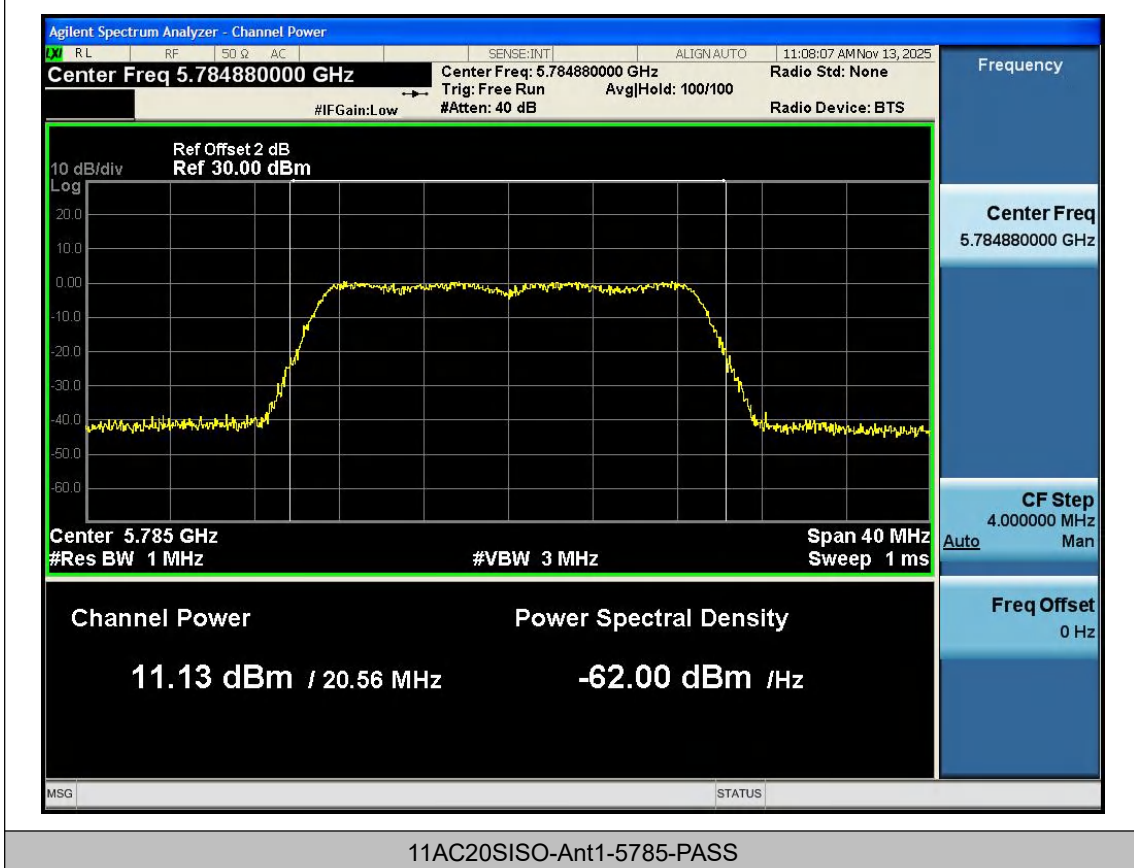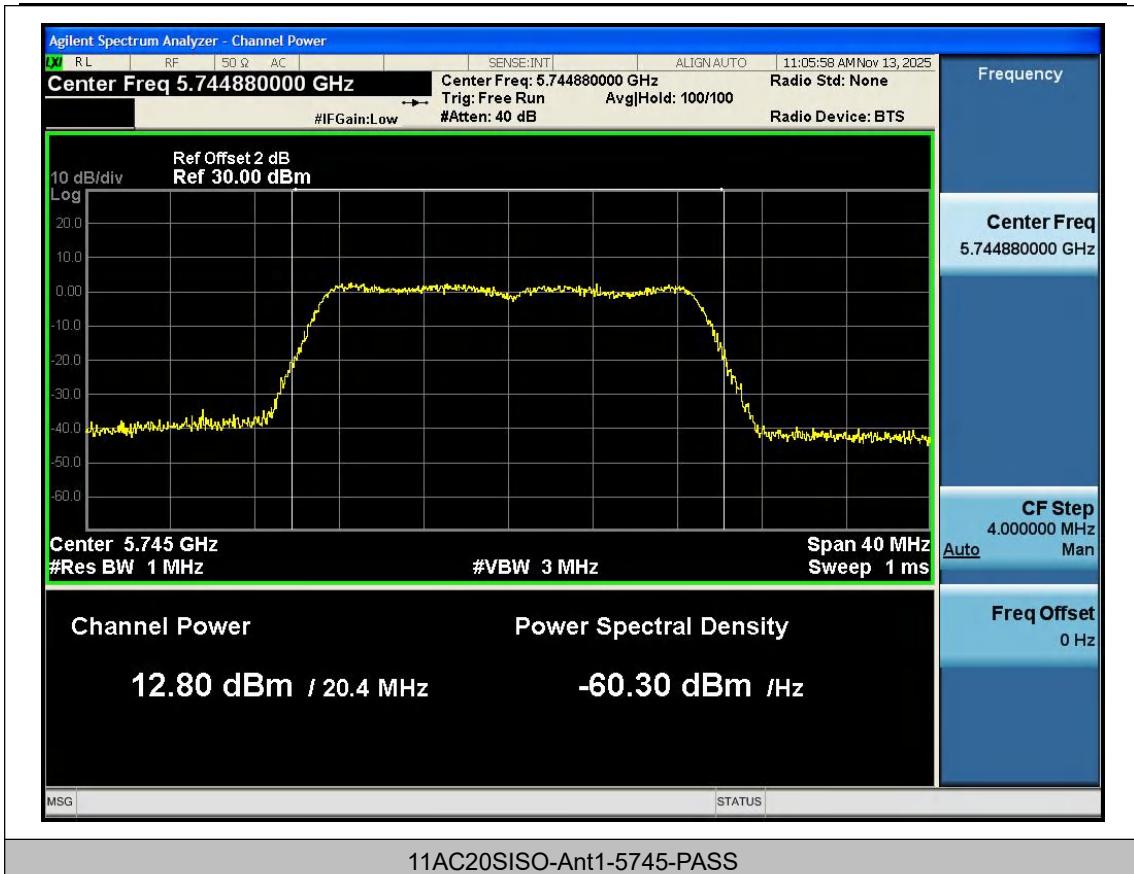

Shenzhen Anbotech Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.



Hotline: 400-003-0500 web: www.anbotech.com E-mail: service@anbotech.com

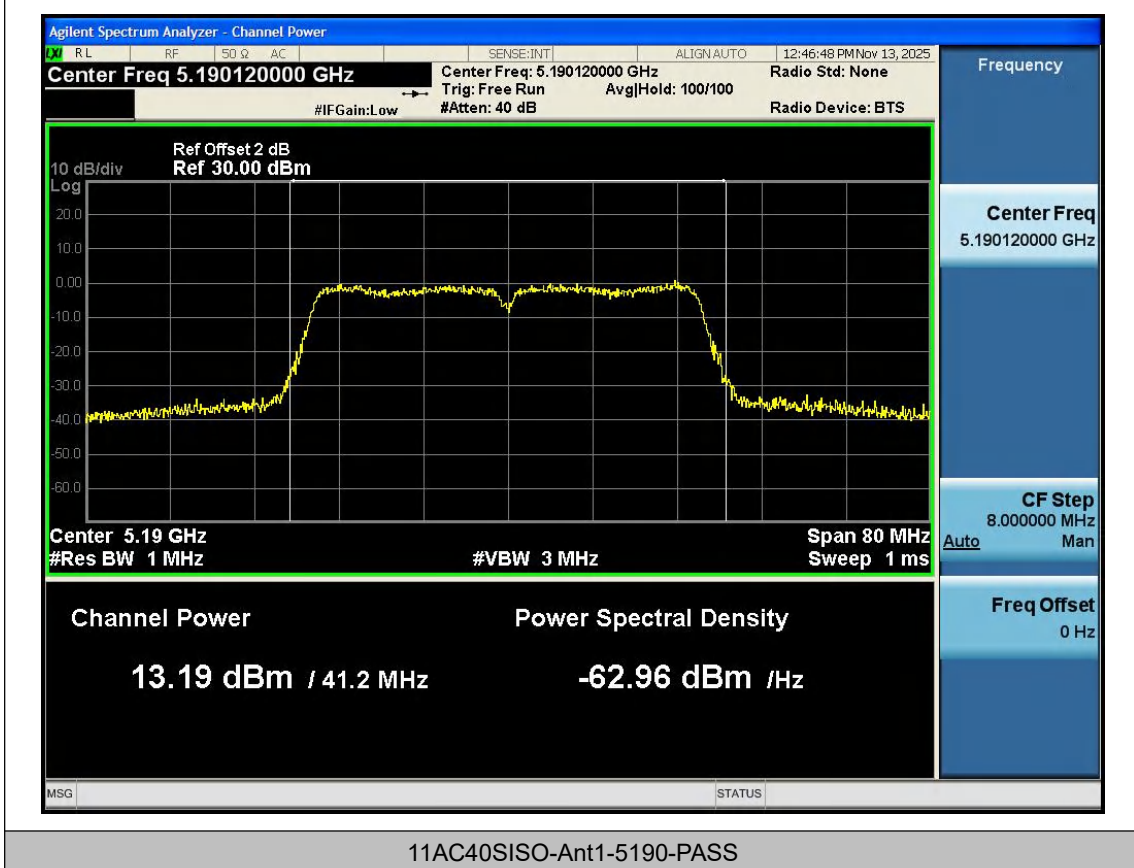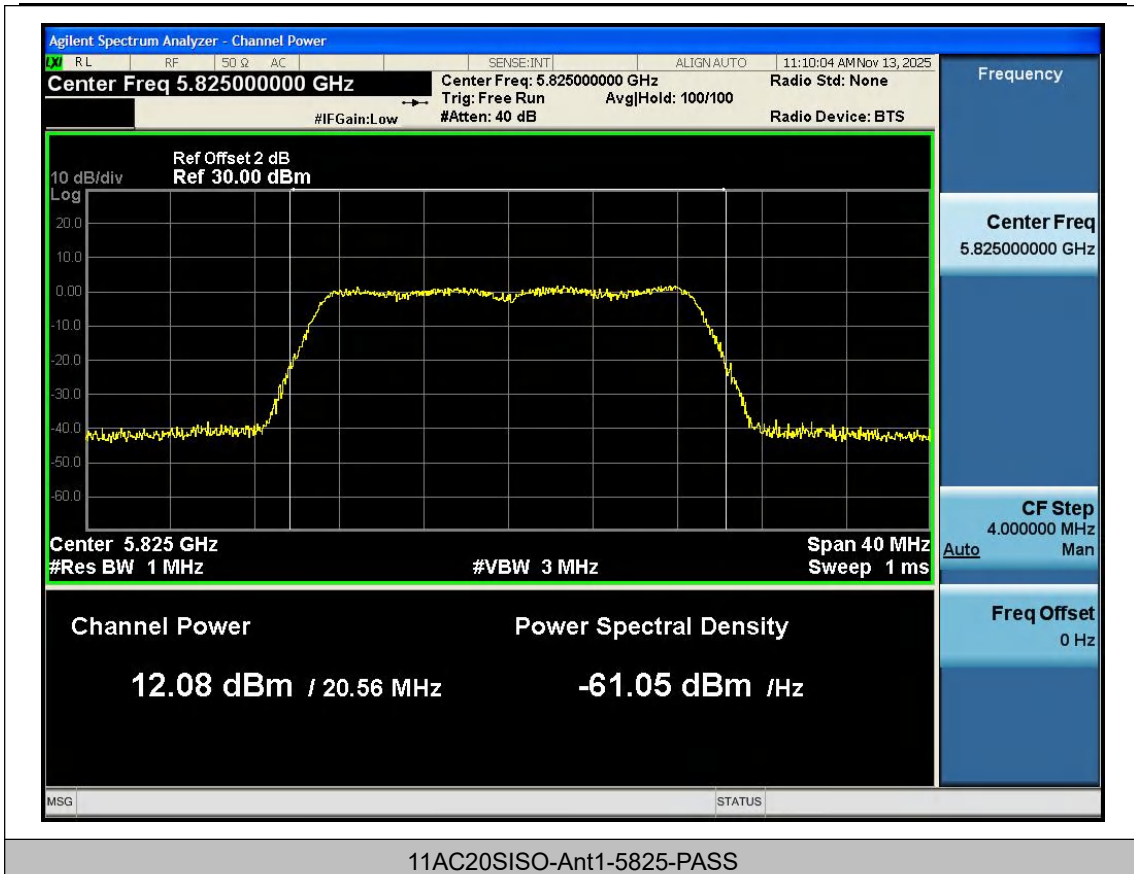

Shenzhen Anbotech Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotech.com E-mail: service@anbotech.com

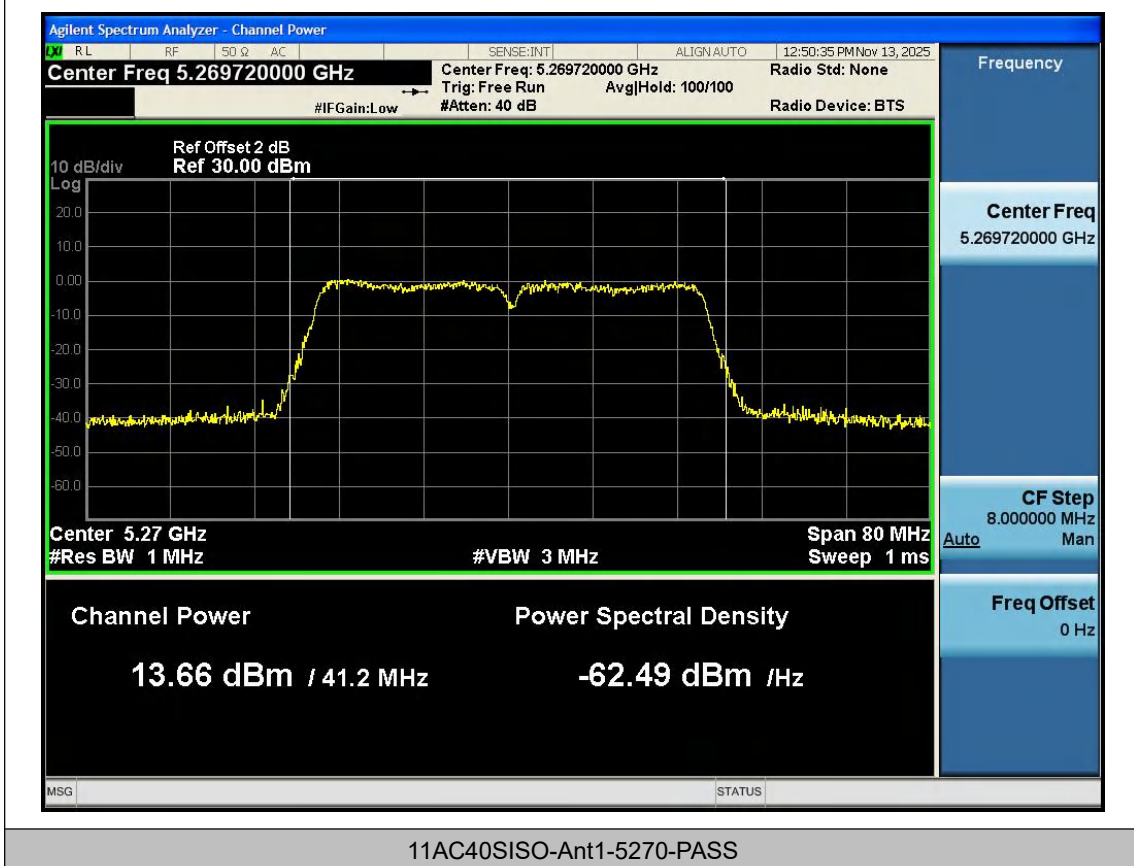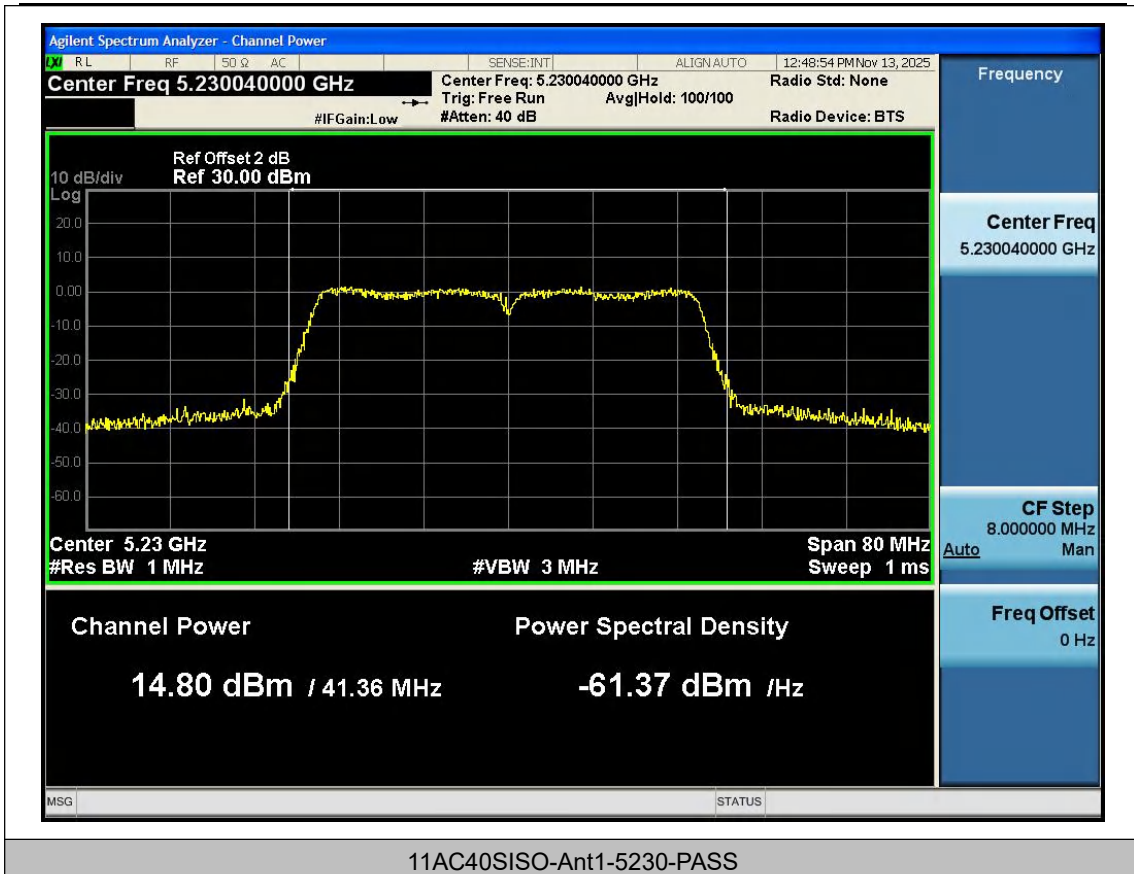

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com



11AC40SISO-Ant1-5310-PASS




11AC40SISO-Ant1-5510-PASS

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

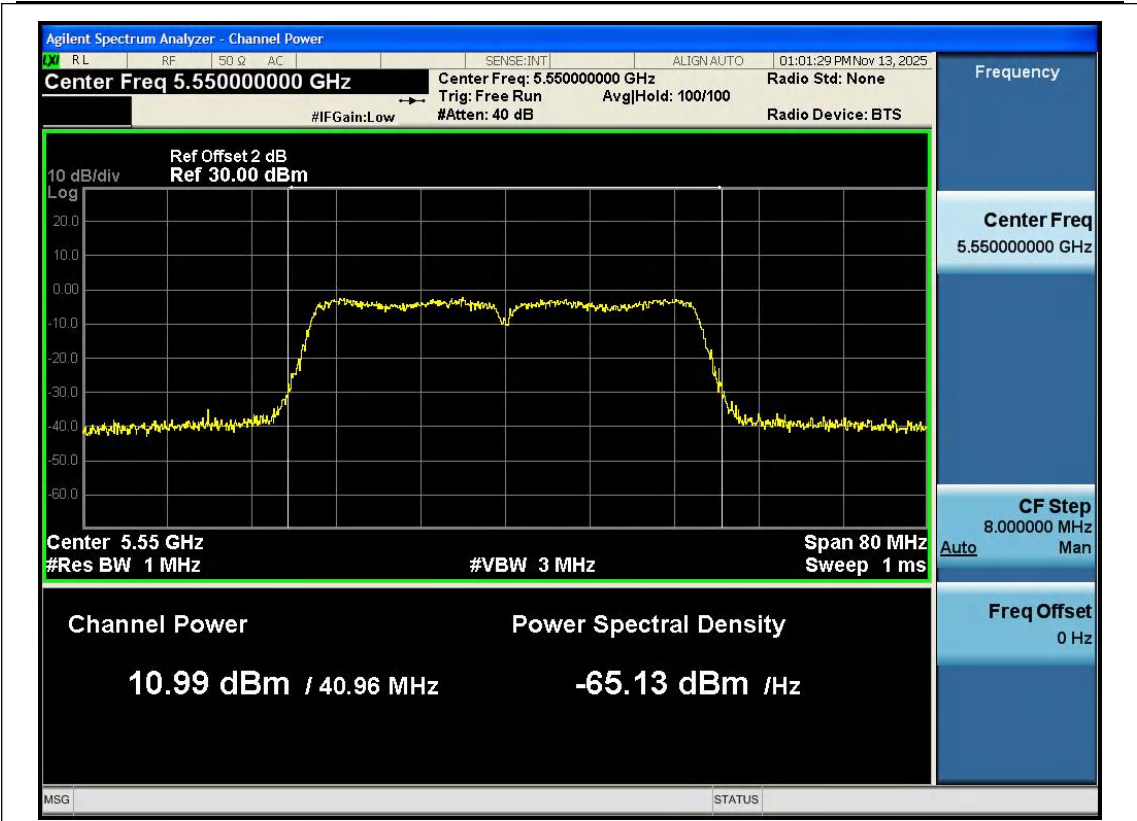

11AC40SISO-Ant1-5550-PASS




11AC40SISO-Ant1-5670-PASS


Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

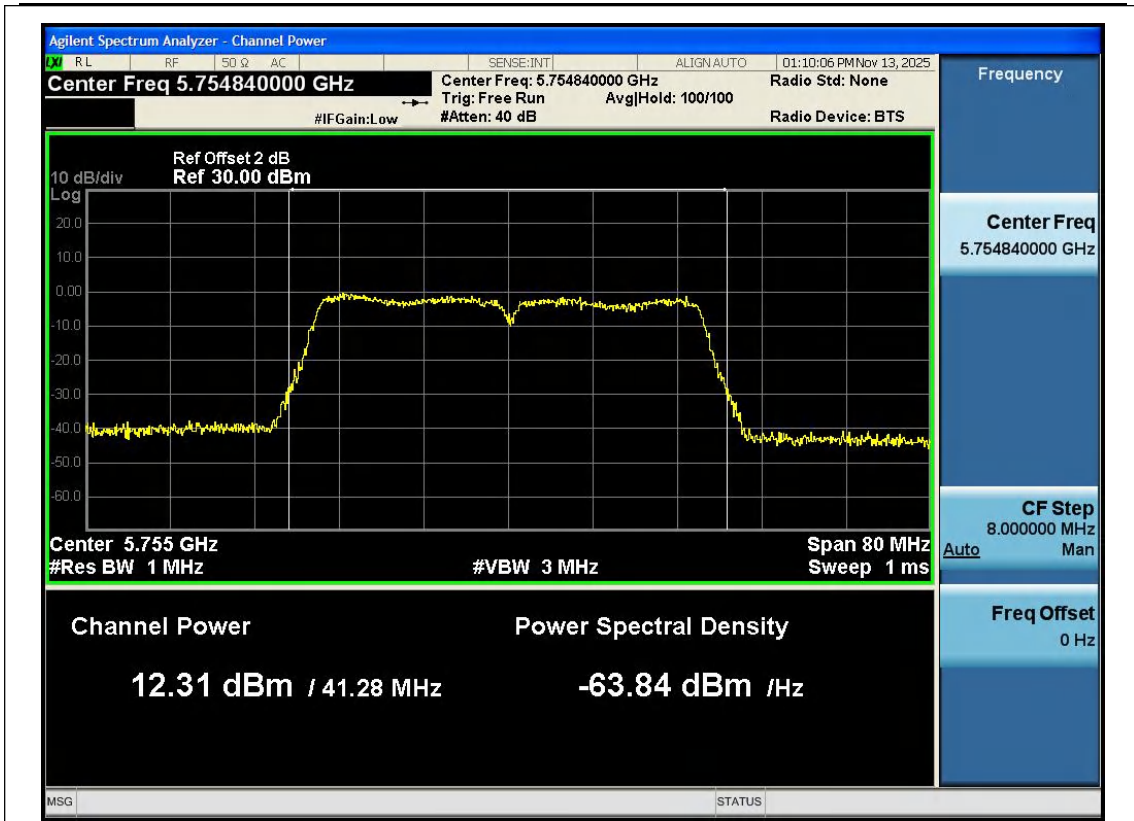

11AC40SISO-Ant1-5755-PASS

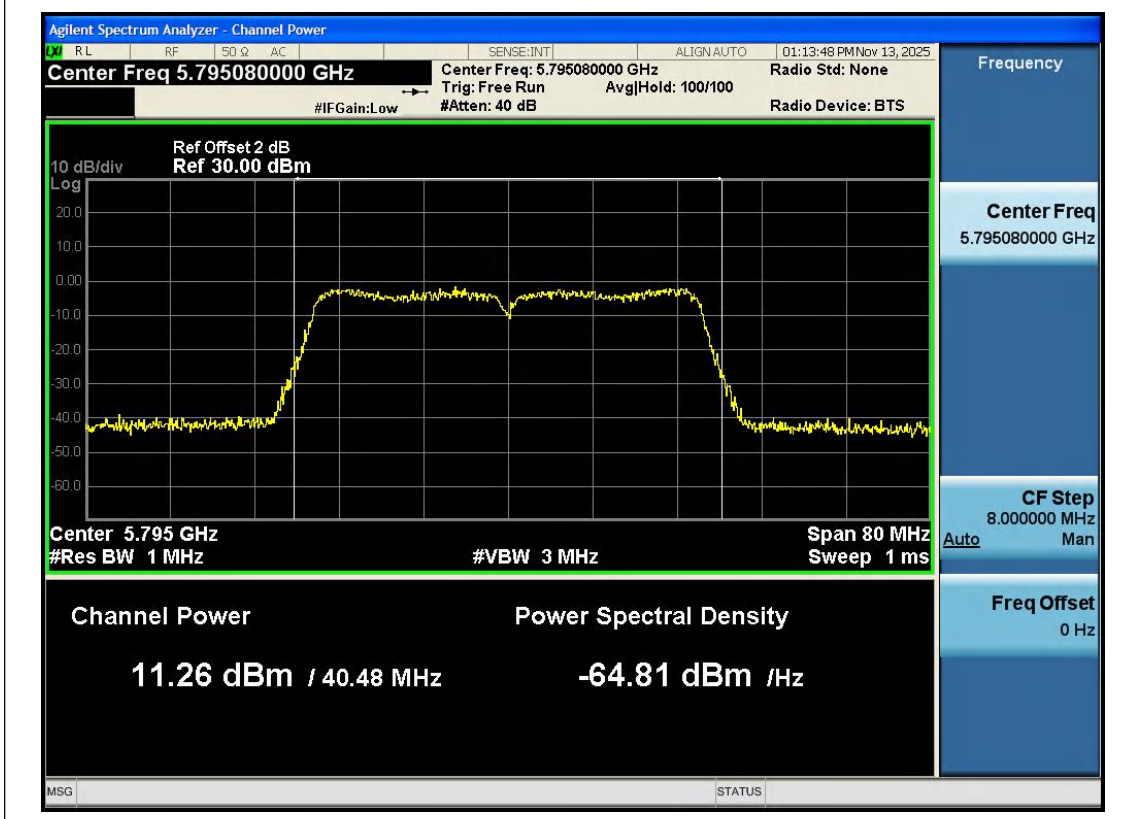


11AC40SISO-Ant1-5795-PASS

Shenzhen Anbotech Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotech.com E-mail: service@anbotech.com

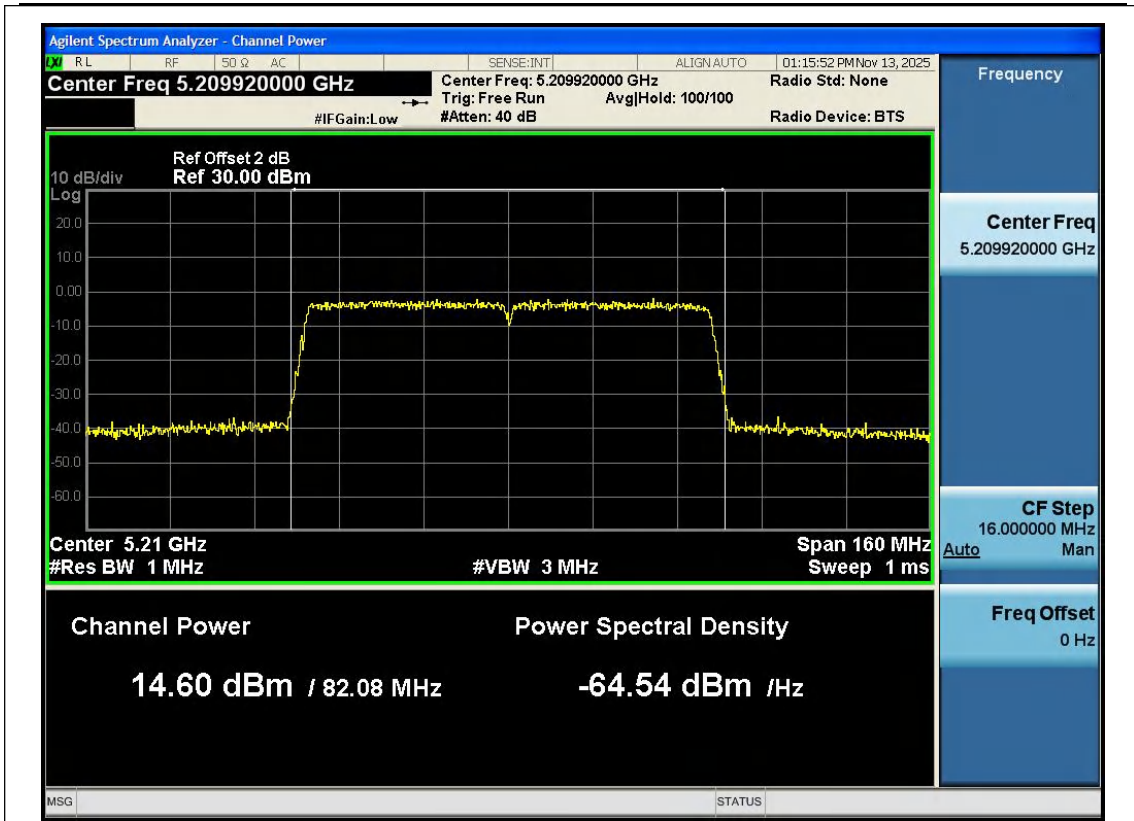

11AC80SISO-Ant1-5210-PASS





11AC80SISO-Ant1-5290-PASS

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

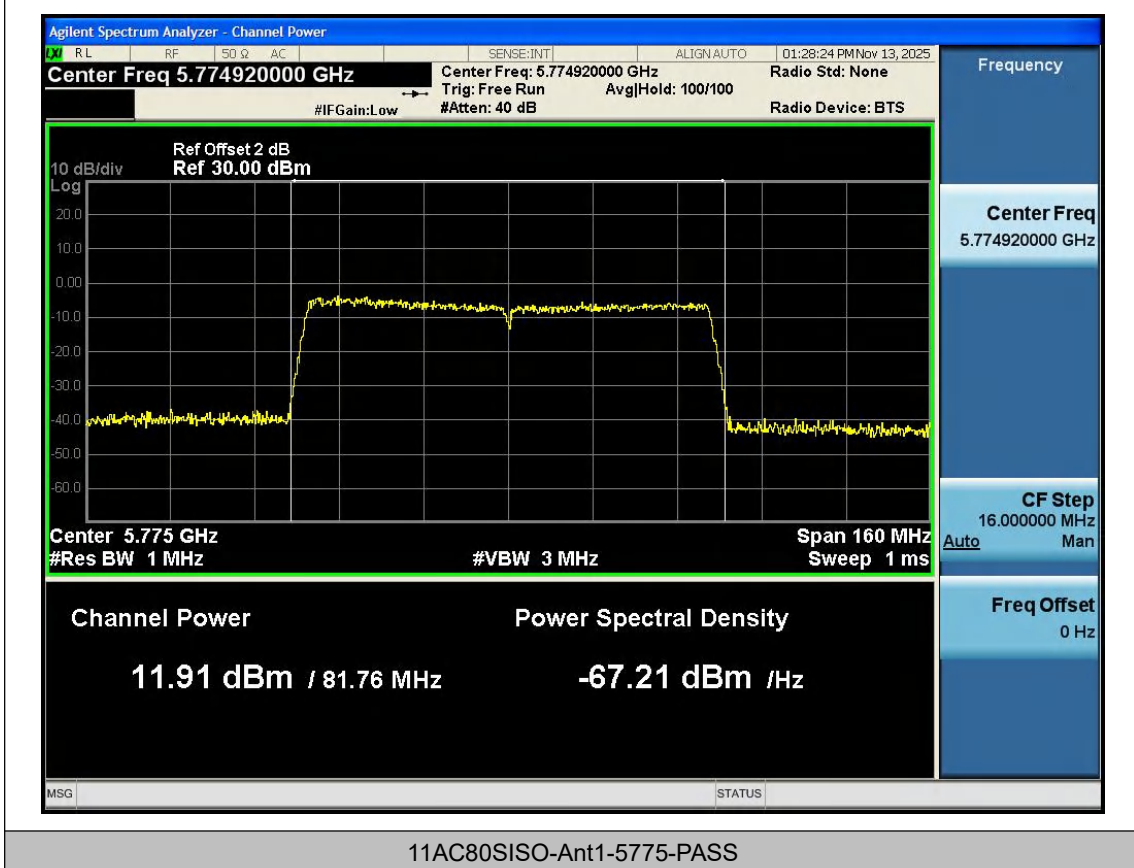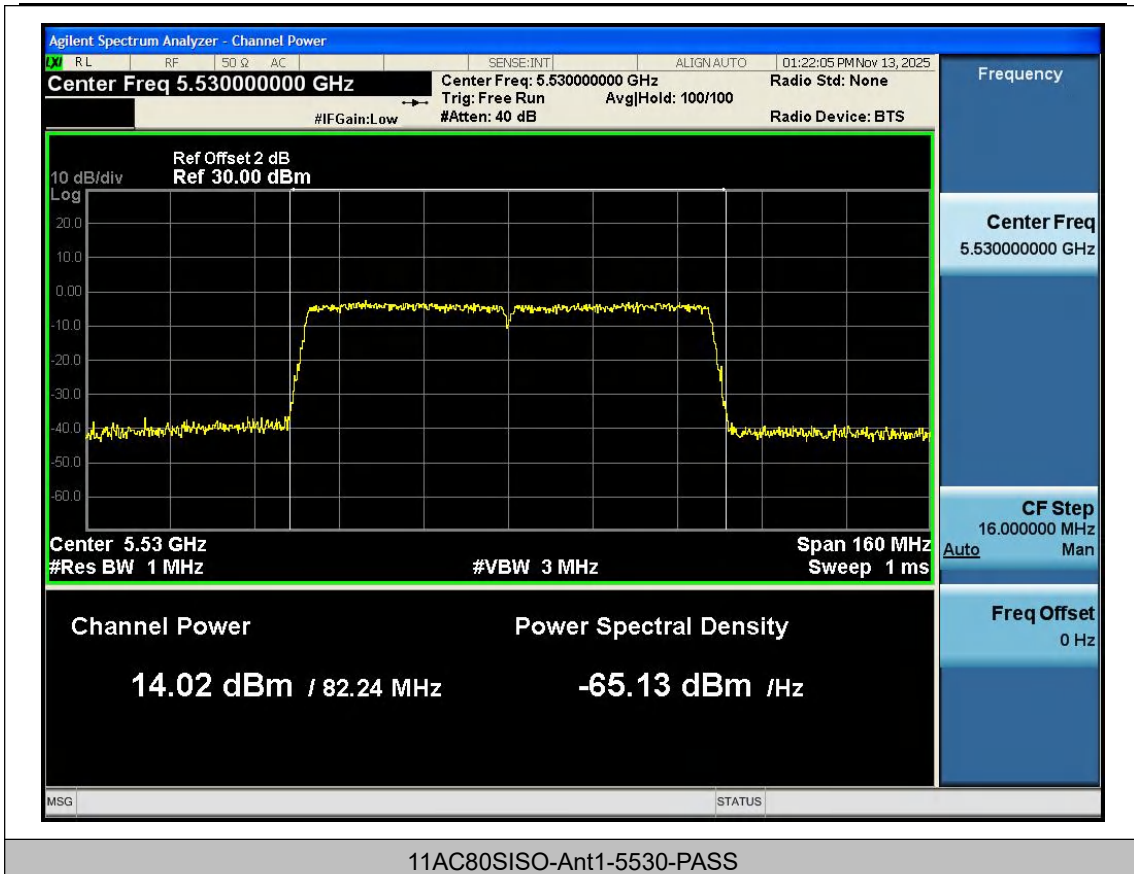

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

Appendix D: Maximum Power Spectral Density

Test Result B1/2/3

Test Mode	Antenna	Frequency [MHz]	Reading Result[dBm/MHz]	DC Factor [dBm]	Result [dBm]	Limit [dBm/MHz]	Verdict
11A	Ant1	5180	-3.01	0.00	-3.01	≤11.00	PASS
11A	Ant1	5220	-2.30	0.00	-2.30	≤11.00	PASS
11A	Ant1	5240	-3.94	0.00	-3.94	≤11.00	PASS
11A	Ant1	5260	-1.41	0.00	-1.41	≤11.00	PASS
11A	Ant1	5300	-4.18	0.00	-4.18	≤11.00	PASS
11A	Ant1	5320	-1.05	0.00	-1.05	≤11.00	PASS
11A	Ant1	5500	-1.58	0.00	-1.58	≤11.00	PASS
11A	Ant1	5580	-2.84	0.00	-2.84	≤11.00	PASS
11A	Ant1	5700	-2.59	0.00	-2.59	≤11.00	PASS
11N20SISO	Ant1	5180	-1.21	0.00	-1.21	≤11.00	PASS
11N20SISO	Ant1	5220	-0.37	0.00	-0.37	≤11.00	PASS
11N20SISO	Ant1	5240	-0.82	0.00	-0.82	≤11.00	PASS
11N20SISO	Ant1	5260	-1.28	0.00	-1.28	≤11.00	PASS
11N20SISO	Ant1	5300	-1.49	0.00	-1.49	≤11.00	PASS
11N20SISO	Ant1	5320	-0.90	0.00	-0.90	≤11.00	PASS
11N20SISO	Ant1	5500	-1.29	0.00	-1.29	≤11.00	PASS
11N20SISO	Ant1	5580	-2.09	0.00	-2.09	≤11.00	PASS
11N20SISO	Ant1	5700	-1.65	0.00	-1.65	≤11.00	PASS
11N40SISO	Ant1	5190	-4.02	0.00	-4.02	≤11.00	PASS
11N40SISO	Ant1	5230	-3.46	0.00	-3.46	≤11.00	PASS
11N40SISO	Ant1	5270	-4.23	0.00	-4.23	≤11.00	PASS
11N40SISO	Ant1	5310	-4.11	0.00	-4.11	≤11.00	PASS
11N40SISO	Ant1	5510	-4.07	0.00	-4.07	≤11.00	PASS
11N40SISO	Ant1	5550	-4.60	0.00	-4.60	≤11.00	PASS
11N40SISO	Ant1	5670	-4.58	0.00	-4.58	≤11.00	PASS
11AC20SISO	Ant1	5180	-1.21	0.00	-1.21	≤11.00	PASS
11AC20SISO	Ant1	5220	-0.27	0.00	-0.27	≤11.00	PASS
11AC20SISO	Ant1	5240	-0.77	0.00	-0.77	≤11.00	PASS
11AC20SISO	Ant1	5260	-1.44	0.00	-1.44	≤11.00	PASS
11AC20SISO	Ant1	5300	-1.29	0.00	-1.29	≤11.00	PASS
11AC20SISO	Ant1	5320	-1.14	0.00	-1.14	≤11.00	PASS
11AC20SISO	Ant1	5500	-1.26	0.00	-1.26	≤11.00	PASS
11AC20SISO	Ant1	5580	-1.85	0.00	-1.85	≤11.00	PASS
11AC20SISO	Ant1	5700	-1.77	0.00	-1.77	≤11.00	PASS
11AC40SISO	Ant1	5190	-5.06	0.00	-5.06	≤11.00	PASS
11AC40SISO	Ant1	5230	-3.36	0.00	-3.36	≤11.00	PASS

11AC40SISO	Ant1	5270	-4.45	0.00	-4.45	≤11.00	PASS
11AC40SISO	Ant1	5310	-3.34	0.00	-3.34	≤11.00	PASS
11AC40SISO	Ant1	5510	-3.47	0.00	-3.47	≤11.00	PASS
11AC40SISO	Ant1	5550	-7.42	0.00	-7.42	≤11.00	PASS
11AC40SISO	Ant1	5670	-4.78	0.00	-4.78	≤11.00	PASS
11AC80SISO	Ant1	5210	-7.45	0.00	-7.45	≤11.00	PASS
11AC80SISO	Ant1	5290	-8.63	0.00	-8.63	≤11.00	PASS
11AC80SISO	Ant1	5530	-8.12	0.00	-8.12	≤11.00	PASS

Note: 1.The Duty Cycle Factor and cable loss are compensated in the graph.

Test Result B4


Test Mode	Antenna	Frequency [MHz]	Reading Result [dBm/300KHz]	DC Factor [dBm]	RB Factor [dBm]	Result [dBm/500KHz]	Limit [dBm/500KHz]	Verdict
11A	Ant1	5745	-7.60	0	2.22	-5.38	≤30.00	PASS
11A	Ant1	5785	-8.55	0	2.22	-6.33	≤30.00	PASS
11A	Ant1	5825	-8.07	0	2.22	-5.85	≤30.00	PASS
11N20SISO	Ant1	5745	-6.50	0	2.22	-4.28	≤30.00	PASS
11N20SISO	Ant1	5785	-8.43	0	2.22	-6.21	≤30.00	PASS
11N20SISO	Ant1	5825	-7.49	0	2.22	-5.27	≤30.00	PASS
11N40SISO	Ant1	5755	-9.56	0	2.22	-7.34	≤30.00	PASS
11N40SISO	Ant1	5795	-11.43	0	2.22	-9.21	≤30.00	PASS
11AC20SISO	Ant1	5745	-6.60	0	2.22	-4.38	≤30.00	PASS
11AC20SISO	Ant1	5785	-8.52	0	2.22	-6.30	≤30.00	PASS
11AC20SISO	Ant1	5825	-7.35	0	2.22	-5.13	≤30.00	PASS
11AC40SISO	Ant1	5755	-9.87	0	2.22	-7.65	≤30.00	PASS
11AC40SISO	Ant1	5795	-11.23	0	2.22	-9.01	≤30.00	PASS
11AC80SISO	Ant1	5775	-13.77	0	2.22	-11.55	≤30.00	PASS

Note: 1.The cable loss and RBW Factor are compensated in the graph.


2. Offset=cable loss(2dB) + RBW Factor (2.22dB)

3. RBW Factor (2.22dB) = $10 \cdot \log_{10}(500/300)$

Test Graphs B1/2/3

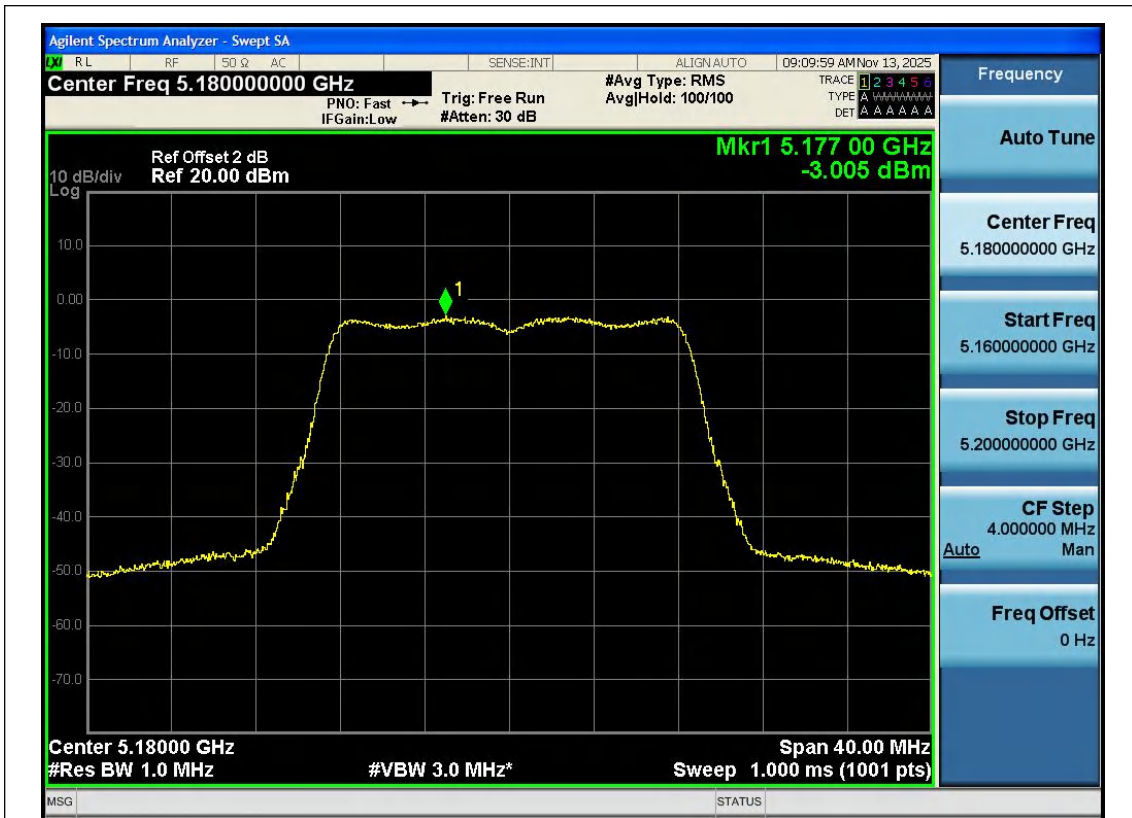

11A-Ant1-5180-PASS

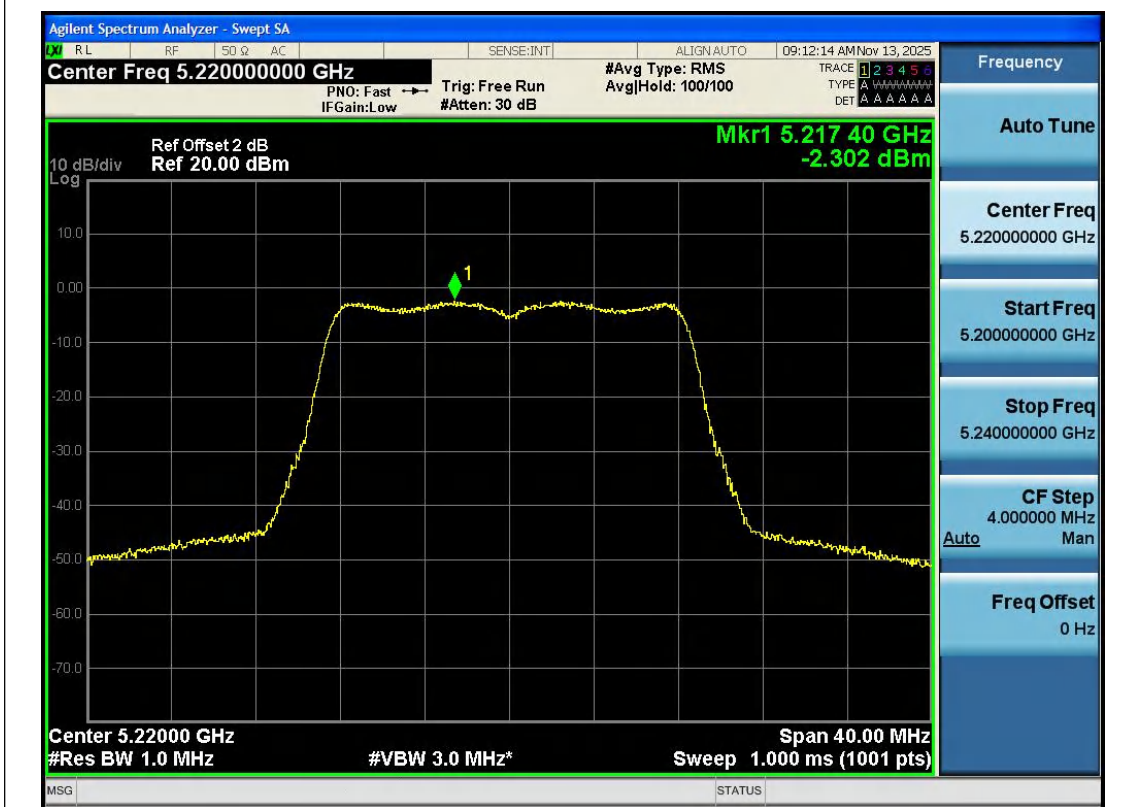


11A-Ant1-5220-PASS


Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

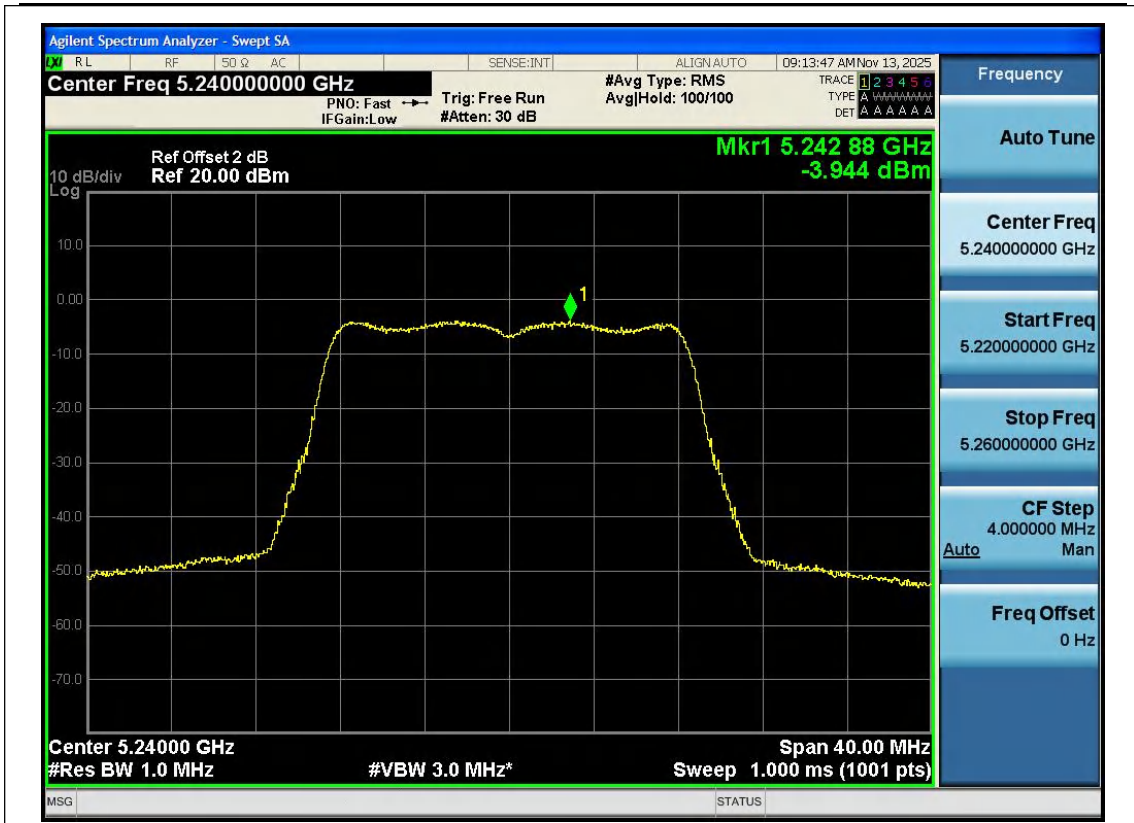

11A-Ant1-5240-PASS

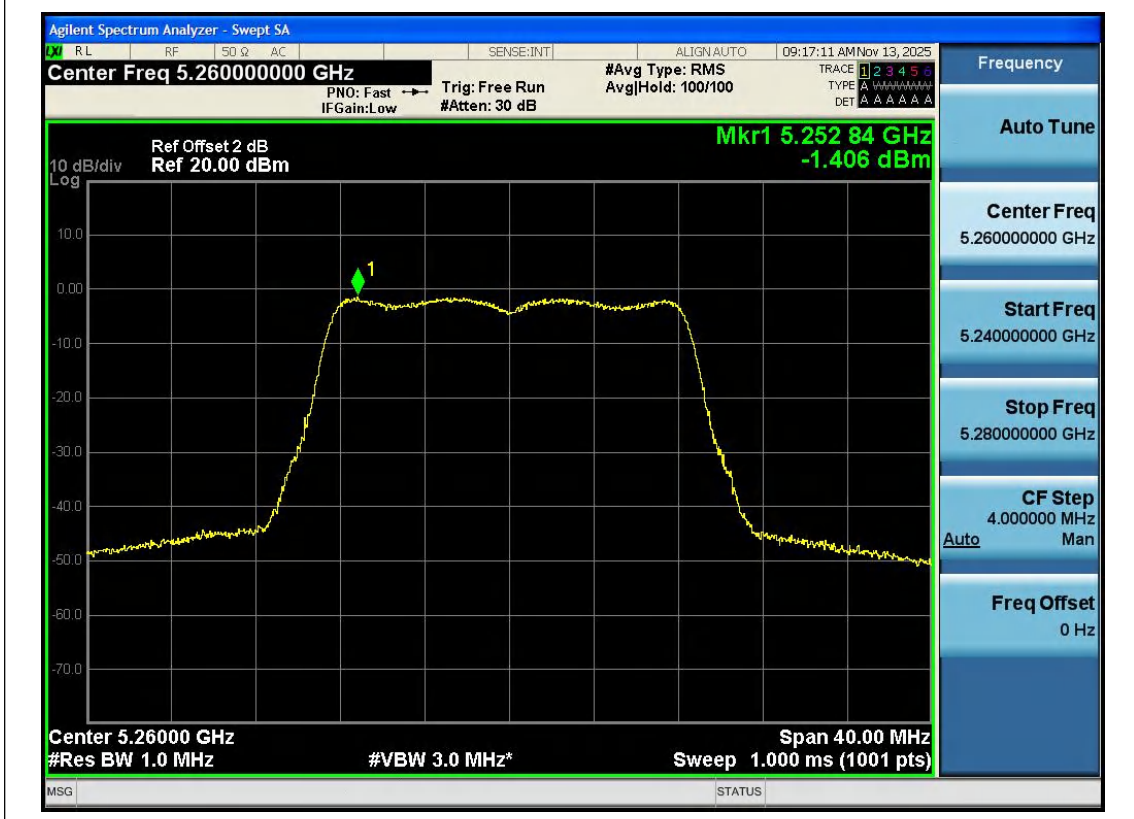


11A-Ant1-5260-PASS

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

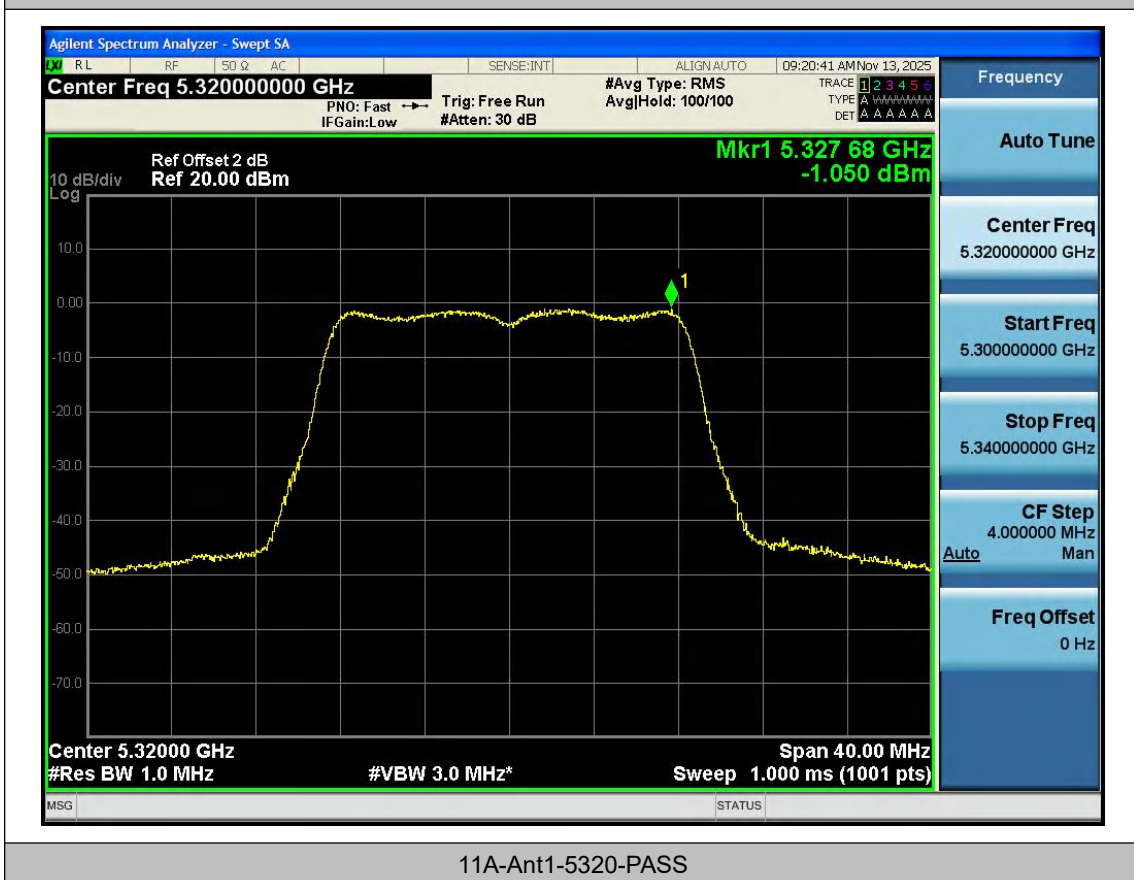


Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

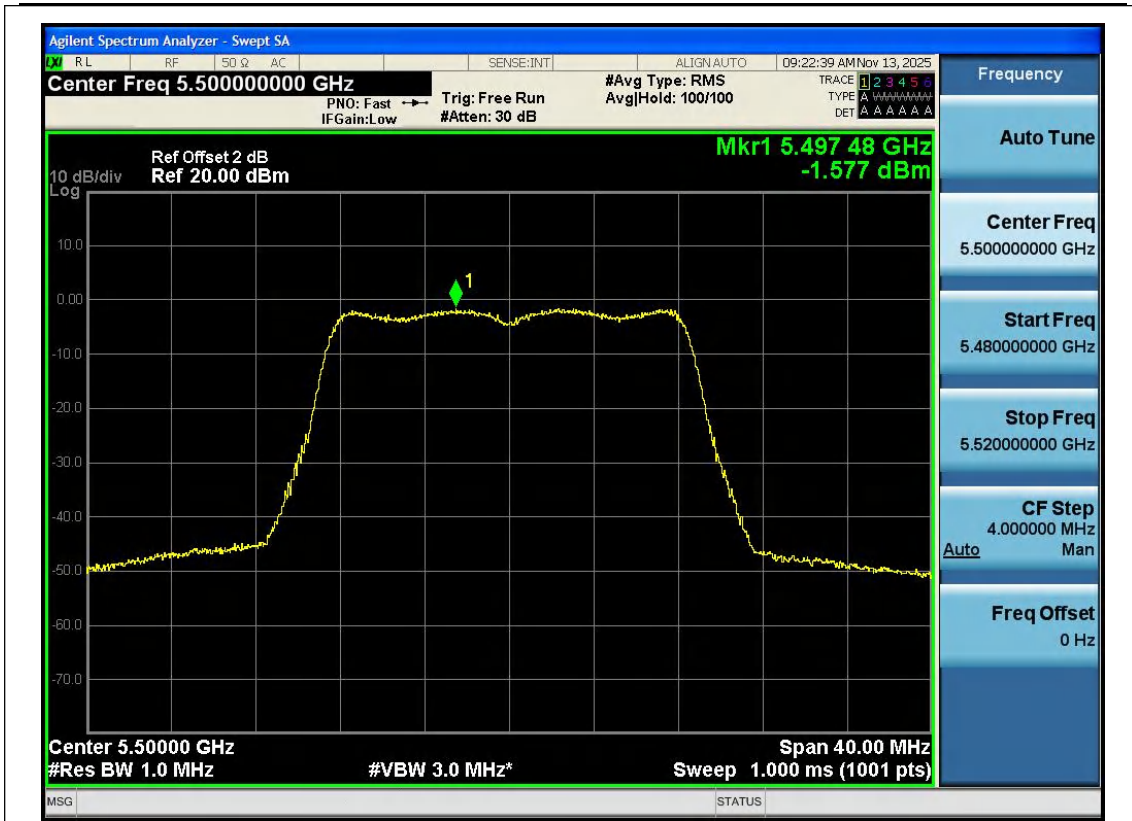

11A-Ant1-5500-PASS

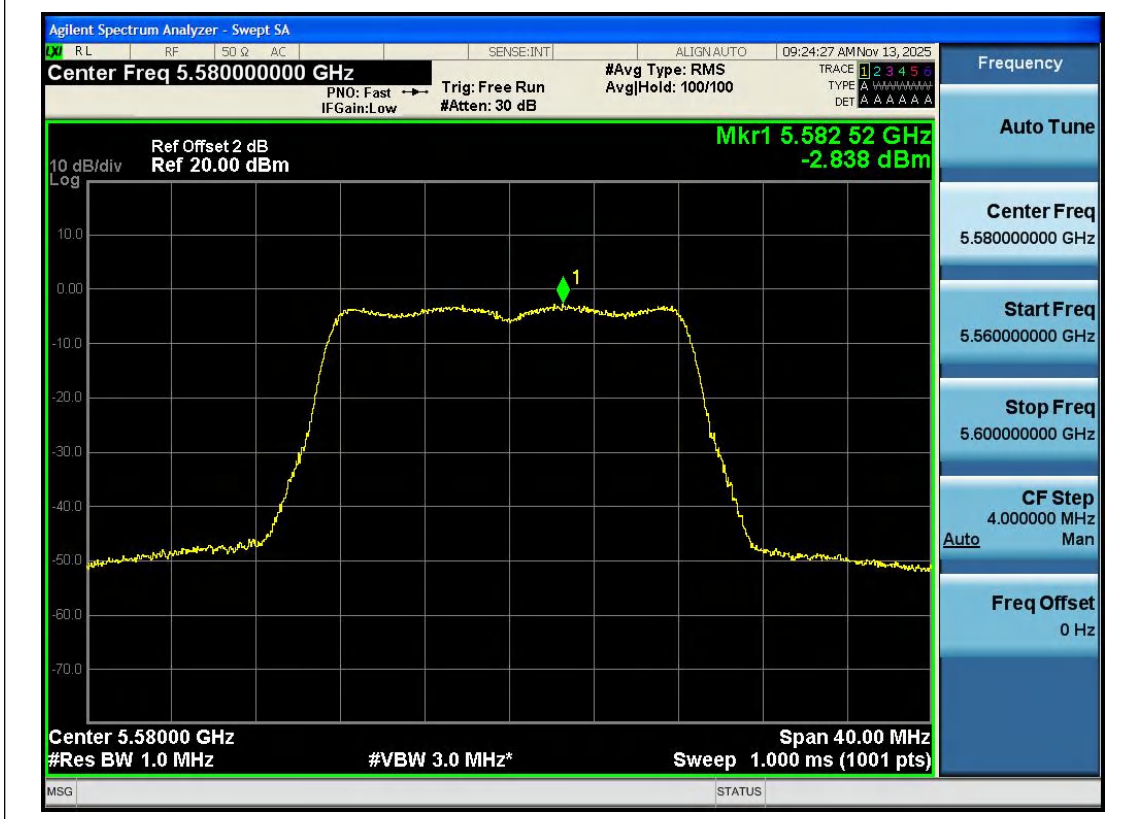


11A-Ant1-5580-PASS


Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

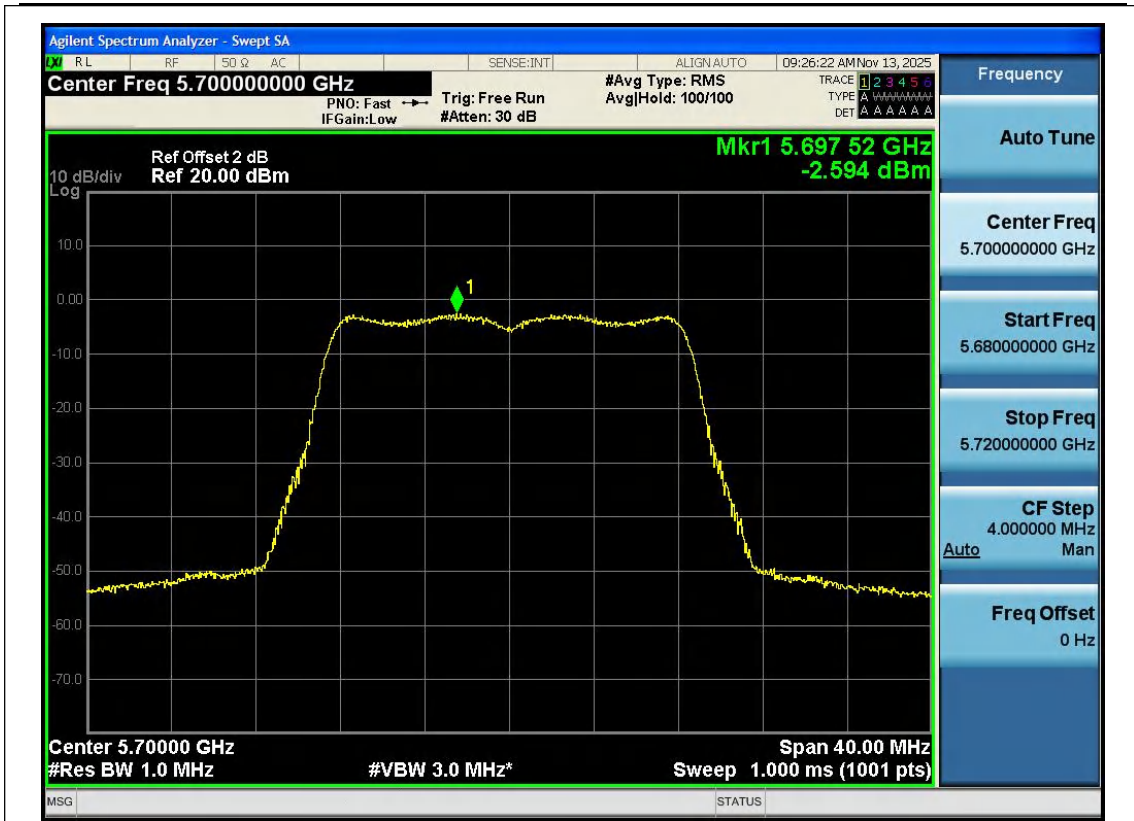

11A-Ant1-5700-PASS

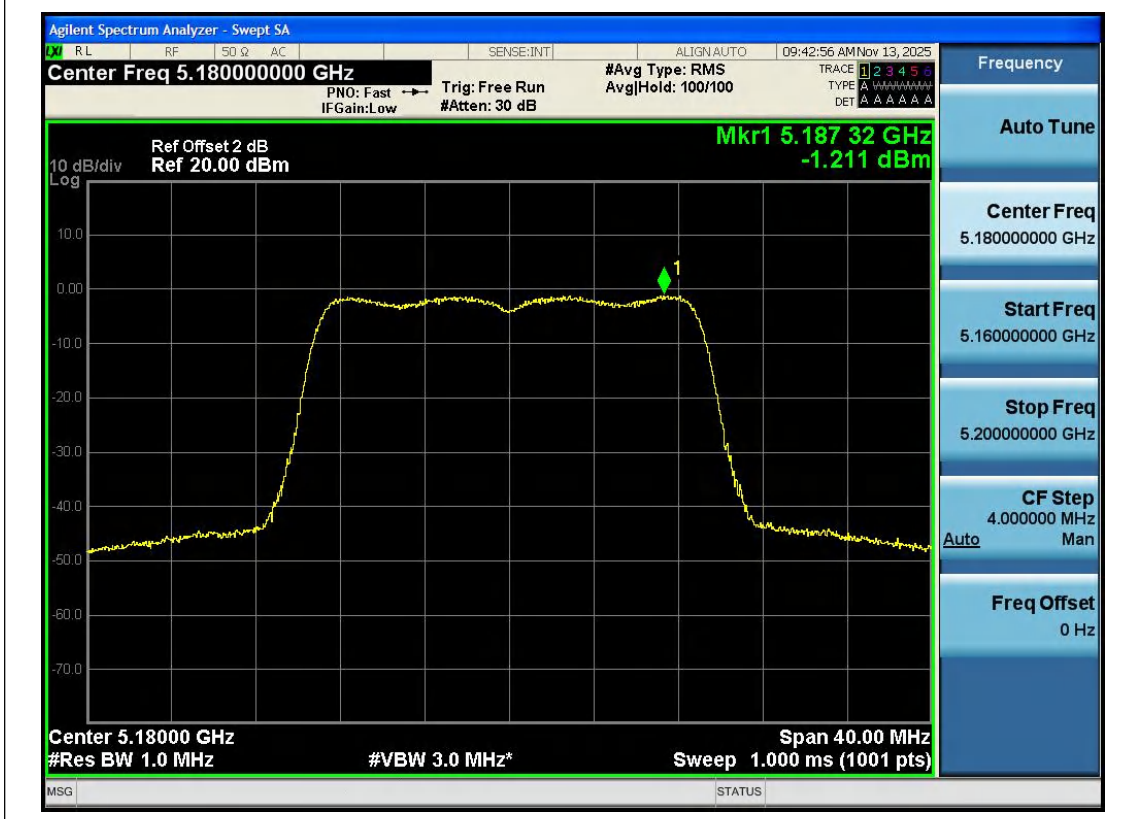

11N20SISO-Ant1-5180-PASS

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com



11N20SISO-Ant1-5220-PASS




11N20SISO-Ant1-5240-PASS


Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

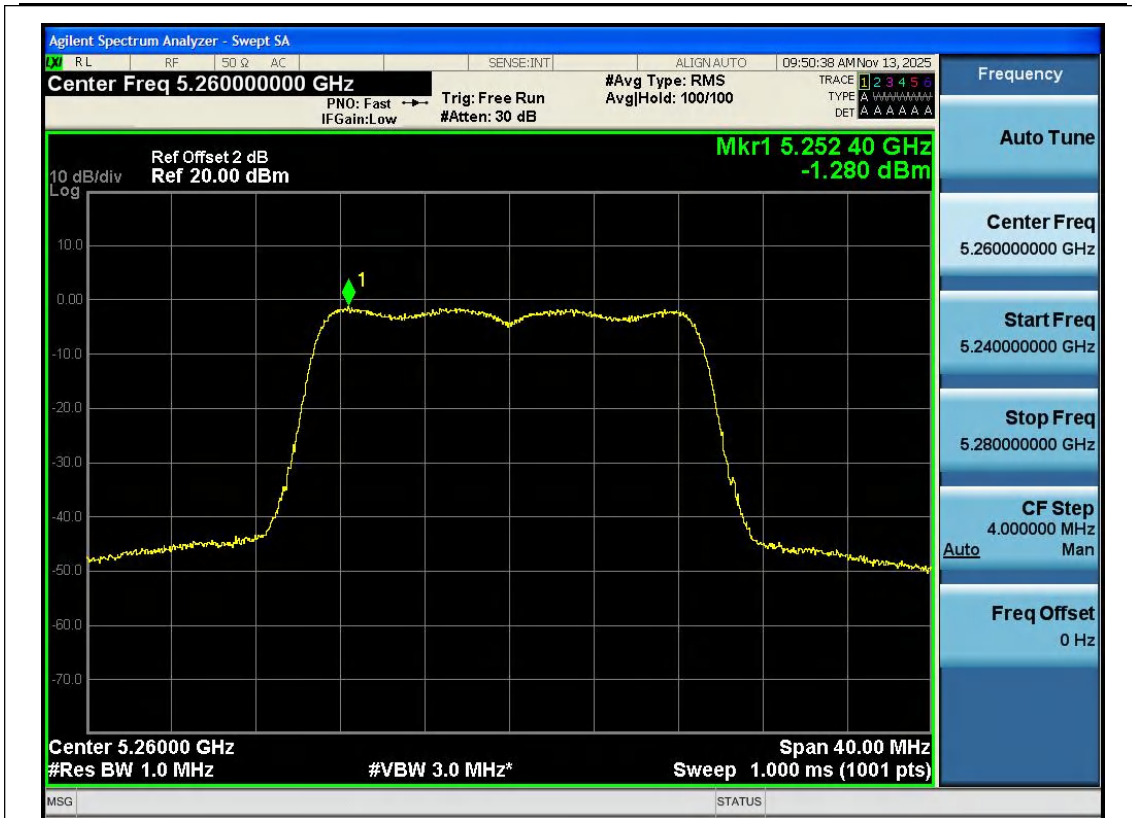

11N20SISO-Ant1-5260-PASS

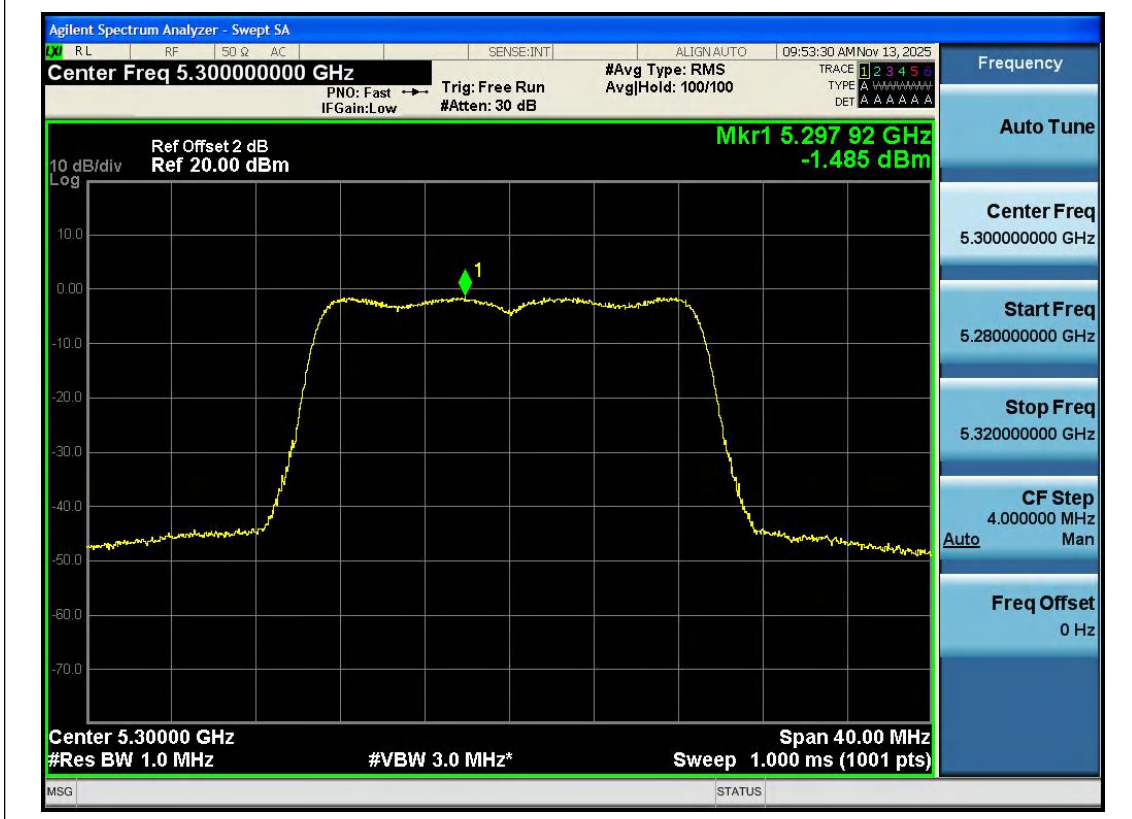

11N20SISO-Ant1-5300-PASS


Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com



11N20SISO-Ant1-5320-PASS

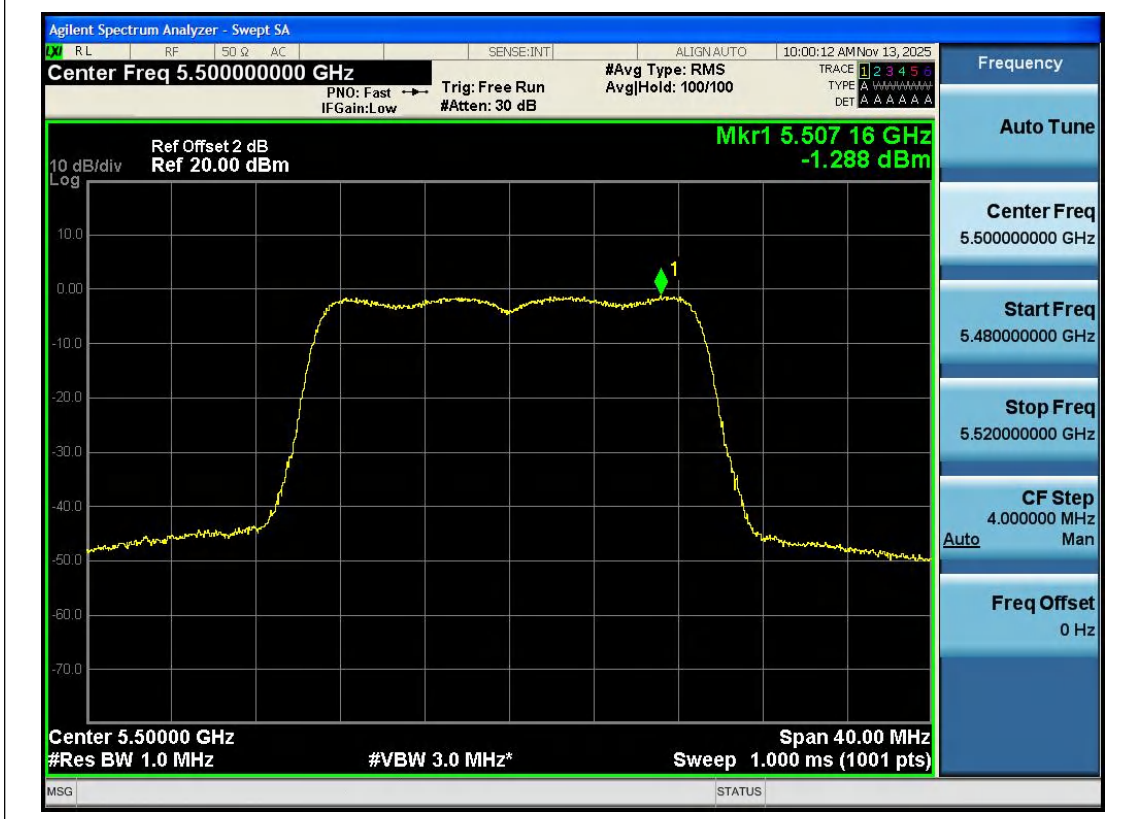

11N20SISO-Ant1-5500-PASS

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com