



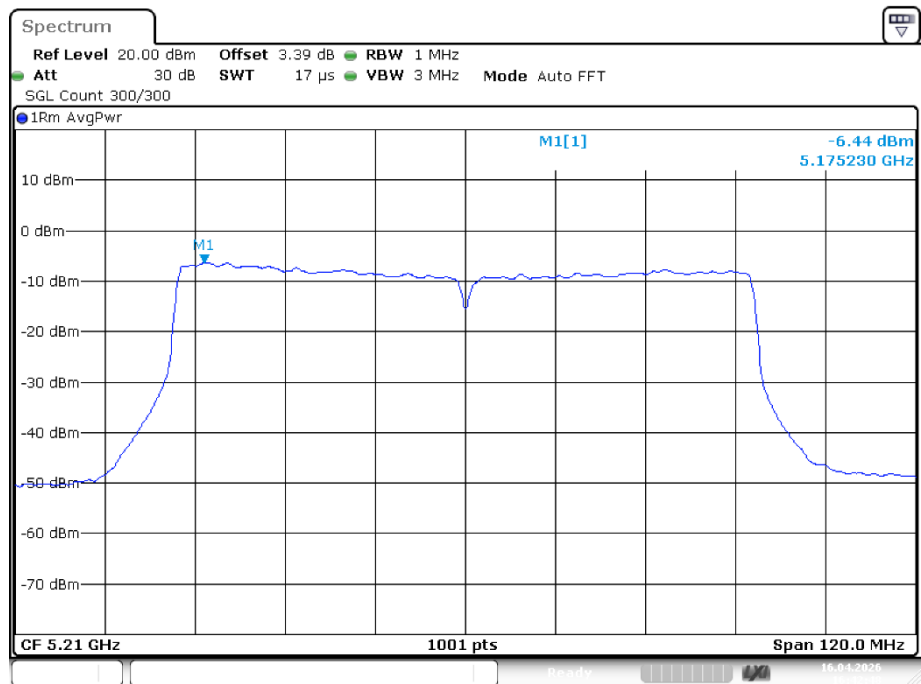


Date: 16.APR.2026 16:42:48

PSD NVNT ac80 5210MHz Ant1

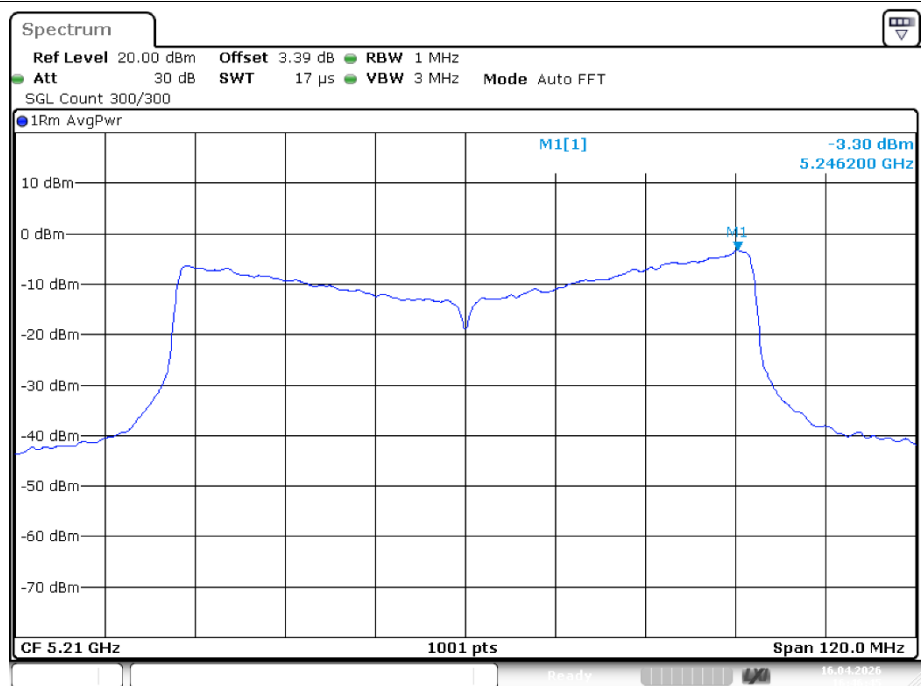


Date: 16.APR.2026 16:46:45

PSD NVNT ac80 5210MHz Ant2

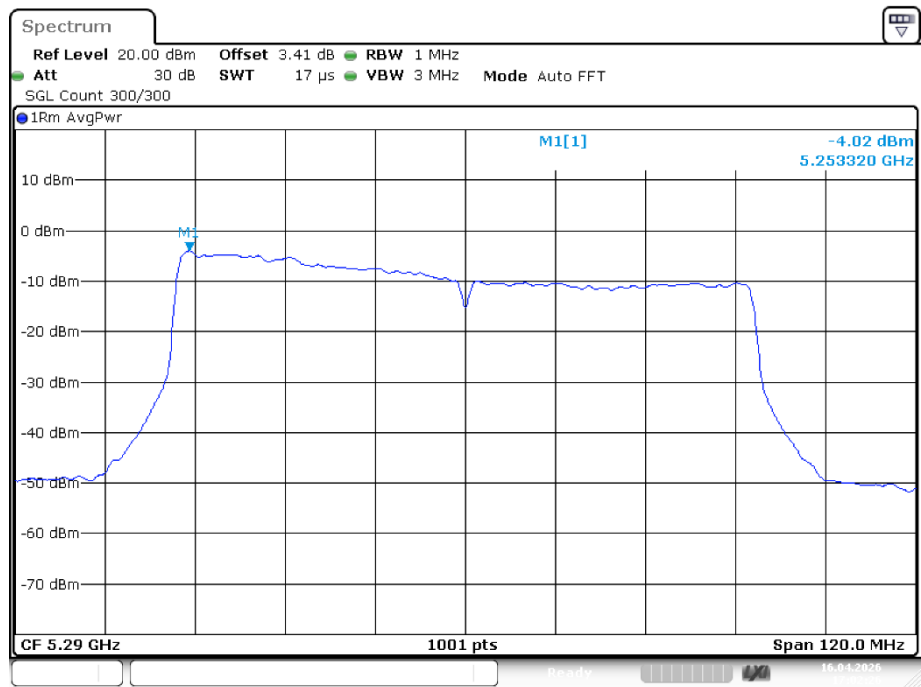


Date: 16.APR.2026 17:02:27

PSD NVNT ac80 5290MHz Ant1

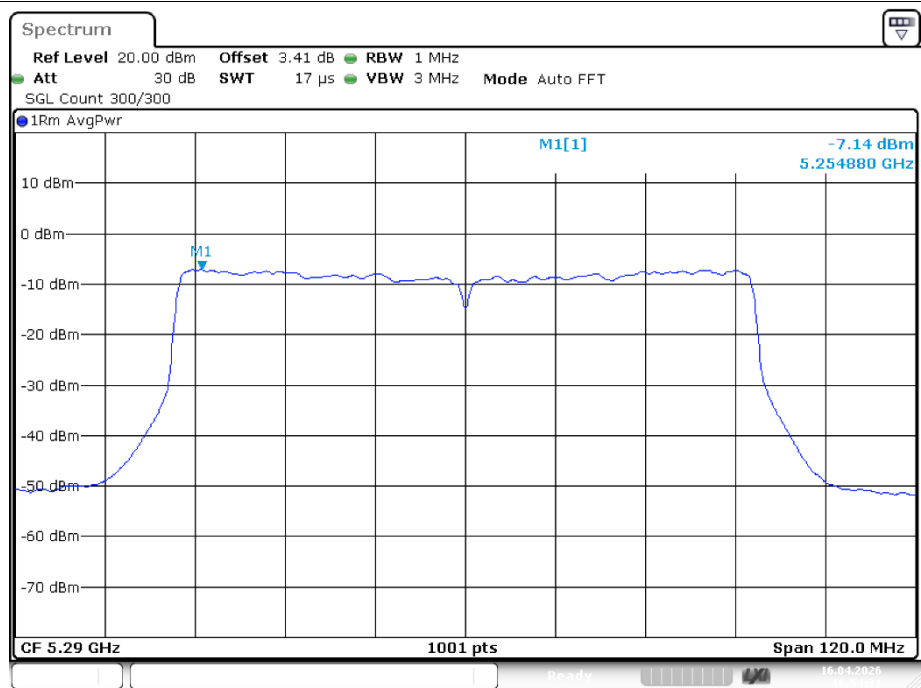


Date: 16.APR.2026 16:54:32


PSD NVNT ac80 5290MHz Ant2

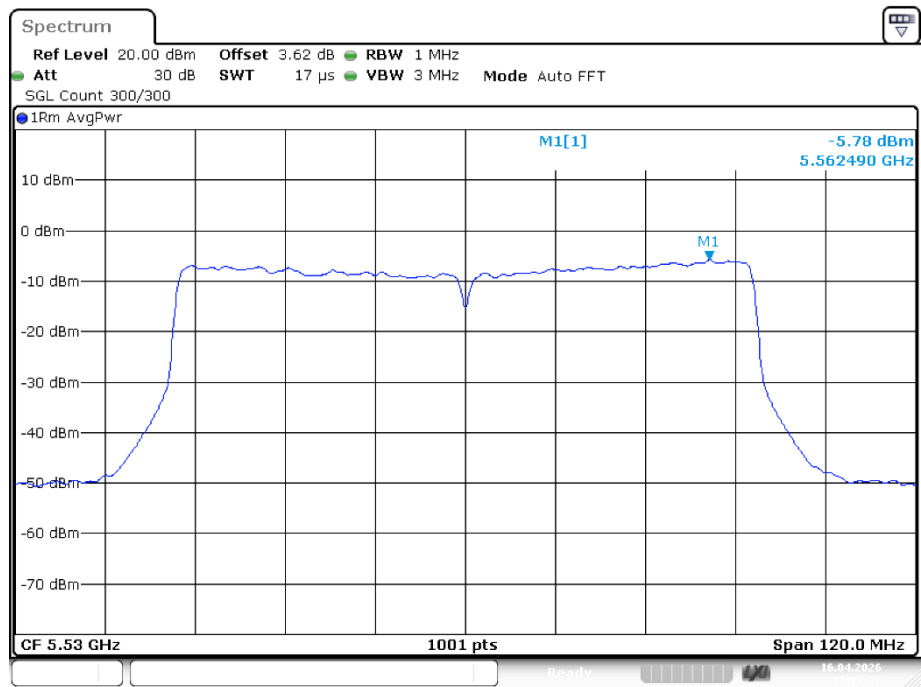

PSD NVNT ac80 5530MHz Ant1

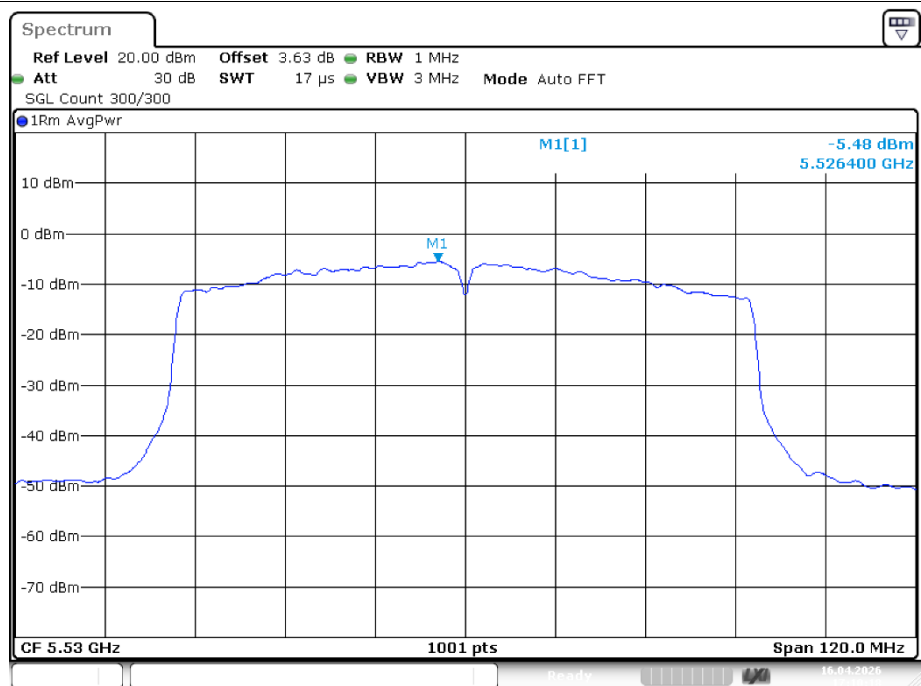


PSD NVNT ac80 5530MHz Ant2

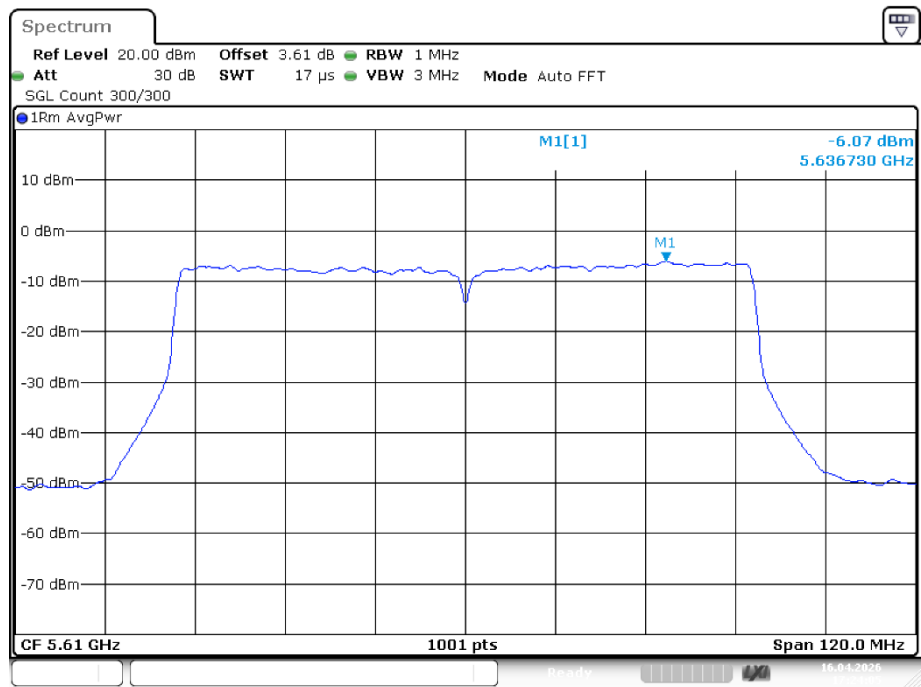


Date: 16.APR.2026 17:24:05

PSD NVNT ac80 5610MHz Ant1

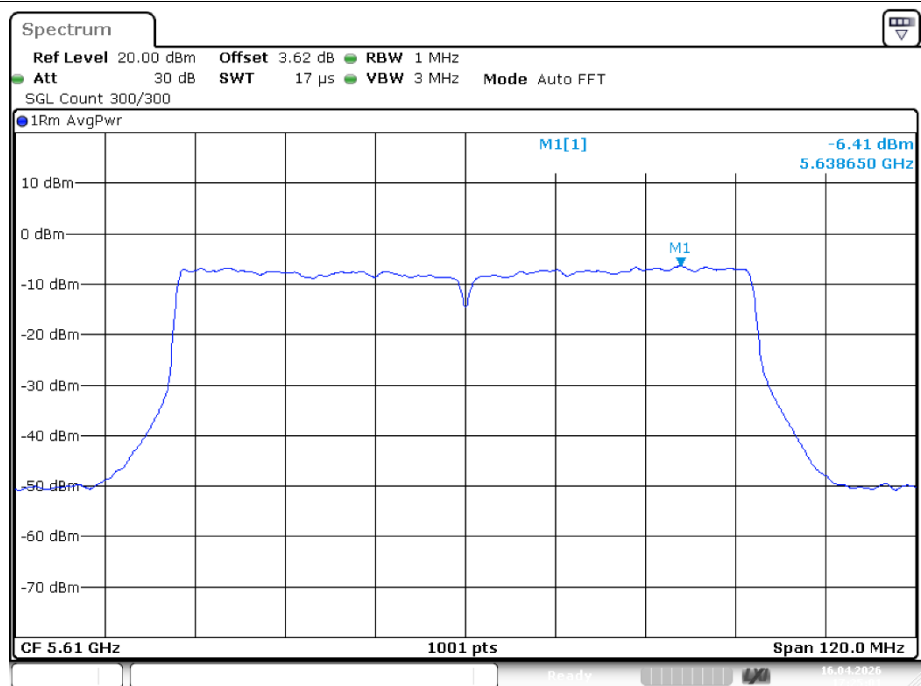


Date: 16.APR.2026 17:25:01

PSD NVNT ac80 5610MHz Ant2

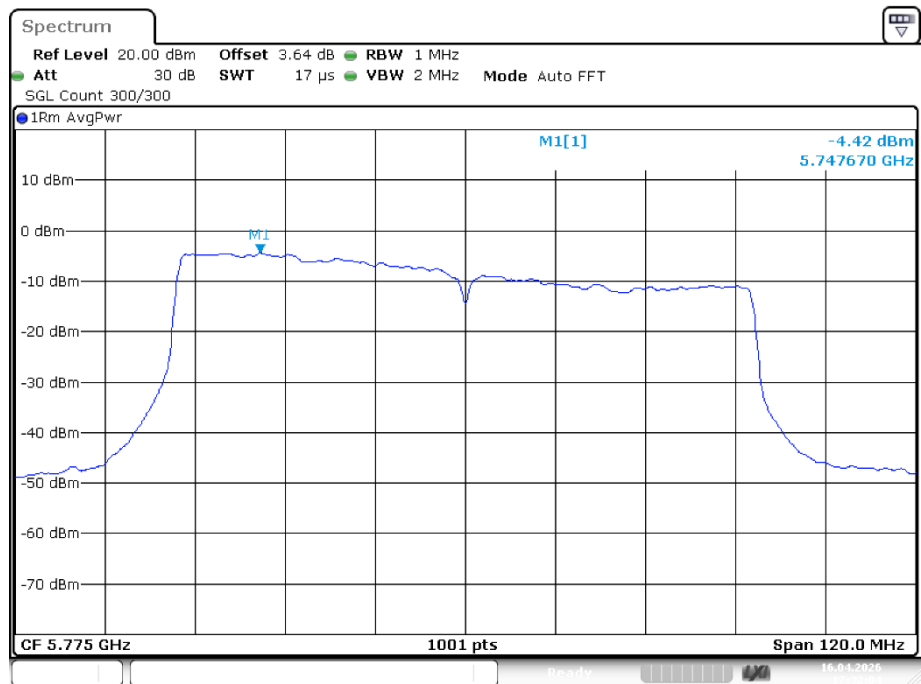


Date: 16.APR.2026 17:32:04

PSD NVNT ac80 5775MHz Ant1

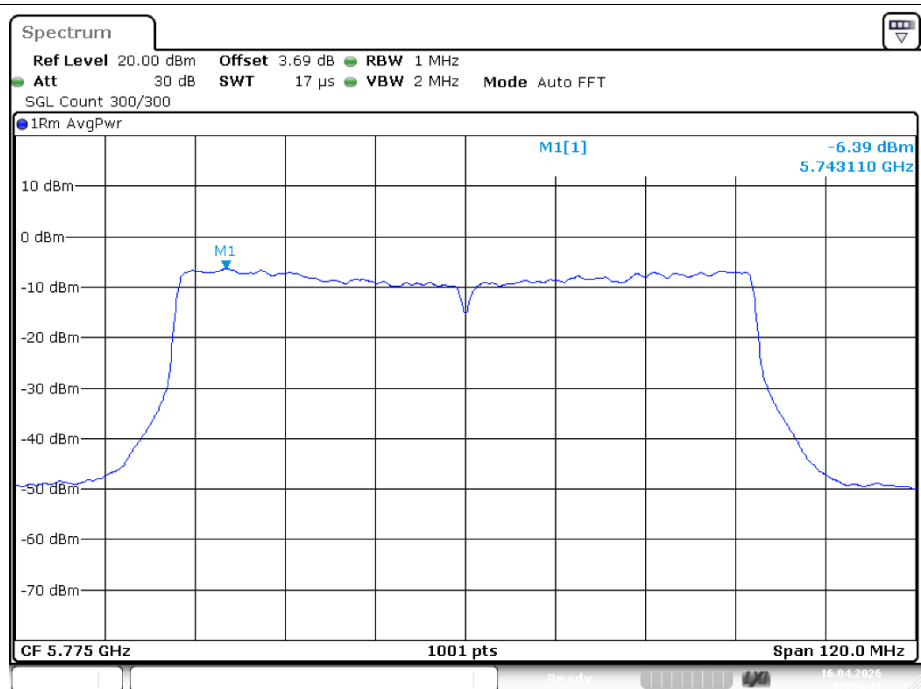


Date: 16.APR.2026 17:34:10

PSD NVNT ac80 5775MHz Ant2

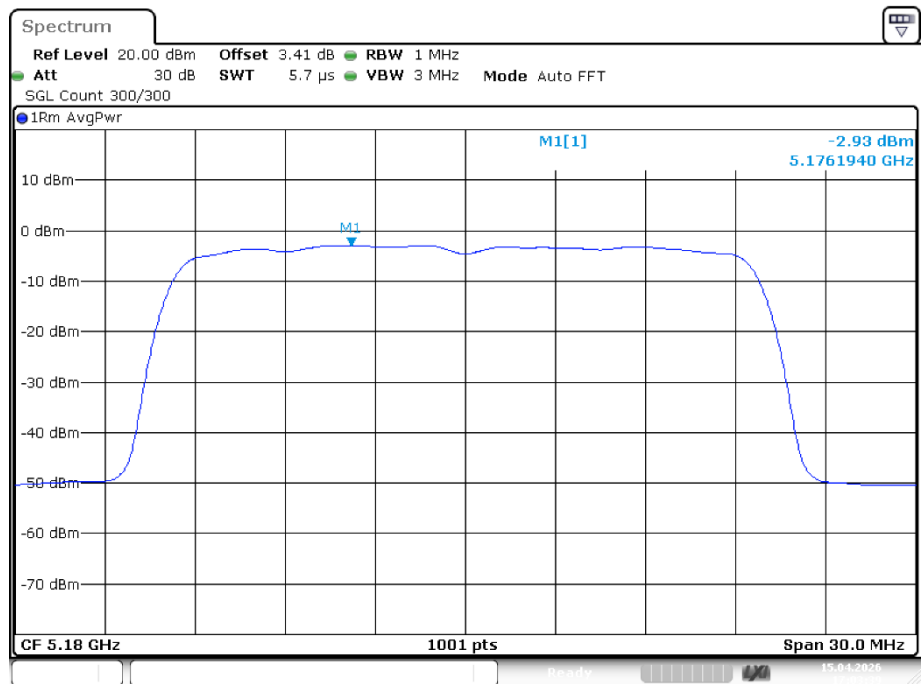


Date: 15.APR.2026 17:03:39

PSD NVNT ax20 5180MHz Ant1

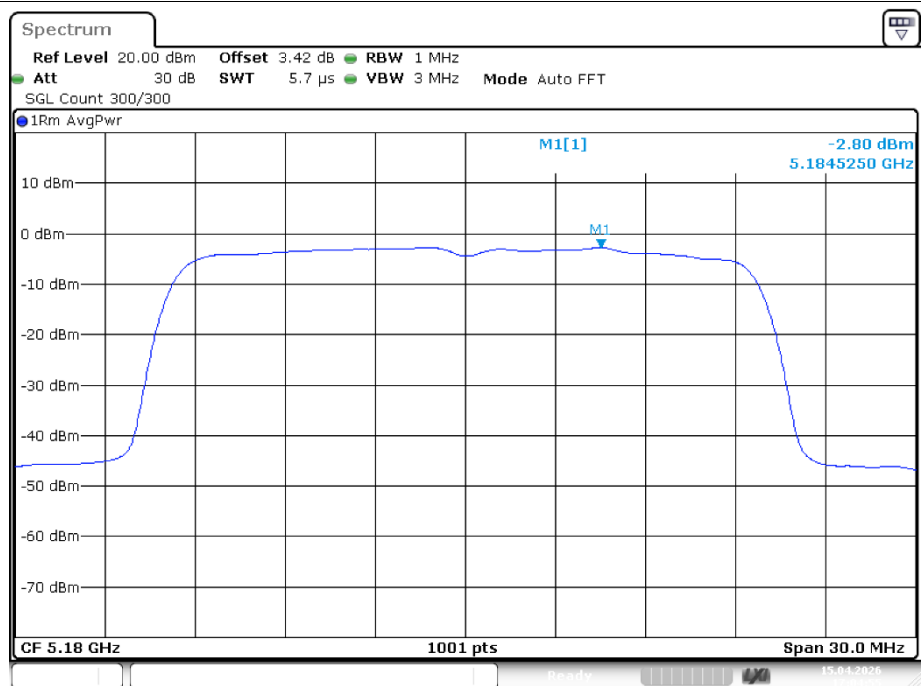


Date: 15.APR.2026 17:04:55

PSD NVNT ax20 5180MHz Ant2

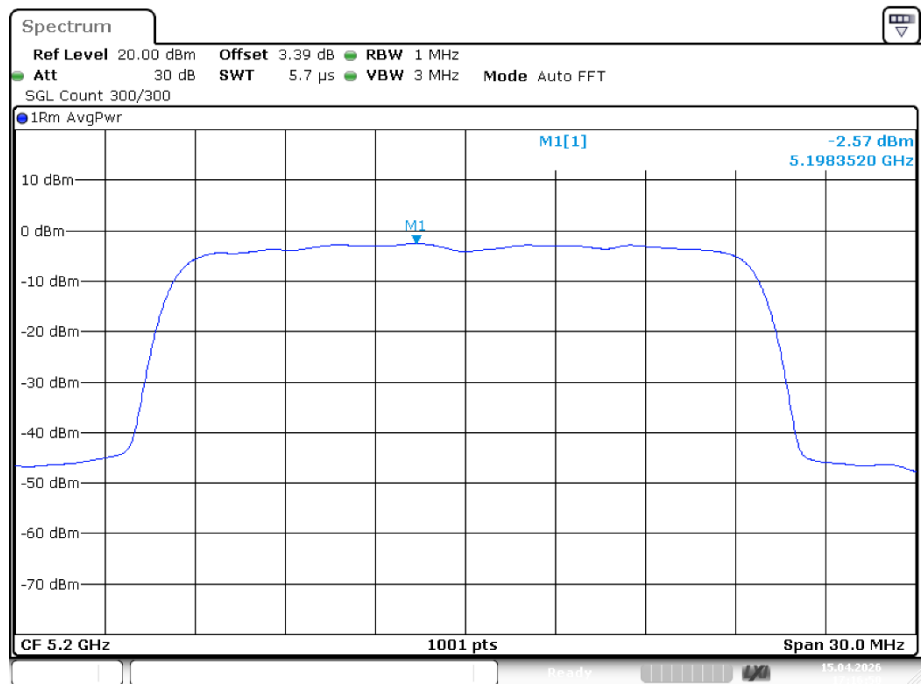


Date: 15.APR.2026 17:16:50

PSD NVNT ax20 5200MHz Ant1

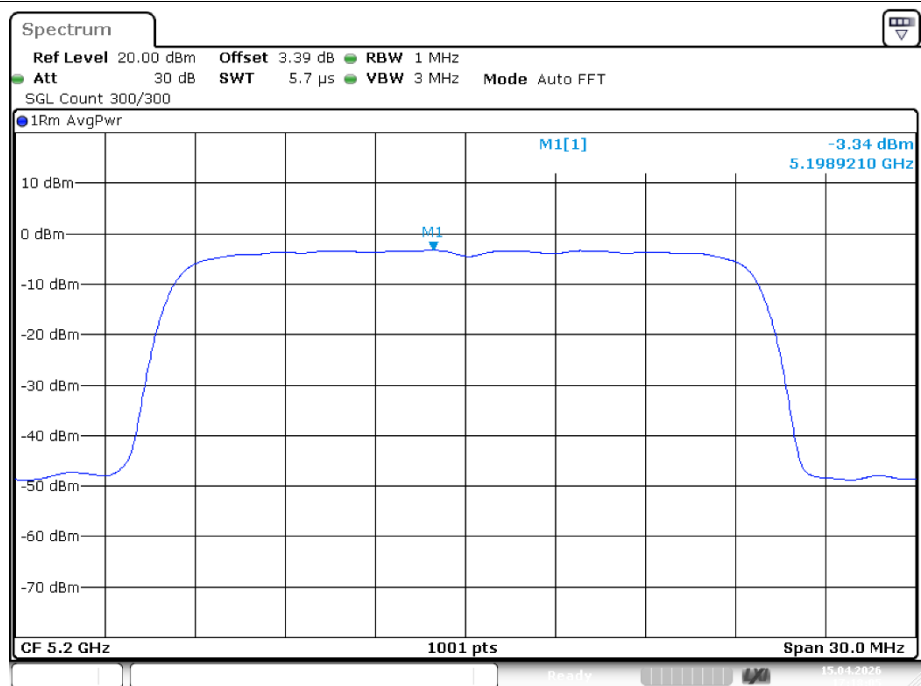


Date: 15.APR.2026 17:18:05

PSD NVNT ax20 5200MHz Ant2

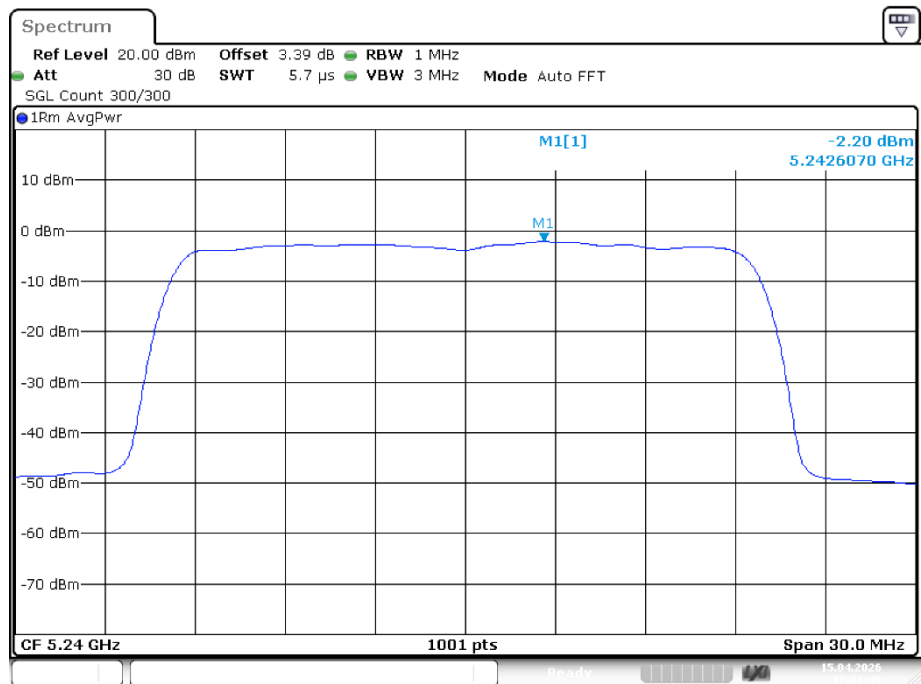


Date: 15.APR.2026 17:21:39

PSD NVNT ax20 5240MHz Ant1

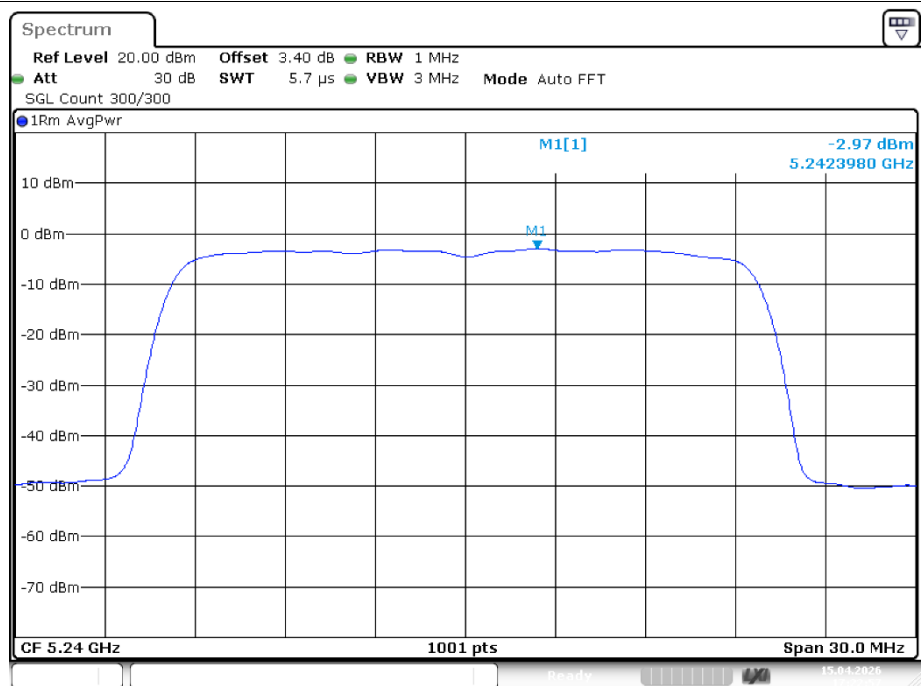


Date: 15.APR.2026 17:22:56

PSD NVNT ax20 5240MHz Ant2

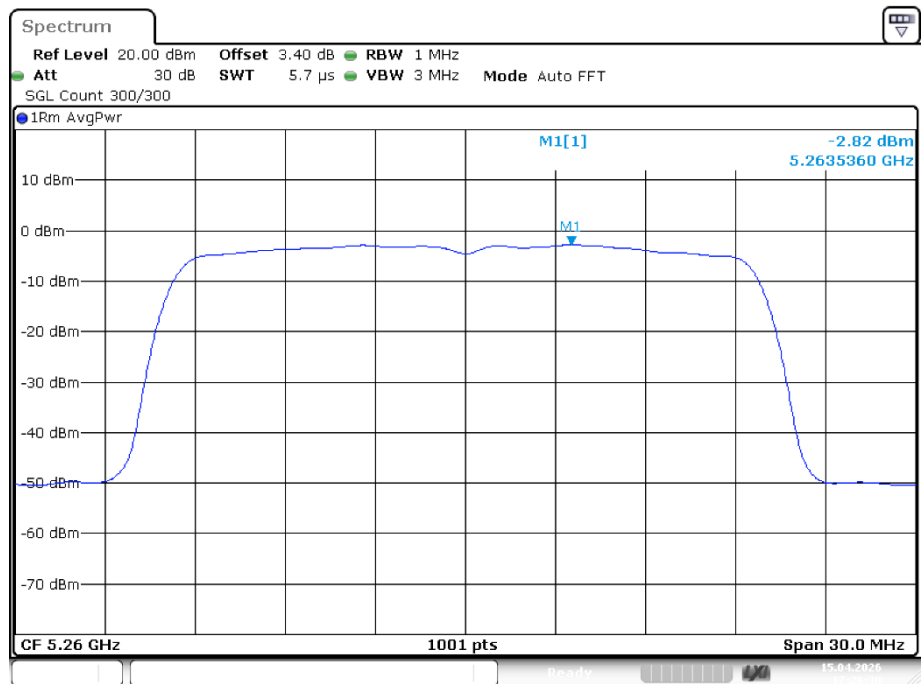


Date: 15.APR.2026 17:26:31

PSD NVNT ax20 5260MHz Ant1

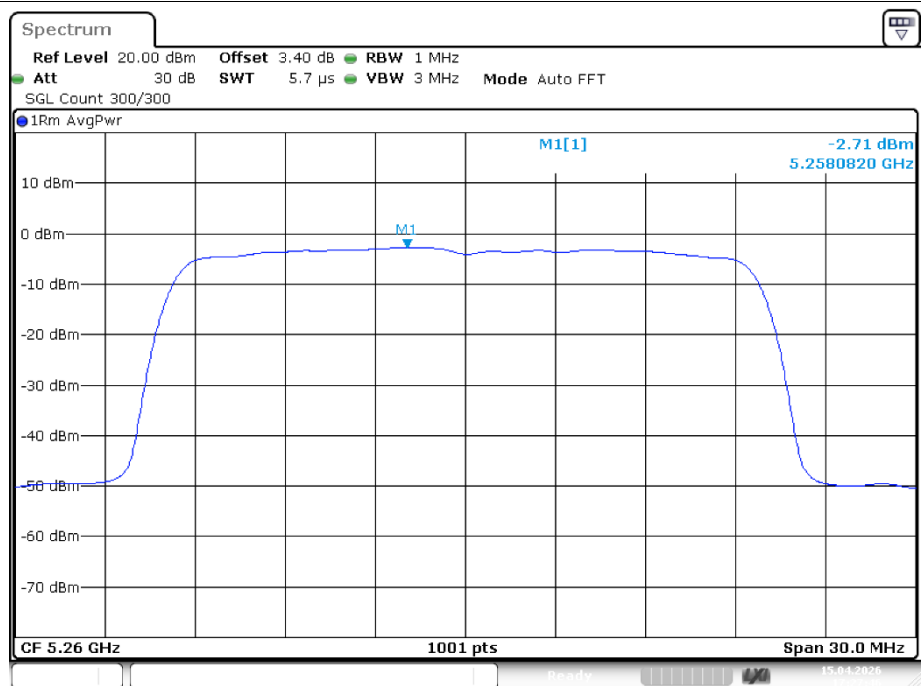


Date: 15.APR.2026 17:27:46

PSD NVNT ax20 5260MHz Ant2

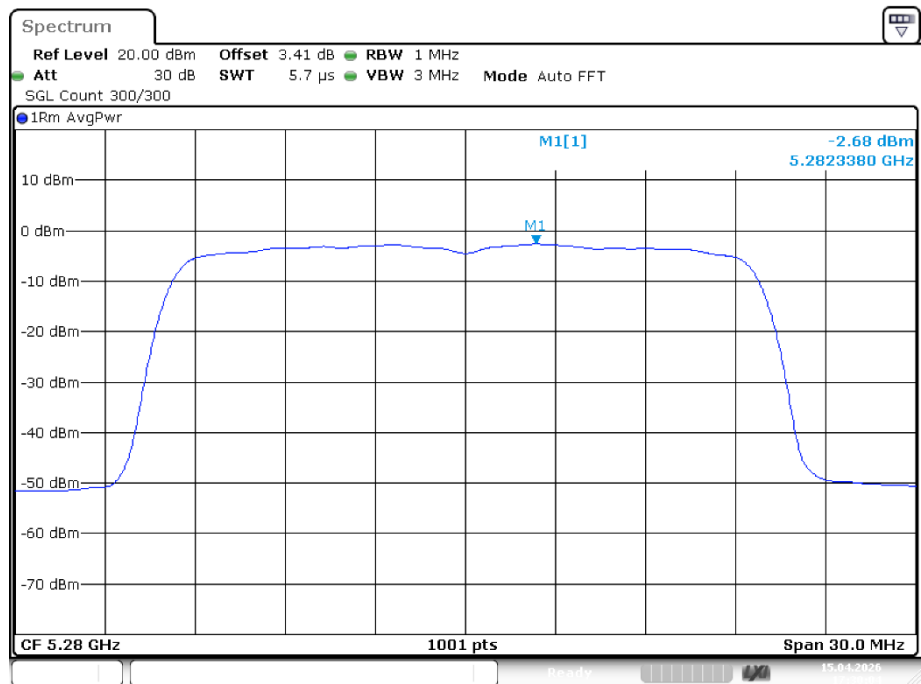


Date: 15.APR.2026 17:30:04

PSD NVNT ax20 5280MHz Ant1

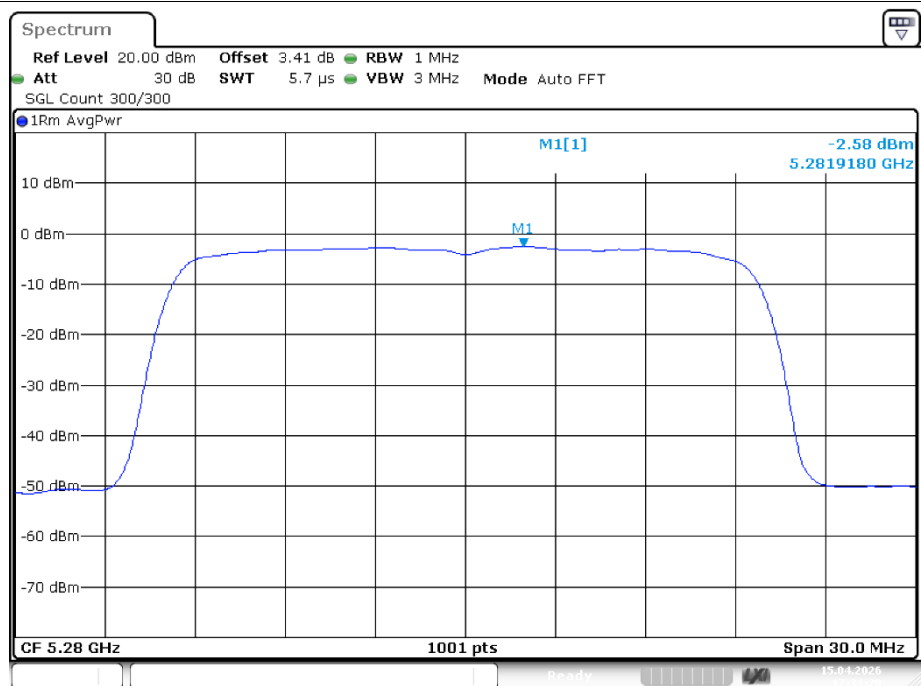


Date: 15.APR.2026 17:31:20

PSD NVNT ax20 5280MHz Ant2

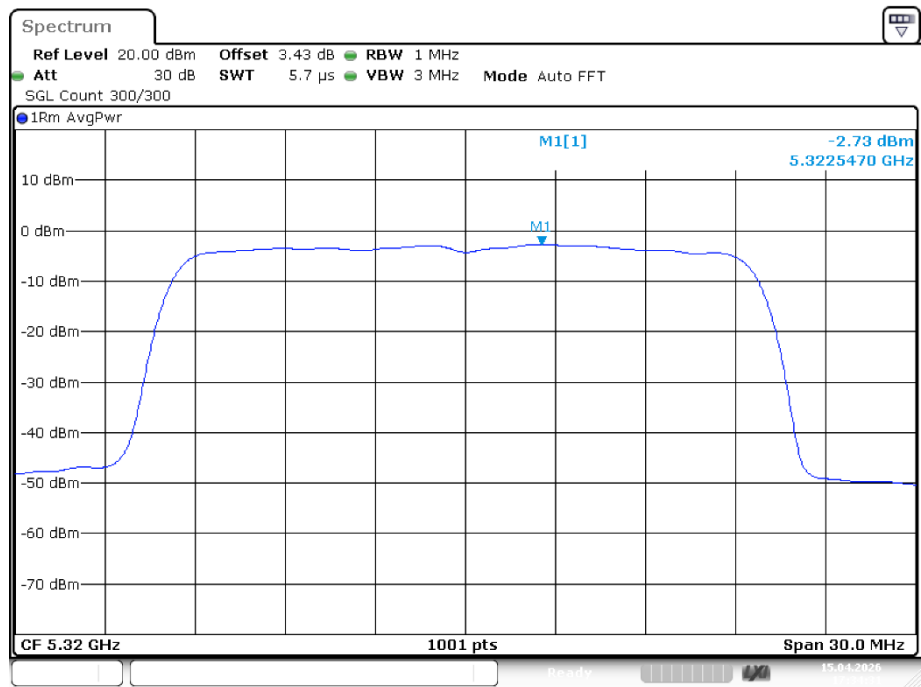


Date: 15.APR.2026 17:34:31

PSD NVNT ax20 5320MHz Ant1

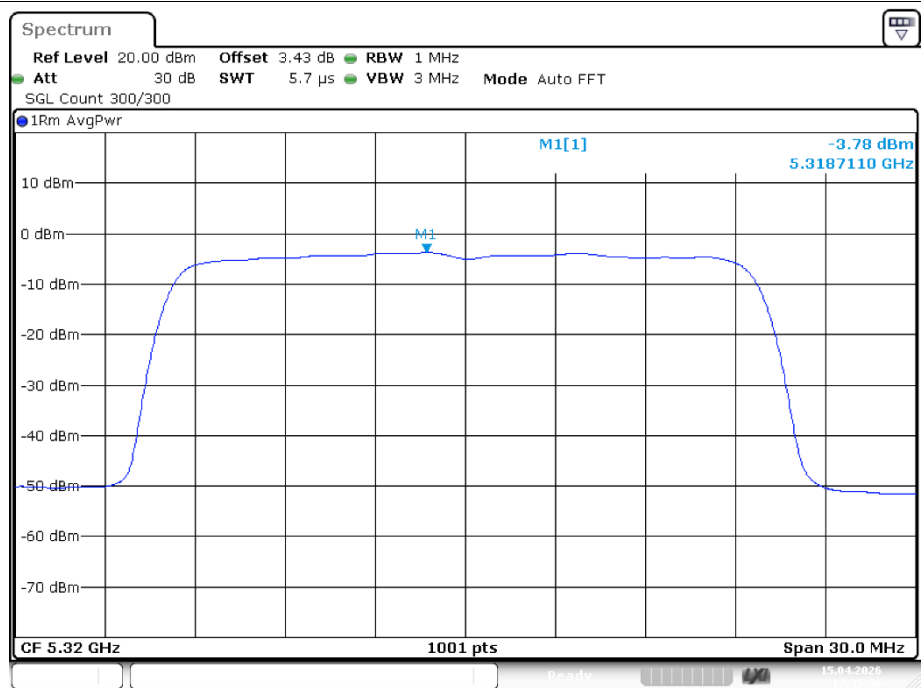


Date: 15.APR.2026 17:35:56

PSD NVNT ax20 5320MHz Ant2

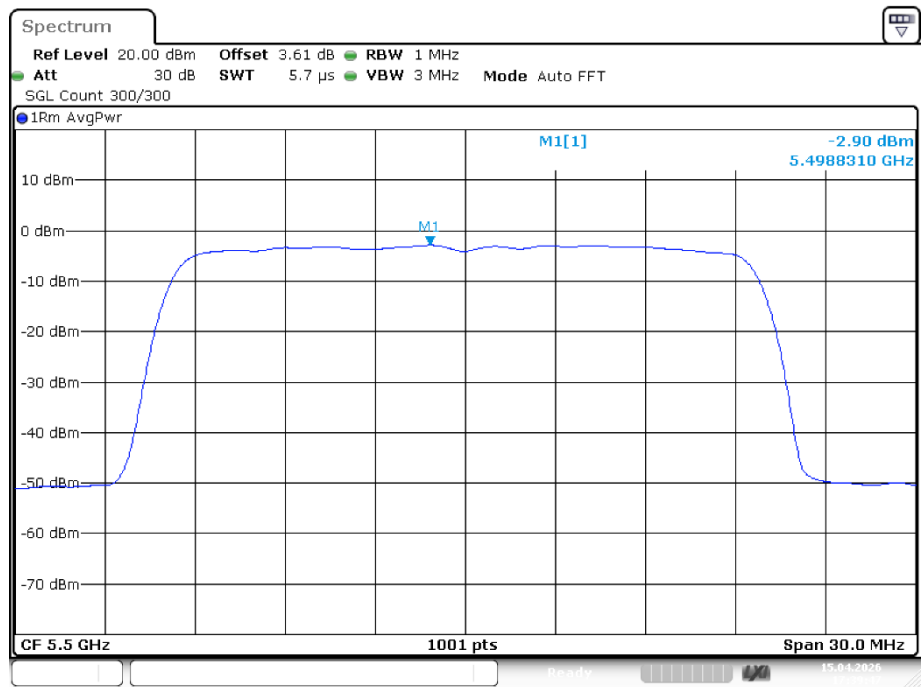


Date: 15.APR.2026 17:39:47

PSD NVNT ax20 5500MHz Ant1

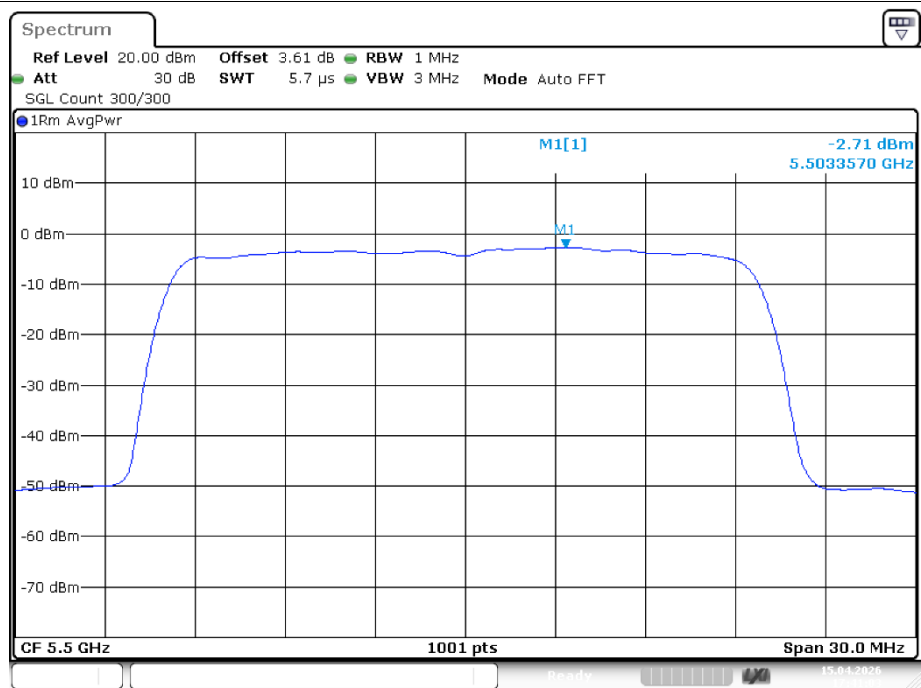


Date: 15.APR.2026 17:41:03

PSD NVNT ax20 5500MHz Ant2

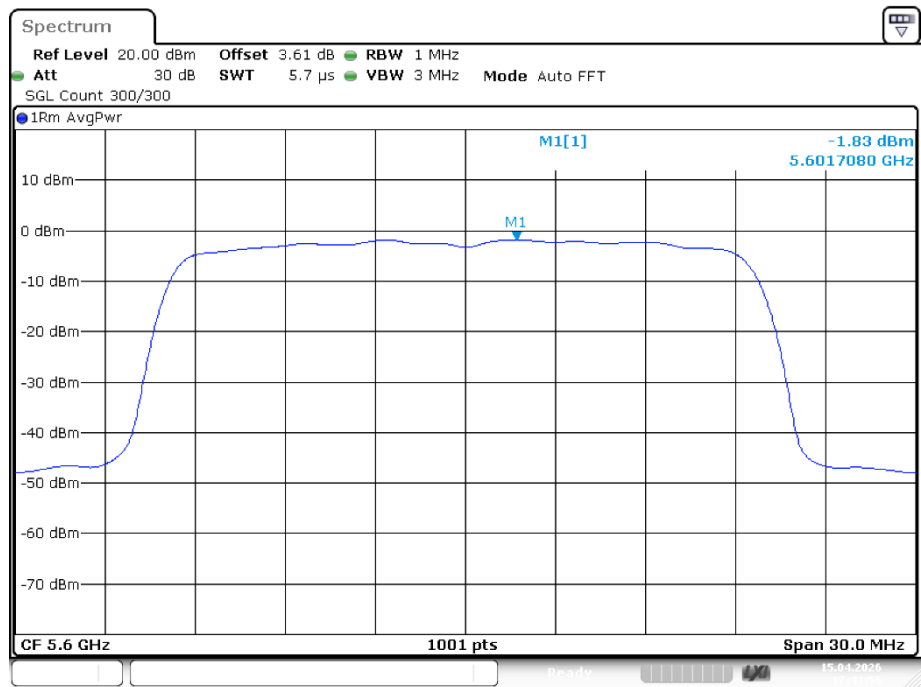


Date: 15.APR.2026 17:43:56

PSD NVNT ax20 5600MHz Ant1

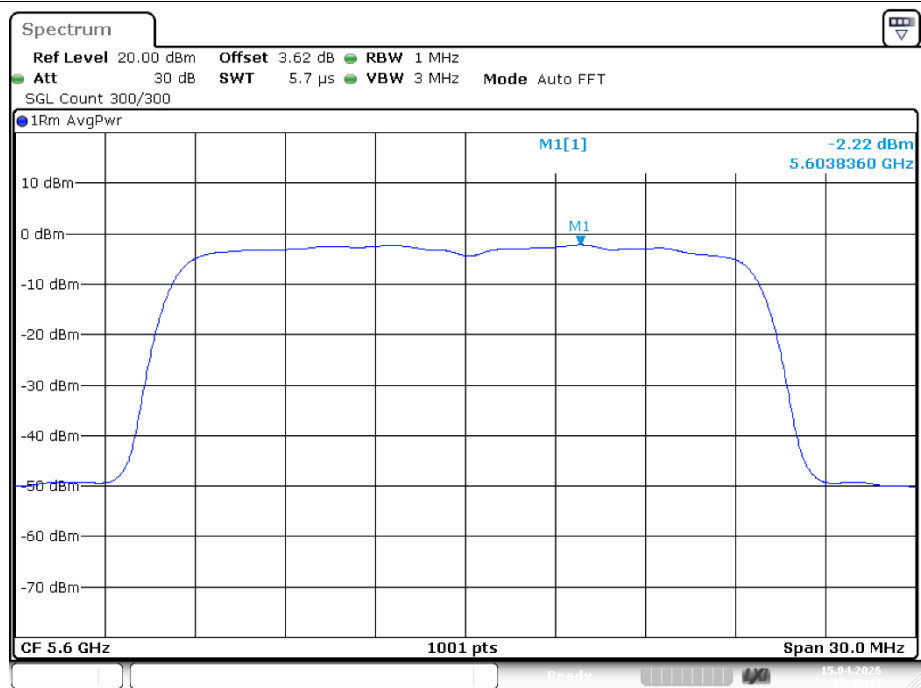


Date: 15.APR.2026 17:45:11

PSD NVNT ax20 5600MHz Ant2

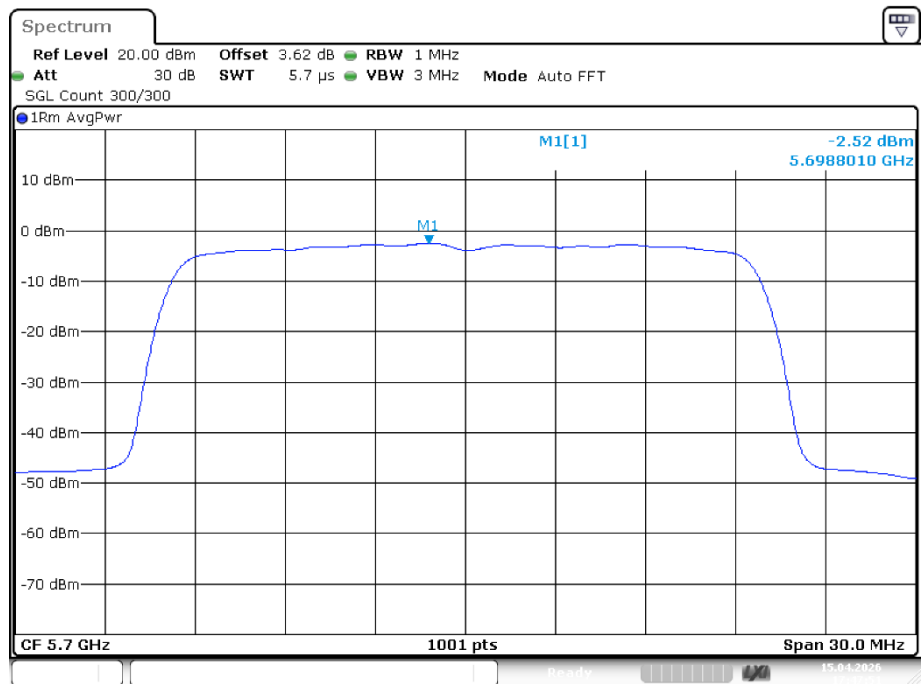


Date: 15.APR.2026 17:47:51

PSD NVNT ax20 5700MHz Ant1

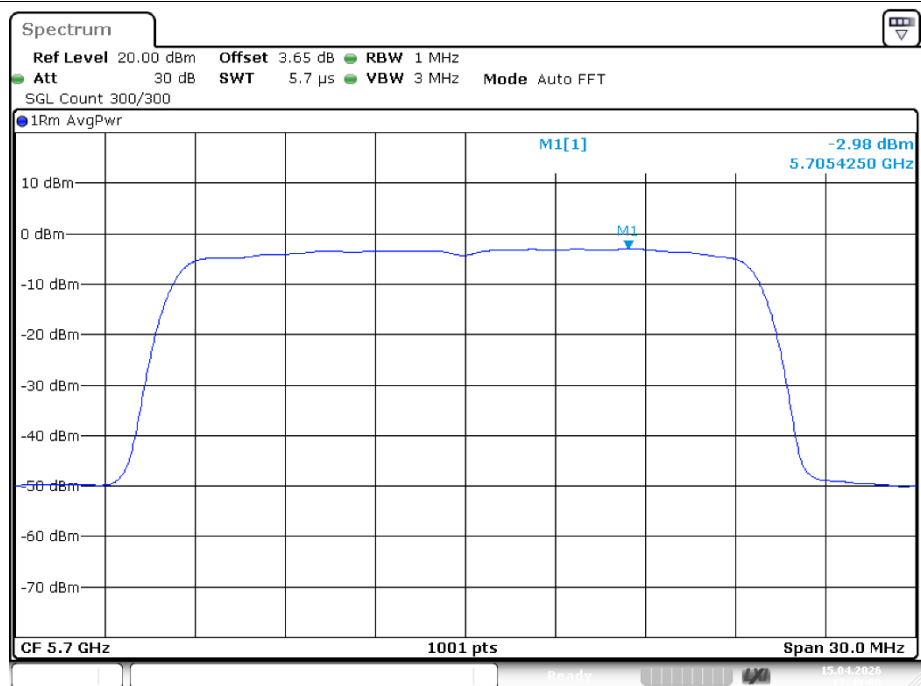


Date: 15.APR.2026 17:49:08

PSD NVNT ax20 5700MHz Ant2

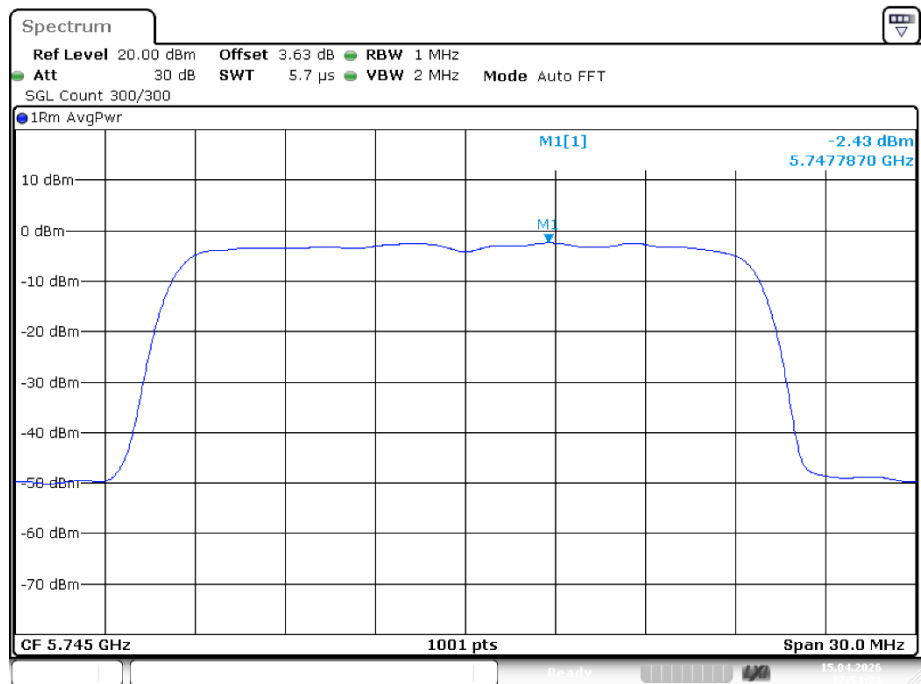


Date: 15.APR.2026 17:54:21

PSD NVNT ax20 5745MHz Ant1

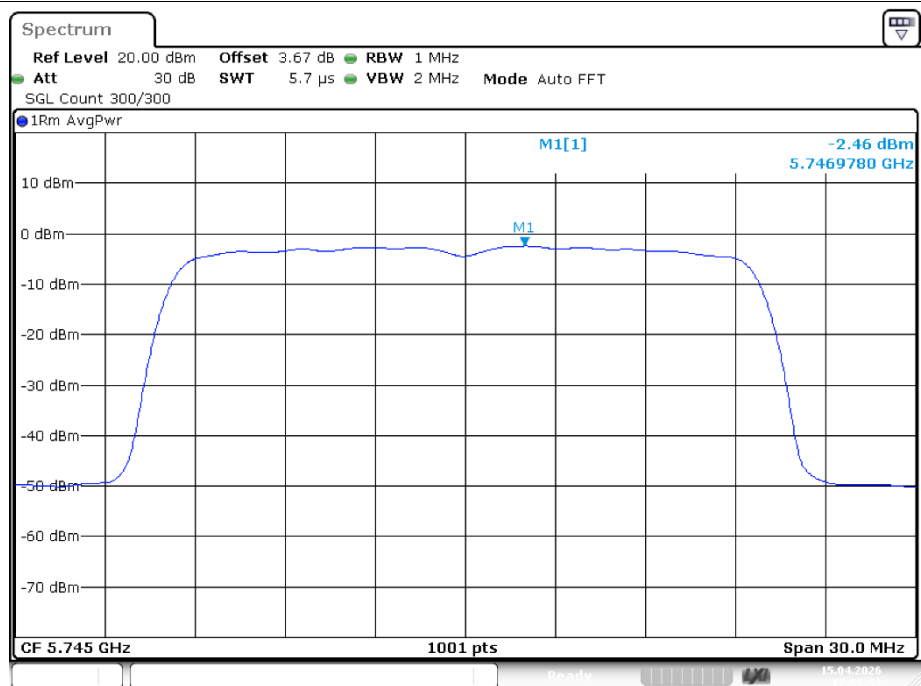


Date: 15.APR.2026 17:55:52

PSD NVNT ax20 5745MHz Ant2

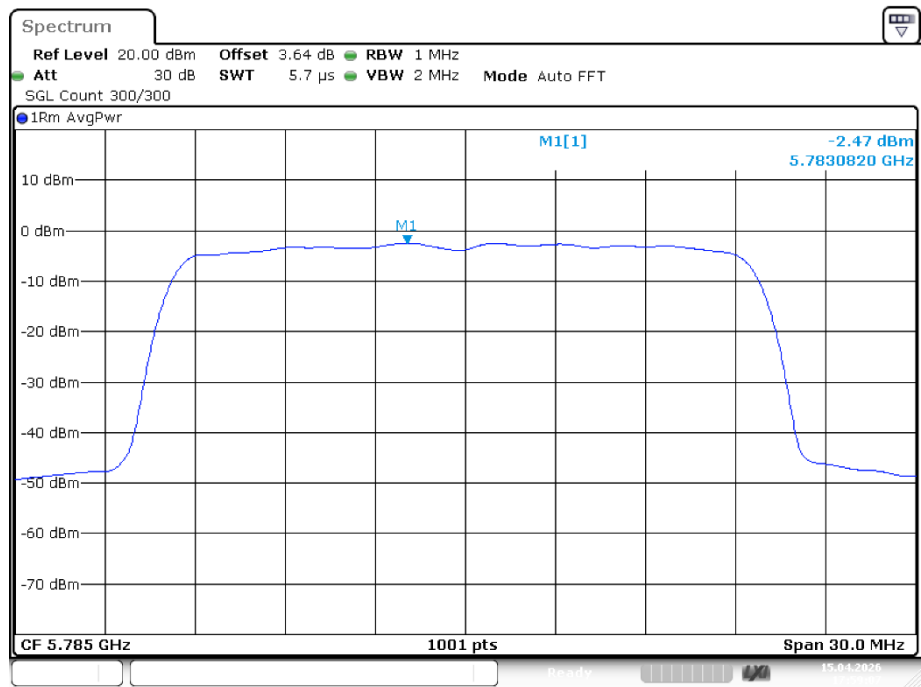


Date: 15.APR.2026 17:59:07

PSD NVNT ax20 5785MHz Ant1

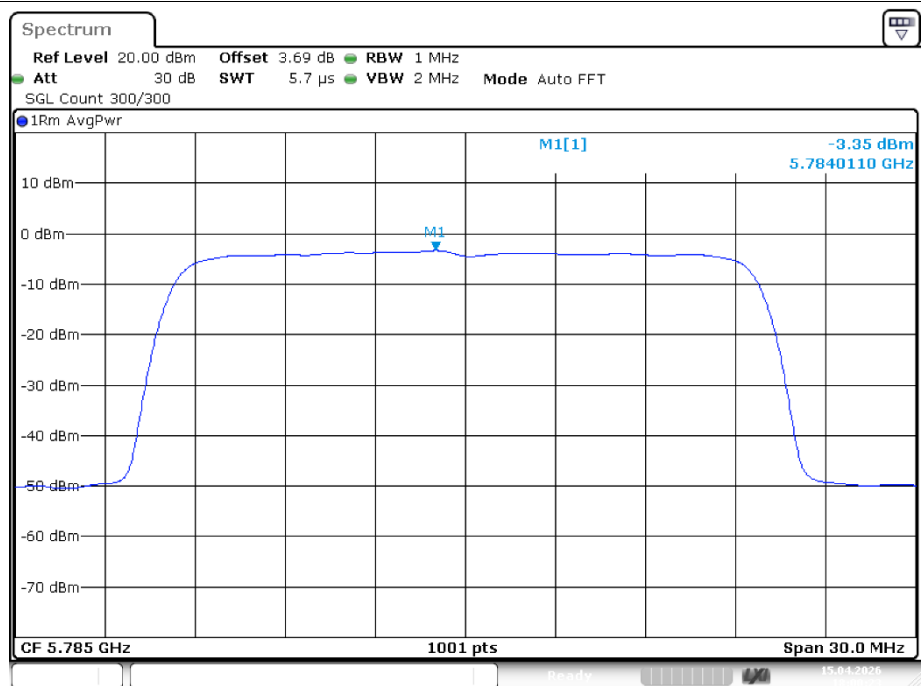


Date: 15.APR.2026 18:00:24

PSD NVNT ax20 5785MHz Ant2

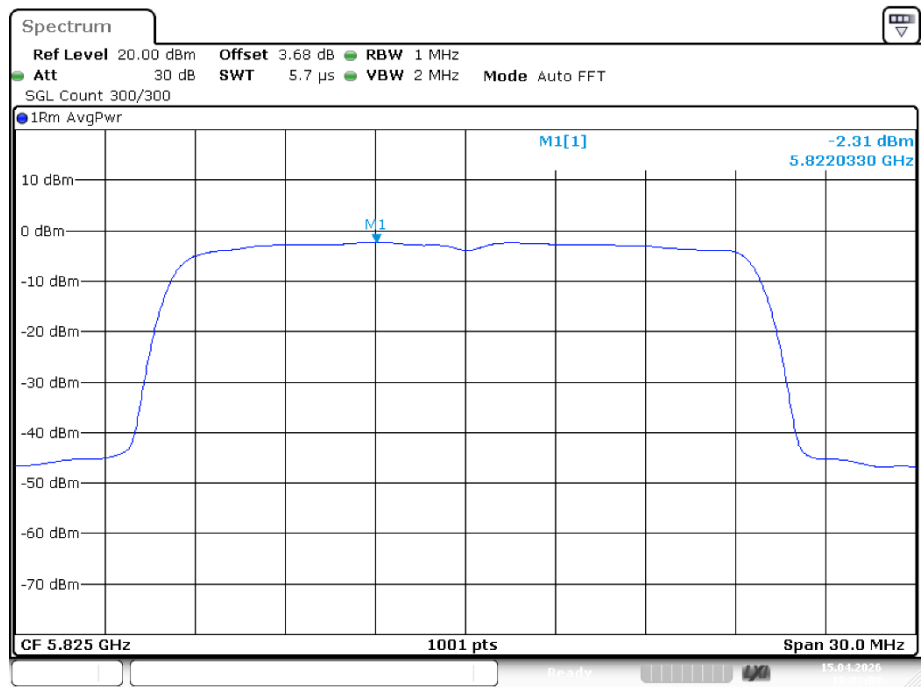


Date: 15.APR.2026 18:02:59

PSD NVNT ax20 5825MHz Ant1

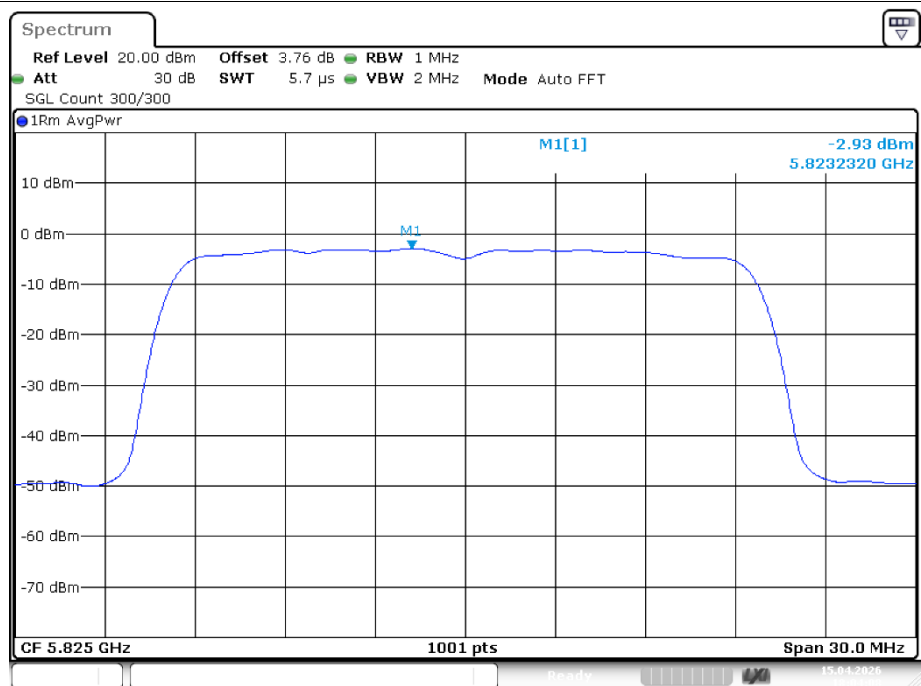


Date: 15.APR.2026 18:04:07

PSD NVNT ax20 5825MHz Ant2

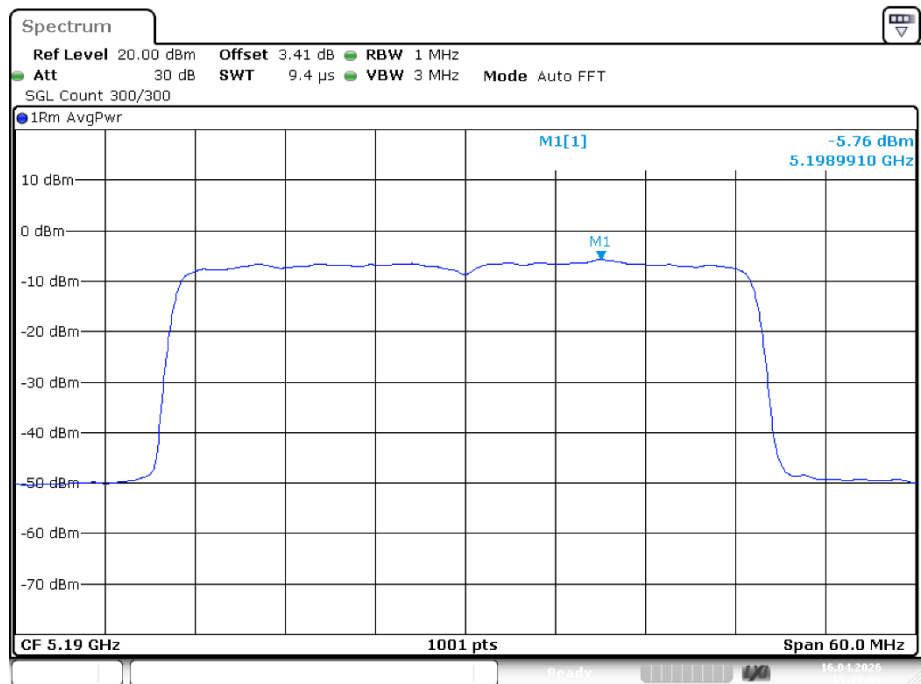


Date: 16.APR.2026 15:38:06

PSD NVNT ax40 5190MHz Ant1

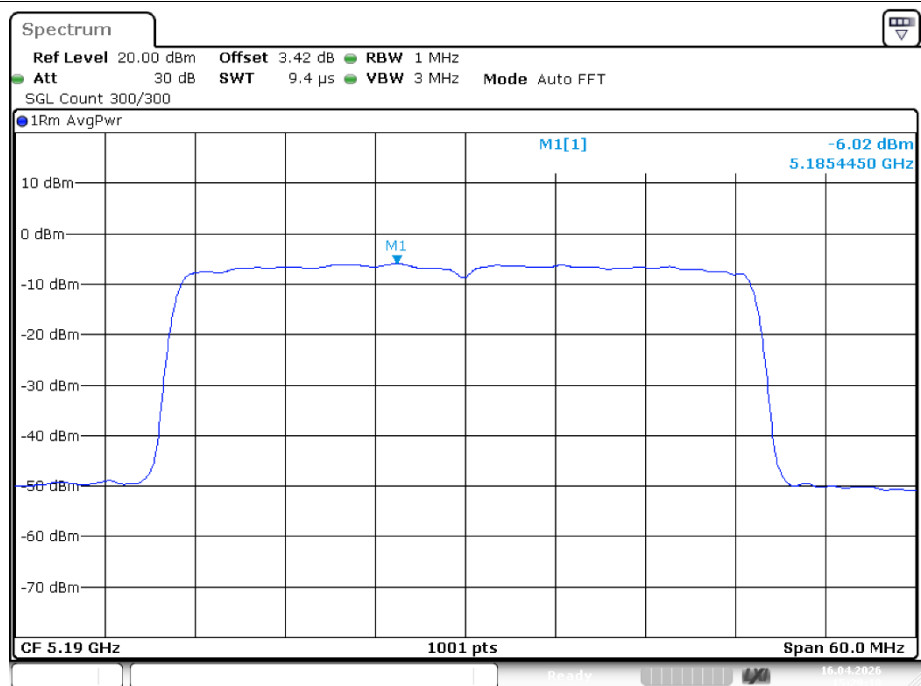


Date: 16.APR.2026 15:29:18

PSD NVNT ax40 5190MHz Ant2

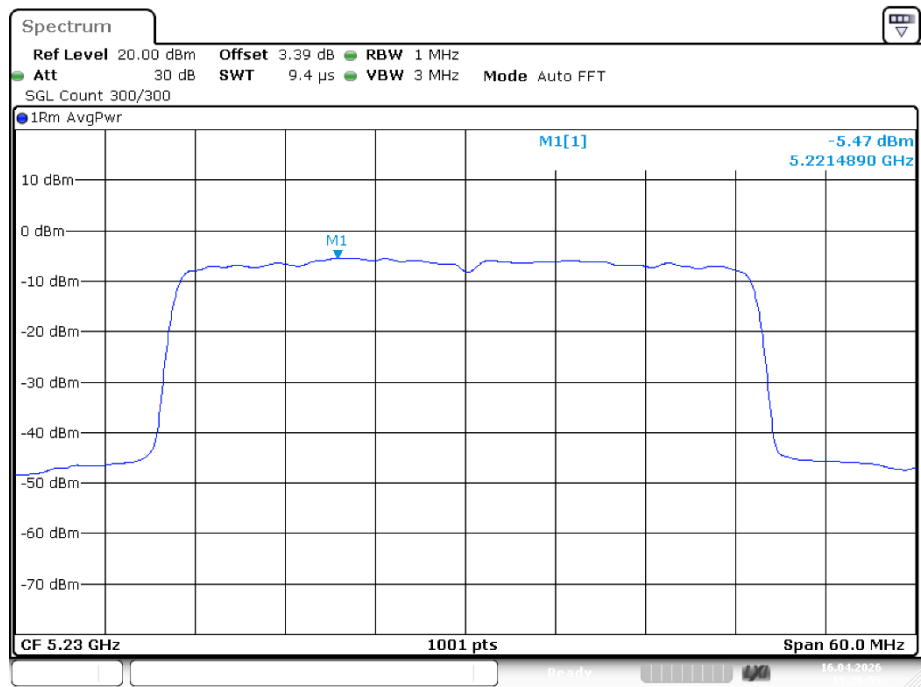


Date: 16.APR.2026 15:26:54

PSD NVNT ax40 5230MHz Ant1

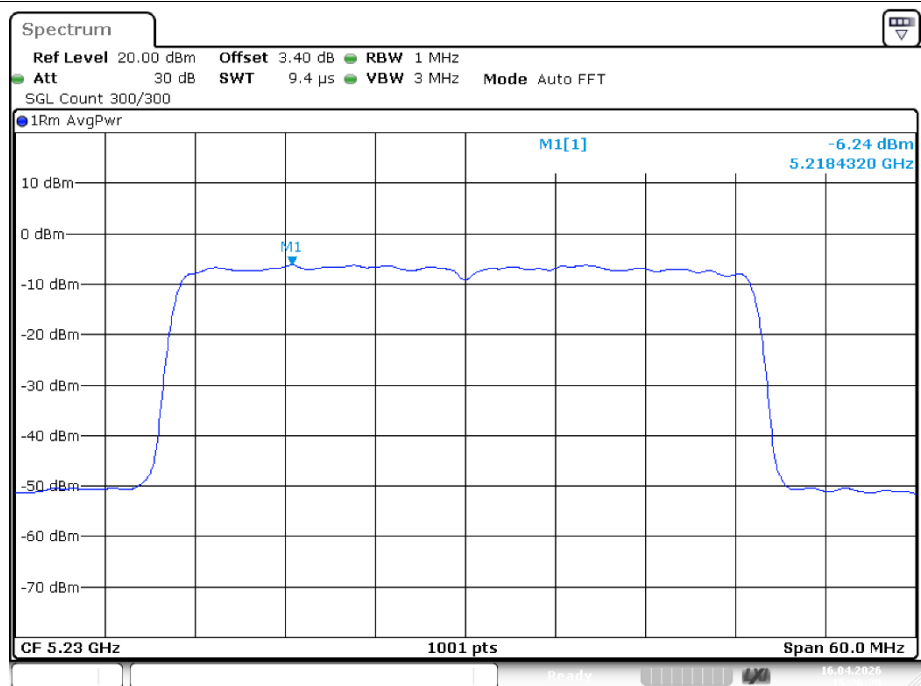


Date: 16.APR.2026 15:26:29

PSD NVNT ax40 5230MHz Ant2

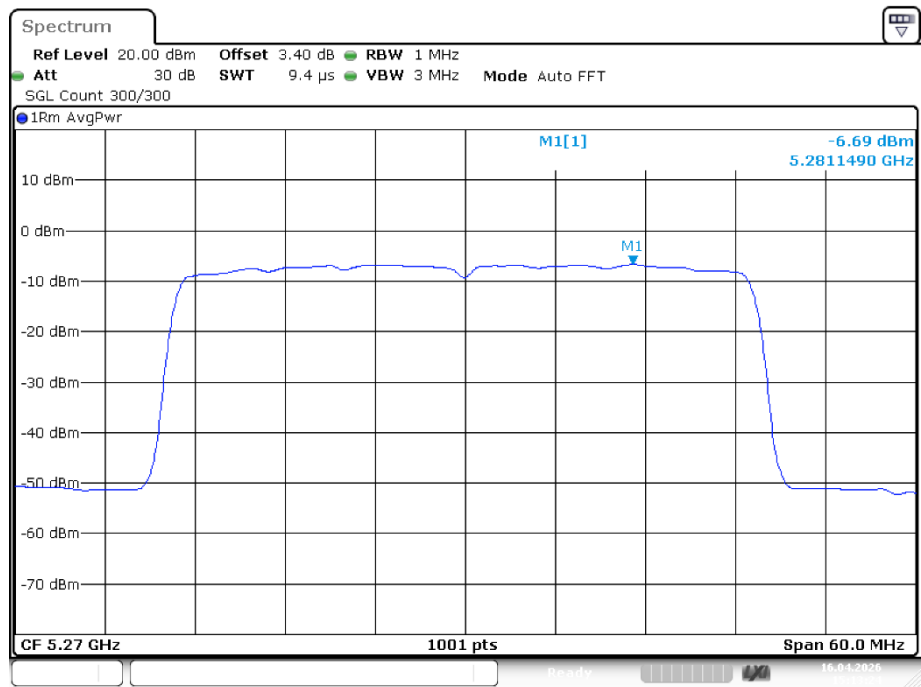


Date: 16.APR.2026 15:13:23

PSD NVNT ax40 5270MHz Ant1

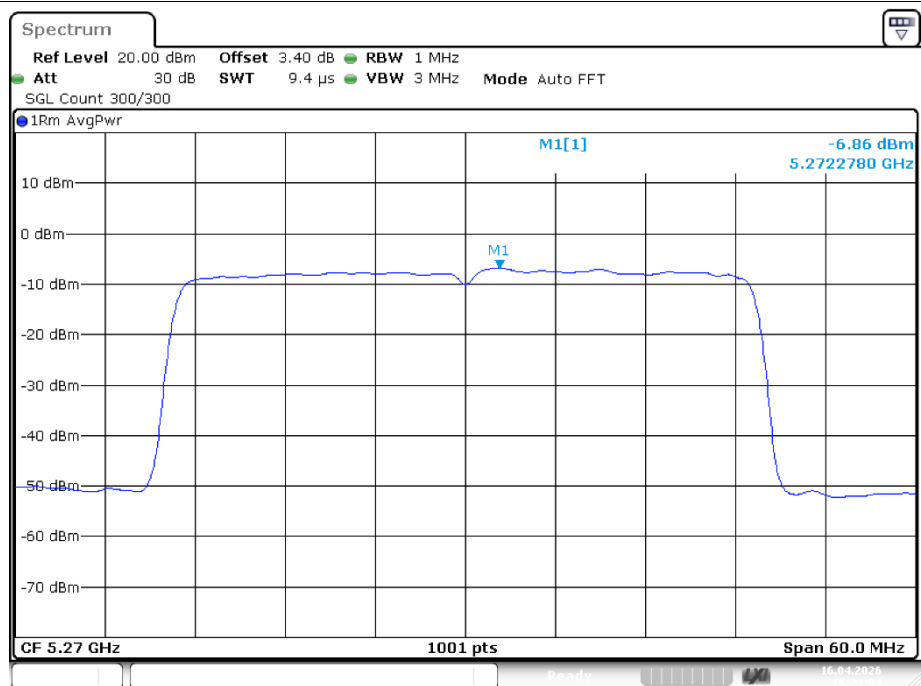


Date: 16.APR.2026 15:21:04

PSD NVNT ax40 5270MHz Ant2

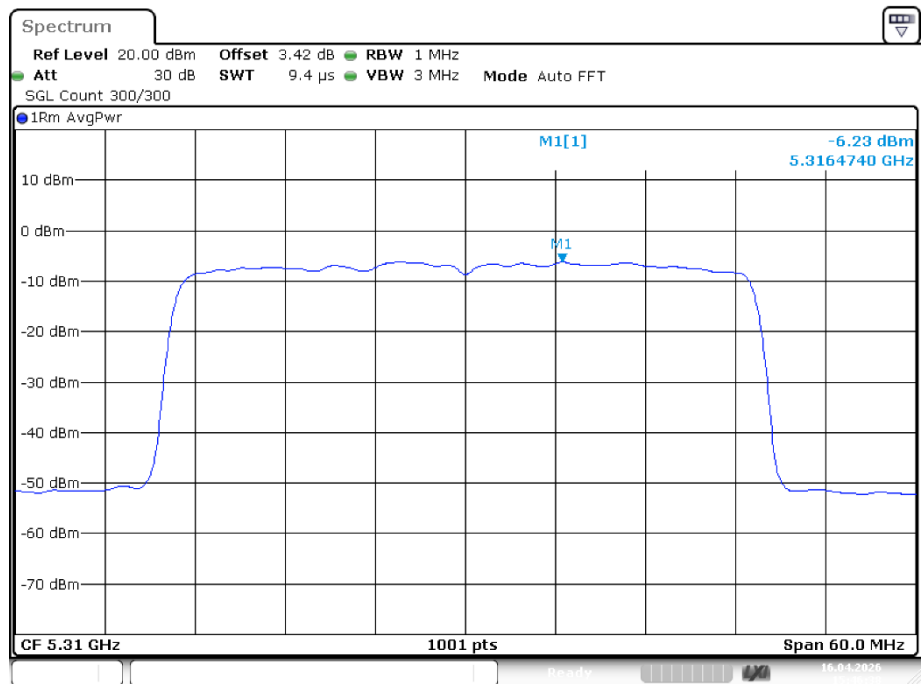


Date: 16.APR.2026 15:46:38

PSD NVNT ax40 5310MHz Ant1

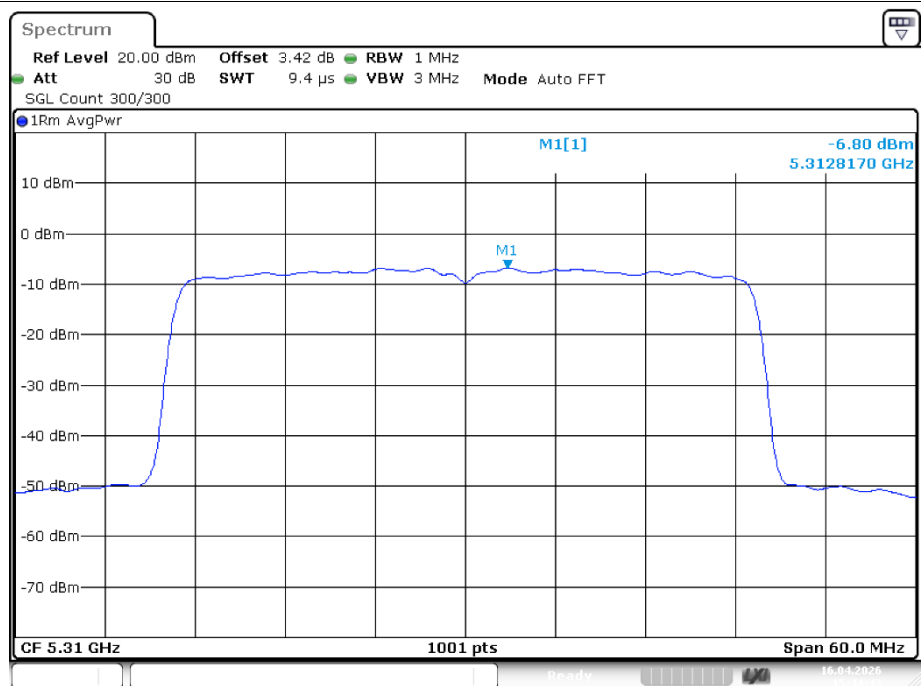


Date: 16.APR.2026 15:44:44

PSD NVNT ax40 5310MHz Ant2

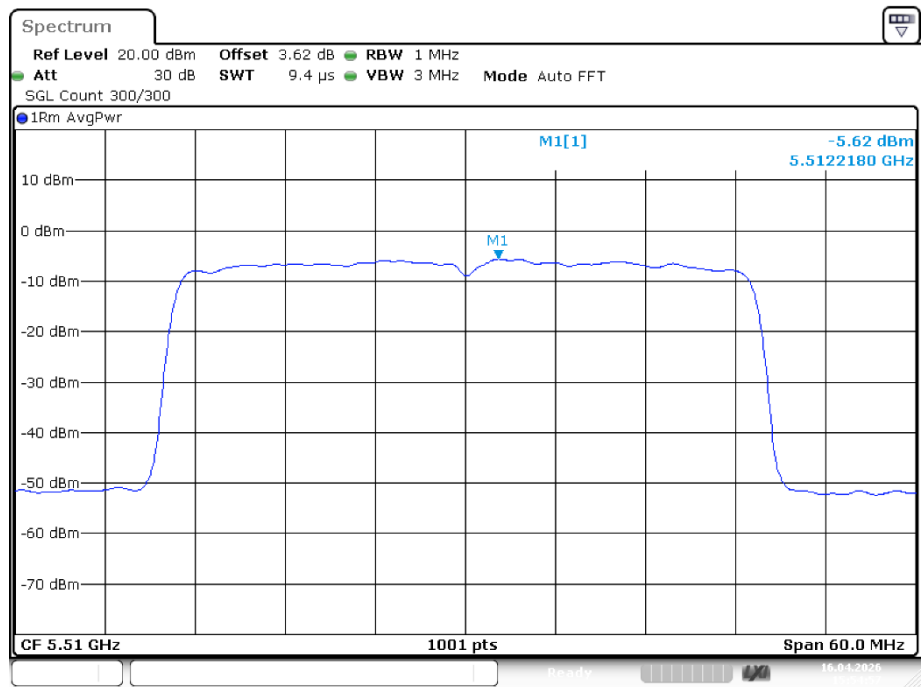


Date: 16.APR.2026 15:54:57

PSD NVNT ax40 5510MHz Ant1

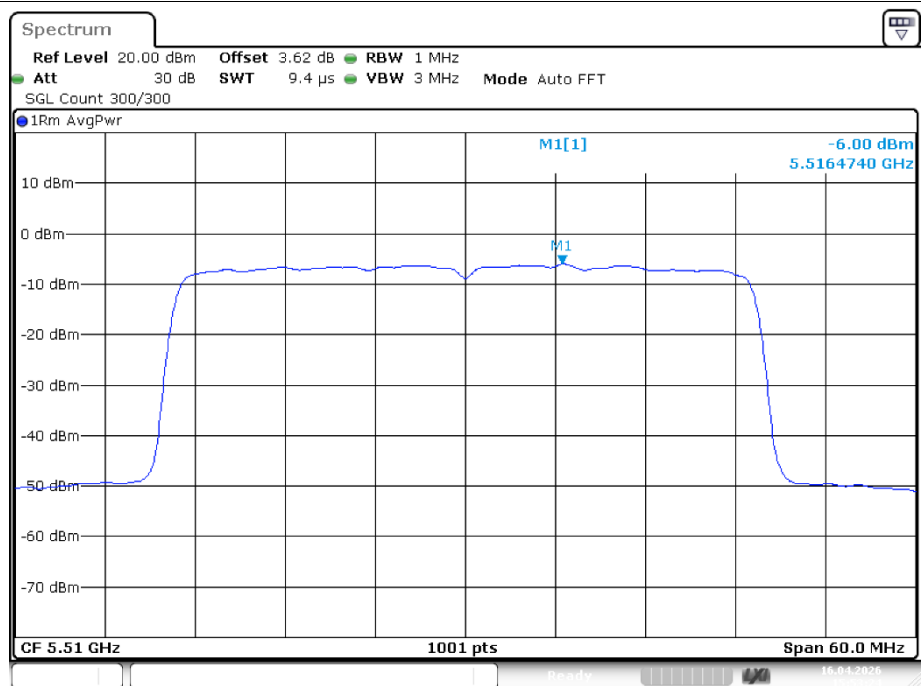


Date: 16.APR.2026 15:53:23

PSD NVNT ax40 5510MHz Ant2

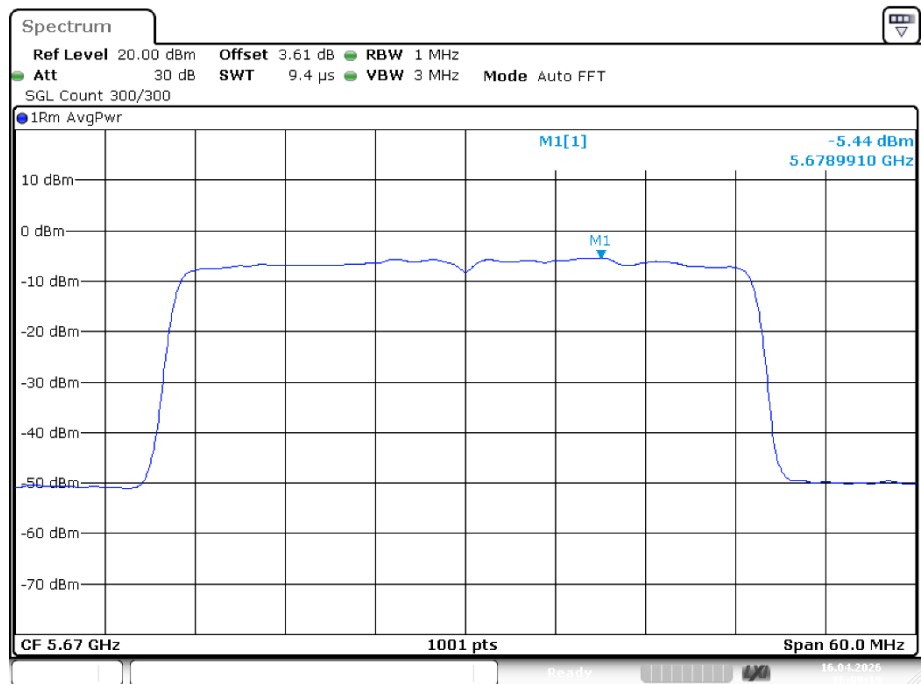


Date: 16.APR.2026 16:09:20

PSD NVNT ax40 5670MHz Ant1

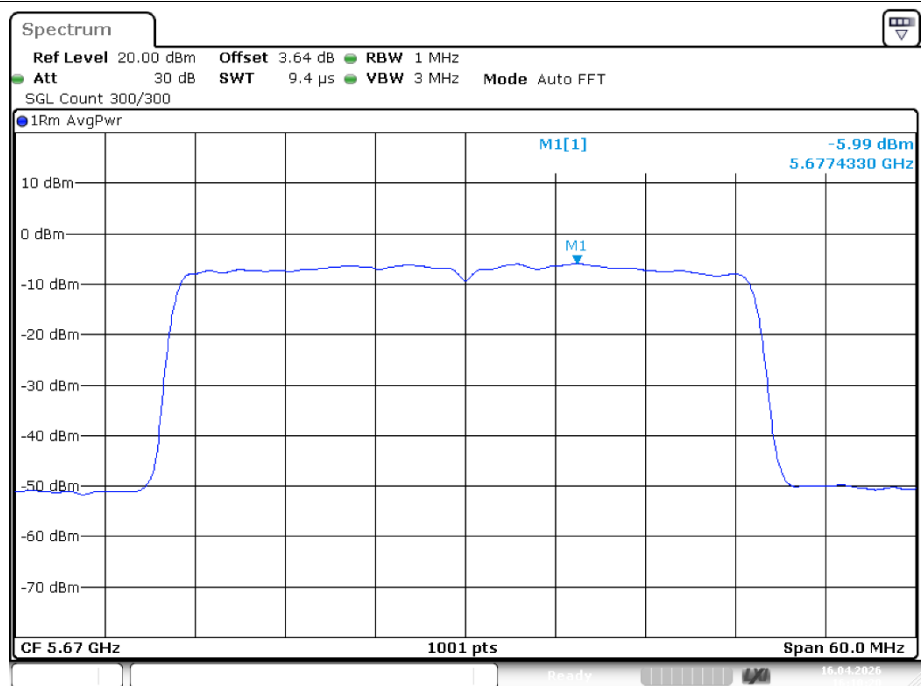


Date: 16.APR.2026 16:10:20


PSD NVNT ax40 5670MHz Ant2

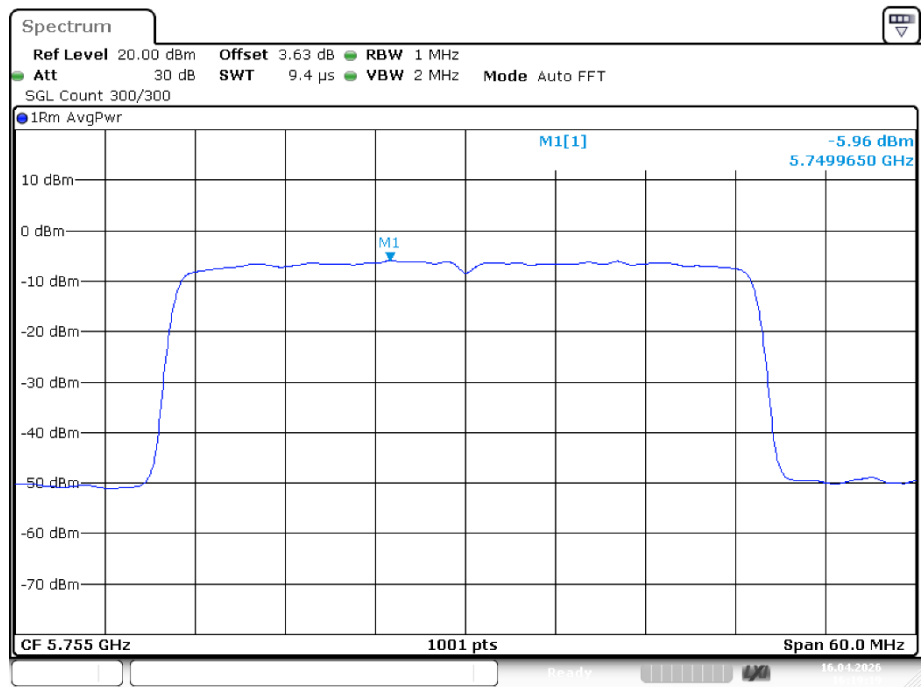

PSD NVNT ax40 5755MHz Ant1

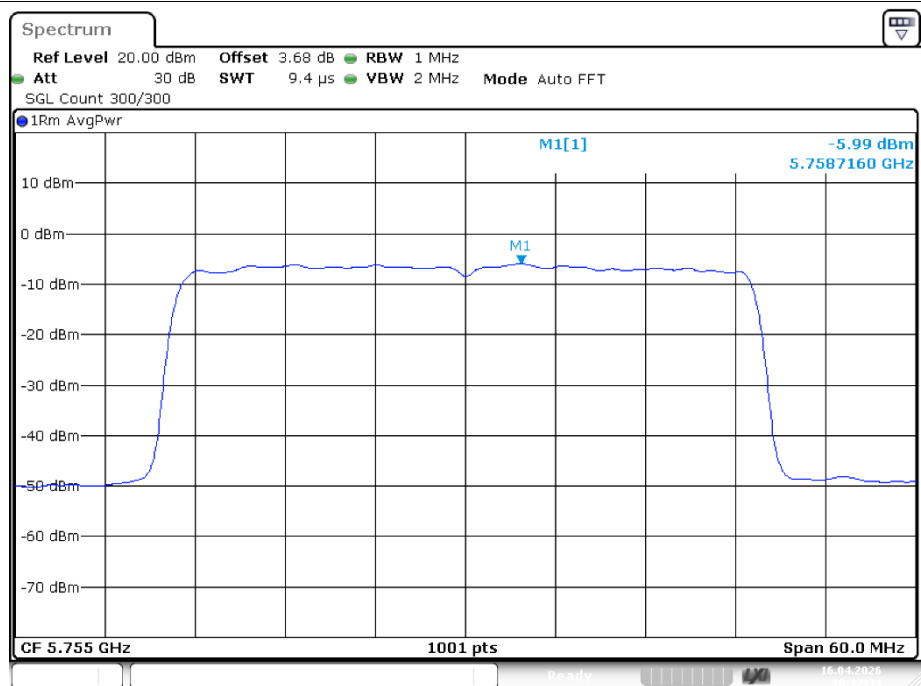


PSD NVNT ax40 5755MHz Ant2

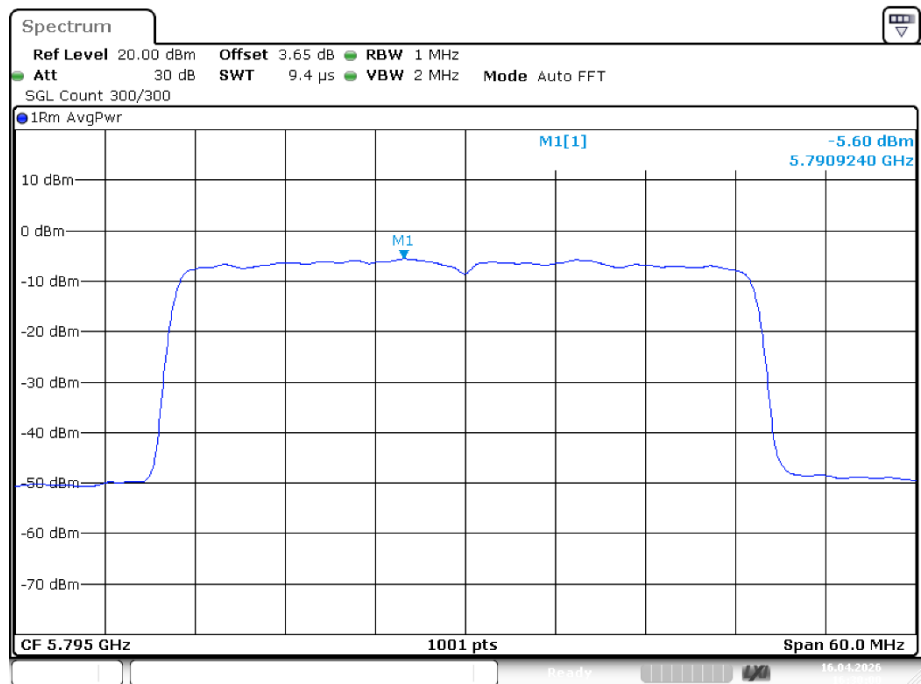


Date: 16.APR.2026 16:30:00

PSD NVNT ax40 5795MHz Ant1

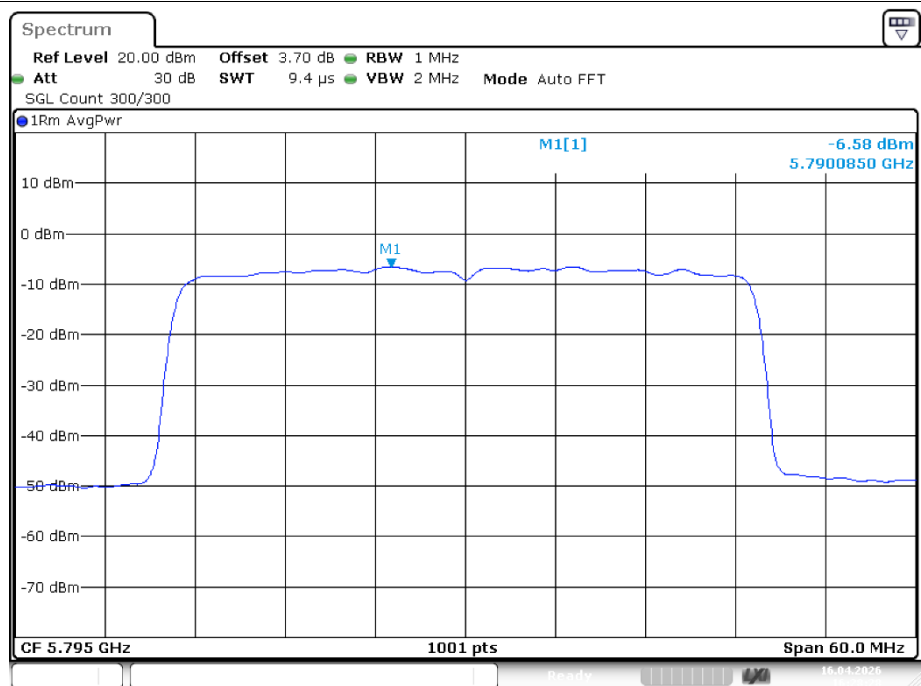


Date: 16.APR.2026 16:28:28


PSD NVNT ax40 5795MHz Ant2

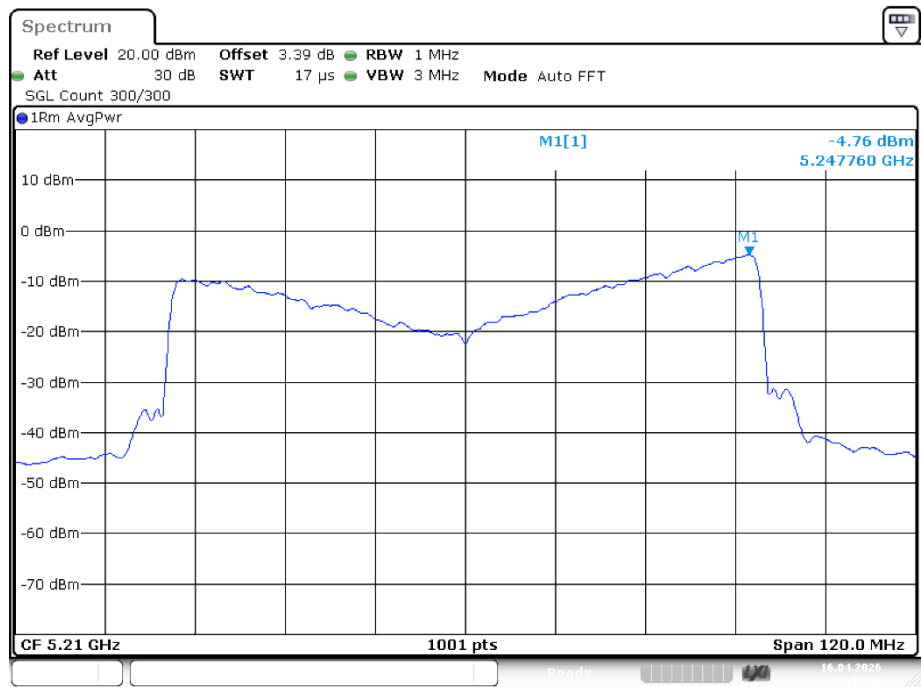

PSD NVNT ax80 5210MHz Ant1

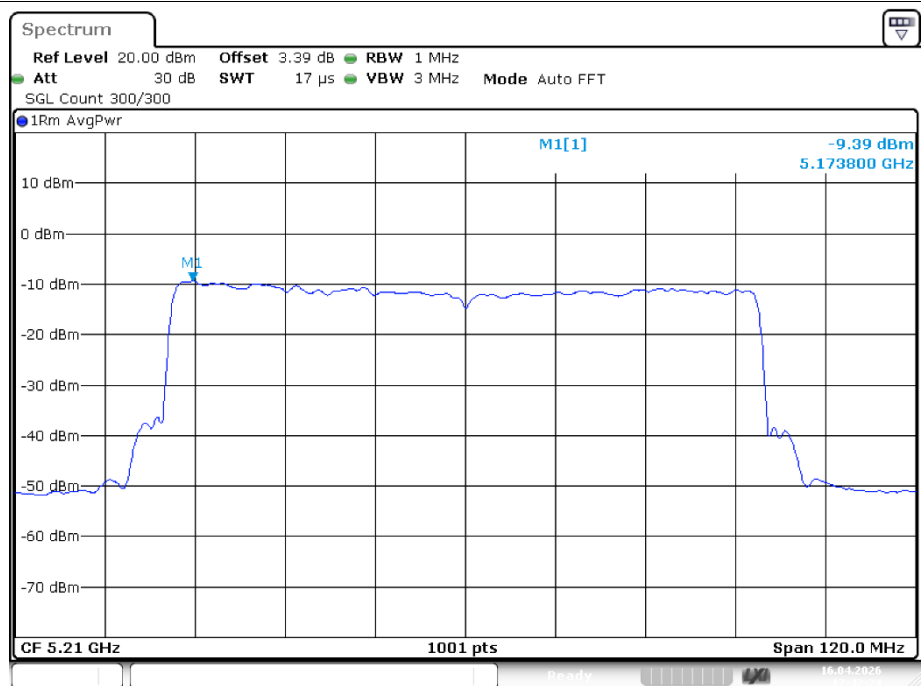


PSD NVNT ax80 5210MHz Ant2

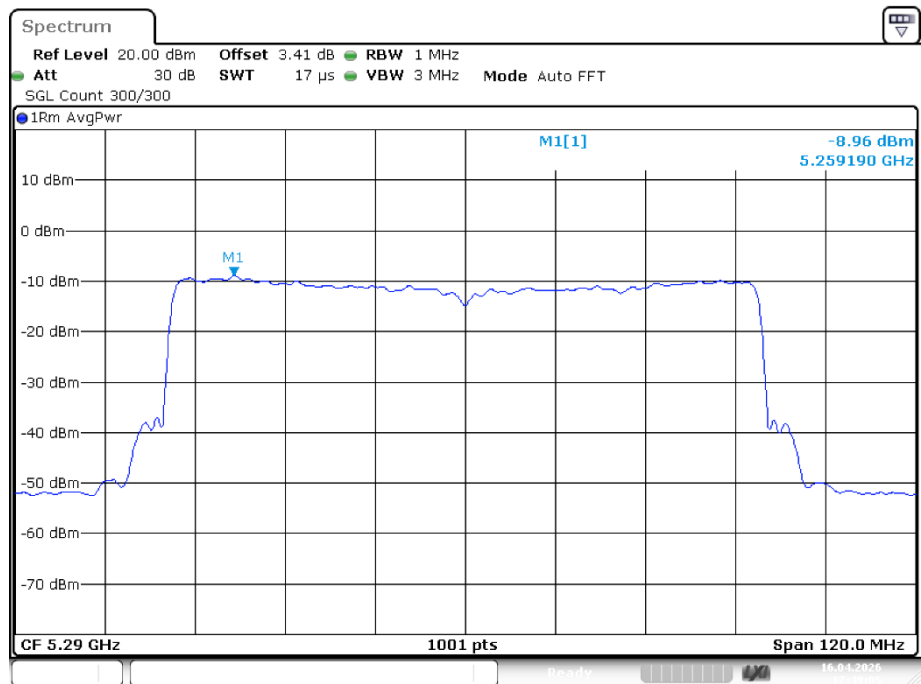


Date: 16.APR.2026 17:49:05

PSD NVNT ax80 5290MHz Ant1

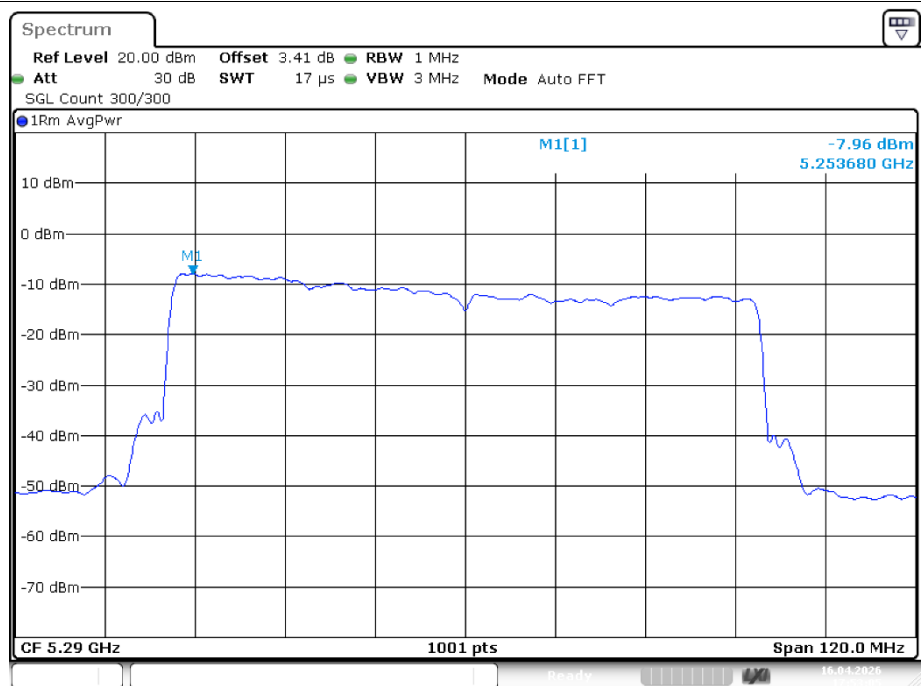


Date: 16.APR.2026 17:53:05

PSD NVNT ax80 5290MHz Ant2

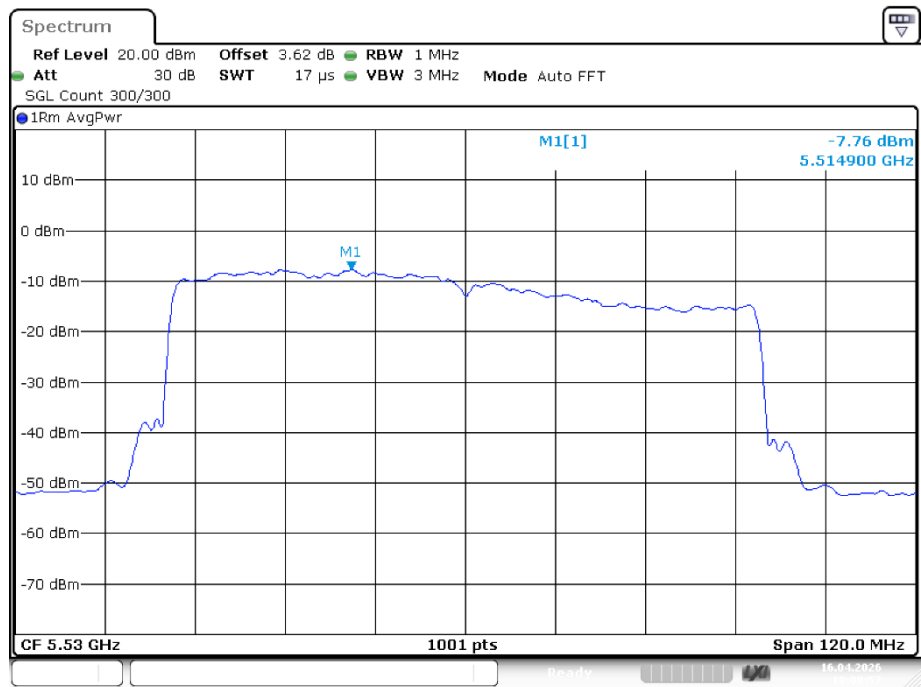


Date: 16.APR.2026 18:00:57

PSD NVNT ax80 5530MHz Ant1

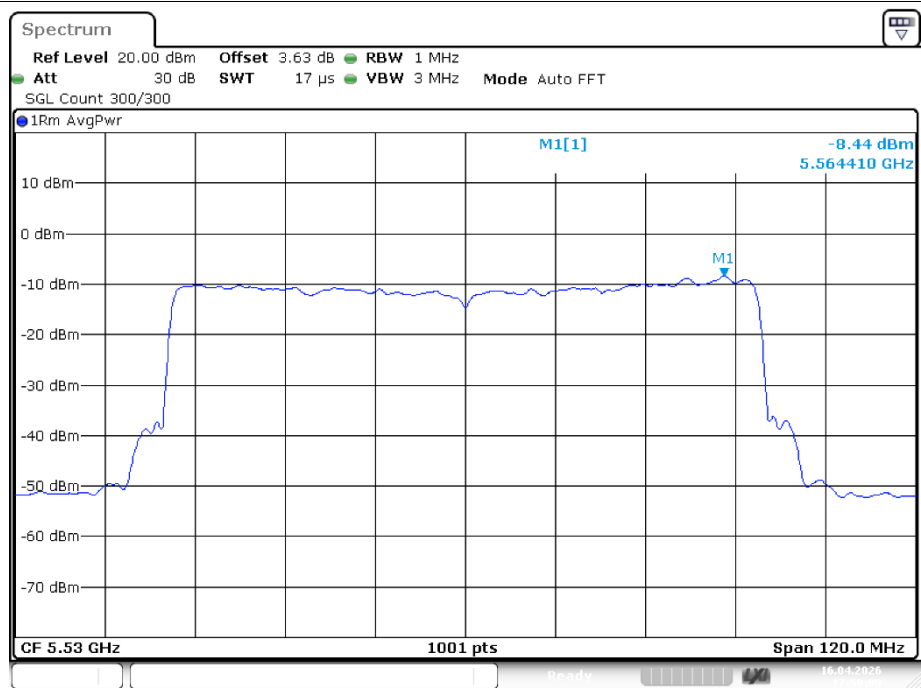


Date: 16.APR.2026 17:59:09

PSD NVNT ax80 5530MHz Ant2

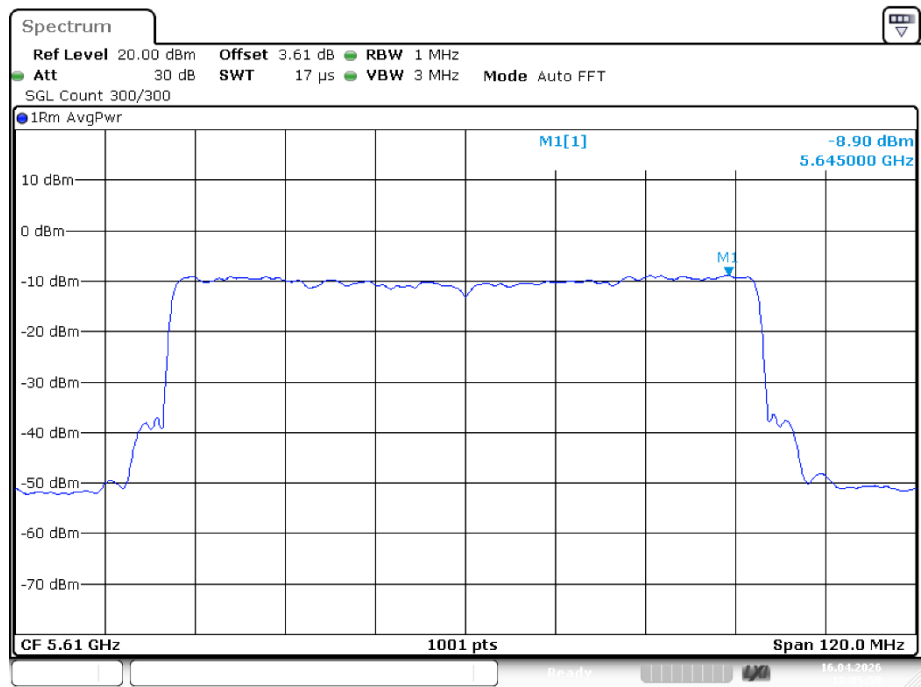


Date: 16.APR.2026 18:05:50

PSD NVNT ax80 5610MHz Ant1

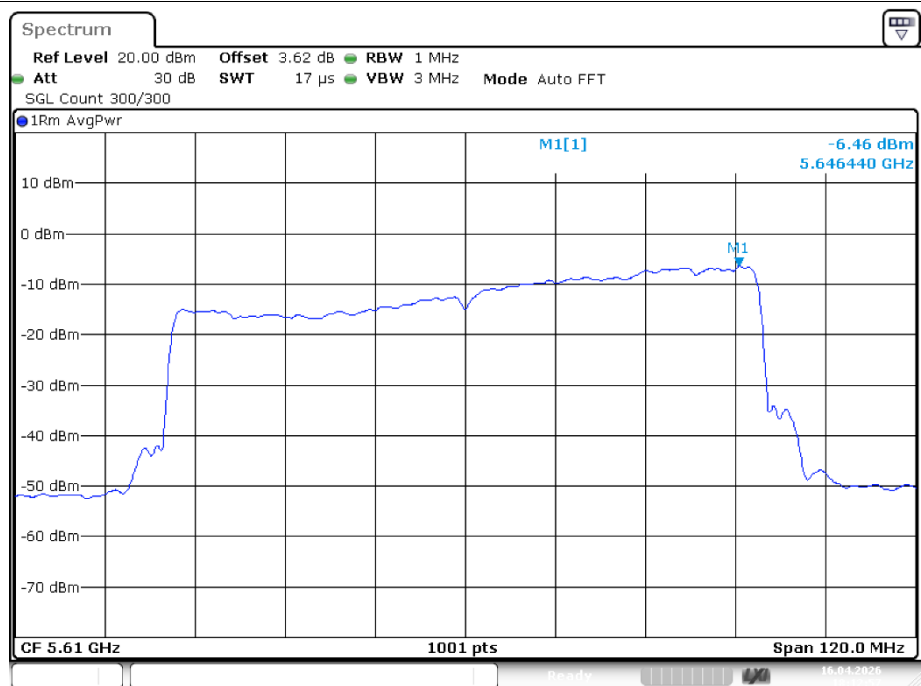


Date: 16.APR.2026 18:12:57

PSD NVNT ax80 5610MHz Ant2

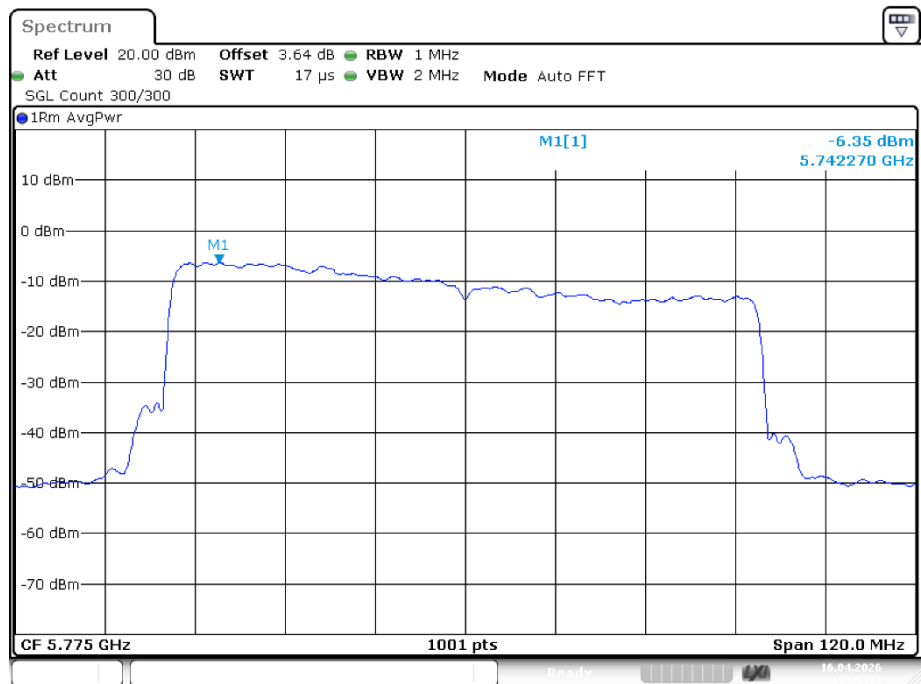

Date: 16.APR.2026 18:26:52

PSD NVNT ax80 5775MHz Ant1

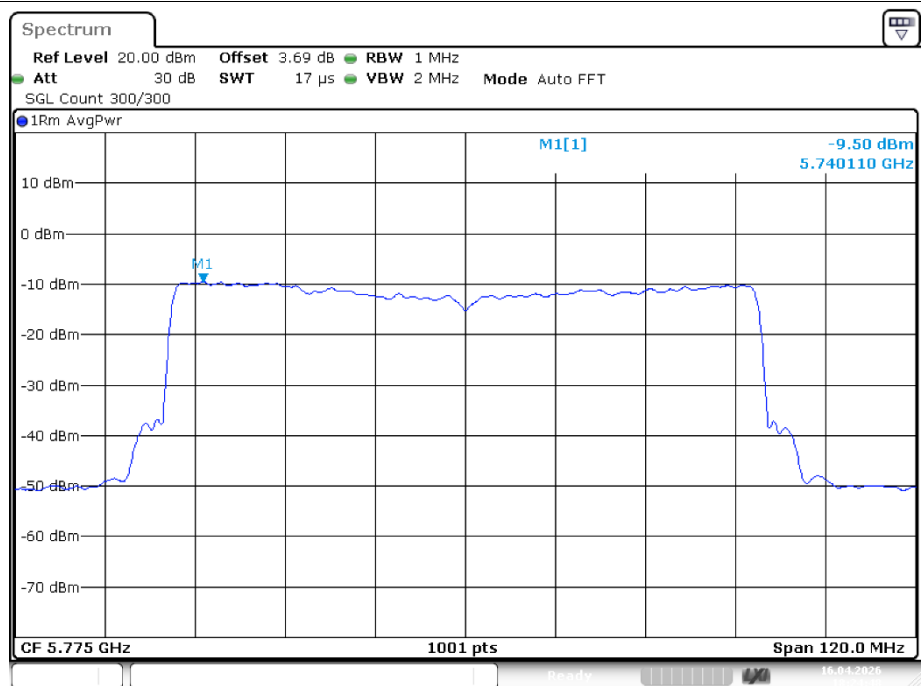

Date: 16.APR.2026 18:24:48

PSD NVNT ax80 5775MHz Ant2

Frequency Stability

Condition	Mode	Frequency (MHz)	Antenna	Measured Frequency (MHz)	Frequency Error (Hz)	Deviation (ppm)	Limit (ppm)	Verdict
40C 10.2V	a	5180	Ant1	5179.94	-60000	-11.58	25	Pass
40C 12V	a	5180	Ant1	5180	0	0	25	Pass
40C 13.8V	a	5180	Ant1	5179.98	-20000	-3.86	25	Pass
-20C 12V	a	5180	Ant1	5179.98	-20000	-3.86	25	Pass
-10C 12V	a	5180	Ant1	5179.96	-40000	-7.72	25	Pass
0C 12V	a	5180	Ant1	5179.98	-20000	-3.86	25	Pass
10C 12V	a	5180	Ant1	5179.98	-20000	-3.86	25	Pass
20C 12V	a	5180	Ant1	5179.98	-20000	-3.86	25	Pass
30C 12V	a	5180	Ant1	5179.98	-20000	-3.86	25	Pass
40C 10.2V	a	5200	Ant1	5199.98	-20000	-3.85	25	Pass
40C 12V	a	5200	Ant1	5199.98	-20000	-3.85	25	Pass
40C 13.8V	a	5200	Ant1	5199.98	-20000	-3.85	25	Pass
-20C 12V	a	5200	Ant1	5199.98	-20000	-3.85	25	Pass
-10C 12V	a	5200	Ant1	5199.98	-20000	-3.85	25	Pass
0C 12V	a	5200	Ant1	5199.98	-20000	-3.85	25	Pass
10C 12V	a	5200	Ant1	5199.98	-20000	-3.85	25	Pass
20C 12V	a	5200	Ant1	5200	0	0	25	Pass
30C 12V	a	5200	Ant1	5199.98	-20000	-3.85	25	Pass
40C 10.2V	a	5240	Ant1	5239.96	-40000	-7.63	25	Pass
40C 12V	a	5240	Ant1	5240	0	0	25	Pass
40C 13.8V	a	5240	Ant1	5239.98	-20000	-3.82	25	Pass
-20C 12V	a	5240	Ant1	5239.98	-20000	-3.82	25	Pass
-10C 12V	a	5240	Ant1	5239.96	-40000	-7.63	25	Pass
0C 12V	a	5240	Ant1	5239.98	-20000	-3.82	25	Pass
10C 12V	a	5240	Ant1	5239.98	-20000	-3.82	25	Pass
20C 12V	a	5240	Ant1	5239.98	-20000	-3.82	25	Pass
30C 12V	a	5240	Ant1	5239.98	-20000	-3.82	25	Pass
40C 10.2V	a	5260	Ant1	5259.98	-20000	-3.8	25	Pass
40C 12V	a	5260	Ant1	5259.96	-40000	-7.6	25	Pass
40C 13.8V	a	5260	Ant1	5259.96	-40000	-7.6	25	Pass
-20C 12V	a	5260	Ant1	5259.98	-20000	-3.8	25	Pass
-10C 12V	a	5260	Ant1	5259.96	-40000	-7.6	25	Pass
0C 12V	a	5260	Ant1	5259.98	-20000	-3.8	25	Pass
10C 12V	a	5260	Ant1	5259.98	-20000	-3.8	25	Pass
20C 12V	a	5260	Ant1	5259.98	-20000	-3.8	25	Pass
30C 12V	a	5260	Ant1	5259.96	-40000	-7.6	25	Pass
40C 10.2V	a	5280	Ant1	5279.96	-40000	-7.58	25	Pass
40C 12V	a	5280	Ant1	5279.98	-20000	-3.79	25	Pass
40C 13.8V	a	5280	Ant1	5279.96	-40000	-7.58	25	Pass
-20C 12V	a	5280	Ant1	5279.98	-20000	-3.79	25	Pass

-10C 12V	a	5280	Ant1	5279.98	-20000	-3.79	25	Pass
0C 12V	a	5280	Ant1	5279.96	-40000	-7.58	25	Pass
10C 12V	a	5280	Ant1	5279.98	-20000	-3.79	25	Pass
20C 12V	a	5280	Ant1	5279.98	-20000	-3.79	25	Pass
30C 12V	a	5280	Ant1	5279.98	-20000	-3.79	25	Pass
40C 10.2V	a	5320	Ant1	5319.96	-40000	-7.52	25	Pass
40C 12V	a	5320	Ant1	5319.94	-60000	-11.28	25	Pass
40C 13.8V	a	5320	Ant1	5319.98	-20000	-3.76	25	Pass
-20C 12V	a	5320	Ant1	5319.98	-20000	-3.76	25	Pass
-10C 12V	a	5320	Ant1	5319.96	-40000	-7.52	25	Pass
0C 12V	a	5320	Ant1	5319.98	-20000	-3.76	25	Pass
10C 12V	a	5320	Ant1	5319.94	-60000	-11.28	25	Pass
20C 12V	a	5320	Ant1	5319.98	-20000	-3.76	25	Pass
30C 12V	a	5320	Ant1	5319.96	-40000	-7.52	25	Pass
40C 10.2V	a	5500	Ant1	5499.96	-40000	-7.27	25	Pass
40C 12V	a	5500	Ant1	5499.96	-40000	-7.27	25	Pass
40C 13.8V	a	5500	Ant1	5499.98	-20000	-3.64	25	Pass
-20C 12V	a	5500	Ant1	5499.98	-20000	-3.64	25	Pass
-10C 12V	a	5500	Ant1	5499.96	-40000	-7.27	25	Pass
0C 12V	a	5500	Ant1	5499.98	-20000	-3.64	25	Pass
10C 12V	a	5500	Ant1	5499.98	-20000	-3.64	25	Pass
20C 12V	a	5500	Ant1	5499.96	-40000	-7.27	25	Pass
30C 12V	a	5500	Ant1	5499.98	-20000	-3.64	25	Pass
40C 10.2V	a	5600	Ant1	5599.98	-20000	-3.57	25	Pass
40C 12V	a	5600	Ant1	5599.94	-60000	-10.71	25	Pass
40C 13.8V	a	5600	Ant1	5599.98	-20000	-3.57	25	Pass
-20C 12V	a	5600	Ant1	5599.98	-20000	-3.57	25	Pass
-10C 12V	a	5600	Ant1	5599.96	-40000	-7.14	25	Pass
0C 12V	a	5600	Ant1	5599.98	-20000	-3.57	25	Pass
10C 12V	a	5600	Ant1	5599.98	-20000	-3.57	25	Pass
20C 12V	a	5600	Ant1	5599.98	-20000	-3.57	25	Pass
30C 12V	a	5600	Ant1	5599.98	-20000	-3.57	25	Pass
40C 10.2V	a	5700	Ant1	5699.98	-20000	-3.51	25	Pass
40C 12V	a	5700	Ant1	5699.96	-40000	-7.02	25	Pass
40C 13.8V	a	5700	Ant1	5699.98	-20000	-3.51	25	Pass
-20C 12V	a	5700	Ant1	5699.98	-20000	-3.51	25	Pass
-10C 12V	a	5700	Ant1	5699.96	-40000	-7.02	25	Pass
0C 12V	a	5700	Ant1	5699.96	-40000	-7.02	25	Pass
10C 12V	a	5700	Ant1	5699.98	-20000	-3.51	25	Pass
20C 12V	a	5700	Ant1	5699.98	-20000	-3.51	25	Pass
30C 12V	a	5700	Ant1	5699.98	-20000	-3.51	25	Pass
40C 10.2V	a	5745	Ant1	5744.98	-20000	-3.48	25	Pass
40C 12V	a	5745	Ant1	5744.98	-20000	-3.48	25	Pass
40C 13.8V	a	5745	Ant1	5744.98	-20000	-3.48	25	Pass

-20C 12V	a	5745	Ant1	5744.96	-40000	-6.96	25	Pass
-10C 12V	a	5745	Ant1	5744.96	-40000	-6.96	25	Pass
0C 12V	a	5745	Ant1	5744.94	-60000	-10.44	25	Pass
10C 12V	a	5745	Ant1	5744.96	-40000	-6.96	25	Pass
20C 12V	a	5745	Ant1	5744.98	-20000	-3.48	25	Pass
30C 12V	a	5745	Ant1	5744.94	-60000	-10.44	25	Pass
40C 10.2V	a	5785	Ant1	5784.96	-40000	-6.91	25	Pass
40C 12V	a	5785	Ant1	5784.98	-20000	-3.46	25	Pass
40C 13.8V	a	5785	Ant1	5784.98	-20000	-3.46	25	Pass
-20C 12V	a	5785	Ant1	5784.98	-20000	-3.46	25	Pass
-10C 12V	a	5785	Ant1	5784.94	-60000	-10.37	25	Pass
0C 12V	a	5785	Ant1	5784.96	-40000	-6.91	25	Pass
10C 12V	a	5785	Ant1	5784.96	-40000	-6.91	25	Pass
20C 12V	a	5785	Ant1	5784.96	-40000	-6.91	25	Pass
30C 12V	a	5785	Ant1	5784.98	-20000	-3.46	25	Pass
40C 10.2V	a	5825	Ant1	5824.96	-40000	-6.87	25	Pass
40C 12V	a	5825	Ant1	5824.98	-20000	-3.43	25	Pass
40C 13.8V	a	5825	Ant1	5824.96	-40000	-6.87	25	Pass
-20C 12V	a	5825	Ant1	5824.96	-40000	-6.87	25	Pass
-10C 12V	a	5825	Ant1	5824.98	-20000	-3.43	25	Pass
0C 12V	a	5825	Ant1	5824.98	-20000	-3.43	25	Pass
10C 12V	a	5825	Ant1	5824.96	-40000	-6.87	25	Pass
20C 12V	a	5825	Ant1	5824.96	-40000	-6.87	25	Pass
30C 12V	a	5825	Ant1	5824.96	-40000	-6.87	25	Pass
40C 10.2V	a	5180	Ant2	5179.96	-40000	-7.72	25	Pass
40C 12V	a	5180	Ant2	5179.96	-40000	-7.72	25	Pass
40C 13.8V	a	5180	Ant2	5179.94	-60000	-11.58	25	Pass
-20C 12V	a	5180	Ant2	5179.98	-20000	-3.86	25	Pass
-10C 12V	a	5180	Ant2	5179.98	-20000	-3.86	25	Pass
0C 12V	a	5180	Ant2	5179.96	-40000	-7.72	25	Pass
10C 12V	a	5180	Ant2	5179.98	-20000	-3.86	25	Pass
20C 12V	a	5180	Ant2	5179.98	-20000	-3.86	25	Pass
30C 12V	a	5180	Ant2	5179.96	-40000	-7.72	25	Pass
40C 10.2V	a	5200	Ant2	5199.98	-20000	-3.85	25	Pass
40C 12V	a	5200	Ant2	5199.98	-20000	-3.85	25	Pass
40C 13.8V	a	5200	Ant2	5199.98	-20000	-3.85	25	Pass
-20C 12V	a	5200	Ant2	5199.94	-60000	-11.54	25	Pass
-10C 12V	a	5200	Ant2	5199.98	-20000	-3.85	25	Pass
0C 12V	a	5200	Ant2	5199.98	-20000	-3.85	25	Pass
10C 12V	a	5200	Ant2	5199.96	-40000	-7.69	25	Pass
20C 12V	a	5200	Ant2	5199.98	-20000	-3.85	25	Pass
30C 12V	a	5200	Ant2	5199.98	-20000	-3.85	25	Pass
40C 10.2V	a	5240	Ant2	5239.98	-20000	-3.82	25	Pass
40C 12V	a	5240	Ant2	5239.98	-20000	-3.82	25	Pass

40C 13.8V	a	5240	Ant2	5239.98	-20000	-3.82	25	Pass
-20C 12V	a	5240	Ant2	5239.96	-40000	-7.63	25	Pass
-10C 12V	a	5240	Ant2	5239.98	-20000	-3.82	25	Pass
0C 12V	a	5240	Ant2	5239.98	-20000	-3.82	25	Pass
10C 12V	a	5240	Ant2	5239.96	-40000	-7.63	25	Pass
20C 12V	a	5240	Ant2	5239.96	-40000	-7.63	25	Pass
30C 12V	a	5240	Ant2	5239.98	-20000	-3.82	25	Pass
40C 10.2V	a	5260	Ant2	5259.96	-40000	-7.6	25	Pass
40C 12V	a	5260	Ant2	5259.96	-40000	-7.6	25	Pass
40C 13.8V	a	5260	Ant2	5259.98	-20000	-3.8	25	Pass
-20C 12V	a	5260	Ant2	5259.98	-20000	-3.8	25	Pass
-10C 12V	a	5260	Ant2	5259.96	-40000	-7.6	25	Pass
0C 12V	a	5260	Ant2	5259.98	-20000	-3.8	25	Pass
10C 12V	a	5260	Ant2	5259.96	-40000	-7.6	25	Pass
20C 12V	a	5260	Ant2	5259.96	-40000	-7.6	25	Pass
30C 12V	a	5260	Ant2	5259.98	-20000	-3.8	25	Pass
40C 10.2V	a	5280	Ant2	5279.98	-20000	-3.79	25	Pass
40C 12V	a	5280	Ant2	5279.98	-20000	-3.79	25	Pass
40C 13.8V	a	5280	Ant2	5279.96	-40000	-7.58	25	Pass
-20C 12V	a	5280	Ant2	5279.96	-40000	-7.58	25	Pass
-10C 12V	a	5280	Ant2	5279.96	-40000	-7.58	25	Pass
0C 12V	a	5280	Ant2	5279.96	-40000	-7.58	25	Pass
10C 12V	a	5280	Ant2	5279.98	-20000	-3.79	25	Pass
20C 12V	a	5280	Ant2	5279.98	-20000	-3.79	25	Pass
30C 12V	a	5280	Ant2	5279.96	-40000	-7.58	25	Pass
40C 10.2V	a	5320	Ant2	5319.98	-20000	-3.76	25	Pass
40C 12V	a	5320	Ant2	5319.98	-20000	-3.76	25	Pass
40C 13.8V	a	5320	Ant2	5319.96	-40000	-7.52	25	Pass
-20C 12V	a	5320	Ant2	5319.96	-40000	-7.52	25	Pass
-10C 12V	a	5320	Ant2	5319.96	-40000	-7.52	25	Pass
0C 12V	a	5320	Ant2	5319.96	-40000	-7.52	25	Pass
10C 12V	a	5320	Ant2	5319.98	-20000	-3.76	25	Pass
20C 12V	a	5320	Ant2	5319.96	-40000	-7.52	25	Pass
30C 12V	a	5320	Ant2	5319.98	-20000	-3.76	25	Pass
40C 10.2V	a	5500	Ant2	5499.98	-20000	-3.64	25	Pass
40C 12V	a	5500	Ant2	5499.98	-20000	-3.64	25	Pass
40C 13.8V	a	5500	Ant2	5499.98	-20000	-3.64	25	Pass
-20C 12V	a	5500	Ant2	5499.96	-40000	-7.27	25	Pass
-10C 12V	a	5500	Ant2	5499.96	-40000	-7.27	25	Pass
0C 12V	a	5500	Ant2	5499.98	-20000	-3.64	25	Pass
10C 12V	a	5500	Ant2	5499.98	-20000	-3.64	25	Pass
20C 12V	a	5500	Ant2	5499.96	-40000	-7.27	25	Pass
30C 12V	a	5500	Ant2	5499.96	-40000	-7.27	25	Pass
40C 10.2V	a	5600	Ant2	5599.96	-40000	-7.14	25	Pass