






PSD NVNT n20 5700MHz Ant1

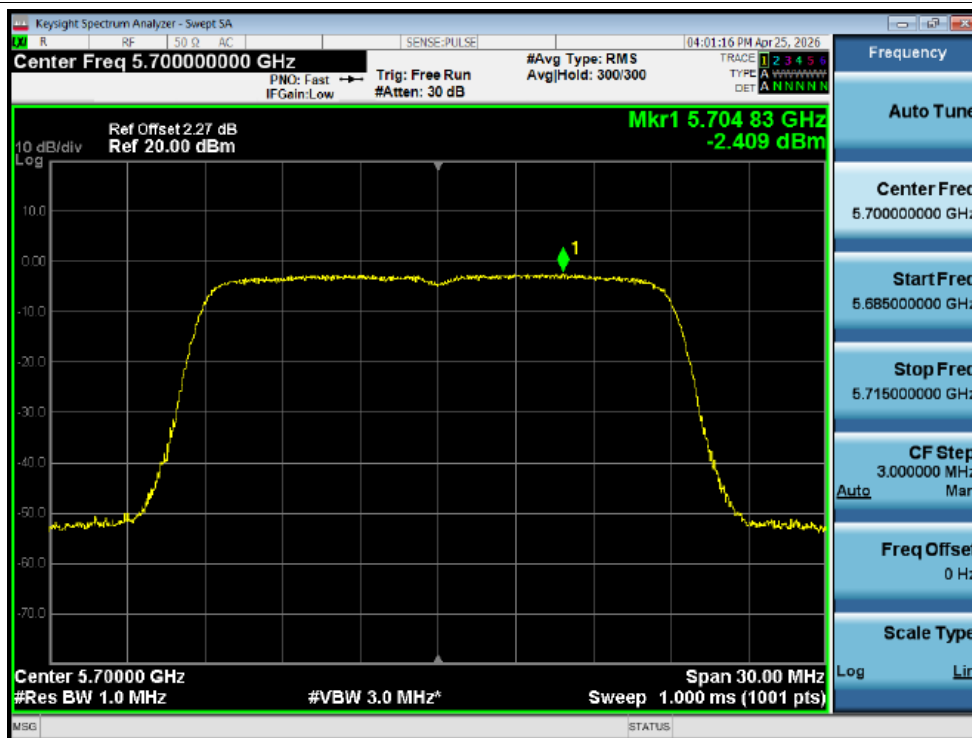


PSD NVNT n20 5700MHz Ant2

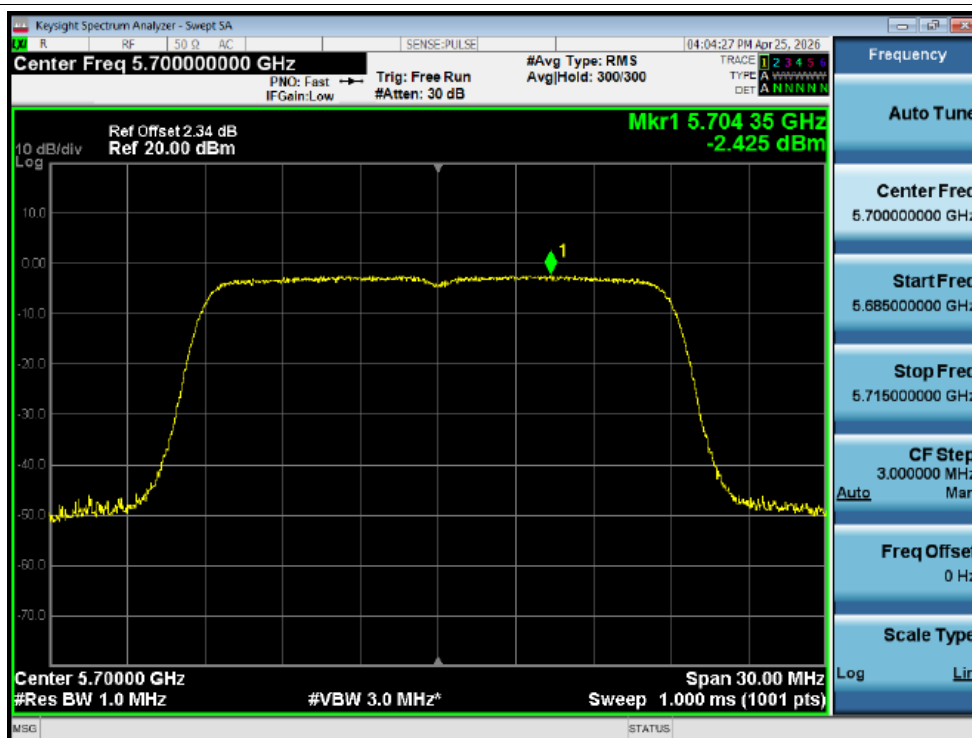


PSD NVNT n20 5745MHz Ant1

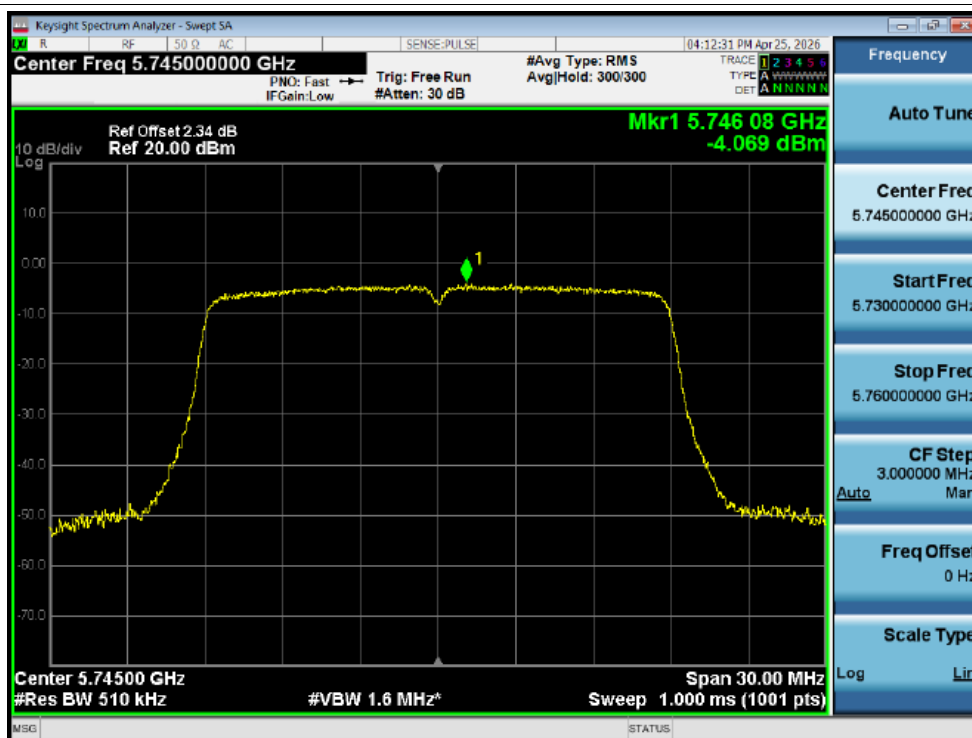

PSD NVNT n20 5745MHz Ant2

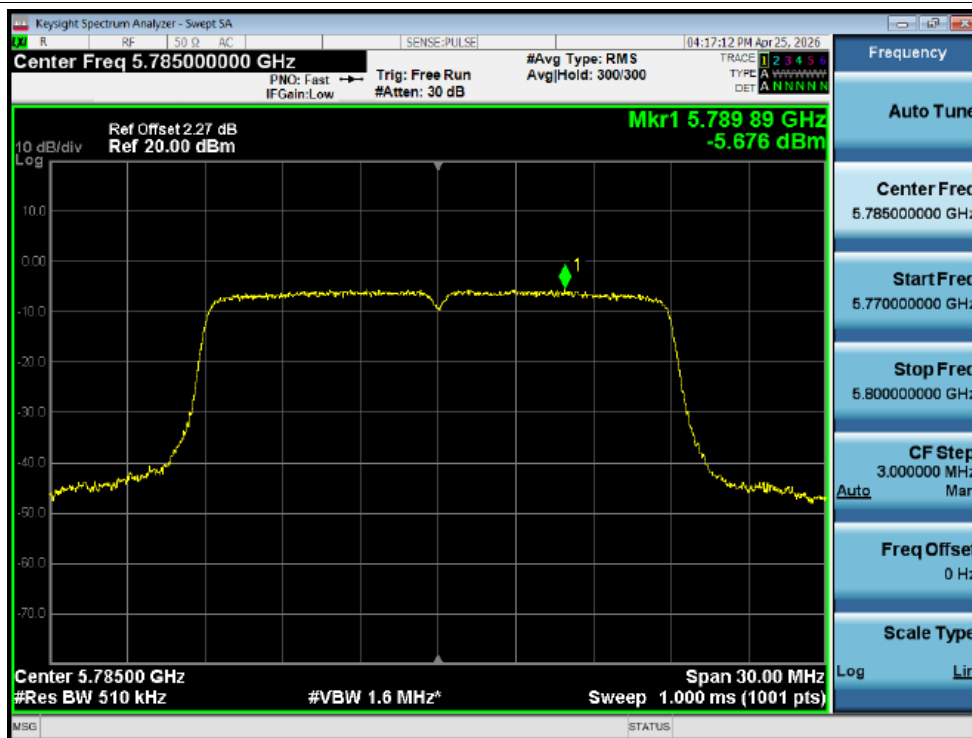


PSD NVNT n20 5785MHz Ant1

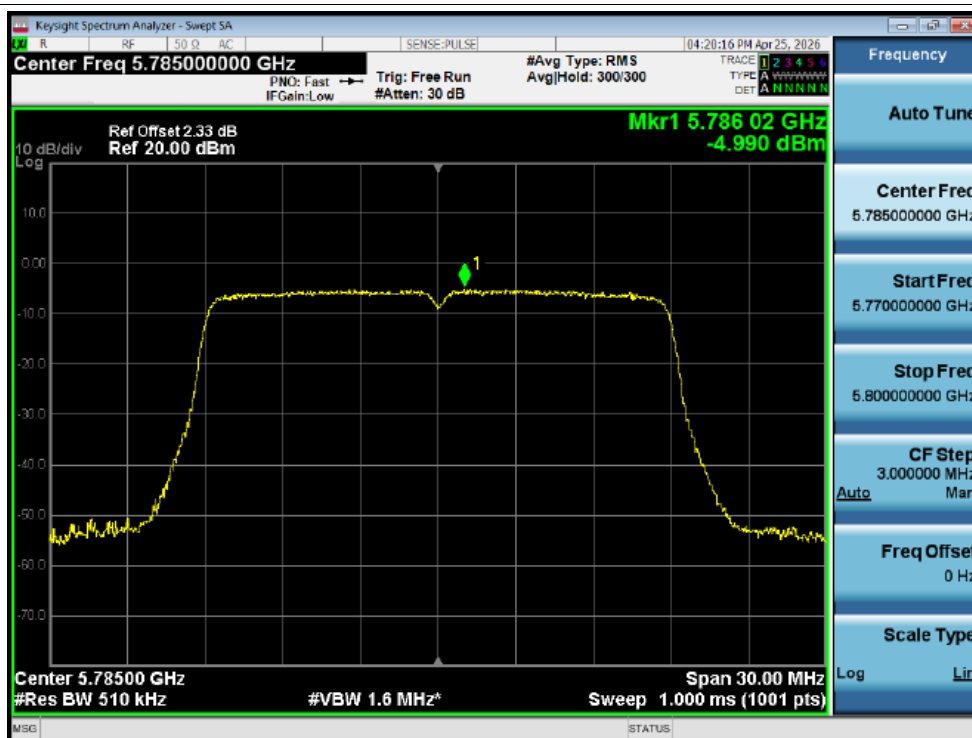


PSD NVNT n20 5785MHz Ant2




PSD NVNT n20 5825MHz Ant1

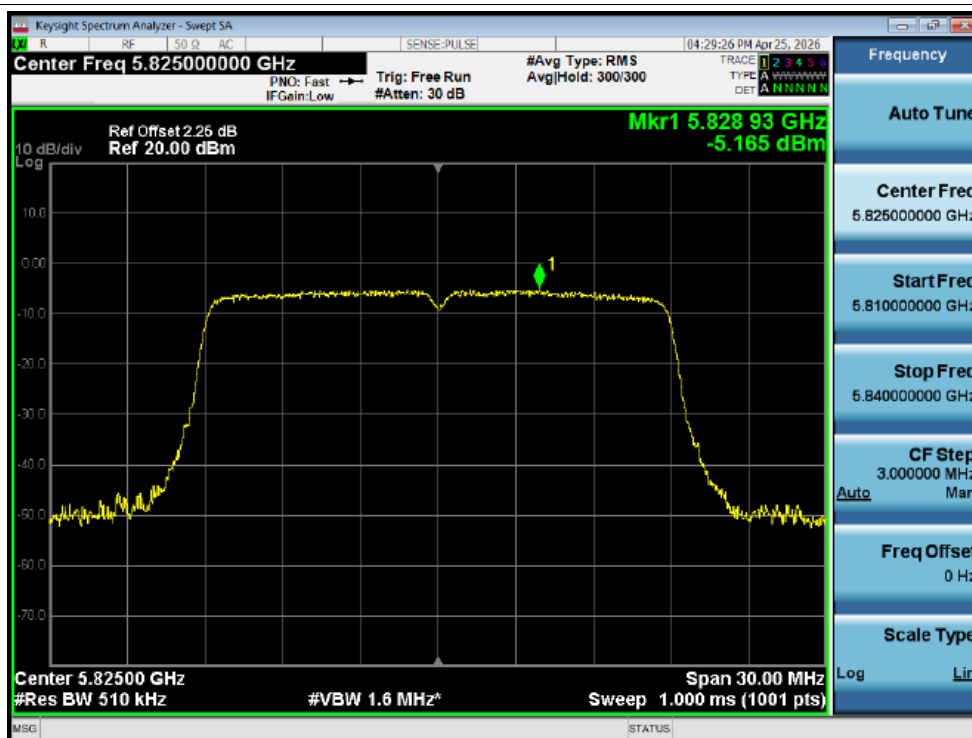

PSD NVNT n20 5825MHz Ant2

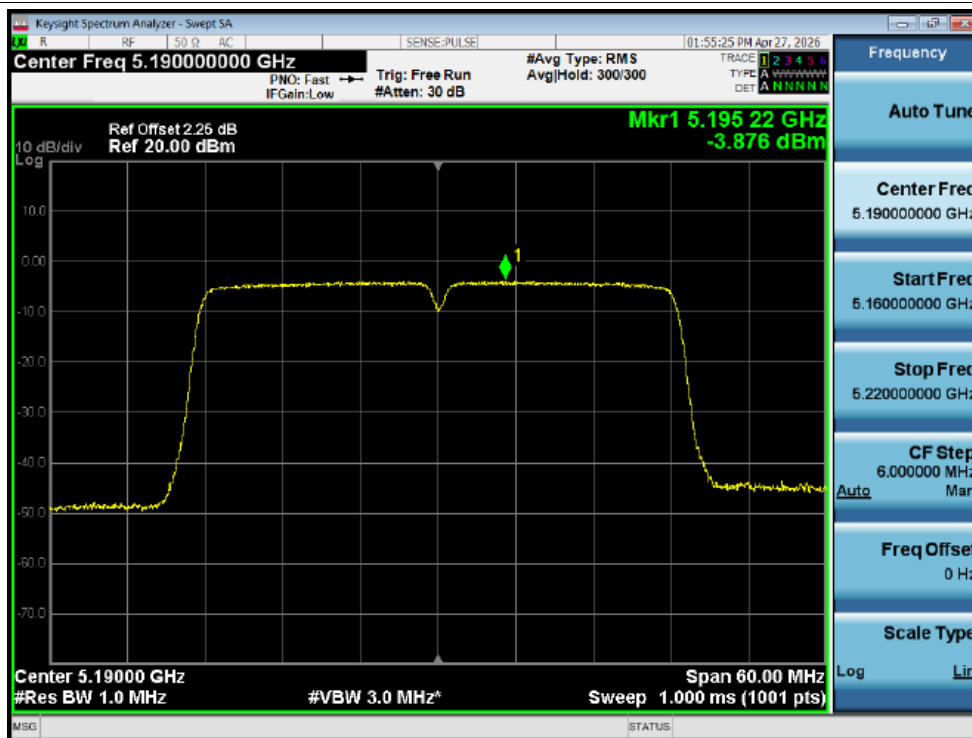


PSD NVNT n40 5190MHz Ant1

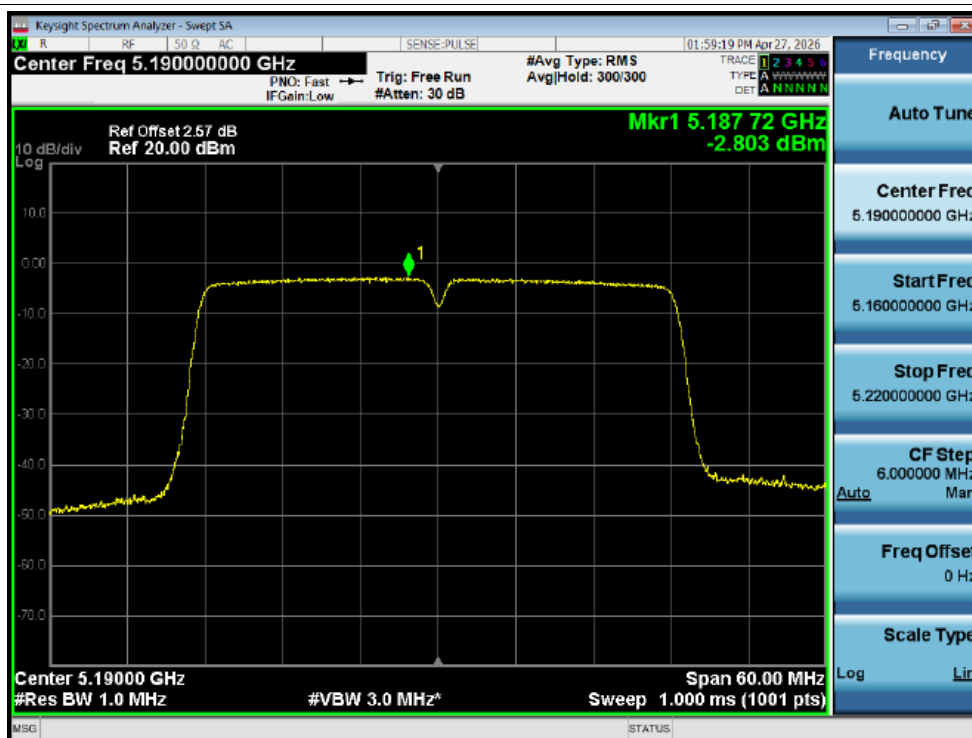


PSD NVNT n40 5190MHz Ant2




PSD NVNT n40 5230MHz Ant1

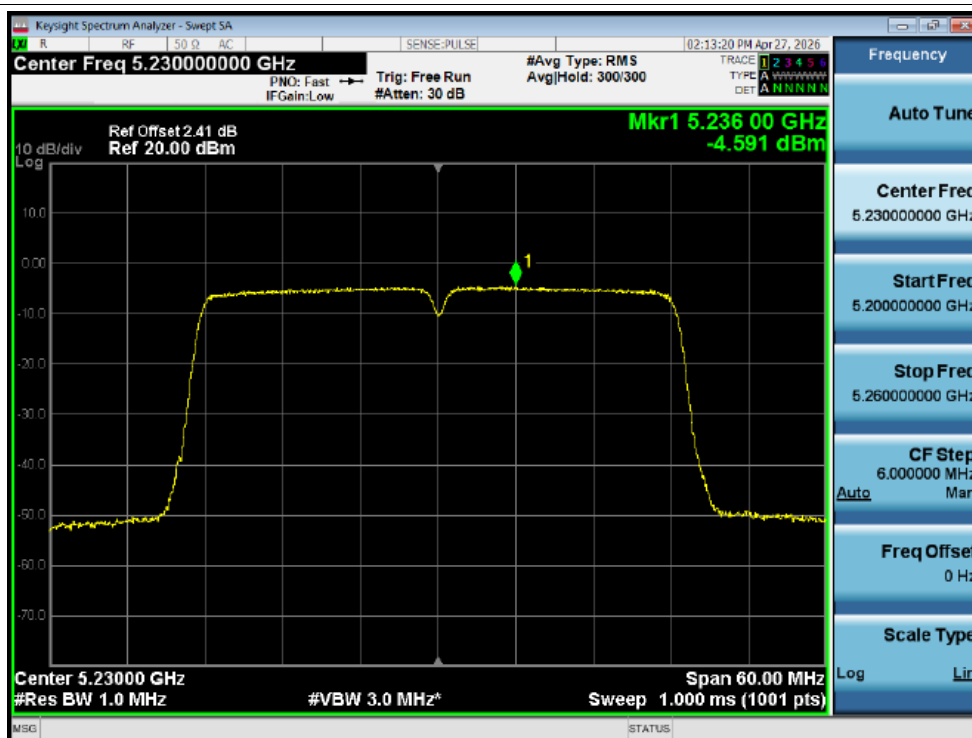

PSD NVNT n40 5230MHz Ant2

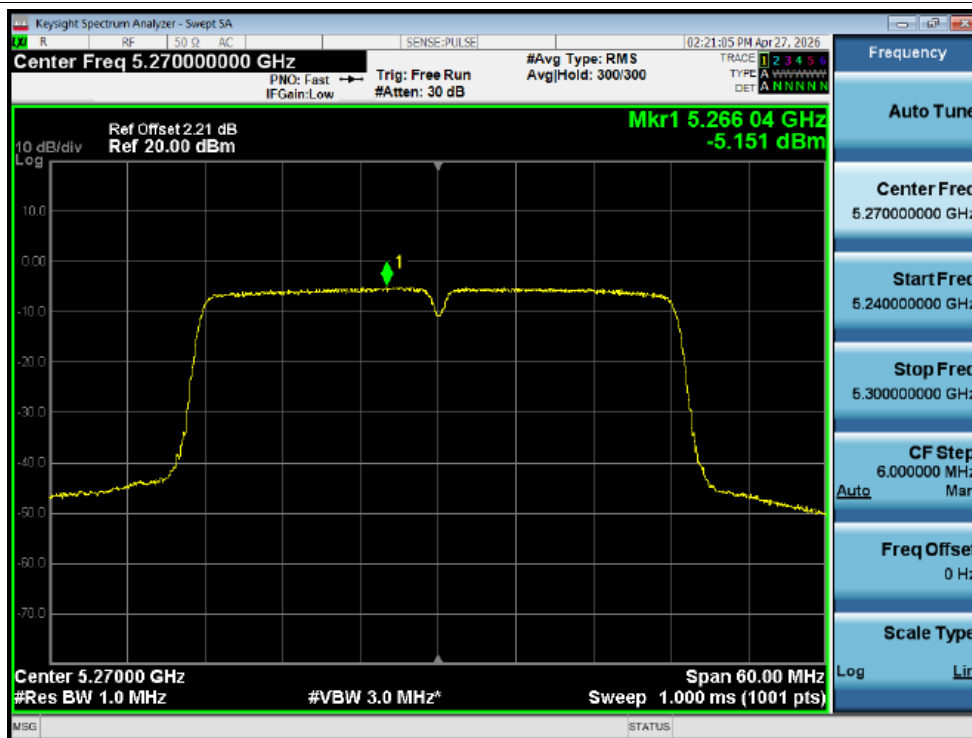


PSD NVNT n40 5270MHz Ant1

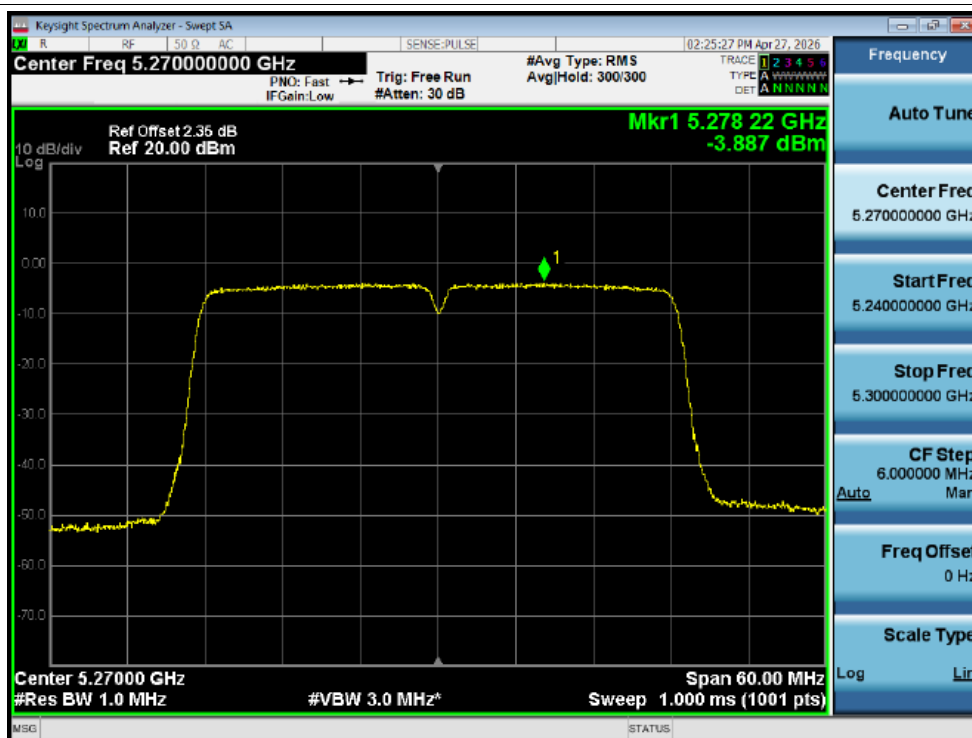

PSD NVNT n40 5270MHz Ant2



PSD NVNT n40 5310MHz Ant1

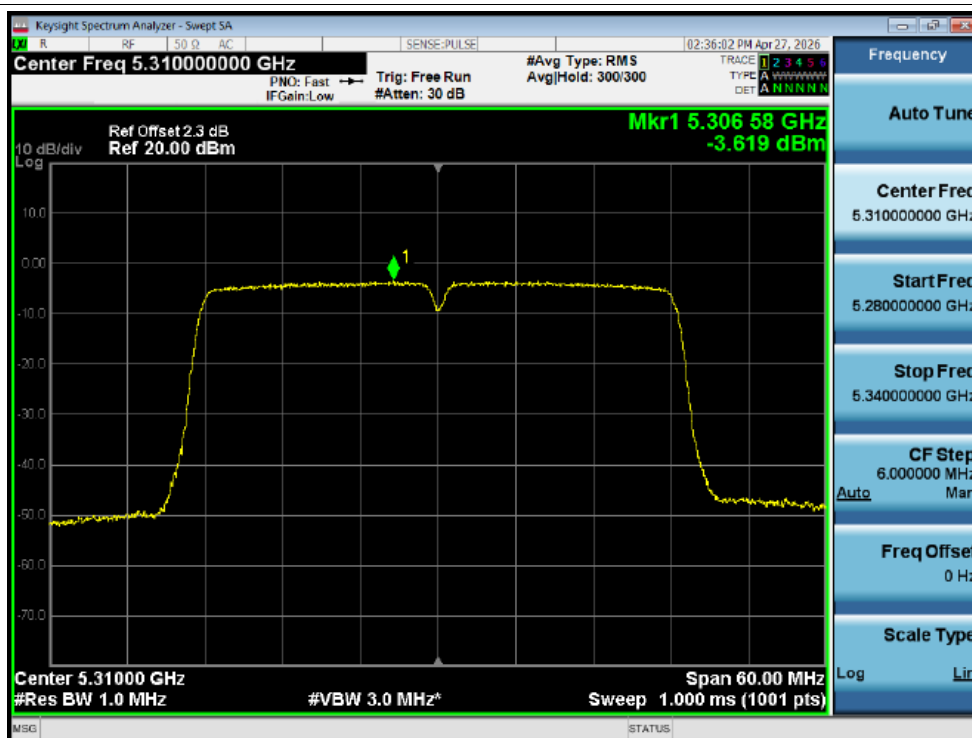

PSD NVNT n40 5310MHz Ant2




PSD NVNT n40 5510MHz Ant1



PSD NVNT n40 5510MHz Ant2




PSD NVNT n40 5590MHz Ant1

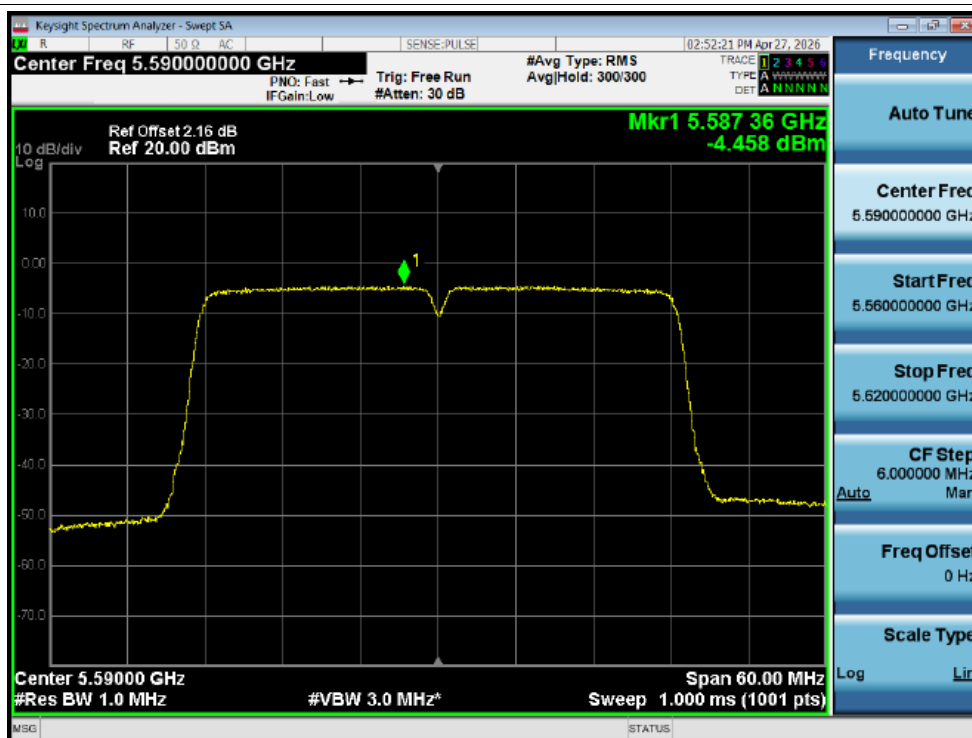

PSD NVNT n40 5590MHz Ant2




PSD NVNT n40 5670MHz Ant1

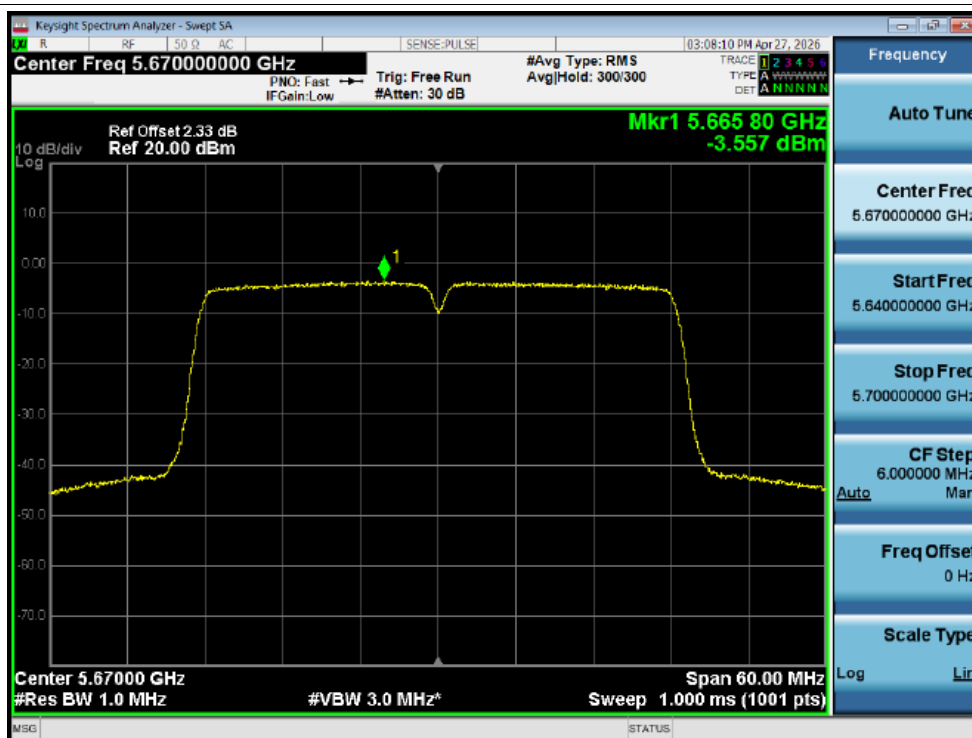

PSD NVNT n40 5670MHz Ant2




PSD NVNT n40 5755MHz Ant1

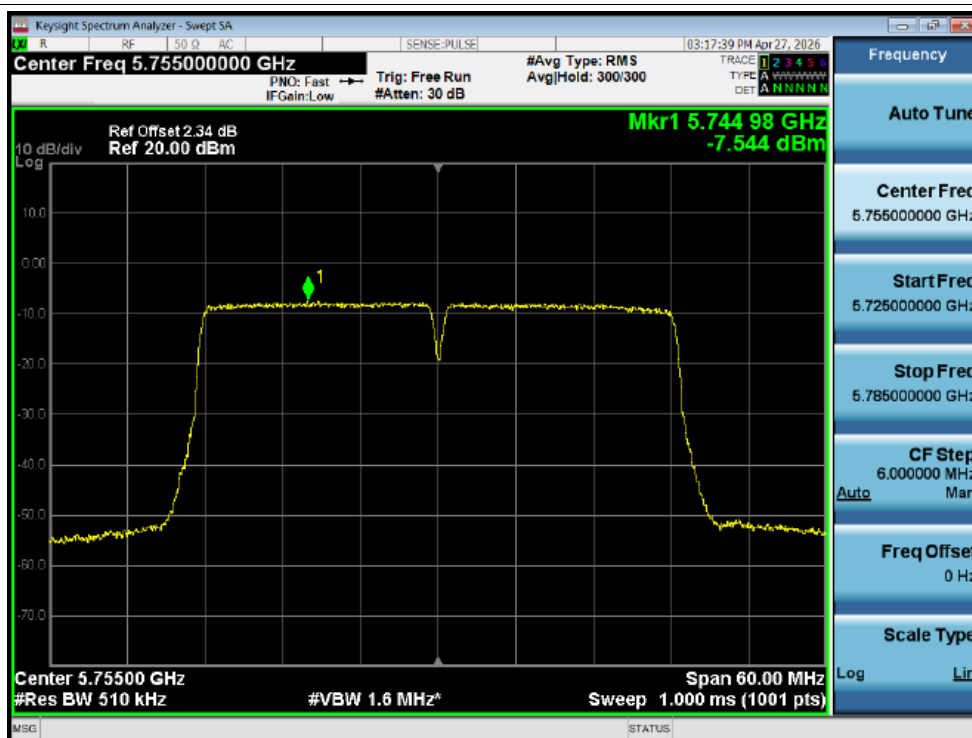

PSD NVNT n40 5755MHz Ant2



PSD NVNT n40 5795MHz Ant1

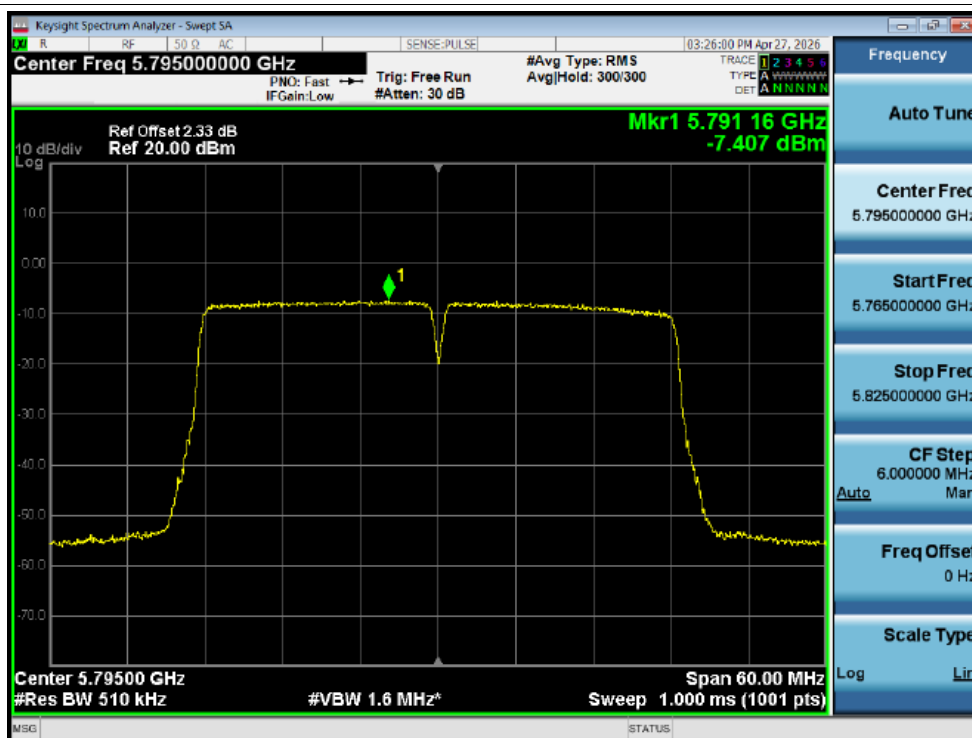


PSD NVNT n40 5795MHz Ant2




PSD NVNT ac20 5180MHz Ant1




PSD NVNT ac20 5180MHz Ant2

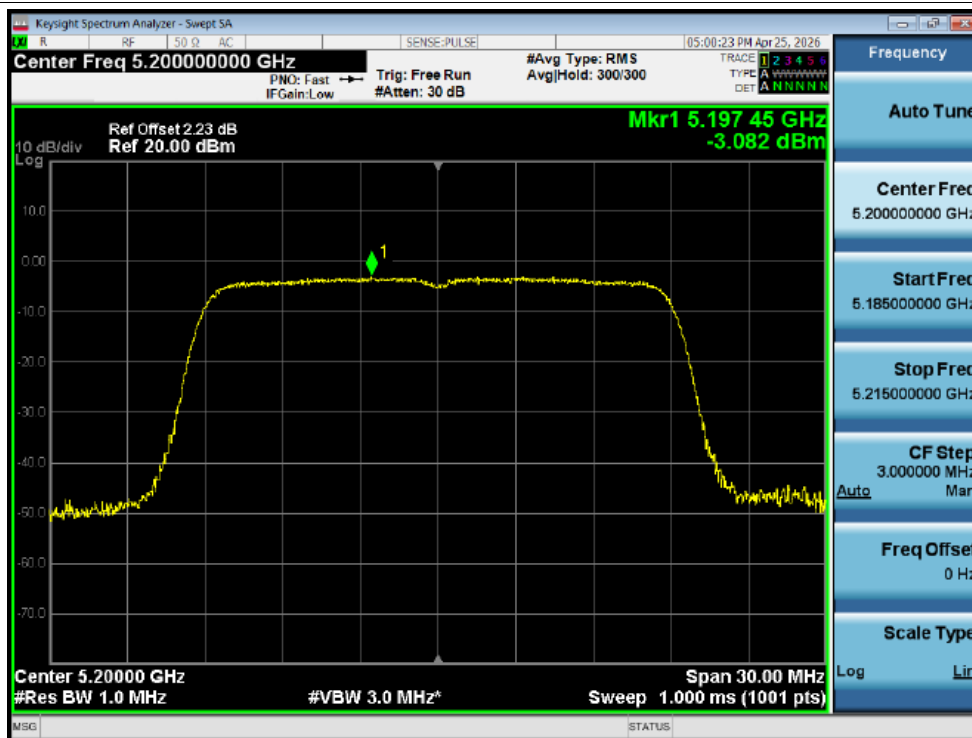


PSD NVNT ac20 5200MHz Ant1

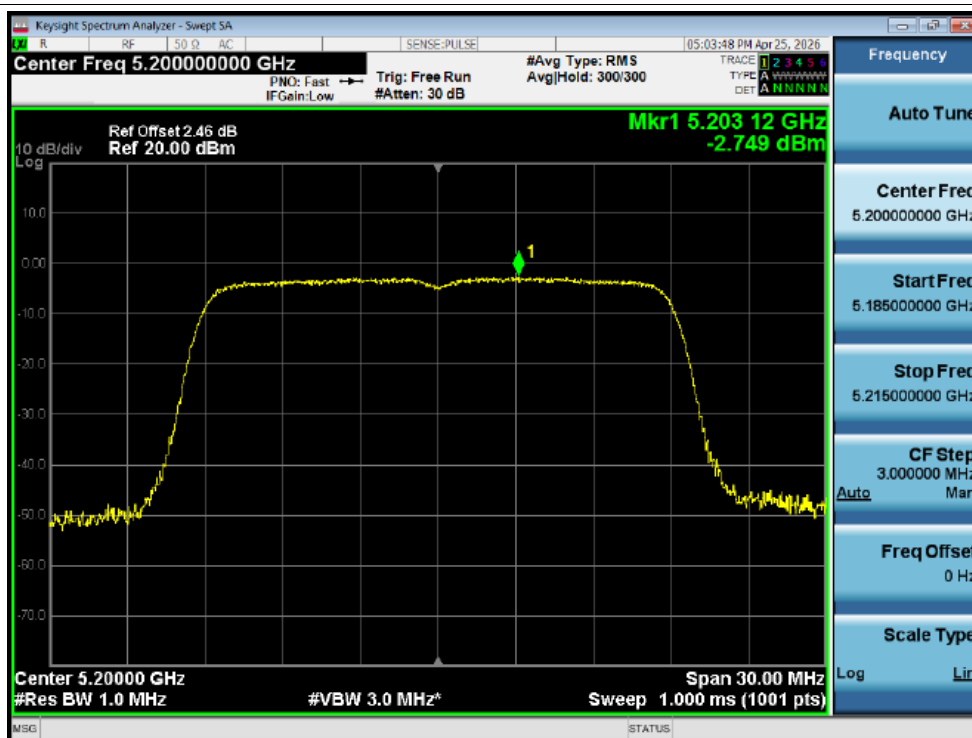


PSD NVNT ac20 5200MHz Ant2

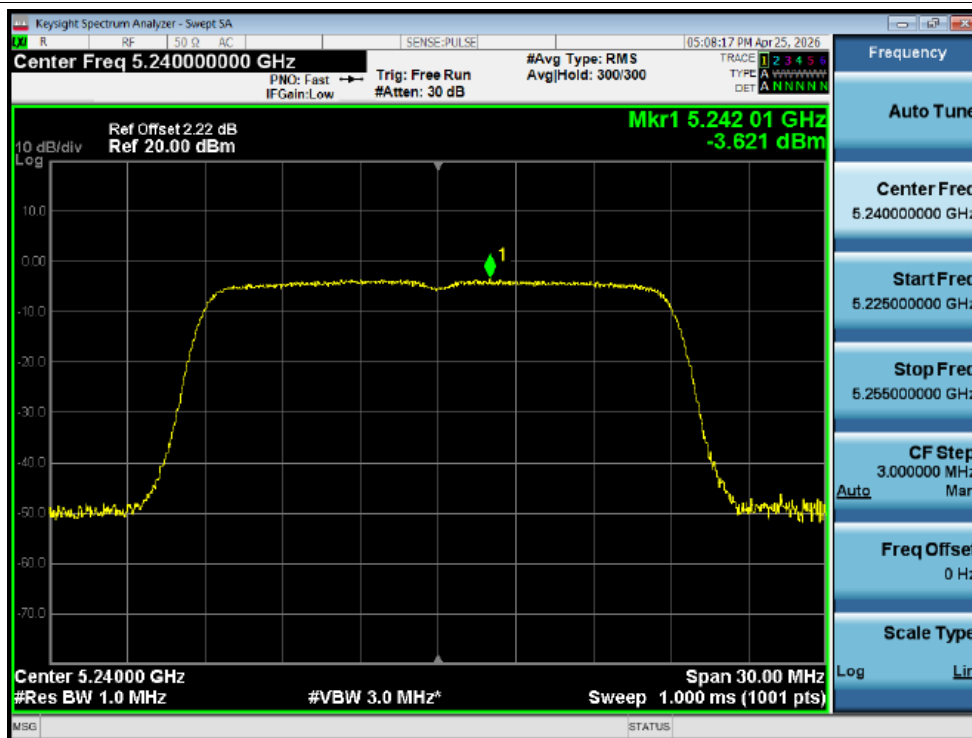


PSD NVNT ac20 5240MHz Ant1

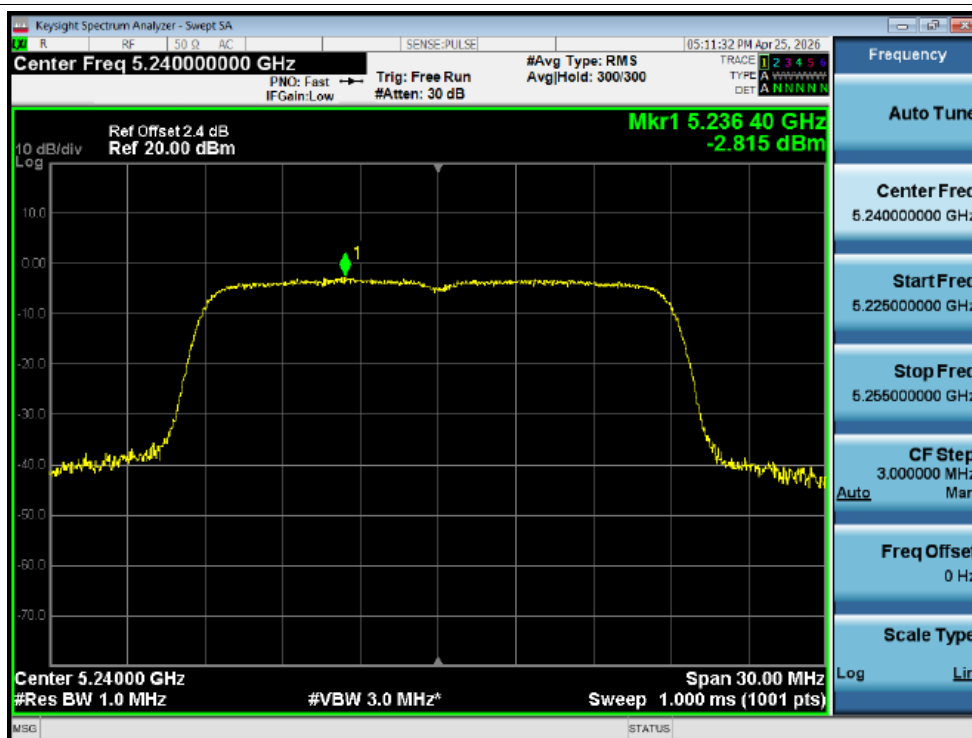


PSD NVNT ac20 5240MHz Ant2

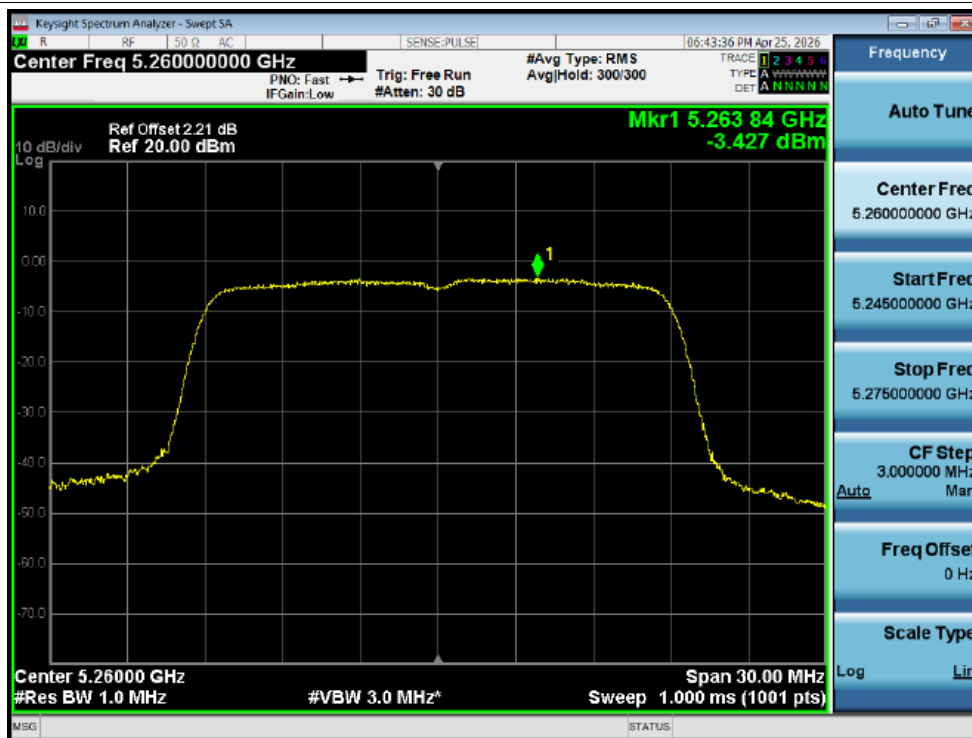


PSD NVNT ac20 5260MHz Ant1

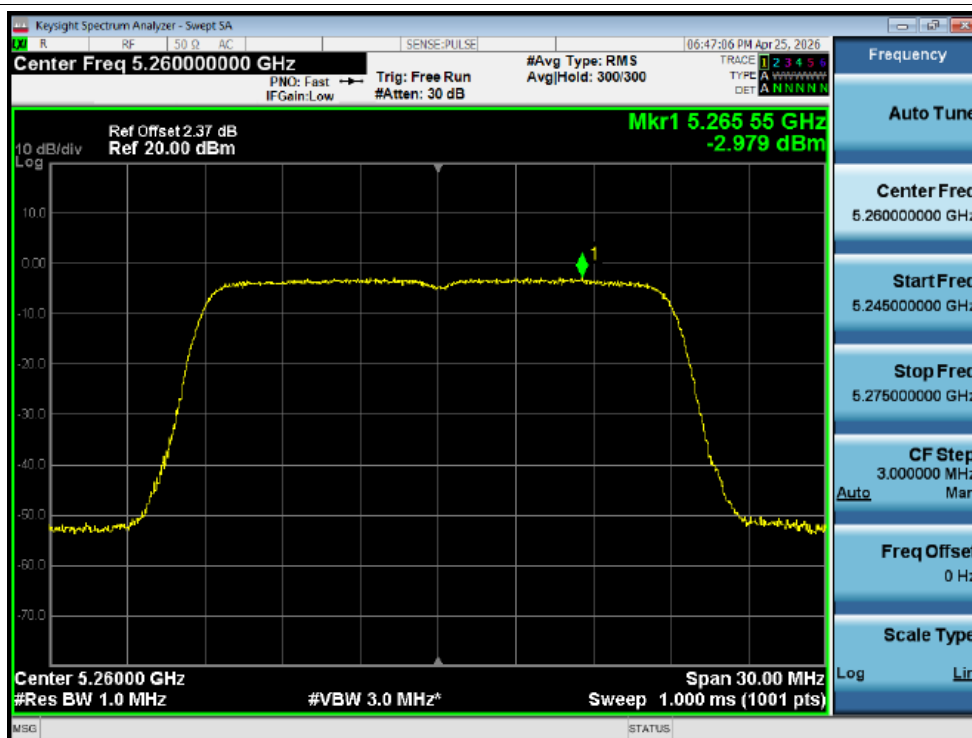

PSD NVNT ac20 5260MHz Ant2

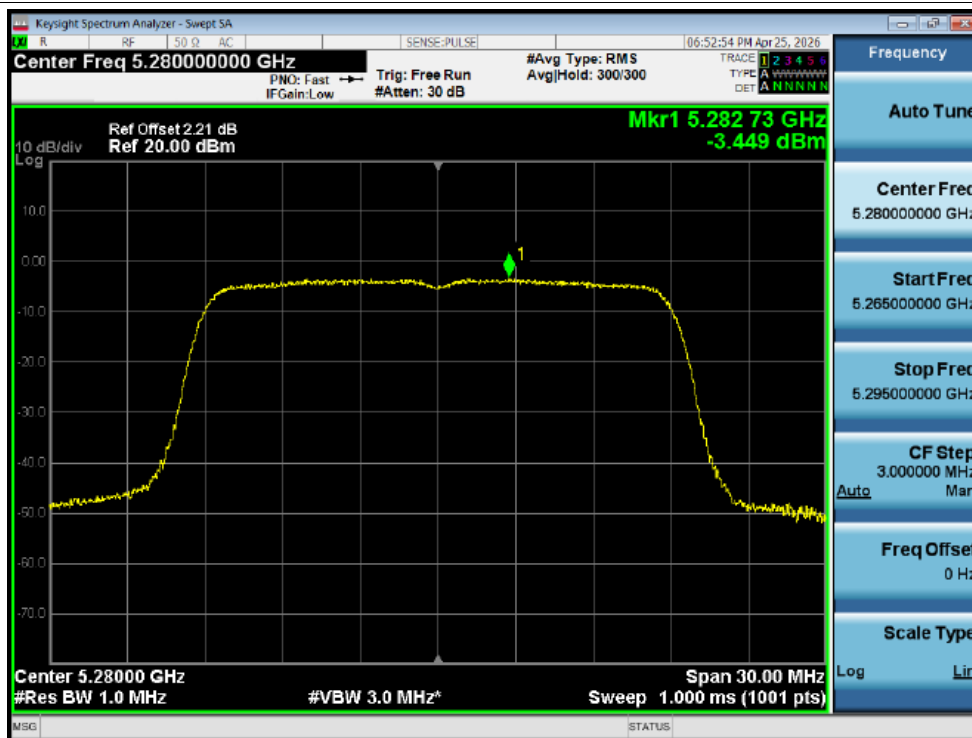


PSD NVNT ac20 5280MHz Ant1

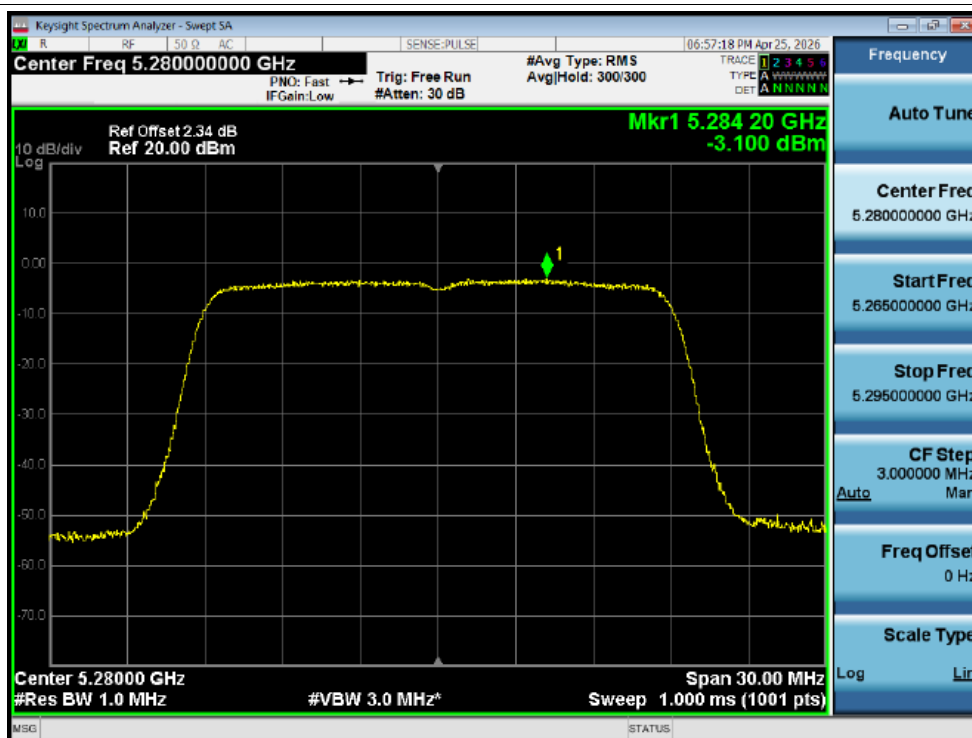


PSD NVNT ac20 5280MHz Ant2




PSD NVNT ac20 5320MHz Ant1

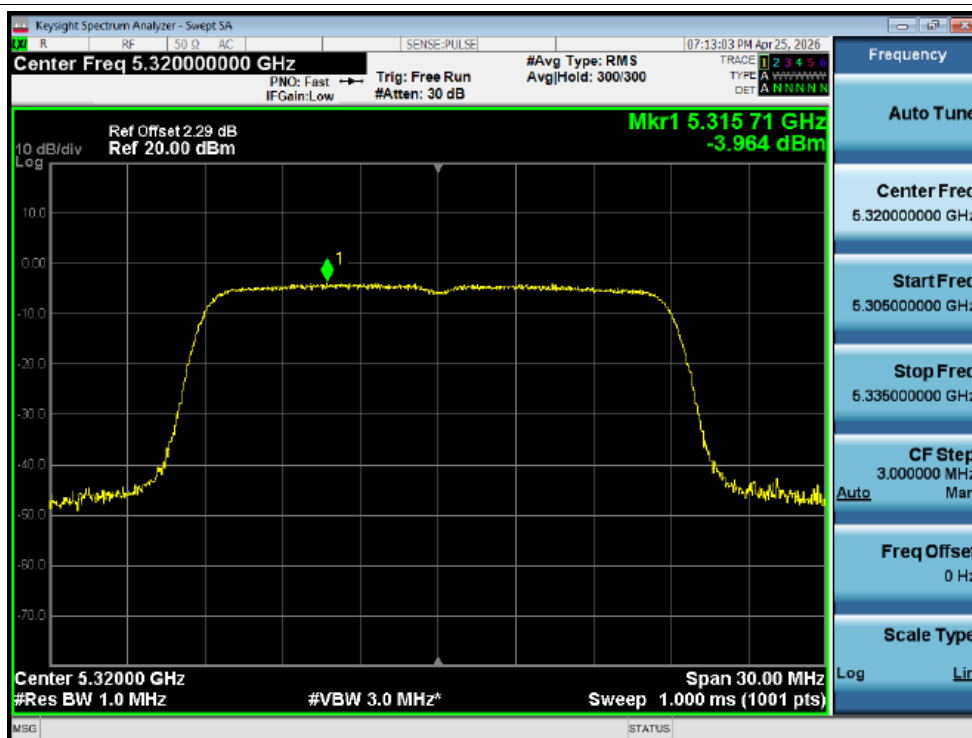


PSD NVNT ac20 5320MHz Ant2

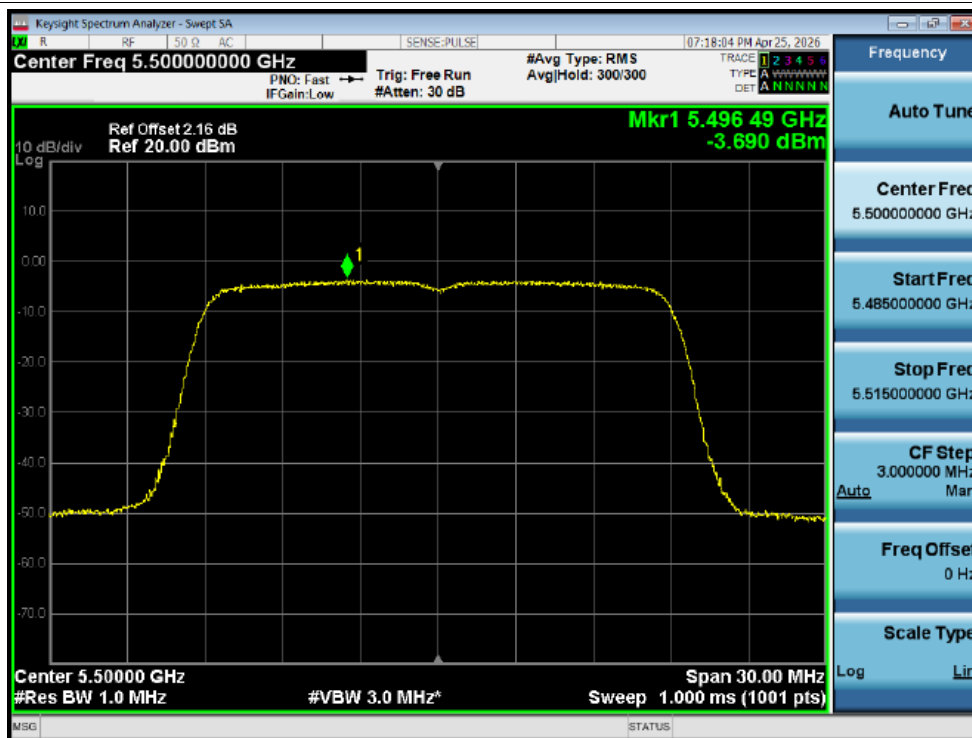


PSD NVNT ac20 5500MHz Ant1

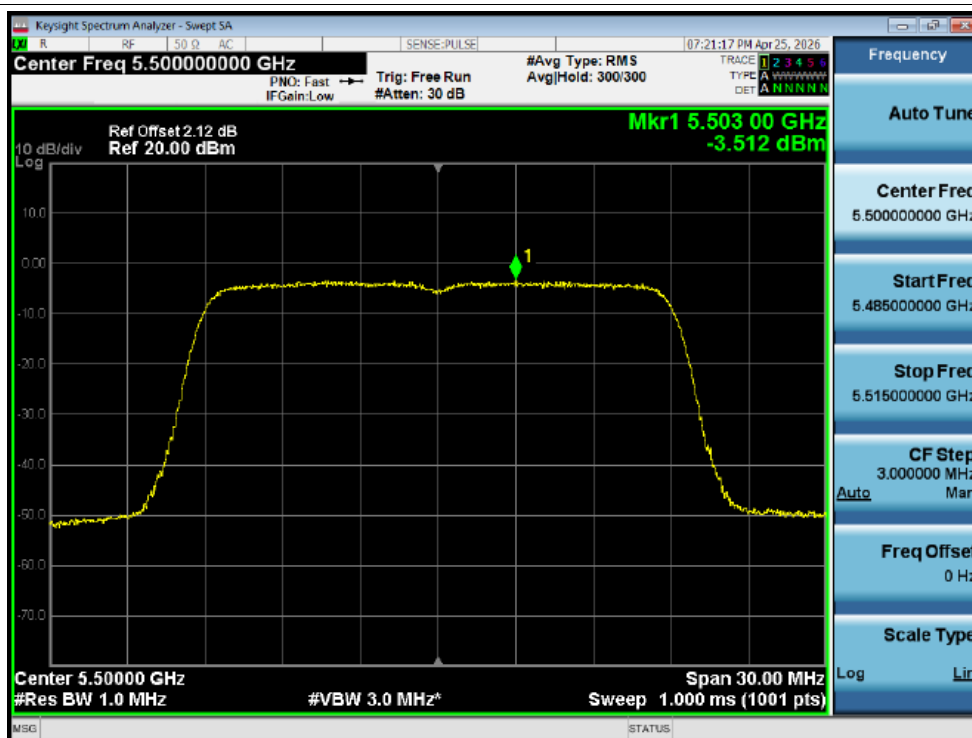

PSD NVNT ac20 5500MHz Ant2

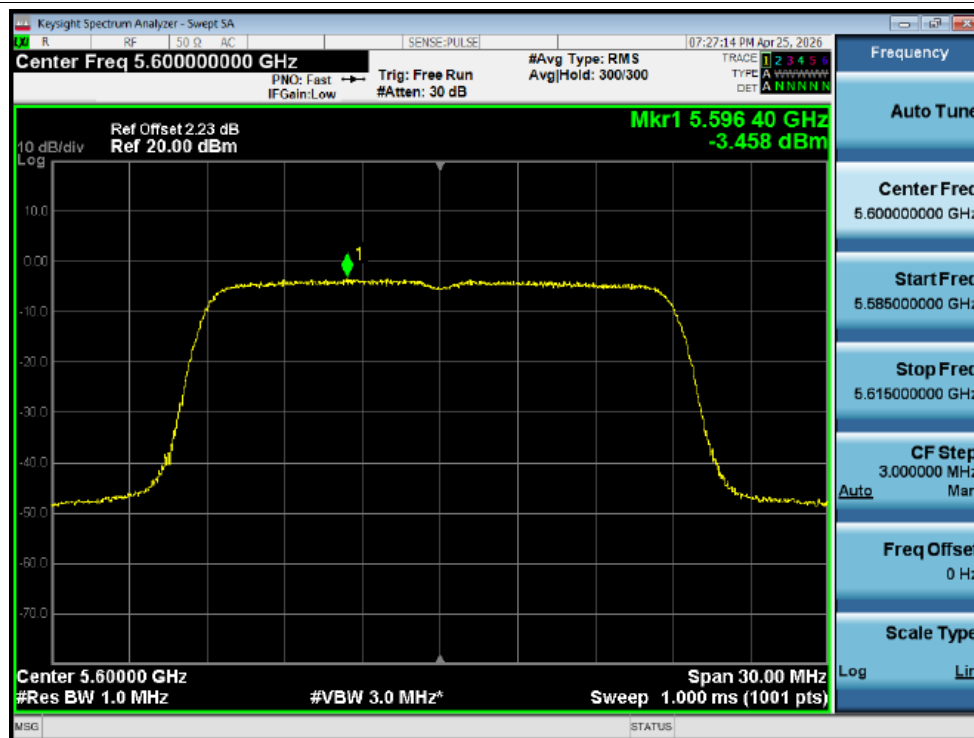


PSD NVNT ac20 5600MHz Ant1

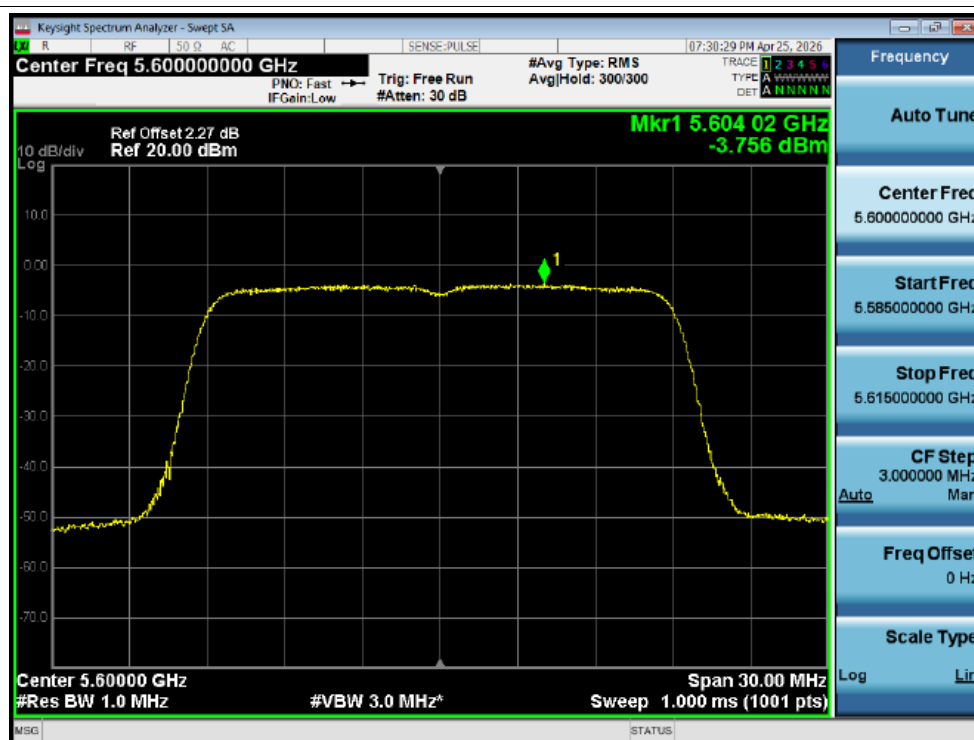

PSD NVNT ac20 5600MHz Ant2




PSD NVNT ac20 5700MHz Ant1

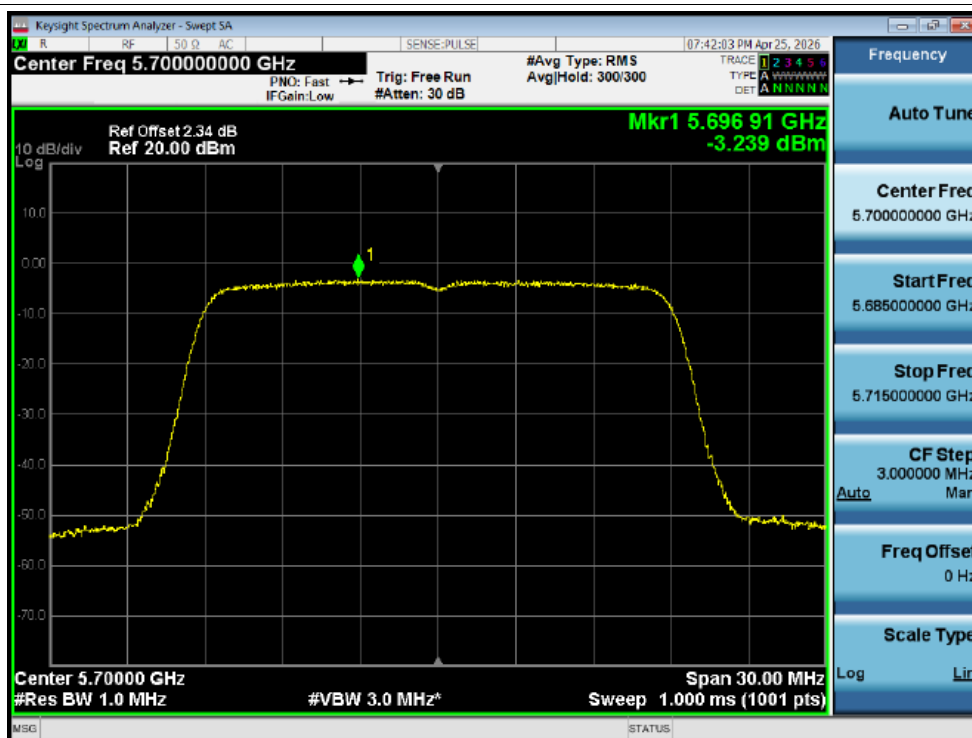

PSD NVNT ac20 5700MHz Ant2



PSD NVNT ac20 5745MHz Ant1

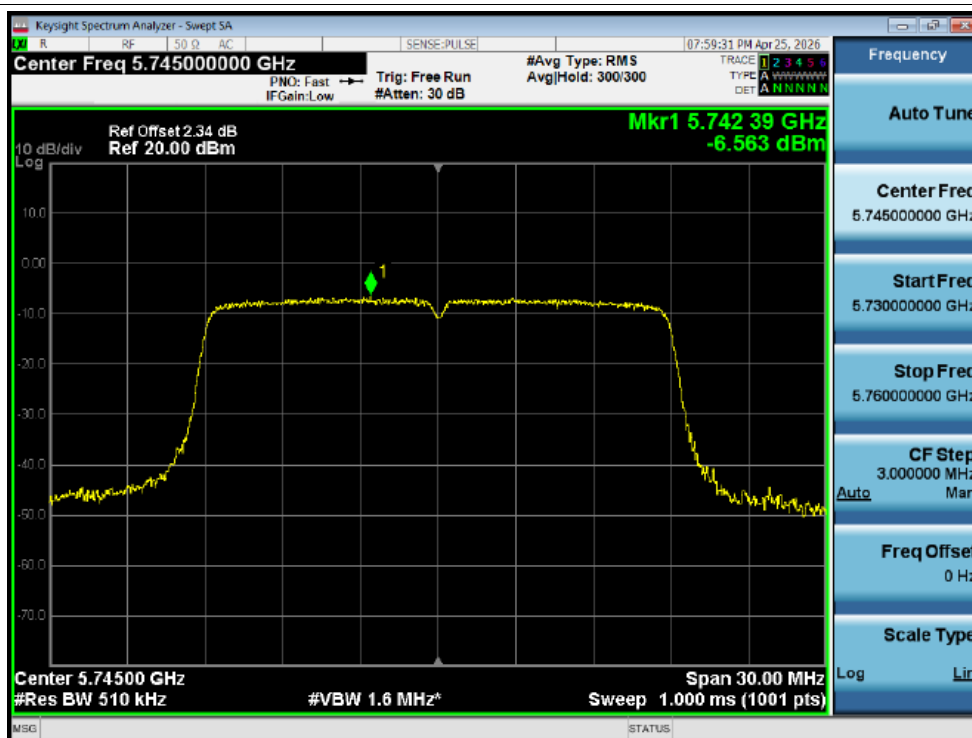

PSD NVNT ac20 5745MHz Ant2



PSD NVNT ac20 5785MHz Ant1



PSD NVNT ac20 5785MHz Ant2



PSD NVNT ac20 5825MHz Ant1



PSD NVNT ac20 5825MHz Ant2



PSD NVNT ac40 5190MHz Ant1



PSD NVNT ac40 5190MHz Ant2




PSD NVNT ac40 5230MHz Ant1




PSD NVNT ac40 5230MHz Ant2




PSD NVNT ac40 5270MHz Ant1

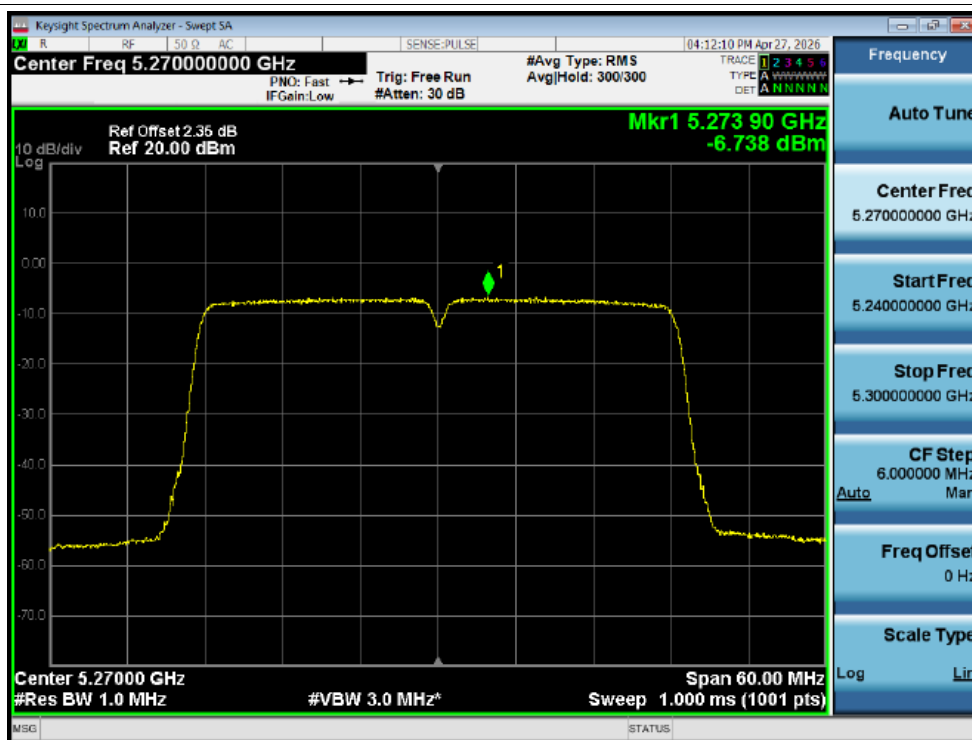

PSD NVNT ac40 5270MHz Ant2

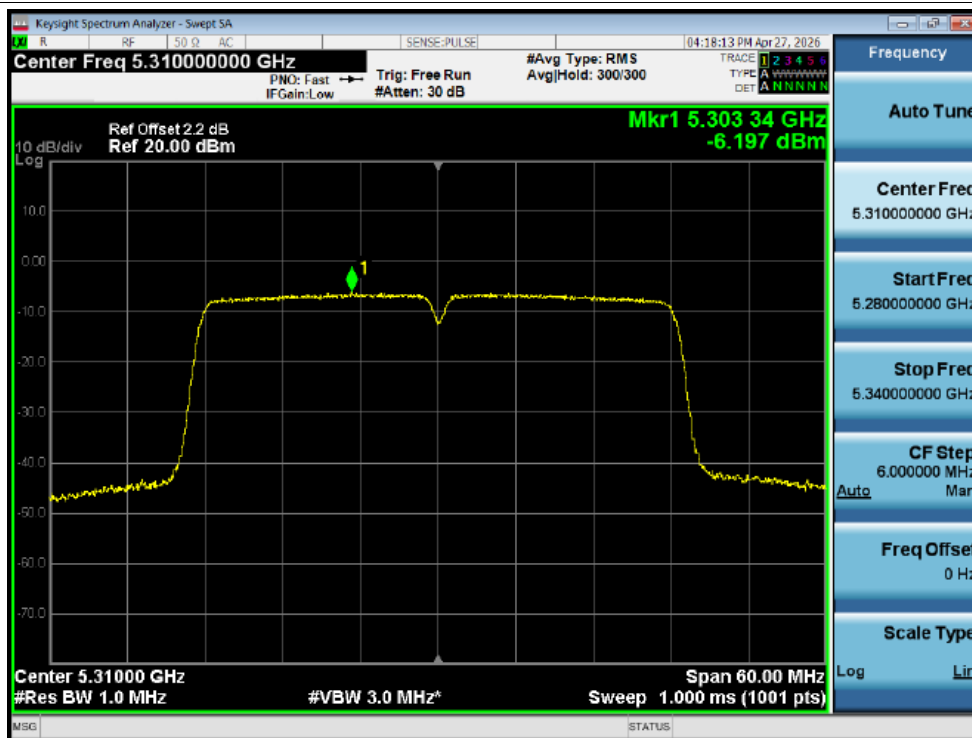

PSD NVNT ac40 5310MHz Ant1

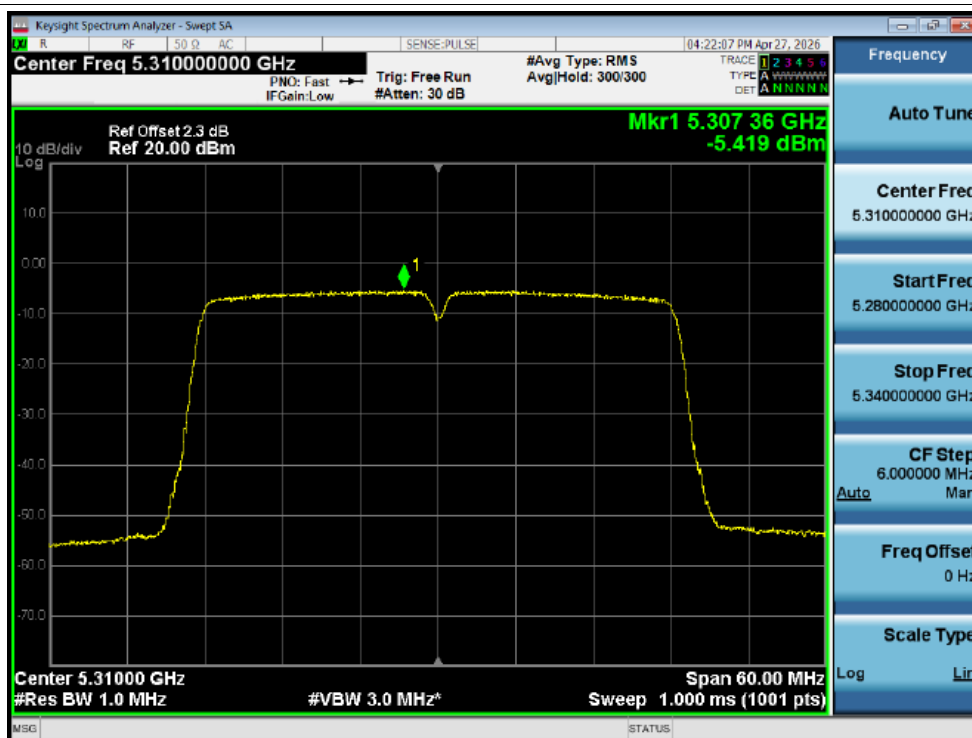

PSD NVNT ac40 5310MHz Ant2




PSD NVNT ac40 5510MHz Ant1




PSD NVNT ac40 5510MHz Ant2




PSD NVNT ac40 5590MHz Ant1

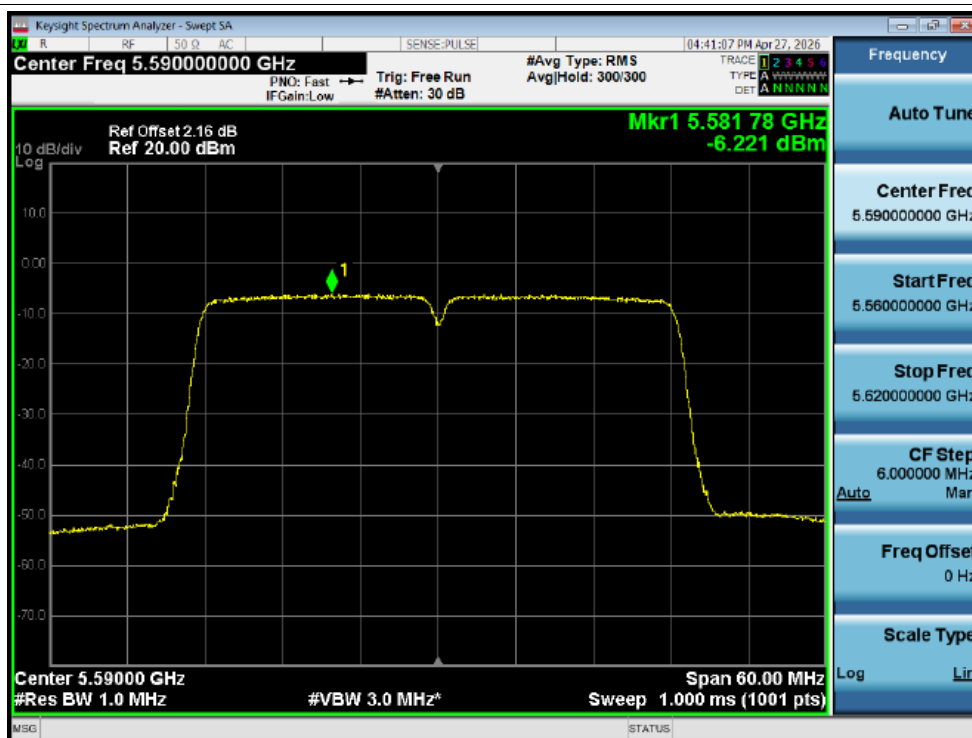

PSD NVNT ac40 5590MHz Ant2

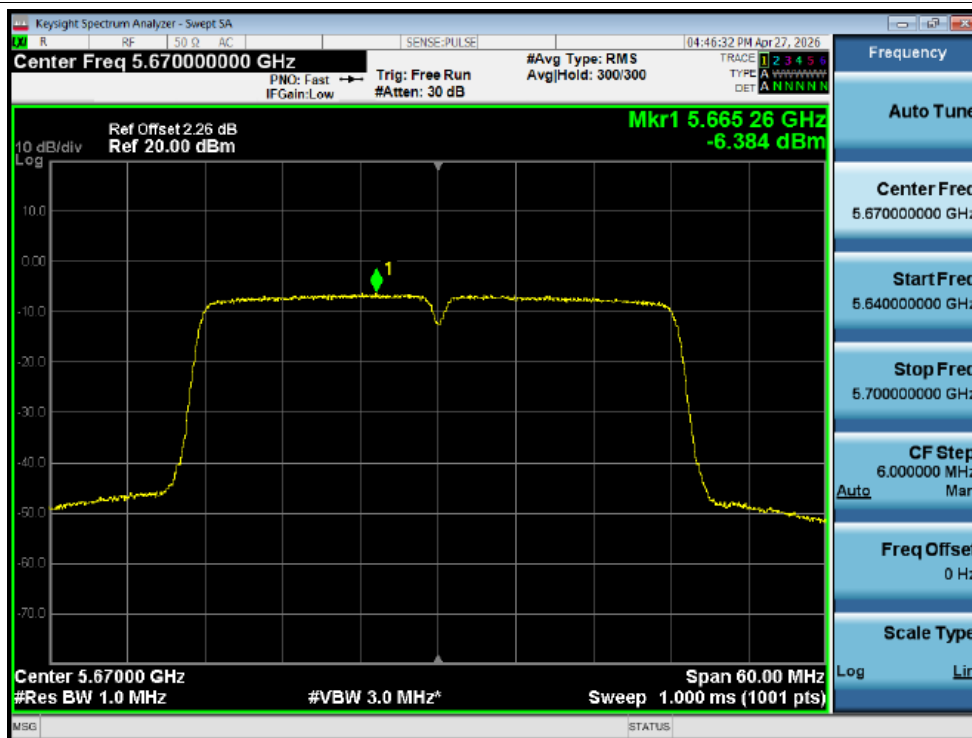

PSD NVNT ac40 5670MHz Ant1

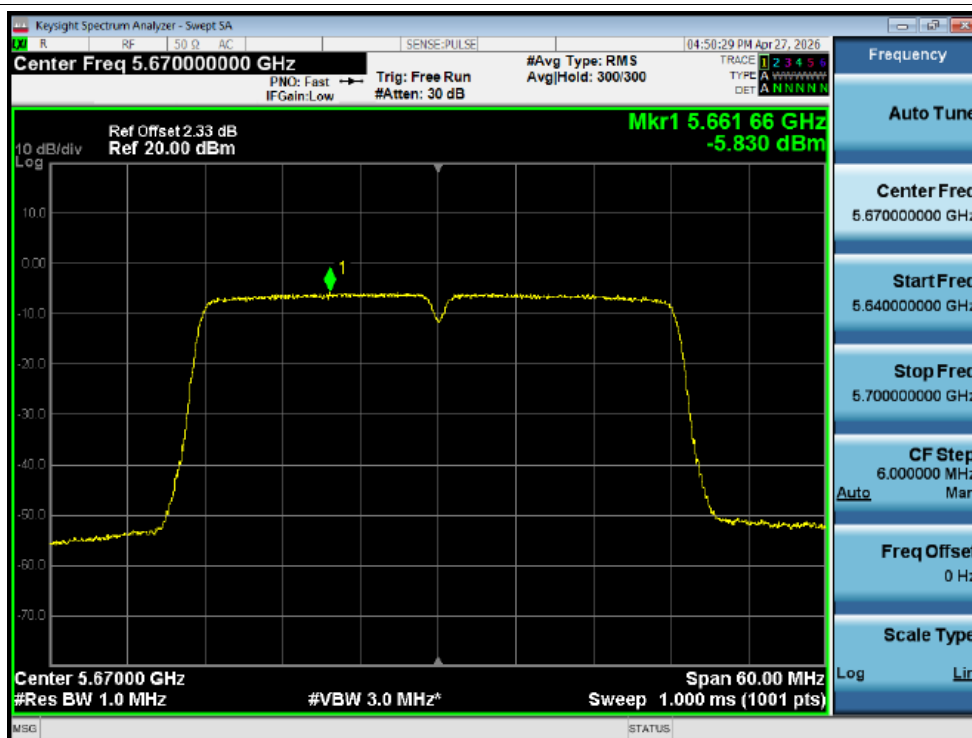

PSD NVNT ac40 5670MHz Ant2




PSD NVNT ac40 5755MHz Ant1



PSD NVNT ac40 5755MHz Ant2




PSD NVNT ac40 5795MHz Ant1

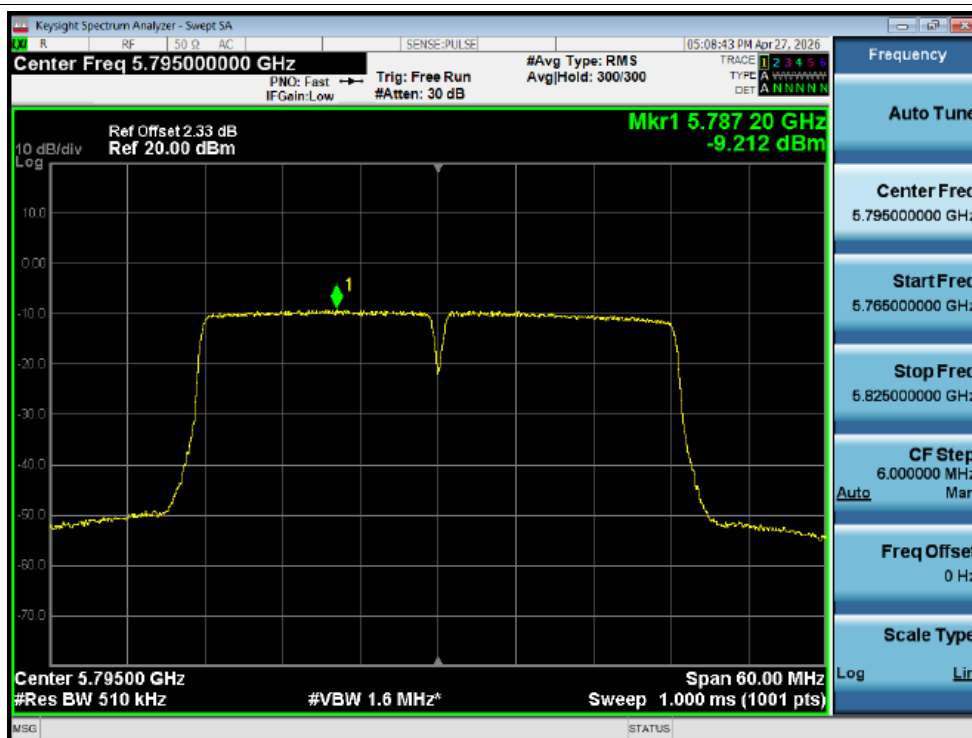

PSD NVNT ac40 5795MHz Ant2



PSD NVNT ac80 5210MHz Ant1

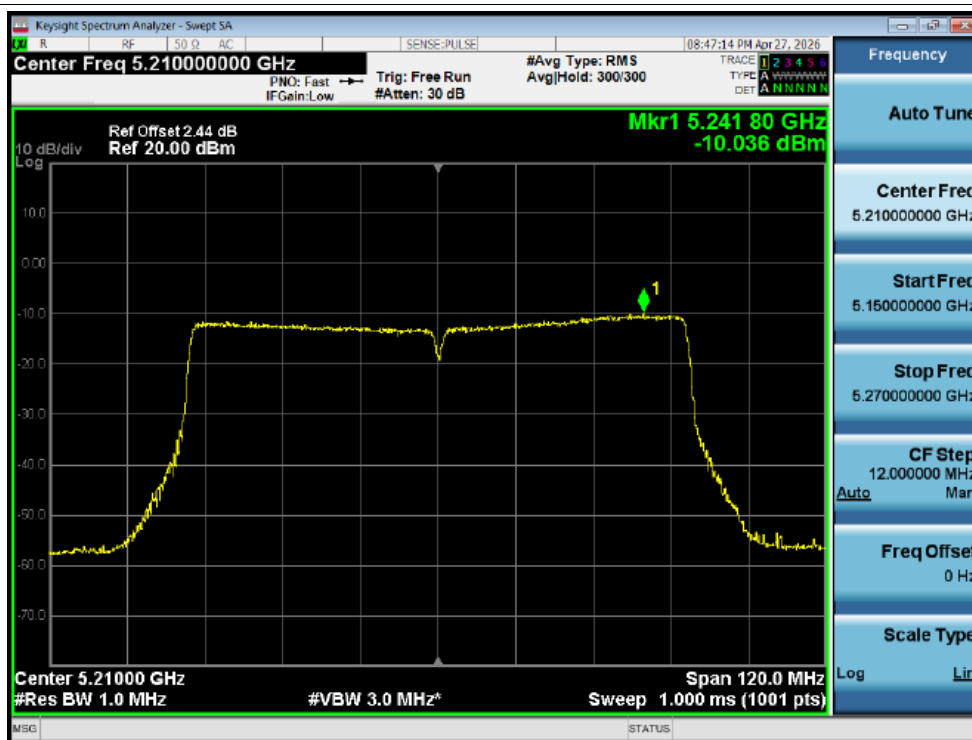

PSD NVNT ac80 5210MHz Ant2



PSD NVNT ac80 5290MHz Ant1



PSD NVNT ac80 5290MHz Ant2



PSD NVNT ac80 5530MHz Ant1



PSD NVNT ac80 5530MHz Ant2




PSD NVNT ac80 5610MHz Ant1



PSD NVNT ac80 5610MHz Ant2




PSD NVNT ac80 5775MHz Ant1

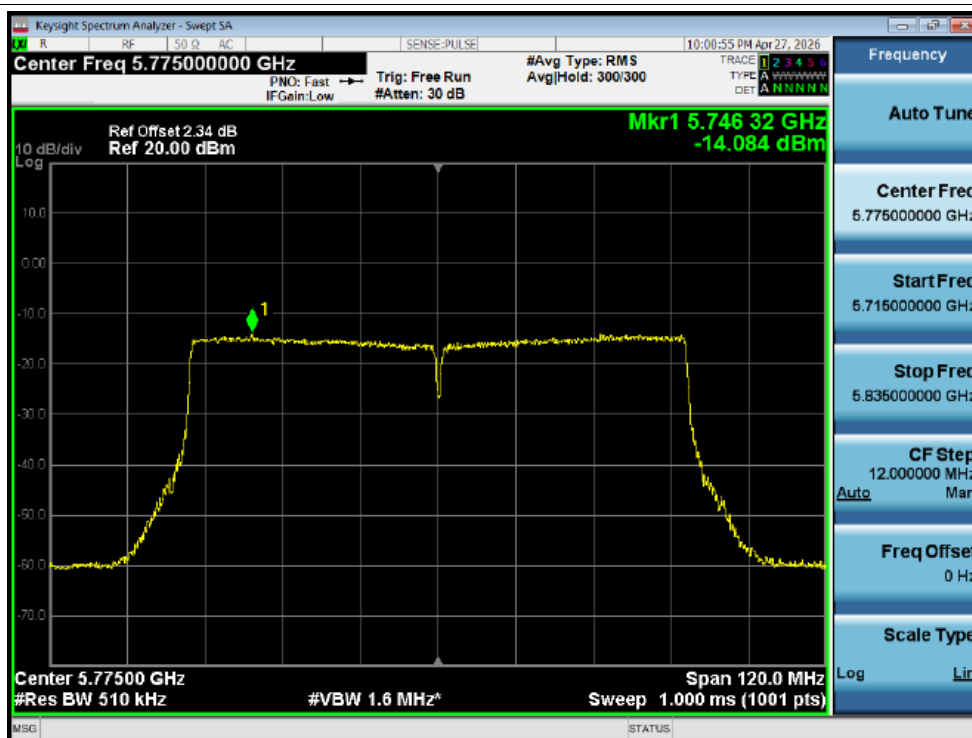


PSD NVNT ac80 5775MHz Ant2




PSD NVNT ax20 5180MHz Ant1

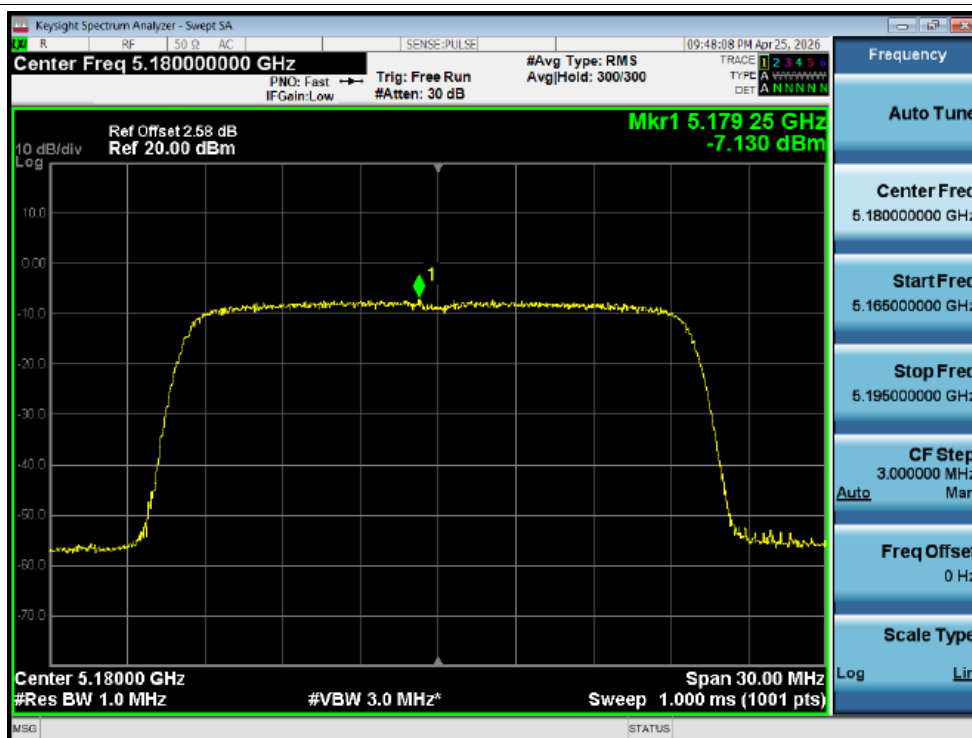


PSD NVNT ax20 5180MHz Ant2

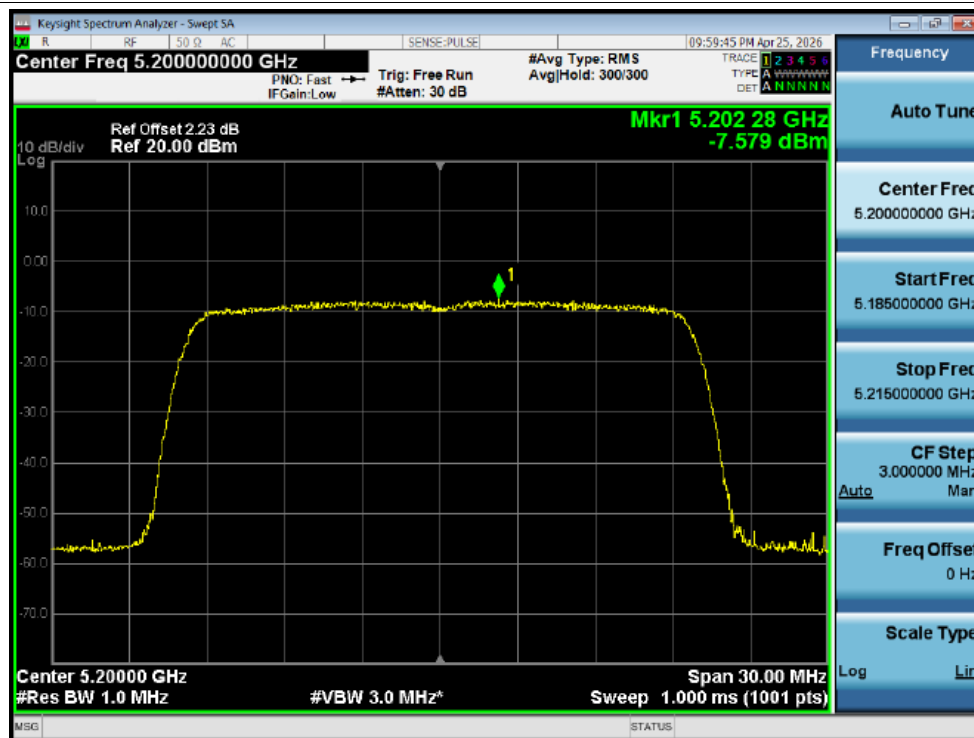

PSD NVNT ax20 5200MHz Ant1

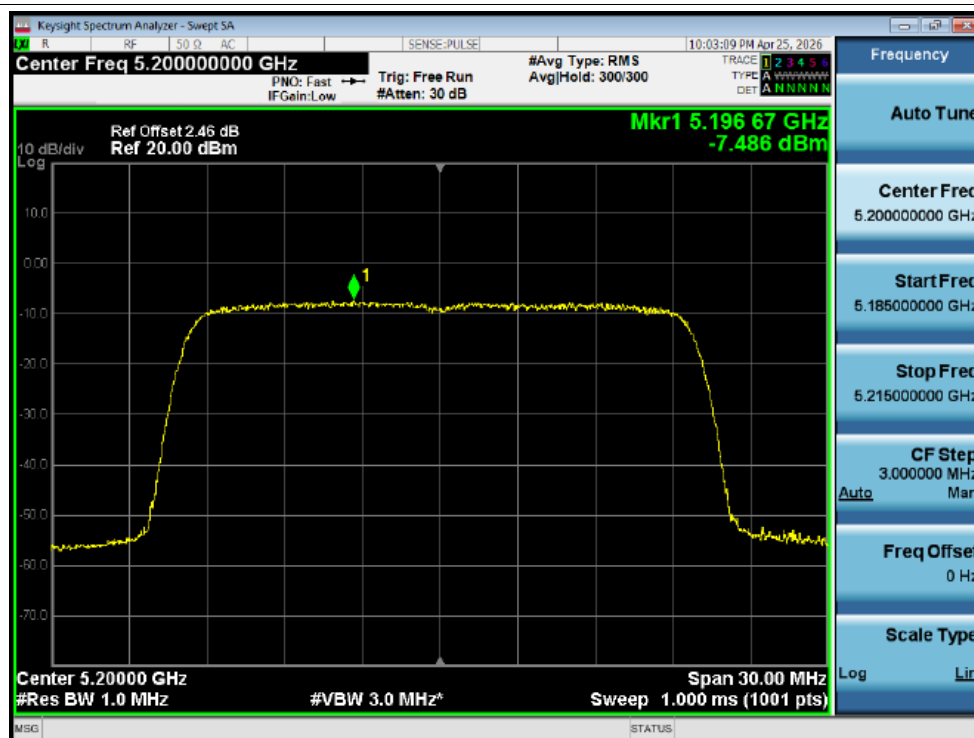


PSD NVNT ax20 5200MHz Ant2

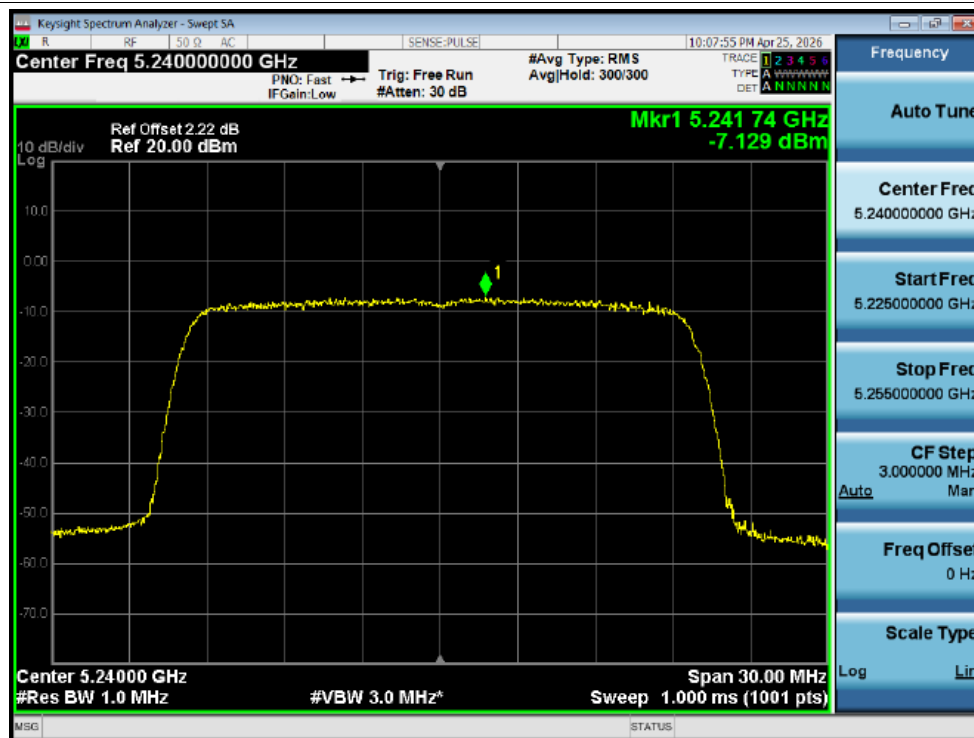


PSD NVNT ax20 5240MHz Ant1




PSD NVNT ax20 5240MHz Ant2

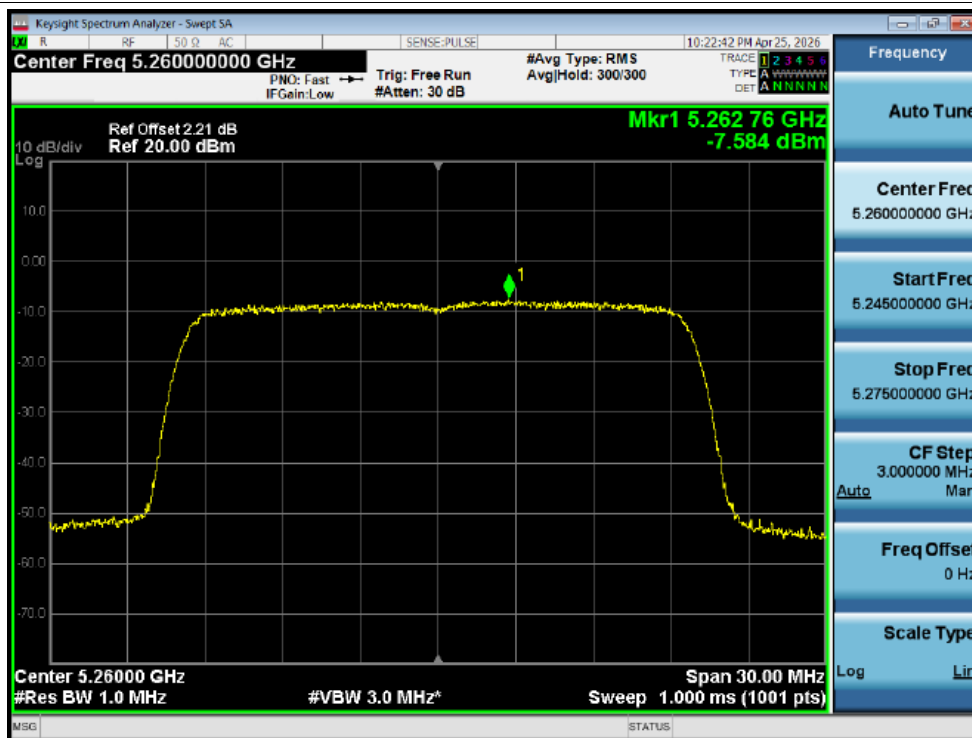


PSD NVNT ax20 5260MHz Ant1

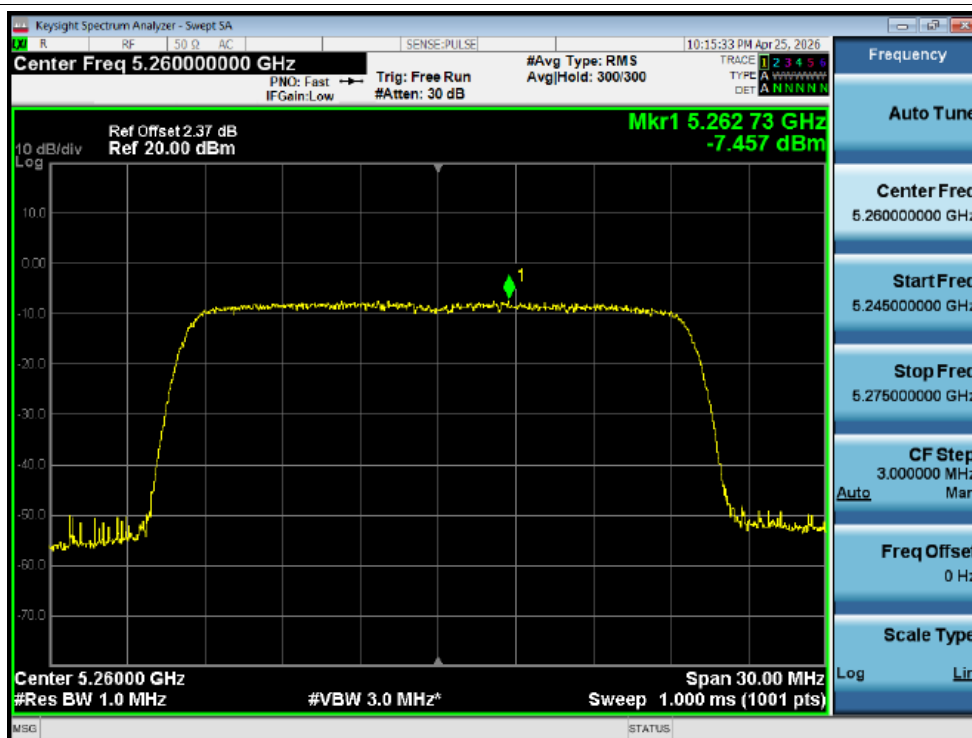


PSD NVNT ax20 5260MHz Ant2

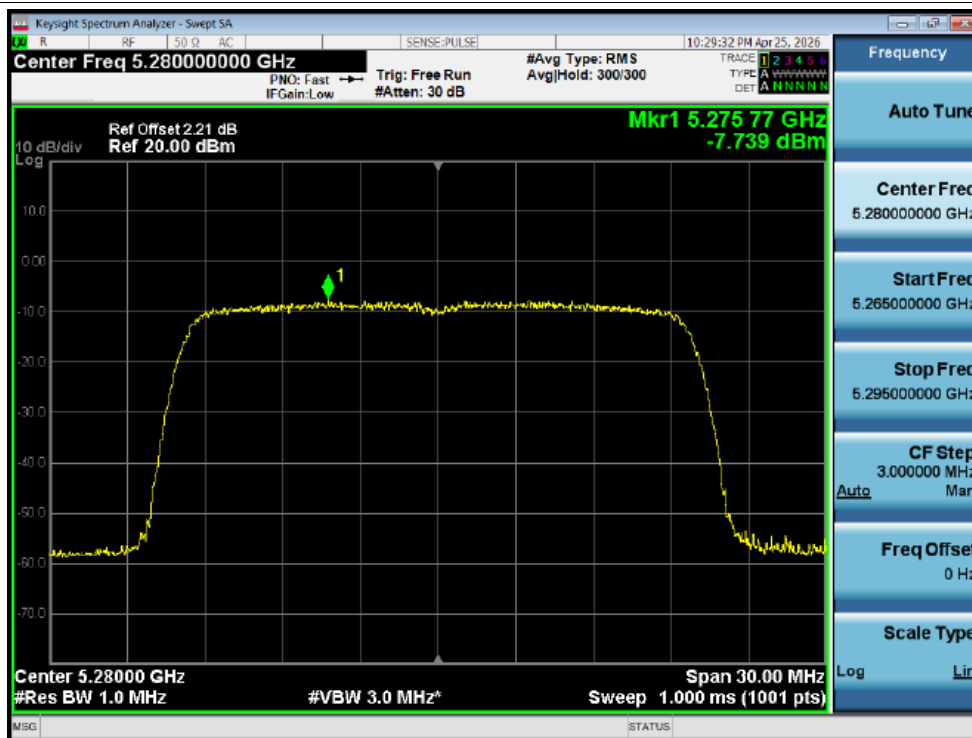


PSD NVNT ax20 5280MHz Ant1

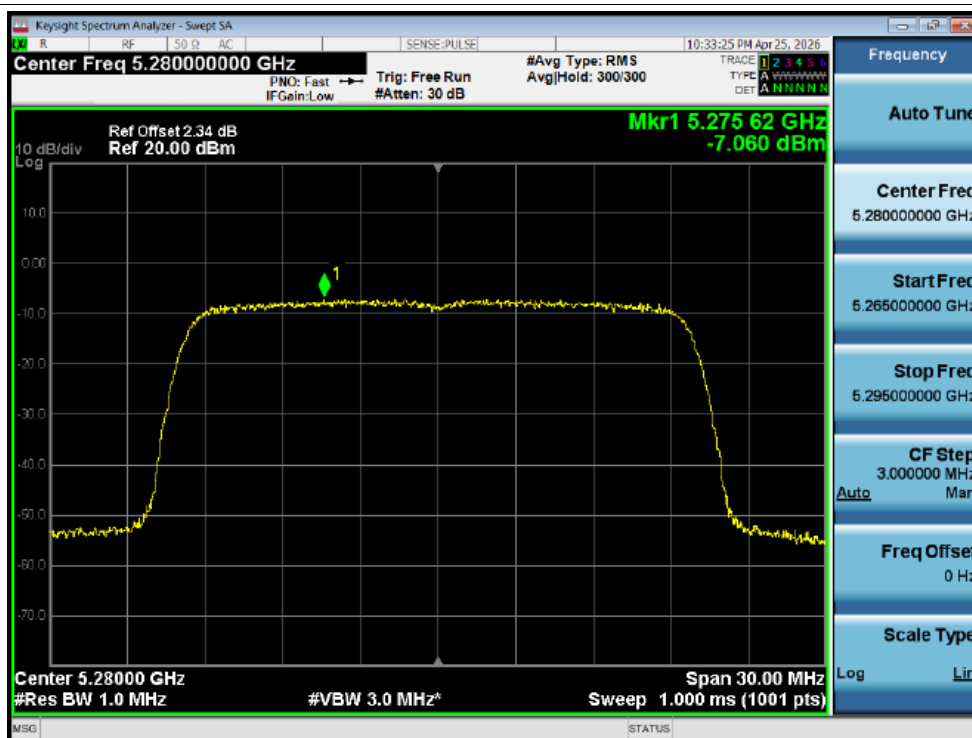


PSD NVNT ax20 5280MHz Ant2

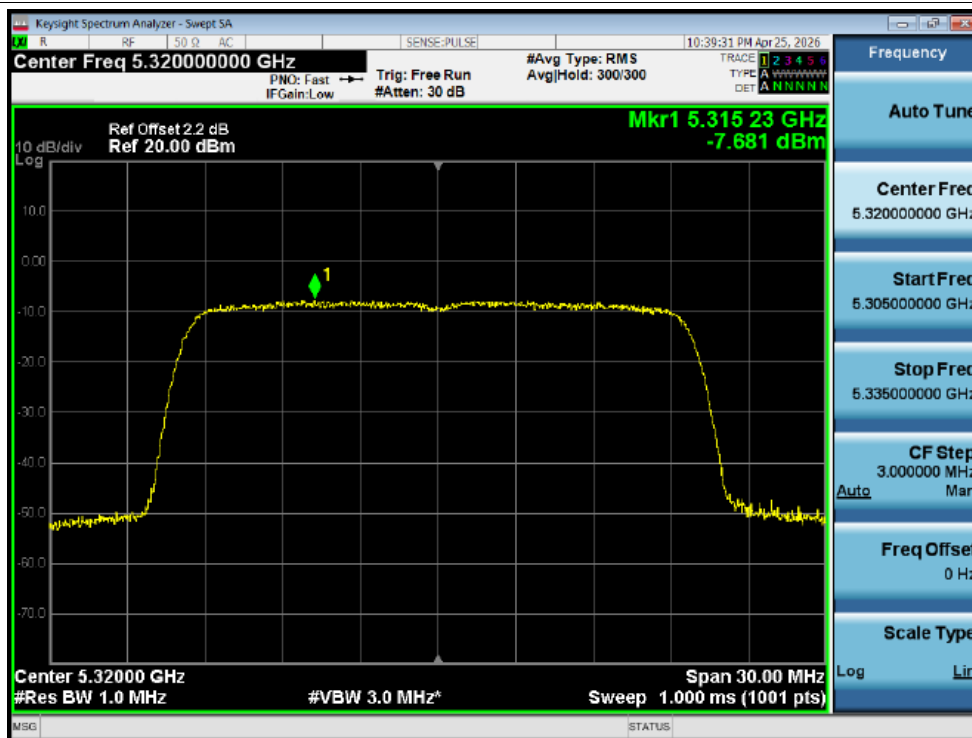


PSD NVNT ax20 5320MHz Ant1

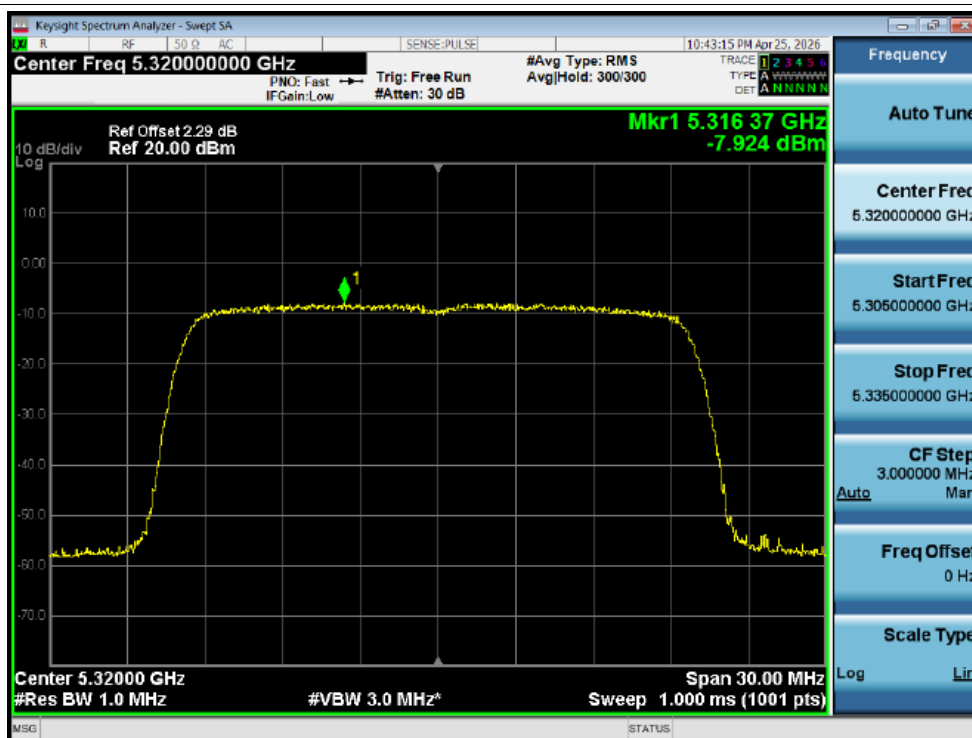


PSD NVNT ax20 5320MHz Ant2

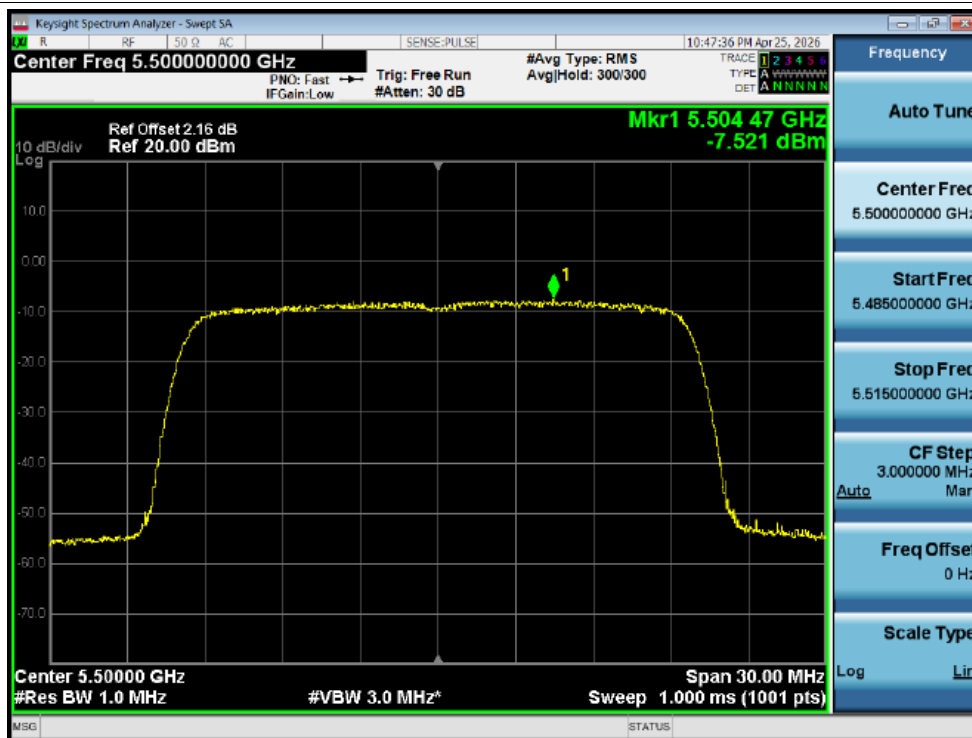


PSD NVNT ax20 5500MHz Ant1

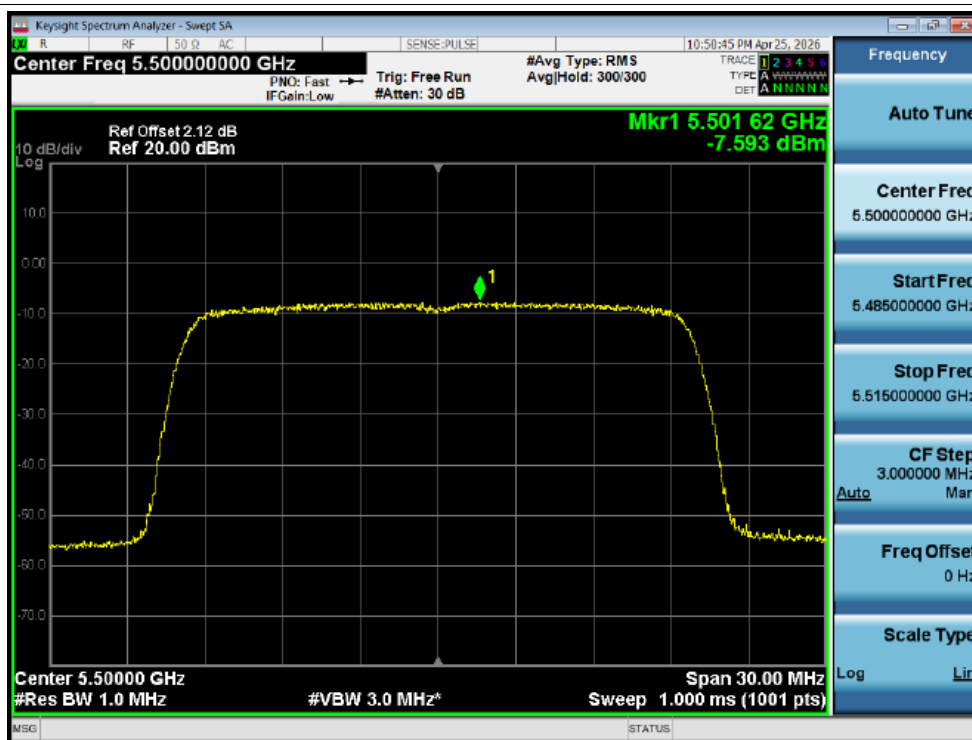


PSD NVNT ax20 5500MHz Ant2

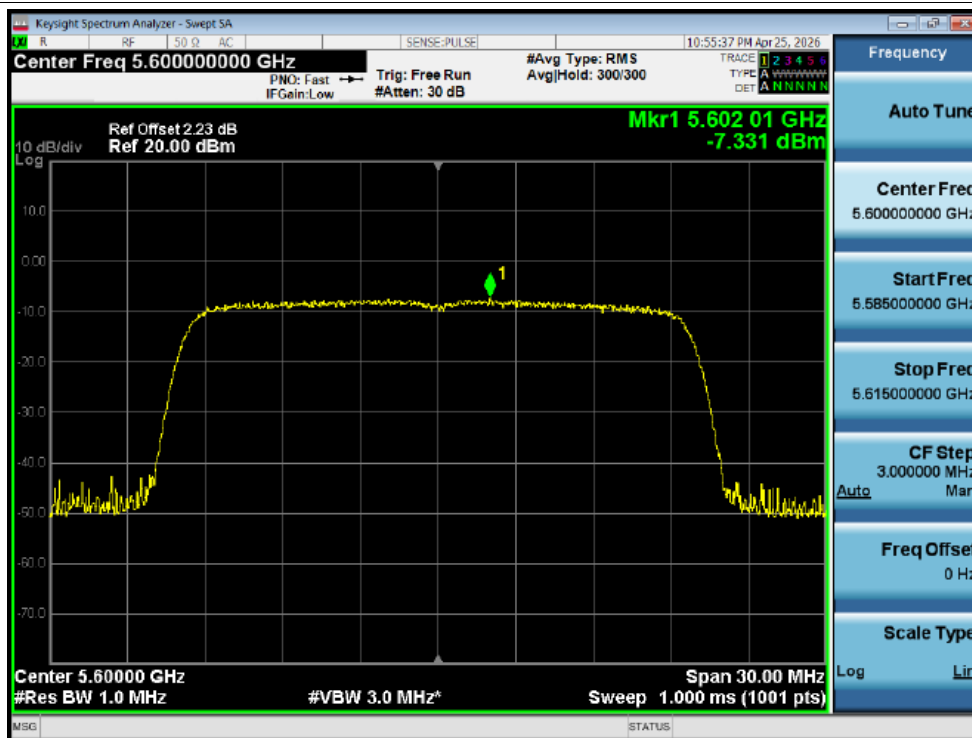


PSD NVNT ax20 5600MHz Ant1

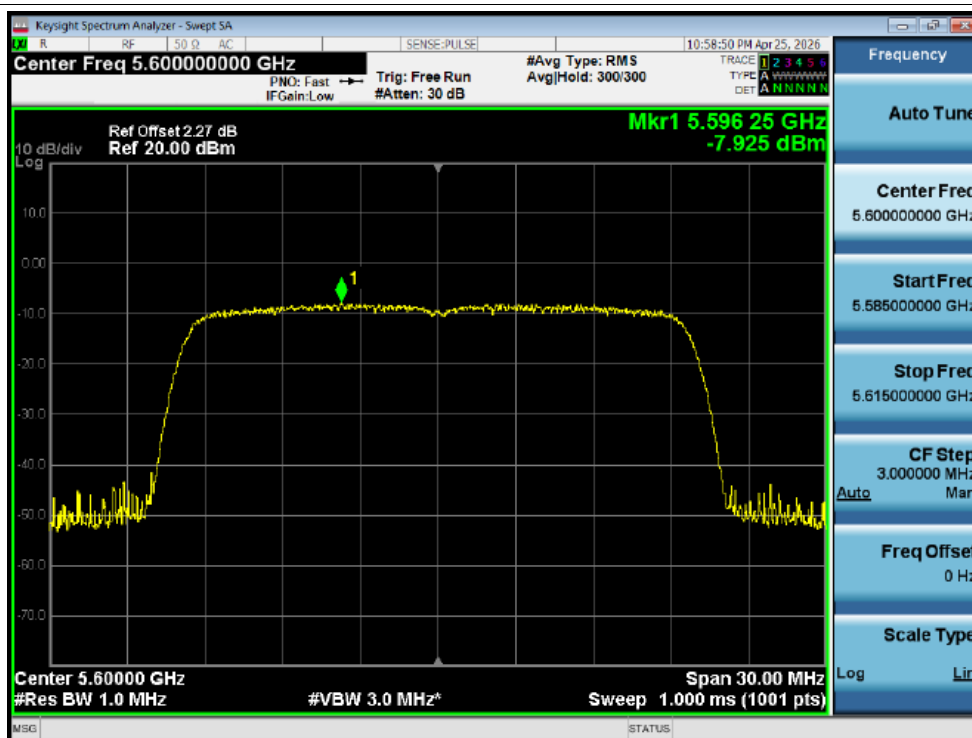

PSD NVNT ax20 5600MHz Ant2

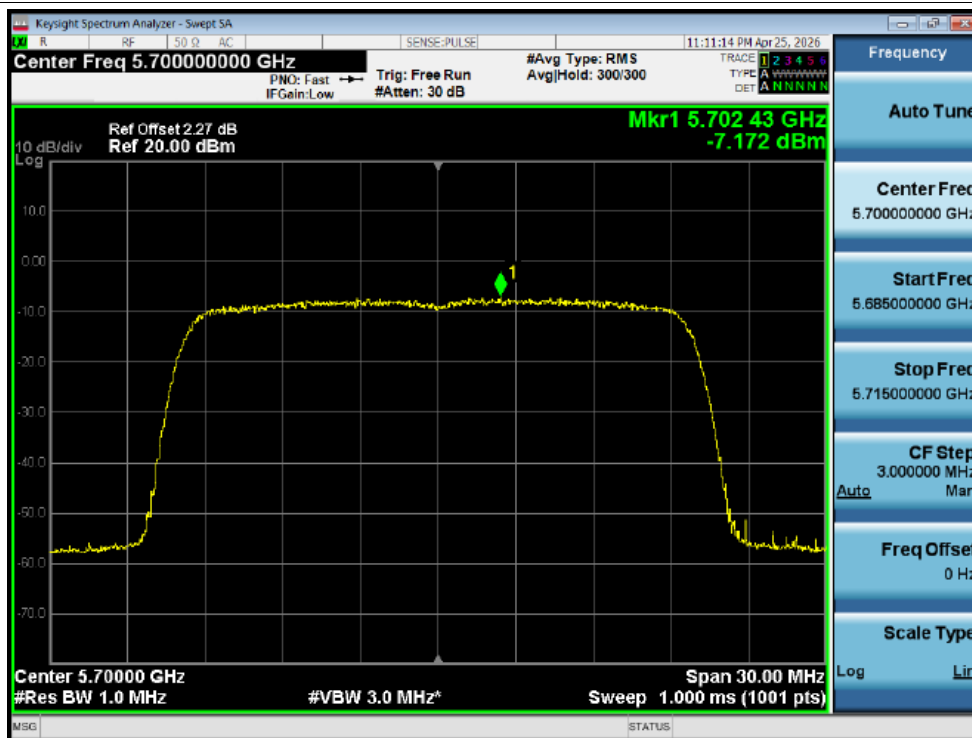

PSD NVNT ax20 5700MHz Ant1

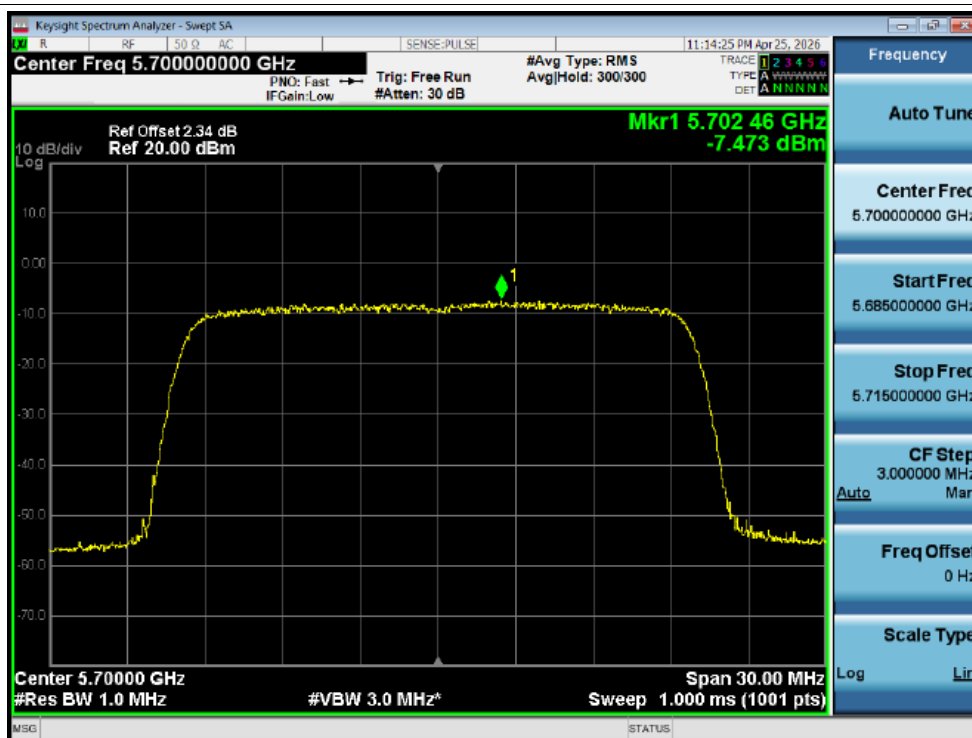

PSD NVNT ax20 5700MHz Ant2



PSD NVNT ax20 5745MHz Ant1



PSD NVNT ax20 5745MHz Ant2



PSD NVNT ax20 5785MHz Ant1



PSD NVNT ax20 5785MHz Ant2




PSD NVNT ax20 5825MHz Ant1



PSD NVNT ax20 5825MHz Ant2




PSD NVNT ax40 5190MHz Ant1

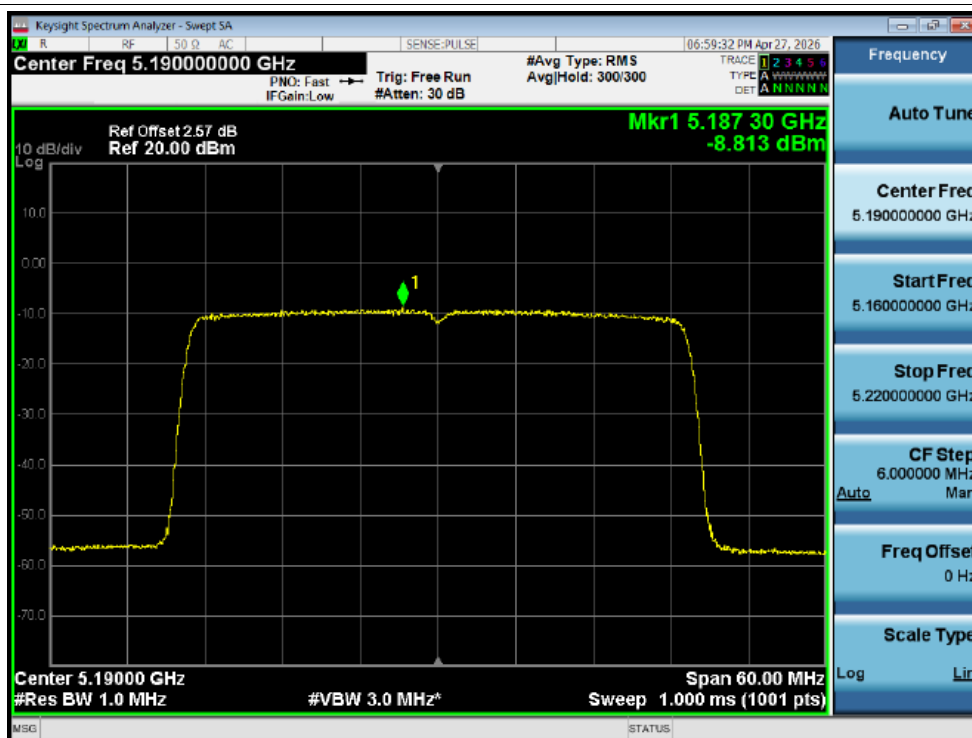

PSD NVNT ax40 5190MHz Ant2




PSD NVNT ax40 5230MHz Ant1

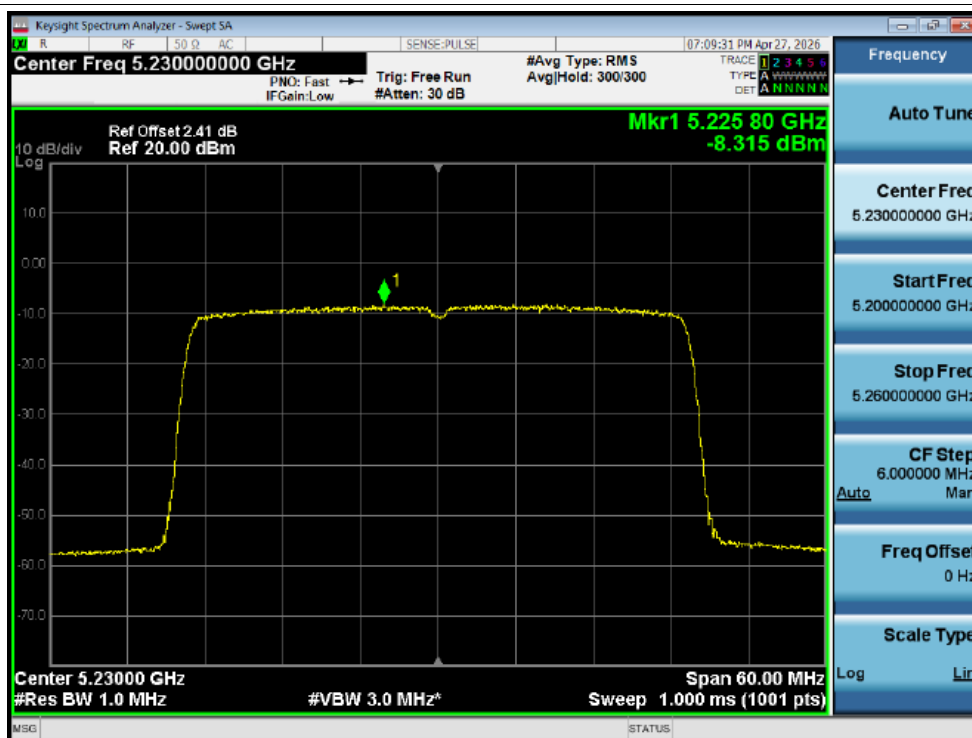

PSD NVNT ax40 5230MHz Ant2




PSD NVNT ax40 5270MHz Ant1

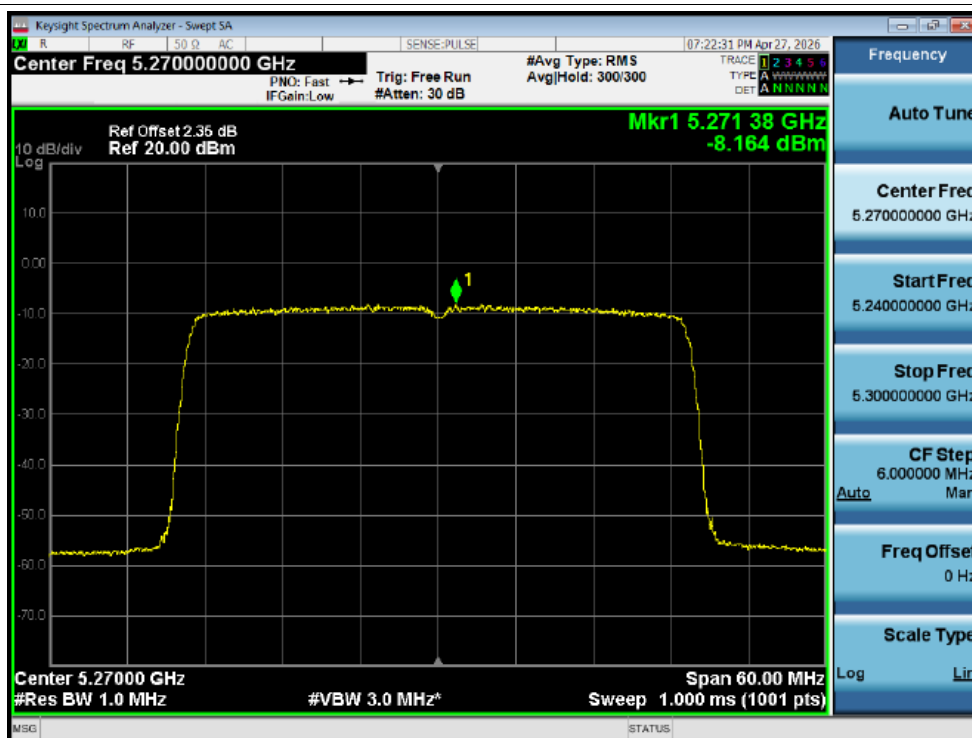

PSD NVNT ax40 5270MHz Ant2



PSD NVNT ax40 5310MHz Ant1

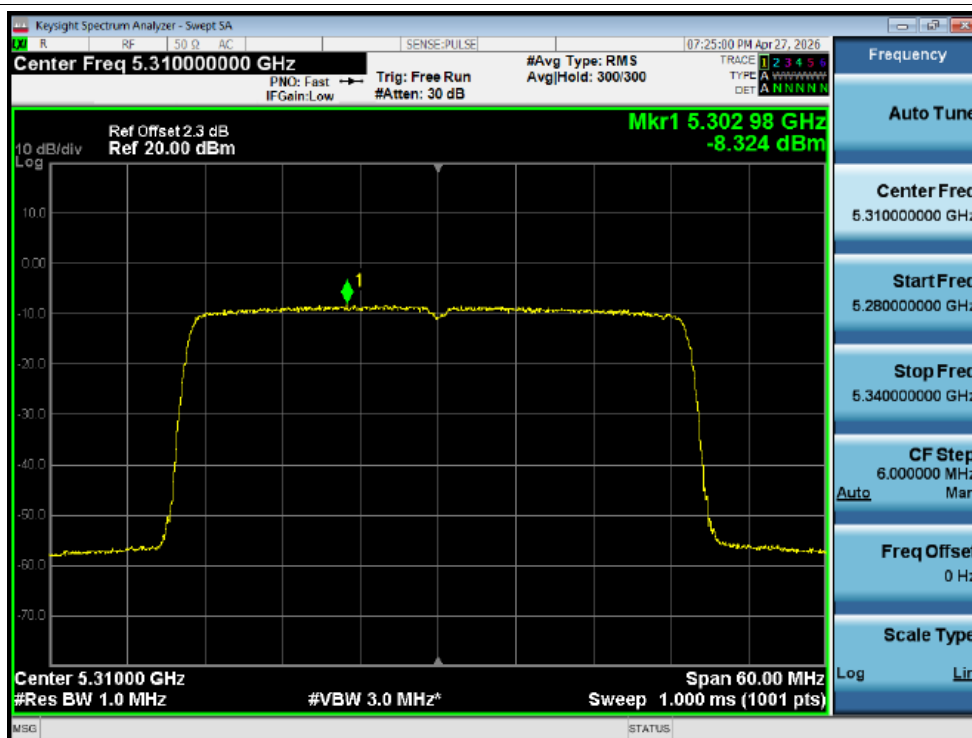

PSD NVNT ax40 5310MHz Ant2




PSD NVNT ax40 5510MHz Ant1



PSD NVNT ax40 5510MHz Ant2



PSD NVNT ax40 5590MHz Ant1

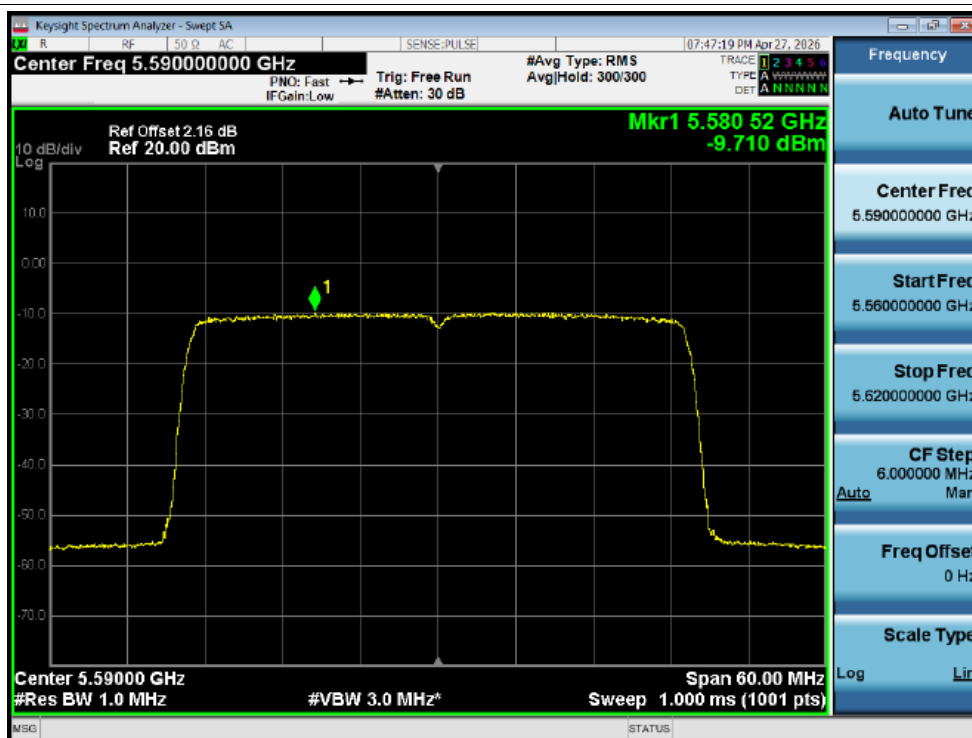

PSD NVNT ax40 5590MHz Ant2




PSD NVNT ax40 5670MHz Ant1



PSD NVNT ax40 5670MHz Ant2



PSD NVNT ax40 5755MHz Ant1

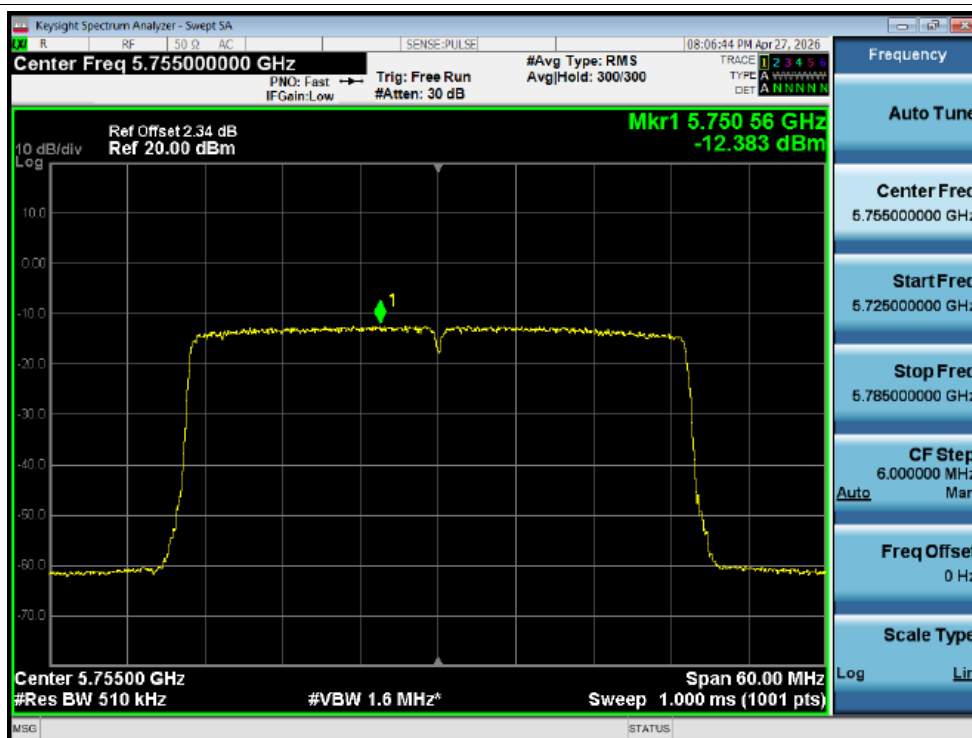

PSD NVNT ax40 5755MHz Ant2



PSD NVNT ax40 5795MHz Ant1



PSD NVNT ax40 5795MHz Ant2



PSD NVNT ax80 5210MHz Ant1



PSD NVNT ax80 5210MHz Ant2



PSD NVNT ax80 5290MHz Ant1



PSD NVNT ax80 5290MHz Ant2



PSD NVNT ax80 5530MHz Ant1



PSD NVNT ax80 5530MHz Ant2



PSD NVNT ax80 5610MHz Ant1



PSD NVNT ax80 5610MHz Ant2



PSD NVNT ax80 5775MHz Ant1



PSD NVNT ax80 5775MHz Ant2

Frequency Stability

Condition	Mode	Frequency (MHz)	Antenna	Measured Frequency (MHz)	Frequency Error (Hz)	Deviation (ppm)	Limit (MHz)	Verdict
25C 2.8V	a	5180	Ant1	5179.98	-20000	-3.86	5150-5250	Pass
25C 3.3V	a	5180	Ant1	5179.98	-20000	-3.86	5150-5250	Pass
25C 3.63V	a	5180	Ant1	5180	0	0	5150-5250	Pass
0C 3V	a	5180	Ant1	5179.98	-20000	-3.86	5150-5250	Pass
10C 3V	a	5180	Ant1	5179.98	-20000	-3.86	5150-5250	Pass
20C 3V	a	5180	Ant1	5179.98	-20000	-3.86	5150-5250	Pass
30C 3V	a	5180	Ant1	5179.98	-20000	-3.86	5150-5250	Pass
40C 3V	a	5180	Ant1	5179.98	-20000	-3.86	5150-5250	Pass
50C 3V	a	5180	Ant1	5179.98	-20000	-3.86	5150-5250	Pass
60C 3V	a	5180	Ant1	5179.96	-40000	-7.72	5150-5250	Pass
70C 3V	a	5180	Ant1	5179.98	-20000	-3.86	5150-5250	Pass
25C 2.8V	a	5200	Ant1	5199.98	-20000	-3.85	5150-5250	Pass
25C 3.3V	a	5200	Ant1	5199.96	-40000	-7.69	5150-5250	Pass
25C 3.63V	a	5200	Ant1	5199.98	-20000	-3.85	5150-5250	Pass
0C 3V	a	5200	Ant1	5200	0	0	5150-5250	Pass
10C 3V	a	5200	Ant1	5199.98	-20000	-3.85	5150-5250	Pass
20C 3V	a	5200	Ant1	5200	0	0	5150-5250	Pass
30C 3V	a	5200	Ant1	5200	0	0	5150-5250	Pass
40C 3V	a	5200	Ant1	5200	0	0	5150-5250	Pass
50C 3V	a	5200	Ant1	5199.98	-20000	-3.85	5150-5250	Pass
60C 3V	a	5200	Ant1	5199.98	-20000	-3.85	5150-5250	Pass
70C 3V	a	5200	Ant1	5200	0	0	5150-5250	Pass
25C 2.8V	a	5240	Ant1	5239.98	-20000	-3.82	5150-5250	Pass
25C 3.3V	a	5240	Ant1	5240	0	0	5150-5250	Pass
25C 3.63V	a	5240	Ant1	5239.98	-20000	-3.82	5150-5250	Pass
0C 3V	a	5240	Ant1	5240	0	0	5150-5250	Pass
10C 3V	a	5240	Ant1	5240	0	0	5150-5250	Pass
20C 3V	a	5240	Ant1	5239.98	-20000	-3.82	5150-5250	Pass
30C 3V	a	5240	Ant1	5239.96	-40000	-7.63	5150-5250	Pass
40C 3V	a	5240	Ant1	5240	0	0	5150-5250	Pass
50C 3V	a	5240	Ant1	5240	0	0	5150-5250	Pass
60C 3V	a	5240	Ant1	5239.98	-20000	-3.82	5150-5250	Pass
70C 3V	a	5240	Ant1	5239.98	-20000	-3.82	5150-5250	Pass
25C 2.8V	a	5260	Ant1	5259.98	-20000	-3.8	5250-5350	Pass
25C 3.3V	a	5260	Ant1	5260	0	0	5250-5350	Pass
25C 3.63V	a	5260	Ant1	5259.98	-20000	-3.8	5250-5350	Pass
0C 3V	a	5260	Ant1	5260	0	0	5250-5350	Pass
10C 3V	a	5260	Ant1	5259.98	-20000	-3.8	5250-5350	Pass
20C 3V	a	5260	Ant1	5260	0	0	5250-5350	Pass

30C 3V	a	5260	Ant1	5260	0	0	5250-5350	Pass
40C 3V	a	5260	Ant1	5260	0	0	5250-5350	Pass
50C 3V	a	5260	Ant1	5259.98	-20000	-3.8	5250-5350	Pass
60C 3V	a	5260	Ant1	5259.98	-20000	-3.8	5250-5350	Pass
70C 3V	a	5260	Ant1	5259.98	-20000	-3.8	5250-5350	Pass
25C 2.8V	a	5280	Ant1	5279.96	-40000	-7.58	5250-5350	Pass
25C 3.3V	a	5280	Ant1	5280	0	0	5250-5350	Pass
25C 3.63V	a	5280	Ant1	5279.98	-20000	-3.79	5250-5350	Pass
0C 3V	a	5280	Ant1	5279.98	-20000	-3.79	5250-5350	Pass
10C 3V	a	5280	Ant1	5280	0	0	5250-5350	Pass
20C 3V	a	5280	Ant1	5279.98	-20000	-3.79	5250-5350	Pass
30C 3V	a	5280	Ant1	5280	0	0	5250-5350	Pass
40C 3V	a	5280	Ant1	5279.98	-20000	-3.79	5250-5350	Pass
50C 3V	a	5280	Ant1	5279.98	-20000	-3.79	5250-5350	Pass
60C 3V	a	5280	Ant1	5279.98	-20000	-3.79	5250-5350	Pass
70C 3V	a	5280	Ant1	5280	0	0	5250-5350	Pass
25C 2.8V	a	5320	Ant1	5319.98	-20000	-3.76	5250-5350	Pass
25C 3.3V	a	5320	Ant1	5319.98	-20000	-3.76	5250-5350	Pass
25C 3.63V	a	5320	Ant1	5319.98	-20000	-3.76	5250-5350	Pass
0C 3V	a	5320	Ant1	5320	0	0	5250-5350	Pass
10C 3V	a	5320	Ant1	5319.98	-20000	-3.76	5250-5350	Pass
20C 3V	a	5320	Ant1	5320	0	0	5250-5350	Pass
30C 3V	a	5320	Ant1	5319.98	-20000	-3.76	5250-5350	Pass
40C 3V	a	5320	Ant1	5319.98	-20000	-3.76	5250-5350	Pass
50C 3V	a	5320	Ant1	5319.98	-20000	-3.76	5250-5350	Pass
60C 3V	a	5320	Ant1	5319.98	-20000	-3.76	5250-5350	Pass
70C 3V	a	5320	Ant1	5319.98	-20000	-3.76	5250-5350	Pass
25C 2.8V	a	5500	Ant1	5500	0	0	5470-5725	Pass
25C 3.3V	a	5500	Ant1	5500	0	0	5470-5725	Pass
25C 3.63V	a	5500	Ant1	5499.98	-20000	-3.64	5470-5725	Pass
0C 3V	a	5500	Ant1	5500	0	0	5470-5725	Pass
10C 3V	a	5500	Ant1	5500	0	0	5470-5725	Pass
20C 3V	a	5500	Ant1	5499.98	-20000	-3.64	5470-5725	Pass
30C 3V	a	5500	Ant1	5500	0	0	5470-5725	Pass
40C 3V	a	5500	Ant1	5499.98	-20000	-3.64	5470-5725	Pass
50C 3V	a	5500	Ant1	5499.98	-20000	-3.64	5470-5725	Pass
60C 3V	a	5500	Ant1	5499.98	-20000	-3.64	5470-5725	Pass
70C 3V	a	5500	Ant1	5500	0	0	5470-5725	Pass
25C 2.8V	a	5600	Ant1	5600	0	0	5470-5725	Pass
25C 3.3V	a	5600	Ant1	5600.02	20000	3.57	5470-5725	Pass
25C 3.63V	a	5600	Ant1	5599.98	-20000	-3.57	5470-5725	Pass
0C 3V	a	5600	Ant1	5599.98	-20000	-3.57	5470-5725	Pass
10C 3V	a	5600	Ant1	5599.98	-20000	-3.57	5470-5725	Pass
20C 3V	a	5600	Ant1	5600	0	0	5470-5725	Pass

30C 3V	a	5600	Ant1	5599.98	-20000	-3.57	5470-5725	Pass
40C 3V	a	5600	Ant1	5599.98	-20000	-3.57	5470-5725	Pass
50C 3V	a	5600	Ant1	5599.98	-20000	-3.57	5470-5725	Pass
60C 3V	a	5600	Ant1	5600	0	0	5470-5725	Pass
70C 3V	a	5600	Ant1	5600	0	0	5470-5725	Pass
25C 2.8V	a	5700	Ant1	5700	0	0	5470-5725	Pass
25C 3.3V	a	5700	Ant1	5700	0	0	5470-5725	Pass
25C 3.63V	a	5700	Ant1	5700	0	0	5470-5725	Pass
0C 3V	a	5700	Ant1	5700	0	0	5470-5725	Pass
10C 3V	a	5700	Ant1	5699.98	-20000	-3.51	5470-5725	Pass
20C 3V	a	5700	Ant1	5700	0	0	5470-5725	Pass
30C 3V	a	5700	Ant1	5699.96	-40000	-7.02	5470-5725	Pass
40C 3V	a	5700	Ant1	5699.98	-20000	-3.51	5470-5725	Pass
50C 3V	a	5700	Ant1	5700	0	0	5470-5725	Pass
60C 3V	a	5700	Ant1	5700	0	0	5470-5725	Pass
70C 3V	a	5700	Ant1	5699.98	-20000	-3.51	5470-5725	Pass
25C 2.8V	a	5745	Ant1	5745	0	0	5725-5850	Pass
25C 3.3V	a	5745	Ant1	5744.98	-20000	-3.48	5725-5850	Pass
25C 3.63V	a	5745	Ant1	5745	0	0	5725-5850	Pass
0C 3V	a	5745	Ant1	5745	0	0	5725-5850	Pass
10C 3V	a	5745	Ant1	5745	0	0	5725-5850	Pass
20C 3V	a	5745	Ant1	5744.98	-20000	-3.48	5725-5850	Pass
30C 3V	a	5745	Ant1	5744.98	-20000	-3.48	5725-5850	Pass
40C 3V	a	5745	Ant1	5745.02	20000	3.48	5725-5850	Pass
50C 3V	a	5745	Ant1	5744.98	-20000	-3.48	5725-5850	Pass
60C 3V	a	5745	Ant1	5744.98	-20000	-3.48	5725-5850	Pass
70C 3V	a	5745	Ant1	5744.98	-20000	-3.48	5725-5850	Pass
25C 2.8V	a	5785	Ant1	5784.98	-20000	-3.46	5725-5850	Pass
25C 3.3V	a	5785	Ant1	5785	0	0	5725-5850	Pass
25C 3.63V	a	5785	Ant1	5785	0	0	5725-5850	Pass
0C 3V	a	5785	Ant1	5784.98	-20000	-3.46	5725-5850	Pass
10C 3V	a	5785	Ant1	5784.98	-20000	-3.46	5725-5850	Pass
20C 3V	a	5785	Ant1	5785	0	0	5725-5850	Pass
30C 3V	a	5785	Ant1	5785	0	0	5725-5850	Pass
40C 3V	a	5785	Ant1	5784.98	-20000	-3.46	5725-5850	Pass
50C 3V	a	5785	Ant1	5784.98	-20000	-3.46	5725-5850	Pass
60C 3V	a	5785	Ant1	5785	0	0	5725-5850	Pass
70C 3V	a	5785	Ant1	5784.98	-20000	-3.46	5725-5850	Pass
25C 2.8V	a	5825	Ant1	5824.98	-20000	-3.43	5725-5850	Pass
25C 3.3V	a	5825	Ant1	5825	0	0	5725-5850	Pass
25C 3.63V	a	5825	Ant1	5824.98	-20000	-3.43	5725-5850	Pass
0C 3V	a	5825	Ant1	5824.98	-20000	-3.43	5725-5850	Pass
10C 3V	a	5825	Ant1	5824.98	-20000	-3.43	5725-5850	Pass
20C 3V	a	5825	Ant1	5824.98	-20000	-3.43	5725-5850	Pass

30C 3V	a	5825	Ant1	5825	0	0	5725-5850	Pass
40C 3V	a	5825	Ant1	5824.98	-20000	-3.43	5725-5850	Pass
50C 3V	a	5825	Ant1	5825	0	0	5725-5850	Pass
60C 3V	a	5825	Ant1	5825	0	0	5725-5850	Pass
70C 3V	a	5825	Ant1	5825	0	0	5725-5850	Pass
25C 2.8V	a	5180	Ant2	5179.98	-20000	-3.86	5150-5250	Pass
25C 3.3V	a	5180	Ant2	5179.98	-20000	-3.86	5150-5250	Pass
25C 3.63V	a	5180	Ant2	5179.98	-20000	-3.86	5150-5250	Pass
0C 3V	a	5180	Ant2	5180	0	0	5150-5250	Pass
10C 3V	a	5180	Ant2	5179.98	-20000	-3.86	5150-5250	Pass
20C 3V	a	5180	Ant2	5180	0	0	5150-5250	Pass
30C 3V	a	5180	Ant2	5179.96	-40000	-7.72	5150-5250	Pass
40C 3V	a	5180	Ant2	5179.98	-20000	-3.86	5150-5250	Pass
50C 3V	a	5180	Ant2	5180	0	0	5150-5250	Pass
60C 3V	a	5180	Ant2	5179.98	-20000	-3.86	5150-5250	Pass
70C 3V	a	5180	Ant2	5179.98	-20000	-3.86	5150-5250	Pass
25C 2.8V	a	5200	Ant2	5200	0	0	5150-5250	Pass
25C 3.3V	a	5200	Ant2	5199.98	-20000	-3.85	5150-5250	Pass
25C 3.63V	a	5200	Ant2	5199.98	-20000	-3.85	5150-5250	Pass
0C 3V	a	5200	Ant2	5200	0	0	5150-5250	Pass
10C 3V	a	5200	Ant2	5200	0	0	5150-5250	Pass
20C 3V	a	5200	Ant2	5200	0	0	5150-5250	Pass
30C 3V	a	5200	Ant2	5199.98	-20000	-3.85	5150-5250	Pass
40C 3V	a	5200	Ant2	5200.02	20000	3.85	5150-5250	Pass
50C 3V	a	5200	Ant2	5200.04	40000	7.69	5150-5250	Pass
60C 3V	a	5200	Ant2	5199.98	-20000	-3.85	5150-5250	Pass
70C 3V	a	5200	Ant2	5200	0	0	5150-5250	Pass
25C 2.8V	a	5240	Ant2	5240.02	20000	3.82	5150-5250	Pass
25C 3.3V	a	5240	Ant2	5240	0	0	5150-5250	Pass
25C 3.63V	a	5240	Ant2	5239.98	-20000	-3.82	5150-5250	Pass
0C 3V	a	5240	Ant2	5239.98	-20000	-3.82	5150-5250	Pass
10C 3V	a	5240	Ant2	5239.98	-20000	-3.82	5150-5250	Pass
20C 3V	a	5240	Ant2	5240	0	0	5150-5250	Pass
30C 3V	a	5240	Ant2	5239.98	-20000	-3.82	5150-5250	Pass
40C 3V	a	5240	Ant2	5240	0	0	5150-5250	Pass
50C 3V	a	5240	Ant2	5239.98	-20000	-3.82	5150-5250	Pass
60C 3V	a	5240	Ant2	5239.98	-20000	-3.82	5150-5250	Pass
70C 3V	a	5240	Ant2	5239.98	-20000	-3.82	5150-5250	Pass
25C 2.8V	a	5260	Ant2	5259.98	-20000	-3.8	5250-5350	Pass
25C 3.3V	a	5260	Ant2	5260	0	0	5250-5350	Pass
25C 3.63V	a	5260	Ant2	5260	0	0	5250-5350	Pass
0C 3V	a	5260	Ant2	5259.98	-20000	-3.8	5250-5350	Pass
10C 3V	a	5260	Ant2	5259.98	-20000	-3.8	5250-5350	Pass
20C 3V	a	5260	Ant2	5259.98	-20000	-3.8	5250-5350	Pass

30C 3V	a	5260	Ant2	5260	0	0	5250-5350	Pass
40C 3V	a	5260	Ant2	5260	0	0	5250-5350	Pass
50C 3V	a	5260	Ant2	5260	0	0	5250-5350	Pass
60C 3V	a	5260	Ant2	5259.98	-20000	-3.8	5250-5350	Pass
70C 3V	a	5260	Ant2	5259.98	-20000	-3.8	5250-5350	Pass
25C 2.8V	a	5280	Ant2	5280	0	0	5250-5350	Pass
25C 3.3V	a	5280	Ant2	5279.98	-20000	-3.79	5250-5350	Pass
25C 3.63V	a	5280	Ant2	5280	0	0	5250-5350	Pass
0C 3V	a	5280	Ant2	5280	0	0	5250-5350	Pass
10C 3V	a	5280	Ant2	5279.98	-20000	-3.79	5250-5350	Pass
20C 3V	a	5280	Ant2	5279.98	-20000	-3.79	5250-5350	Pass
30C 3V	a	5280	Ant2	5280	0	0	5250-5350	Pass
40C 3V	a	5280	Ant2	5279.98	-20000	-3.79	5250-5350	Pass
50C 3V	a	5280	Ant2	5280	0	0	5250-5350	Pass
60C 3V	a	5280	Ant2	5279.98	-20000	-3.79	5250-5350	Pass
70C 3V	a	5280	Ant2	5280	0	0	5250-5350	Pass
25C 2.8V	a	5320	Ant2	5320	0	0	5250-5350	Pass
25C 3.3V	a	5320	Ant2	5320	0	0	5250-5350	Pass
25C 3.63V	a	5320	Ant2	5319.98	-20000	-3.76	5250-5350	Pass
0C 3V	a	5320	Ant2	5319.98	-20000	-3.76	5250-5350	Pass
10C 3V	a	5320	Ant2	5320	0	0	5250-5350	Pass
20C 3V	a	5320	Ant2	5319.98	-20000	-3.76	5250-5350	Pass
30C 3V	a	5320	Ant2	5319.96	-40000	-7.52	5250-5350	Pass
40C 3V	a	5320	Ant2	5319.98	-20000	-3.76	5250-5350	Pass
50C 3V	a	5320	Ant2	5319.98	-20000	-3.76	5250-5350	Pass
60C 3V	a	5320	Ant2	5319.98	-20000	-3.76	5250-5350	Pass
70C 3V	a	5320	Ant2	5319.98	-20000	-3.76	5250-5350	Pass
25C 2.8V	a	5500	Ant2	5499.98	-20000	-3.64	5470-5725	Pass
25C 3.3V	a	5500	Ant2	5500	0	0	5470-5725	Pass
25C 3.63V	a	5500	Ant2	5499.98	-20000	-3.64	5470-5725	Pass
0C 3V	a	5500	Ant2	5499.98	-20000	-3.64	5470-5725	Pass
10C 3V	a	5500	Ant2	5500	0	0	5470-5725	Pass
20C 3V	a	5500	Ant2	5499.98	-20000	-3.64	5470-5725	Pass
30C 3V	a	5500	Ant2	5499.98	-20000	-3.64	5470-5725	Pass
40C 3V	a	5500	Ant2	5500	0	0	5470-5725	Pass
50C 3V	a	5500	Ant2	5499.98	-20000	-3.64	5470-5725	Pass
60C 3V	a	5500	Ant2	5500	0	0	5470-5725	Pass
70C 3V	a	5500	Ant2	5500	0	0	5470-5725	Pass
25C 2.8V	a	5600	Ant2	5599.98	-20000	-3.57	5470-5725	Pass
25C 3.3V	a	5600	Ant2	5599.98	-20000	-3.57	5470-5725	Pass
25C 3.63V	a	5600	Ant2	5599.98	-20000	-3.57	5470-5725	Pass
0C 3V	a	5600	Ant2	5599.98	-20000	-3.57	5470-5725	Pass
10C 3V	a	5600	Ant2	5599.98	-20000	-3.57	5470-5725	Pass
20C 3V	a	5600	Ant2	5600	0	0	5470-5725	Pass