

Appendix Test Data

Report No.:	1812C50263412504	Test Sample No.:	1-2-2
Start Test Date:	2025-5-28	Finish Test Date:	2025-6-10
Test Engineer:	Hu Sen Guan	Auditor:	Justin Feng
Temperature:	27.7°C	Relative Humidity:	53%
Pressure:	101kPa		

Appendix A1: 26dB Bandwidth

Test Result

Test Mode	Antenna	Frequency[MHz]	26db EBW [MHz]	FL[MHz]	FH[MHz]	Limit[MHz]	Verdict
11A	Ant1	5180	17.52	5171.24	5188.76	---	---
11A	Ant1	5200	17.84	5191.08	5208.92	---	---
11A	Ant1	5240	17.60	5231.20	5248.80	---	---
11A	Ant1	5745	17.64	5736.16	5753.80	---	---
11A	Ant1	5785	17.80	5776.04	5793.84	---	---
11A	Ant1	5825	17.64	5816.16	5833.80	---	---
11N20SISO	Ant1	5180	18.72	5170.64	5189.36	---	---
11N20SISO	Ant1	5200	18.52	5190.76	5209.28	---	---
11N20SISO	Ant1	5240	18.92	5230.52	5249.44	---	---
11N20SISO	Ant1	5745	18.72	5735.60	5754.32	---	---
11N20SISO	Ant1	5785	18.76	5775.56	5794.32	---	---
11N20SISO	Ant1	5825	18.84	5815.52	5834.36	---	---
11N40SISO	Ant1	5190	38.40	5170.80	5209.20	---	---
11N40SISO	Ant1	5230	38.56	5210.80	5249.36	---	---
11N40SISO	Ant1	5755	38.32	5735.88	5774.20	---	---
11N40SISO	Ant1	5795	38.72	5775.72	5814.44	---	---
11AC20SISO	Ant1	5180	18.88	5170.48	5189.36	---	---
11AC20SISO	Ant1	5200	18.72	5190.64	5209.36	---	---
11AC20SISO	Ant1	5240	18.96	5230.56	5249.52	---	---
11AC20SISO	Ant1	5745	18.64	5735.68	5754.32	---	---
11AC20SISO	Ant1	5785	18.84	5775.60	5794.44	---	---
11AC20SISO	Ant1	5825	18.80	5815.52	5834.32	---	---
11AC40SISO	Ant1	5190	38.56	5170.80	5209.36	---	---
11AC40SISO	Ant1	5230	38.16	5210.96	5249.12	---	---

11AC40SISO	Ant1	5755	38.56	5735.80	5774.36	---	---
11AC40SISO	Ant1	5795	38.40	5775.80	5814.20	---	---
11AC80SISO	Ant1	5210	81.28	5170.00	5251.28	---	---
11AC80SISO	Ant1	5775	84.16	5732.44	5816.60	---	---
11AX20SISO	Ant1	5180	19.88	5170.08	5189.96	---	---
11AX20SISO	Ant1	5200	19.92	5190.08	5210.00	---	---
11AX20SISO	Ant1	5240	19.92	5230.08	5250.00	---	---
11AX20SISO	Ant1	5745	19.76	5735.08	5754.84	---	---
11AX20SISO	Ant1	5785	19.84	5775.04	5794.88	---	---
11AX20SISO	Ant1	5825	19.84	5815.12	5834.96	---	---
11AX40SISO	Ant1	5190	39.44	5170.32	5209.76	---	---
11AX40SISO	Ant1	5230	39.52	5210.24	5249.76	---	---
11AX40SISO	Ant1	5755	39.28	5735.40	5774.68	---	---
11AX40SISO	Ant1	5795	39.44	5775.16	5814.60	---	---
11AX80SISO	Ant1	5210	80.16	5169.84	5250.00	---	---
11AX80SISO	Ant1	5775	80.32	5734.84	5815.16	---	---


Shenzhen Anbotek Compliance Laboratory Limited


Address: Sogood Industrial Zone Laboratory & 1/F. of Building D, Sogood Science and Technology Park,
Sanwei Community, Hangcheng Subdistrict, Bao'an District, Shenzhen, Guangdong, China
Tel:(86)0755-26066440 Email:service@anbotek.com




Hotline
400-003-0500
www.anbotek.com

Test Graphs

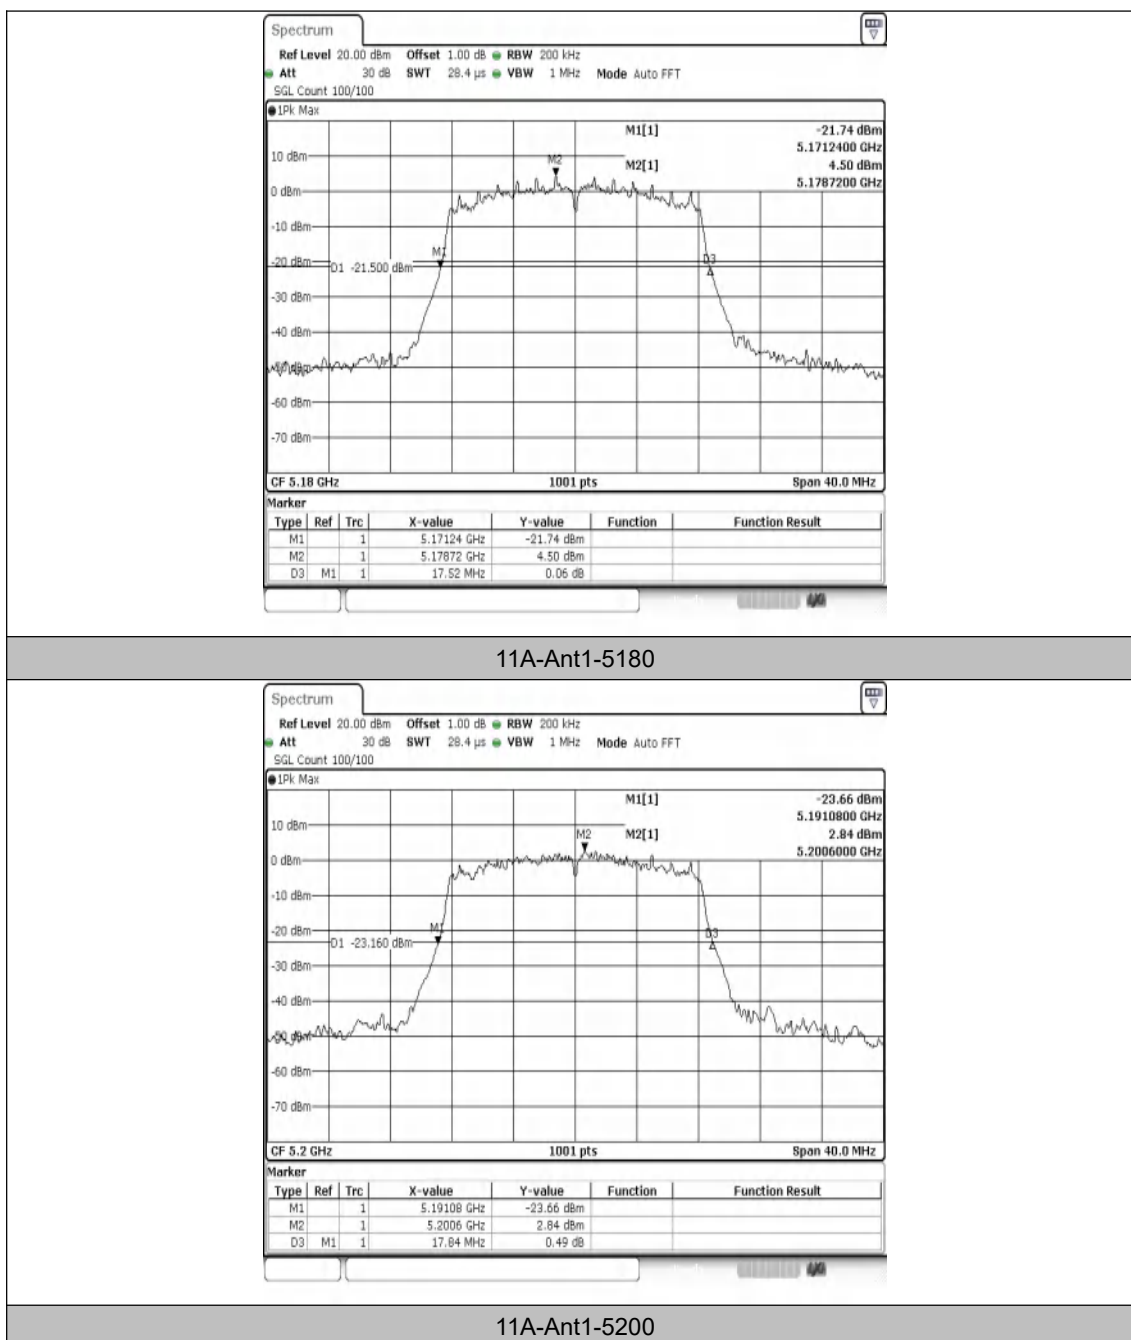


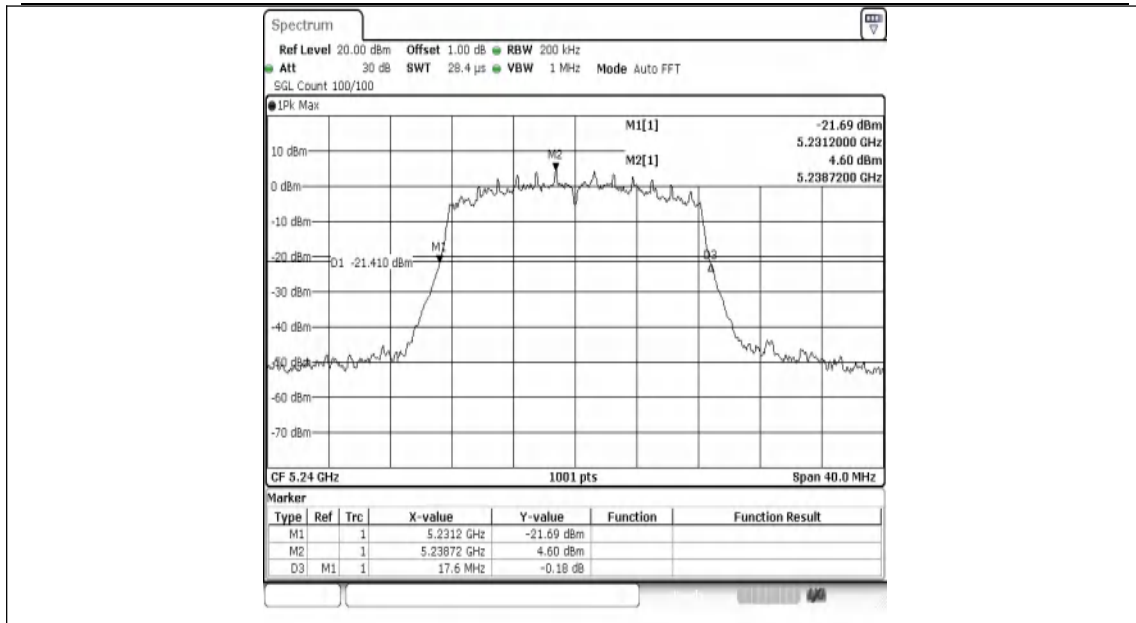


11A-Ant1-5240

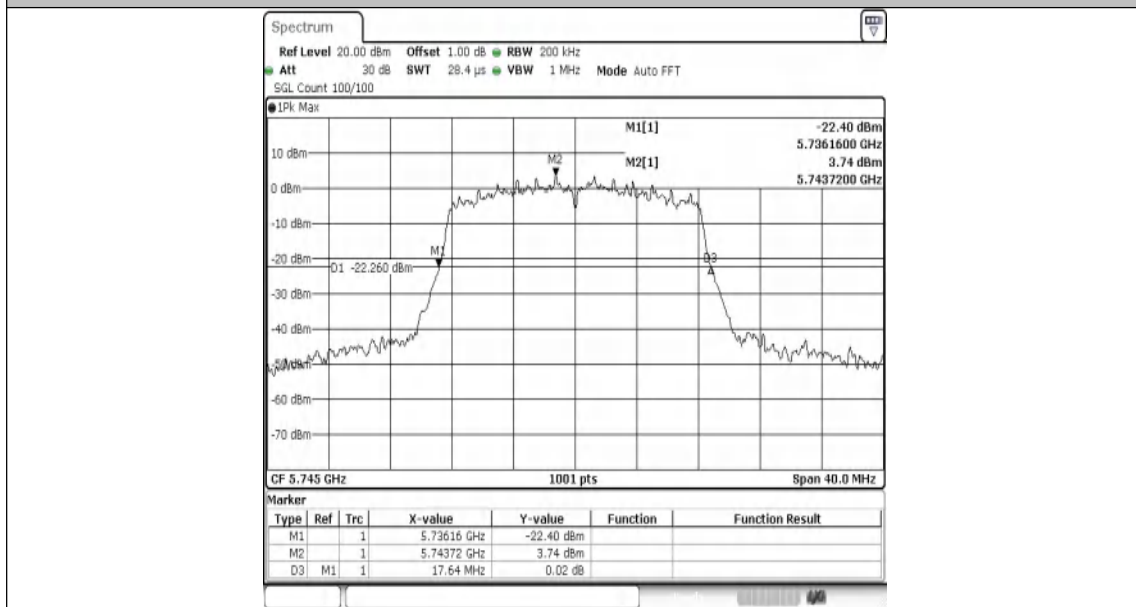


11A-Ant1-5745

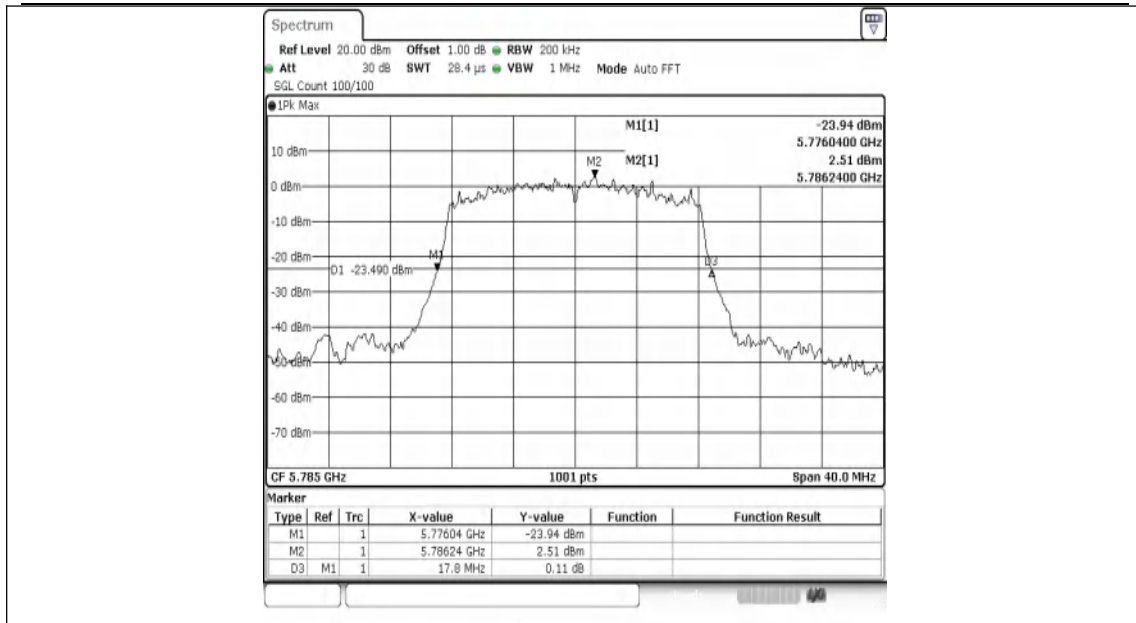


11A-Ant1-5785

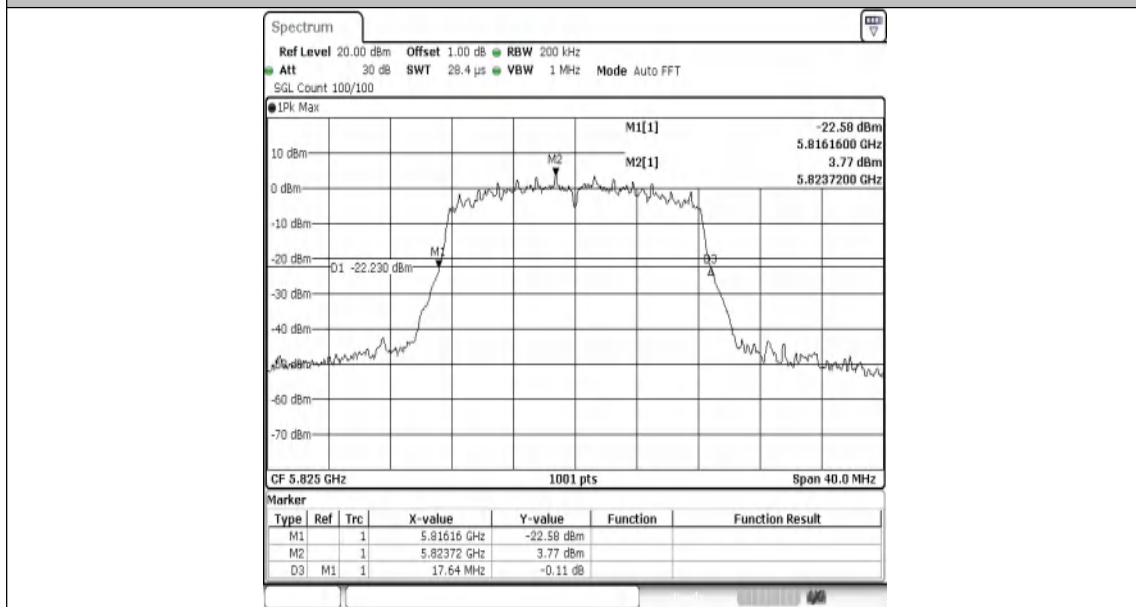


11A-Ant1-5825

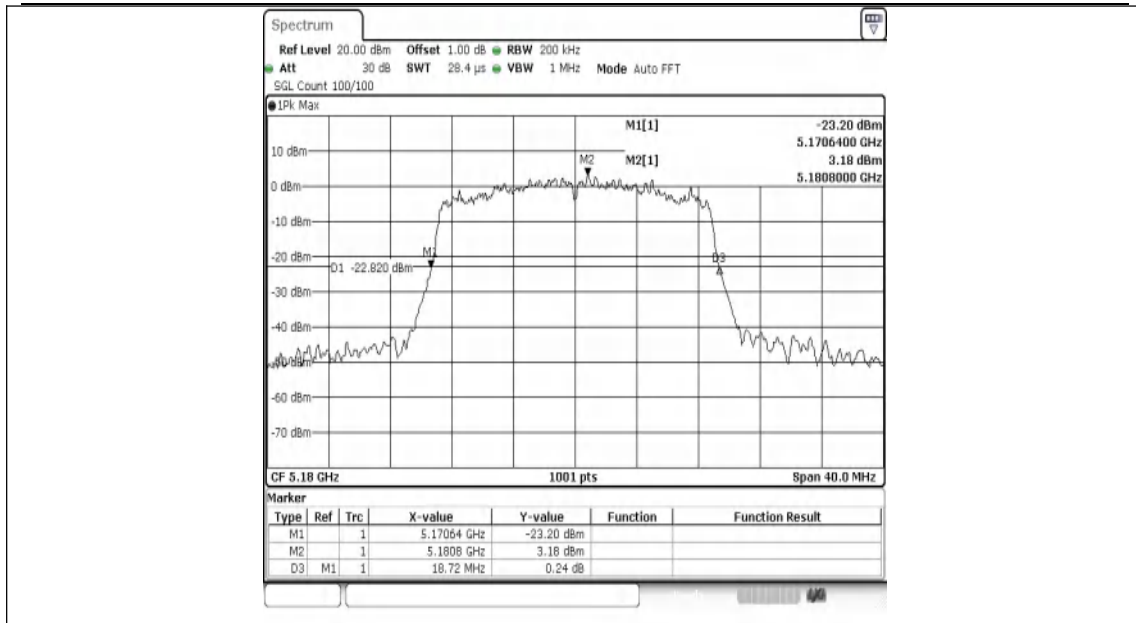



11N20SISO-Ant1-5180

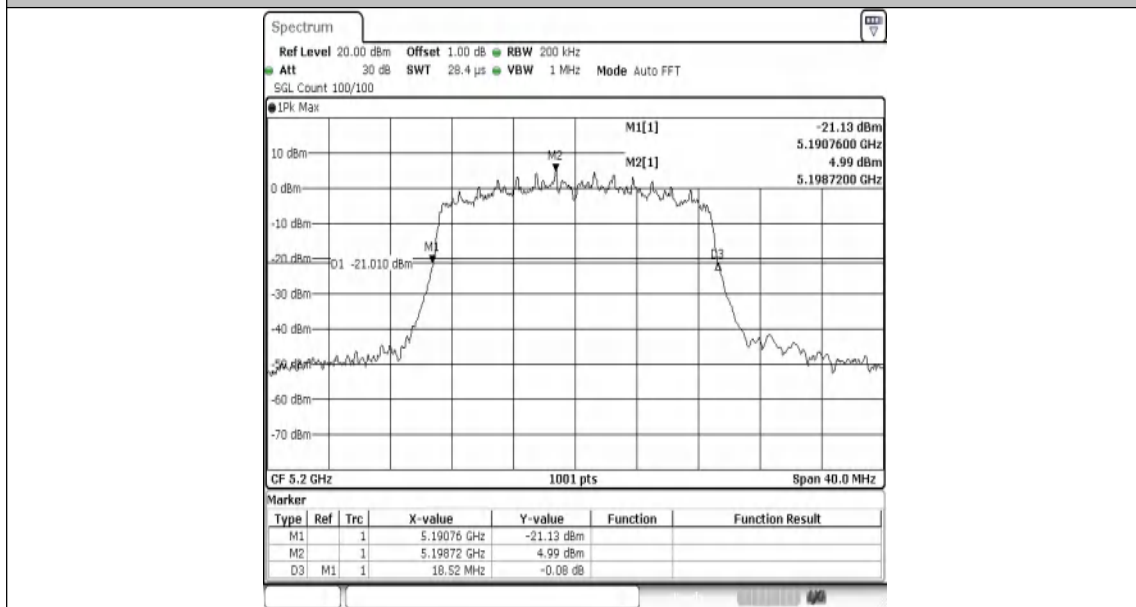


11N20SISO-Ant1-5200

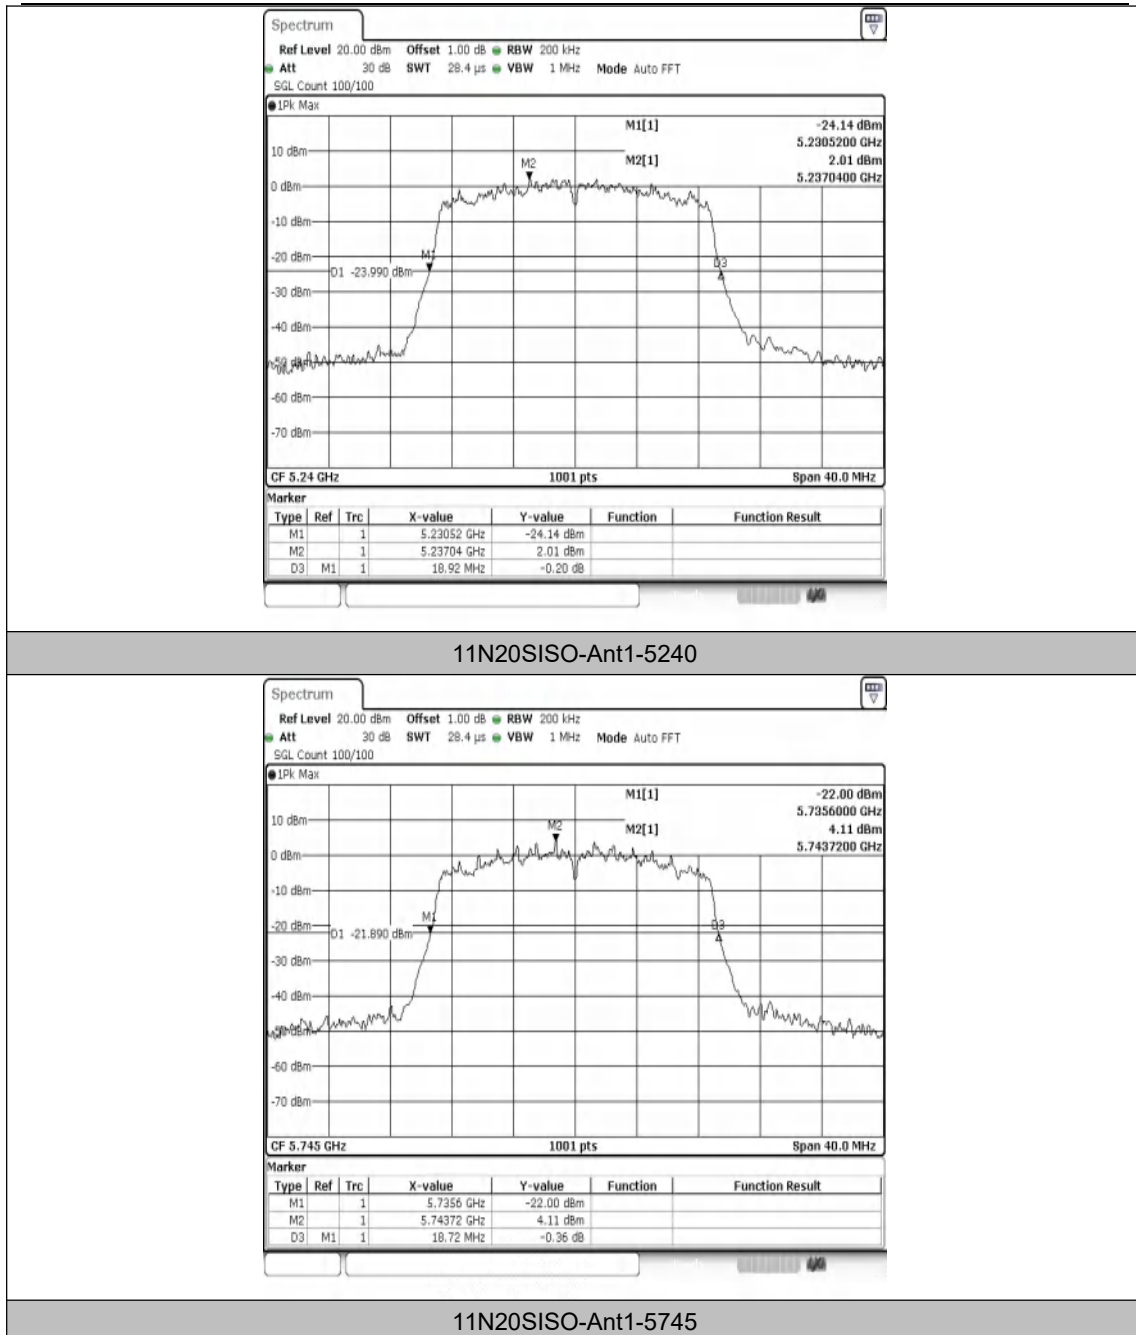


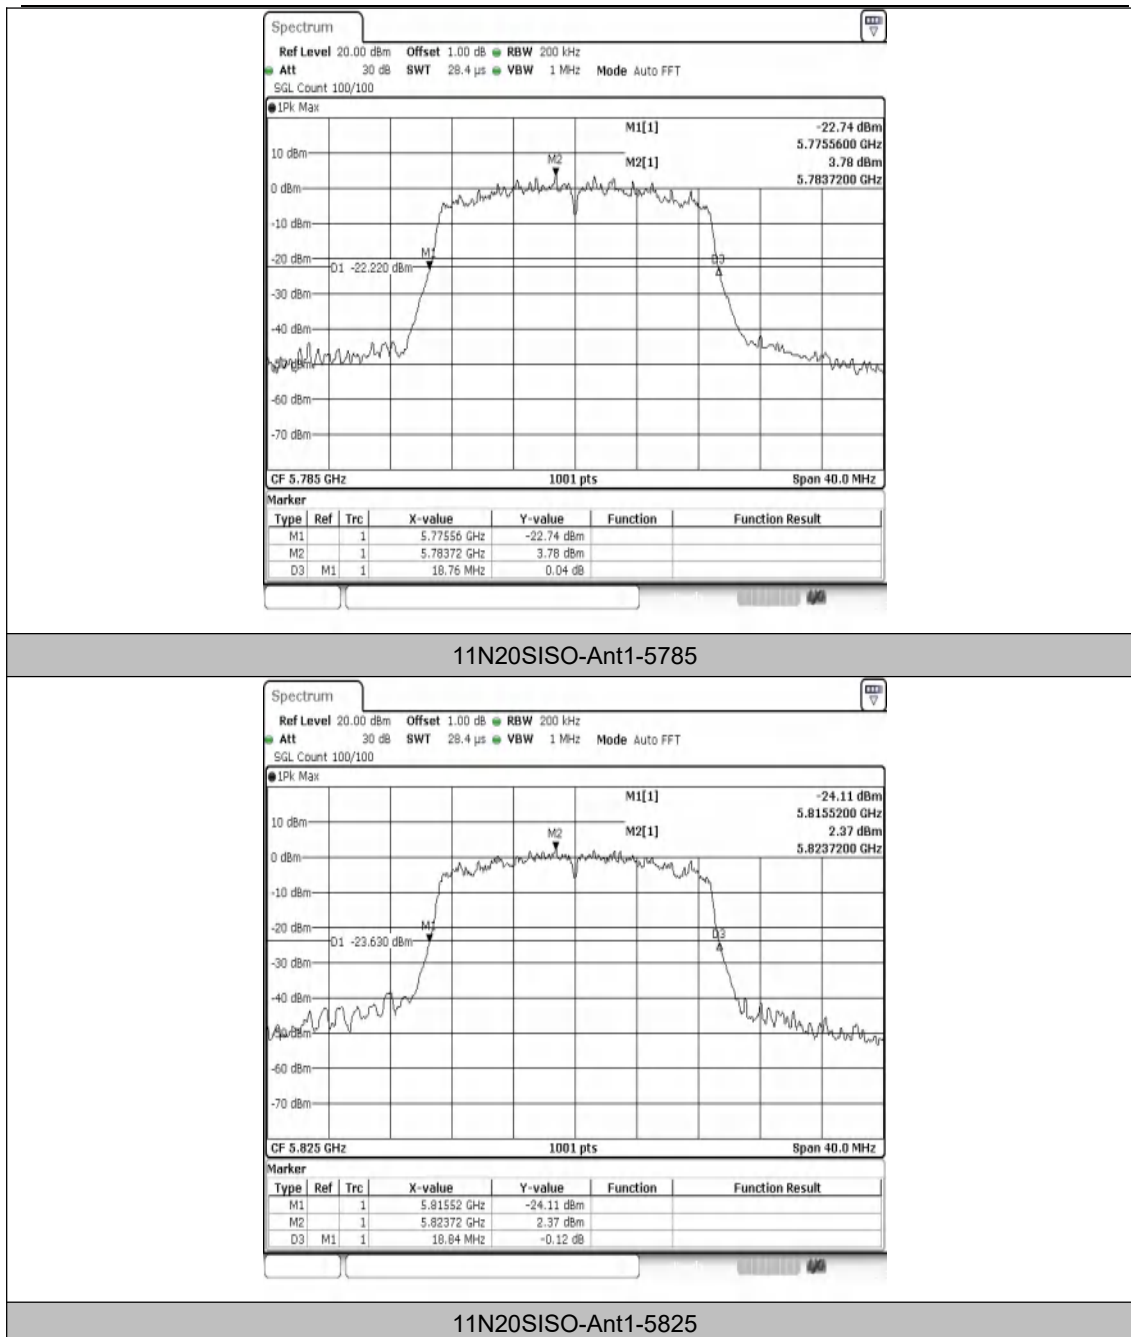

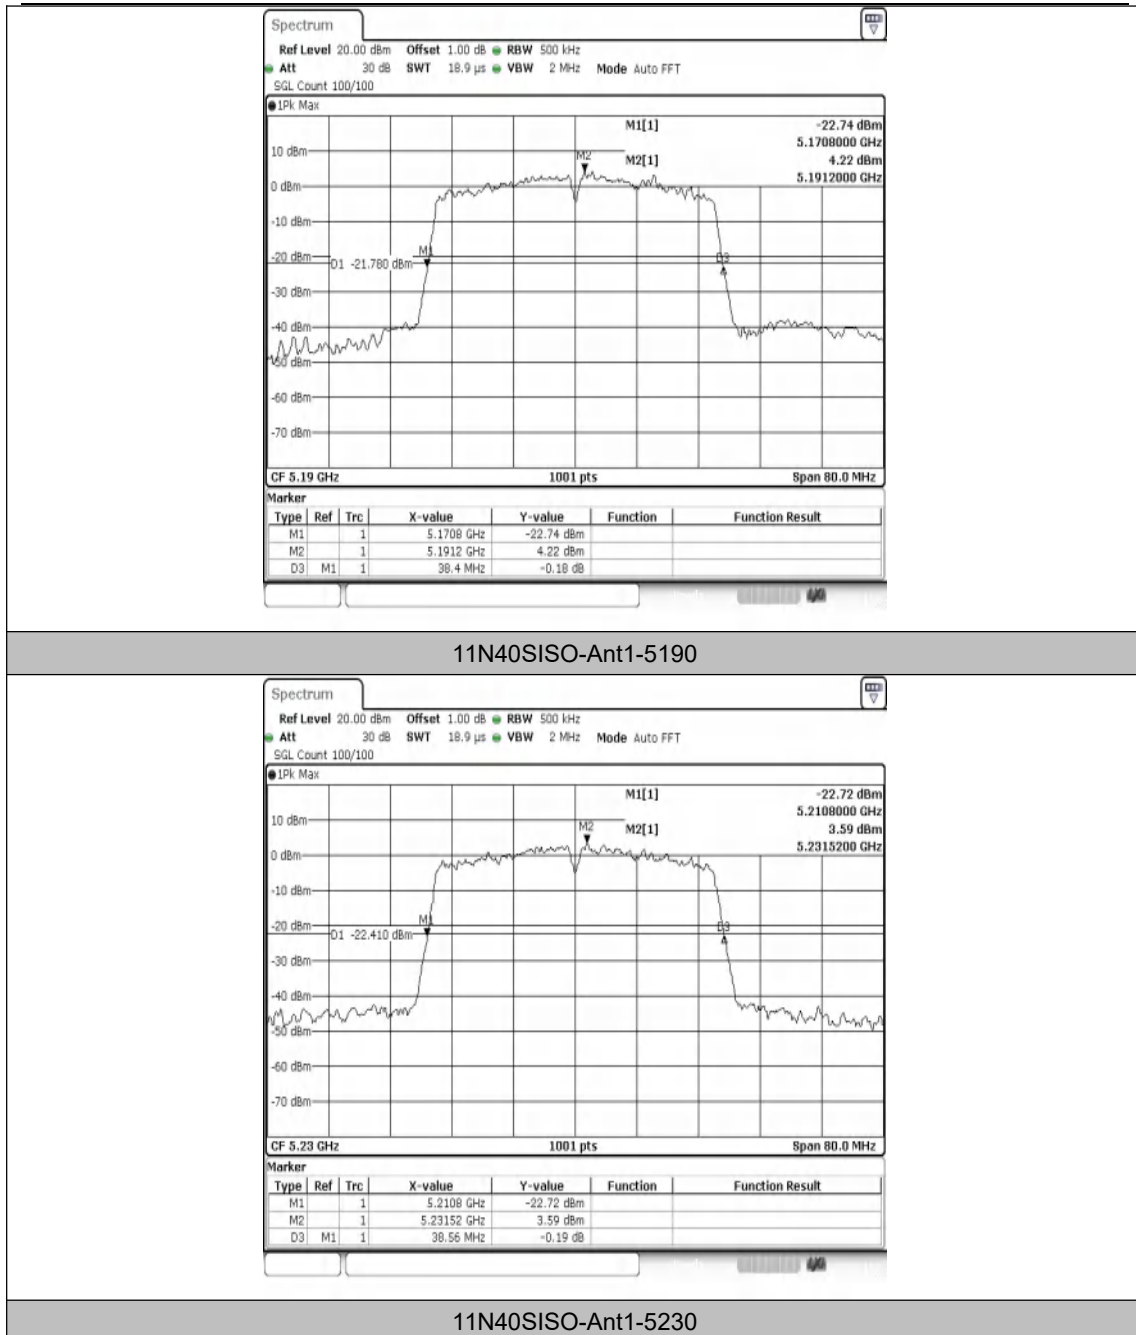


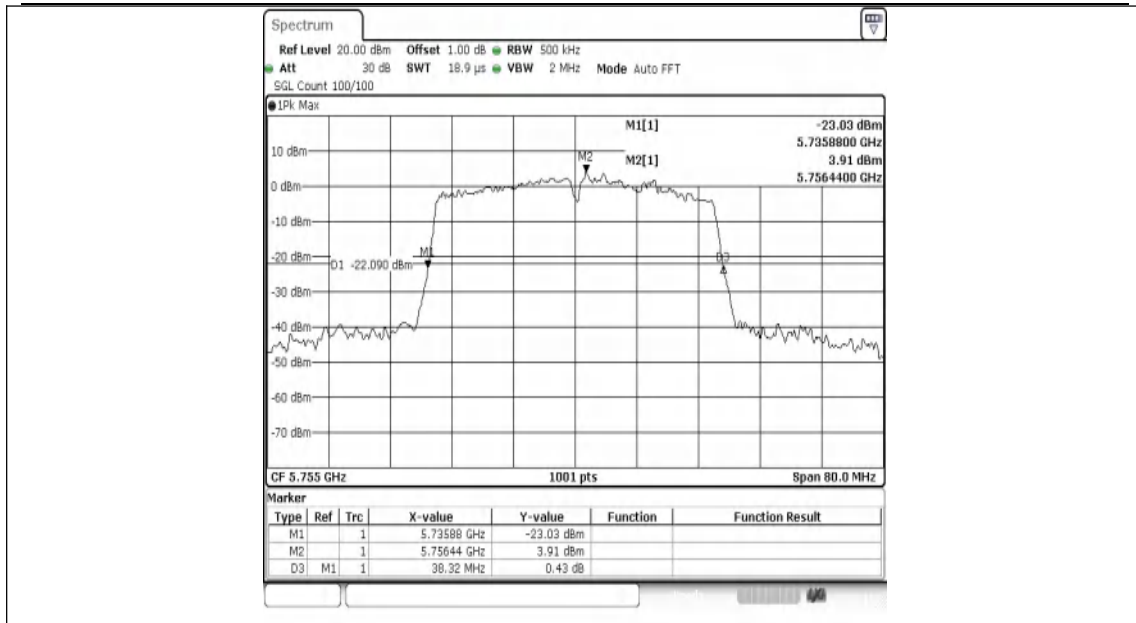


11N40SISO-Ant1-5755

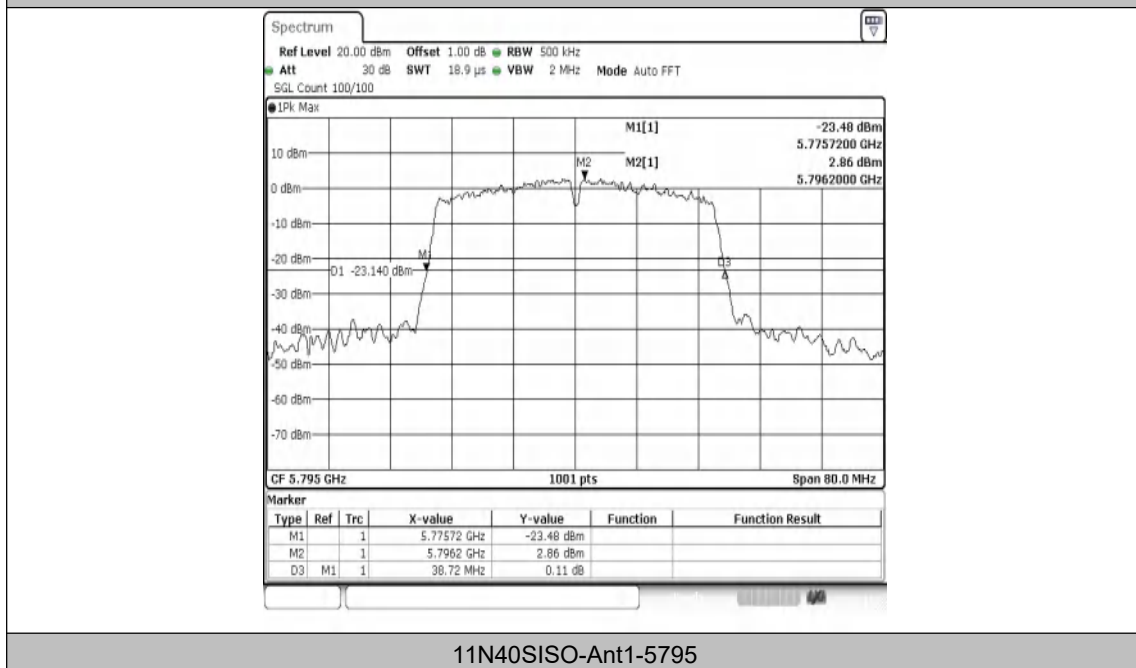


11N40SISO-Ant1-5795

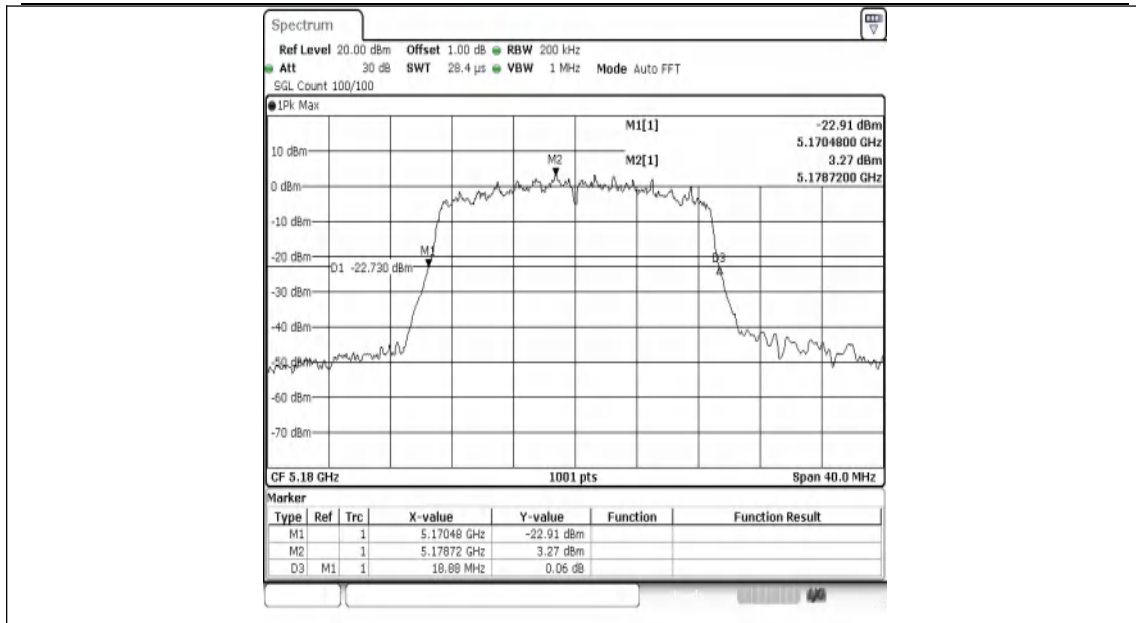


11AC20SISO-Ant1-5180

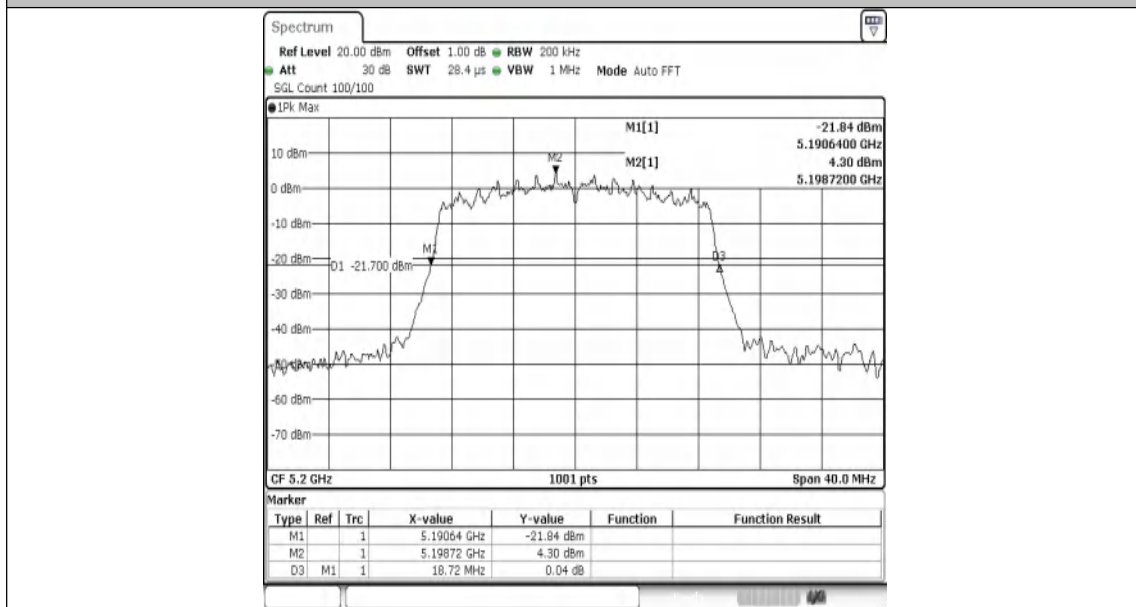


11AC20SISO-Ant1-5200

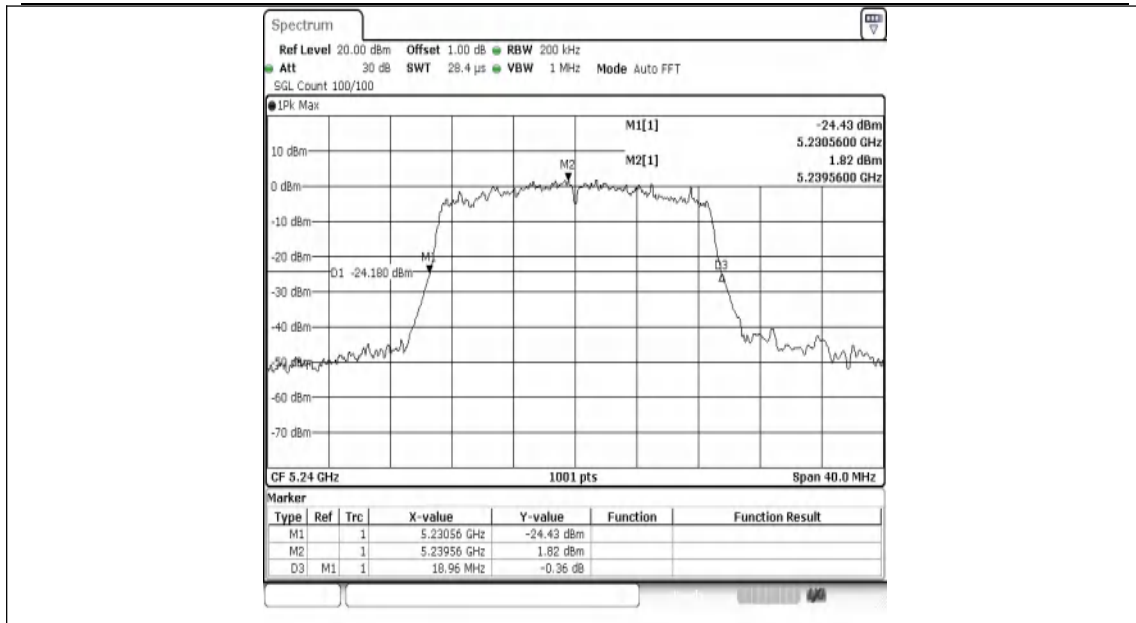

11AC20SISO-Ant1-5240

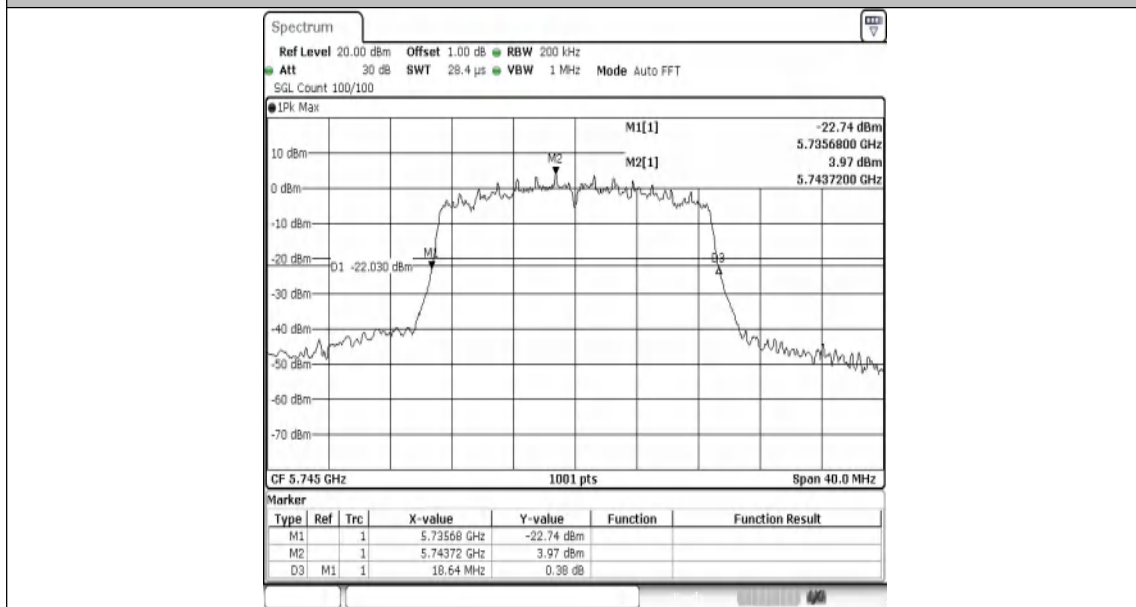


11AC20SISO-Ant1-5745

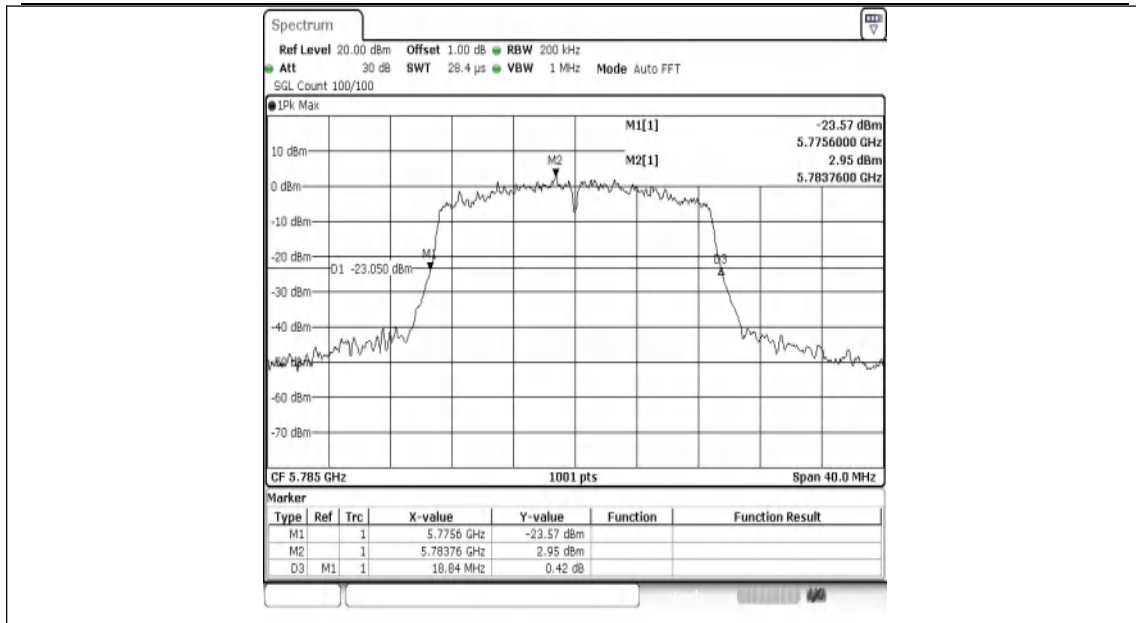


11AC20SISO-Ant1-5785




11AC20SISO-Ant1-5825

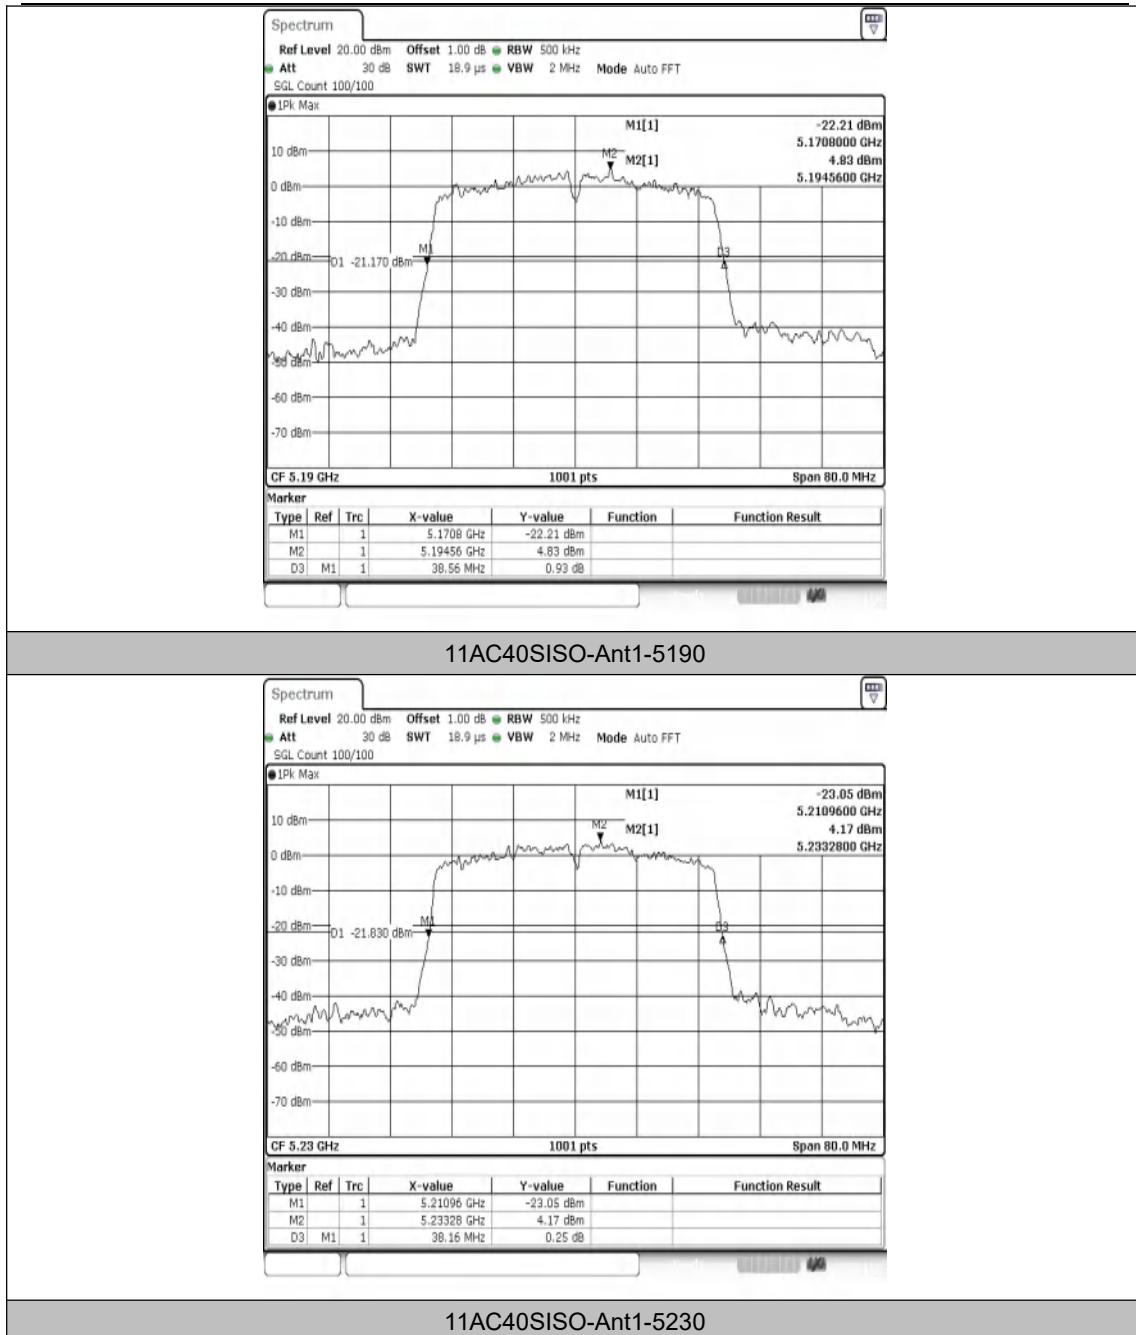


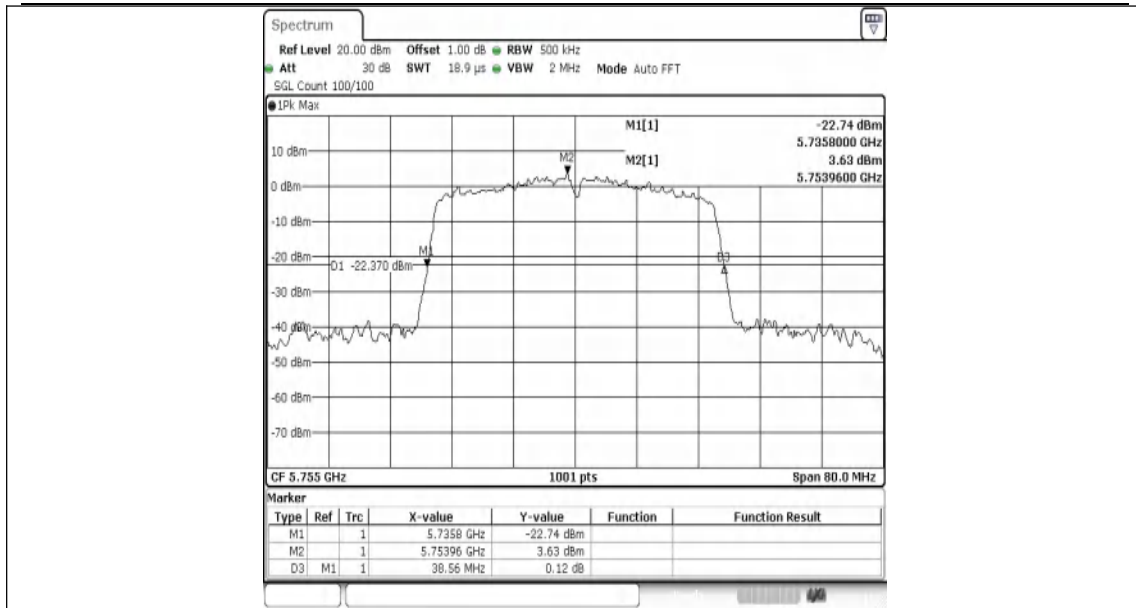

11AC40SISO-Ant1-5755

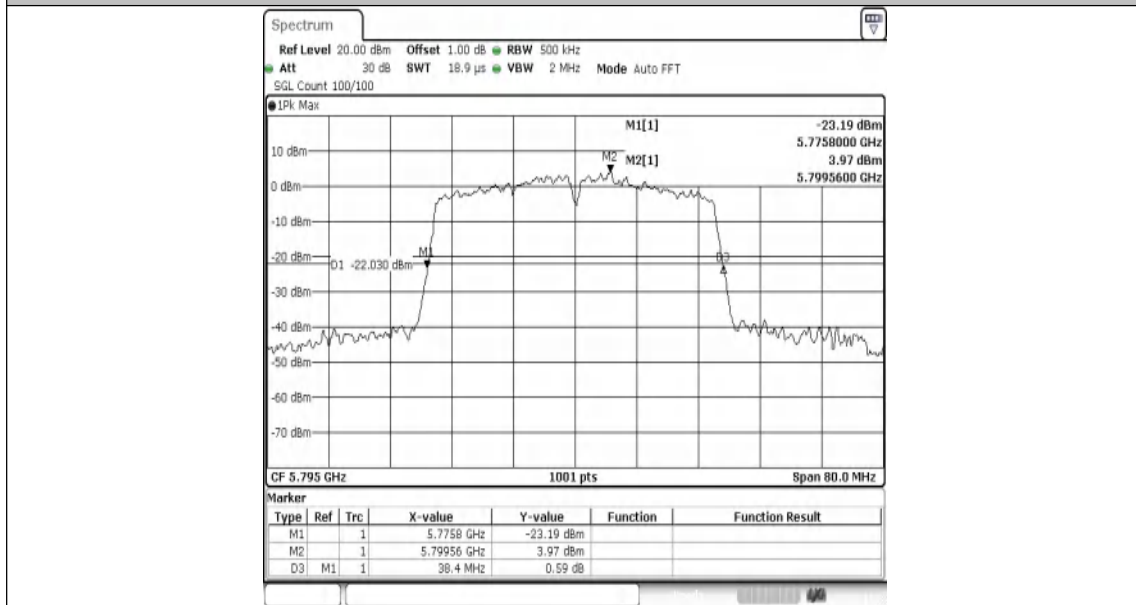


11AC40SISO-Ant1-5795

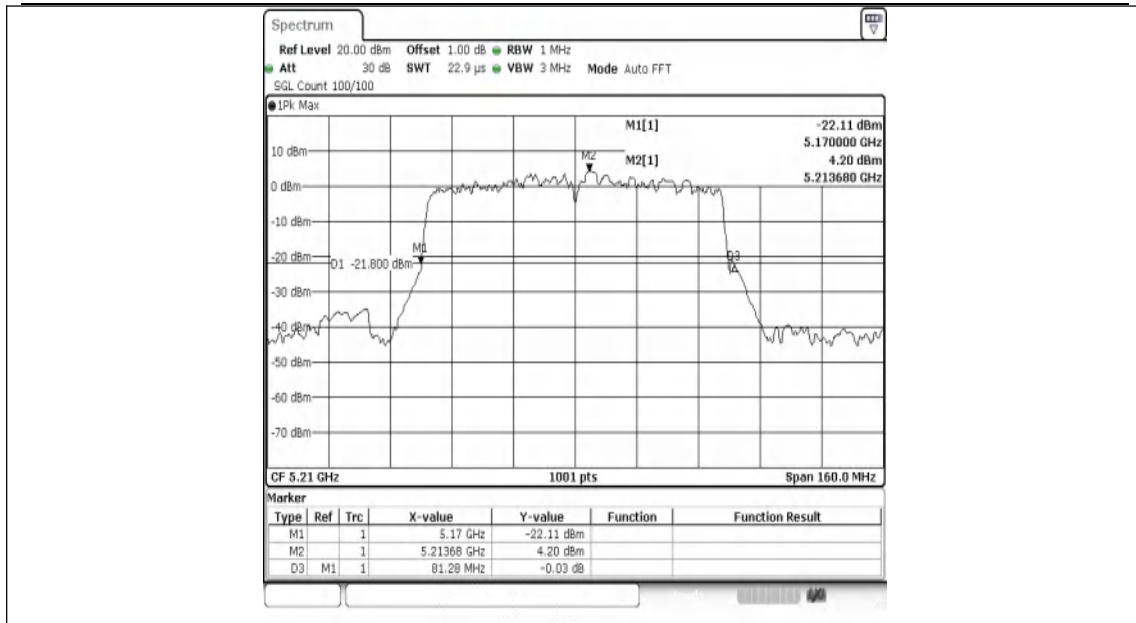


11AC80SISO-Ant1-5210




11AC80SISO-Ant1-5775

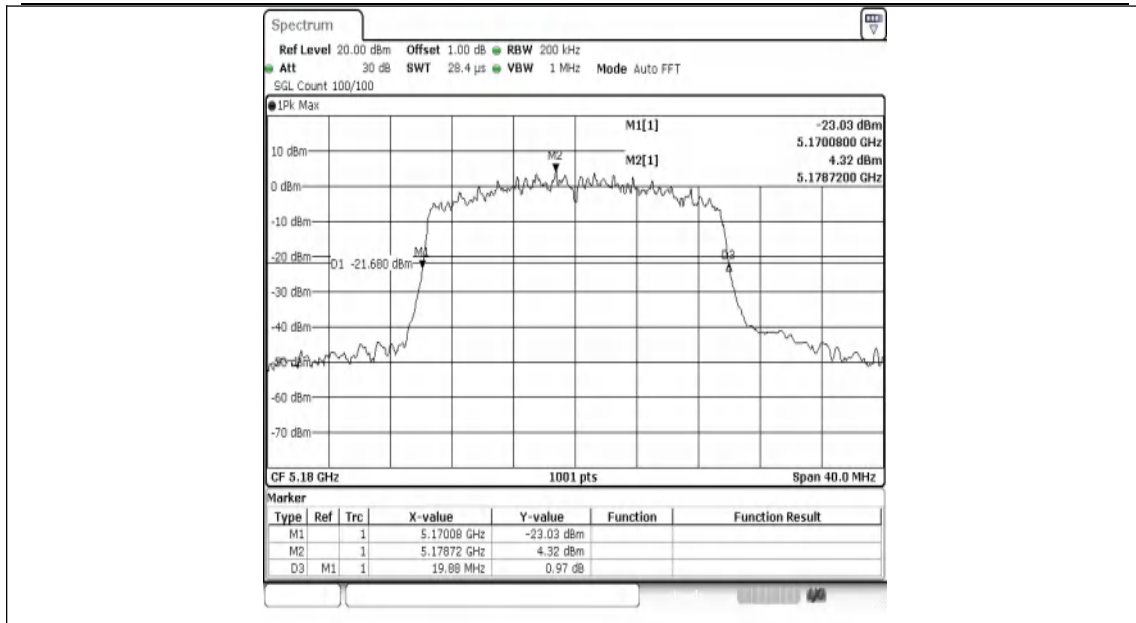


11AX20SISO-Ant1-5180

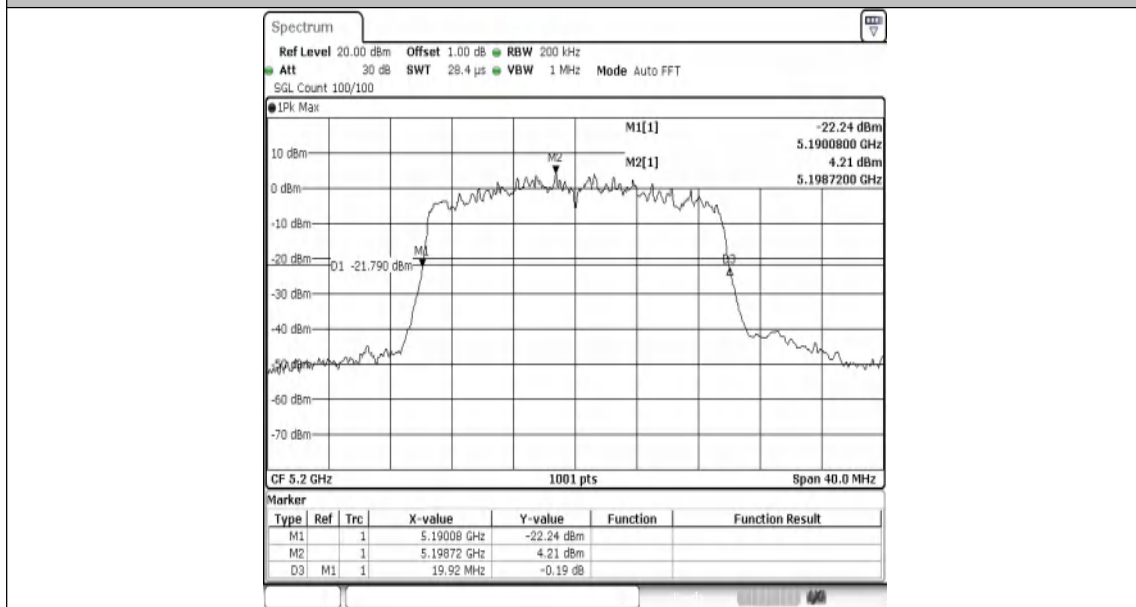


11AX20SISO-Ant1-5200

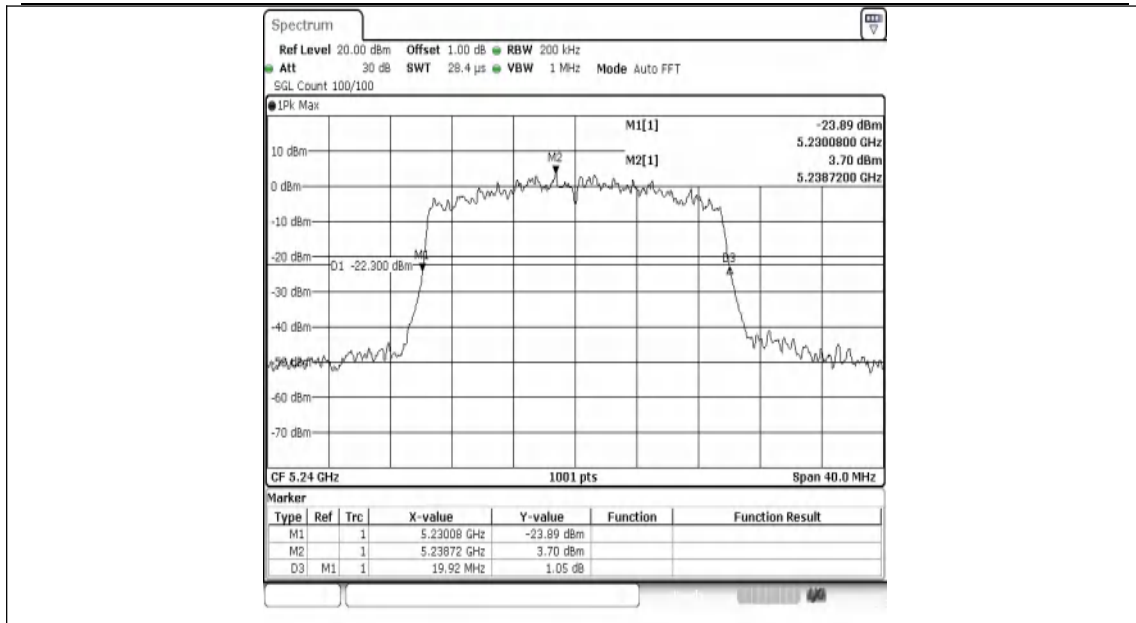


11AX20SISO-Ant1-5240

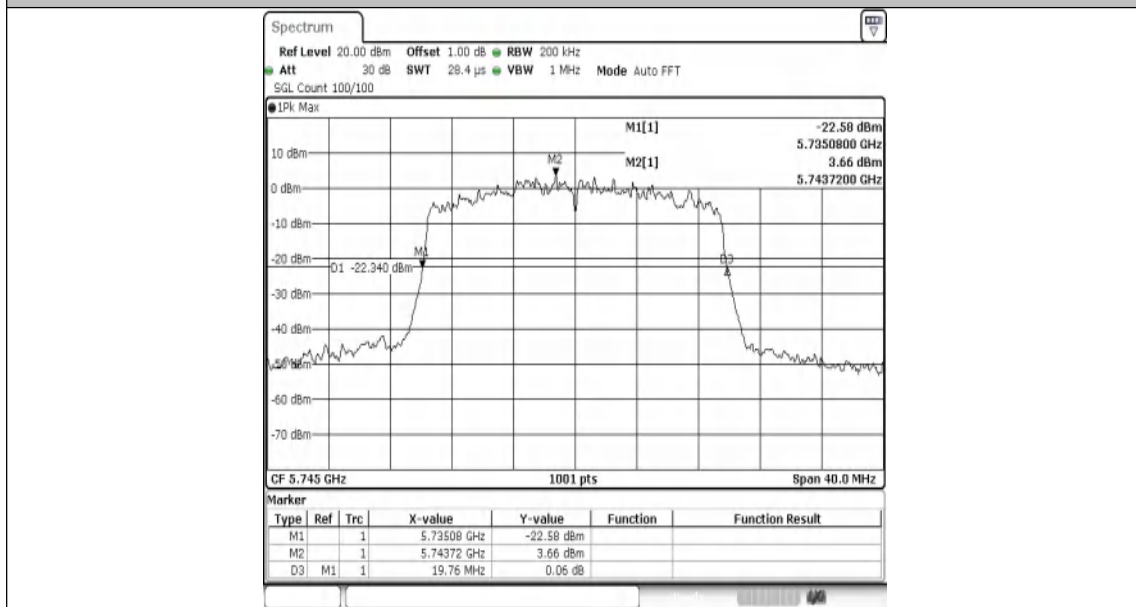


11AX20SISO-Ant1-5745

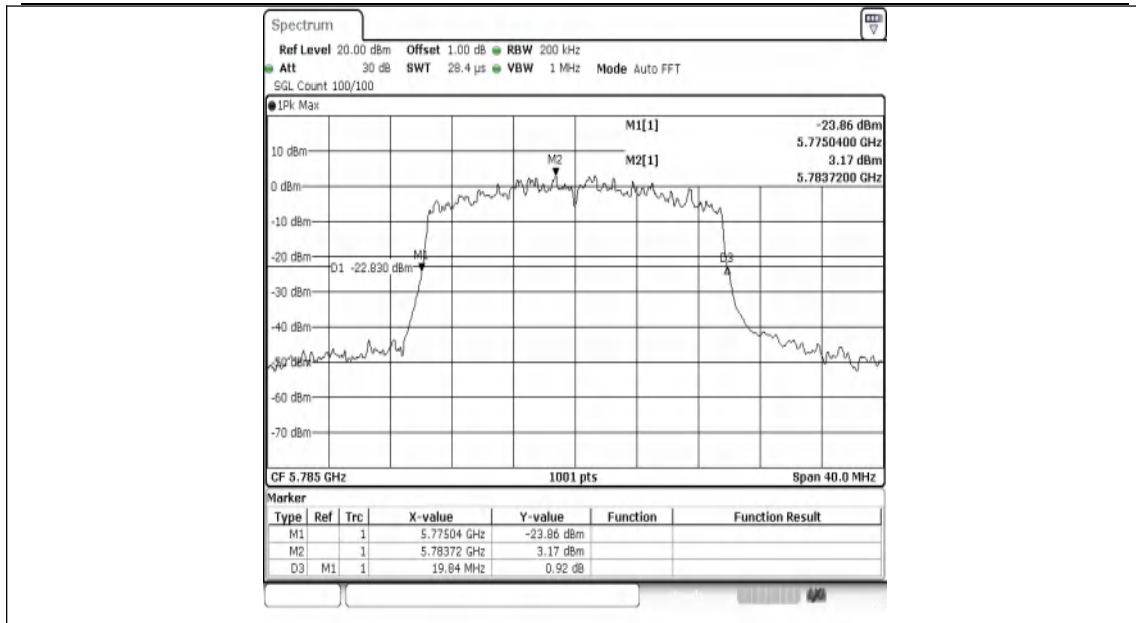


11AX20SISO-Ant1-5785

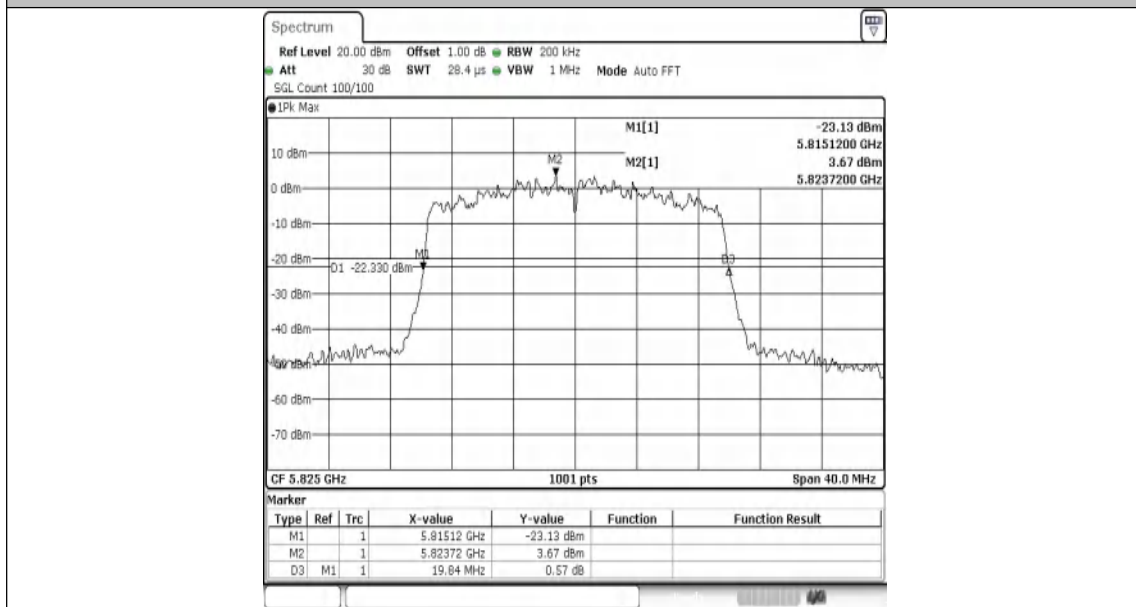


11AX20SISO-Ant1-5825

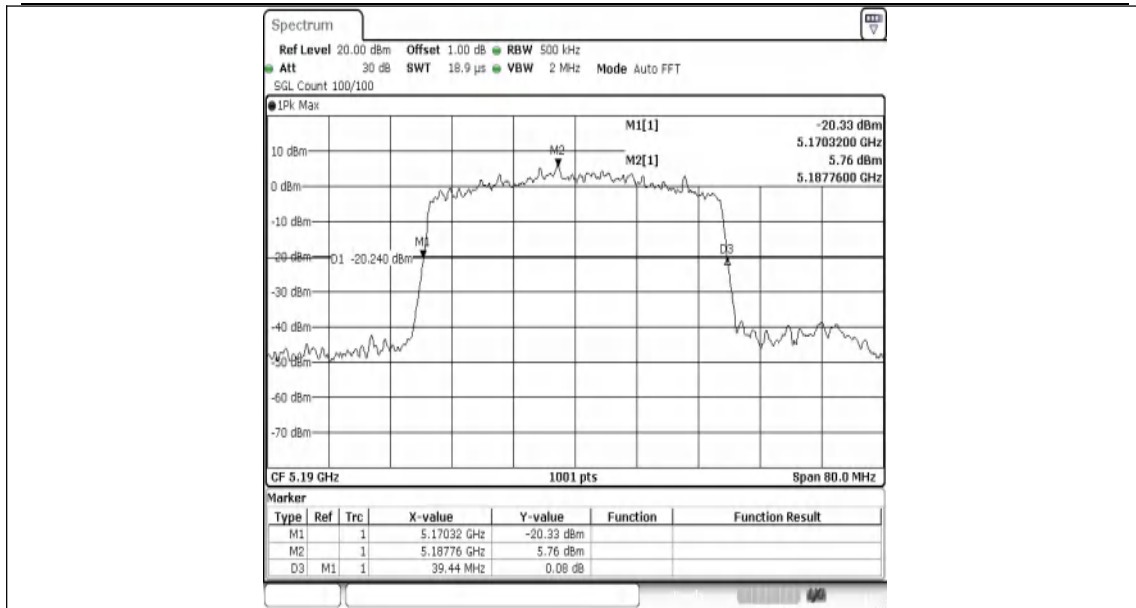


11AX40SISO-Ant1-5190

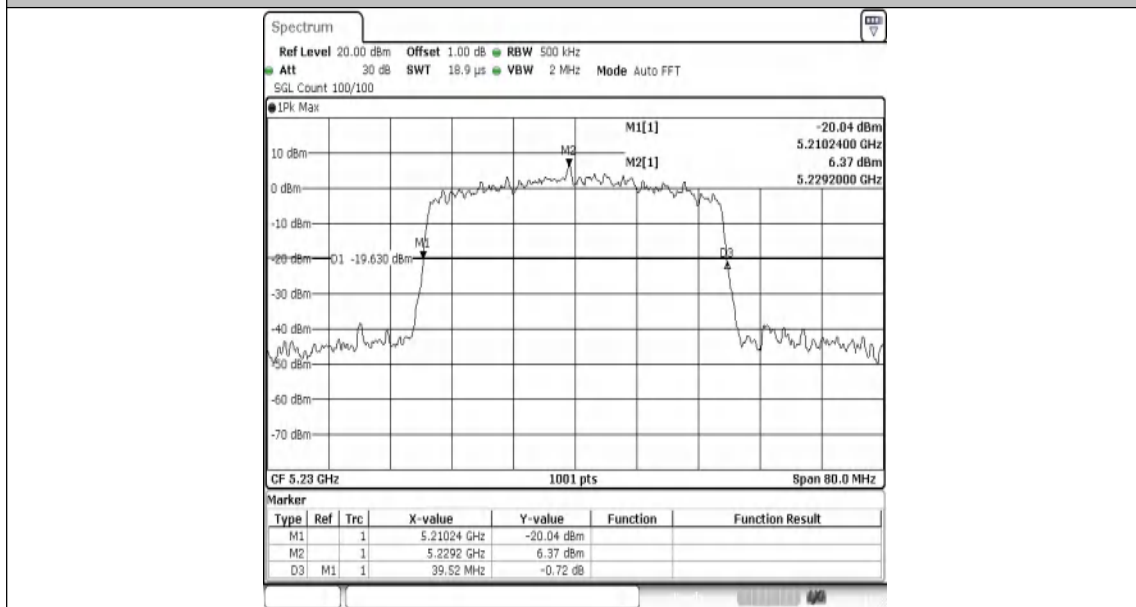


11AX40SISO-Ant1-5230

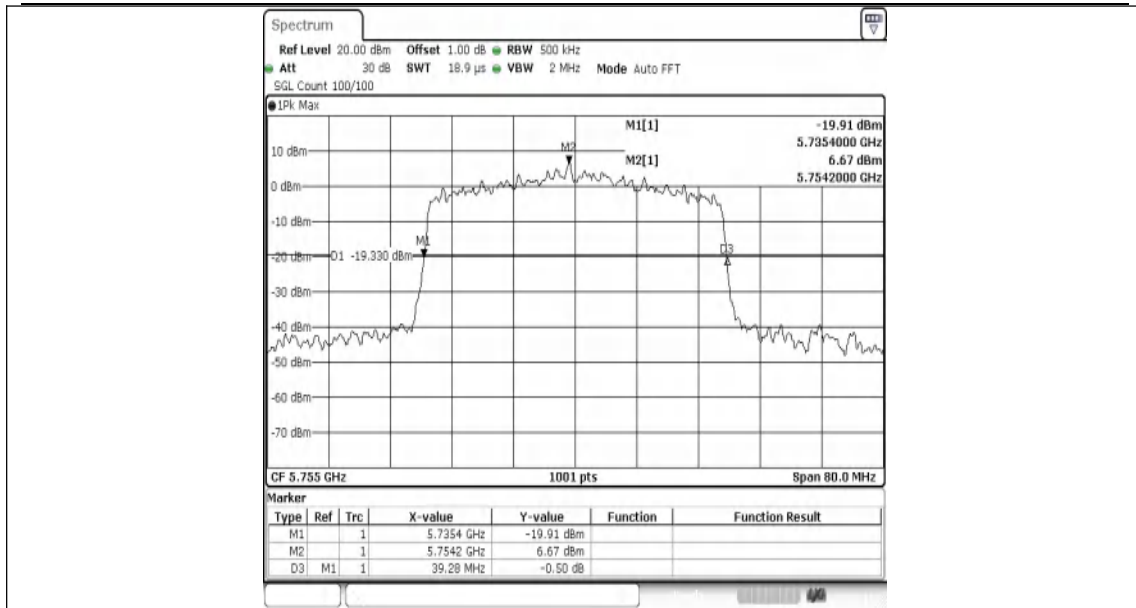

11AX40SISO-Ant1-5755

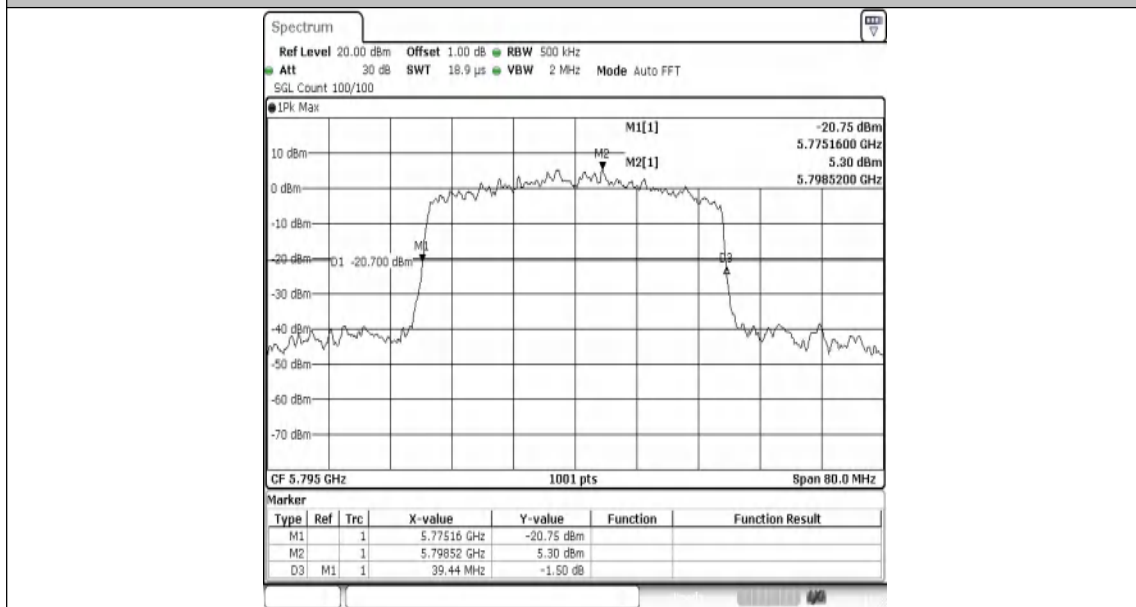

11AX40SISO-Ant1-5795

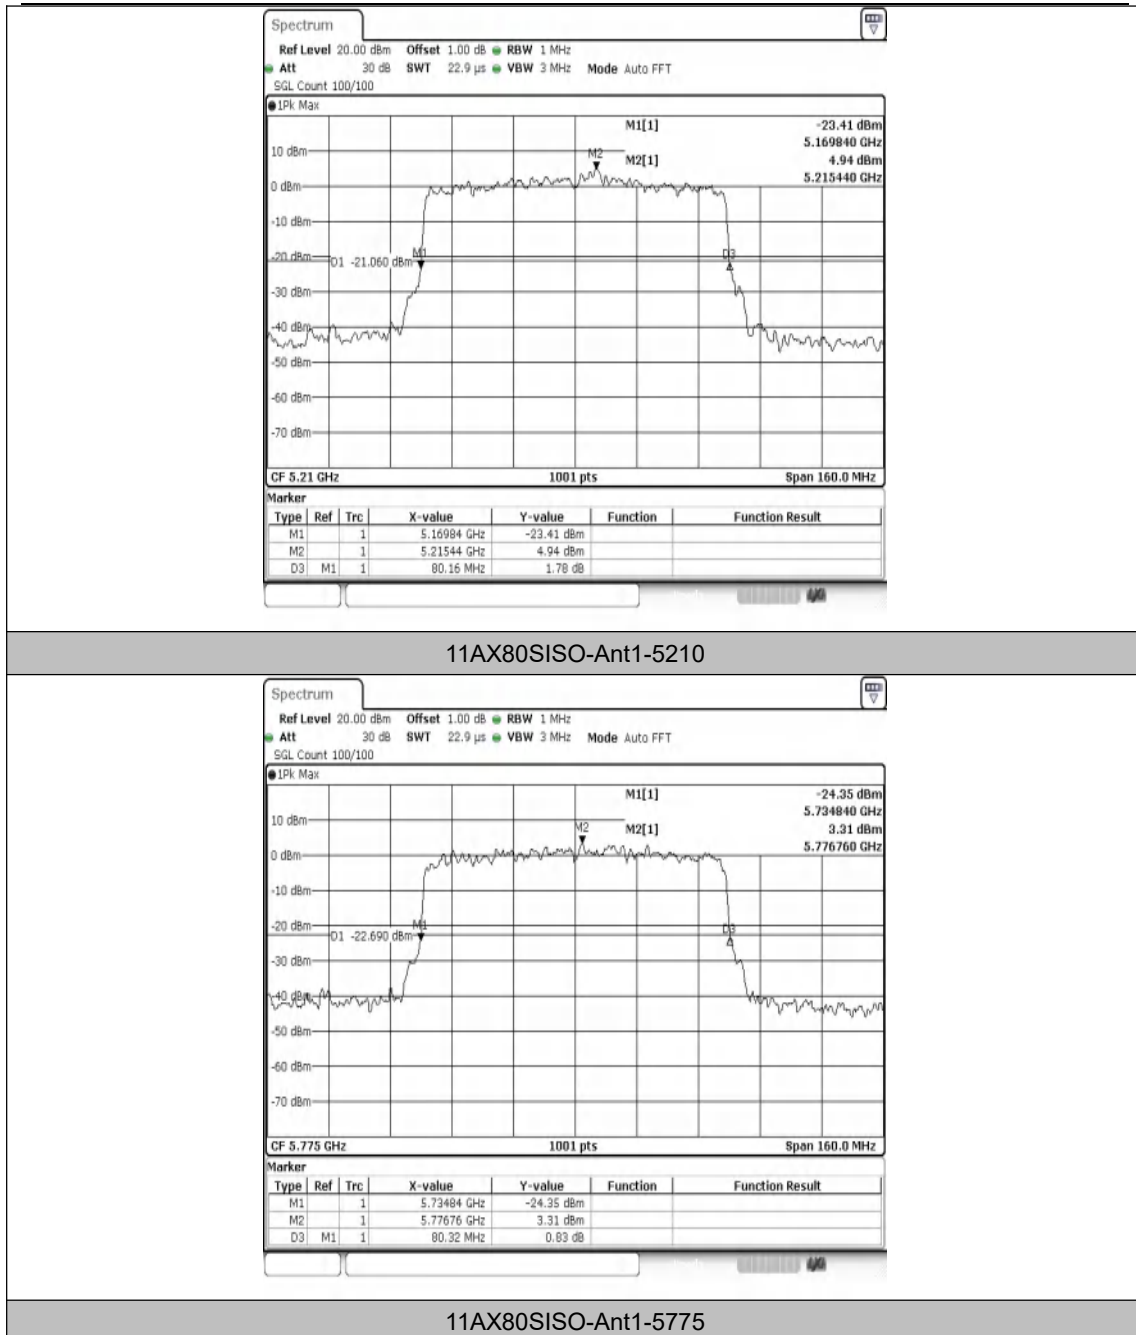

Appendix A2: 99% Occupied Bandwidth

Test Result

Test Mode	Antenna	Frequency[MHz]	OCB [MHz]	FL[MHz]	FH[MHz]	Limit[MHz]	Verdict
11A	Ant1	5180	16.224	5171.8881	5188.1119	---	---
11A	Ant1	5200	16.184	5191.8881	5208.0719	---	---
11A	Ant1	5240	16.184	5231.8881	5248.0719	---	---
11A	Ant1	5745	16.144	5736.8881	5753.0320	---	---
11A	Ant1	5785	16.104	5776.8881	5792.9920	---	---
11A	Ant1	5825	16.184	5816.8482	5833.0320	---	---
11N20SISO	Ant1	5180	17.303	5171.3287	5188.6314	---	---
11N20SISO	Ant1	5200	17.263	5191.3287	5208.5914	---	---
11N20SISO	Ant1	5240	17.263	5231.3287	5248.5914	---	---
11N20SISO	Ant1	5745	17.303	5736.2887	5753.5914	---	---
11N20SISO	Ant1	5785	17.343	5776.2887	5793.6314	---	---
11N20SISO	Ant1	5825	17.303	5816.2887	5833.5914	---	---
11N40SISO	Ant1	5190	35.564	5172.1778	5207.7423	---	---
11N40SISO	Ant1	5230	35.644	5212.1778	5247.8222	---	---
11N40SISO	Ant1	5755	35.564	5737.1778	5772.7423	---	---
11N40SISO	Ant1	5795	35.564	5777.1778	5812.7423	---	---
11AC20SISO	Ant1	5180	17.343	5171.3287	5188.6713	---	---
11AC20SISO	Ant1	5200	17.383	5191.2887	5208.6713	---	---
11AC20SISO	Ant1	5240	17.383	5231.2887	5248.6713	---	---
11AC20SISO	Ant1	5745	17.423	5736.2488	5753.6713	---	---
11AC20SISO	Ant1	5785	17.383	5776.2887	5793.6713	---	---
11AC20SISO	Ant1	5825	17.343	5816.2887	5833.6314	---	---
11AC40SISO	Ant1	5190	35.325	5172.3377	5207.6623	---	---
11AC40SISO	Ant1	5230	35.564	5212.1778	5247.7423	---	---
11AC40SISO	Ant1	5755	35.564	5737.1778	5772.7423	---	---
11AC40SISO	Ant1	5795	35.485	5777.2577	5812.7423	---	---
11AC80SISO	Ant1	5210	76.084	5171.6384	5247.7223	---	---
11AC80SISO	Ant1	5775	75.924	5736.7982	5812.7223	---	---
11AX20SISO	Ant1	5180	18.581	5170.6494	5189.2308	---	---
11AX20SISO	Ant1	5200	18.581	5190.6494	5209.2308	---	---
11AX20SISO	Ant1	5240	18.581	5230.6893	5249.2707	---	---
11AX20SISO	Ant1	5745	18.581	5735.6494	5754.2308	---	---
11AX20SISO	Ant1	5785	18.581	5775.6494	5794.2308	---	---
11AX20SISO	Ant1	5825	18.581	5815.6094	5834.1908	---	---
11AX40SISO	Ant1	5190	36.683	5171.6184	5208.3017	---	---
11AX40SISO	Ant1	5230	36.923	5211.5385	5248.4615	---	---

11AX40SISO	Ant1	5755	36.923	5736.5385	5773.4615	---	---
11AX40SISO	Ant1	5795	37.003	5776.5385	5813.5415	---	---
11AX80SISO	Ant1	5210	76.563	5171.7982	5248.3616	---	---
11AX80SISO	Ant1	5775	76.563	5736.7982	5813.3616	---	---


Shenzhen Anbotek Compliance Laboratory Limited


Address: Sogood Industrial Zone Laboratory & 1/F. of Building D, Sogood Science and Technology Park,
Sanwei Community, Hangcheng Subdistrict, Bao'an District, Shenzhen, Guangdong, China
Tel:(86)0755-26066440 Email:service@anbotek.com



Hotline
400-003-0500
www.anbotek.com

Test Graphs

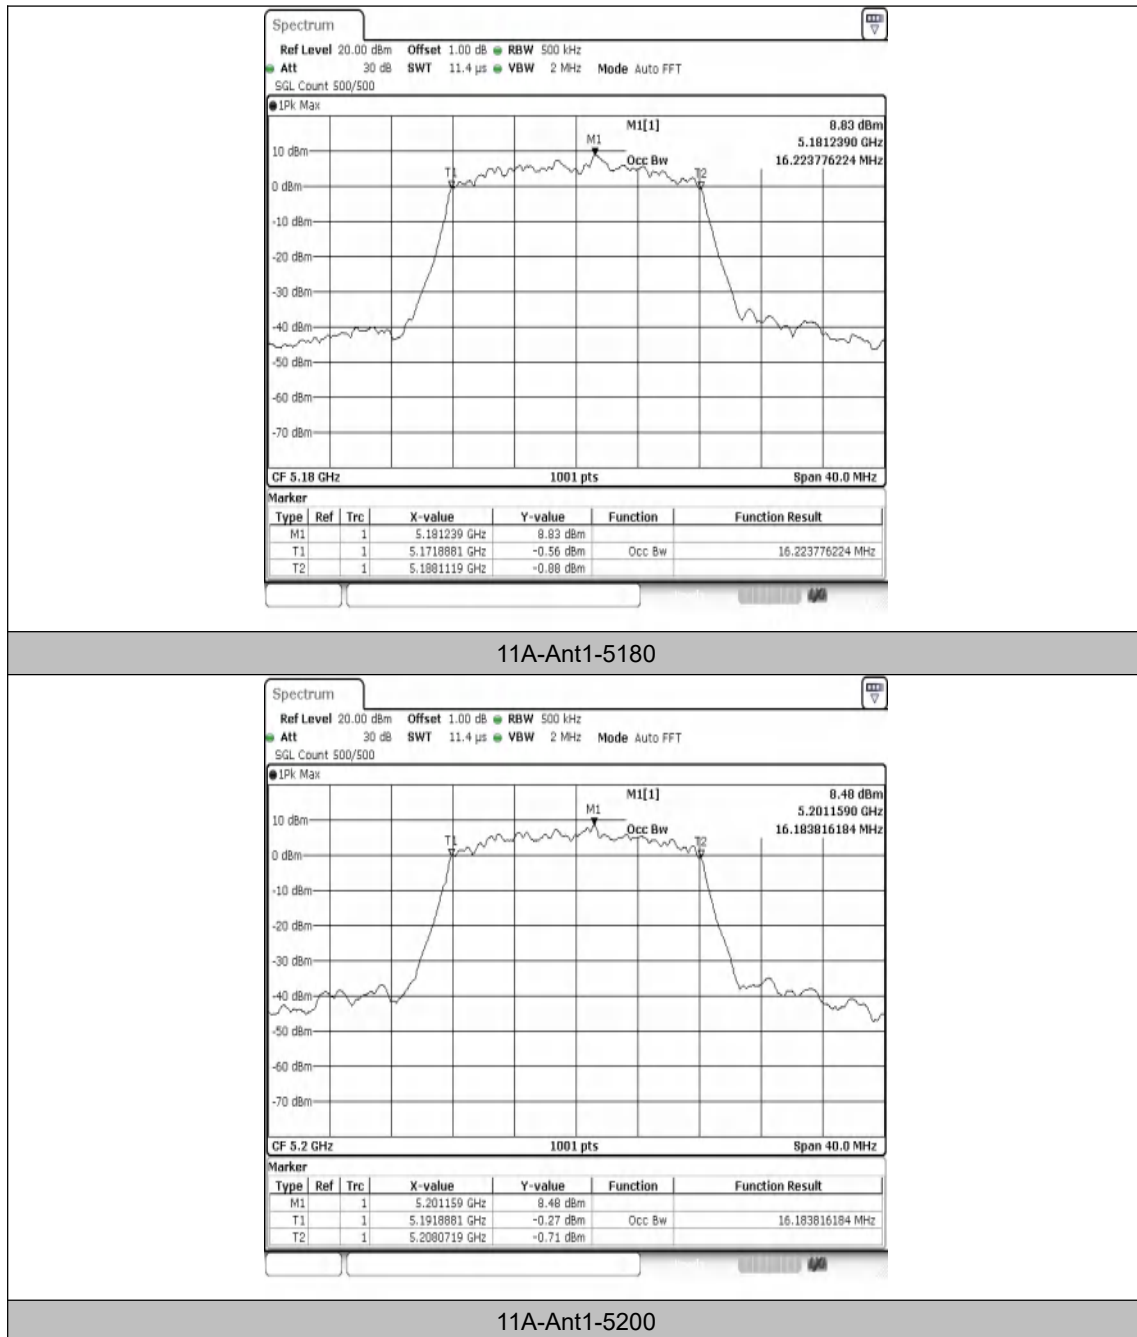


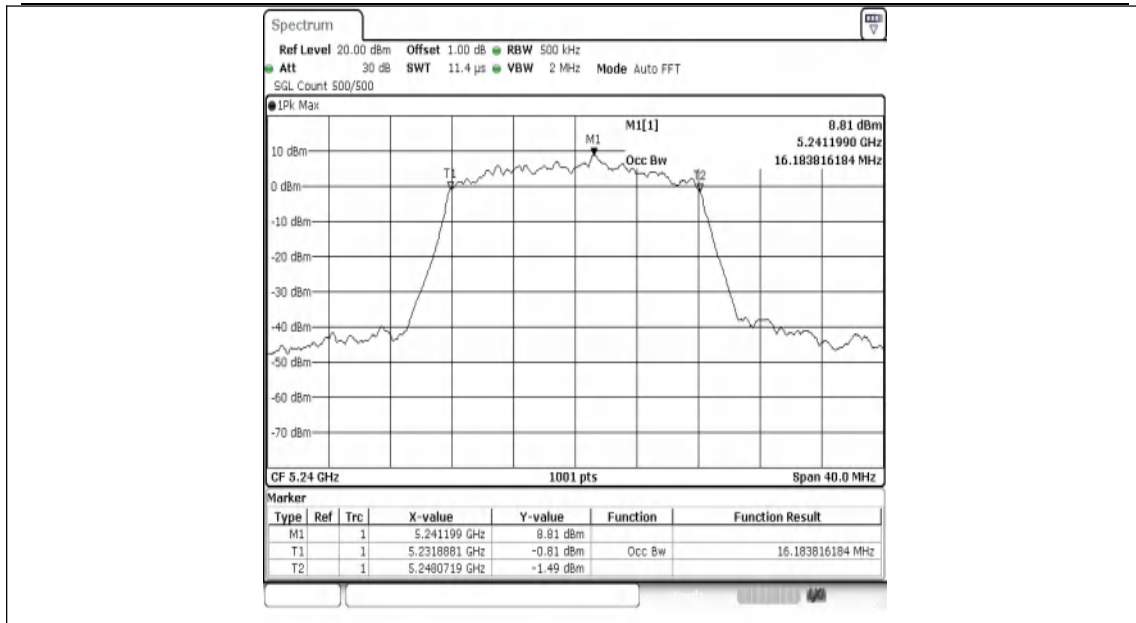


11A-Ant1-5240




11A-Ant1-5745

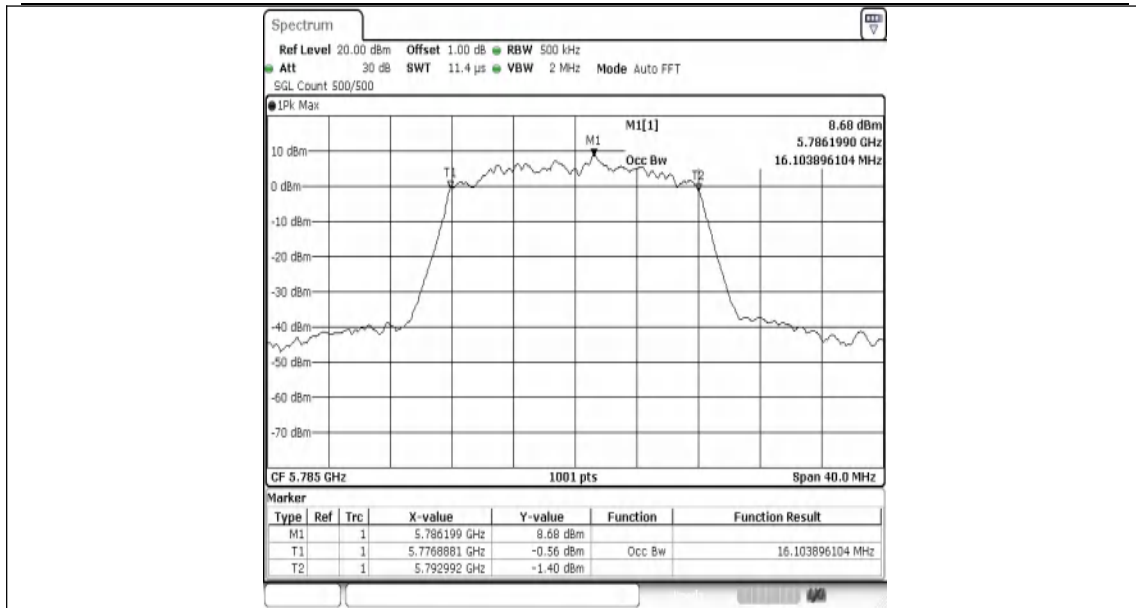


11A-Ant1-5785

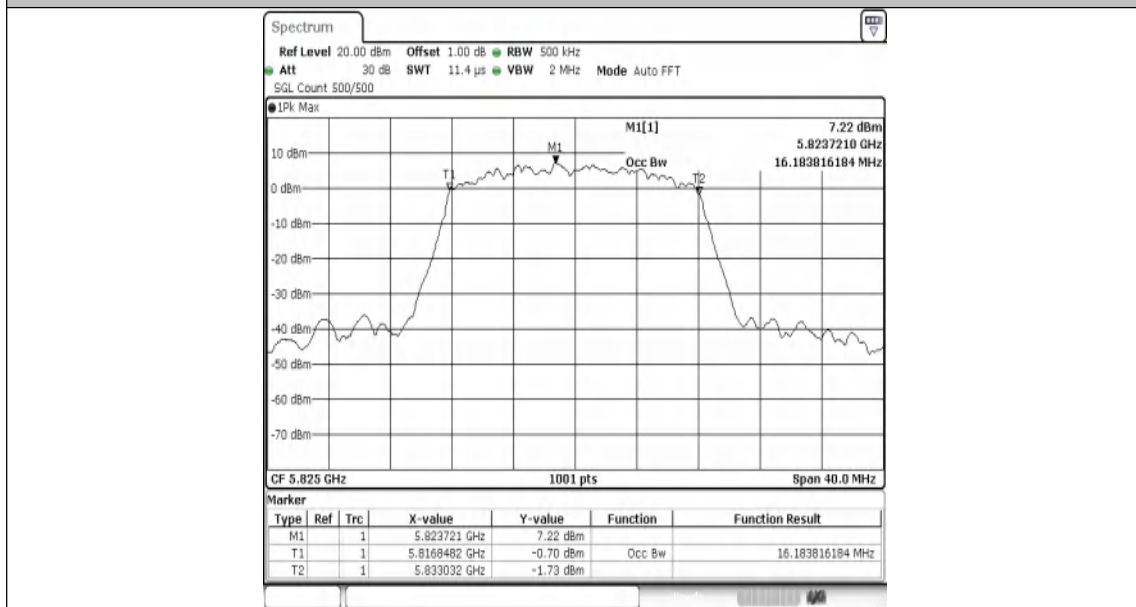


11A-Ant1-5825

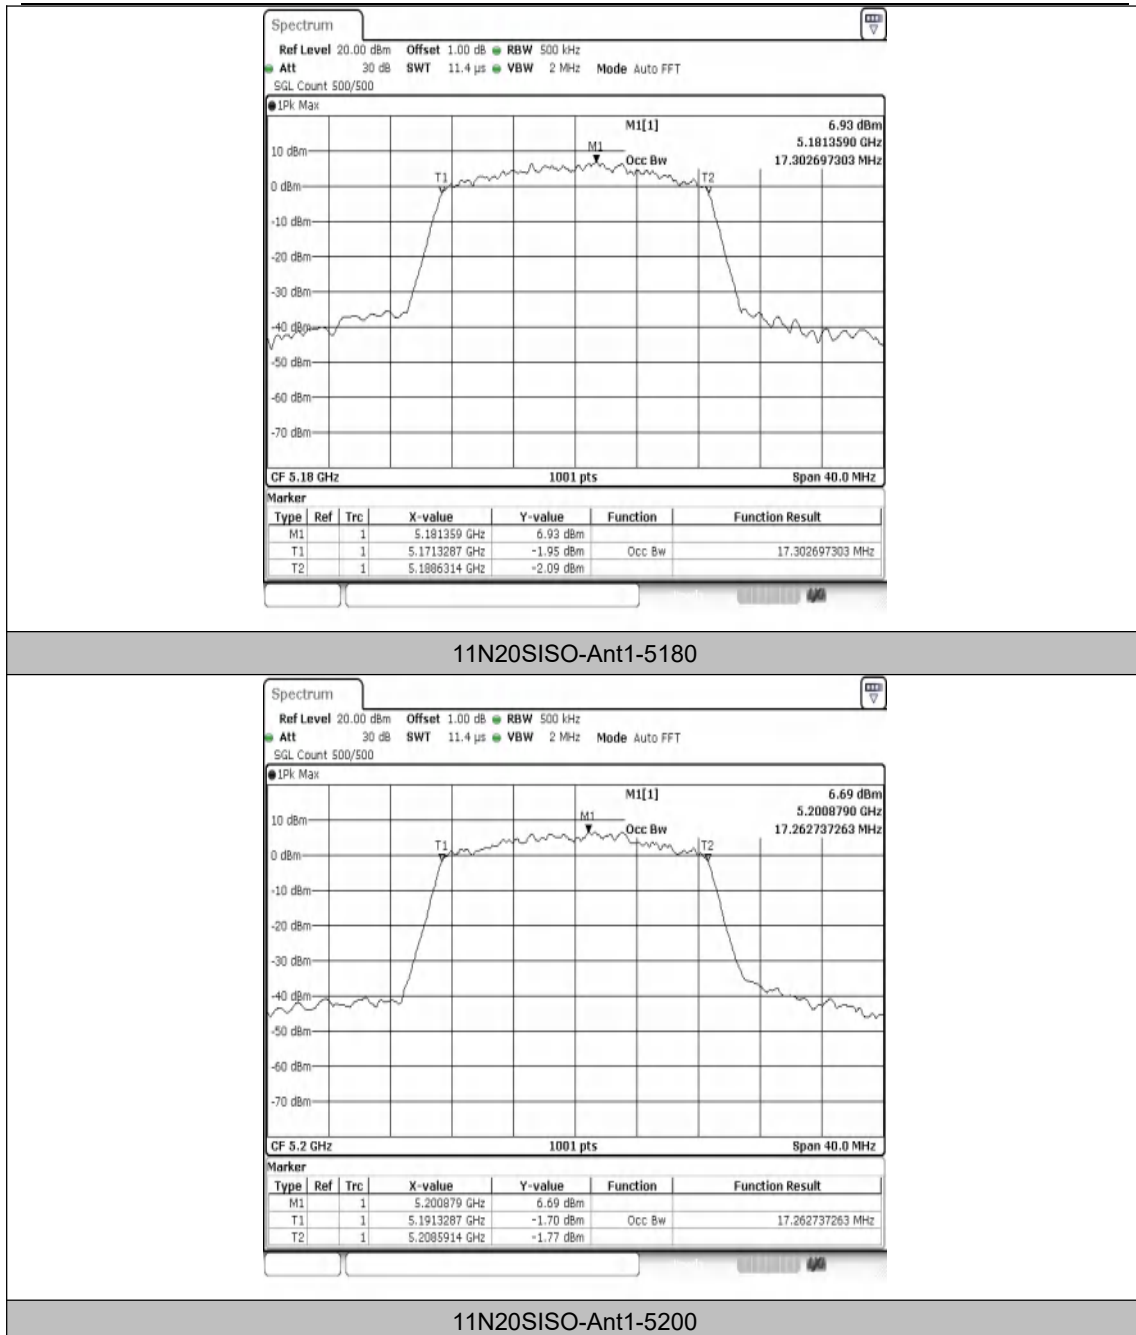


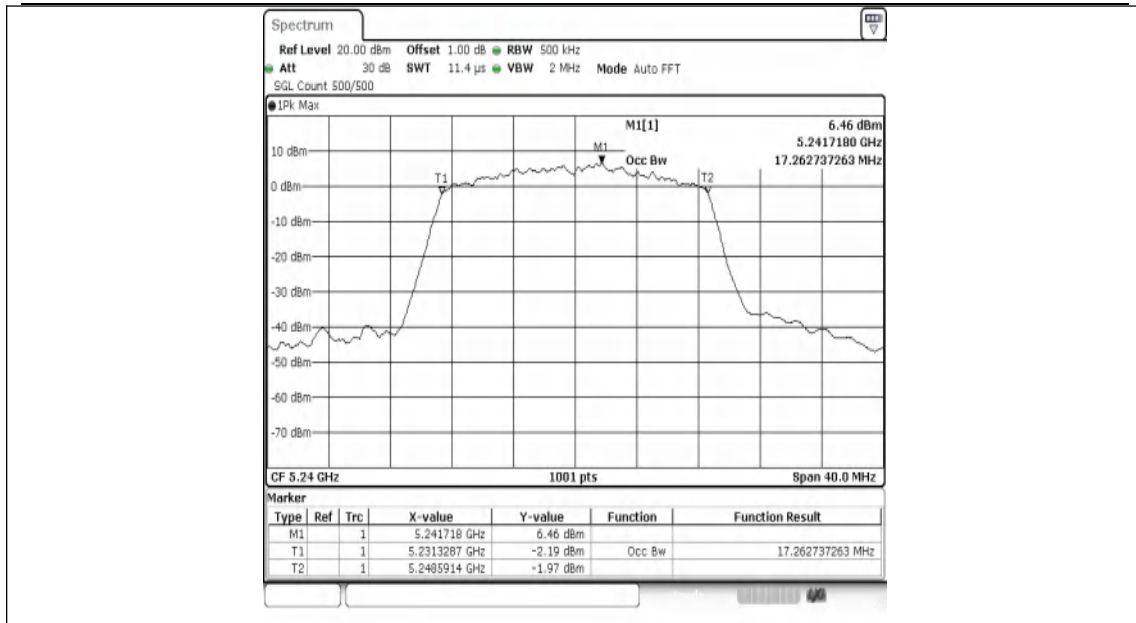


11N20SISO-Ant1-5240

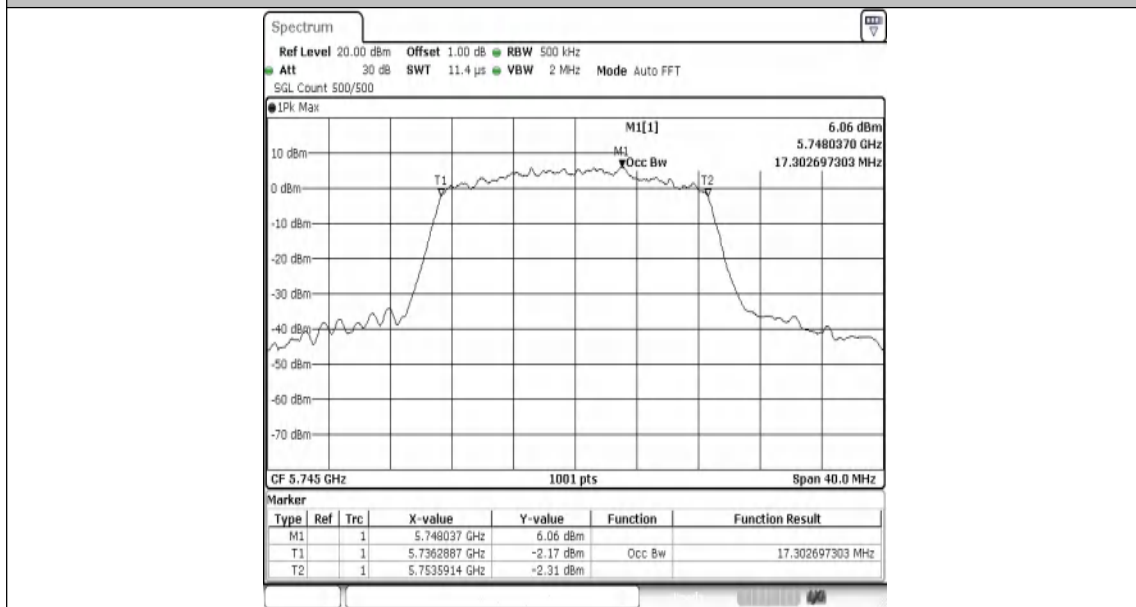


11N20SISO-Ant1-5745

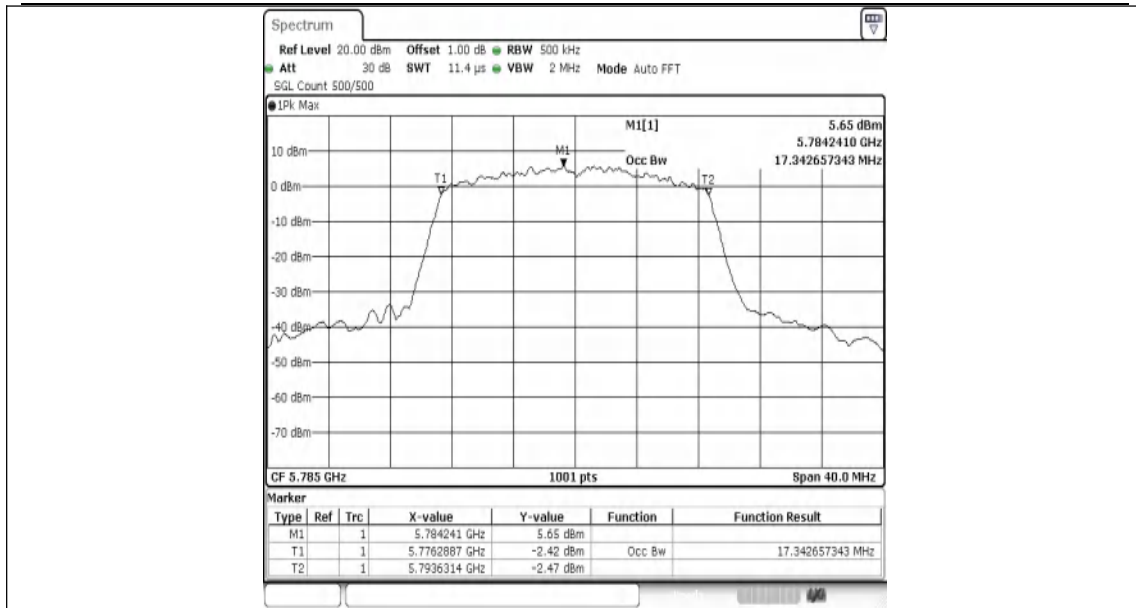


11N20SISO-Ant1-5785

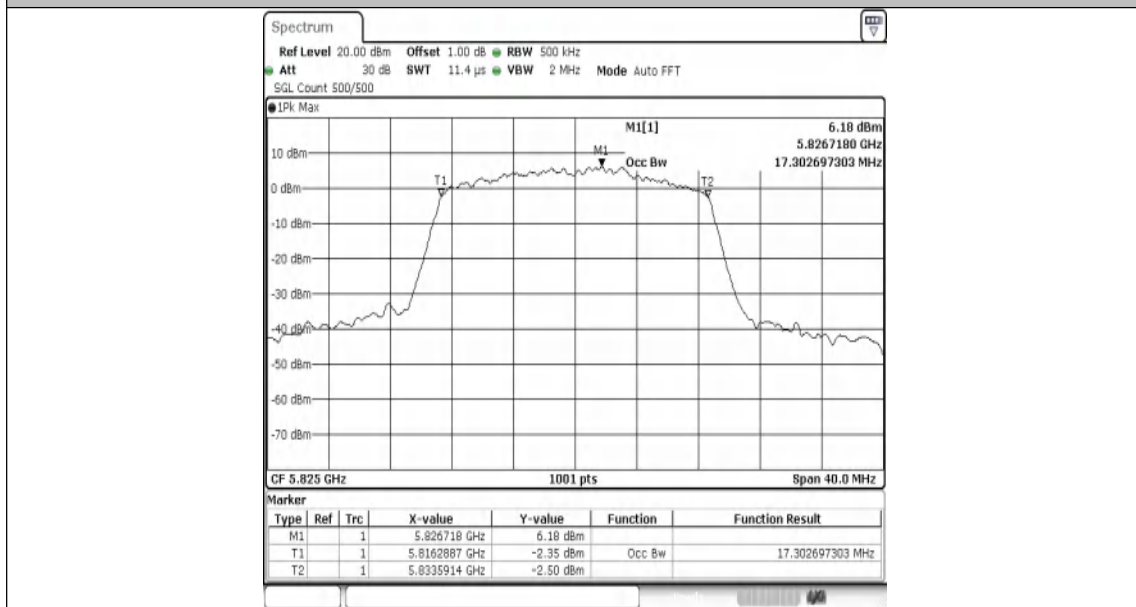


11N20SISO-Ant1-5825

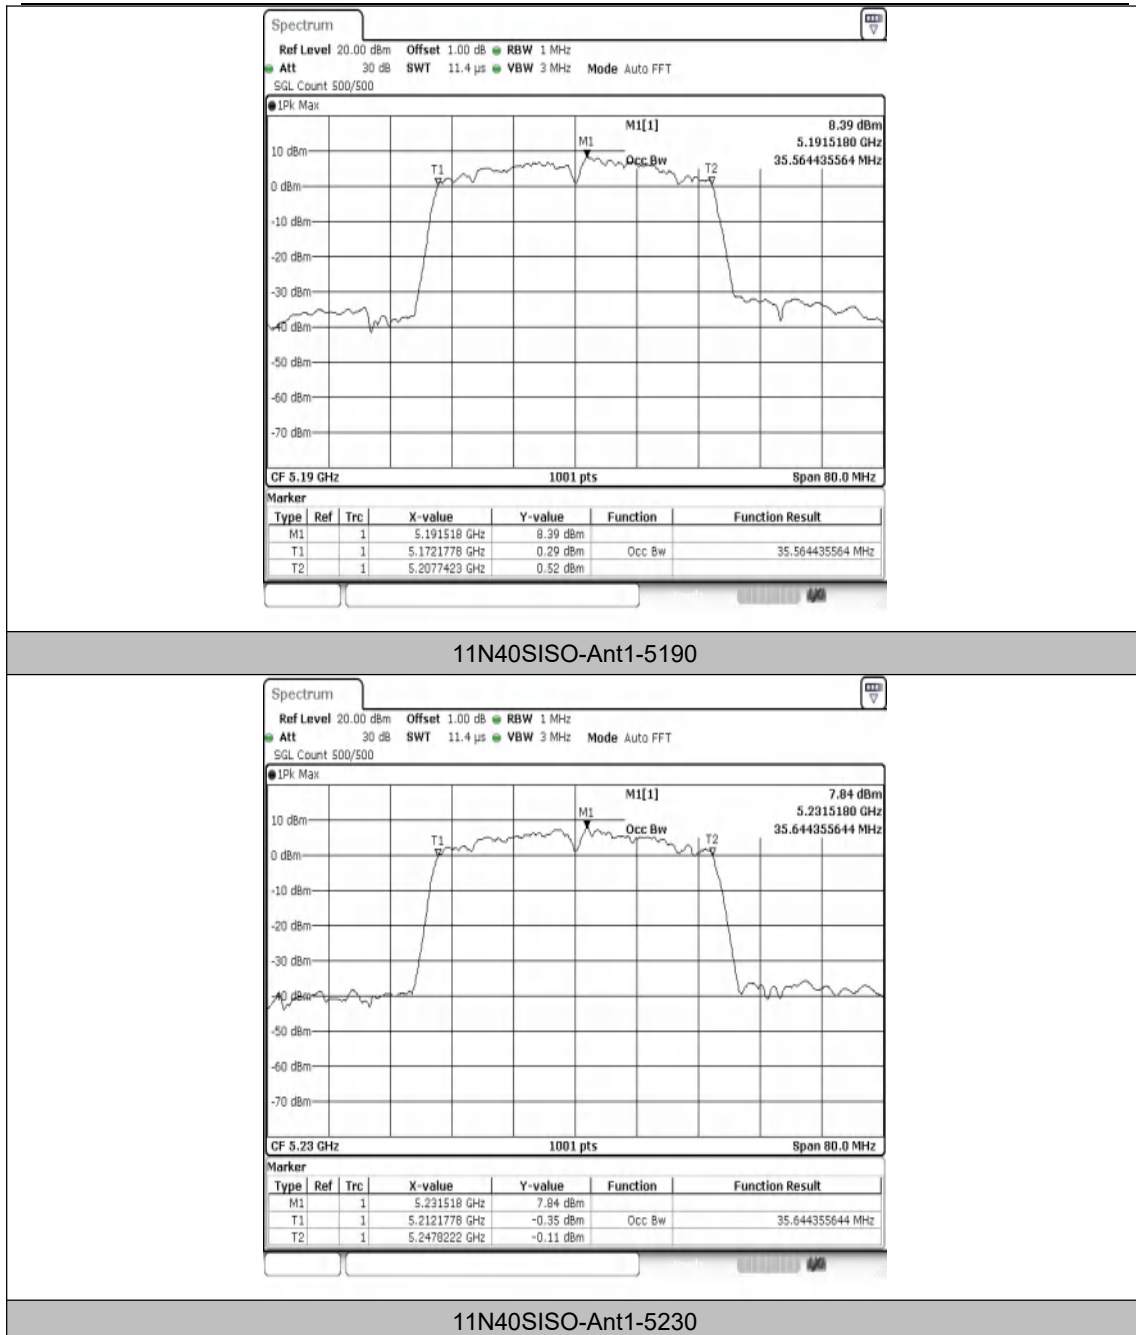


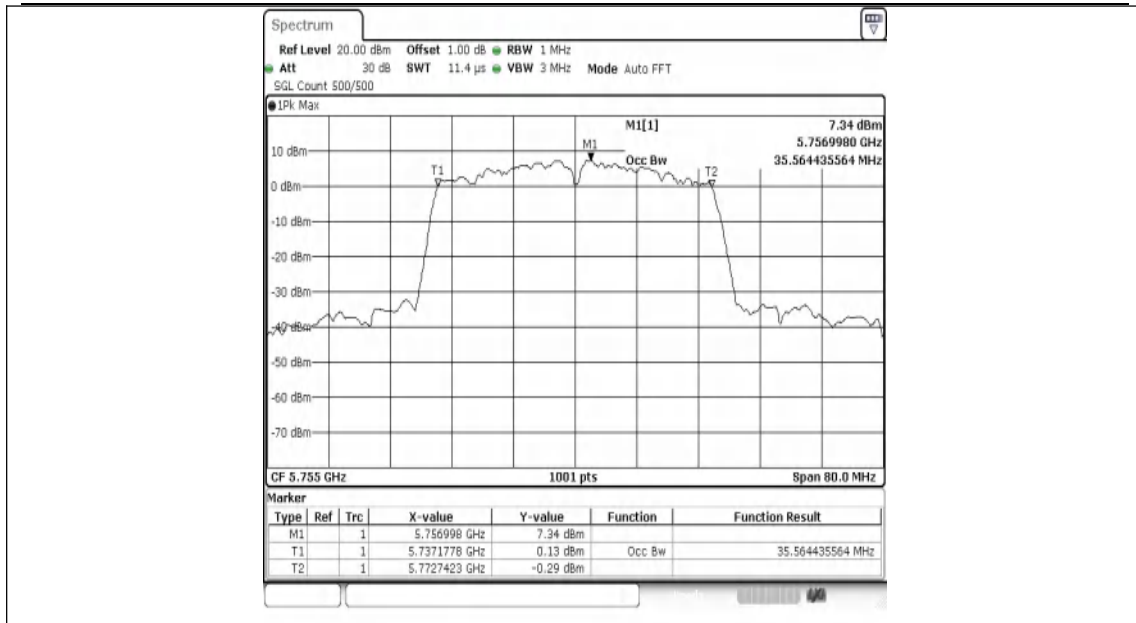


11N40SISO-Ant1-5755

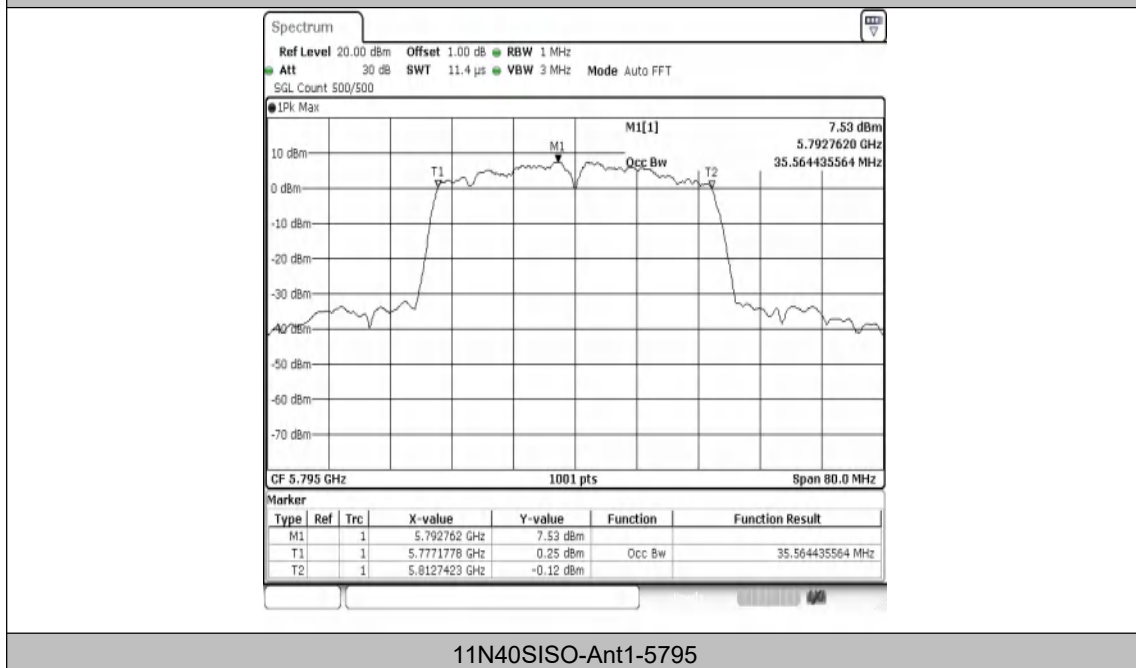


11N40SISO-Ant1-5795

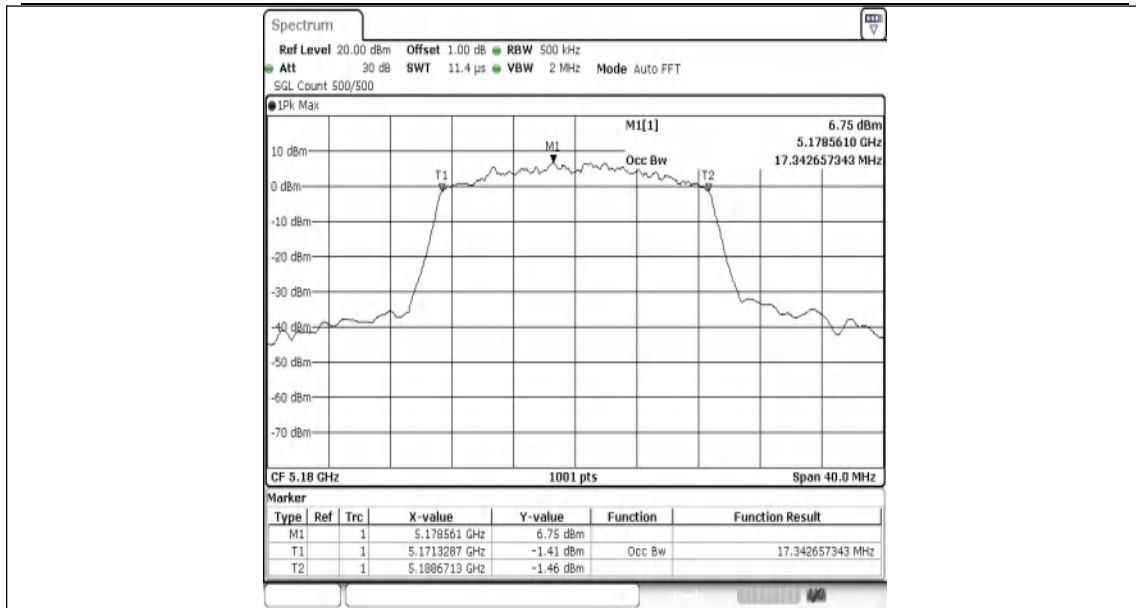


11AC20SISO-Ant1-5180

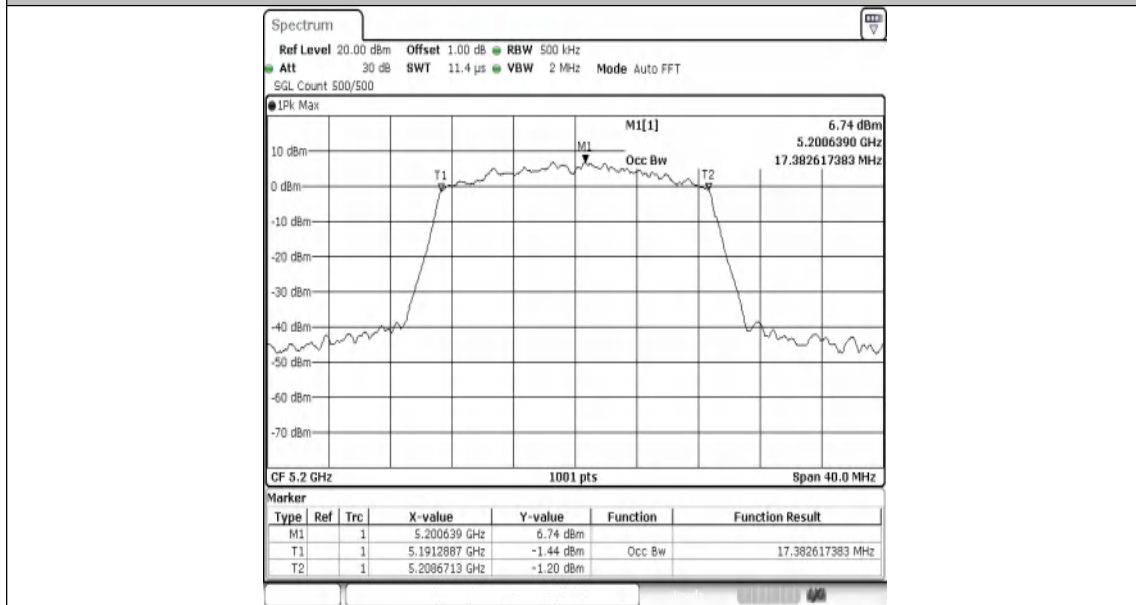


11AC20SISO-Ant1-5200

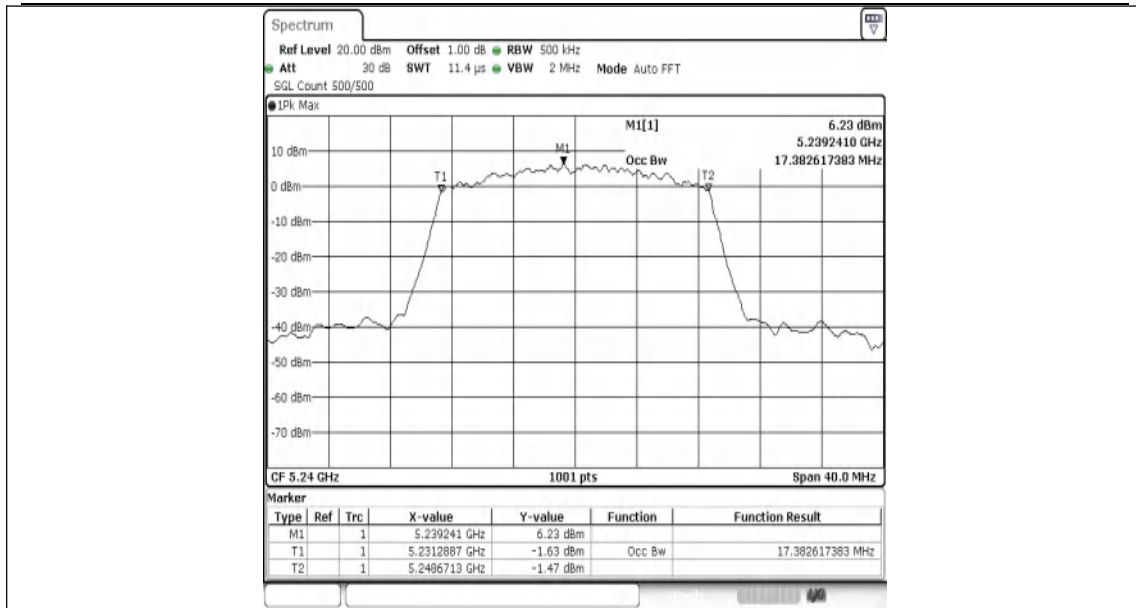


11AC20SISO-Ant1-5240

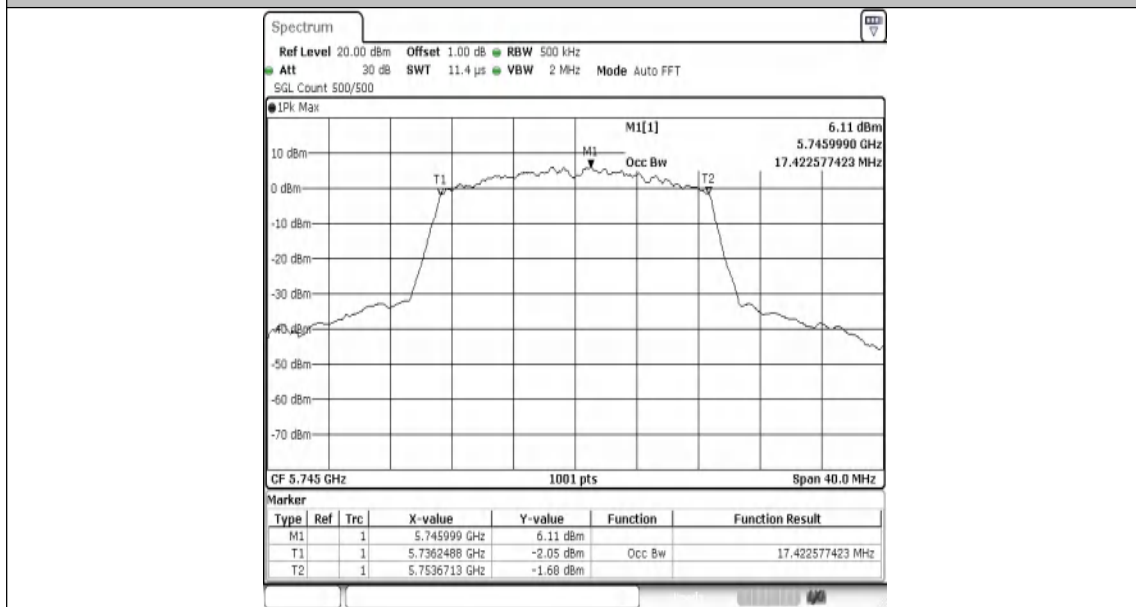


11AC20SISO-Ant1-5745

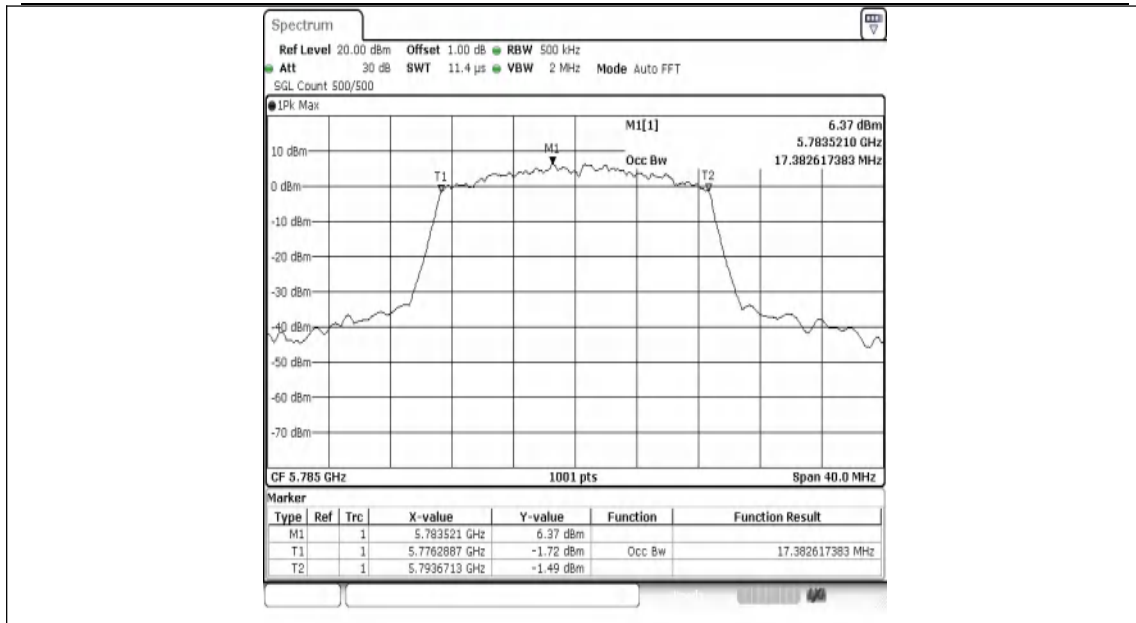


11AC20SISO-Ant1-5785

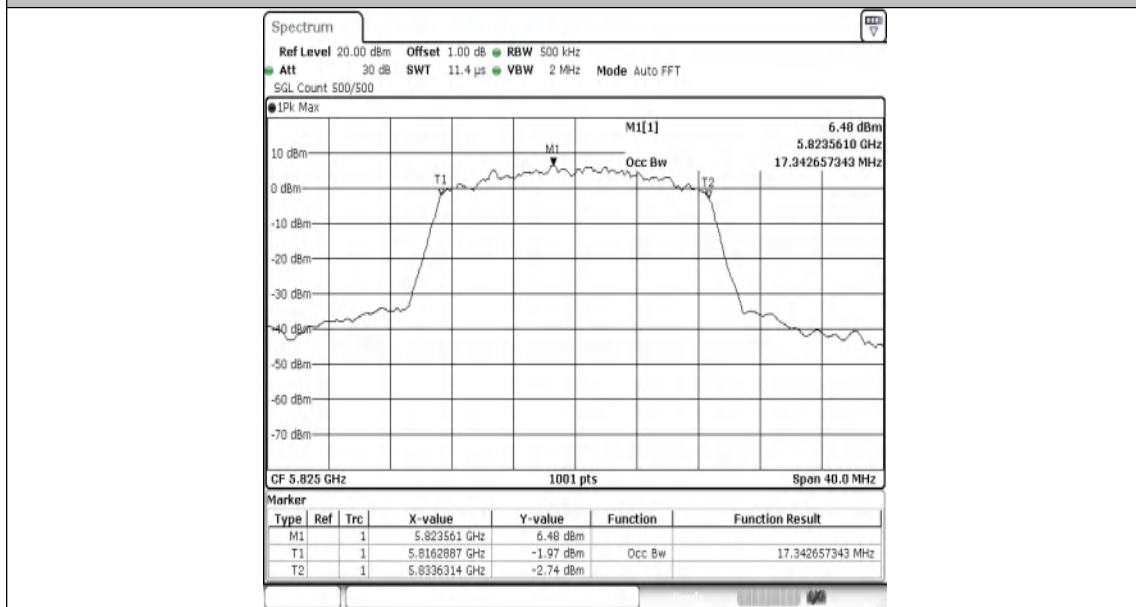


11AC20SISO-Ant1-5825

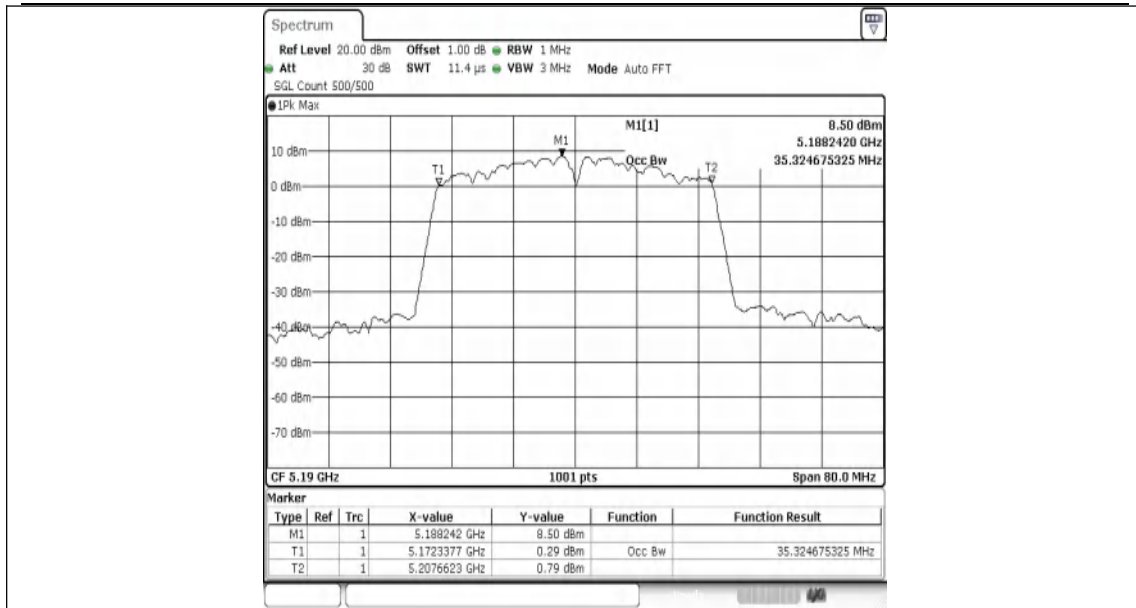


11AC40SISO-Ant1-5190

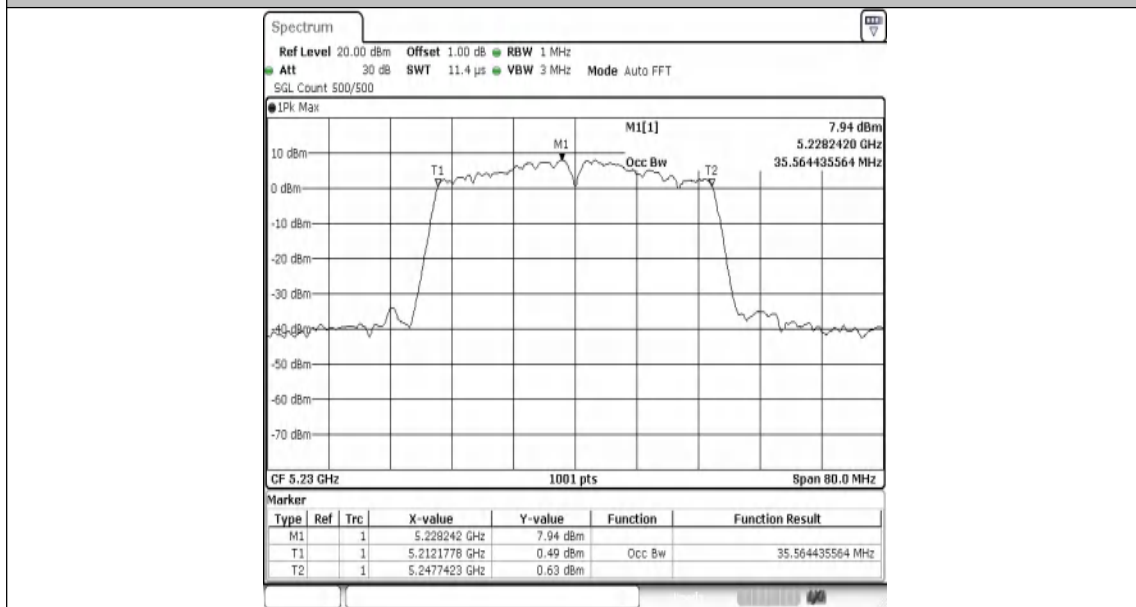


11AC40SISO-Ant1-5230

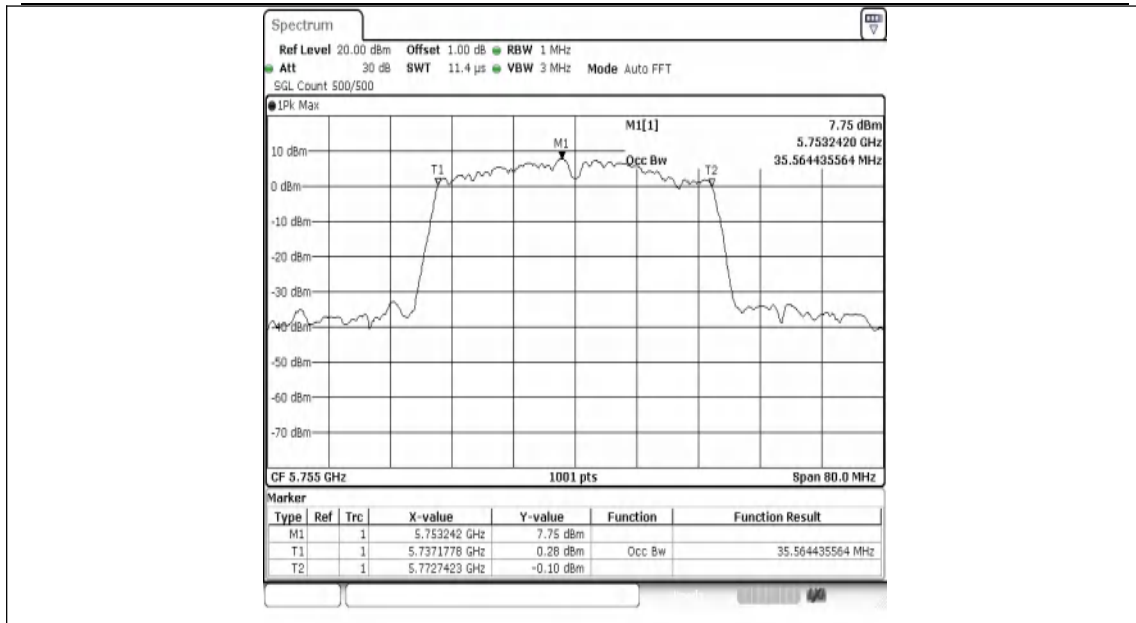

11AC40SISO-Ant1-5755

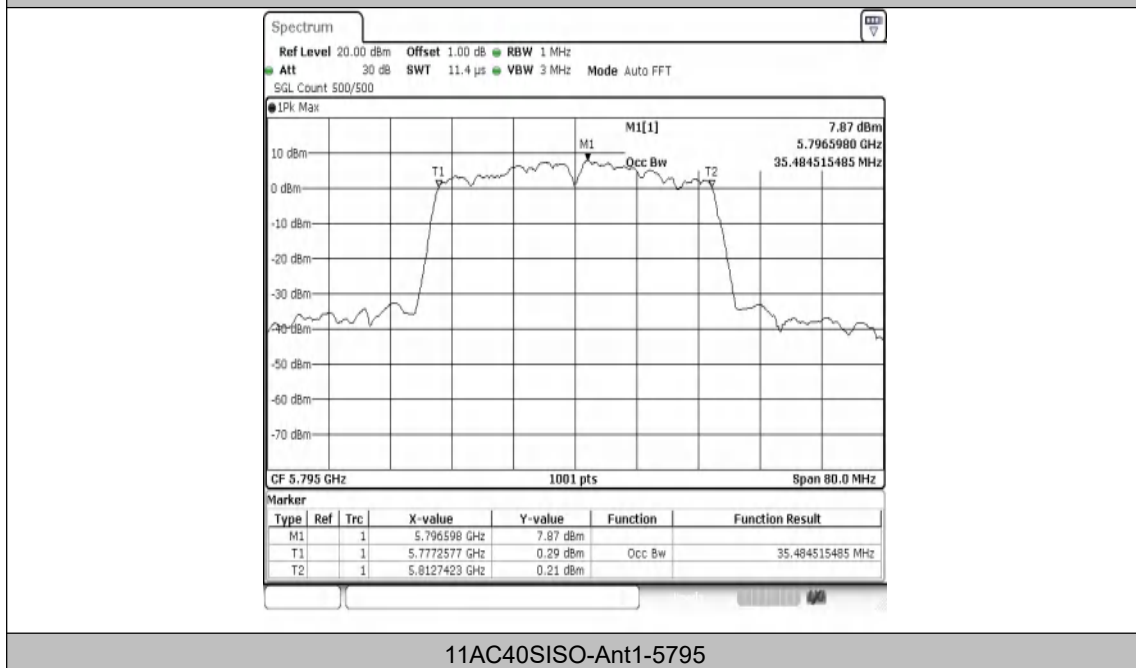


11AC40SISO-Ant1-5795

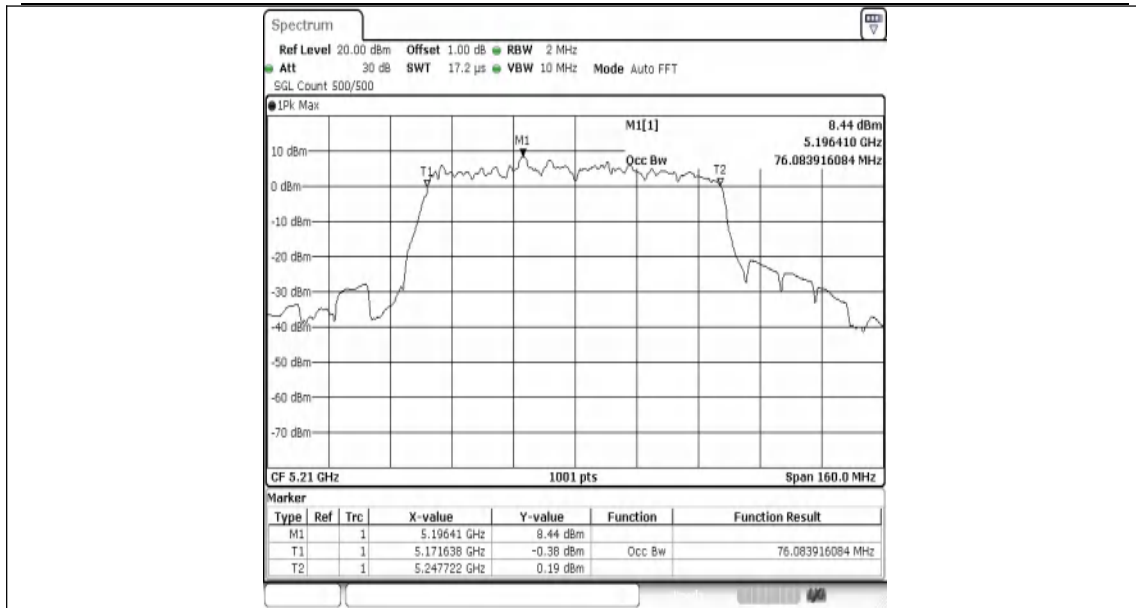


11AC80SISO-Ant1-5210




11AC80SISO-Ant1-5775

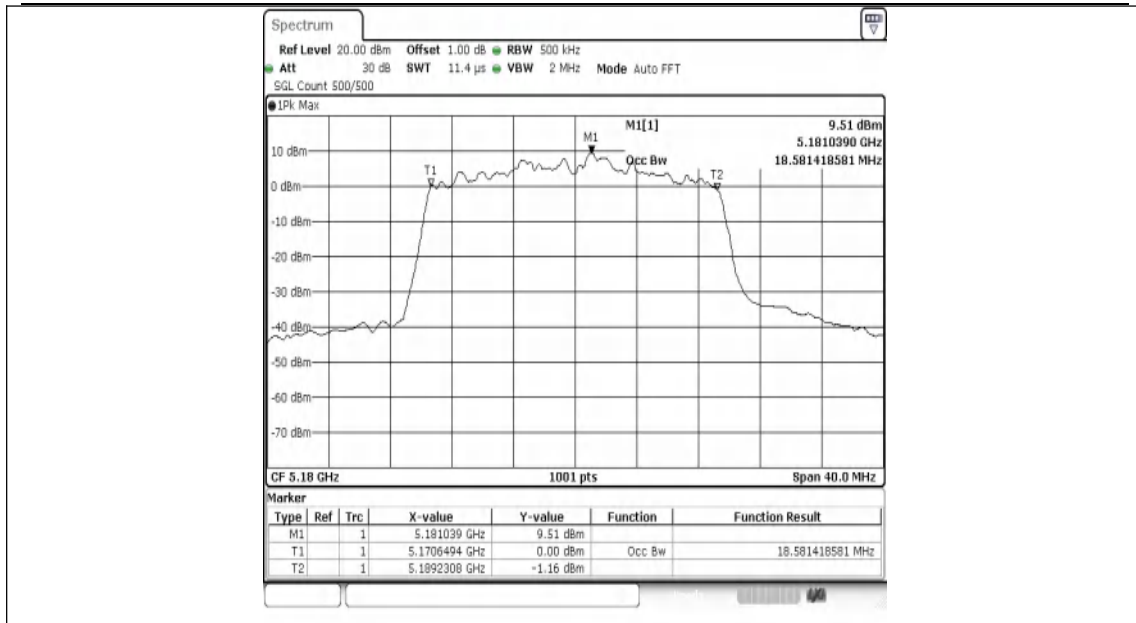


11AX20SISO-Ant1-5180

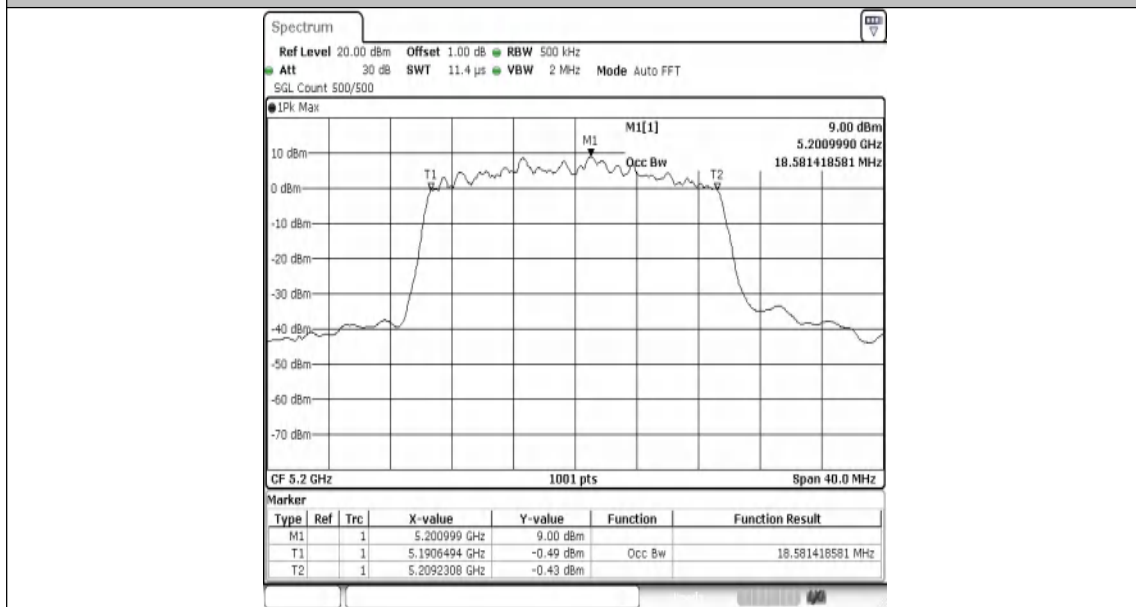


11AX20SISO-Ant1-5200

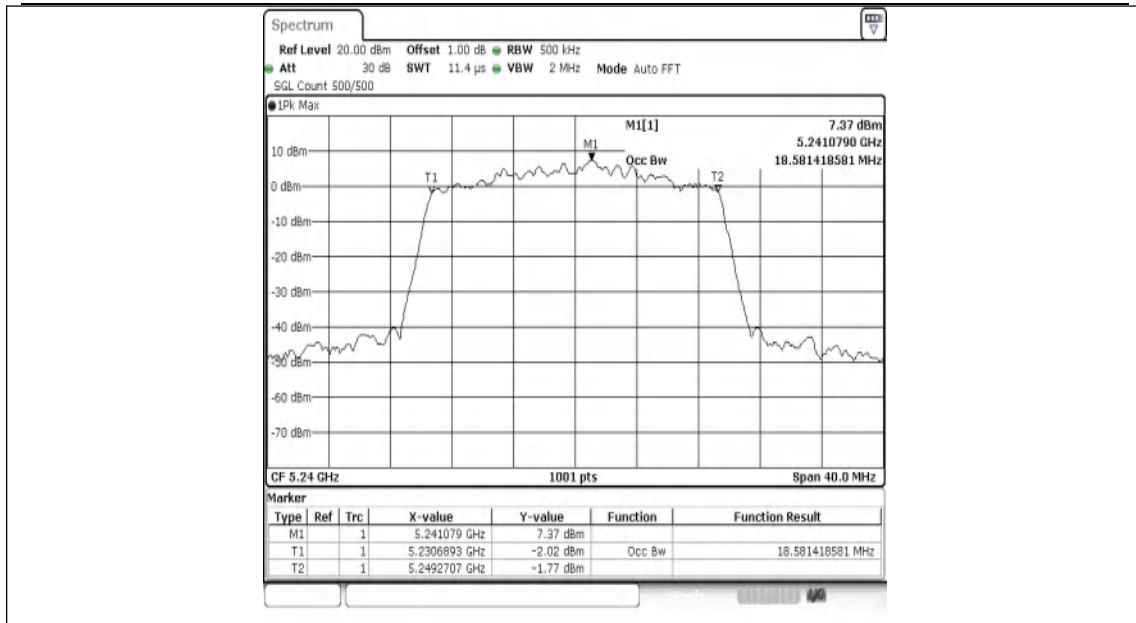


11AX20SISO-Ant1-5240

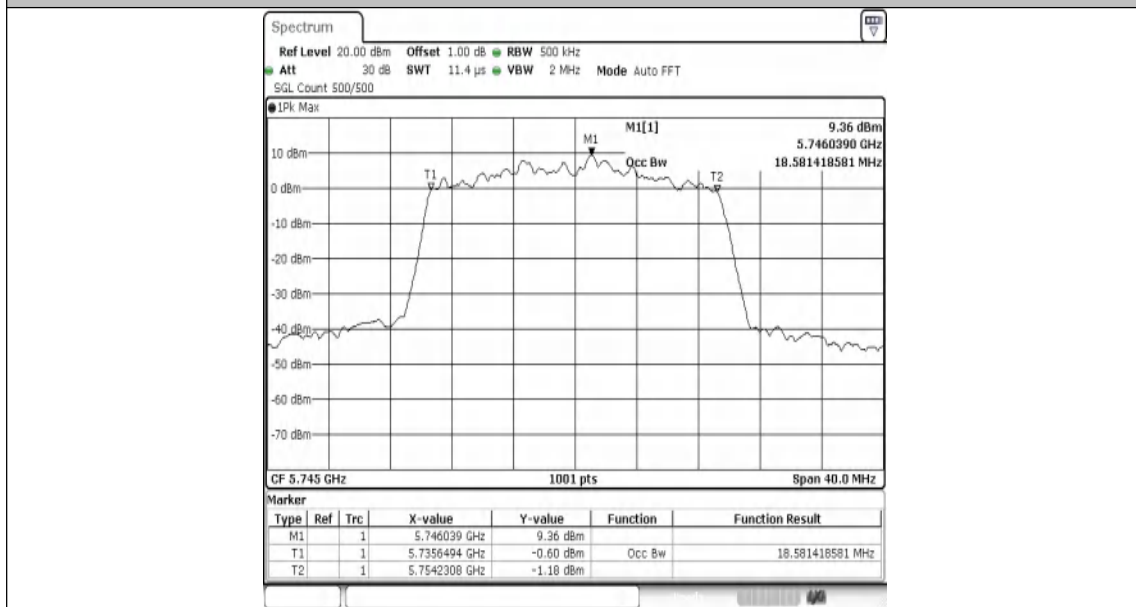


11AX20SISO-Ant1-5745

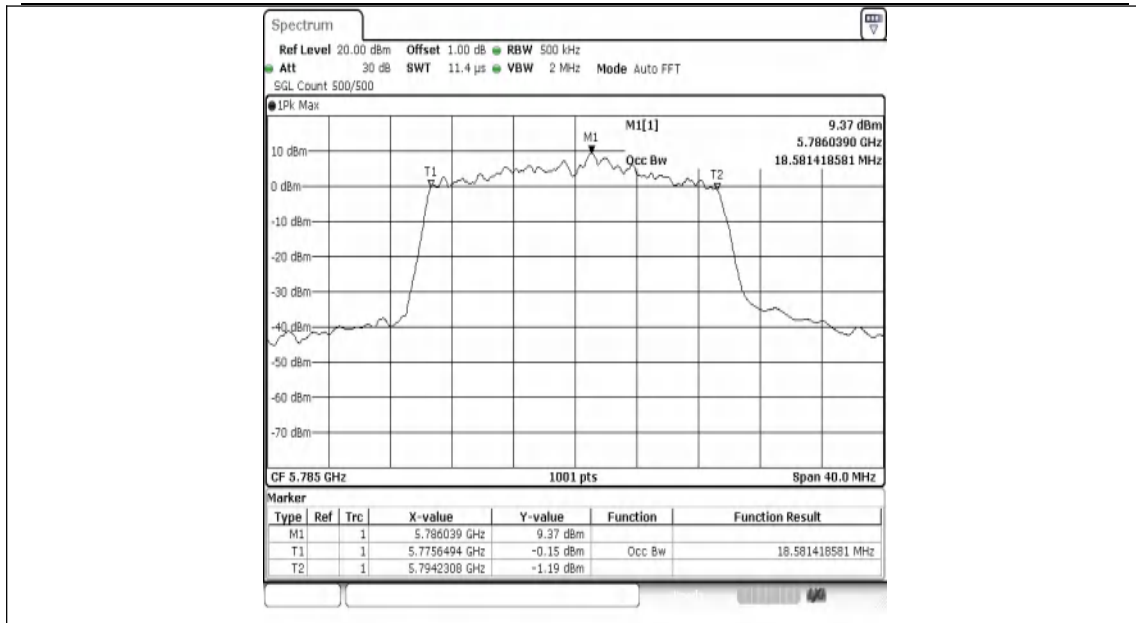


11AX20SISO-Ant1-5785

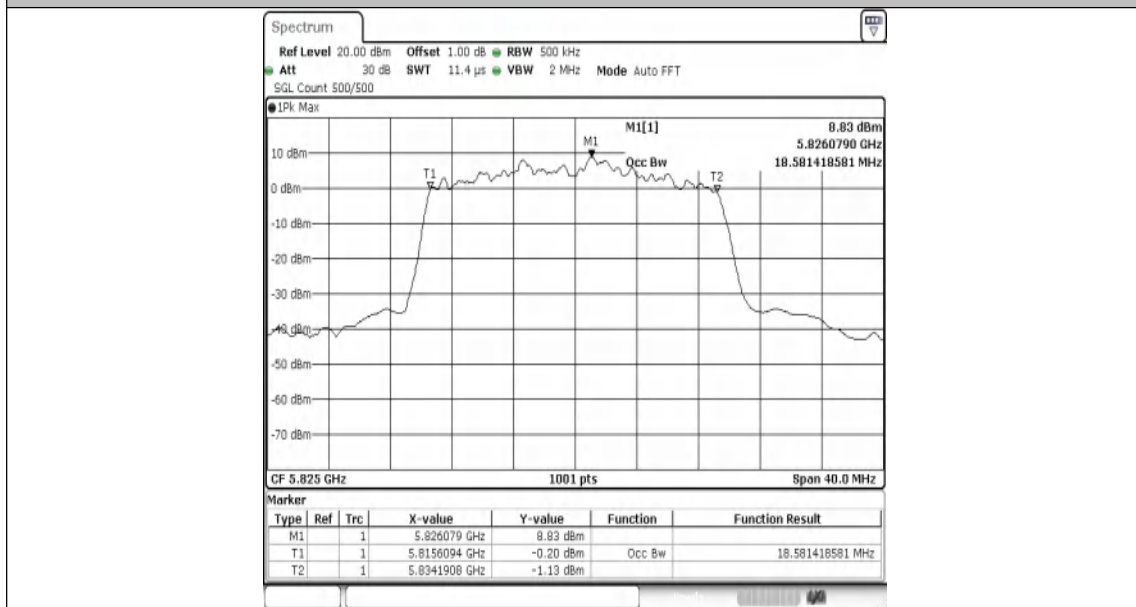


11AX20SISO-Ant1-5825

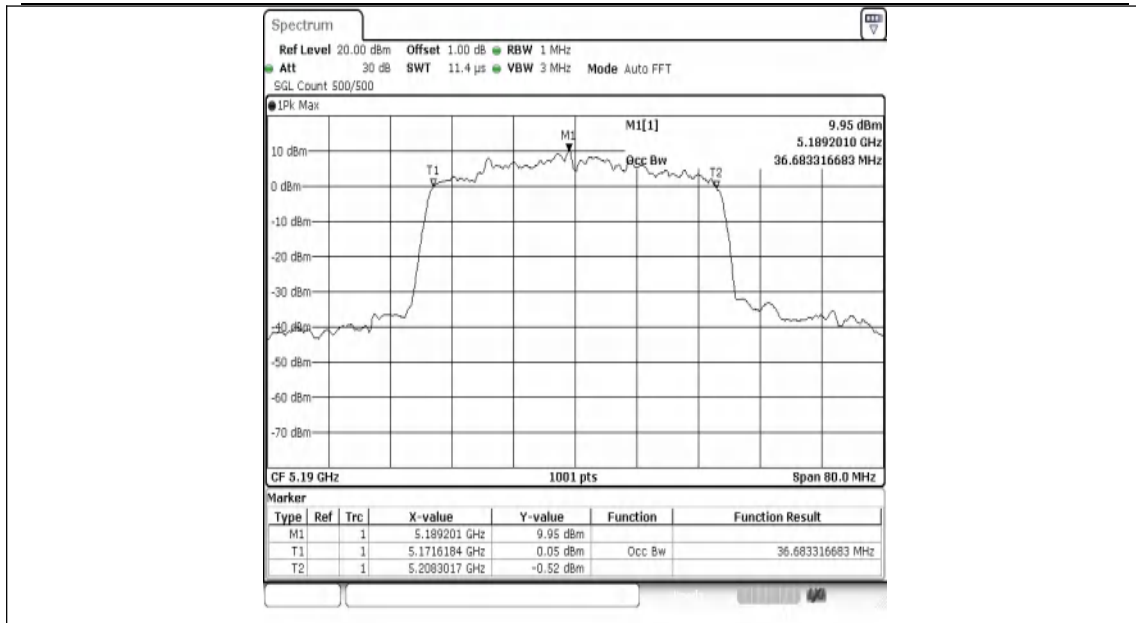

11AX40SISO-Ant1-5190

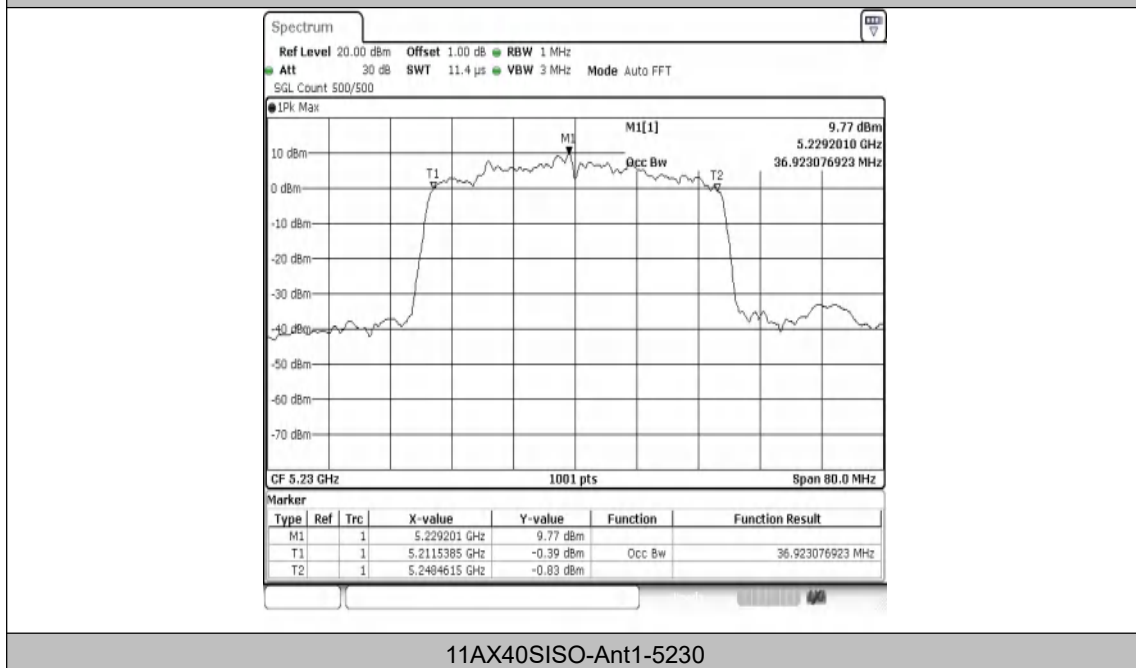


11AX40SISO-Ant1-5230

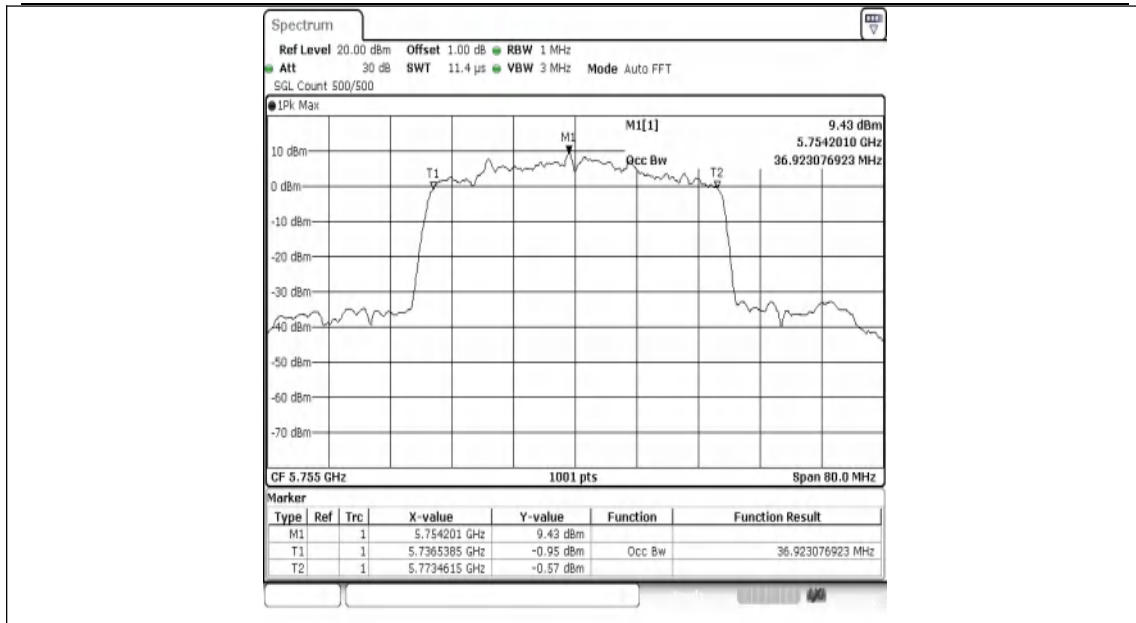


11AX40SISO-Ant1-5755



11AX40SISO-Ant1-5795

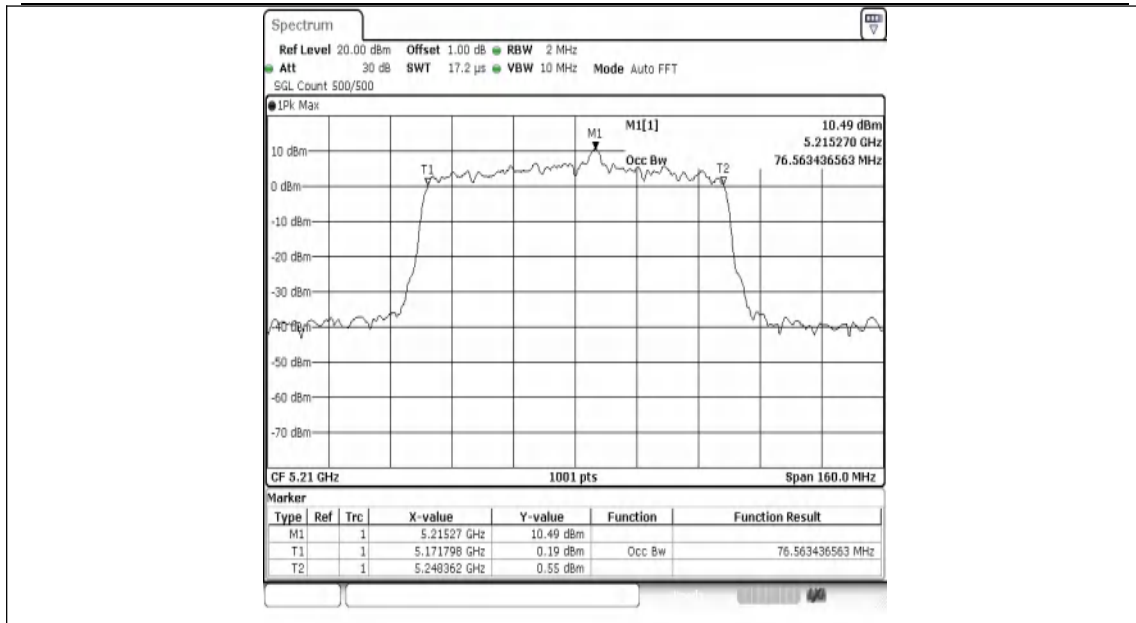

11AX80SISO-Ant1-5210

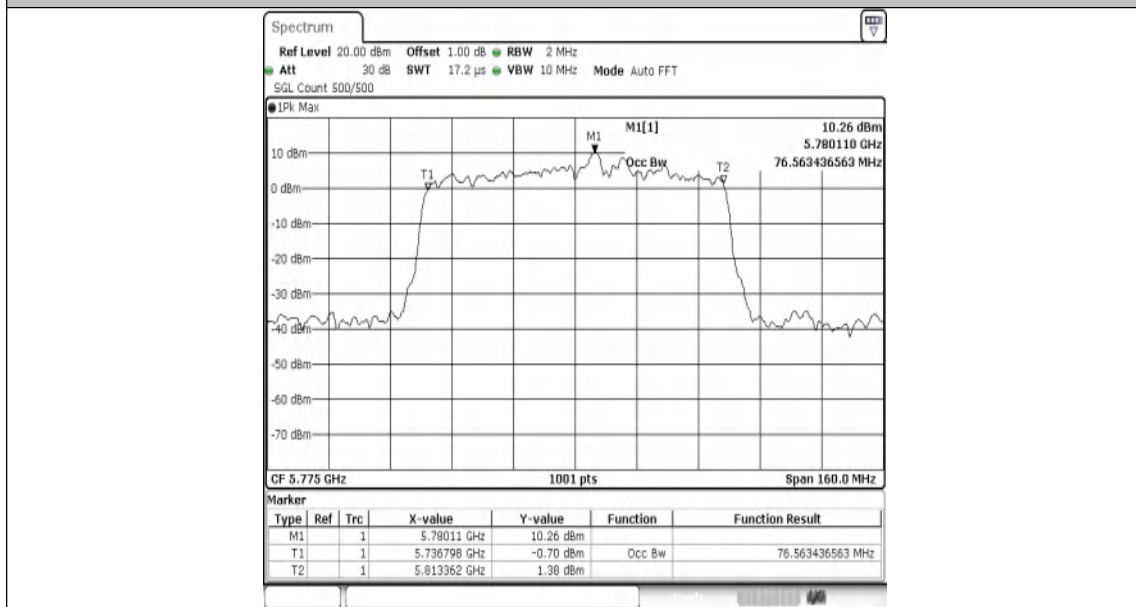


11AX80SISO-Ant1-5775


Appendix A3: Minimum 6dB Bandwidth

Test Result B4


Test Mode	Antenna	Frequency[MHz]	6db EBW [MHz]	FL[MHz]	FH[MHz]	Limit[MHz]	Verdict
11A	Ant1	5745	13.80	5737.48	5751.28	0.5	PASS
11A	Ant1	5785	15.08	5777.44	5792.52	0.5	PASS
11A	Ant1	5825	15.52	5817.24	5832.76	0.5	PASS
11N20SISO	Ant1	5745	15.08	5737.44	5752.52	0.5	PASS
11N20SISO	Ant1	5785	13.80	5777.48	5791.28	0.5	PASS
11N20SISO	Ant1	5825	15.04	5817.48	5832.52	0.5	PASS
11N40SISO	Ant1	5755	31.36	5738.68	5770.04	0.5	PASS
11N40SISO	Ant1	5795	31.36	5778.68	5810.04	0.5	PASS
11AC20SISO	Ant1	5745	13.84	5738.68	5752.52	0.5	PASS
11AC20SISO	Ant1	5785	16.16	5776.60	5792.76	0.5	PASS
11AC20SISO	Ant1	5825	15.08	5817.44	5832.52	0.5	PASS
11AC40SISO	Ant1	5755	26.32	5743.72	5770.04	0.5	PASS
11AC40SISO	Ant1	5795	31.36	5778.68	5810.04	0.5	PASS
11AC80SISO	Ant1	5775	75.20	5737.40	5812.60	0.5	PASS
11AX20SISO	Ant1	5745	15.08	5737.44	5752.52	0.5	PASS
11AX20SISO	Ant1	5785	15.08	5777.44	5792.52	0.5	PASS
11AX20SISO	Ant1	5825	13.84	5818.68	5832.52	0.5	PASS
11AX40SISO	Ant1	5755	30.08	5739.96	5770.04	0.5	PASS
11AX40SISO	Ant1	5795	26.32	5778.68	5805.00	0.5	PASS
11AX80SISO	Ant1	5775	75.20	5737.40	5812.60	0.5	PASS

Test Graphs B4

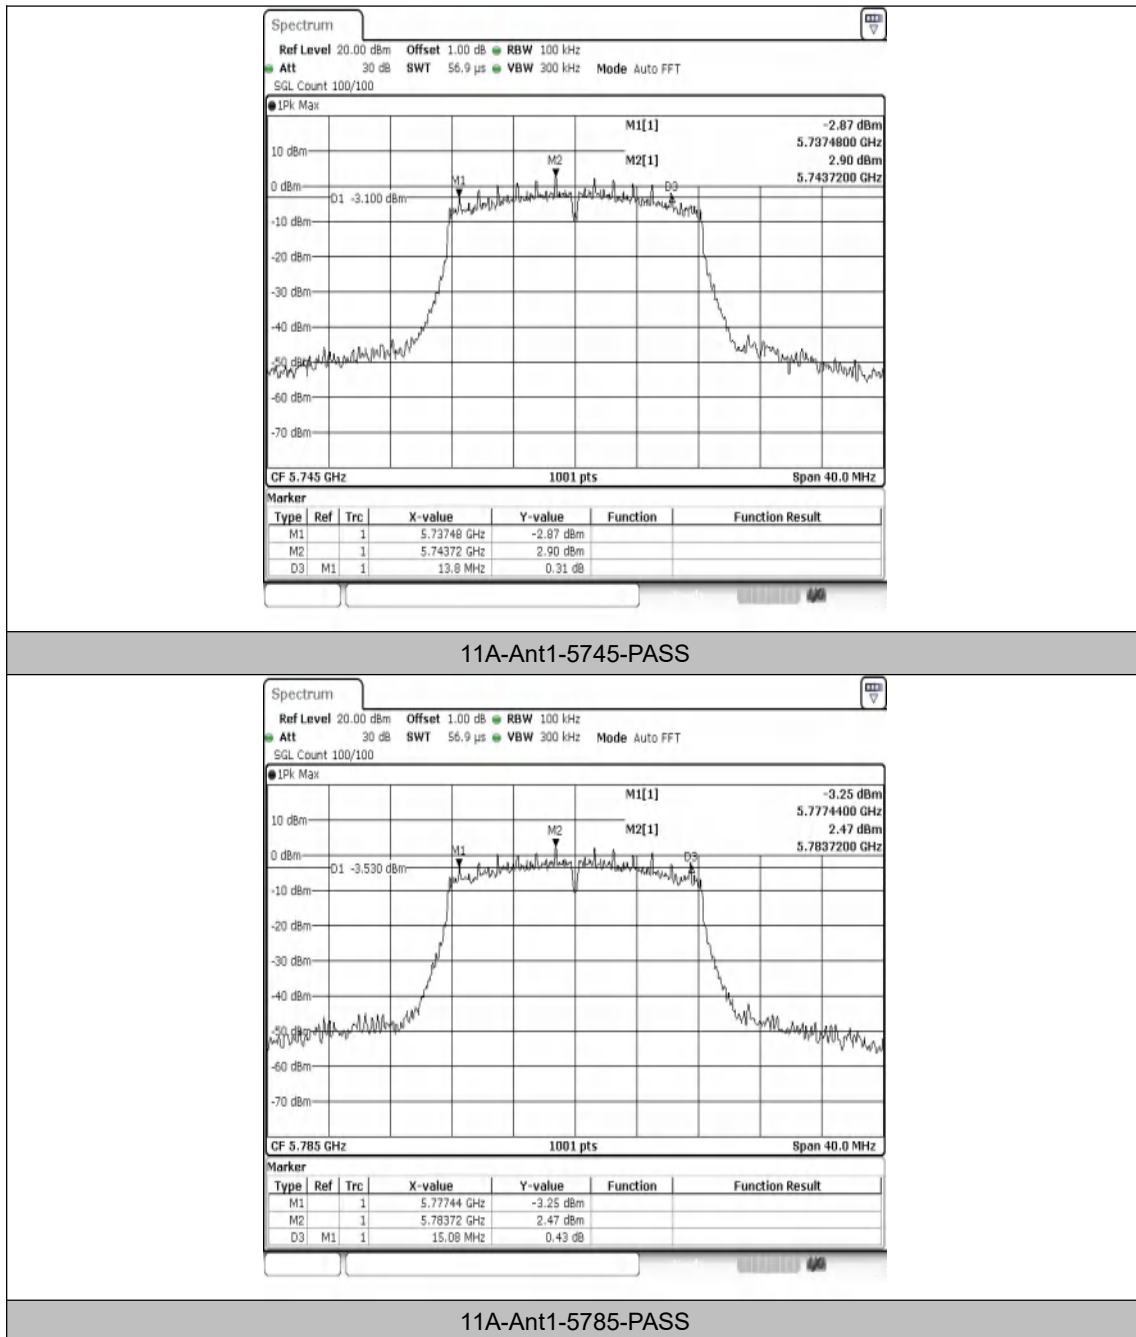


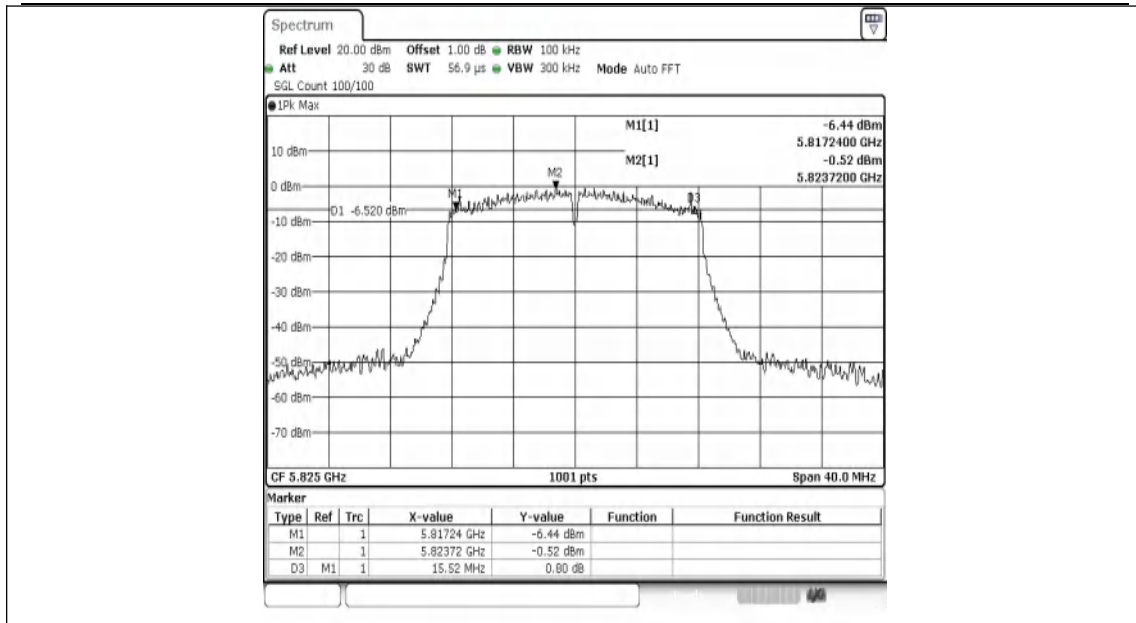


11A-Ant1-5825-PASS

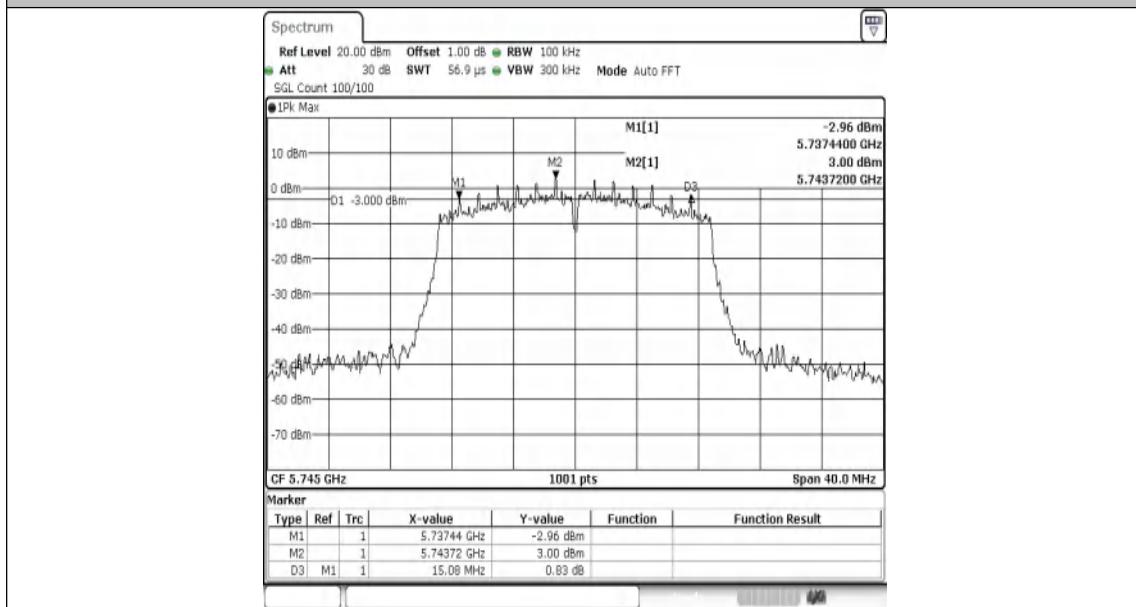


11N20SISO-Ant1-5745-PASS

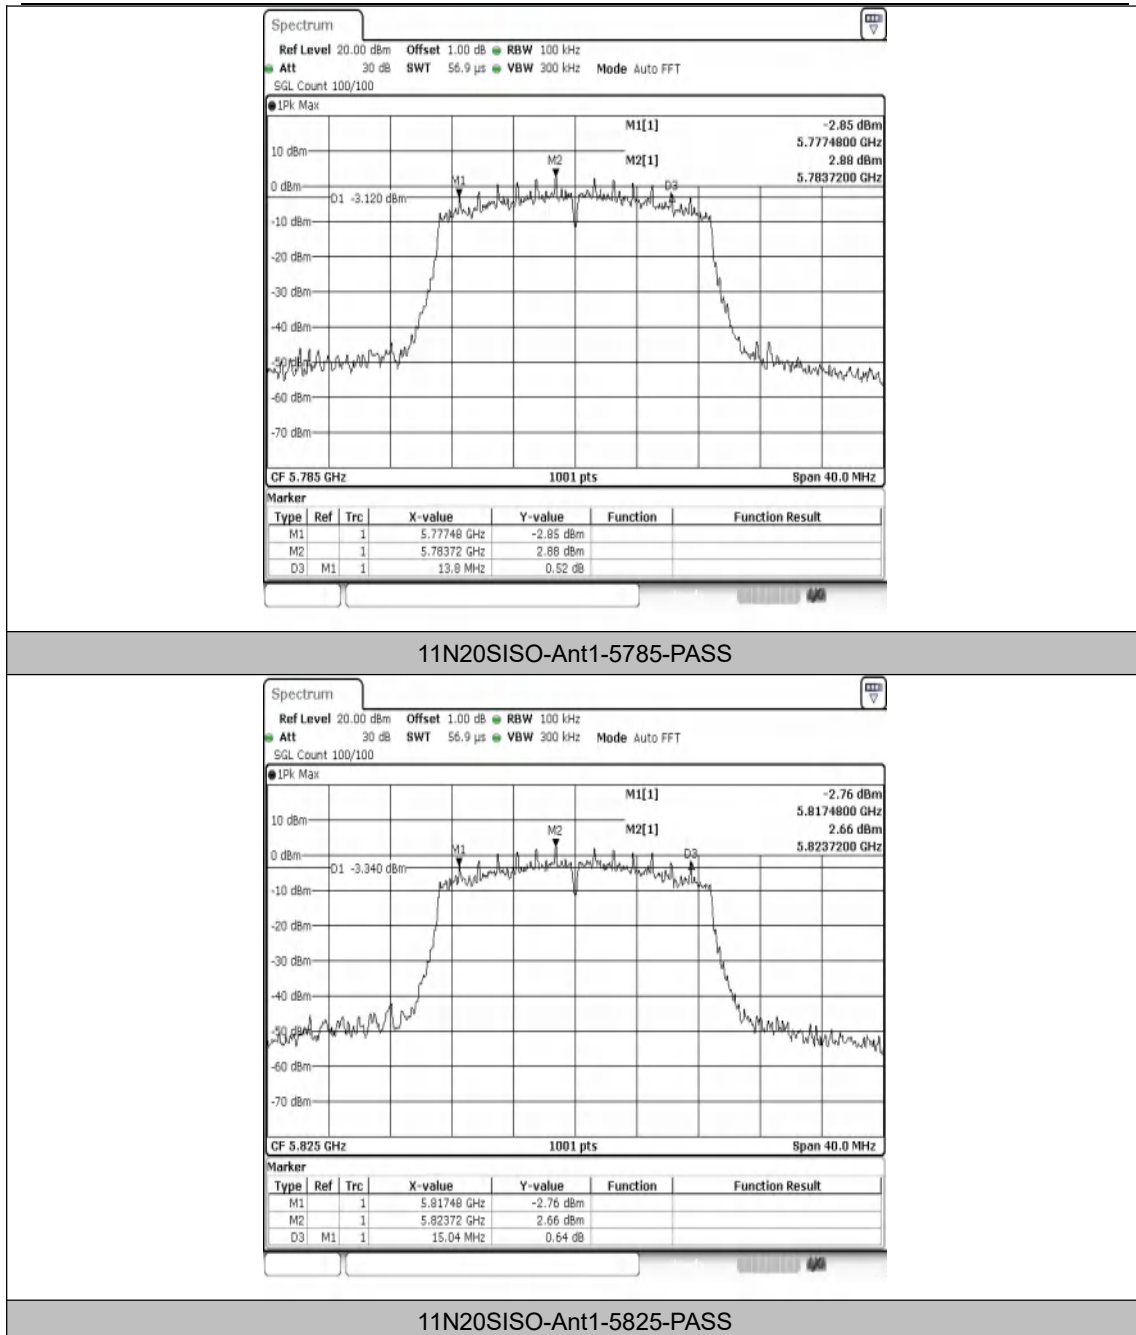


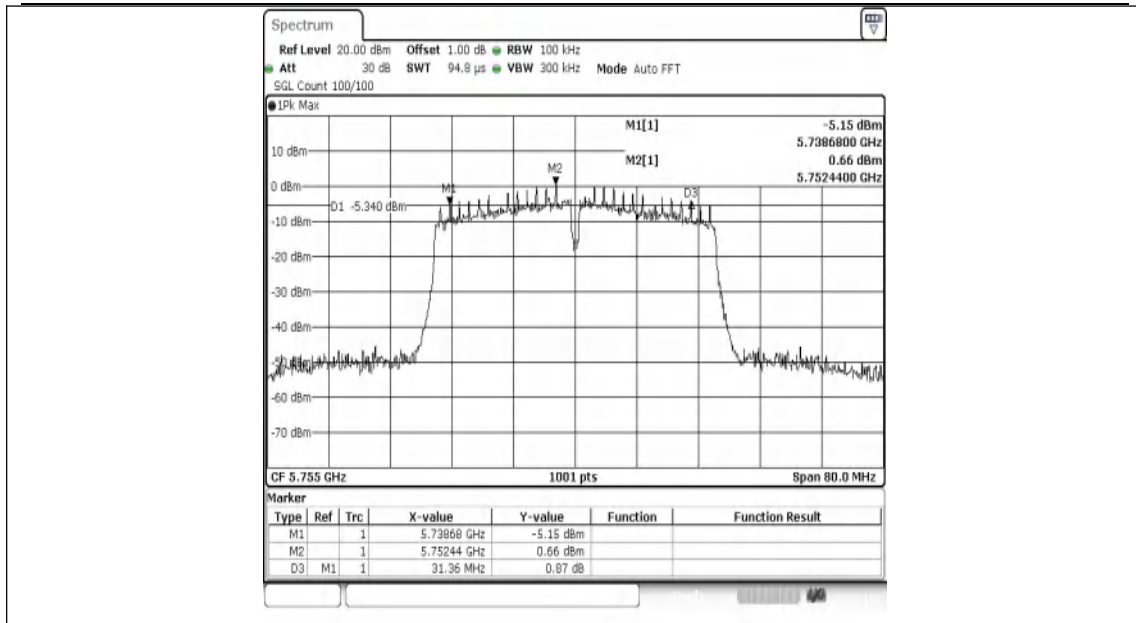


11N40ISO-Ant1-5755-PASS

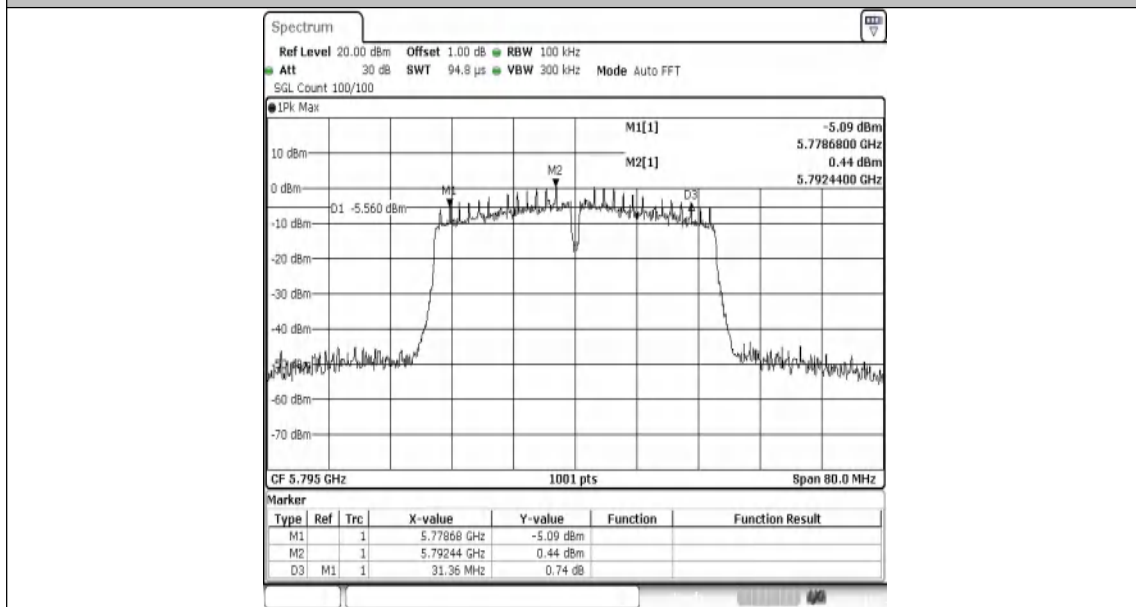


11N40ISO-Ant1-5795-PASS

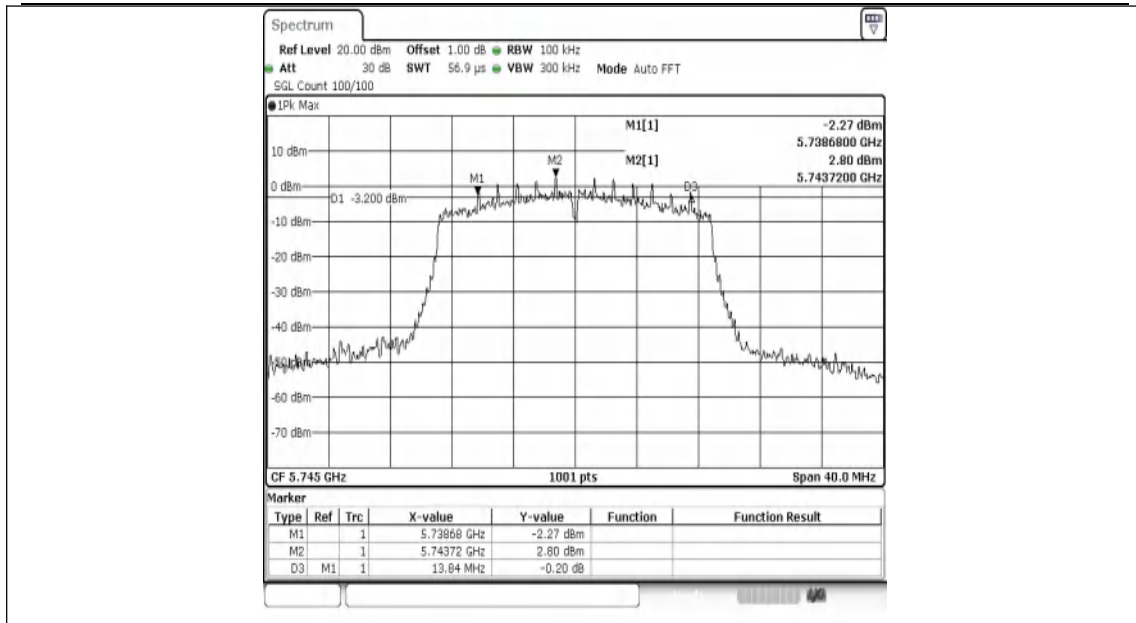


11AC20SISO-Ant1-5745-PASS

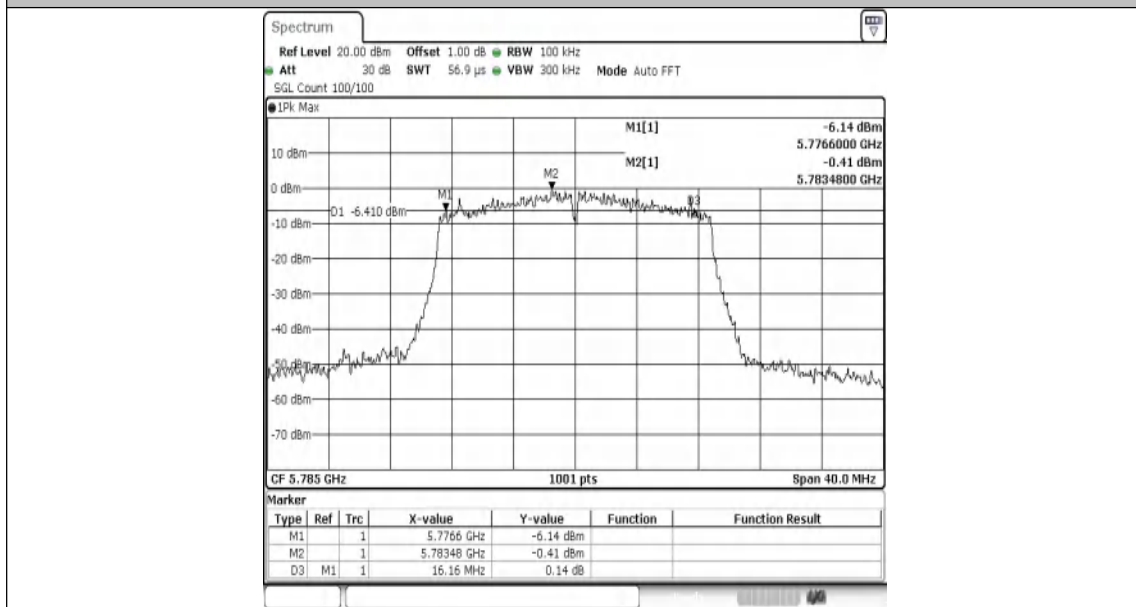


11AC20SISO-Ant1-5785-PASS

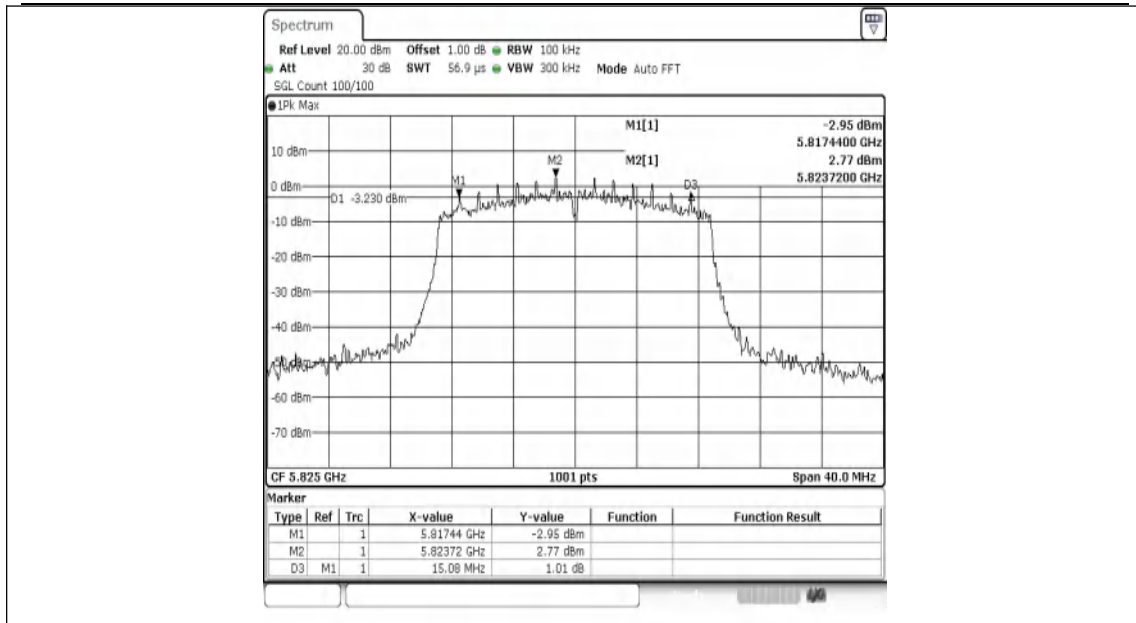


11AC20SISO-Ant1-5825-PASS

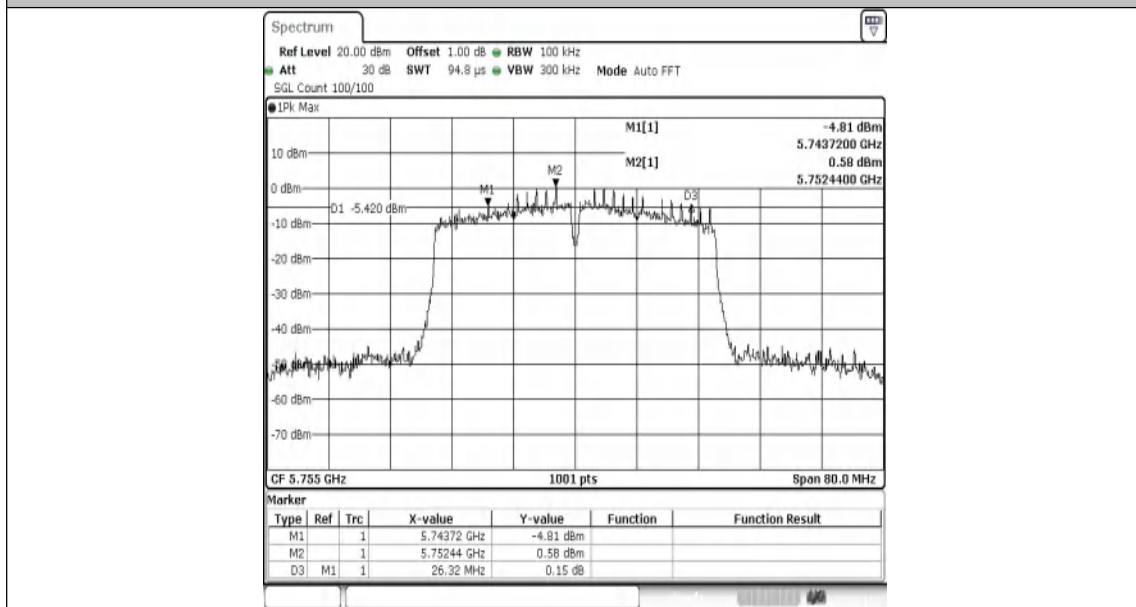


11AC40SISO-Ant1-5755-PASS

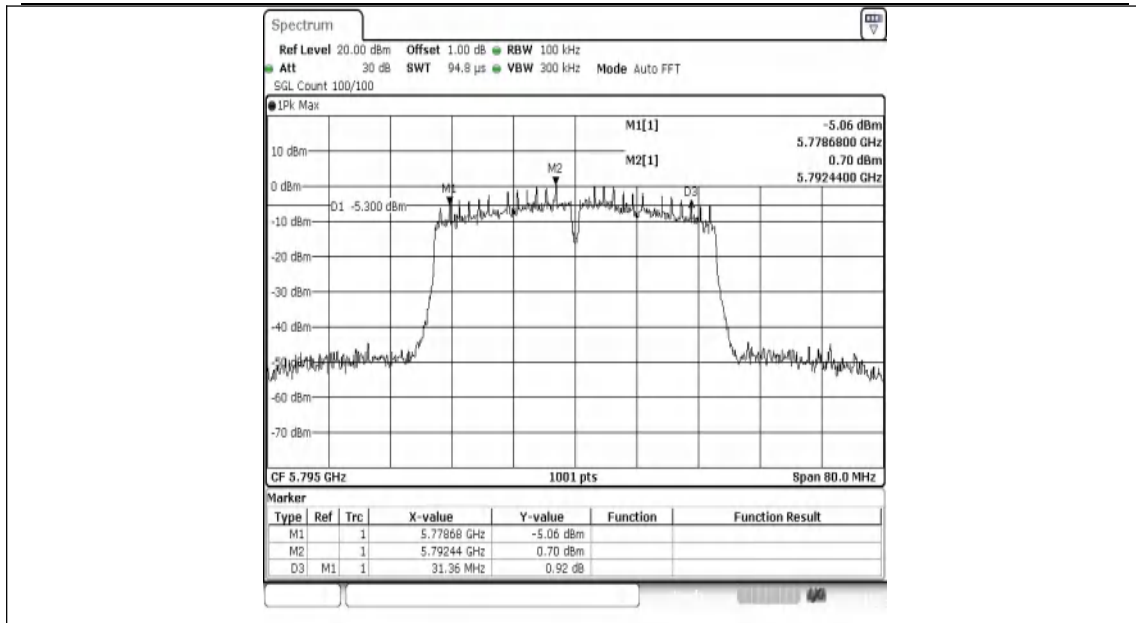


11AC40SISO-Ant1-5795-PASS

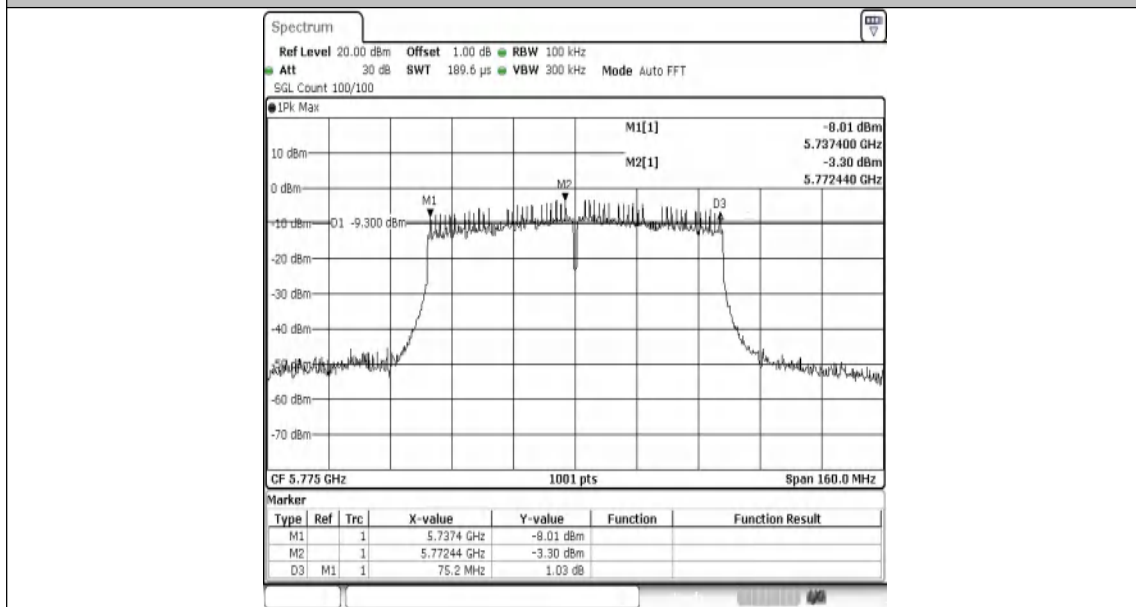


11AC80SISO-Ant1-5775-PASS

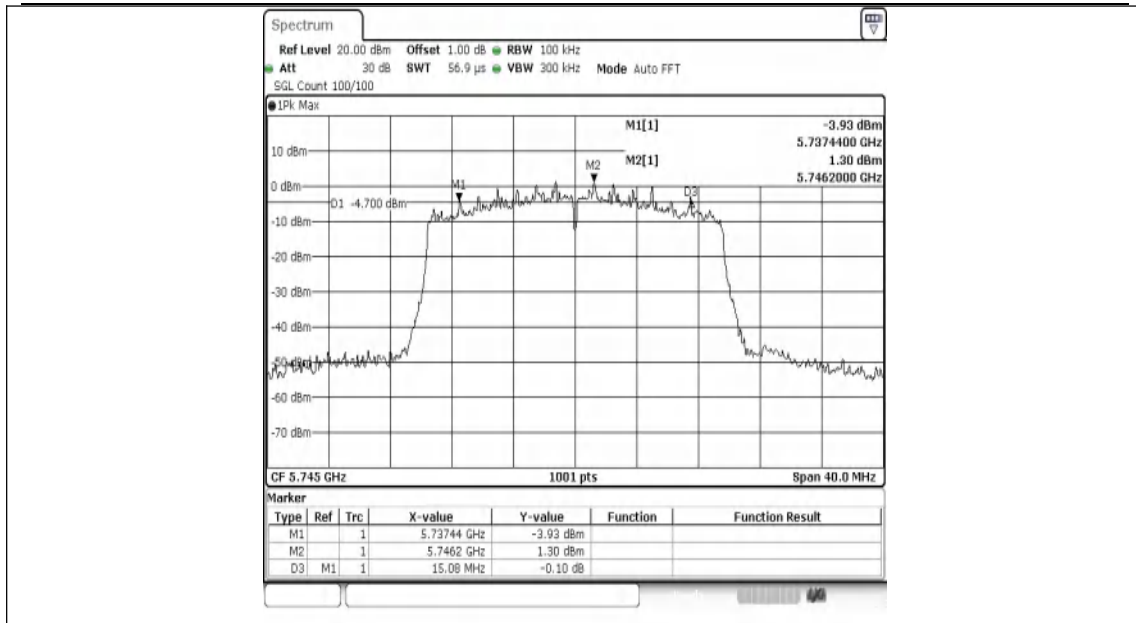


11AX20SISO-Ant1-5745-PASS

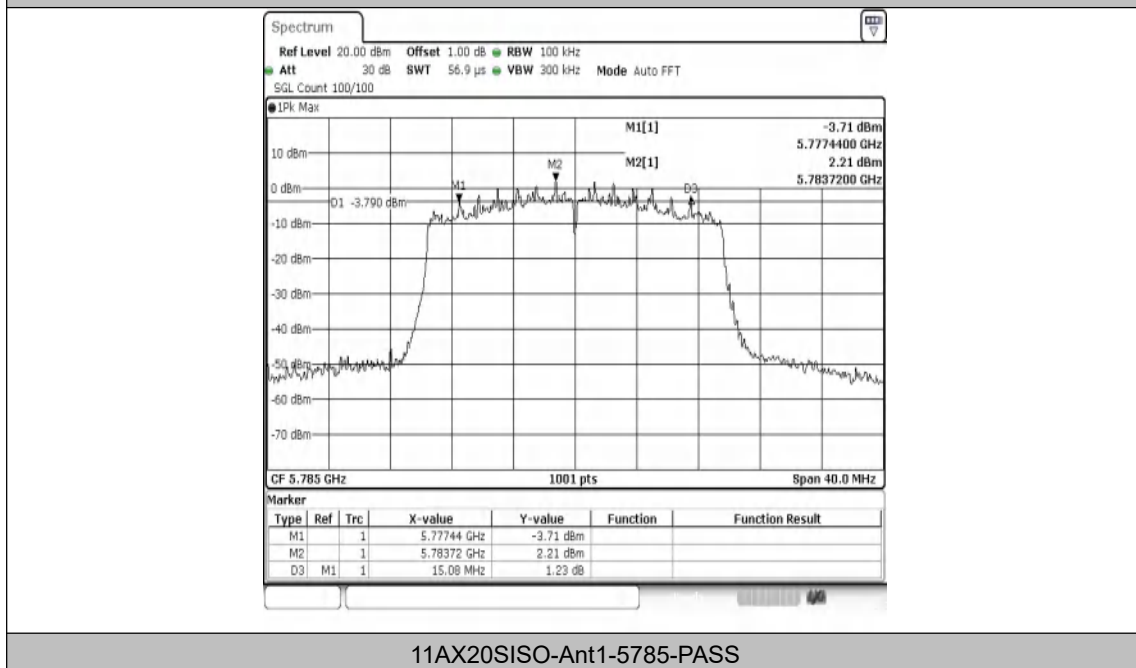

11AX20SISO-Ant1-5785-PASS

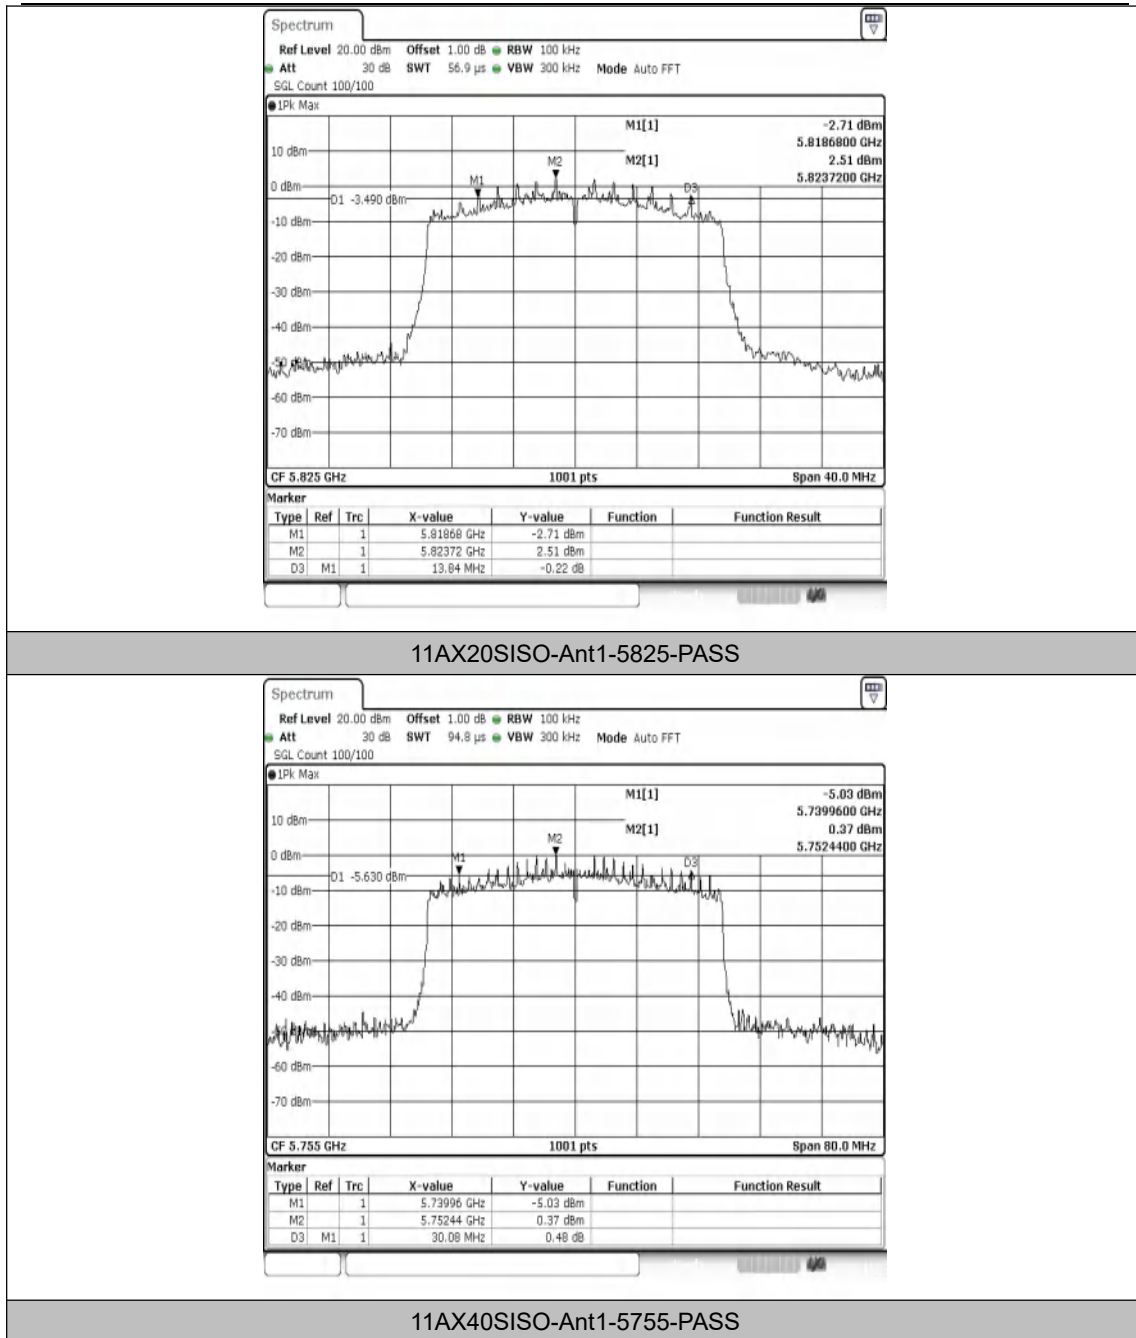

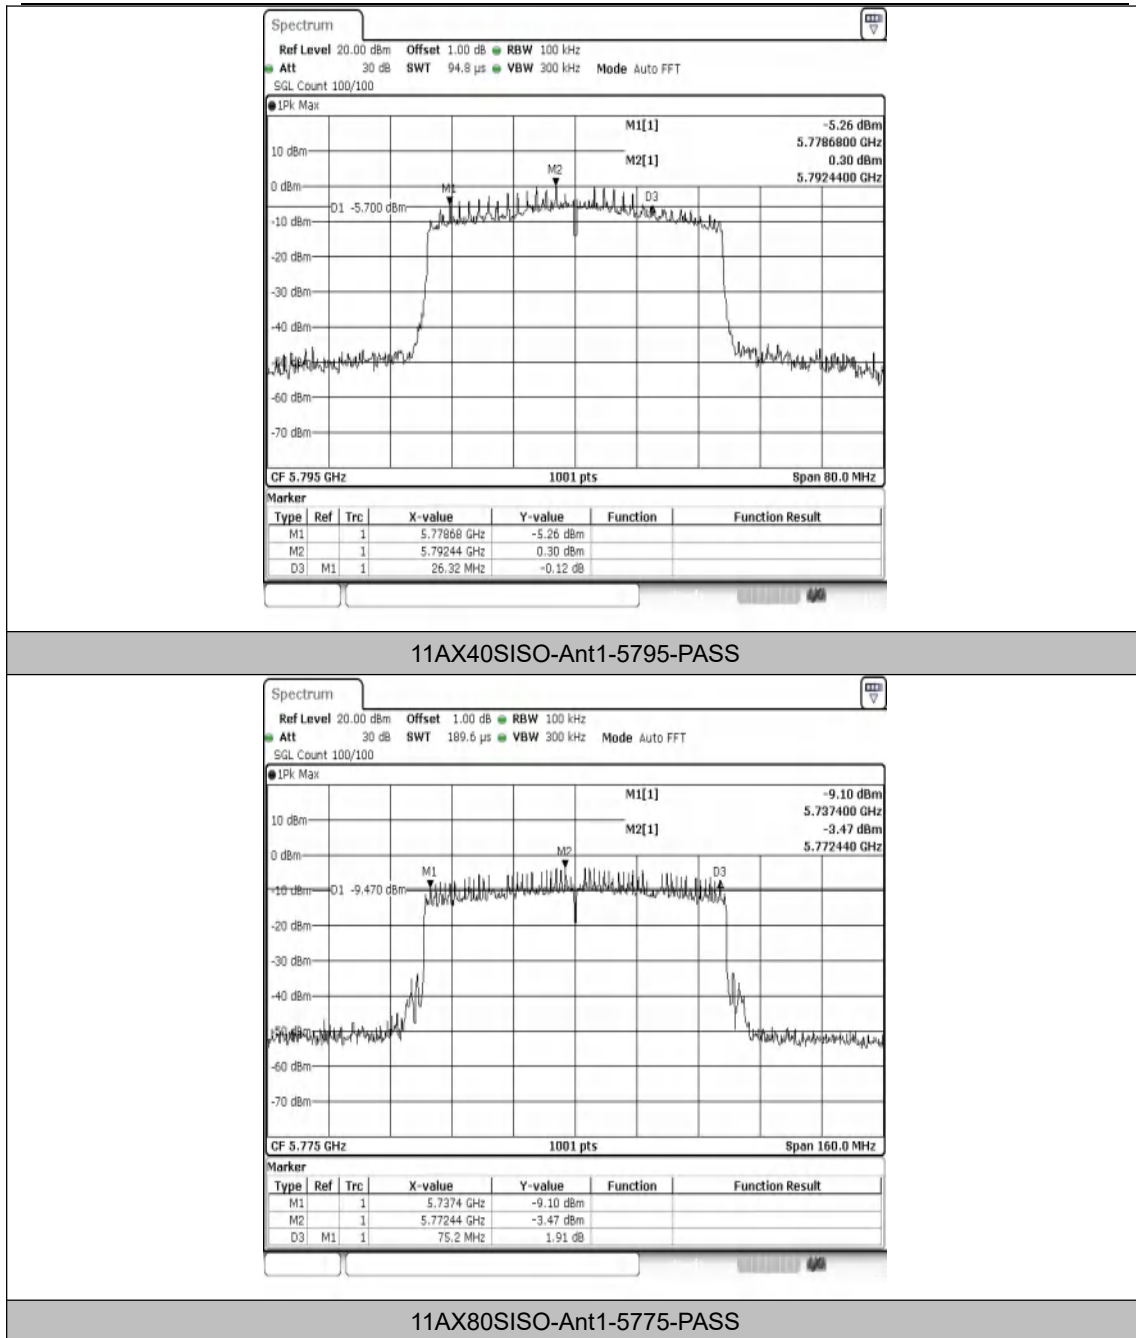

Appendix B: Duty Cycle

Test Result

Test Mode	Antenna	Frequency[MHz]	Transmission Duration [ms]	Transmission Period [ms]	Duty Cycle [%]	Dc Factor [dB]	1/T
11A	Ant1	5180	100.00	100.00	100.00	0.00	0.01
11A	Ant1	5200	100.00	100.00	100.00	0.00	0.01
11A	Ant1	5240	100.00	100.00	100.00	0.00	0.01
11A	Ant1	5745	100.00	100.00	100.00	0.00	0.01
11A	Ant1	5785	100.00	100.00	100.00	0.00	0.01
11A	Ant1	5825	100.00	100.00	100.00	0.00	0.01
11N20SISO	Ant1	5180	100.00	100.00	100.00	0.00	0.01
11N20SISO	Ant1	5200	100.00	100.00	100.00	0.00	0.01
11N20SISO	Ant1	5240	100.00	100.00	100.00	0.00	0.01
11N20SISO	Ant1	5745	100.00	100.00	100.00	0.00	0.01
11N20SISO	Ant1	5785	100.00	100.00	100.00	0.00	0.01
11N20SISO	Ant1	5825	100.00	100.00	100.00	0.00	0.01
11N40SISO	Ant1	5190	100.00	100.00	100.00	0.00	0.01
11N40SISO	Ant1	5230	100.00	100.00	100.00	0.00	0.01
11N40SISO	Ant1	5755	100.00	100.00	100.00	0.00	0.01
11N40SISO	Ant1	5795	100.00	100.00	100.00	0.00	0.01
11AC20SISO	Ant1	5180	100.00	100.00	100.00	0.00	0.01
11AC20SISO	Ant1	5200	100.00	100.00	100.00	0.00	0.01
11AC20SISO	Ant1	5240	100.00	100.00	100.00	0.00	0.01
11AC20SISO	Ant1	5745	100.00	100.00	100.00	0.00	0.01
11AC20SISO	Ant1	5785	100.00	100.00	100.00	0.00	0.01
11AC20SISO	Ant1	5825	100.00	100.00	100.00	0.00	0.01
11AC40SISO	Ant1	5190	100.00	100.00	100.00	0.00	0.01
11AC40SISO	Ant1	5230	100.00	100.00	100.00	0.00	0.01
11AC40SISO	Ant1	5755	100.00	100.00	100.00	0.00	0.01
11AC40SISO	Ant1	5795	100.00	100.00	100.00	0.00	0.01
11AC80SISO	Ant1	5210	100.00	100.00	100.00	0.00	0.01
11AC80SISO	Ant1	5775	100.00	100.00	100.00	0.00	0.01
11AX20SISO	Ant1	5180	100.00	100.00	100.00	0.00	0.01
11AX20SISO	Ant1	5200	100.00	100.00	100.00	0.00	0.01
11AX20SISO	Ant1	5240	100.00	100.00	100.00	0.00	0.01
11AX20SISO	Ant1	5745	100.00	100.00	100.00	0.00	0.01
11AX20SISO	Ant1	5785	100.00	100.00	100.00	0.00	0.01
11AX20SISO	Ant1	5825	100.00	100.00	100.00	0.00	0.01
11AX40SISO	Ant1	5190	100.00	100.00	100.00	0.00	0.01
11AX40SISO	Ant1	5230	100.00	100.00	100.00	0.00	0.01

Shenzhen Anbotech Compliance Laboratory Limited

11AX40SISO	Ant1	5755	100.00	100.00	100.00	0.00	0.01
11AX40SISO	Ant1	5795	100.00	100.00	100.00	0.00	0.01
11AX80SISO	Ant1	5210	100.00	100.00	100.00	0.00	0.01
11AX80SISO	Ant1	5775	100.00	100.00	100.00	0.00	0.01


Shenzhen Anbotek Compliance Laboratory Limited

Address: Sogood Industrial Zone Laboratory & 1/F. of Building D, Sogood Science and Technology Park,
Sanwei Community, Hangcheng Subdistrict, Bao'an District, Shenzhen, Guangdong, China
Tel: (86) 0755-26066440 Email: service@anbotek.com



Hotline
400-003-0500
www.anbotek.com


Test Graphs

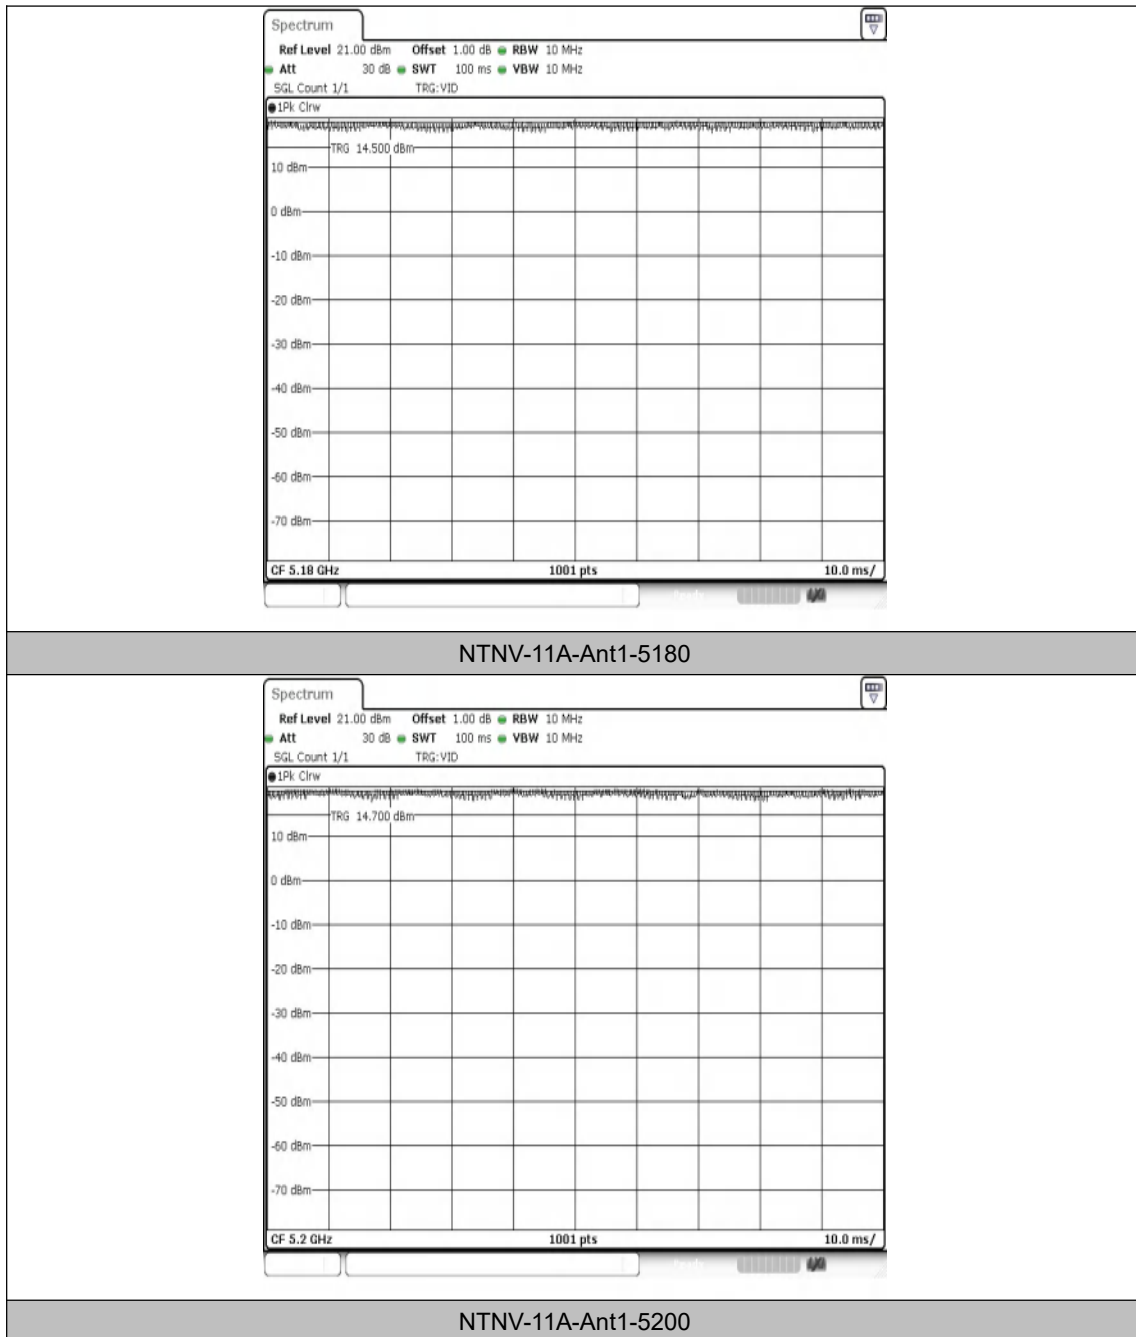

Shenzhen Anbotek Compliance Laboratory Limited

Address: Sogood Industrial Zone Laboratory & 1/F. of Building D, Sogood Science and Technology Park,
Sanwei Community, Hangcheng Subdistrict, Bao'an District, Shenzhen, Guangdong, China
Tel: (86) 0755-26066440 Email: service@anbotek.com


Hotline
400-003-0500
www.anbotek.com

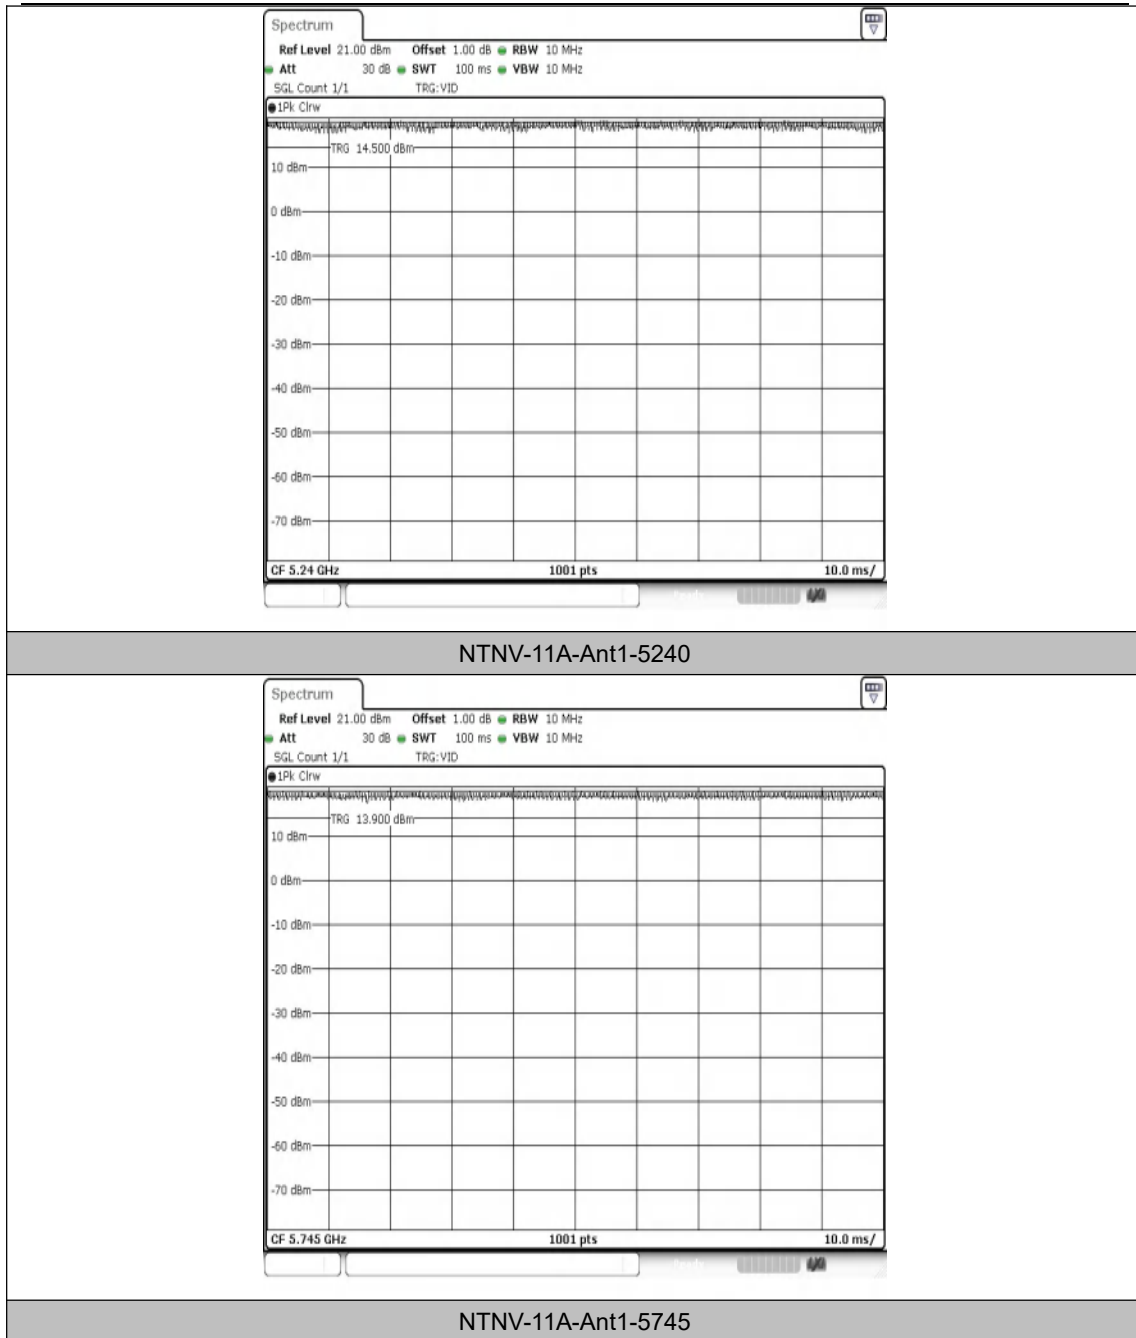

Shenzhen Anbotech Compliance Laboratory Limited

Address: Sogood Industrial Zone Laboratory & 1/F. of Building D, Sogood Science and Technology Park,
 Sanwei Community, Hangcheng Subdistrict, Bao'an District, Shenzhen, Guangdong, China
 Tel: (86) 0755-26066440 Email: service@anbotech.com


 Hotline
 400-003-0500
www.anbotech.com

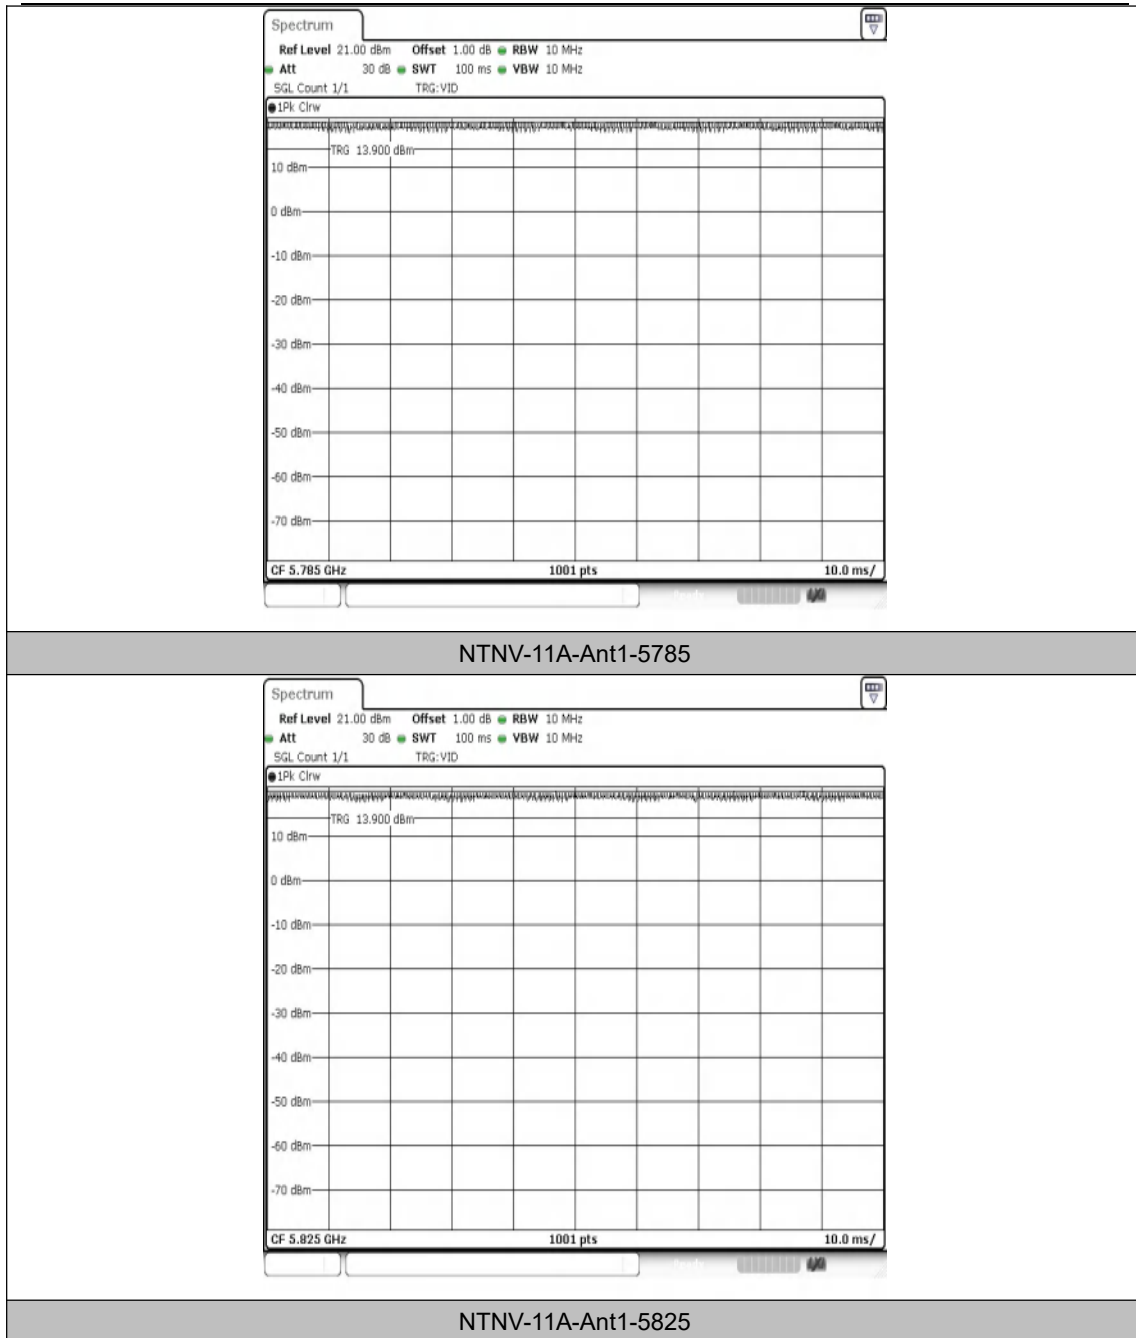

Shenzhen Anbotech Compliance Laboratory Limited

Address: Sogood Industrial Zone Laboratory & 1/F. of Building D, Sogood Science and Technology Park,
Sanwei Community, Hangcheng Subdistrict, Bao'an District, Shenzhen, Guangdong, China
Tel: (86) 0755-26066440 Email: service@anbotech.com


Hotline
400-003-0500
www.anbotech.com

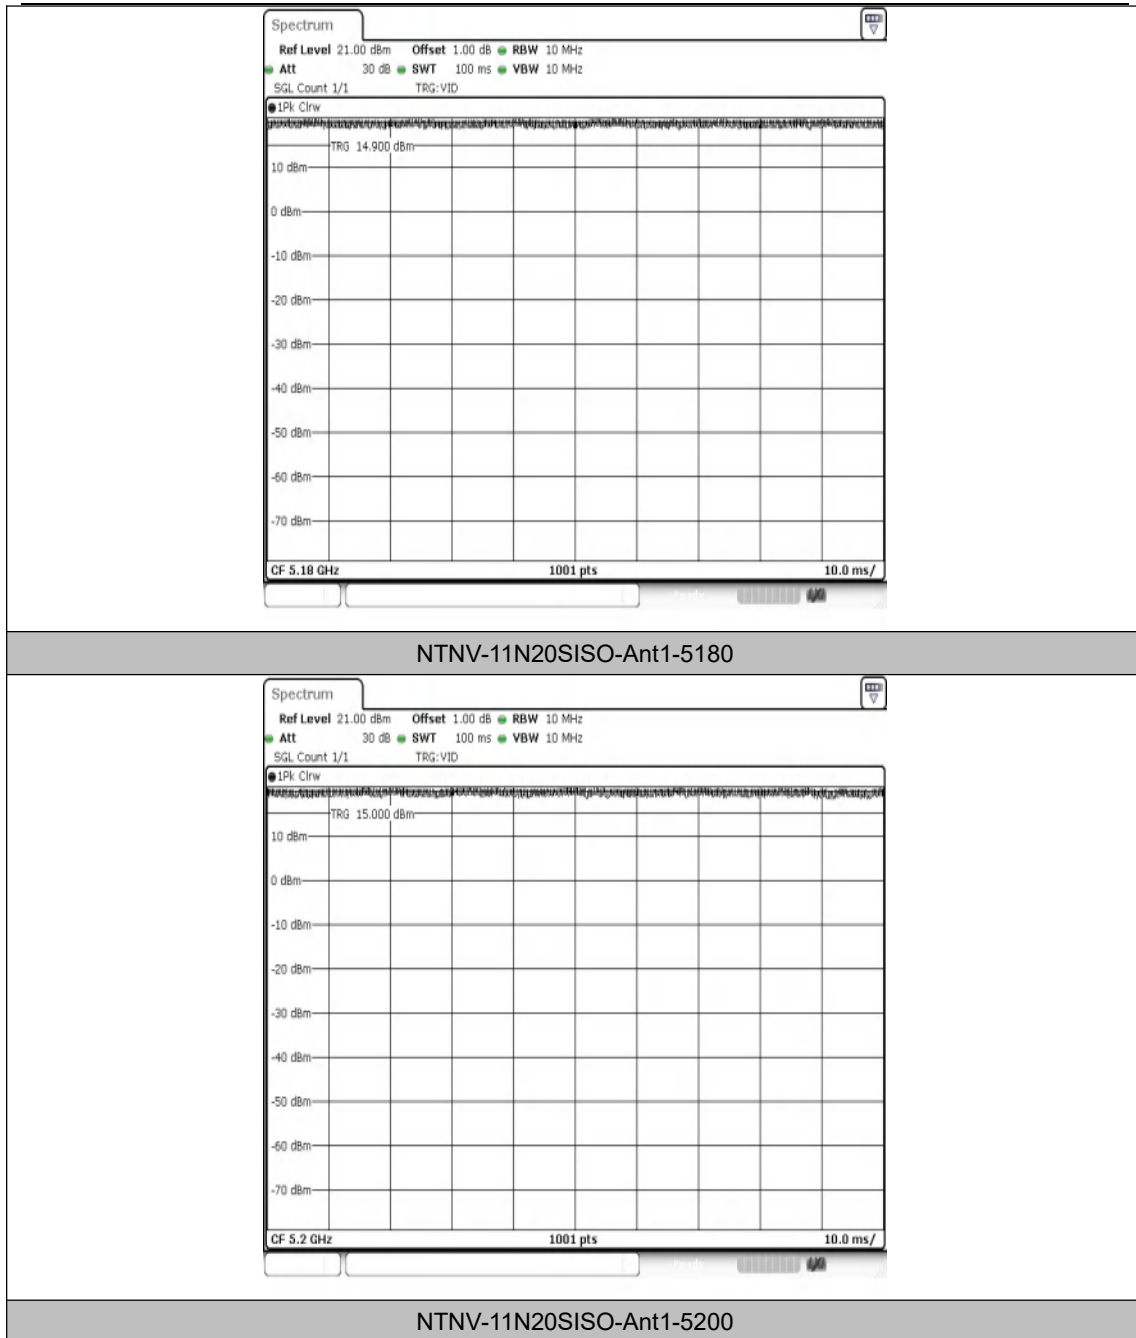

Shenzhen Anbotech Compliance Laboratory Limited

Address: Sogood Industrial Zone Laboratory & 1/F. of Building D, Sogood Science and Technology Park,
Sanwei Community, Hangcheng Subdistrict, Bao'an District, Shenzhen, Guangdong, China
Tel: (86) 0755-26066440 Email: service@anbotech.com


Hotline
400-003-0500
www.anbotech.com

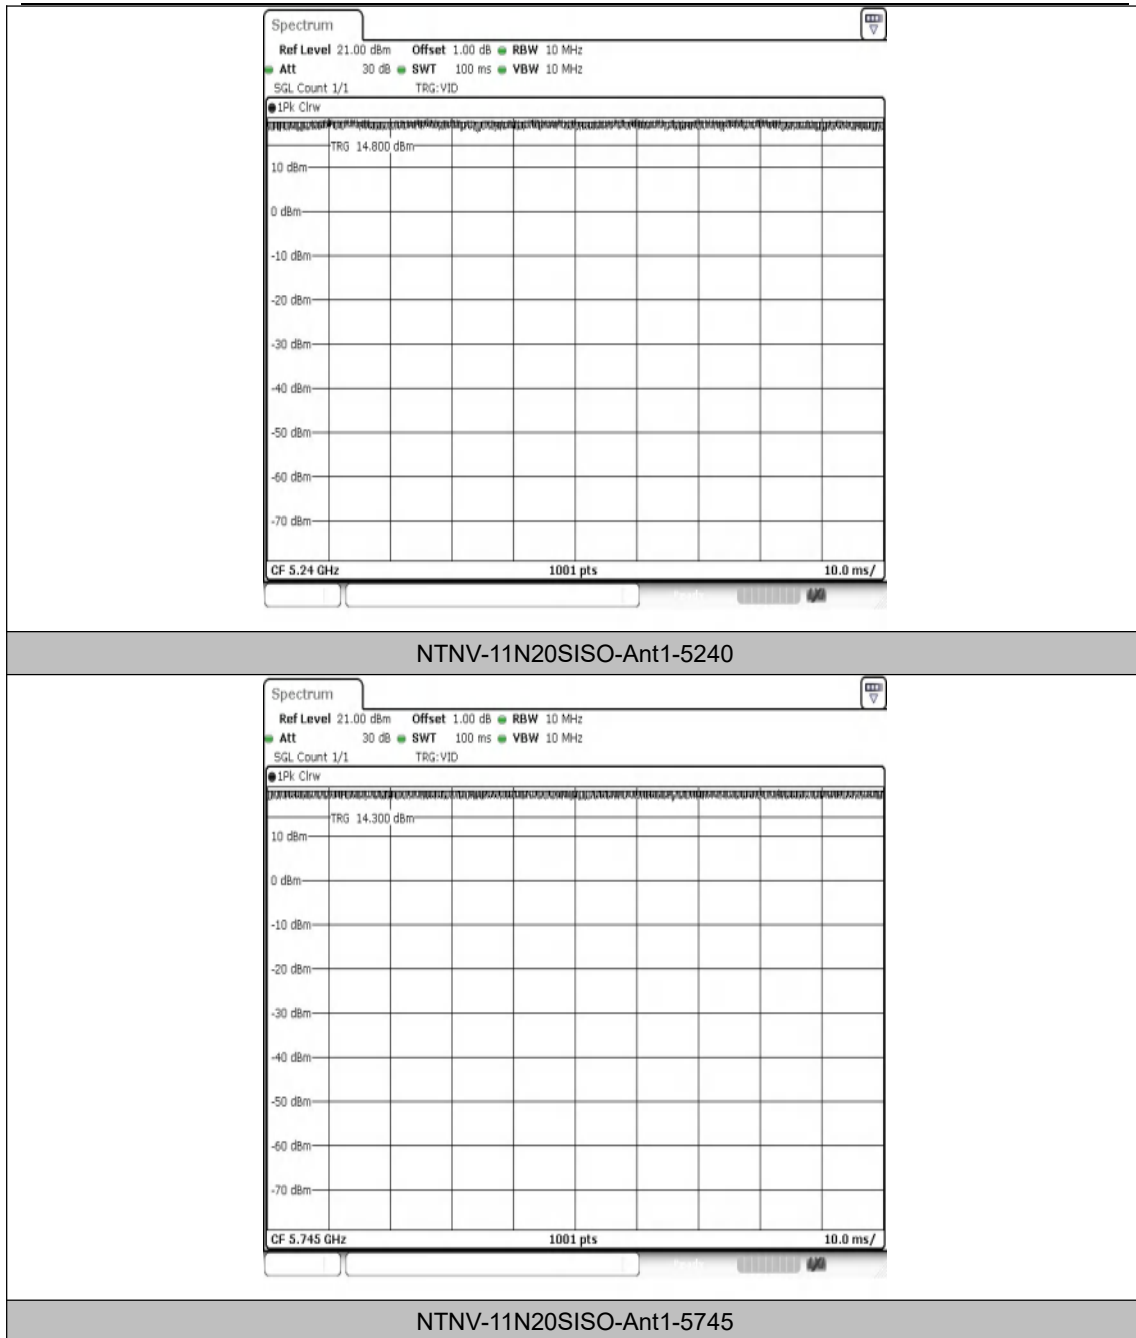

Shenzhen Anbotech Compliance Laboratory Limited

Address: Sogood Industrial Zone Laboratory & 1/F. of Building D, Sogood Science and Technology Park,
Sanwei Community, Hangcheng Subdistrict, Bao'an District, Shenzhen, Guangdong, China
Tel: (86) 0755-26066440 Email: service@anbotech.com


 Hotline
400-003-0500
www.anbotech.com

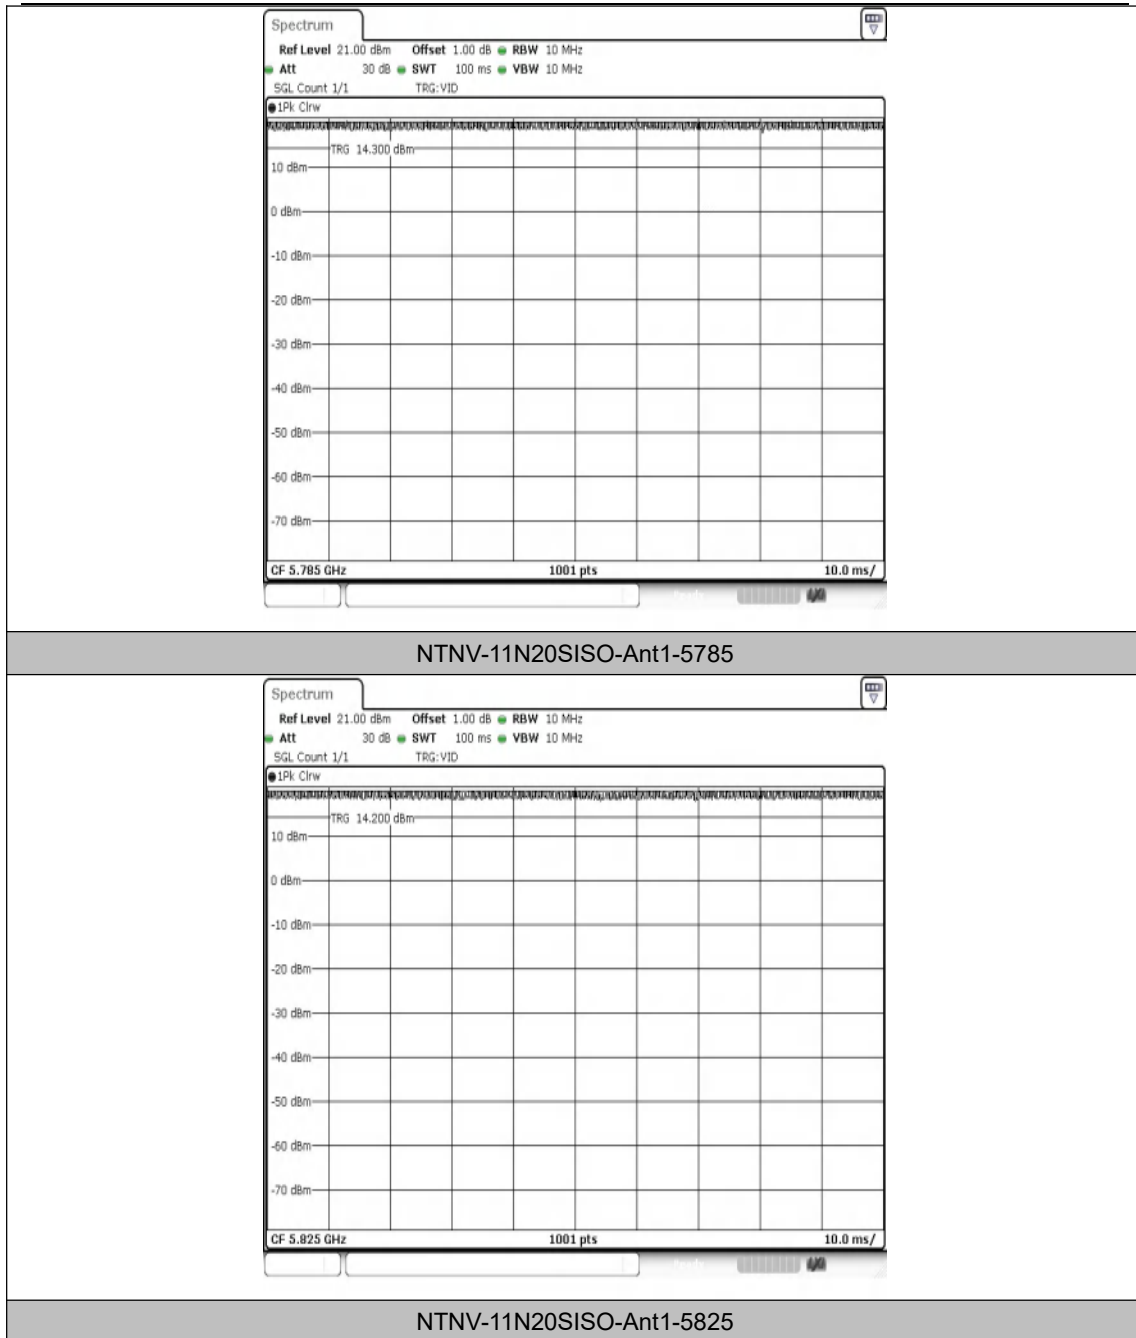

Shenzhen Anbotech Compliance Laboratory Limited

Address: Sogood Industrial Zone Laboratory & 1/F. of Building D, Sogood Science and Technology Park,
Sanwei Community, Hangcheng Subdistrict, Bao'an District, Shenzhen, Guangdong, China
Tel:(86)0755-26066440 Email:service@anbotech.com


Hotline
400-003-0500
www.anbotech.com

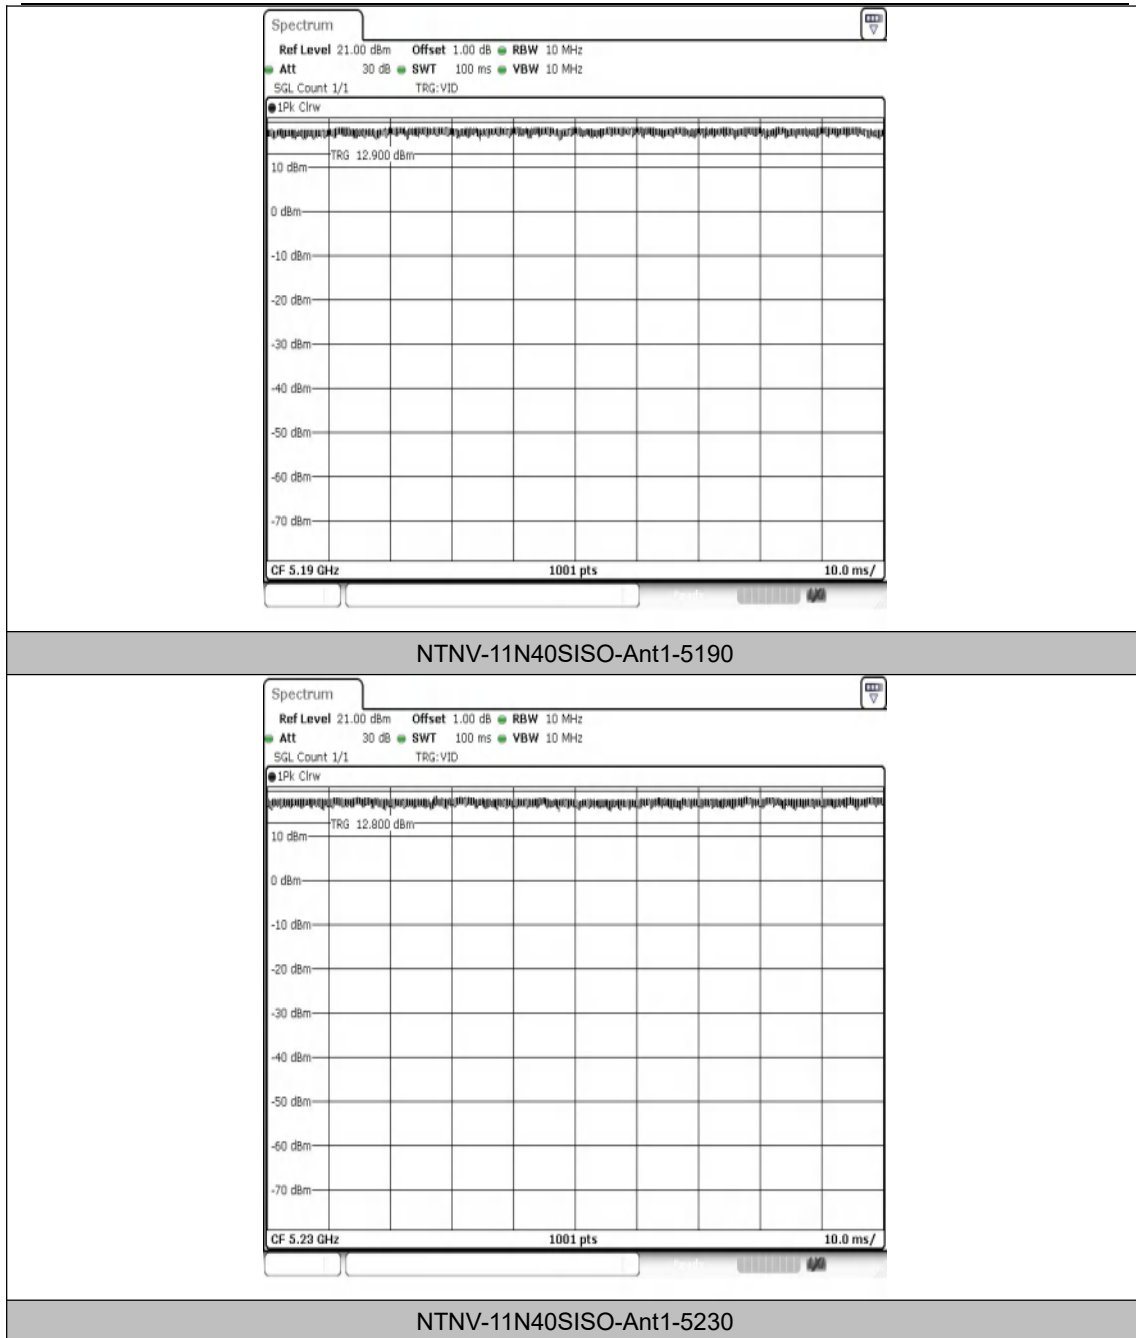

Shenzhen Anbotech Compliance Laboratory Limited

Address: Sogood Industrial Zone Laboratory & 1/F. of Building D, Sogood Science and Technology Park,
Sanwei Community, Hangcheng Subdistrict, Bao'an District, Shenzhen, Guangdong, China
Tel: (86) 0755-26066440 Email: service@anbotech.com


Hotline
400-003-0500
www.anbotech.com

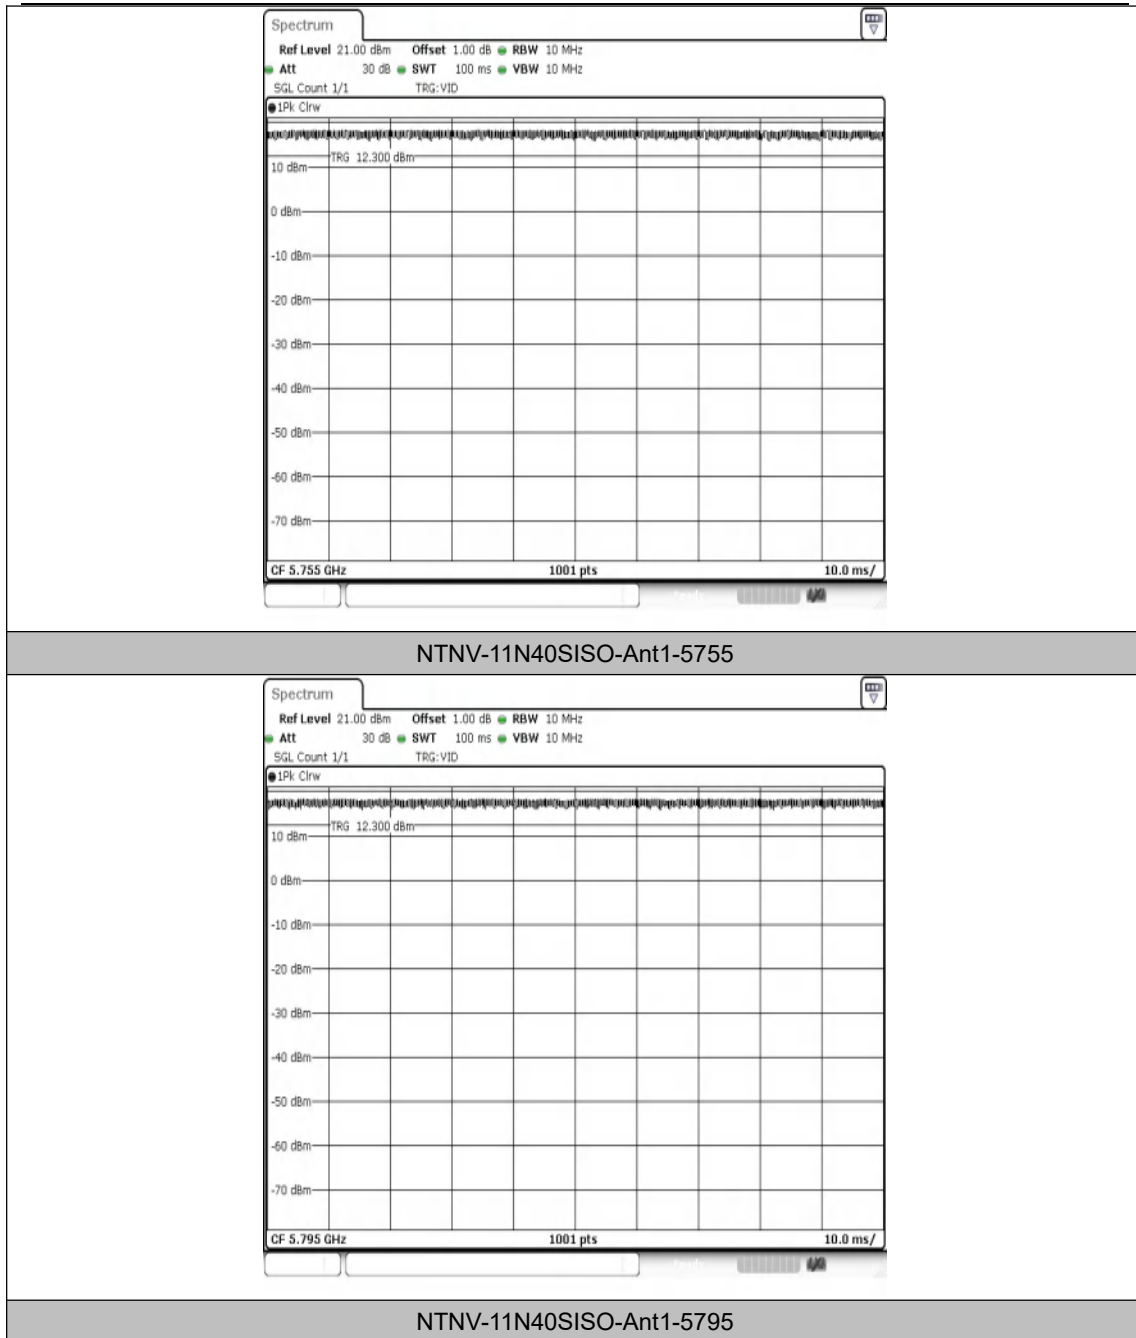

Shenzhen Anbotech Compliance Laboratory Limited

Address: Sogood Industrial Zone Laboratory & 1/F. of Building D, Sogood Science and Technology Park,
Sanwei Community, Hangcheng Subdistrict, Bao'an District, Shenzhen, Guangdong, China
Tel:(86)0755-26066440 Email:service@anbotech.com


Hotline
400-003-0500
www.anbotech.com

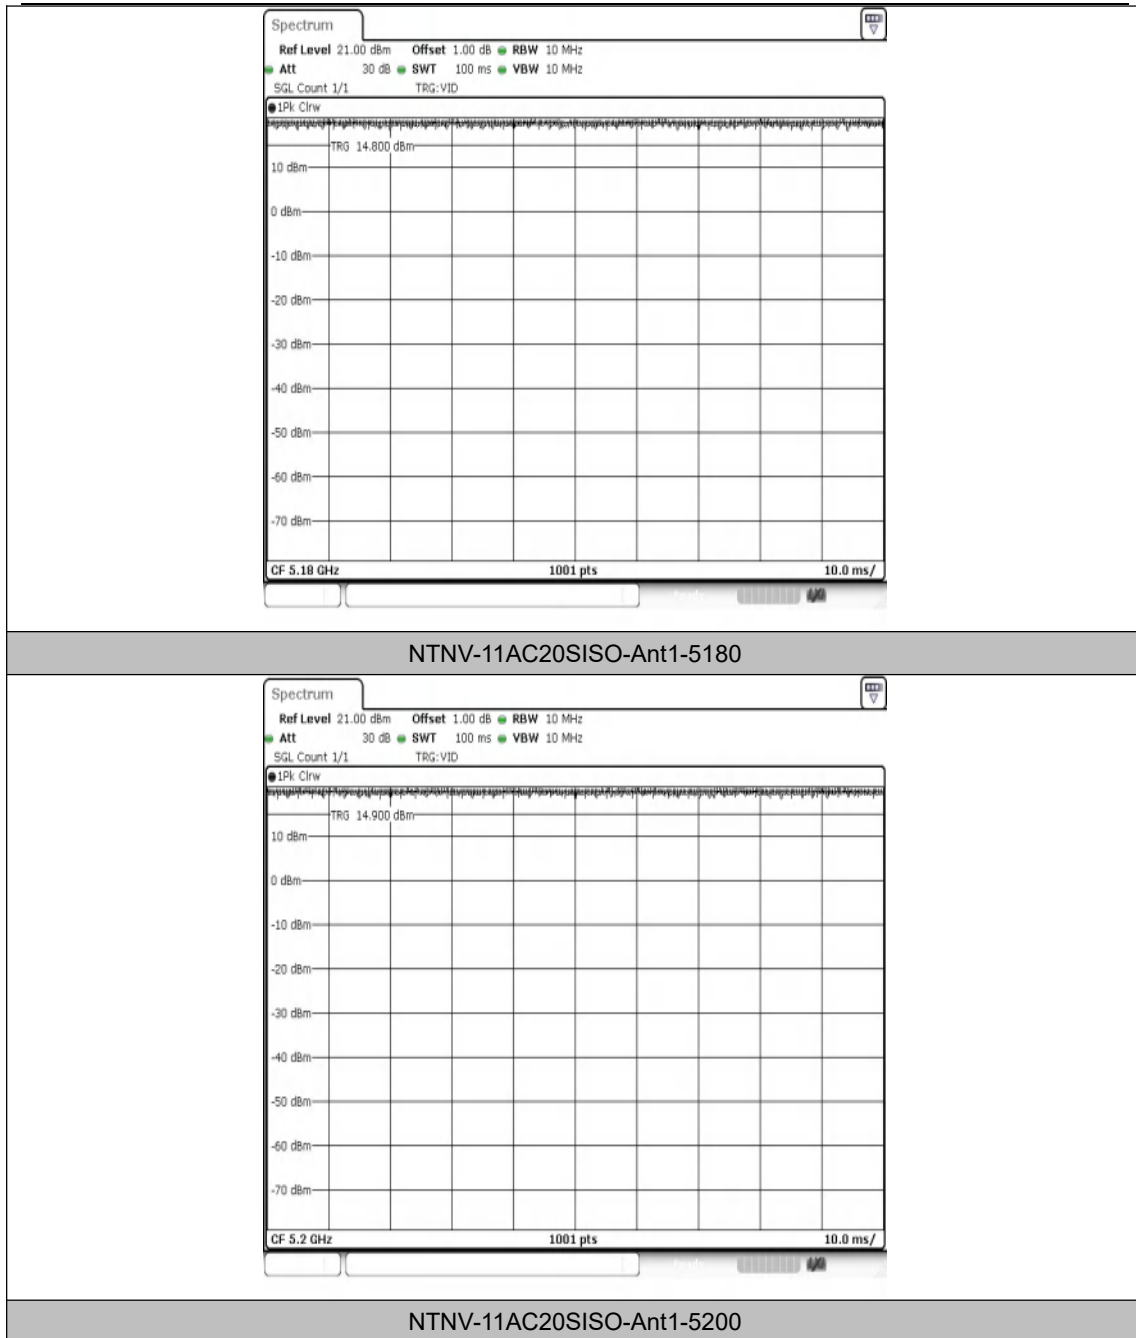

Shenzhen Anbotech Compliance Laboratory Limited

Address: Sogood Industrial Zone Laboratory & 1/F. of Building D, Sogood Science and Technology Park,
Sanwei Community, Hangcheng Subdistrict, Bao'an District, Shenzhen, Guangdong, China
Tel: (86) 0755-26066440 Email: service@anbotech.com


Hotline
400-003-0500
www.anbotech.com

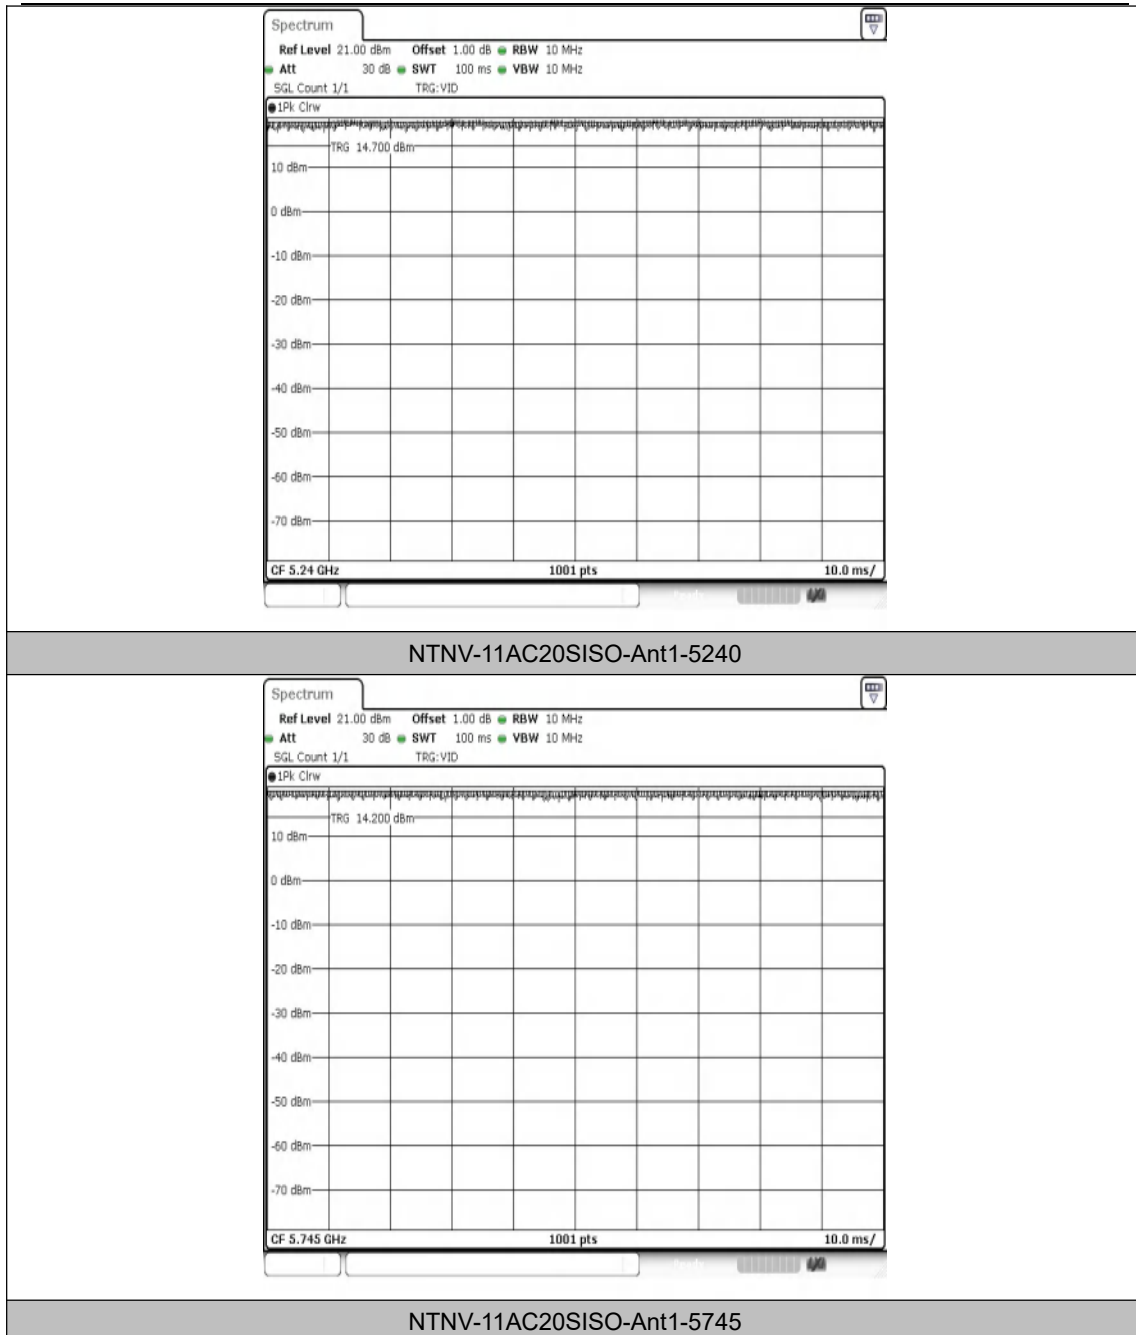

Shenzhen Anbotech Compliance Laboratory Limited

Address: Sogood Industrial Zone Laboratory & 1/F. of Building D, Sogood Science and Technology Park,
Sanwei Community, Hangcheng Subdistrict, Bao'an District, Shenzhen, Guangdong, China
Tel: (86) 0755-26066440 Email: service@anbotech.com


Hotline
400-003-0500
www.anbotech.com

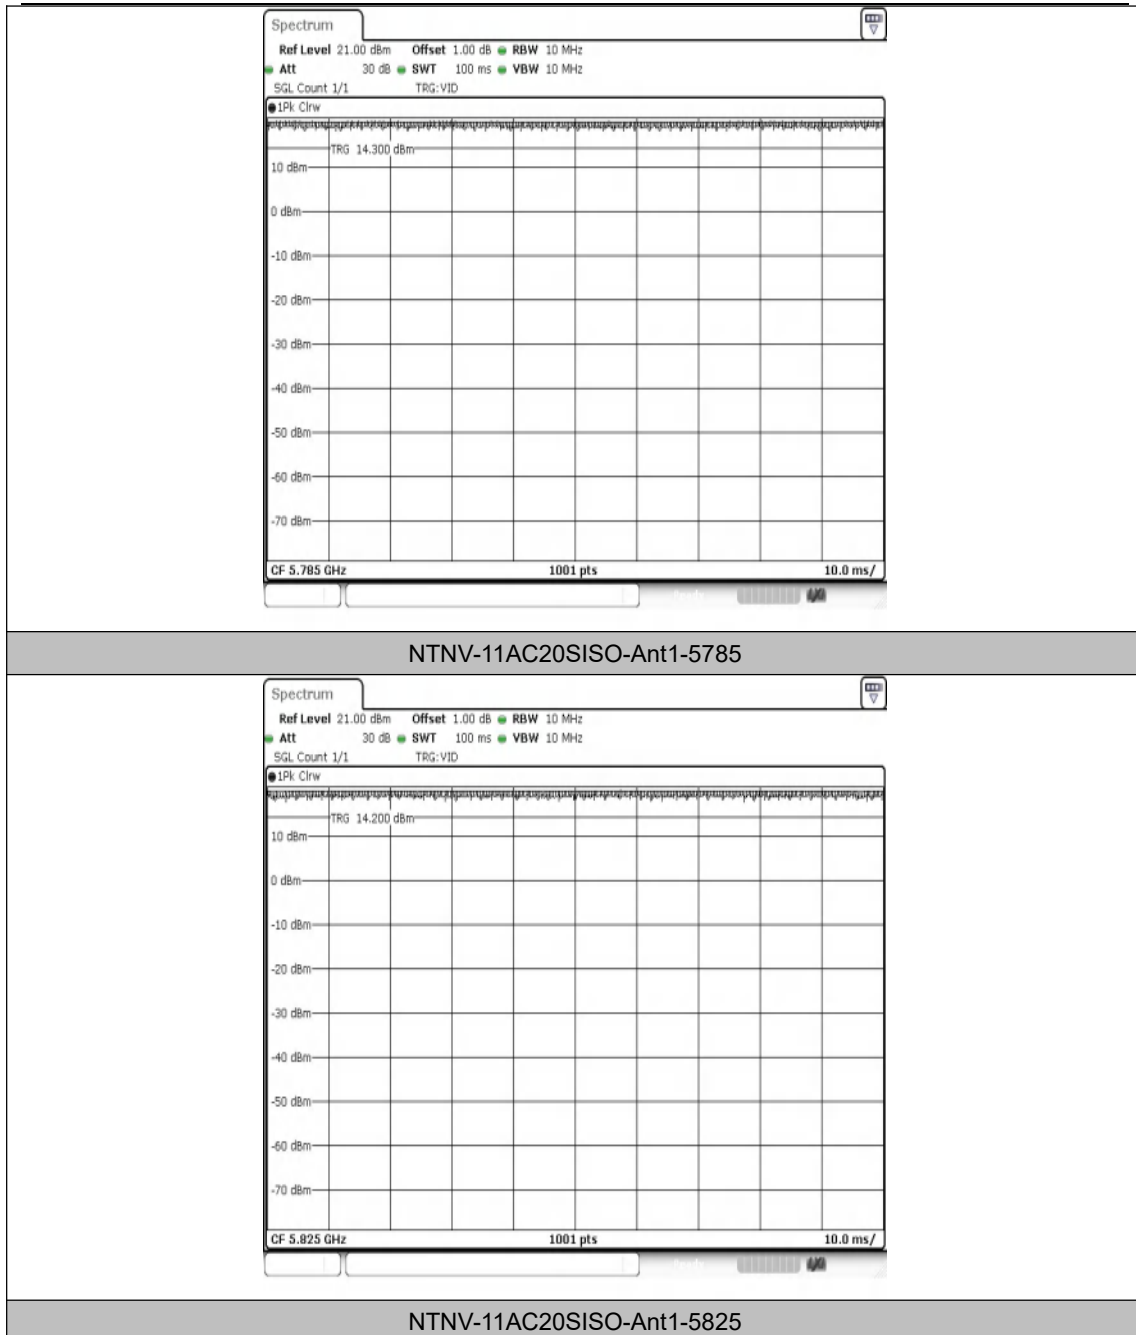

Shenzhen Anbotech Compliance Laboratory Limited

Address: Sogood Industrial Zone Laboratory & 1/F. of Building D, Sogood Science and Technology Park,
Sanwei Community, Hangcheng Subdistrict, Bao'an District, Shenzhen, Guangdong, China
Tel:(86)0755-26066440 Email:service@anbotech.com


Hotline
400-003-0500
www.anbotech.com

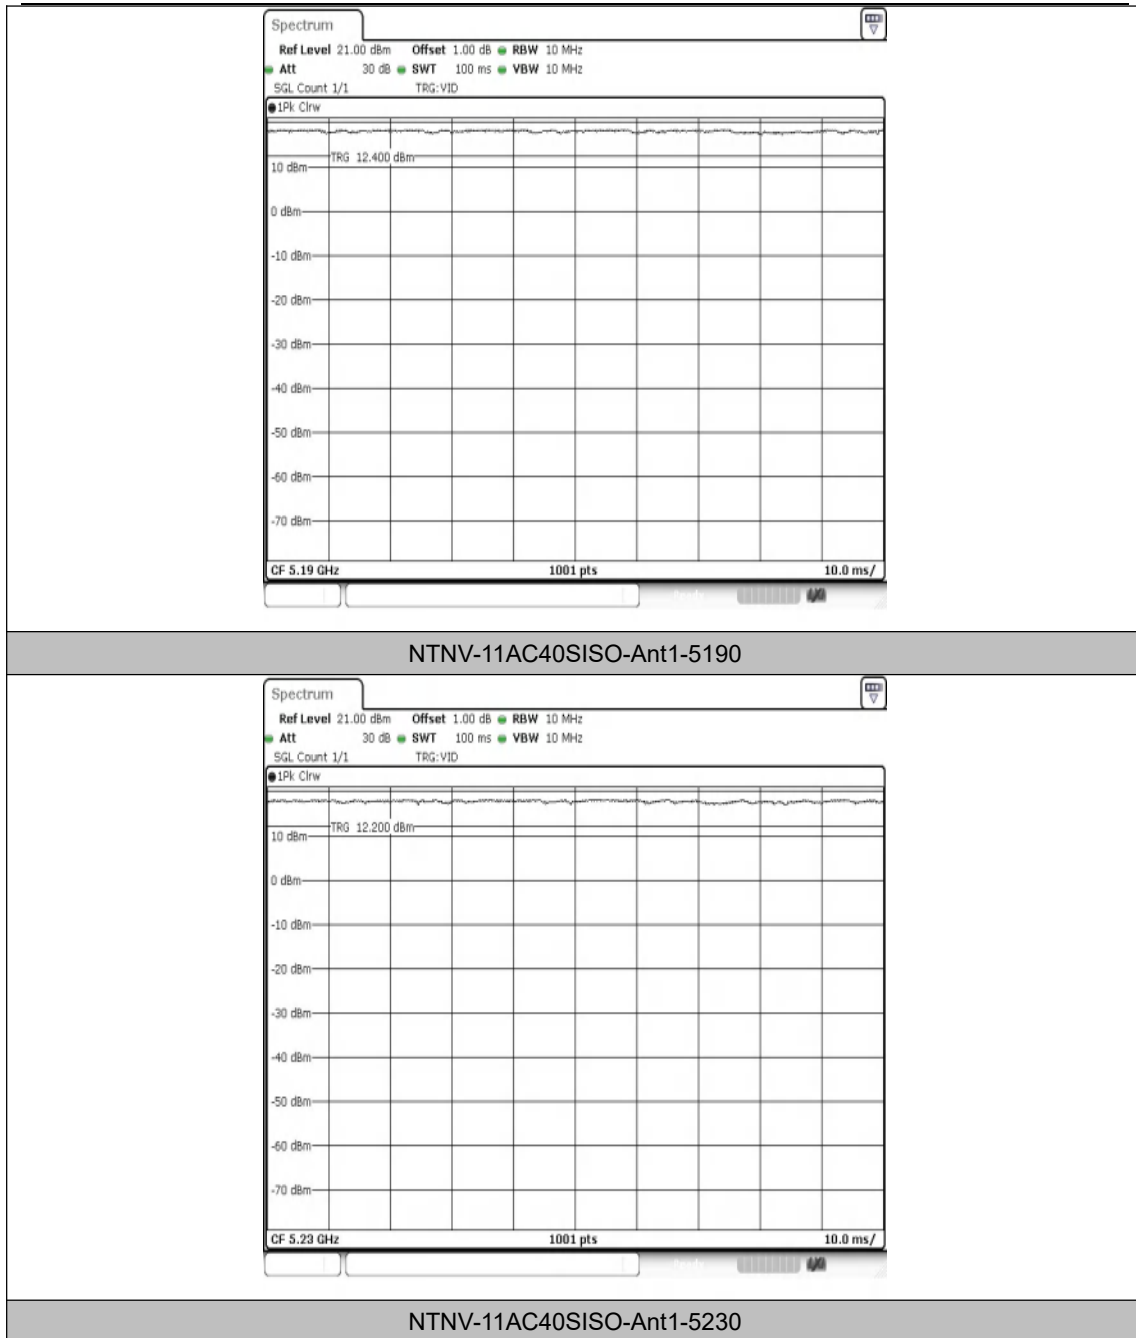

Shenzhen Anbotech Compliance Laboratory Limited

Address: Sogood Industrial Zone Laboratory & 1/F. of Building D, Sogood Science and Technology Park,
Sanwei Community, Hangcheng Subdistrict, Bao'an District, Shenzhen, Guangdong, China
Tel:(86)0755-26066440 Email:service@anbotech.com


Hotline
400-003-0500
www.anbotech.com

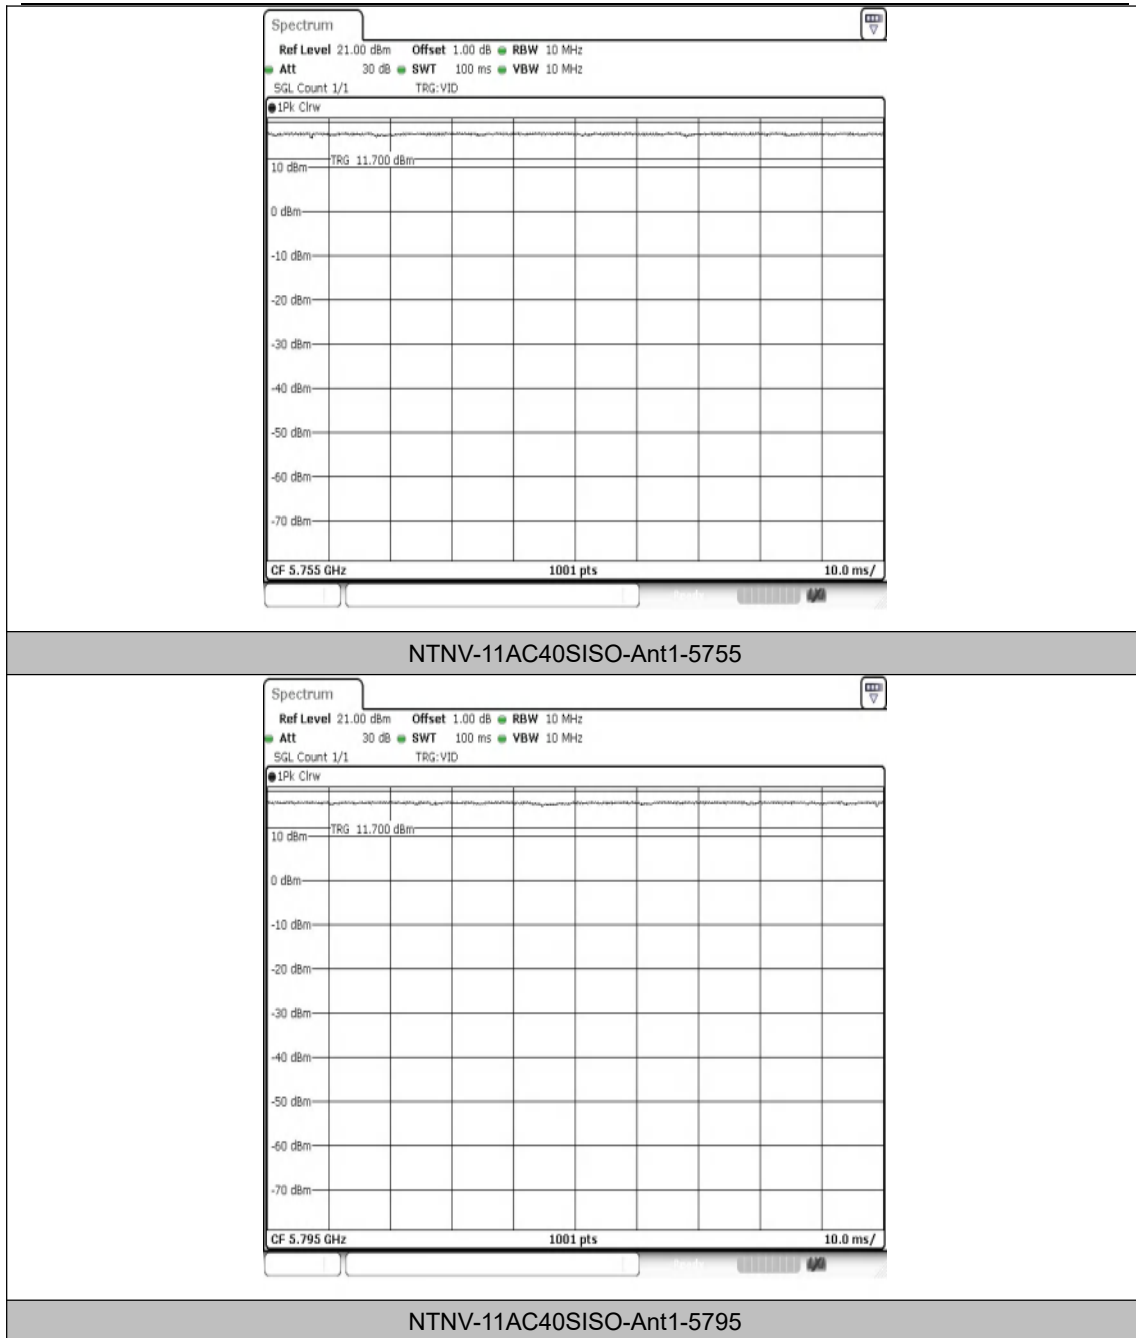

Shenzhen Anbotech Compliance Laboratory Limited

Address: Sogood Industrial Zone Laboratory & 1/F. of Building D, Sogood Science and Technology Park,
Sanwei Community, Hangcheng Subdistrict, Bao'an District, Shenzhen, Guangdong, China
Tel:(86)0755-26066440 Email:service@anbotech.com


Hotline
400-003-0500
www.anbotech.com

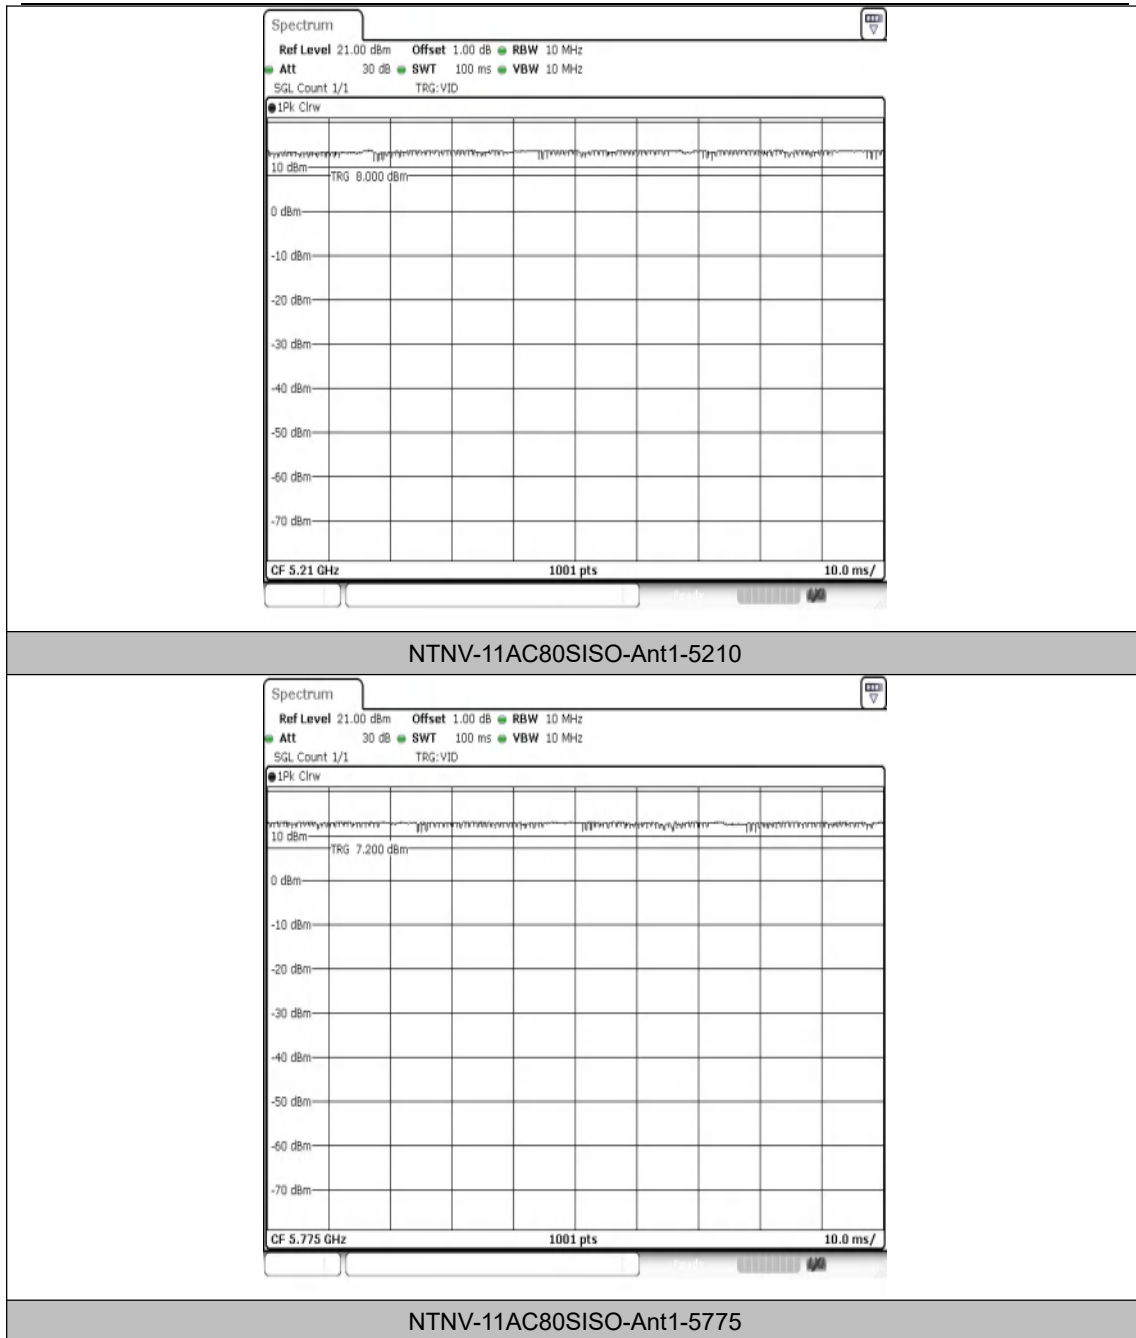


Shenzhen Anbotech Compliance Laboratory Limited

Address: Sogood Industrial Zone Laboratory & 1/F. of Building D, Sogood Science and Technology Park,
Sanwei Community, Hangcheng Subdistrict, Bao'an District, Shenzhen, Guangdong, China
Tel: (86) 0755-26066440 Email: service@anbotech.com

Hotline
400-003-0500
www.anbotech.com

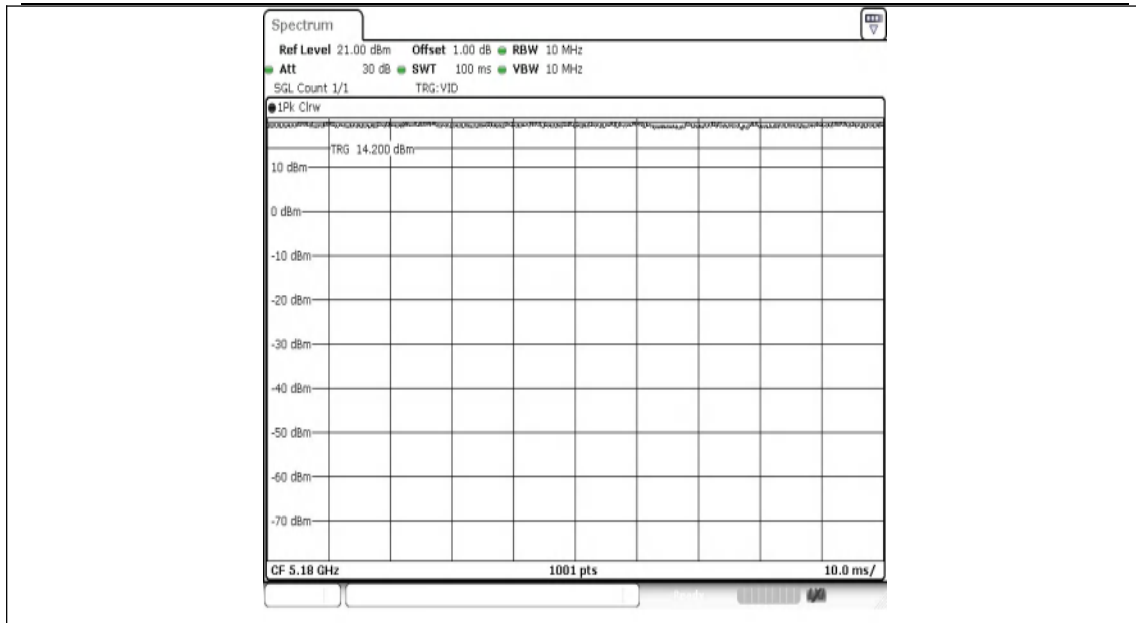

NTNV-11AX20SISO-Ant1-5180

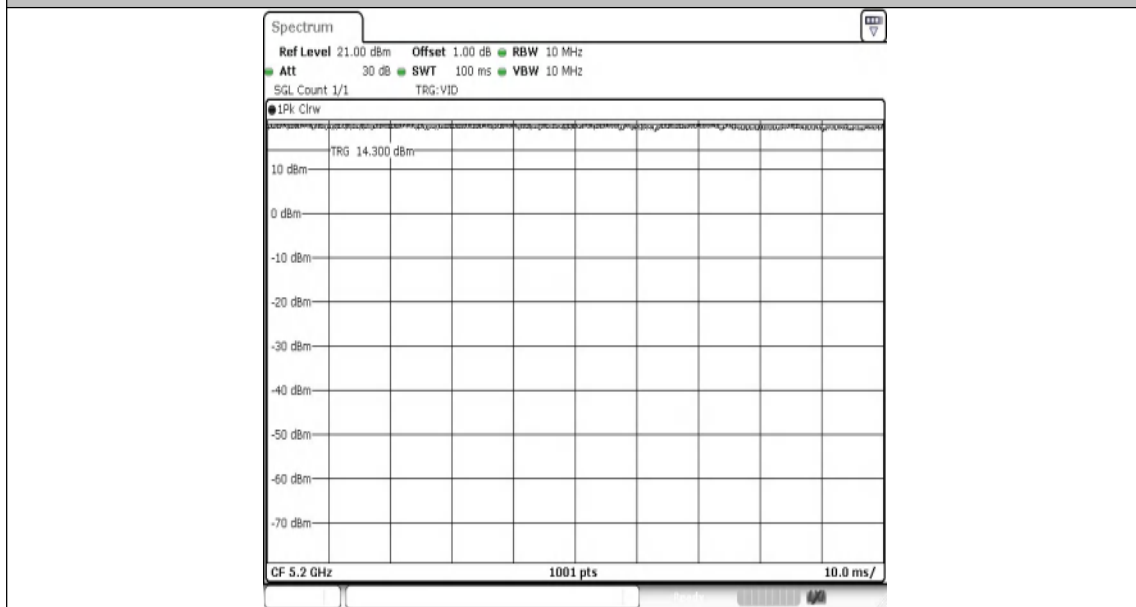


NTNV-11AX20SISO-Ant1-5200

Shenzhen Anbotech Compliance Laboratory Limited

Address: Sogood Industrial Zone Laboratory & 1/F. of Building D, Sogood Science and Technology Park,
Sanwei Community, Hangcheng Subdistrict, Bao'an District, Shenzhen, Guangdong, China
Tel:(86)0755-26066440 Email:service@anbotech.com


Hotline
400-003-0500
www.anbotech.com

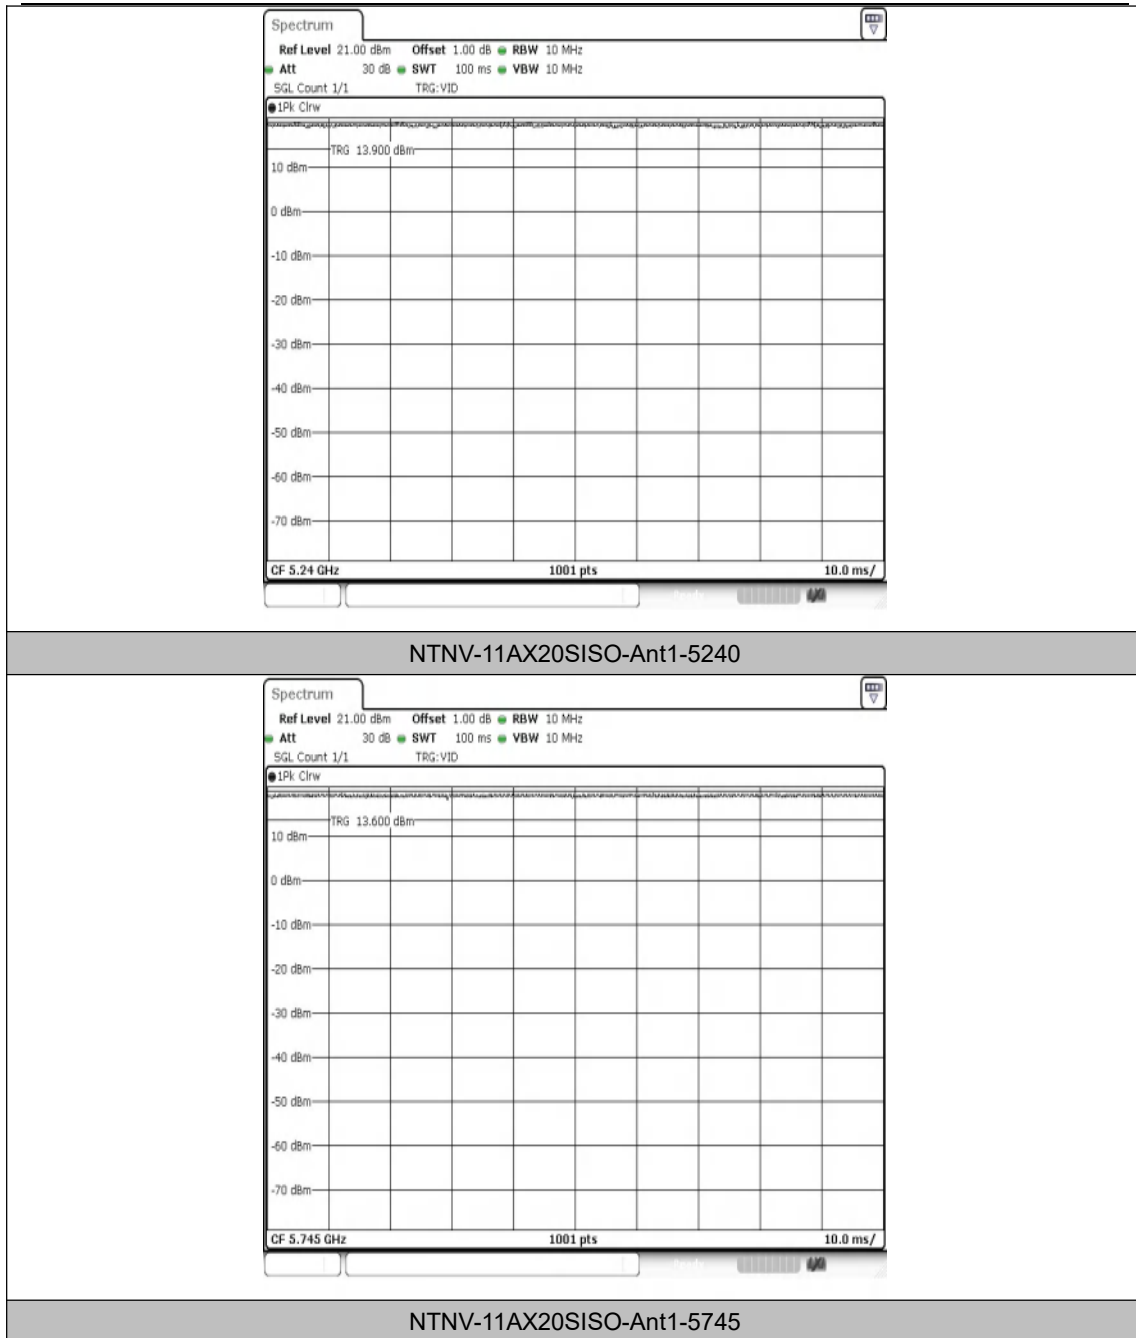

Shenzhen Anbotech Compliance Laboratory Limited

Address: Sogood Industrial Zone Laboratory & 1/F. of Building D, Sogood Science and Technology Park,
Sanwei Community, Hangcheng Subdistrict, Bao'an District, Shenzhen, Guangdong, China
Tel:(86)0755-26066440 Email:service@anbotech.com


Hotline
400-003-0500
www.anbotech.com

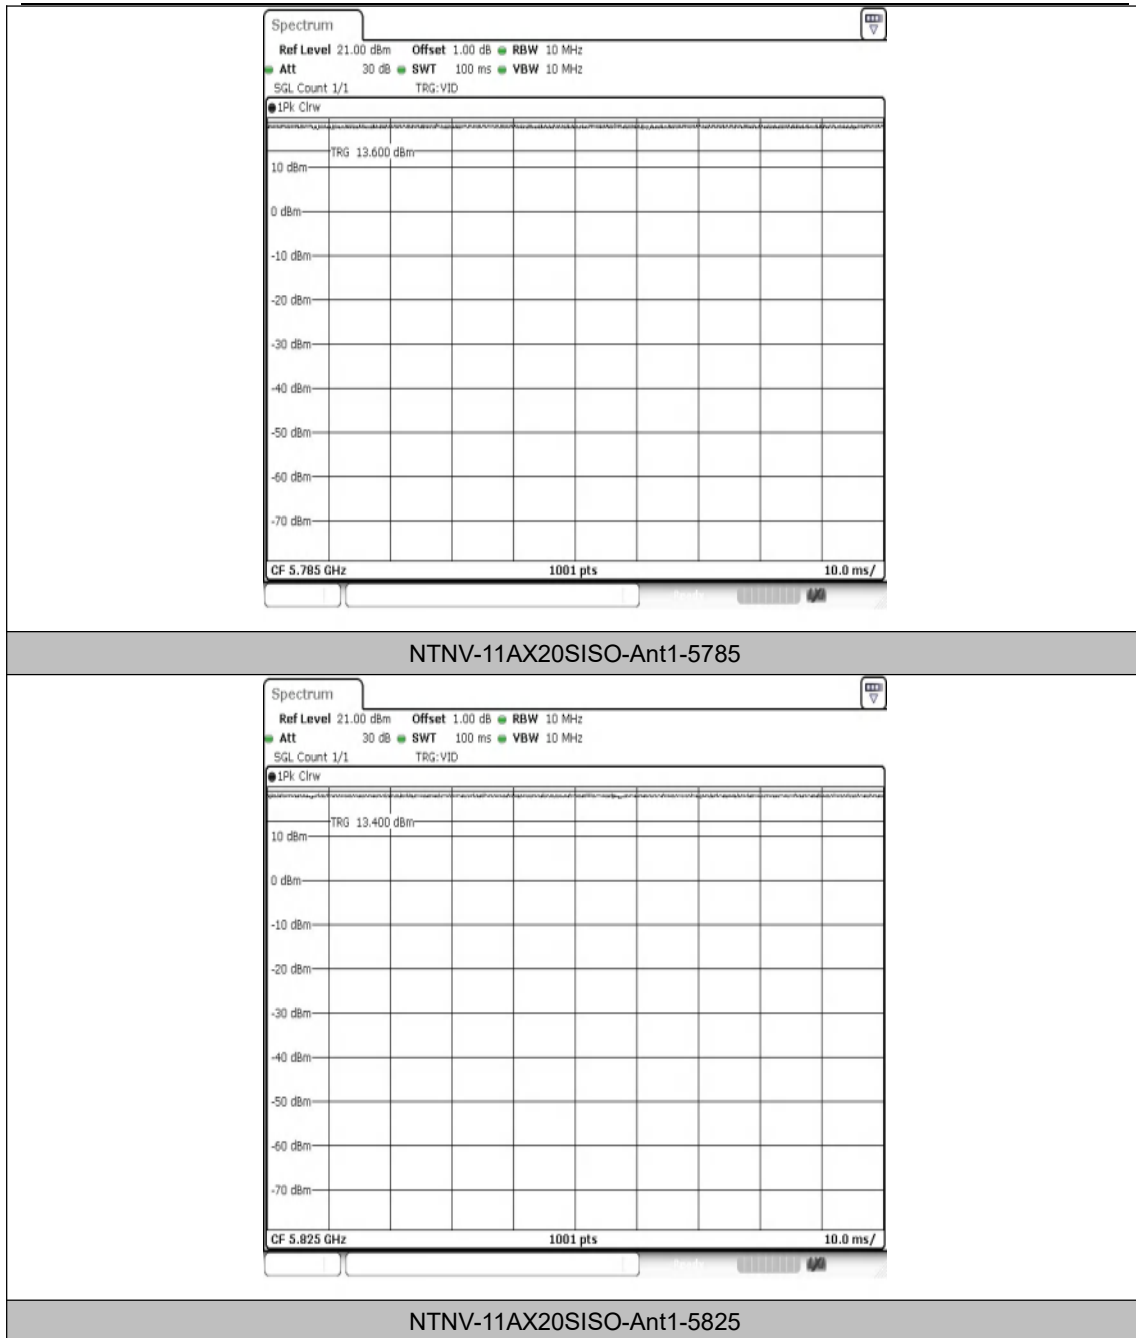

Shenzhen Anbotech Compliance Laboratory Limited

Address: Sogood Industrial Zone Laboratory & 1/F. of Building D, Sogood Science and Technology Park,
Sanwei Community, Hangcheng Subdistrict, Bao'an District, Shenzhen, Guangdong, China
Tel:(86)0755-26066440 Email:service@anbotech.com


Hotline
400-003-0500
www.anbotech.com

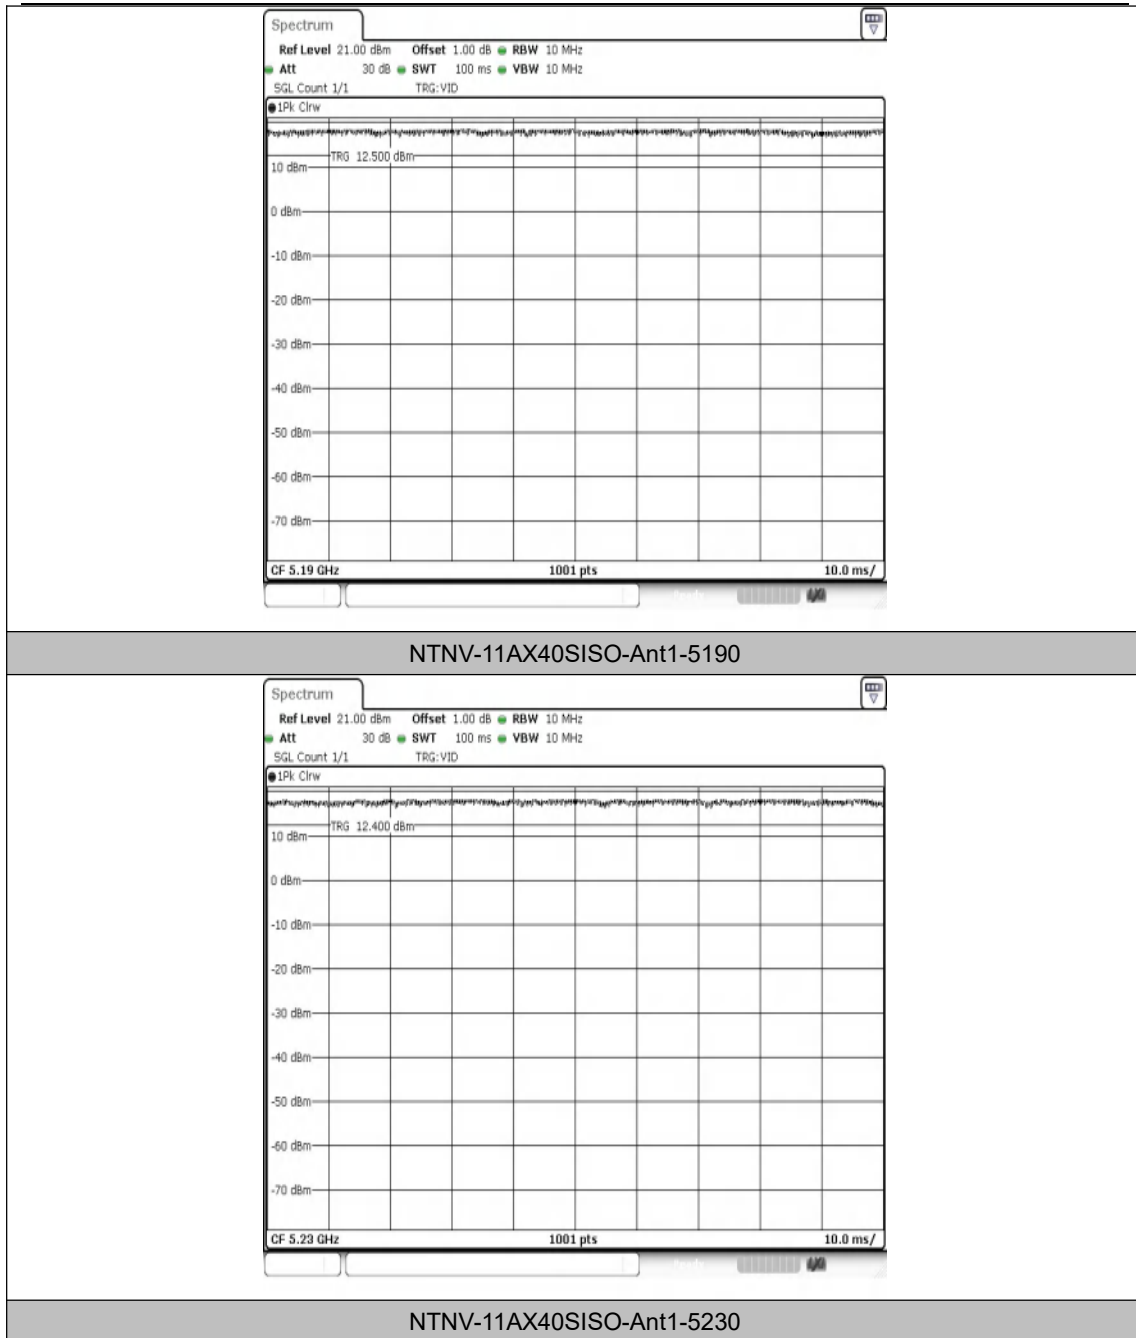

Shenzhen Anbotech Compliance Laboratory Limited

Address: Sogood Industrial Zone Laboratory & 1/F. of Building D, Sogood Science and Technology Park,
Sanwei Community, Hangcheng Subdistrict, Bao'an District, Shenzhen, Guangdong, China
Tel:(86)0755-26066440 Email:service@anbotech.com


Hotline
400-003-0500
www.anbotech.com

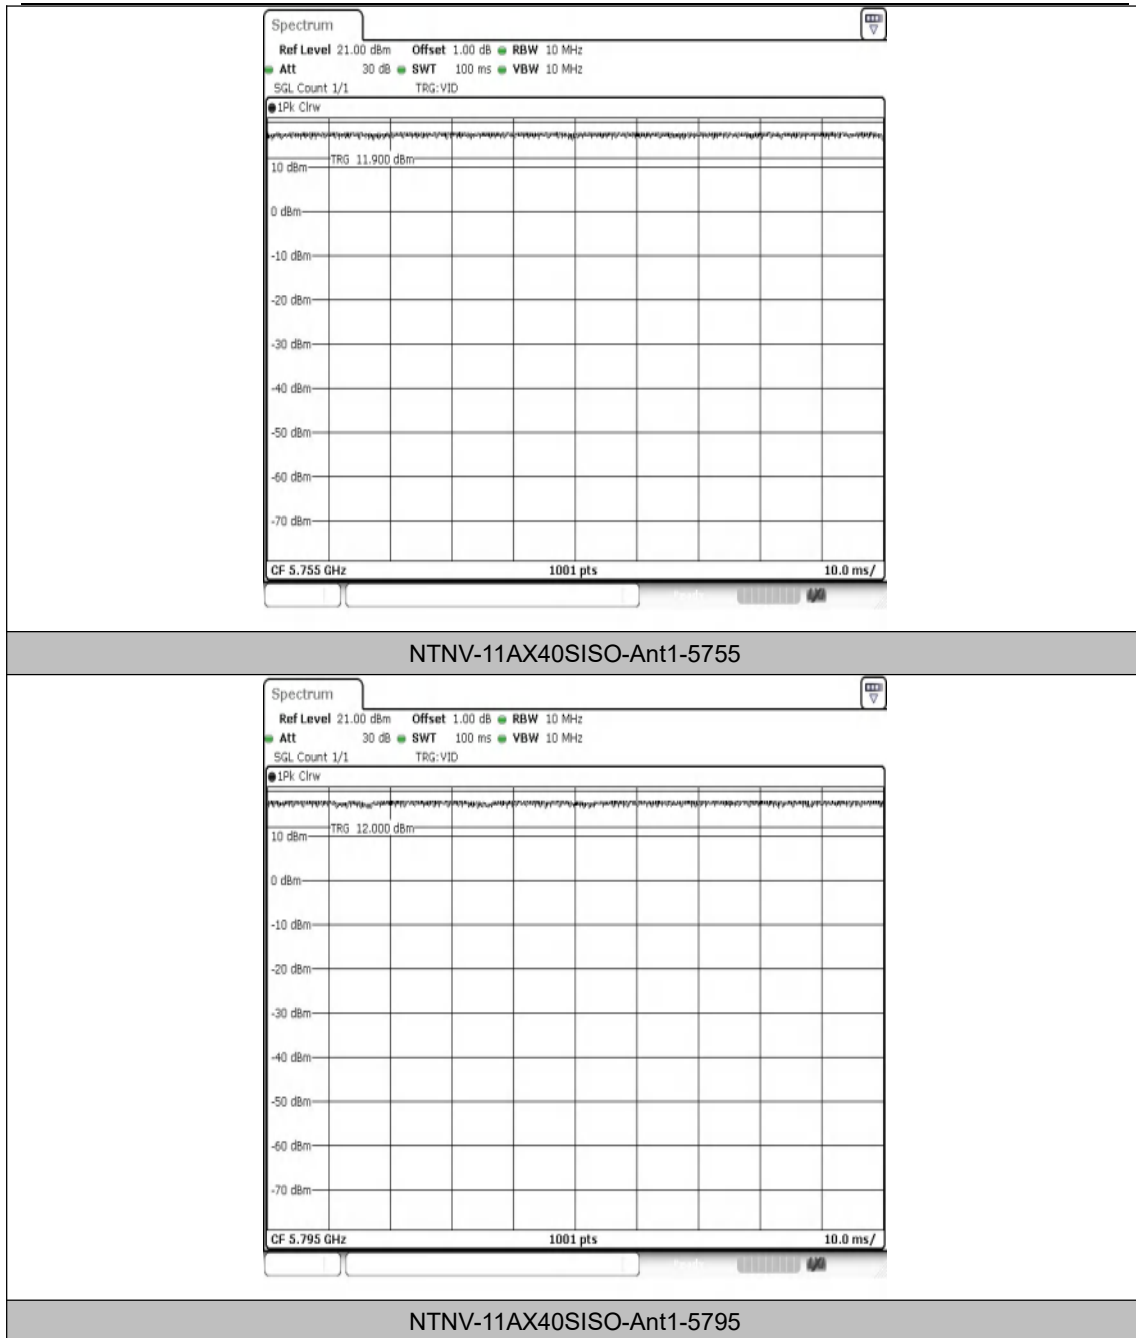

Shenzhen Anbotech Compliance Laboratory Limited

Address: Sogood Industrial Zone Laboratory & 1/F. of Building D, Sogood Science and Technology Park,
Sanwei Community, Hangcheng Subdistrict, Bao'an District, Shenzhen, Guangdong, China
Tel: (86) 0755-26066440 Email: service@anbotech.com

Hotline
400-003-0500
www.anbotech.com

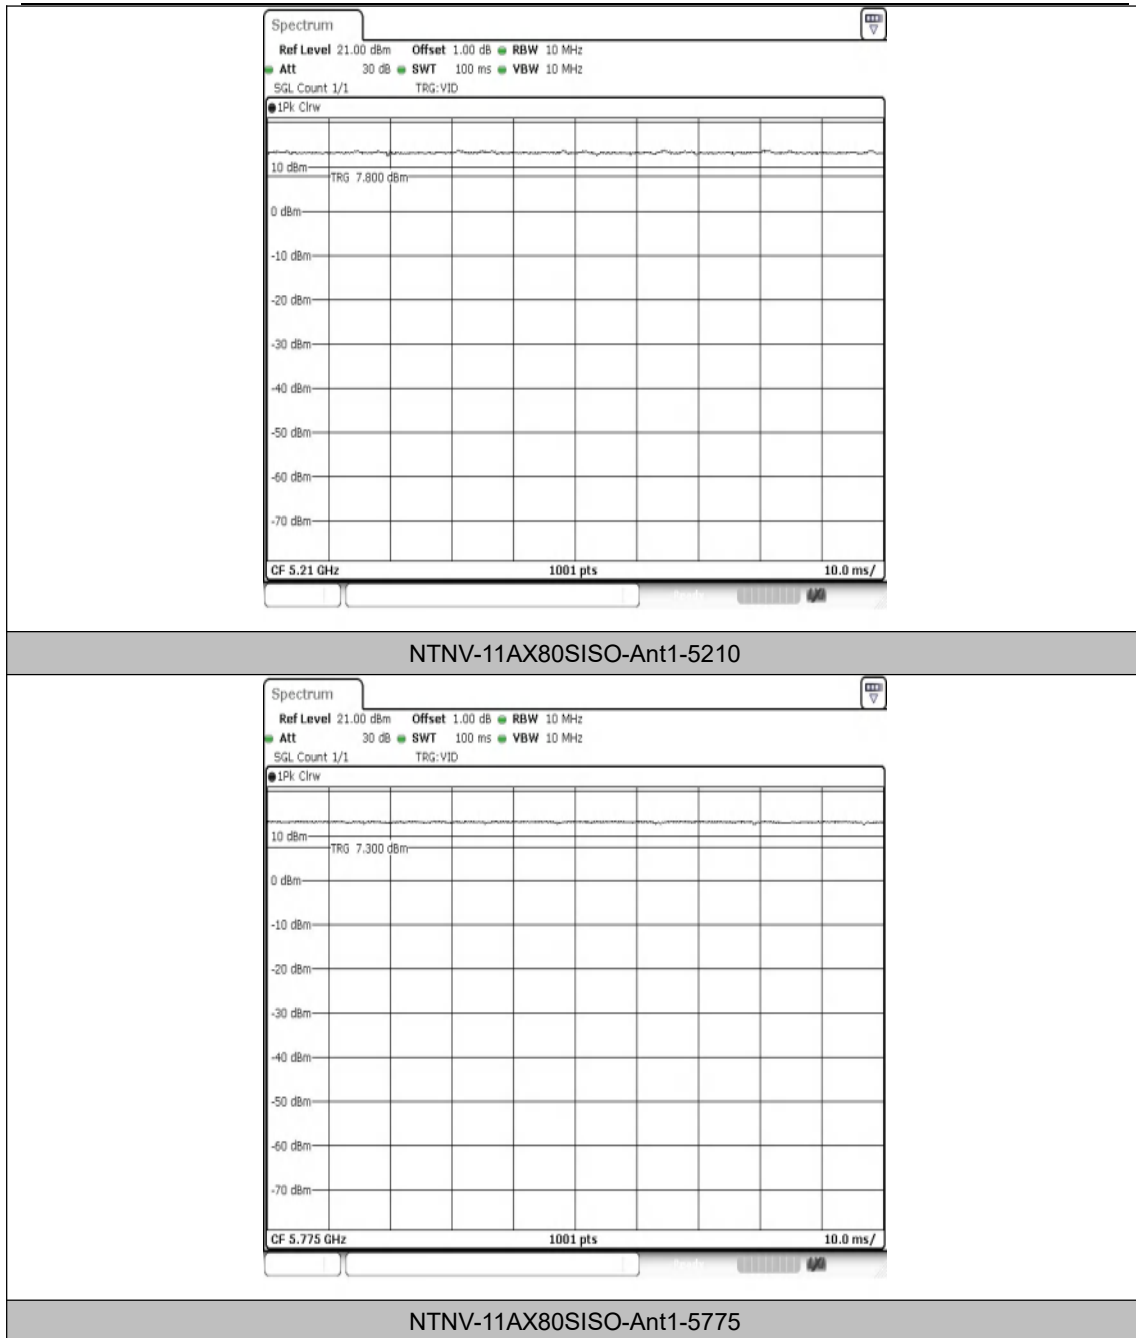

Shenzhen Anbotech Compliance Laboratory Limited

Address: Sogood Industrial Zone Laboratory & 1/F. of Building D, Sogood Science and Technology Park,
Sanwei Community, Hangcheng Subdistrict, Bao'an District, Shenzhen, Guangdong, China
Tel:(86)0755-26066440 Email:service@anbotech.com

Hotline
400-003-0500
www.anbotech.com

Appendix C: Maximum Conducted Output Power


Test Result Channel Power

Test Mode	Antenna	Frequency[MHz]	Set Power	Channel Power [dBm]	Duty Cycle [%]	DC Factor [dB]	Result [dBm]	Limit [dBm]	Verdict
11A	Ant1	5180	---	12.53	100.00	0.00	12.53	≤23.98	PASS
11A	Ant1	5200	---	12.82	100.00	0.00	12.82	≤23.98	PASS
11A	Ant1	5240	---	12.54	100.00	0.00	12.54	≤23.98	PASS
11A	Ant1	5745	---	12.37	100.00	0.00	12.37	≤30.00	PASS
11A	Ant1	5785	---	12.47	100.00	0.00	12.47	≤30.00	PASS
11A	Ant1	5825	---	12.39	100.00	0.00	12.39	≤30.00	PASS
11N20SISO	Ant1	5180	---	12.59	100.00	0.00	12.59	≤23.98	PASS
11N20SISO	Ant1	5200	---	12.67	100.00	0.00	12.67	≤23.98	PASS
11N20SISO	Ant1	5240	---	12.41	100.00	0.00	12.41	≤23.98	PASS
11N20SISO	Ant1	5745	---	12.23	100.00	0.00	12.23	≤30.00	PASS
11N20SISO	Ant1	5785	---	12.32	100.00	0.00	12.32	≤30.00	PASS
11N20SISO	Ant1	5825	---	12.23	100.00	0.00	12.23	≤30.00	PASS
11N40SISO	Ant1	5190	---	12.95	100.00	0.00	12.95	≤23.98	PASS
11N40SISO	Ant1	5230	---	12.62	100.00	0.00	12.62	≤23.98	PASS
11N40SISO	Ant1	5755	---	12.42	100.00	0.00	12.42	≤30.00	PASS
11N40SISO	Ant1	5795	---	12.54	100.00	0.00	12.54	≤30.00	PASS
11AC20SISO	Ant1	5180	---	12.57	100.00	0.00	12.57	≤23.98	PASS
11AC20SISO	Ant1	5200	---	12.68	100.00	0.00	12.68	≤23.98	PASS
11AC20SISO	Ant1	5240	---	12.38	100.00	0.00	12.38	≤23.98	PASS
11AC20SISO	Ant1	5745	---	12.28	100.00	0.00	12.28	≤30.00	PASS
11AC20SISO	Ant1	5785	---	12.32	100.00	0.00	12.32	≤30.00	PASS
11AC20SISO	Ant1	5825	---	12.28	100.00	0.00	12.28	≤30.00	PASS
11AC40SISO	Ant1	5190	---	13.12	100.00	0.00	13.12	≤23.98	PASS
11AC40SISO	Ant1	5230	---	12.91	100.00	0.00	12.91	≤23.98	PASS
11AC40SISO	Ant1	5755	---	12.47	100.00	0.00	12.47	≤30.00	PASS
11AC40SISO	Ant1	5795	---	12.57	100.00	0.00	12.57	≤30.00	PASS
11AC80SISO	Ant1	5210	---	12.35	100.00	0.00	12.35	≤23.98	PASS
11AC80SISO	Ant1	5775	---	11.90	100.00	0.00	11.90	≤30.00	PASS
11AX20SISO	Ant1	5180	---	12.26	100.00	0.00	12.26	≤23.98	PASS
11AX20SISO	Ant1	5200	---	12.35	100.00	0.00	12.35	≤23.98	PASS
11AX20SISO	Ant1	5240	---	12.34	100.00	0.00	12.34	≤23.98	PASS
11AX20SISO	Ant1	5745	---	12.05	100.00	0.00	12.05	≤30.00	PASS
11AX20SISO	Ant1	5785	---	12.08	100.00	0.00	12.08	≤30.00	PASS
11AX20SISO	Ant1	5825	---	11.98	100.00	0.00	11.98	≤30.00	PASS
11AX40SISO	Ant1	5190	---	12.85	100.00	0.00	12.85	≤23.98	PASS

11AX40SISO	Ant1	5230	---	12.63	100.00	0.00	12.63	≤23.98	PASS
11AX40SISO	Ant1	5755	---	12.30	100.00	0.00	12.30	≤30.00	PASS
11AX40SISO	Ant1	5795	---	12.42	100.00	0.00	12.42	≤30.00	PASS
11AX80SISO	Ant1	5210	---	12.25	100.00	0.00	12.25	≤23.98	PASS
11AX80SISO	Ant1	5775	---	12.17	100.00	0.00	12.17	≤30.00	PASS

Note: 1.The cable loss are compensated in the graph.


Test Graphs Channel Power

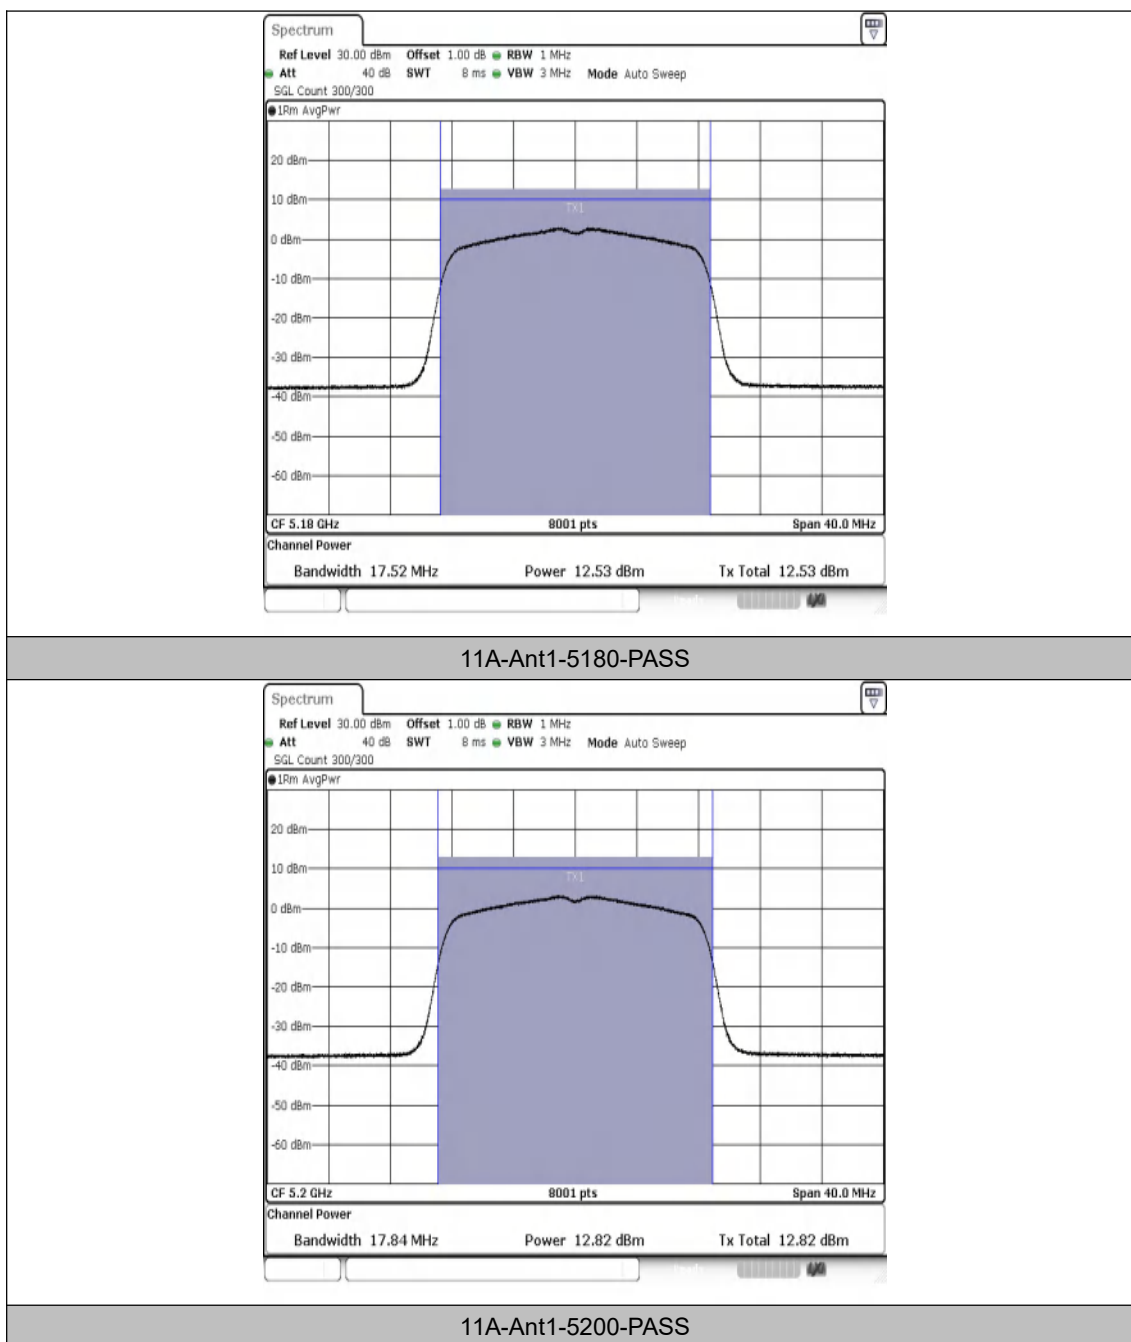

Shenzhen Anbotek Compliance Laboratory Limited

Address: Sogood Industrial Zone Laboratory & 1/F. of Building D, Sogood Science and Technology Park,
Sanwei Community, Hangcheng Subdistrict, Bao'an District, Shenzhen, Guangdong, China
Tel: (86) 0755-26066440 Email: service@anbotek.com


Hotline
400-003-0500
www.anbotek.com

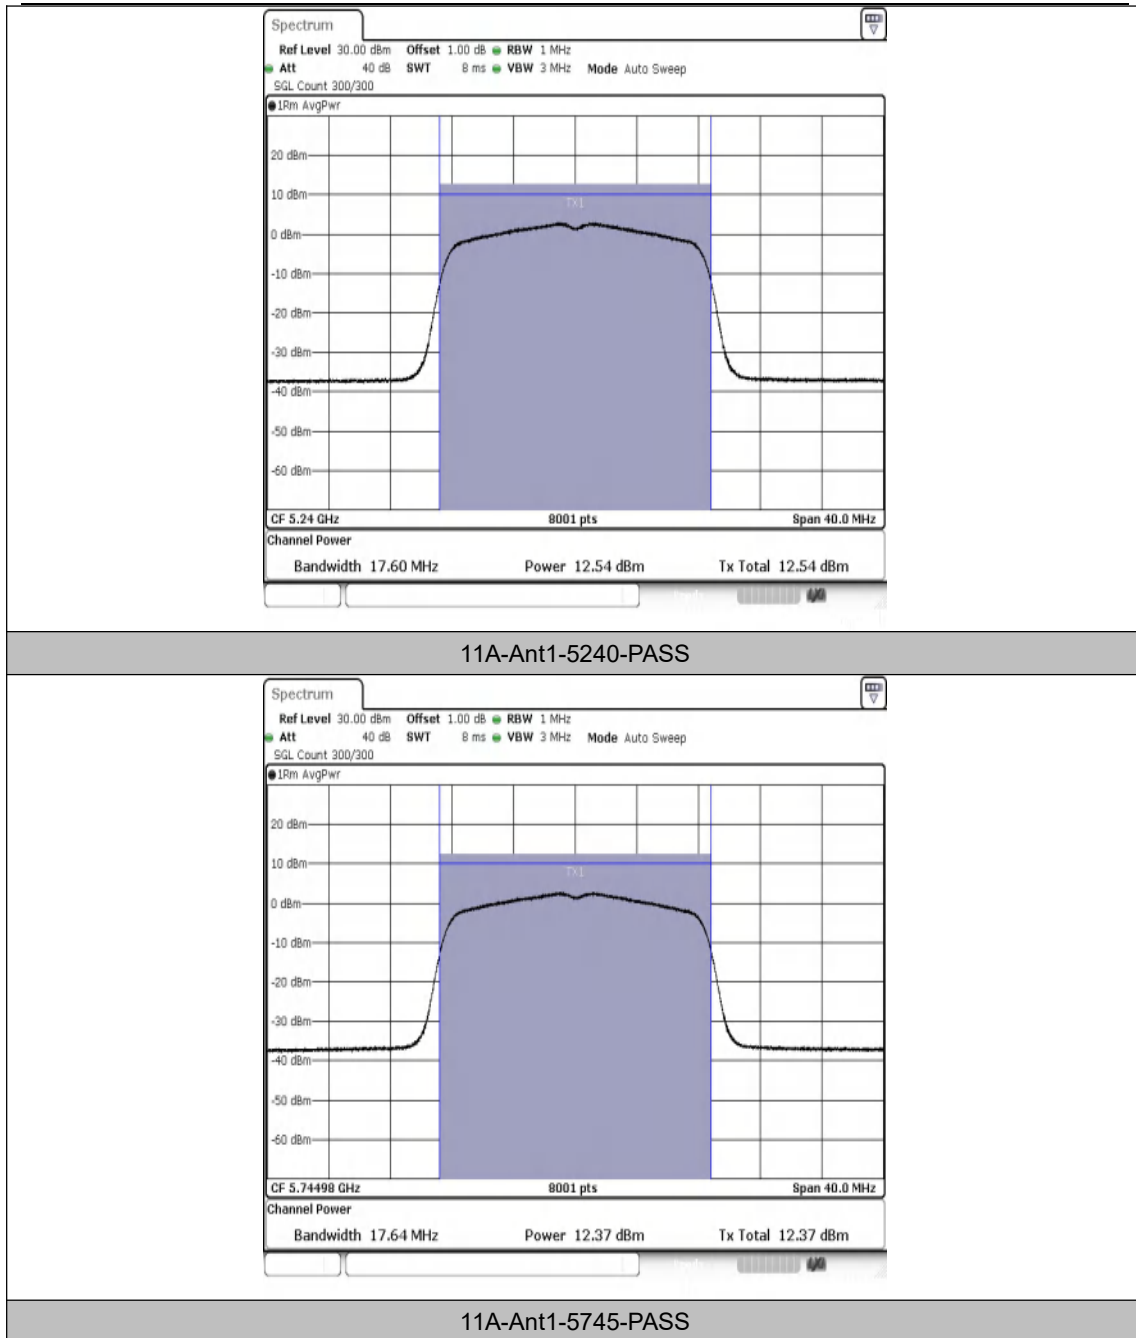

Shenzhen Anbotech Compliance Laboratory Limited

Address: Sogood Industrial Zone Laboratory & 1/F. of Building D, Sogood Science and Technology Park,
Sanwei Community, Hangcheng Subdistrict, Bao'an District, Shenzhen, Guangdong, China
Tel:(86)0755-26066440 Email:service@anbotech.com


Hotline
400-003-0500
www.anbotech.com

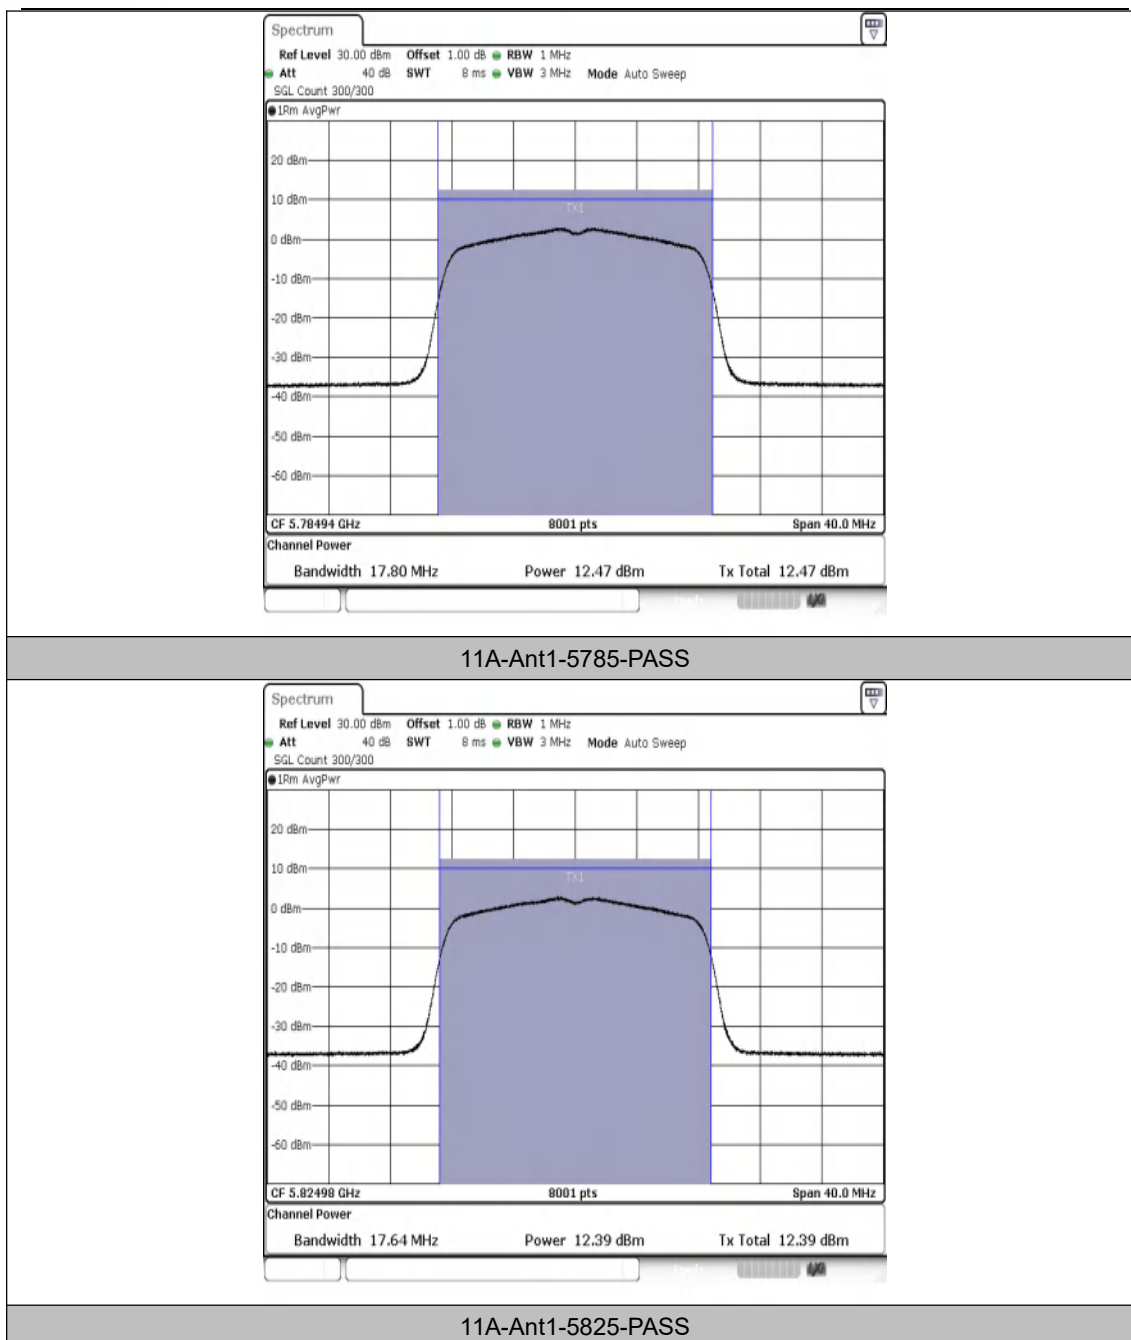

Shenzhen Anbotek Compliance Laboratory Limited

Address: Sogood Industrial Zone Laboratory & 1/F. of Building D, Sogood Science and Technology Park,
Sanwei Community, Hangcheng Subdistrict, Bao'an District, Shenzhen, Guangdong, China
Tel: (86) 0755-26066440 Email: service@anbotek.com


Hotline
400-003-0500
www.anbotek.com

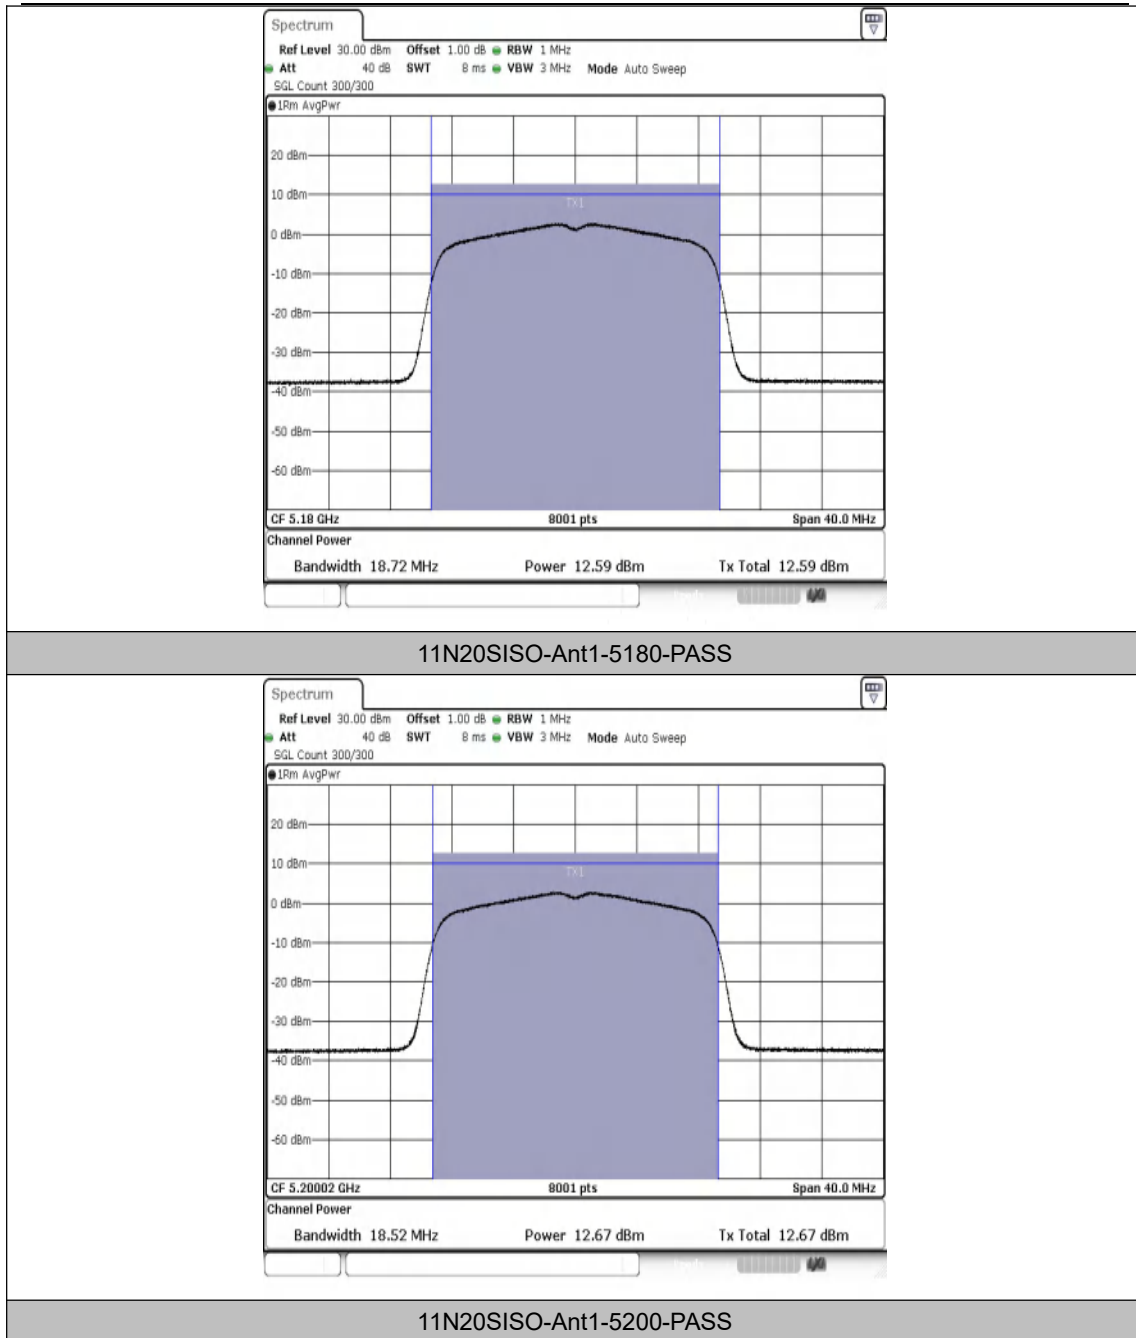

Shenzhen Anbotech Compliance Laboratory Limited

Address: Sogood Industrial Zone Laboratory & 1/F. of Building D, Sogood Science and Technology Park,
Sanwei Community, Hangcheng Subdistrict, Bao'an District, Shenzhen, Guangdong, China
Tel: (86) 0755-26066440 Email: service@anbotech.com


Hotline
400-003-0500
www.anbotech.com

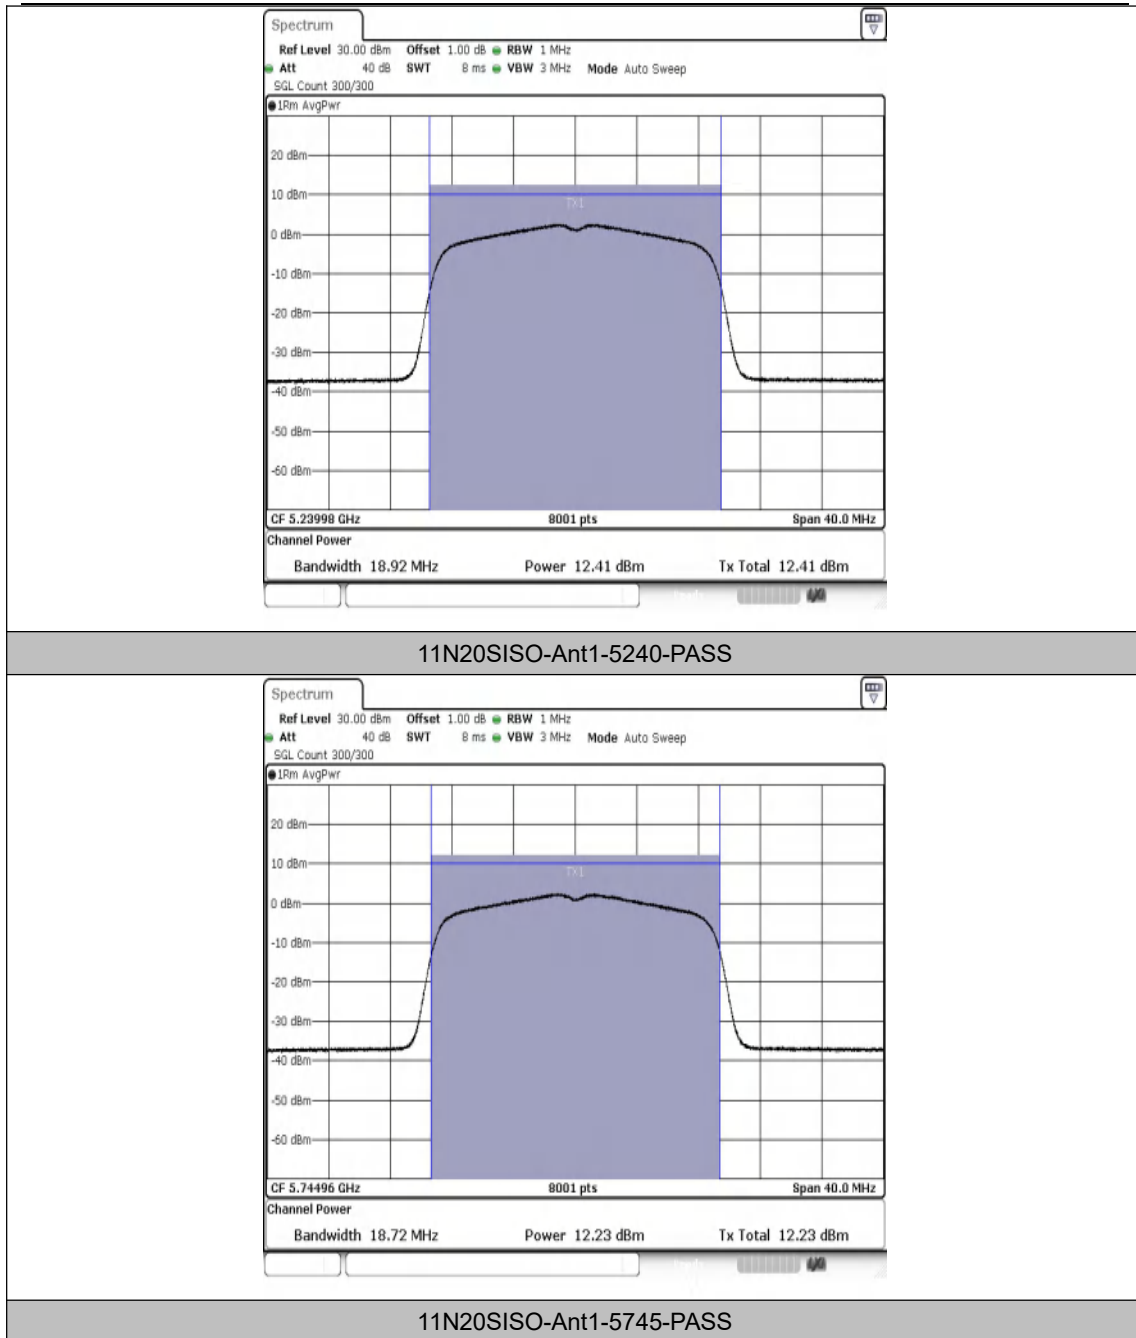

Shenzhen Anbotech Compliance Laboratory Limited

Address: Sogood Industrial Zone Laboratory & 1/F. of Building D, Sogood Science and Technology Park,
Sanwei Community, Hangcheng Subdistrict, Bao'an District, Shenzhen, Guangdong, China
Tel:(86)0755-26066440 Email:service@anbotech.com


Hotline
400-003-0500
www.anbotech.com

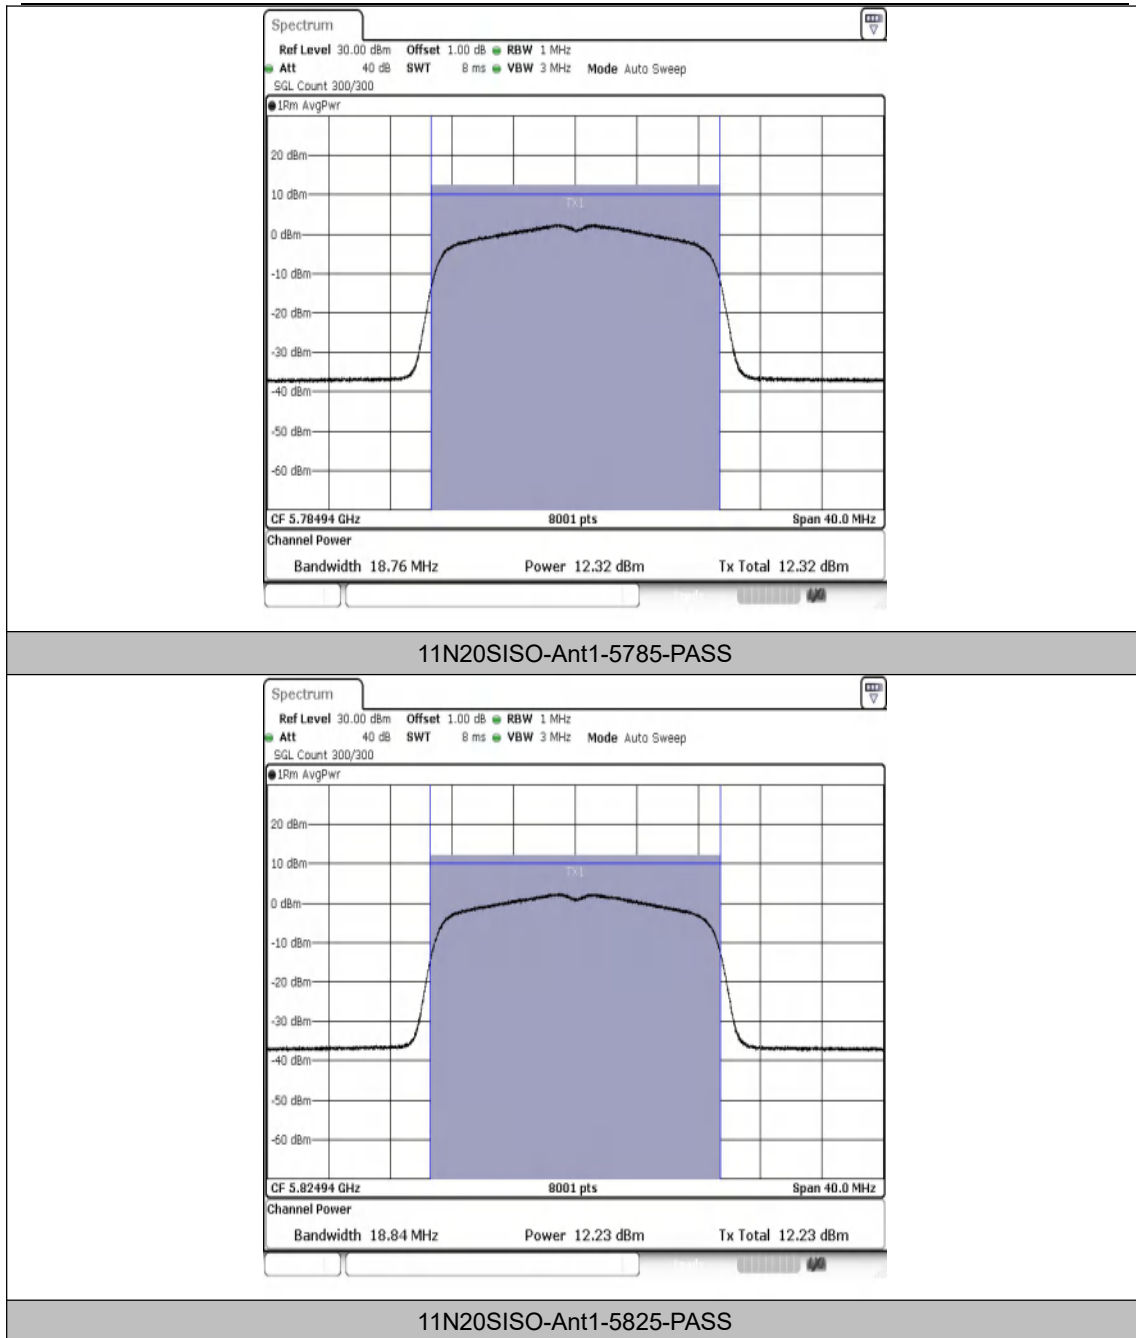

Shenzhen Anbotech Compliance Laboratory Limited

Address: Sogood Industrial Zone Laboratory & 1/F. of Building D, Sogood Science and Technology Park,
Sanwei Community, Hangcheng Subdistrict, Bao'an District, Shenzhen, Guangdong, China
Tel: (86) 0755-26066440 Email: service@anbotech.com


Hotline
400-003-0500
www.anbotech.com

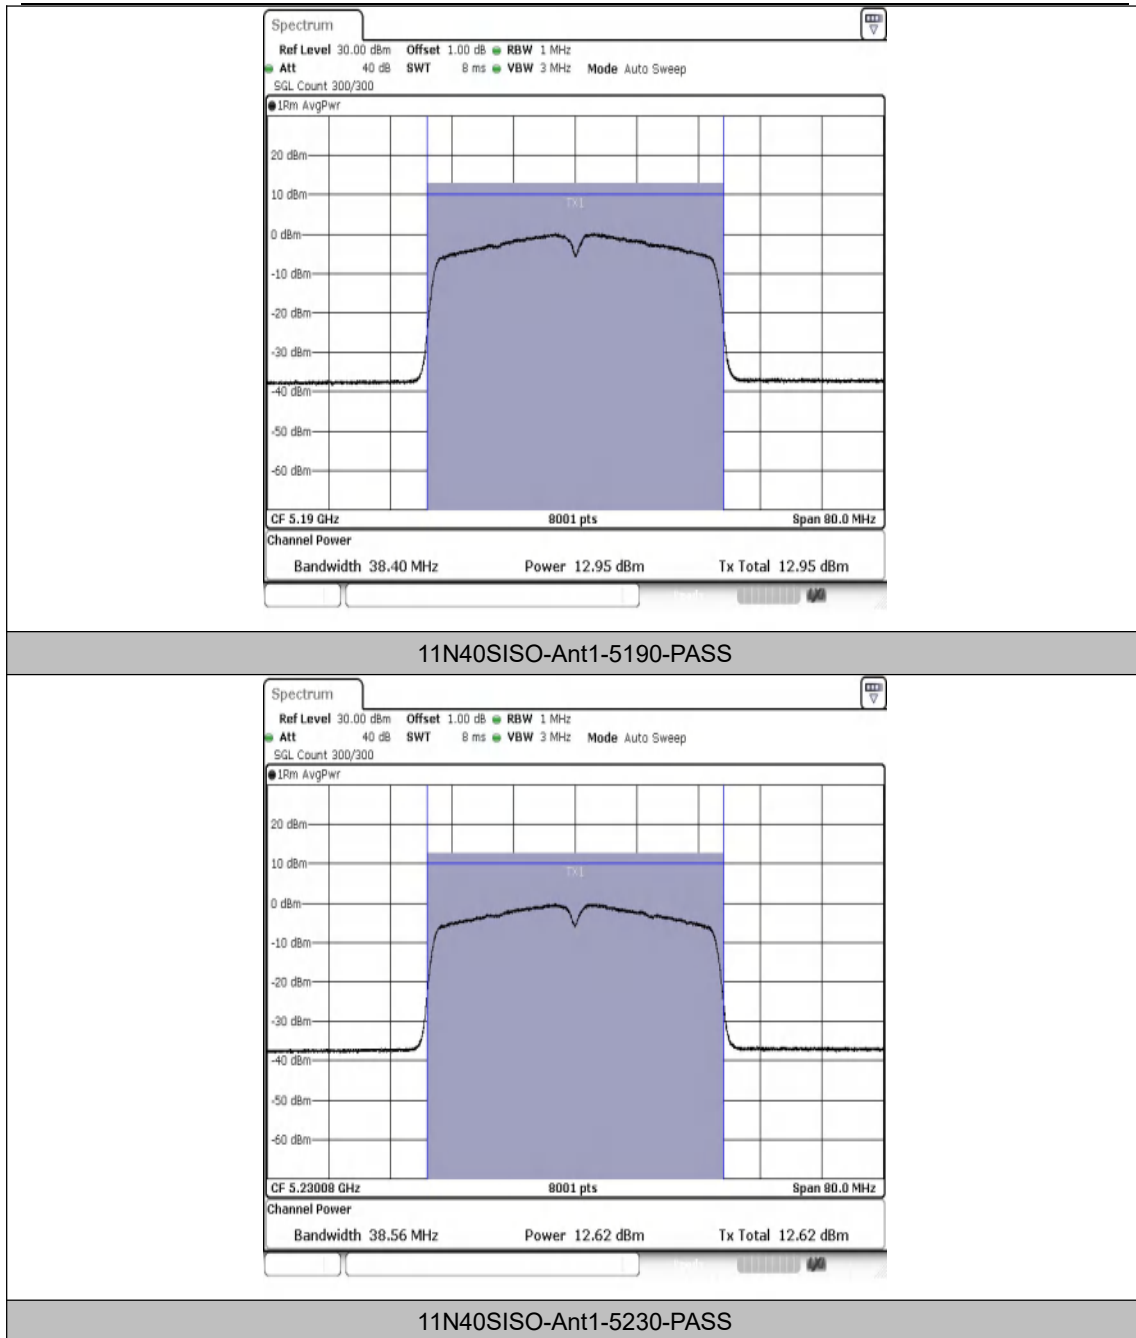

Shenzhen Anbotech Compliance Laboratory Limited

Address: Sogood Industrial Zone Laboratory & 1/F. of Building D, Sogood Science and Technology Park,
Sanwei Community, Hangcheng Subdistrict, Bao'an District, Shenzhen, Guangdong, China
Tel:(86)0755-26066440 Email:service@anbotech.com


Hotline
400-003-0500
www.anbotech.com

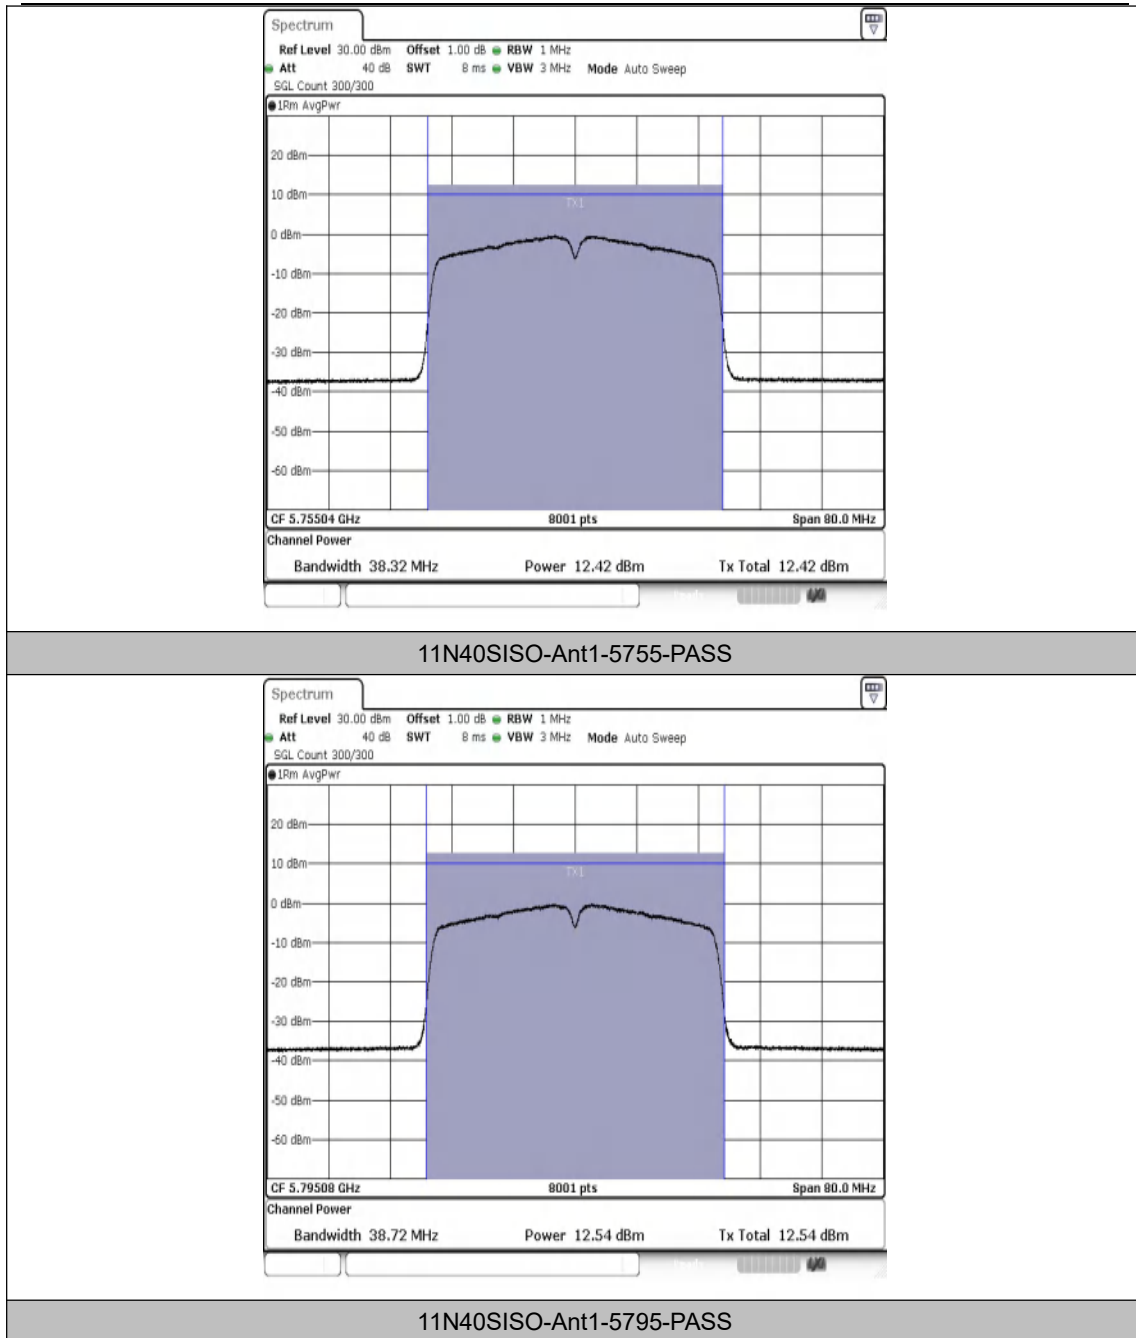

Shenzhen Anbotech Compliance Laboratory Limited

Address: Sogood Industrial Zone Laboratory & 1/F. of Building D, Sogood Science and Technology Park,
Sanwei Community, Hangcheng Subdistrict, Bao'an District, Shenzhen, Guangdong, China
Tel: (86) 0755-26066440 Email: service@anbotech.com


Hotline
400-003-0500
www.anbotech.com

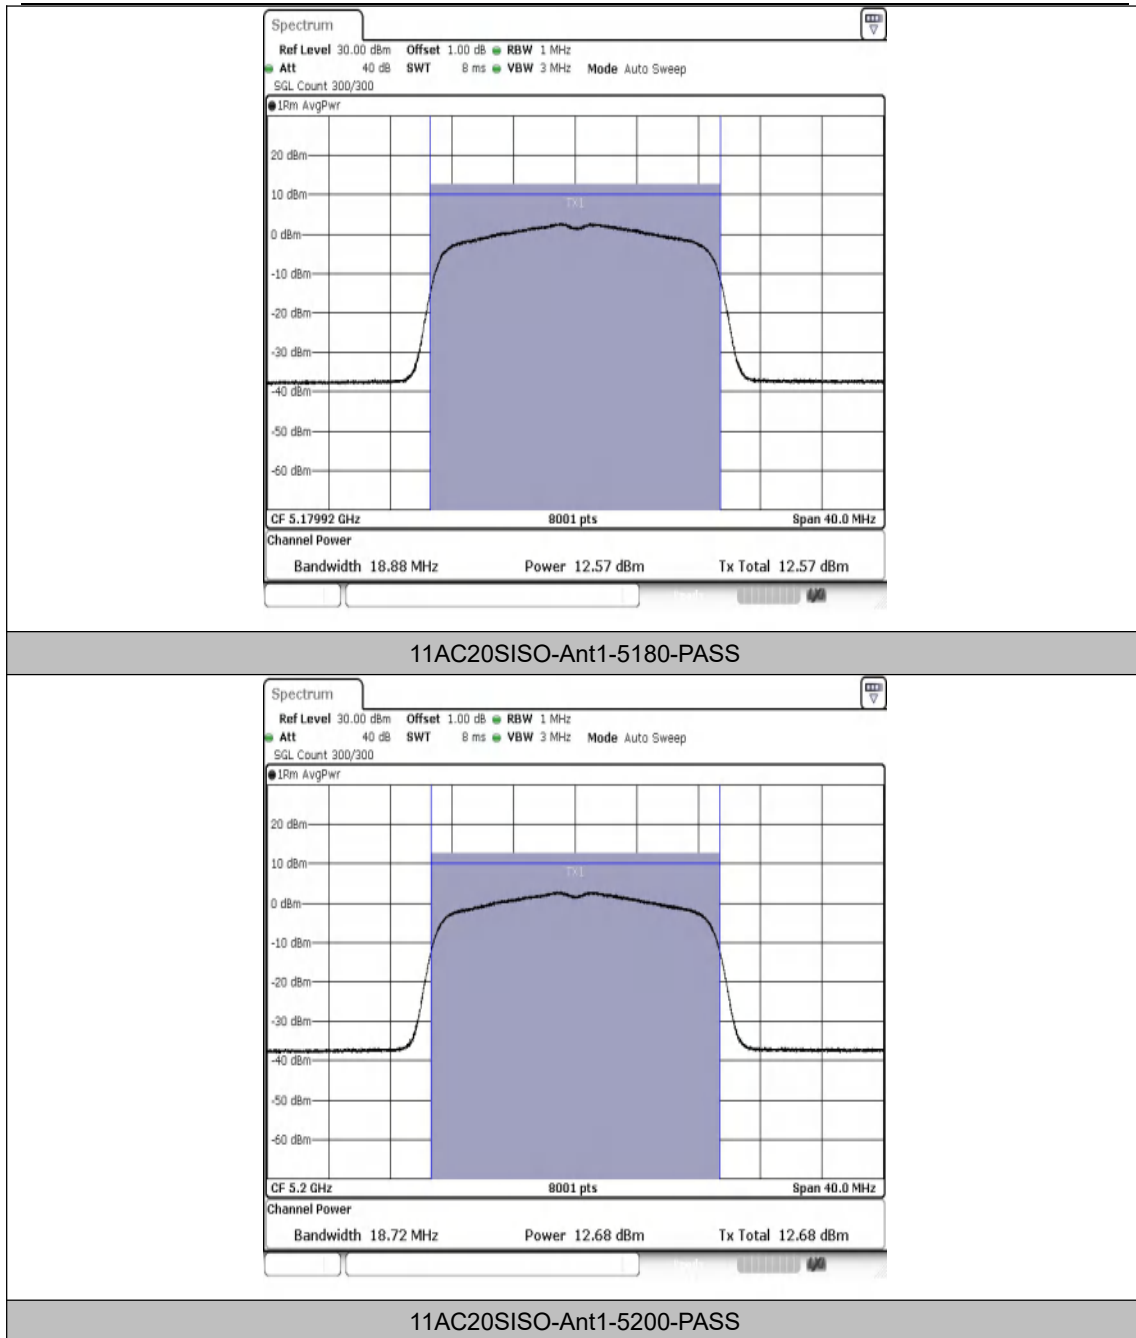


Shenzhen Anbotech Compliance Laboratory Limited

Address: Sogood Industrial Zone Laboratory & 1/F. of Building D, Sogood Science and Technology Park,
Sanwei Community, Hangcheng Subdistrict, Bao'an District, Shenzhen, Guangdong, China
Tel: (86) 0755-26066440 Email: service@anbotech.com

Hotline
400-003-0500
www.anbotech.com

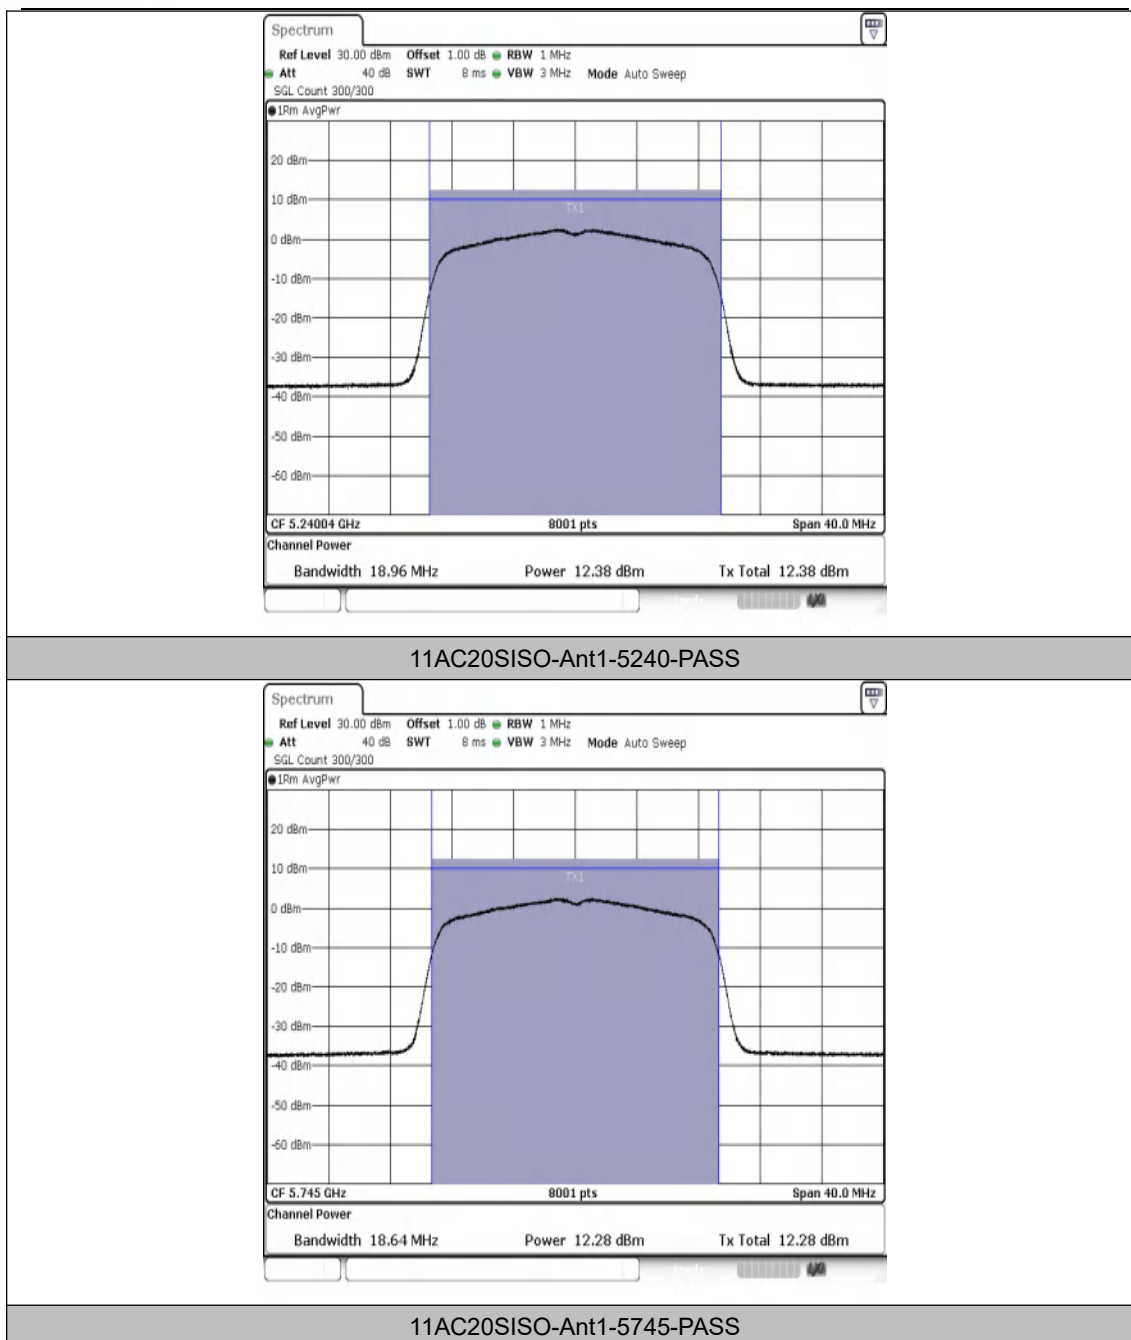

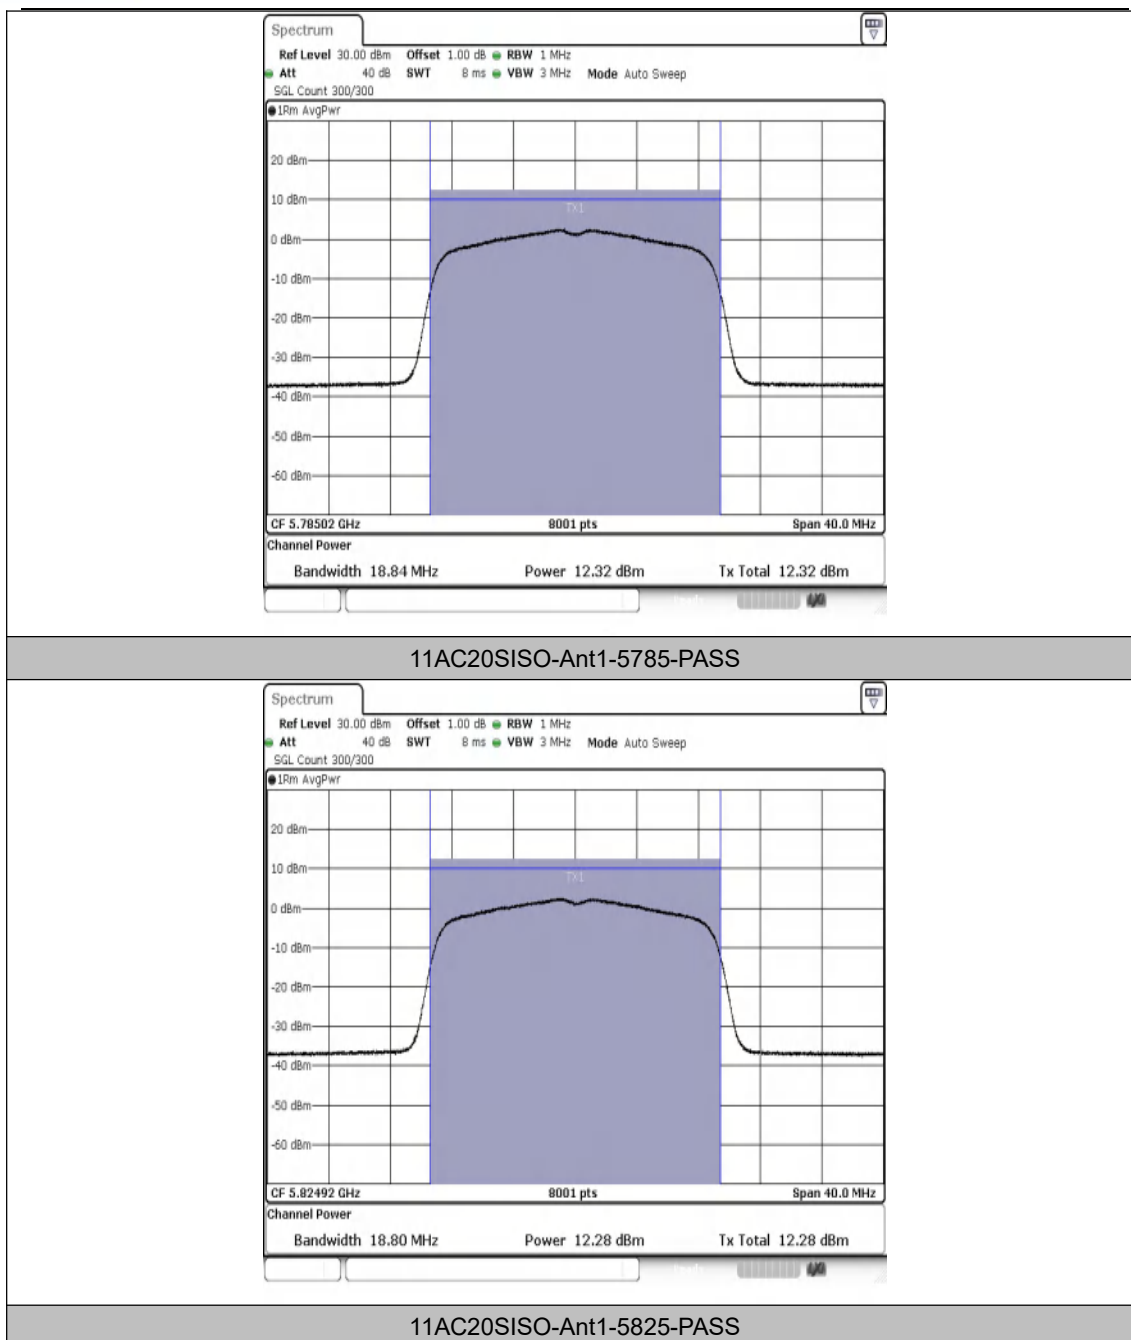



Shenzhen Anbotek Compliance Laboratory Limited


Address: Sogood Industrial Zone Laboratory & 1/F. of Building D, Sogood Science and Technology Park,
Sanwei Community, Hangcheng Subdistrict, Bao'an District, Shenzhen, Guangdong, China
Tel:(86)0755-26066440 Email:service@anbotek.com




Hotline
400-003-0500
www.anbotek.com

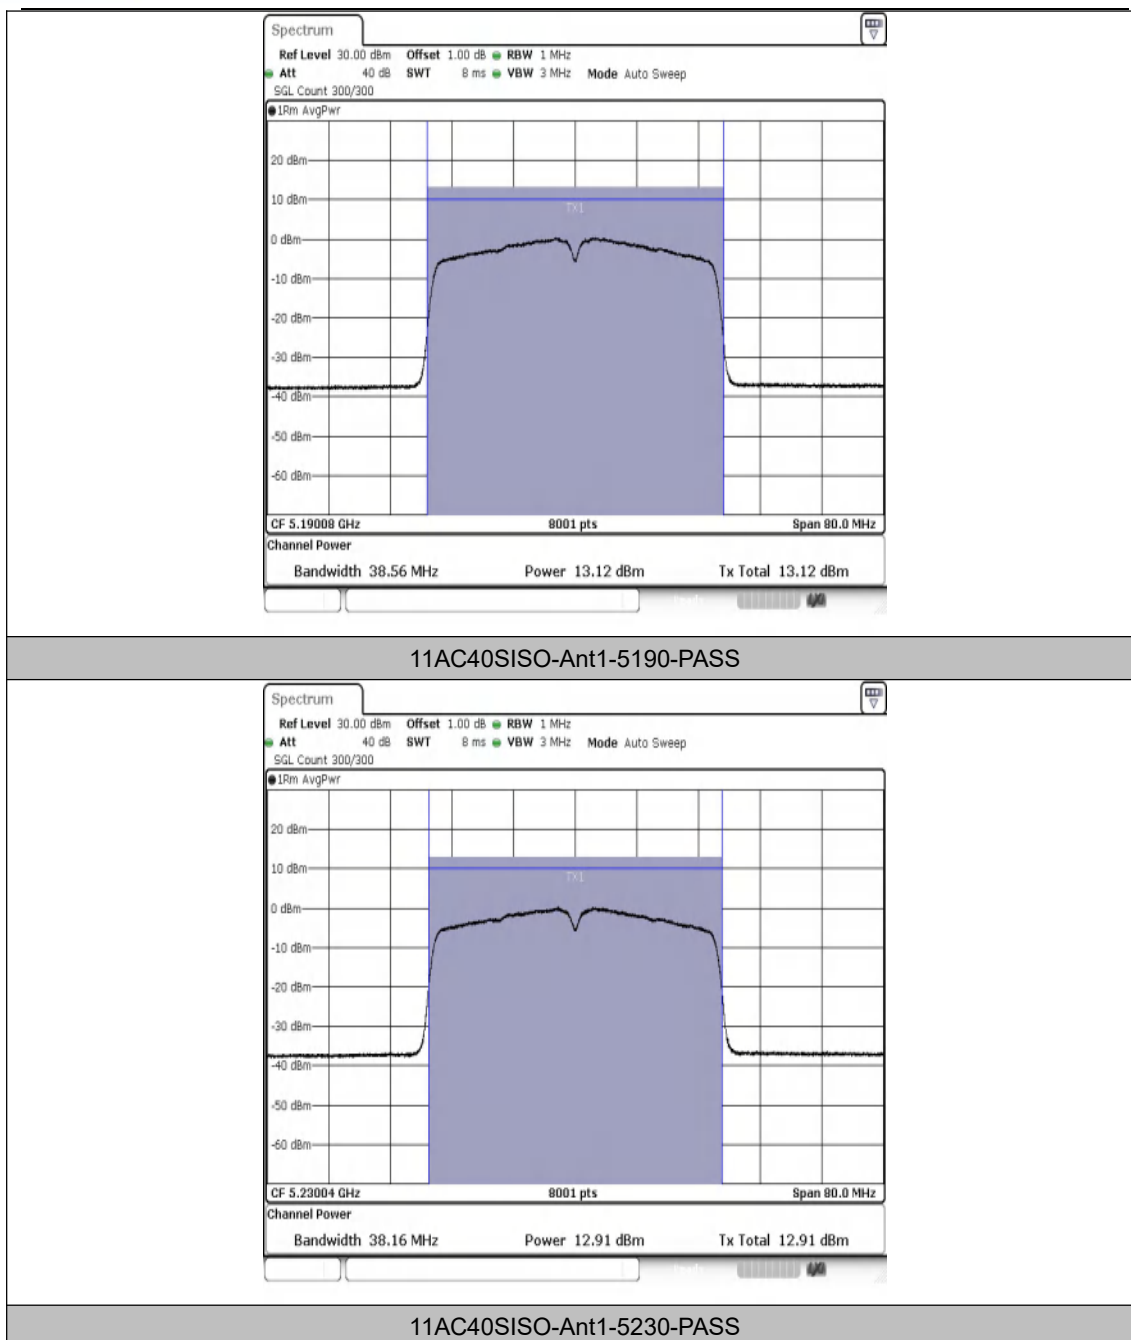

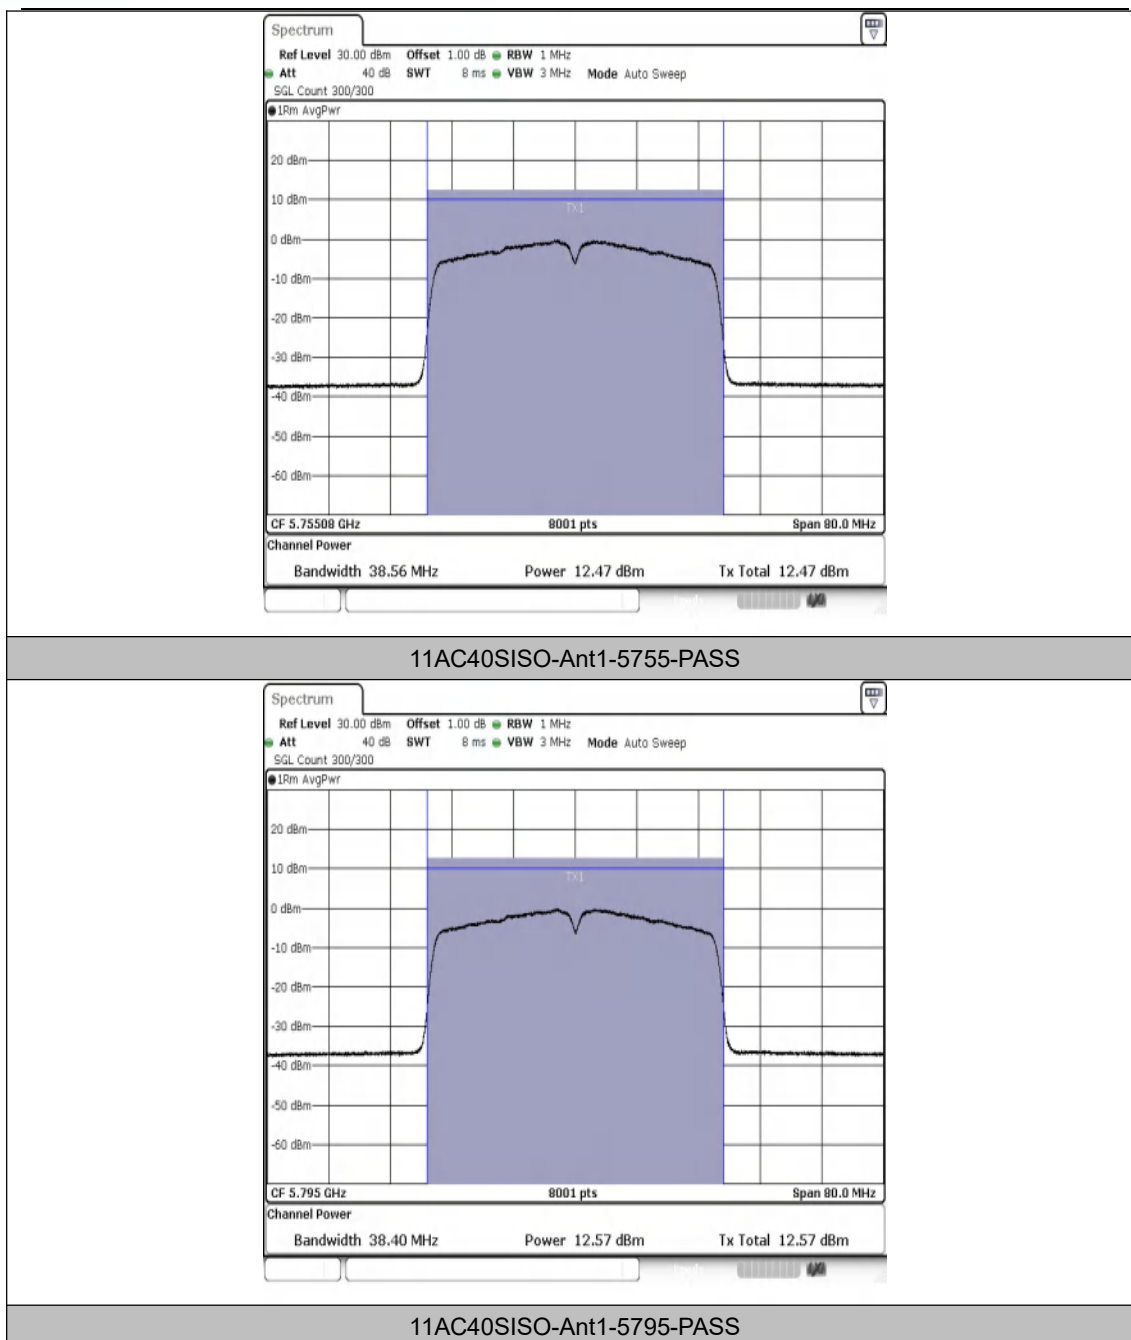

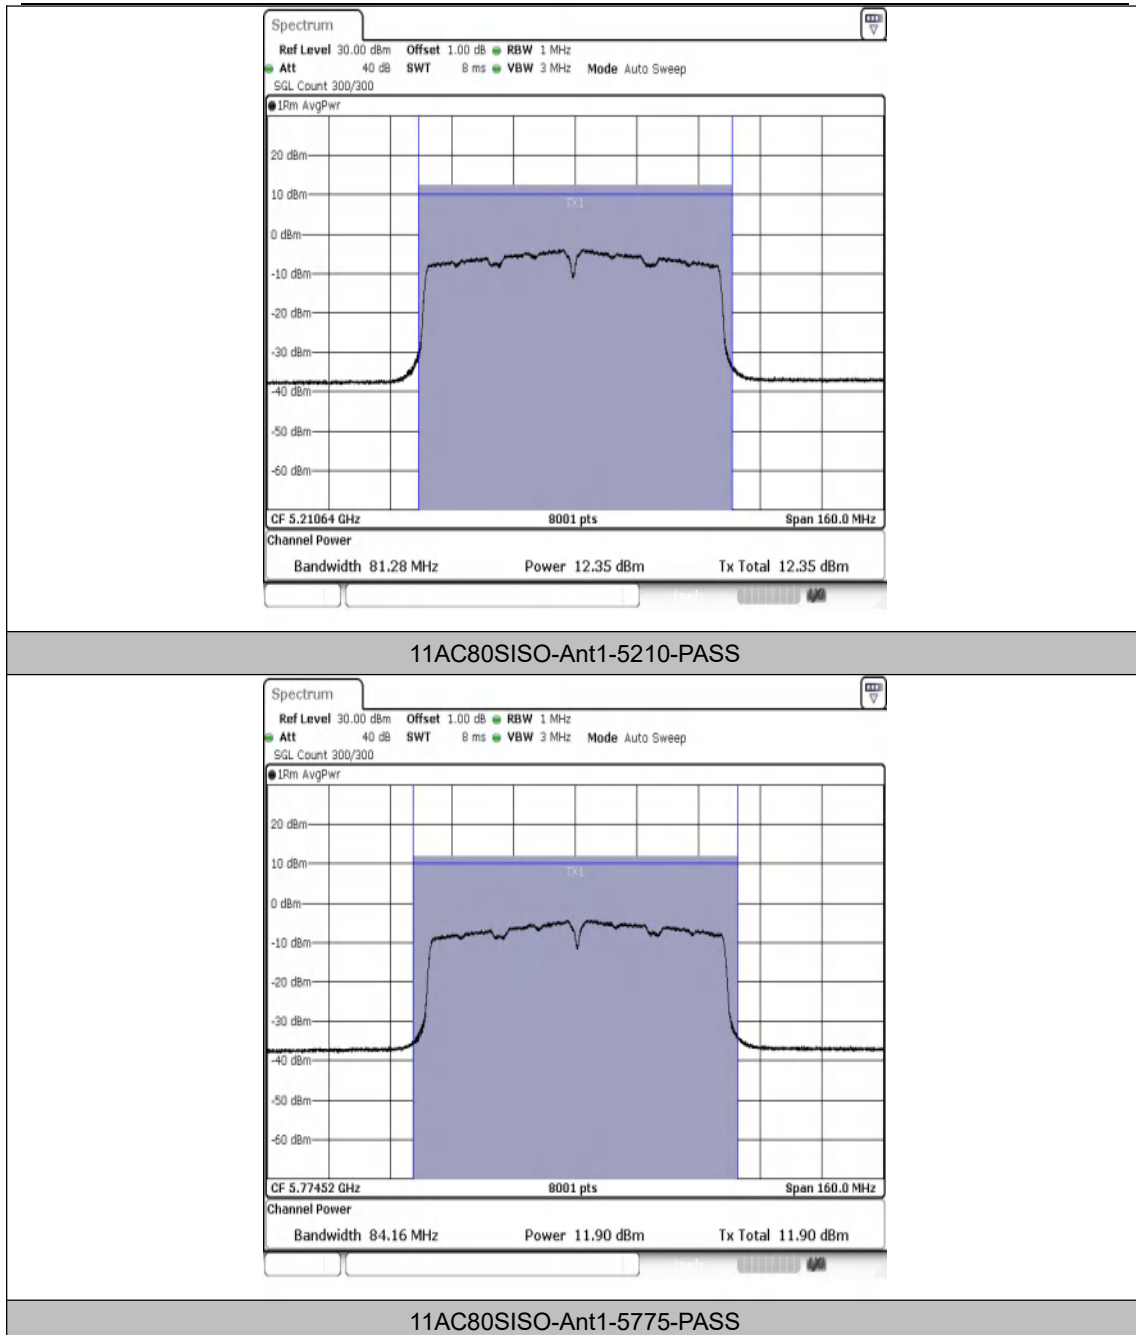


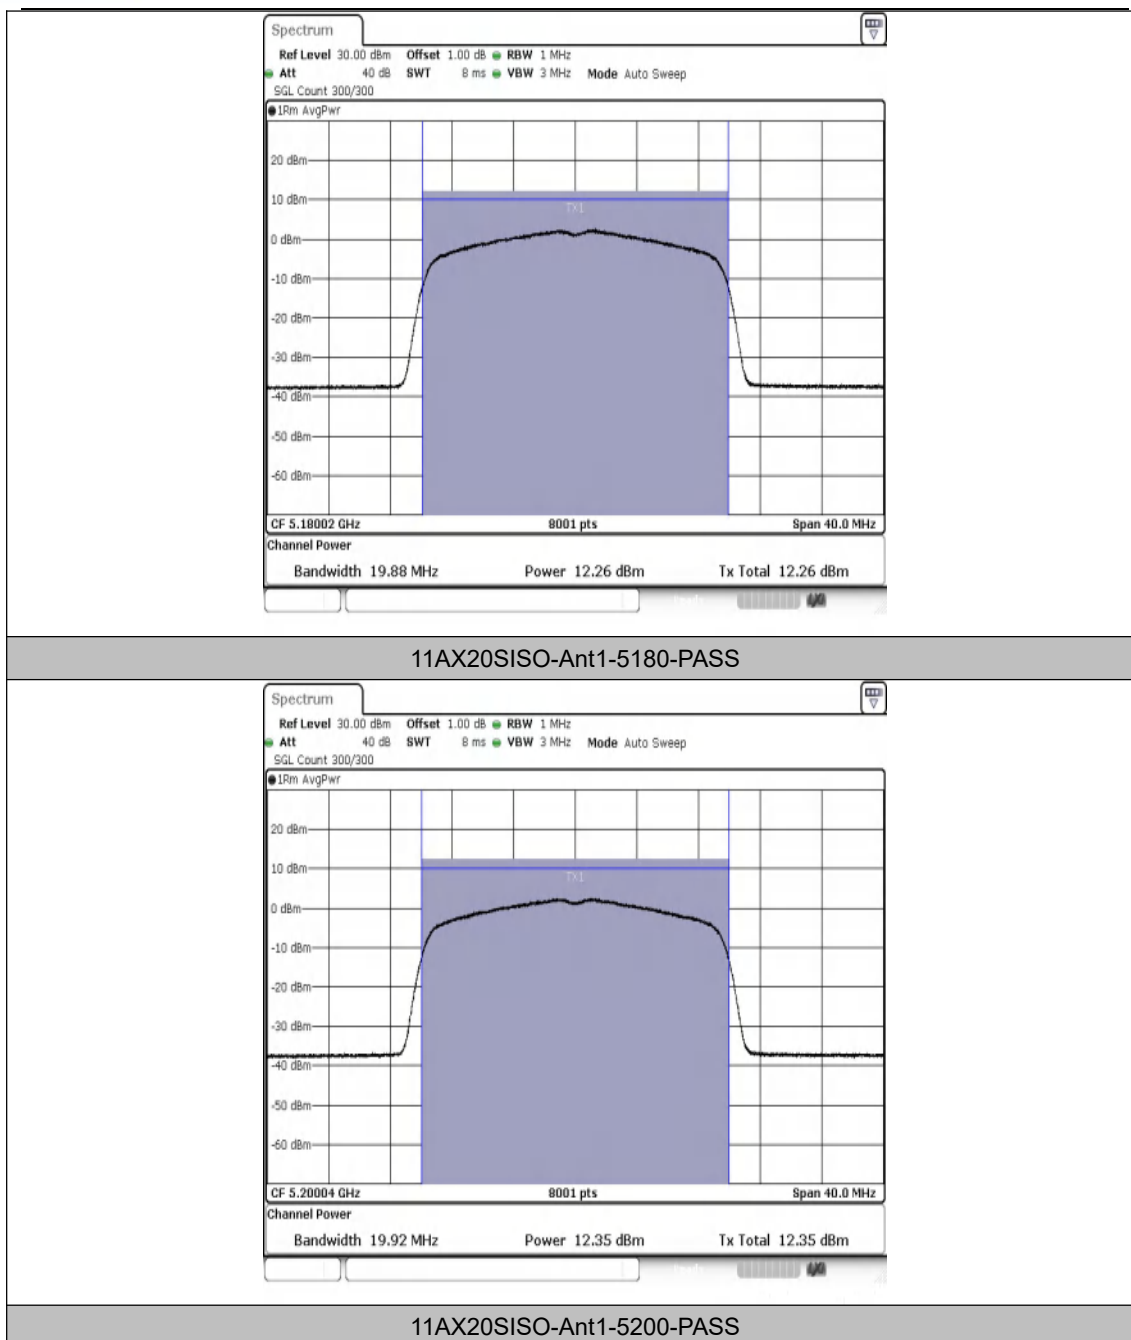

Shenzhen Anbotech Compliance Laboratory Limited

Address: Sogood Industrial Zone Laboratory & 1/F. of Building D, Sogood Science and Technology Park,
Sanwei Community, Hangcheng Subdistrict, Bao'an District, Shenzhen, Guangdong, China
Tel: (86) 0755-26066440 Email: service@anbotech.com


Hotline
400-003-0500
www.anbotech.com

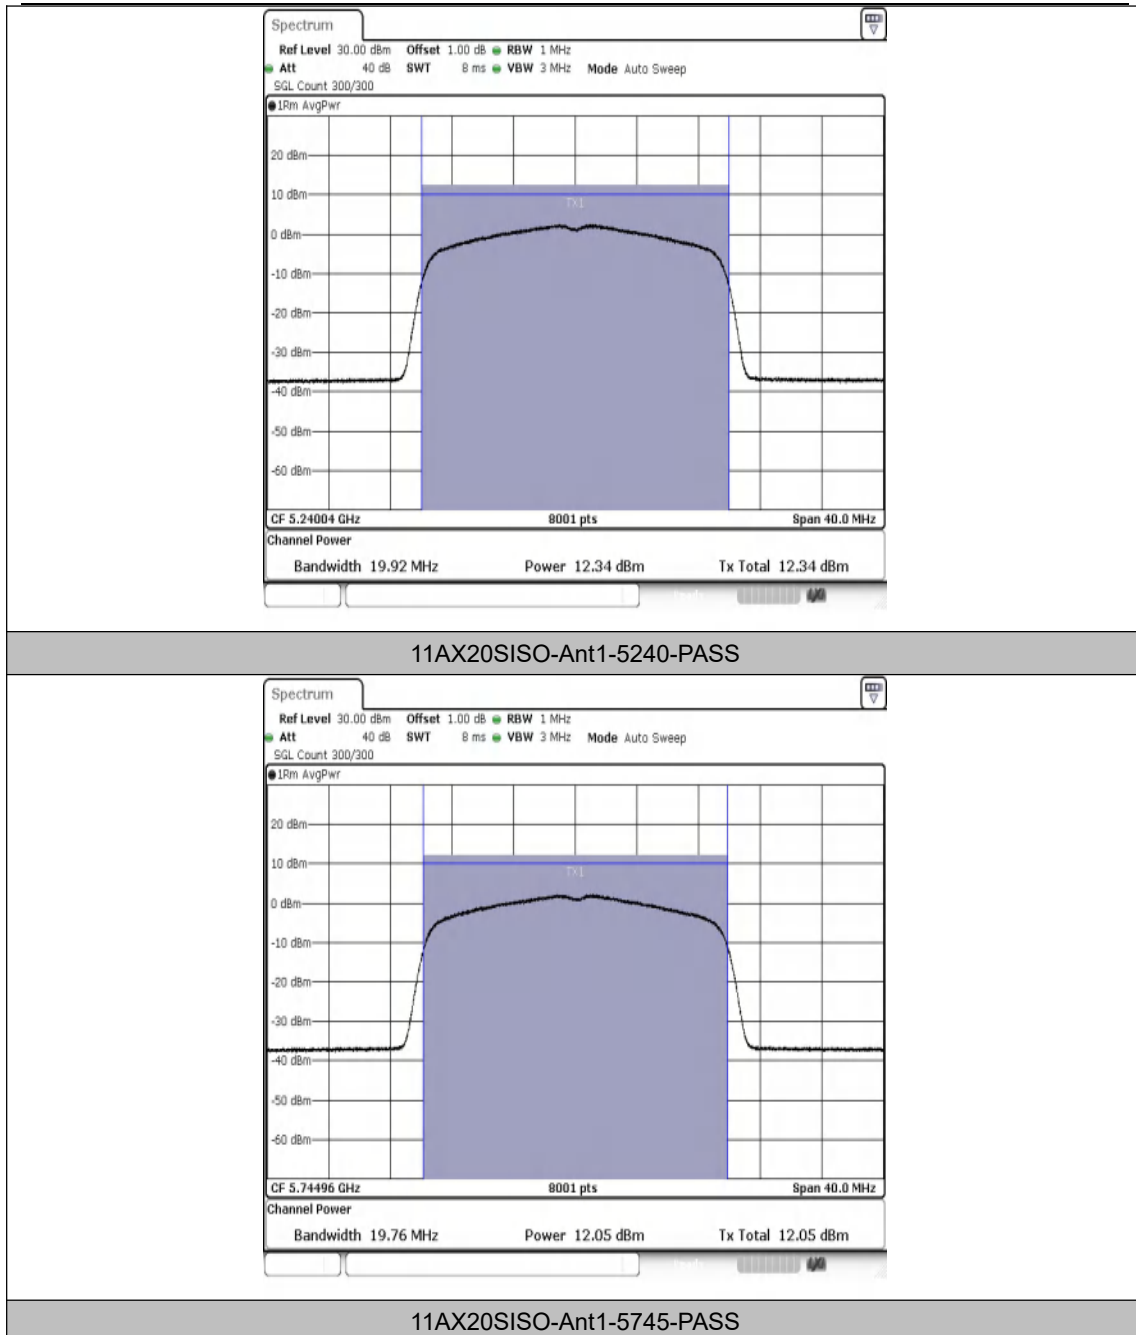



Shenzhen Anbotech Compliance Laboratory Limited


Address: Sogood Industrial Zone Laboratory & 1/F. of Building D, Sogood Science and Technology Park,
Sanwei Community, Hangcheng Subdistrict, Bao'an District, Shenzhen, Guangdong, China
Tel: (86) 0755-26066440 Email: service@anbotech.com

Hotline
400-003-0500
www.anbotech.com

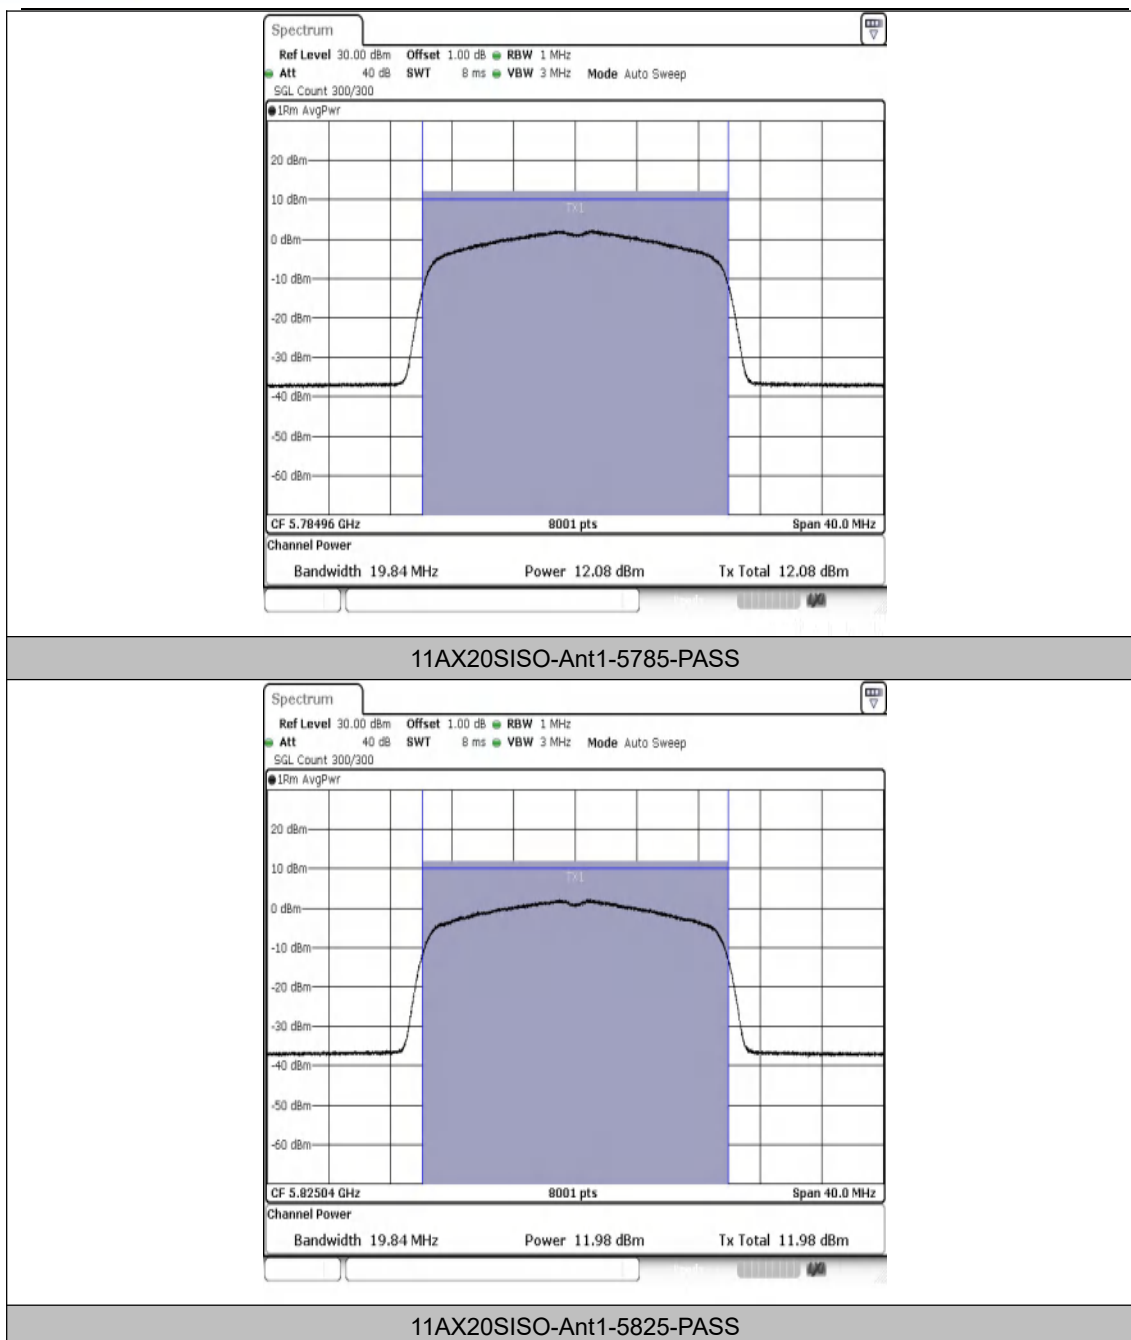

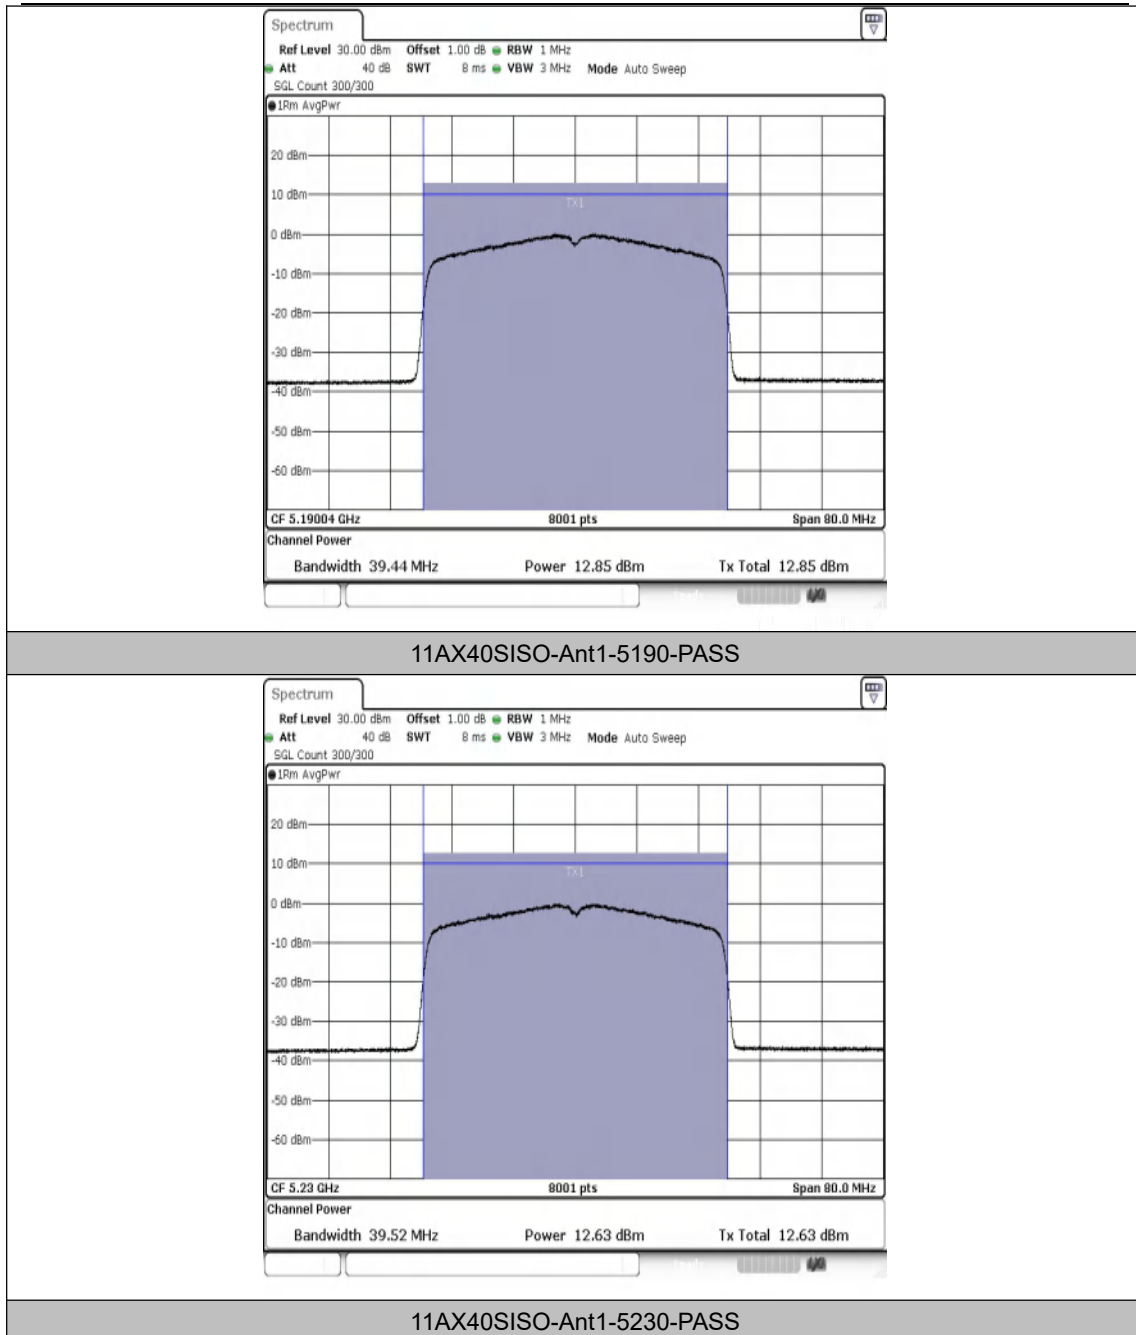

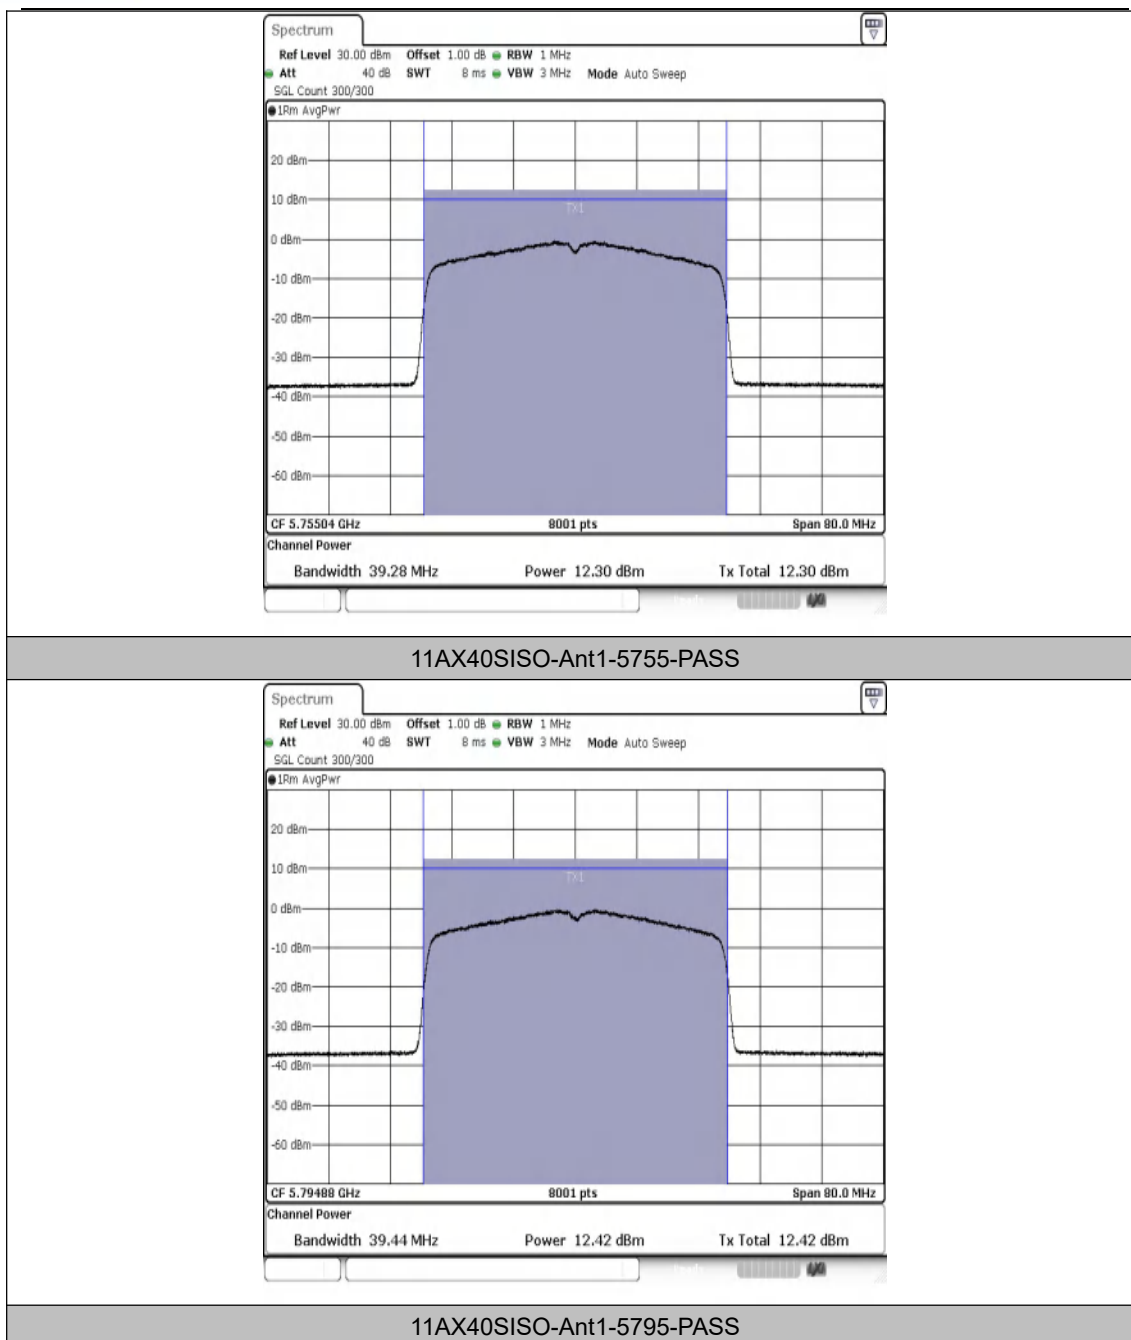

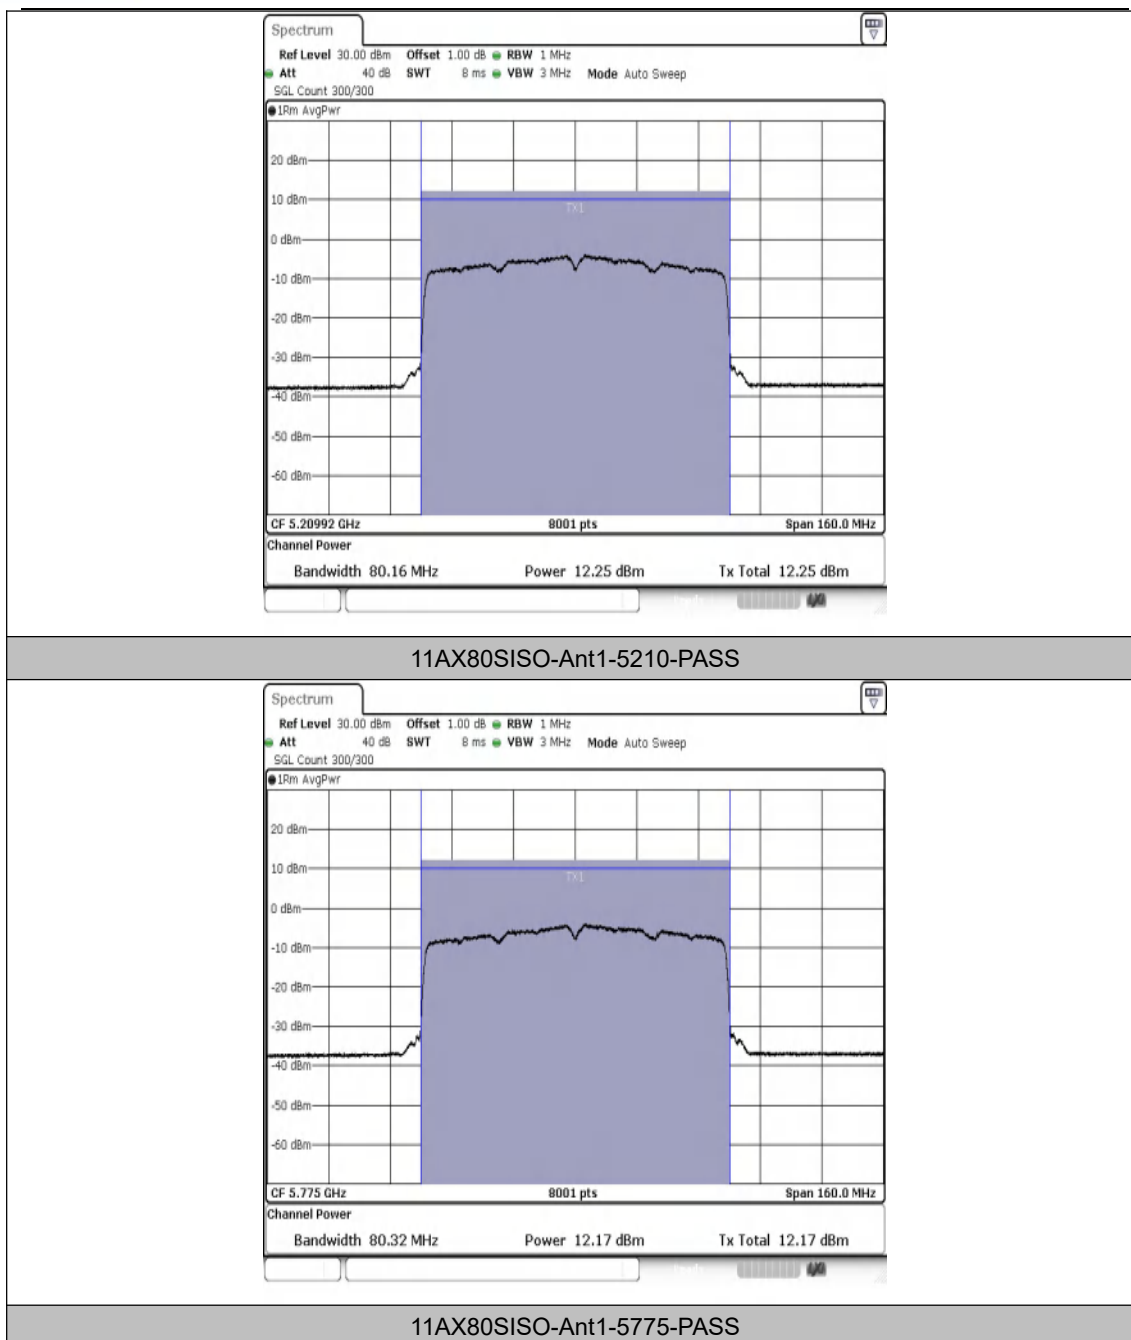

Shenzhen Anbotech Compliance Laboratory Limited

Address: Sogood Industrial Zone Laboratory & 1/F. of Building D, Sogood Science and Technology Park,
Sanwei Community, Hangcheng Subdistrict, Bao'an District, Shenzhen, Guangdong, China
Tel:(86)0755-26066440 Email:service@anbotech.com

Hotline
400-003-0500
www.anbotech.com

Appendix D: Maximum Power Spectral Density

Test Result B1/2/3

Test Mode	Antenna	Frequency [MHz]	Reading Result [dBm/MHz]	DC Factor [dB]	Result [dBm/MHz]	Limit [dBm/MHz]	Verdict
11A	Ant1	5180	2.82	0.00	2.82	≤11.00	PASS
11A	Ant1	5200	2.81	0.00	2.81	≤11.00	PASS
11A	Ant1	5240	2.76	0.00	2.76	≤11.00	PASS
11N20SISO	Ant1	5180	3.23	0.00	3.23	≤11.00	PASS
11N20SISO	Ant1	5200	3.15	0.00	3.15	≤11.00	PASS
11N20SISO	Ant1	5240	2.07	0.00	2.07	≤11.00	PASS
11N40SISO	Ant1	5190	0.34	0.00	0.34	≤11.00	PASS
11N40SISO	Ant1	5230	0.16	0.00	0.16	≤11.00	PASS
11AC20SISO	Ant1	5180	2.42	0.00	2.42	≤11.00	PASS
11AC20SISO	Ant1	5200	2.95	0.00	2.95	≤11.00	PASS
11AC20SISO	Ant1	5240	2.47	0.00	2.47	≤11.00	PASS
11AC40SISO	Ant1	5190	0.21	0.00	0.21	≤11.00	PASS
11AC40SISO	Ant1	5230	0.13	0.00	0.13	≤11.00	PASS
11AC80SISO	Ant1	5210	-3.32	0.00	-3.32	≤11.00	PASS
11AX20SISO	Ant1	5180	2.46	0.00	2.46	≤11.00	PASS
11AX20SISO	Ant1	5200	2.23	0.00	2.23	≤11.00	PASS
11AX20SISO	Ant1	5240	2.66	0.00	2.66	≤11.00	PASS
11AX40SISO	Ant1	5190	-0.51	0.00	-0.51	≤11.00	PASS
11AX40SISO	Ant1	5230	0.03	0.00	0.03	≤11.00	PASS
11AX80SISO	Ant1	5210	-3.93	0.00	-3.93	≤11.00	PASS

Note: 1.The Duty Cycle Factor and cable loss and RBW Factor are compensated in the graph.


Test Result B4

Test Mode	Antenna	Frequency [MHz]	Reading Result[dBm/500KHz]	DC Factor [dB]	Result [dBm/500 KHz]	Limit[dBm /500KHz]	Verdict
11A	Ant1	5745	-0.37	0.00	-0.37	≤30.00	PASS
11A	Ant1	5785	-0.26	0.00	-0.26	≤30.00	PASS
11A	Ant1	5825	0.15	0.00	0.15	≤30.00	PASS
11N20SISO	Ant1	5745	-0.69	0.00	-0.69	≤30.00	PASS
11N20SISO	Ant1	5785	-0.53	0.00	-0.53	≤30.00	PASS
11N20SISO	Ant1	5825	-0.38	0.00	-0.38	≤30.00	PASS
11N40SISO	Ant1	5755	-3.19	0.00	-3.19	≤30.00	PASS
11N40SISO	Ant1	5795	-2.54	0.00	-2.54	≤30.00	PASS
11AC20SISO	Ant1	5745	-0.21	0.00	-0.21	≤30.00	PASS
11AC20SISO	Ant1	5785	-0.64	0.00	-0.64	≤30.00	PASS
11AC20SISO	Ant1	5825	-0.14	0.00	-0.14	≤30.00	PASS
11AC40SISO	Ant1	5755	-2.72	0.00	-2.72	≤30.00	PASS
11AC40SISO	Ant1	5795	-2.71	0.00	-2.71	≤30.00	PASS
11AC80SISO	Ant1	5775	-6.99	0.00	-6.99	≤30.00	PASS
11AX20SISO	Ant1	5745	-0.67	0.00	-0.67	≤30.00	PASS
11AX20SISO	Ant1	5785	-0.99	0.00	-0.99	≤30.00	PASS
11AX20SISO	Ant1	5825	-0.89	0.00	-0.89	≤30.00	PASS
11AX40SISO	Ant1	5755	-3.41	0.00	-3.41	≤30.00	PASS
11AX40SISO	Ant1	5795	-3.52	0.00	-3.52	≤30.00	PASS
11AX80SISO	Ant1	5775	-7.02	0.00	-7.02	≤30.00	PASS

Note: 1.The Duty Cycle Factor and cable loss and RBW Factor are compensated in the graph.



Test Graphs B1/2/3

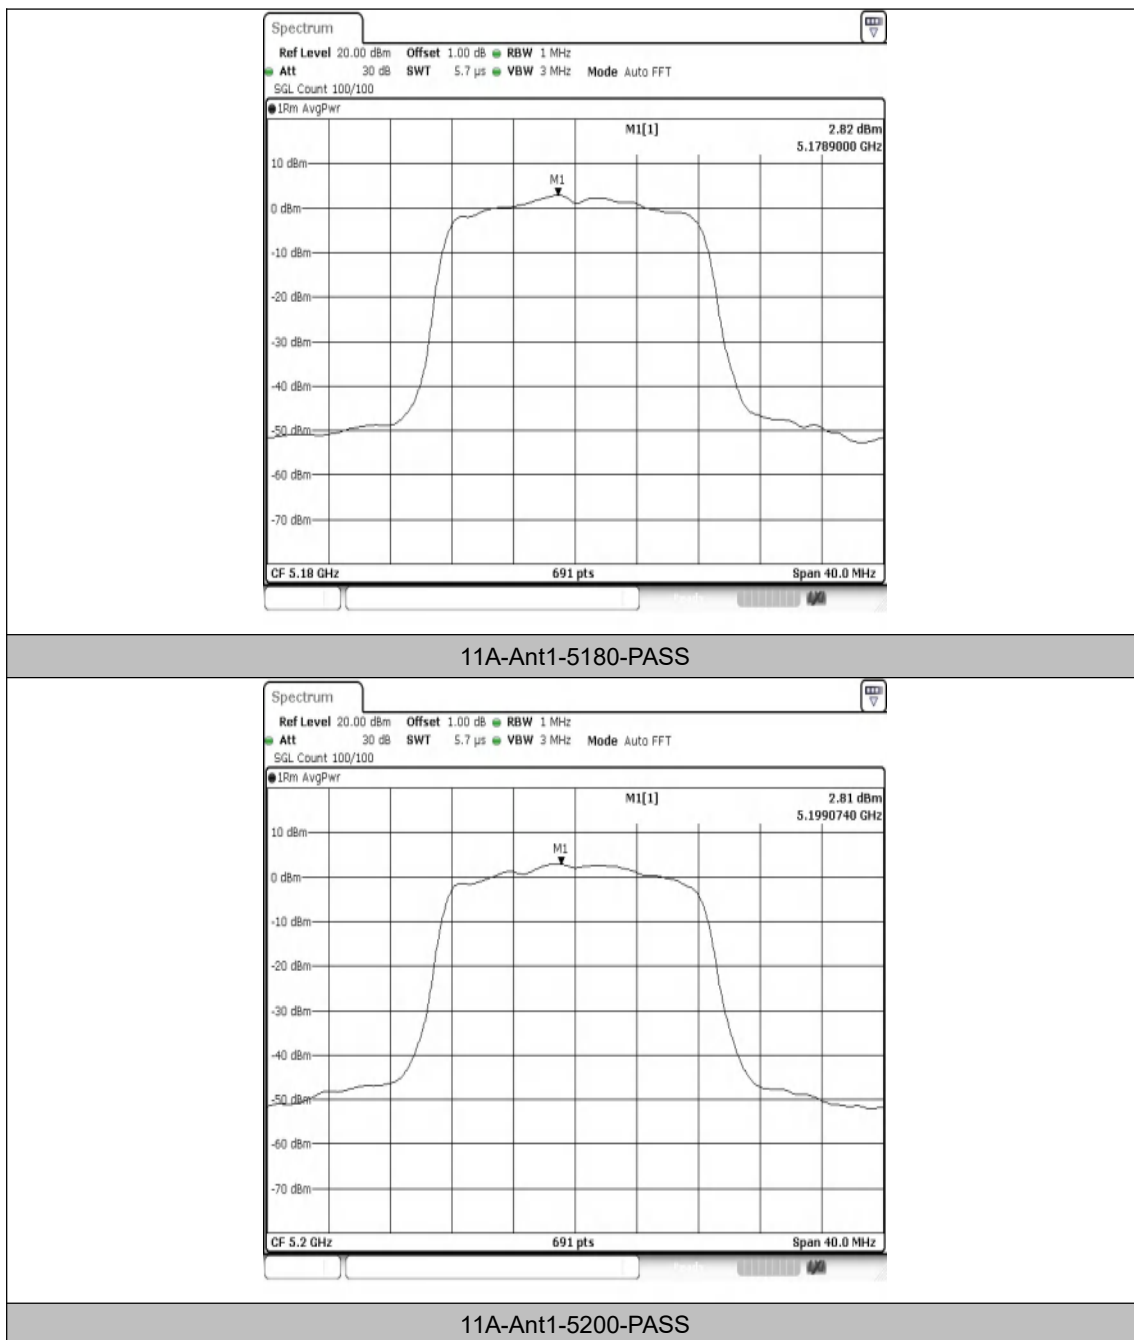



Shenzhen Anbotek Compliance Laboratory Limited


Address: Sogood Industrial Zone Laboratory & 1/F. of Building D, Sogood Science and Technology Park,
Sanwei Community, Hangcheng Subdistrict, Bao'an District, Shenzhen, Guangdong, China
Tel: (86) 0755-26066440 Email: service@anbotek.com




Hotline
400-003-0500
www.anbotek.com

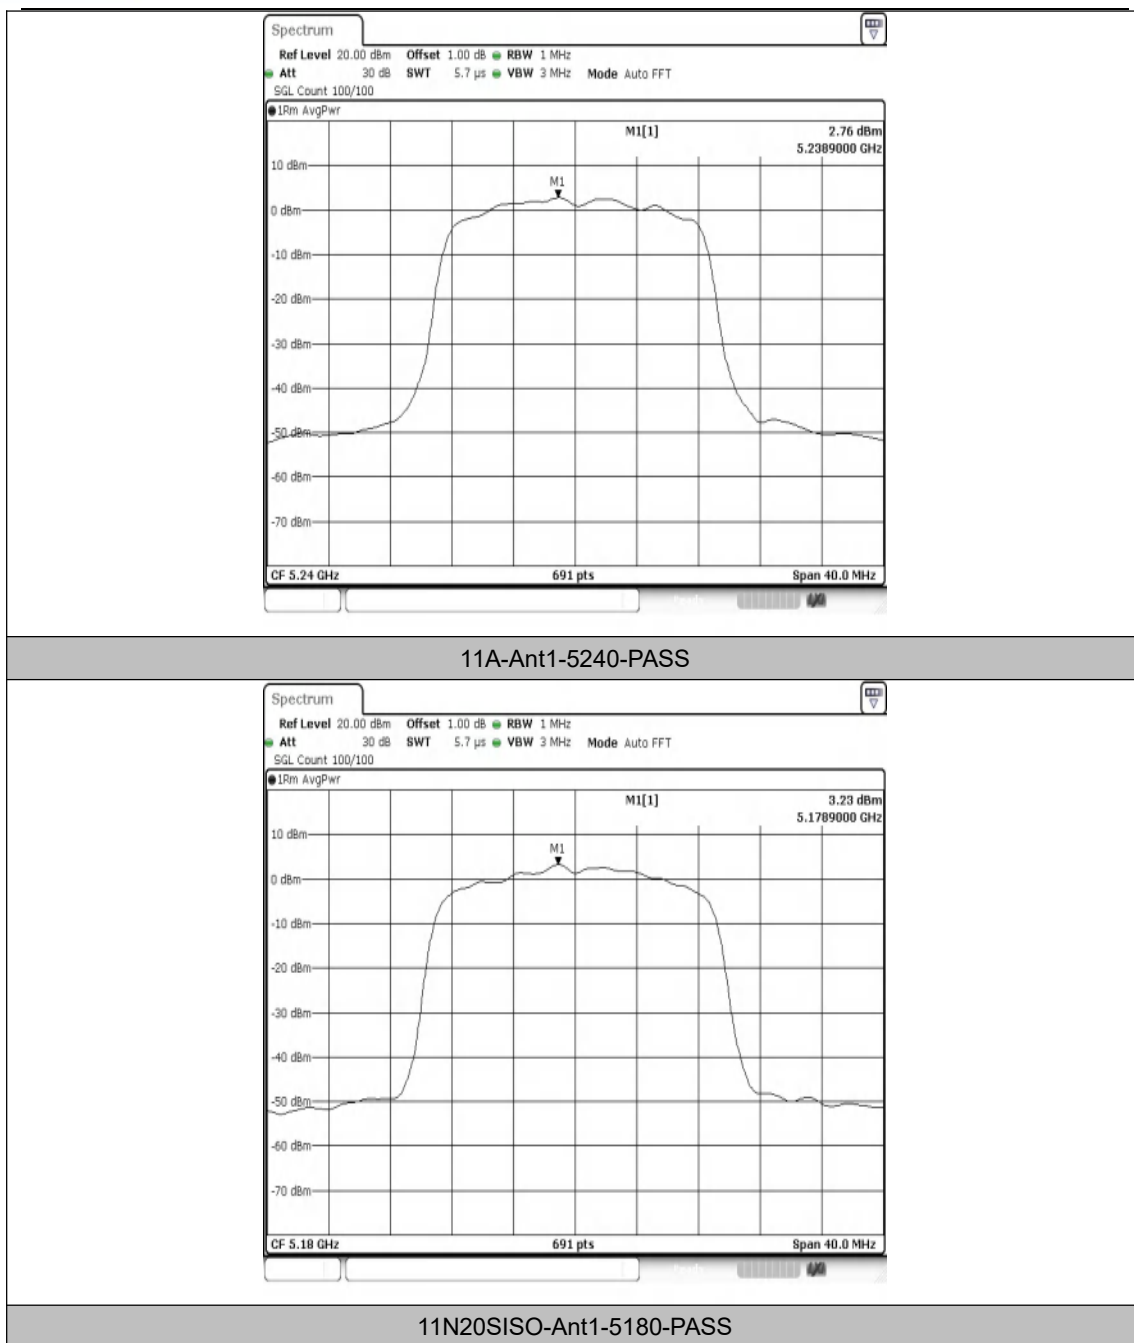


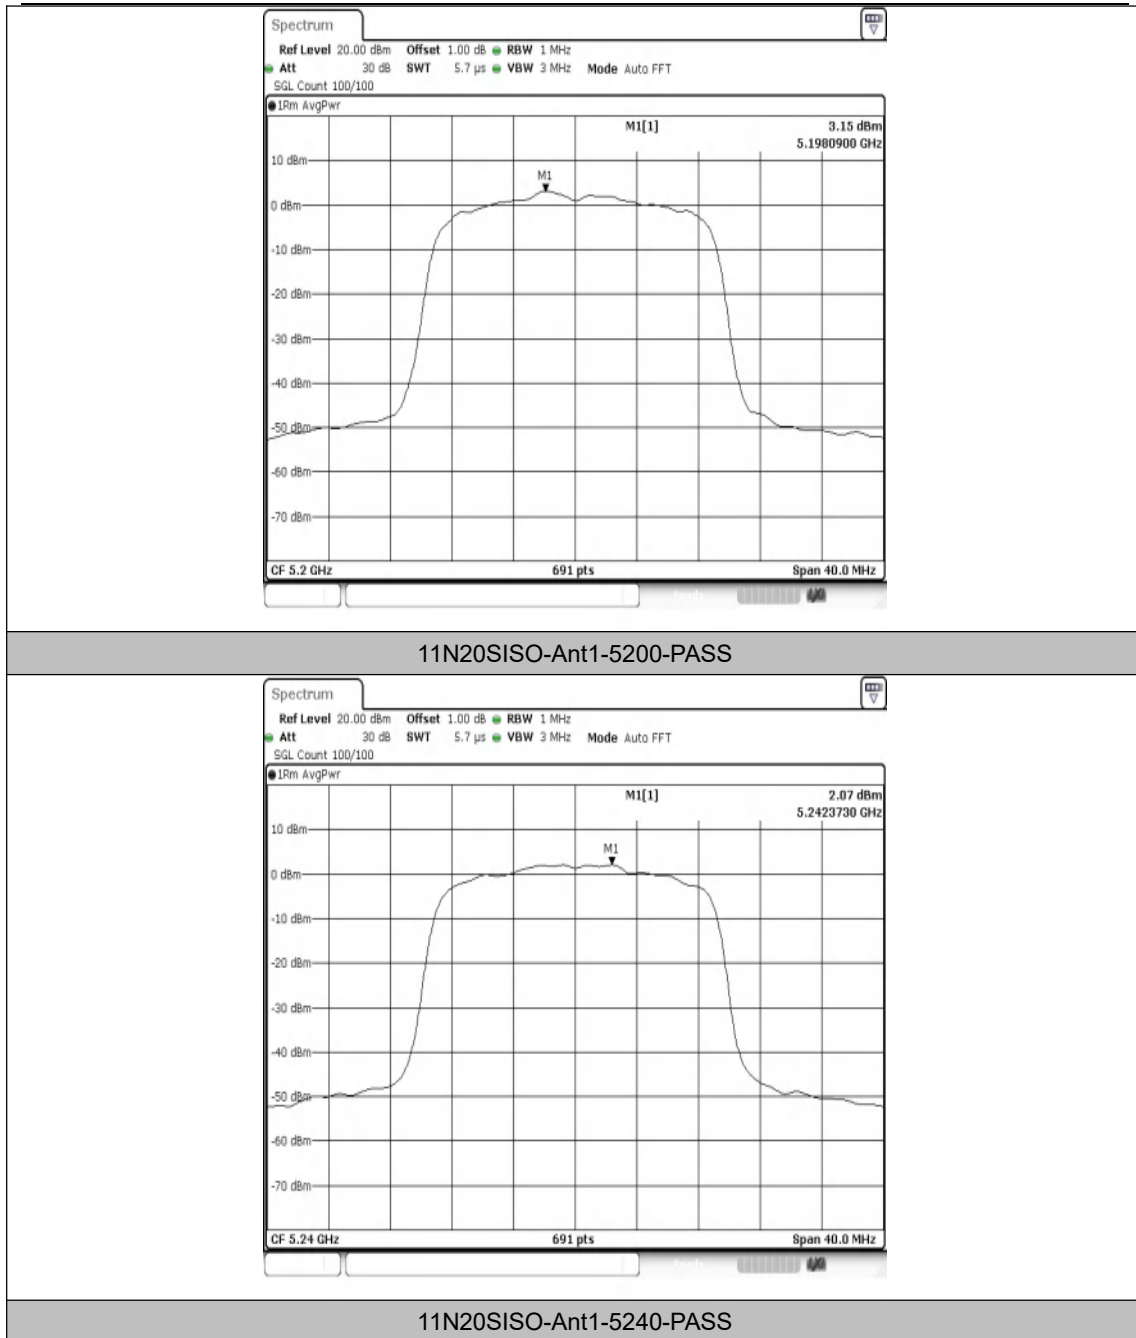

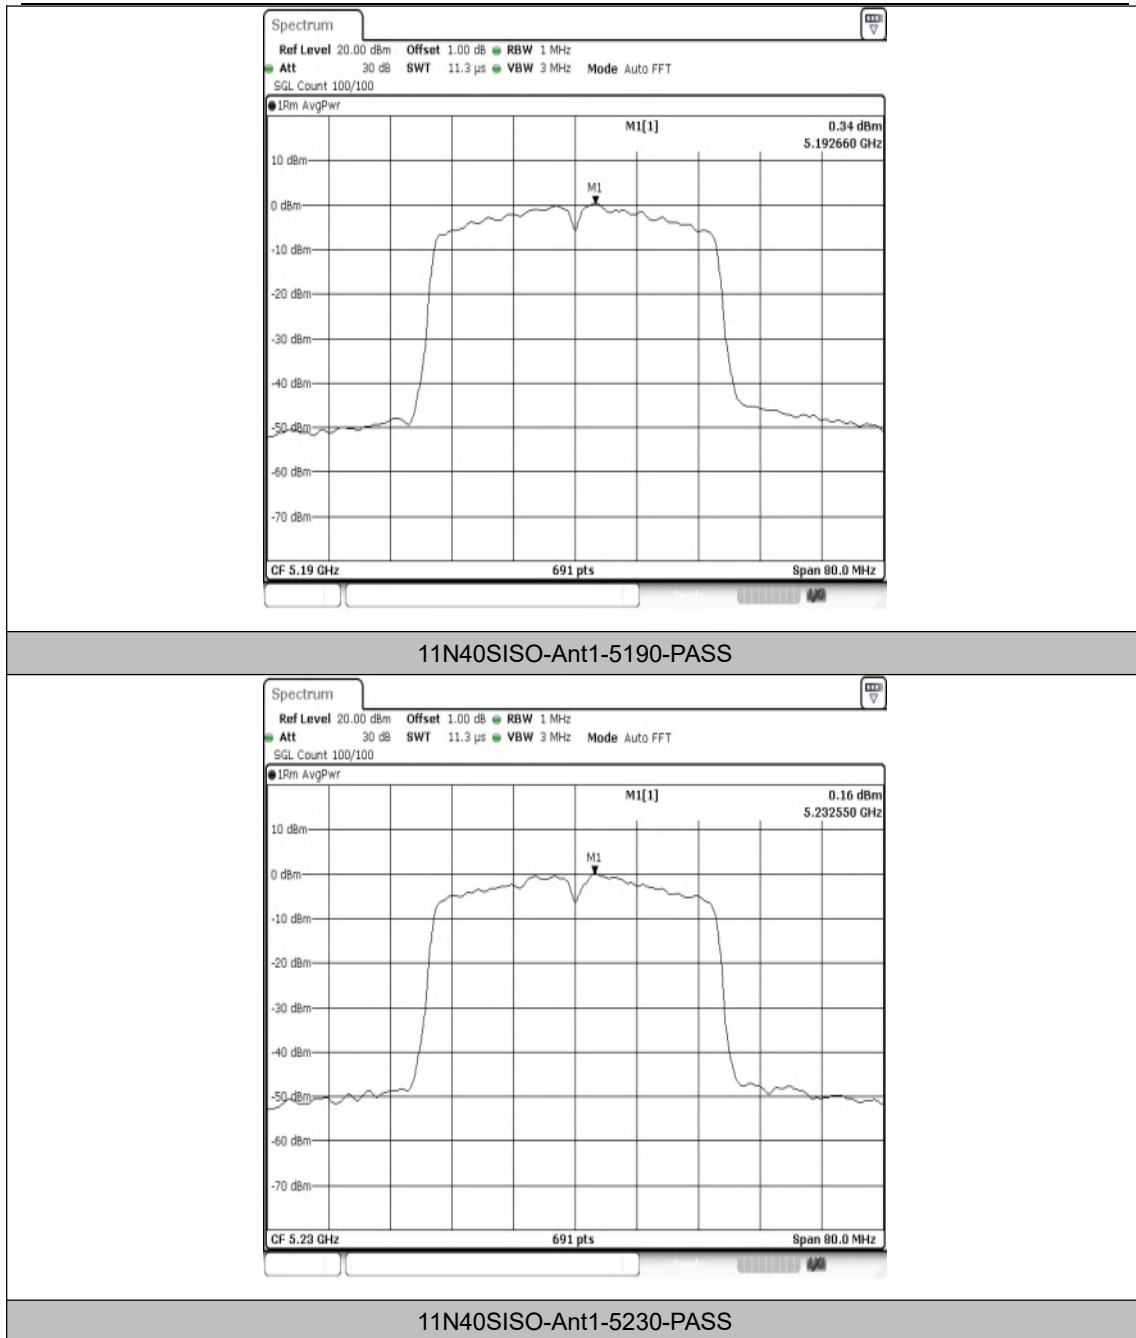


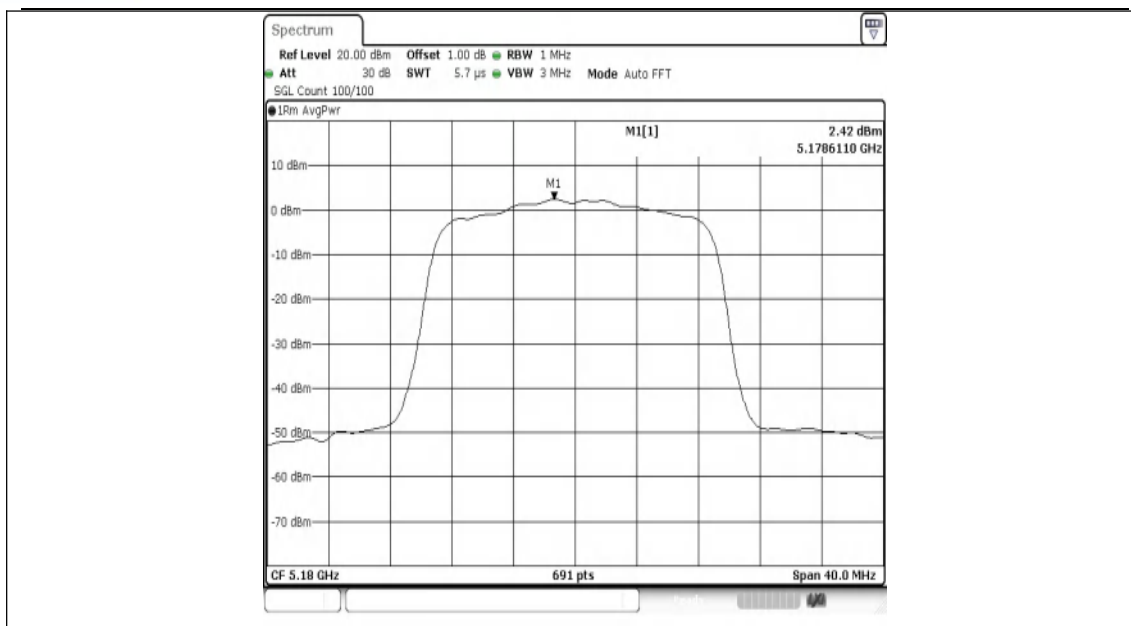


11AC20SISO-Ant1-5180-PASS

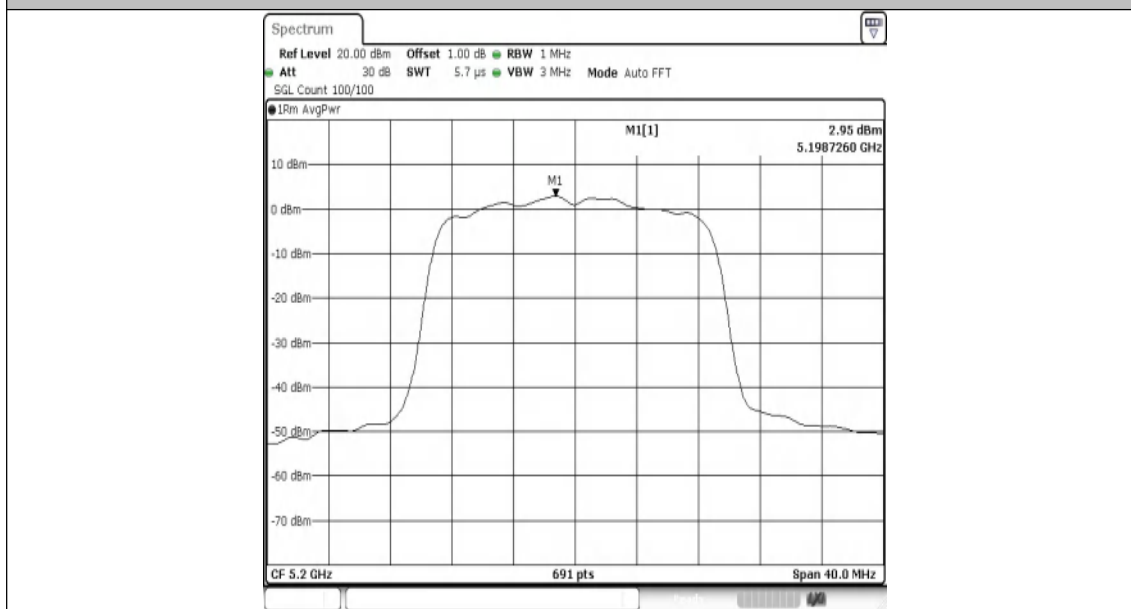


11AC20SISO-Ant1-5200-PASS

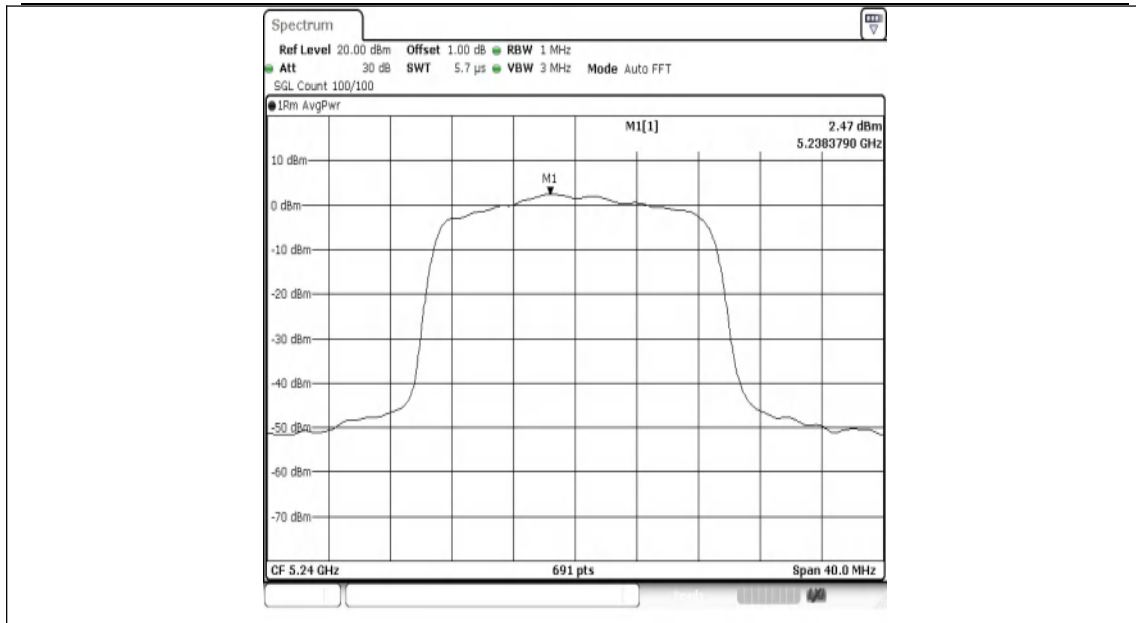


11AC20SISO-Ant1-5240-PASS

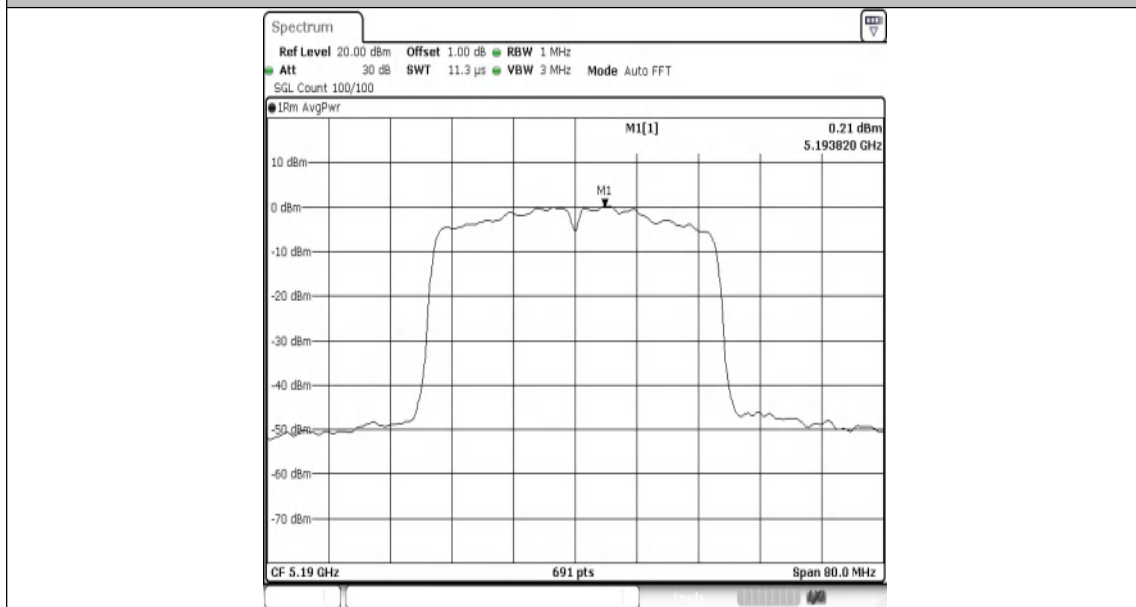


11AC40SISO-Ant1-5190-PASS

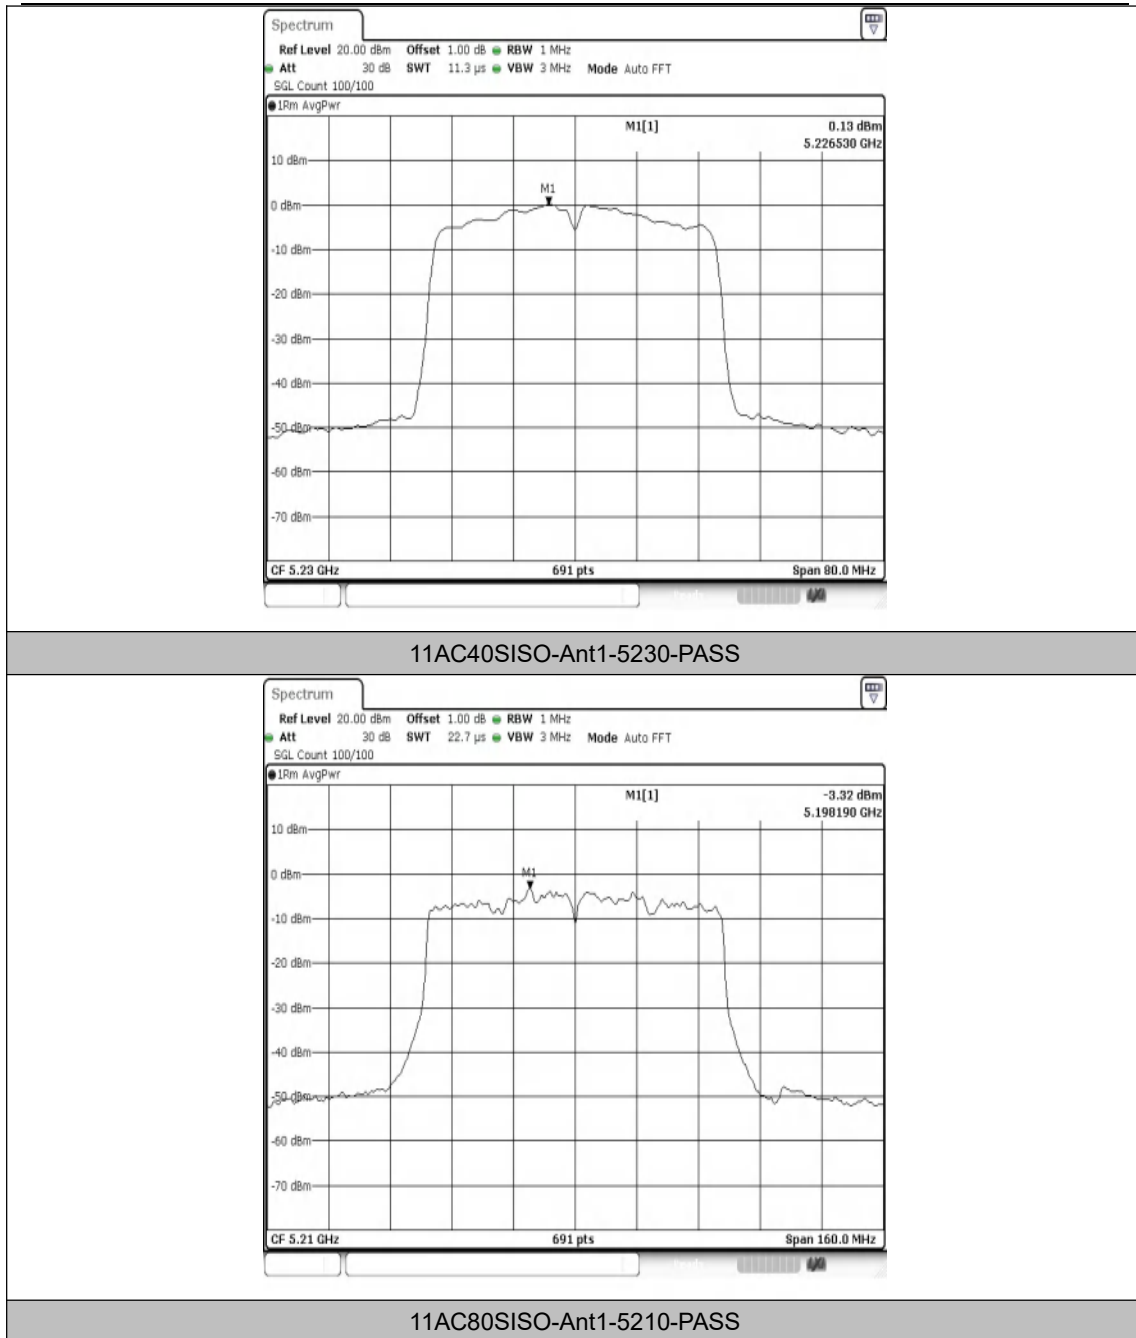


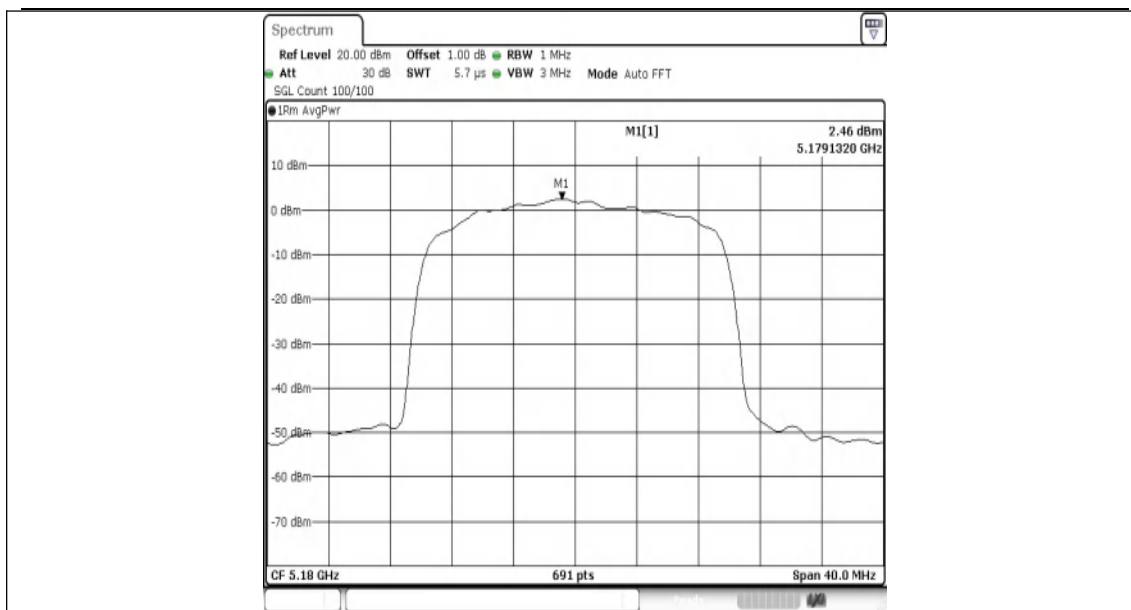


11AX20SISO-Ant1-5180-PASS

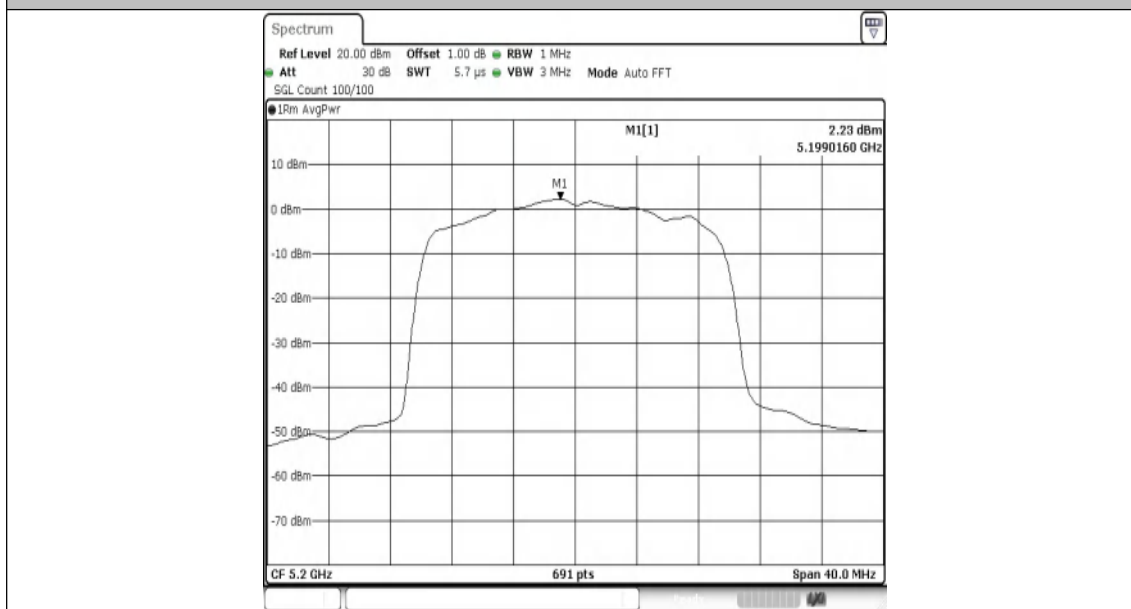


11AX20SISO-Ant1-5200-PASS

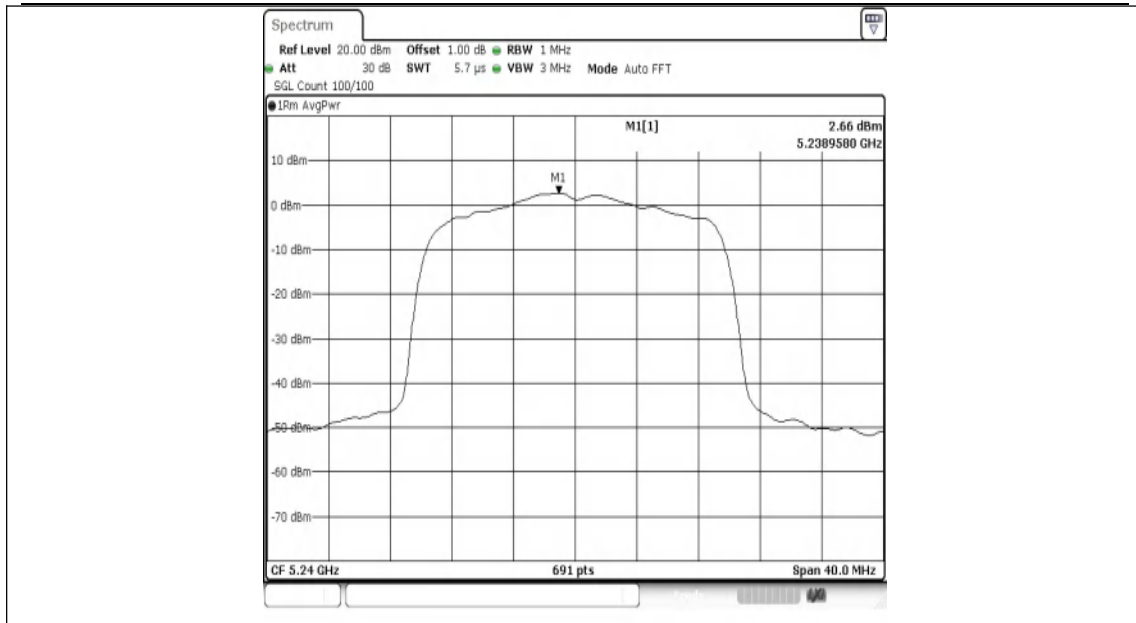


11AX20SISO-Ant1-5240-PASS

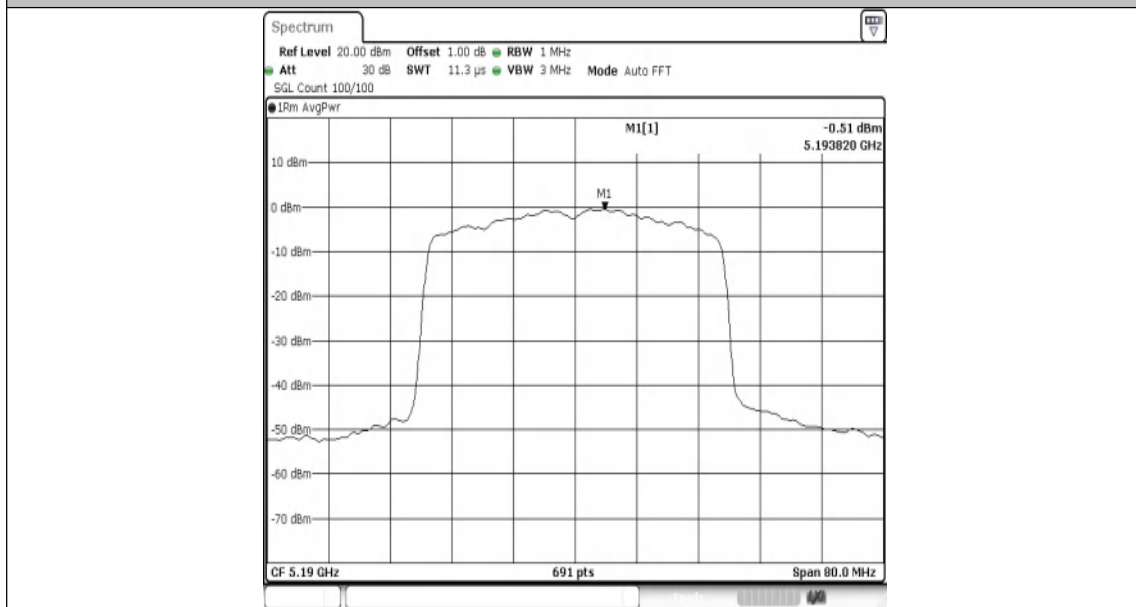

11AX40SISO-Ant1-5190-PASS

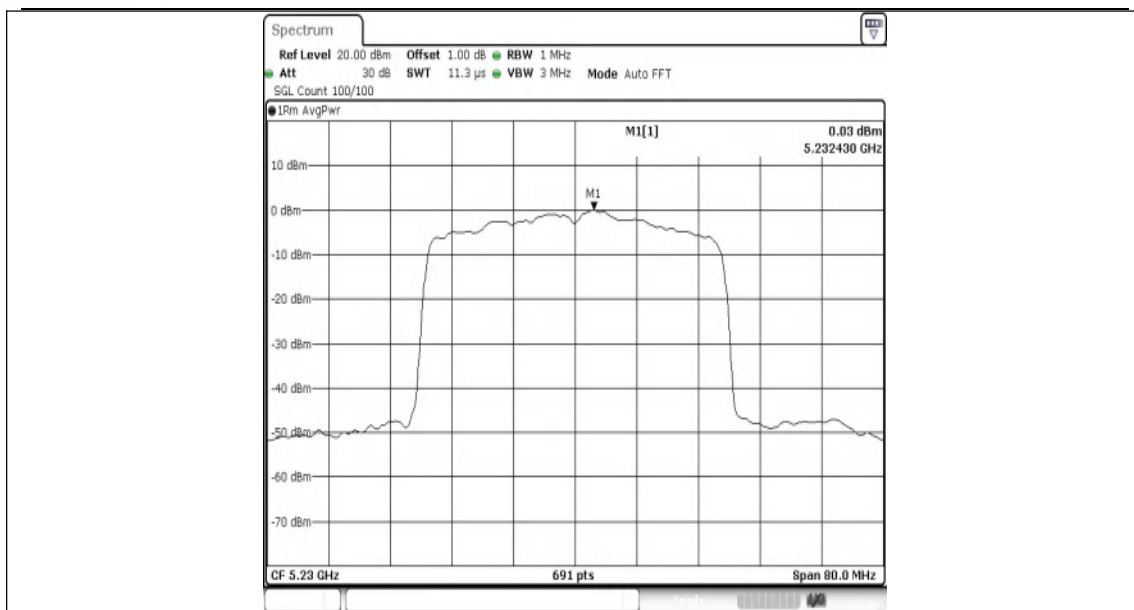


11AX40SISO-Ant1-5230-PASS

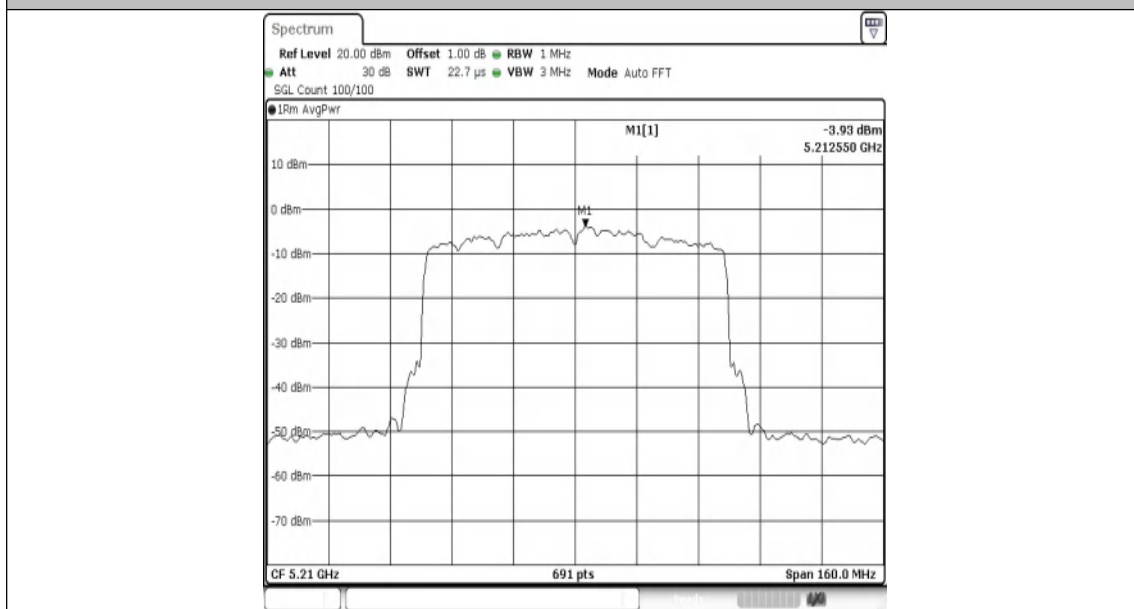

11AX80SISO-Ant1-5210-PASS


Test Graphs B4

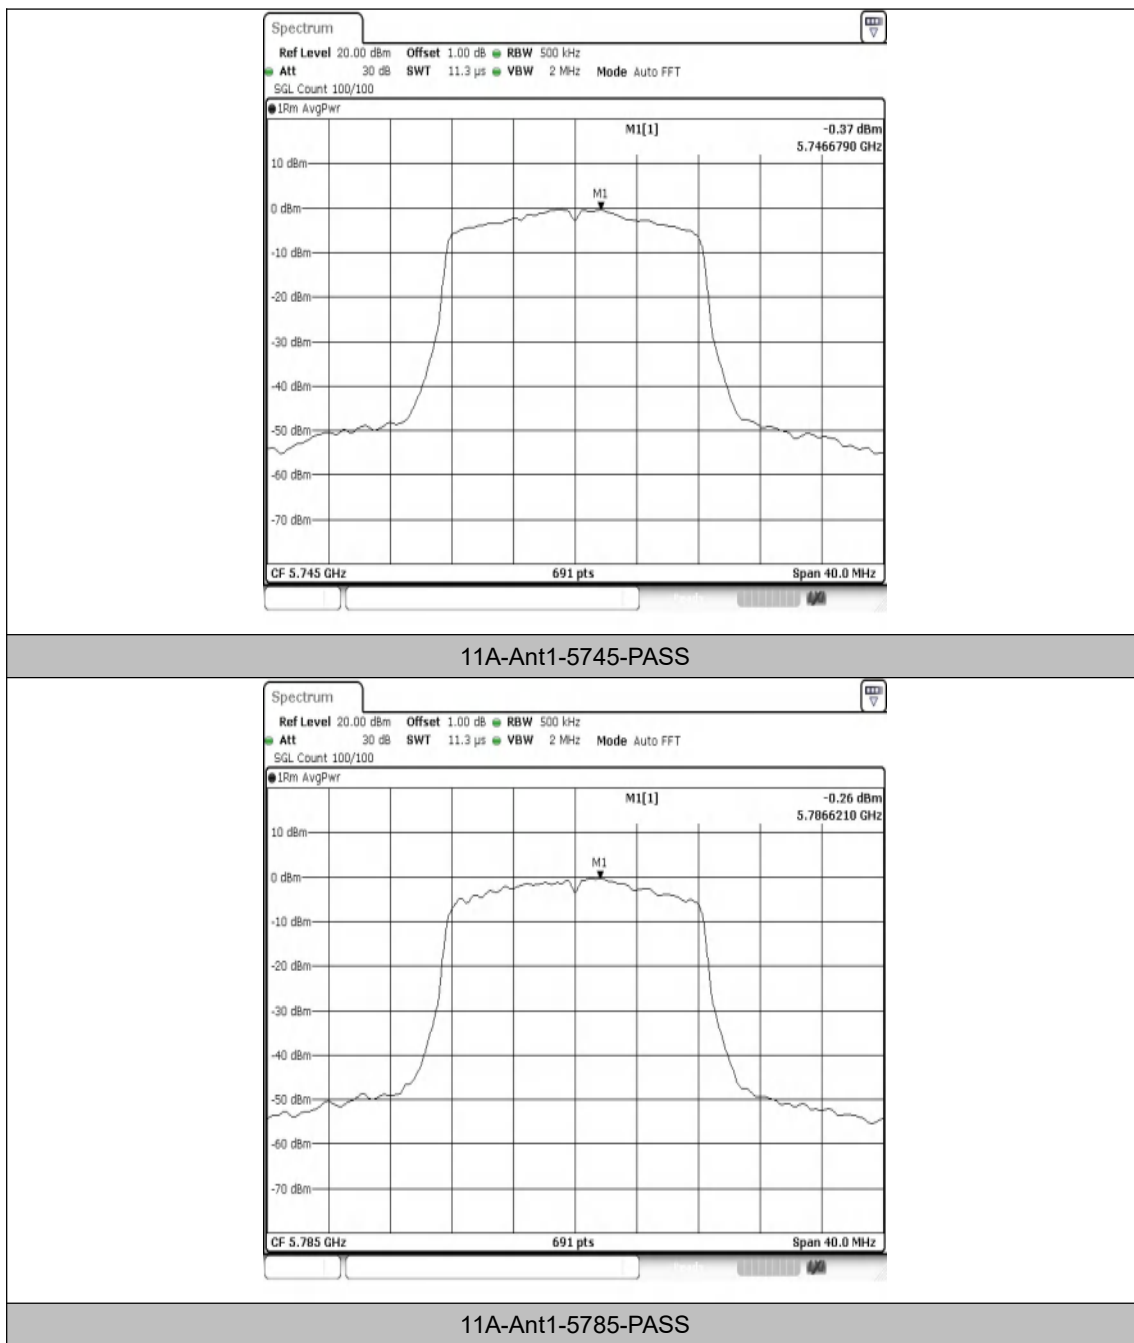

Shenzhen Anbotek Compliance Laboratory Limited

Address: Sogood Industrial Zone Laboratory & 1/F. of Building D, Sogood Science and Technology Park,
Sanwei Community, Hangcheng Subdistrict, Bao'an District, Shenzhen, Guangdong, China
Tel: (86) 0755-26066440 Email: service@anbotek.com


Hotline
400-003-0500
www.anbotek.com

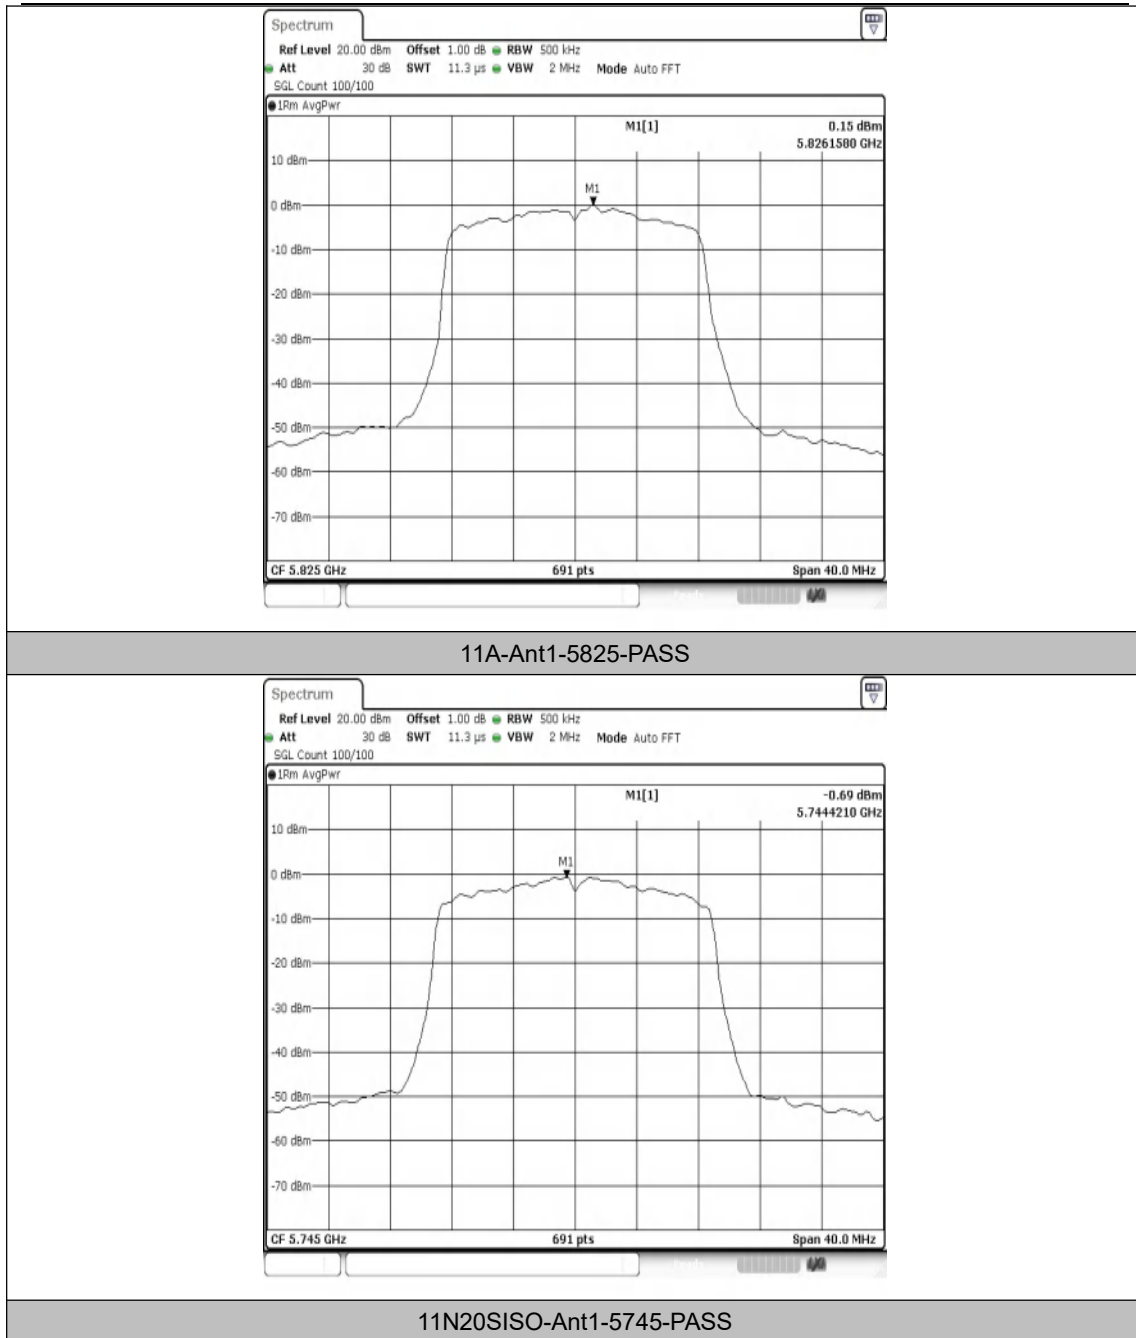



Shenzhen Anbotech Compliance Laboratory Limited

Address: Sogood Industrial Zone Laboratory & 1/F. of Building D, Sogood Science and Technology Park,
Sanwei Community, Hangcheng Subdistrict, Bao'an District, Shenzhen, Guangdong, China
Tel: (86) 0755-26066440 Email: service@anbotech.com


Hotline
400-003-0500
www.anbotech.com

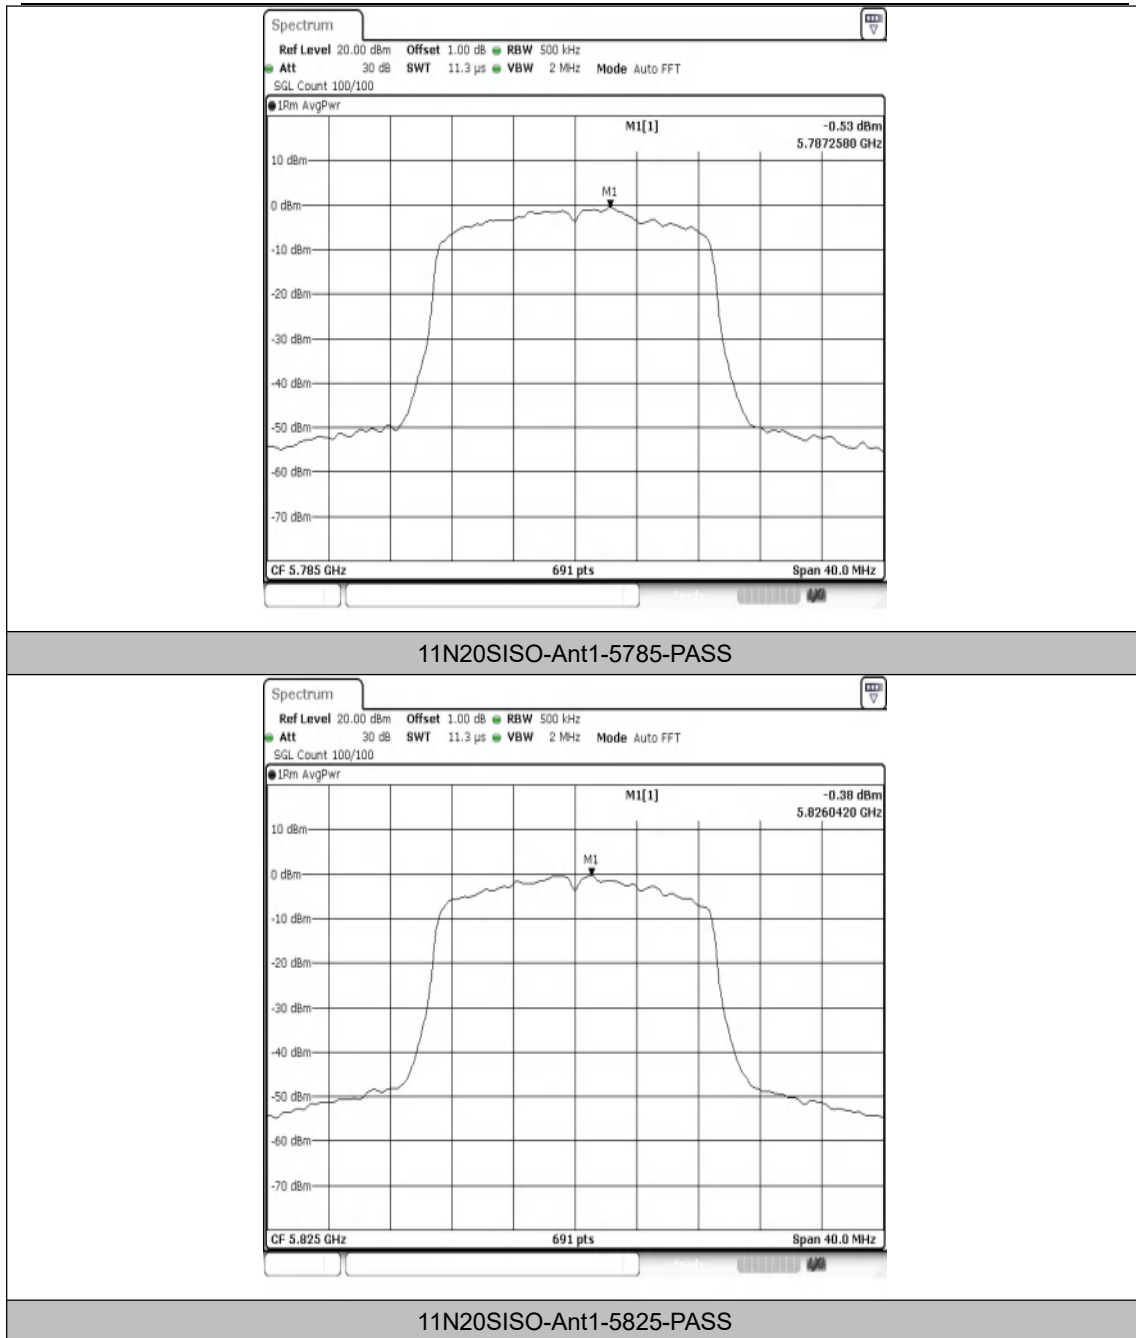

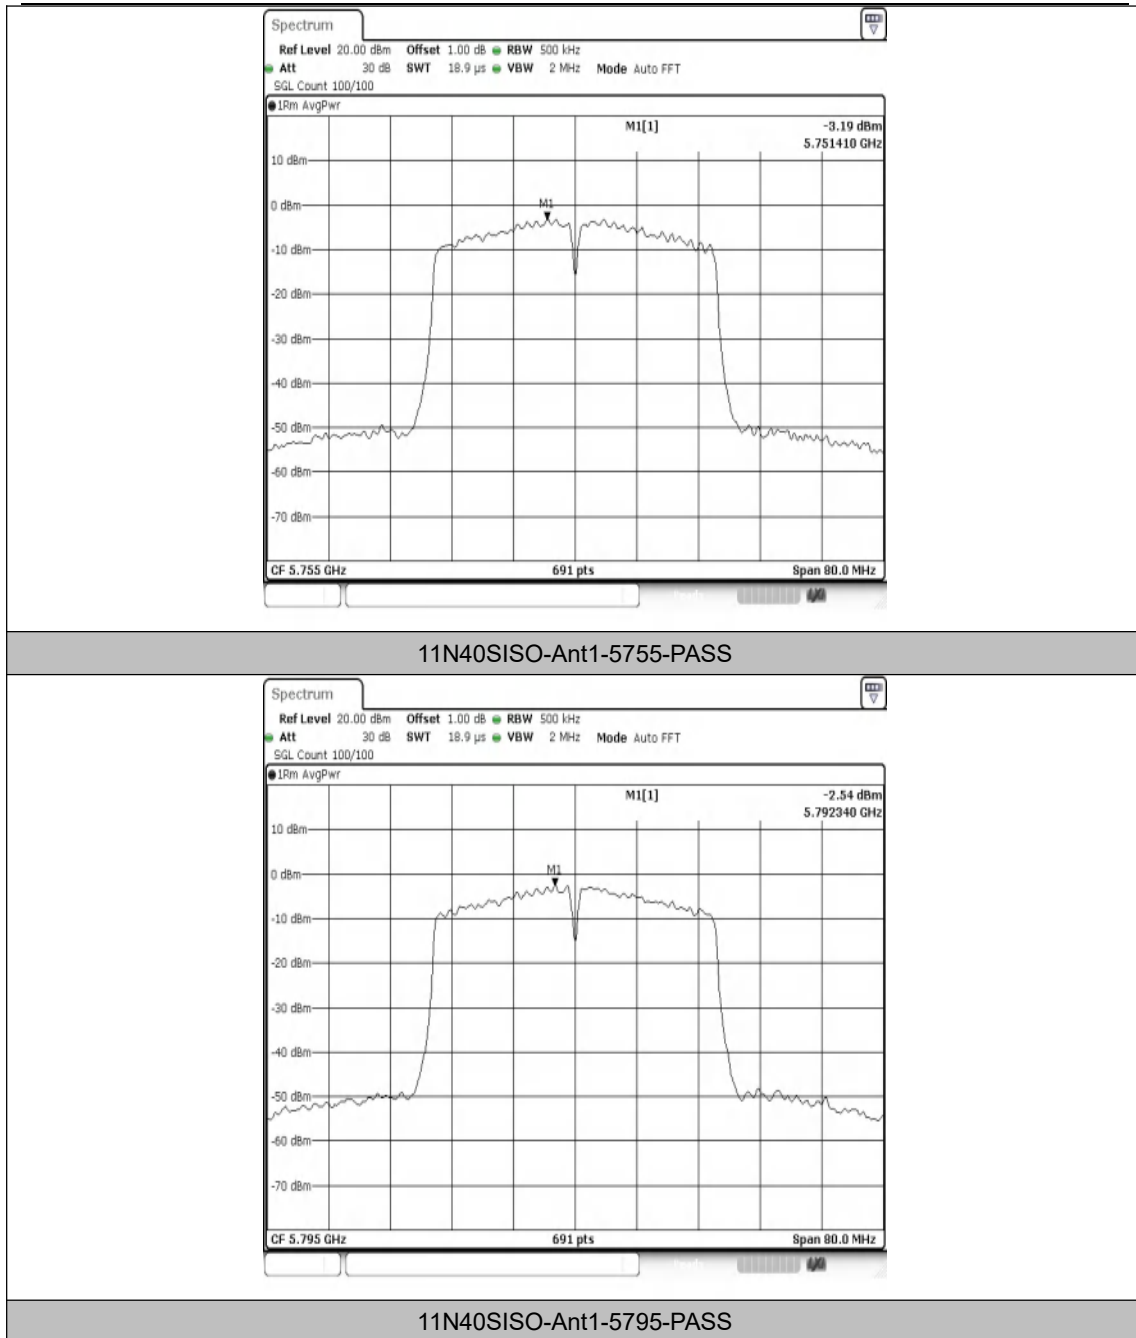


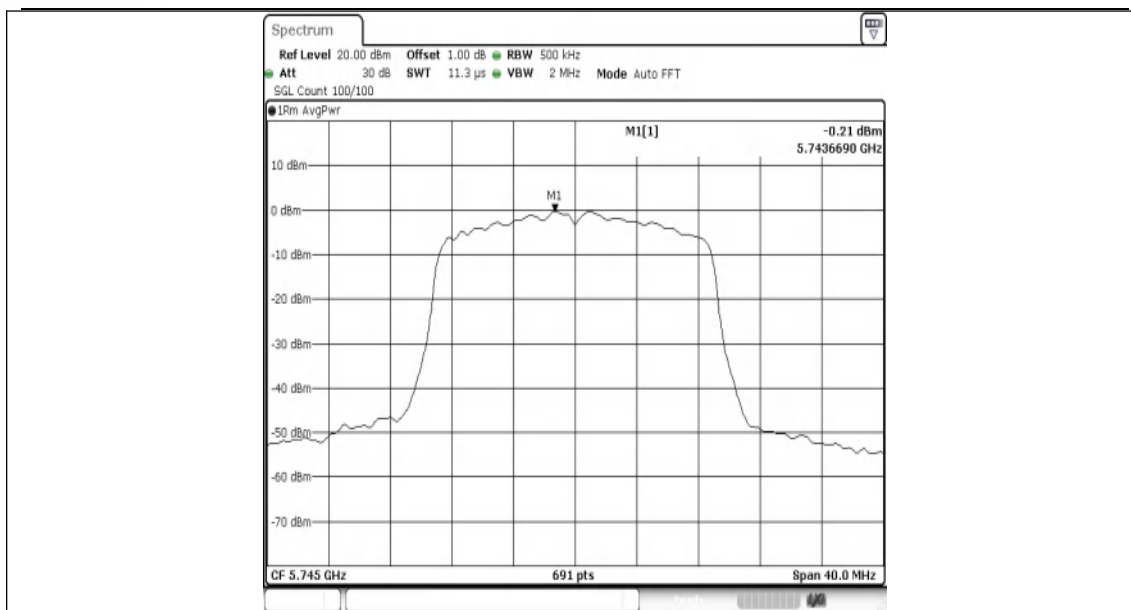


11AC20SISO-Ant1-5745-PASS

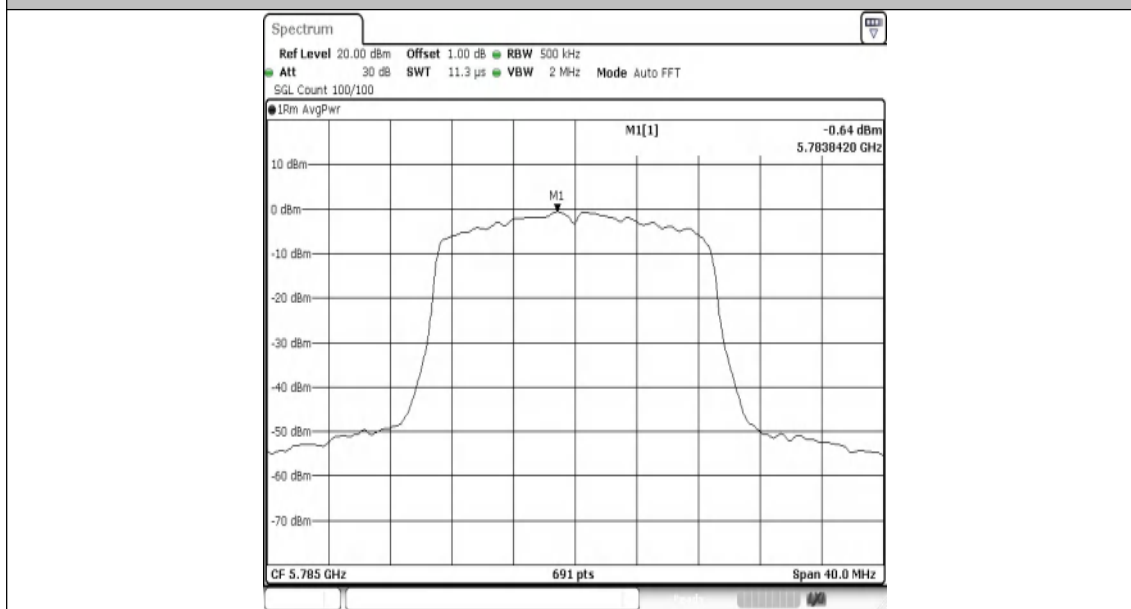


11AC20SISO-Ant1-5785-PASS

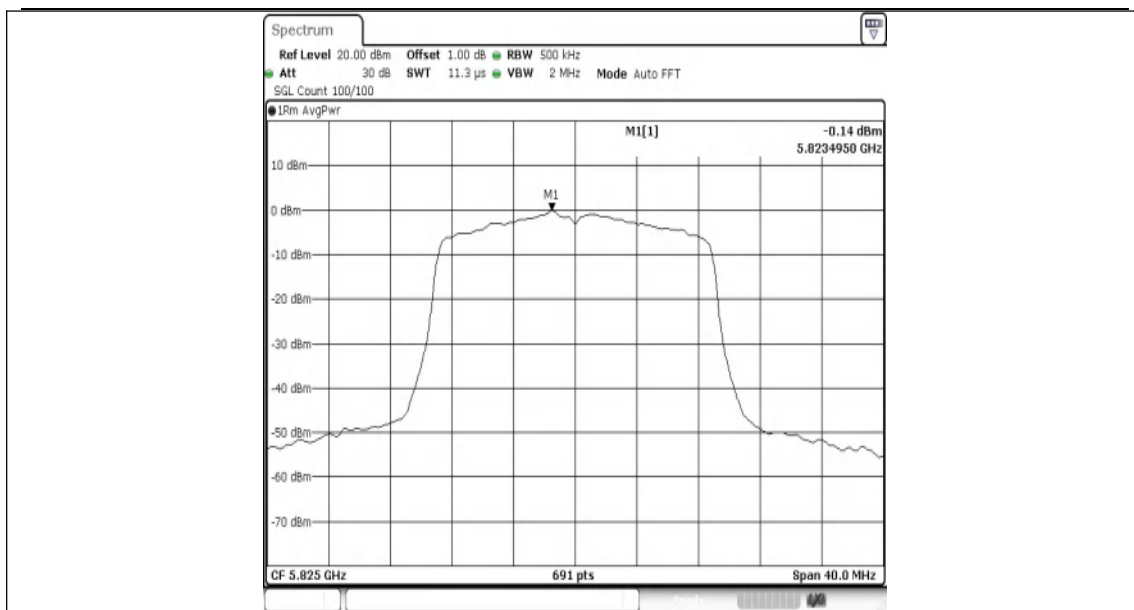


11AC20SISO-Ant1-5825-PASS

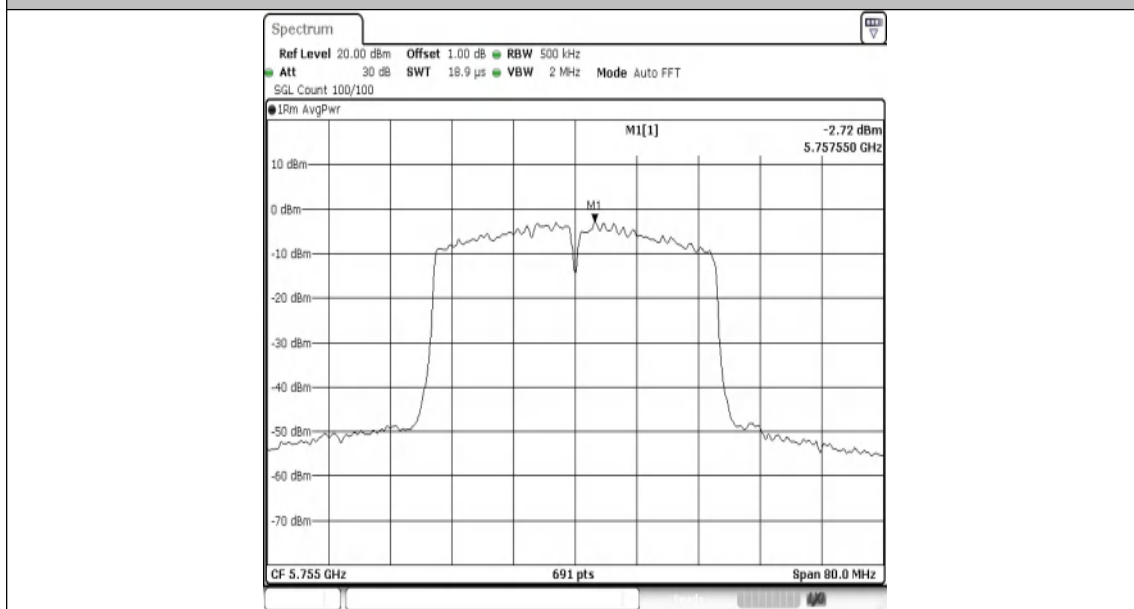


11AC40SISO-Ant1-5755-PASS

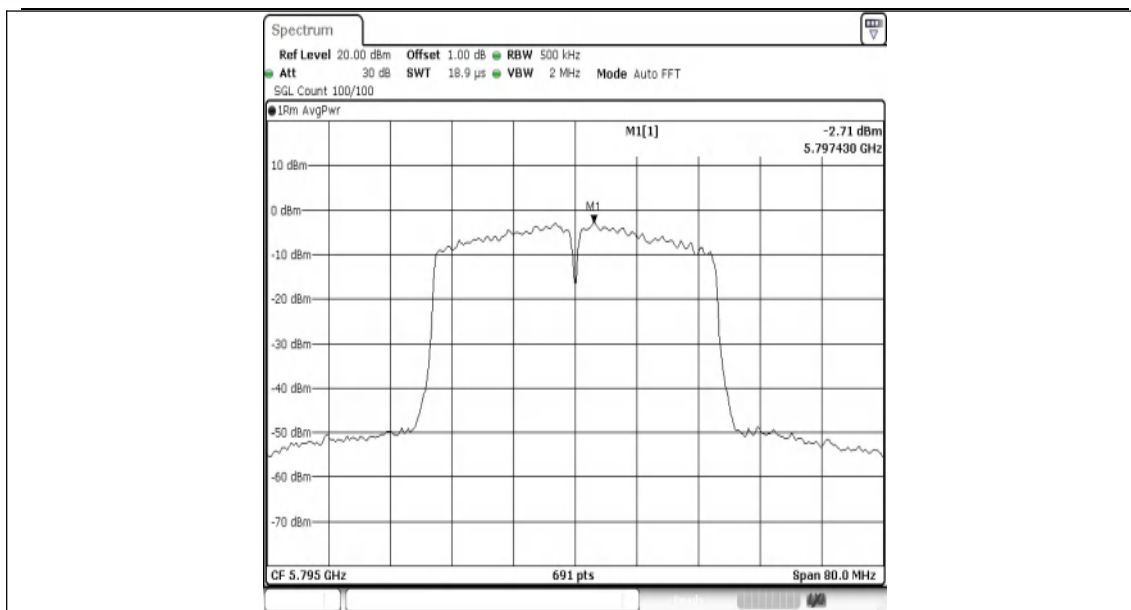


11AC40SISO-Ant1-5795-PASS

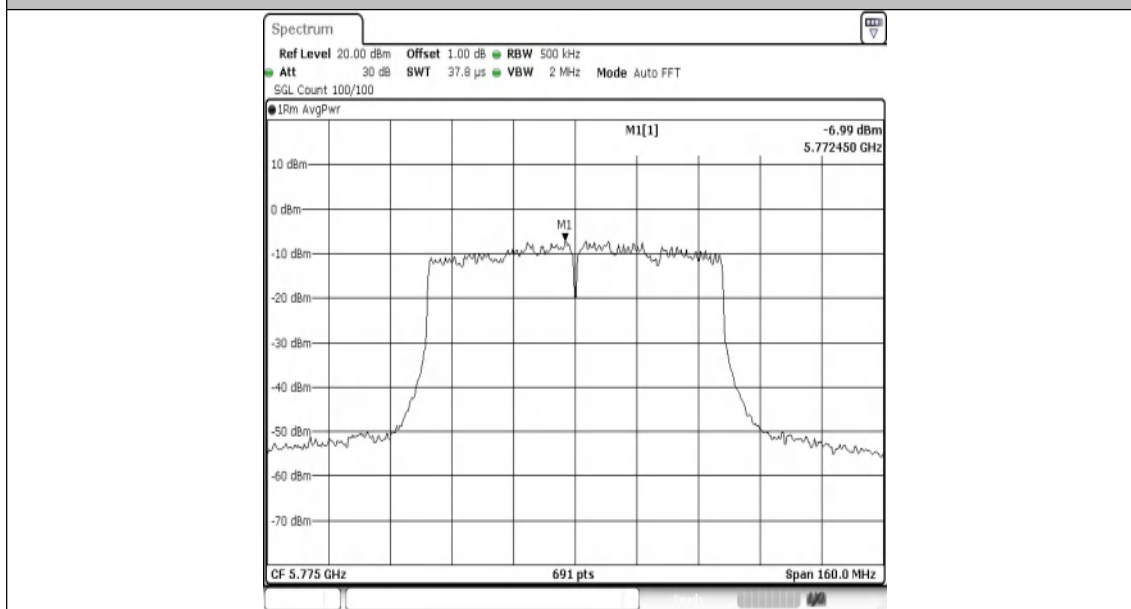


11AC80SISO-Ant1-5775-PASS

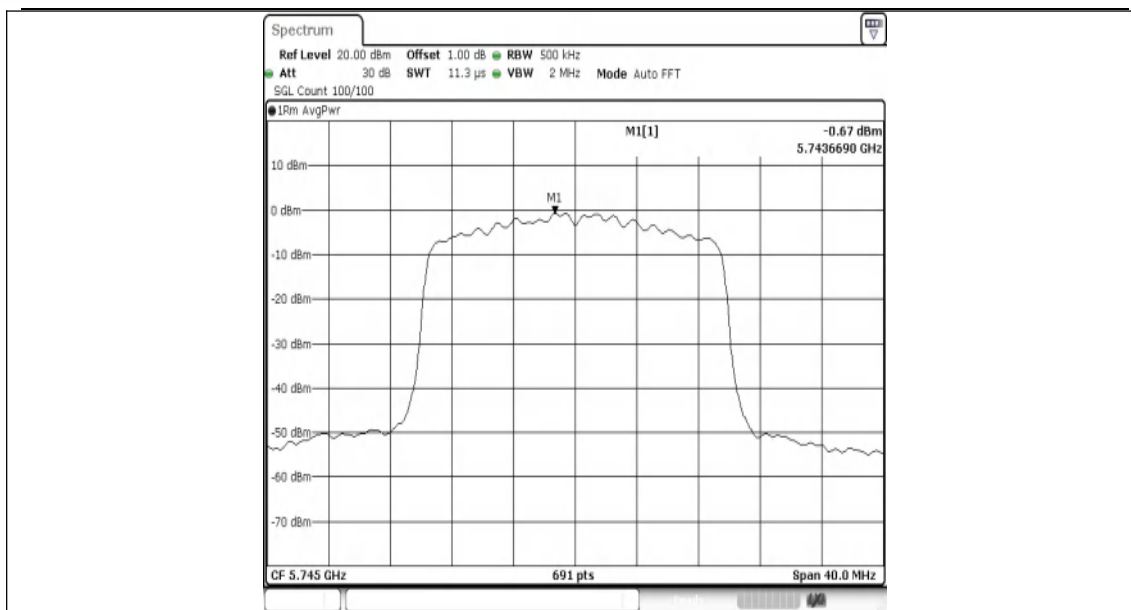

11AX20SISO-Ant1-5745-PASS

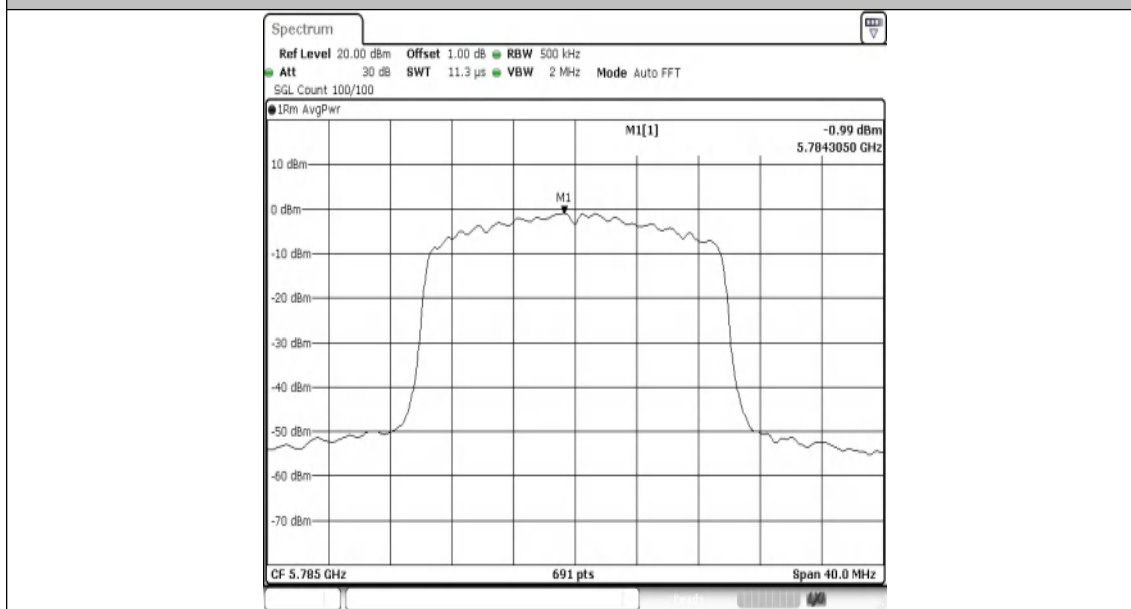


11AX20SISO-Ant1-5785-PASS

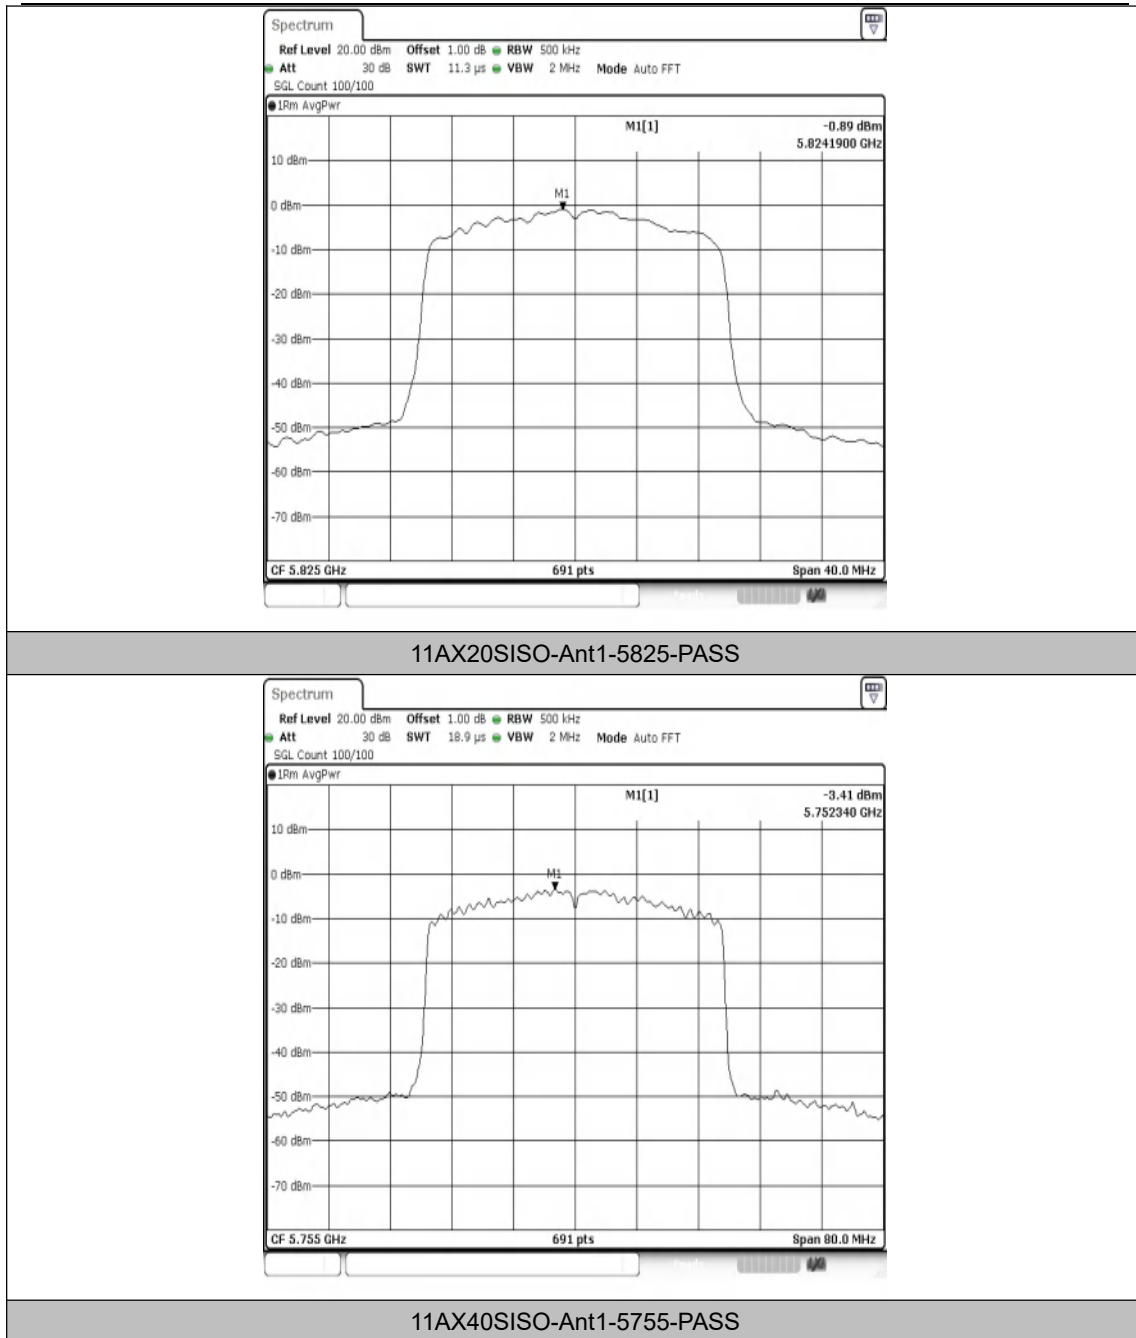


Shenzhen Anbotech Compliance Laboratory Limited

Address: Sogood Industrial Zone Laboratory & 1/F. of Building D, Sogood Science and Technology Park,
Sanwei Community, Hangcheng Subdistrict, Bao'an District, Shenzhen, Guangdong, China
Tel: (86) 0755-26066440 Email: service@anbotech.com

Hotline
400-003-0500
www.anbotech.com

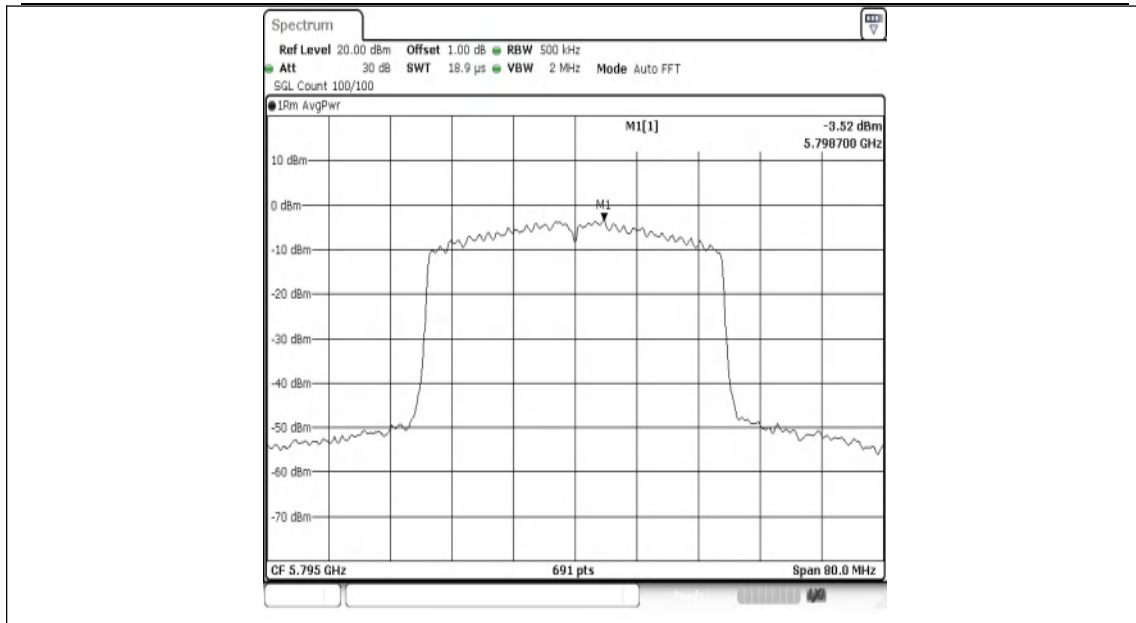

11AX40ISO-Ant1-5795-PASS

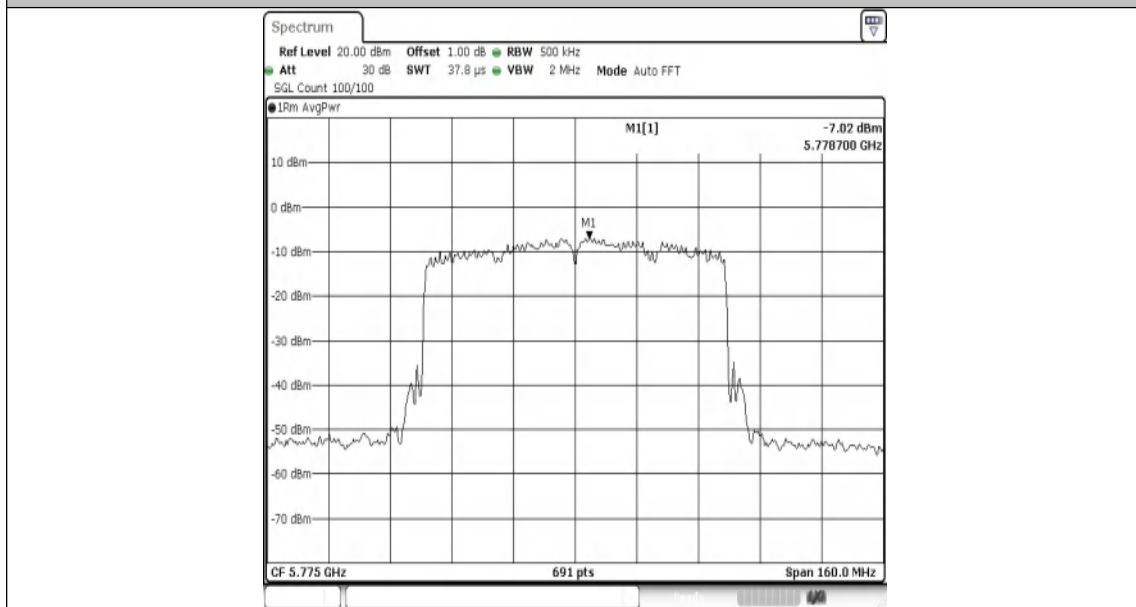

11AX80ISO-Ant1-5775-PASS

Appendix E: Band edge measurements

Test Result B1/2/3

Test Mode	Antenna	ChName	Frequency[MHz]	Result[dBm]	Limit[dBm]	Verdict
11A	Ant1	Low	5180	-39.93	≤-27	PASS
11A	Ant1	High	5240	-48.08	≤-27	PASS
11N20SISO	Ant1	Low	5180	-39.98	≤-27	PASS
11N20SISO	Ant1	High	5240	-48.58	≤-27	PASS
11N40SISO	Ant1	Low	5190	-39.05	≤-27	PASS
11N40SISO	Ant1	High	5230	-48.2	≤-27	PASS
11AC20SISO	Ant1	Low	5180	-39.7	≤-27	PASS
11AC20SISO	Ant1	High	5240	-47.72	≤-27	PASS
11AC40SISO	Ant1	Low	5190	-39.6	≤-27	PASS
11AC40SISO	Ant1	High	5230	-47.99	≤-27	PASS
11AC80SISO	Ant1	Low	5210	-34.37	≤-27	PASS
11AC80SISO	Ant1	High	5210	-48.8	≤-27	PASS
11AX20SISO	Ant1	Low	5180	-39.9	≤-27	PASS
11AX20SISO	Ant1	High	5240	-48.18	≤-27	PASS
11AX40SISO	Ant1	Low	5190	-37.64	≤-27	PASS
11AX40SISO	Ant1	High	5230	-48.19	≤-27	PASS
11AX80SISO	Ant1	Low	5210	-38.4	≤-27	PASS
11AX80SISO	Ant1	High	5210	-48.58	≤-27	PASS

Note: The margin plus the antenna gain also meets the limit.

Test Result B4

Test Mode	Antenna	Ch. Name	Frequency[MHz]	FreqRange [MHz]	Result [dBm]	Limit [dBm]	Verdict
11A	Ant1	Low	5745	5720~5725	-45.48	≤16.36	PASS
11A	Ant1	Low	5745	5700~5720	-48.61	≤10.05	PASS
11A	Ant1	Low	5745	5650~5700	-50.97	≤-26.88	PASS
11A	Ant1	Low	5745	5760~5650	-49.32	≤-27	PASS
11A	Ant1	High	5825	5850~5855	-48.23	≤15.65	PASS
11A	Ant1	High	5825	5855~5875	-48.24	≤11.33	PASS
11A	Ant1	High	5825	5875~5925	-48.31	≤-26.29	PASS
11A	Ant1	High	5825	5925~5935	-49.61	≤-27	PASS
11N20SI SO	Ant1	Low	5745	5720~5725	-40.49	≤20.92	PASS
11N20SI SO	Ant1	Low	5745	5700~5720	-48.14	≤10.84	PASS
11N20SI SO	Ant1	Low	5745	5650~5700	-51.17	≤-26.75	PASS
11N20SI SO	Ant1	Low	5745	5760~5650	-49.65	≤-27	PASS
11N20SI SO	Ant1	High	5825	5850~5855	-47.32	≤15.65	PASS
11N20SI SO	Ant1	High	5825	5855~5875	-48.78	≤10.46	PASS
11N20SI SO	Ant1	High	5825	5875~5925	-50.53	≤-26.87	PASS
11N20SI SO	Ant1	High	5825	5925~5935	-49.96	≤-27	PASS
11N40SI SO	Ant1	Low	5755	5720~5725	-36.39	≤18.13	PASS
11N40SI SO	Ant1	Low	5755	5700~5720	-37.76	≤15.42	PASS
11N40SI SO	Ant1	Low	5755	5650~5700	-47.86	≤-25.34	PASS
11N40SI SO	Ant1	Low	5755	5780~5650	-50.22	≤-27	PASS
11N40SI SO	Ant1	High	5795	5850~5855	-48.9	≤15.85	PASS
11N40SI SO	Ant1	High	5795	5855~5875	-46.85	≤11.21	PASS
11N40SI SO	Ant1	High	5795	5875~5925	-49.44	≤-26.61	PASS
11N40SI	Ant1	High	5795	5925~5935	-49.15	≤-27	PASS

Shenzhen Anbotek Compliance Laboratory Limited

SO							
11AC20S ISO	Ant1	Low	5745	5720~5725	-39.79	≤20.92	PASS
11AC20S ISO	Ant1	Low	5745	5700~5720	-47.71	≤11.07	PASS
11AC20S ISO	Ant1	Low	5745	5650~5700	-51.18	≤-26.88	PASS
11AC20S ISO	Ant1	Low	5745	5760~5650	-47.01	≤-27	PASS
11AC20S ISO	Ant1	High	5825	5850~5855	-48.31	≤15.65	PASS
11AC20S ISO	Ant1	High	5825	5855~5875	-48.95	≤10.02	PASS
11AC20S ISO	Ant1	High	5825	5875~5925	-50.51	≤-26.29	PASS
11AC20S ISO	Ant1	High	5825	5925~5935	-49.76	≤-27	PASS
11AC40S ISO	Ant1	Low	5755	5720~5725	-39.56	≤15.90	PASS
11AC40S ISO	Ant1	Low	5755	5700~5720	-39.01	≤15.36	PASS
11AC40S ISO	Ant1	Low	5755	5650~5700	-47.32	≤-25.05	PASS
11AC40S ISO	Ant1	Low	5755	5780~5650	-48.69	≤-27	PASS
11AC40S ISO	Ant1	High	5795	5850~5855	-49.05	≤15.85	PASS
11AC40S ISO	Ant1	High	5795	5855~5875	-48.49	≤10.21	PASS
11AC40S ISO	Ant1	High	5795	5875~5925	-48.95	≤-26.44	PASS
11AC40S ISO	Ant1	High	5795	5925~5935	-48.79	≤-27	PASS
11AC80S ISO	Ant1	Low	5775	5720~5725	-36.04	≤15.67	PASS
11AC80S ISO	Ant1	Low	5775	5700~5720	-39.15	≤11.02	PASS
11AC80S ISO	Ant1	Low	5775	5650~5700	-49.82	≤-26.88	PASS
11AC80S ISO	Ant1	Low	5775	5800~5650	-47.96	≤-27	PASS
11AC80S ISO	Ant1	High	5775	5850~5855	-42.56	≤15.98	PASS


Shenzhen Anbotech Compliance Laboratory Limited





11AC80S ISO	Ant1	High	5775	5855~5875	-43.2	≤10.54	PASS
11AC80S ISO	Ant1	High	5775	5875~5925	-49.93	≤-26.86	PASS
11AC80S ISO	Ant1	High	5775	5925~5935	-48.84	≤-27	PASS
11AX20SI SO	Ant1	Low	5745	5720~5725	-43.26	≤16.36	PASS
11AX20SI SO	Ant1	Low	5745	5700~5720	-46.86	≤10.23	PASS
11AX20SI SO	Ant1	Low	5745	5650~5700	-49.85	≤-26.38	PASS
11AX20SI SO	Ant1	Low	5745	5760~5650	-49.39	≤-27	PASS
11AX20SI SO	Ant1	High	5825	5850~5855	-48.09	≤15.65	PASS
11AX20SI SO	Ant1	High	5825	5855~5875	-46.96	≤11.50	PASS
11AX20SI SO	Ant1	High	5825	5875~5925	-50.69	≤-26.44	PASS
11AX20SI SO	Ant1	High	5825	5925~5935	-48.65	≤-27	PASS
11AX40SI SO	Ant1	Low	5755	5720~5725	-37.35	≤15.90	PASS
11AX40SI SO	Ant1	Low	5755	5700~5720	-37.12	≤15.47	PASS
11AX40SI SO	Ant1	Low	5755	5650~5700	-50.15	≤-26.65	PASS
11AX40SI SO	Ant1	Low	5755	5780~5650	-49.06	≤-27	PASS
11AX40SI SO	Ant1	High	5795	5850~5855	-48.66	≤15.85	PASS
11AX40SI SO	Ant1	High	5795	5855~5875	-48.48	≤10.47	PASS
11AX40SI SO	Ant1	High	5795	5875~5925	-51.05	≤-26.97	PASS
11AX40SI SO	Ant1	High	5795	5925~5935	-49.69	≤-27	PASS

Note: The margin plus the antenna gain also meets the limit.

Test Graphs B1/2/3

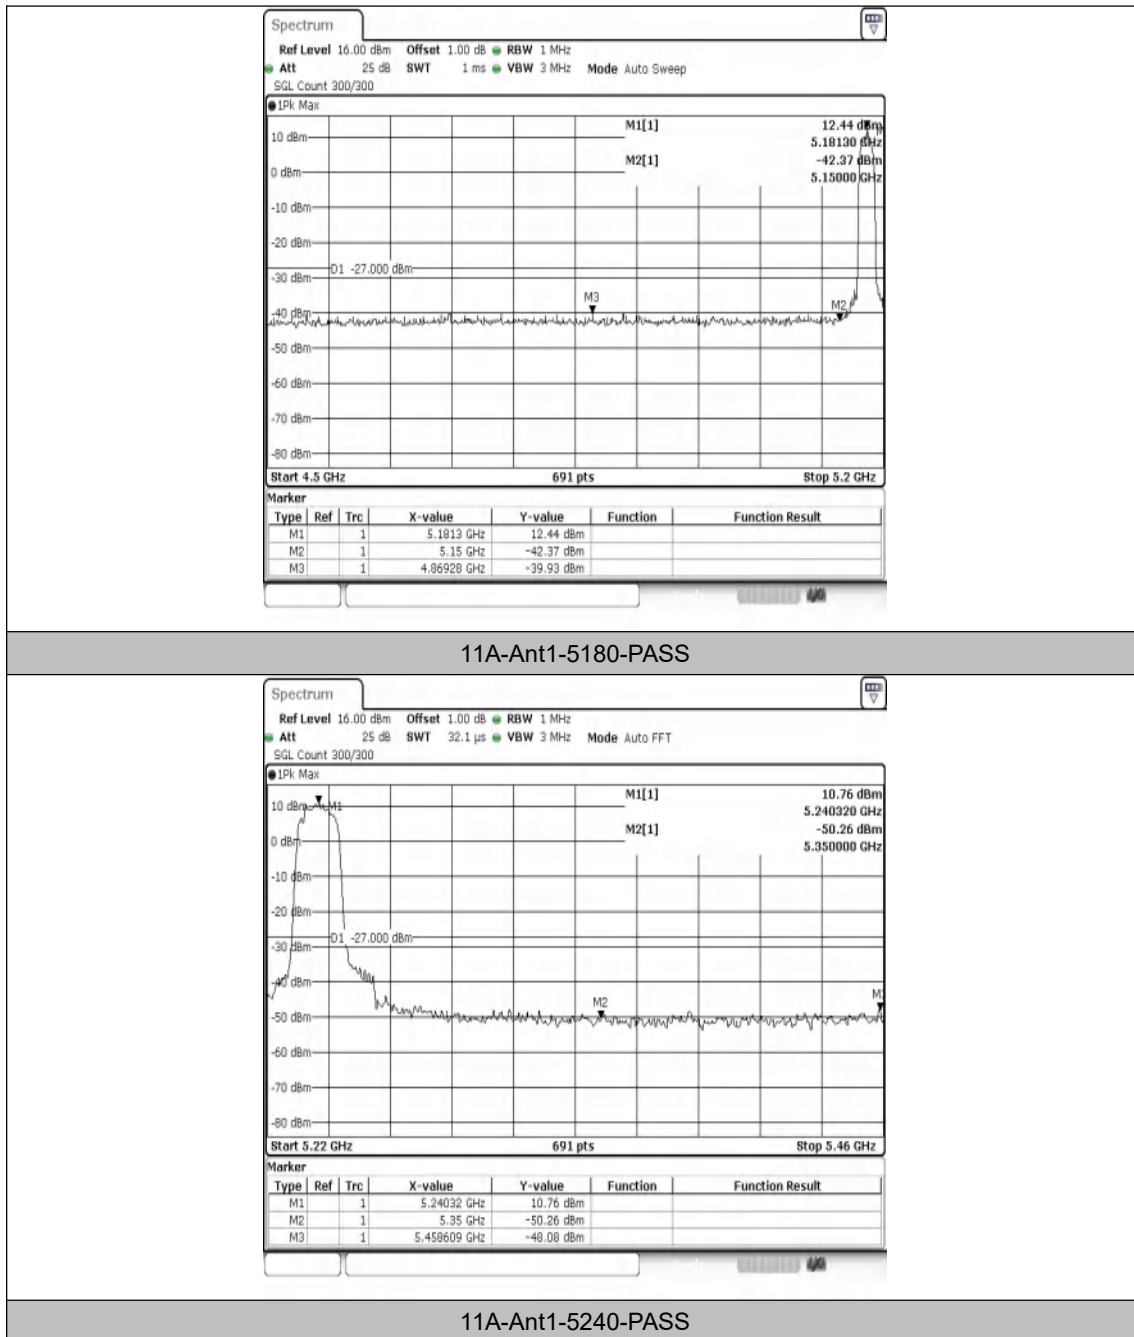

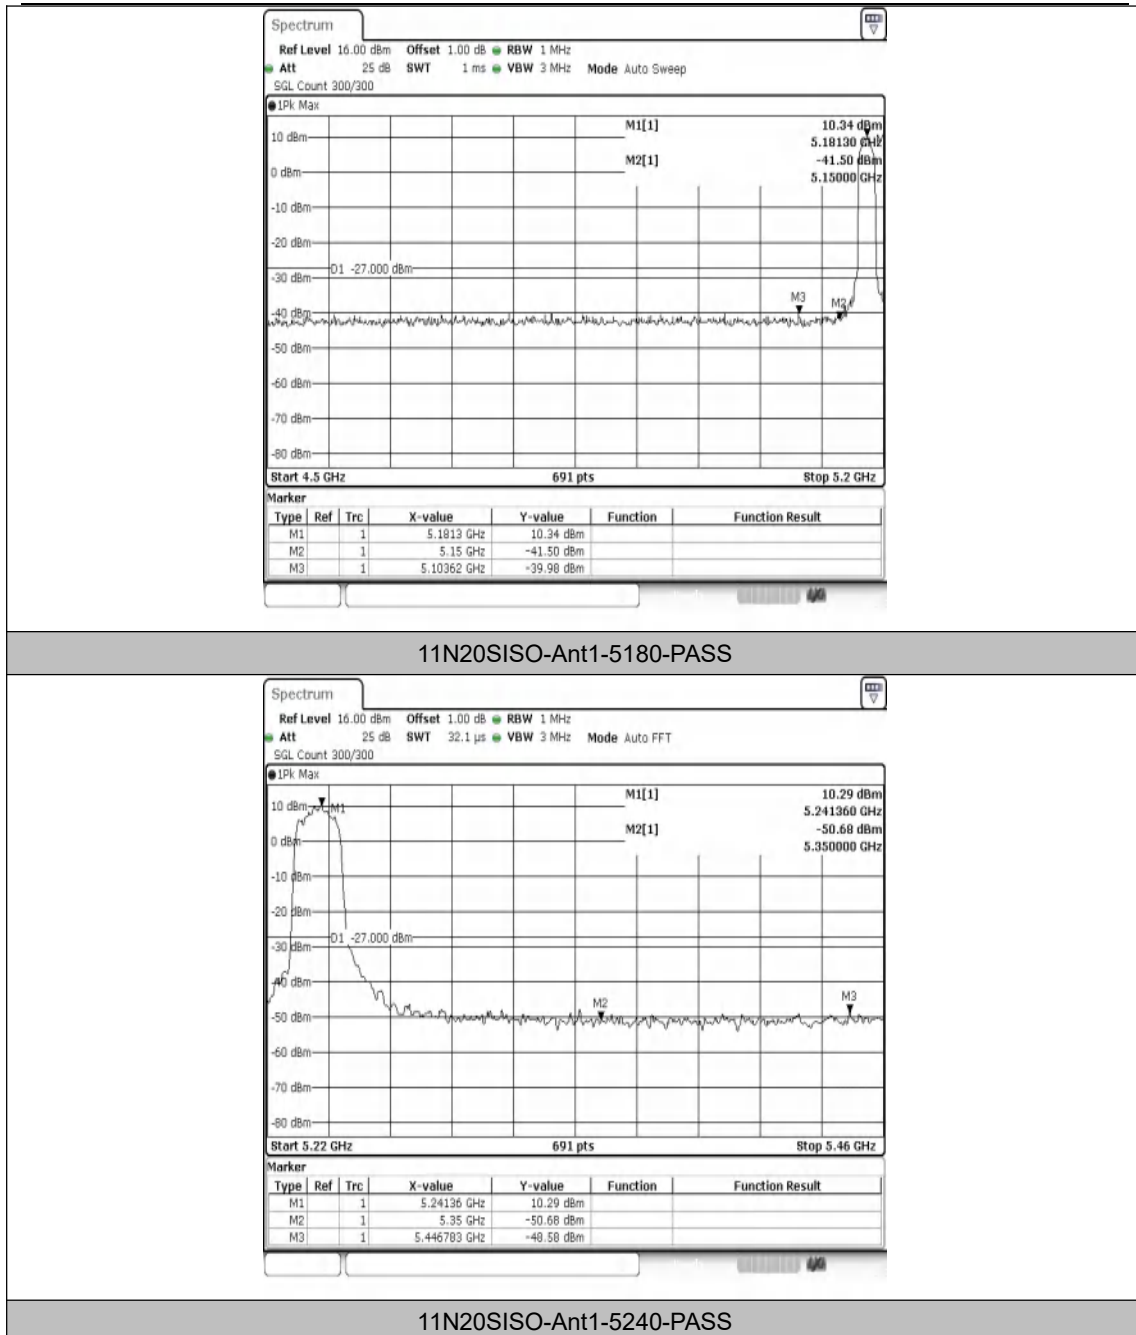


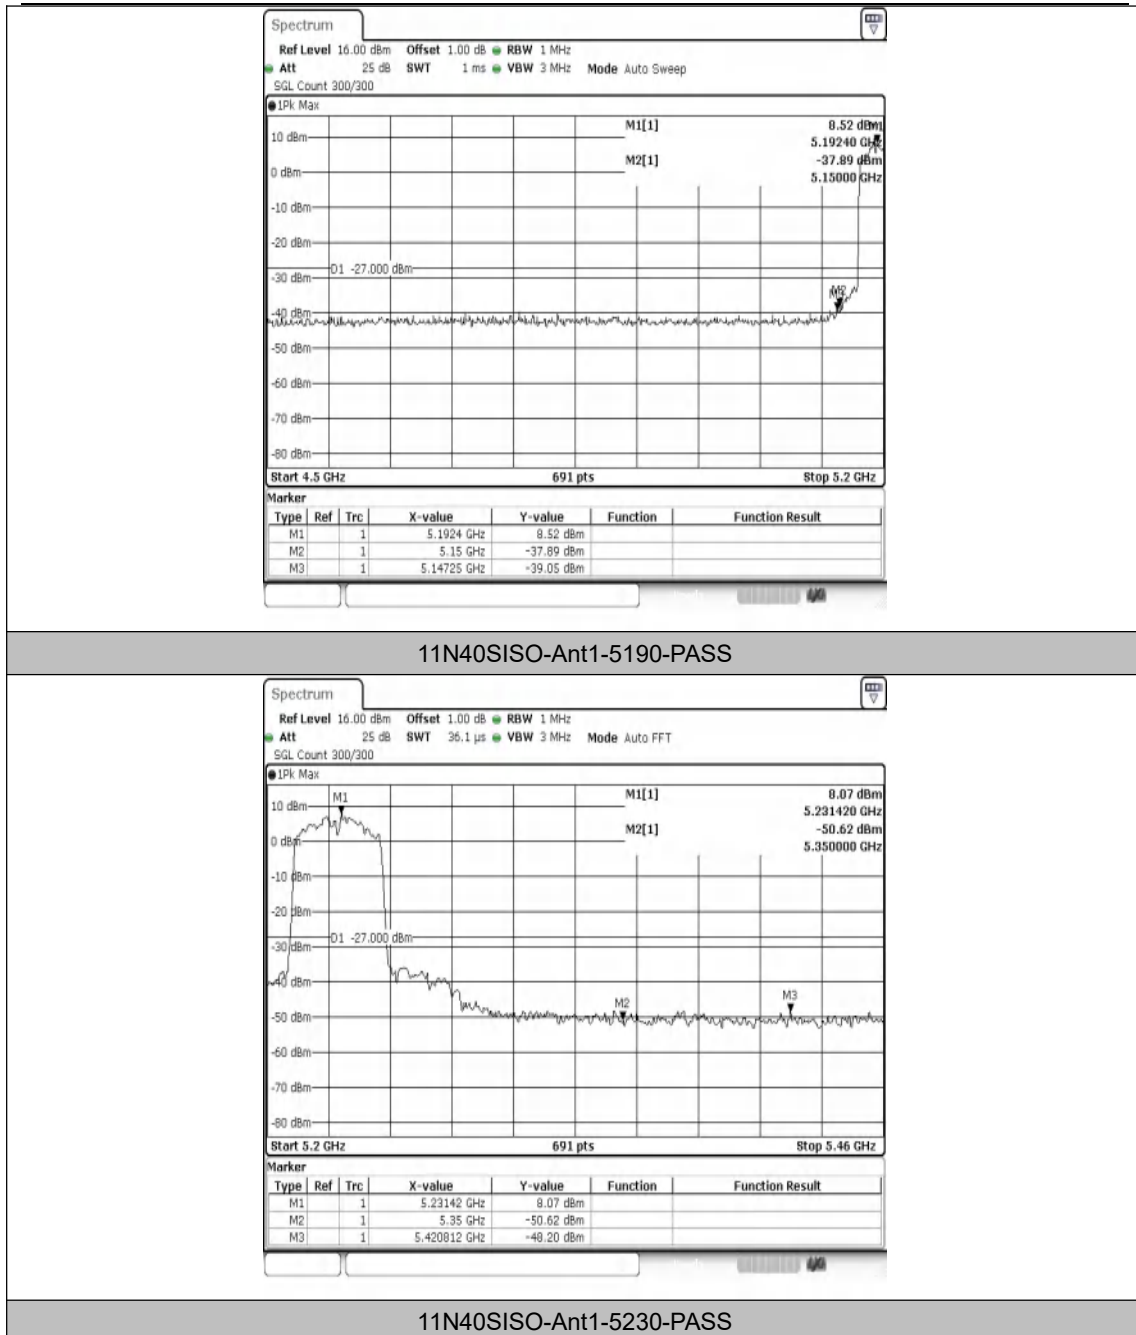


Shenzhen Anbotech Compliance Laboratory Limited

Address: Sogood Industrial Zone Laboratory & 1/F. of Building D, Sogood Science and Technology Park,
Sanwei Community, Hangcheng Subdistrict, Bao'an District, Shenzhen, Guangdong, China
Tel: (86) 0755-26066440 Email: service@anbotech.com

Hotline
400-003-0500
www.anbotech.com

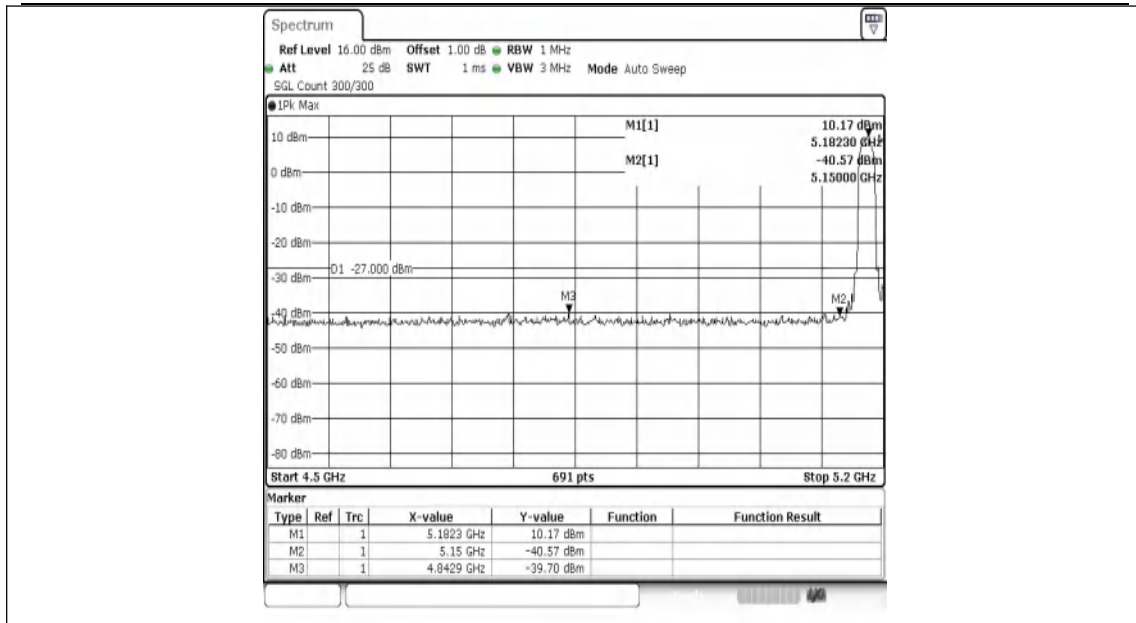


11AC20SISO-Ant1-5180-PASS

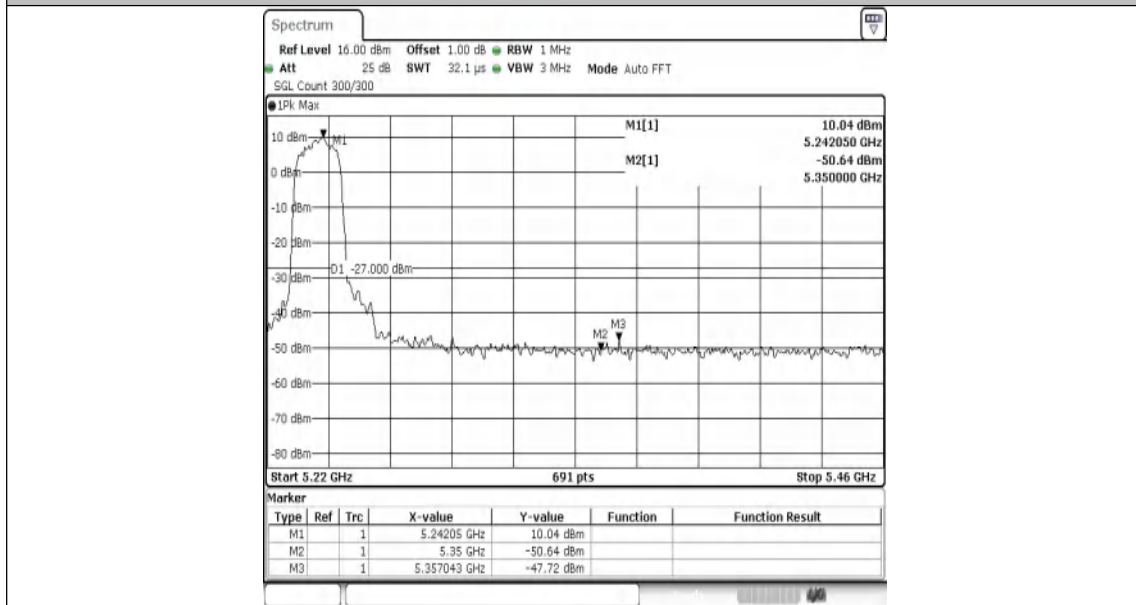


11AC20SISO-Ant1-5240-PASS




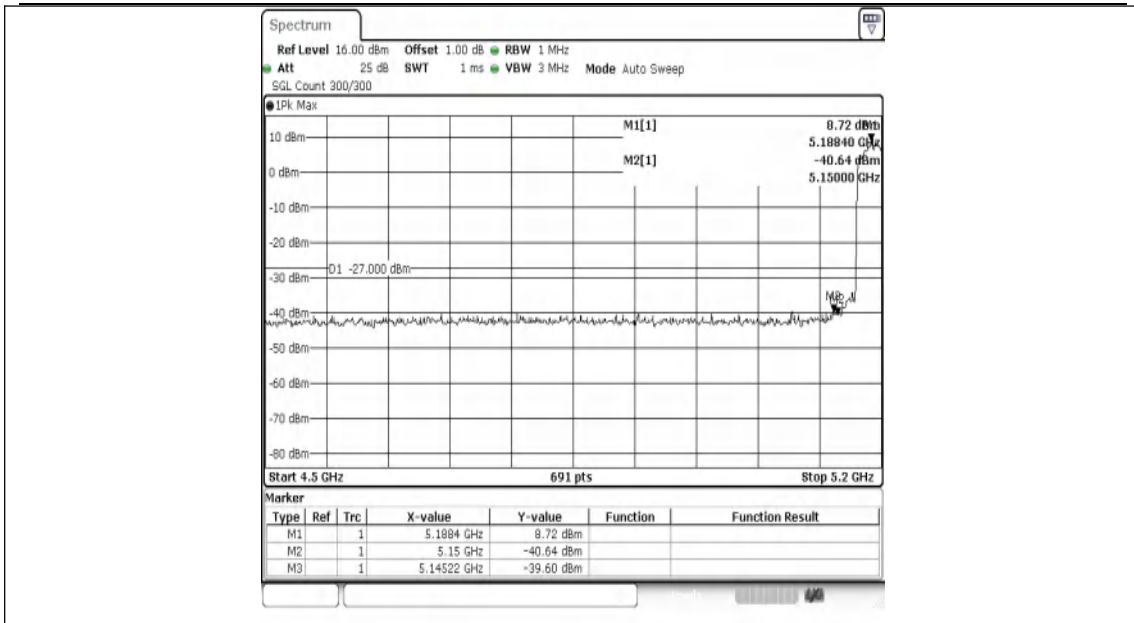



11AC40SISO-Ant1-5190-PASS

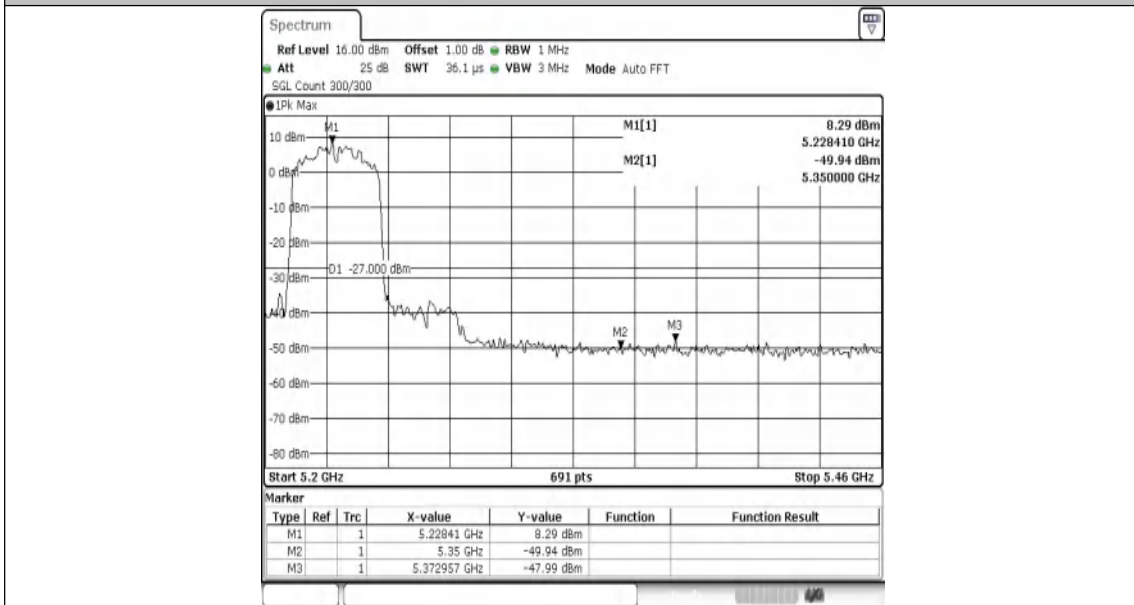


11AC40SISO-Ant1-5230-PASS

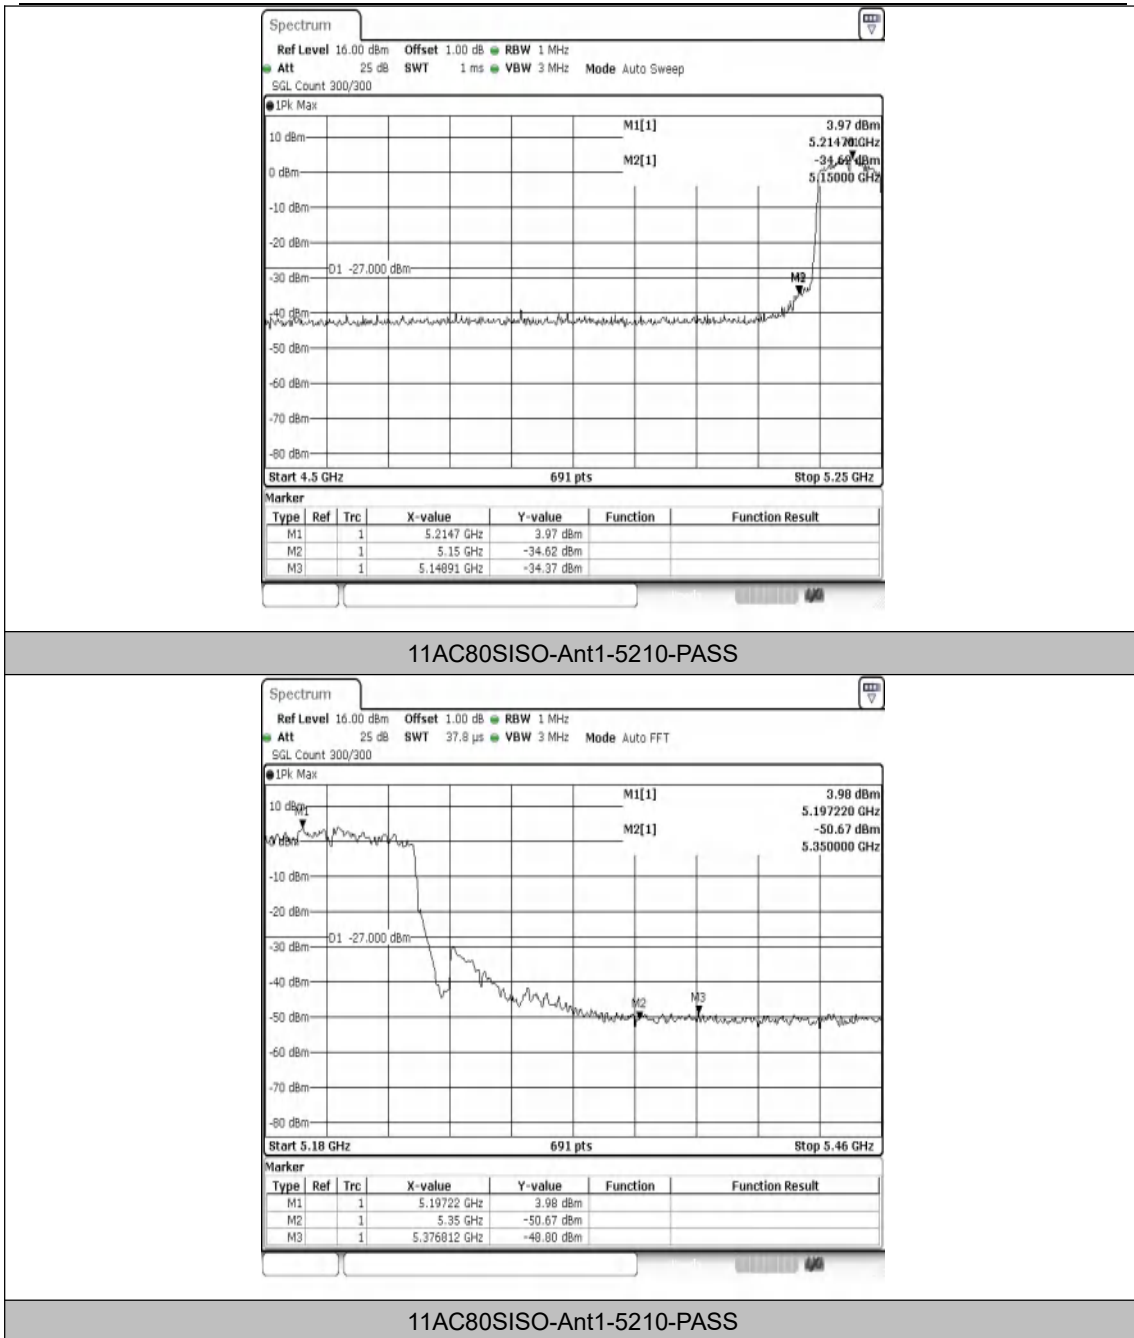


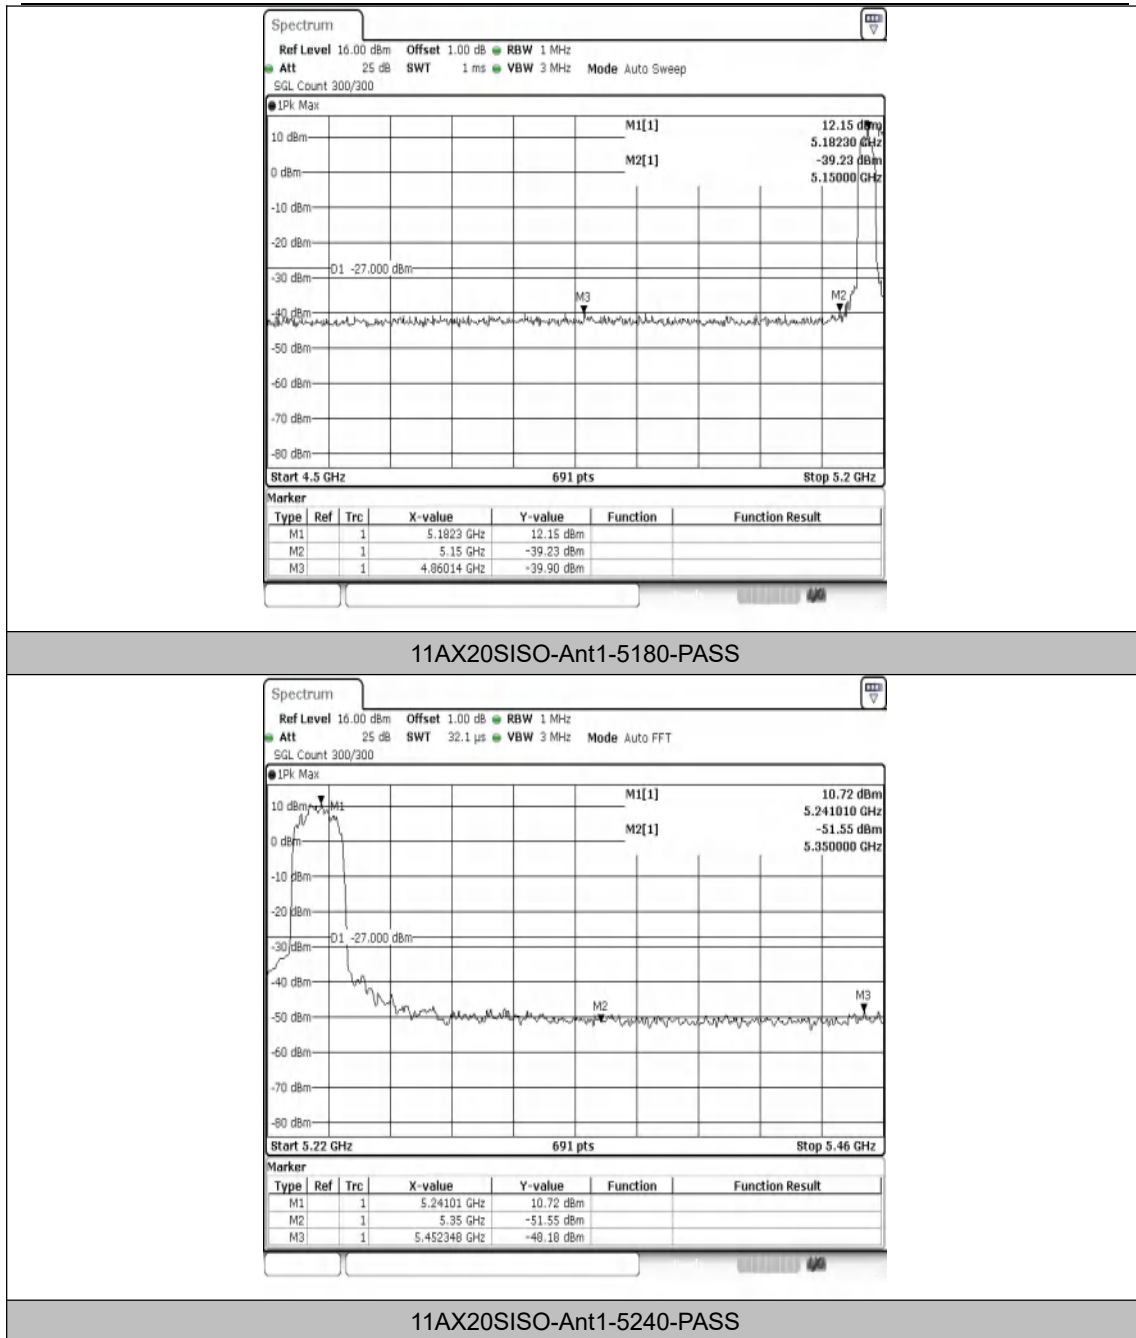


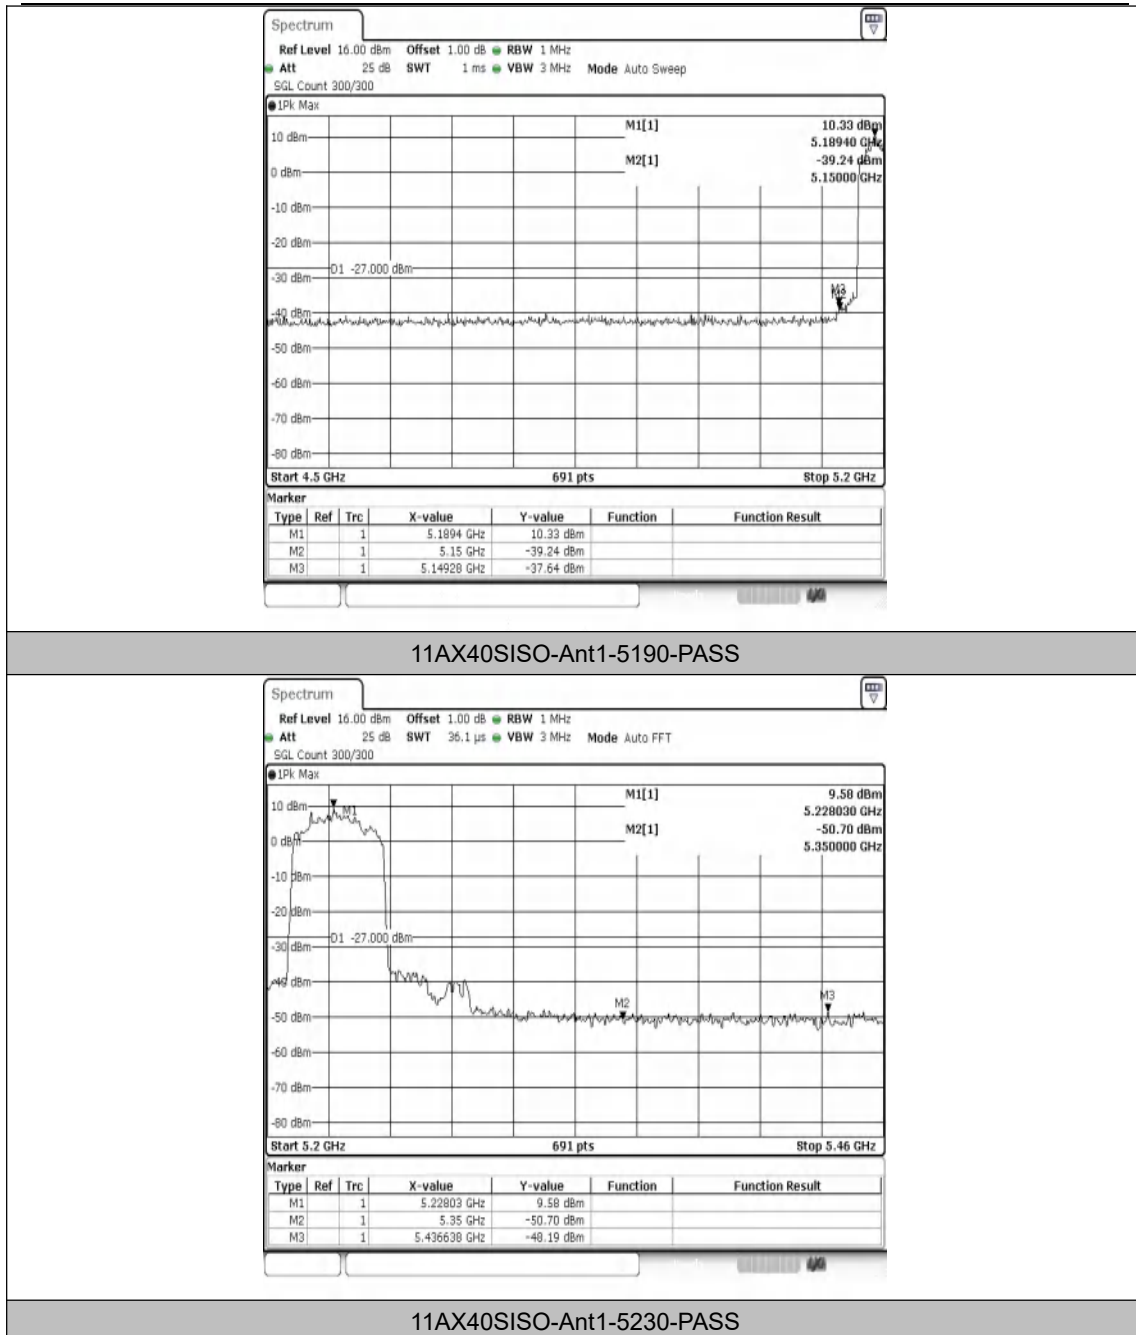


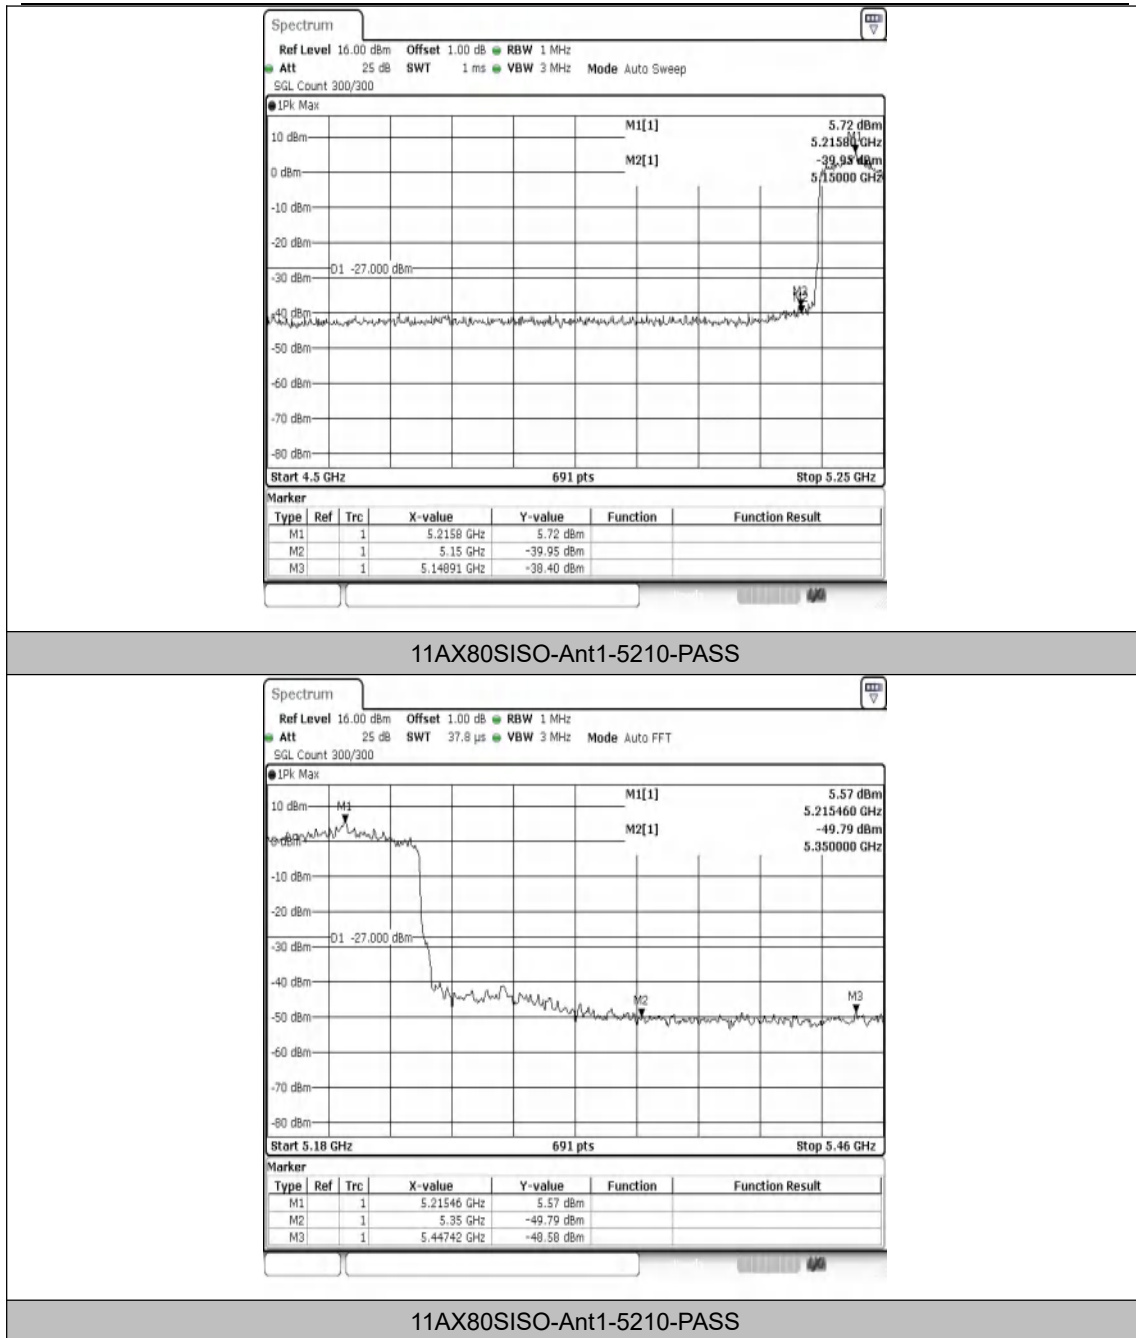



Test Graphs B4

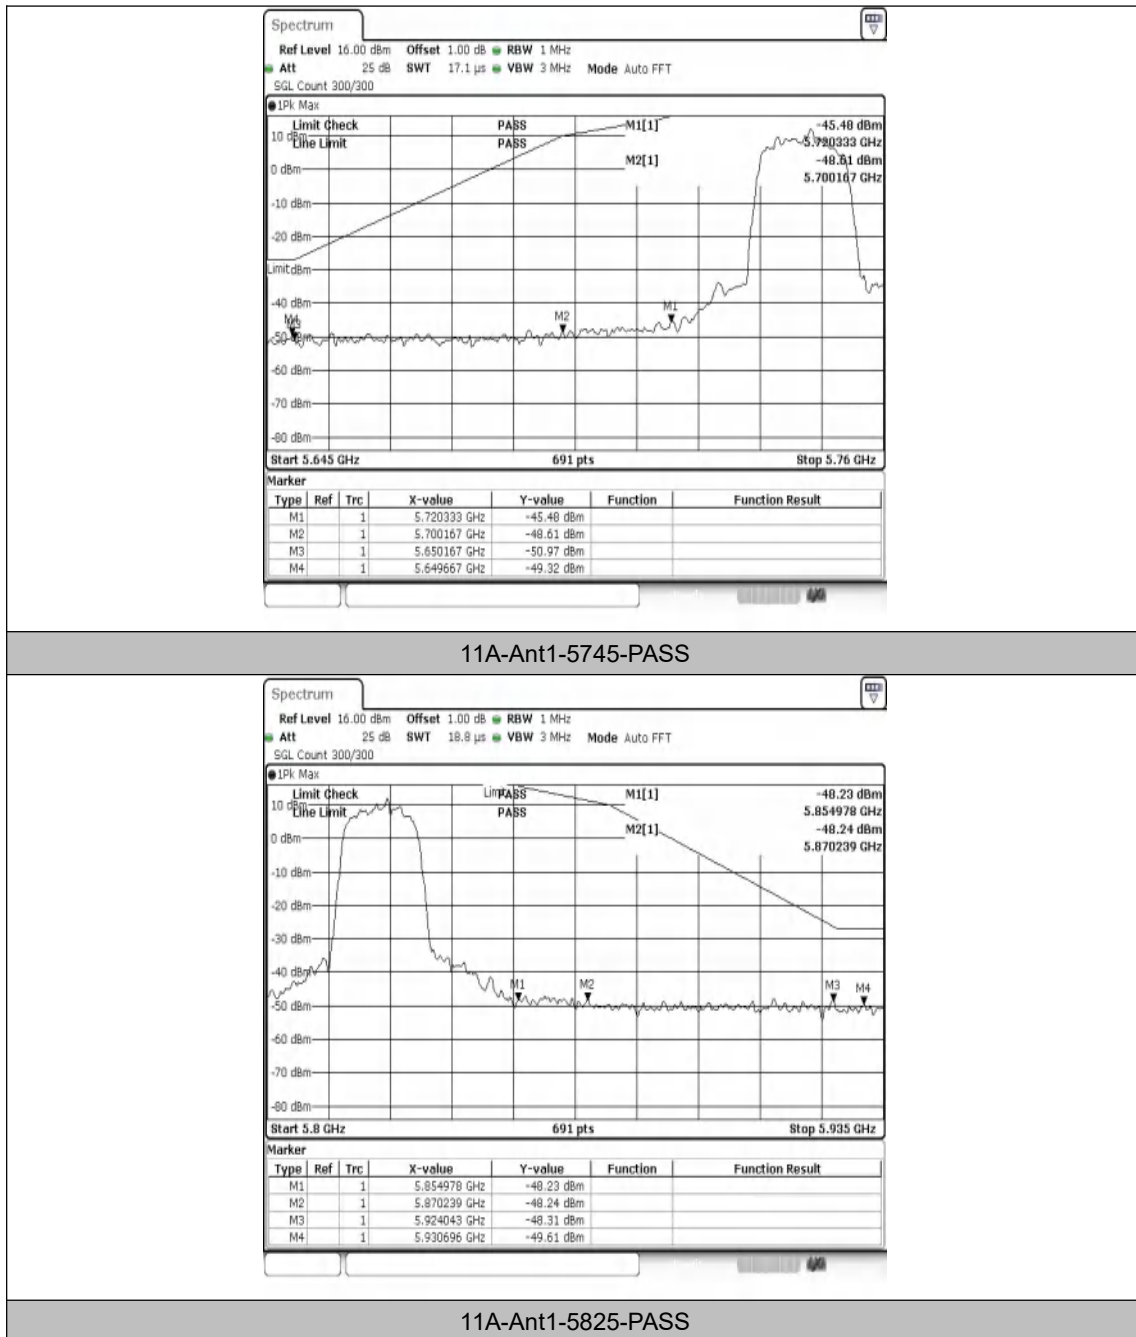


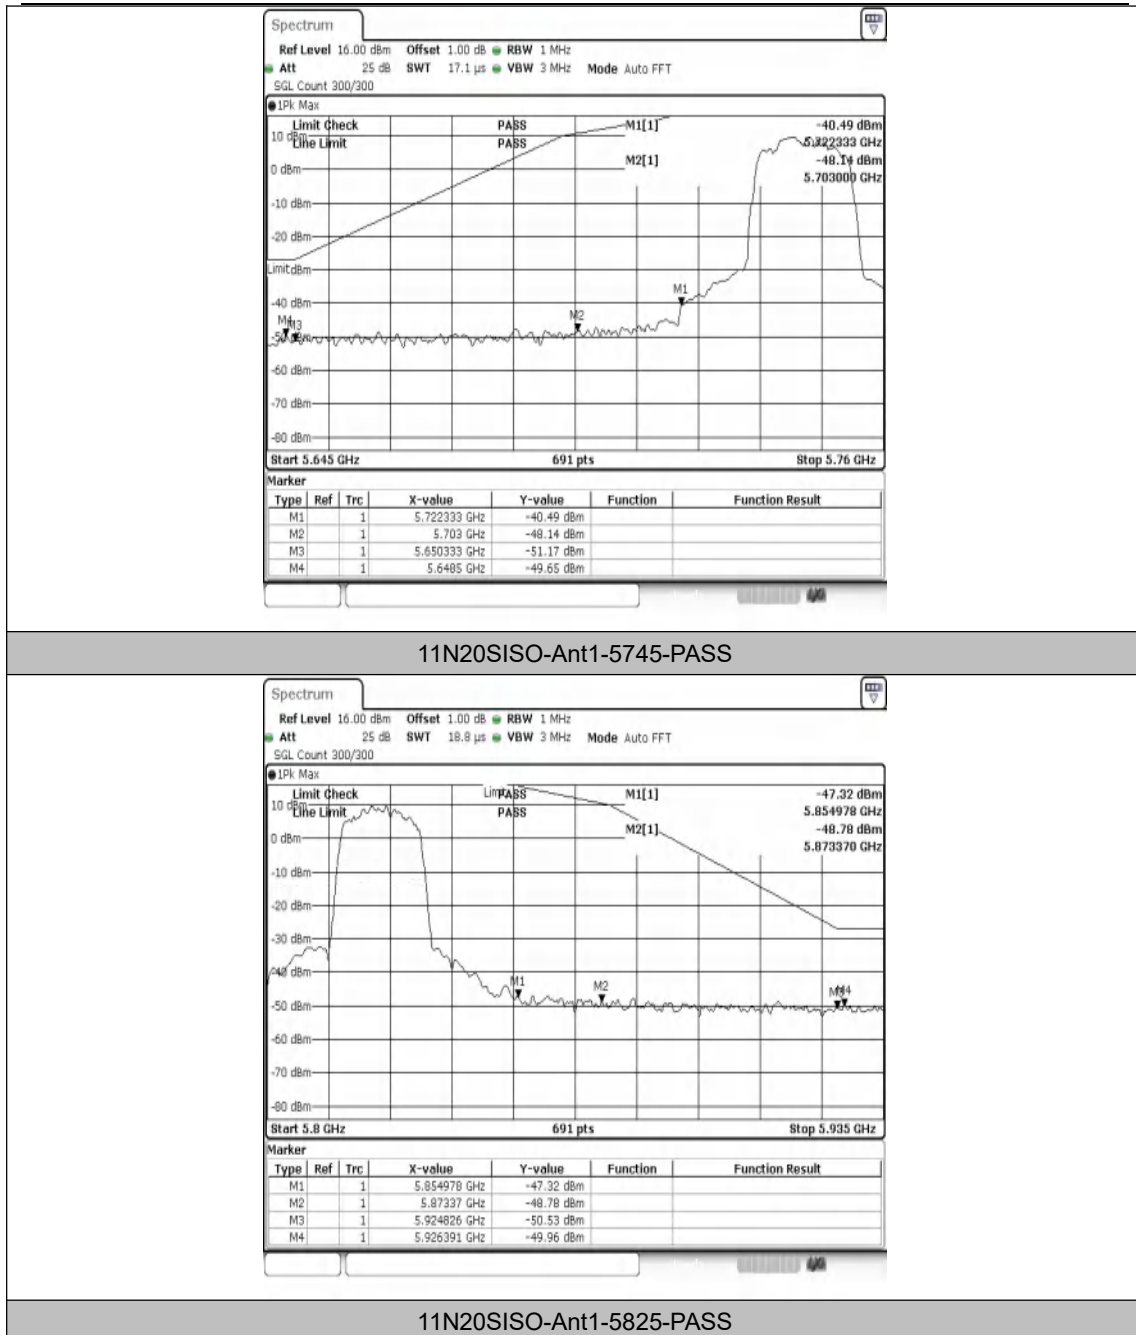


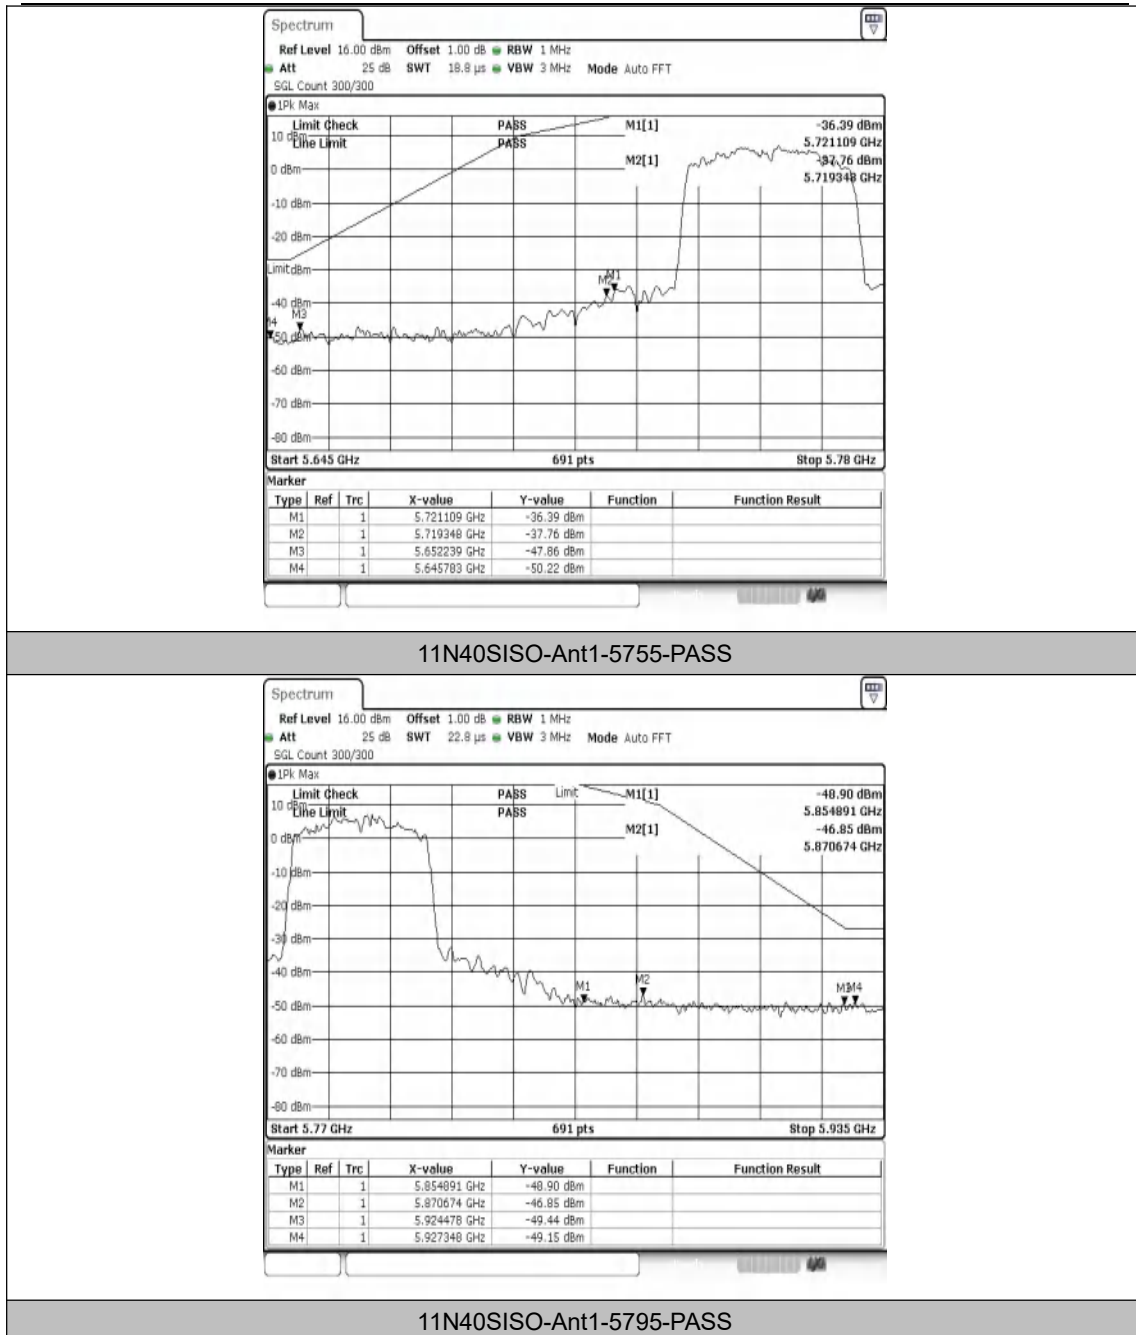


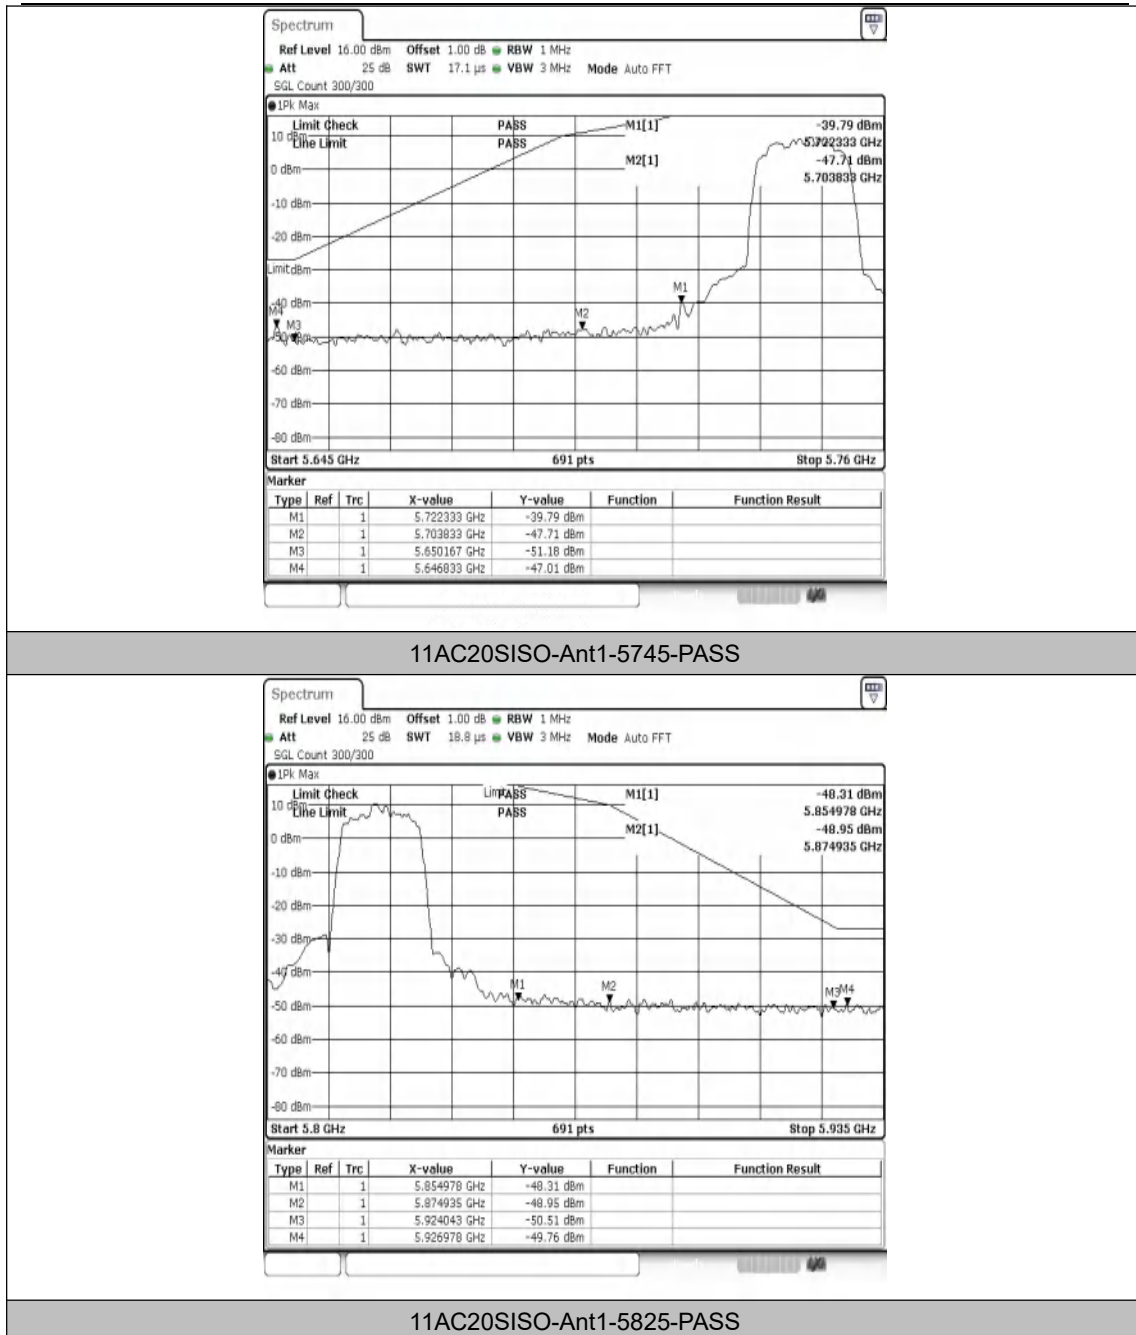

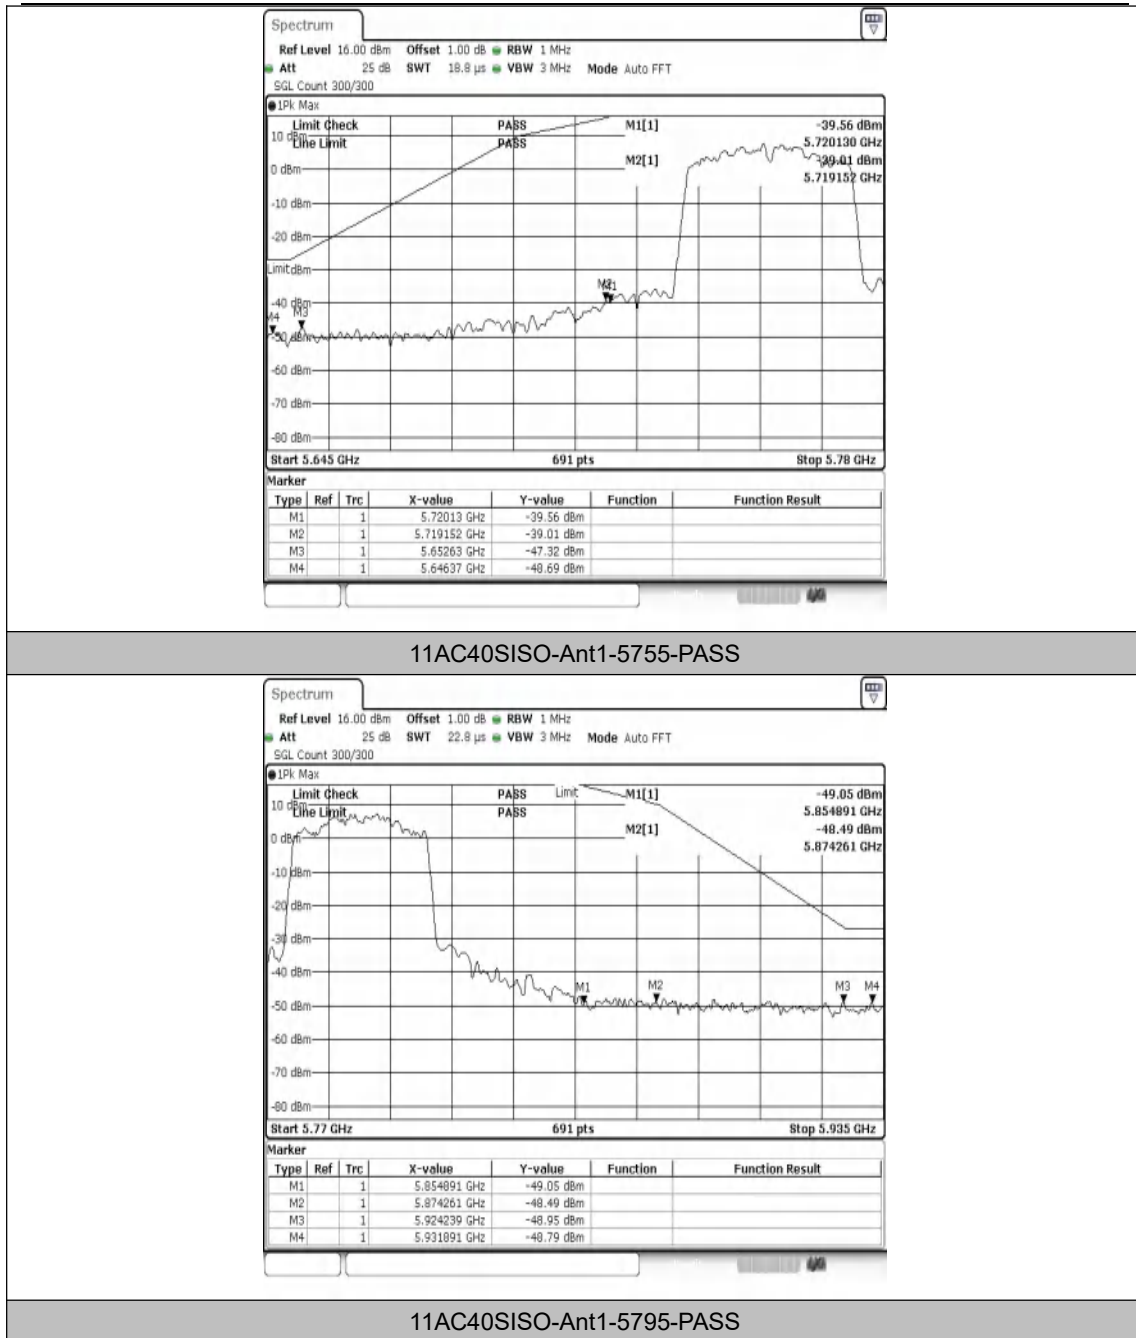

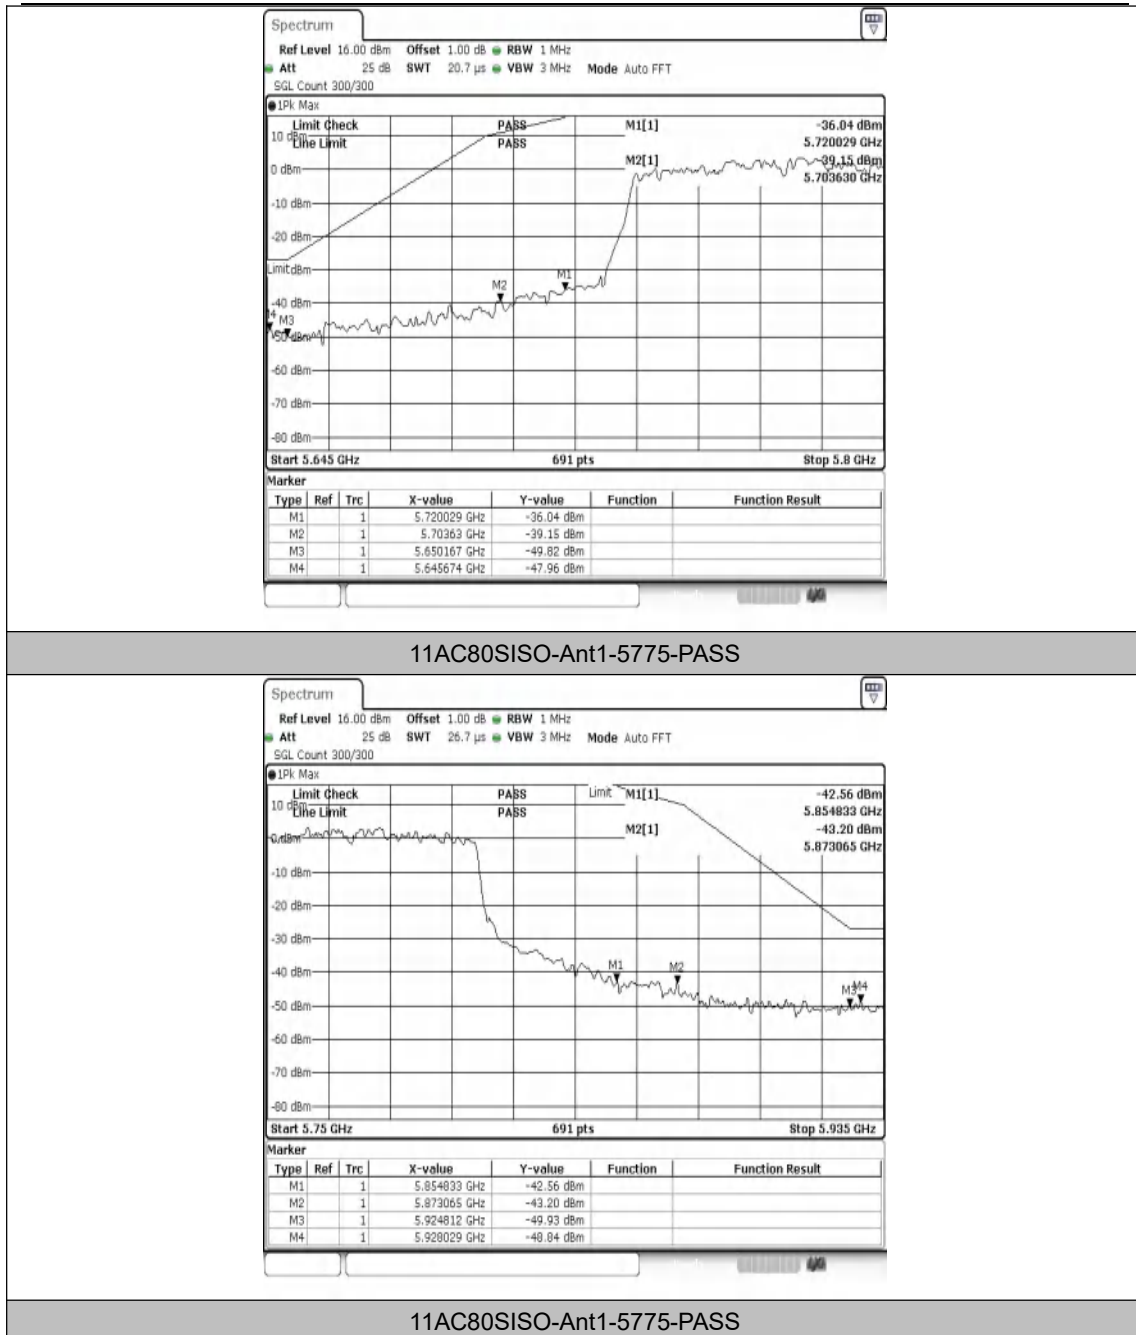

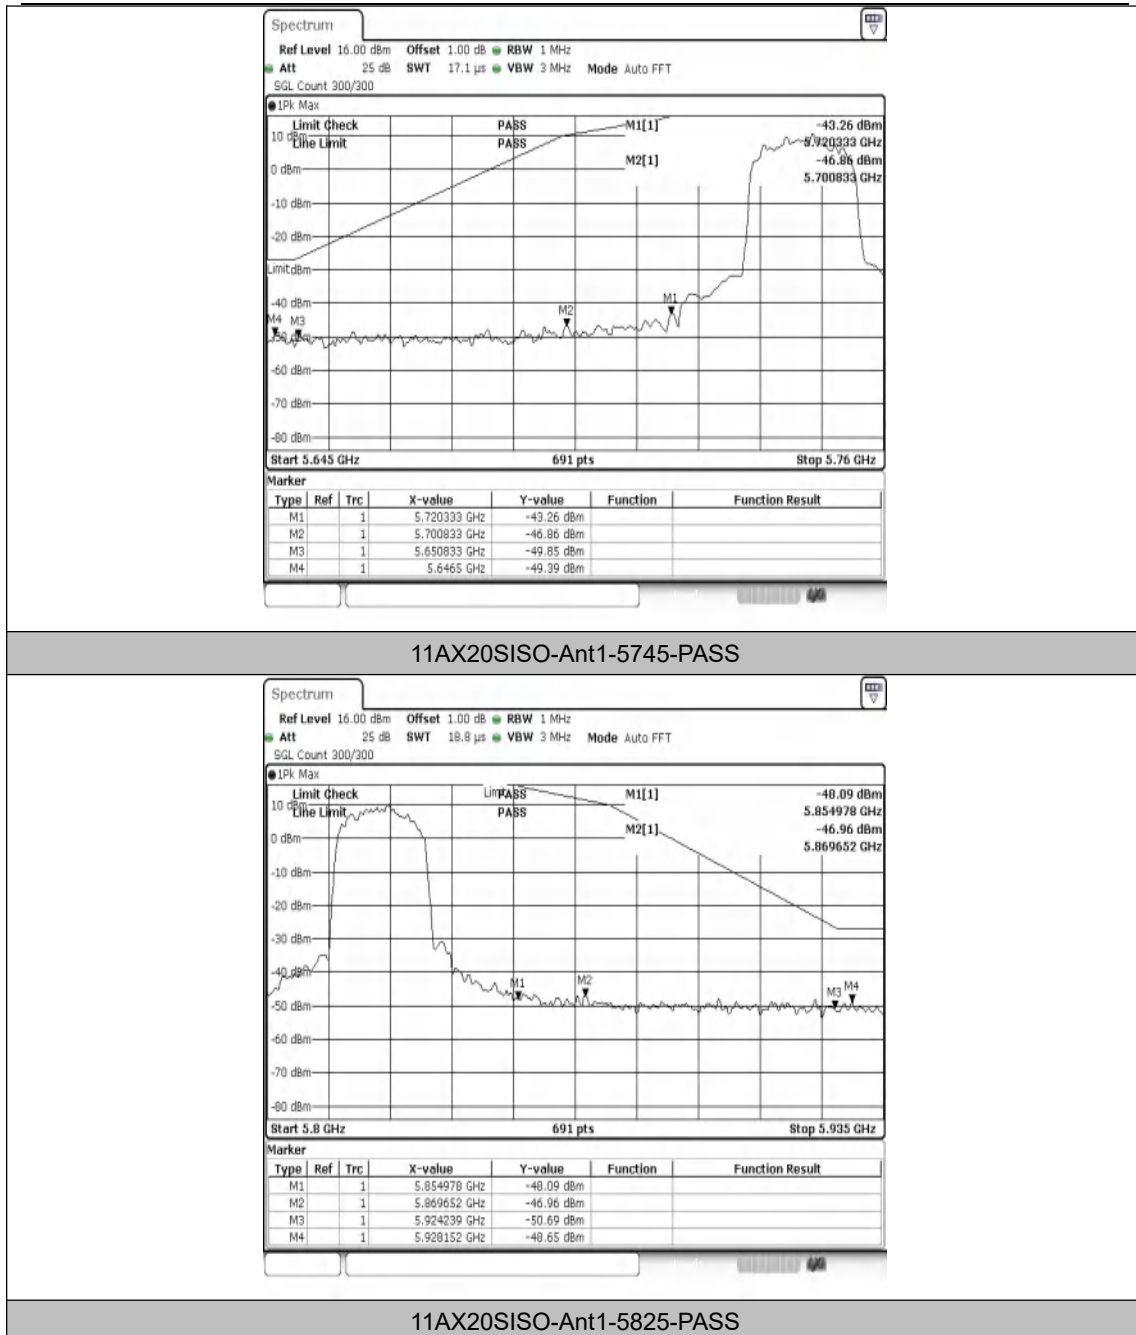

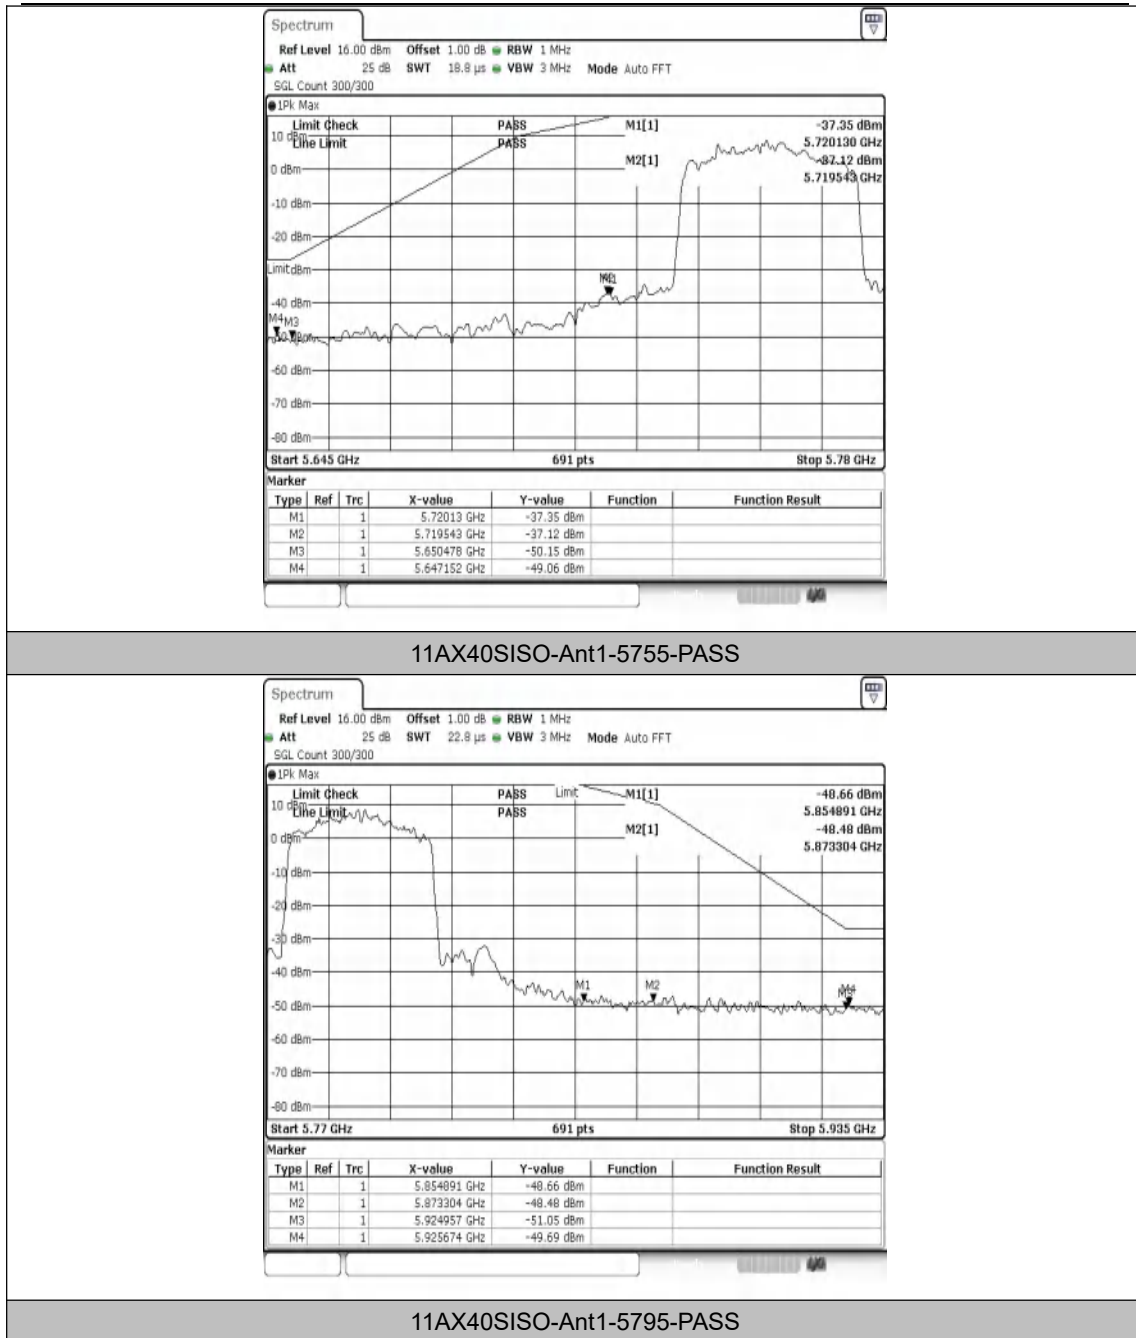

---End---