




802.11ac(VHT20) HCH 5240MHz_Ant1_NTNV

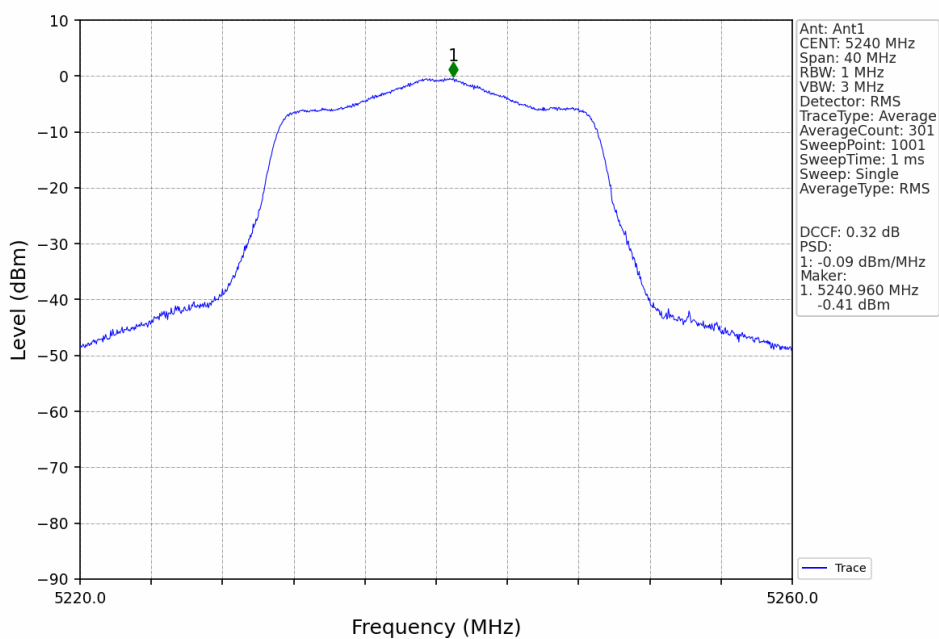


802.11ac(VHT20) HCH 5240MHz_Ant2_NTNV

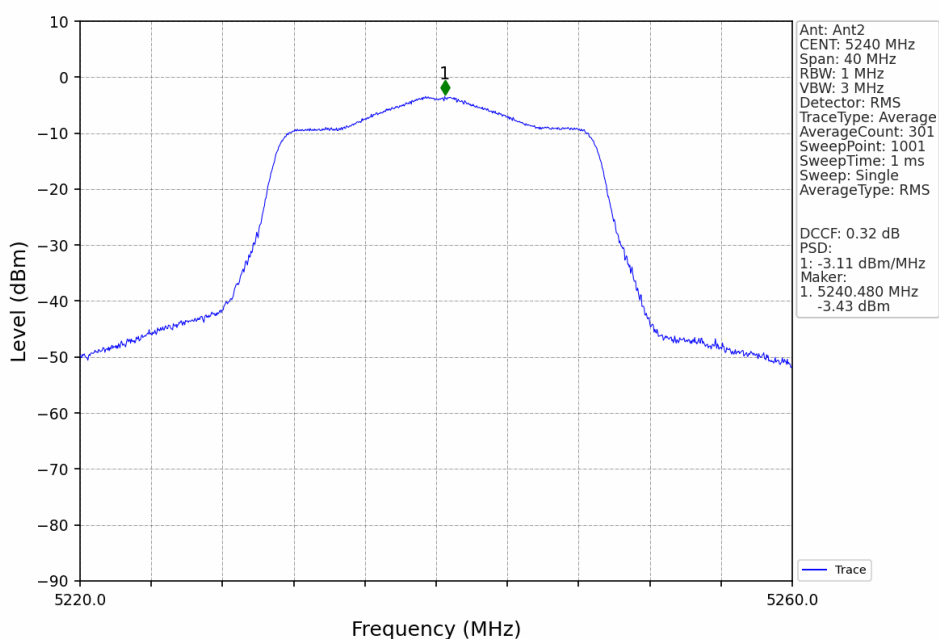


802.11ac(VHT40) LCH 5190MHz Ant1 NTN

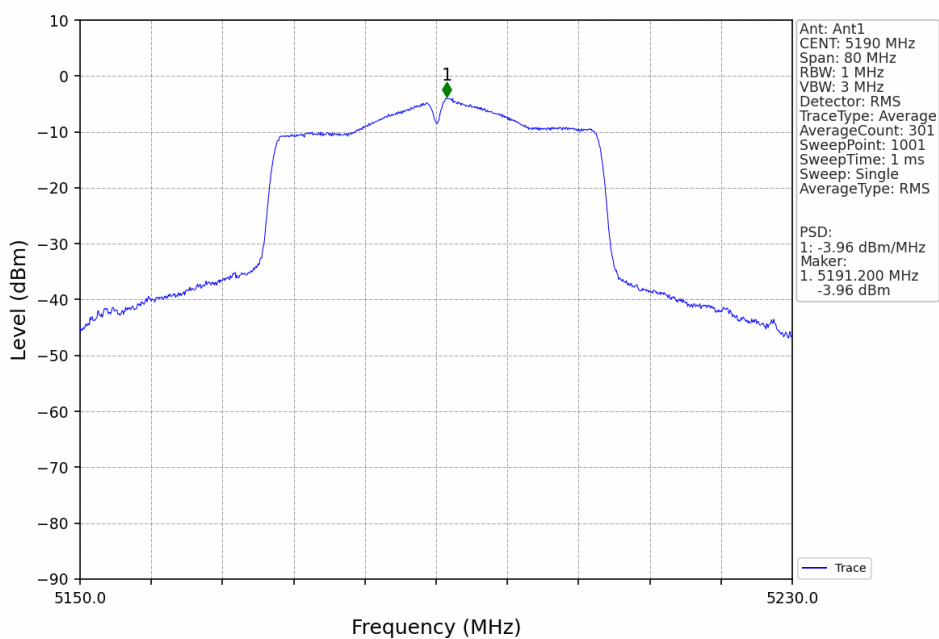


802.11ac(VHT40) LCH 5190MHz Ant2 NTN

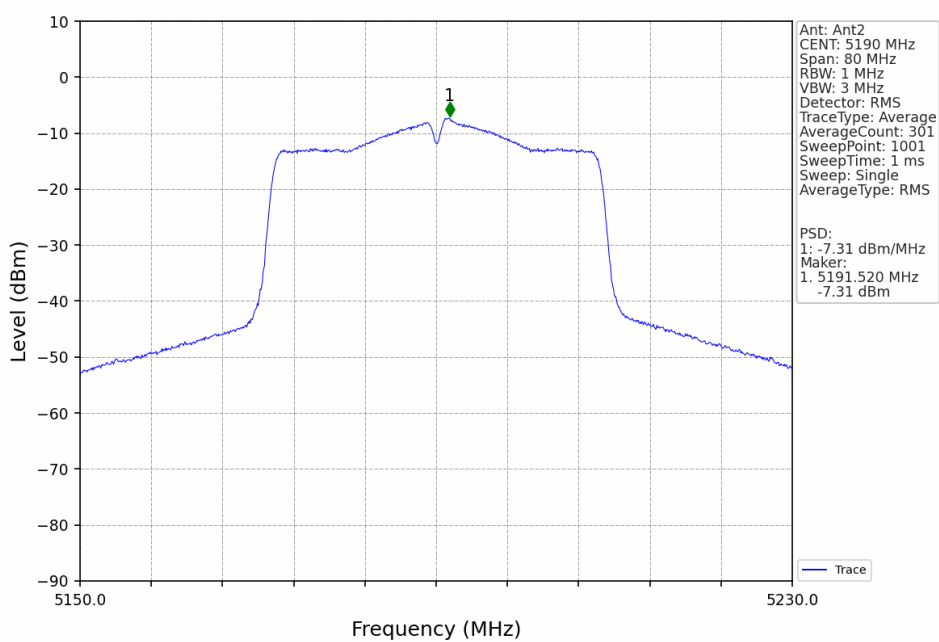


802.11ac(VHT40) HCH 5230MHz_Ant1_NTNV

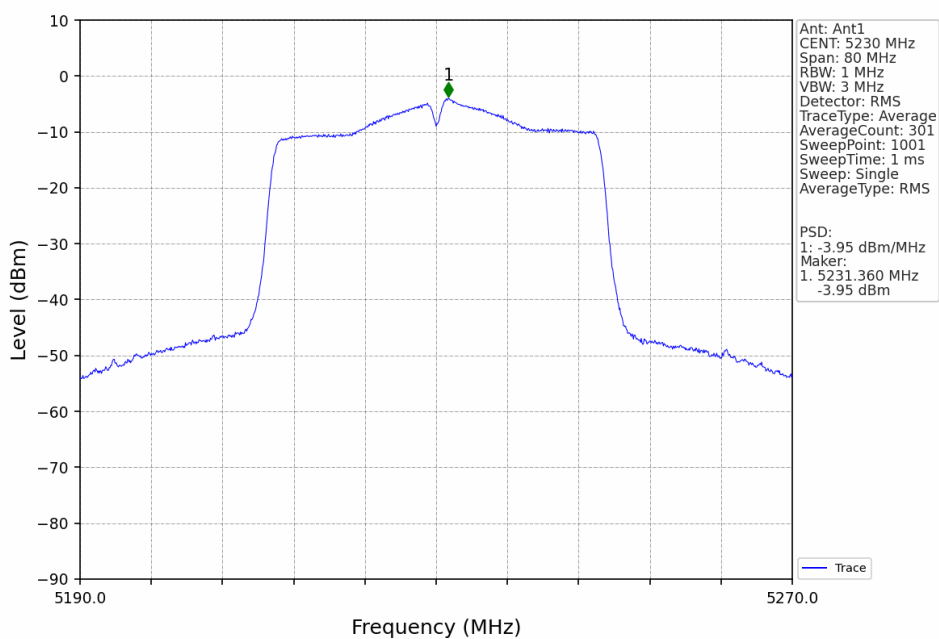


802.11ac(VHT40) HCH 5230MHz_Ant2_NTNV

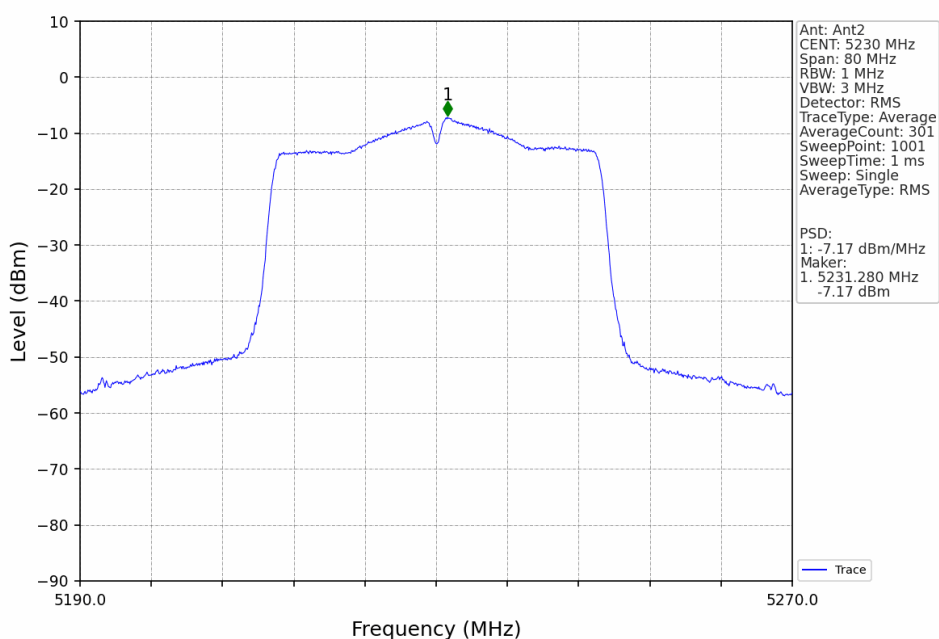


802.11ac(VHT80) MCH 5210MHz Ant1 NTN

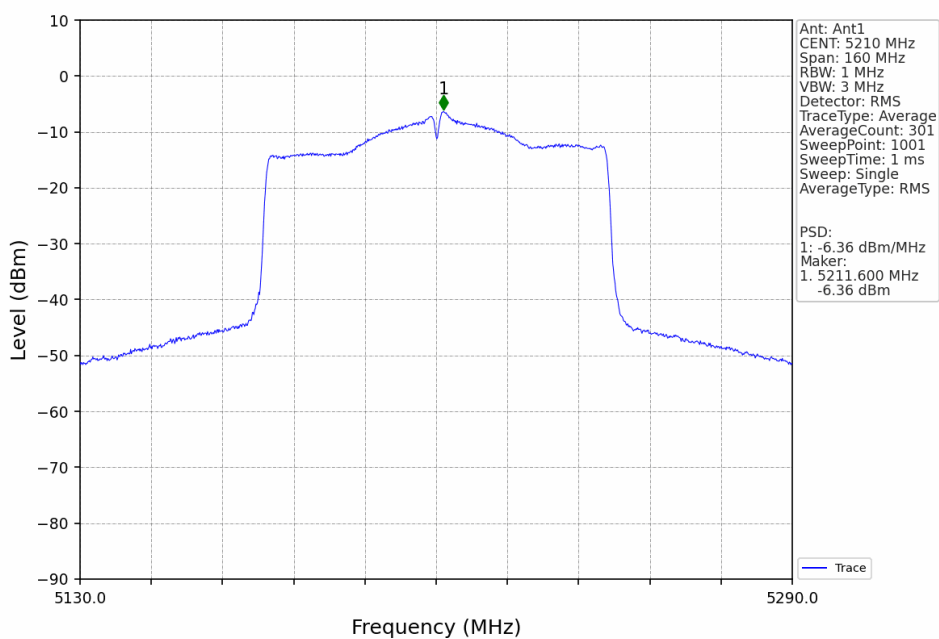


802.11ac(VHT80) MCH 5210MHz Ant2 NTN

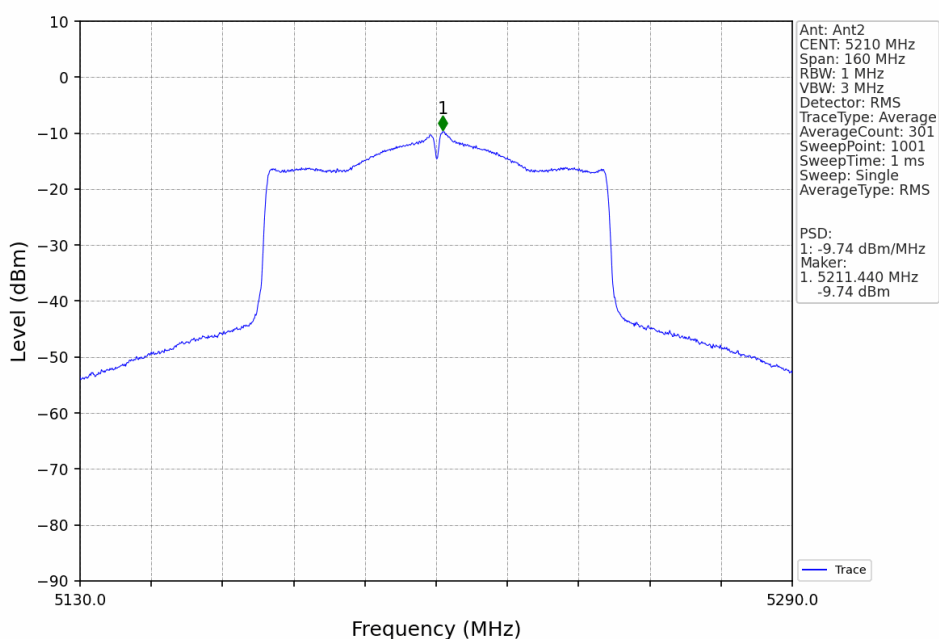


802.11ax(HEW20) LCH 5180MHz SU / Ant1 NTV

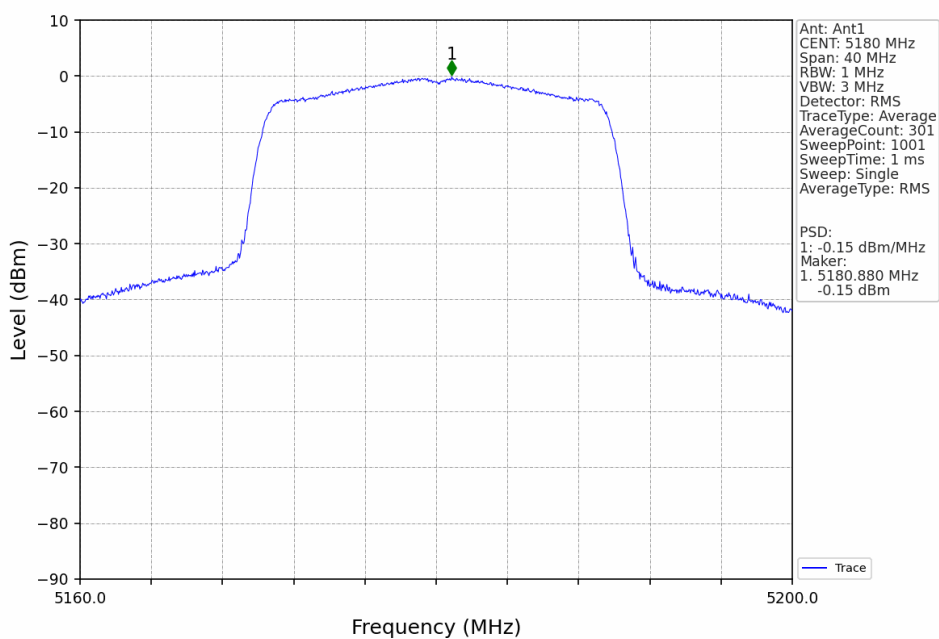


802.11ax(HEW20) LCH 5180MHz SU / Ant2 NTV

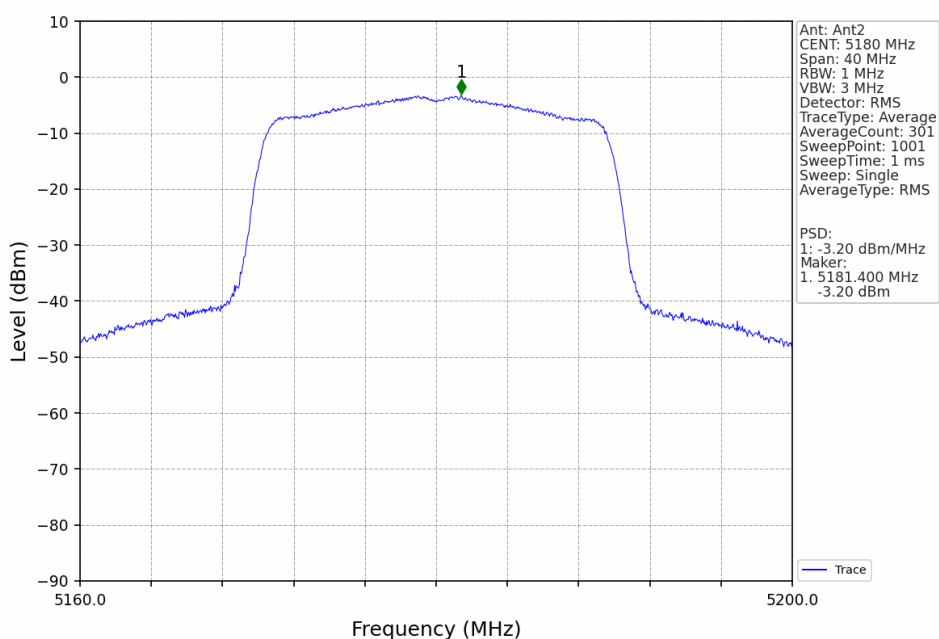


802.11ax(HEW20) MCH 5200MHz SU / Ant1 NTN

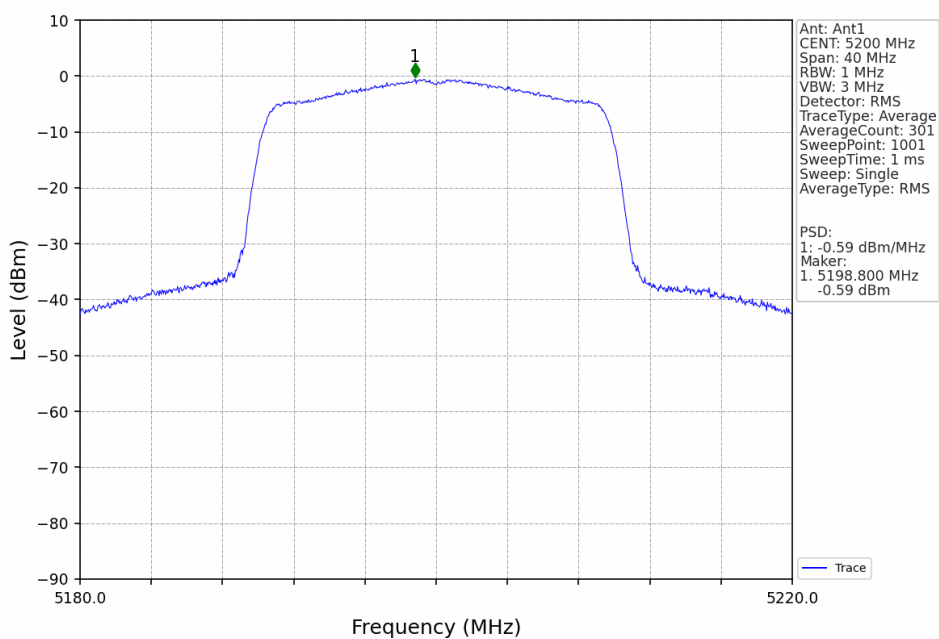


802.11ax(HEW20) MCH 5200MHz SU / Ant2 NTN

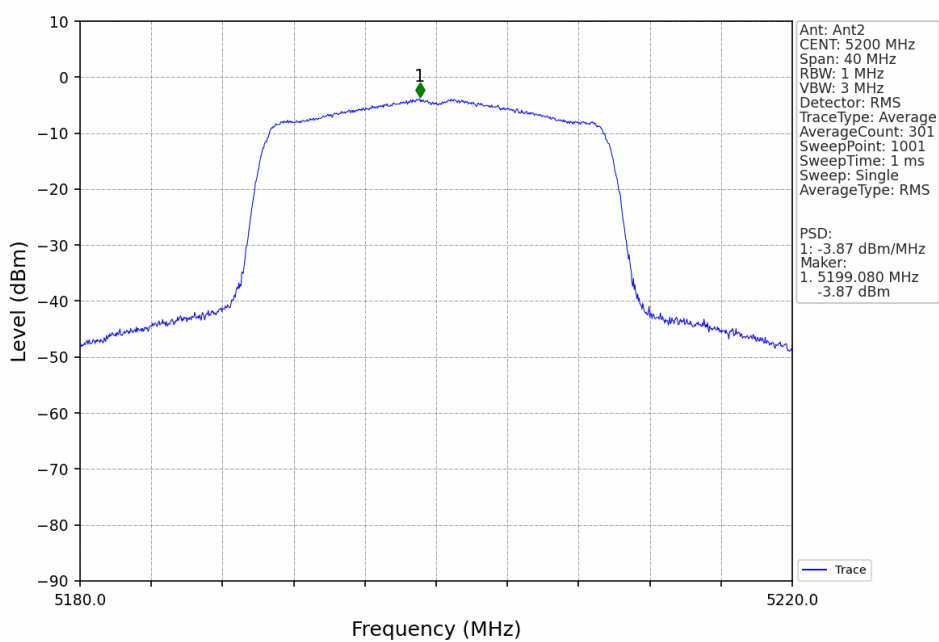


802.11ax(HEW20) HCH 5240MHz SU / Ant1 NTN

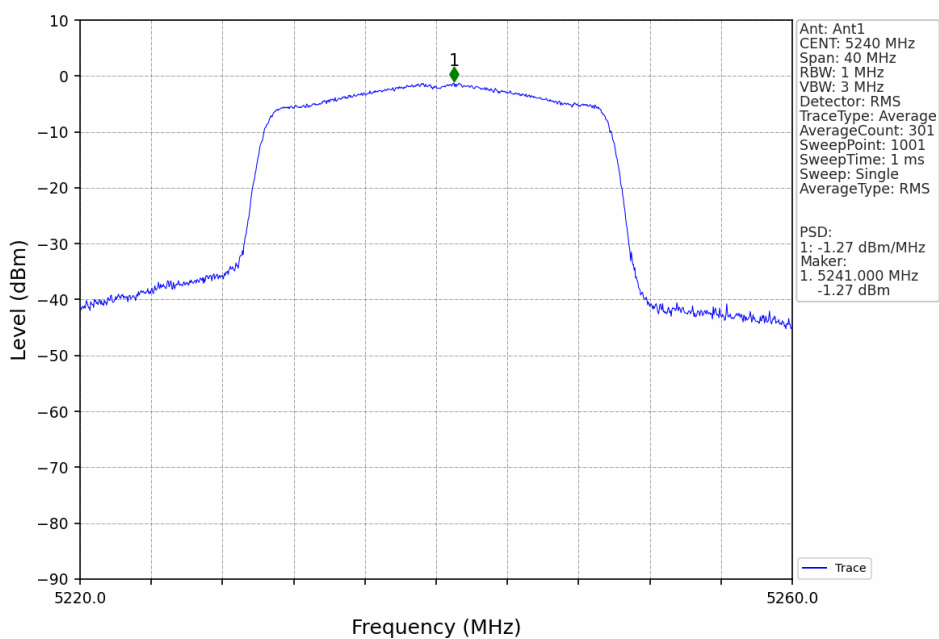


802.11ax(HEW20) HCH 5240MHz SU / Ant2 NTN

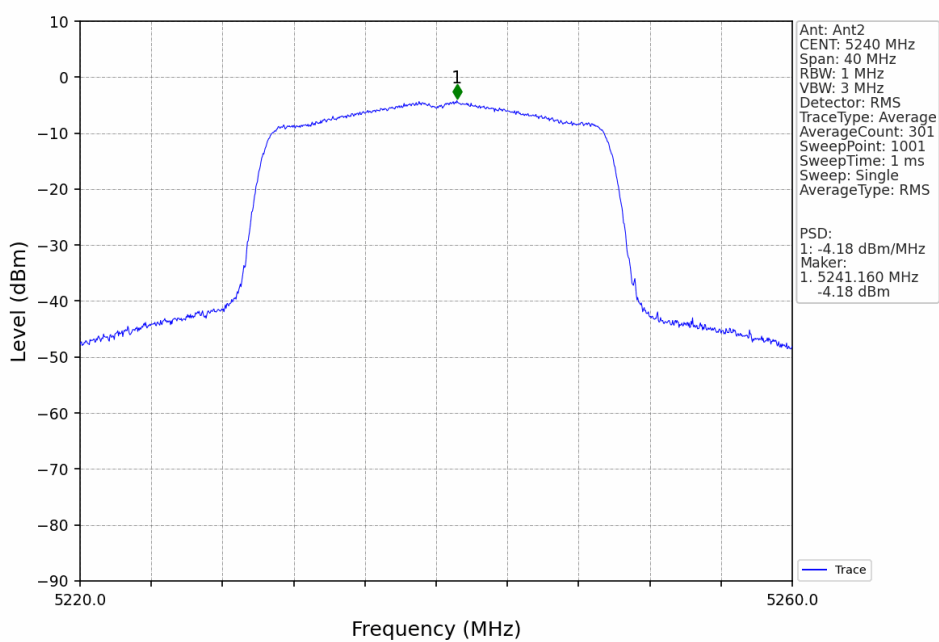


802.11ax(HEW40) LCH 5190MHz SU / Ant1 NTN

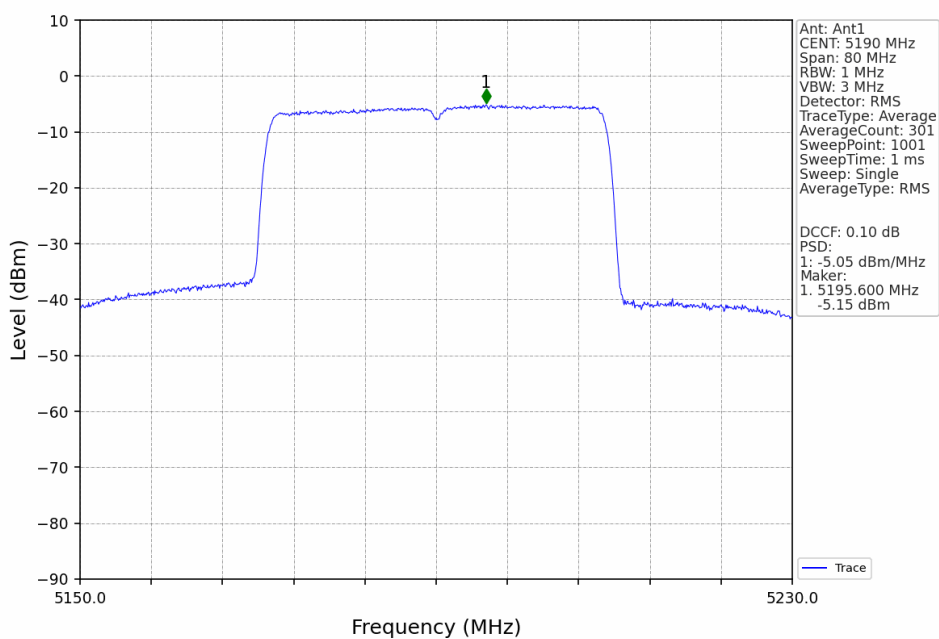


802.11ax(HEW40) LCH 5190MHz SU / Ant2 NTN

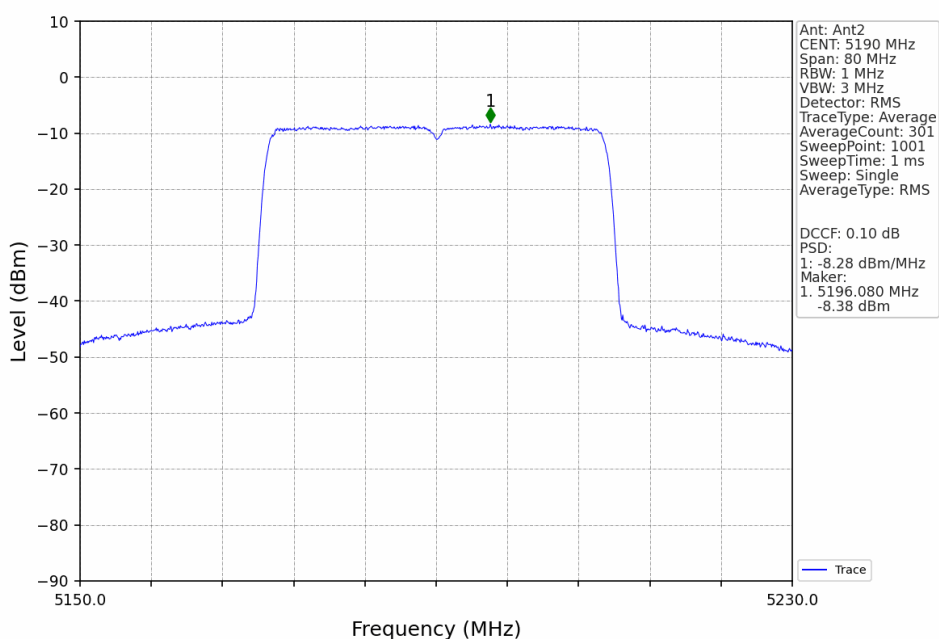


802.11ax(HEW40) HCH 5230MHz SU / Ant1 NTN

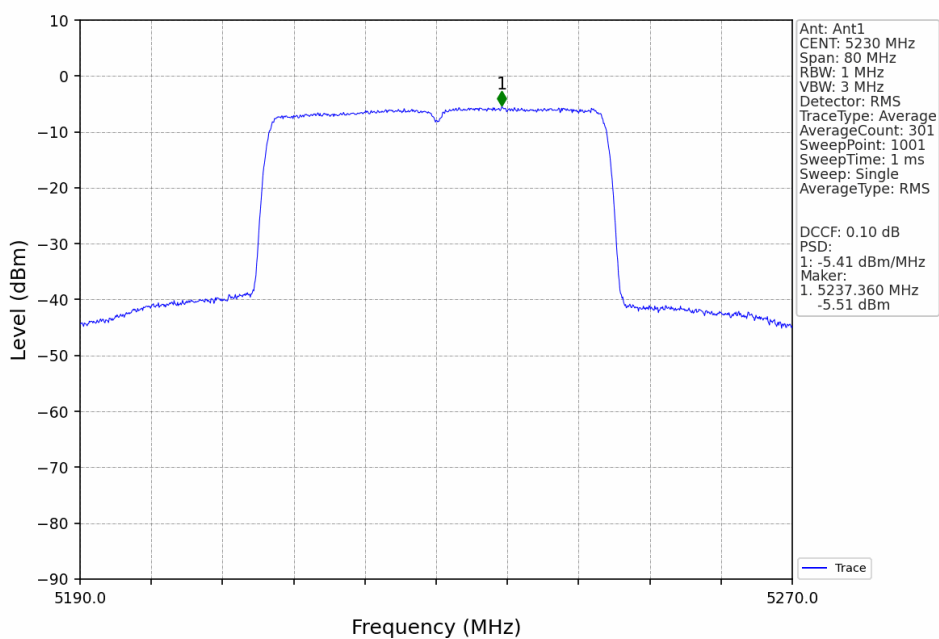


802.11ax(HEW40) HCH 5230MHz SU / Ant2 NTN

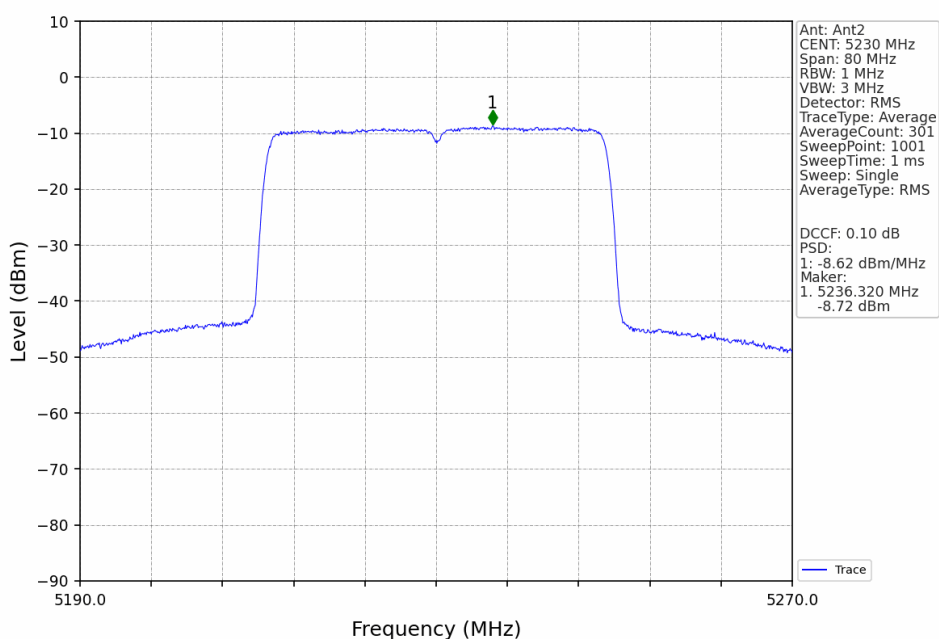

802.11ax(HEW80) MCH 5210MHz SU / Ant1 NTN

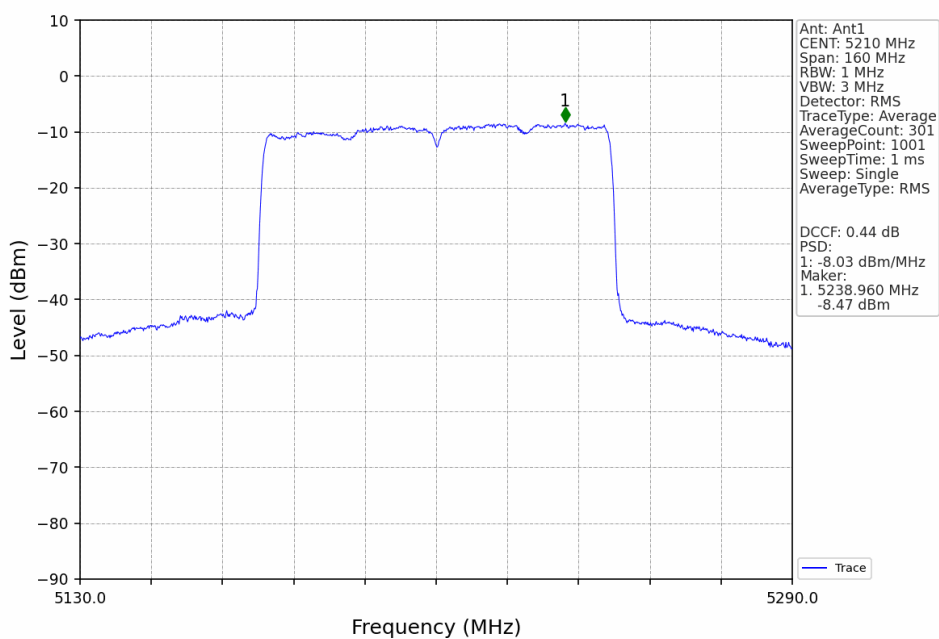


802.11ax(HEW80) MCH 5210MHz SU / Ant2 NTN

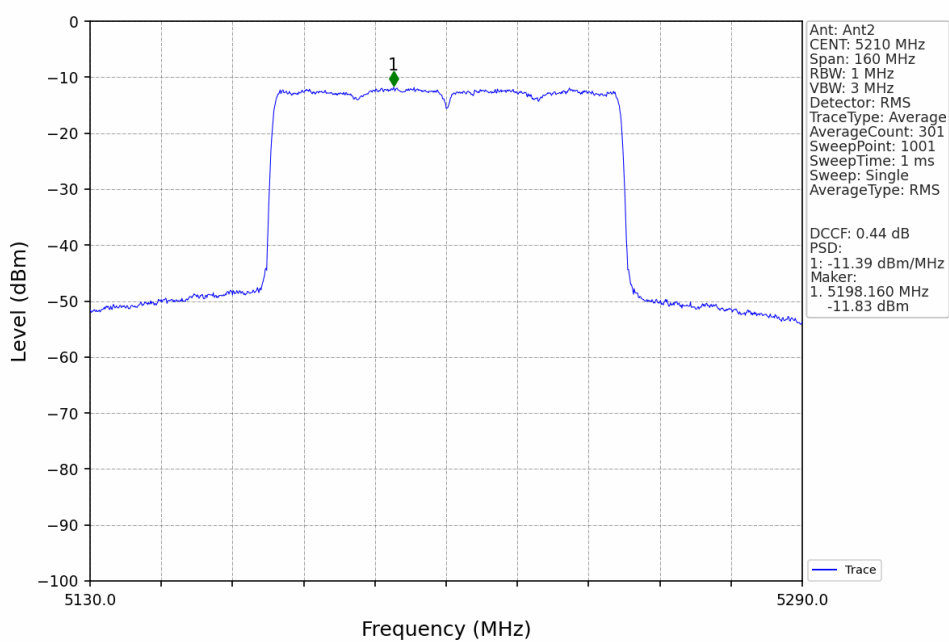


4.2.2 PSD-Band3


802.11a_LCH_5745MHz_Ant1_NTNV

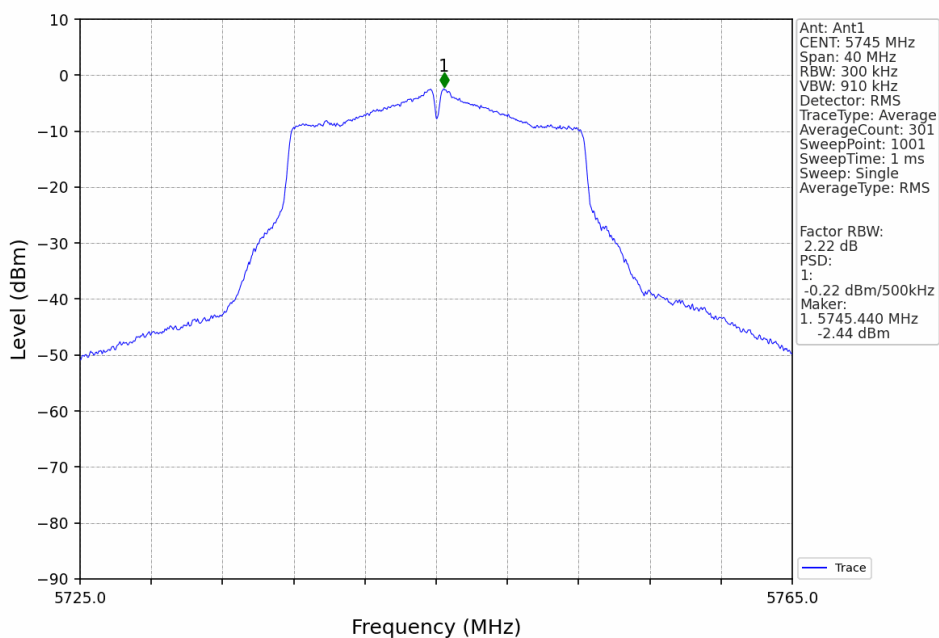


802.11a_LCH_5745MHz_Ant2_NTNV

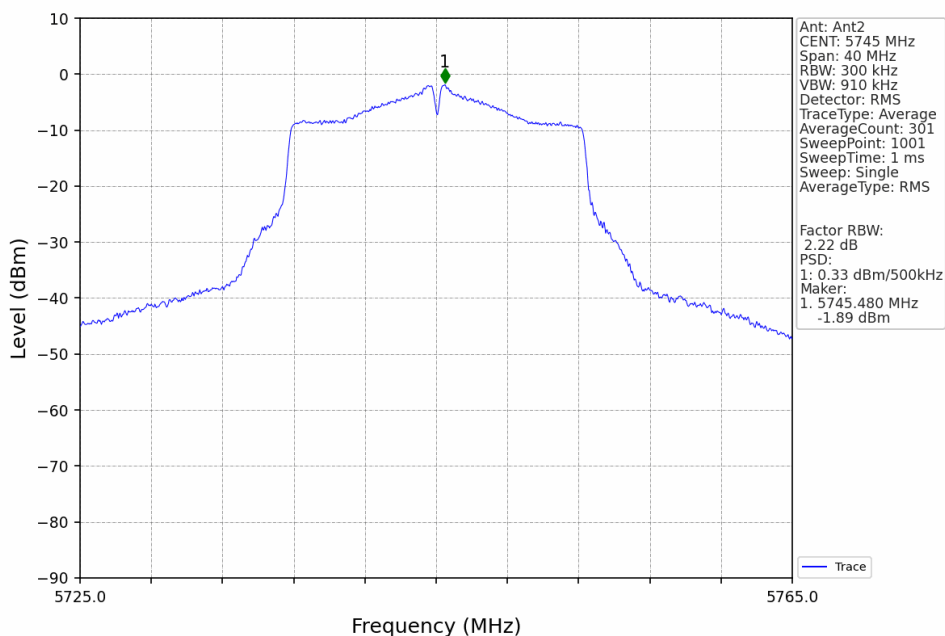


802.11a MCH 5785MHz Ant1 NTN

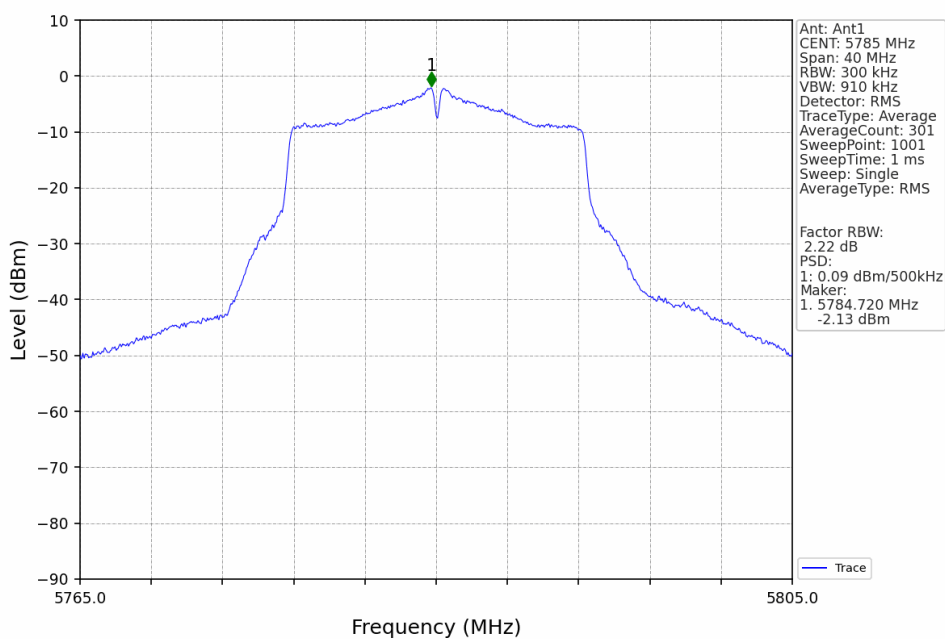


802.11a MCH 5785MHz Ant2 NTN

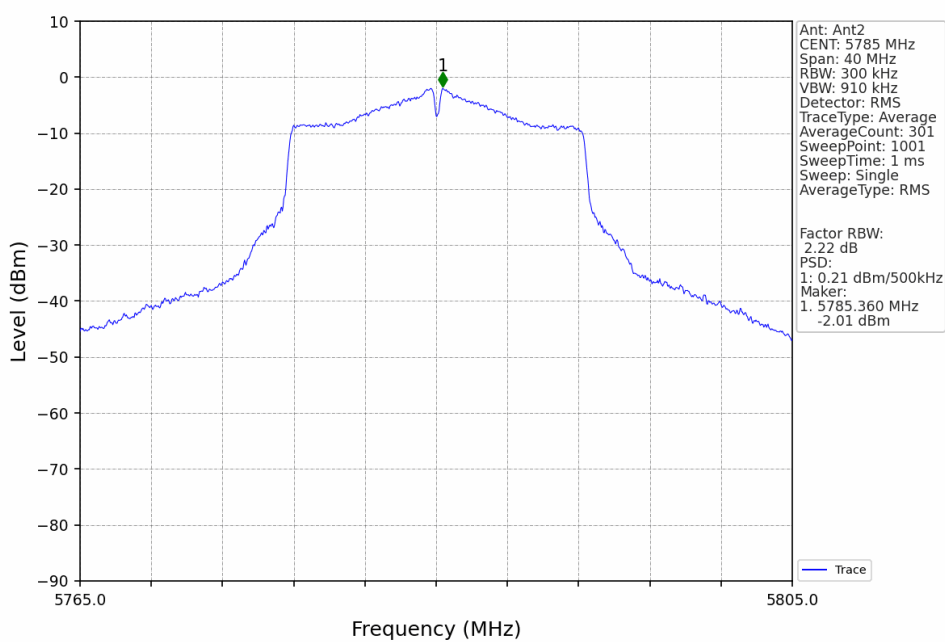


802.11a HCH 5825MHz Ant1 NTN

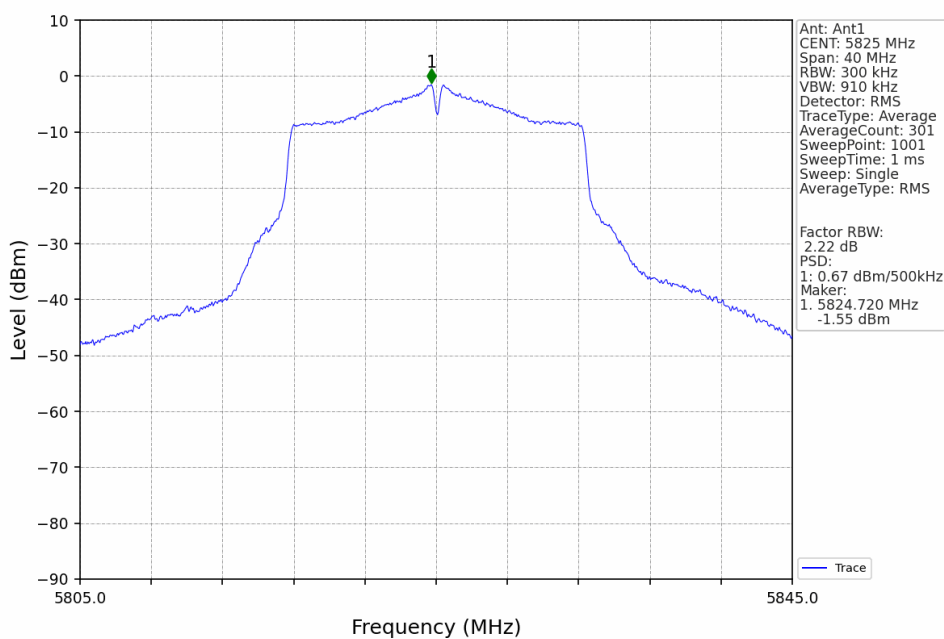


802.11a HCH 5825MHz Ant2 NTN

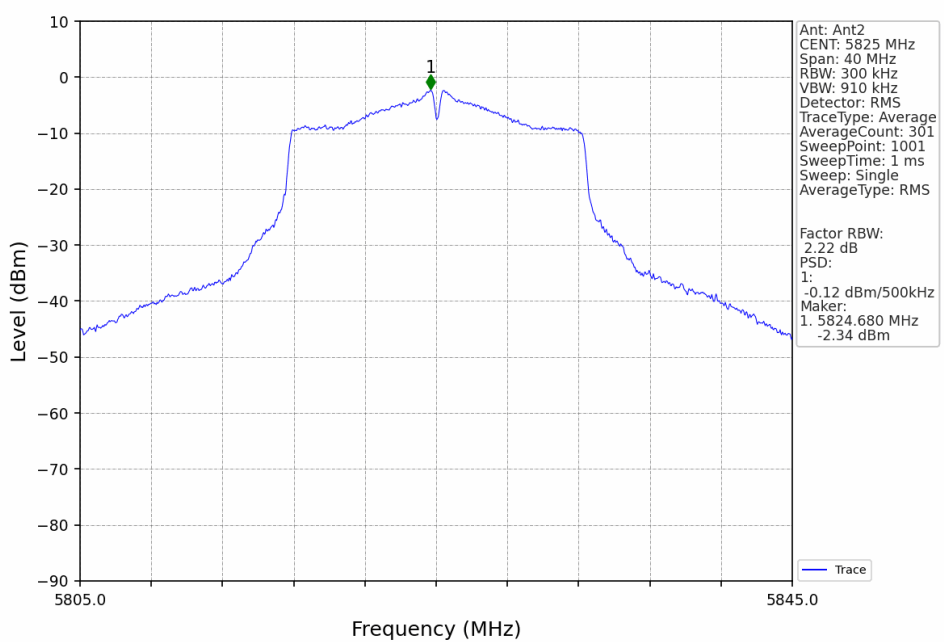


802.11n(HT20) LCH 5745MHz_Ant1_NTNV

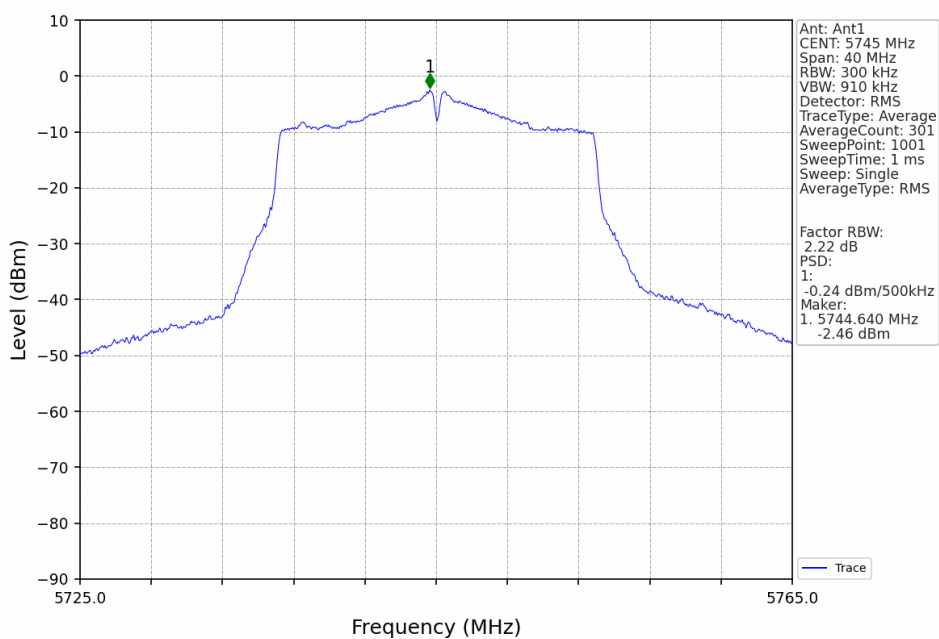


802.11n(HT20) LCH 5745MHz_Ant2_NTNV

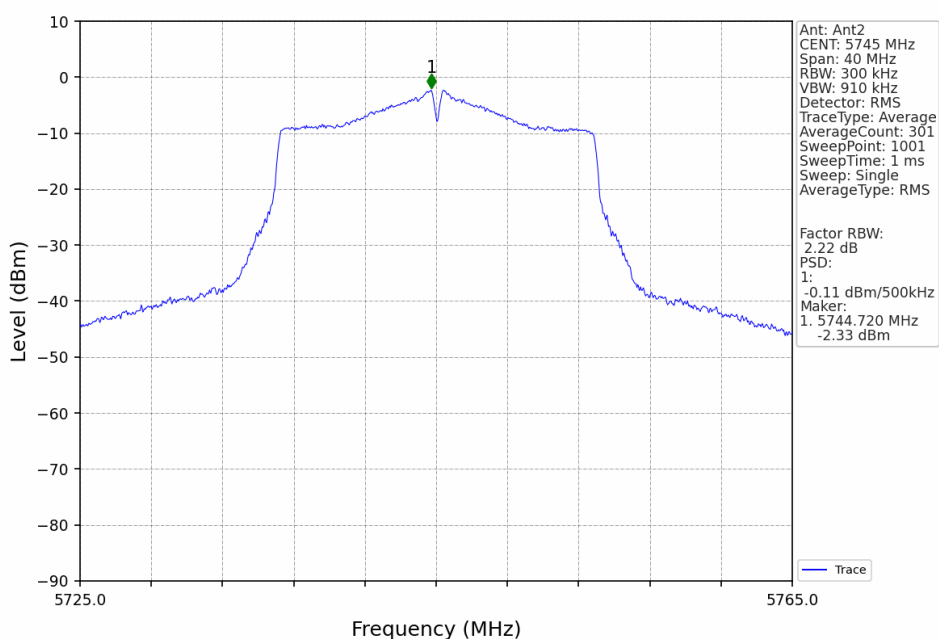


802.11n(HT20) MCH_5785MHz_Ant1_NTNV

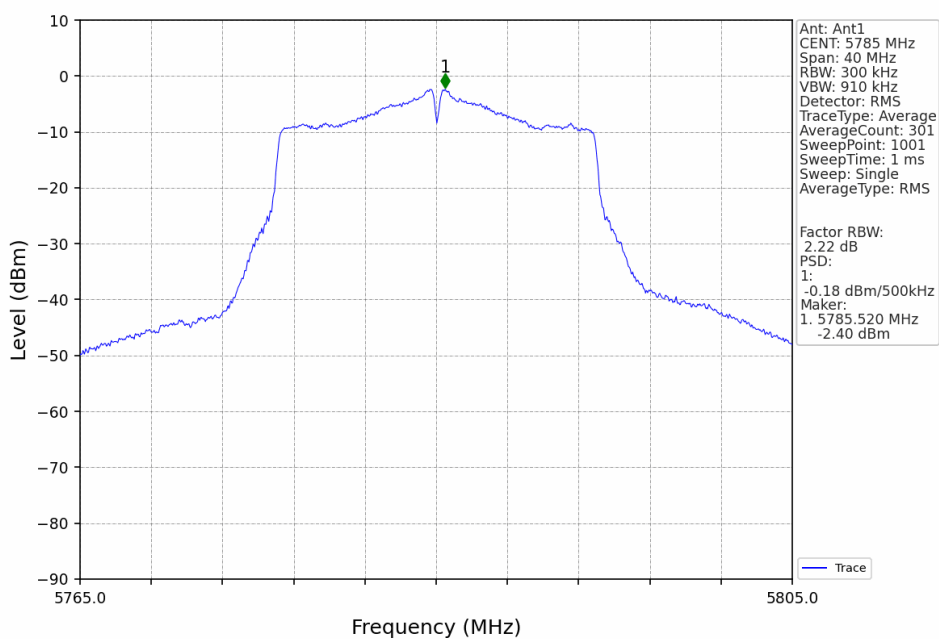


802.11n(HT20) MCH_5785MHz_Ant2_NTNV

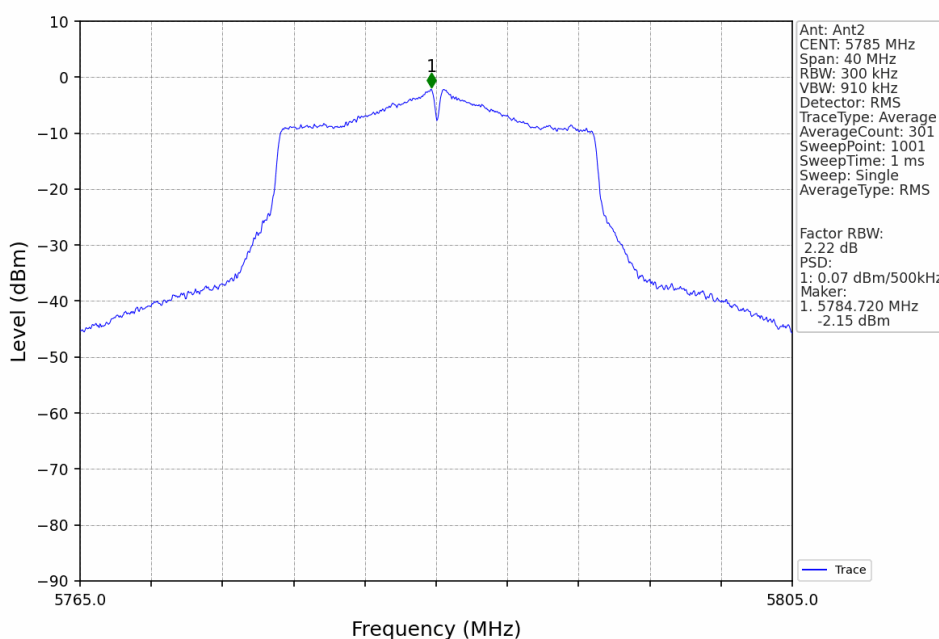


802.11n(HT20) HCH 5825MHz Ant1_NTNV

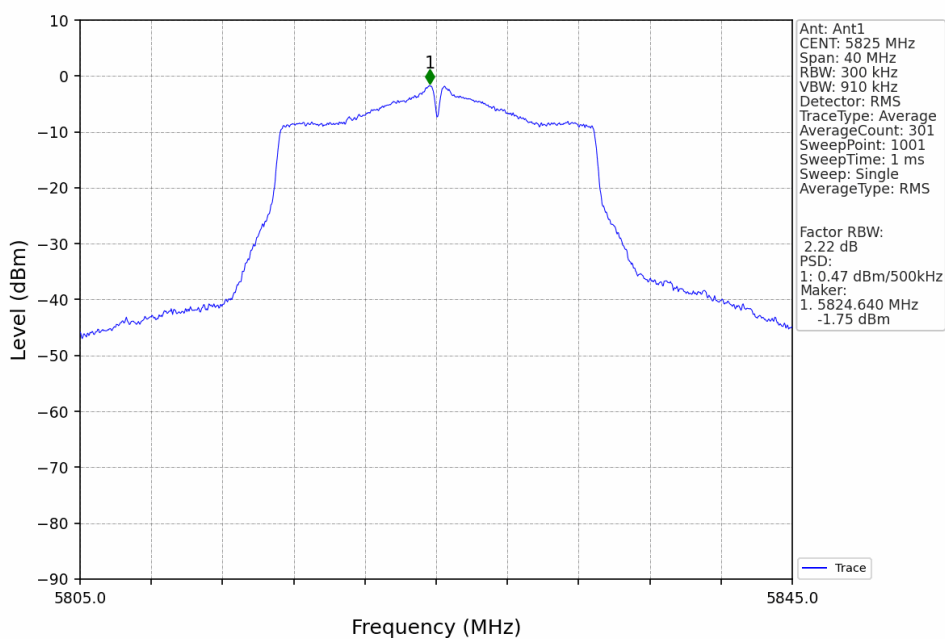


802.11n(HT20) HCH 5825MHz Ant2_NTNV

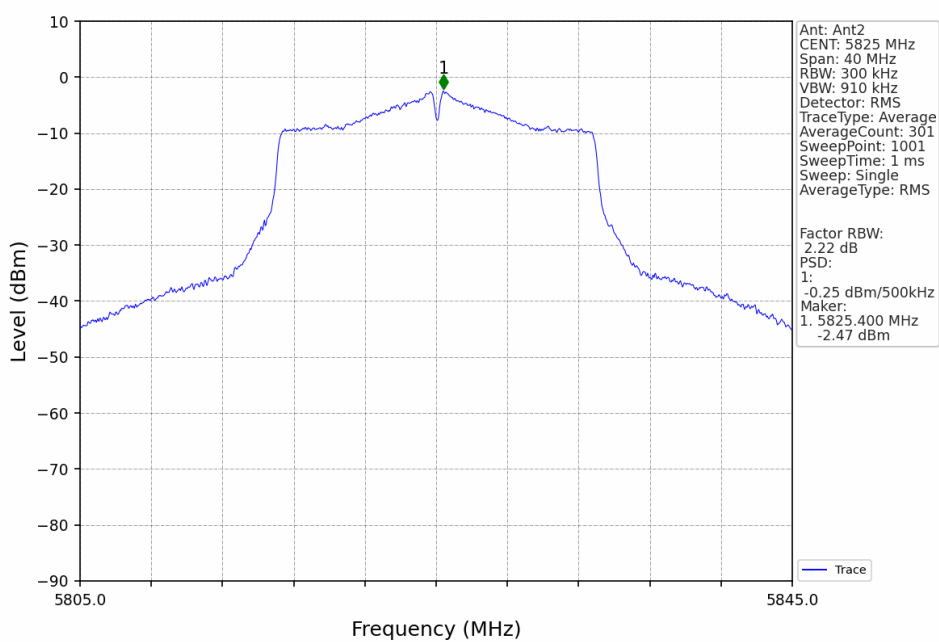


802.11n(HT40) LCH 5755MHz_Ant1_NTNV

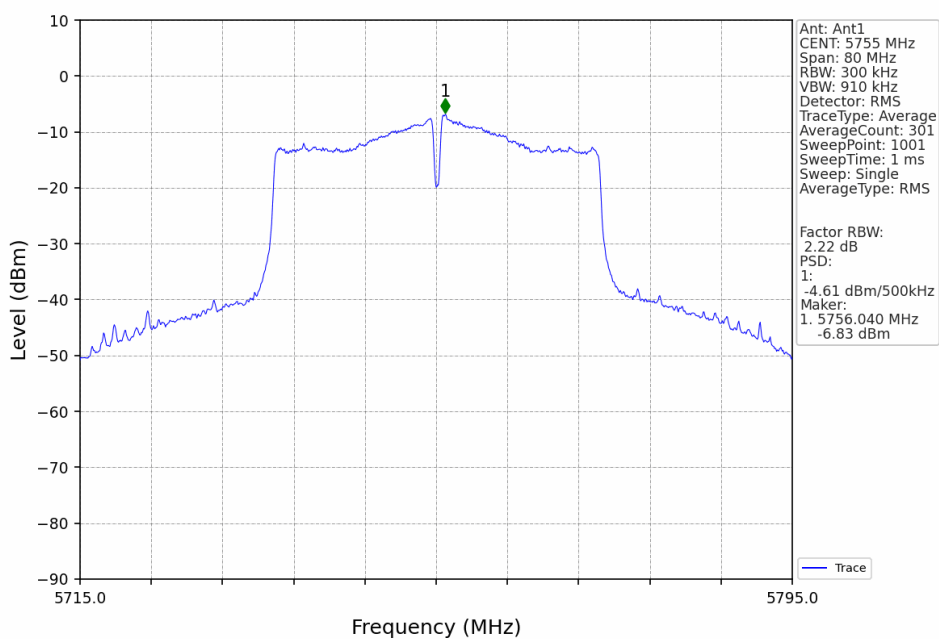


802.11n(HT40) LCH 5755MHz_Ant2_NTNV

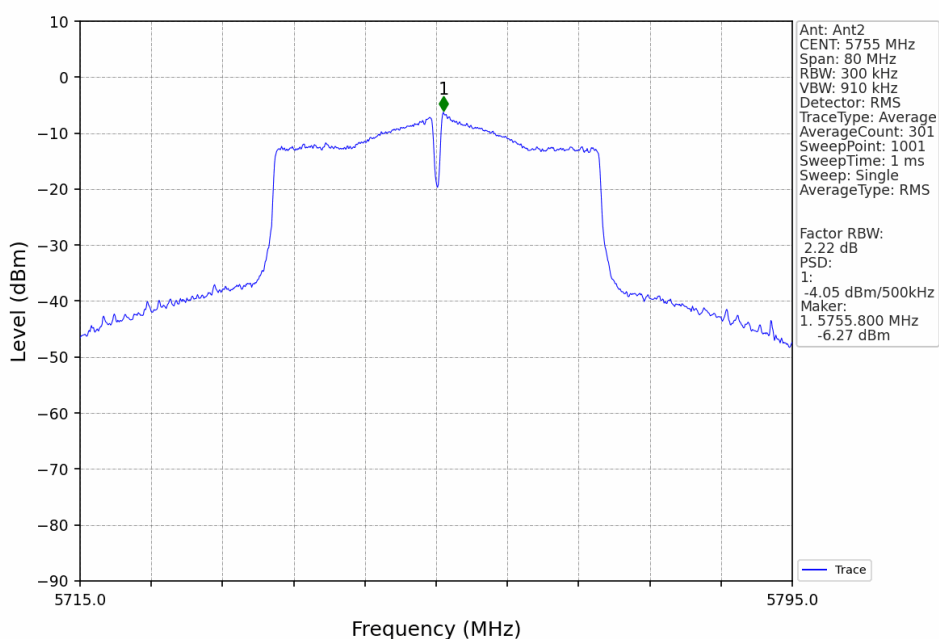


802.11n(HT40) HCH 5795MHz Ant1_NTNV

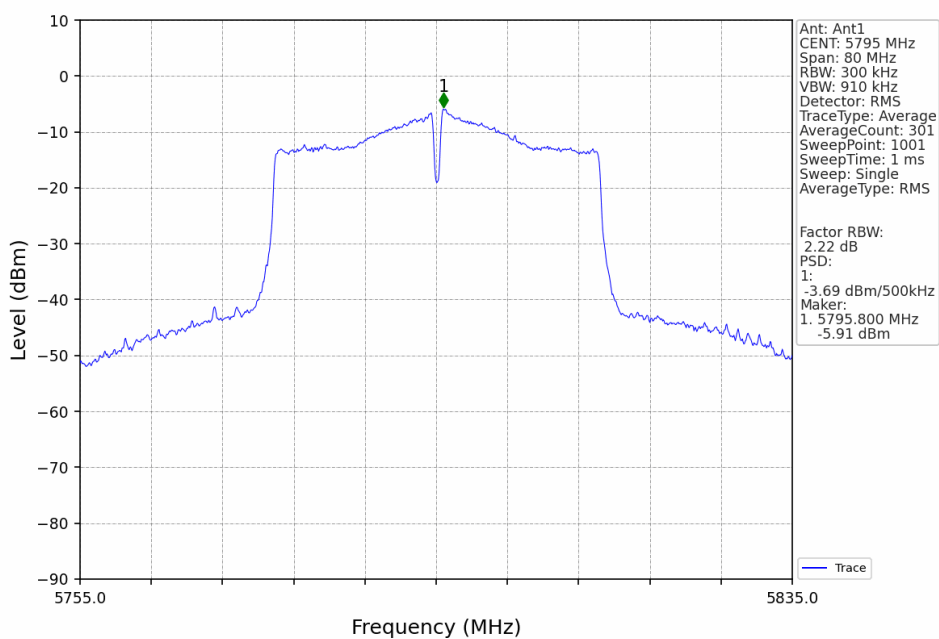


802.11n(HT40) HCH 5795MHz Ant2_NTNV

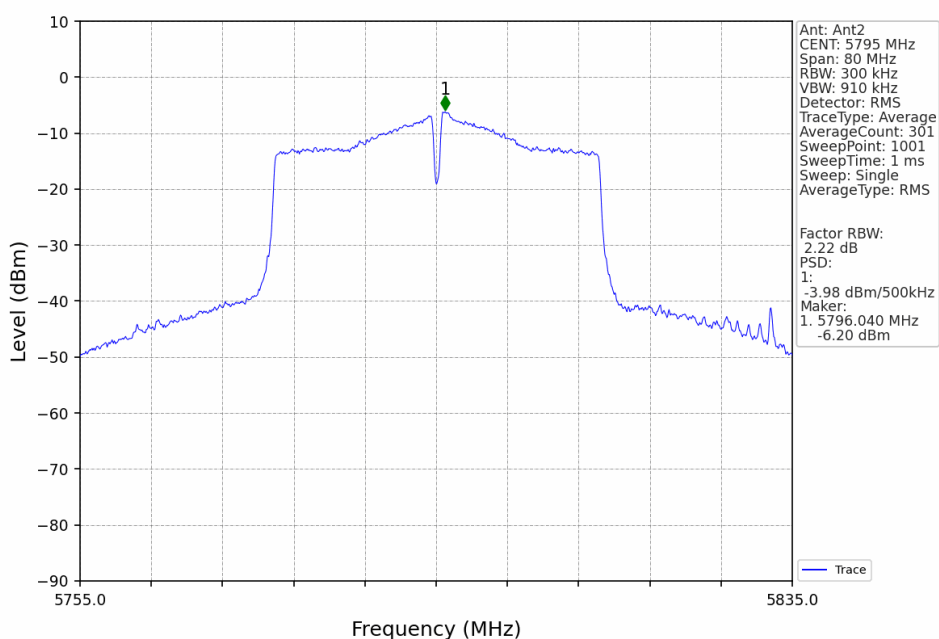


802.11ac(VHT20) LCH 5745MHz Ant1 NTN

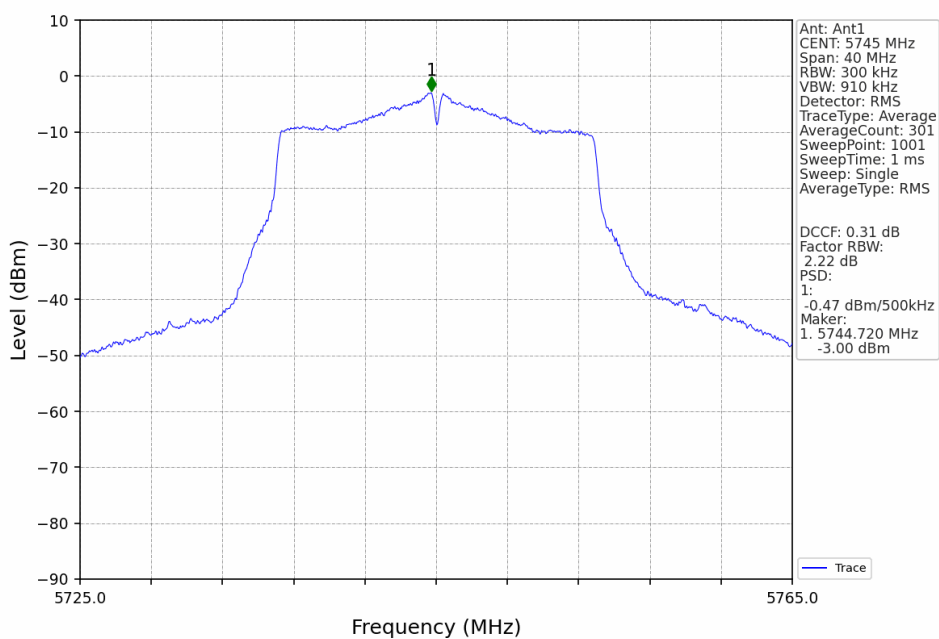


802.11ac(VHT20) LCH 5745MHz Ant2 NTN

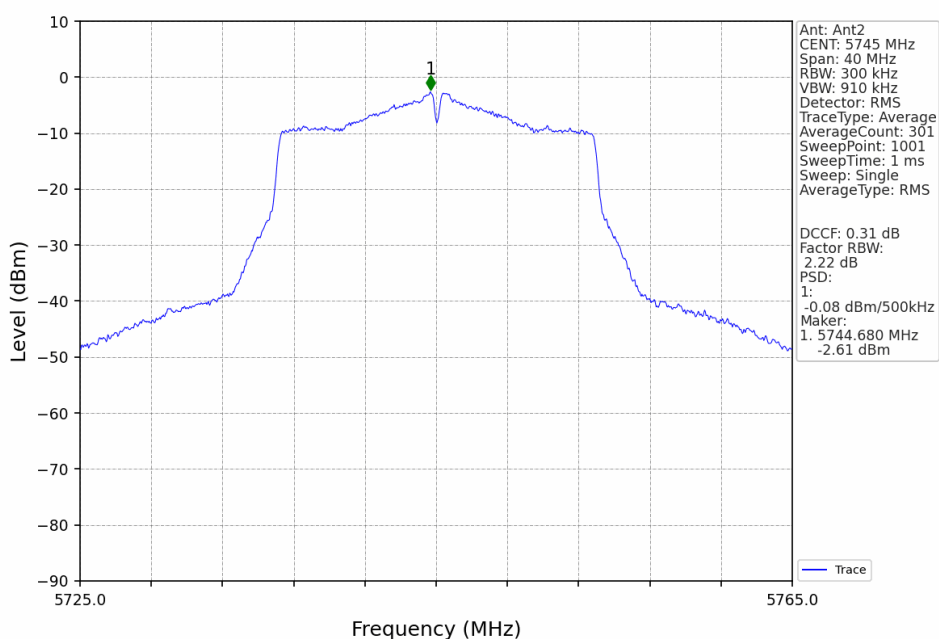


802.11ac(VHT20) MCH 5785MHz_Ant1_NTNV

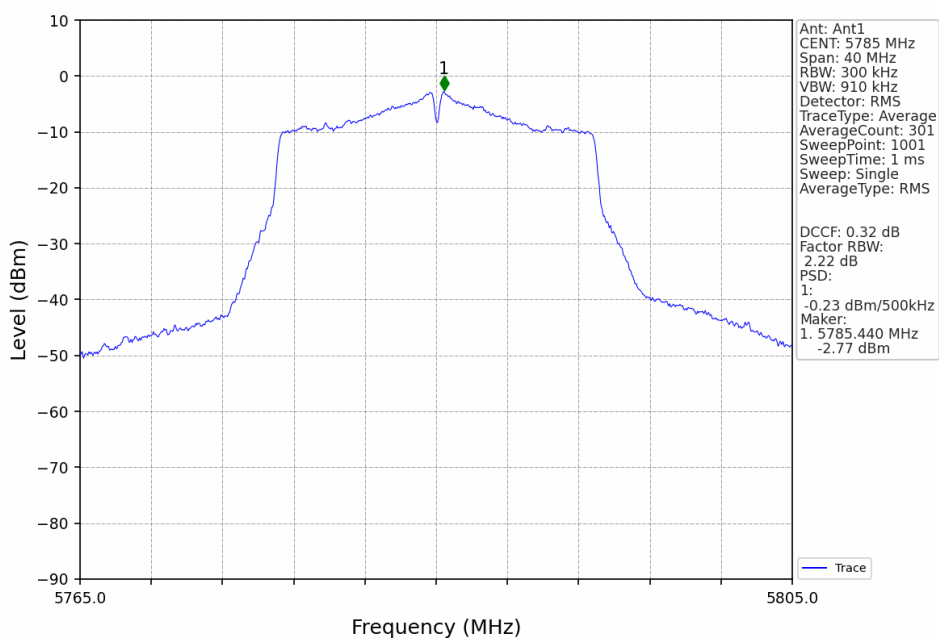


802.11ac(VHT20) MCH 5785MHz_Ant2_NTNV

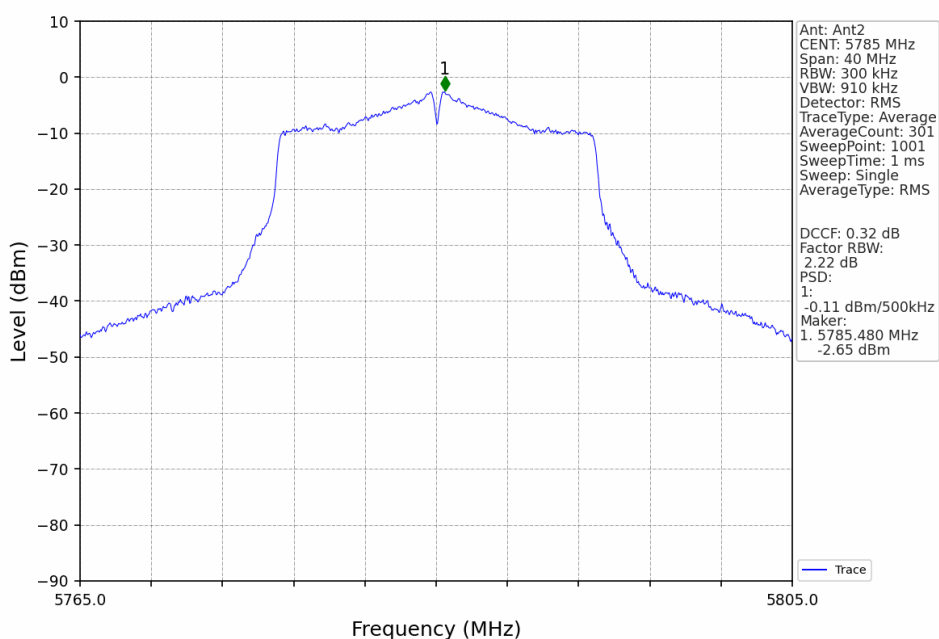


802.11ac(VHT20) HCH 5825MHz_Ant1_NTNV

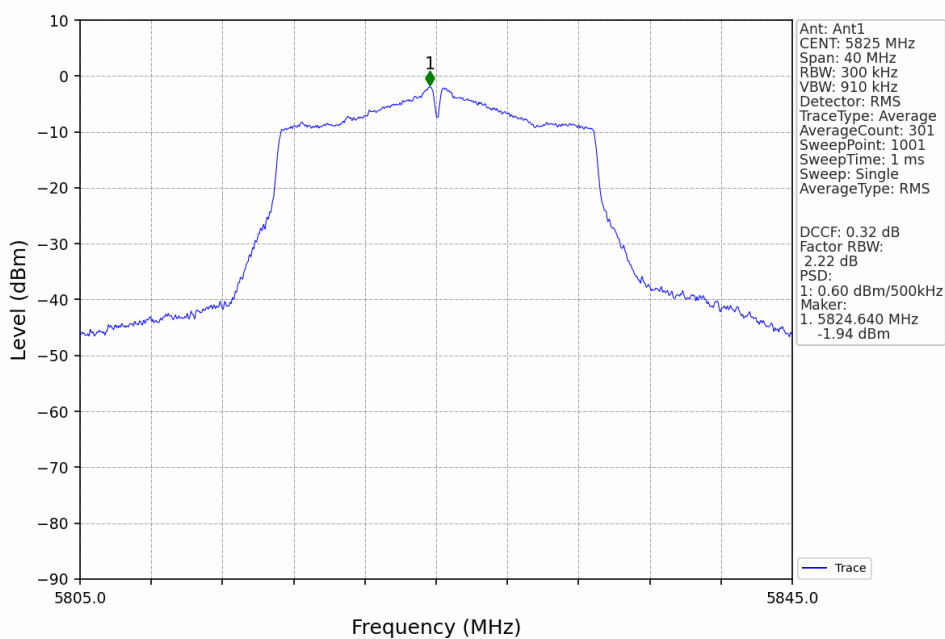


802.11ac(VHT20) HCH 5825MHz_Ant2_NTNV

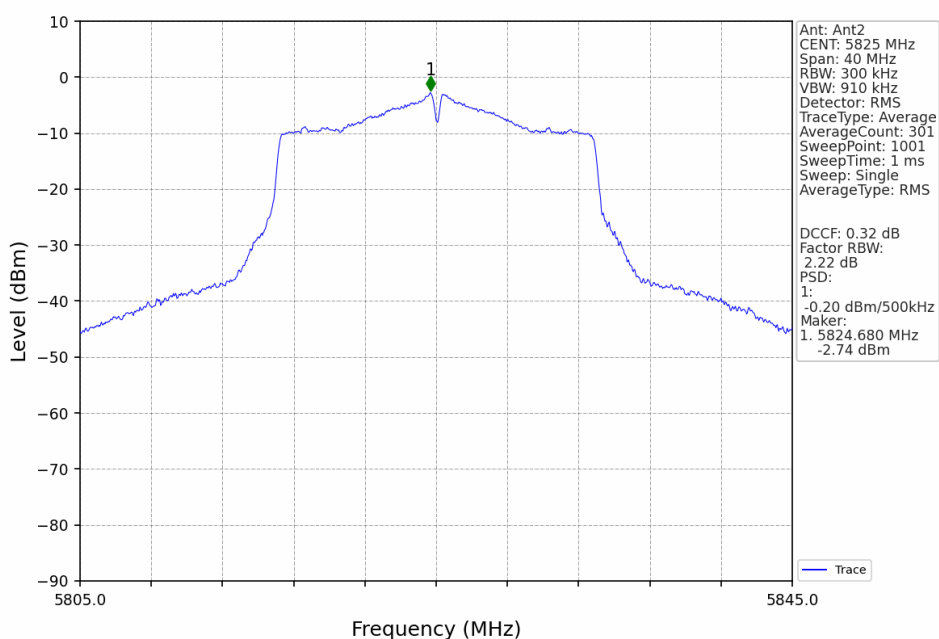


802.11ac(VHT40) LCH 5755MHz Ant1 NTN

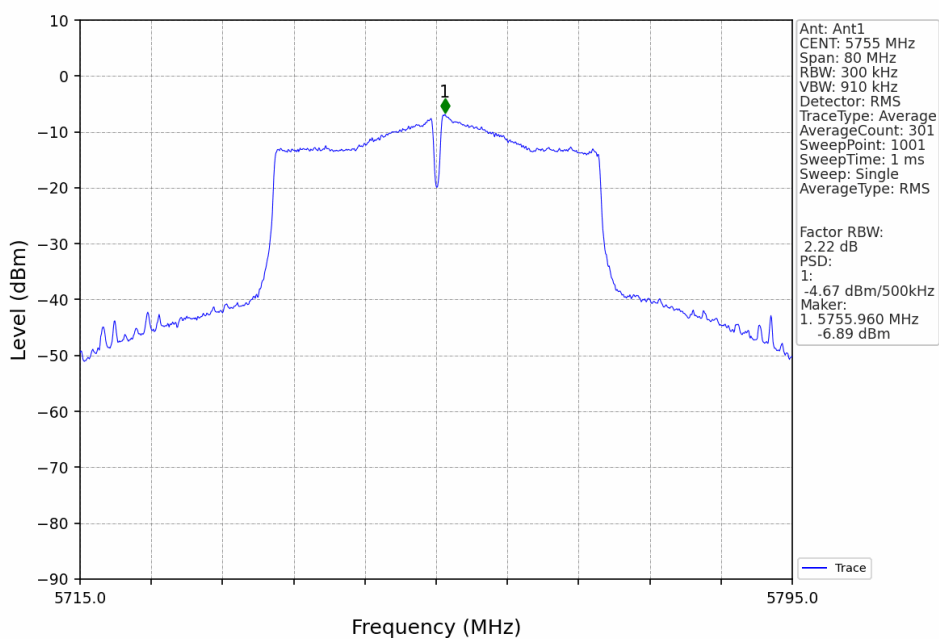


802.11ac(VHT40) LCH 5755MHz Ant2 NTN

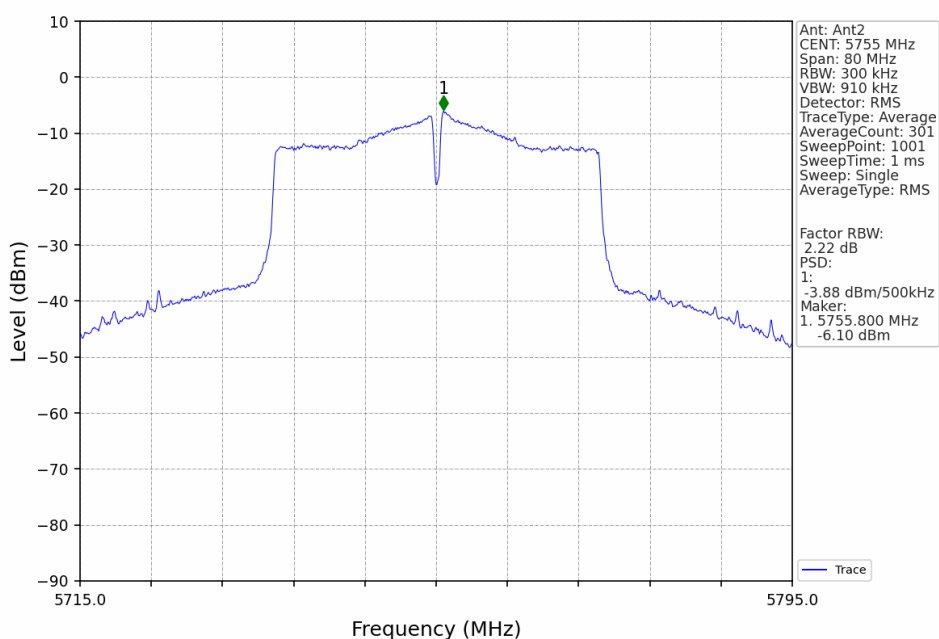


802.11ac(VHT40) HCH 5795MHz Ant1 NTN

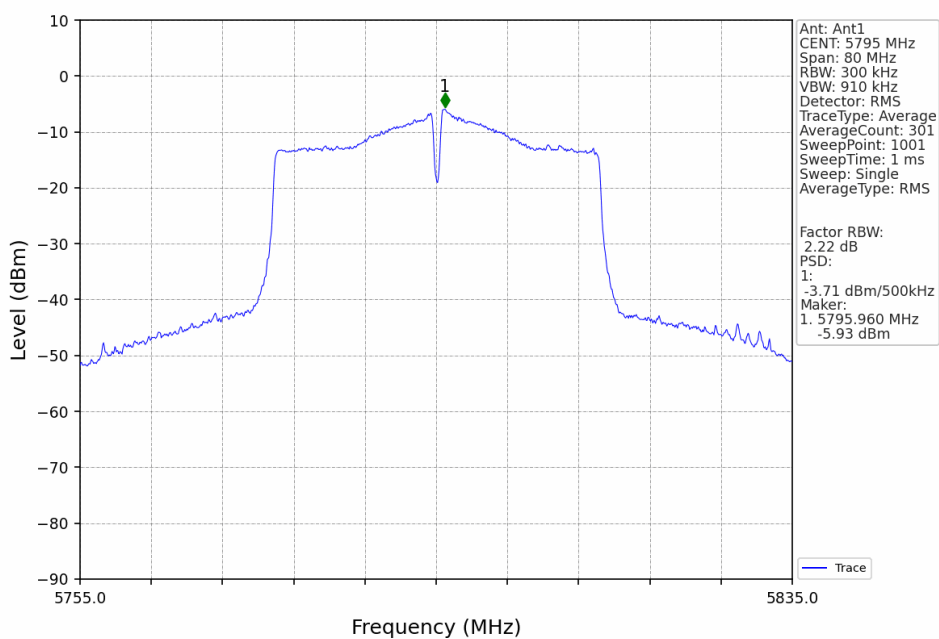


802.11ac(VHT40) HCH 5795MHz Ant2 NTN

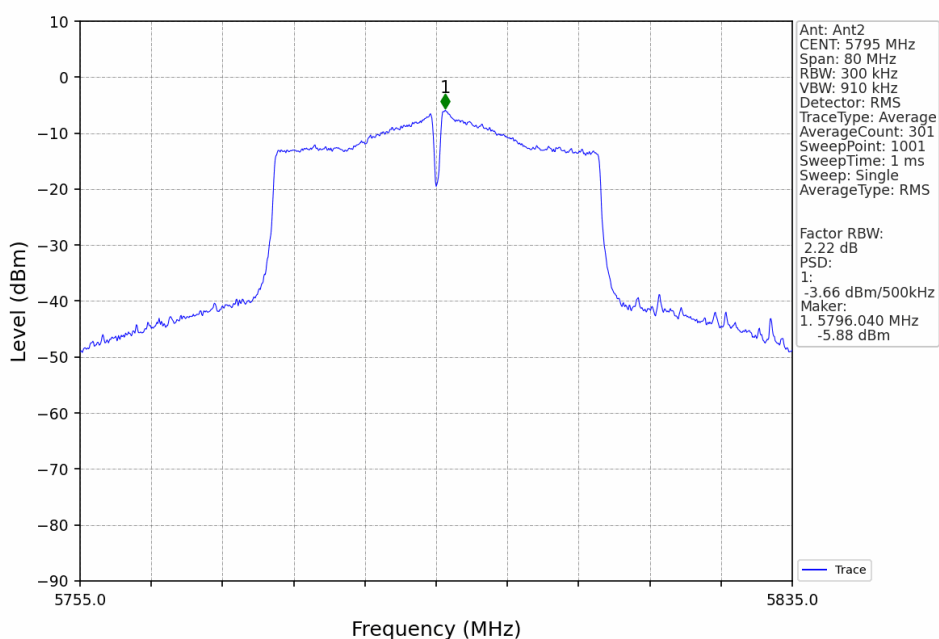


802.11ac(VHT80) MCH 5775MHz_Ant1_NTNV

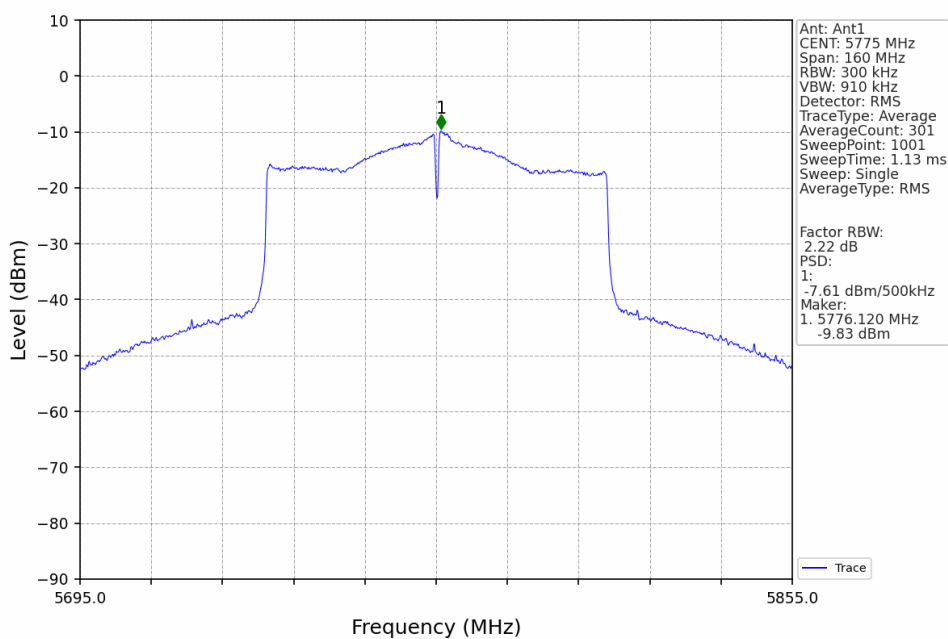


802.11ac(VHT80) MCH 5775MHz_Ant2_NTNV

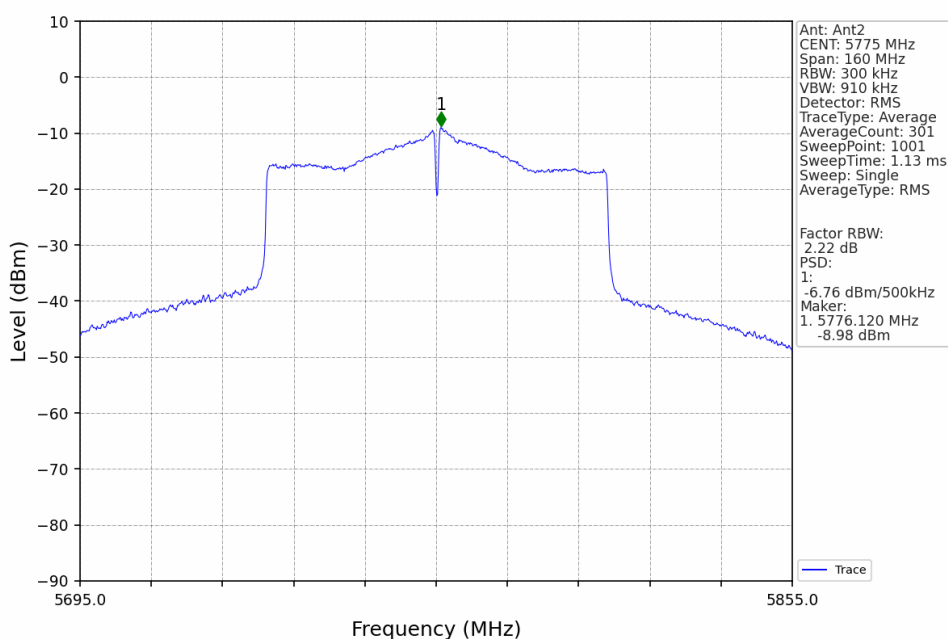


802.11ax(HEW20) LCH 5745MHz SU / Ant1 NTV

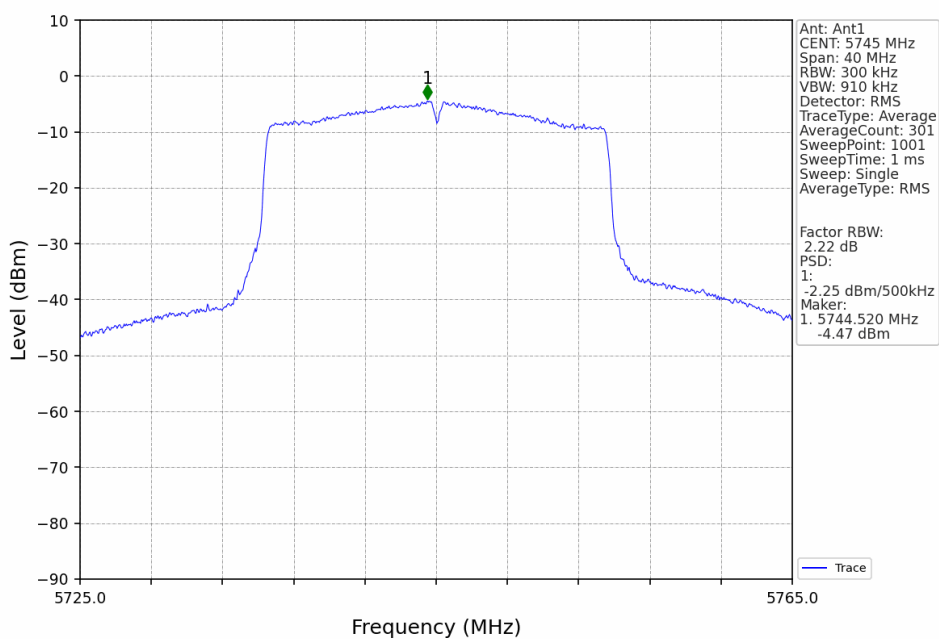


802.11ax(HEW20) LCH 5745MHz SU / Ant2 NTV

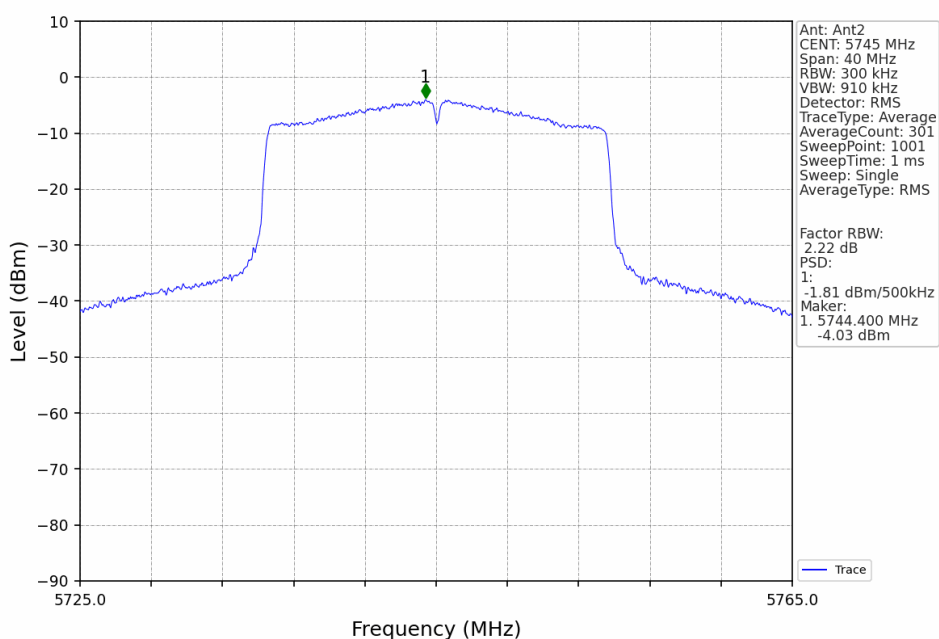


802.11ax(HEW20) MCH 5785MHz SU / Ant1 NTN

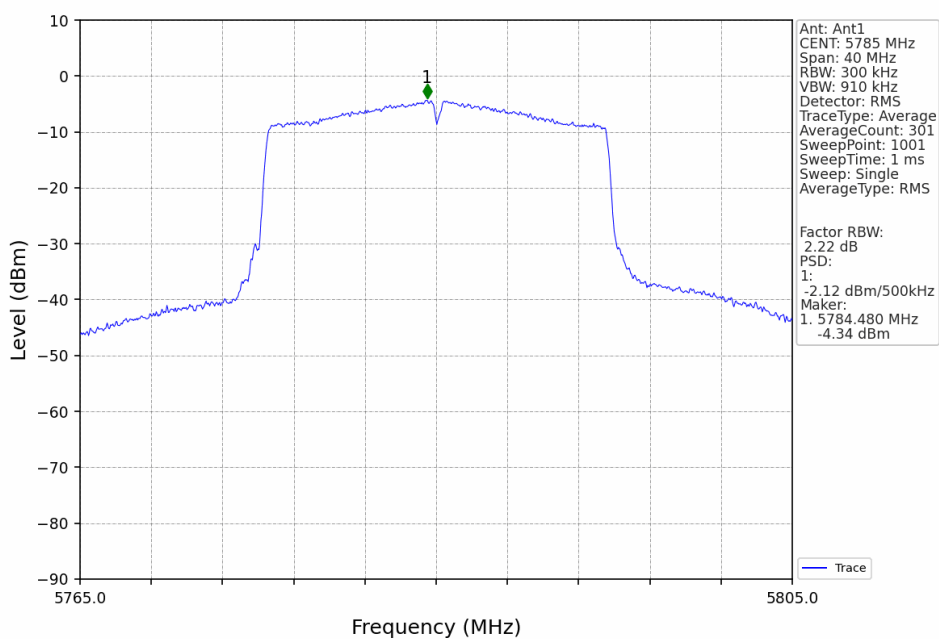


802.11ax(HEW20) MCH 5785MHz SU / Ant2 NTN

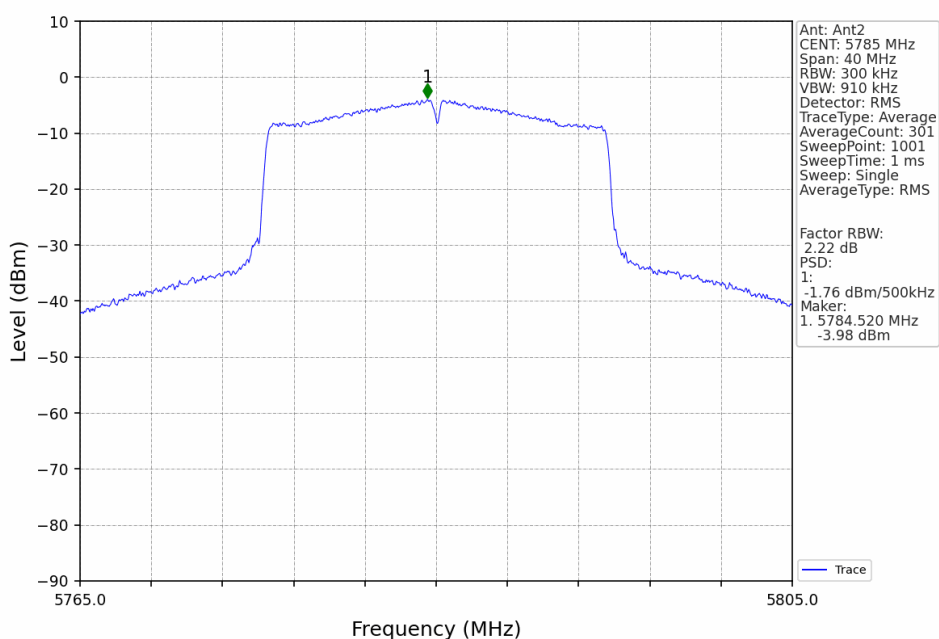


802.11ax(HEW20) HCH 5825MHz SU / Ant1 NTN

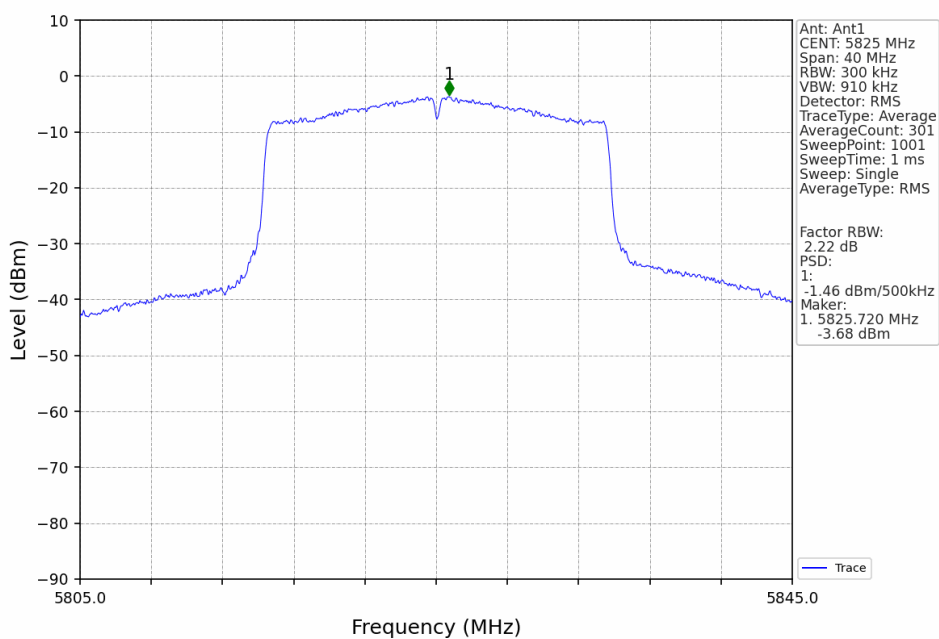


802.11ax(HEW20) HCH 5825MHz SU / Ant2 NTN

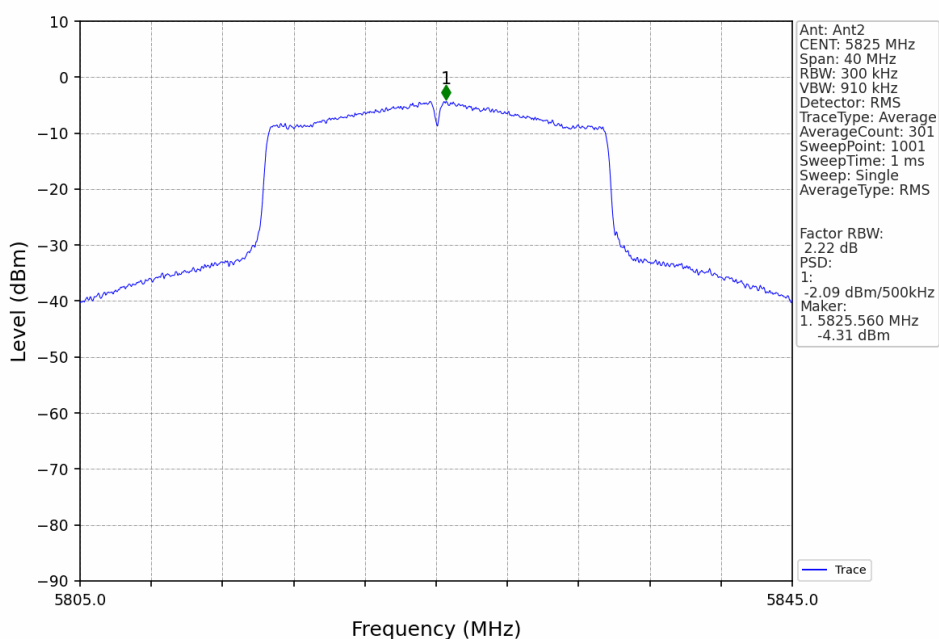


802.11ax(HEW40) LCH 5755MHz SU / Ant1 NTNV

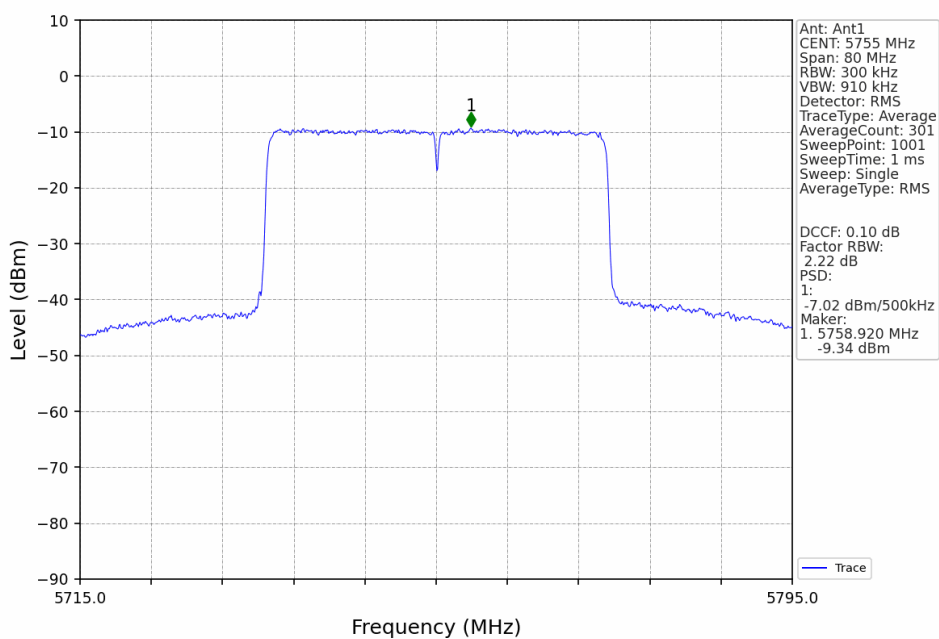


802.11ax(HEW40) LCH 5755MHz SU / Ant2 NTNV

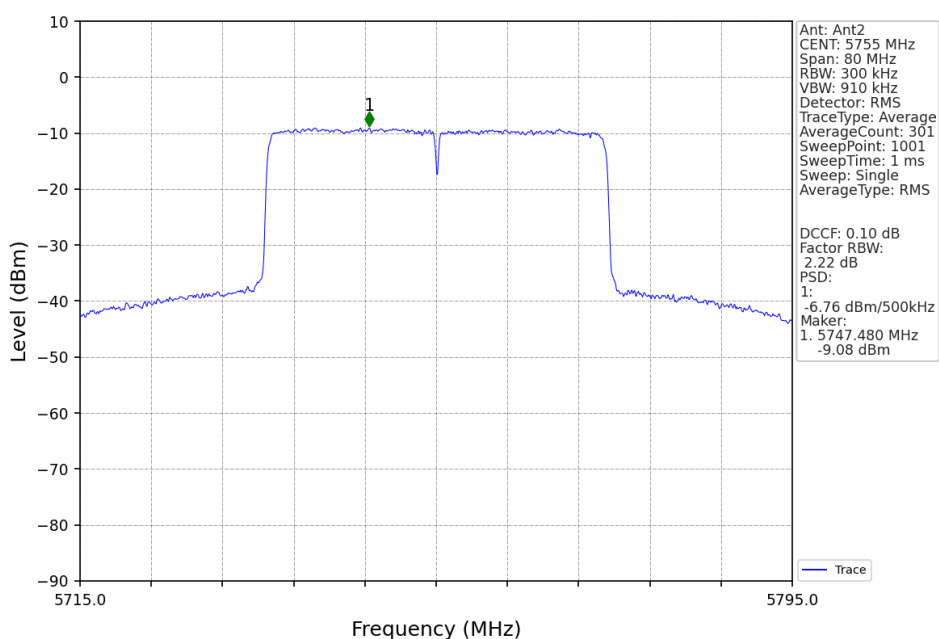


802.11ax(HEW40) HCH 5795MHz SU / Ant1 NTN

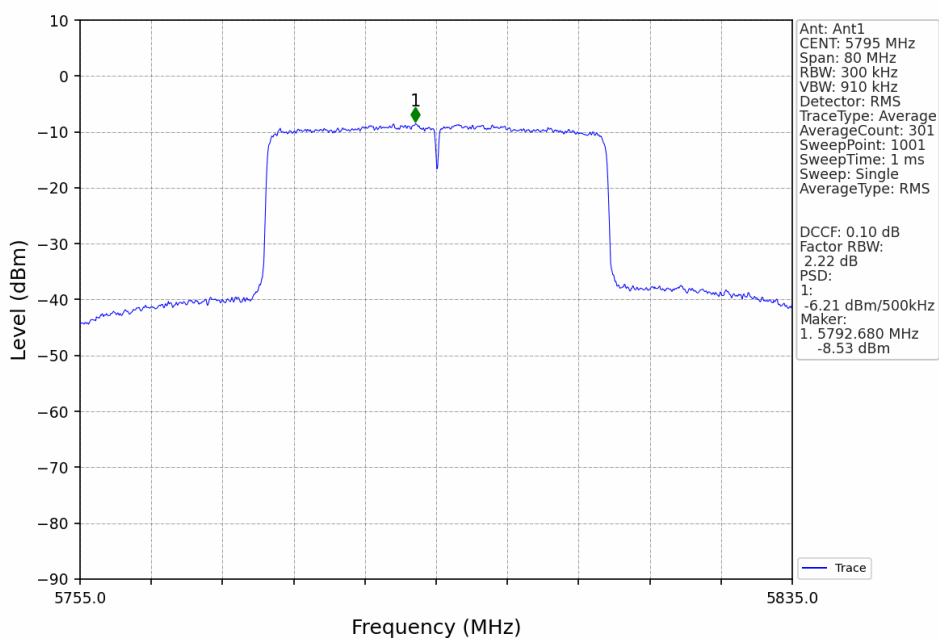


802.11ax(HEW40) HCH 5795MHz SU / Ant2 NTN

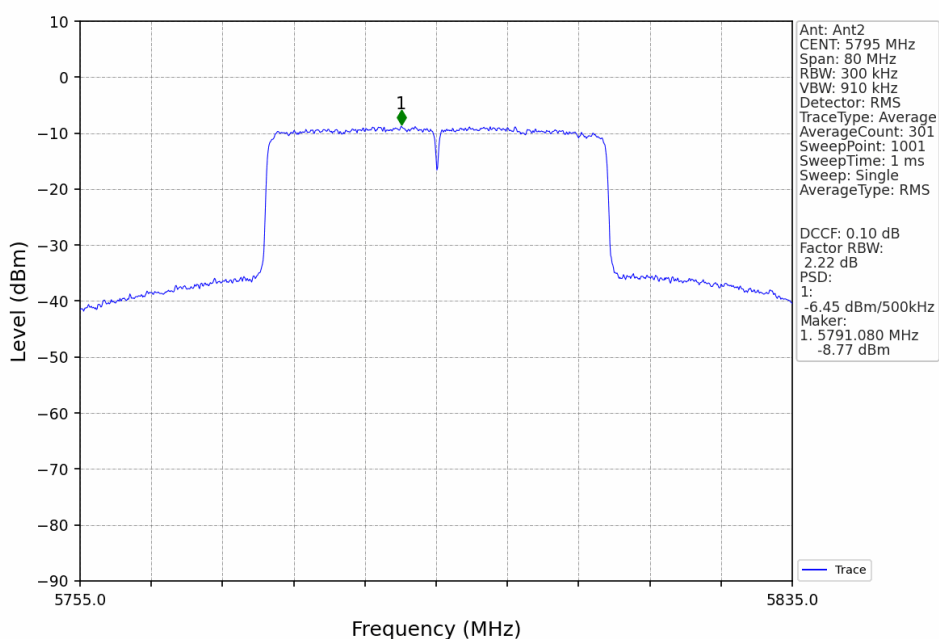

802.11ax(HEW80) MCH 5775MHz SU / Ant1 NTN

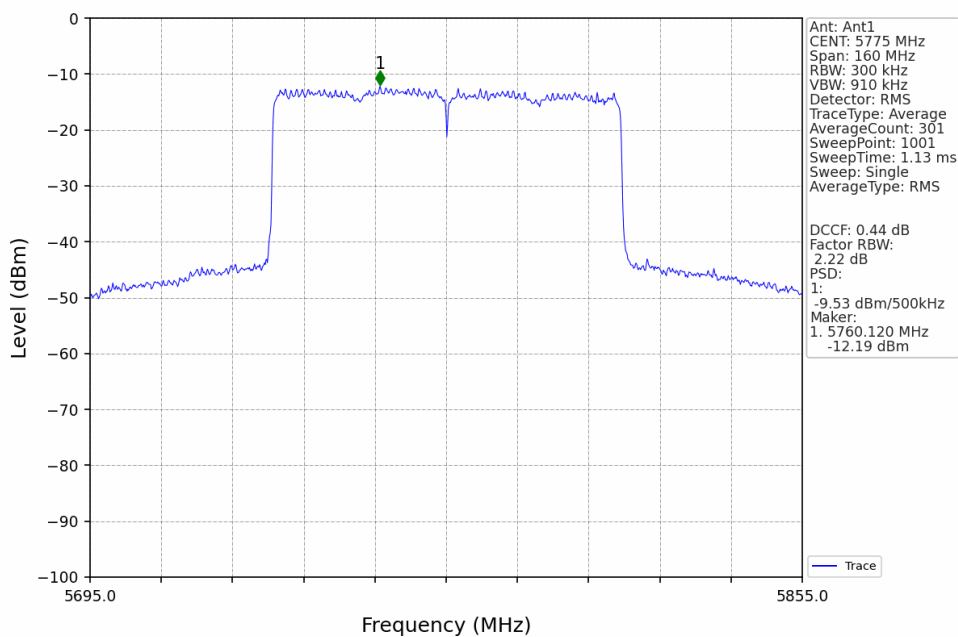

802.11ax(HEW80) MCH 5775MHz SU / Ant2 NTN

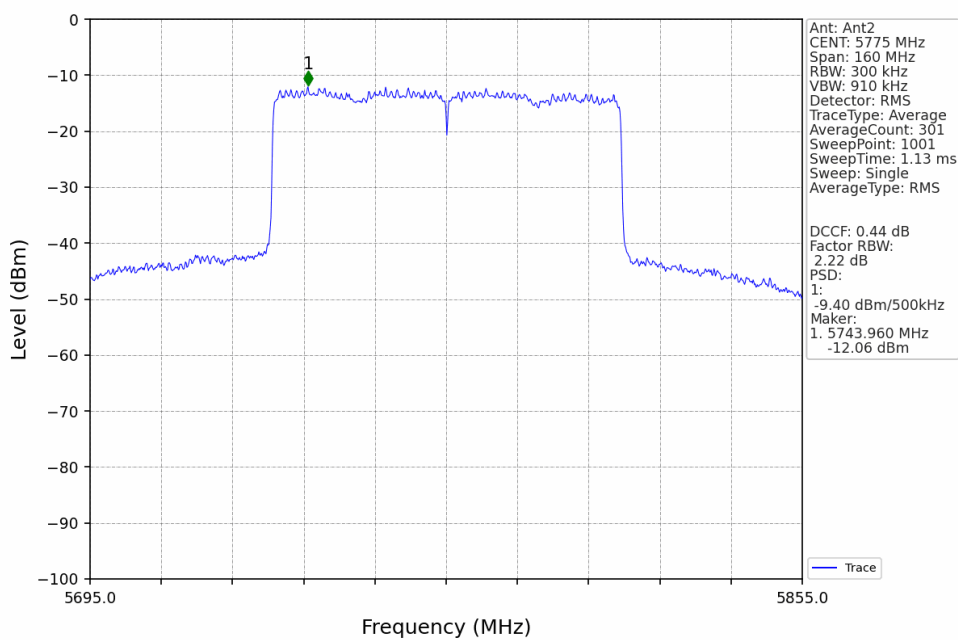

5. Frequency Stability

5.1 Test Result

Ant1							
Mode	TX Type	Frequency (MHz)	Temperature (°C)	Voltage (VAC)	Measured Frequency (MHz)	Limit (MHz)	Verdict
Carrier Wave	SISO	5180	20	102	5181.113	5150 to 5250	Pass
				120	5181.113	5150 to 5250	Pass
				138	5181.113	5150 to 5250	Pass
			-30	120	5181.113	5150 to 5250	Pass
			-20	120	5181.113	5150 to 5250	Pass
			-10	120	5181.113	5150 to 5250	Pass
			0	120	5181.113	5150 to 5250	Pass
			10	120	5181.113	5150 to 5250	Pass
			30	120	5181.113	5150 to 5250	Pass
			40	120	5181.113	5150 to 5250	Pass
			50	120	5181.113	5150 to 5250	Pass
		5200	20	102	5200.111	5150 to 5250	Pass
				120	5200.111	5150 to 5250	Pass
				138	5200.111	5150 to 5250	Pass
			-30	120	5200.111	5150 to 5250	Pass
			-20	120	5200.111	5150 to 5250	Pass
			-10	120	5200.111	5150 to 5250	Pass
			0	120	5200.111	5150 to 5250	Pass
			10	120	5200.111	5150 to 5250	Pass
			30	120	5200.111	5150 to 5250	Pass
			40	120	5200.111	5150 to 5250	Pass
			50	120	5200.111	5150 to 5250	Pass
		5240	20	102	5240.108	5150 to 5250	Pass
				120	5240.108	5150 to 5250	Pass
				138	5240.108	5150 to 5250	Pass
			-30	120	5240.108	5150 to 5250	Pass
			-20	120	5240.108	5150 to 5250	Pass
			-10	120	5240.108	5150 to 5250	Pass
			0	120	5240.108	5150 to 5250	Pass
			10	120	5240.108	5150 to 5250	Pass
			30	120	5240.108	5150 to 5250	Pass
			40	120	5240.108	5150 to 5250	Pass
			50	120	5240.108	5150 to 5250	Pass
		5190	20	102	5190.109	5150 to 5250	Pass
				120	5190.109	5150 to 5250	Pass
				138	5190.109	5150 to 5250	Pass
			-30	120	5190.109	5150 to 5250	Pass
			-20	120	5190.109	5150 to 5250	Pass
			-10	120	5190.109	5150 to 5250	Pass
			0	120	5190.109	5150 to 5250	Pass
			10	120	5190.109	5150 to 5250	Pass
			30	120	5190.109	5150 to 5250	Pass
			40	120	5190.109	5150 to 5250	Pass
			50	120	5190.109	5150 to 5250	Pass
		5230	20	102	5230.108	5150 to 5250	Pass
				120	5230.108	5150 to 5250	Pass
				138	5230.108	5150 to 5250	Pass
			-30	120	5230.108	5150 to 5250	Pass
			-20	120	5230.108	5150 to 5250	Pass
			-10	120	5230.108	5150 to 5250	Pass
			0	120	5230.108	5150 to 5250	Pass
			10	120	5230.108	5150 to 5250	Pass
			30	120	5230.108	5150 to 5250	Pass

			40	120	5230.108	5150 to 5250	Pass
			50	120	5230.108	5150 to 5250	Pass
		5210	20	102	5210.111	5150 to 5250	Pass
				120	5210.111	5150 to 5250	Pass
				138	5210.111	5150 to 5250	Pass
				120	5210.111	5150 to 5250	Pass
			-30	120	5210.111	5150 to 5250	Pass
			-20	120	5210.111	5150 to 5250	Pass
			-10	120	5210.111	5150 to 5250	Pass
			0	120	5210.111	5150 to 5250	Pass
			10	120	5210.111	5150 to 5250	Pass
			30	120	5210.111	5150 to 5250	Pass
			40	120	5210.111	5150 to 5250	Pass
			50	120	5210.111	5150 to 5250	Pass
		5745	20	102	5745.119	5725 to 5850	Pass
				120	5745.119	5725 to 5850	Pass
				138	5745.119	5725 to 5850	Pass
				120	5745.119	5725 to 5850	Pass
			-30	120	5745.119	5725 to 5850	Pass
			-20	120	5745.119	5725 to 5850	Pass
			-10	120	5745.119	5725 to 5850	Pass
			0	120	5745.119	5725 to 5850	Pass
			10	120	5745.119	5725 to 5850	Pass
			30	120	5745.119	5725 to 5850	Pass
			40	120	5745.119	5725 to 5850	Pass
			50	120	5745.119	5725 to 5850	Pass
		5785	20	102	5785.117	5725 to 5850	Pass
				120	5785.117	5725 to 5850	Pass
				138	5785.117	5725 to 5850	Pass
				120	5785.117	5725 to 5850	Pass
			-30	120	5785.117	5725 to 5850	Pass
			-20	120	5785.117	5725 to 5850	Pass
			-10	120	5785.117	5725 to 5850	Pass
			0	120	5785.117	5725 to 5850	Pass
			10	120	5785.117	5725 to 5850	Pass
			30	120	5785.117	5725 to 5850	Pass
			40	120	5785.117	5725 to 5850	Pass
			50	120	5785.117	5725 to 5850	Pass
		5825	20	102	5825.118	5725 to 5850	Pass
				120	5825.118	5725 to 5850	Pass
				138	5825.118	5725 to 5850	Pass
				120	5825.118	5725 to 5850	Pass
			-30	120	5825.118	5725 to 5850	Pass
			-20	120	5825.118	5725 to 5850	Pass
			-10	120	5825.118	5725 to 5850	Pass
			0	120	5825.118	5725 to 5850	Pass
			10	120	5825.118	5725 to 5850	Pass
			30	120	5825.118	5725 to 5850	Pass
			40	120	5825.118	5725 to 5850	Pass
			50	120	5825.118	5725 to 5850	Pass
		5755	20	102	5755.119	5725 to 5850	Pass
				120	5755.119	5725 to 5850	Pass
				138	5755.119	5725 to 5850	Pass
				120	5755.119	5725 to 5850	Pass
			-30	120	5755.119	5725 to 5850	Pass
			-20	120	5755.119	5725 to 5850	Pass
			-10	120	5755.119	5725 to 5850	Pass
			0	120	5755.119	5725 to 5850	Pass
			10	120	5755.119	5725 to 5850	Pass
			30	120	5755.119	5725 to 5850	Pass
			40	120	5755.119	5725 to 5850	Pass
			50	120	5755.119	5725 to 5850	Pass
		5795	20	102	5795.115	5725 to 5850	Pass
				120	5795.115	5725 to 5850	Pass
				138	5795.115	5725 to 5850	Pass
				120	5795.115	5725 to 5850	Pass
			-30	120	5795.115	5725 to 5850	Pass
			-20	120	5795.115	5725 to 5850	Pass
			-10	120	5795.115	5725 to 5850	Pass
			0	120	5795.115	5725 to 5850	Pass
			10	120	5795.115	5725 to 5850	Pass

			30	120	5795.115	5725 to 5850	Pass
			40	120	5795.115	5725 to 5850	Pass
			50	120	5795.115	5725 to 5850	Pass
		5775	20	102	5775.118	5725 to 5850	Pass
				120	5775.118	5725 to 5850	Pass
				138	5775.118	5725 to 5850	Pass
			-30	120	5775.118	5725 to 5850	Pass
			-20	120	5775.118	5725 to 5850	Pass
			-10	120	5775.118	5725 to 5850	Pass
			0	120	5775.118	5725 to 5850	Pass
			10	120	5775.118	5725 to 5850	Pass
			30	120	5775.118	5725 to 5850	Pass
			40	120	5775.118	5725 to 5850	Pass
			50	120	5775.118	5725 to 5850	Pass

only the worst condition report(ANT1)

Appendix B: Photographs of Test Setup

Please refer to document Appendix No.: TCT260128E033-A

Appendix C: Photographs of EUT

Please refer to document Appendix No.: TCT260128E033-B & TCT260128E033-C

*******END OF REPORT*******