


Appendix Test Data-B4

Report No.:	1812C60443612504-02	Test Sample No.:	1-2-2
Start Test Date:	2026-8-31	Finish Test Date:	2026-8-31
Test Engineer:	Pearl Ao	Auditor:	Justin Feng
Temperature:	26.2°C	Relative Humidity:	47%
Pressure:	99.2kPa		

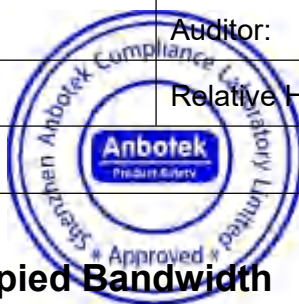


Appendix A1: 99% Occupied Bandwidth

Test Result

Test Mode	Antenna	Frequency[MHz]	OCB [MHz]	FL[MHz]	FH[MHz]	Limit[MHz]	Verdict
11A	Ant1	5745	17.600	5736.1942	5753.7942	---	---
11A	Ant1	5785	17.701	5776.1284	5793.8294	---	---
11A	Ant1	5825	17.748	5816.0011	5833.7491	---	---
11N20SISO	Ant1	5745	18.793	5735.6027	5754.3957	---	---
11N20SISO	Ant1	5785	18.783	5775.5679	5794.3509	---	---
11N20SISO	Ant1	5825	18.781	5815.5528	5834.3338	---	---
11N40SISO	Ant1	5755	37.173	5736.3564	5773.5294	---	---
11N40SISO	Ant1	5795	37.193	5776.4305	5813.6235	---	---
11AC20SISO	Ant1	5745	18.863	5735.5919	5754.4549	---	---
11AC20SISO	Ant1	5785	18.786	5775.6079	5794.3939	---	---
11AC20SISO	Ant1	5825	18.816	5815.5351	5834.3511	---	---
11AC40SISO	Ant1	5755	37.235	5736.4223	5773.6573	---	---
11AC40SISO	Ant1	5795	37.179	5776.4572	5813.6362	---	---
11AX20SISO	Ant1	5745	19.507	5735.2707	5754.7777	---	---
11AX20SISO	Ant1	5785	19.429	5775.2942	5794.7232	---	---
11AX20SISO	Ant1	5825	19.498	5815.2584	5834.7564	---	---
11AX40SISO	Ant1	5755	38.324	5735.9198	5774.2438	---	---
11AX40SISO	Ant1	5795	38.440	5775.8214	5814.2614	---	---

Test Graphs

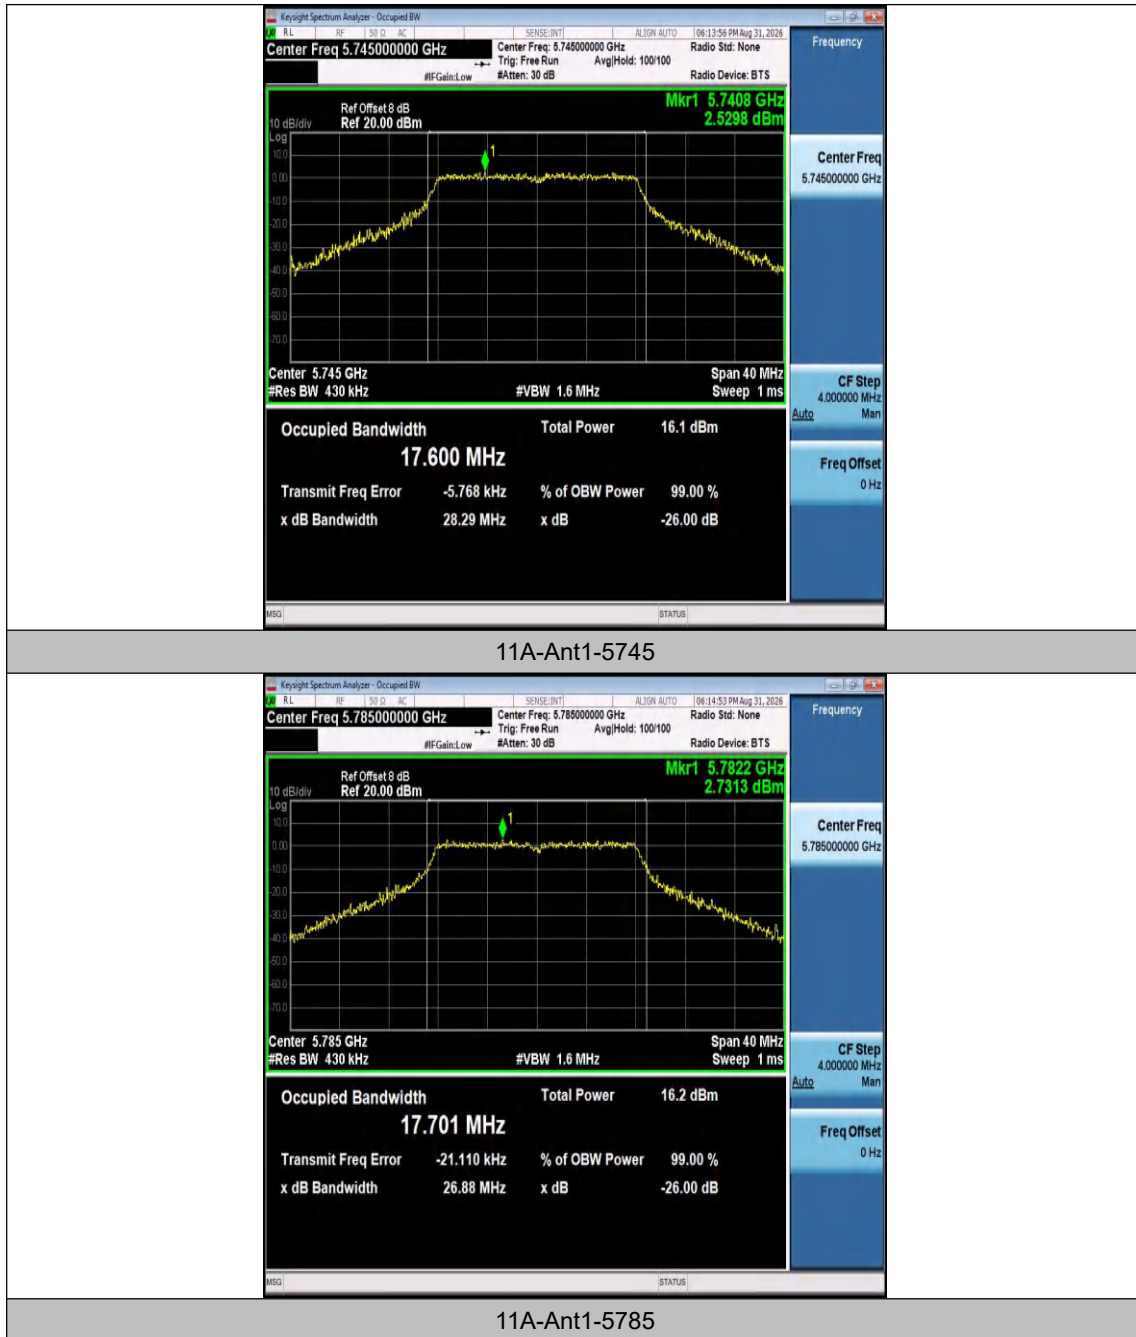

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com



Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com



Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

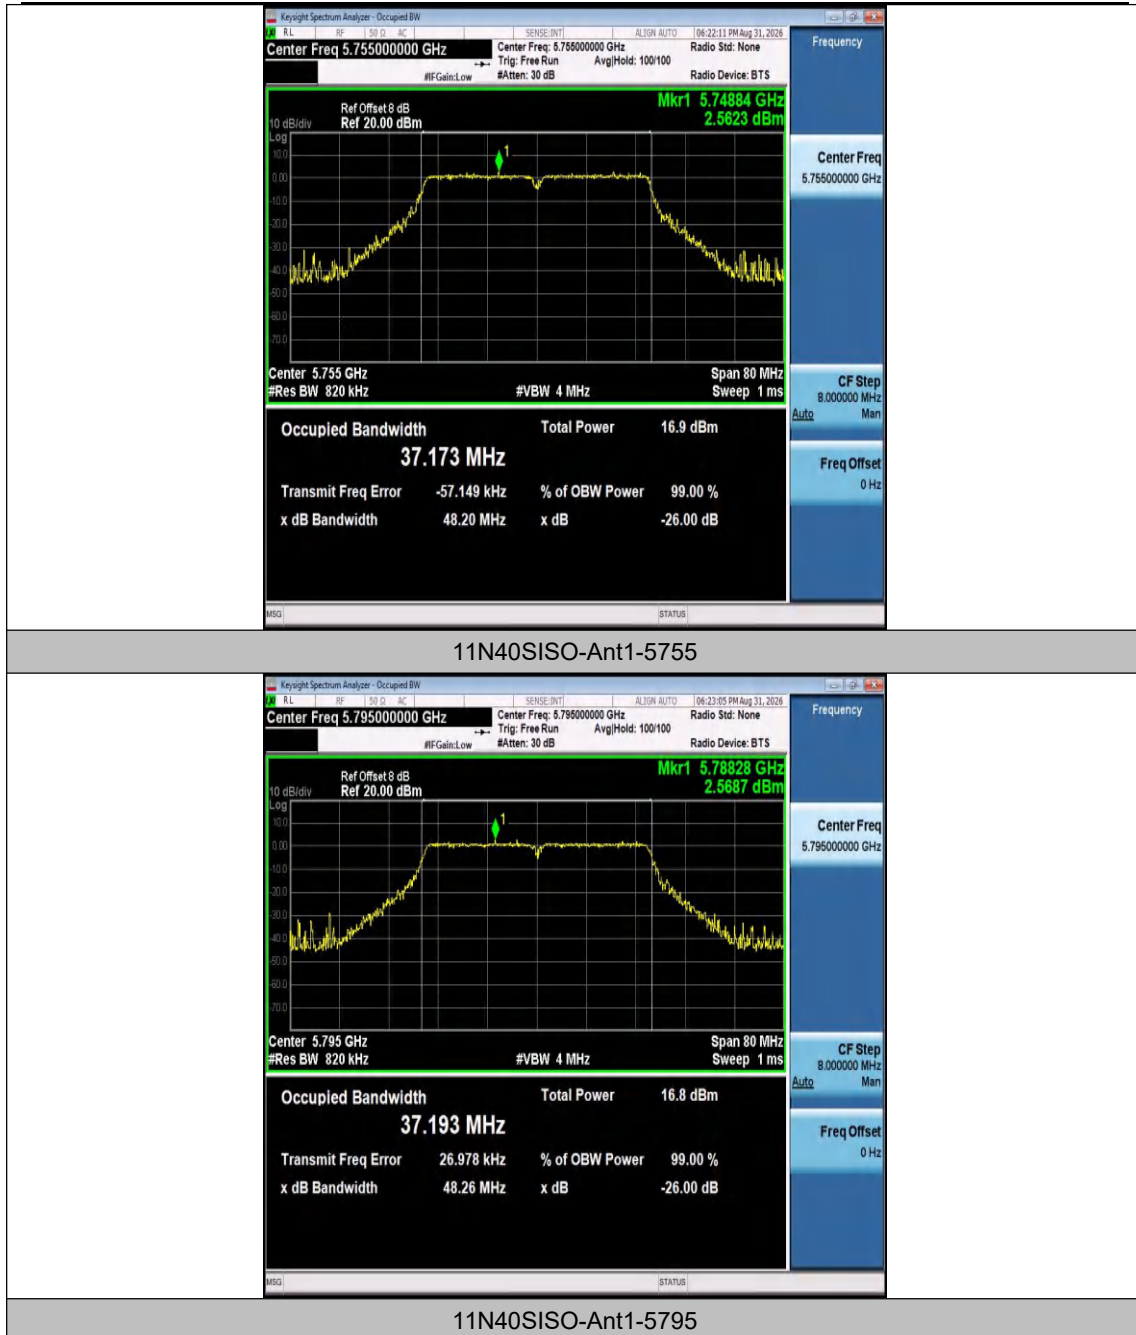

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com



Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

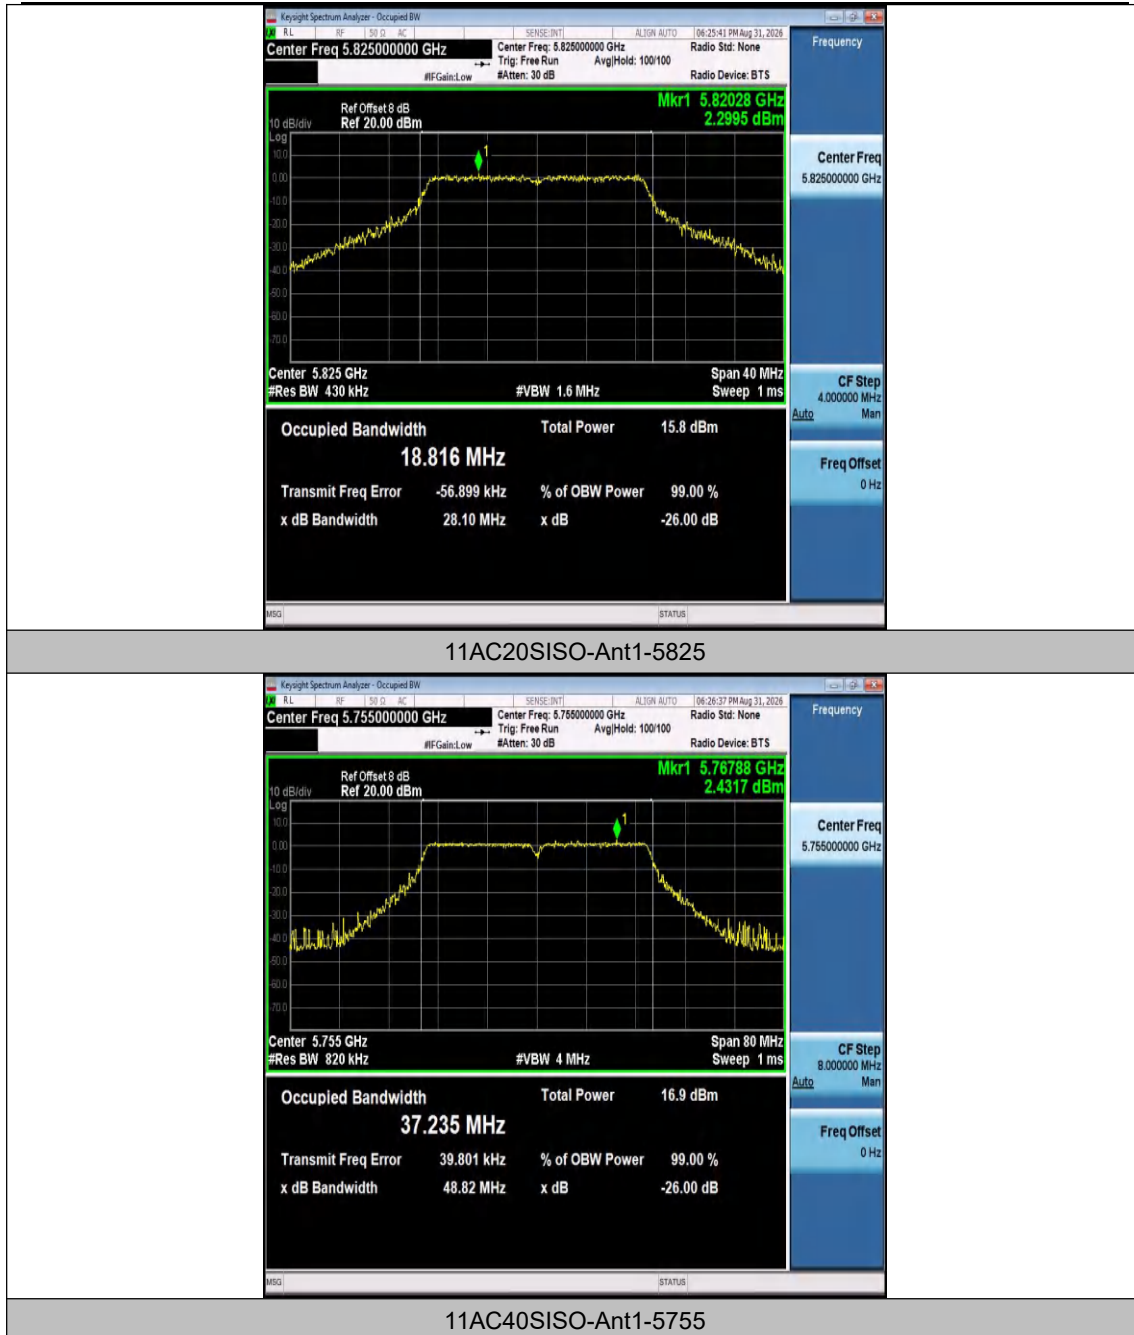

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com



Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com



Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

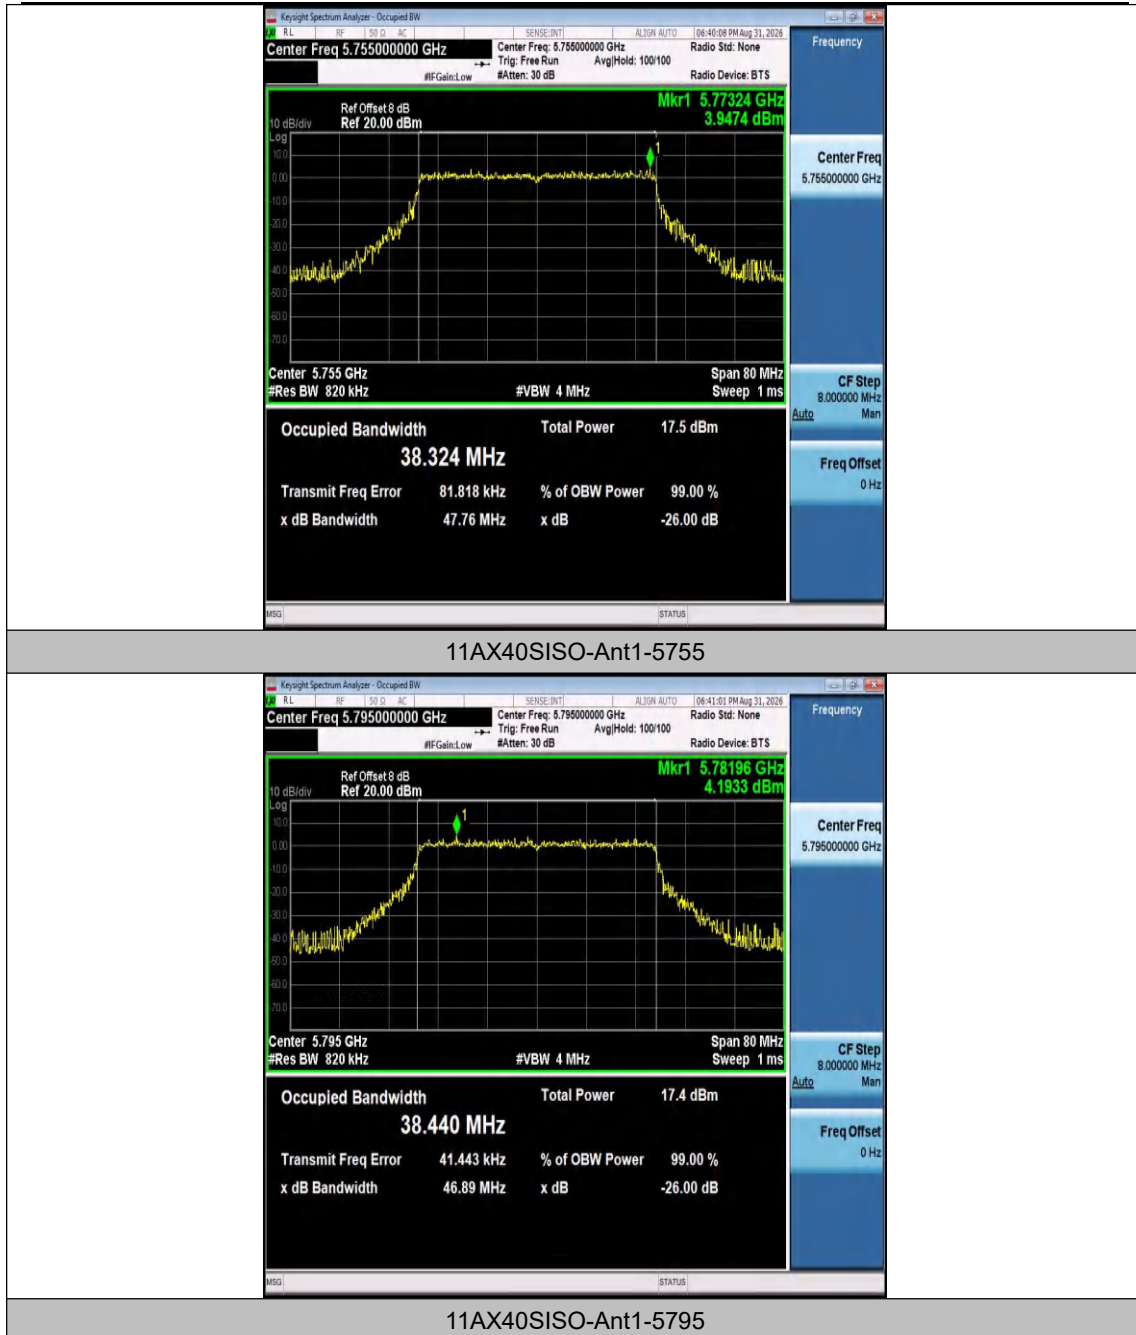

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

Appendix A2: Minimum 6dB Bandwidth

Test Result B4

Test Mode	Antenna	Frequency[MHz]	6db EBW [MHz]	FL[MHz]	FH[MHz]	Limit[MHz]	Verdict
11A	Ant1	5745	16.360	5736.800	5753.160	0.5	PASS
11A	Ant1	5785	16.360	5776.800	5793.160	0.5	PASS
11A	Ant1	5825	16.360	5816.800	5833.160	0.5	PASS
11N20SISO	Ant1	5745	17.600	5736.160	5753.760	0.5	PASS
11N20SISO	Ant1	5785	17.600	5776.160	5793.760	0.5	PASS
11N20SISO	Ant1	5825	17.640	5816.160	5833.800	0.5	PASS
11N40SISO	Ant1	5755	36.320	5736.840	5773.160	0.5	PASS
11N40SISO	Ant1	5795	36.400	5776.760	5813.160	0.5	PASS
11AC20SISO	Ant1	5745	17.600	5736.160	5753.760	0.5	PASS
11AC20SISO	Ant1	5785	17.640	5776.160	5793.800	0.5	PASS
11AC20SISO	Ant1	5825	17.760	5816.080	5833.840	0.5	PASS
11AC40SISO	Ant1	5755	36.400	5736.760	5773.160	0.5	PASS
11AC40SISO	Ant1	5795	36.400	5776.760	5813.160	0.5	PASS
11AX20SISO	Ant1	5745	18.960	5735.480	5754.440	0.5	PASS
11AX20SISO	Ant1	5785	19.000	5775.440	5794.440	0.5	PASS
11AX20SISO	Ant1	5825	18.960	5815.440	5834.400	0.5	PASS
11AX40SISO	Ant1	5755	38.000	5736.040	5774.040	0.5	PASS
11AX40SISO	Ant1	5795	38.000	5775.960	5813.960	0.5	PASS

Test Graphs B4

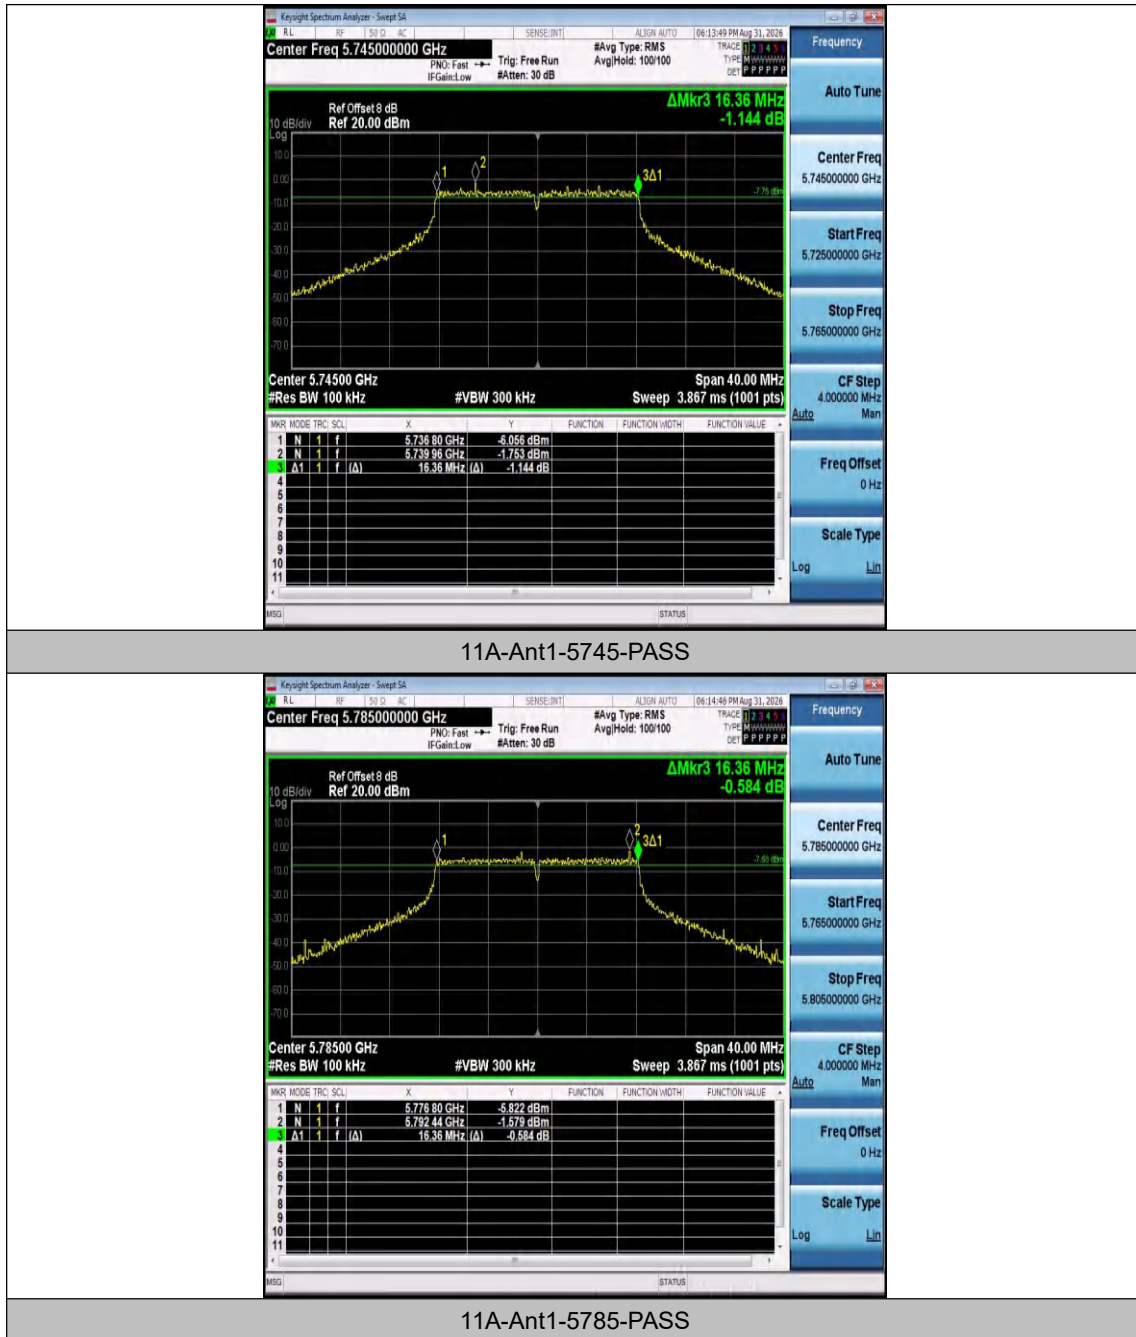


Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com




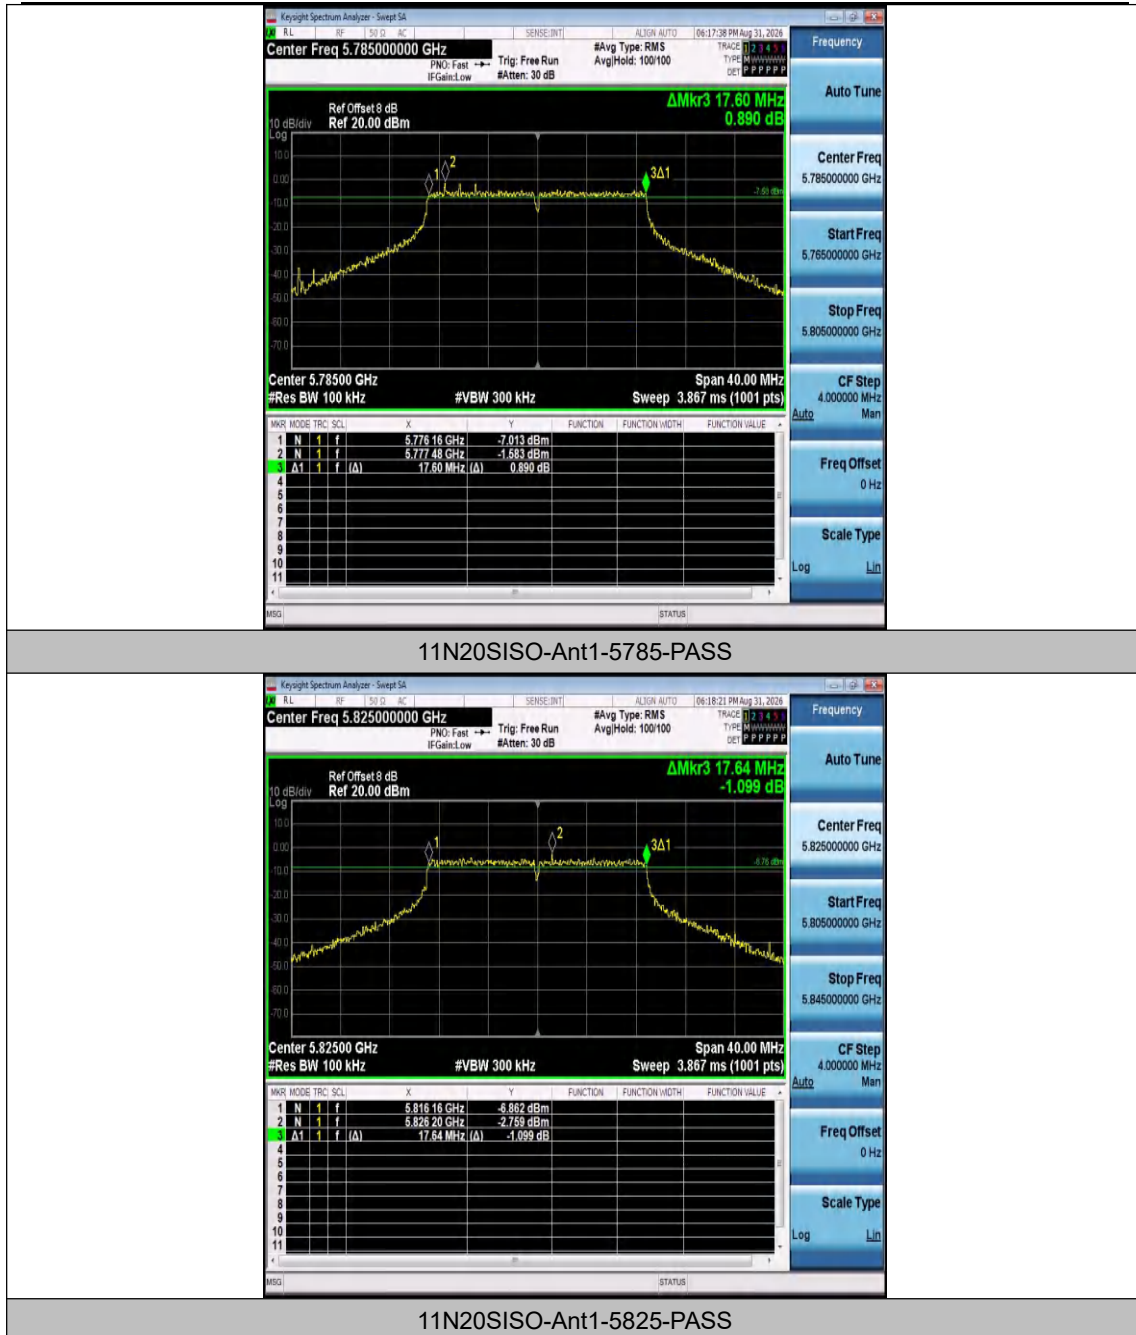



Shenzhen Anbotek Compliance Laboratory Limited


Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

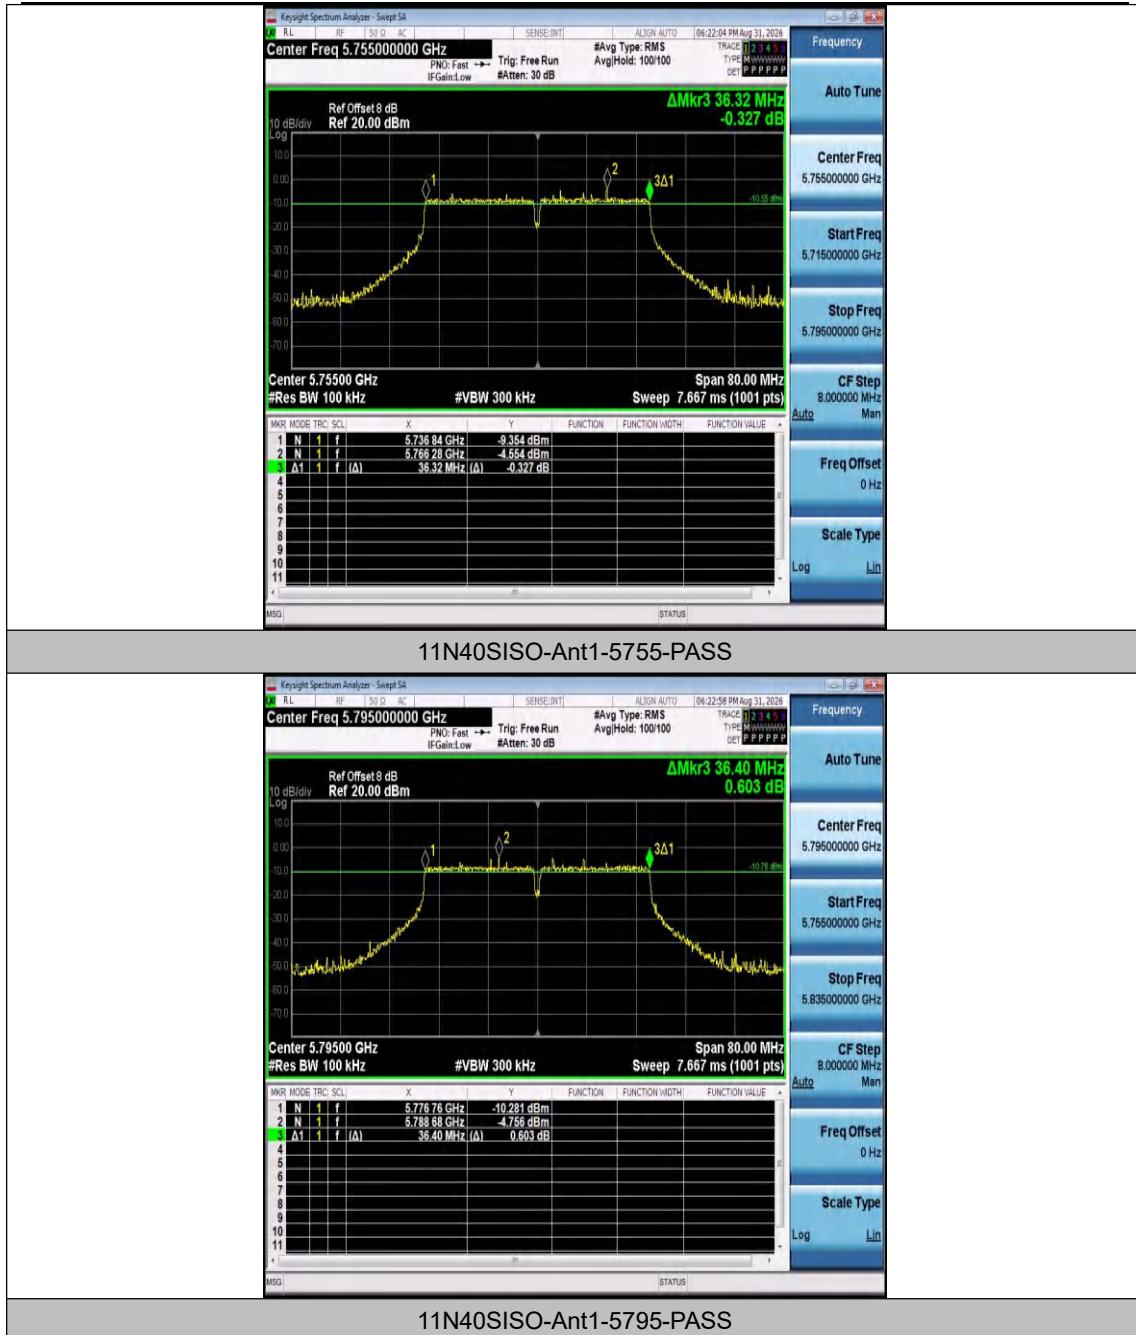


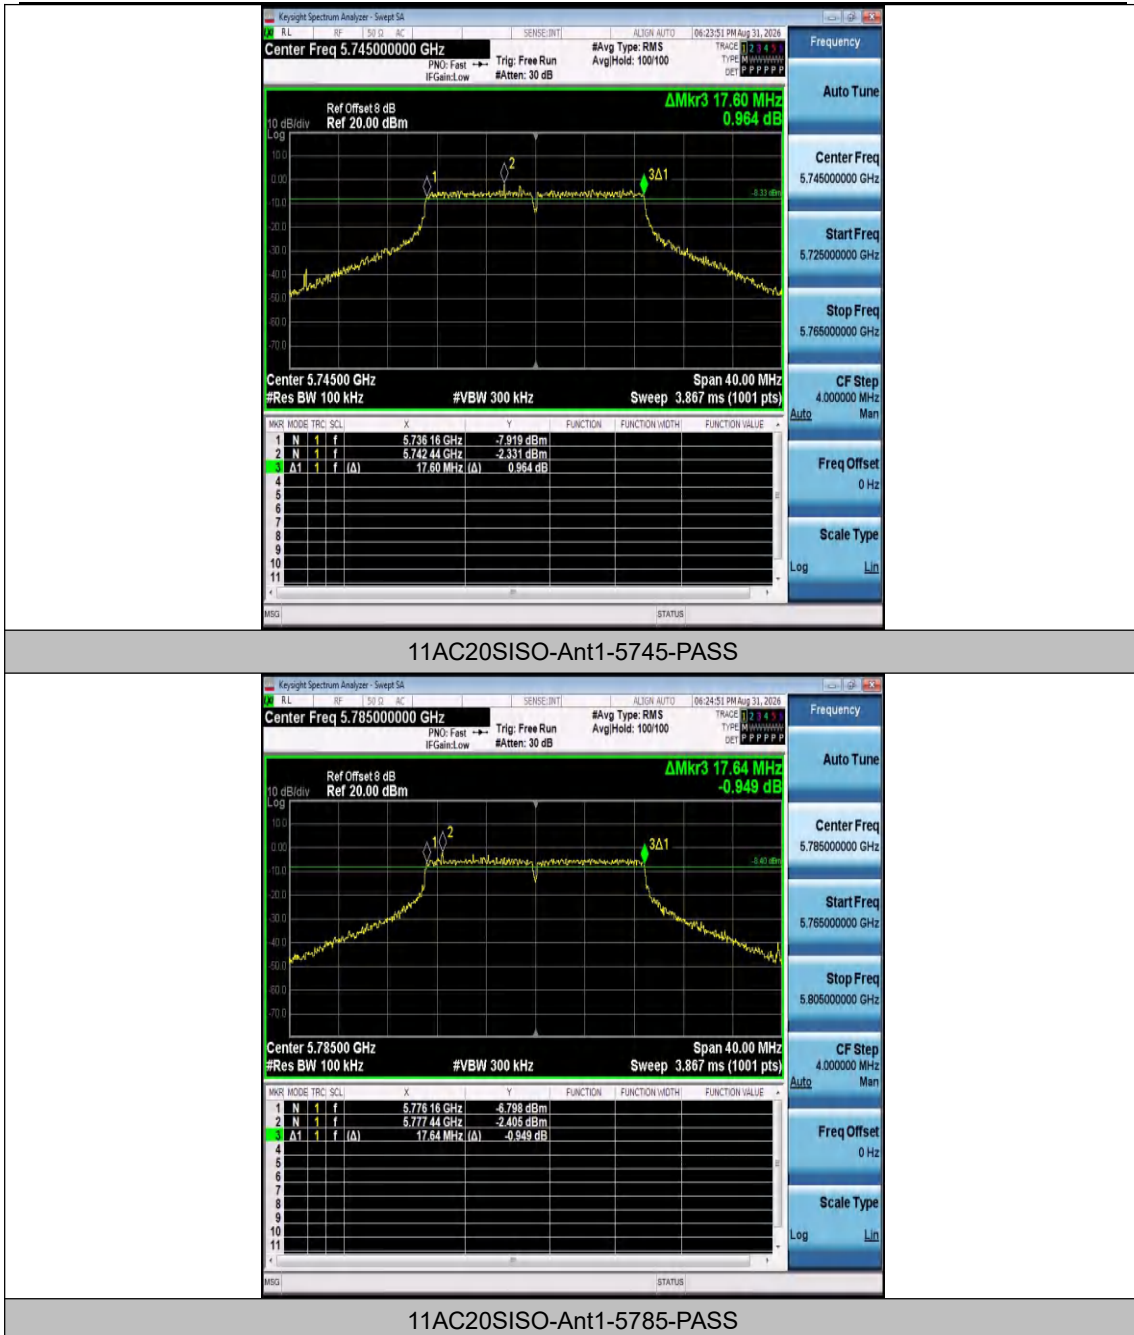

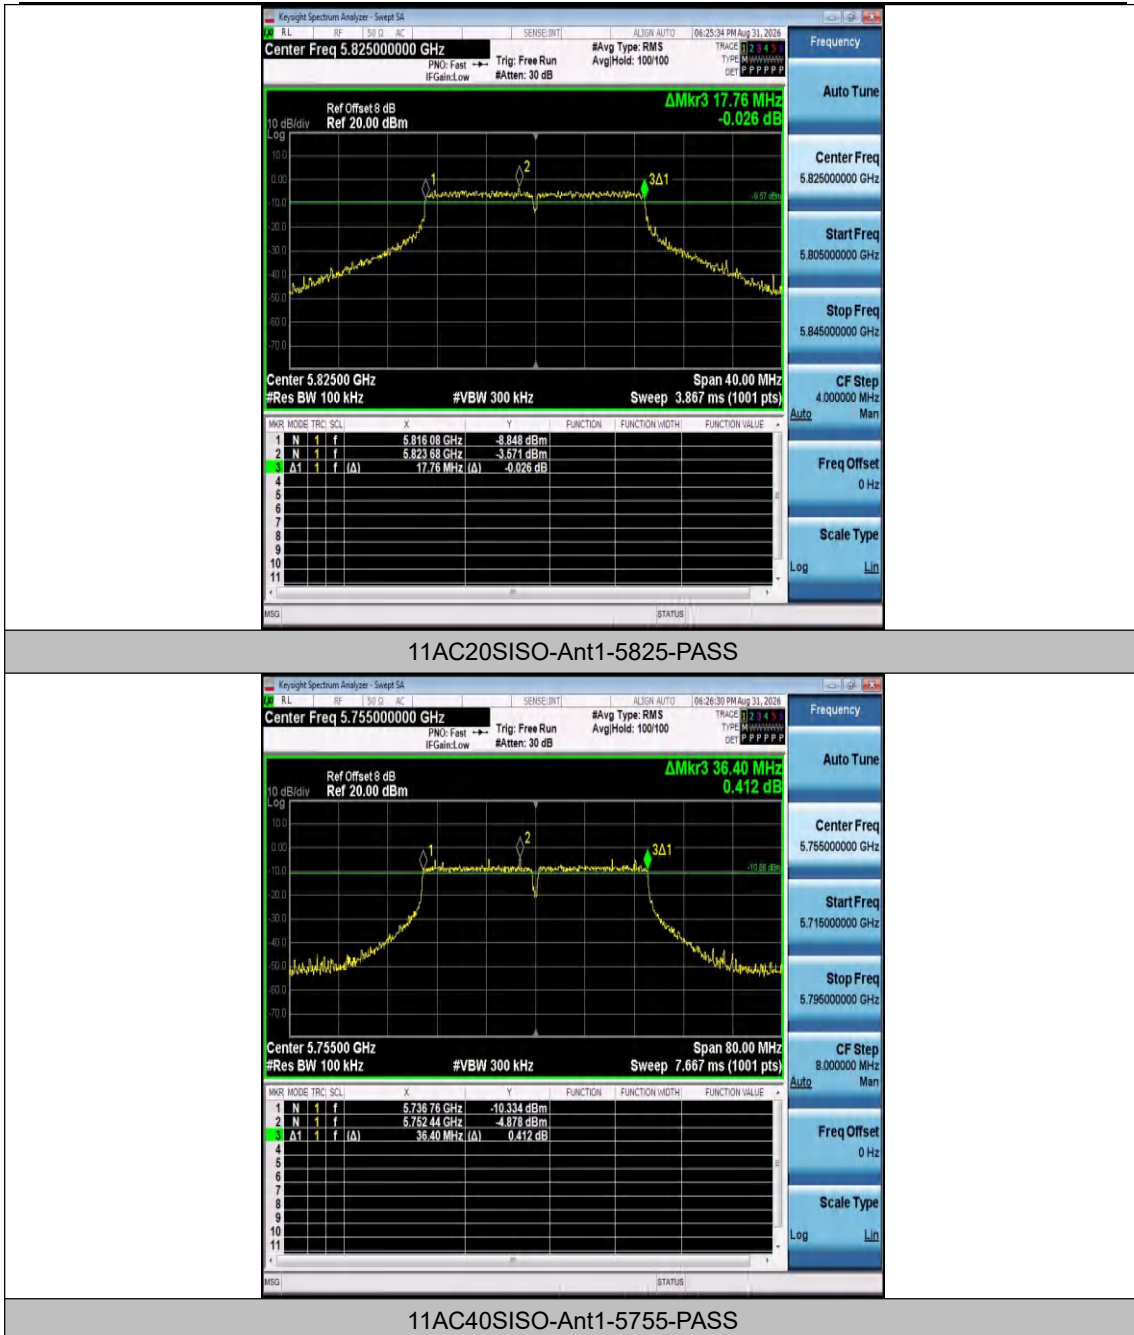

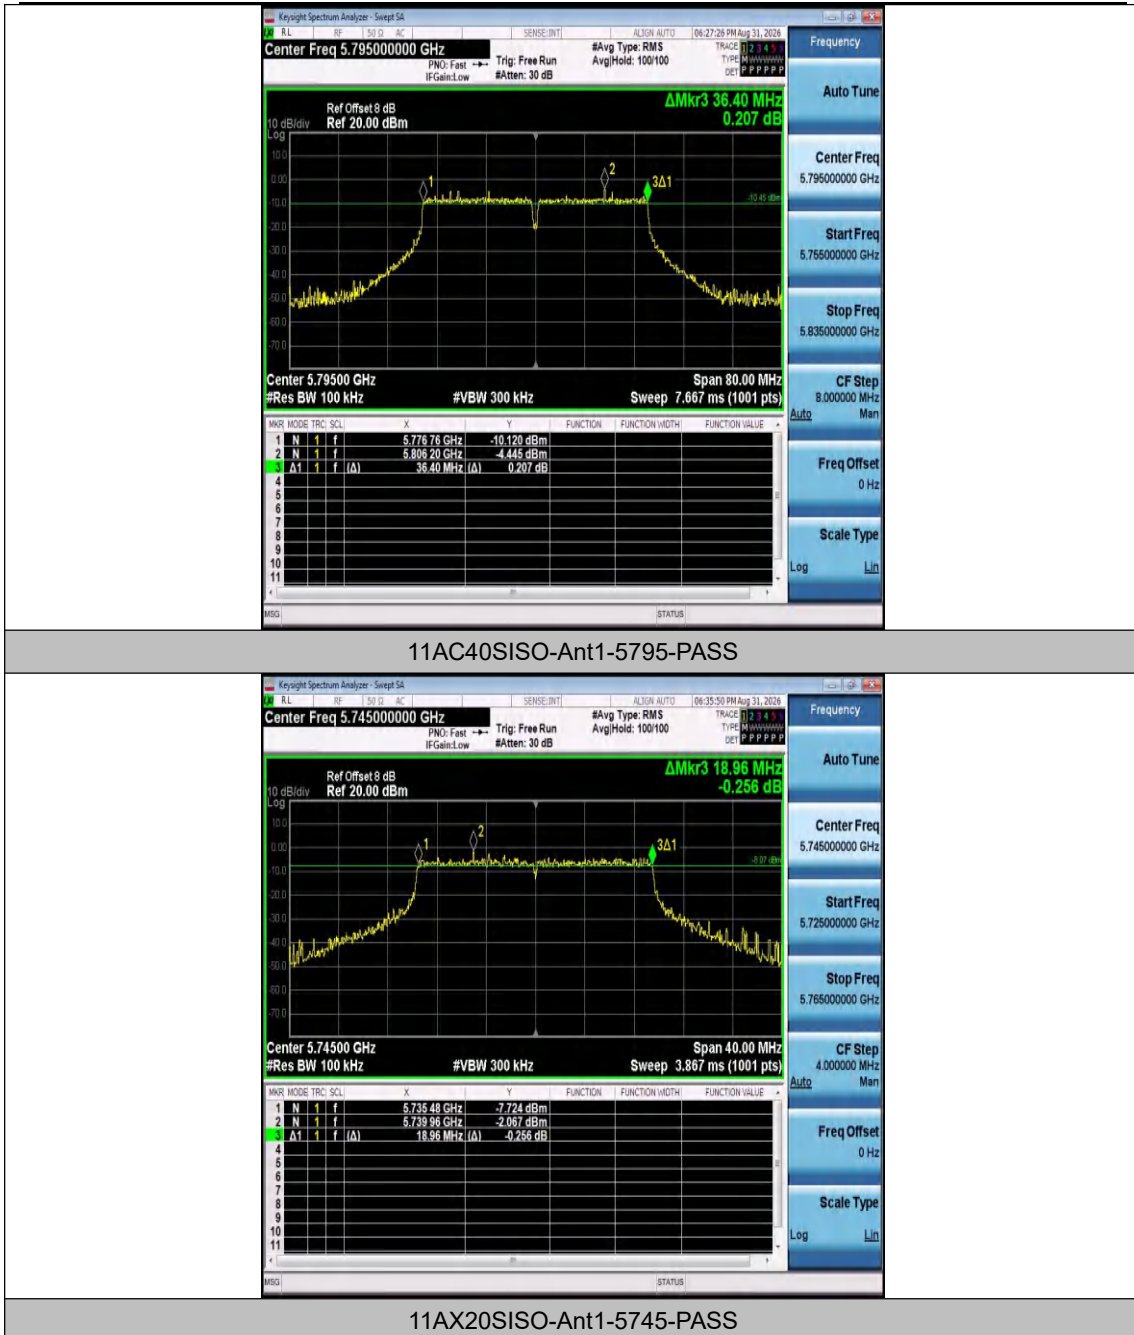

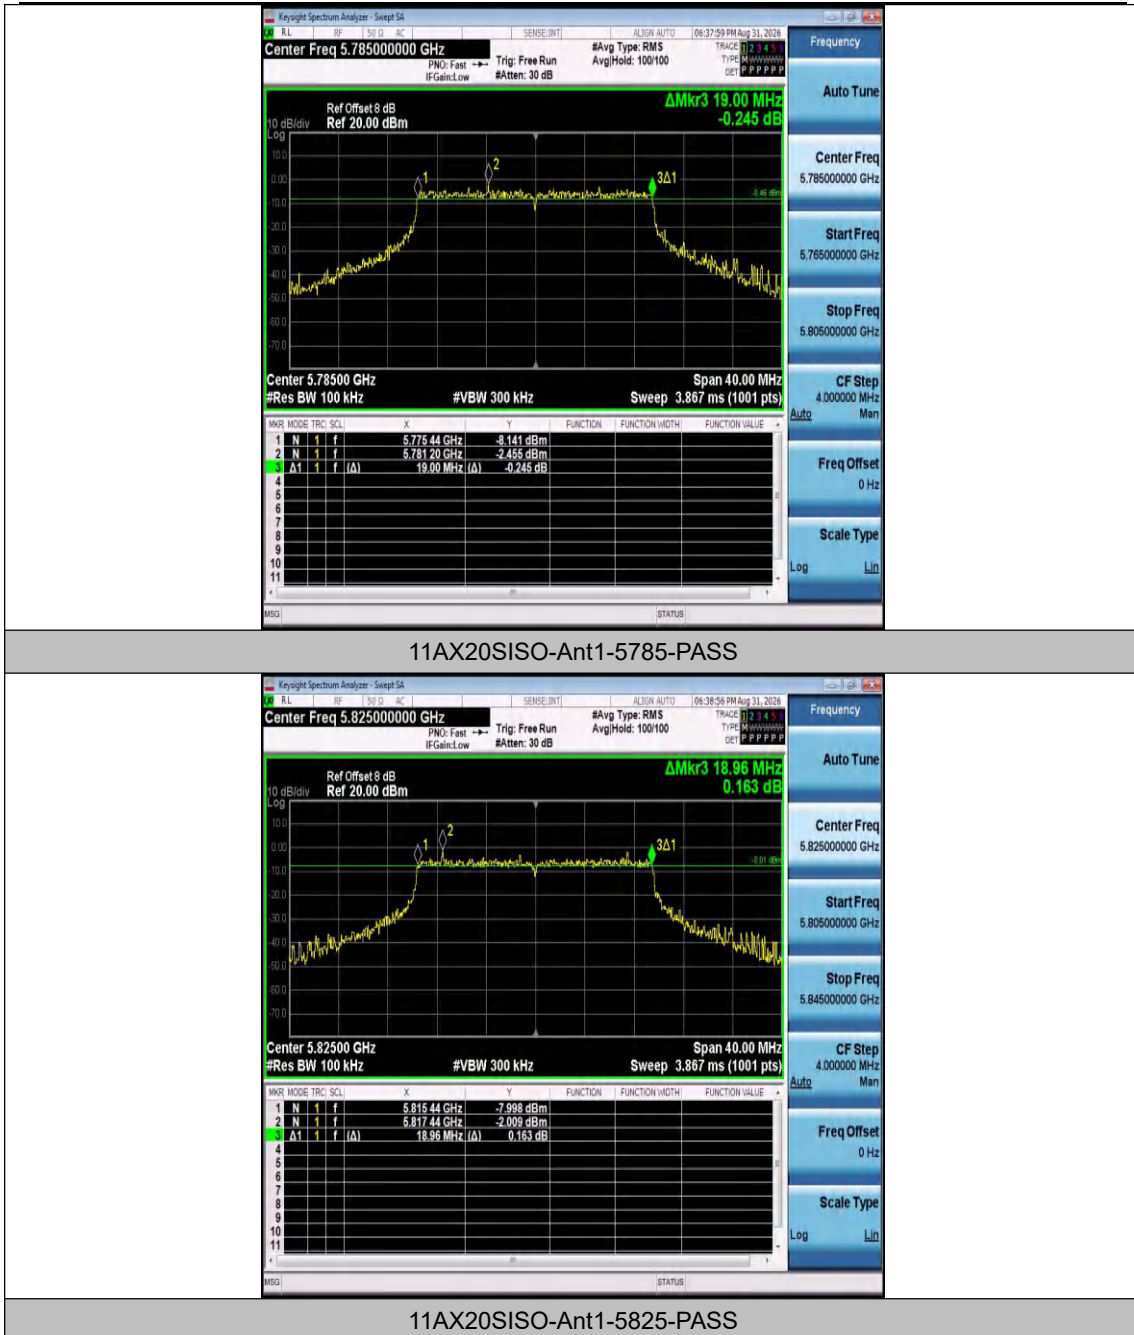

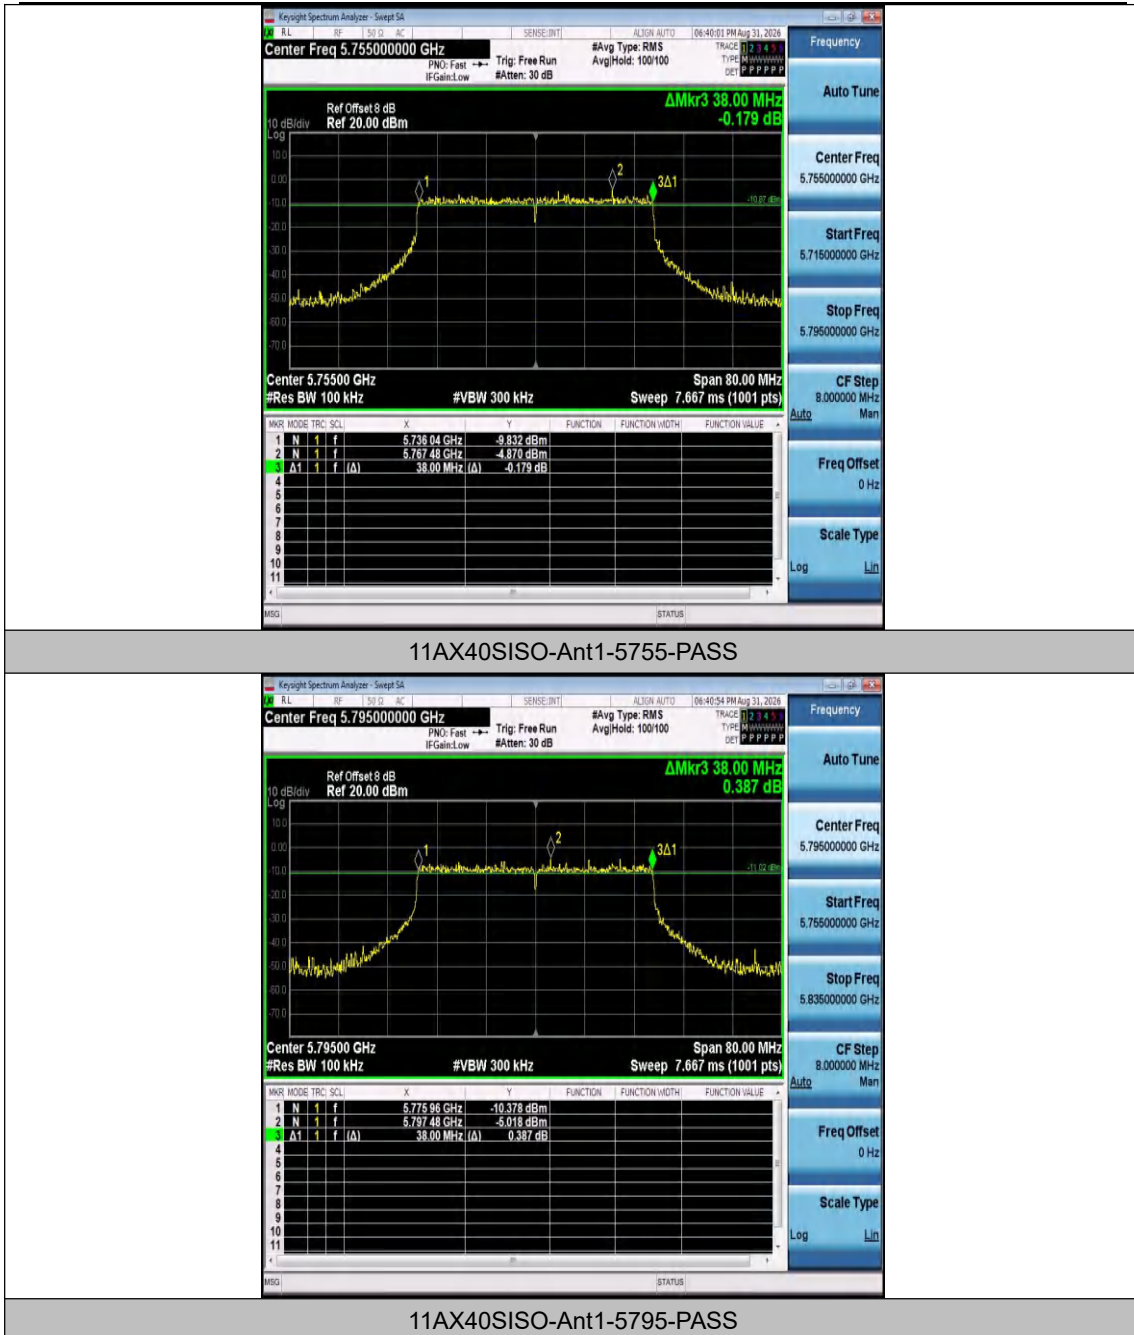


Appendix B: Duty Cycle

Test Result

Test Mode	Antenna	Frequency [MHz]	Transmission Duration [ms]	Transmission Period [ms]	Duty Cycle [%]	Dc Factor [dB]	1/T
11A	Ant1	5745	100.00	100.00	100.00	0.00	0.01
11A	Ant1	5785	100.00	100.00	100.00	0.00	0.01
11A	Ant1	5825	100.00	100.00	100.00	0.00	0.01
11N20SISO	Ant1	5745	100.00	100.00	100.00	0.00	0.01
11N20SISO	Ant1	5785	100.00	100.00	100.00	0.00	0.01
11N20SISO	Ant1	5825	100.00	100.00	100.00	0.00	0.01
11N40SISO	Ant1	5755	100.00	100.00	100.00	0.00	0.01
11N40SISO	Ant1	5795	100.00	100.00	100.00	0.00	0.01
11AC20SISO	Ant1	5745	100.00	100.00	100.00	0.00	0.01
11AC20SISO	Ant1	5785	100.00	100.00	100.00	0.00	0.01
11AC20SISO	Ant1	5825	100.00	100.00	100.00	0.00	0.01
11AC40SISO	Ant1	5755	100.00	100.00	100.00	0.00	0.01
11AC40SISO	Ant1	5795	100.00	100.00	100.00	0.00	0.01
11AX20SISO	Ant1	5745	100.00	100.00	100.00	0.00	0.01
11AX20SISO	Ant1	5785	100.00	100.00	100.00	0.00	0.01
11AX20SISO	Ant1	5825	100.00	100.00	100.00	0.00	0.01
11AX40SISO	Ant1	5755	100.00	100.00	100.00	0.00	0.01
11AX40SISO	Ant1	5795	100.00	100.00	100.00	0.00	0.01
11AX80SISO	Ant1	5775	100.00	100.00	100.00	0.00	0.01


Test Graphs

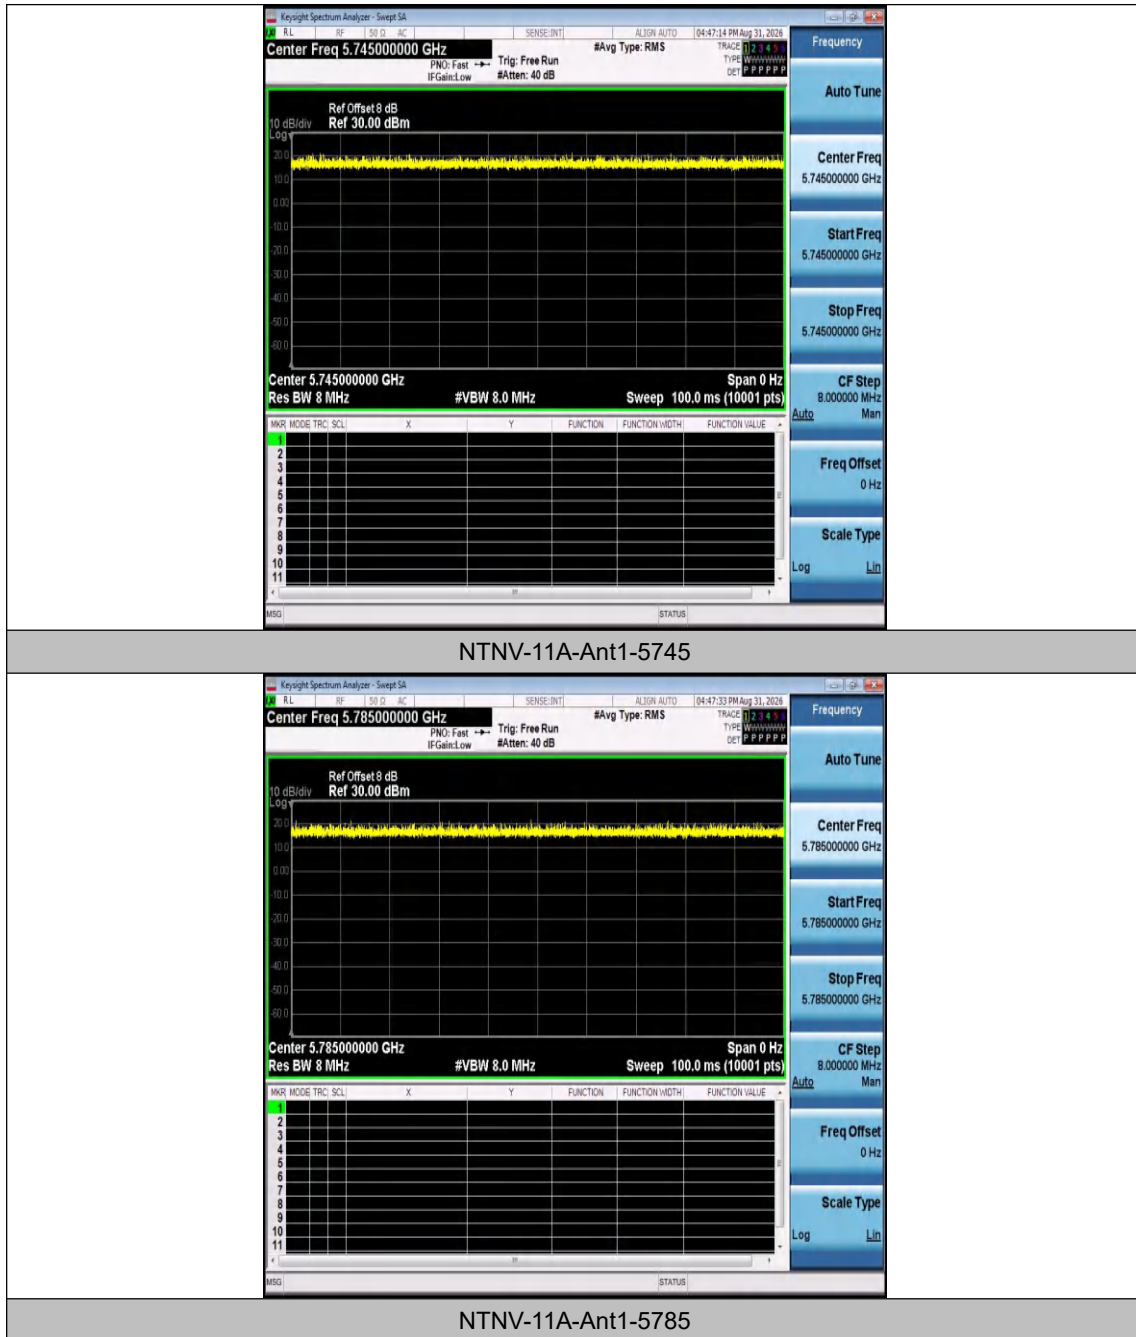

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

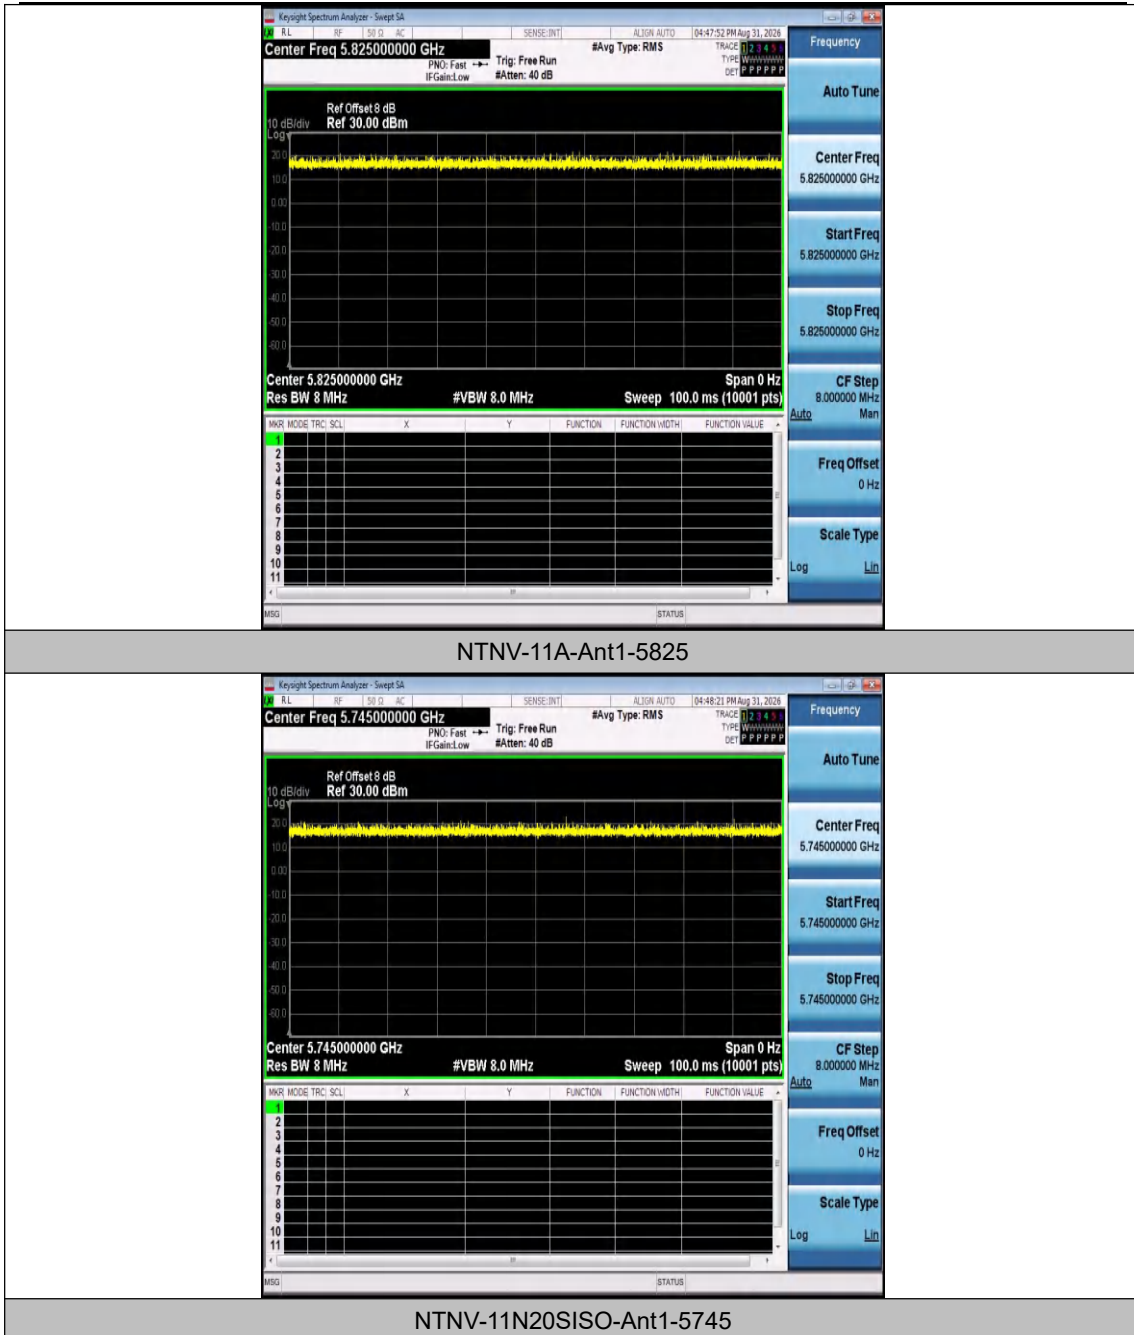

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

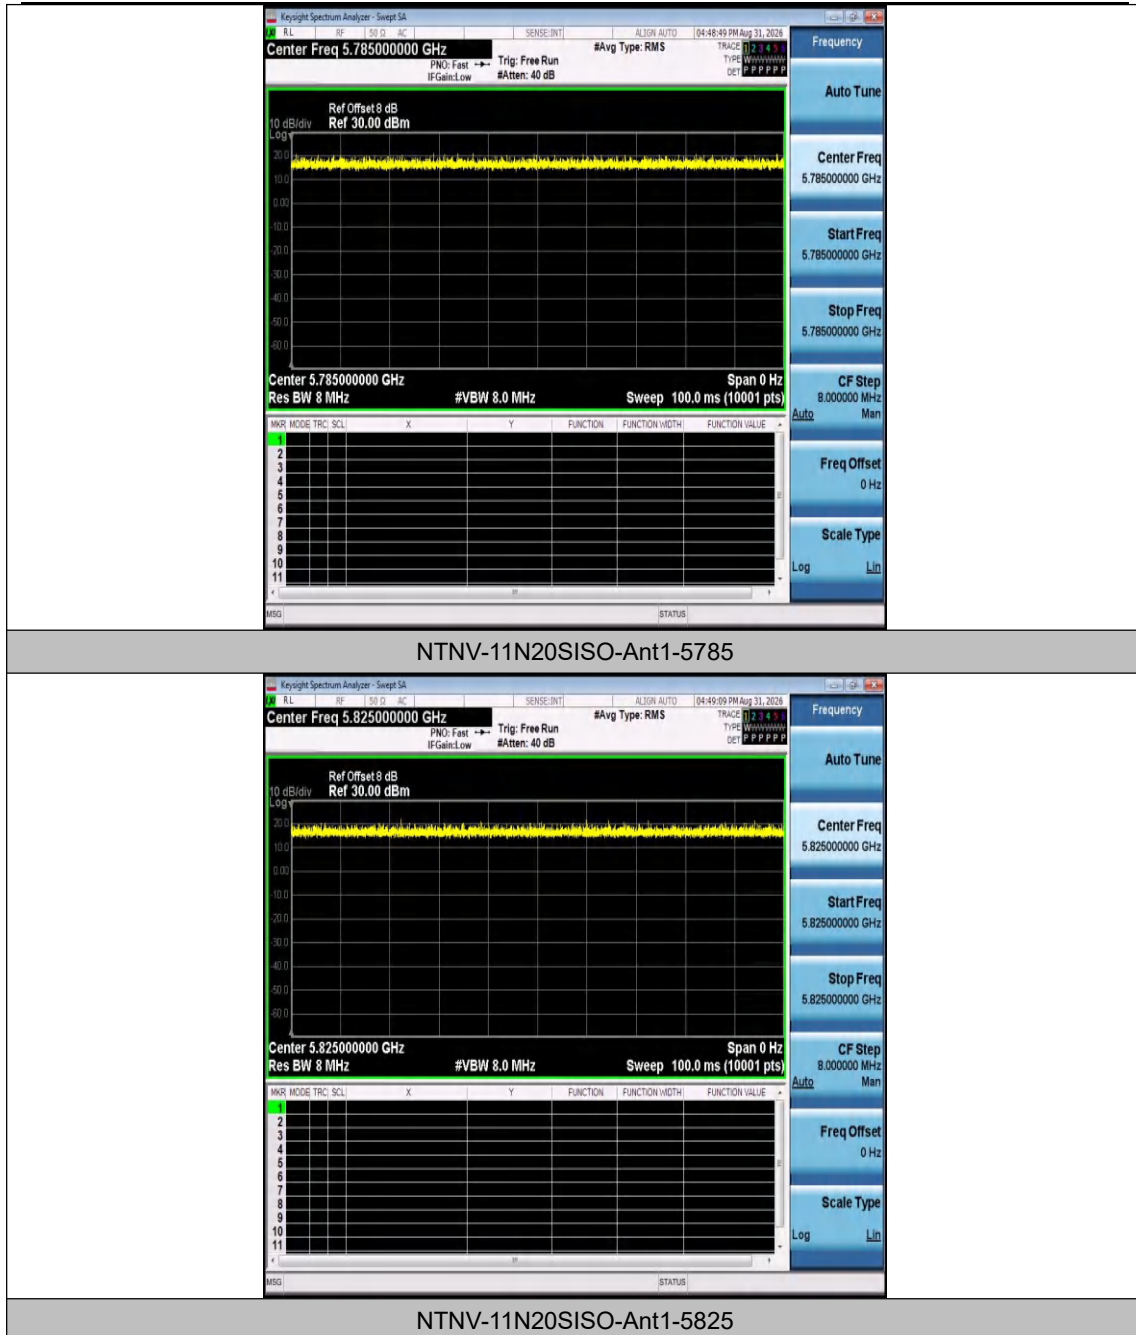

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

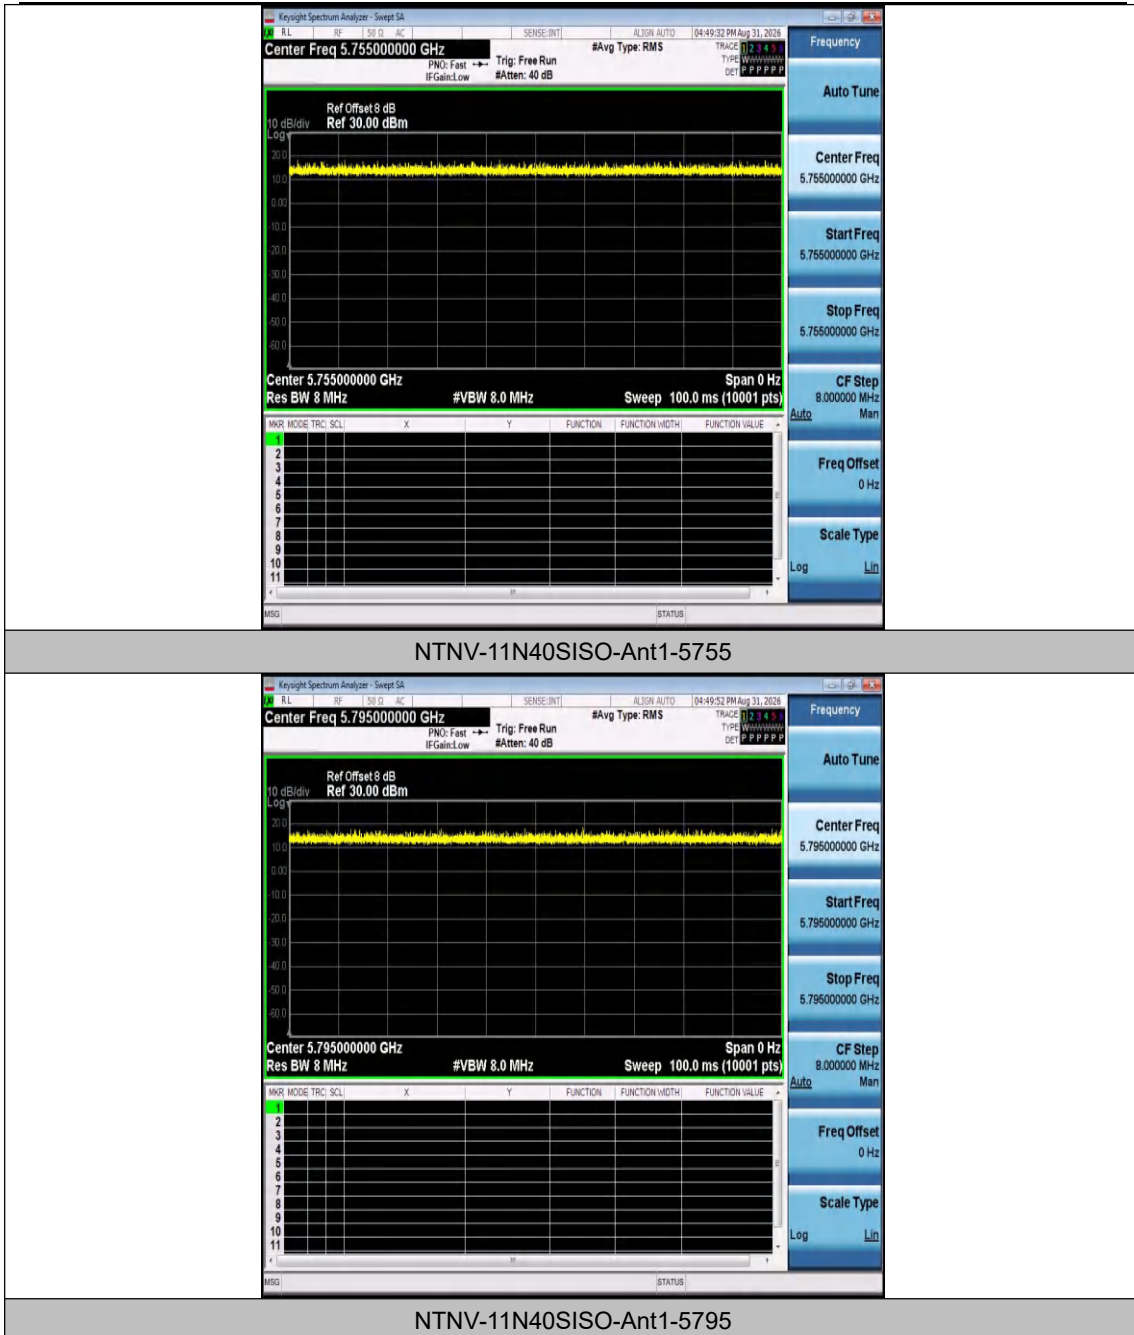

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

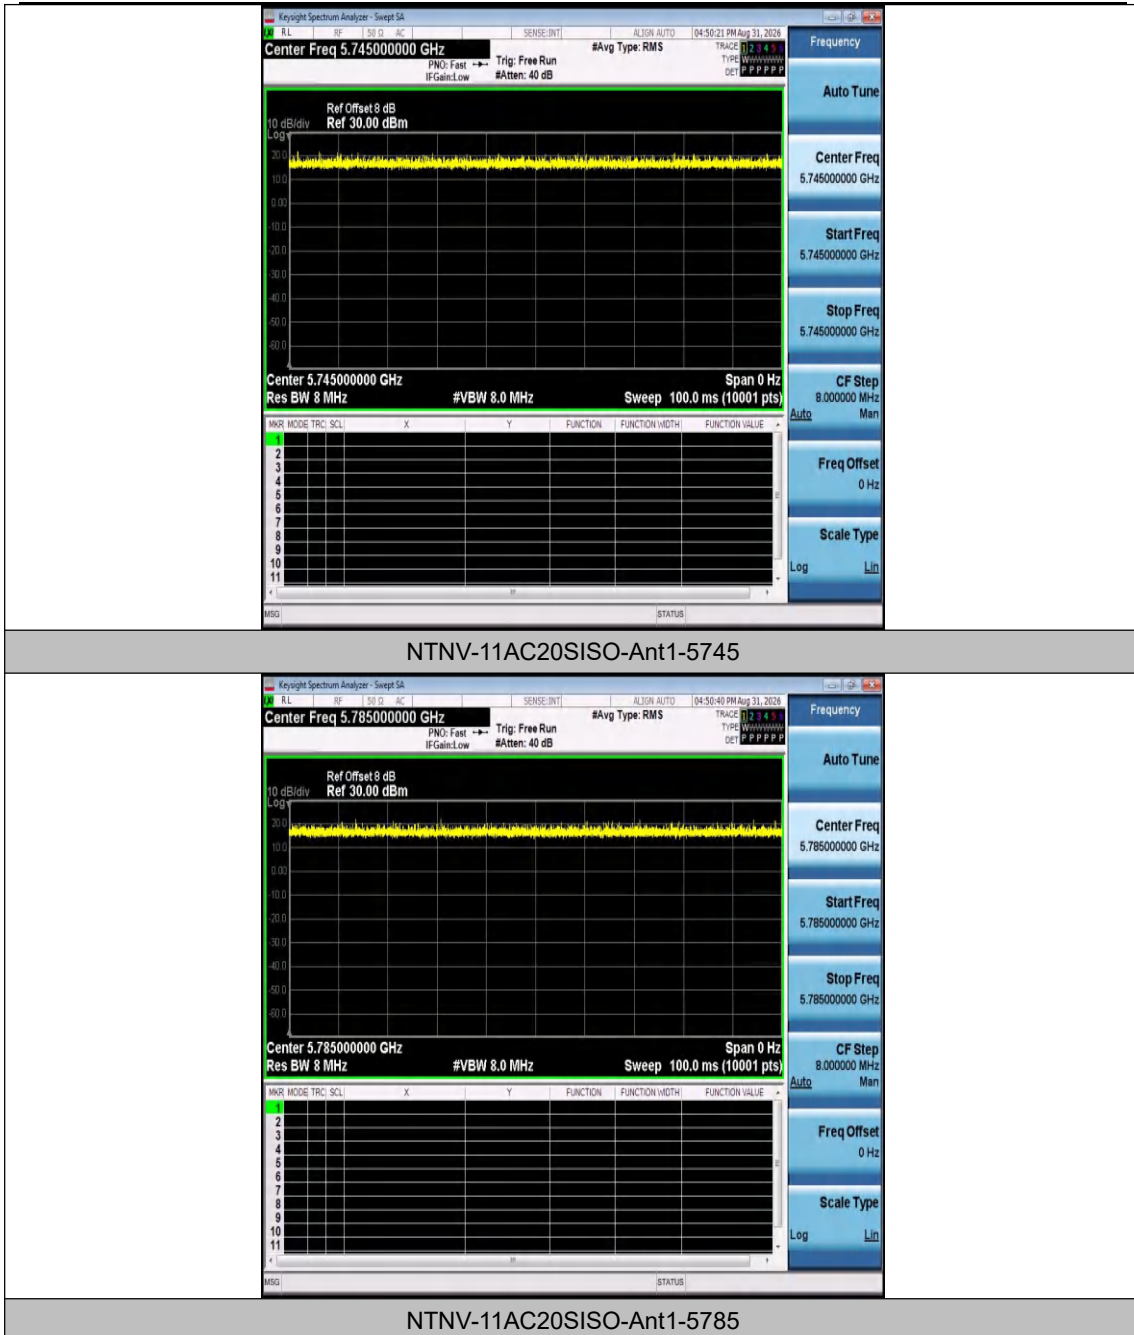

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

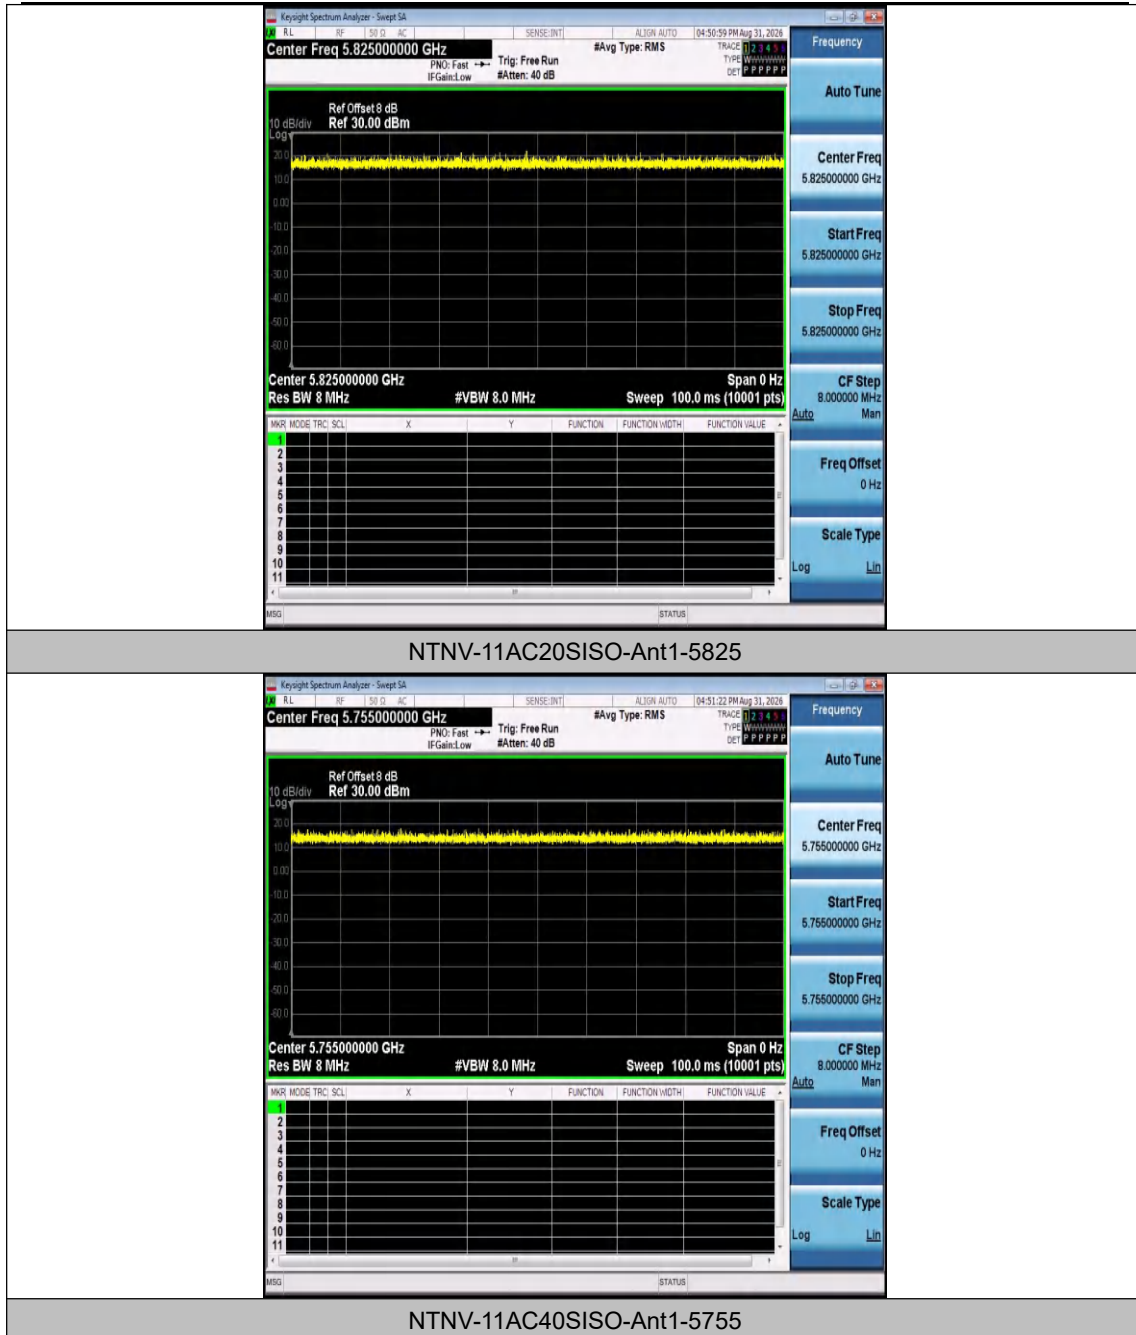

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

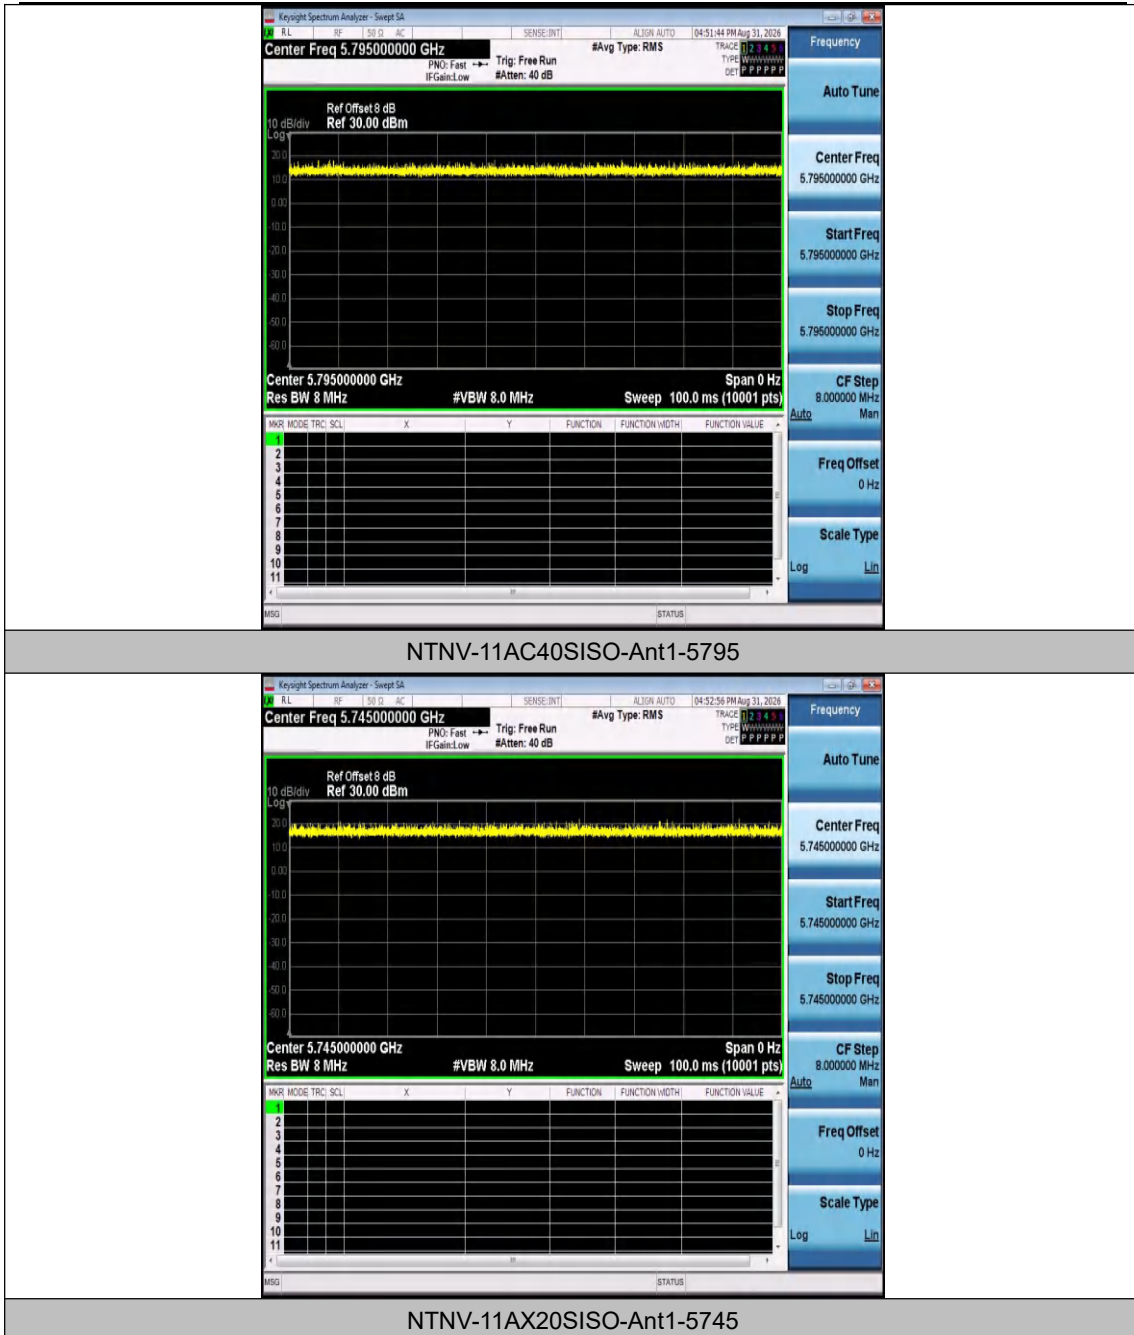


Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

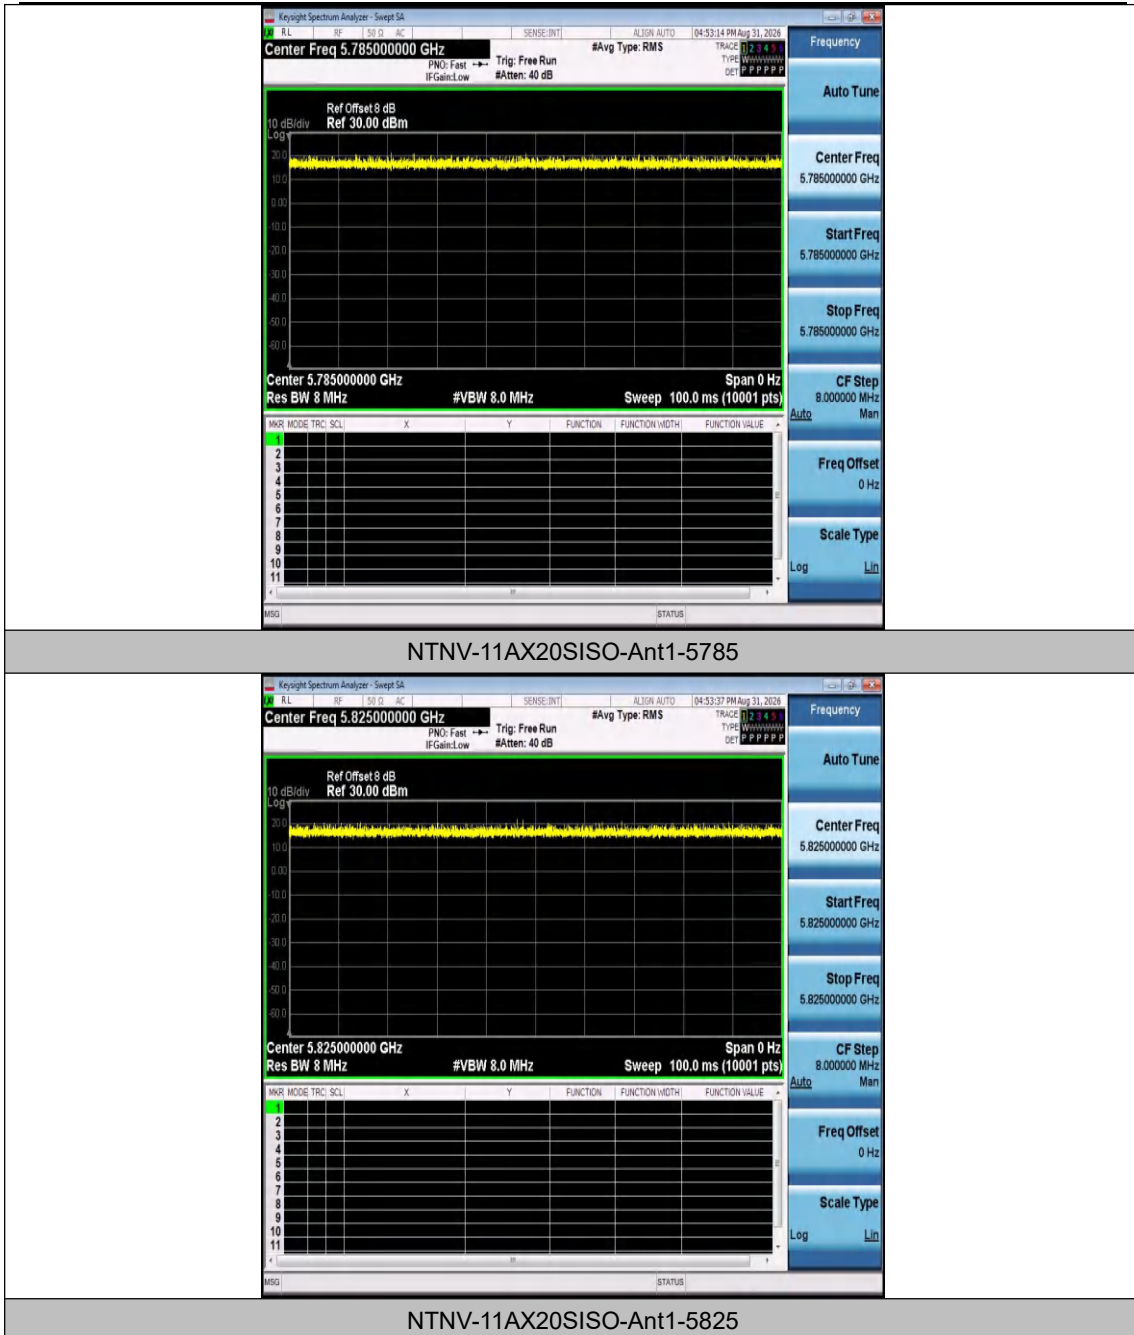

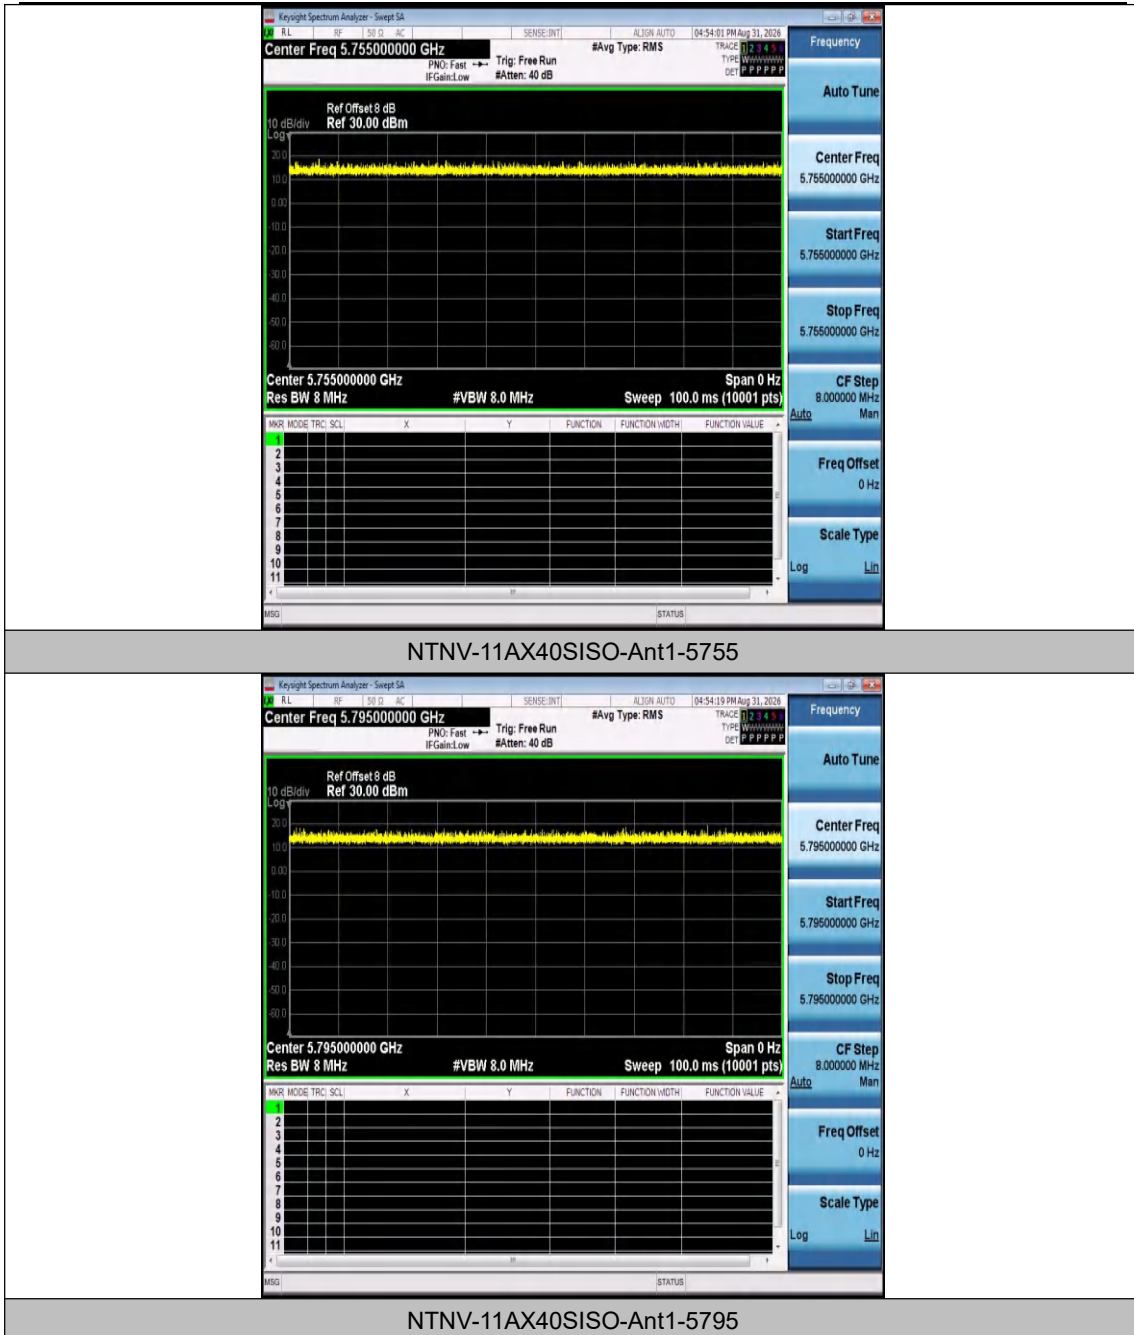

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

Appendix C: Maximum Conducted Output Power

Test Result Channel Power

Test Mode	Antenna	Frequency[MHz]	Result [dBm]	Limit [dBm]	Verdict
11A	Ant1	5745	14.39	≤30.00	PASS
11A	Ant1	5785	14.50	≤30.00	PASS
11A	Ant1	5825	14.29	≤30.00	PASS
11N20SISO	Ant1	5745	14.42	≤30.00	PASS
11N20SISO	Ant1	5785	14.55	≤30.00	PASS
11N20SISO	Ant1	5825	14.29	≤30.00	PASS
11N40SISO	Ant1	5755	14.47	≤30.00	PASS
11N40SISO	Ant1	5795	14.50	≤30.00	PASS
11AC20SISO	Ant1	5745	14.33	≤30.00	PASS
11AC20SISO	Ant1	5785	14.51	≤30.00	PASS
11AC20SISO	Ant1	5825	14.26	≤30.00	PASS
11AC40SISO	Ant1	5755	14.53	≤30.00	PASS
11AC40SISO	Ant1	5795	14.41	≤30.00	PASS
11AX20SISO	Ant1	5745	14.96	≤30.00	PASS
11AX20SISO	Ant1	5785	15.21	≤30.00	PASS
11AX20SISO	Ant1	5825	14.95	≤30.00	PASS
11AX40SISO	Ant1	5755	15.11	≤30.00	PASS
11AX40SISO	Ant1	5795	15.04	≤30.00	PASS

Note: 1.The cable loss are compensated in the graph.

Test Graphs Channel Power




Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com




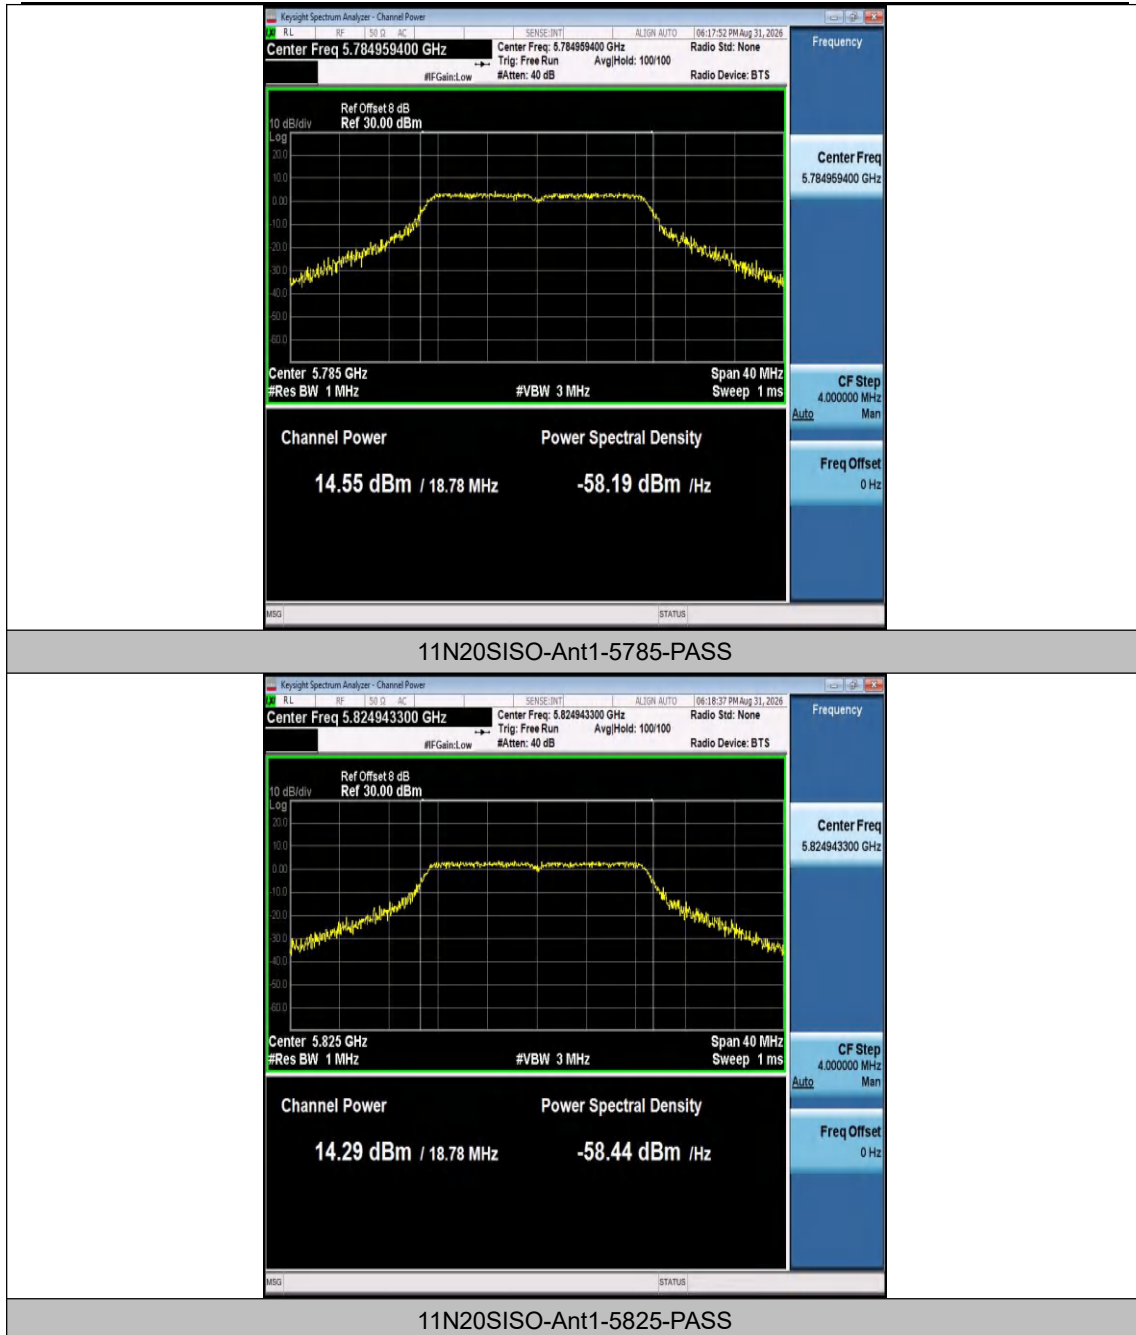


Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

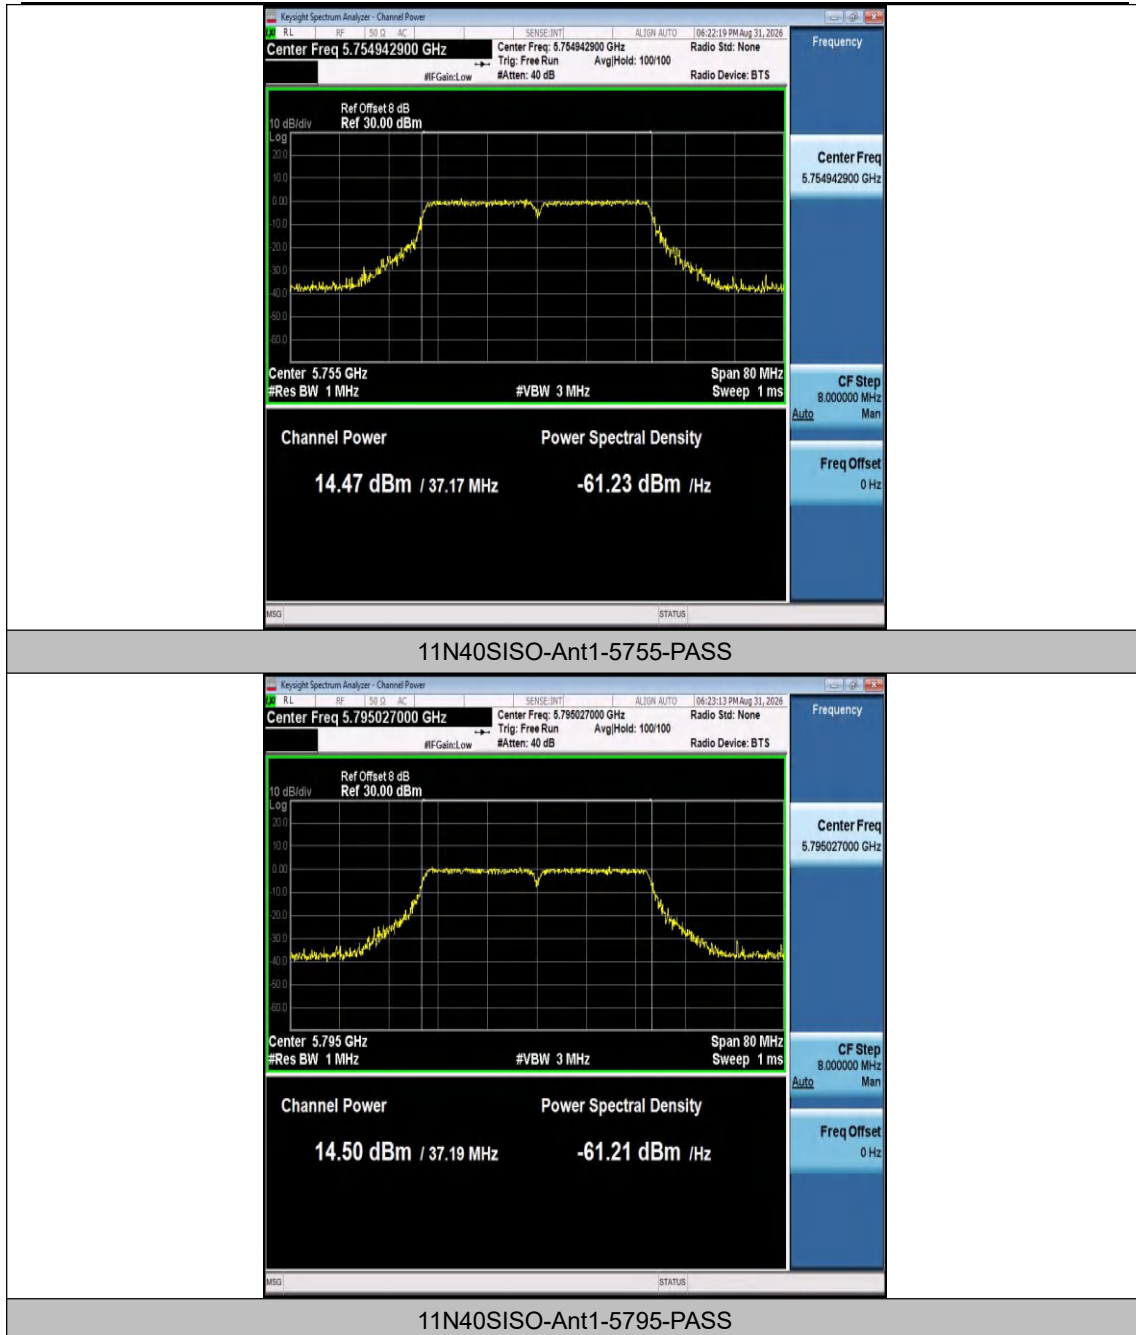


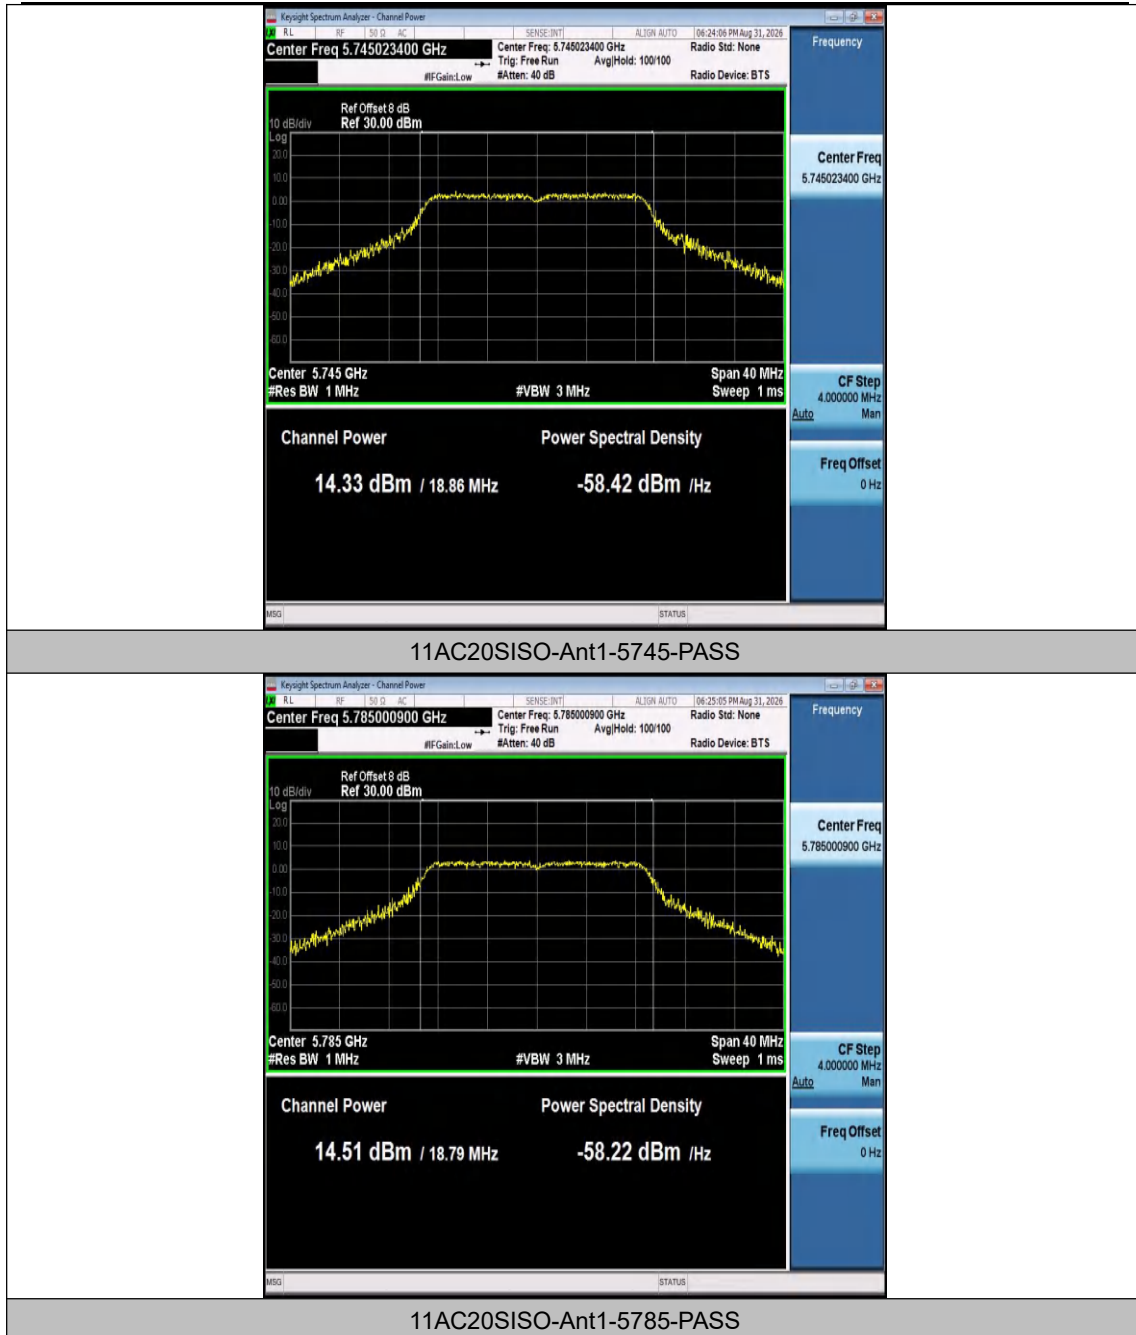

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

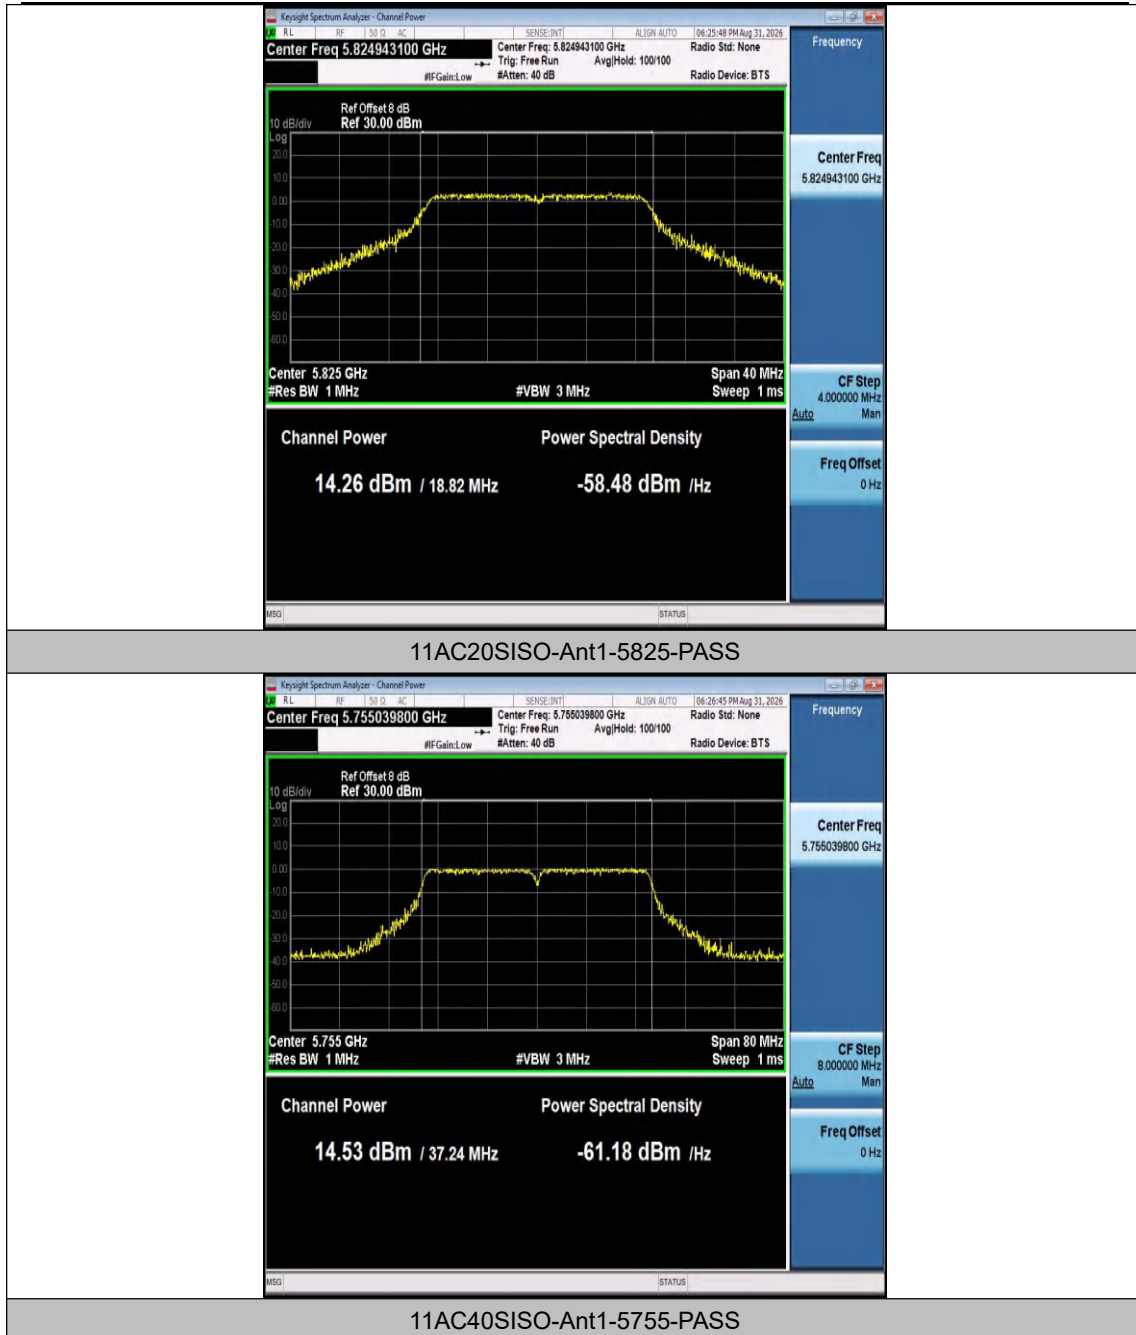

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

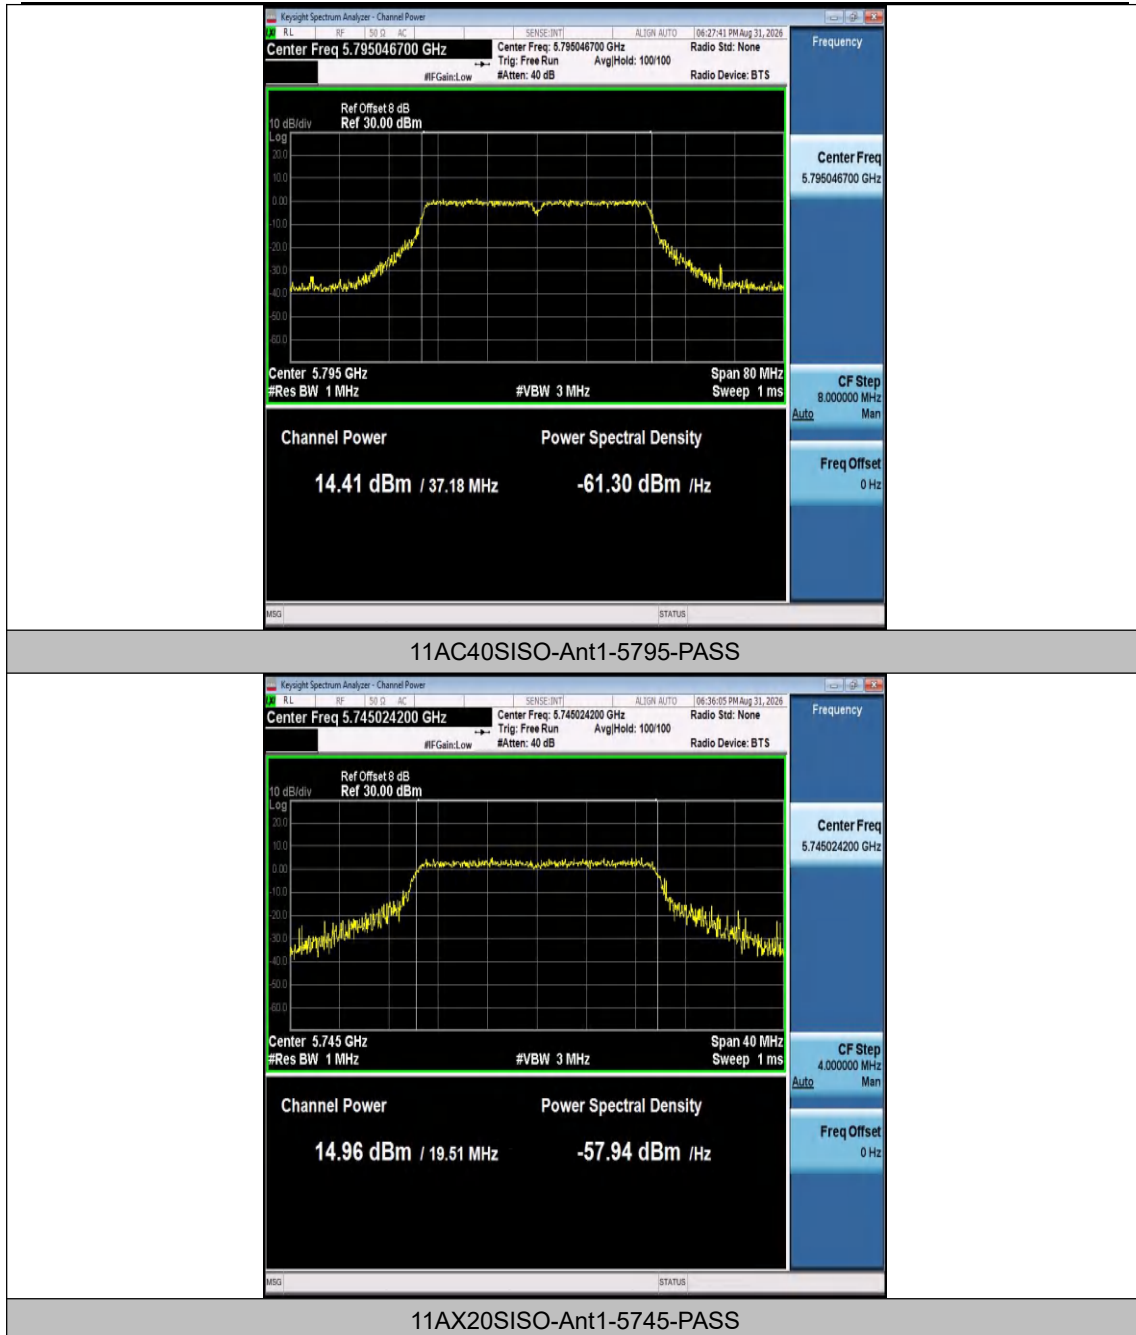

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

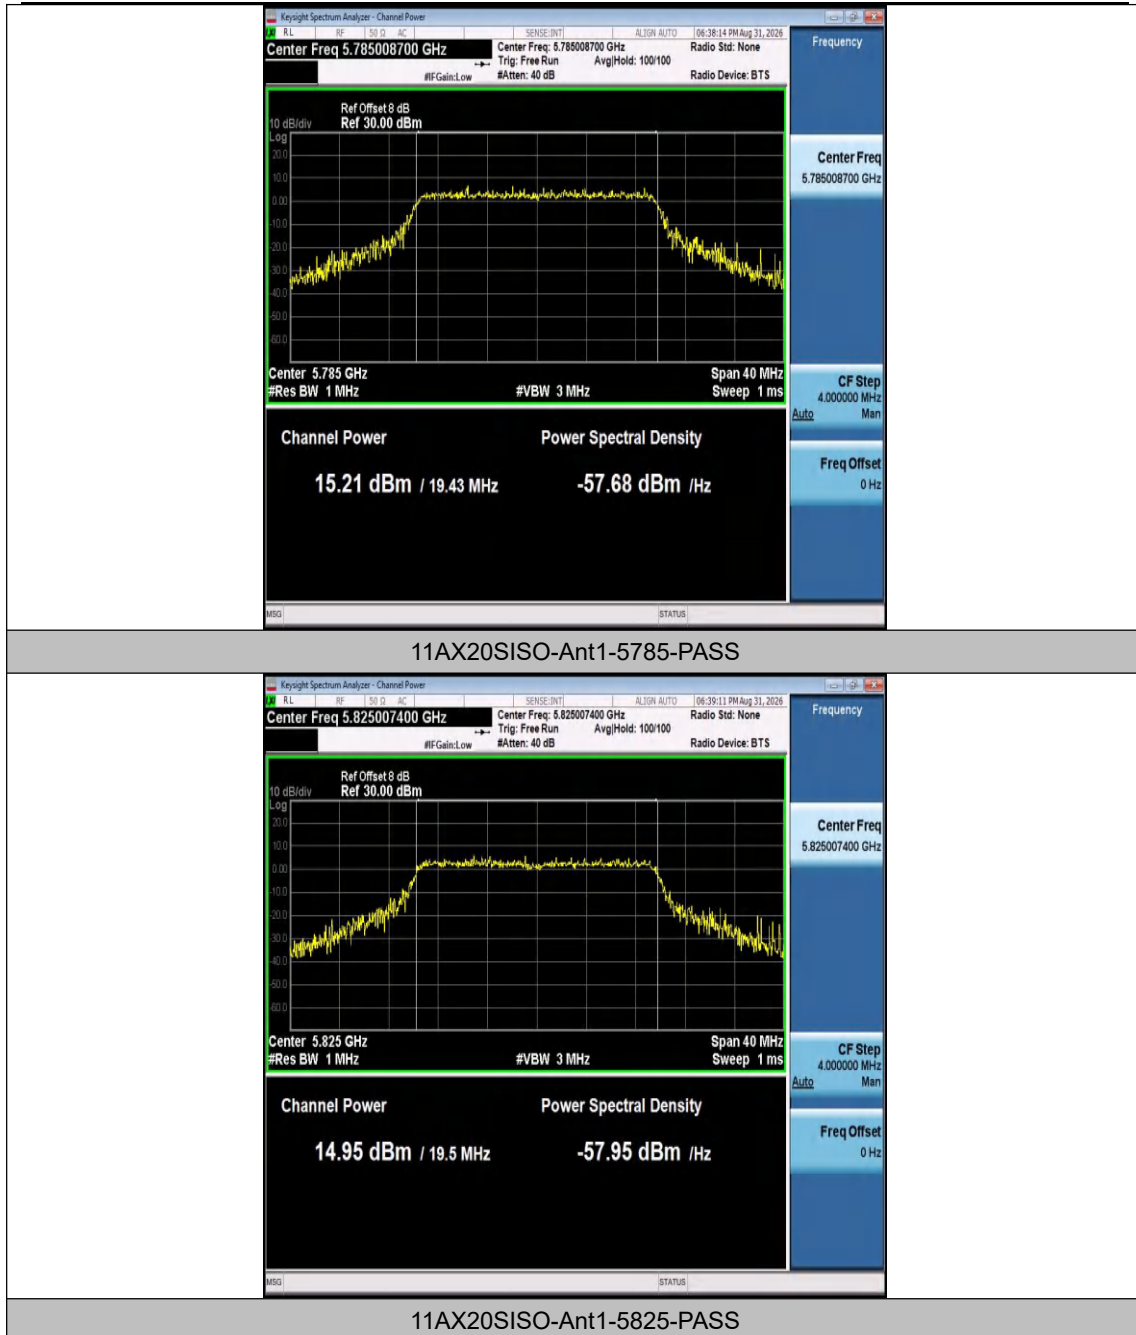

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

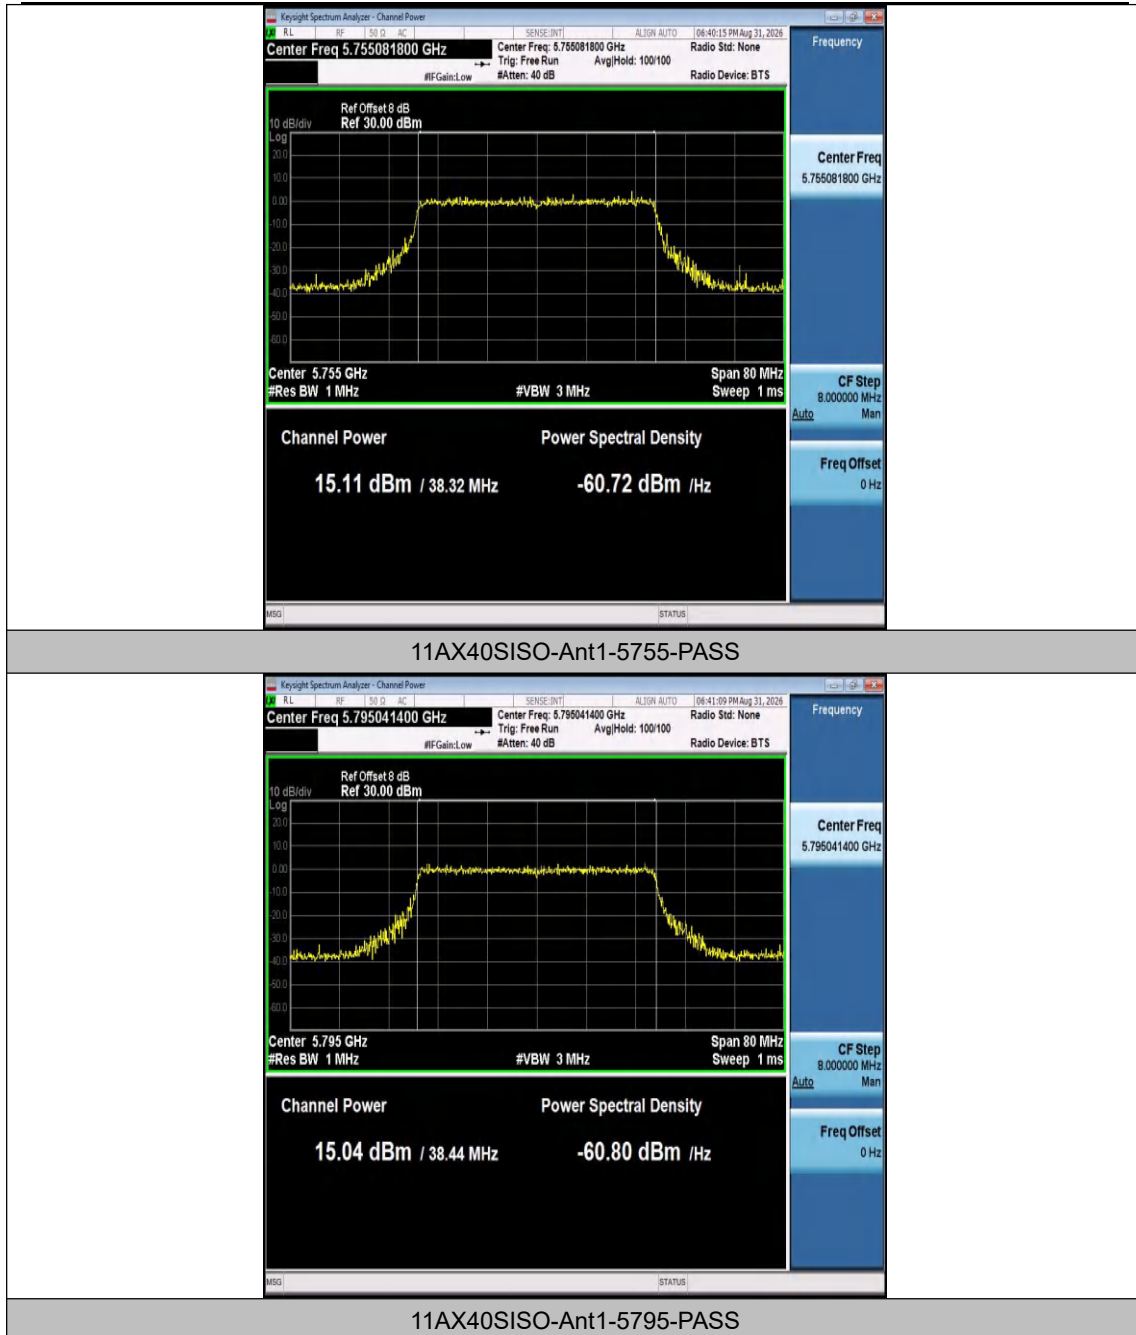

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

Appendix D: Maximum Power Spectral Density


Test Result B4

Test Mode	Antenna	Frequency [MHz]	Reading Result [dBm/510KHz]	Result [dBm/500KHz]	Limit [dBm/500KHz]	Verdict
11A	Ant1	5745	-4.23	-4.32	≤30.00	PASS
11A	Ant1	5785	-4.00	-4.09	≤30.00	PASS
11A	Ant1	5825	-4.60	-4.69	≤30.00	PASS
11N20SISO	Ant1	5745	-4.57	-4.66	≤30.00	PASS
11N20SISO	Ant1	5785	-4.51	-4.60	≤30.00	PASS
11N20SISO	Ant1	5825	-4.77	-4.86	≤30.00	PASS
11N40SISO	Ant1	5755	-7.72	-7.81	≤30.00	PASS
11N40SISO	Ant1	5795	-7.42	-7.51	≤30.00	PASS
11AC20SISO	Ant1	5745	-4.40	-4.49	≤30.00	PASS
11AC20SISO	Ant1	5785	-4.48	-4.57	≤30.00	PASS
11AC20SISO	Ant1	5825	-4.85	-4.94	≤30.00	PASS
11AC40SISO	Ant1	5755	-7.74	-7.83	≤30.00	PASS
11AC40SISO	Ant1	5795	-7.78	-7.87	≤30.00	PASS
11AX20SISO	Ant1	5745	-4.67	-4.76	≤30.00	PASS
11AX20SISO	Ant1	5785	-4.67	-4.76	≤30.00	PASS
11AX20SISO	Ant1	5825	-5.13	-5.22	≤30.00	PASS
11AX40SISO	Ant1	5755	-7.76	-7.85	≤30.00	PASS
11AX40SISO	Ant1	5795	-7.87	-7.96	≤30.00	PASS

Note:

- 1.The cable loss and RBW Factor are compensated in the graph.
- 2.Offset=cable loss + RBW Factor (-0.09dB)


Test GraphsB4

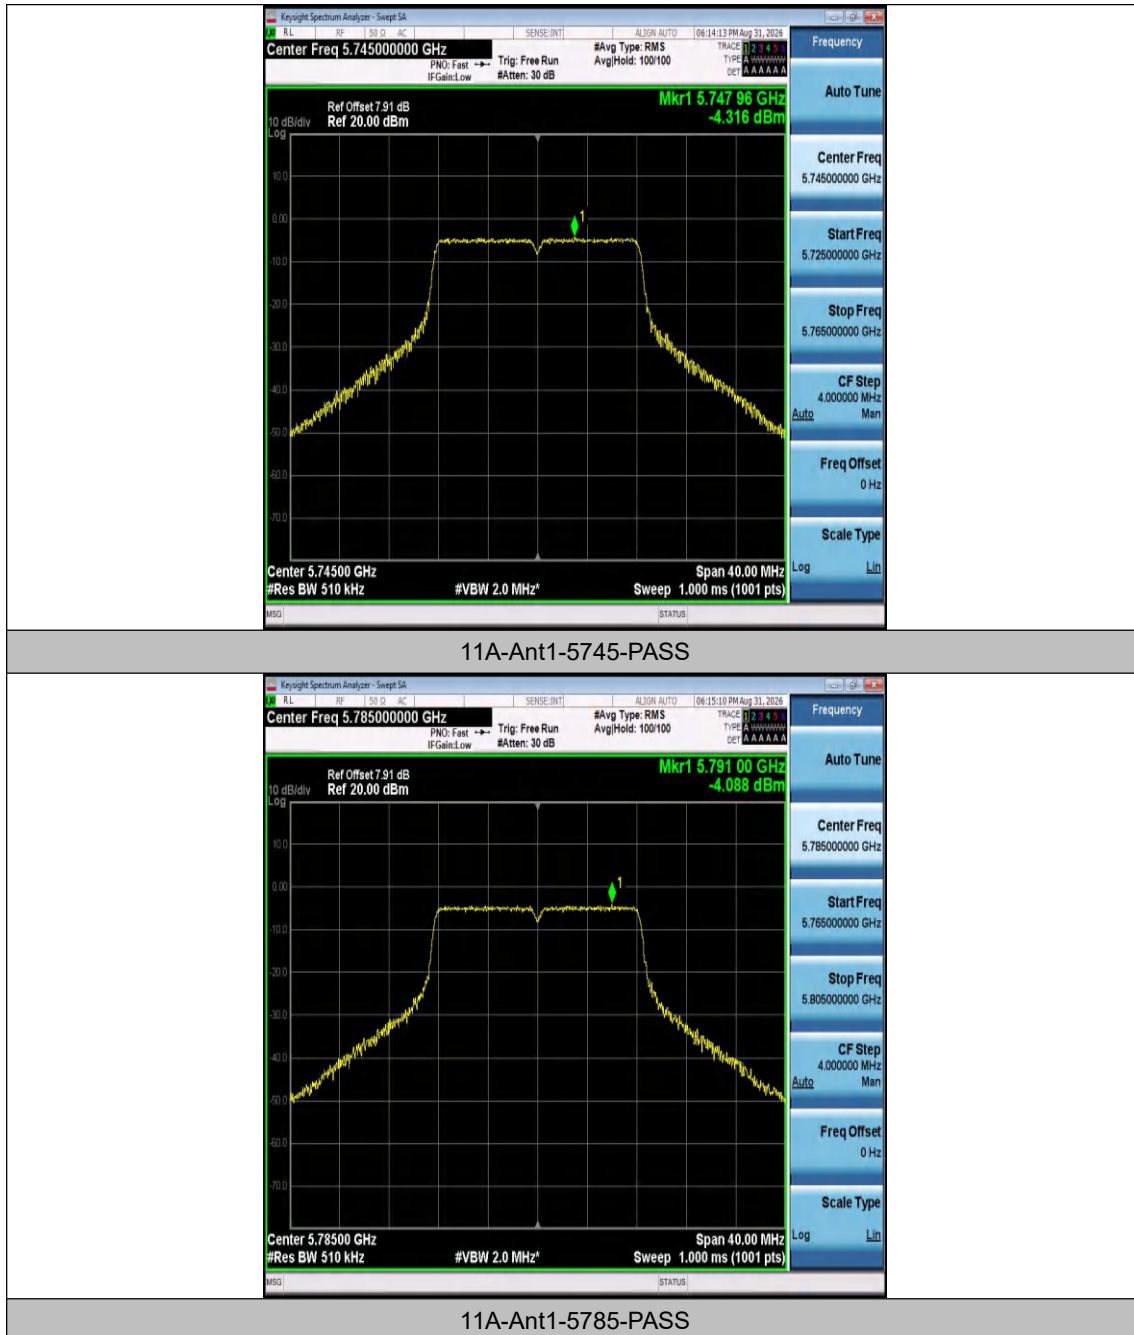

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

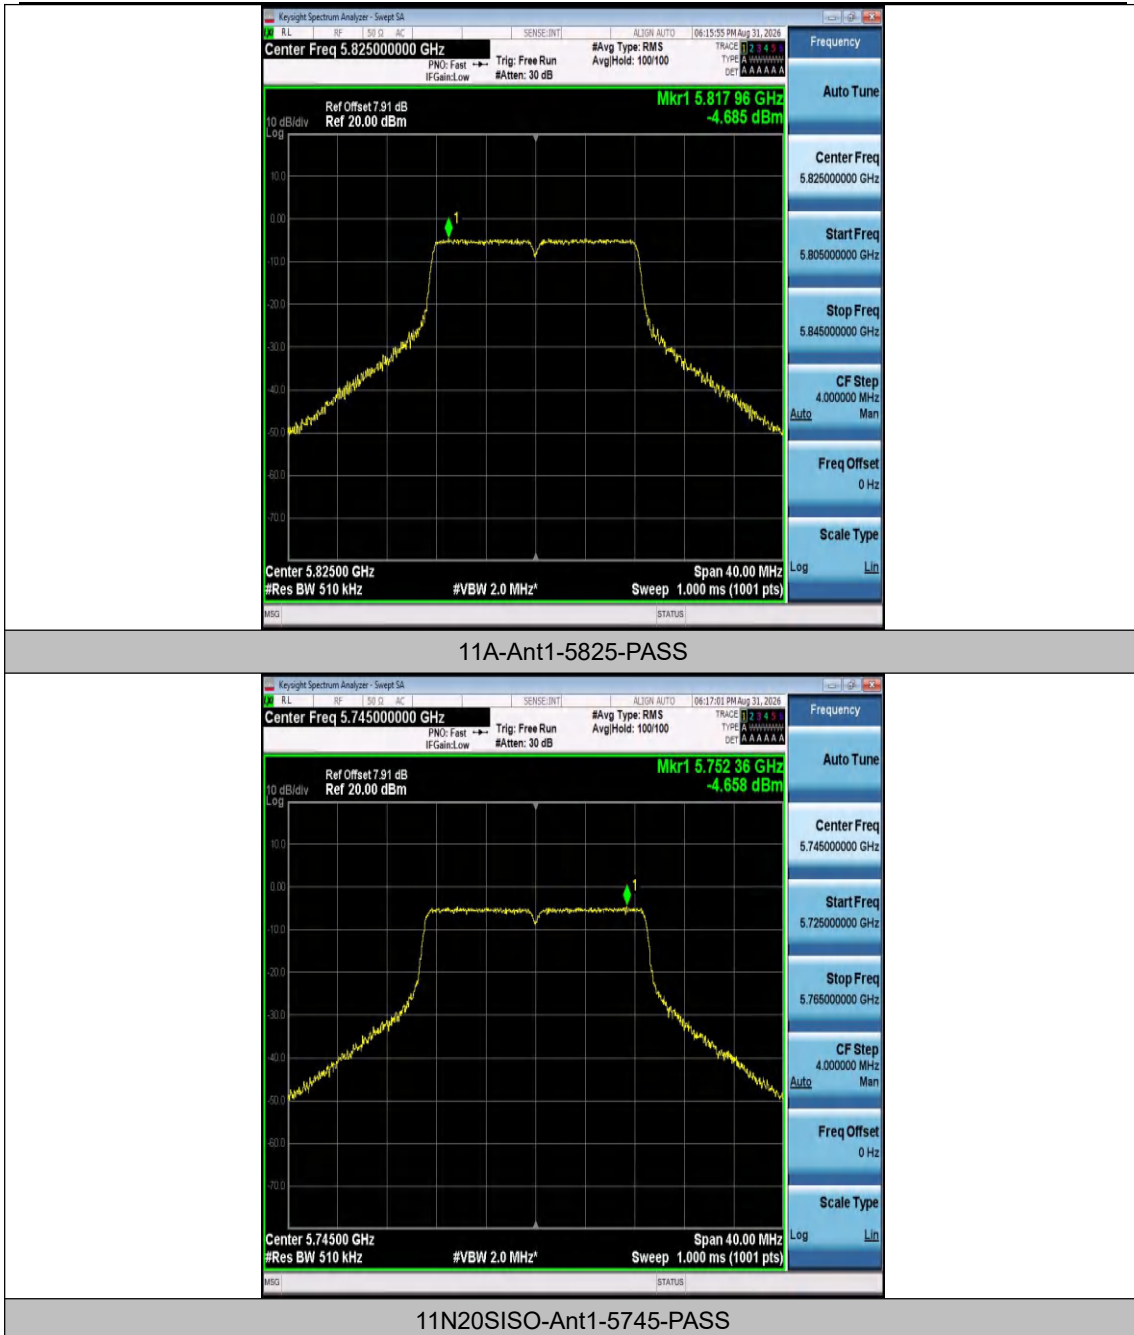

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

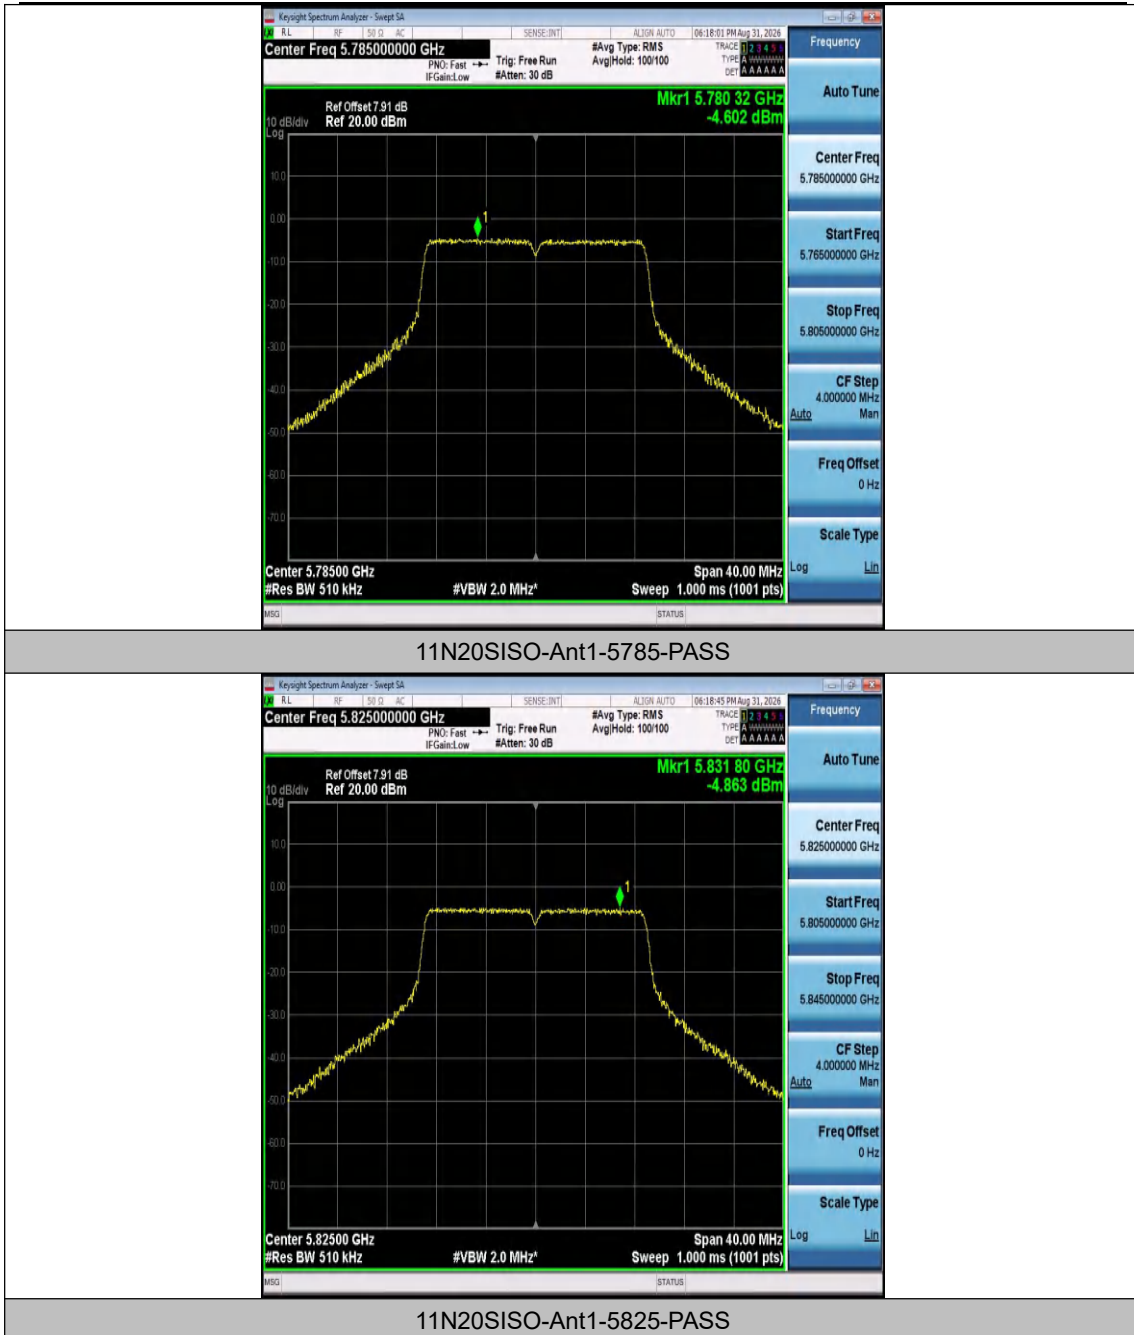

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

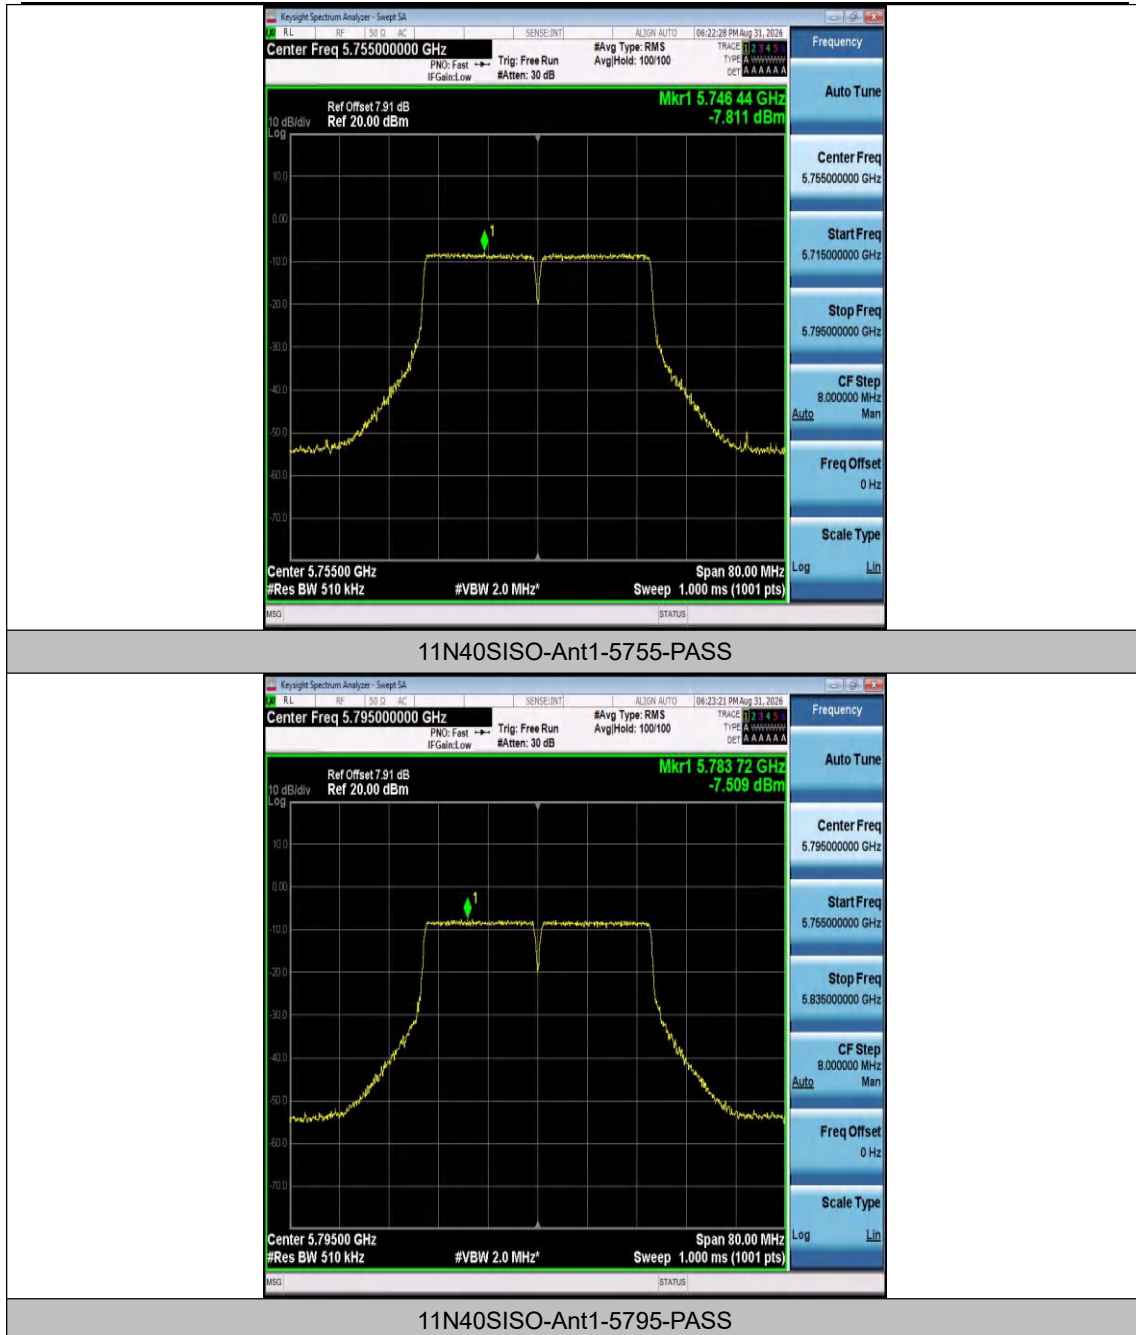

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

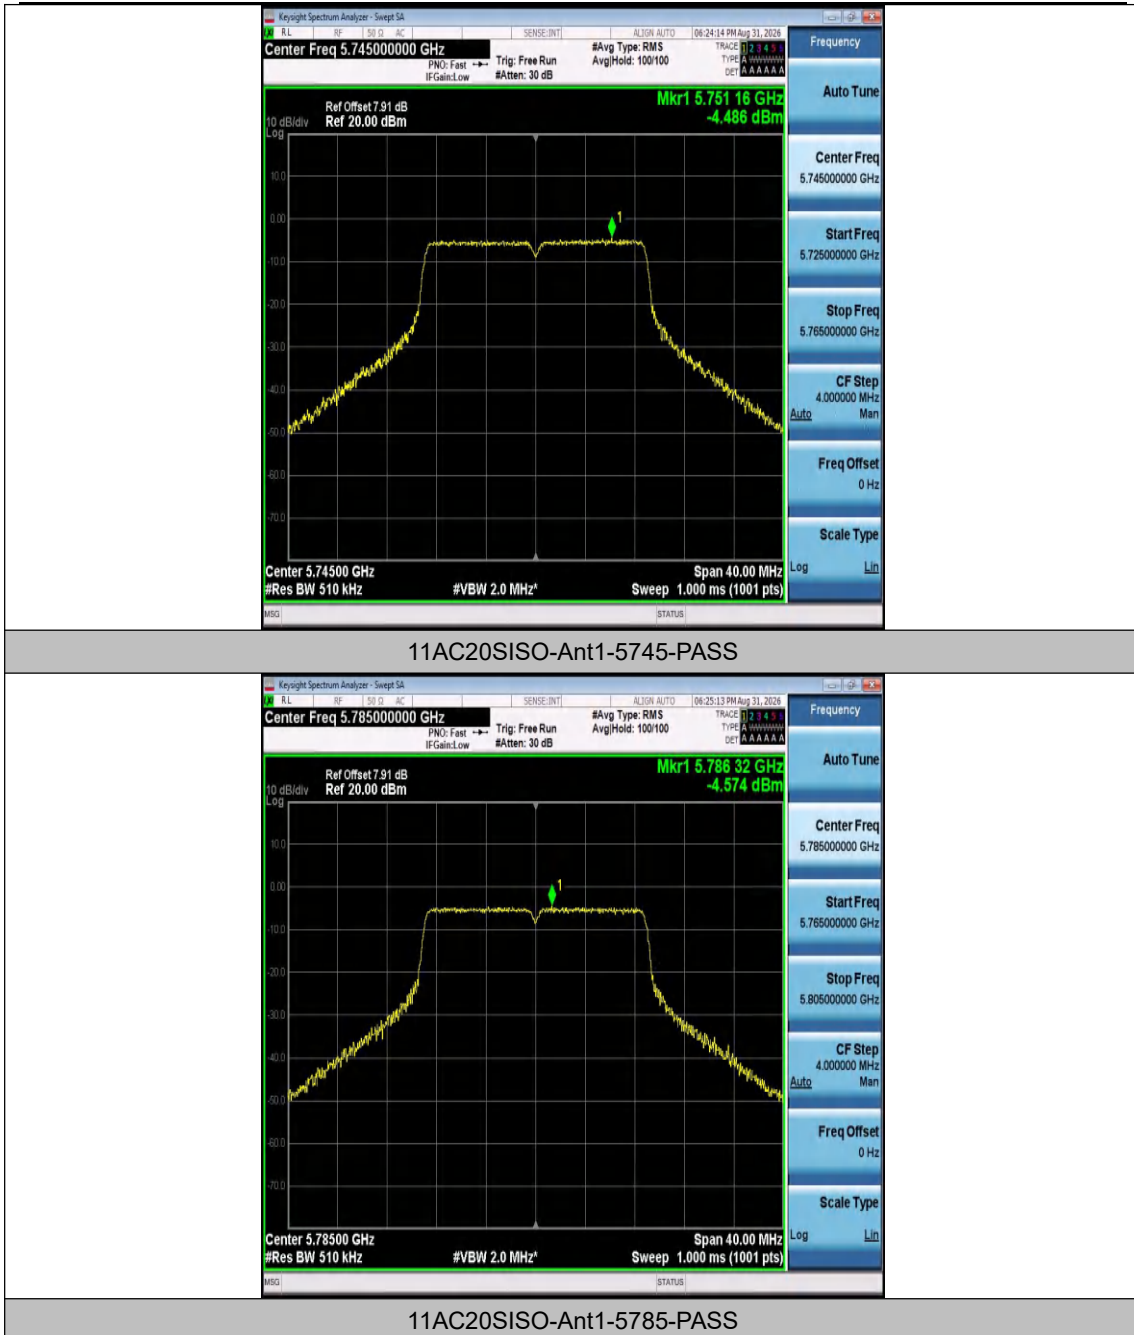

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

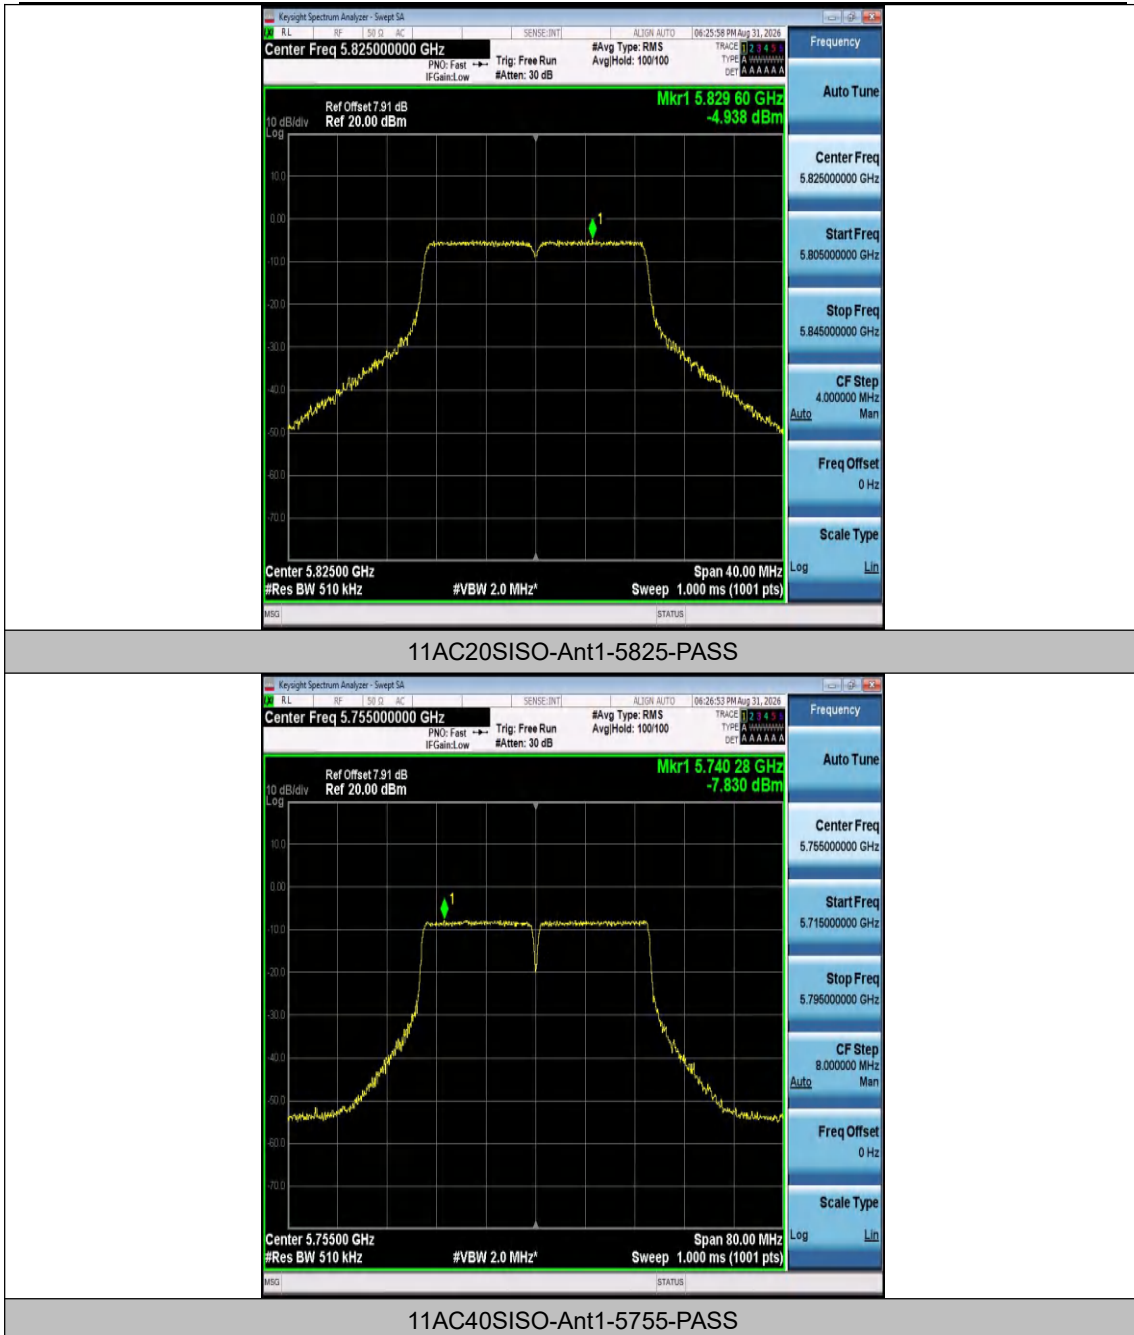

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

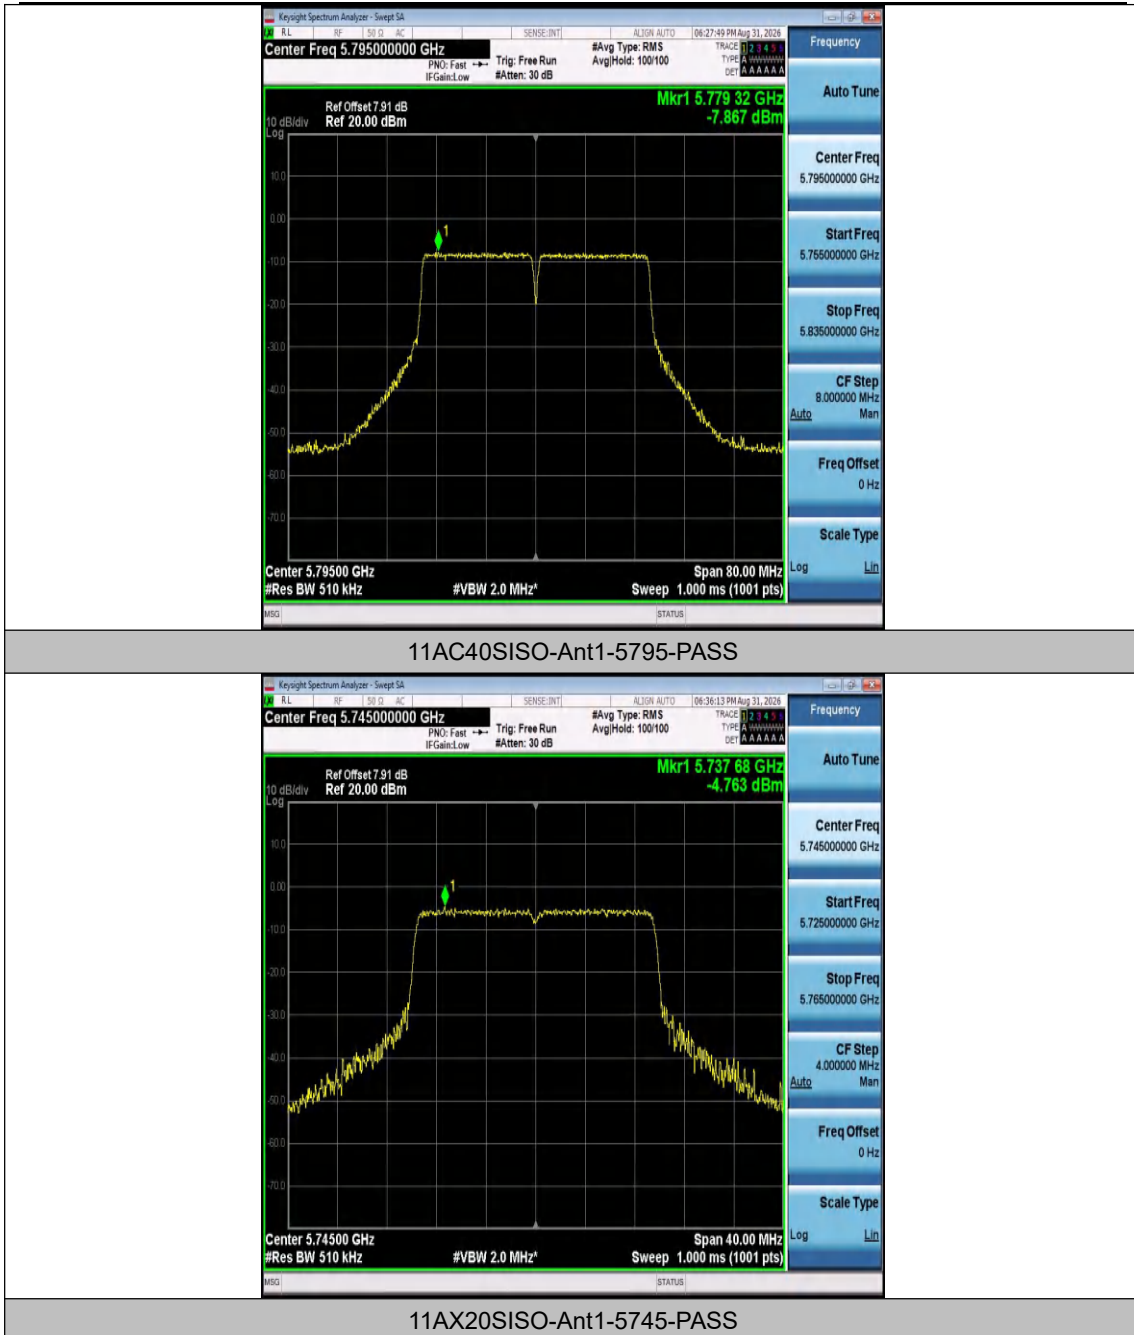

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

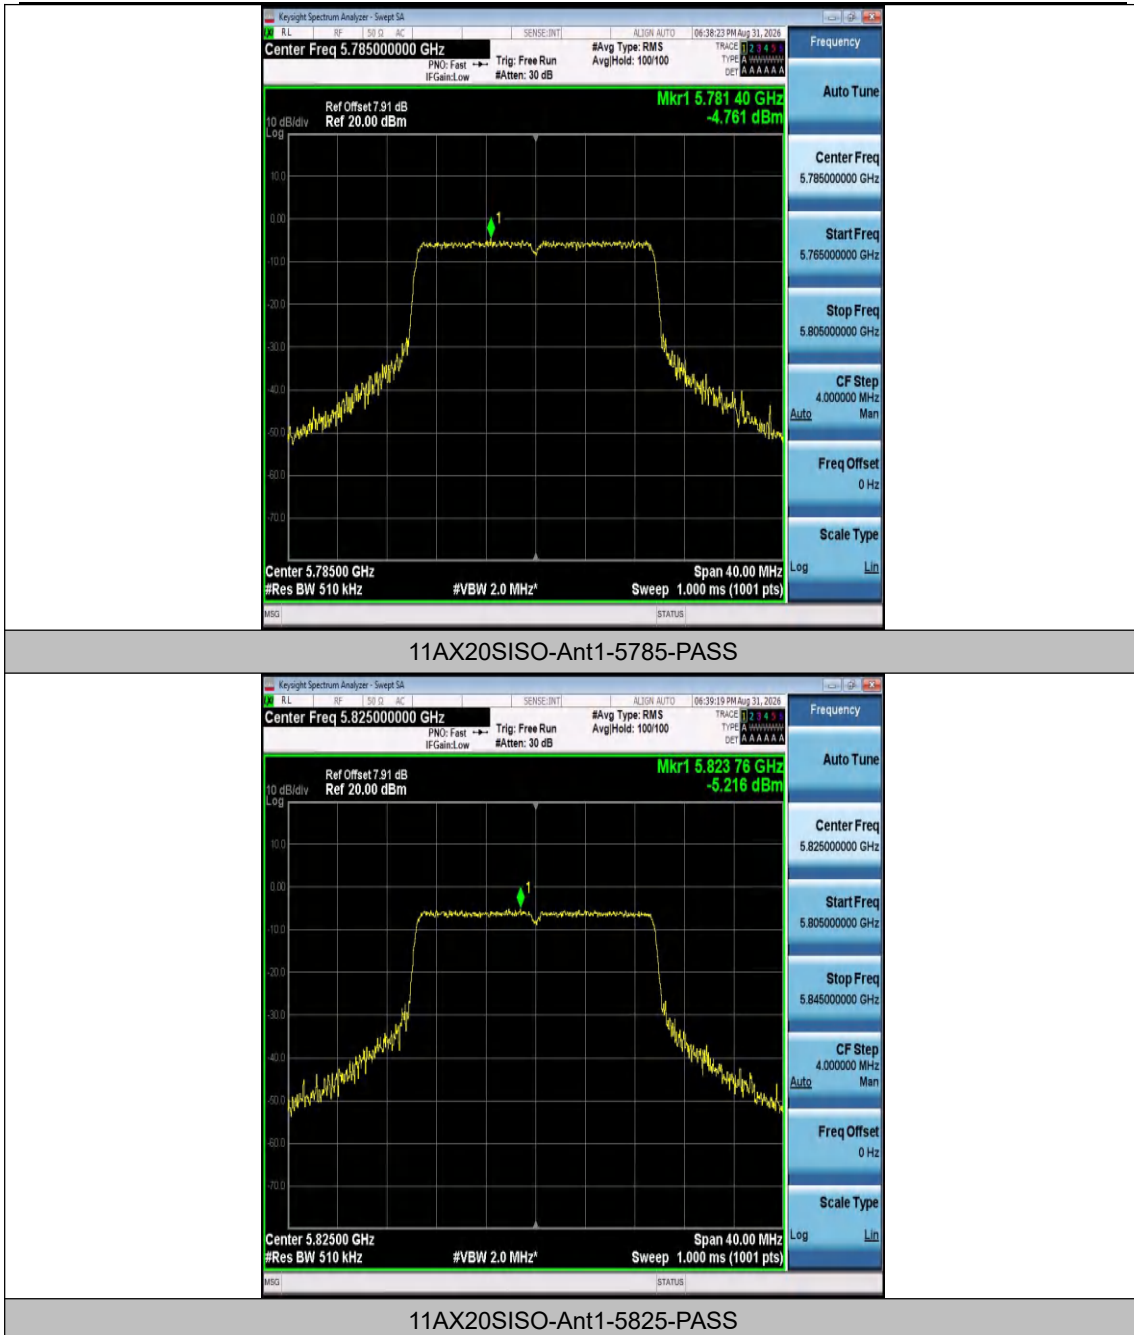

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

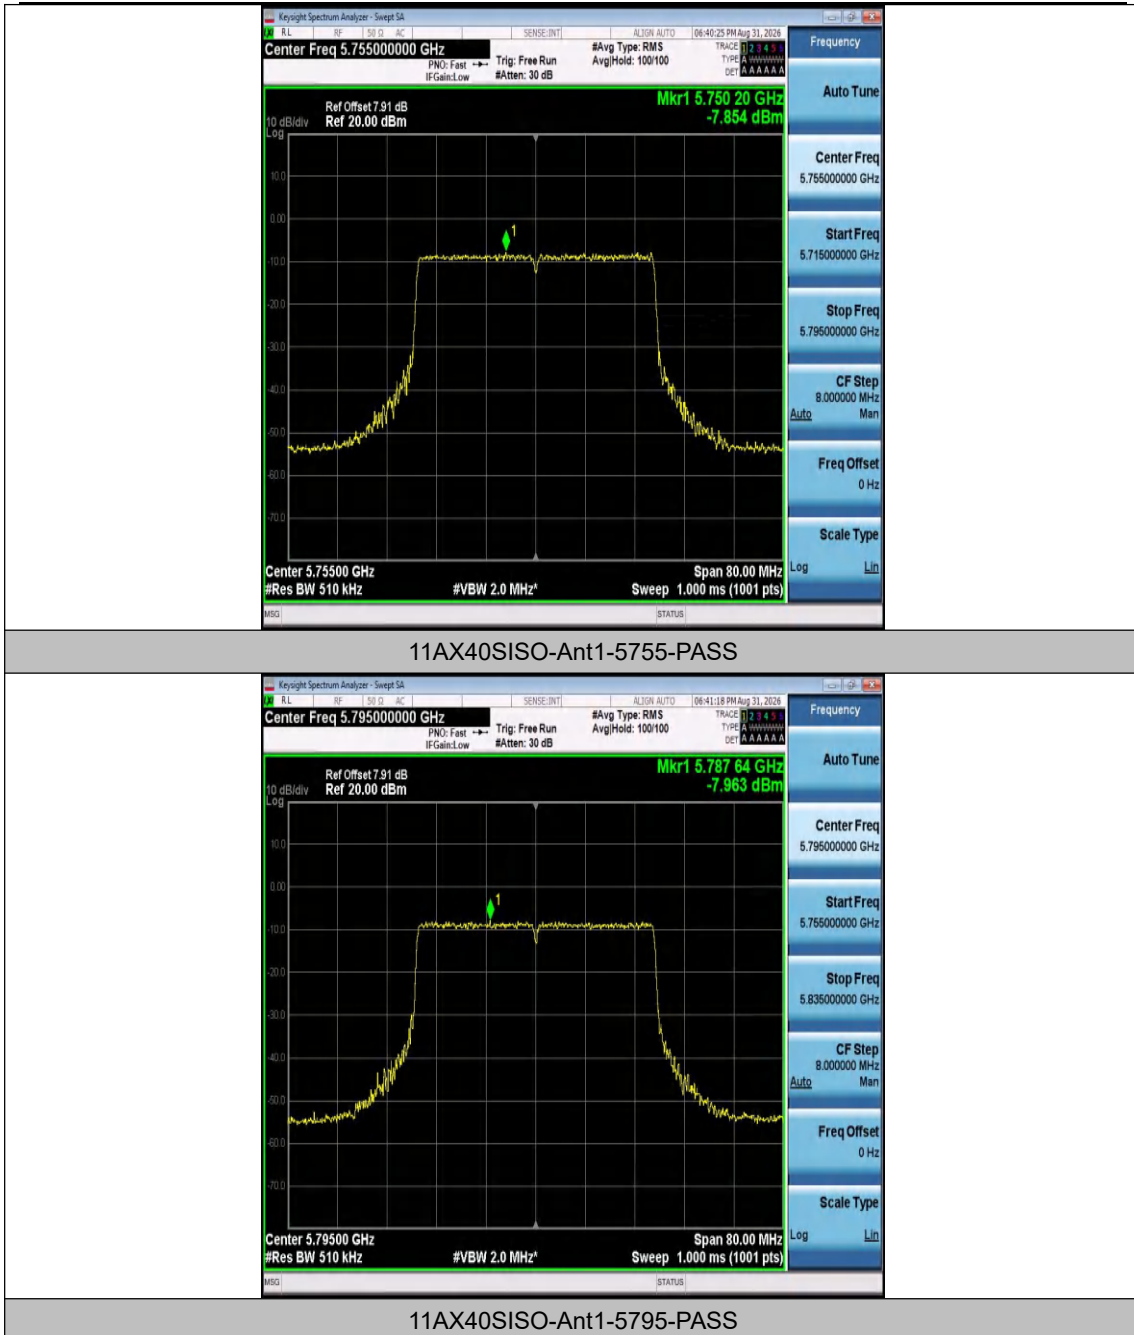

Appendix E: Band edge measurements

Test Result B4

Test Mode	Antenna	Ch. Name	Frequency [MHz]	FreqRange [MHz]	Result [dBm]	Limit [dBm]	Verdict
11A	Ant1	Low	5745	5720~5725	-31.02	≤16.08	PASS
11A	Ant1	Low	5745	5700~5720	-32.24	≤13.40	PASS
11A	Ant1	Low	5745	5650~5700	-40.35	≤-26.53	PASS
11A	Ant1	Low	5745	5645~5650	-39.85	≤-27	PASS
11A	Ant1	High	5825	5850~5855	-35.34	≤16.34	PASS
11A	Ant1	High	5825	5855~5875	-29.16	≤15.24	PASS
11A	Ant1	High	5825	5875~5925	-39.01	≤-26.61	PASS
11A	Ant1	High	5825	5925~5935	-39.54	≤-27	PASS
11N20SISO	Ant1	Low	5745	5720~5725	-27.52	≤20.27	PASS
11N20SISO	Ant1	Low	5745	5700~5720	-25.92	≤14.47	PASS
11N20SISO	Ant1	Low	5745	5650~5700	-40.3	≤-26.79	PASS
11N20SISO	Ant1	Low	5745	5645~5650	-39.16	≤-27	PASS
11N20SISO	Ant1	High	5825	5850~5855	-35.79	≤18.50	PASS
11N20SISO	Ant1	High	5825	5855~5875	-24.09	≤15.50	PASS
11N20SISO	Ant1	High	5825	5875~5925	-40.06	≤-26.81	PASS
11N20SISO	Ant1	High	5825	5925~5935	-38.73	≤-27	PASS
11N40SISO	Ant1	Low	5755	5720~5725	-31.58	≤19.43	PASS
11N40SISO	Ant1	Low	5755	5700~5720	-32.01	≤10.82	PASS
11N40SISO	Ant1	Low	5755	5650~5700	-39.8	≤-25.80	PASS
11N40SISO	Ant1	Low	5755	5645~5650	-40.34	≤-27	PASS
11N40SISO	Ant1	High	5795	5850~5855	-33.04	≤21.30	PASS
11N40SISO	Ant1	High	5795	5855~5875	-39.84	≤10.20	PASS
11N40SISO	Ant1	High	5795	5875~5925	-39.77	≤-26.71	PASS
11N40SISO	Ant1	High	5795	5925~5935	-37.67	≤-27	PASS
11AC20SISO	Ant1	Low	5745	5720~5725	-28.91	≤16.08	PASS
11AC20SISO	Ant1	Low	5745	5700~5720	-23.51	≤15.43	PASS
11AC20SISO	Ant1	Low	5745	5650~5700	-39.66	≤-25.68	PASS
11AC20SISO	Ant1	Low	5745	5645~5650	-38.85	≤-27	PASS
11AC20SISO	Ant1	High	5825	5850~5855	-33.53	≤16.03	PASS
11AC20SISO	Ant1	High	5825	5855~5875	-31.46	≤14.71	PASS
11AC20SISO	Ant1	High	5825	5875~5925	-39.9	≤-26.91	PASS
11AC20SISO	Ant1	High	5825	5925~5935	-38.47	≤-27	PASS
11AC40SISO	Ant1	Low	5755	5720~5725	-31.3	≤16.35	PASS
11AC40SISO	Ant1	Low	5755	5700~5720	-31.48	≤10.97	PASS
11AC40SISO	Ant1	Low	5755	5650~5700	-41.41	≤-26.80	PASS

11AC40SISO	Ant1	Low	5755	5645~5650	-38.76	≤ -27	PASS
11AC40SISO	Ant1	High	5795	5850~5855	-37.47	≤ 17.16	PASS
11AC40SISO	Ant1	High	5795	5855~5875	-38.84	≤ 10.71	PASS
11AC40SISO	Ant1	High	5795	5875~5925	-39.46	≤ -26.95	PASS
11AC40SISO	Ant1	High	5795	5925~5935	-38.92	≤ -27	PASS
11AX20SISO	Ant1	Low	5745	5720~5725	-28.01	≤ 18.18	PASS
11AX20SISO	Ant1	Low	5745	5700~5720	-28.82	≤ 15.37	PASS
11AX20SISO	Ant1	Low	5745	5650~5700	-40.79	≤ -26.96	PASS
11AX20SISO	Ant1	Low	5745	5645~5650	-40.18	≤ -27	PASS
11AX20SISO	Ant1	High	5825	5850~5855	-31.77	≤ 16.65	PASS
11AX20SISO	Ant1	High	5825	5855~5875	-31.34	≤ 14.59	PASS
11AX20SISO	Ant1	High	5825	5875~5925	-40.32	≤ -26.91	PASS
11AX20SISO	Ant1	High	5825	5925~5935	-38.5	≤ -27	PASS
11AX40SISO	Ant1	Low	5755	5720~5725	-28.51	≤ 16.97	PASS
11AX40SISO	Ant1	Low	5755	5700~5720	-29.18	≤ 11.72	PASS
11AX40SISO	Ant1	Low	5755	5650~5700	-40.35	≤ -26.50	PASS
11AX40SISO	Ant1	Low	5755	5645~5650	-39.57	≤ -27	PASS
11AX40SISO	Ant1	High	5795	5850~5855	-32.38	≤ 20.55	PASS
11AX40SISO	Ant1	High	5795	5855~5875	-39.67	≤ 10.29	PASS
11AX40SISO	Ant1	High	5795	5875~5925	-39.18	≤ -26.46	PASS
11AX40SISO	Ant1	High	5795	5925~5935	-38.3	≤ -27	PASS

Note: The margin plus the antenna gain also meets the limit.

Test Graphs B4






Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com





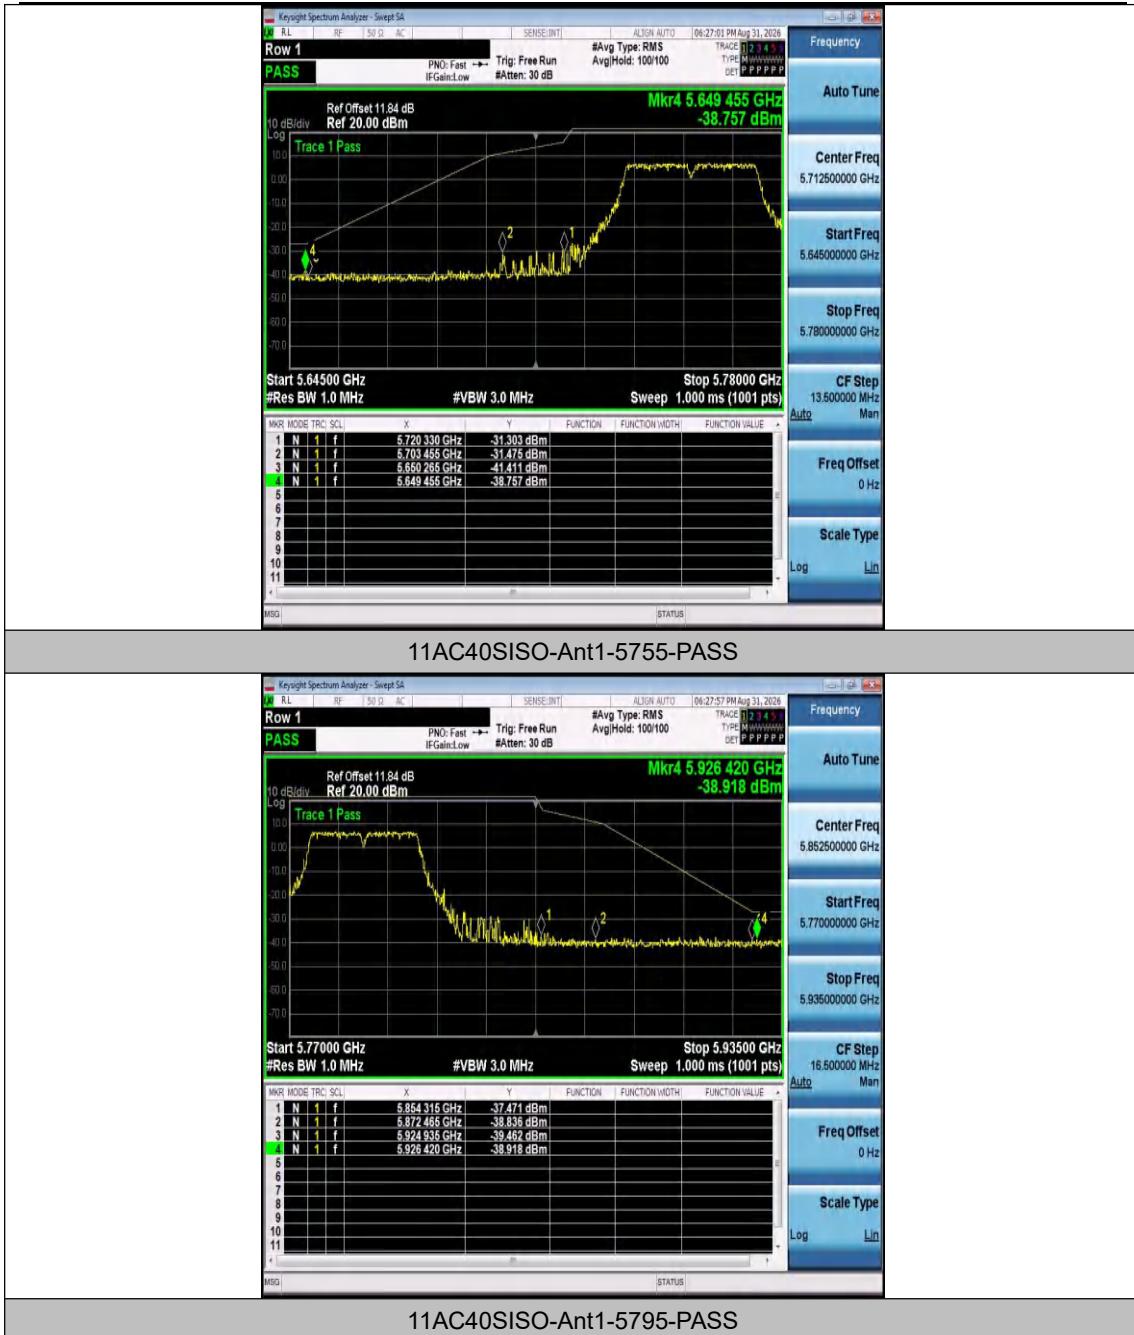

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com





---END---