



AFC Device (DUT) Test Report

FCC ID : 2ABOF-G1RN6AHI042
Equipment : RNv SYSTEM (6 GHz)
Brand Name : Tarana
Model Name : G1RN6AHI042
Applicant : Tarana Wireless, Inc.
590 Alder Dr, Milpitas, CA 95035 , USA
Manufacturer : Tarana Wireless, Inc.
590 Alder Dr, Milpitas, CA 95035 , USA
Standard : FCC Part 15.407

The product was received on Oct. 31, 2024 and testing was performed from Jan. 22, 2025 to Feb. 11, 2025. We, Sporton International (USA) Inc., would like to declare that the tested sample has been evaluated in accordance with the test procedures given in WiFi Alliance AFC Device (DUT) Compliance Test Plan Version 1.7 and has been in compliance with the applicable technical standards.

The test results in this report apply exclusively to the tested model / sample. Without written approval from Sporton International (USA) Inc., the test report shall not be reproduced except in full.

Approved by: Neil Kao

Sporton International (USA) Inc.
1175 Montague Expressway, Milpitas, CA 95035

Table of Contents

1. Administration Data	4
1.1 Testing Laboratory	4
1.2 Applicant	4
1.3 Manufacturer	4
1.4 Applied Standard	5
2. General Information	5
2.1 Description of Device Under Test (DUT)	5
2.2 Protocol Test Summary	7
2.3 Support Equipment	9
2.4 Measuring Equipment List	9
2.5 Measurement Uncertainty	9
3. Measurement Environment	10
3.1 Test configuration	10
4. Protocol Test Results	11
4.1 Successful registration and spectrum access request	11
4.1.1 AFCD.RSA Test Vector	15
4.1.2 AFCD.RSA RF Transmit Power Measurement	15
4.2 Unsuccessful spectrum access request	19
4.2.1 AFCD.USA Test Vectors	20
4.3 Successful spectrum access update	21
4.3.1 AFCD.SAU Test Vectors	25
4.3.2 AFCD.SAU RF Transmit Power Measurement	26
4.4 Unsuccessful spectrum access update	30
4.4.1 AFCD.UAU Test Vectors	33
4.5 Unsuccessful server validation	34
4.5.1 AFCD.USV Test Vectors	35

Appendix A. Setup Photographs

Appendix B. AFC Test Logs

History of this test report

Report No.	Version	Description	Issue Date
FR241120001	01	Initial issue of report.	Mar. 04, 2025

Conformity Assessment Condition:

The test results (PASS/FAIL) with all measurement uncertainty excluded are presented against the regulation limits or in accordance with the requirements stipulated by the applicant/manufacture who shall bear all the risks of non-compliance that may potentially occur if measurement uncertainty is taken into account.

Disclaimer:

The product specifications of the DUT presented in the test report that may affect the test assessments are declared by the manufacturer who shall take full responsibility for the authenticity.

1. Administration Data

1.1 Testing Laboratory

Test Site	Sporton International (USA) Inc.
Test Site Location	1175 Montague Expressway, Milpitas, CA 95035 TEL: (408) 904-3300
Test Site No.	Sporton Site No.
	TH01-CA
Test Engineer	Thomas Chen
Temperature	23 ~ 26 °C
Relative Humidity	43 ~ 47 %

FCC Designation No.: US1250

1.2 Applicant

Company Name	Tarana Wireless, Inc.
Address	590 Alder Dr, Milpitas, CA 95035 , USA

1.3 Manufacturer

Company Name	Tarana Wireless, Inc.
Address	590 Alder Dr, Milpitas, CA 95035 , USA

1.4 Applied Standard

According to the specifications declared by the manufacturer, the DUT must comply with the requirement of the following standards:

Standards	[n.1]. FCC Part 15.407
	[n.2]. FCC KDB 987594 D01 U-NII 6GHz General Requirements v02r02
	[n.3]. FCC KDB 987594 D05 AFC DUT Test Harness Testing v01r01
	[n.4]. WiFi Alliance AFC System to AFC Device Interface Specification v1.5, 5 May 2023
	[n.5]. WiFi Alliance AFC Device (DUT) Compliance Test Plan v1.7, 16 Jun 2024
	[n.6]. WiFi Alliance AFC Device (DUT) Compliance Test Vectors v1.2, 27 Jun 2023
	[n.7]. ANSI C63.10-2013

Remark: All the test items were validated and recorded in accordance with the standards without any modification during the testing.

2. General Information

2.1 Description of Device Under Test (DUT)

Product Feature & Specification	
EUT Type	RNv SYSTEM (6 GHZ)
Brand Name	Tarana
Model Name	G1RN6AHI042
FCC ID	2ABOF-G1RN6AHI042
Device Under Test Type	☐ Standard Power Access Point ☒ Fixed Client
Domain Proxy support	☒ with Domain Proxy ☐ without Domain Proxy
Deployment	☐ Indoor ☒ Outdoor
DUT HW Version	30-0197-001.4.0
DUT FW Version	SYS.A3.R10.XXX.3.603.013.00
DUT Serial Number	M228A1245000133
Domain Proxy SW Version	20250211101422-ed8f72d7-devel

AFC DUT general capabilities declaration		
Item	Question	Vendor response
1	AFC DUT Type.	☐ Standard Power Access Point (6SD) ☒ Fixed Client (6FC) ☒ Domain Proxy
2	Does the AFC DUT support sending an Available Spectrum Inquiry Request based on the inquiredFrequencyRange field	No (Yes/No)
3	Does the AFC DUT support sending an Available Spectrum Inquiry Request based on the inquired Channels fields?	Yes (Yes/No)
4 (For 2, 3)	If the Answer to Items 2 and 3 is “Yes”, what is AFC DUT’s default inquiry type?	☐ Frequency based ☒ Channel based ☐ Both
5	Does the AFC DUT need to be supplied with BSS configuration parameters?	No (Yes/No)
6	Does the AFC DUT manufacturer attest to AFC DUT compliance with rules for LPI operation?	No (Yes/No)
7	Does the AFC DUT need to be supplied with mandatory registration information to formulate an Available Spectrum Inquiry Request	No (Yes/No)
8 (For 7)	If the Answer to Item 7 is “Yes”. What is the geographic Supported by the AFC DUT?	☒ Ellipse ☐ Linear Polygon ☐ Radial Polygon
9	Does the AFC DUT support 160 MHz channel width operation?	No (Yes/No)
10	Which method does AFC DUT acting as a Fixed Client uses for sending an Available Spectrum Inquiry Request?	☒ In-band ☐ Out-of-band
11	Does the AFC DUT support 320 MHz channel width operation?	No (Yes/No)

2.2 Protocol Test Summary

Section	Test Case ID	Test Description	FCC Requirement	Short Description	Test Result
4.1	AFCD.RSA	Successful registration and spectrum access request	47 CFR Section 15.407(k)(1)	Transmit only as instructed by AFC System	PASS
			47 CFR Section 15.407(k)(8)(i)	Register with AFC System prior to initial transmission	
			47 CFR Section 15.407(k)(8)(ii)	Provide required registration parameters	
			47 CFR Section 15.407(k)(8)(iii)	Registration either directly or via proxy	
			47 CFR Section 15.407(l)(ii)	Determination of appropriate channel configuration implied by AFC System response	
			47 CFR 15.407(k)(8)(iv)	Must contact an AFC system at least once per day to obtain the latest list of available frequencies and the maximum permissible power	
4.2	AFCD.USA	Unsuccessful registration and spectrum access request	47 CFR Section 15.407(k)(1)	Transmit only as instructed by AFC System	PASS
			47 CFR Section 15.407(k)(8)(i)	Register with AFC System prior to initial transmission	
			47 CFR Section 15.407(k)(8)(ii)	Provide required registration parameters	
			47 CFR Section 15.407(k)(8)(iii)	Registration either directly or via proxy	

Section	Test Case ID	Test Description	FCC Requirement	Short Description	Test Result
4.3	AFCD.SAU	Successful spectrum access update	47 CFR Section 15.407(k)(8)(i)	Register with AFC System after change of location	PASS
			47 CFR Section 15.407(k)(8)(ii)	Update AFC System upon change of registration parameters	
			47 CFR Section 15.407(k)(9)(i)	Report location and uncertainty from power-off condition	
4.4	AFCD.UAU	Unsuccessful spectrum access update	47 CFR Section 15.407(k)(8)(i)	Register with AFC System after change of location	
			47 CFR Section 15.407(k)(8)(ii)	Update AFC System upon change of registration parameters	
			47 CFR Section 15.407(k)(9)(i)	Report location and uncertainty from power-off condition	
4.5	AFCD.USV	Unsuccessful server validation	47 CFR Section 15.407(k)(8)(v)	Incorporate adequate security measurements to prevent it from accessing AFC systems not approved by the FCC	PASS

Note: For Protocol Test Results, please find the Appendix B for AFC Test Logs.

2.3 Support Equipment

Name	Manufacturer	Type/Model	Serial Number	FCC ID
Base Node (BN)	Tarana Wireless	G1BN6ASI002	S171F2223507676	2ABOF-G1BN6ASI002

2.4 Measuring Equipment List

Name	Manufacturer	Type/Model	Serial Number	Calibration	
				Last Cal.	Due Date
Spectrum Analyzer	Rohde & Schwarz	FSV3044	101128	Oct. 22, 2024	Oct. 21, 2025

2.5 Measurement Uncertainty


Uncertainty of Conducted Power Measurement

Measuring Uncertainty for a Level of Confidence of 95% ($U = 2uc(y)$)	0.43dB
---	--------

3. Measurement Environment

Measurement Environment Information	
AFC DUT Test Harness	AFC DUT Test Harness Version (2.0.65.144)
Operating System	Ubuntu 22.04
TLS version	V 1.2

3.1 Test configuration

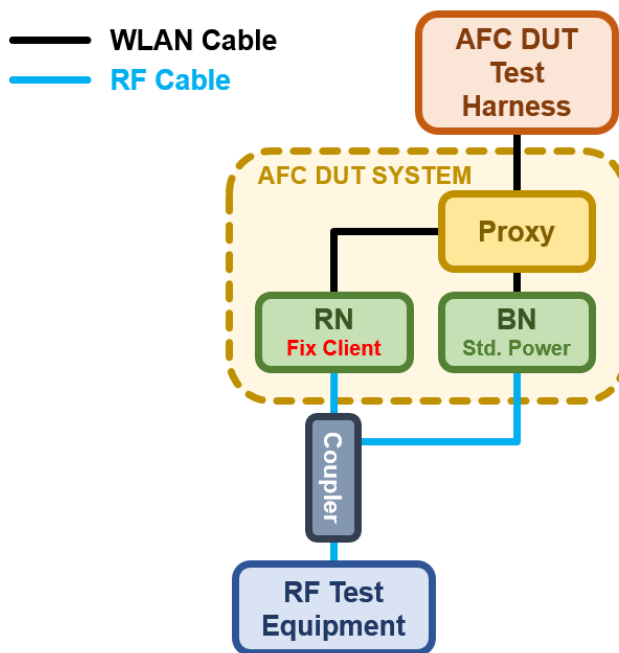

Proxy representing Standard Power Access Point (BN)
and Fixed Client Device (RN) Test Setup

4. Protocol Test Results

4.1 Successful registration and spectrum access request

#	Description	Results
1	If the AFC DUT is Standard Power Access Point, go to Step 2, else go to Step 12	Go to step 12
2	AFC DUT set to Initial Pre-test State. If needed (see Table 5 declaration), configure the AFC DUT with BSS parameters per Table 9 and a temporary test regulatory identifier (e.g., FCC ID), geographic coordinates, antenna height, and uncertainty parameters. Configure the AFC DUT with AFC System URL and server root certificate. Trigger the AFC DUT to send to the AFC DUT Test Harness an Available Spectrum Inquiry Request.	Not applicable
3	AFC DUT sends a valid Available Spectrum Inquiry Request containing the inquiredFrequencyRange and/or the inquiredChannels fields*.	Not applicable
4	AFC DUT Test Harness validates the presence of mandatory registration information	Not applicable
5	AFC DUT Test Harness sends an Available Spectrum Inquiry Response containing a list of available frequency ranges and/or channels and the maximum permissible transmit power in the availableFrequencyInfo and/or availableChannelInfo fields.	Not applicable

#	Description	Results
6	Throughout Step 1 to Step 4, RF Test Equipment monitors the output of the AFC DUT to confirm that the AFC DUT does not transmit: ● In the band if the AFC DUT supports only SP operation Or ● Above LPI limits for AFC DUT whose manufacturer attests to its compliance with rules for LPI operation Wait for 60 seconds RF Test Equipment monitors any transmission by the AFC DUT conforms to the following: ● For SP only operation, AFC DUT conforms to the conditions contained in the Available Spectrum Inquiry Response and does not exceed emissions limits in adjacent frequencies. ● For AFC DUT whose manufacturer attests to its compliance with rules for LPI operation, AFC DUT transmit power in the band is less than CEILING [LPI limits, SP limits contained in the Available Spectrum Inquiry Response] and does not exceed emissions limits in adjacent frequencies.	Not applicable
7	Trigger the AFC DUT to send to the AFC DUT Test Harness an Available Spectrum Inquiry Request.	Not applicable
8	AFC DUT sends a valid Available Spectrum Inquiry Request containing the inquiredFrequencyRange and/or the inquiredChannels fields*.	Not applicable
9	AFC DUT Test Harness validates the presence of mandatory registration information	Not applicable
10	AFC DUT Test Harness sends an Available Spectrum Inquiry Response containing a list of available frequency ranges and/or channels and the maximum permissible transmit power in the availableFrequencyInfo and/or availableChannelInfo fields which are significantly different from Step 5.	Not applicable

#	Description	Results
11	Wait for 5 minutes (configurable) RF Test Equipment monitors any transmission by the AFC DUT conforms to the following: - For SP only operation, AFC DUT conforms to the conditions contained in the latest Available Spectrum Inquiry Response and does not exceed emissions limits in adjacent frequencies. - For AFC DUT whose manufacturer attests to its compliance with rules for LPI operation, AFC DUT transmit power in the band is less than CEILING [LPI limits, SP limits contained in the latest Available Spectrum Inquiry Response] and does not exceed emissions limits in adjacent frequencies.	Not applicable
12	If the AFC DUT is Fixed Client, go to Step 13 else Stop the test	Go to step 13
13	The AFC DUT set to Initial Pre-test State.	Done
14	If needed (see Table 5 declaration), configure the AFC DUT with a temporary test regulatory identifier (e.g., FCC ID), geographic coordinates, antenna height, and uncertainty parameters. Configure the AFC DUT with AFC System URL and server root certificate. Trigger the AFC DUT to send to the AFC DUT Test Harness an Available Spectrum Inquiry Request using either In-band or Out-of-band methods.	Done
15	AFC DUT sends a valid Available Spectrum Inquiry Request containing the inquiredFrequencyRange and/or the inquiredChannels fields*	PASS
16	AFC DUT Test Harness validates the presence of mandatory registration information	PASS
17	AFC DUT Test Harness sends an Available Spectrum Inquiry Response containing a list of available frequency ranges and/or channels and the maximum permissible transmit power in the availableFrequencyInfo and/or availableChannelInfo fields.	Done
18	If AFC DUT used Out-of-band method, initiate connection procedure between AFC DUT and SP Access Point by following instructions provided by the AFC DUT Vendor	Done

#	Description	Results
19	Wait for 60 seconds RF Test Equipment monitors any transmission by the AFC DUT conforms to the conditions contained in the Available Spectrum Inquiry Response and does not exceed emissions limits in adjacent frequencies	PASS
20	Trigger the AFC DUT to send to the AFC DUT Test Harness an Available Spectrum Inquiry Request using either In-band or Out-of-band methods	Done
21	AFC DUT sends a valid Available Spectrum Inquiry Request containing the inquiredFrequencyRange and/or the inquiredChannels fields*	PASS
22	AFC DUT Test Harness validates the presence of mandatory registration information	PASS
23	AFC DUT Test Harness sends an Available Spectrum Inquiry Response containing a list of available frequency ranges and/or channels and the maximum permissible transmit power in the availableFrequencyInfo and/or availableChannelInfo fields which are significantly different from Step 17.	Done
24	If AFC DUT used Out-of-band method, initiate connection procedure between AFC DUT and SP Access Point by following instructions provided by the AFC DUT Vendor	Done
25	Wait for 60 seconds (configurable) RF Test Equipment monitors any transmission by the AFC DUT conforms to the conditions contained in the latest Available Spectrum Inquiry Response and does not exceed emissions limits in adjacent frequencies	PASS

4.1.1 AFCD.RSA Test Vector

Test Vector	Test Category	Results
AFCD.RSA	Successful registration and spectrum access request	PASS

4.1.2 AFCD.RSA RF Transmit Power Measurement

Center Frequency [MHz]	BW [MHz]	DUT Internal Loss [dB]	Duty Cycle Factor [dB]	Directional Gain [dBi]	SA Reading Power [dBm]		Total EIRP [dBm]	AFC EIRP Limit [dBm]
					Pol H	Pol V		
6045	40	15.07	6.83	20.50	-11.37	-11.14	34.16	36.00
6765					-9.36	-14.31	34.25	36.00
5965					-15.45	-14.45	30.49	31.35
6205					-11.17	-14.38	32.93	34.35

Note 1: DUT will transmit on two of available channels which has highest allowed power based on response from AFC system. During testing, both channels were validated to ensure each channel's EIRP power does not exceed allowed power from AFC.

Note 2: The maximum of UNII-5 and UNII-7 Antenna Gain = 20.50dBi.



The device is driving cross-polarized antenna, which has 2 horizontal polarization antenna and 2 vertical polarization antennas.



Directional Gain (2H/2V) = 20.5dBi + 10log (Ntx = 2 / Nss = 2) = 20.5dBi.


Note 3: Conducted power was measured as the sum of 2 horizontal polarization output ports and the sum of 2 vertical polarization output ports, which are then added together to calculate the total conducted output power.

Note 4: The path loss between the DUT and the Spectrum Analyzer has been offset and configured in the Spectrum Analyzer.

Note 5: The duty cycle factor, calculated as 10log (1/duty cycle) and listed in the table above, is used to compute the average power during continuous transmission.

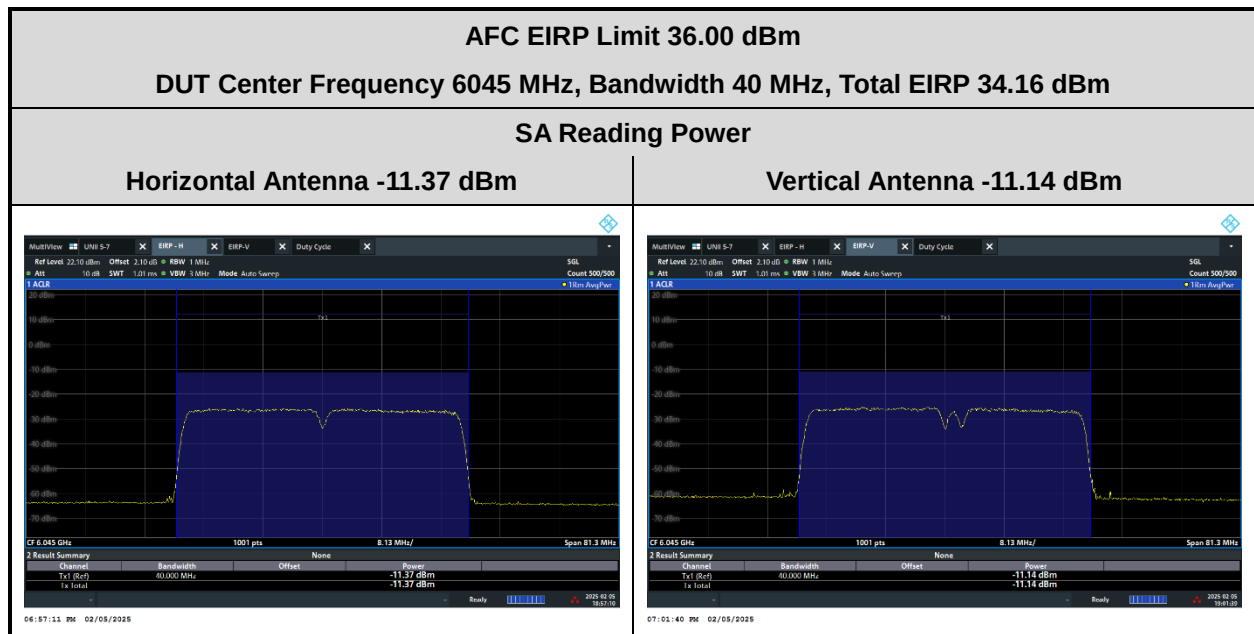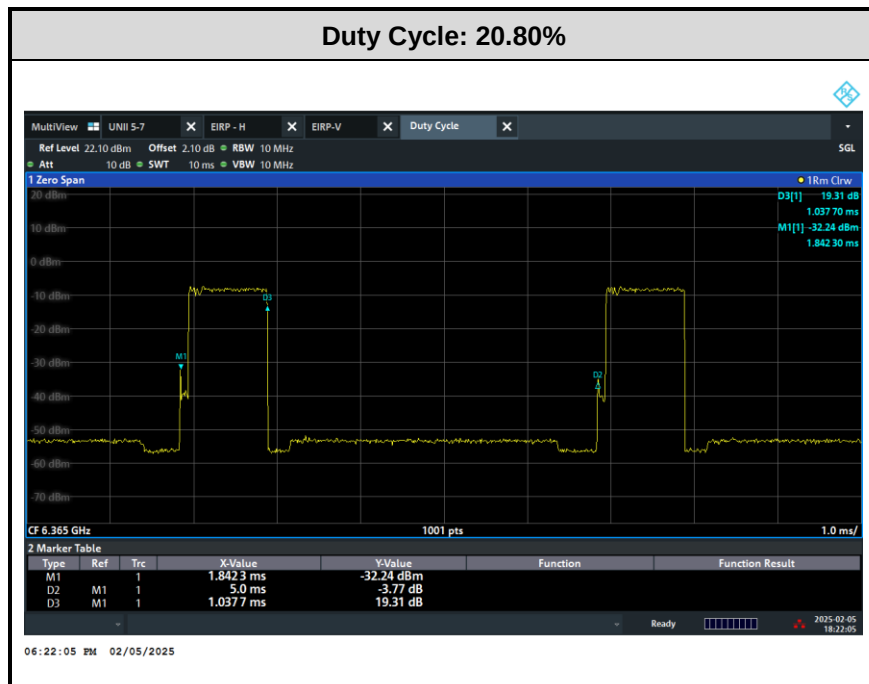

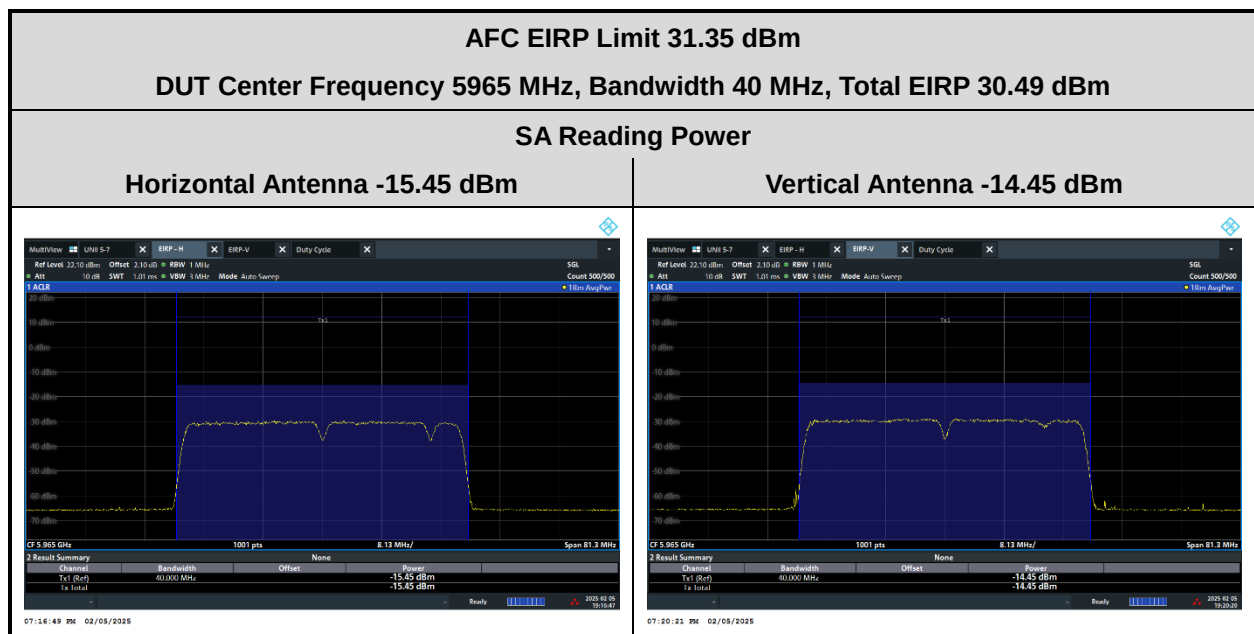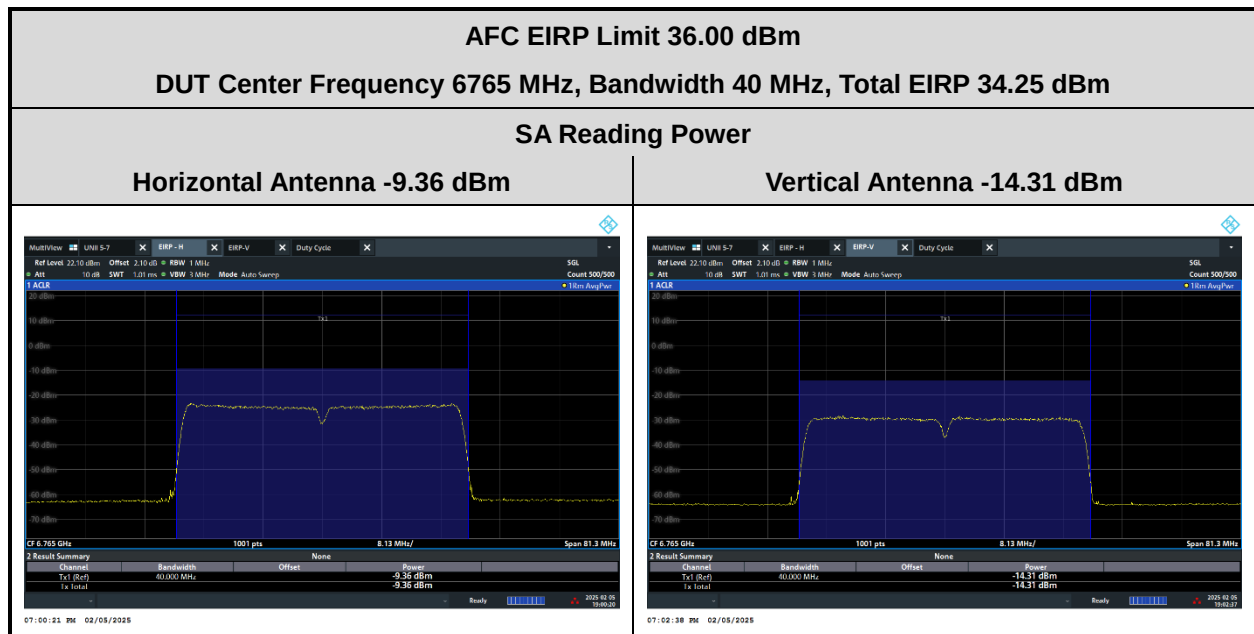

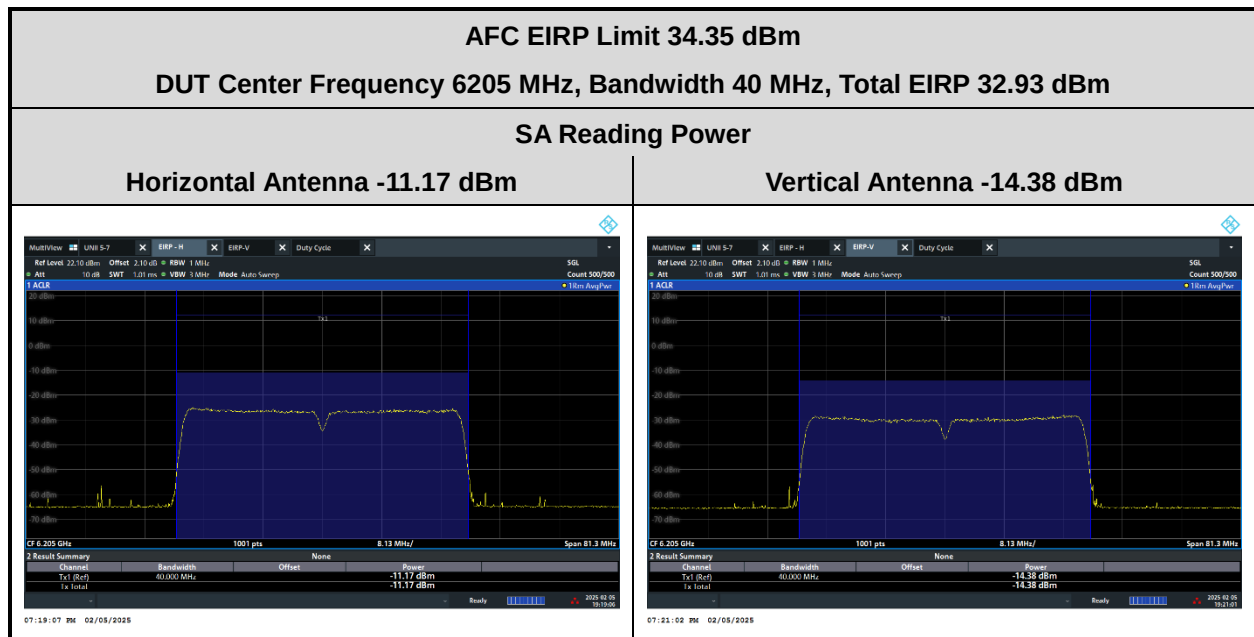

4.2 Unsuccessful spectrum access request

#	Description	Results
1	If the AFC DUT is Standard Power Access Point, go to Step 2, else go to Step 7	Go to step 7
2	AFC DUT set to Initial Pre-test State. If needed (see Table 5 declaration), configure the AFC DUT with BSS parameters per Table 9 and a temporary test regulatory identifier (e.g., FCC ID), geographic coordinates, antenna height, and uncertainty parameters. Configure the AFC DUT with AFC System URL and server root certificate. Trigger the AFC DUT to send to the AFC DUT Test Harness an Available Spectrum Inquiry Request.	Not applicable
3	AFC DUT sends a valid Available Spectrum Inquiry Request containing the inquiredFrequencyRange and/or the inquiredChannels fields*.	Not applicable
4	AFC DUT Test Harness validates mandatory registration information.	Not applicable
5	AFC DUT Test Harness sends an Available Spectrum Inquiry Response indicating that no frequency ranges and/or channels are available.	Not applicable
6	Throughout Step 2 to Step 5 and subsequent to Step 5, RF Test Equipment monitors the output of the AFC DUT to confirm the following: ● For SP only operation, AFC DUT does not transmit in the band. ● For AFC DUT whose manufacturer attests to its compliance with rules for LPI operation, the AFC DUT does not transmit above LPI limits.	Not applicable
7	If the AFC DUT is Fixed Client, go to Step 8 else Stop the test	Go to step 8
8	The AFC DUT set to Initial Pre-test State.	Done
9	If needed (see Table 5 declaration), configure the AFC DUT with a temporary test regulatory identifier (e.g., FCC ID or IC ID), geographic coordinates, antenna height, and uncertainty parameters. Configure the AFC DUT with AFC System URL and server root certificate. Trigger the AFC DUT to send to the AFC DUT Test Harness an Available Spectrum Inquiry Request.	Done
10	AFC DUT sends a valid Available Spectrum Inquiry Request containing the inquiredFrequencyRange and/or the inquiredChannels fields*.	PASS
11	AFC DUT Test Harness validates mandatory registration information.	PASS

#	Description	Results
12	AFC DUT Test Harness sends an Available Spectrum Inquiry Response indicating that no frequency ranges and/or channels are available using either In-band or Out-of-band methods.	Done
13	If AFC DUT used Out-of-band method, initiate connection procedure between Fixed Client and SP Access Point by following instructions provided by the AFC DUT Vendor	Done
14	Wait for 60 seconds RF Test Equipment monitors that the AFC DUT does not transmit above maximum transmit power limits advertised by the Standard Power Access Point for Standard Client Devices in the channel.	PASS

4.2.1 AFCD.USA Test Vectors

Test Vector	Test Category	Results
AFCD.USA	Unsuccessful spectrum access request	PASS

4.3 Successful spectrum access update

#	Description	Results
1	If the AFC DUT is Standard Power Access Point, go to Step 2, else go to Step 12	Go to step 12
2	AFC DUT set to Initial Pre-test State. If needed (see Table 5 declaration), configure the DUT with BSS parameters per Table 9 and a temporary test regulatory identifier (e.g., FCC ID), geographic coordinates, antenna height, and uncertainty parameters. Configure the AFC DUT with AFC System URL and server root certificate. Trigger the AFC DUT to send to the AFC DUT Test Harness an Available Spectrum Inquiry Request.	Not applicable
3	AFC DUT sends a valid Available Spectrum Inquiry Request containing the inquiredFrequencyRange and/or the inquiredChannels fields*.	Not applicable
4	AFC DUT Harness validates mandatory registration information.	Not applicable
5	AFC DUT Test Harness sends an Available Spectrum Inquiry Response containing a list of available frequency ranges and/or channels and the maximum permissible transmit power in the availableFrequencyInfo and/or availableChannelInfo fields.	Not applicable

#	Description	Results
6	Throughout the preceding steps, RF Test Equipment monitors the output of the AFC DUT to confirm that the AFC DUT does not transmit: ● In the band if the AFC DUT supports only SP operation Or ● Above LPI limits for AFC DUT whose manufacturer attests to its compliance with rules for LPI operation Wait for 60 seconds RF Test Equipment monitors any transmission by the AFC DUT conforms to the following: ● For SP only operation, AFC DUT conforms to the conditions contained in the Available Spectrum Inquiry Response and does not exceed emissions limits in adjacent frequencies. ● For AFC DUT whose manufacturer attests to its compliance with rules for LPI operation, AFC DUT transmit power in the band is less than CEILING [LPI limits, SP limits contained in the Available Spectrum Inquiry Response] and does not exceed emissions limits in adjacent frequencies.	Not applicable
7	AFC DUT is power cycled. If needed (see Table 5 declaration), configure the AFC DUT with a temporary test regulatory identifier (e.g., FCC ID), new geographic coordinates, antenna height, and uncertainty parameters. Configure the AFC DUT with AFC System URL and server root certificate.	Not applicable
8	Wait for 60 seconds If the AFC DUT does not send an Available Spectrum Inquiry Request, RF Test Equipment monitors the output of the AFC DUT to verify the following and STOP the test ● For SP only operation, AFC DUT does not transmit in the band. ● For AFC DUT whose manufacturer attests to its compliance with rules for LPI operation, the AFC DUT does not transmit above LPI limits. If the AFC DUT sends an Available Spectrum Inquiry Request, then CONTINUE with Step 9	Not applicable

#	Description	Results
9	AFC DUT Test Harness evaluates validity of mandatory registration information	Not applicable
10	AFC DUT Test Harness waits for 60 seconds before sending an Available Spectrum Inquiry Response containing a list of available frequency ranges and/or channels and the maximum permissible transmit power in the availableFrequencyInfo and/or availableChannelInfo fields which are significantly different from Step 5. - During the 60 seconds wait time: - For AFC DUT whose manufacturer attests to its compliance with rules for LPI operation, RF Test Equipment monitors the output of the AFC DUT to confirm that AFC DUT does not transmit above LPI threshold limits - For SP only operation, RF Test Equipment monitors the output of the AFC DUT to confirm that AFC DUT doesn't transmit in the band	Not applicable
11	Wait for 60 seconds RF Test Equipment monitors any transmission by the AFC DUT conforms to the following: - For SP only operation, AFC DUT conforms to the conditions contained in the Available Spectrum Inquiry Response and does not exceed emissions limits in adjacent frequencies. - For AFC DUT whose manufacturer attests to its compliance with rules for LPI operation, AFC DUT transmit power in the band is less than CEILING [LPI limits, SP limits contained in the Available Spectrum Inquiry Response] and does not exceed emissions limits in adjacent frequencies.	Not applicable
12	If the AFC DUT is Fixed Client, go to Step 13 else Stop the test	Go to step 13
13	The AFC DUT set to Initial Pre-test State.	Done

#	Description	Results
14	If needed (see Table 5 declaration), configure the AFC DUT with a temporary test regulatory identifier (e.g., FCC ID), geographic coordinates, antenna height, and uncertainty parameters. Configure the AFC DUT with AFC System URL and server root certificate. Trigger the AFC DUT to send to the AFC DUT Test Harness an Available Spectrum Inquiry Request using either In-band or Out-of-band methods.	Done
15	AFC DUT sends a valid Available Spectrum Inquiry Request containing the inquiredFrequencyRange and/or the inquiredChannels fields*	PASS
16	AFC DUT Test Harness validates the presence of mandatory registration information	PASS
17	AFC DUT Test Harness sends an Available Spectrum Inquiry Response containing a list of available frequency ranges and/or channels and the maximum permissible transmit power in the availableFrequencyInfo and/or availableChannelInfo fields.	Done
18	If AFC DUT used Out-of-band method, initiate connection procedure between AFC DUT and SP Access Point by following instructions provided by the AFC DUT Vendor	Done
19	Wait for 60 seconds RF Test Equipment monitors any transmission by the AFC DUT conforms to the conditions contained in the Available Spectrum Inquiry Response and does not exceed emissions limits in adjacent frequencies	PASS
20	AFC DUT is power cycled. If needed (see Table 5 declaration), configure the AFC DUT with a temporary test regulatory identifier (e.g., FCC ID), new geographic coordinates, antenna height, and uncertainty parameters. Configure the AFC DUT with AFC System URL and server root certificate	Done

#	Description	Results
21	Wait for 60 seconds If the AFC DUT does not send an Available Spectrum Inquiry Request, RF Test Equipment monitors the output of the AFC DUT to verify the AFC DUT does not transmit above maximum transmit power limits advertised by the Standard Power Access Point for Standard Client Devices in the channel and STOP the test. If the AFC DUT sends an Available Spectrum Inquiry Request, then CONTINUE with Step 21	PASS
22	AFC DUT Test Harness evaluates validity of mandatory registration information	PASS
23	AFC DUT Test Harness waits for 60 seconds before sending an Available Spectrum Inquiry Response containing a list of available frequency ranges and/or channels and the maximum permissible transmit power in the availableFrequencyInfo and/or availableChannelInfo fields which are significantly different from step 17. During the 60 seconds wait time, RF Test Equipment monitors the output of the AFC DUT to confirm that the AFC DUT does not transmit above maximum transmit power limits advertised by the Standard Power Access Point for Standard Client Devices in the channel.	PASS
24	If AFC DUT used Out-of-band method, initiate connection procedure between AFC DUT and SP Access Point by following instructions provided by the AFC DUT Vendor	Done
25	Wait for 60 seconds RF Test Equipment monitors any transmission by the AFC DUT conforms to the conditions contained in the Available Spectrum Inquiry Response and does not exceed emissions limits in adjacent frequencies	PASS



4.3.1 AFCD.SAU Test Vectors



Test Vector	Test Category	Results
AFCD.SAU	Successful spectrum access update	PASS


4.3.2 AFCD.SAU RF Transmit Power Measurement

Center Frequency [MHz]	BW [MHz]	DUT Internal Loss [dB]	Duty Cycle Factor [dB]	Directional Gain [dBi]	SA Reading Power [dBm]		Total EIRP [dBm]	AFC EIRP Limit [dBm]
					Pol H	Pol V		
6365	40	15.07	6.88	20.50	-10.48	-13.51	33.67	34.48
6805					-12.14	-17.05	31.48	33.94
6365					-10.44	-13.96	33.56	33.99
6805					-19.45	-22.98	24.54	24.95

- Note 1: DUT will transmit on two of available channels which has highest allowed power based on response from AFC system. During testing, both channels were validated to ensure each channel's EIRP power does not exceed allowed power from AFC.
- Note 2: The maximum of UNII-5 and UNII-7 Antenna Gain = 20.50dBi.
The device is driving cross-polarized antenna, which has 2 horizontal polarization antenna and 2 vertical polarization antennas.
Directional Gain (2H/2V) = 20.5dBi + 10log (Ntx = 2 / Nss = 2) = 20.5dBi.
- Note 3: Conducted power was measured as the sum of 2 horizontal polarization output ports and the sum of 2 vertical polarization output ports, which are then added together to calculate the total conducted output power.
- Note 4: The path loss between the DUT and the Spectrum Analyzer has been offset and configured in the Spectrum Analyzer.
- Note 5: The duty cycle factor, calculated as 10log (1/duty cycle) and listed in the table above, is used to compute the average power during continuous transmission.

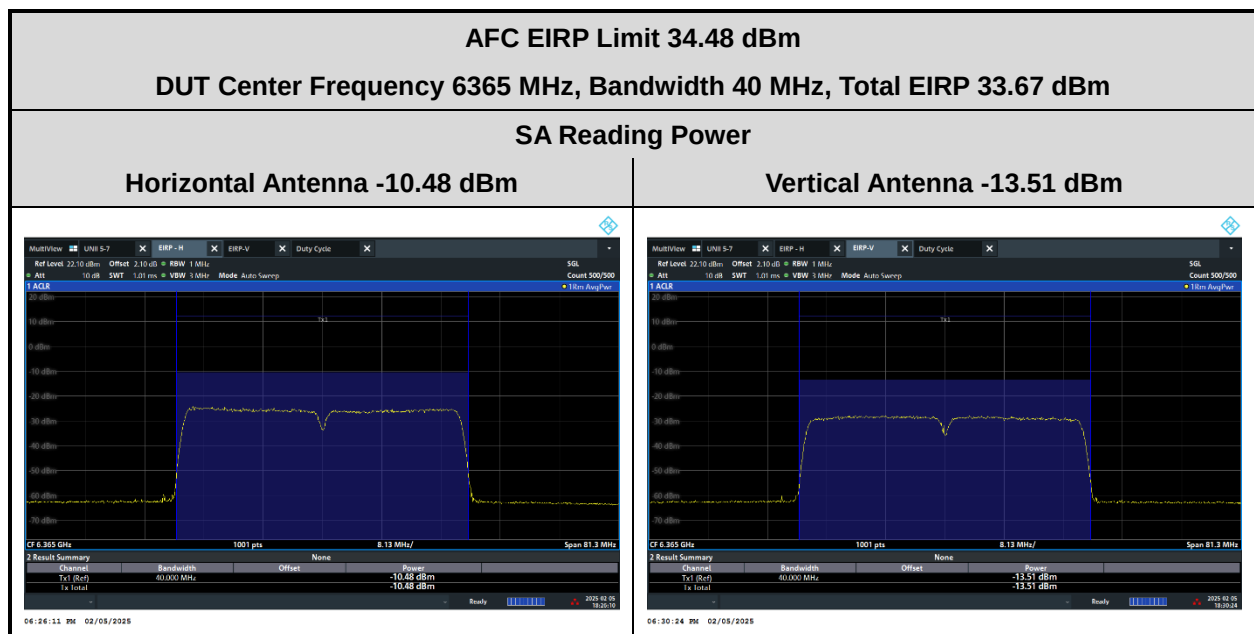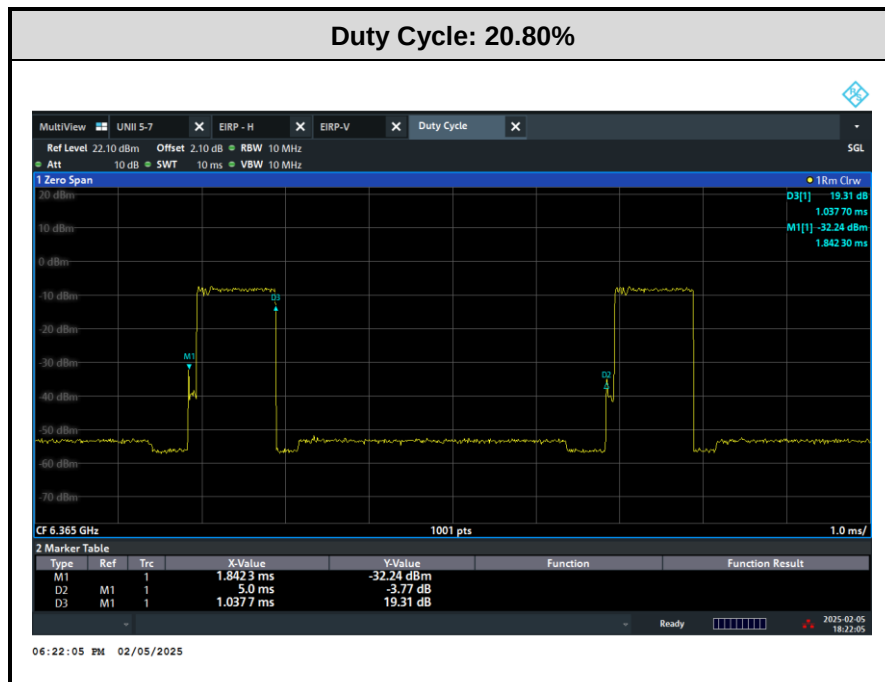

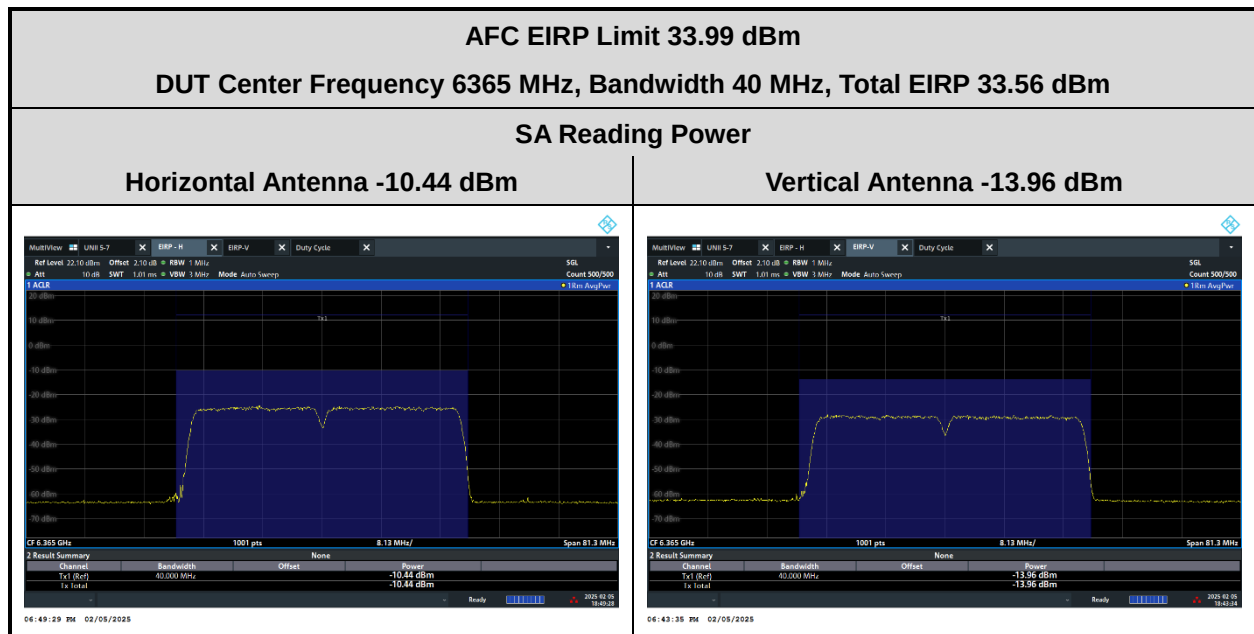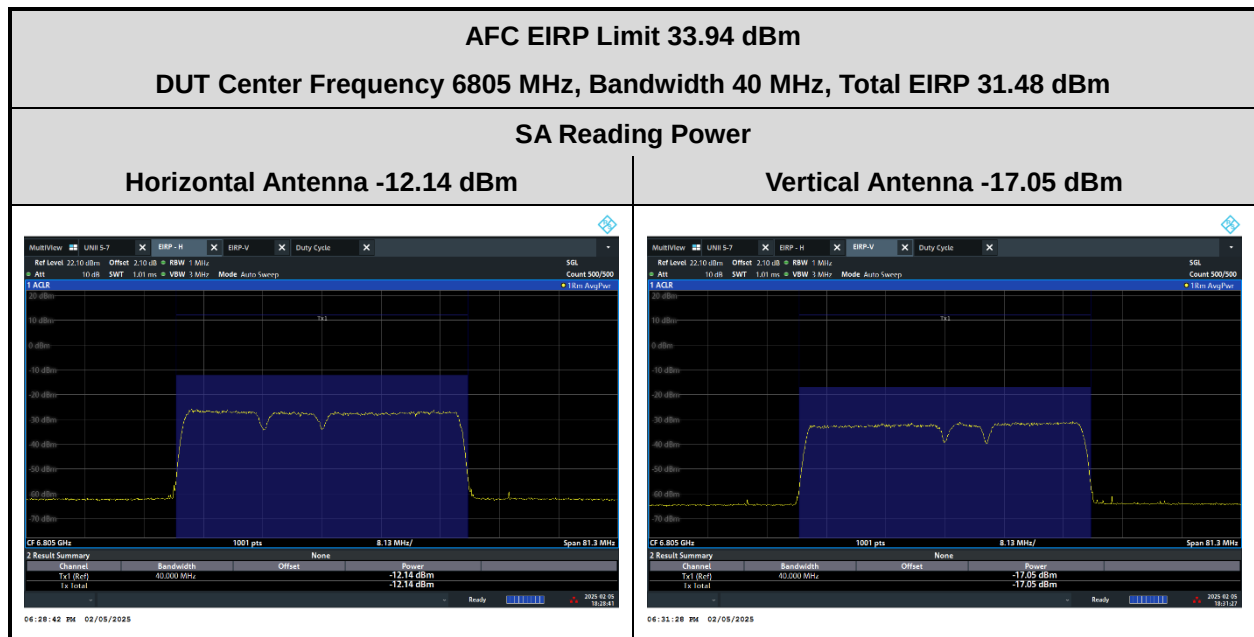

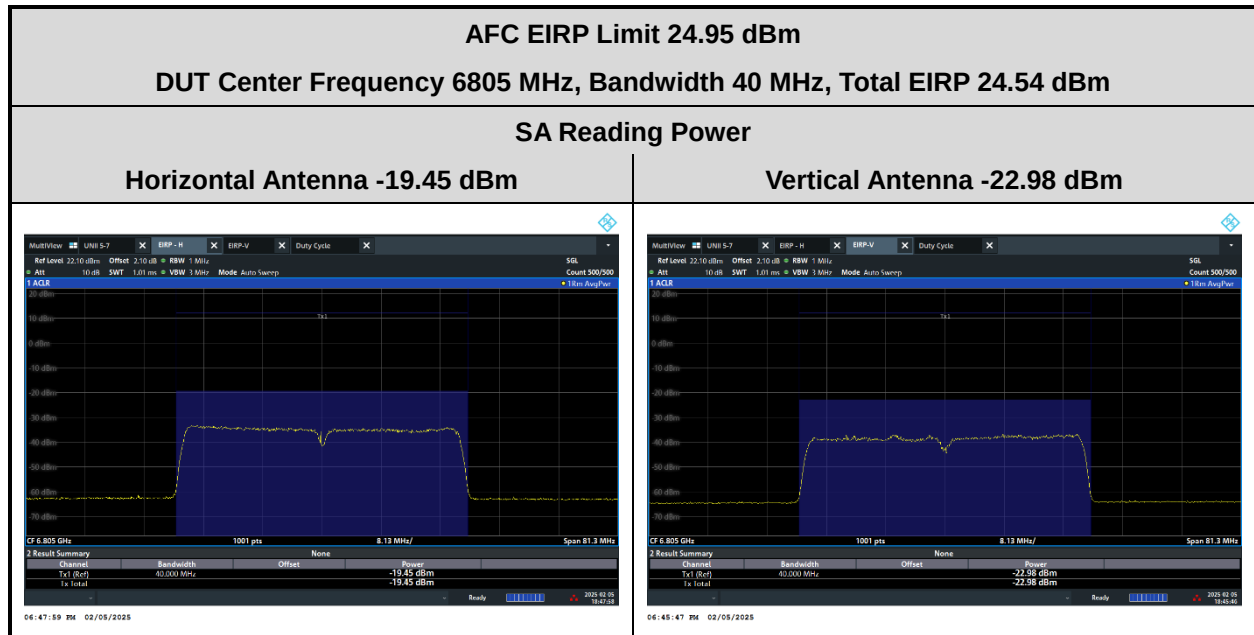

4.4 Unsuccessful spectrum access update

#	Description	Results
1	If the AFC DUT is Standard Power Access Point, go to Step 2, else go to Step 12	Go to step 12
2	AFC DUT set to Initial Pre-test State. If needed (see Table 5 declaration), configure the AFC DUT with BSS parameters per Table 9 and a temporary test regulatory identifier (e.g., FCC ID), geographic coordinates, antenna height, and uncertainty parameters. Configure the DUT with AFC System URL and server root certificate. Trigger the DUT to send to the AFC DUT Test Harness an Available Spectrum Inquiry Request using either In-band or Out-of-band methods.	Not applicable
3	AFC DUT sends a valid Available Spectrum Inquiry Request containing the inquiredFrequencyRange and/or the inquiredChannels fields.	Not applicable
4	AFC DUT Test Harness validates mandatory registration information	Not applicable
5	AFC DUT Test Harness sends an Available Spectrum Inquiry Response containing a list of available frequency ranges and/or channels and the maximum permissible transmit power in the availableFrequencyInfo and/or availableChannelInfo fields.	Not applicable

#	Description	Results
6	Throughout the Step 2 to 5, RF Test Equipment monitors the output of the AFC DUT to confirm that the AFC DUT does not transmit: ● In the band if the AFC DUT supports only SP operation Or ● Above LPI limits for AFC DUT whose manufacturer attests to its compliance with rules for LPI operation Wait for 60 seconds RF Test Equipment monitors any transmission by the AFC DUT conforms to the following: ● For SP only operation, AFC DUT conforms to the conditions contained in the Available Spectrum Inquiry Response and does not exceed emissions limits in adjacent frequencies. For AFC DUT whose manufacturer attests to its compliance with rules for LPI operation, AFC DUT transmit power in the band is less than CEILING [LPI limits, SP limits contained in the Available Spectrum Inquiry Response] and does not exceed emissions limits in adjacent frequencies	Not applicable
7	AFC DUT is power cycled. If needed (see Table 5declaration), configure the AFC DUT with a temporary test regulatory identifier (e.g., FCC ID), new geographic coordinates, antenna height, and uncertainty parameters. Configure the AFC DUT with AFC System URL and server root certificate.	Not applicable
8	Wait for 60 seconds ● If the AFC DUT does not send an Available Spectrum Inquiry Request, RF Test Equipment monitors the output of the DUT to verify the following and STOP the test: ■ For SP only operation, AFC DUT does not transmit in the band, ■ For AFC DUT whose manufacturer attests to its compliance with rules for LPI operation, the AFC DUT does not transmit above LPI limits. ● If the AFC DUT sends an Available Spectrum Inquiry Request, then CONTINUE with Step 8	Not applicable
9	AFC DUT Test Harness evaluates validity of mandatory registration information.	Not applicable

#	Description	Results
10	AFC DUT Test Harness sends an Available Spectrum Inquiry Response indicating that no frequency ranges and/or channels are available.	Not applicable
11	Throughout Step 7 to 10 and subsequent to Step 10 Test Equipment monitors the output of the AFC DUT to confirm that: For SP only operation, AFC DUT does not transmit in the band. For AFC DUT whose manufacturer attests to its compliance with rules for LPI operation, the AFC DUT does not transmit above LPI limits.	Not applicable
12	If the AFC DUT is Fixed Client, go to Step 13 else Stop the test	Go to step 13
13	The AFC DUT set to Initial Pre-test State.	Done
14	If needed (see Table 5 declaration), configure the DUT with a temporary test regulatory identifier (e.g., FCC ID), geographic coordinates, antenna height, and uncertainty parameters. Configure the AFC DUT with AFC System URL and server root certificate. Trigger the AFC DUT to send to the AFC DUT Test Harness an Available Spectrum Inquiry Request using either In-band or Out-of-band methods.	Done
15	AFC DUT sends a valid Available Spectrum Inquiry Request containing the inquiredFrequencyRange and/or the inquiredChannels fields*	PASS
16	AFC DUT Test Harness validates the presence of mandatory registration information	PASS
17	AFC DUT Test Harness sends an Available Spectrum Inquiry Response containing a list of available frequency ranges and/or channels and the maximum permissible transmit power in the availableFrequencyInfo and/or availableChannelInfo fields.	Done
18	If AFC DUT used Out-of-band method, initiate connection procedure between AFC DUT and SP Access Point by following instructions provided by the AFC DUT Vendor	Done
19	Wait for 60 seconds RF Test Equipment monitors any transmission by the AFC DUT conforms to the conditions contained in the Available Spectrum Inquiry Response and does not exceed emissions limits in adjacent frequencies	PASS

#	Description	Results
20	AFC DUT is power cycled. If needed (see Table 5 declaration), configure the AFC DUT with a temporary test regulatory identifier (e.g., FCC ID or IC ID), new geographic coordinates, antenna height, and uncertainty parameters. Configure the AFC DUT with AFC System URL and server root certificate	Done
21	Wait for 60 seconds If the AFC DUT does not send an Available Spectrum Inquiry Request, RF Test Equipment monitors that the AFC DUT does not transmit above maximum transmit power limits advertised by the Standard Power Access Point for Standard Client Devices in the channel., If the AFC DUT sends an Available Spectrum Inquiry Request, then CONTINUE with Step 22 else STOP the test	PASS
22	AFC DUT Test Harness evaluates validity of mandatory registration information.	PASS
23	AFC DUT Test Harness sends an Available Spectrum Inquiry Response indicating that no frequency ranges and/or channels are available.	Done
24	If AFC DUT used Out-of-band method, initiate connection procedure between AFC DUT and SP Access Point by following instructions provided by the AFC DUT Vendor	Done
25	Wait for 60 seconds RF Test Equipment monitors that the AFC DUT does not transmit above maximum transmit power limits advertised by the Standard Power Access Point for Standard Client Devices in the channel.	PASS

4.4.1 AFCD.UAU Test Vectors

Test Vector	Test Category	Results
AFCD.UAU	Unsuccessful spectrum access update	PASS

4.5 Unsuccessful server validation


#	Description	Results
1	The AFC DUT set to Initial Pre-test State. If needed (see Table 5 declaration), configure the AFC DUT with BSS parameters per Table 9 and a temporary test regulatory identifier (e.g., FCC ID), geographic coordinates, antenna height, and uncertainty parameters. Configure the AFC DUT Test Harness with TLS configuration that is the same as the default configuration defined in Section 2.3.1 except for the following: ● Run 1: A different server certificate (and private key) with SAN domain name entry "badafc.com" (i.e. that does not match AFC system URL's domain name); signed by the same root certificate as per Section 2.3.1 ● Run 2: A different server certificate (and private key) where all attributes other than Public Key are the same as the server certificate per Section 2.3.1, but the certificate is signed by a different root certificate ● Run 3: A different server certificate (and private key) with SAN domain name entry "wfatestorg.org" only (i.e. SAN domain name only matches suffix of AFC server's hostname); signed by the same root certificate as per Section 2.3.1 ● Run 4: A different server certificate (and private key) where all attributes other than Public Key are the same as the server certificate per Section 2.3.1 signed by the same root certificate as per Section 2.3.1, but the server certificate is revoked as indicated in stapled OCSP response ● Run 5: Same configuration as per Section 2.3.1, except OCSP stapling is disabled and CRL/OCSP servers are not available ● Run 6: Same configuration as per Section 2.3.1, except stapled OCSP response has expired and CRL/OCSP servers are not available ● Run 7: Same configuration as per Section 2.3.1, except only the TLS cipher suite "eNULL" (no encryption) is enabled ● Run 8: N/A (same configuration as per Section 2.3.1) Configure the DUT with the AFC System URL and the following root certificate: ● Runs 1-7: Root certificate as per Section 2.3.1 ● Run 8: No root certificate Trigger the DUT to send to the AFC DUT Test Harness an Available Spectrum Inquiry Request.	Done

#	Description	Results
2	AFC DUT Test Harness waits 10 seconds, and verifies no Available Spectrum Inquiry Request is sent to it.	PASS
3	Steps 1 and 2 are repeated for each of the remaining Runs	PASS

4.5.1 AFCD.USV Test Vectors

Test Vector	Test Category	Results
AFCD.USV	Unsuccessful server validation	PASS

Appendix A. Setup Photographs

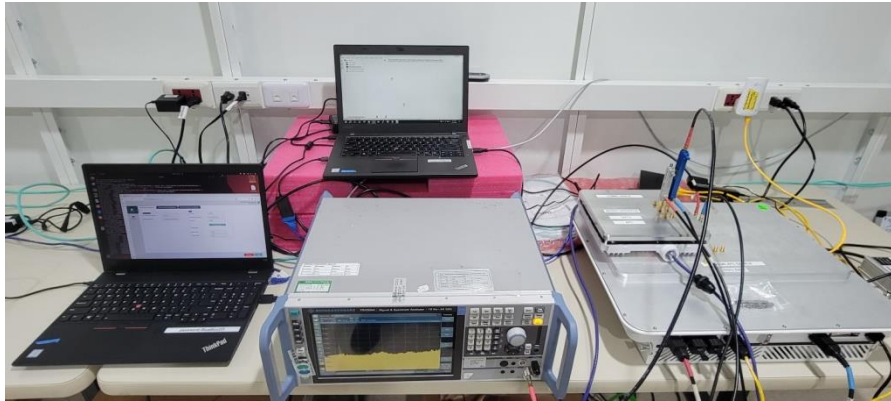



Appendix B. AFC DUT Test Logs and Tool Report

Section	Test Case ID	Test Description	FCC Requirement	Short Description	Test Result
4.1	AFCD.RSA	Successful registration and spectrum access request	47 CFR Section 15.407(k)(1)	Transmit only as instructed by AFC System	PASS
			47 CFR Section 15.407(k)(8)(i)	Register with AFC System prior to initial transmission	
			47 CFR Section 15.407(k)(8)(ii)	Provide required registration parameters	
			47 CFR Section 15.407(k)(8)(iii)	Registration either directly or via proxy	
			47 CFR Section 15.407(l)(ii)	Determination of appropriate channel configuration implied by AFC System response	
			47 CFR 15.407(k)(8)(iv)	Must contact an AFC system at least once per day to obtain the latest list of available frequencies and the maximum permissible power	

Note: For AFCD.RSA test logs, please refer to section B.1.

Section	Test Case ID	Test Description	FCC Requirement	Short Description	Test Result
4.2	AFCD.USA	Unsuccessful registration and spectrum access request	47 CFR Section 15.407(k)(1)	Transmit only as instructed by AFC System	PASS
			47 CFR Section 15.407(k)(8)(i)	Register with AFC System prior to initial transmission	
			47 CFR Section 15.407(k)(8)(ii)	Provide required registration parameters	
			47 CFR Section 15.407(k)(8)(iii)	Registration either directly or via proxy	

Note: For AFCD.USA test logs, please refer to section B.2.



Section	Test Case ID	Test Description	FCC Requirement	Short Description	Test Result
4.3	AFCD.SAU	Successful spectrum access update	47 CFR Section 15.407(k)(8)(i)	Register with AFC System after change of location	PASS
			47 CFR Section 15.407(k)(8)(ii)	Update AFC System upon change of registration parameters	
			47 CFR Section 15.407(k)(9)(i)	Report location and uncertainty from power-off condition	

Note: For AFCD.SAU test logs, please refer to section B.3.

Section	Test Case ID	Test Description	FCC Requirement	Short Description	Test Result
4.4	AFCD.UAU	Unsuccessful spectrum access update	47 CFR Section 15.407(k)(8)(i)	Register with AFC System after change of location	PASS
			47 CFR Section 15.407(k)(8)(ii)	Update AFC System upon change of registration parameters	
			47 CFR Section 15.407(k)(9)(i)	Report location and uncertainty from power-off condition	

Note: For AFCD.UAU test logs, please refer to section B.4.

Section	Test Case ID	Test Description	FCC Requirement	Short Description	Test Result
4.5	AFCD.USV	Unsuccessful server validation	47 CFR Section 15.407(k)(8)(v)	Incorporate adequate security measurements to prevent it from accessing AFC systems not approved by the FCC	PASS

Note: For AFCD.USV test logs, please refer to section B.5.

**B.1. Successful registration and spectrum access request (RSA)****B.1.1. AFC DUT Compliance Test Report****RSA Test 1****AFC DUT Compliance Test Report****DUT Information**

AFC DUT System	Fixed Client
DUT Vendor Name	Tarana
DUT Product Model	RNv

Test Result

FCC Requirements	TestCaseName	Test Result
15.407(k)(1), 15.407(k)(8)(i), 15.407(k)(8)(ii), 15.407(k)(8)(iii), 15.407(l)(ii)	CT_AFC_FC_STA_AFCDRSA31_Channel_40MHz_10648_1 (Successful registration and spectrum access request)	PASS

Test Measurements

TestCaseName: CT_AFC_FC_STA_AFCDRSA31_Channel_40MHz_10648_1 (Successful registration and spectrum access request)
TestResult:PASS
Band:6GHz

Measurements Name	Description	Value	Validation Result
AFC_DUT_SEND_SPECTRUM_INQUIRYREQUEST	AFC DUT sends an Available Spectrum Inquiry Request	true	PASS
AFC_DUT_SPECTRUM_INQUIRYREQUEST_VALID	Valid mandatory registration information	true	PASS
AFC_DUT_CONFORM_SPECTRUM_INQUIRYRESPONSE	AFC DUT conforms to the conditions in Spectrum Response (36.0 dBm EIRP) on channel center frequency index 19 bandwidth 40.	true	PASS

RSA Test 2**AFC DUT Compliance Test Report****DUT Information**

AFC DUT System	Fixed Client
DUT Vendor Name	Tarana
DUT Product Model	RNv

Test Result

FCC Requirements	TestCaseName	Test Result
15.407(k)(1), 15.407(k)(8)(i), 15.407(k)(8)(ii), 15.407(k)(8)(iii), 15.407(l)(ii)	CT_AFC_FC_STA_AFCDRSA31_Channel_40MHz_10648_1 (Successful registration and spectrum access request)	PASS

Test Measurements

TestCaseName: CT_AFC_FC_STA_AFCDRSA31_Channel_40MHz_10648_1 (Successful registration and spectrum access request)
TestResult:PASS
Band:6GHz

Measurements Name	Description	Value	Validation Result
AFC_DUT_SEND_SPECTRUM_INQUIRYREQUEST	AFC DUT sends an Available Spectrum Inquiry Request	true	PASS
AFC_DUT_SPECTRUM_INQUIRYREQUEST_VALID	Valid mandatory registration information	true	PASS
AFC_DUT_CONFORM_SPECTRUM_INQUIRYRESPONSE	AFC DUT conforms to the conditions in Spectrum Response (31.358116710441205 dBm EIRP) on channel center frequency index 3 bandwidth 40.	true	PASS

B.1.2. DUT Available Spectrum Inquiry Request-Response

RSA Test 1

```
##### 2025-02-06T02:50:07Z #####
{
  "headers": {
    "Host": "testserver.wfatestorg.org",
    "Accept": "*/*",
    "Content-Type": "application/json",
    "Accept-Encoding": "gzip",
    "User-Agent": "okhttp/2.7.5",
    "X-Forwarded-For": "52.26.231.101",
    "X-Forwarded-Host": "testserver.wfatestorg.org",
    "X-Forwarded-Server": "testserver.wfatestorg.org",
    "Content-Length": "537",
    "Connection": "Keep-Alive"
  },
  "body": {
    "version": "1.4",
    "availableSpectrumInquiryRequests": [
      {
        "requestId": "S171F2223507676-1738810202757",
        "deviceDescriptor": {
          "serialNumber": "S171F2223507676",
          "certificationId": [
            {
              "rulesetId": "US_47_CFR_PART_15_SUBPART_E",
              "id": "2ABOF-G1BN6ASI002"
            }
          ]
        },
        "location": {
          "ellipse": {
            "center": {
              "longitude": -115.30364,
              "latitude": 36.189533
            },
            "minorAxis": 10,
            "majorAxis": 10,
            "orientation": 0.0
          },
          "elevation": {
            "height": 0.0,
            "heightType": "AGL",
            "verticalUncertainty": 1
          },
          "indoorDeployment": 2
        },
        "inquiredChannels": [
          {
            "globalOperatingClass": 132
          }
        ],
        "minDesiredPower": -175.0
      }
    ]
  }
}
```

```
    }
  ]
}

##### 2025-02-06T02:50:07Z #####
{
  "headers": {
    "Host": "testserver.wfatestorg.org",
    "Accept": "*/*",
    "Content-Type": "application/json",
    "Accept-Encoding": "gzip",
    "User-Agent": "okhttp/2.7.5",
    "X-Forwarded-For": "52.26.231.101",
    "X-Forwarded-Host": "testserver.wfatestorg.org",
    "X-Forwarded-Server": "testserver.wfatestorg.org",
    "Content-Length": "535",
    "Connection": "Keep-Alive"
  },
  "body": {
    "version": "1.4",
    "availableSpectrumInquiryRequests": [
      {
        "requestId": "M228A1245000133-1738810197195",
        "deviceDescriptor": {
          "serialNumber": "M228A1245000133",
          "certificationId": [
            {
              "rulesetId": "US_47_CFR_PART_15_SUBPART_E",
              "id": "2ABOF-G1RN6AHB012"
            }
          ]
        }
      }
    ],
    "location": {
      "ellipse": {
        "center": {
          "longitude": -115.30756,
          "latitude": 39.4188
        },
        "minorAxis": 10,
        "majorAxis": 10,
        "orientation": 0.0
      },
      "elevation": {
        "height": 0.0,
        "heightType": "AGL",
        "verticalUncertainty": 1
      },
      "indoorDeployment": 2
    },
    "inquiredChannels": [
      {
        "globalOperatingClass": 132
      }
    ]
  }
}
```



```
    ],
    "minDesiredPower": -175.0
  }
]
}

##### 2025-02-06T02:50:07Z #####
{
  "availableSpectrumInquiryResponses": [
    {
      "response": {
        "responseCode": 0,
        "shortDescription": "SUCCESS"
      },
      "availableChannelInfo": [
        {
          "channelCfi": [
            3,
            11,
            19,
            27,
            35,
            43,
            51,
            59,
            67,
            75,
            83,
            91,
            123,
            131,
            139,
            147,
            155,
            163,
            171,
            179
          ],
          "globalOperatingClass": 132,
          "maxEirp": [
            26.504726644465933,
            31.138815640543456,
            36.0,
            34.94571966487374,
            26.591235148404735,
            34.84069527813757,
            25.19693150929523,
            31.197112299308095,
            34.46312760898016,
            31.871873176267965,
            24.120712505532122,
            24.167976135615376,
            26.247065424614597,
```



```
                26.016177173198546,
                26.02579190304984,
                28.92518237320654,
                26.191050440023943,
                36.0,
                26.90870138218972,
                29.64900677203037
            ]
        }
    ],
    "requestId": "M228A1245000133-1738810197195",
    "availabilityExpireTime": "2025-02-07T02:50:07Z",
    "rulesetId": "US_47_CFR_PART_15_SUBPART_E"
}
],
"version": "1.4"
}

##### 2025-02-06T02:50:07Z #####
{
    "availableSpectrumInquiryResponses": [
        {
            "response": {
                "responseCode": 0,
                "shortDescription": "SUCCESS"
            },
            "availableChannelInfo": [
                {
                    "channelCfi": [
                        3,
                        11,
                        19,
                        27,
                        35,
                        43,
                        51,
                        59,
                        67,
                        75,
                        83,
                        91,
                        123,
                        131,
                        139,
                        147,
                        155,
                        163,
                        171,
                        179
                    ],
                    "globalOperatingClass": 132,
                    "maxEirp": [
                        26.504726644465933,
                        31.138815640543456,
```



```
36.0,
34.94571966487374,
26.591235148404735,
34.84069527813757,
25.19693150929523,
31.197112299308095,
34.46312760898016,
31.871873176267965,
24.120712505532122,
24.167976135615376,
26.247065424614597,
26.016177173198546,
26.02579190304984,
28.92518237320654,
26.191050440023943,
36.0,
26.90870138218972,
29.64900677203037
    ]
  }
},
"requestId": "M228A1245000133-1738810197195",
"availabilityExpireTime": "2025-02-07T02:50:07Z",
"rulesetId": "US_47_CFR_PART_15_SUBPART_E"
}
],
"version": "1.4"
}

##### 2025-02-06T02:50:30Z #####
{
  "headers": {
    "Host": "testserver.wfatestorg.org",
    "Accept": "*/*",
    "Content-Type": "application/json",
    "Accept-Encoding": "gzip",
    "User-Agent": "okhttp/2.7.5",
    "X-Forwarded-For": "52.26.231.101",
    "X-Forwarded-Host": "testserver.wfatestorg.org",
    "X-Forwarded-Server": "testserver.wfatestorg.org",
    "Content-Length": "535",
    "Connection": "Keep-Alive"
  },
  "body": {
    "version": "1.4",
    "availableSpectrumInquiryRequests": [
      {
        "requestId": "M228A1245000133-1738810230525",
        "deviceDescriptor": {
          "serialNumber": "M228A1245000133",
          "certificationId": [
            {
              "rulesetId": "US_47_CFR_PART_15_SUBPART_E",
              "id": "2ABOF-G1RN6AHB012"
            }
          ]
        }
      }
    ]
  }
}
```



```
    }
  ]
},
"location": {
  "ellipse": {
    "center": {
      "longitude": -115.30756,
      "latitude": 39.4188
    },
    "minorAxis": 10,
    "majorAxis": 10,
    "orientation": 0.0
  },
  "elevation": {
    "height": 0.0,
    "heightType": "AGL",
    "verticalUncertainty": 1
  },
  "indoorDeployment": 2
},
"inquiredChannels": [
  {
    "globalOperatingClass": 132
  }
],
"minDesiredPower": -175.0
}
]
}
```

2025-02-06T02:50:30Z

```
{
  "availableSpectrumInquiryResponses": [
    {
      "response": {
        "responseCode": 0,
        "shortDescription": "SUCCESS"
      },
      "availableChannelInfo": [
        {
          "channelCfi": [
            3,
            11,
            19,
            27,
            35,
            43,
            51,
            59,
            67,
            75,
            83,
            91,
```



```
123,
131,
139,
147,
155,
163,
171,
179
],
"globalOperatingClass": 132,
"maxEirp": [
  26.504726644465933,
  31.138815640543456,
  36.0,
  34.94571966487374,
  26.591235148404735,
  34.84069527813757,
  25.19693150929523,
  31.197112299308095,
  34.46312760898016,
  31.871873176267965,
  24.120712505532122,
  24.167976135615376,
  26.247065424614597,
  26.016177173198546,
  26.02579190304984,
  28.92518237320654,
  26.191050440023943,
  36.0,
  26.90870138218972,
  29.64900677203037
]
}
],
"requestId": "M228A1245000133-1738810230525",
"availabilityExpireTime": "2025-02-07T02:50:30Z",
"rulesetId": "US_47_CFR_PART_15_SUBPART_E"
}
],
"version": "1.4"
}
```

**RSA Test 2**

```
##### 2025-02-06T03:04:49Z #####
{
  "headers": {
    "Host": "testserver.wfatestorg.org",
    "Accept": "*/*",
    "Content-Type": "application/json",
    "Accept-Encoding": "gzip",
    "User-Agent": "okhttp/2.7.5",
    "X-Forwarded-For": "52.26.231.101",
    "X-Forwarded-Host": "testserver.wfatestorg.org",
    "X-Forwarded-Server": "testserver.wfatestorg.org",
    "Content-Length": "535",
    "Connection": "Keep-Alive"
  },
  "body": {
    "version": "1.4",
    "availableSpectrumInquiryRequests": [
      {
        "requestId": "M228A1245000133-1738811079379",
        "deviceDescriptor": {
          "serialNumber": "M228A1245000133",
          "certificationId": [
            {
              "rulesetId": "US_47_CFR_PART_15_SUBPART_E",
              "id": "2ABOF-G1RN6AHB012"
            }
          ]
        }
      }
    ],
    "location": {
      "ellipse": {
        "center": {
          "longitude": -115.30756,
          "latitude": 39.4188
        },
        "minorAxis": 10,
        "majorAxis": 10,
        "orientation": 0.0
      },
      "elevation": {
        "height": 0.0,
        "heightType": "AGL",
        "verticalUncertainty": 1
      },
      "indoorDeployment": 2
    },
    "inquiredChannels": [
      {
        "globalOperatingClass": 132
      }
    ],
    "minDesiredPower": -175.0
  }
}
```



```
}
}

##### 2025-02-06T03:04:49Z #####
{
  "headers": {
    "Host": "testserver.wfatestorg.org",
    "Accept": "*/*",
    "Content-Type": "application/json",
    "Accept-Encoding": "gzip",
    "User-Agent": "okhttp/2.7.5",
    "X-Forwarded-For": "52.26.231.101",
    "X-Forwarded-Host": "testserver.wfatestorg.org",
    "X-Forwarded-Server": "testserver.wfatestorg.org",
    "Content-Length": "536",
    "Connection": "Keep-Alive"
  },
  "body": {
    "version": "1.4",
    "availableSpectrumInquiryRequests": [
      {
        "requestId": "S171F2223507676-1738811087379",
        "deviceDescriptor": {
          "serialNumber": "S171F2223507676",
          "certificationId": [
            {
              "rulesetId": "US_47_CFR_PART_15_SUBPART_E",
              "id": "2ABOF-G1BN6ASI002"
            }
          ]
        }
      }
    ],
    "location": {
      "ellipse": {
        "center": {
          "longitude": -115.30364,
          "latitude": 36.18952
        },
        "minorAxis": 10,
        "majorAxis": 10,
        "orientation": 0.0
      },
      "elevation": {
        "height": 0.0,
        "heightType": "AGL",
        "verticalUncertainty": 1
      },
      "indoorDeployment": 2
    },
    "inquiredChannels": [
      {
        "globalOperatingClass": 132
      }
    ],
    "minDesiredPower": -175.0
  }
}
```



```
    }
  ]
}

##### 2025-02-06T03:04:49Z #####
{
  "availableSpectrumInquiryResponses": [
    {
      "response": {
        "responseCode": 0,
        "shortDescription": "SUCCESS"
      },
      "availableChannelInfo": [
        {
          "channelCfi": [
            3,
            11,
            19,
            27,
            35,
            43,
            51,
            59,
            67,
            75,
            83,
            91,
            123,
            131,
            139,
            147,
            155,
            163,
            171,
            179
          ],
          "globalOperatingClass": 132,
          "maxEirp": [
            31.358116710441205,
            29.566994651677533,
            30.698746530884605,
            30.451955587575707,
            28.615195368567317,
            24.239680518836437,
            34.35667348665206,
            27.594438510398135,
            28.53334938326685,
            25.648721373835958,
            26.795772130508723,
            30.70283890778395,
            27.35466880400162,
            31.742024970191,
            29.03100445138297,
```



```
                26.773473467662036,
                24.611187321424282,
                27.598583163126655,
                24.47812883382373,
                29.65580017440892
            ]
        }
    ],
    "requestId": "S171F2223507676-1738811087379",
    "availabilityExpireTime": "2025-02-07T03:04:49Z",
    "rulesetId": "US_47_CFR_PART_15_SUBPART_E"
}
],
"version": "1.4"
}

##### 2025-02-06T03:04:49Z #####
{
    "availableSpectrumInquiryResponses": [
        {
            "response": {
                "responseCode": 0,
                "shortDescription": "SUCCESS"
            },
            "availableChannelInfo": [
                {
                    "channelCfi": [
                        3,
                        11,
                        19,
                        27,
                        35,
                        43,
                        51,
                        59,
                        67,
                        75,
                        83,
                        91,
                        123,
                        131,
                        139,
                        147,
                        155,
                        163,
                        171,
                        179
                    ],
                    "globalOperatingClass": 132,
                    "maxEirp": [
                        31.358116710441205,
                        29.566994651677533,
                        30.698746530884605,
                        30.451955587575707,
```



```
28.615195368567317,
24.239680518836437,
34.35667348665206,
27.594438510398135,
28.53334938326685,
25.648721373835958,
26.795772130508723,
30.70283890778395,
27.35466880400162,
31.742024970191,
29.03100445138297,
26.773473467662036,
24.611187321424282,
27.598583163126655,
24.47812883382373,
29.65580017440892
    ]
  }
],
"requestId": "S171F2223507676-1738811087379",
"availabilityExpireTime": "2025-02-07T03:04:49Z",
"rulesetId": "US_47_CFR_PART_15_SUBPART_E"
}
],
"version": "1.4"
}

##### 2025-02-06T03:05:31Z #####
{
  "headers": {
    "Host": "testserver.wfatestorg.org",
    "Accept": "*/*",
    "Content-Type": "application/json",
    "Accept-Encoding": "gzip",
    "User-Agent": "okhttp/2.7.5",
    "X-Forwarded-For": "52.26.231.101",
    "X-Forwarded-Host": "testserver.wfatestorg.org",
    "X-Forwarded-Server": "testserver.wfatestorg.org",
    "Content-Length": "535",
    "Connection": "Keep-Alive"
  },
  "body": {
    "version": "1.4",
    "availableSpectrumInquiryRequests": [
      {
        "requestId": "M228A1245000133-1738811131091",
        "deviceDescriptor": {
          "serialNumber": "M228A1245000133",
          "certificationId": [
            {
              "rulesetId": "US_47_CFR_PART_15_SUBPART_E",
              "id": "2ABOF-G1RN6AHB012"
            }
          ]
        }
      }
    ]
  }
}
```



```
    },
    "location": {
      "ellipse": {
        "center": {
          "longitude": -115.30756,
          "latitude": 39.4188
        },
        "minorAxis": 10,
        "majorAxis": 10,
        "orientation": 0.0
      },
      "elevation": {
        "height": 0.0,
        "heightType": "AGL",
        "verticalUncertainty": 1
      },
      "indoorDeployment": 2
    },
    "inquiredChannels": [
      {
        "globalOperatingClass": 132
      }
    ],
    "minDesiredPower": -175.0
  }
}
```

2025-02-06T03:05:31Z

```
{
  "availableSpectrumInquiryResponses": [
    {
      "response": {
        "responseCode": 0,
        "shortDescription": "SUCCESS"
      },
      "availableChannelInfo": [
        {
          "channelCfi": [
            3,
            11,
            19,
            27,
            35,
            43,
            51,
            59,
            67,
            75,
            83,
            91,
            123,
            131,
```



```
139,  
147,  
155,  
163,  
171,  
179  
],  
"globalOperatingClass": 132,  
"maxEirp": [  
  31.358116710441205,  
  29.566994651677533,  
  30.698746530884605,  
  30.451955587575707,  
  28.615195368567317,  
  24.239680518836437,  
  34.35667348665206,  
  27.594438510398135,  
  28.53334938326685,  
  25.648721373835958,  
  26.795772130508723,  
  30.70283890778395,  
  27.35466880400162,  
  31.742024970191,  
  29.03100445138297,  
  26.773473467662036,  
  24.611187321424282,  
  27.598583163126655,  
  24.47812883382373,  
  29.65580017440892  
]  
}  
],  
"requestId": "M228A1245000133-1738811131091",  
"availabilityExpireTime": "2025-02-07T03:05:31Z",  
"rulesetId": "US_47_CFR_PART_15_SUBPART_E"  
}  
],  
"version": "1.4"  
}
```

**B.2. Unsuccessful registration and spectrum access request (USA)****B.2.1. AFC DUT Compliance Test Report****AFC DUT Compliance Test Report****DUT Information**

AFC DUT System	Fixed Client
DUT Vendor Name	Tarana
DUT Product Model	RNv

Test Result

FCC Requirements	TestCaseName	Test Result
15.407(k)(1), 15.407(k)(8)(i), 15.407(k)(8)(ii), 15.407(k)(8)(iii)	CT_AFC_FC_STA_AFCDUSA32_Channel_10651_1 (Unsuccessful registration and spectrum access request)	PASS

Test Measurements

TestCaseName: CT_AFC_FC_STA_AFCDUSA32_Channel_10651_1 (Unsuccessful registration and spectrum access request)
TestResult: PASS
Band: 6GHz

Measurements Name	Description	Value	Validation Result
AFC_DUT_SEND_SPECTRUM_INQUIRYREQUEST	AFC DUT sends an Available Spectrum Inquiry Request	true	PASS
AFC_DUT_SPECTRUM_INQUIRYREQUEST_VALID	Valid mandatory registration information	true	PASS
AFC_DUT_CONFORM_SPECTRUM_INQUIRYRESPONSE	AFC DUT conforms to the conditions in the Spectrum Inquiry Response	true	PASS

B.2.2. DUT Available Spectrum Inquiry Request-Response

```
##### 2025-02-05T02:21:13Z #####
{
  "headers": {
    "Host": "testserver.wfatestorg.org",
    "Accept": "*/*",
    "Content-Type": "application/json",
    "Accept-Encoding": "gzip",
    "User-Agent": "okhttp/2.7.5",
    "X-Forwarded-For": "52.26.231.101",
    "X-Forwarded-Host": "testserver.wfatestorg.org",
    "X-Forwarded-Server": "testserver.wfatestorg.org",
    "Content-Length": "537",
    "Connection": "Keep-Alive"
  },
  "body": {
    "version": "1.4",
    "availableSpectrumInquiryRequests": [
      {
        "requestId": "S171F2223507676-1738722062857",
        "deviceDescriptor": {
          "serialNumber": "S171F2223507676",
          "certificationId": [
            {
              "rulesetId": "US_47_CFR_PART_15_SUBPART_E",
              "id": "2ABOF-G1BN6ASI002"
            }
          ]
        }
      }
    ]
  }
}
```



```
        "location": {
          "ellipse": {
            "center": {
              "longitude": -115.30364,
              "latitude": 36.189526
            },
            "minorAxis": 10,
            "majorAxis": 10,
            "orientation": 0.0
          },
          "elevation": {
            "height": 0.0,
            "heightType": "AGL",
            "verticalUncertainty": 1
          },
          "indoorDeployment": 2
        },
        "inquiredChannels": [
          {
            "globalOperatingClass": 132
          }
        ],
        "minDesiredPower": -175.0
      }
    ]
  }
}

##### 2025-02-05T02:21:13Z #####
{
  "headers": {
    "Host": "testserver.wfatestorg.org",
    "Accept": "*/*",
    "Content-Type": "application/json",
    "Accept-Encoding": "gzip",
    "User-Agent": "okhttp/2.7.5",
    "X-Forwarded-For": "52.26.231.101",
    "X-Forwarded-Host": "testserver.wfatestorg.org",
    "X-Forwarded-Server": "testserver.wfatestorg.org",
    "Content-Length": "535",
    "Connection": "Keep-Alive"
  },
  "body": {
    "version": "1.4",
    "availableSpectrumInquiryRequests": [
      {
        "requestId": "M228A1245000133-1738722069097",
        "deviceDescriptor": {
          "serialNumber": "M228A1245000133",
          "certificationId": [
            {
              "rulesetId": "US_47_CFR_PART_15_SUBPART_E",
              "id": "2ABOF-G1RN6AHB012"
            }
          ]
        }
      }
    ]
  }
}
```



```
    ],
    },
    "location": {
      "ellipse": {
        "center": {
          "longitude": -115.30756,
          "latitude": 39.4188
        },
        "minorAxis": 10,
        "majorAxis": 10,
        "orientation": 0.0
      },
      "elevation": {
        "height": 0.0,
        "heightType": "AGL",
        "verticalUncertainty": 1
      },
      "indoorDeployment": 2
    },
    "inquiredChannels": [
      {
        "globalOperatingClass": 132
      }
    ],
    "minDesiredPower": -175.0
  }
}

##### 2025-02-05T02:21:13Z #####
{
  "availableSpectrumInquiryResponses": [
    {
      "response": {
        "responseCode": 0,
        "shortDescription": "SUCCESS"
      },
      "availableChannelInfo": [],
      "requestId": "M228A1245000133-1738722069097",
      "availabilityExpireTime": "2025-02-06T02:21:13Z",
      "rulesetId": "US_47_CFR_PART_15_SUBPART_E"
    }
  ],
  "version": "1.4"
}

##### 2025-02-05T02:21:13Z #####
{
  "availableSpectrumInquiryResponses": [
    {
      "response": {
        "responseCode": 0,
        "shortDescription": "SUCCESS"
      }
    }
  ]
}
```



```
    },
    "availableChannelInfo": [],
    "requestId": "M228A1245000133-1738722069097",
    "availabilityExpireTime": "2025-02-06T02:21:13Z",
    "rulesetId": "US_47_CFR_PART_15_SUBPART_E"
  }
},
"version": "1.4"
}
```



B.3. Successful spectrum access update (SAU)

B.3.1. AFC DUT Compliance Test Report

AFC DUT Compliance Test Report

DUT Information

AFC DUT System	Fixed Client
DUT Vendor Name	Tarana
DUT Product Model	RNv

Test Result

FCC Requirements	TestCaseName	Test Result
15.407(k)(9)(i), 15.407(k)(9)(ii), 15.407(k)(9)(i)	CT_AFC_FC_STA_AFCD5AU33_Channel_10652_1 (Successful spectrum access update)	PASS

Test Measurements

TestCaseName: CT_AFC_FC_STA_AFCD5AU33_Channel_10652_1 (Successful spectrum access update)
TestResult: PASS
Band: 6GHz

Measurements Name	Description	Value	Validation Result
AFC_DUT_SEND_SPECTRUM_INQUIRYREQUEST	AFC DUT sends an Available Spectrum Inquiry Request	true	PASS
AFC_DUT_SPECTRUM_INQUIRYREQUEST_VALID_1	Valid mandatory registration information	true	PASS
AFC_DUT_CONFORM_SPECTRUM_INQUIRYRESPONSE_1	AFC DUT conforms to the conditions in Spectrum Response (34.48710677778148 dBm EIRP) on channel 83 bandwidth 20.	true	PASS
AFC_DUT_SPECTRUM_INQUIRYREQUEST_VALID_2	Valid mandatory registration information	true	PASS
AFC_DUT_SP_OPERATION_2	AFC DUT transmit with standard power in the band before the Spectrum Inquiry Response	false	PASS
AFC_DUT_CONFORM_SPECTRUM_INQUIRYRESPONSE_2	AFC DUT conforms to the conditions in Spectrum Response (33.997065306845755 dBm EIRP) on channel 83 bandwidth 20.	true	PASS

B.3.2. DUT Available Spectrum Inquiry Request-Response

```
##### 2025-02-06T02:13:37Z #####
{
  "headers": {
    "Host": "testserver.wfatestorg.org",
    "Accept": "*/*",
    "Content-Type": "application/json",
    "Accept-Encoding": "gzip",
    "User-Agent": "okhttp/2.7.5",
    "X-Forwarded-For": "52.26.231.101",
    "X-Forwarded-Host": "testserver.wfatestorg.org",
    "X-Forwarded-Server": "testserver.wfatestorg.org",
    "Content-Length": "537",
    "Connection": "Keep-Alive"
  },
  "body": {
    "version": "1.4",
    "availableSpectrumInquiryRequests": [
      {
        "requestId": "S171F2223507676-1738808007543",
        "deviceDescriptor": {
          "serialNumber": "S171F2223507676",
          "certificationId": [
            {
              "rulesetId": "US_47_CFR_PART_15_SUBPART_E",
```

```

        "id": "2ABOF-G1BN6ASI002"
      }
    ]
  },
  "location": {
    "ellipse": {
      "center": {
        "longitude": -115.303635,
        "latitude": 36.18953
      },
      "minorAxis": 10,
      "majorAxis": 10,
      "orientation": 0.0
    },
    "elevation": {
      "height": 0.0,
      "heightType": "AGL",
      "verticalUncertainty": 1
    },
    "indoorDeployment": 2
  },
  "inquiredChannels": [
    {
      "globalOperatingClass": 132
    }
  ],
  "minDesiredPower": -175.0
}
]
}
}

##### 2025-02-06T02:13:37Z #####
{
  "headers": {
    "Host": "testserver.wfatestorg.org",
    "Accept": "*/*",
    "Content-Type": "application/json",
    "Accept-Encoding": "gzip",
    "User-Agent": "okhttp/2.7.5",
    "X-Forwarded-For": "52.26.231.101",
    "X-Forwarded-Host": "testserver.wfatestorg.org",
    "X-Forwarded-Server": "testserver.wfatestorg.org",
    "Content-Length": "535",
    "Connection": "Keep-Alive"
  },
  "body": {
    "version": "1.4",
    "availableSpectrumInquiryRequests": [
      {
        "requestId": "M228A1245000133-1738808011542",
        "deviceDescriptor": {
          "serialNumber": "M228A1245000133",
          "certificationId": [

```



```
        {
            "rulesetId": "US_47_CFR_PART_15_SUBPART_E",
            "id": "2ABOF-G1RN6AHB012"
        }
    ]
},
"location": {
    "ellipse": {
        "center": {
            "longitude": -115.30756,
            "latitude": 39.4188
        },
        "minorAxis": 10,
        "majorAxis": 10,
        "orientation": 0.0
    },
    "elevation": {
        "height": 0.0,
        "heightType": "AGL",
        "verticalUncertainty": 1
    },
    "indoorDeployment": 2
},
"inquiredChannels": [
    {
        "globalOperatingClass": 132
    }
],
"minDesiredPower": -175.0
}
]
}
}

##### 2025-02-06T02:13:37Z #####
{
    "availableSpectrumInquiryResponses": [
        {
            "response": {
                "responseCode": 0,
                "shortDescription": "SUCCESS"
            },
            "availableChannelInfo": [
                {
                    "channelCfi": [
                        3,
                        11,
                        19,
                        27,
                        35,
                        43,
                        51,
                        59,
                        67,
```



```
75,
83,
91,
123,
131,
139,
147,
155,
163,
171,
179
],
"globalOperatingClass": 132,
"maxEirp": [
  24.222640756910092,
  25.306301603524425,
  24.230855783557995,
  26.563254815310223,
  27.70768505967489,
  26.95525878475802,
  24.584606273137602,
  24.929938683830194,
  26.473268278693357,
  32.64921704369062,
  34.48710677778148,
  27.25522964540842,
  26.20250668518335,
  31.83941142898936,
  24.544829706646986,
  25.051761779952784,
  27.03201615900929,
  30.64982425189296,
  33.94703839533655,
  25.906016864939215
]
}
],
"requestId": "M228A1245000133-1738808011542",
"availabilityExpireTime": "2025-02-07T02:13:37Z",
"rulesetId": "US_47_CFR_PART_15_SUBPART_E"
}
],
"version": "1.4"
}

##### 2025-02-06T02:13:37Z #####
{
  "availableSpectrumInquiryResponses": [
    {
      "response": {
        "responseCode": 0,
        "shortDescription": "SUCCESS"
      },
      "availableChannelInfo": [
```



```
{
  "channelCfi": [
    3,
    11,
    19,
    27,
    35,
    43,
    51,
    59,
    67,
    75,
    83,
    91,
    123,
    131,
    139,
    147,
    155,
    163,
    171,
    179
  ],
  "globalOperatingClass": 132,
  "maxEirp": [
    24.222640756910092,
    25.306301603524425,
    24.230855783557995,
    26.563254815310223,
    27.70768505967489,
    26.95525878475802,
    24.584606273137602,
    24.929938683830194,
    26.473268278693357,
    32.64921704369062,
    34.48710677778148,
    27.25522964540842,
    26.20250668518335,
    31.83941142898936,
    24.544829706646986,
    25.051761779952784,
    27.03201615900929,
    30.64982425189296,
    33.94703839533655,
    25.906016864939215
  ]
},
{
  "requestId": "M228A1245000133-1738808011542",
  "availabilityExpireTime": "2025-02-07T02:13:37Z",
  "rulesetId": "US_47_CFR_PART_15_SUBPART_E"
},
{
  "version": "1.4"
}
```



```
}

##### 2025-02-06T02:14:30Z #####
{
  "headers": {
    "Host": "testserver.wfatestorg.org",
    "Accept": "*/*",
    "Content-Type": "application/json",
    "Accept-Encoding": "gzip",
    "User-Agent": "okhttp/2.7.5",
    "X-Forwarded-For": "52.26.231.101",
    "X-Forwarded-Host": "testserver.wfatestorg.org",
    "X-Forwarded-Server": "testserver.wfatestorg.org",
    "Content-Length": "535",
    "Connection": "Keep-Alive"
  },
  "body": {
    "version": "1.4",
    "availableSpectrumInquiryRequests": [
      {
        "requestId": "M228A1245000133-1738808070298",
        "deviceDescriptor": {
          "serialNumber": "M228A1245000133",
          "certificationId": [
            {
              "rulesetId": "US_47_CFR_PART_15_SUBPART_E",
              "id": "2ABOF-G1RN6AHB012"
            }
          ]
        }
      }
    ],
    "location": {
      "ellipse": {
        "center": {
          "longitude": -115.30756,
          "latitude": 39.4188
        },
        "minorAxis": 10,
        "majorAxis": 10,
        "orientation": 0.0
      },
      "elevation": {
        "height": 0.0,
        "heightType": "AGL",
        "verticalUncertainty": 1
      },
      "indoorDeployment": 2
    },
    "inquiredChannels": [
      {
        "globalOperatingClass": 132
      }
    ],
    "minDesiredPower": -175.0
  }
}
```



```
]
}
}

##### 2025-02-06T02:14:30Z #####
{
  "availableSpectrumInquiryResponses": [
    {
      "response": {
        "responseCode": 0,
        "shortDescription": "SUCCESS"
      },
      "availableChannelInfo": [
        {
          "channelCfi": [
            3,
            11,
            19,
            27,
            35,
            43,
            51,
            59,
            67,
            75,
            83,
            91,
            123,
            131,
            139,
            147,
            155,
            163,
            171,
            179
          ],
          "globalOperatingClass": 132,
          "maxEirp": [
            24.222640756910092,
            25.306301603524425,
            24.230855783557995,
            26.563254815310223,
            27.70768505967489,
            26.95525878475802,
            24.584606273137602,
            24.929938683830194,
            26.473268278693357,
            32.64921704369062,
            34.48710677778148,
            27.25522964540842,
            26.20250668518335,
            31.83941142898936,
            24.544829706646986,
            25.051761779952784,
```



```
                27.03201615900929,
                30.64982425189296,
                33.94703839533655,
                25.906016864939215
            ]
        }
    ],
    "requestId": "M228A1245000133-1738808070298",
    "availabilityExpireTime": "2025-02-07T02:14:30Z",
    "rulesetId": "US_47_CFR_PART_15_SUBPART_E"
}
],
"version": "1.4"
}

##### 2025-02-06T02:36:16Z #####
{
  "headers": {
    "Host": "testserver.wfatestorg.org",
    "Accept": "*/*",
    "Content-Type": "application/json",
    "Accept-Encoding": "gzip",
    "User-Agent": "okhttp/2.7.5",
    "X-Forwarded-For": "52.26.231.101",
    "X-Forwarded-Host": "testserver.wfatestorg.org",
    "X-Forwarded-Server": "testserver.wfatestorg.org",
    "Content-Length": "535",
    "Connection": "Keep-Alive"
  },
  "body": {
    "version": "1.4",
    "availableSpectrumInquiryRequests": [
      {
        "requestId": "M228A1245000133-1738809376390",
        "deviceDescriptor": {
          "serialNumber": "M228A1245000133",
          "certificationId": [
            {
              "rulesetId": "US_47_CFR_PART_15_SUBPART_E",
              "id": "2ABOF-G1RN6AHB012"
            }
          ]
        }
      }
    ],
    "location": {
      "ellipse": {
        "center": {
          "longitude": -115.30756,
          "latitude": 39.4188
        },
        "minorAxis": 10,
        "majorAxis": 10,
        "orientation": 0.0
      },
      "elevation": {
```

```

        "height": 0.0,
        "heightType": "AGL",
        "verticalUncertainty": 1
      },
      "indoorDeployment": 2
    },
    "inquiredChannels": [
      {
        "globalOperatingClass": 132
      }
    ],
    "minDesiredPower": -175.0
  }
]
}

##### 2025-02-06T02:36:16Z #####
{
  "headers": {
    "Host": "testserver.wfatestorg.org",
    "Accept": "*/*",
    "Content-Type": "application/json",
    "Accept-Encoding": "gzip",
    "User-Agent": "okhttp/2.7.5",
    "X-Forwarded-For": "52.26.231.101",
    "X-Forwarded-Host": "testserver.wfatestorg.org",
    "X-Forwarded-Server": "testserver.wfatestorg.org",
    "Content-Length": "535",
    "Connection": "Keep-Alive"
  },
  "body": {
    "version": "1.4",
    "availableSpectrumInquiryRequests": [
      {
        "requestId": "M228A1245000133-1738809376411",
        "deviceDescriptor": {
          "serialNumber": "M228A1245000133",
          "certificationId": [
            {
              "rulesetId": "US_47_CFR_PART_15_SUBPART_E",
              "id": "2ABOF-G1RN6AHB012"
            }
          ]
        }
      }
    ],
    "location": {
      "ellipse": {
        "center": {
          "longitude": -115.30756,
          "latitude": 39.4188
        },
        "minorAxis": 10,
        "majorAxis": 10,
        "orientation": 0.0
      }
    }
  }
}

```



```
    },
    "elevation": {
      "height": 0.0,
      "heightType": "AGL",
      "verticalUncertainty": 1
    },
    "indoorDeployment": 2
  },
  "inquiredChannels": [
    {
      "globalOperatingClass": 132
    }
  ],
  "minDesiredPower": -175.0
}
]
}
}

##### 2025-02-06T02:36:16Z #####
{
  "headers": {
    "Host": "testserver.wfatestorg.org",
    "Accept": "*/*",
    "Content-Type": "application/json",
    "Accept-Encoding": "gzip",
    "User-Agent": "okhttp/2.7.5",
    "X-Forwarded-For": "52.26.231.101",
    "X-Forwarded-Host": "testserver.wfatestorg.org",
    "X-Forwarded-Server": "testserver.wfatestorg.org",
    "Content-Length": "535",
    "Connection": "Keep-Alive"
  },
  "body": {
    "version": "1.4",
    "availableSpectrumInquiryRequests": [
      {
        "requestId": "M228A1245000133-1738809376891",
        "deviceDescriptor": {
          "serialNumber": "M228A1245000133",
          "certificationId": [
            {
              "rulesetId": "US_47_CFR_PART_15_SUBPART_E",
              "id": "2ABOF-G1RN6AHB012"
            }
          ]
        }
      }
    ],
    "location": {
      "ellipse": {
        "center": {
          "longitude": -115.30756,
          "latitude": 39.4188
        },
        "minorAxis": 10,
```

```

        "majorAxis": 10,
        "orientation": 0.0
    },
    "elevation": {
        "height": 0.0,
        "heightType": "AGL",
        "verticalUncertainty": 1
    },
    "indoorDeployment": 2
},
"inquiredChannels": [
    {
        "globalOperatingClass": 132
    }
],
"minDesiredPower": -175.0
}
]
}
}

##### 2025-02-06T02:36:31Z #####
{
    "headers": {
        "Host": "testserver.wfatestorg.org",
        "Accept": "*/*",
        "Content-Type": "application/json",
        "Accept-Encoding": "gzip",
        "User-Agent": "okhttp/2.7.5",
        "X-Forwarded-For": "52.26.231.101",
        "X-Forwarded-Host": "testserver.wfatestorg.org",
        "X-Forwarded-Server": "testserver.wfatestorg.org",
        "Content-Length": "535",
        "Connection": "Keep-Alive"
    },
    "body": {
        "version": "1.4",
        "availableSpectrumInquiryRequests": [
            {
                "requestId": "M228A1245000133-1738809391027",
                "deviceDescriptor": {
                    "serialNumber": "M228A1245000133",
                    "certificationId": [
                        {
                            "rulesetId": "US_47_CFR_PART_15_SUBPART_E",
                            "id": "2ABOF-G1RN6AHB012"
                        }
                    ]
                }
            }
        ],
        "location": {
            "ellipse": {
                "center": {
                    "longitude": -115.30756,
                    "latitude": 39.4188
                }
            }
        }
    }
}

```



```
    },
    "minorAxis": 10,
    "majorAxis": 10,
    "orientation": 0.0
  },
  "elevation": {
    "height": 0.0,
    "heightType": "AGL",
    "verticalUncertainty": 1
  },
  "indoorDeployment": 2
},
"inquiredChannels": [
  {
    "globalOperatingClass": 132
  }
],
"minDesiredPower": -175.0
}
]
}
```

2025-02-06T02:36:57Z

```
{
  "availableSpectrumInquiryResponses": [
    {
      "response": {
        "responseCode": 0,
        "shortDescription": "SUCCESS"
      },
      "availableChannelInfo": [
        {
          "channelCfi": [
            3,
            11,
            19,
            27,
            35,
            43,
            51,
            59,
            67,
            75,
            83,
            91,
            123,
            131,
            139,
            147,
            155,
            163,
            171,
            179
          ]
        }
      ]
    }
  ]
}
```



```
    ],
    "globalOperatingClass": 132,
    "maxEirp": [
      28.269120762298556,
      26.419687657038864,
      26.061165790288932,
      30.189979208053757,
      25.429798406654285,
      25.985085031392906,
      24.685520331093155,
      26.764236438674864,
      32.967287393297894,
      25.499350514542662,
      33.997065306845755,
      26.995424533645604,
      29.467101494946835,
      25.18317594558473,
      29.393514091317098,
      25.6723462126968,
      29.377283195233304,
      28.035746552901138,
      24.954483765357416,
      33.35126613662997
    ]
  }
},
"requestId": "M228A1245000133-1738809376411",
"availabilityExpireTime": "2025-02-07T02:36:57Z",
"rulesetId": "US_47_CFR_PART_15_SUBPART_E"
}
],
"version": "1.4"
}

##### 2025-02-06T02:36:58Z #####
{
  "availableSpectrumInquiryResponses": [
    {
      "response": {
        "responseCode": 0,
        "shortDescription": "SUCCESS"
      },
      "availableChannelInfo": [
        {
          "channelCfi": [
            3,
            11,
            19,
            27,
            35,
            43,
            51,
            59,
            67,
```



```
75,
83,
91,
123,
131,
139,
147,
155,
163,
171,
179
],
"globalOperatingClass": 132,
"maxEirp": [
  28.269120762298556,
  26.419687657038864,
  26.061165790288932,
  30.189979208053757,
  25.429798406654285,
  25.985085031392906,
  24.685520331093155,
  26.764236438674864,
  32.967287393297894,
  25.499350514542662,
  33.997065306845755,
  26.995424533645604,
  29.467101494946835,
  25.18317594558473,
  29.393514091317098,
  25.6723462126968,
  29.377283195233304,
  28.035746552901138,
  24.954483765357416,
  33.35126613662997
]
}
],
"requestId": "M228A1245000133-1738809376891",
"availabilityExpireTime": "2025-02-07T02:36:58Z",
"rulesetId": "US_47_CFR_PART_15_SUBPART_E"
}
],
"version": "1.4"
}

##### 2025-02-06T02:36:58Z #####
{
  "availableSpectrumInquiryResponses": [
    {
      "response": {
        "responseCode": 0,
        "shortDescription": "SUCCESS"
      },
      "availableChannelInfo": [
```



```
{
  "channelCfi": [
    3,
    11,
    19,
    27,
    35,
    43,
    51,
    59,
    67,
    75,
    83,
    91,
    123,
    131,
    139,
    147,
    155,
    163,
    171,
    179
  ],
  "globalOperatingClass": 132,
  "maxEirp": [
    28.269120762298556,
    26.419687657038864,
    26.061165790288932,
    30.189979208053757,
    25.429798406654285,
    25.985085031392906,
    24.685520331093155,
    26.764236438674864,
    32.967287393297894,
    25.499350514542662,
    33.997065306845755,
    26.995424533645604,
    29.467101494946835,
    25.18317594558473,
    29.393514091317098,
    25.6723462126968,
    29.377283195233304,
    28.035746552901138,
    24.954483765357416,
    33.35126613662997
  ]
},
{
  "requestId": "M228A1245000133-1738809391027",
  "availabilityExpireTime": "2025-02-07T02:36:58Z",
  "rulesetId": "US_47_CFR_PART_15_SUBPART_E"
},
{
  "version": "1.4"
}
```



```
}

##### 2025-02-06T02:36:58Z #####
{
  "availableSpectrumInquiryResponses": [
    {
      "response": {
        "responseCode": 0,
        "shortDescription": "SUCCESS"
      },
      "availableChannelInfo": [
        {
          "channelCfi": [
            3,
            11,
            19,
            27,
            35,
            43,
            51,
            59,
            67,
            75,
            83,
            91,
            123,
            131,
            139,
            147,
            155,
            163,
            171,
            179
          ],
          "globalOperatingClass": 132,
          "maxEirp": [
            28.269120762298556,
            26.419687657038864,
            26.061165790288932,
            30.189979208053757,
            25.429798406654285,
            25.985085031392906,
            24.685520331093155,
            26.764236438674864,
            32.967287393297894,
            25.499350514542662,
            33.997065306845755,
            26.995424533645604,
            29.467101494946835,
            25.18317594558473,
            29.393514091317098,
            25.6723462126968,
            29.377283195233304,
            28.035746552901138,

```



```
24.954483765357416,  
33.35126613662997  
    ]  
  }  
],  
  "requestId": "M228A1245000133-1738809376390",  
  "availabilityExpireTime": "2025-02-07T02:36:58Z",  
  "rulesetId": "US_47_CFR_PART_15_SUBPART_E"  
}  
],  
  "version": "1.4"  
}
```

**B.4. Unsuccessful spectrum access update (UAU)****B.4.1. AFC DUT Compliance Test Report****AFC DUT Compliance Test Report****DUT Information**

AFC DUT System	Fixed Client
DUT Vendor Name	Tarana
DUT Product Model	RNv

Test Result

FCC Requirements	TestCaseName	Test Result
15.407(k)(8)(i), 15.407(k)(8)(ii), 15.407(k)(9)(i)	CT_AFC_FC_STA_AFCDU34_Channel_10653_1 (Unsuccessful spectrum access update)	PASS

Test Measurements

TestCaseName: CT_AFC_FC_STA_AFCDU34_Channel_10653_1 (Unsuccessful spectrum access update)
TestResult: PASS
Band: 6GHz

Measurements Name	Description	Value	Validation Result
AFC_DUT_SEND_SPECTRUM_INQUIRYREQUEST	AFC DUT sends an Available Spectrum Inquiry Request	true	PASS
AFC_DUT_SPECTRUM_INQUIRYREQUEST_VALID_1	Valid mandatory registration information	true	PASS
AFC_DUT_CONFORM_SPECTRUM_INQUIRYRESPONSE_1	AFC DUT conforms to the conditions in Spectrum Response (36.0 dBm EIRP) on channel 3 bandwidth 20.	true	PASS
AFC_DUT_SPECTRUM_INQUIRYREQUEST_VALID_2	Valid mandatory registration information	true	PASS
AFC_DUT_CONFORM_SPECTRUM_INQUIRYRESPONSE_2	AFC DUT conforms to the conditions in the Spectrum Inquiry Response	true	PASS

B.4.2. DUT Available Spectrum Inquiry Request-Response

```
##### 2025-02-06T03:26:44Z #####
{
  "headers": {
    "Host": "testserver.wfatestorg.org",
    "Accept": "*/*",
    "Content-Type": "application/json",
    "Accept-Encoding": "gzip",
    "User-Agent": "okhttp/2.7.5",
    "X-Forwarded-For": "52.26.231.101",
    "X-Forwarded-Host": "testserver.wfatestorg.org",
    "X-Forwarded-Server": "testserver.wfatestorg.org",
    "Content-Length": "535",
    "Connection": "Keep-Alive"
  },
  "body": {
    "version": "1.4",
    "availableSpectrumInquiryRequests": [
      {
        "requestId": "M228A1245000133-1738812394481",
        "deviceDescriptor": {
          "serialNumber": "M228A1245000133",
          "certificationId": [
            {
              "rulesetId": "US_47_CFR_PART_15_SUBPART_E",
              "id": "2ABOF-G1RN6AHB012"
            }
          ]
        }
      }
    ]
  }
}
```

```

    }
  ]
},
"location": {
  "ellipse": {
    "center": {
      "longitude": -115.30756,
      "latitude": 39.4188
    },
    "minorAxis": 10,
    "majorAxis": 10,
    "orientation": 0.0
  },
  "elevation": {
    "height": 0.0,
    "heightType": "AGL",
    "verticalUncertainty": 1
  },
  "indoorDeployment": 2
},
"inquiredChannels": [
  {
    "globalOperatingClass": 132
  }
],
"minDesiredPower": -175.0
}
]
}
}

##### 2025-02-06T03:26:44Z #####
{
  "headers": {
    "Host": "testserver.wfatestorg.org",
    "Accept": "*/*",
    "Content-Type": "application/json",
    "Accept-Encoding": "gzip",
    "User-Agent": "okhttp/2.7.5",
    "X-Forwarded-For": "52.26.231.101",
    "X-Forwarded-Host": "testserver.wfatestorg.org",
    "X-Forwarded-Server": "testserver.wfatestorg.org",
    "Content-Length": "537",
    "Connection": "Keep-Alive"
  },
  "body": {
    "version": "1.4",
    "availableSpectrumInquiryRequests": [
      {
        "requestId": "S171F2223507676-1738812401755",
        "deviceDescriptor": {
          "serialNumber": "S171F2223507676",
          "certificationId": [

```



```
        "rulesetId": "US_47_CFR_PART_15_SUBPART_E",
        "id": "2ABOF-G1BN6ASI002"
      }
    ]
  },
  "location": {
    "ellipse": {
      "center": {
        "longitude": -115.30364,
        "latitude": 36.189533
      },
      "minorAxis": 10,
      "majorAxis": 10,
      "orientation": 0.0
    },
    "elevation": {
      "height": 0.0,
      "heightType": "AGL",
      "verticalUncertainty": 1
    },
    "indoorDeployment": 2
  },
  "inquiredChannels": [
    {
      "globalOperatingClass": 132
    }
  ],
  "minDesiredPower": -175.0
}
]
}
}

##### 2025-02-06T03:26:44Z #####
{
  "availableSpectrumInquiryResponses": [
    {
      "response": {
        "responseCode": 0,
        "shortDescription": "SUCCESS"
      },
      "availableChannelInfo": [
        {
          "channelCfi": [
            3,
            11,
            19,
            27,
            35,
            43,
            51,
            59,
            67,
            75,

```



```

      83,
      91,
      123,
      131,
      139,
      147,
      155,
      163,
      171,
      179
    ],
    "globalOperatingClass": 132,
    "maxEirp": [
      36.0,
      36.0,
      36.0,
      36.0,
      36.0,
      36.0,
      36.0,
      36.0,
      36.0,
      36.0,
      36.0,
      36.0,
      36.0,
      36.0,
      36.0,
      36.0,
      36.0,
      36.0,
      36.0,
      36.0,
      36.0
    ]
  }
},
{
  "requestId": "S171F2223507676-1738812401755",
  "availabilityExpireTime": "2025-02-07T03:26:44Z",
  "rulesetId": "US_47_CFR_PART_15_SUBPART_E"
}
],
"version": "1.4"
}

##### 2025-02-06T03:26:44Z #####
{
  "availableSpectrumInquiryResponses": [
    {
      "response": {
        "responseCode": 0,
        "shortDescription": "SUCCESS"
      },
      "availableChannelInfo": [
        {

```



```

    "channelCfi": [
      3,
      11,
      19,
      27,
      35,
      43,
      51,
      59,
      67,
      75,
      83,
      91,
      123,
      131,
      139,
      147,
      155,
      163,
      171,
      179
    ],
    "globalOperatingClass": 132,
    "maxEirp": [
      36.0,
      36.0,
      36.0,
      36.0,
      36.0,
      36.0,
      36.0,
      36.0,
      36.0,
      36.0,
      36.0,
      36.0,
      36.0,
      36.0,
      36.0,
      36.0,
      36.0,
      36.0,
      36.0,
      36.0
    ]
  }
},
"requestId": "S171F2223507676-1738812401755",
"availabilityExpireTime": "2025-02-07T03:26:44Z",
"rulesetId": "US_47_CFR_PART_15_SUBPART_E"
}
],
"version": "1.4"
}

```



```
##### 2025-02-06T03:41:16Z #####
{
  "headers": {
    "Host": "testserver.wfatestorg.org",
    "Accept": "*/*",
    "Content-Type": "application/json",
    "Accept-Encoding": "gzip",
    "User-Agent": "okhttp/2.7.5",
    "X-Forwarded-For": "52.26.231.101",
    "X-Forwarded-Host": "testserver.wfatestorg.org",
    "X-Forwarded-Server": "testserver.wfatestorg.org",
    "Content-Length": "535",
    "Connection": "Keep-Alive"
  },
  "body": {
    "version": "1.4",
    "availableSpectrumInquiryRequests": [
      {
        "requestId": "M228A1245000133-1738813276451",
        "deviceDescriptor": {
          "serialNumber": "M228A1245000133",
          "certificationId": [
            {
              "rulesetId": "US_47_CFR_PART_15_SUBPART_E",
              "id": "2ABOF-G1RN6AHB012"
            }
          ]
        }
      }
    ],
    "location": {
      "ellipse": {
        "center": {
          "longitude": -115.30756,
          "latitude": 39.4188
        },
        "minorAxis": 10,
        "majorAxis": 10,
        "orientation": 0.0
      },
      "elevation": {
        "height": 0.0,
        "heightType": "AGL",
        "verticalUncertainty": 1
      },
      "indoorDeployment": 2
    },
    "inquiredChannels": [
      {
        "globalOperatingClass": 132
      }
    ],
    "minDesiredPower": -175.0
  }
}
```



```
}
}

##### 2025-02-06T03:41:16Z #####
{
  "availableSpectrumInquiryResponses": [
    {
      "response": {
        "responseCode": 0,
        "shortDescription": "SUCCESS"
      },
      "availableChannelInfo": [],
      "requestId": "M228A1245000133-1738813276451",
      "availabilityExpireTime": "2025-02-07T03:41:16Z",
      "rulesetId": "US_47_CFR_PART_15_SUBPART_E"
    }
  ],
  "version": "1.4"
}

##### 2025-02-06T03:41:16Z #####
{
  "headers": {
    "Host": "testserver.wfatestorg.org",
    "Accept": "*/*",
    "Content-Type": "application/json",
    "Accept-Encoding": "gzip",
    "User-Agent": "okhttp/2.7.5",
    "X-Forwarded-For": "52.26.231.101",
    "X-Forwarded-Host": "testserver.wfatestorg.org",
    "X-Forwarded-Server": "testserver.wfatestorg.org",
    "Content-Length": "535",
    "Connection": "Keep-Alive"
  },
  "body": {
    "version": "1.4",
    "availableSpectrumInquiryRequests": [
      {
        "requestId": "M228A1245000133-1738813276971",
        "deviceDescriptor": {
          "serialNumber": "M228A1245000133",
          "certificationId": [
            {
              "rulesetId": "US_47_CFR_PART_15_SUBPART_E",
              "id": "2ABOF-G1RN6AHB012"
            }
          ]
        },
        "location": {
          "ellipse": {
            "center": {
              "longitude": -115.30756,
              "latitude": 39.4188
            }
          }
        }
      }
    ]
  }
}
```

```

        "minorAxis": 10,
        "majorAxis": 10,
        "orientation": 0.0
    },
    "elevation": {
        "height": 0.0,
        "heightType": "AGL",
        "verticalUncertainty": 1
    },
    "indoorDeployment": 2
},
"inquiredChannels": [
    {
        "globalOperatingClass": 132
    }
],
"minDesiredPower": -175.0
}
]
}
}

##### 2025-02-06T03:41:17Z #####
{
  "headers": {
    "Host": "testserver.wfatestorg.org",
    "Accept": "*/*",
    "Content-Type": "application/json",
    "Accept-Encoding": "gzip",
    "User-Agent": "okhttp/2.7.5",
    "X-Forwarded-For": "52.26.231.101",
    "X-Forwarded-Host": "testserver.wfatestorg.org",
    "X-Forwarded-Server": "testserver.wfatestorg.org",
    "Content-Length": "535",
    "Connection": "Keep-Alive"
  },
  "body": {
    "version": "1.4",
    "availableSpectrumInquiryRequests": [
      {
        "requestId": "M228A1245000133-1738813276988",
        "deviceDescriptor": {
          "serialNumber": "M228A1245000133",
          "certificationId": [
            {
              "rulesetId": "US_47_CFR_PART_15_SUBPART_E",
              "id": "2ABOF-G1RN6AHB012"
            }
          ]
        }
      }
    ],
    "location": {
      "ellipse": {
        "center": {
          "longitude": -115.30756,

```



```
        "latitude": 39.4188
      },
      "minorAxis": 10,
      "majorAxis": 10,
      "orientation": 0.0
    },
    "elevation": {
      "height": 0.0,
      "heightType": "AGL",
      "verticalUncertainty": 1
    },
    "indoorDeployment": 2
  },
  "inquiredChannels": [
    {
      "globalOperatingClass": 132
    }
  ],
  "minDesiredPower": -175.0
}
]
}
}

##### 2025-02-06T03:41:17Z #####
{
  "availableSpectrumInquiryResponses": [
    {
      "response": {
        "responseCode": 0,
        "shortDescription": "SUCCESS"
      },
      "availableChannelInfo": [],
      "requestId": "M228A1245000133-1738813276971",
      "availabilityExpireTime": "2025-02-07T03:41:17Z",
      "rulesetId": "US_47_CFR_PART_15_SUBPART_E"
    }
  ],
  "version": "1.4"
}

##### 2025-02-06T03:41:17Z #####
{
  "availableSpectrumInquiryResponses": [
    {
      "response": {
        "responseCode": 0,
        "shortDescription": "SUCCESS"
      },
      "availableChannelInfo": [],
      "requestId": "M228A1245000133-1738813276988",
      "availabilityExpireTime": "2025-02-07T03:41:17Z",
      "rulesetId": "US_47_CFR_PART_15_SUBPART_E"
    }
  ]
}
```



```
    ],
    "version": "1.4"
  }

##### 2025-02-06T03:41:30Z #####
{
  "headers": {
    "Host": "testserver.wfatestorg.org",
    "Accept": "*/*",
    "Content-Type": "application/json",
    "Accept-Encoding": "gzip",
    "User-Agent": "okhttp/2.7.5",
    "X-Forwarded-For": "52.26.231.101",
    "X-Forwarded-Host": "testserver.wfatestorg.org",
    "X-Forwarded-Server": "testserver.wfatestorg.org",
    "Content-Length": "535",
    "Connection": "Keep-Alive"
  },
  "body": {
    "version": "1.4",
    "availableSpectrumInquiryRequests": [
      {
        "requestId": "M228A1245000133-1738813290634",
        "deviceDescriptor": {
          "serialNumber": "M228A1245000133",
          "certificationId": [
            {
              "rulesetId": "US_47_CFR_PART_15_SUBPART_E",
              "id": "2ABOF-G1RN6AHB012"
            }
          ]
        }
      }
    ],
    "location": {
      "ellipse": {
        "center": {
          "longitude": -115.30756,
          "latitude": 39.4188
        },
        "minorAxis": 10,
        "majorAxis": 10,
        "orientation": 0.0
      },
      "elevation": {
        "height": 0.0,
        "heightType": "AGL",
        "verticalUncertainty": 1
      },
      "indoorDeployment": 2
    },
    "inquiredChannels": [
      {
        "globalOperatingClass": 132
      }
    ]
  },
}
```



```
        "minDesiredPower": -175.0
      }
    ]
  }
}

##### 2025-02-06T03:41:30Z #####
{
  "availableSpectrumInquiryResponses": [
    {
      "response": {
        "responseCode": 0,
        "shortDescription": "SUCCESS"
      },
      "availableChannelInfo": [],
      "requestId": "M228A1245000133-1738813290634",
      "availabilityExpireTime": "2025-02-07T03:41:30Z",
      "rulesetId": "US_47_CFR_PART_15_SUBPART_E"
    }
  ],
  "version": "1.4"
}

##### 2025-02-06T03:42:31Z #####
{
  "headers": {
    "Host": "testserver.wfatestorg.org",
    "Accept": "*/*",
    "Content-Type": "application/json",
    "Accept-Encoding": "gzip",
    "User-Agent": "okhttp/2.7.5",
    "X-Forwarded-For": "52.26.231.101",
    "X-Forwarded-Host": "testserver.wfatestorg.org",
    "X-Forwarded-Server": "testserver.wfatestorg.org",
    "Content-Length": "535",
    "Connection": "Keep-Alive"
  },
  "body": {
    "version": "1.4",
    "availableSpectrumInquiryRequests": [
      {
        "requestId": "M228A1245000133-1738813351285",
        "deviceDescriptor": {
          "serialNumber": "M228A1245000133",
          "certificationId": [
            {
              "rulesetId": "US_47_CFR_PART_15_SUBPART_E",
              "id": "2ABOF-G1RN6AHB012"
            }
          ]
        }
      }
    ],
    "location": {
      "ellipse": {
        "center": {
```



```
        "longitude": -115.30756,
        "latitude": 39.4188
      },
      "minorAxis": 10,
      "majorAxis": 10,
      "orientation": 0.0
    },
    "elevation": {
      "height": 0.0,
      "heightType": "AGL",
      "verticalUncertainty": 1
    },
    "indoorDeployment": 2
  },
  "inquiredChannels": [
    {
      "globalOperatingClass": 132
    }
  ],
  "minDesiredPower": -175.0
}
]
}
}

##### 2025-02-06T03:42:31Z #####
{
  "availableSpectrumInquiryResponses": [
    {
      "response": {
        "responseCode": 0,
        "shortDescription": "SUCCESS"
      },
      "availableChannelInfo": [],
      "requestId": "M228A1245000133-1738813351285",
      "availabilityExpireTime": "2025-02-07T03:42:31Z",
      "rulesetId": "US_47_CFR_PART_15_SUBPART_E"
    }
  ],
  "version": "1.4"
}
```



B.5. Unsuccessful server validation (USV)

B.5.1. AFC DUT Compliance Test Report

AFC DUT Compliance Test Report

DUT Information

AFC DUT System	Fixed Client
DUT Vendor Name	Tarana
DUT Product Model	RN

Test Result

FCC Requirements	TestCaseName	Test Result
15.407(k)(8)(v)	CT_AFC_ServerValidation_STA_AFCDUSV35_TLSCipherSuiteENULL_10667_1 (Unsuccessful server validation)	PASS
15.407(k)(8)(v)	CT_AFC_ServerValidation_STA_AFCDUSV35_StapledOCSPRespExpired_10666_1 (Unsuccessful server validation)	PASS
15.407(k)(8)(v)	CT_AFC_ServerValidation_STA_AFCDUSV35_OCSPStaplingDisabled_10665_1 (Unsuccessful server validation)	PASS
15.407(k)(8)(v)	CT_AFC_ServerValidation_STA_AFCDUSV35_ServerCertRevoked_10664_1 (Unsuccessful server validation)	PASS
15.407(k)(8)(v)	CT_AFC_ServerValidation_STA_AFCDUSV35_MatchSuffixSAN_10663_1 (Unsuccessful server validation)	PASS
15.407(k)(8)(v)	CT_AFC_ServerValidation_STA_AFCDUSV35_DifferentRootCA_10662_1 (Unsuccessful server validation)	PASS
15.407(k)(8)(v)	CT_AFC_ServerValidation_STA_AFCDUSV35_NonMatchSAN_10661_1 (Unsuccessful server validation)	PASS

Test Measurements

TestCaseName: CT_AFC_ServerValidation_STA_AFCDUSV35_TLSCipherSuiteENULL_10667_1 (Unsuccessful server validation)
TestResult:PASS
Band:6GHz

Measurements Name	Description	Value	Validation Result
AFC_DUT_SEND_SPECTRUM_INQUIRYREQUEST	AFC DUT sends an Available Spectrum Inquiry Request	false	PASS

TestCaseName: CT_AFC_ServerValidation_STA_AFCDUSV35_StapledOCSPRespExpired_10666_1 (Unsuccessful server validation)
TestResult:PASS
Band:6GHz

Measurements Name	Description	Value	Validation Result
AFC_DUT_SEND_SPECTRUM_INQUIRYREQUEST	AFC DUT sends an Available Spectrum Inquiry Request	false	PASS

TestCaseName: CT_AFC_ServerValidation_STA_AFCDUSV35_OCSPStaplingDisabled_10665_1 (Unsuccessful server validation)
TestResult:PASS
Band:6GHz

Measurements Name	Description	Value	Validation Result
AFC_DUT_SEND_SPECTRUM_INQUIRYREQUEST	AFC DUT sends an Available Spectrum Inquiry Request	false	PASS

TestCaseName: CT_AFC_ServerValidation_STA_AFCDUSV35_ServerCertRevoked_10664_1 (Unsuccessful server validation)
TestResult:PASS
Band:6GHz

Measurements Name	Description	Value	Validation Result
AFC_DUT_SEND_SPECTRUM_INQUIRYREQUEST	AFC DUT sends an Available Spectrum Inquiry Request	false	PASS

TestCaseName: CT_AFC_ServerValidation_STA_AFCDUSV35_MatchSuffixSAN_10663_1 (Unsuccessful server validation)
TestResult:PASS
Band:6GHz

Measurements Name	Description	Value	Validation Result
AFC_DUT_SEND_SPECTRUM_INQUIRYREQUEST	AFC DUT sends an Available Spectrum Inquiry Request	false	PASS

TestCaseName: CT_AFC_ServerValidation_STA_AFCDUSV35_DifferentRootCA_10662_1 (Unsuccessful server validation)
TestResult:PASS
Band:6GHz

Measurements Name	Description	Value	Validation Result
AFC_DUT_SEND_SPECTRUM_INQUIRYREQUEST	AFC DUT sends an Available Spectrum Inquiry Request	false	PASS



TestCaseName: CT_AFC_ServerValidation_STA_AFCDUSV35_NonMatchSAN_10661_1 (Unsuccessful server validation)
TestResult:PASS
Band:6GHz

Measurements Name	Description	Value	Validation Result
AFC_DUT_SEND_SPECTRUM_INQUIRYREQUEST	AFC DUT sends an Available Spectrum Inquiry Request	false	PASS

TestCaseName: CT_AFC_ServerValidation_STA_AFCDUSV35_NoRootCA_10668_1 (Unsuccessful server validation)
TestResult:PASS
Band:6GHz

Measurements Name	Description	Value	Validation Result
AFC_DUT_SEND_SPECTRUM_INQUIRYREQUEST	AFC DUT sends an Available Spectrum Inquiry Request	false	PASS

—THE END—