



Appendix H: Test Data for E-UTRA Band 41

Product Name: Handheld GNSS Receiver

Test Model: P6H

Environmental Conditions

Temperature:	23.5° C
Relative Humidity:	52.4%
ATM Pressure:	100.0 kPa
Test Engineer:	Paddi Chen
Supervised by:	Nick Peng



Shenzhen LCS Compliance Testing Laboratory Ltd.
Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China
Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com
Scan code to check authenticity



H.1 Conducted Output Power Data

Test Result

Band	Bandwidth	Modulation	Channel	RB Configuration	Result(dBm)	Verdict
Band41	5MHz	QPSK	39675	1RB#0	21.68	PASS
Band41	5MHz	16QAM	39675	1RB#0	21.17	PASS
Band41	5MHz	QPSK	39675	1RB#12	21.64	PASS
Band41	5MHz	16QAM	39675	1RB#12	21.32	PASS
Band41	5MHz	QPSK	39675	1RB#24	21.58	PASS
Band41	5MHz	16QAM	39675	1RB#24	21.27	PASS
Band41	5MHz	QPSK	39675	12RB#0	20.89	PASS
Band41	5MHz	16QAM	39675	12RB#0	20.22	PASS
Band41	5MHz	QPSK	39675	12RB#6	20.91	PASS
Band41	5MHz	16QAM	39675	12RB#6	20.14	PASS
Band41	5MHz	QPSK	39675	12RB#13	20.84	PASS
Band41	5MHz	16QAM	39675	12RB#13	20.17	PASS
Band41	5MHz	QPSK	39675	25RB#0	20.83	PASS
Band41	5MHz	16QAM	39675	25RB#0	20.00	PASS
Band41	5MHz	QPSK	40620	1RB#0	21.34	PASS
Band41	5MHz	16QAM	40620	1RB#0	20.71	PASS
Band41	5MHz	QPSK	40620	1RB#12	21.35	PASS
Band41	5MHz	16QAM	40620	1RB#12	21.11	PASS
Band41	5MHz	QPSK	40620	1RB#24	21.42	PASS
Band41	5MHz	16QAM	40620	1RB#24	21.02	PASS
Band41	5MHz	QPSK	40620	12RB#0	20.42	PASS
Band41	5MHz	16QAM	40620	12RB#0	19.60	PASS
Band41	5MHz	QPSK	40620	12RB#6	20.43	PASS
Band41	5MHz	16QAM	40620	12RB#6	19.61	PASS
Band41	5MHz	QPSK	40620	12RB#13	20.51	PASS
Band41	5MHz	16QAM	40620	12RB#13	19.69	PASS
Band41	5MHz	QPSK	40620	25RB#0	20.37	PASS
Band41	5MHz	16QAM	40620	25RB#0	19.69	PASS
Band41	5MHz	QPSK	41565	1RB#0	21.44	PASS
Band41	5MHz	16QAM	41565	1RB#0	21.12	PASS
Band41	5MHz	QPSK	41565	1RB#12	21.47	PASS
Band41	5MHz	16QAM	41565	1RB#12	21.19	PASS
Band41	5MHz	QPSK	41565	1RB#24	21.63	PASS
Band41	5MHz	16QAM	41565	1RB#24	21.33	PASS
Band41	5MHz	QPSK	41565	12RB#0	20.58	PASS



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



Band41	5MHz	16QAM	41565	12RB#0	19.71	PASS
Band41	5MHz	QPSK	41565	12RB#6	20.60	PASS
Band41	5MHz	16QAM	41565	12RB#6	19.72	PASS
Band41	5MHz	QPSK	41565	12RB#13	20.70	PASS
Band41	5MHz	16QAM	41565	12RB#13	19.84	PASS
Band41	5MHz	QPSK	41565	25RB#0	20.60	PASS
Band41	5MHz	16QAM	41565	25RB#0	19.93	PASS
Band41	10MHz	QPSK	39700	1RB#0	22.32	PASS
Band41	10MHz	16QAM	39700	1RB#0	22.03	PASS
Band41	10MHz	QPSK	39700	1RB#24	22.44	PASS
Band41	10MHz	16QAM	39700	1RB#24	22.15	PASS
Band41	10MHz	QPSK	39700	1RB#49	22.60	PASS
Band41	10MHz	16QAM	39700	1RB#49	22.28	PASS
Band41	10MHz	QPSK	39700	25RB#0	21.39	PASS
Band41	10MHz	16QAM	39700	25RB#0	20.61	PASS
Band41	10MHz	QPSK	39700	25RB#12	21.40	PASS
Band41	10MHz	16QAM	39700	25RB#12	20.61	PASS
Band41	10MHz	QPSK	39700	25RB#25	21.57	PASS
Band41	10MHz	16QAM	39700	25RB#25	20.75	PASS
Band41	10MHz	QPSK	39700	50RB#0	21.49	PASS
Band41	10MHz	16QAM	39700	50RB#0	20.79	PASS
Band41	10MHz	QPSK	40620	1RB#0	21.53	PASS
Band41	10MHz	16QAM	40620	1RB#0	21.24	PASS
Band41	10MHz	QPSK	40620	1RB#24	21.72	PASS
Band41	10MHz	16QAM	40620	1RB#24	21.35	PASS
Band41	10MHz	QPSK	40620	1RB#49	21.84	PASS
Band41	10MHz	16QAM	40620	1RB#49	21.57	PASS
Band41	10MHz	QPSK	40620	25RB#0	20.50	PASS
Band41	10MHz	16QAM	40620	25RB#0	19.75	PASS
Band41	10MHz	QPSK	40620	25RB#12	20.51	PASS
Band41	10MHz	16QAM	40620	25RB#12	19.76	PASS
Band41	10MHz	QPSK	40620	25RB#25	20.83	PASS
Band41	10MHz	16QAM	40620	25RB#25	19.97	PASS
Band41	10MHz	QPSK	40620	50RB#0	20.65	PASS
Band41	10MHz	16QAM	40620	50RB#0	19.89	PASS
Band41	10MHz	QPSK	41540	1RB#0	21.60	PASS
Band41	10MHz	16QAM	41540	1RB#0	21.38	PASS
Band41	10MHz	QPSK	41540	1RB#24	21.78	PASS
Band41	10MHz	16QAM	41540	1RB#24	21.42	PASS
Band41	10MHz	QPSK	41540	1RB#49	21.82	PASS



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



Band41	10MHz	16QAM	41540	1RB#49	21.47	PASS
Band41	10MHz	QPSK	41540	25RB#0	20.65	PASS
Band41	10MHz	16QAM	41540	25RB#0	19.79	PASS
Band41	10MHz	QPSK	41540	25RB#12	20.66	PASS
Band41	10MHz	16QAM	41540	25RB#12	19.79	PASS
Band41	10MHz	QPSK	41540	25RB#25	20.74	PASS
Band41	10MHz	16QAM	41540	25RB#25	19.97	PASS
Band41	10MHz	QPSK	41540	50RB#0	20.70	PASS
Band41	10MHz	16QAM	41540	50RB#0	19.93	PASS
Band41	15MHz	QPSK	39725	1RB#0	22.30	PASS
Band41	15MHz	16QAM	39725	1RB#0	21.97	PASS
Band41	15MHz	QPSK	39725	1RB#38	22.56	PASS
Band41	15MHz	16QAM	39725	1RB#38	21.36	PASS
Band41	15MHz	QPSK	39725	1RB#74	22.26	PASS
Band41	15MHz	16QAM	39725	1RB#74	21.73	PASS
Band41	15MHz	QPSK	39725	38RB#0	21.15	PASS
Band41	15MHz	16QAM	39725	38RB#0	21.26	PASS
Band41	15MHz	QPSK	39725	38RB#18	21.23	PASS
Band41	15MHz	16QAM	39725	38RB#18	21.23	PASS
Band41	15MHz	QPSK	39725	38RB#37	21.23	PASS
Band41	15MHz	16QAM	39725	38RB#37	21.23	PASS
Band41	15MHz	QPSK	39725	75RB#0	21.23	PASS
Band41	15MHz	16QAM	39725	75RB#0	20.51	PASS
Band41	15MHz	QPSK	40620	1RB#0	21.48	PASS
Band41	15MHz	16QAM	40620	1RB#0	21.12	PASS
Band41	15MHz	QPSK	40620	1RB#38	21.72	PASS
Band41	15MHz	16QAM	40620	1RB#38	21.37	PASS
Band41	15MHz	QPSK	40620	1RB#74	21.92	PASS
Band41	15MHz	16QAM	40620	1RB#74	21.53	PASS
Band41	15MHz	QPSK	40620	38RB#0	20.59	PASS
Band41	15MHz	16QAM	40620	38RB#0	20.60	PASS
Band41	15MHz	QPSK	40620	38RB#18	20.60	PASS
Band41	15MHz	16QAM	40620	38RB#18	20.60	PASS
Band41	15MHz	QPSK	40620	38RB#37	20.60	PASS
Band41	15MHz	16QAM	40620	38RB#37	20.60	PASS
Band41	15MHz	QPSK	40620	75RB#0	20.60	PASS
Band41	15MHz	16QAM	40620	75RB#0	19.94	PASS
Band41	15MHz	QPSK	41515	1RB#0	21.52	PASS
Band41	15MHz	16QAM	41515	1RB#0	21.18	PASS
Band41	15MHz	QPSK	41515	1RB#38	21.77	PASS



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



Band41	15MHz	16QAM	41515	1RB#38	21.28	PASS
Band41	15MHz	QPSK	41515	1RB#74	21.80	PASS
Band41	15MHz	16QAM	41515	1RB#74	21.32	PASS
Band41	15MHz	QPSK	41515	38RB#0	20.57	PASS
Band41	15MHz	16QAM	41515	38RB#0	20.57	PASS
Band41	15MHz	QPSK	41515	38RB#18	20.58	PASS
Band41	15MHz	16QAM	41515	38RB#18	20.58	PASS
Band41	15MHz	QPSK	41515	38RB#37	20.58	PASS
Band41	15MHz	16QAM	41515	38RB#37	20.58	PASS
Band41	15MHz	QPSK	41515	75RB#0	20.58	PASS
Band41	15MHz	16QAM	41515	75RB#0	19.80	PASS
Band41	20MHz	QPSK	39750	1RB#0	22.05	PASS
Band41	20MHz	16QAM	39750	1RB#0	21.39	PASS
Band41	20MHz	QPSK	39750	1RB#49	22.23	PASS
Band41	20MHz	16QAM	39750	1RB#49	21.54	PASS
Band41	20MHz	QPSK	39750	1RB#99	22.51	PASS
Band41	20MHz	16QAM	39750	1RB#99	22.01	PASS
Band41	20MHz	QPSK	39750	50RB#0	21.46	PASS
Band41	20MHz	16QAM	39750	50RB#0	20.90	PASS
Band41	20MHz	QPSK	39750	50RB#25	21.45	PASS
Band41	20MHz	16QAM	39750	50RB#25	20.92	PASS
Band41	20MHz	QPSK	39750	50RB#50	21.82	PASS
Band41	20MHz	16QAM	39750	50RB#50	21.18	PASS
Band41	20MHz	QPSK	39750	100RB#0	21.67	PASS
Band41	20MHz	16QAM	39750	100RB#0	20.92	PASS
Band41	20MHz	QPSK	40620	1RB#0	21.15	PASS
Band41	20MHz	16QAM	40620	1RB#0	20.90	PASS
Band41	20MHz	QPSK	40620	1RB#49	21.38	PASS
Band41	20MHz	16QAM	40620	1RB#49	21.21	PASS
Band41	20MHz	QPSK	40620	1RB#99	21.78	PASS
Band41	20MHz	16QAM	40620	1RB#99	21.48	PASS
Band41	20MHz	QPSK	40620	50RB#0	20.55	PASS
Band41	20MHz	16QAM	40620	50RB#0	19.90	PASS
Band41	20MHz	QPSK	40620	50RB#25	20.61	PASS
Band41	20MHz	16QAM	40620	50RB#25	19.91	PASS
Band41	20MHz	QPSK	40620	50RB#50	20.92	PASS
Band41	20MHz	16QAM	40620	50RB#50	20.30	PASS
Band41	20MHz	QPSK	40620	100RB#0	20.70	PASS
Band41	20MHz	16QAM	40620	100RB#0	20.01	PASS
Band41	20MHz	QPSK	41490	1RB#0	21.28	PASS



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



Band41	20MHz	16QAM	41490	1RB#0	21.26	PASS
Band41	20MHz	QPSK	41490	1RB#49	21.36	PASS
Band41	20MHz	16QAM	41490	1RB#49	21.36	PASS
Band41	20MHz	QPSK	41490	1RB#99	21.57	PASS
Band41	20MHz	16QAM	41490	1RB#99	21.56	PASS
Band41	20MHz	QPSK	41490	50RB#0	20.44	PASS
Band41	20MHz	16QAM	41490	50RB#0	19.89	PASS
Band41	20MHz	QPSK	41490	50RB#25	20.46	PASS
Band41	20MHz	16QAM	41490	50RB#25	19.89	PASS
Band41	20MHz	QPSK	41490	50RB#50	20.71	PASS
Band41	20MHz	16QAM	41490	50RB#50	20.06	PASS
Band41	20MHz	QPSK	41490	100RB#0	20.46	PASS
Band41	20MHz	16QAM	41490	100RB#0	19.88	PASS





H.2 Peak-to-Average Ratio(CCDF)

Test Result

Band	Bandwidth	Modulation	Channel	RB Configuration	Result(dB)	Limit(dB)	Verdict
Band41	5MHz	QPSK	39675	1RB#0	7.87	13	PASS
Band41	5MHz	16QAM	39675	1RB#0	8.38	13	PASS
Band41	5MHz	QPSK	39675	25RB#0	8.80	13	PASS
Band41	5MHz	16QAM	39675	25RB#0	9.53	13	PASS
Band41	5MHz	QPSK	40620	1RB#0	8.78	13	PASS
Band41	5MHz	16QAM	40620	1RB#0	9.15	13	PASS
Band41	5MHz	QPSK	40620	25RB#0	9.10	13	PASS
Band41	5MHz	16QAM	40620	25RB#0	9.96	13	PASS
Band41	5MHz	QPSK	41565	1RB#0	8.48	13	PASS
Band41	5MHz	16QAM	41565	1RB#0	8.69	13	PASS
Band41	5MHz	QPSK	41565	25RB#0	9.20	13	PASS
Band41	5MHz	16QAM	41565	25RB#0	9.78	13	PASS
Band41	10MHz	QPSK	39700	1RB#0	7.84	13	PASS
Band41	10MHz	16QAM	39700	1RB#0	8.18	13	PASS
Band41	10MHz	QPSK	39700	50RB#0	8.89	13	PASS
Band41	10MHz	16QAM	39700	50RB#0	9.64	13	PASS
Band41	10MHz	QPSK	40620	1RB#0	8.52	13	PASS
Band41	10MHz	16QAM	40620	1RB#0	9.06	13	PASS
Band41	10MHz	QPSK	40620	50RB#0	9.14	13	PASS
Band41	10MHz	16QAM	40620	50RB#0	9.70	13	PASS
Band41	10MHz	QPSK	41540	1RB#0	8.52	13	PASS
Band41	10MHz	16QAM	41540	1RB#0	9.10	13	PASS
Band41	10MHz	QPSK	41540	50RB#0	9.20	13	PASS
Band41	10MHz	16QAM	41540	50RB#0	9.87	13	PASS
Band41	15MHz	QPSK	39725	1RB#0	7.79	13	PASS
Band41	15MHz	16QAM	39725	1RB#0	8.36	13	PASS
Band41	15MHz	QPSK	39725	75RB#0	9.40	13	PASS
Band41	15MHz	16QAM	39725	75RB#0	9.76	13	PASS
Band41	15MHz	QPSK	40620	1RB#0	8.59	13	PASS
Band41	15MHz	16QAM	40620	1RB#0	9.01	13	PASS
Band41	15MHz	QPSK	40620	75RB#0	9.36	13	PASS
Band41	15MHz	16QAM	40620	75RB#0	10.00	13	PASS
Band41	15MHz	QPSK	41515	1RB#0	8.46	13	PASS
Band41	15MHz	16QAM	41515	1RB#0	8.93	13	PASS



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity





Band41	15MHz	QPSK	41515	75RB#0	9.42	13	PASS
Band41	15MHz	16QAM	41515	75RB#0	9.69	13	PASS
Band41	20MHz	QPSK	39750	1RB#0	7.76	13	PASS
Band41	20MHz	16QAM	39750	1RB#0	8.21	13	PASS
Band41	20MHz	QPSK	39750	100RB#0	8.76	13	PASS
Band41	20MHz	16QAM	39750	100RB#0	9.52	13	PASS
Band41	20MHz	QPSK	40620	1RB#0	8.38	13	PASS
Band41	20MHz	16QAM	40620	1RB#0	8.82	13	PASS
Band41	20MHz	QPSK	40620	100RB#0	8.92	13	PASS
Band41	20MHz	16QAM	40620	100RB#0	9.62	13	PASS
Band41	20MHz	QPSK	41490	1RB#0	8.48	13	PASS
Band41	20MHz	16QAM	41490	1RB#0	8.60	13	PASS
Band41	20MHz	QPSK	41490	100RB#0	9.04	13	PASS
Band41	20MHz	16QAM	41490	100RB#0	9.81	13	PASS





Test Graphs

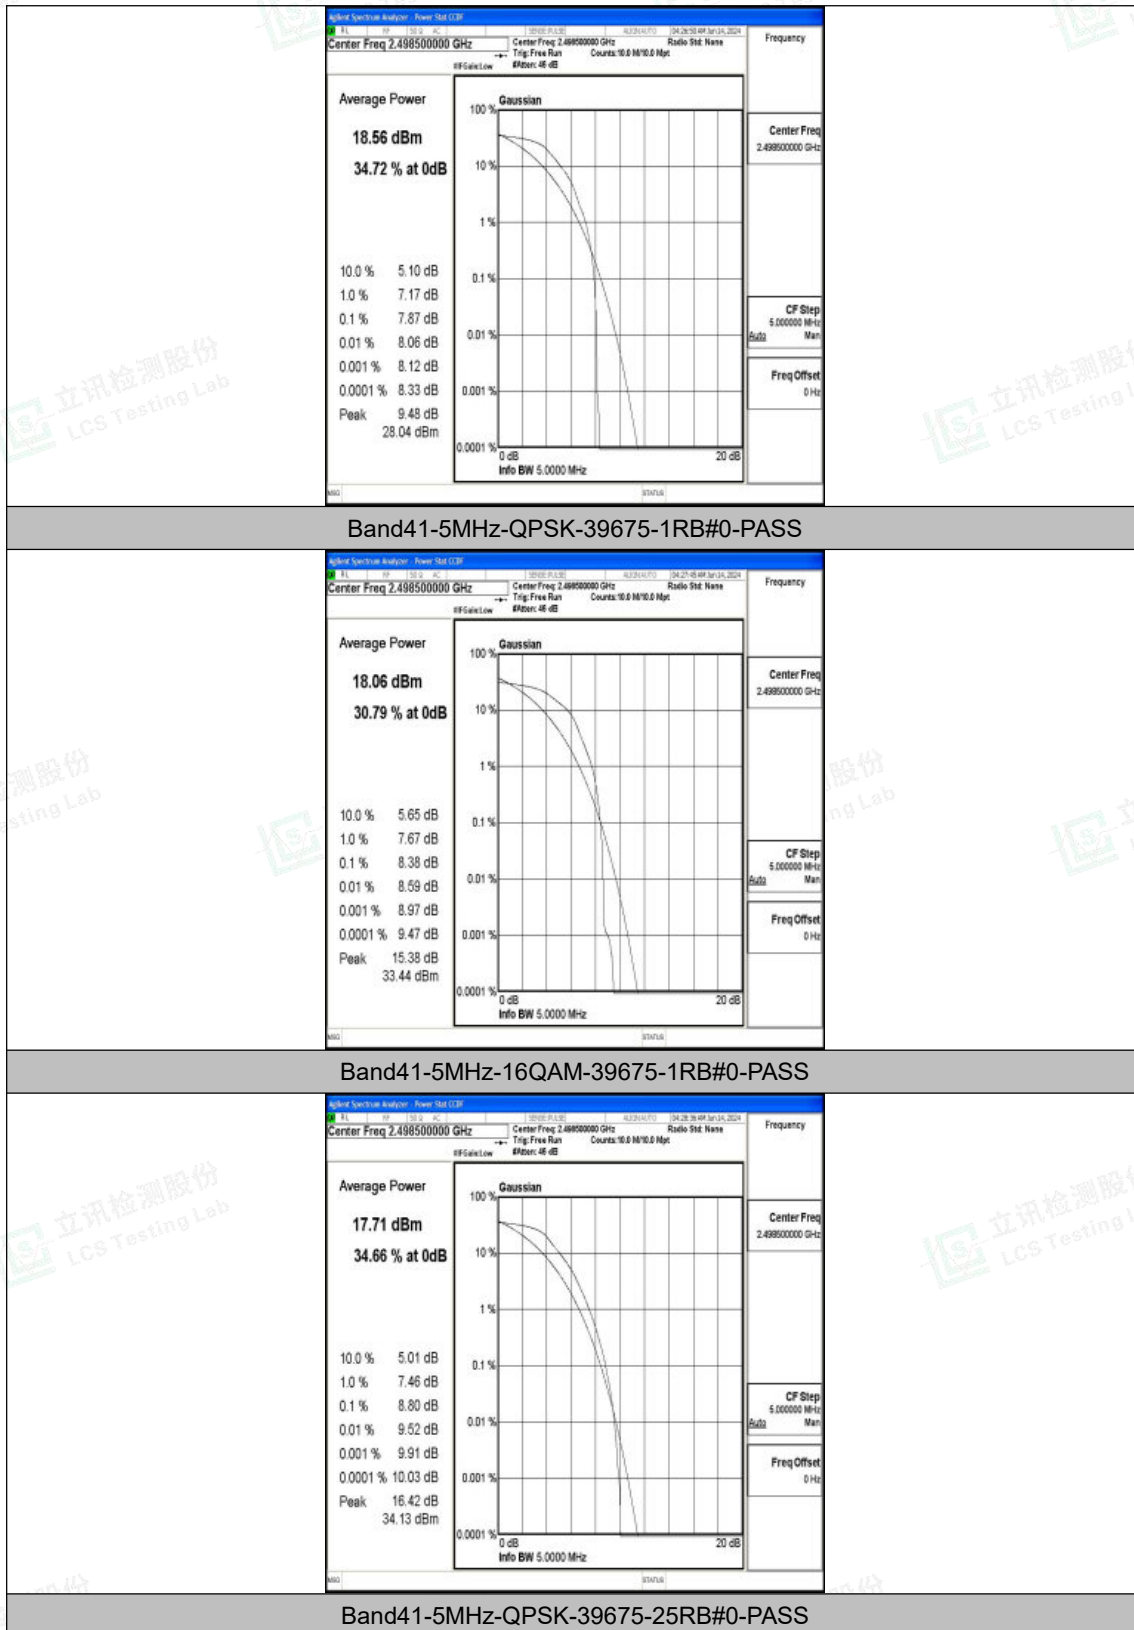

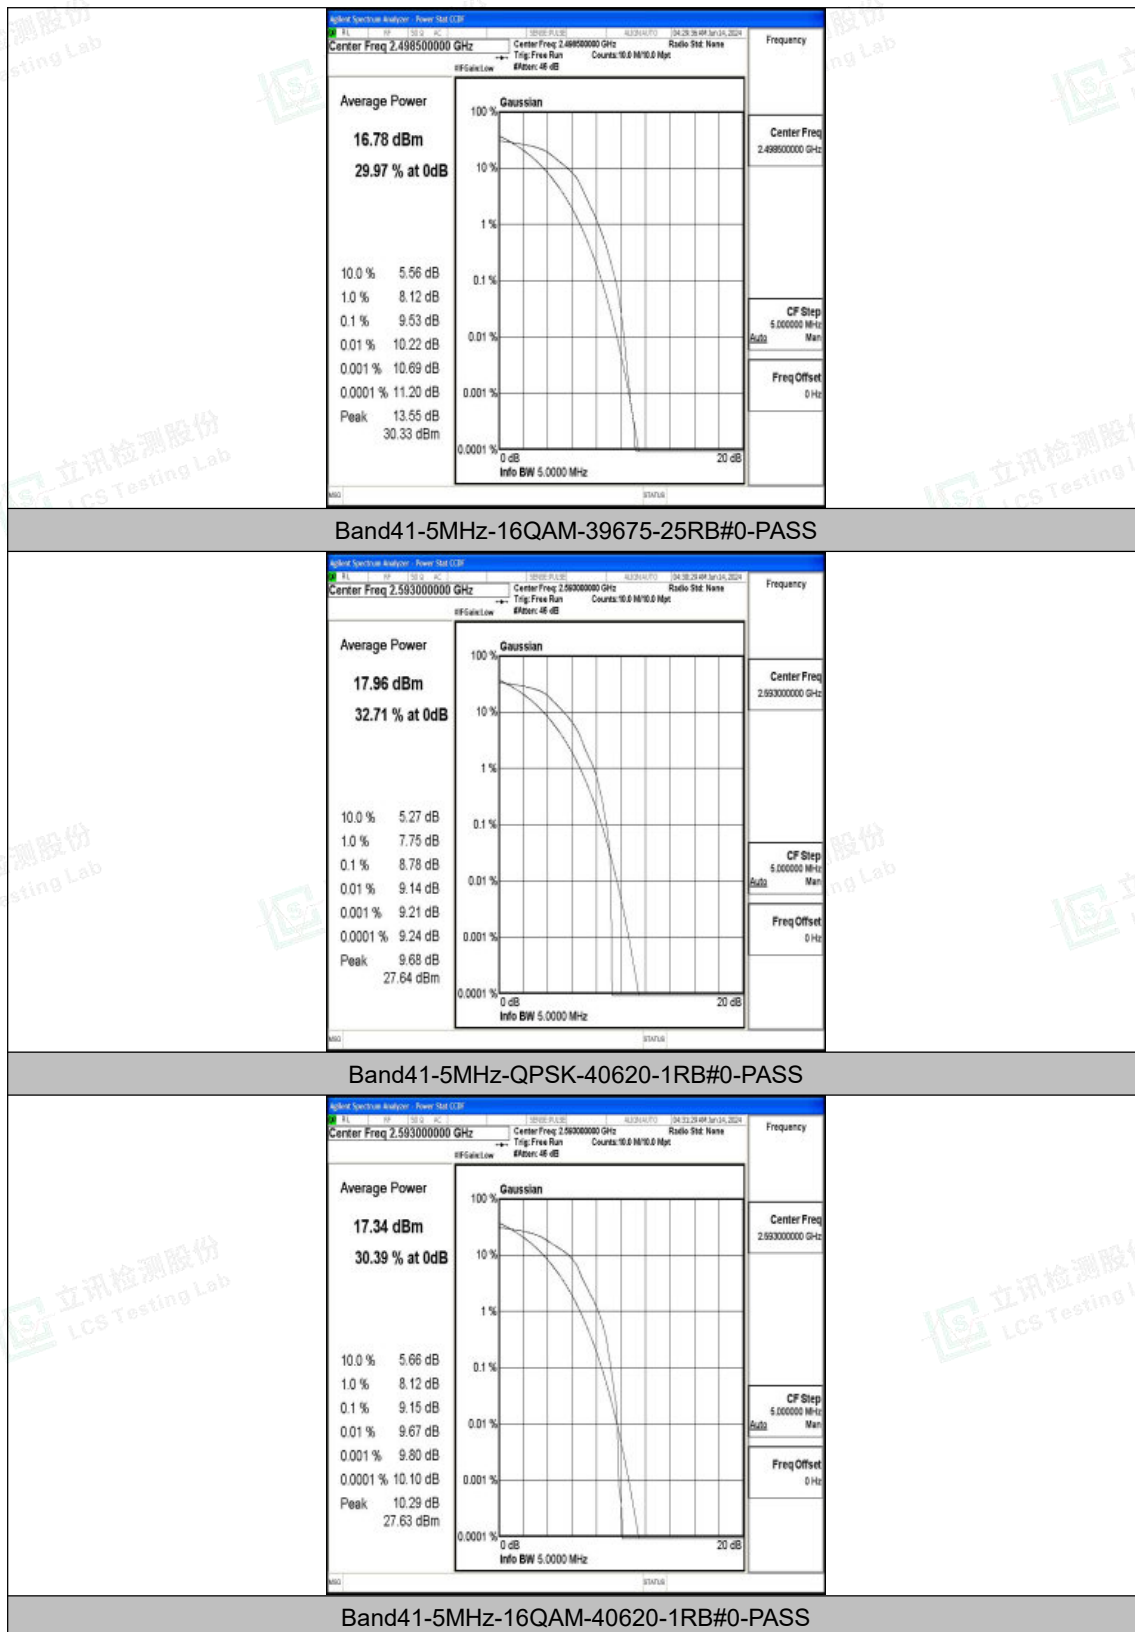


Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity

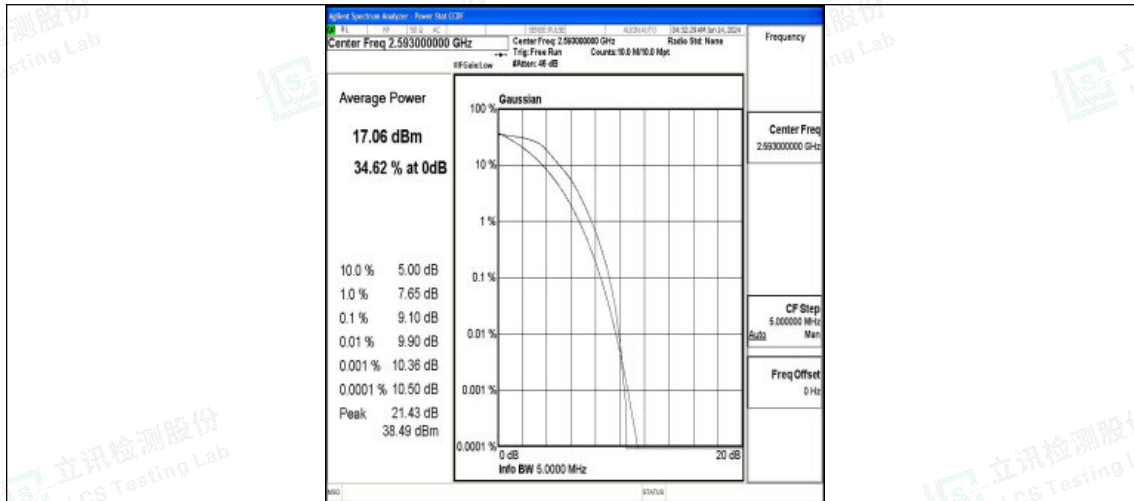

Band41-5MHz-QPSK-40620-25RB#0-PASS

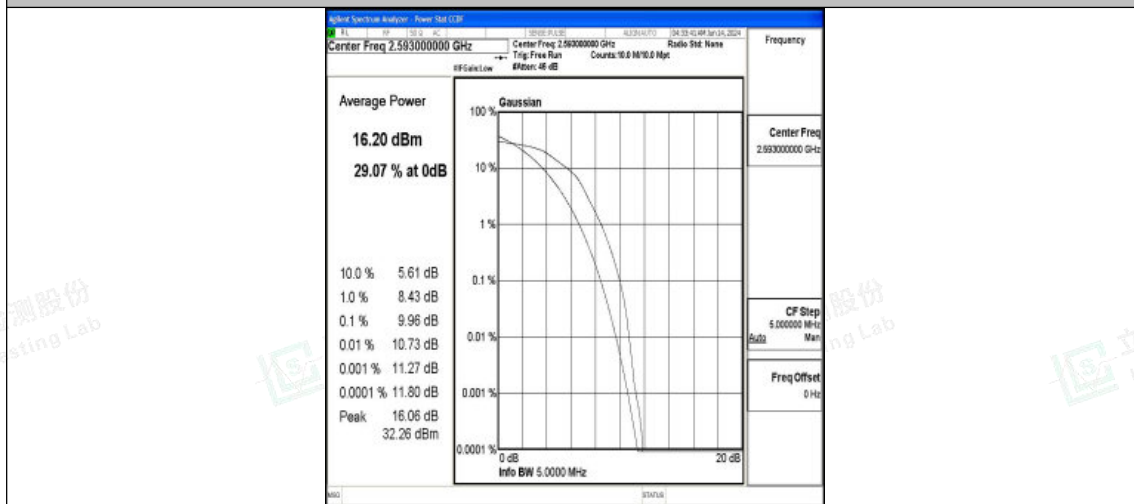


Band41-5MHz-16QAM-40620-25RB#0-PASS

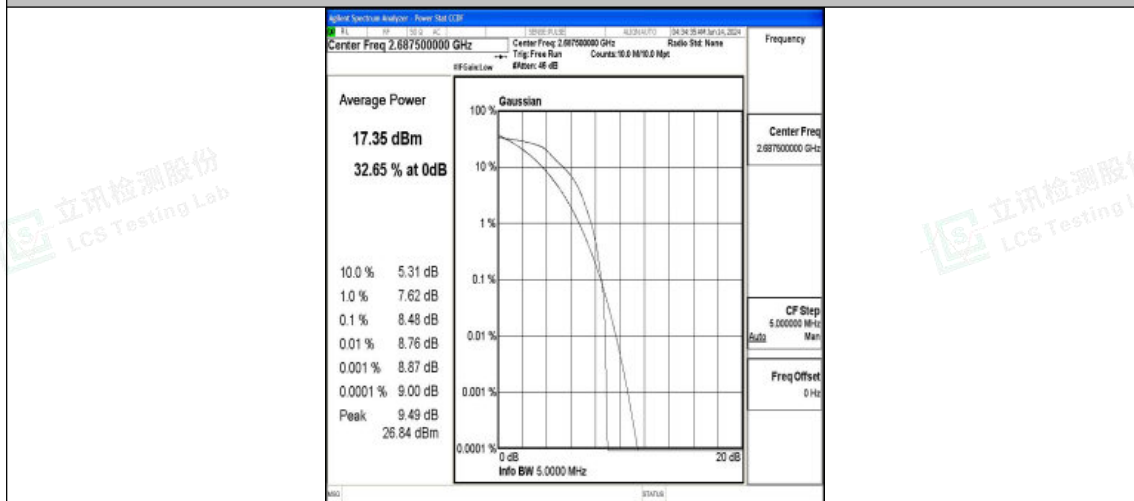


Band41-5MHz-QPSK-41565-1RB#0-PASS




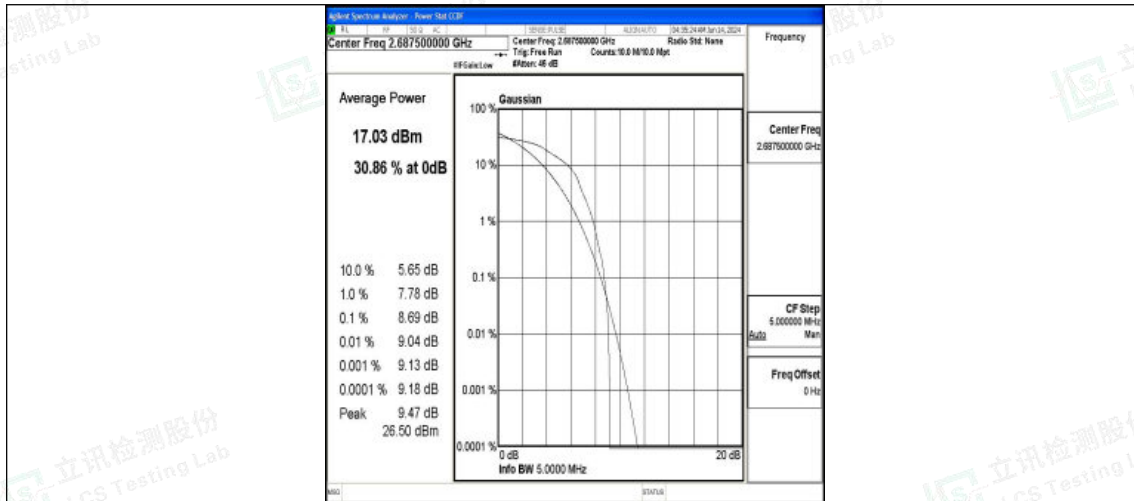

Band41-5MHz-16QAM-41565-1RB#0-PASS

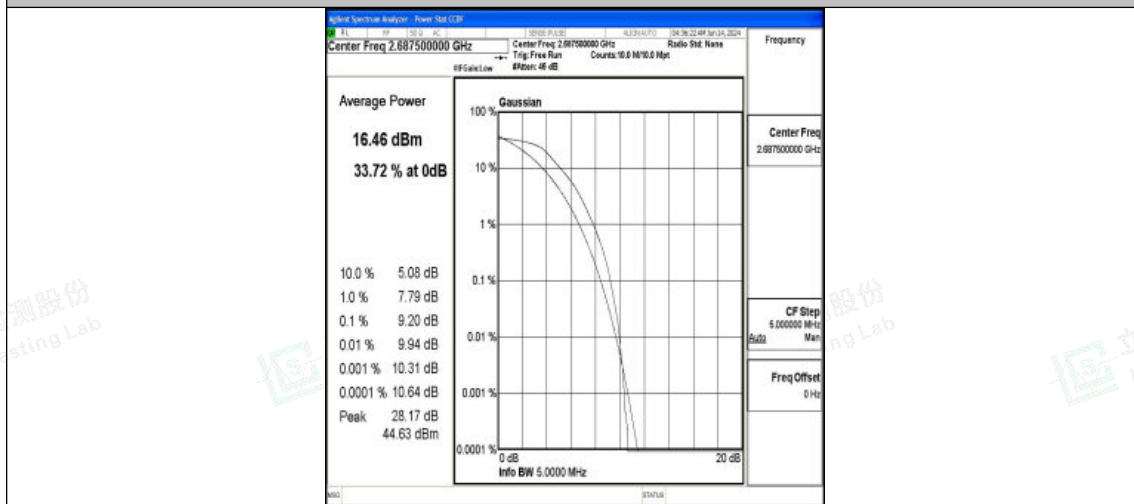

Band41-5MHz-QPSK-41565-25RB#0-PASS

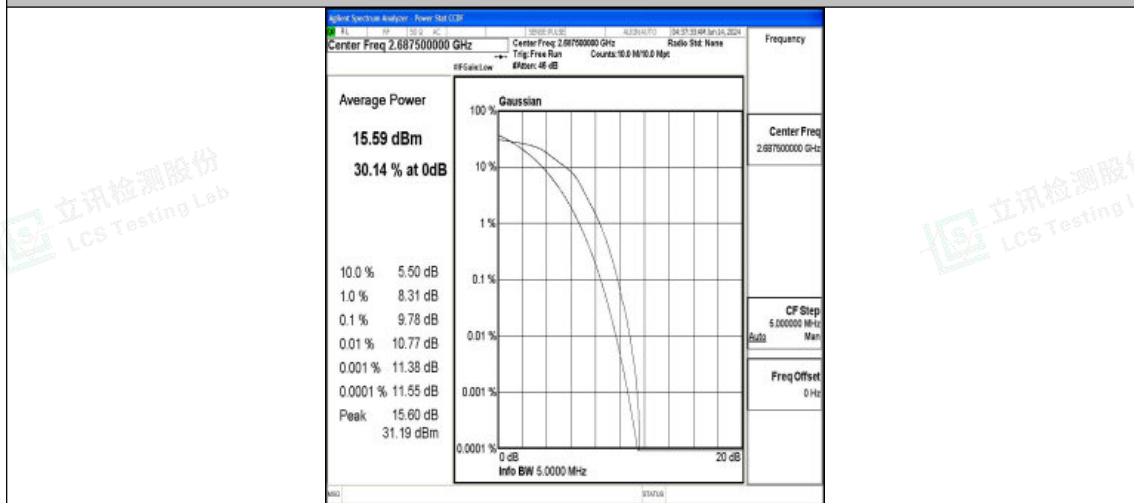

Band41-5MHz-16QAM-41565-25RB#0-PASS




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity

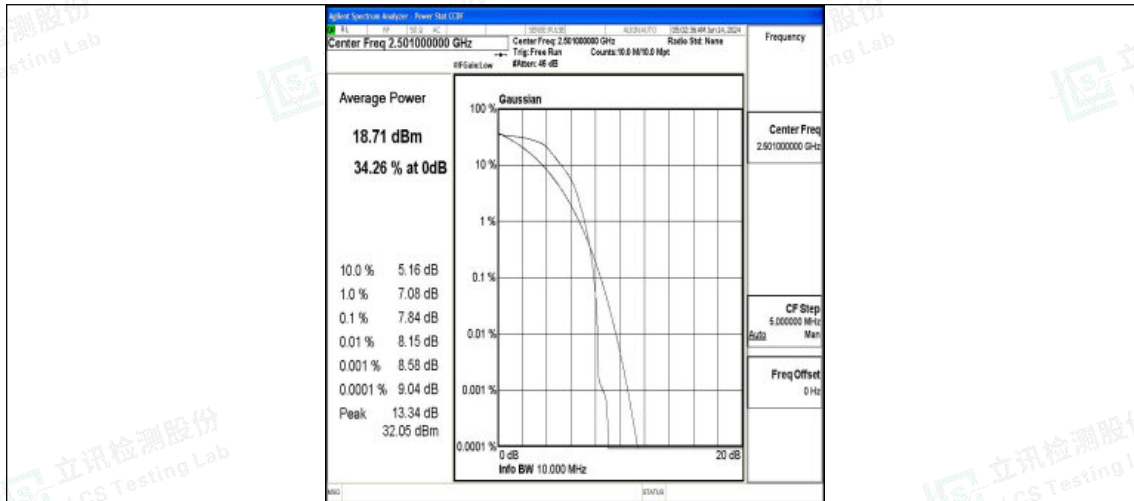

Band41-10MHz-QPSK-39700-1RB#0-PASS

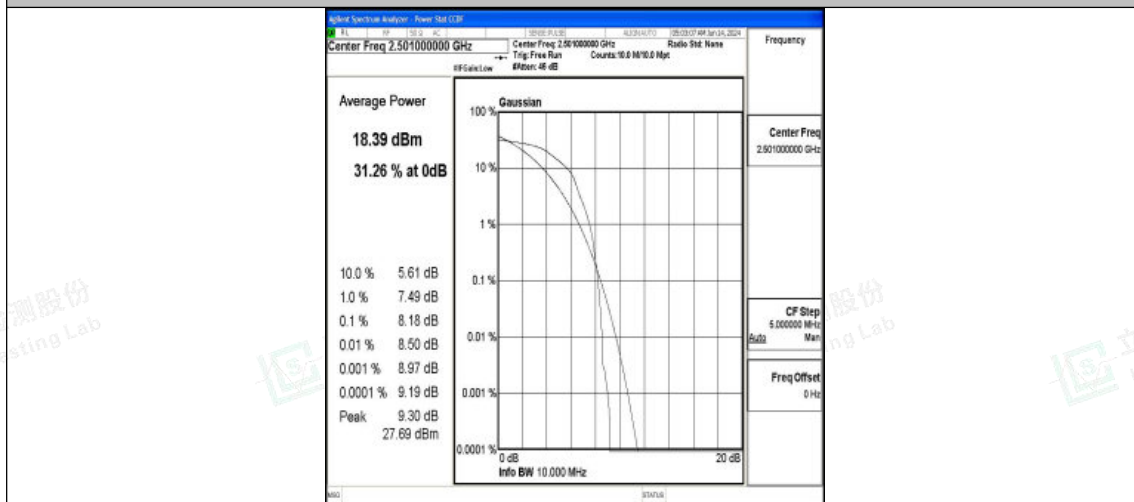

Band41-10MHz-16QAM-39700-1RB#0-PASS

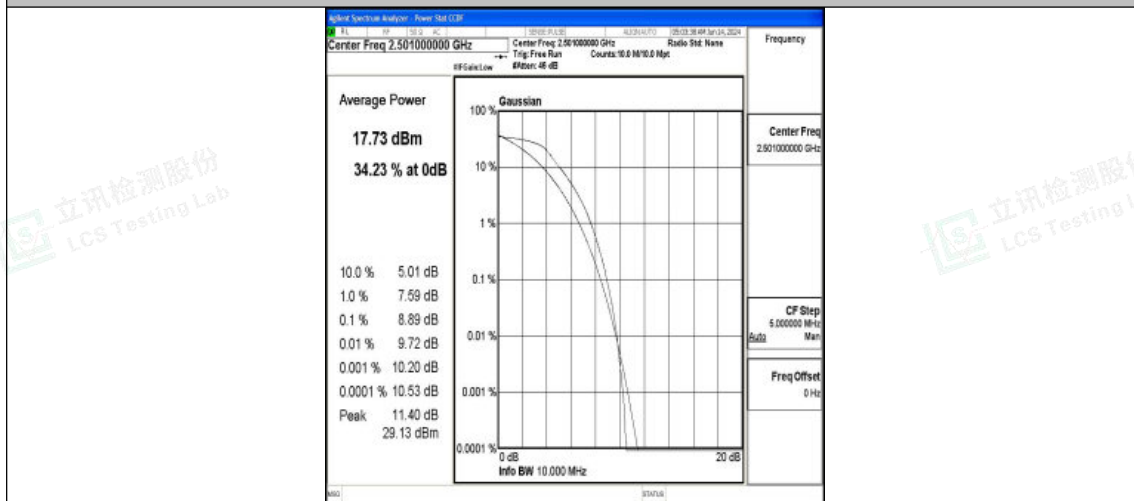

Band41-10MHz-QPSK-39700-50RB#0-PASS




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity

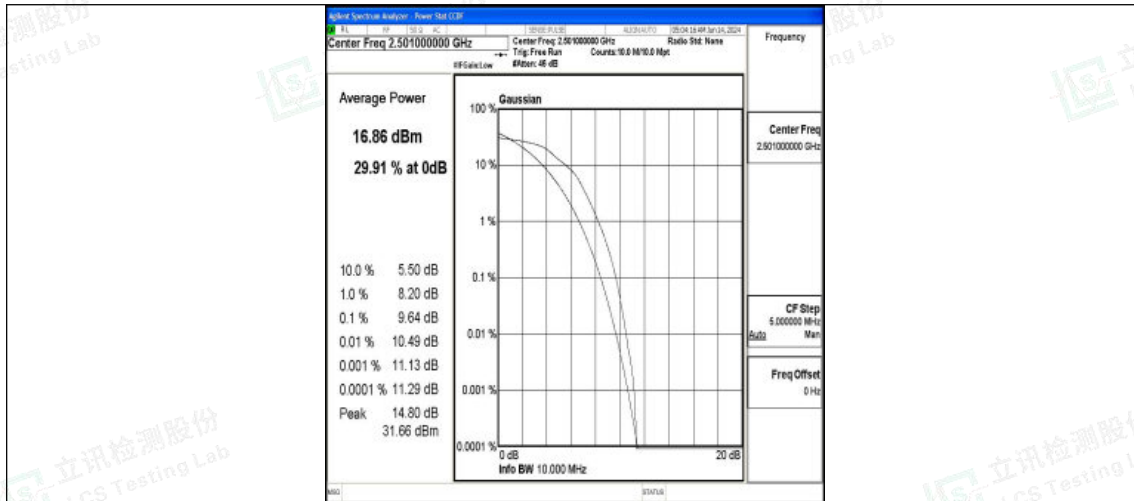

Band41-10MHz-16QAM-39700-50RB#0-PASS

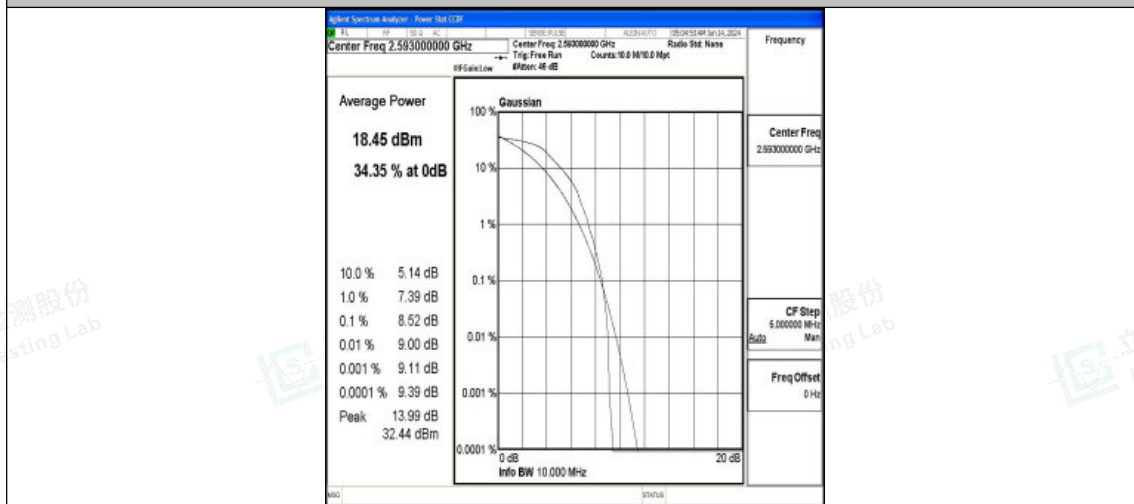


Band41-10MHz-QPSK-40620-1RB#0-PASS

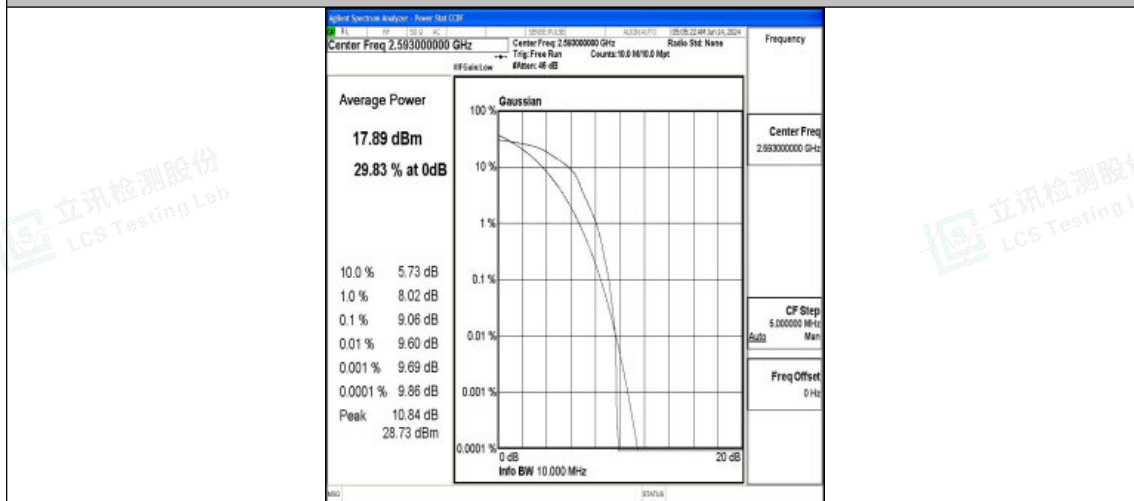


Band41-10MHz-16QAM-40620-1RB#0-PASS




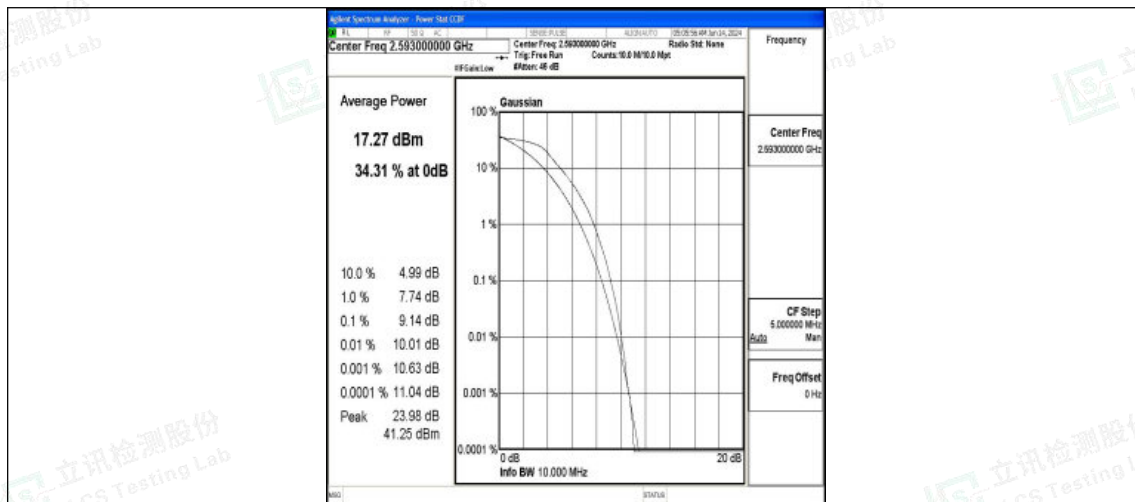

Band41-10MHz-QPSK-40620-50RB#0-PASS

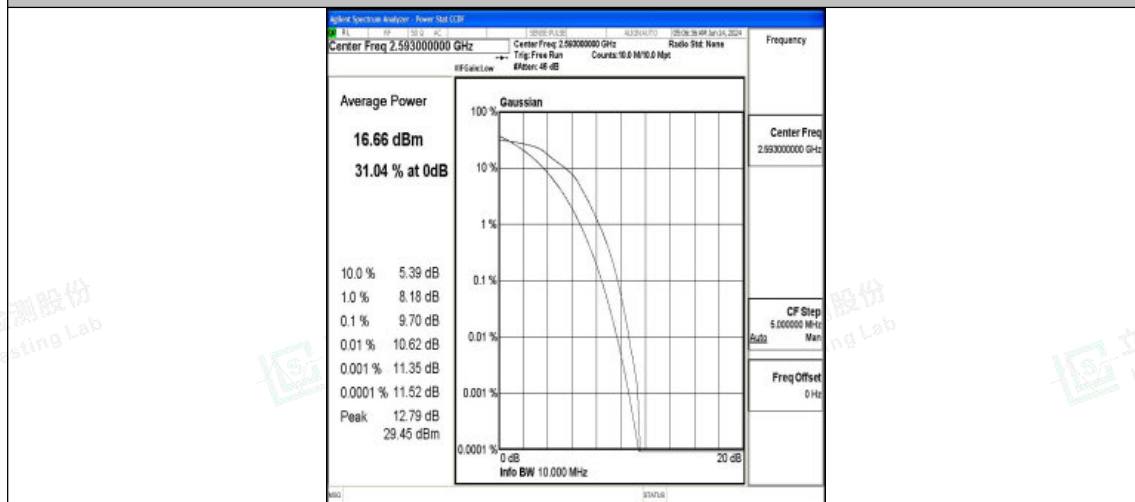


Band41-10MHz-16QAM-40620-50RB#0-PASS

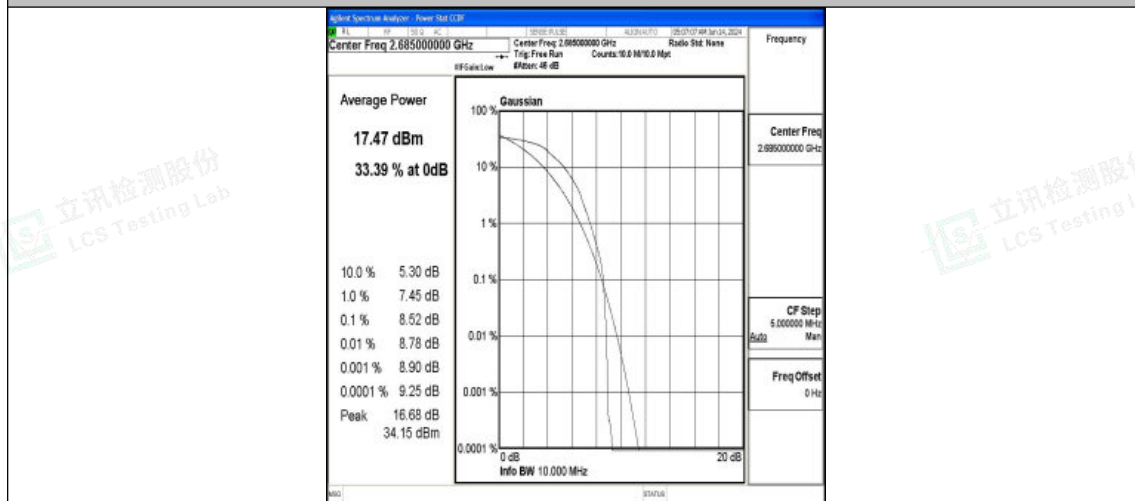


Band41-10MHz-QPSK-41540-1RB#0-PASS




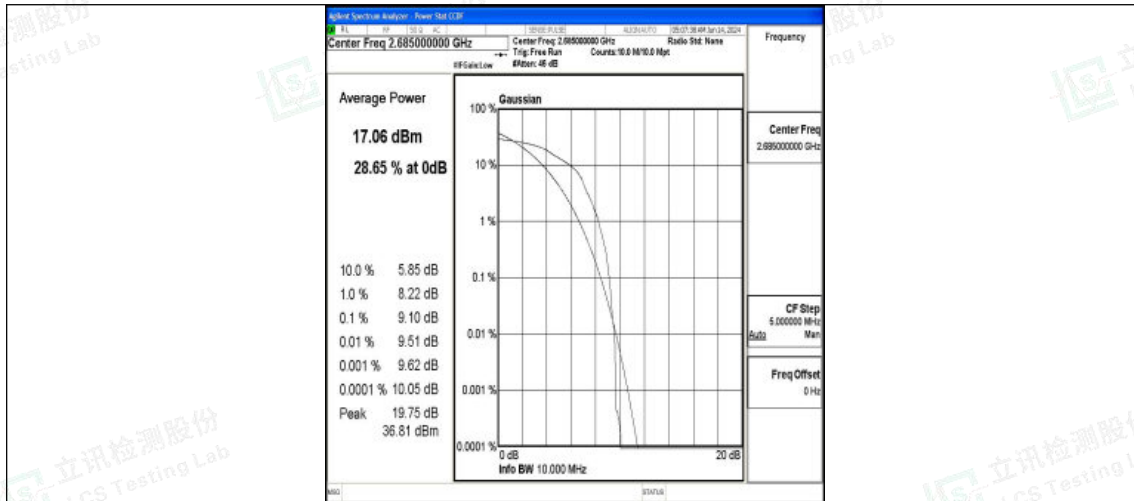

Band41-10MHz-16QAM-41540-1RB#0-PASS

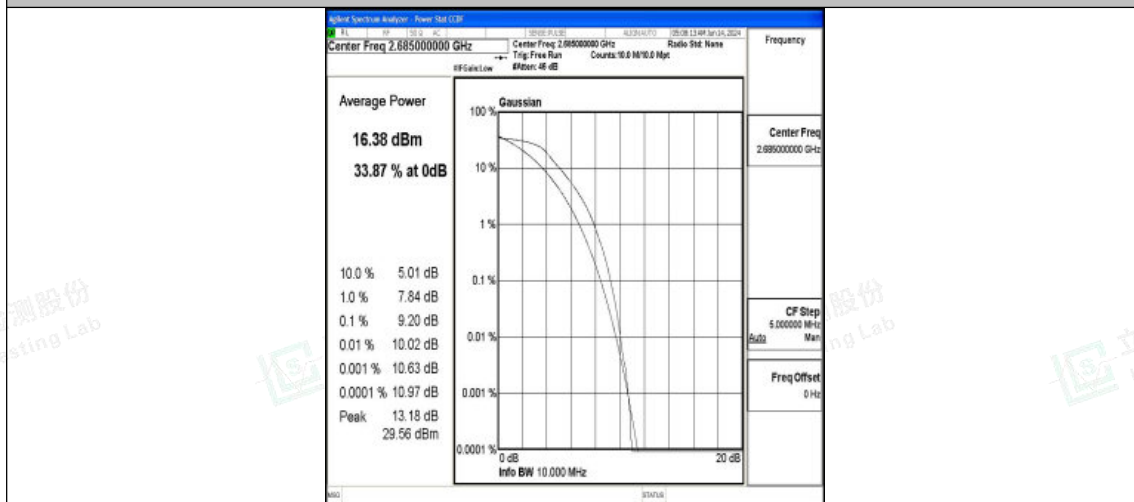

Band41-10MHz-QPSK-41540-50RB#0-PASS

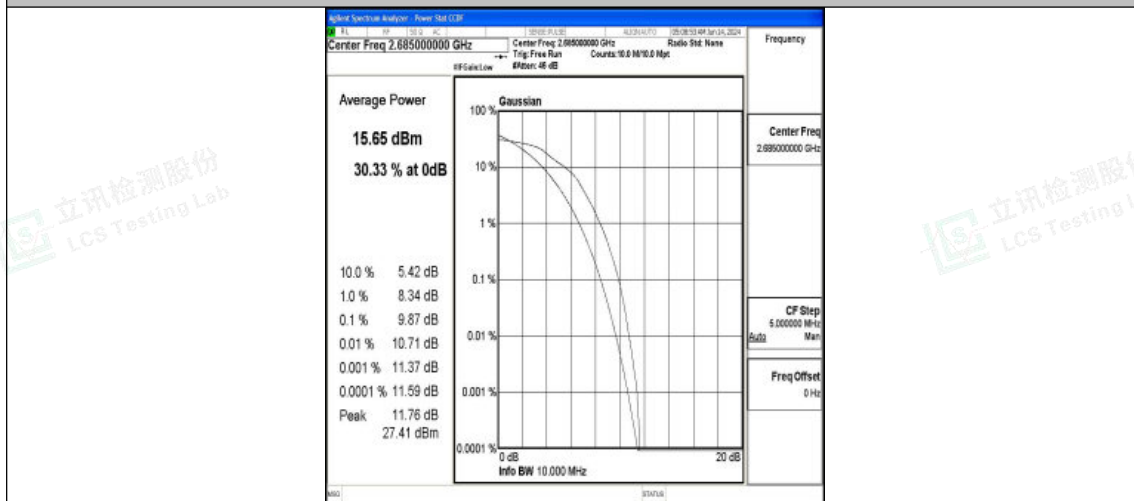

Band41-10MHz-16QAM-41540-50RB#0-PASS




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity

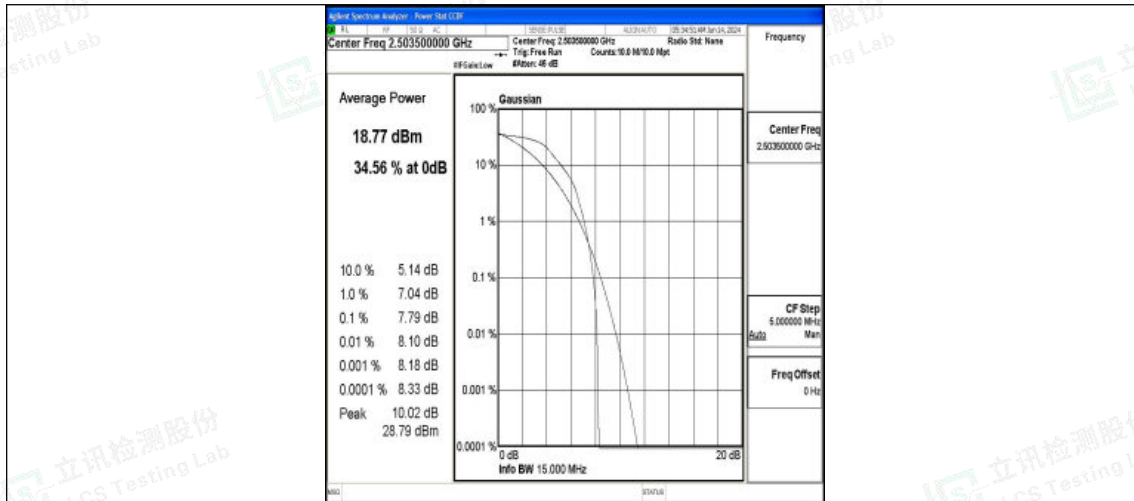

Band41-15MHz-QPSK-39725-1RB#0-PASS

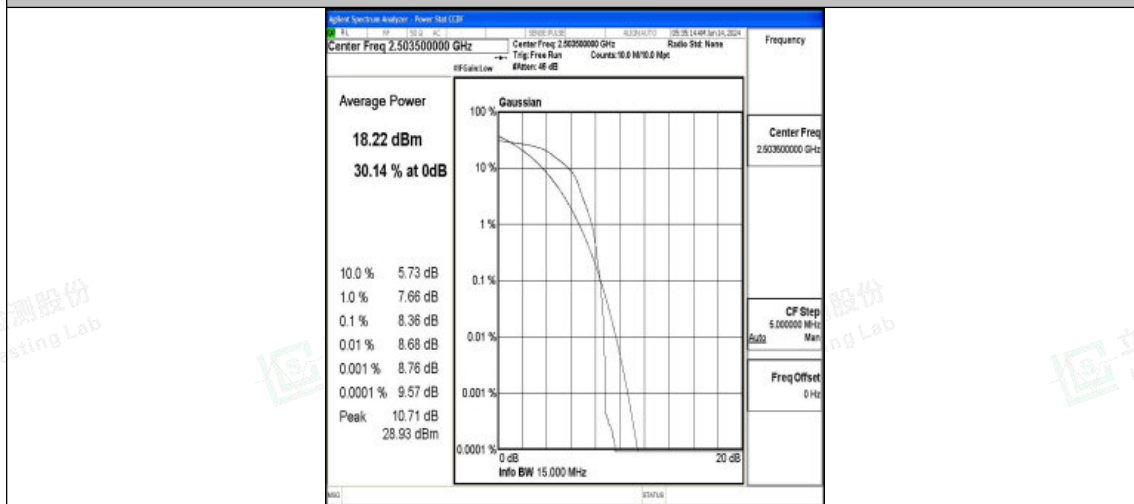

Band41-15MHz-16QAM-39725-1RB#0-PASS

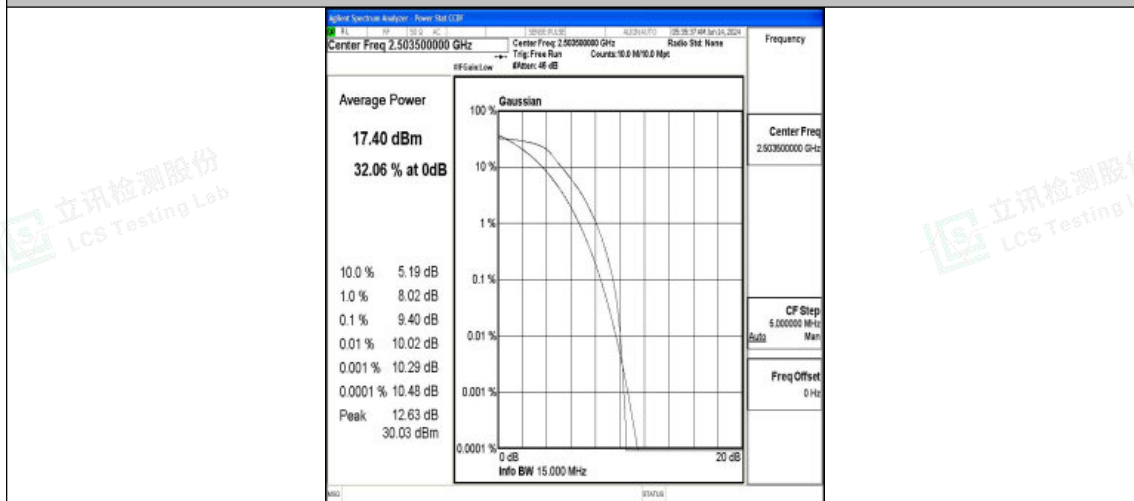

Band41-15MHz-QPSK-39725-75RB#0-PASS




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity

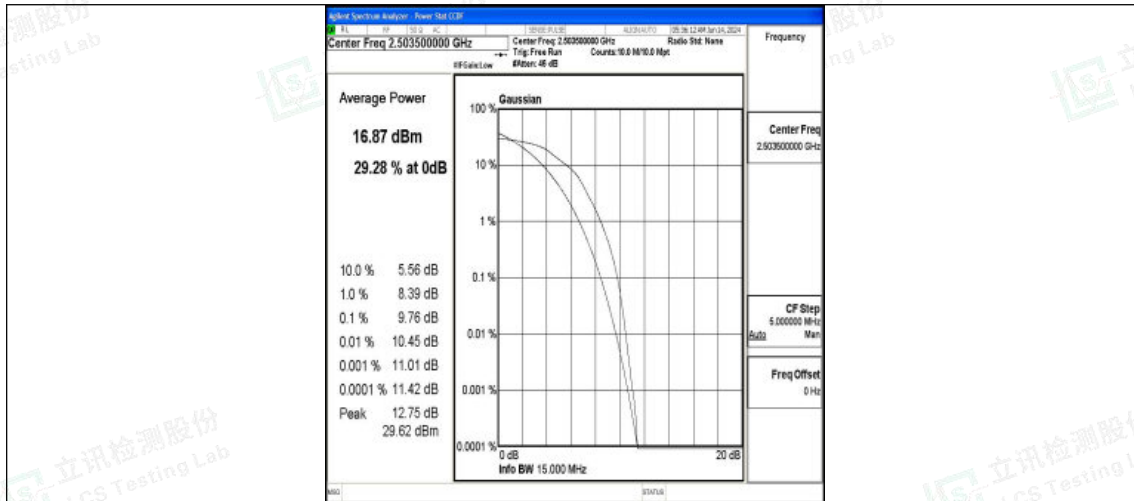

Band41-15MHz-16QAM-39725-75RB#0-PASS

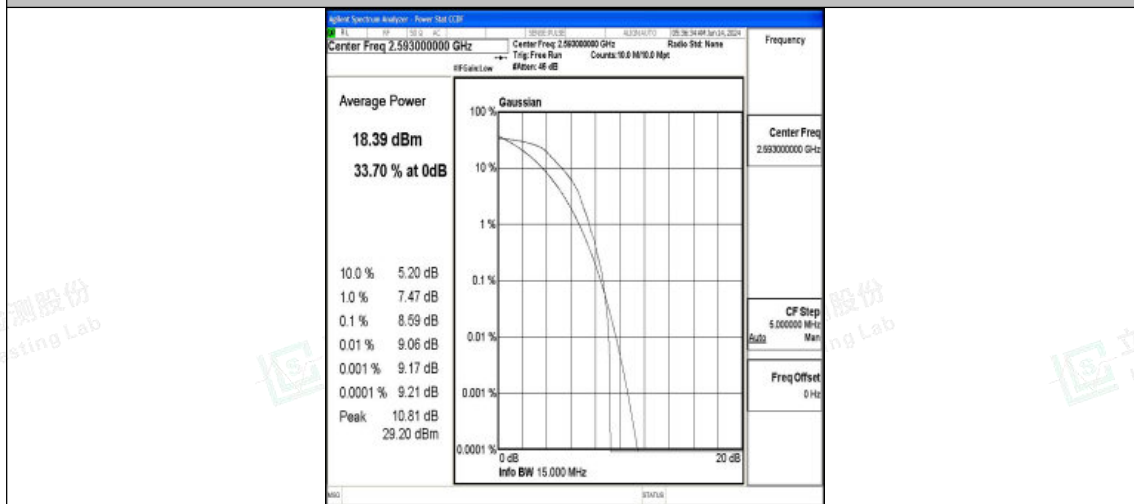

Band41-15MHz-QPSK-40620-1RB#0-PASS

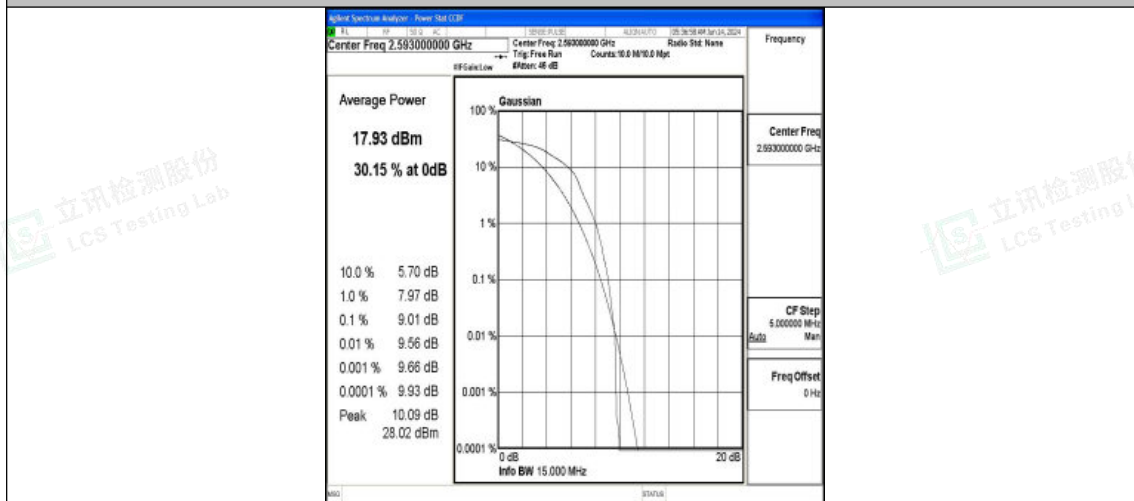

Band41-15MHz-16QAM-40620-1RB#0-PASS




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity

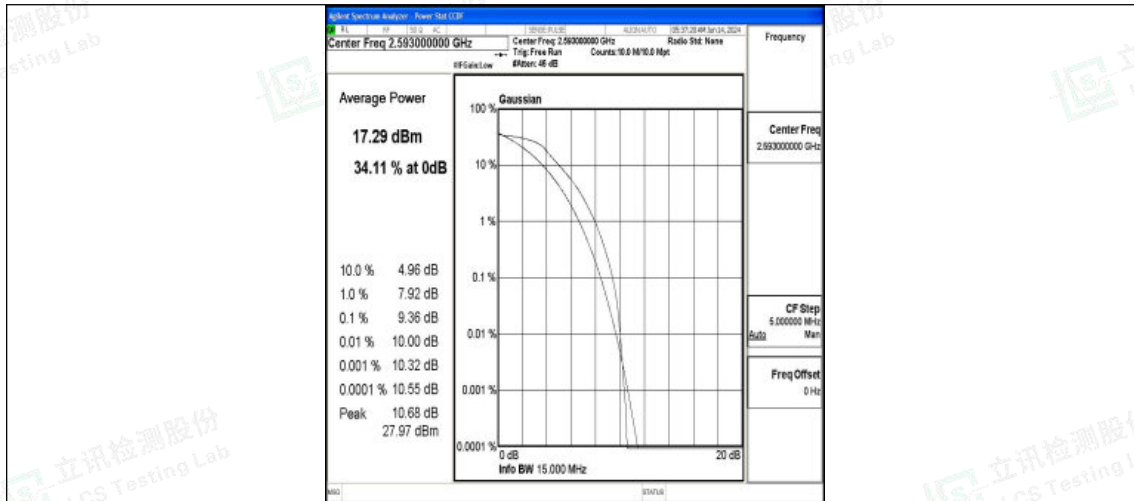

Band41-15MHz-QPSK-40620-75RB#0-PASS

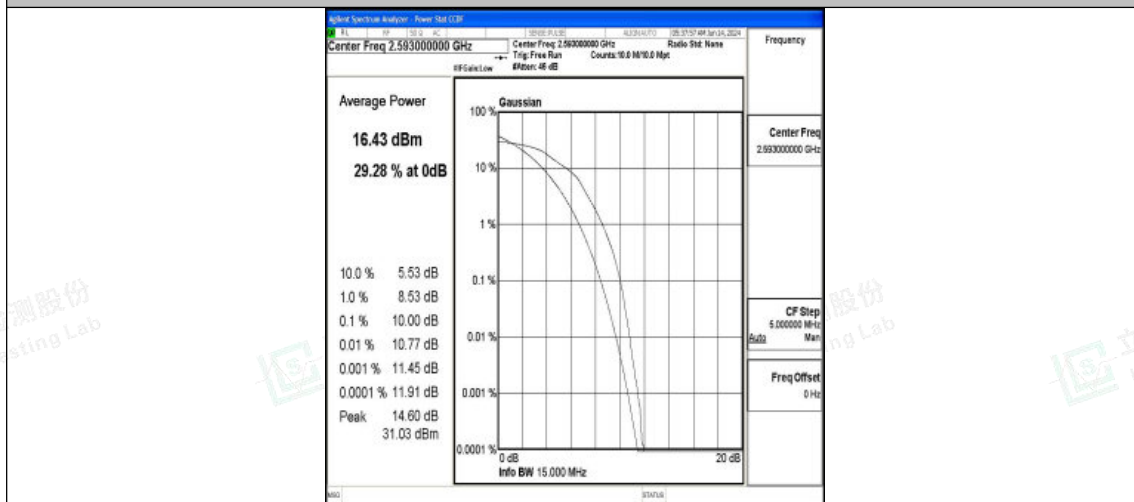


Band41-15MHz-16QAM-40620-75RB#0-PASS

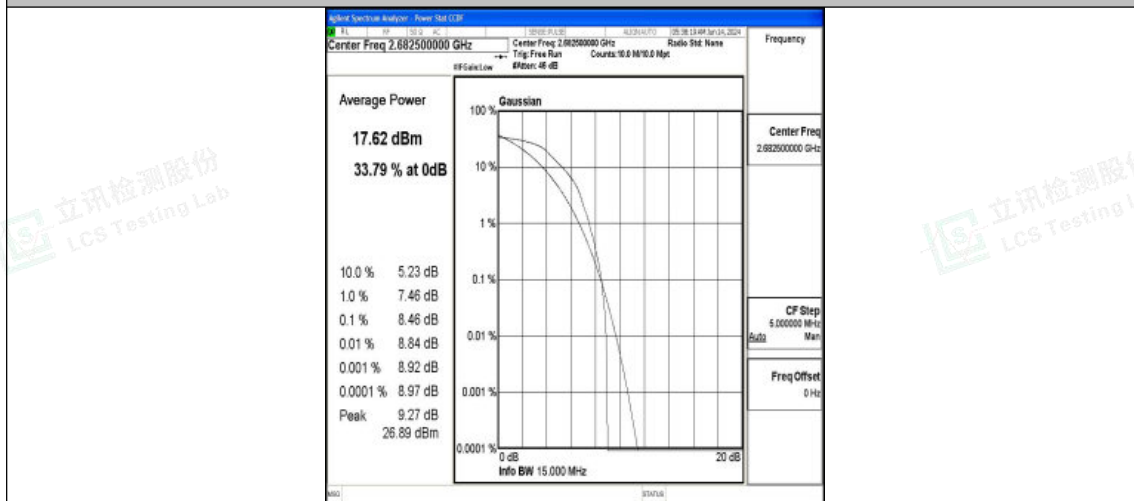


Band41-15MHz-QPSK-41515-1RB#0-PASS




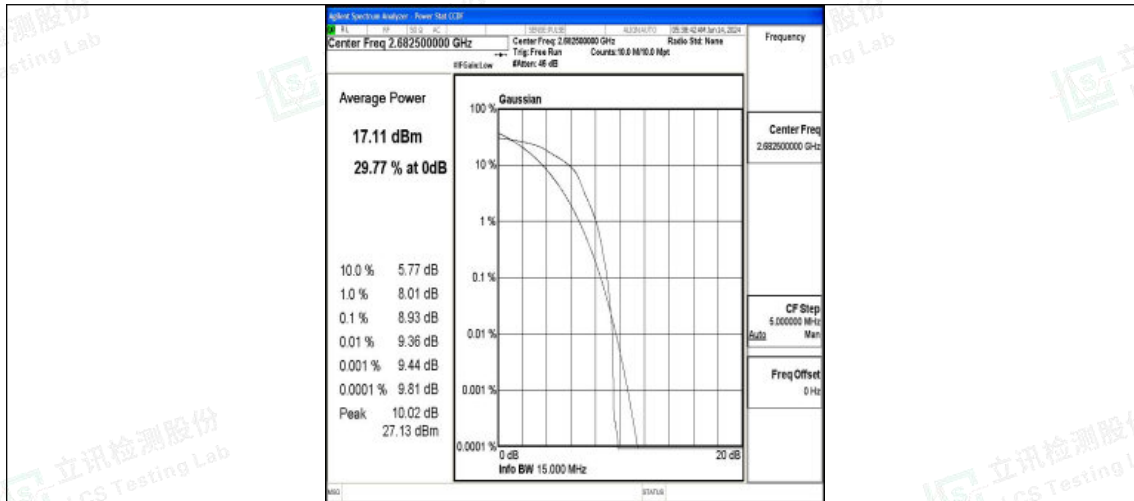

Band41-15MHz-16QAM-41515-1RB#0-PASS

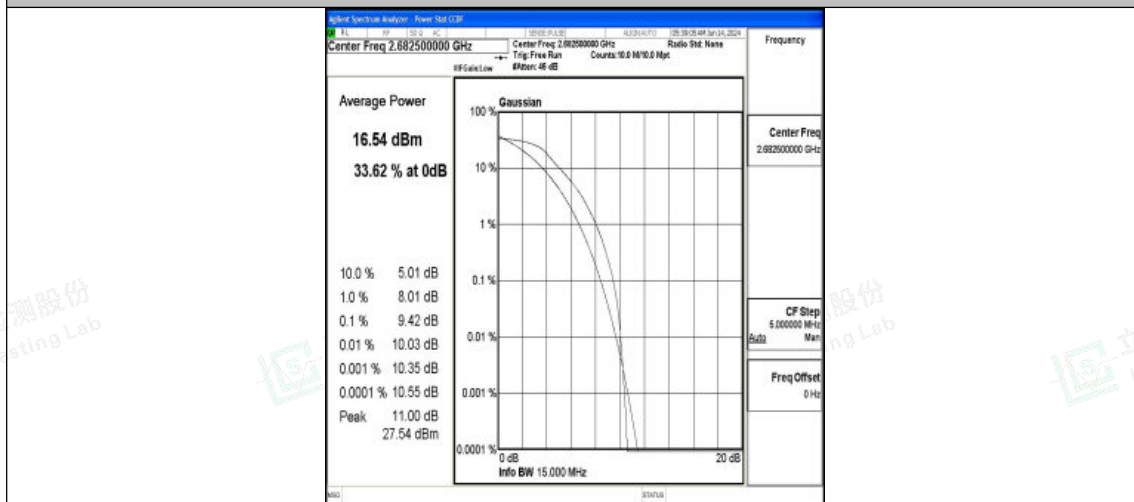

Band41-15MHz-QPSK-41515-75RB#0-PASS

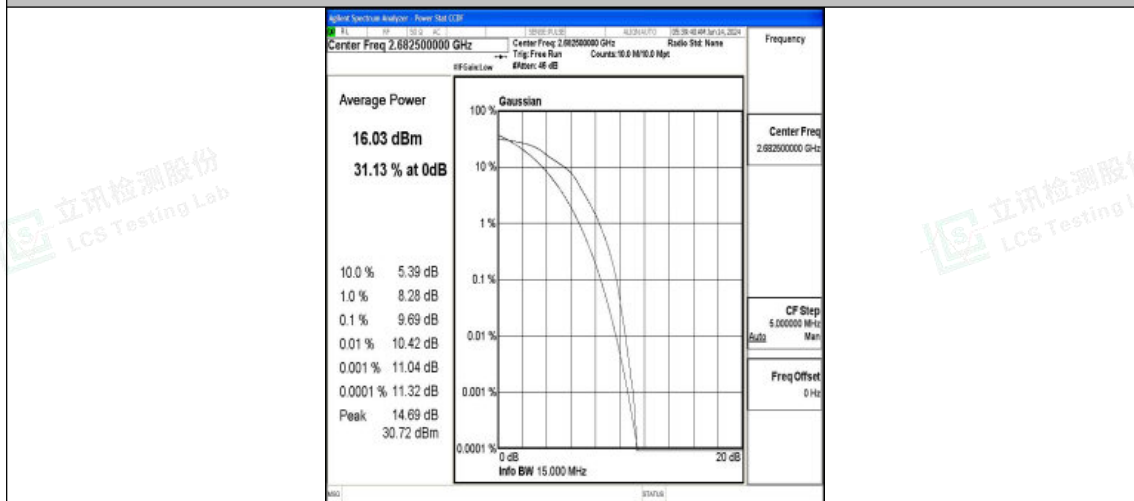

Band41-15MHz-16QAM-41515-75RB#0-PASS




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity

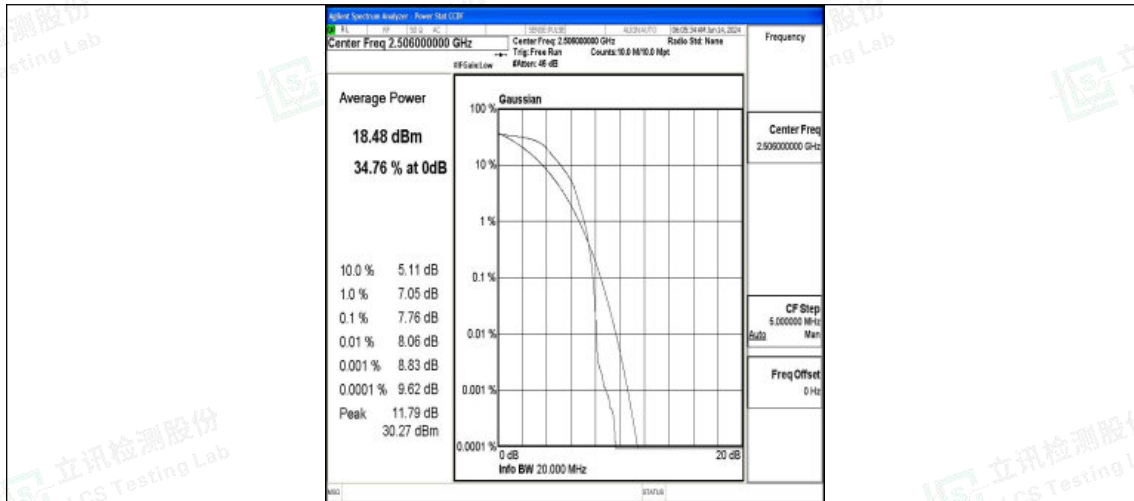

Band41-20MHz-QPSK-39750-1RB#0-PASS

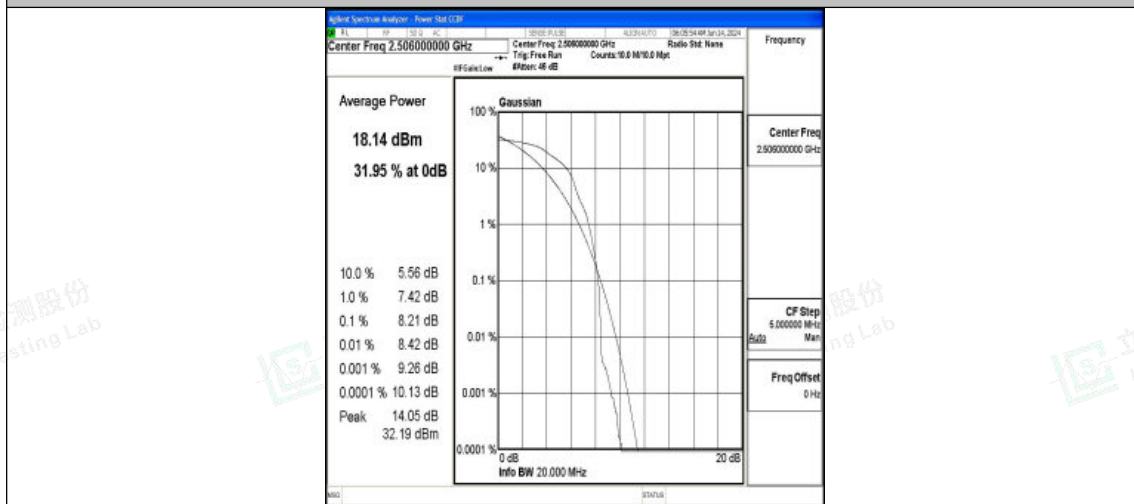

Band41-20MHz-16QAM-39750-1RB#0-PASS

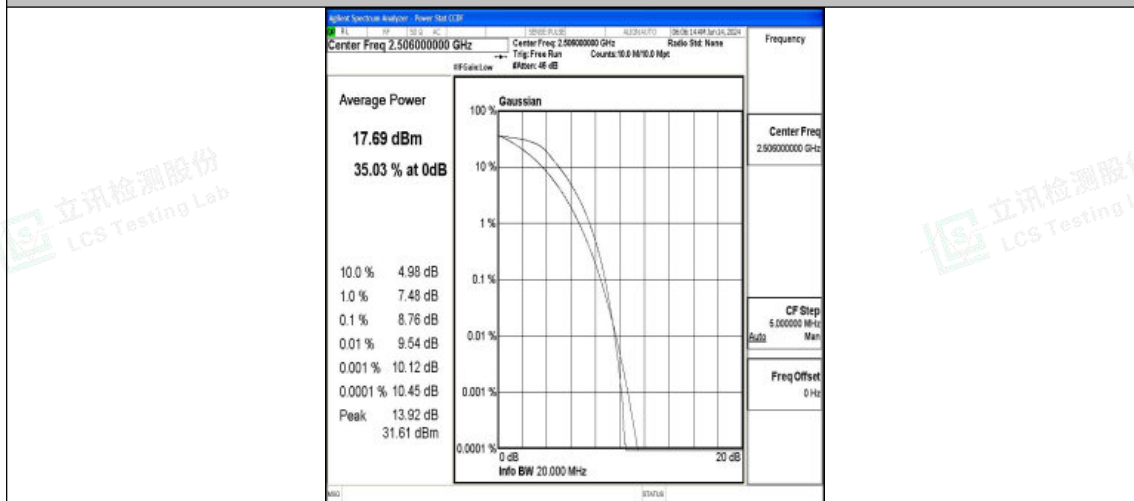

Band41-20MHz-QPSK-39750-100RB#0-PASS




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity

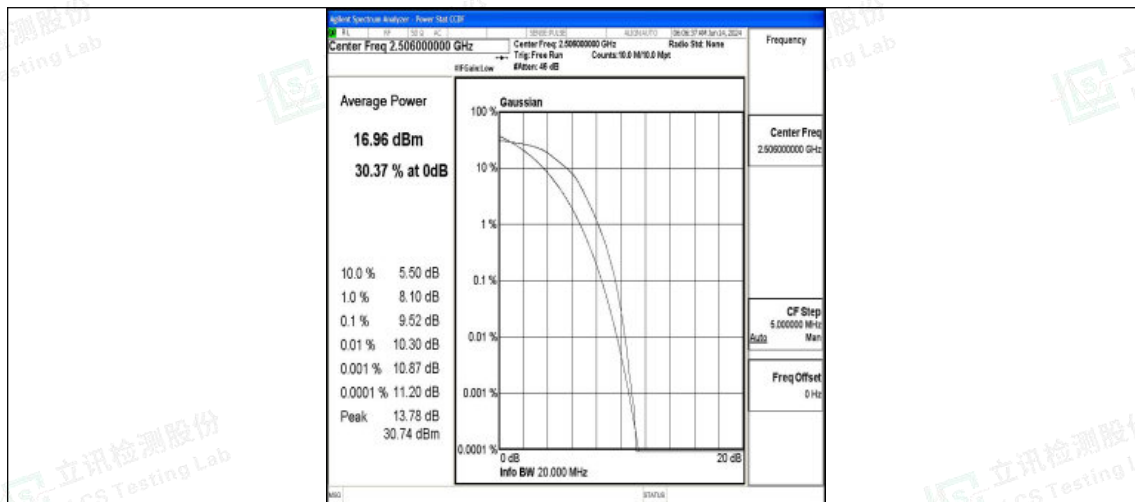

Band41-20MHz-16QAM-39750-100RB#0-PASS

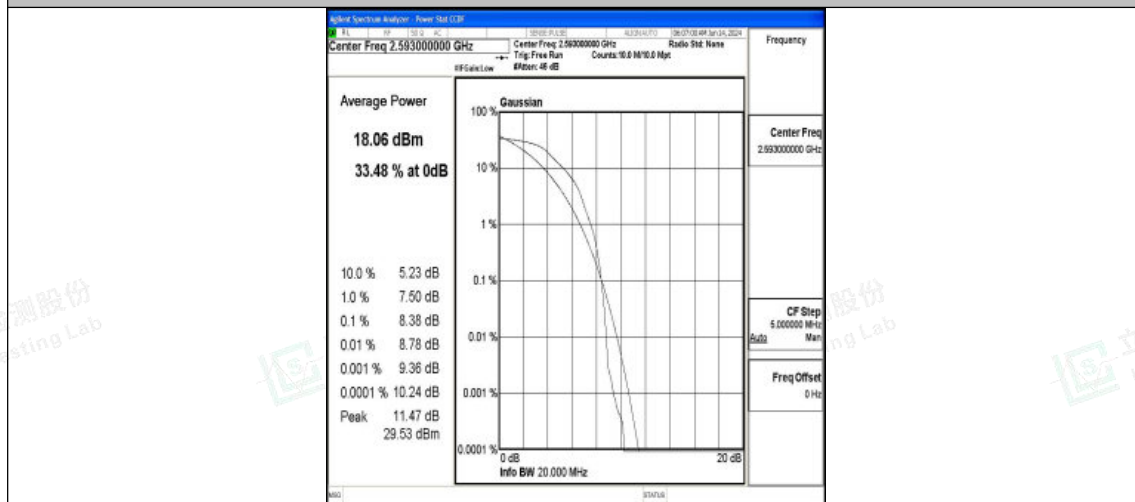


Band41-20MHz-QPSK-40620-1RB#0-PASS

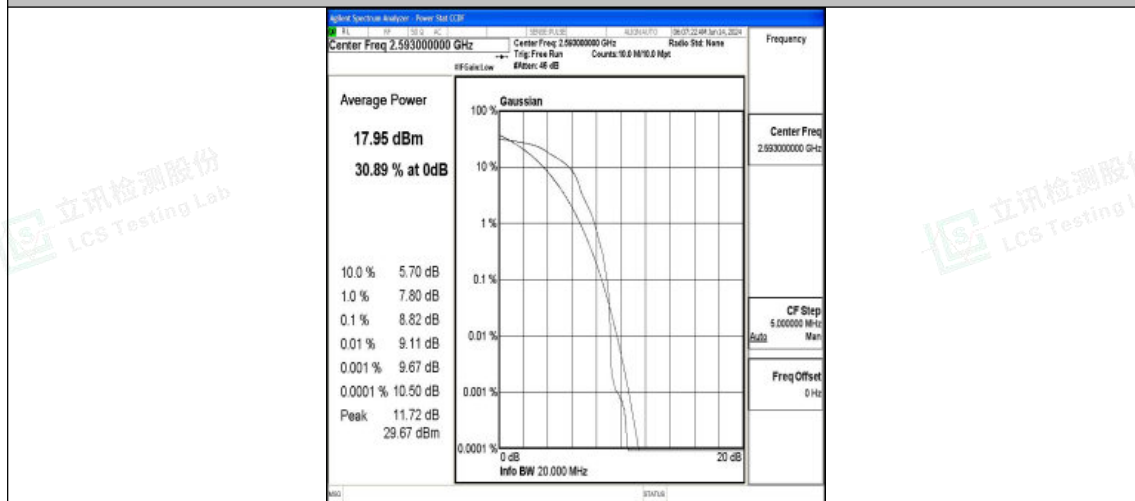


Band41-20MHz-16QAM-40620-1RB#0-PASS




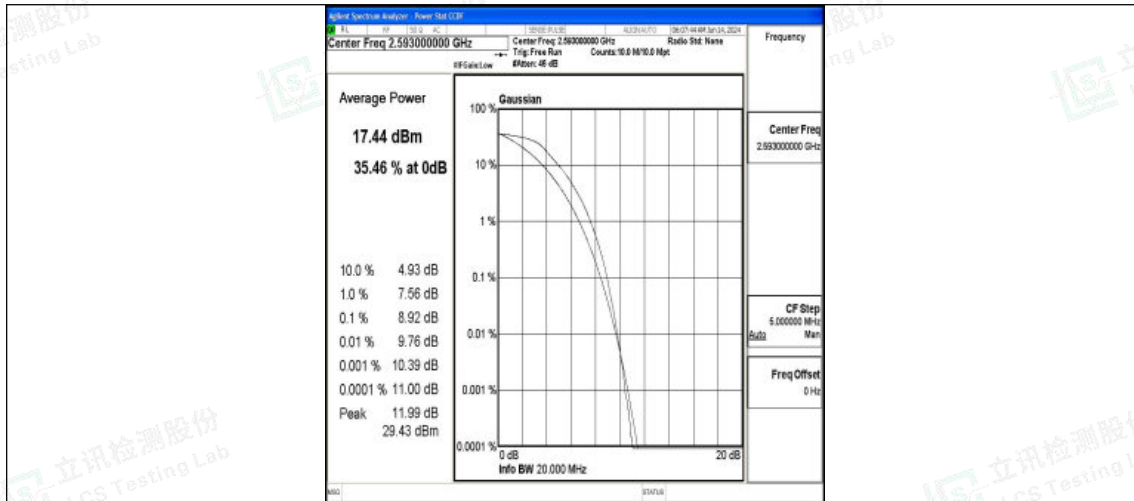

Band41-20MHz-QPSK-40620-100RB#0-PASS

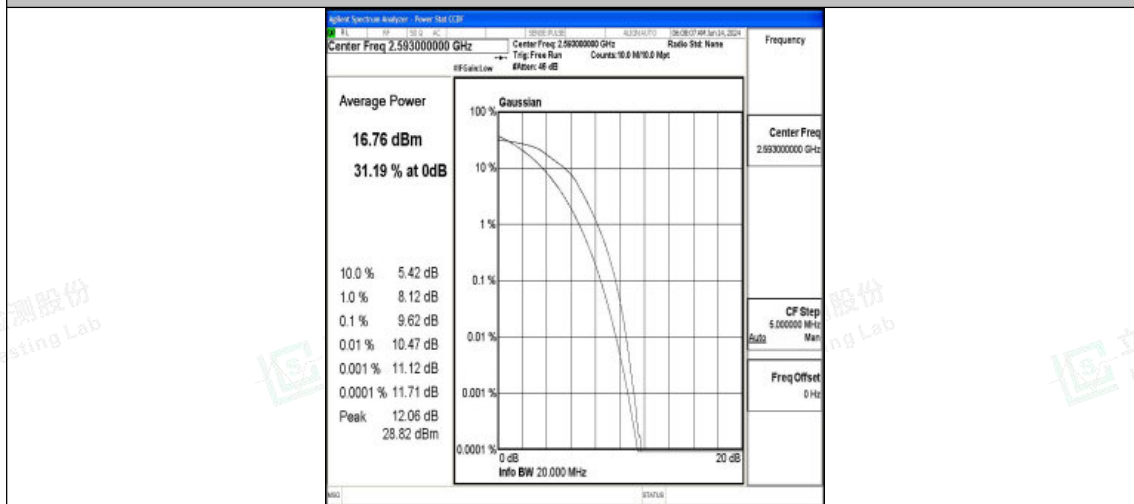

Band41-20MHz-16QAM-40620-100RB#0-PASS

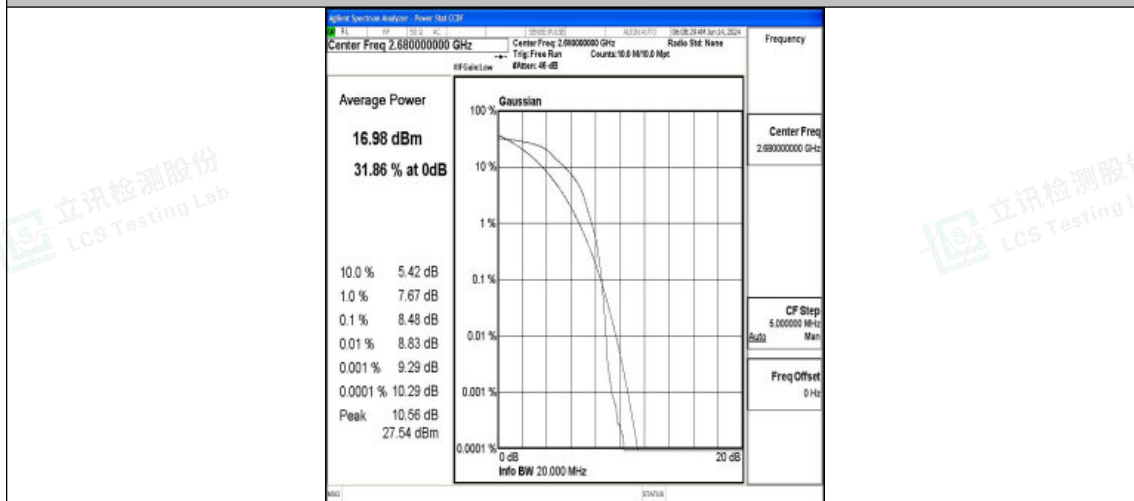

Band41-20MHz-QPSK-41490-1RB#0-PASS




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity

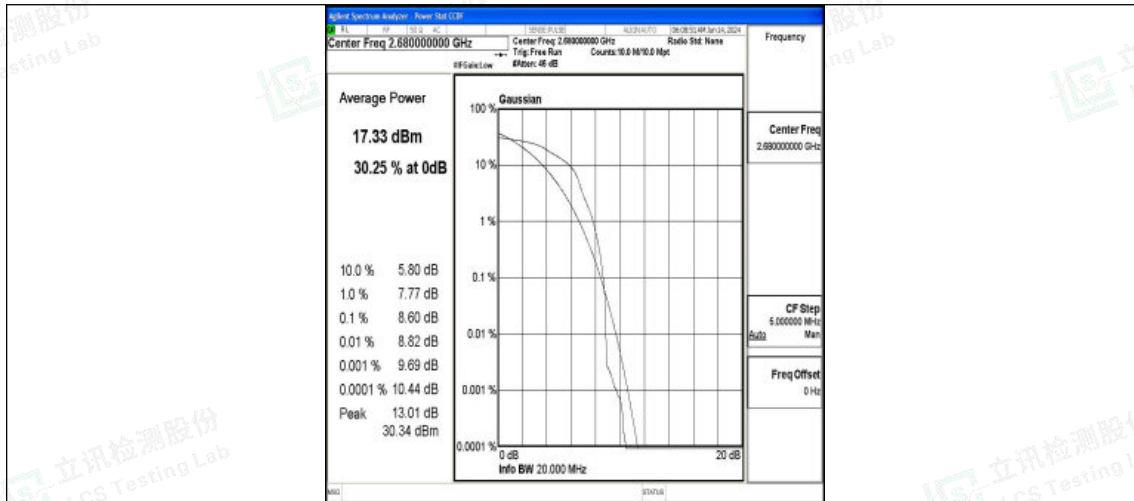

Band41-20MHz-16QAM-41490-1RB#0-PASS

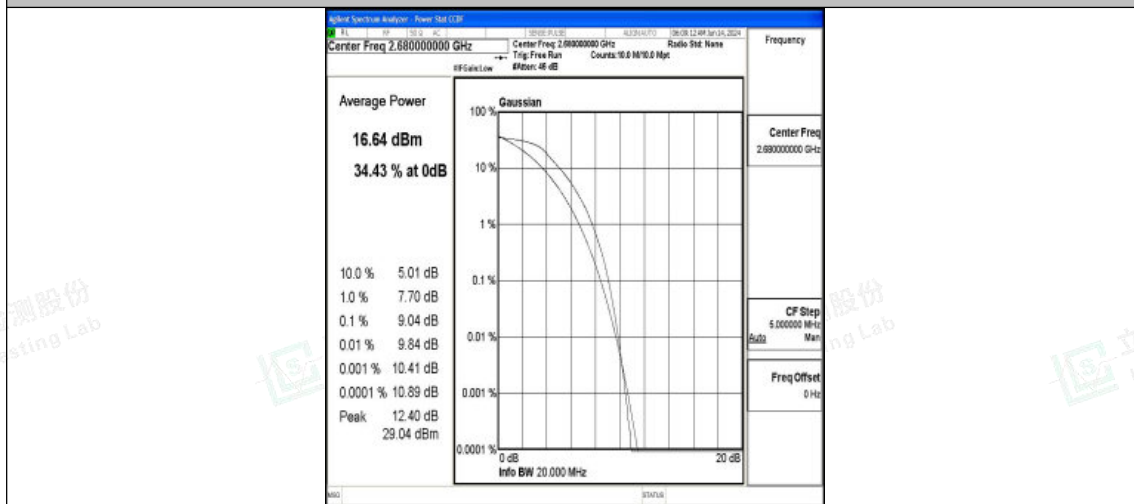

Band41-20MHz-QPSK-41490-100RB#0-PASS

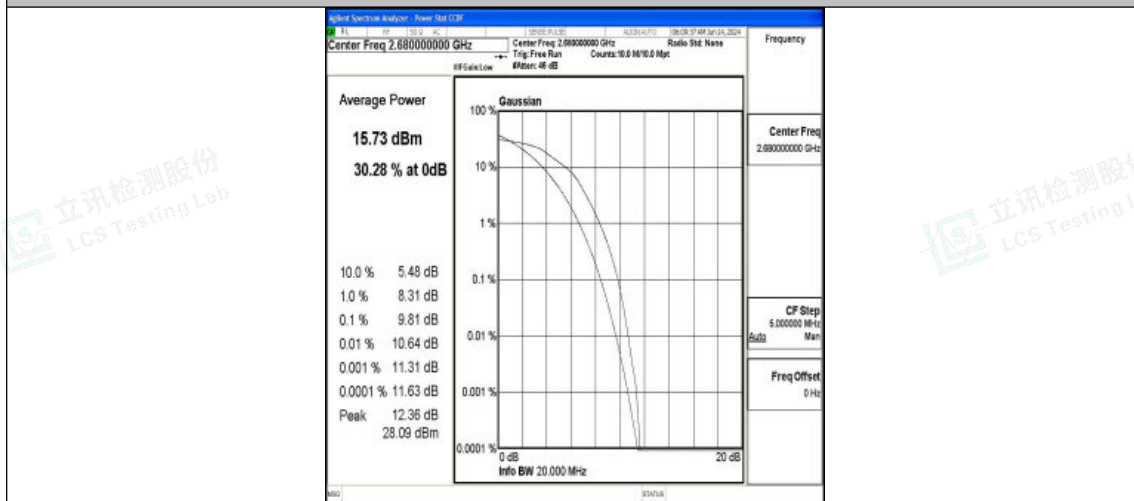

Band41-20MHz-16QAM-41490-100RB#0-PASS





H.3 26dB Bandwidth and Occupied Bandwidth

Test Result

Band	Bandwidth	Modulation	Channel	RB Configuration	Occupied Bandwidth (MHz)	26dB Bandwidth (MHz)	Verdict
Band41	5MHz	QPSK	39675	25RB#0	4.5153	5.264	PASS
Band41	5MHz	16QAM	39675	25RB#0	4.5087	5.292	PASS
Band41	5MHz	QPSK	40620	25RB#0	4.5226	5.216	PASS
Band41	5MHz	16QAM	40620	25RB#0	4.5260	5.351	PASS
Band41	5MHz	QPSK	41565	25RB#0	4.4968	5.162	PASS
Band41	5MHz	16QAM	41565	25RB#0	4.5007	5.269	PASS
Band41	10MHz	QPSK	39700	50RB#0	8.9917	10.14	PASS
Band41	10MHz	16QAM	39700	50RB#0	8.9904	10.05	PASS
Band41	10MHz	QPSK	40620	50RB#0	8.9994	10.15	PASS
Band41	10MHz	16QAM	40620	50RB#0	9.0096	10.17	PASS
Band41	10MHz	QPSK	41540	50RB#0	9.0148	10.14	PASS
Band41	10MHz	16QAM	41540	50RB#0	9.0137	11.08	PASS
Band41	15MHz	QPSK	39725	75RB#0	13.540	16.59	PASS
Band41	15MHz	16QAM	39725	75RB#0	13.478	15.40	PASS
Band41	15MHz	QPSK	40620	75RB#0	13.538	16.16	PASS
Band41	15MHz	16QAM	40620	75RB#0	13.521	15.11	PASS
Band41	15MHz	QPSK	41515	75RB#0	13.524	15.92	PASS
Band41	15MHz	16QAM	41515	75RB#0	13.516	15.58	PASS
Band41	20MHz	QPSK	39750	100RB#0	17.933	20.35	PASS
Band41	20MHz	16QAM	39750	100RB#0	17.976	20.40	PASS
Band41	20MHz	QPSK	40620	100RB#0	18.017	20.54	PASS
Band41	20MHz	16QAM	40620	100RB#0	18.022	20.30	PASS
Band41	20MHz	QPSK	41490	100RB#0	17.997	20.26	PASS
Band41	20MHz	16QAM	41490	100RB#0	17.988	20.18	PASS



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



Test Graphs




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity

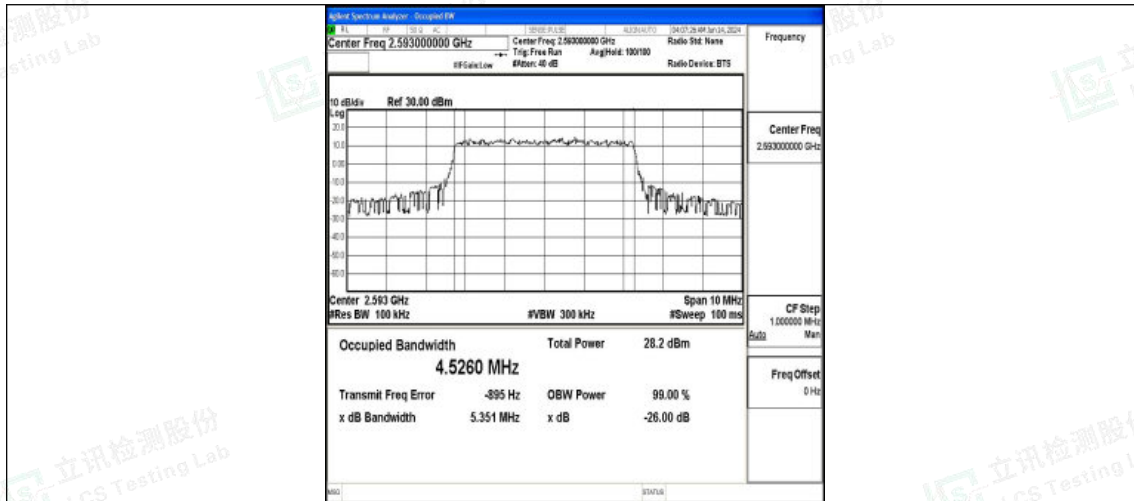

Band41-5MHz-16QAM-40620-25RB#0-PASS

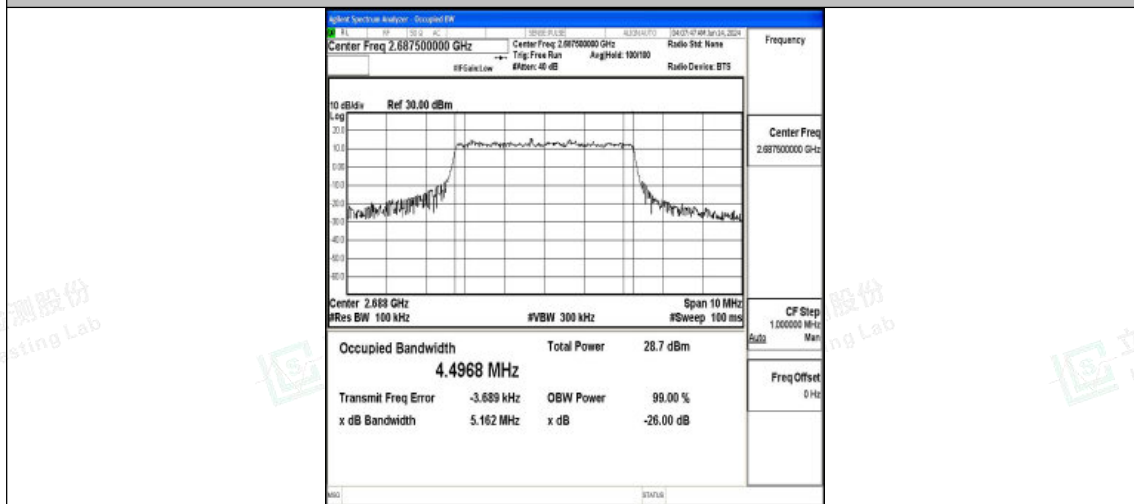

Band41-5MHz-QPSK-41565-25RB#0-PASS

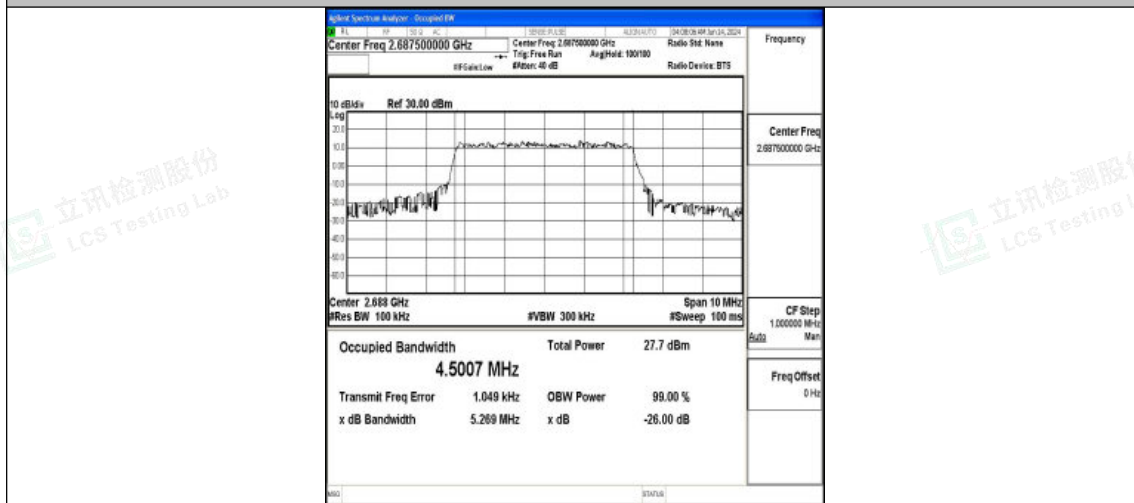

Band41-5MHz-16QAM-41565-25RB#0-PASS




Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

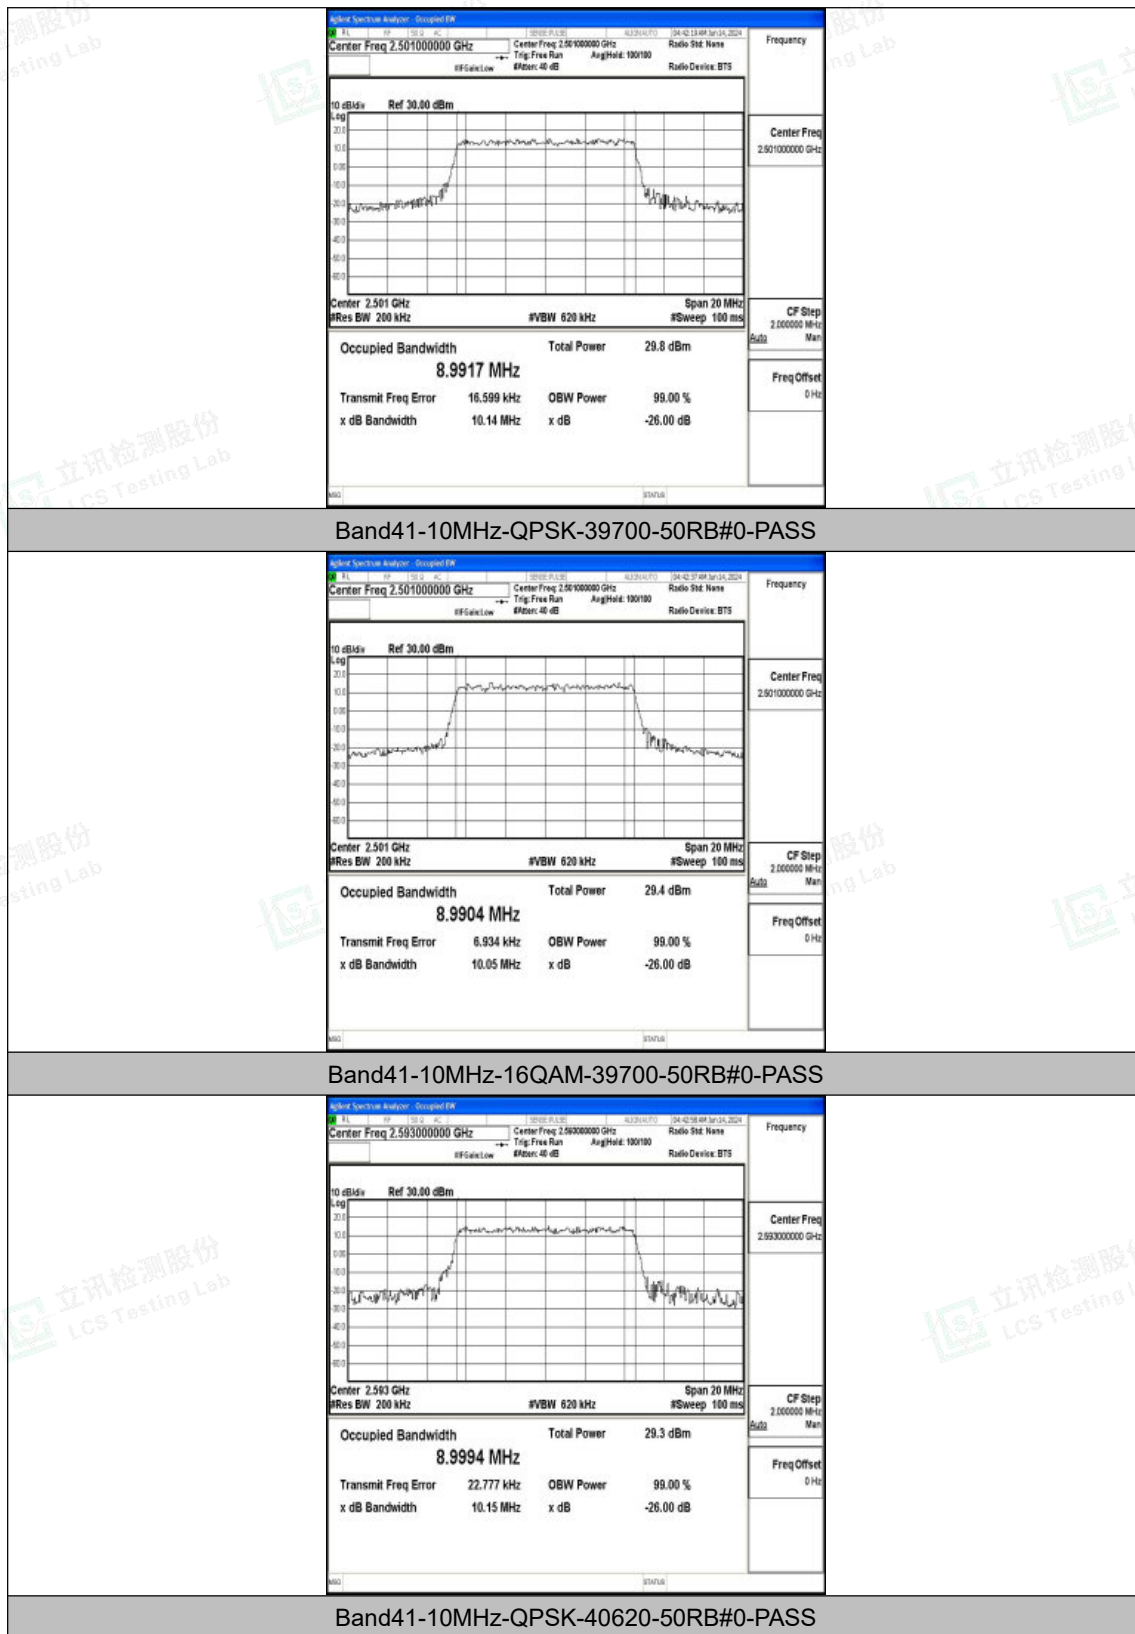


Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity

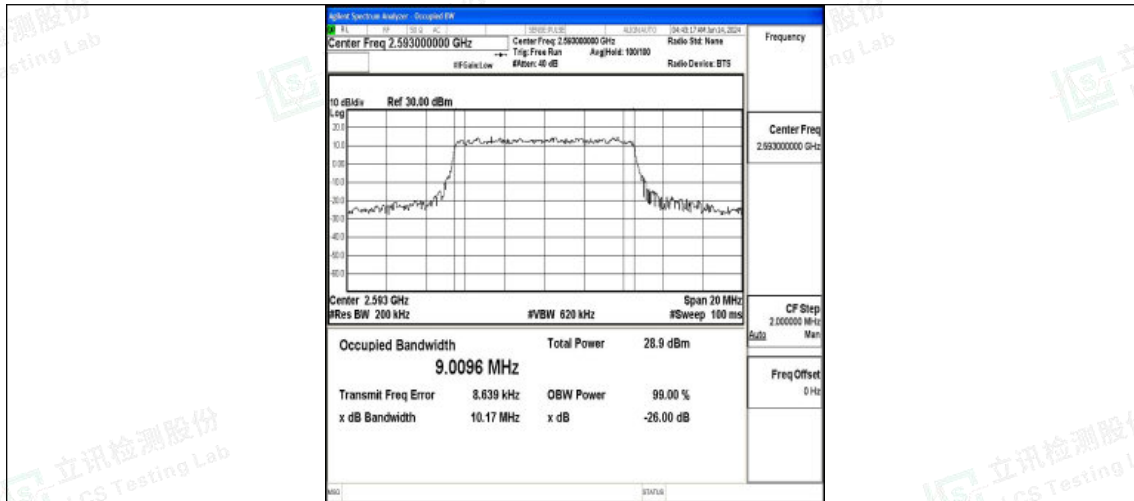

Band41-10MHz-16QAM-40620-50RB#0-PASS

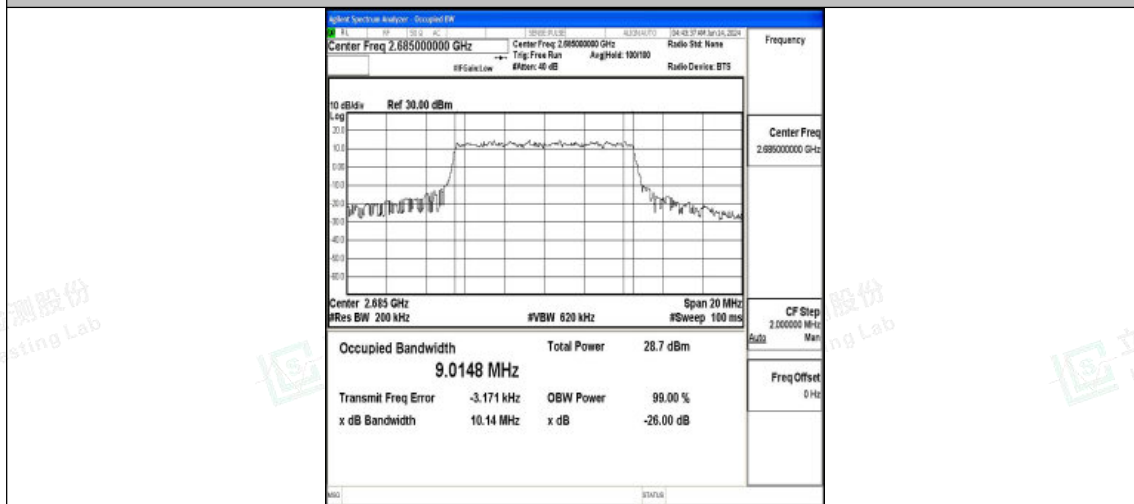

Band41-10MHz-QPSK-41540-50RB#0-PASS

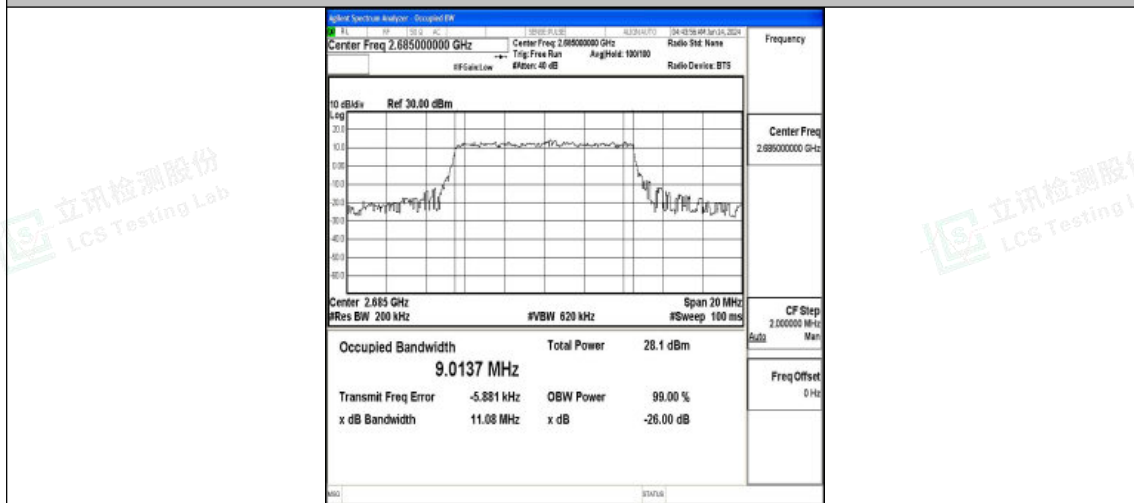

Band41-10MHz-16QAM-41540-50RB#0-PASS




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity

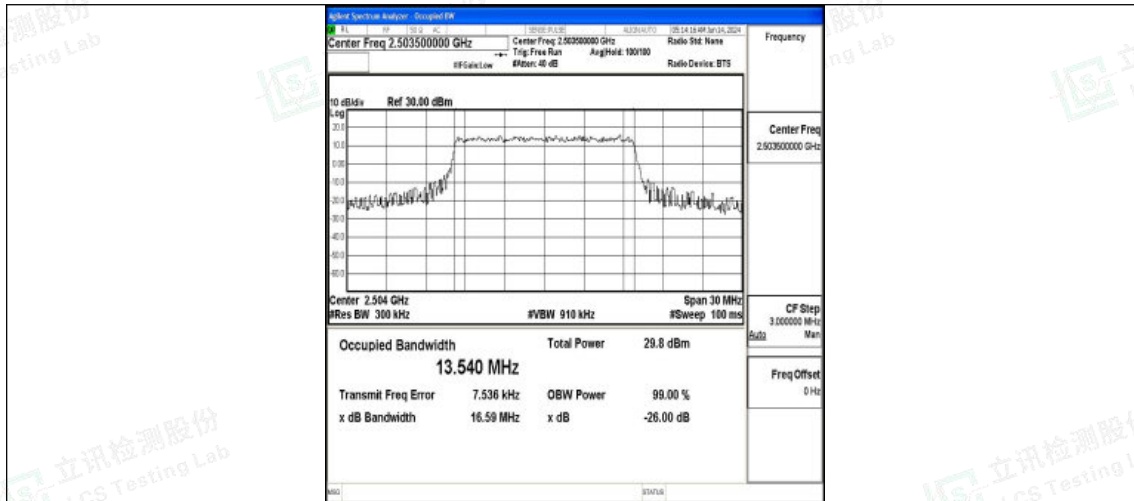

Band41-15MHz-QPSK-39725-75RB#0-PASS

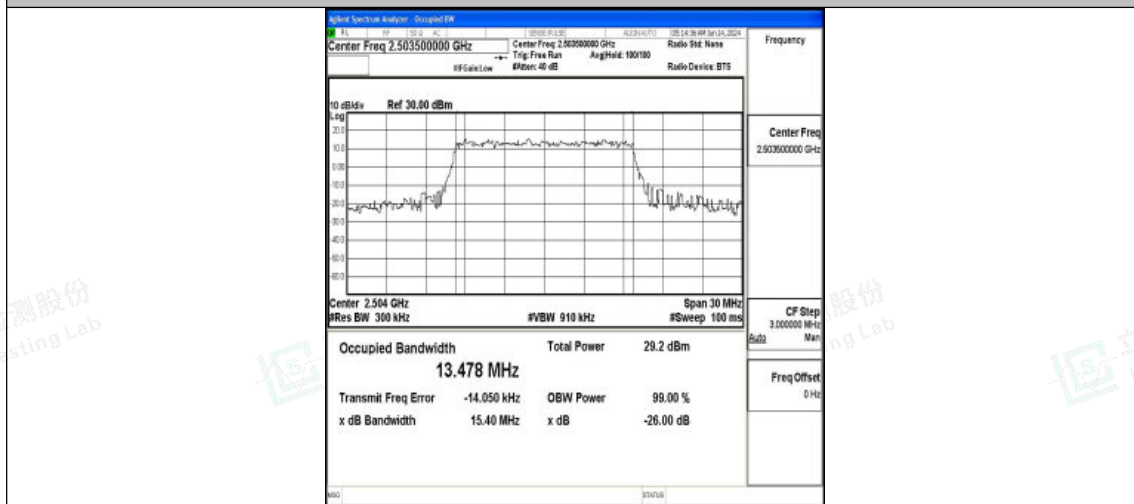

Band41-15MHz-16QAM-39725-75RB#0-PASS

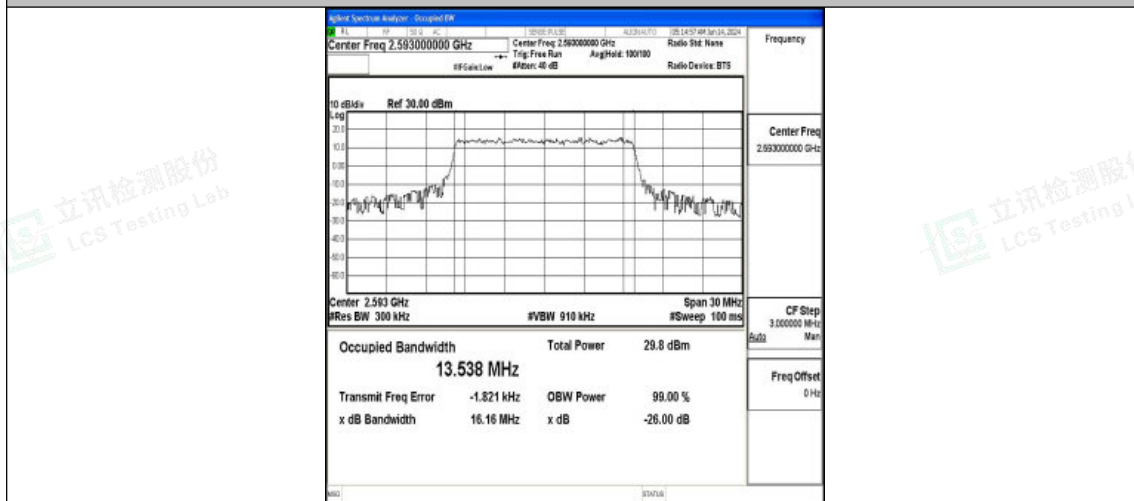

Band41-15MHz-QPSK-40620-75RB#0-PASS




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity

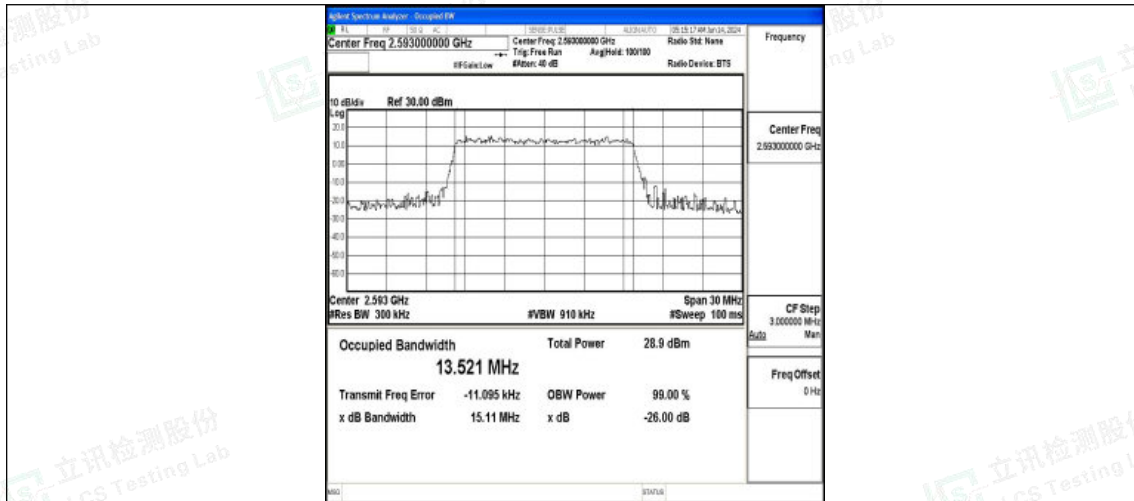

Band41-15MHz-16QAM-40620-75RB#0-PASS

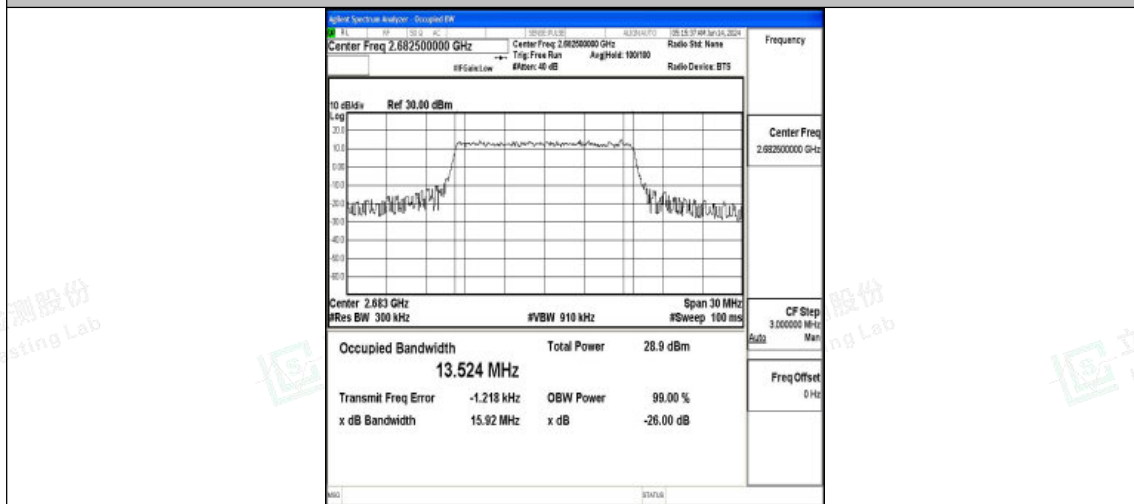

Band41-15MHz-QPSK-41515-75RB#0-PASS

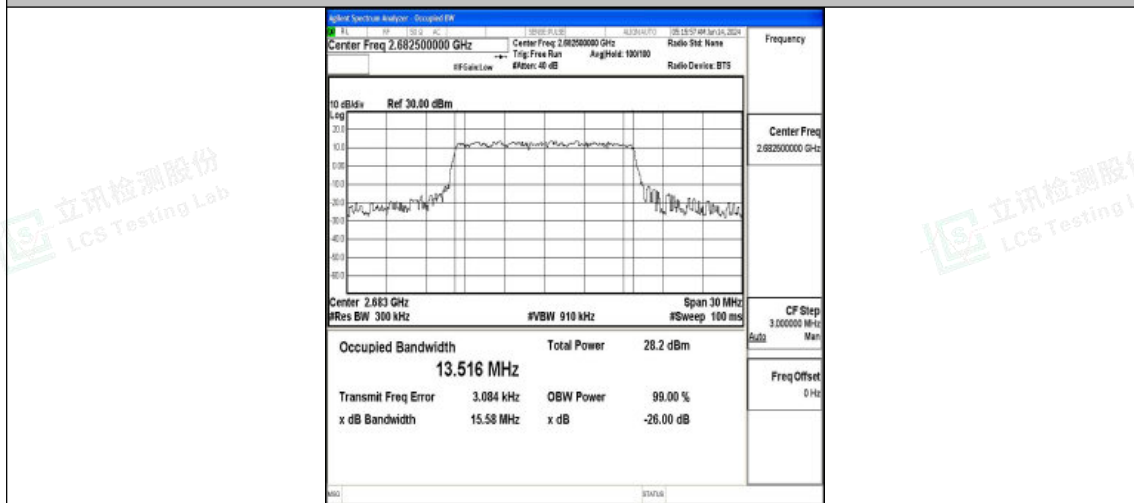

Band41-15MHz-16QAM-41515-75RB#0-PASS




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity

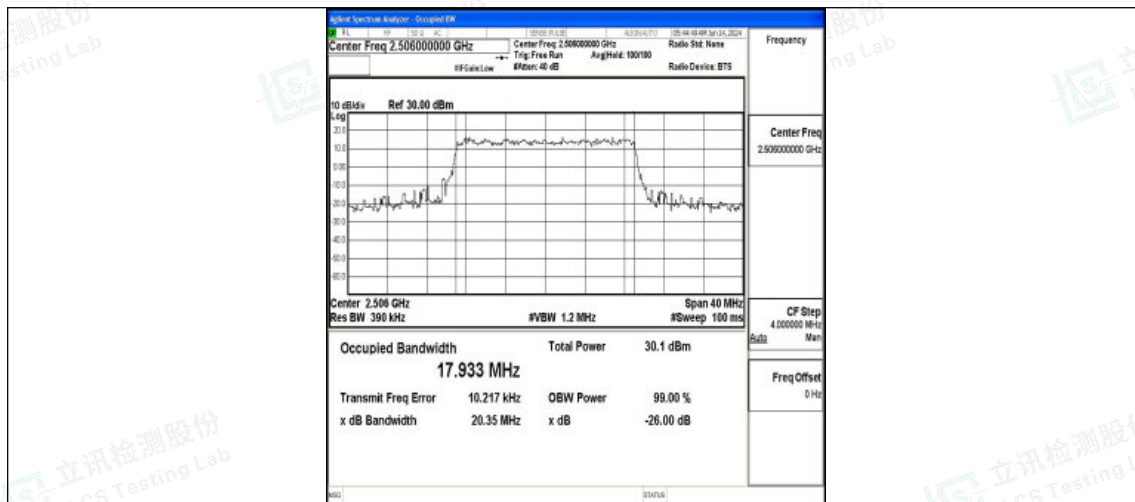

Band41-20MHz-QPSK-39750-100RB#0-PASS

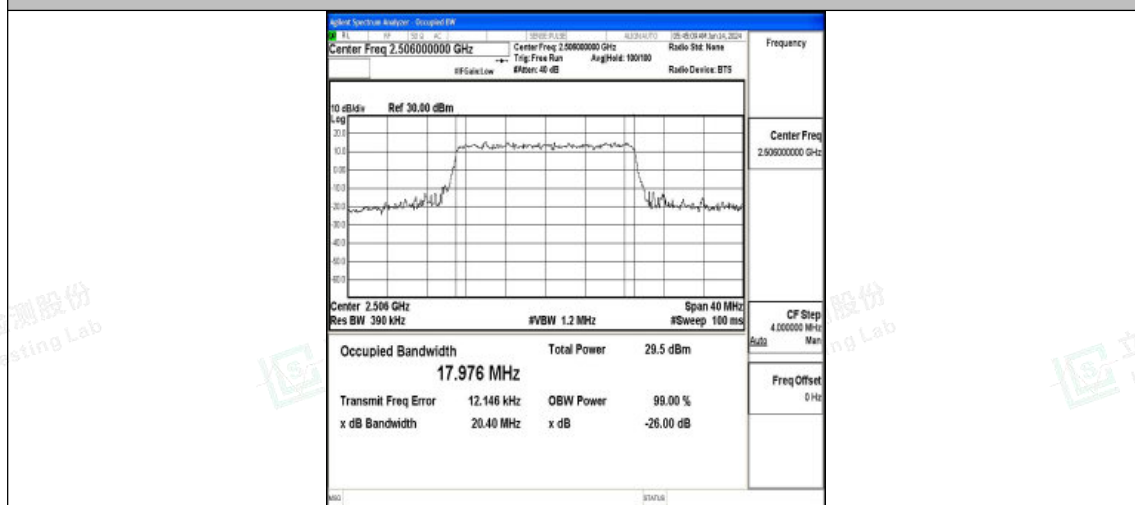

Band41-20MHz-16QAM-39750-100RB#0-PASS

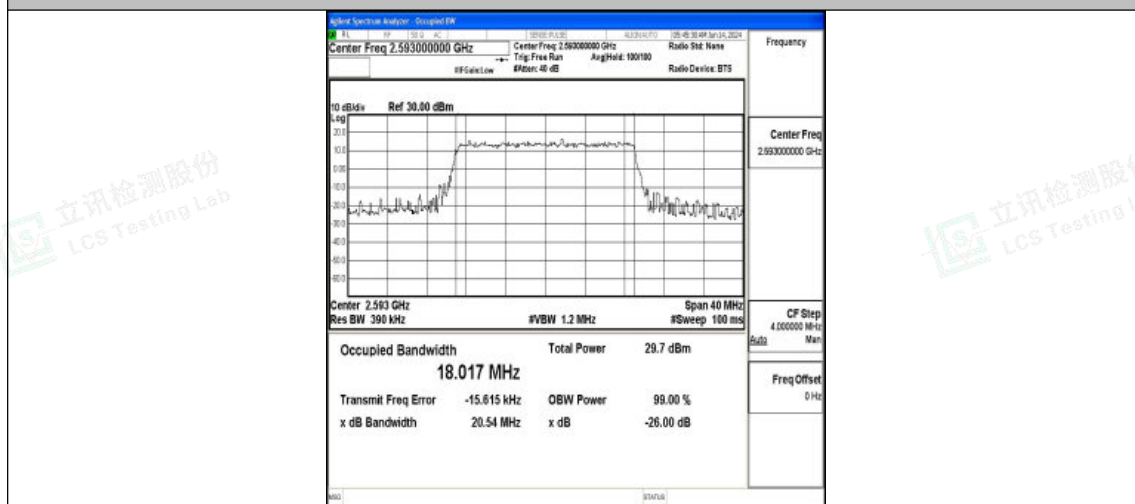

Band41-20MHz-QPSK-40620-100RB#0-PASS




Shenzhen LCS Compliance Testing Laboratory Ltd.


Shenzhen EEC Compliance Testing Laboratory Ltd.
Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen,
518000, China

Tel: + (86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity

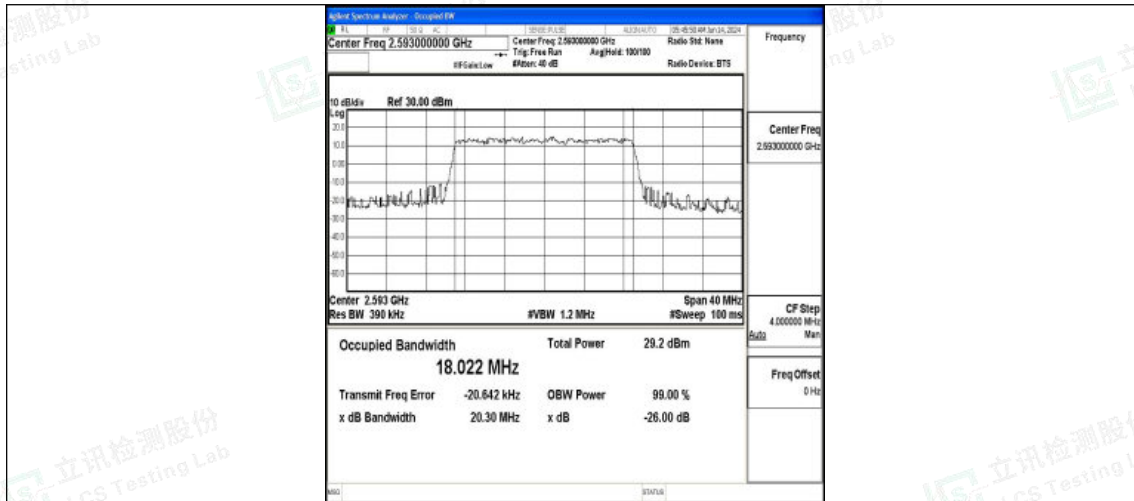

Band41-20MHz-16QAM-40620-100RB#0-PASS

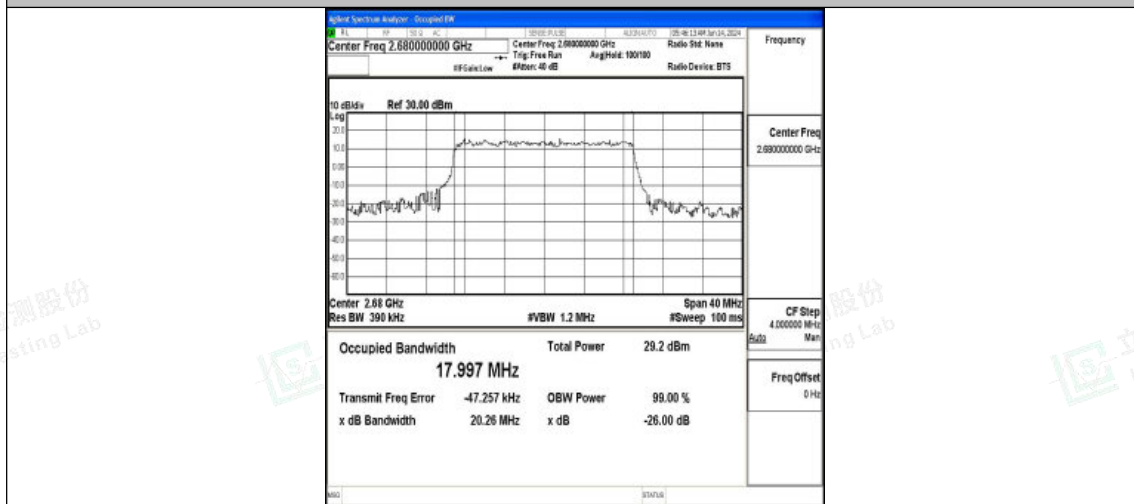

Band41-20MHz-QPSK-41490-100RB#0-PASS

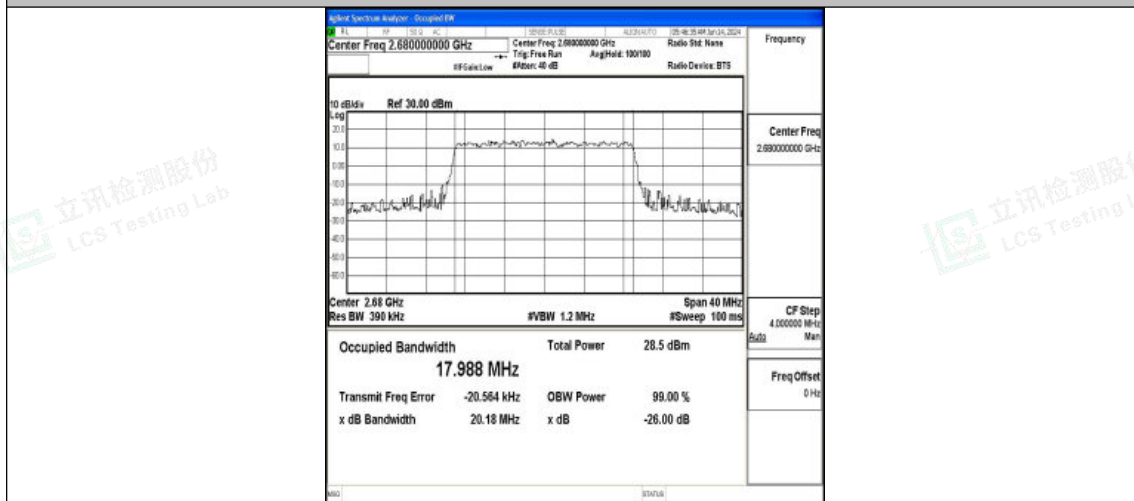

Band41-20MHz-16QAM-41490-100RB#0-PASS



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity





H.4 Band Edge

Test Result

Band	Bandwidth	Modulation	Channel	RB Configuration	Peak Frequency	Result(dBm)	Verdict
Band41	5MHz	QPSK	39675	25RB#0	2490.41	-43.61	PASS
Band41	5MHz	16QAM	39675	25RB#0	2490.43	-42.75	PASS
Band41	5MHz	QPSK	41565	25RB#0	2696.25	-44.52	PASS
Band41	5MHz	16QAM	41565	25RB#0	2696.15	-45.65	PASS
Band41	10MHz	QPSK	39700	50RB#0	2490.38	-36.32	PASS
Band41	10MHz	16QAM	39700	50RB#0	2490.39	-37.33	PASS
Band41	10MHz	QPSK	41540	50RB#0	2700.58	-41.19	PASS
Band41	10MHz	16QAM	41540	50RB#0	2700.13	-41.91	PASS
Band41	15MHz	QPSK	39725	75RB#0	2489.70	-33.64	PASS
Band41	15MHz	16QAM	39725	75RB#0	2489.43	-33.98	PASS
Band41	15MHz	QPSK	41515	75RB#0	2706.33	-39.79	PASS
Band41	15MHz	16QAM	41515	75RB#0	2706.22	-40.58	PASS
Band41	20MHz	QPSK	39750	100RB#0	2489.23	-32.42	PASS
Band41	20MHz	16QAM	39750	100RB#0	2489.37	-32.98	PASS
Band41	20MHz	QPSK	41490	100RB#0	2710.46	-39.94	PASS
Band41	20MHz	16QAM	41490	100RB#0	2710.59	-40.67	PASS

Test Graphs

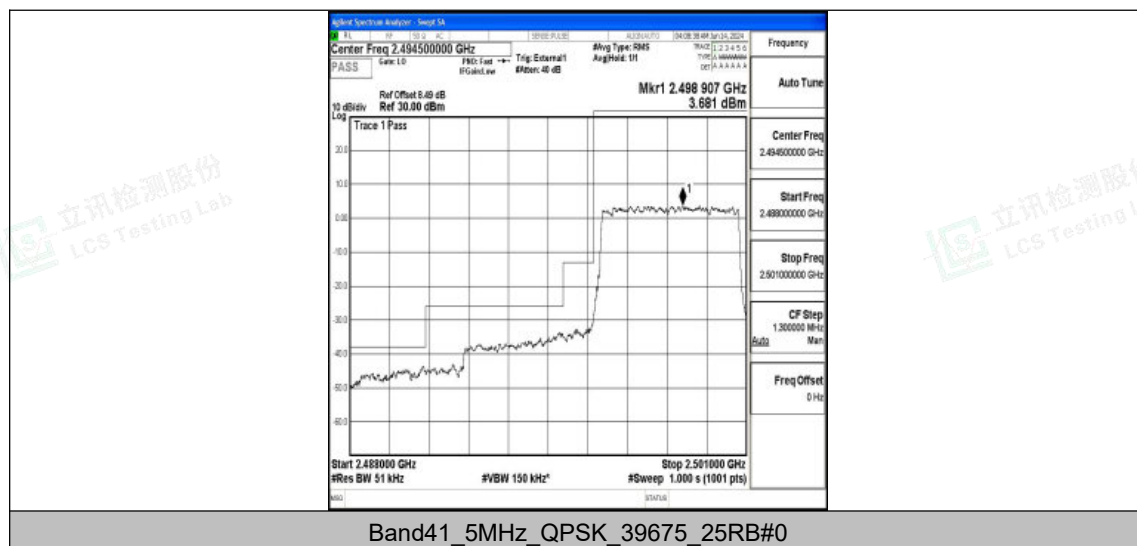

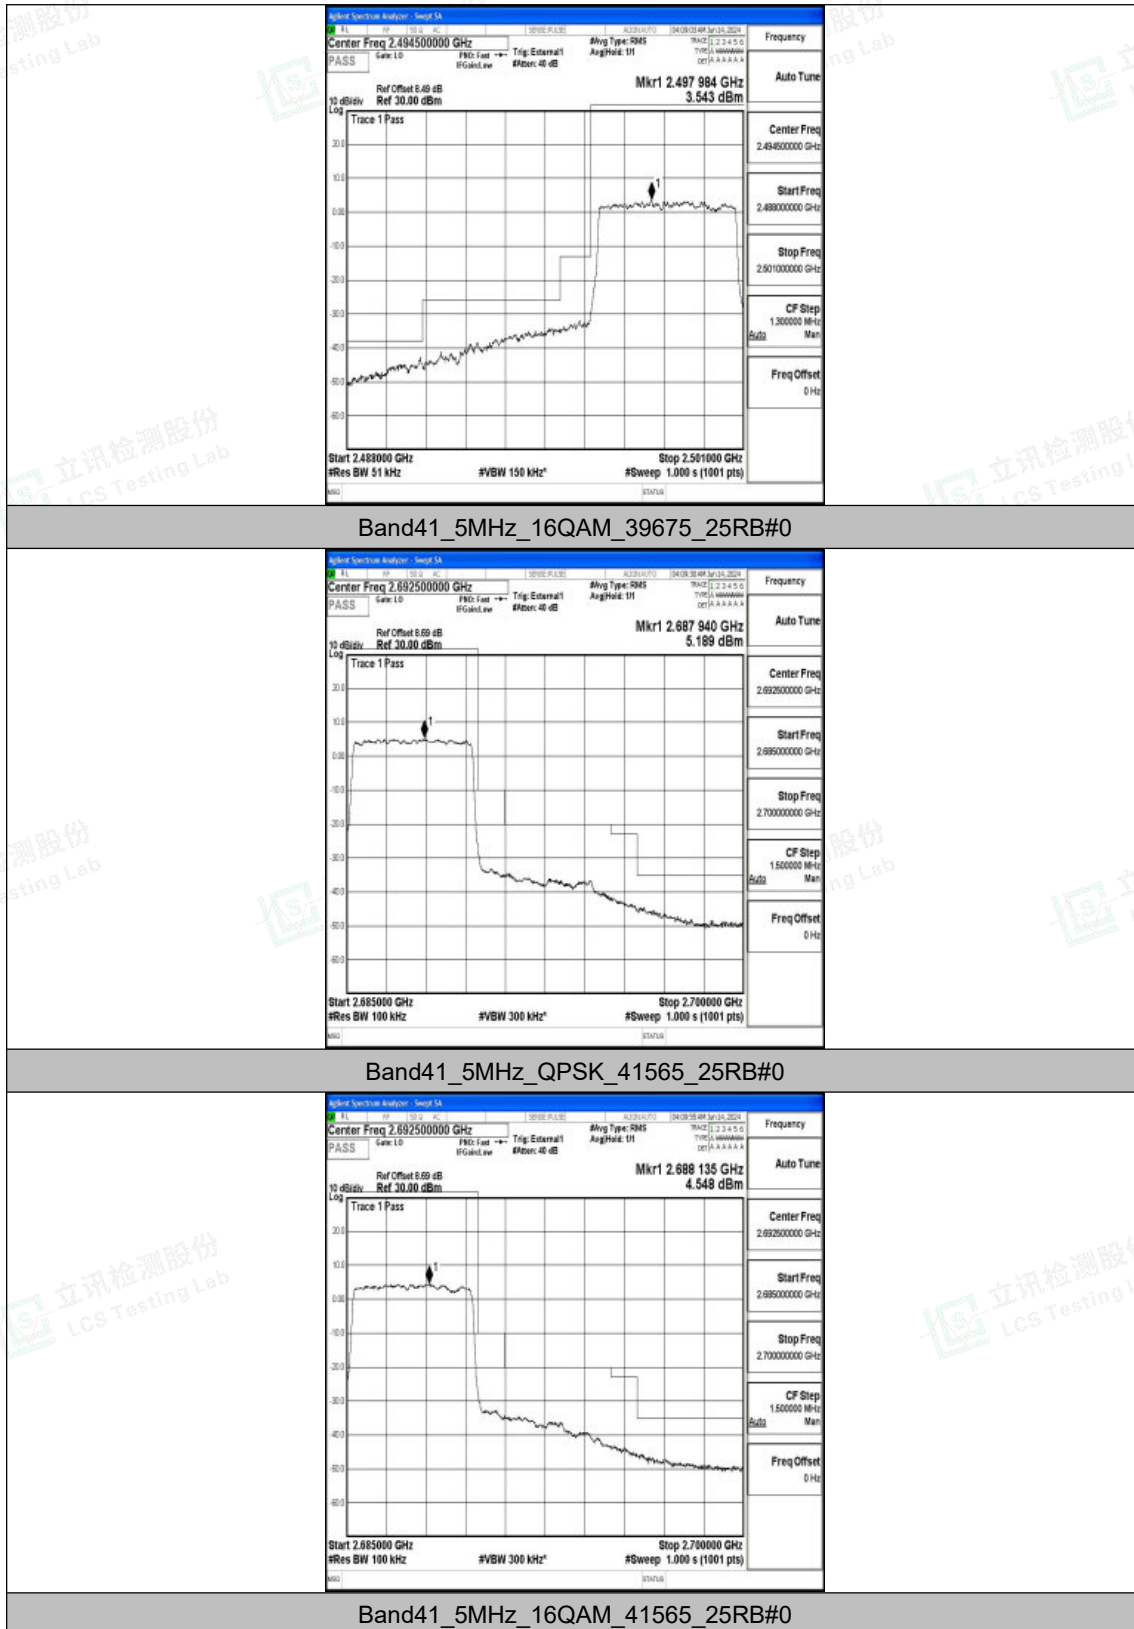


Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity

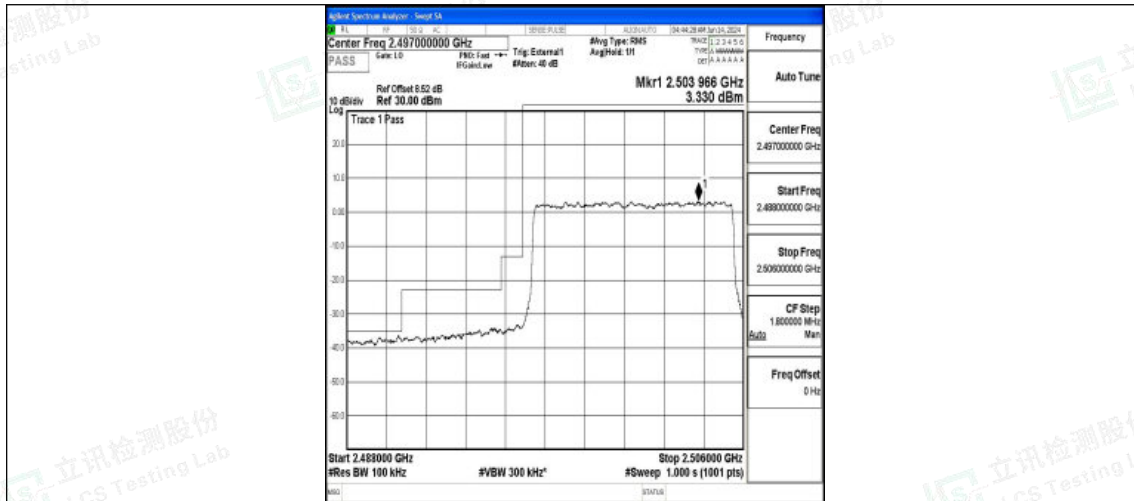

Band41_10MHz_QPSK_39700_50RB#0

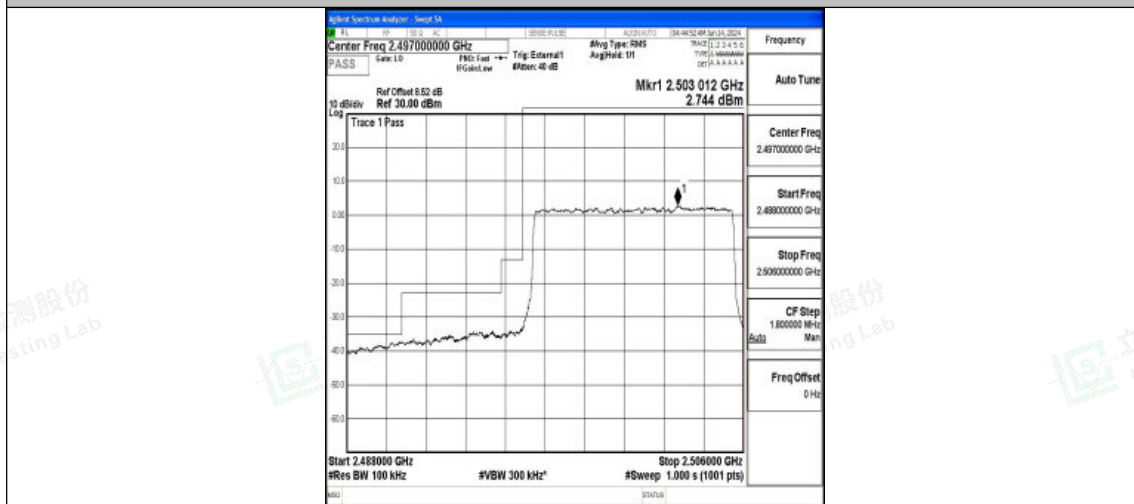


Band41_10MHz_16QAM_39700_50RB#0

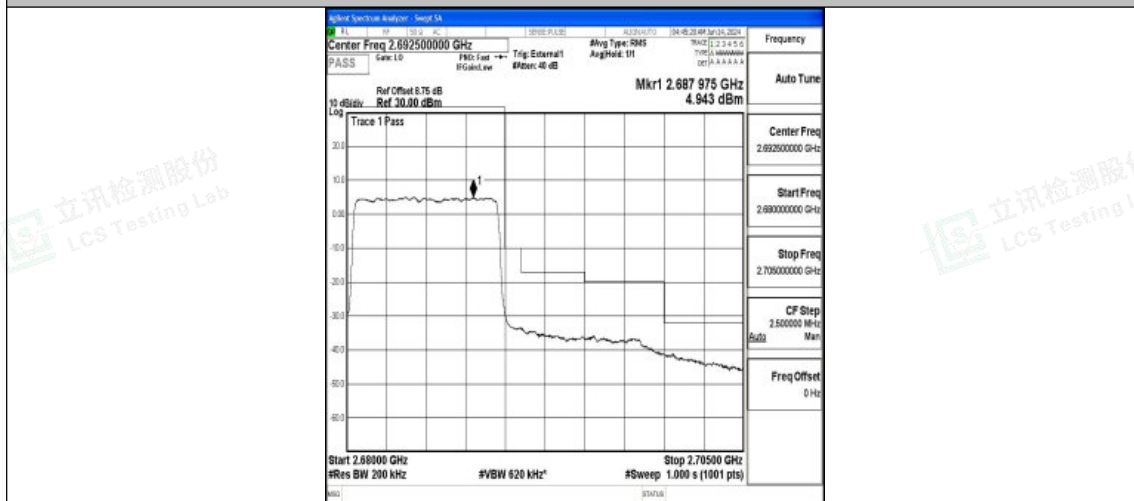


Band41_10MHz_QPSK_41540_50RB#0




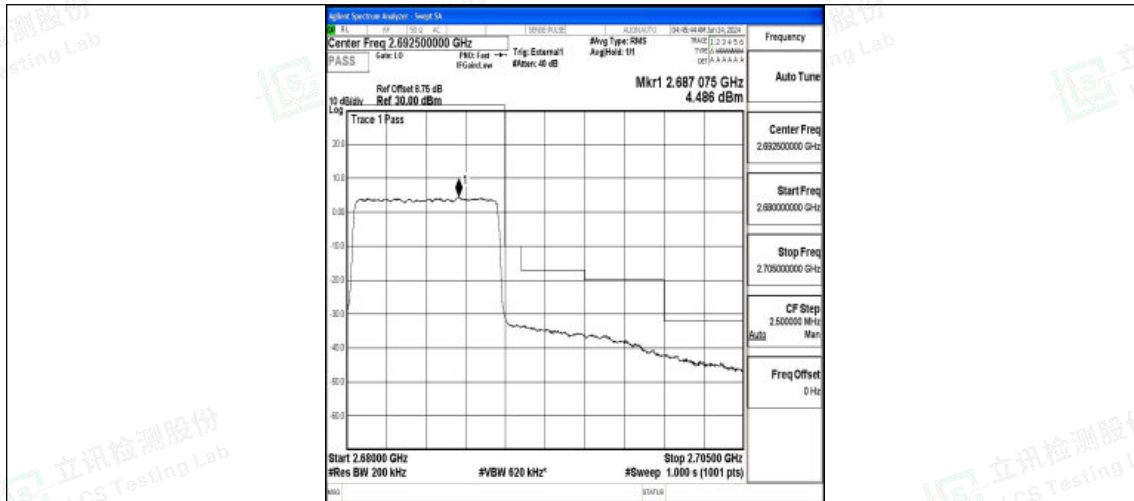

Band41_10MHz_16QAM_41540_50RB#0

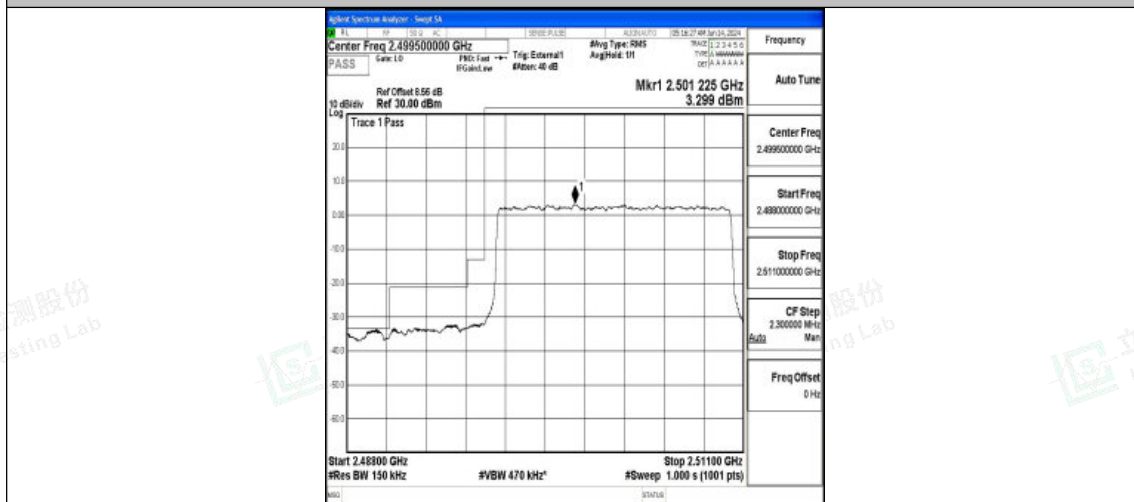

Band41_15MHz_QPSK_39725_75RB#0

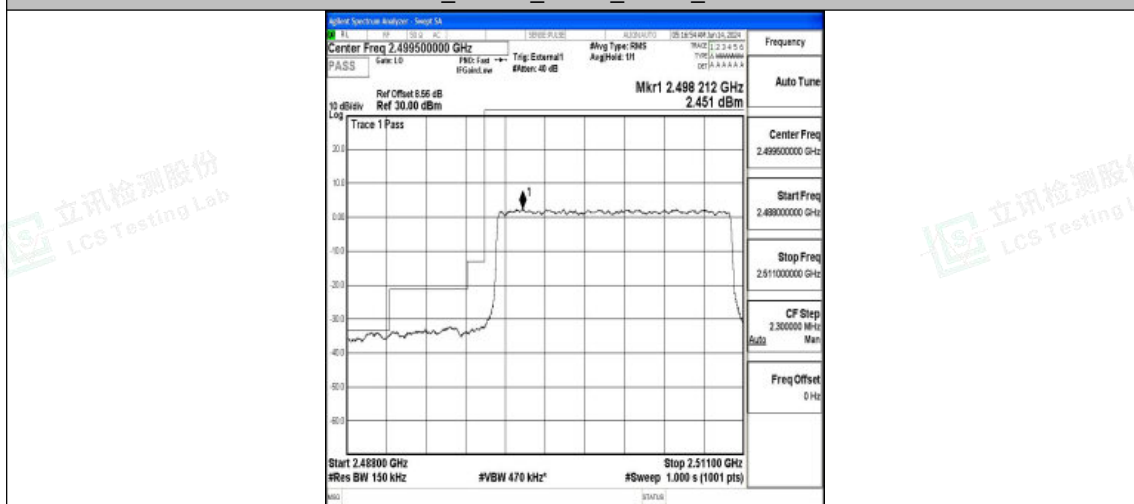

Band41_15MHz_16QAM_39725_75RB#0



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



H.5 Conducted Spurious Emission

Test Result

Band	Bandwidth	Modulation	Channel	RB Configuration	Frequency Range	Result (dBm)	Verdict
Band41	5MHz	QPSK	39675	1RB#0	0.009~0.15	-65.58	PASS
Band41	5MHz	QPSK	39675	1RB#0	0.15~30	-59.83	PASS
Band41	5MHz	QPSK	39675	1RB#0	30~1000	-61.99	PASS
Band41	5MHz	QPSK	39675	1RB#0	1000~20000	-33.34	PASS
Band41	5MHz	QPSK	39675	1RB#0	20000~27000	-35.37	PASS
Band41	5MHz	16QAM	39675	1RB#0	0.009~0.15	-66.00	PASS
Band41	5MHz	16QAM	39675	1RB#0	0.15~30	-63.16	PASS
Band41	5MHz	16QAM	39675	1RB#0	30~1000	-62.14	PASS
Band41	5MHz	16QAM	39675	1RB#0	1000~20000	-33.24	PASS
Band41	5MHz	16QAM	39675	1RB#0	20000~27000	-35.02	PASS
Band41	5MHz	QPSK	40620	1RB#0	0.009~0.15	-66.39	PASS
Band41	5MHz	QPSK	40620	1RB#0	0.15~30	-60.80	PASS
Band41	5MHz	QPSK	40620	1RB#0	30~1000	-62.31	PASS
Band41	5MHz	QPSK	40620	1RB#0	1000~20000	-33.03	PASS
Band41	5MHz	QPSK	40620	1RB#0	20000~27000	-35.36	PASS
Band41	5MHz	16QAM	40620	1RB#0	0.009~0.15	-68.72	PASS
Band41	5MHz	16QAM	40620	1RB#0	0.15~30	-61.86	PASS
Band41	5MHz	16QAM	40620	1RB#0	30~1000	-62.17	PASS
Band41	5MHz	16QAM	40620	1RB#0	1000~20000	-33.13	PASS
Band41	5MHz	16QAM	40620	1RB#0	20000~27000	-35.29	PASS
Band41	5MHz	QPSK	41565	1RB#0	0.009~0.15	-67.66	PASS
Band41	5MHz	QPSK	41565	1RB#0	0.15~30	-60.88	PASS
Band41	5MHz	QPSK	41565	1RB#0	30~1000	-62.24	PASS
Band41	5MHz	QPSK	41565	1RB#0	1000~20000	-32.61	PASS
Band41	5MHz	QPSK	41565	1RB#0	20000~27000	-35.21	PASS
Band41	5MHz	16QAM	41565	1RB#0	0.009~0.15	-66.45	PASS
Band41	5MHz	16QAM	41565	1RB#0	0.15~30	-59.22	PASS
Band41	5MHz	16QAM	41565	1RB#0	30~1000	-62.02	PASS
Band41	5MHz	16QAM	41565	1RB#0	1000~20000	-33.45	PASS
Band41	5MHz	16QAM	41565	1RB#0	20000~27000	-35.12	PASS
Band41	10MHz	QPSK	39700	1RB#0	0.009~0.15	-67.87	PASS
Band41	10MHz	QPSK	39700	1RB#0	0.15~30	-64.05	PASS
Band41	10MHz	QPSK	39700	1RB#0	30~1000	-62.18	PASS
Band41	10MHz	QPSK	39700	1RB#0	1000~20000	-33.11	PASS



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



Band41	10MHz	QPSK	39700	1RB#0	20000~27000	-35.17	PASS
Band41	10MHz	16QAM	39700	1RB#0	0.009~0.15	-66.00	PASS
Band41	10MHz	16QAM	39700	1RB#0	0.15~30	-63.54	PASS
Band41	10MHz	16QAM	39700	1RB#0	30~1000	-62.30	PASS
Band41	10MHz	16QAM	39700	1RB#0	1000~20000	-33.28	PASS
Band41	10MHz	16QAM	39700	1RB#0	20000~27000	-35.22	PASS
Band41	10MHz	QPSK	40620	1RB#0	0.009~0.15	-65.86	PASS
Band41	10MHz	QPSK	40620	1RB#0	0.15~30	-59.44	PASS
Band41	10MHz	QPSK	40620	1RB#0	30~1000	-62.13	PASS
Band41	10MHz	QPSK	40620	1RB#0	1000~20000	-32.48	PASS
Band41	10MHz	QPSK	40620	1RB#0	20000~27000	-34.88	PASS
Band41	10MHz	16QAM	40620	1RB#0	0.009~0.15	-67.63	PASS
Band41	10MHz	16QAM	40620	1RB#0	0.15~30	-60.21	PASS
Band41	10MHz	16QAM	40620	1RB#0	30~1000	-61.81	PASS
Band41	10MHz	16QAM	40620	1RB#0	1000~20000	-33.22	PASS
Band41	10MHz	16QAM	40620	1RB#0	20000~27000	-35.45	PASS
Band41	10MHz	QPSK	41540	1RB#0	0.009~0.15	-67.57	PASS
Band41	10MHz	QPSK	41540	1RB#0	0.15~30	-58.44	PASS
Band41	10MHz	QPSK	41540	1RB#0	30~1000	-62.35	PASS
Band41	10MHz	QPSK	41540	1RB#0	1000~20000	-33.18	PASS
Band41	10MHz	QPSK	41540	1RB#0	20000~27000	-35.24	PASS
Band41	10MHz	16QAM	41540	1RB#0	0.009~0.15	-68.46	PASS
Band41	10MHz	16QAM	41540	1RB#0	0.15~30	-59.38	PASS
Band41	10MHz	16QAM	41540	1RB#0	30~1000	-61.67	PASS
Band41	10MHz	16QAM	41540	1RB#0	1000~20000	-33.28	PASS
Band41	10MHz	16QAM	41540	1RB#0	20000~27000	-35.46	PASS
Band41	15MHz	QPSK	39725	1RB#0	0.009~0.15	-65.12	PASS
Band41	15MHz	QPSK	39725	1RB#0	0.15~30	-60.11	PASS
Band41	15MHz	QPSK	39725	1RB#0	30~1000	-61.93	PASS
Band41	15MHz	QPSK	39725	1RB#0	1000~20000	-32.72	PASS
Band41	15MHz	QPSK	39725	1RB#0	20000~27000	-35.12	PASS
Band41	15MHz	16QAM	39725	1RB#0	0.009~0.15	-67.32	PASS
Band41	15MHz	16QAM	39725	1RB#0	0.15~30	-61.36	PASS
Band41	15MHz	16QAM	39725	1RB#0	30~1000	-62.23	PASS
Band41	15MHz	16QAM	39725	1RB#0	1000~20000	-33.29	PASS
Band41	15MHz	16QAM	39725	1RB#0	20000~27000	-35.25	PASS
Band41	15MHz	QPSK	40620	1RB#0	0.009~0.15	-68.63	PASS
Band41	15MHz	QPSK	40620	1RB#0	0.15~30	-59.87	PASS
Band41	15MHz	QPSK	40620	1RB#0	30~1000	-62.14	PASS
Band41	15MHz	QPSK	40620	1RB#0	1000~20000	-33.20	PASS



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



Band41	15MHz	QPSK	40620	1RB#0	20000~27000	-35.42	PASS
Band41	15MHz	16QAM	40620	1RB#0	0.009~0.15	-67.73	PASS
Band41	15MHz	16QAM	40620	1RB#0	0.15~30	-62.14	PASS
Band41	15MHz	16QAM	40620	1RB#0	30~1000	-62.03	PASS
Band41	15MHz	16QAM	40620	1RB#0	1000~20000	-33.28	PASS
Band41	15MHz	16QAM	40620	1RB#0	20000~27000	-35.60	PASS
Band41	15MHz	QPSK	41515	1RB#0	0.009~0.15	-67.57	PASS
Band41	15MHz	QPSK	41515	1RB#0	0.15~30	-60.09	PASS
Band41	15MHz	QPSK	41515	1RB#0	30~1000	-62.30	PASS
Band41	15MHz	QPSK	41515	1RB#0	1000~20000	-33.23	PASS
Band41	15MHz	QPSK	41515	1RB#0	20000~27000	-35.16	PASS
Band41	15MHz	16QAM	41515	1RB#0	0.009~0.15	-68.64	PASS
Band41	15MHz	16QAM	41515	1RB#0	0.15~30	-62.37	PASS
Band41	15MHz	16QAM	41515	1RB#0	30~1000	-62.16	PASS
Band41	15MHz	16QAM	41515	1RB#0	1000~20000	-33.37	PASS
Band41	15MHz	16QAM	41515	1RB#0	20000~27000	-35.46	PASS
Band41	20MHz	QPSK	39750	1RB#0	0.009~0.15	-65.45	PASS
Band41	20MHz	QPSK	39750	1RB#0	0.15~30	-59.77	PASS
Band41	20MHz	QPSK	39750	1RB#0	30~1000	-62.38	PASS
Band41	20MHz	QPSK	39750	1RB#0	1000~20000	-33.23	PASS
Band41	20MHz	QPSK	39750	1RB#0	20000~27000	-35.20	PASS
Band41	20MHz	16QAM	39750	1RB#0	0.009~0.15	-67.38	PASS
Band41	20MHz	16QAM	39750	1RB#0	0.15~30	-62.26	PASS
Band41	20MHz	16QAM	39750	1RB#0	30~1000	-62.23	PASS
Band41	20MHz	16QAM	39750	1RB#0	1000~20000	-33.45	PASS
Band41	20MHz	16QAM	39750	1RB#0	20000~27000	-35.05	PASS
Band41	20MHz	QPSK	40620	1RB#0	0.009~0.15	-66.49	PASS
Band41	20MHz	QPSK	40620	1RB#0	0.15~30	-60.90	PASS
Band41	20MHz	QPSK	40620	1RB#0	30~1000	-62.12	PASS
Band41	20MHz	QPSK	40620	1RB#0	1000~20000	-33.31	PASS
Band41	20MHz	QPSK	40620	1RB#0	20000~27000	-35.36	PASS
Band41	20MHz	16QAM	40620	1RB#0	0.009~0.15	-67.76	PASS
Band41	20MHz	16QAM	40620	1RB#0	0.15~30	-61.65	PASS
Band41	20MHz	16QAM	40620	1RB#0	30~1000	-61.96	PASS
Band41	20MHz	16QAM	40620	1RB#0	1000~20000	-33.07	PASS
Band41	20MHz	16QAM	40620	1RB#0	20000~27000	-35.14	PASS
Band41	20MHz	QPSK	41490	1RB#0	0.009~0.15	-66.47	PASS
Band41	20MHz	QPSK	41490	1RB#0	0.15~30	-62.17	PASS
Band41	20MHz	QPSK	41490	1RB#0	30~1000	-62.01	PASS
Band41	20MHz	QPSK	41490	1RB#0	1000~20000	-32.99	PASS



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China


Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity




Band41	20MHz	QPSK	41490	1RB#0	20000~27000	-35.33	PASS
Band41	20MHz	16QAM	41490	1RB#0	0.009~0.15	-67.95	PASS
Band41	20MHz	16QAM	41490	1RB#0	0.15~30	-62.67	PASS
Band41	20MHz	16QAM	41490	1RB#0	30~1000	-61.81	PASS
Band41	20MHz	16QAM	41490	1RB#0	1000~20000	-33.52	PASS
Band41	20MHz	16QAM	41490	1RB#0	20000~27000	-34.71	PASS


Test Graphs

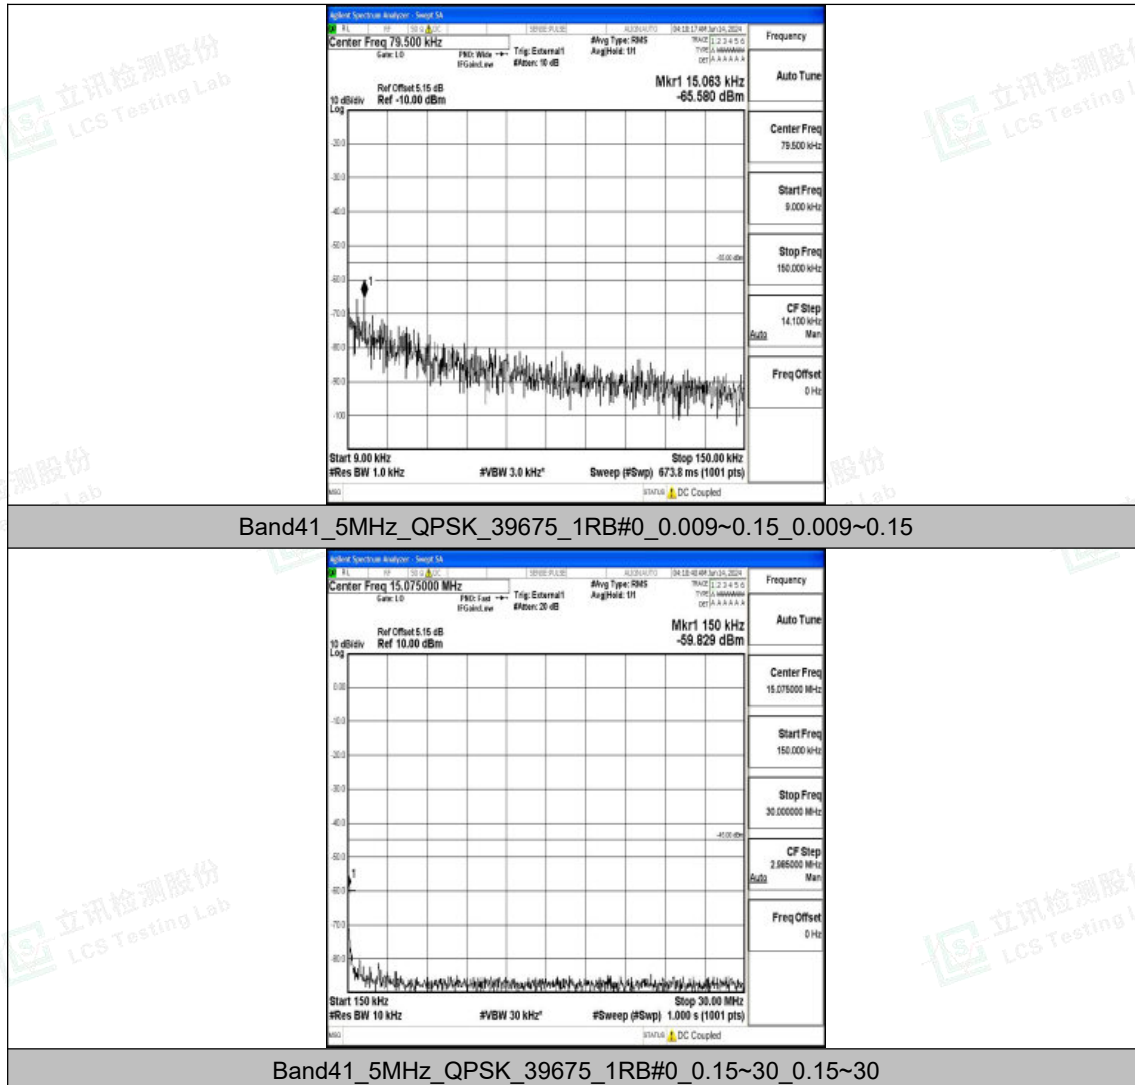

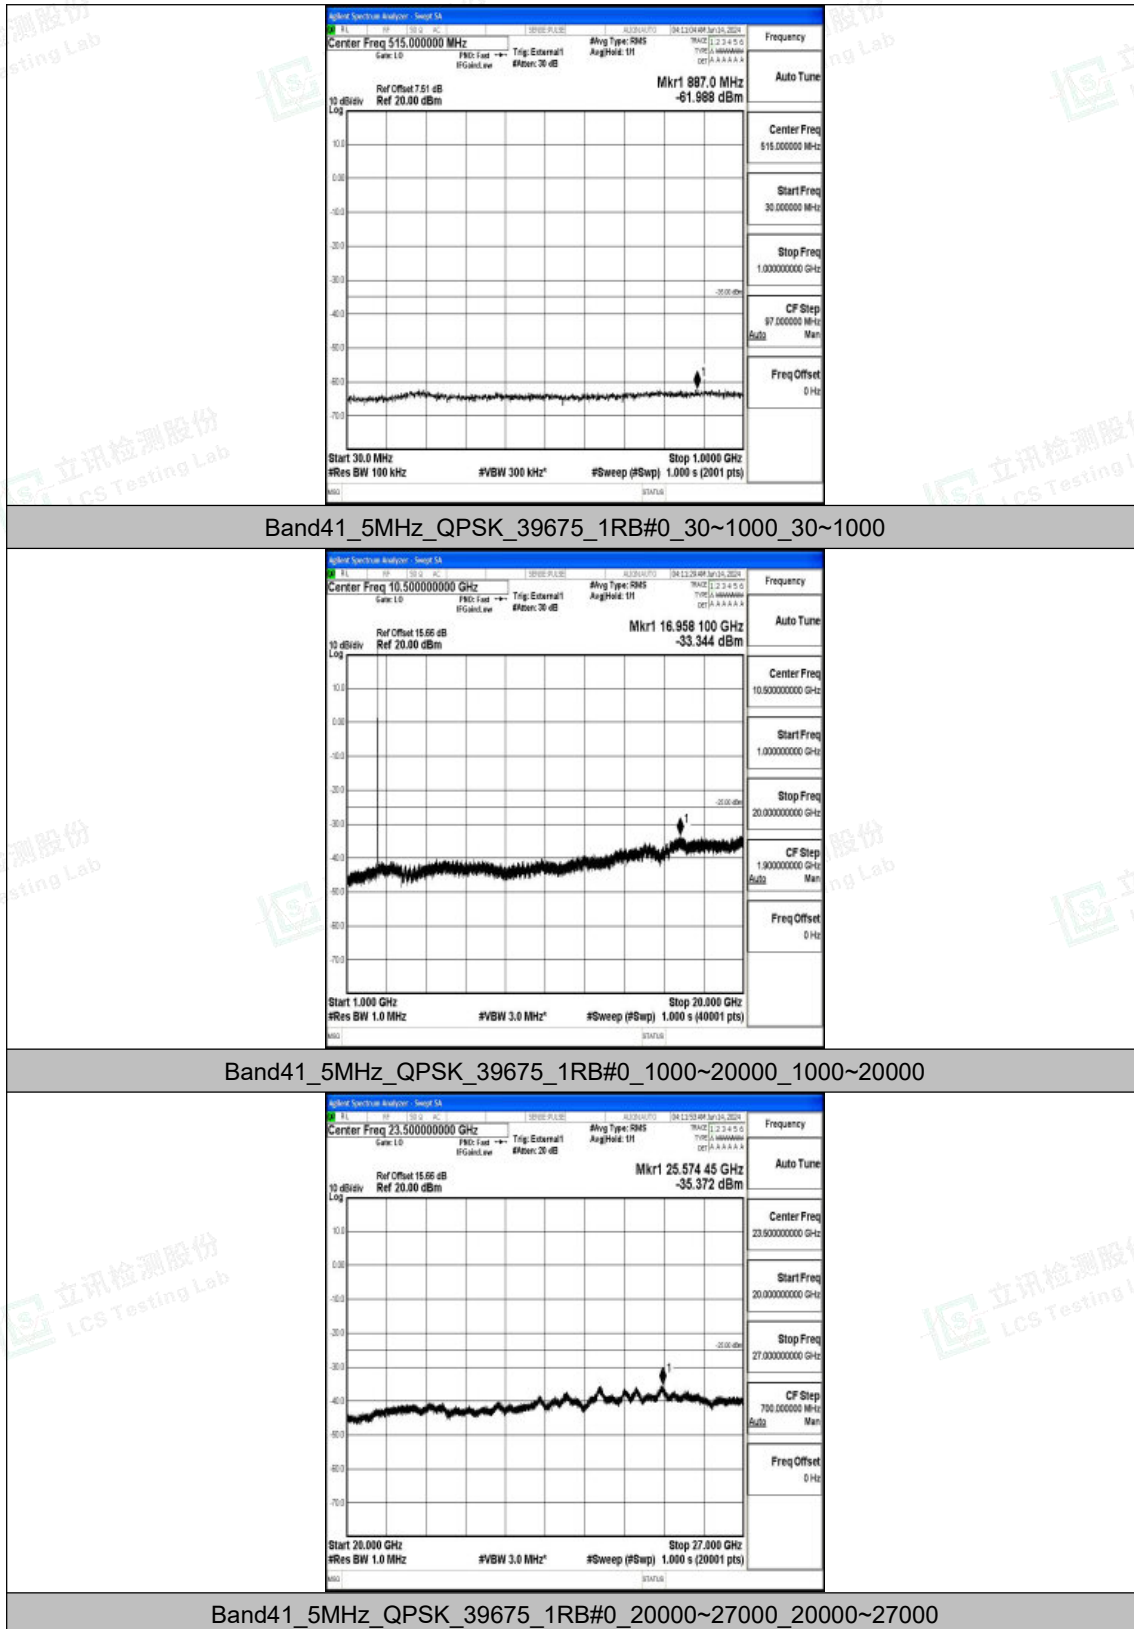


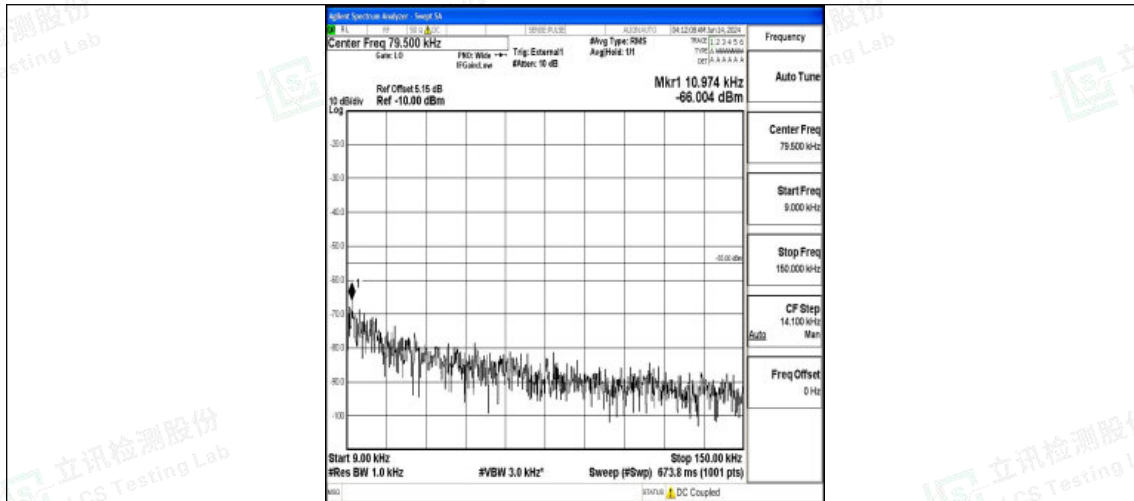

Band41_5MHz_16QAM_39675_1RB#0_0.009~0.15_0.009~0.15

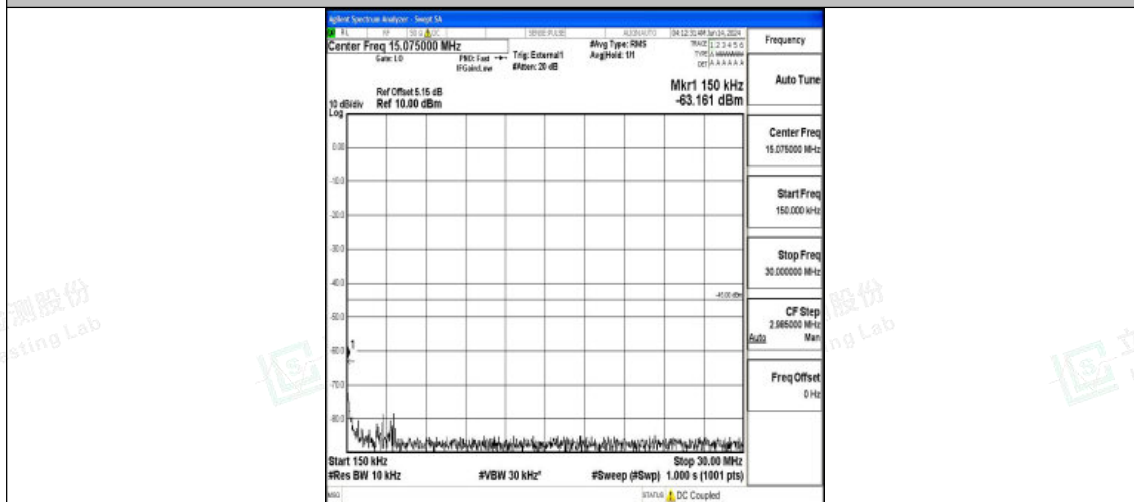

Band41_5MHz_16QAM_39675_1RB#0_0.15~30_0.15~30

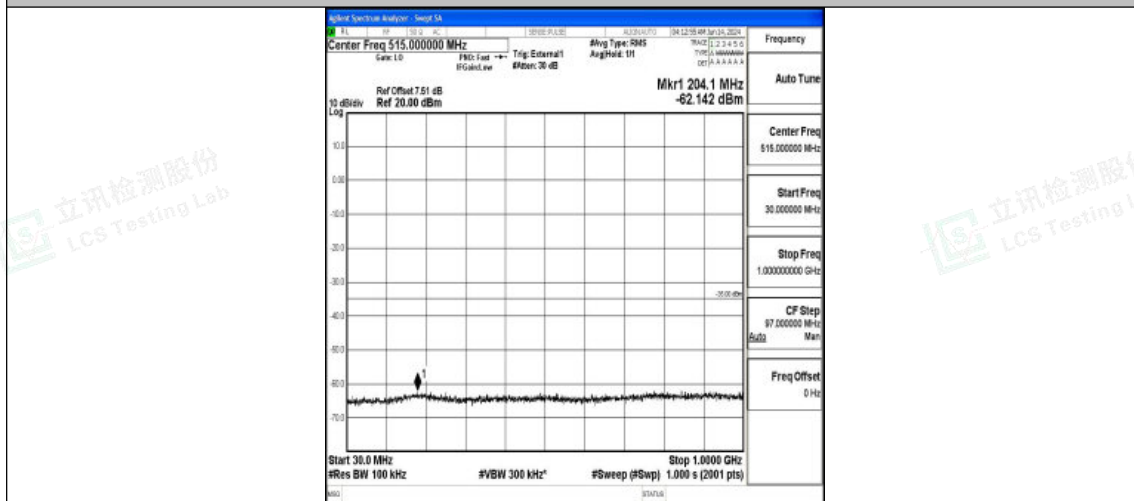

Band41_5MHz_16QAM_39675_1RB#0_30~1000_30~1000





Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China


Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

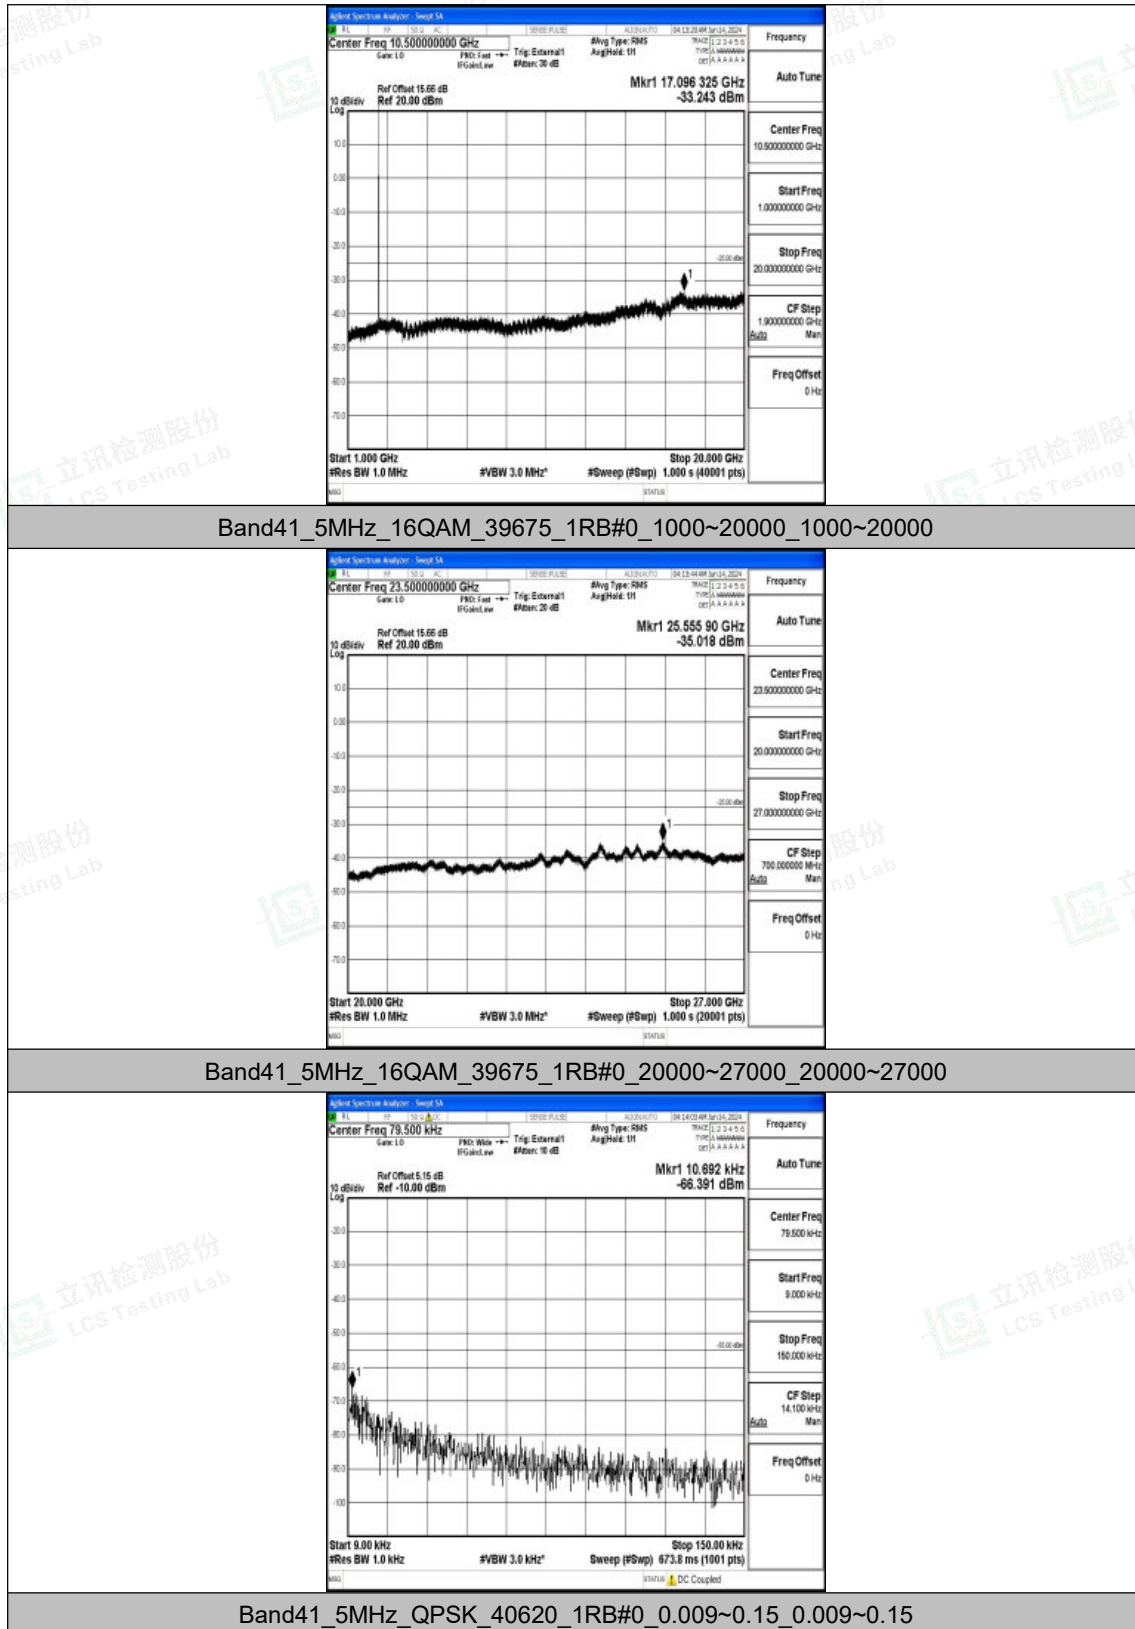


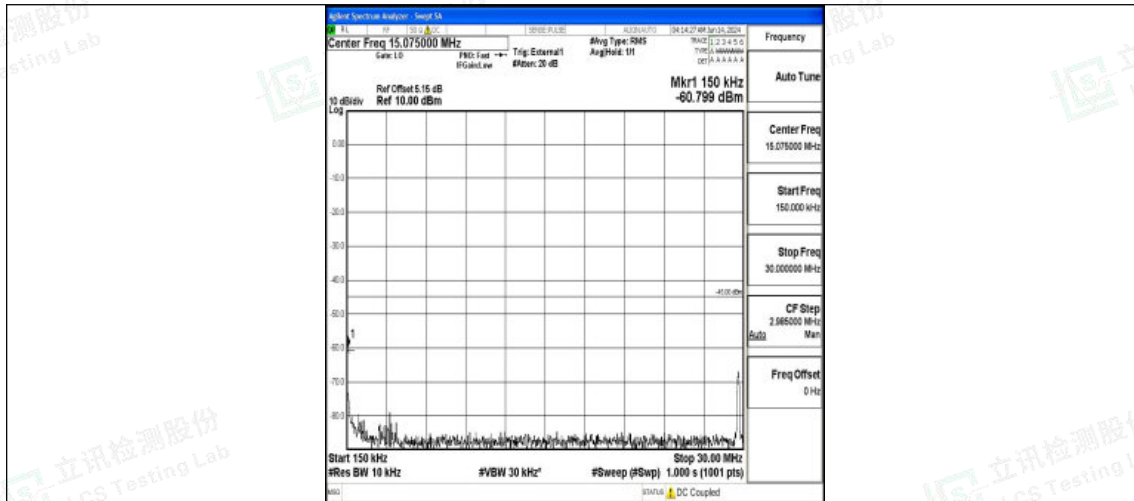

Band41_5MHz_QPSK_40620_1RB#0_0.15~30_0.15~30

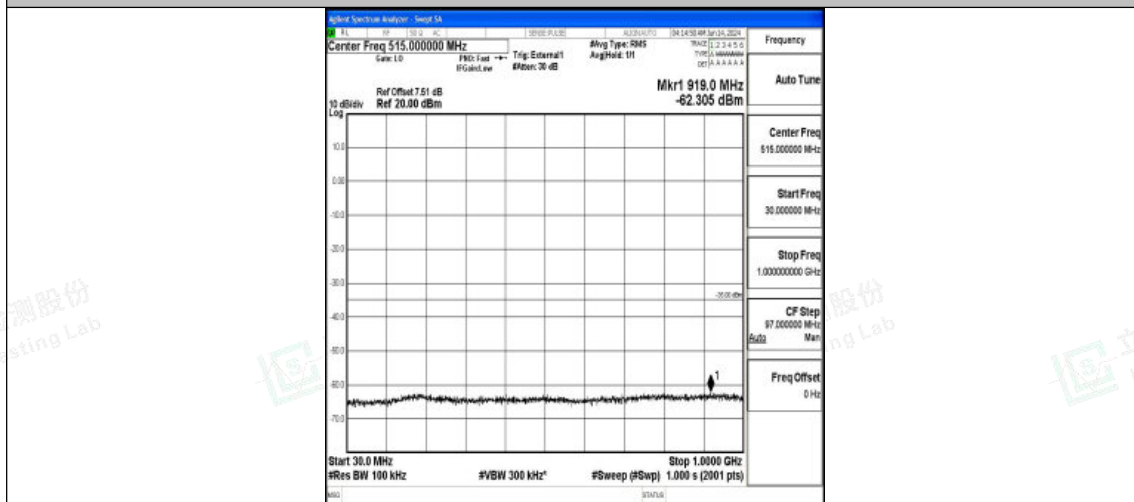

Band41_5MHz_QPSK_40620_1RB#0_30~1000_30~1000

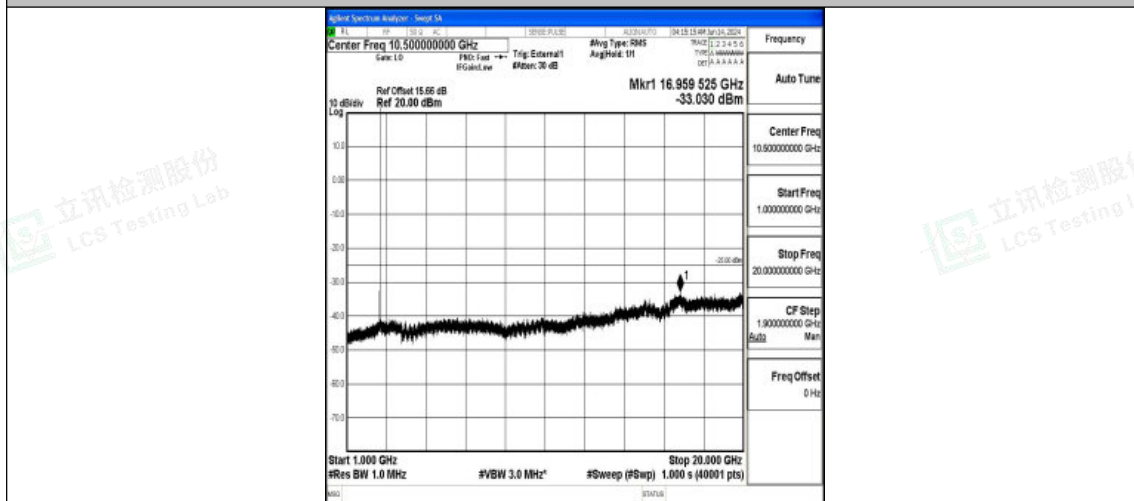

Band41_5MHz_QPSK_40620_1RB#0_1000~20000_1000~20000




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity

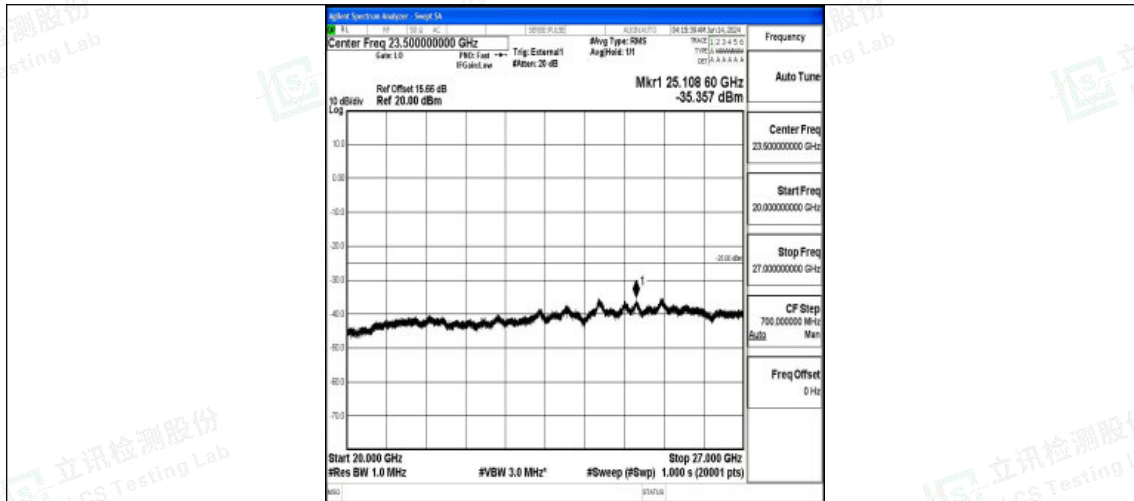

Band41_5MHz_QPSK_40620_1RB#0_20000~27000_20000~27000

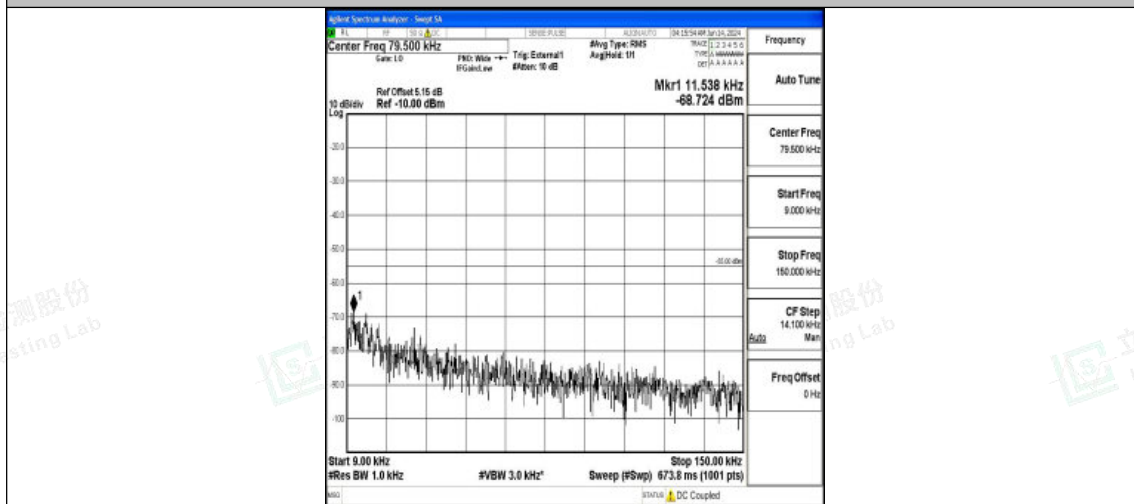

Band41_5MHz_16QAM_40620_1RB#0_0.009~0.15_0.009~0.15

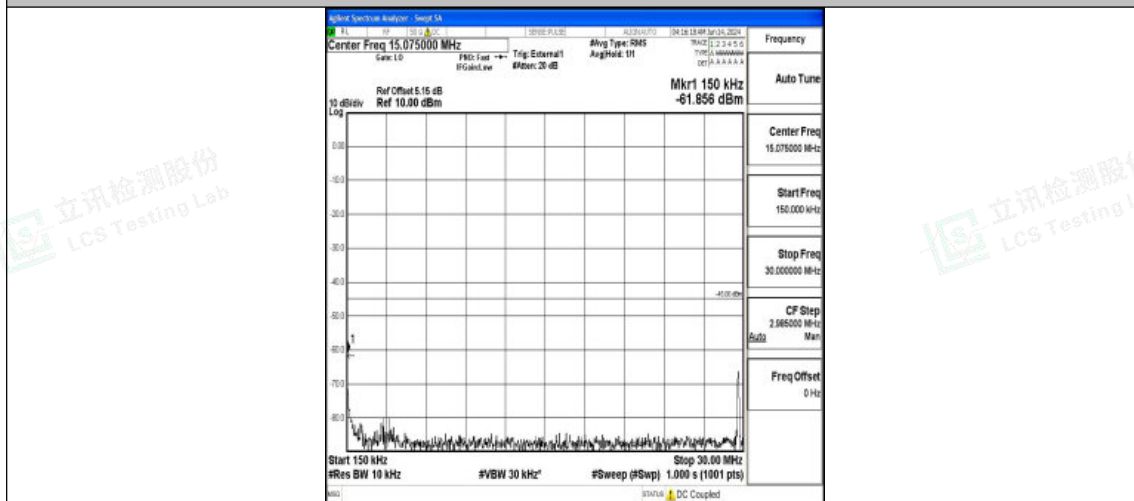

Band41_5MHz_16QAM_40620_1RB#0_0.15~30_0.15~30




Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

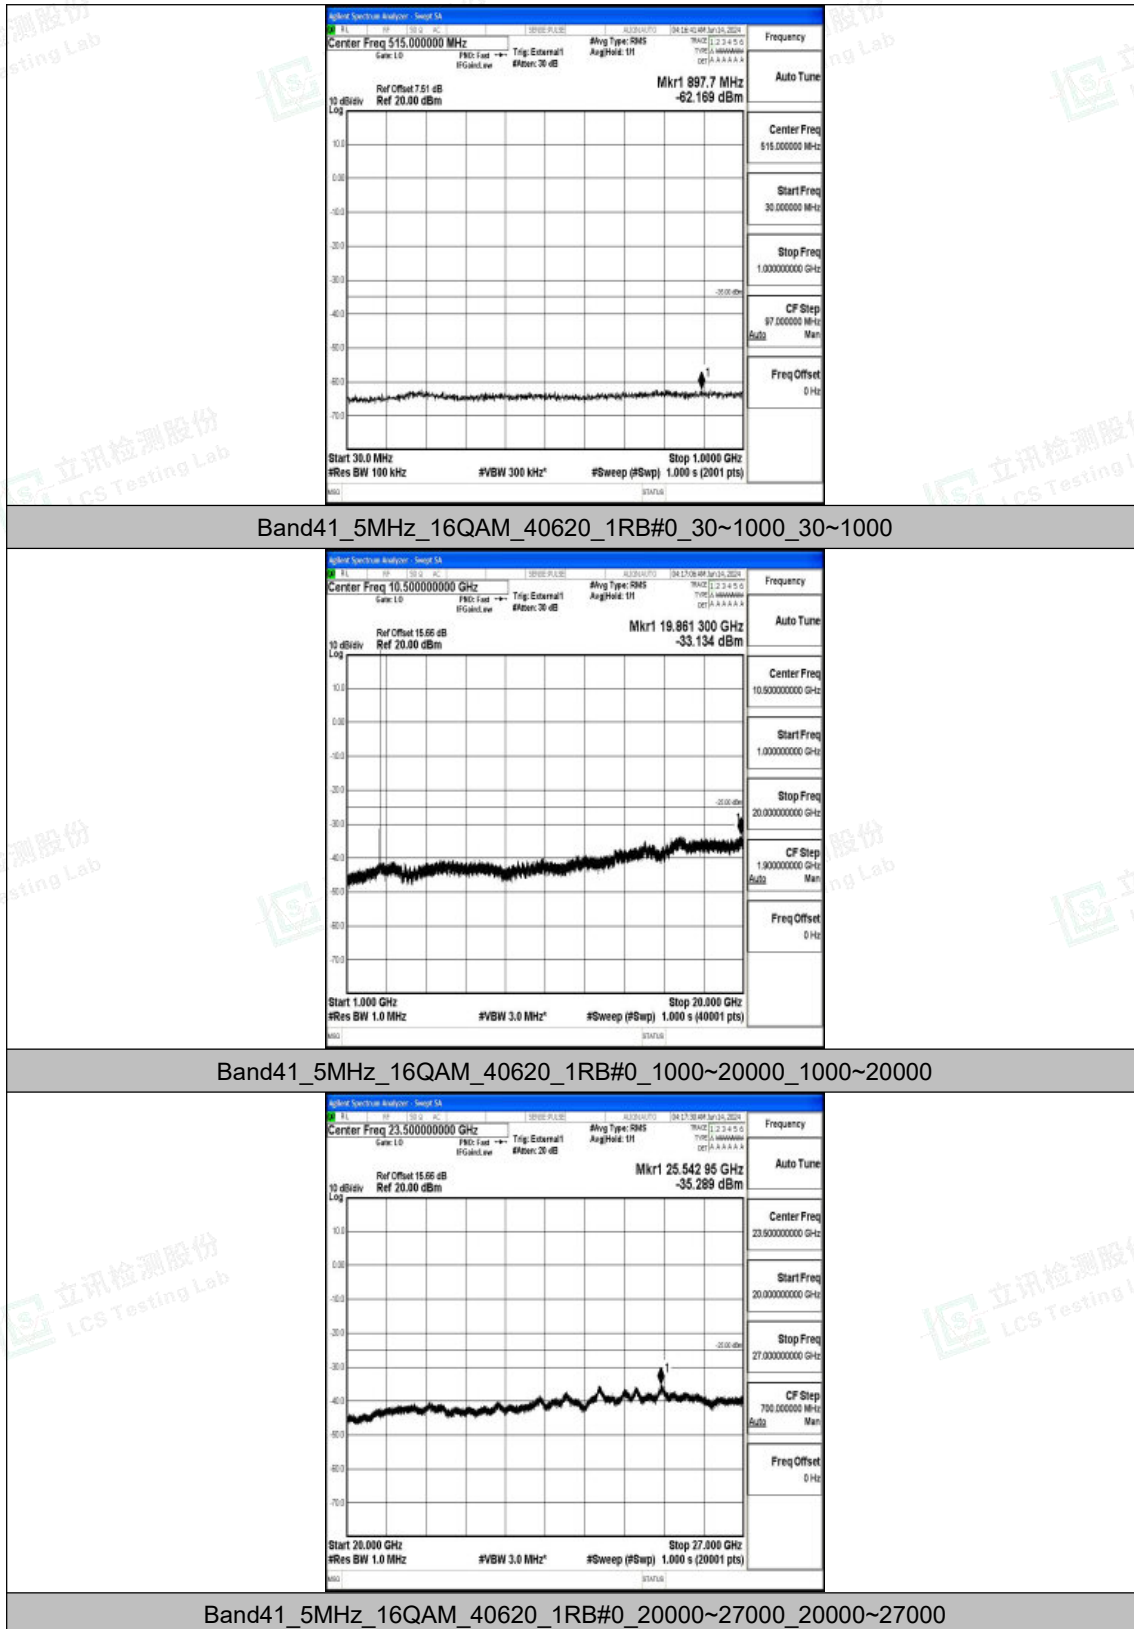


Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity

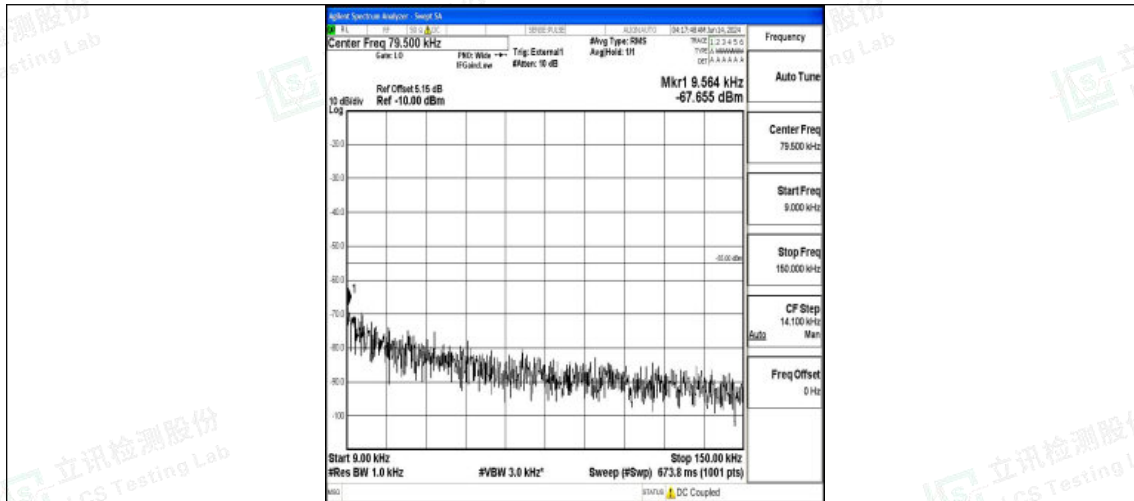

Band41_5MHz_QPSK_41565_1RB#0_0.009~0.15_0.009~0.15

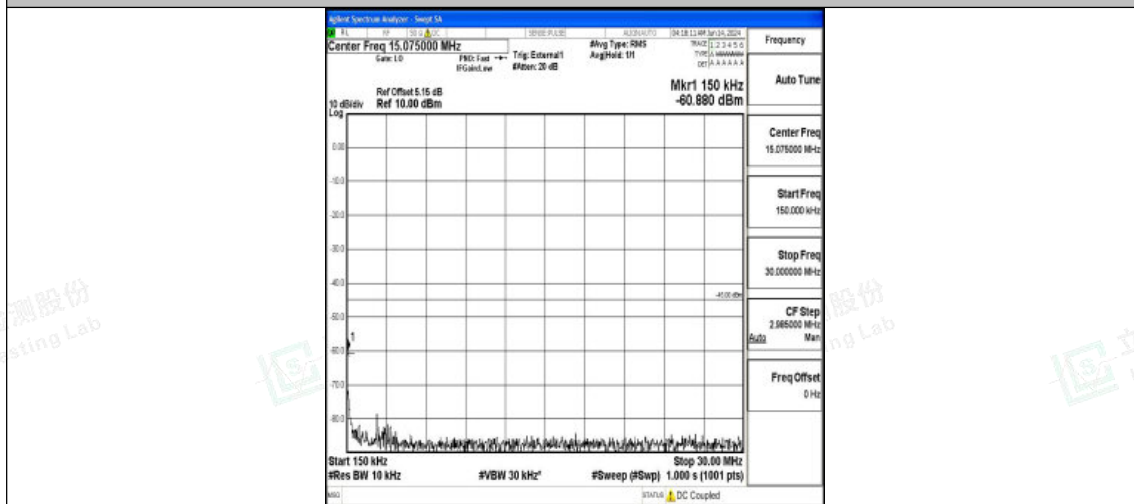

Band41_5MHz_QPSK_41565_1RB#0_0.15~30_0.15~30

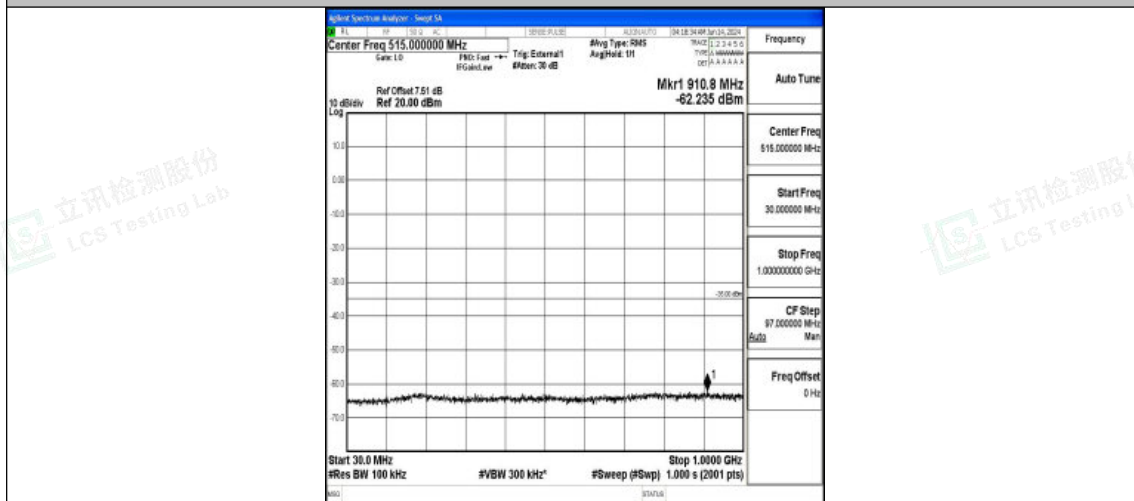

Band41_5MHz_QPSK_41565_1RB#0_30~1000_30~1000



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity