



Appendix N: Test Data for E-UTRA Band 41

Product Name: Data Collector
Test Model: R50

Environmental Conditions

Temperature:	23.6°C
Relative Humidity:	52.5%
ATM Pressure:	100.0 kPa
Test Engineer:	Jay Luo
Supervised by:	Nick Peng



Shenzhen LCS Compliance Testing Laboratory Ltd.
Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street,
Baoan District, Shenzhen, 518000, China
Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com
Scan code to check authenticity



N.1 Conducted Output Power Data

Test Result

Band	Bandwidth	Modulation	Channel	RB Configuration	Result(dBm)	Verdict
Band41	5MHz	QPSK	39675	1RB#0	21.43	PASS
Band41	5MHz	16QAM	39675	1RB#0	21.37	PASS
Band41	5MHz	QPSK	39675	1RB#12	21.42	PASS
Band41	5MHz	16QAM	39675	1RB#12	22.62	PASS
Band41	5MHz	QPSK	39675	1RB#24	21.47	PASS
Band41	5MHz	16QAM	39675	1RB#24	21.26	PASS
Band41	5MHz	QPSK	39675	12RB#0	20.49	PASS
Band41	5MHz	16QAM	39675	12RB#0	19.71	PASS
Band41	5MHz	QPSK	39675	12RB#6	20.35	PASS
Band41	5MHz	16QAM	39675	12RB#6	19.76	PASS
Band41	5MHz	QPSK	39675	12RB#13	20.39	PASS
Band41	5MHz	16QAM	39675	12RB#13	19.75	PASS
Band41	5MHz	QPSK	39675	25RB#0	20.39	PASS
Band41	5MHz	16QAM	39675	25RB#0	19.81	PASS
Band41	5MHz	QPSK	40620	1RB#0	22.22	PASS
Band41	5MHz	16QAM	40620	1RB#0	21.62	PASS
Band41	5MHz	QPSK	40620	1RB#12	22.15	PASS
Band41	5MHz	16QAM	40620	1RB#12	21.85	PASS
Band41	5MHz	QPSK	40620	1RB#24	22.11	PASS
Band41	5MHz	16QAM	40620	1RB#24	22.13	PASS
Band41	5MHz	QPSK	40620	12RB#0	21.13	PASS
Band41	5MHz	16QAM	40620	12RB#0	20.47	PASS
Band41	5MHz	QPSK	40620	12RB#6	21.09	PASS
Band41	5MHz	16QAM	40620	12RB#6	20.47	PASS
Band41	5MHz	QPSK	40620	12RB#13	21.11	PASS
Band41	5MHz	16QAM	40620	12RB#13	20.43	PASS
Band41	5MHz	QPSK	40620	25RB#0	21.11	PASS
Band41	5MHz	16QAM	40620	25RB#0	20.51	PASS
Band41	5MHz	QPSK	41565	1RB#0	21.55	PASS
Band41	5MHz	16QAM	41565	1RB#0	21.15	PASS
Band41	5MHz	QPSK	41565	1RB#12	21.59	PASS
Band41	5MHz	16QAM	41565	1RB#12	21.36	PASS
Band41	5MHz	QPSK	41565	1RB#24	21.60	PASS
Band41	5MHz	16QAM	41565	1RB#24	21.32	PASS
Band41	5MHz	QPSK	41565	12RB#0	20.45	PASS



Shenzhen LCS Compliance Testing Laboratory Ltd.
Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street,
Baoan District, Shenzhen, 518000, China
Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com
Scan code to check authenticity



Band41	5MHz	16QAM	41565	12RB#0	19.80	PASS
Band41	5MHz	QPSK	41565	12RB#6	20.46	PASS
Band41	5MHz	16QAM	41565	12RB#6	19.82	PASS
Band41	5MHz	QPSK	41565	12RB#13	20.51	PASS
Band41	5MHz	16QAM	41565	12RB#13	19.80	PASS
Band41	5MHz	QPSK	41565	25RB#0	20.45	PASS
Band41	5MHz	16QAM	41565	25RB#0	19.90	PASS
Band41	10MHz	QPSK	39700	1RB#0	22.28	PASS
Band41	10MHz	16QAM	39700	1RB#0	22.16	PASS
Band41	10MHz	QPSK	39700	1RB#24	22.23	PASS
Band41	10MHz	16QAM	39700	1RB#24	22.23	PASS
Band41	10MHz	QPSK	39700	1RB#49	22.37	PASS
Band41	10MHz	16QAM	39700	1RB#49	22.20	PASS
Band41	10MHz	QPSK	39700	25RB#0	21.14	PASS
Band41	10MHz	16QAM	39700	25RB#0	20.49	PASS
Band41	10MHz	QPSK	39700	25RB#12	21.14	PASS
Band41	10MHz	16QAM	39700	25RB#12	20.52	PASS
Band41	10MHz	QPSK	39700	25RB#25	21.21	PASS
Band41	10MHz	16QAM	39700	25RB#25	20.51	PASS
Band41	10MHz	QPSK	39700	50RB#0	21.11	PASS
Band41	10MHz	16QAM	39700	50RB#0	20.58	PASS
Band41	10MHz	QPSK	40620	1RB#0	22.36	PASS
Band41	10MHz	16QAM	40620	1RB#0	22.33	PASS
Band41	10MHz	QPSK	40620	1RB#24	22.13	PASS
Band41	10MHz	16QAM	40620	1RB#24	22.25	PASS
Band41	10MHz	QPSK	40620	1RB#49	22.37	PASS
Band41	10MHz	16QAM	40620	1RB#49	22.30	PASS
Band41	10MHz	QPSK	40620	25RB#0	21.10	PASS
Band41	10MHz	16QAM	40620	25RB#0	20.40	PASS
Band41	10MHz	QPSK	40620	25RB#12	21.09	PASS
Band41	10MHz	16QAM	40620	25RB#12	20.41	PASS
Band41	10MHz	QPSK	40620	25RB#25	21.03	PASS
Band41	10MHz	16QAM	40620	25RB#25	20.44	PASS
Band41	10MHz	QPSK	40620	50RB#0	20.95	PASS
Band41	10MHz	16QAM	40620	50RB#0	20.45	PASS
Band41	10MHz	QPSK	41540	1RB#0	21.76	PASS
Band41	10MHz	16QAM	41540	1RB#0	21.59	PASS
Band41	10MHz	QPSK	41540	1RB#24	21.78	PASS
Band41	10MHz	16QAM	41540	1RB#24	21.61	PASS
Band41	10MHz	QPSK	41540	1RB#49	21.77	PASS



Shenzhen LCS Compliance Testing Laboratory Ltd.
Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street,
Baoan District, Shenzhen, 518000, China
Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com
Scan code to check authenticity



Band41	10MHz	16QAM	41540	1RB#49	21.57	PASS
Band41	10MHz	QPSK	41540	25RB#0	20.60	PASS
Band41	10MHz	16QAM	41540	25RB#0	19.80	PASS
Band41	10MHz	QPSK	41540	25RB#12	20.60	PASS
Band41	10MHz	16QAM	41540	25RB#12	19.81	PASS
Band41	10MHz	QPSK	41540	25RB#25	20.46	PASS
Band41	10MHz	16QAM	41540	25RB#25	19.78	PASS
Band41	10MHz	QPSK	41540	50RB#0	20.45	PASS
Band41	10MHz	16QAM	41540	50RB#0	19.81	PASS
Band41	15MHz	QPSK	39725	1RB#0	22.24	PASS
Band41	15MHz	16QAM	39725	1RB#0	22.23	PASS
Band41	15MHz	QPSK	39725	1RB#38	22.30	PASS
Band41	15MHz	16QAM	39725	1RB#38	22.19	PASS
Band41	15MHz	QPSK	39725	1RB#74	22.29	PASS
Band41	15MHz	16QAM	39725	1RB#74	22.22	PASS
Band41	15MHz	QPSK	39725	38RB#0	21.15	PASS
Band41	15MHz	16QAM	39725	38RB#0	21.15	PASS
Band41	15MHz	QPSK	39725	38RB#18	21.15	PASS
Band41	15MHz	16QAM	39725	38RB#18	20.92	PASS
Band41	15MHz	QPSK	39725	38RB#37	20.92	PASS
Band41	15MHz	16QAM	39725	38RB#37	20.92	PASS
Band41	15MHz	QPSK	39725	75RB#0	20.92	PASS
Band41	15MHz	16QAM	39725	75RB#0	20.30	PASS
Band41	15MHz	QPSK	40620	1RB#0	22.42	PASS
Band41	15MHz	16QAM	40620	1RB#0	22.34	PASS
Band41	15MHz	QPSK	40620	1RB#38	22.32	PASS
Band41	15MHz	16QAM	40620	1RB#38	22.29	PASS
Band41	15MHz	QPSK	40620	1RB#74	22.32	PASS
Band41	15MHz	16QAM	40620	1RB#74	22.28	PASS
Band41	15MHz	QPSK	40620	38RB#0	21.24	PASS
Band41	15MHz	16QAM	40620	38RB#0	21.29	PASS
Band41	15MHz	QPSK	40620	38RB#18	21.25	PASS
Band41	15MHz	16QAM	40620	38RB#18	21.20	PASS
Band41	15MHz	QPSK	40620	38RB#37	21.20	PASS
Band41	15MHz	16QAM	40620	38RB#37	21.15	PASS
Band41	15MHz	QPSK	40620	75RB#0	21.15	PASS
Band41	15MHz	16QAM	40620	75RB#0	20.68	PASS
Band41	15MHz	QPSK	41515	1RB#0	21.85	PASS
Band41	15MHz	16QAM	41515	1RB#0	21.66	PASS
Band41	15MHz	QPSK	41515	1RB#38	21.84	PASS



Shenzhen LCS Compliance Testing Laboratory Ltd.
Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street,
Baoan District, Shenzhen, 518000, China
Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com
Scan code to check authenticity



Band41	15MHz	16QAM	41515	1RB#38	21.66	PASS
Band41	15MHz	QPSK	41515	1RB#74	21.77	PASS
Band41	15MHz	16QAM	41515	1RB#74	21.57	PASS
Band41	15MHz	QPSK	41515	38RB#0	20.67	PASS
Band41	15MHz	16QAM	41515	38RB#0	20.68	PASS
Band41	15MHz	QPSK	41515	38RB#18	20.68	PASS
Band41	15MHz	16QAM	41515	38RB#18	20.68	PASS
Band41	15MHz	QPSK	41515	38RB#37	20.68	PASS
Band41	15MHz	16QAM	41515	38RB#37	20.69	PASS
Band41	15MHz	QPSK	41515	75RB#0	20.69	PASS
Band41	15MHz	16QAM	41515	75RB#0	20.03	PASS
Band41	20MHz	QPSK	39750	1RB#0	21.79	PASS
Band41	20MHz	16QAM	39750	1RB#0	21.36	PASS
Band41	20MHz	QPSK	39750	1RB#49	21.83	PASS
Band41	20MHz	16QAM	39750	1RB#49	21.29	PASS
Band41	20MHz	QPSK	39750	1RB#99	21.94	PASS
Band41	20MHz	16QAM	39750	1RB#99	21.52	PASS
Band41	20MHz	QPSK	39750	50RB#0	20.90	PASS
Band41	20MHz	16QAM	39750	50RB#0	20.44	PASS
Band41	20MHz	QPSK	39750	50RB#25	20.87	PASS
Band41	20MHz	16QAM	39750	50RB#25	20.44	PASS
Band41	20MHz	QPSK	39750	50RB#50	20.89	PASS
Band41	20MHz	16QAM	39750	50RB#50	20.45	PASS
Band41	20MHz	QPSK	39750	100RB#0	20.96	PASS
Band41	20MHz	16QAM	39750	100RB#0	20.29	PASS
Band41	20MHz	QPSK	40620	1RB#0	22.00	PASS
Band41	20MHz	16QAM	40620	1RB#0	22.27	PASS
Band41	20MHz	QPSK	40620	1RB#49	21.89	PASS
Band41	20MHz	16QAM	40620	1RB#49	22.10	PASS
Band41	20MHz	QPSK	40620	1RB#99	21.88	PASS
Band41	20MHz	16QAM	40620	1RB#99	21.86	PASS
Band41	20MHz	QPSK	40620	50RB#0	21.29	PASS
Band41	20MHz	16QAM	40620	50RB#0	20.77	PASS
Band41	20MHz	QPSK	40620	50RB#25	21.30	PASS
Band41	20MHz	16QAM	40620	50RB#25	20.61	PASS
Band41	20MHz	QPSK	40620	50RB#50	20.99	PASS
Band41	20MHz	16QAM	40620	50RB#50	20.52	PASS
Band41	20MHz	QPSK	40620	100RB#0	21.05	PASS
Band41	20MHz	16QAM	40620	100RB#0	20.39	PASS
Band41	20MHz	QPSK	41490	1RB#0	21.50	PASS



Shenzhen LCS Compliance Testing Laboratory Ltd.
Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street,
Baoan District, Shenzhen, 518000, China
Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com
Scan code to check authenticity



Band41	20MHz	16QAM	41490	1RB#0	21.70	PASS
Band41	20MHz	QPSK	41490	1RB#49	21.44	PASS
Band41	20MHz	16QAM	41490	1RB#49	21.63	PASS
Band41	20MHz	QPSK	41490	1RB#99	21.47	PASS
Band41	20MHz	16QAM	41490	1RB#99	21.62	PASS
Band41	20MHz	QPSK	41490	50RB#0	20.72	PASS
Band41	20MHz	16QAM	41490	50RB#0	20.09	PASS
Band41	20MHz	QPSK	41490	50RB#25	20.68	PASS
Band41	20MHz	16QAM	41490	50RB#25	20.09	PASS
Band41	20MHz	QPSK	41490	50RB#50	20.58	PASS
Band41	20MHz	16QAM	41490	50RB#50	20.17	PASS
Band41	20MHz	QPSK	41490	100RB#0	20.66	PASS
Band41	20MHz	16QAM	41490	100RB#0	19.93	PASS



Shenzhen LCS Compliance Testing Laboratory Ltd.
Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street,
Baoan District, Shenzhen, 518000, China
Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com
Scan code to check authenticity



N.2 Peak-to-Average Ratio(CCDF)

Test Result

Band	Bandwidth	Modulation	Channel	RB Configuration	Result(dB)	Limit(dB)	Verdict
Band41	5MHz	QPSK	39675	1RB#0	8.42	13	PASS
Band41	5MHz	16QAM	39675	1RB#0	8.97	13	PASS
Band41	5MHz	QPSK	39675	25RB#0	8.93	13	PASS
Band41	5MHz	16QAM	39675	25RB#0	9.63	13	PASS
Band41	5MHz	QPSK	40620	1RB#0	8.05	13	PASS
Band41	5MHz	16QAM	40620	1RB#0	8.49	13	PASS
Band41	5MHz	QPSK	40620	25RB#0	8.70	13	PASS
Band41	5MHz	16QAM	40620	25RB#0	9.41	13	PASS
Band41	5MHz	QPSK	41565	1RB#0	6.99	13	PASS
Band41	5MHz	16QAM	41565	1RB#0	7.47	13	PASS
Band41	5MHz	QPSK	41565	25RB#0	8.36	13	PASS
Band41	5MHz	16QAM	41565	25RB#0	9.03	13	PASS
Band41	10MHz	QPSK	39700	1RB#0	7.99	13	PASS
Band41	10MHz	16QAM	39700	1RB#0	9.06	13	PASS
Band41	10MHz	QPSK	39700	50RB#0	9.12	13	PASS
Band41	10MHz	16QAM	39700	50RB#0	9.73	13	PASS
Band41	10MHz	QPSK	40620	1RB#0	8.15	13	PASS
Band41	10MHz	16QAM	40620	1RB#0	8.69	13	PASS
Band41	10MHz	QPSK	40620	50RB#0	8.70	13	PASS
Band41	10MHz	16QAM	40620	50RB#0	9.43	13	PASS
Band41	10MHz	QPSK	41540	1RB#0	6.83	13	PASS
Band41	10MHz	16QAM	41540	1RB#0	7.65	13	PASS
Band41	10MHz	QPSK	41540	50RB#0	8.43	13	PASS
Band41	10MHz	16QAM	41540	50RB#0	9.12	13	PASS
Band41	15MHz	QPSK	39725	1RB#0	8.29	13	PASS
Band41	15MHz	16QAM	39725	1RB#0	8.89	13	PASS
Band41	15MHz	QPSK	39725	75RB#0	9.31	13	PASS
Band41	15MHz	16QAM	39725	75RB#0	9.78	13	PASS
Band41	15MHz	QPSK	40620	1RB#0	8.12	13	PASS
Band41	15MHz	16QAM	40620	1RB#0	8.82	13	PASS
Band41	15MHz	QPSK	40620	75RB#0	9.01	13	PASS
Band41	15MHz	16QAM	40620	75RB#0	9.77	13	PASS
Band41	15MHz	QPSK	41515	1RB#0	7.35	13	PASS
Band41	15MHz	16QAM	41515	1RB#0	7.84	13	PASS



Shenzhen LCS Compliance Testing Laboratory Ltd.
Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street,
Baoan District, Shenzhen, 518000, China
Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com
Scan code to check authenticity




Band41	15MHz	QPSK	41515	75RB#0	8.59	13	PASS
Band41	15MHz	16QAM	41515	75RB#0	9.01	13	PASS
Band41	20MHz	QPSK	39750	1RB#0	7.80	13	PASS
Band41	20MHz	16QAM	39750	1RB#0	8.37	13	PASS
Band41	20MHz	QPSK	39750	100RB#0	9.13	13	PASS
Band41	20MHz	16QAM	39750	100RB#0	9.62	13	PASS
Band41	20MHz	QPSK	40620	1RB#0	7.93	13	PASS
Band41	20MHz	16QAM	40620	1RB#0	8.44	13	PASS
Band41	20MHz	QPSK	40620	100RB#0	8.81	13	PASS
Band41	20MHz	16QAM	40620	100RB#0	9.48	13	PASS
Band41	20MHz	QPSK	41490	1RB#0	7.75	13	PASS
Band41	20MHz	16QAM	41490	1RB#0	7.90	13	PASS
Band41	20MHz	QPSK	41490	100RB#0	8.29	13	PASS
Band41	20MHz	16QAM	41490	100RB#0	8.99	13	PASS




Shenzhen LCS Compliance Testing Laboratory Ltd.
Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street,
Baoan District, Shenzhen, 518000, China
Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com
Scan code to check authenticity




Test Graphs

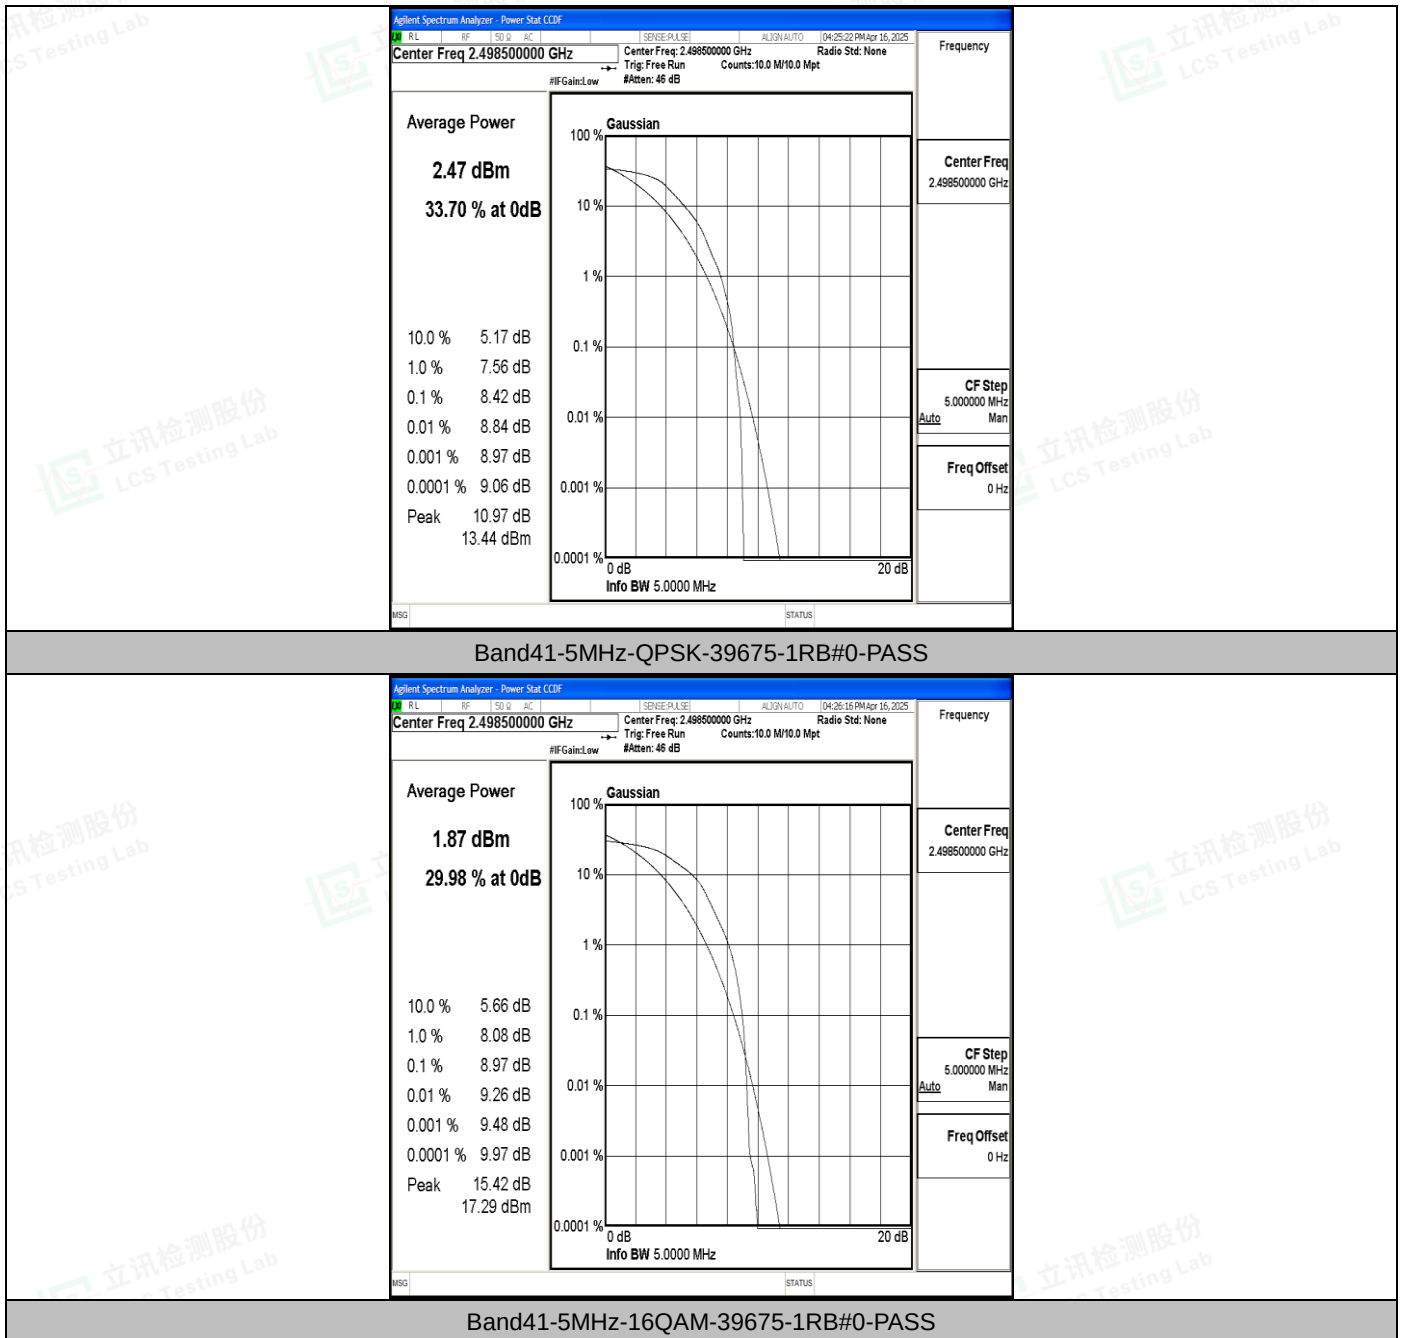

Shenzhen LCS Compliance Testing Laboratory Ltd.
Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street,
Baoan District, Shenzhen, 518000, China
Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com
Scan code to check authenticity

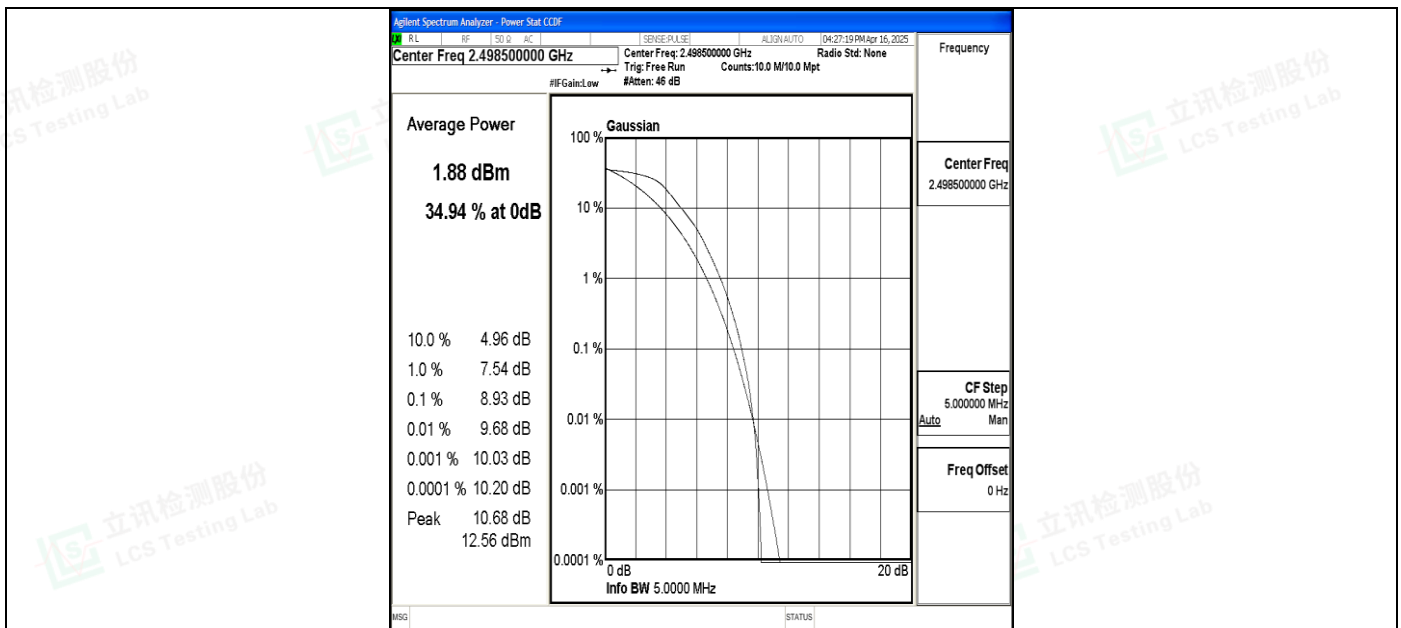


Band41-5MHz-QPSK-39675-25RB#0-PASS

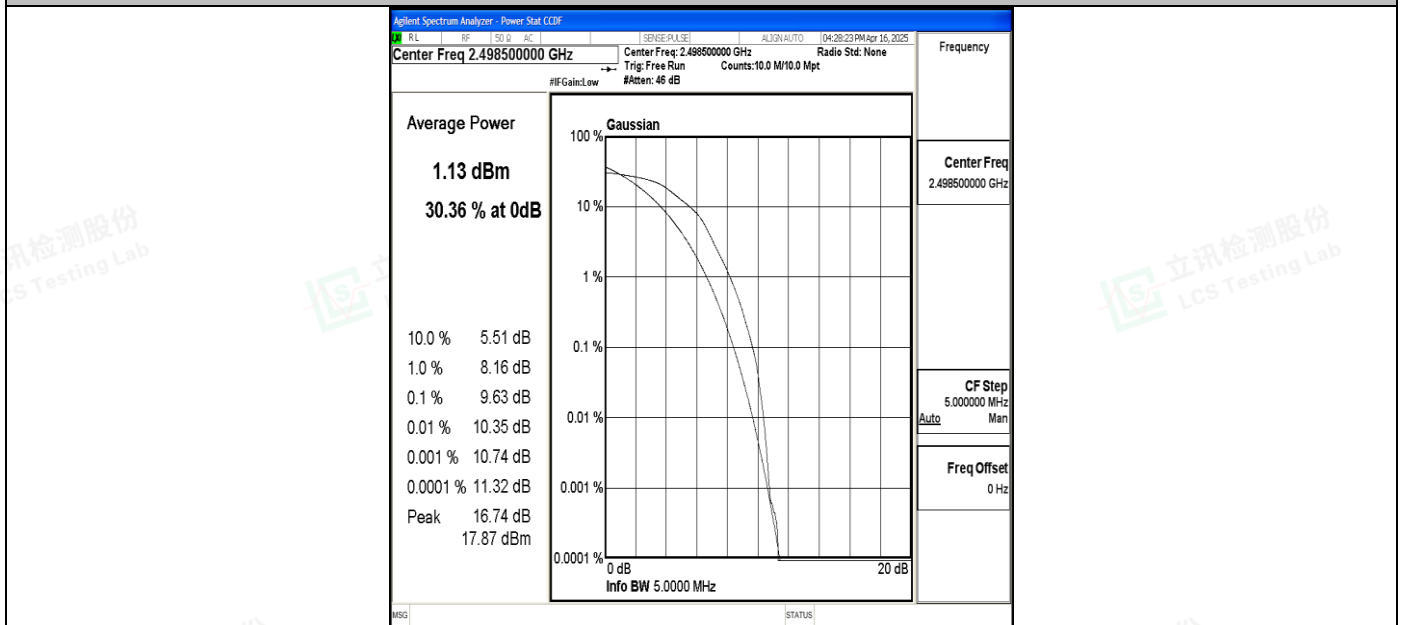


Band41-5MHz-16QAM-39675-25RB#0-PASS



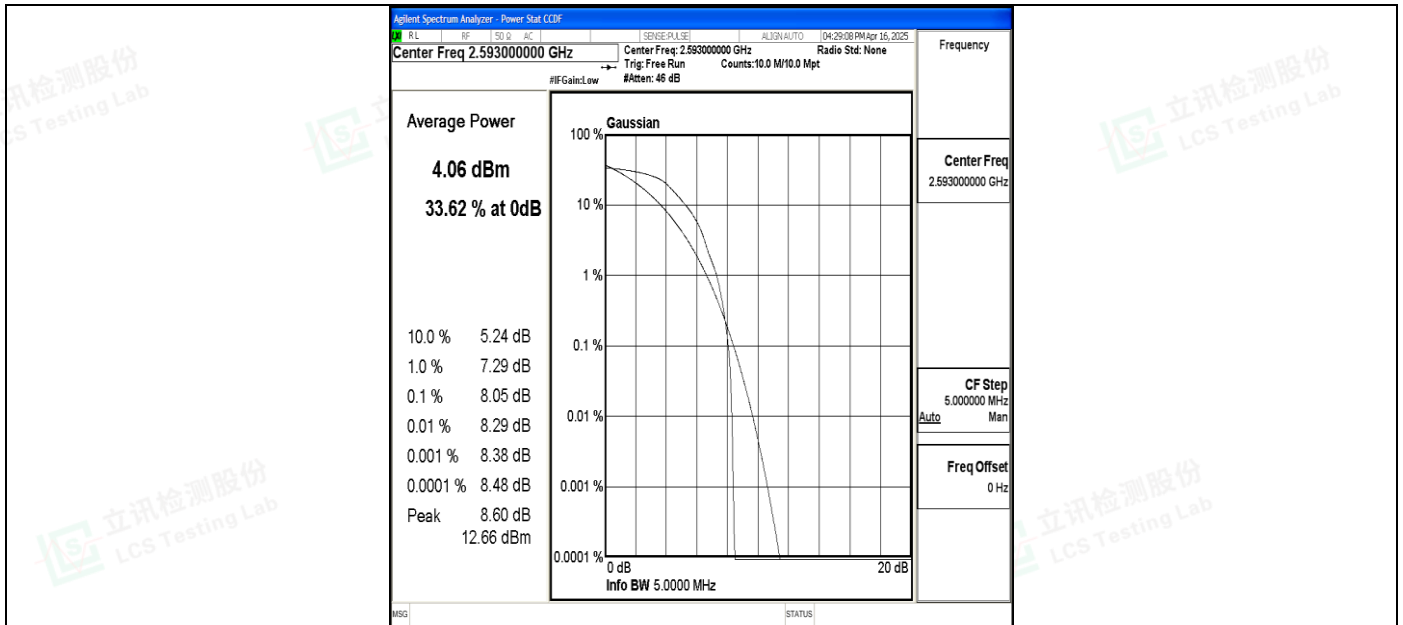


Band41-5MHz-QPSK-40620-1RB#0-PASS

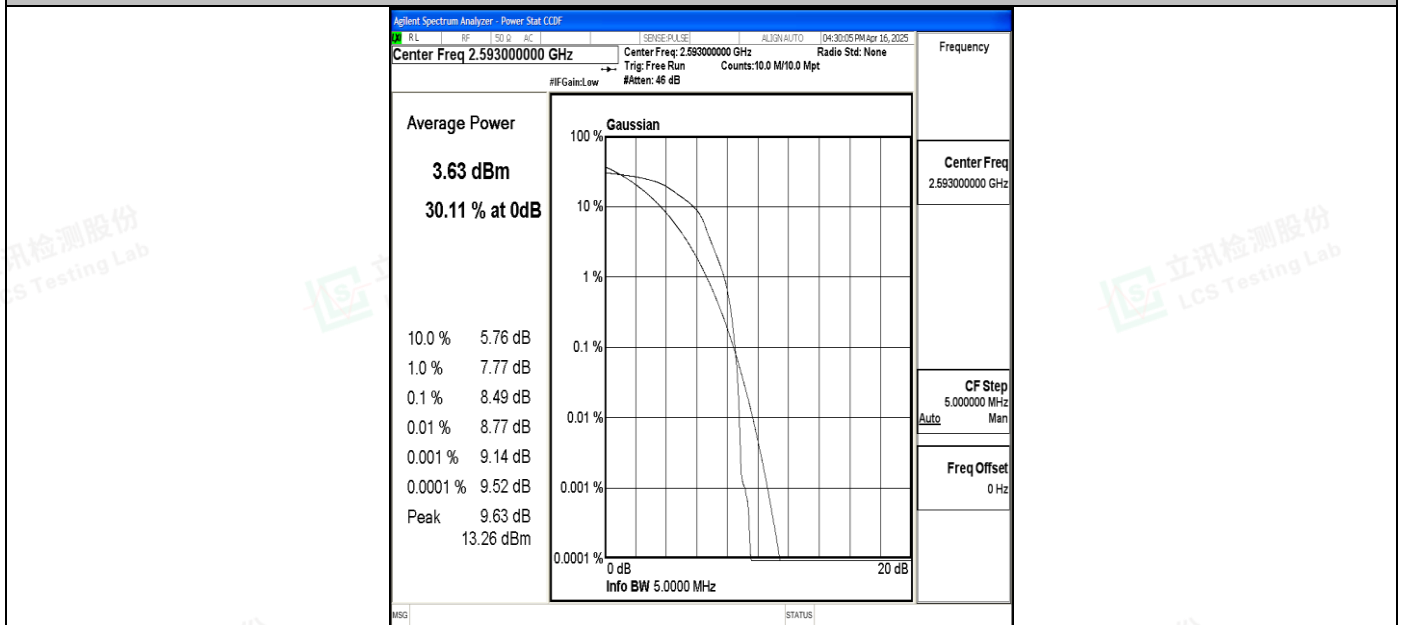


Band41-5MHz-16QAM-40620-1RB#0-PASS



Shenzhen LCS Compliance Testing Laboratory Ltd.
Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street,
Baoan District, Shenzhen, 518000, China
Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com
Scan code to check authenticity

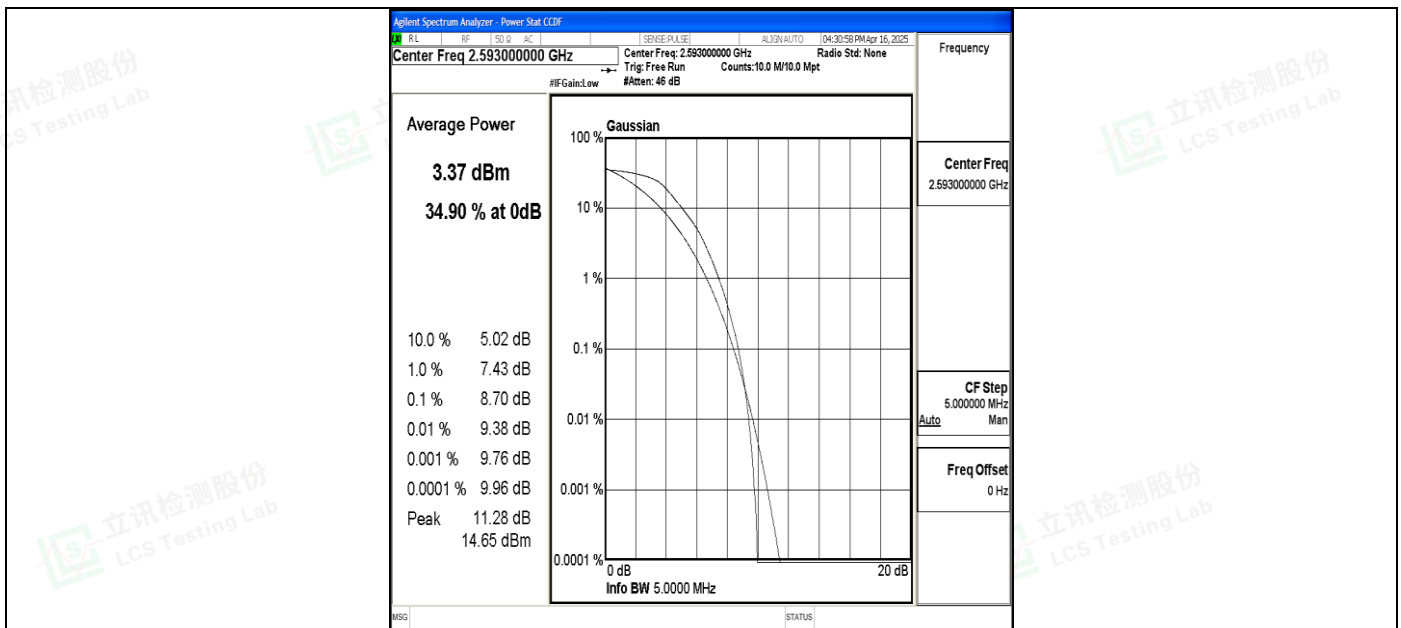


Band41-5MHz-QPSK-40620-25RB#0-PASS

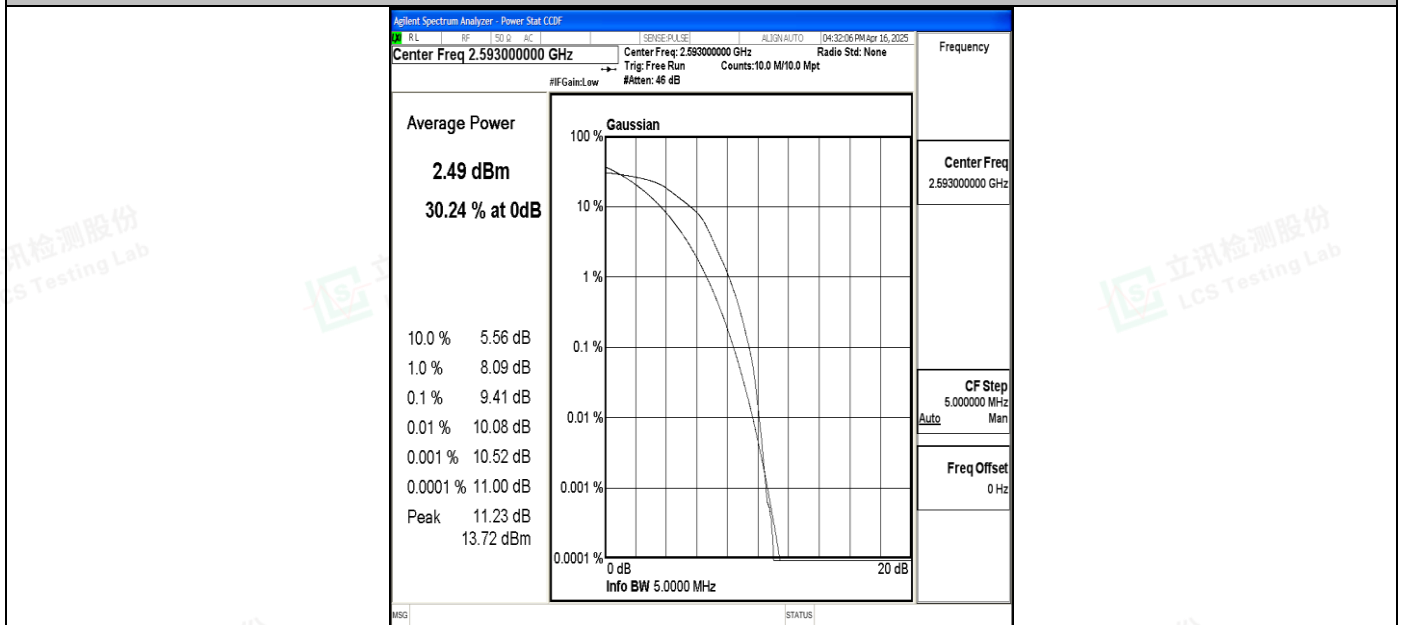


Band41-5MHz-16QAM-40620-25RB#0-PASS



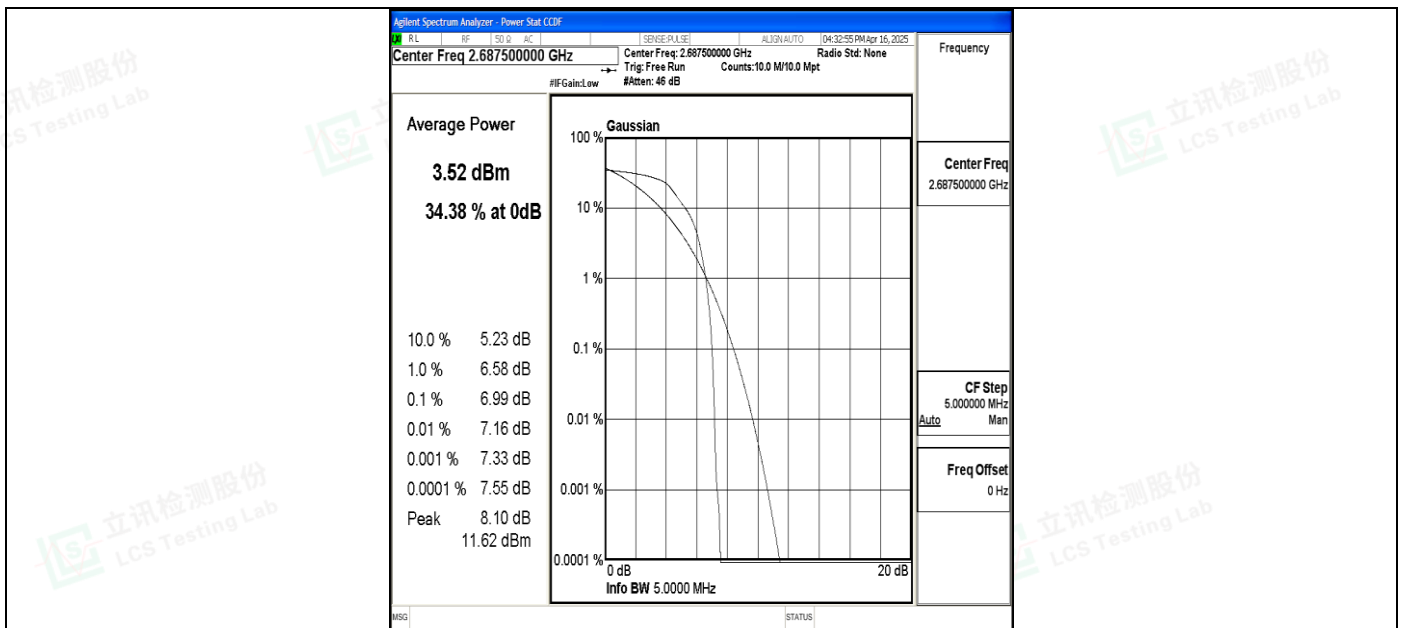


Band41-5MHz-QPSK-41565-1RB#0-PASS

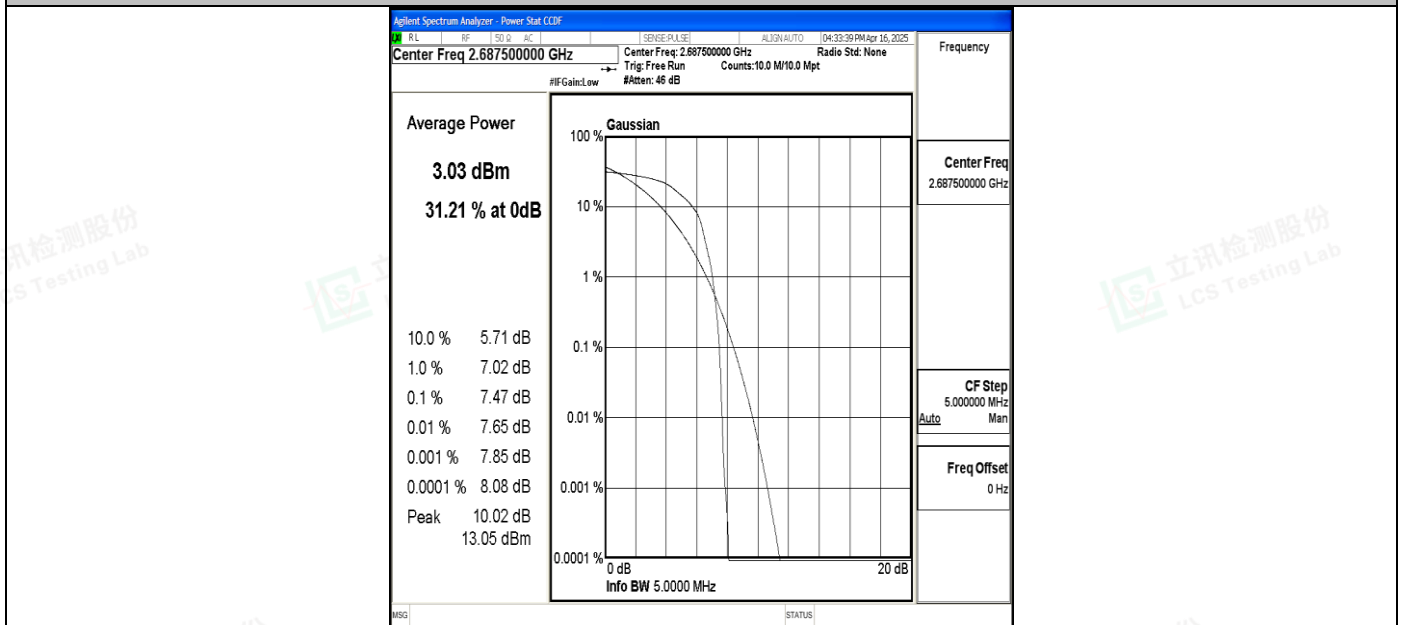


Band41-5MHz-16QAM-41565-1RB#0-PASS



Shenzhen LCS Compliance Testing Laboratory Ltd.
Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street,
Baoan District, Shenzhen, 518000, China
Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com
Scan code to check authenticity

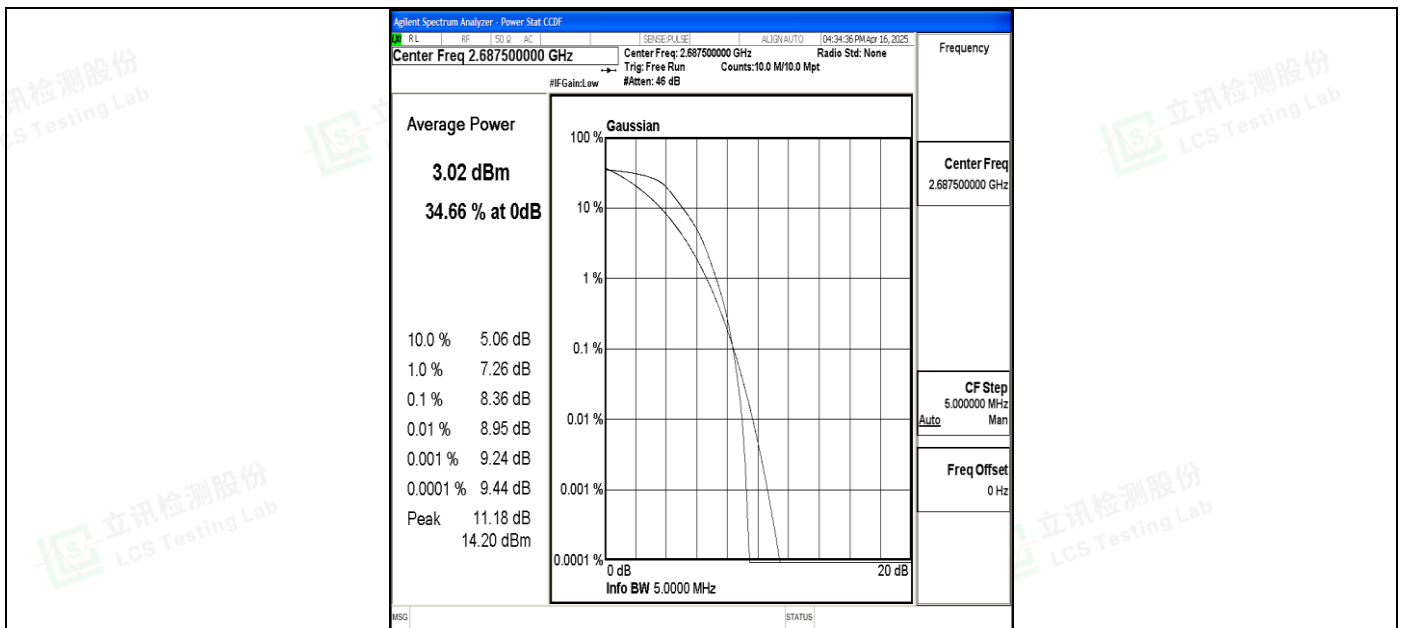


Band41-5MHz-QPSK-41565-25RB#0-PASS

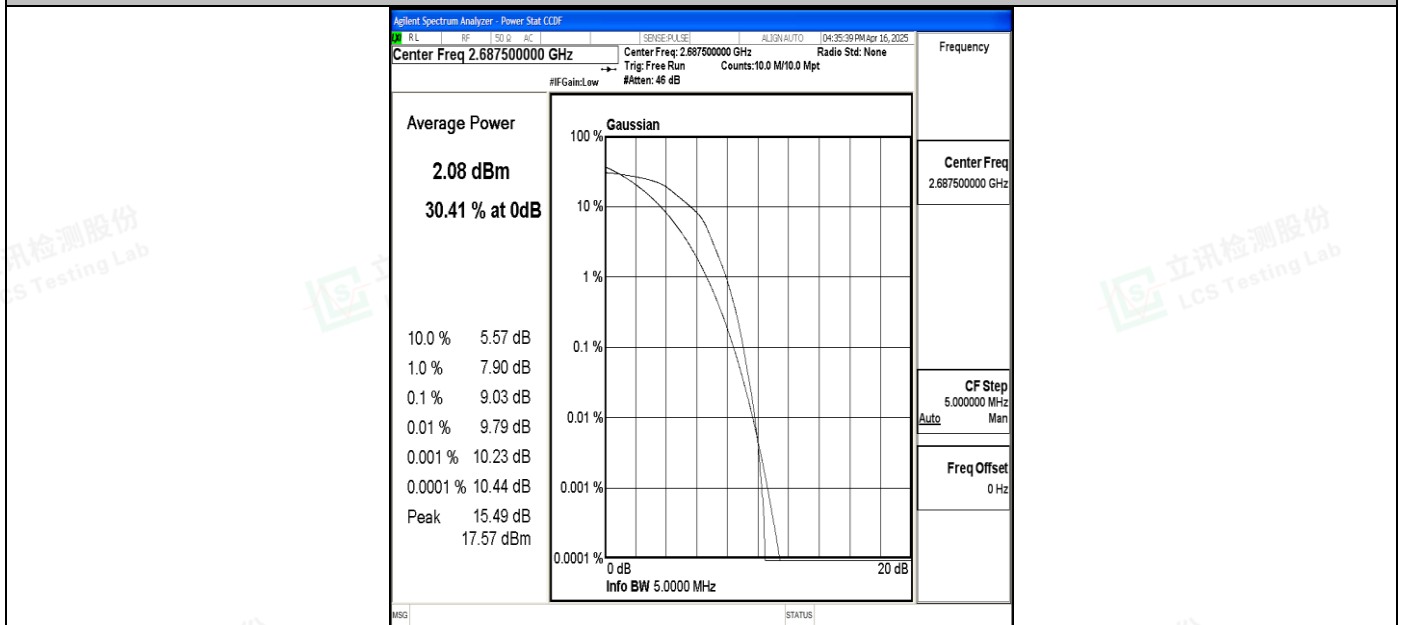


Band41-5MHz-16QAM-41565-25RB#0-PASS



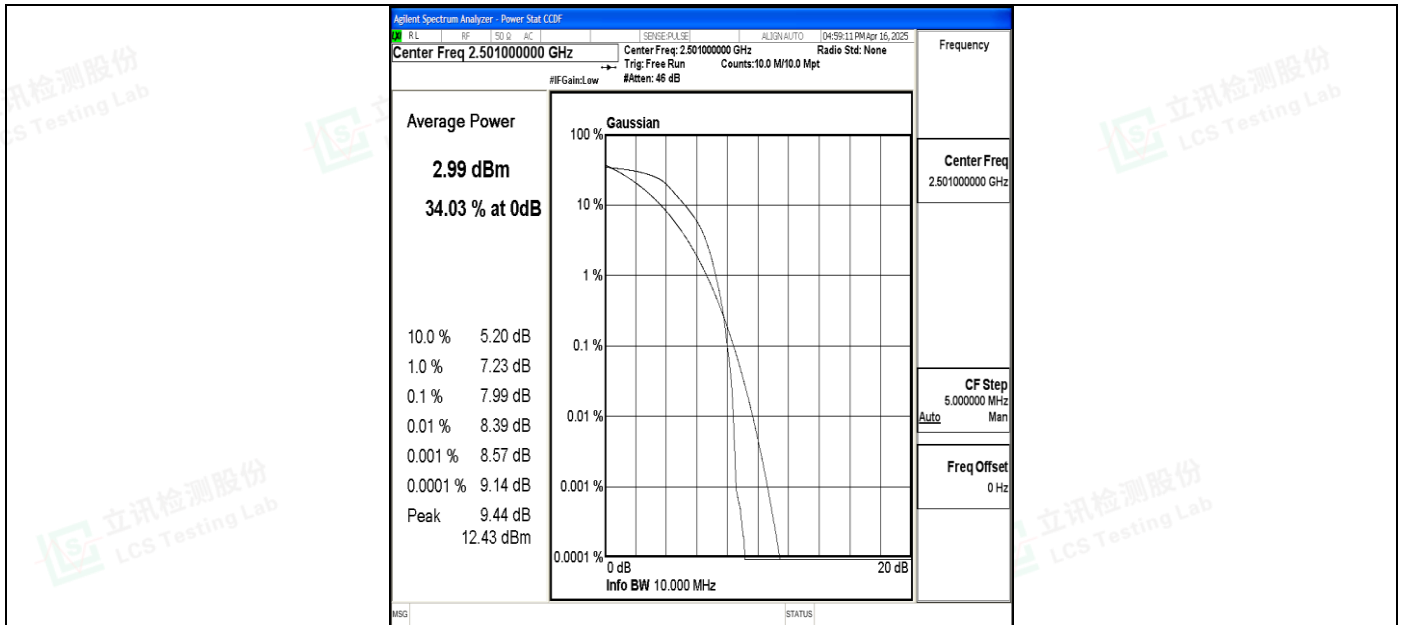


Band41-10MHz-QPSK-39700-1RB#0-PASS

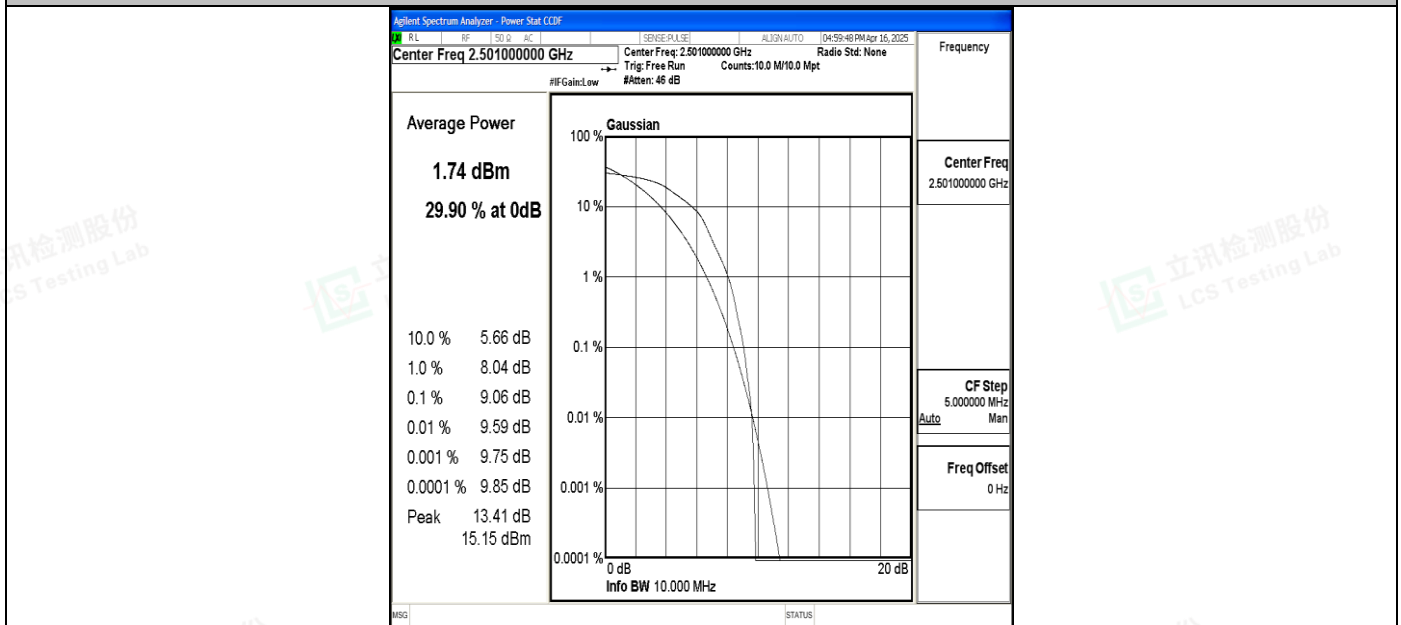


Band41-10MHz-16QAM-39700-1RB#0-PASS



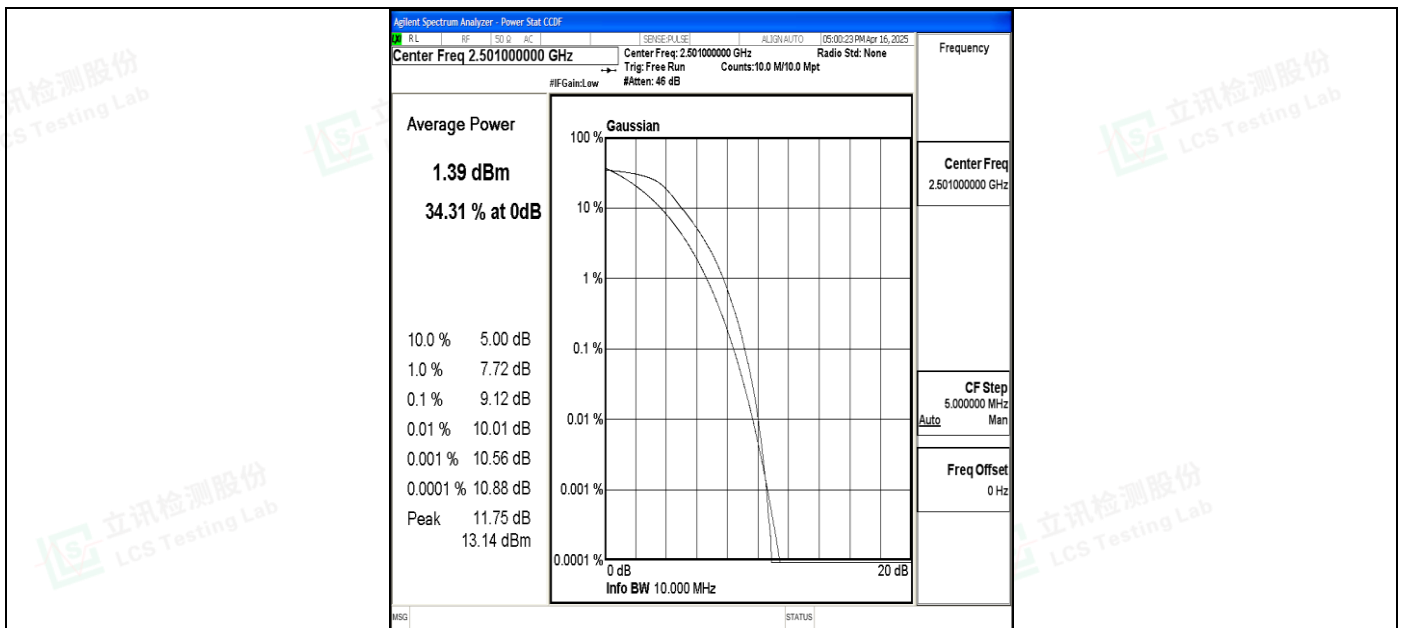


Band41-10MHz-QPSK-39700-50RB#0-PASS

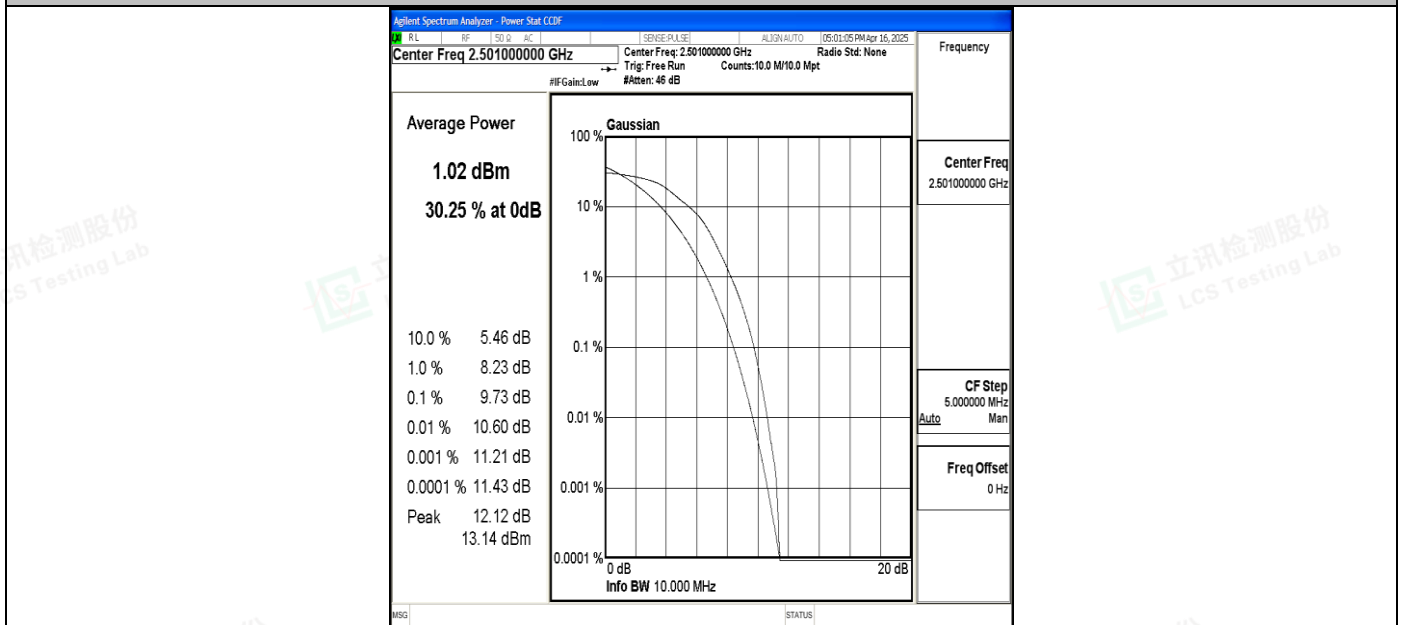


Band41-10MHz-16QAM-39700-50RB#0-PASS



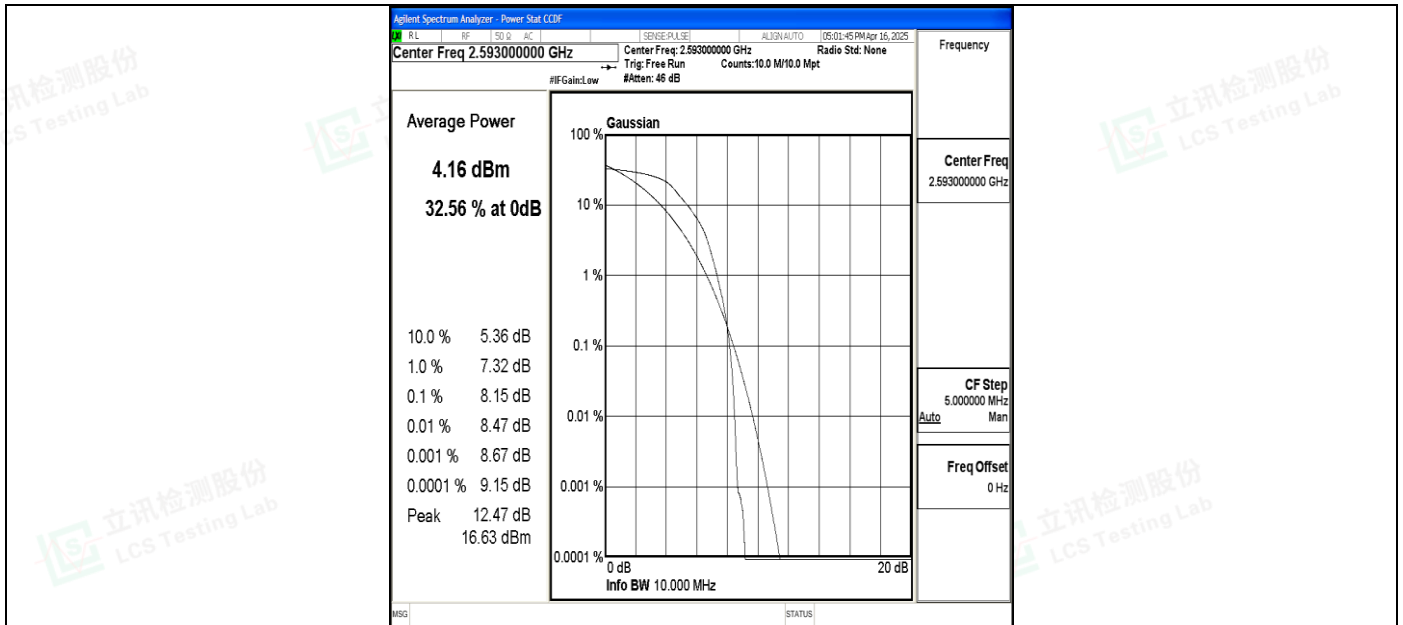


Band41-10MHz-QPSK-40620-1RB#0-PASS

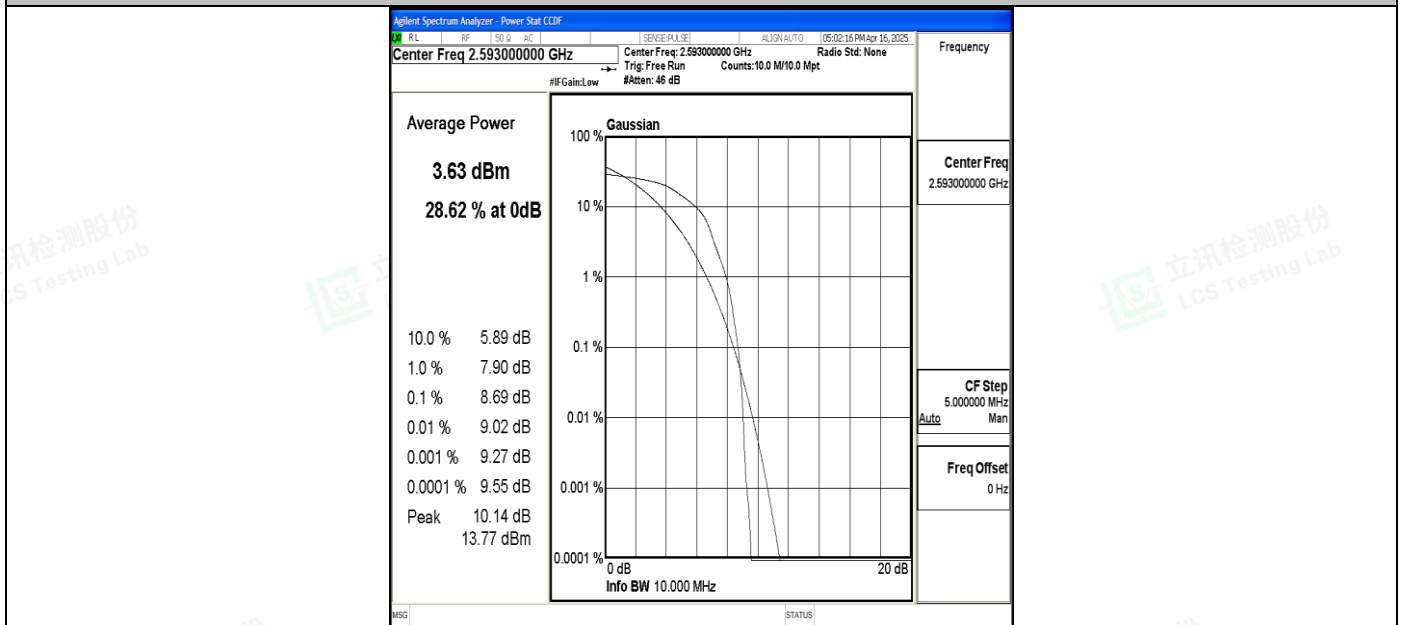


Band41-10MHz-16QAM-40620-1RB#0-PASS



Shenzhen LCS Compliance Testing Laboratory Ltd.
Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street,
Baoan District, Shenzhen, 518000, China
Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com
Scan code to check authenticity

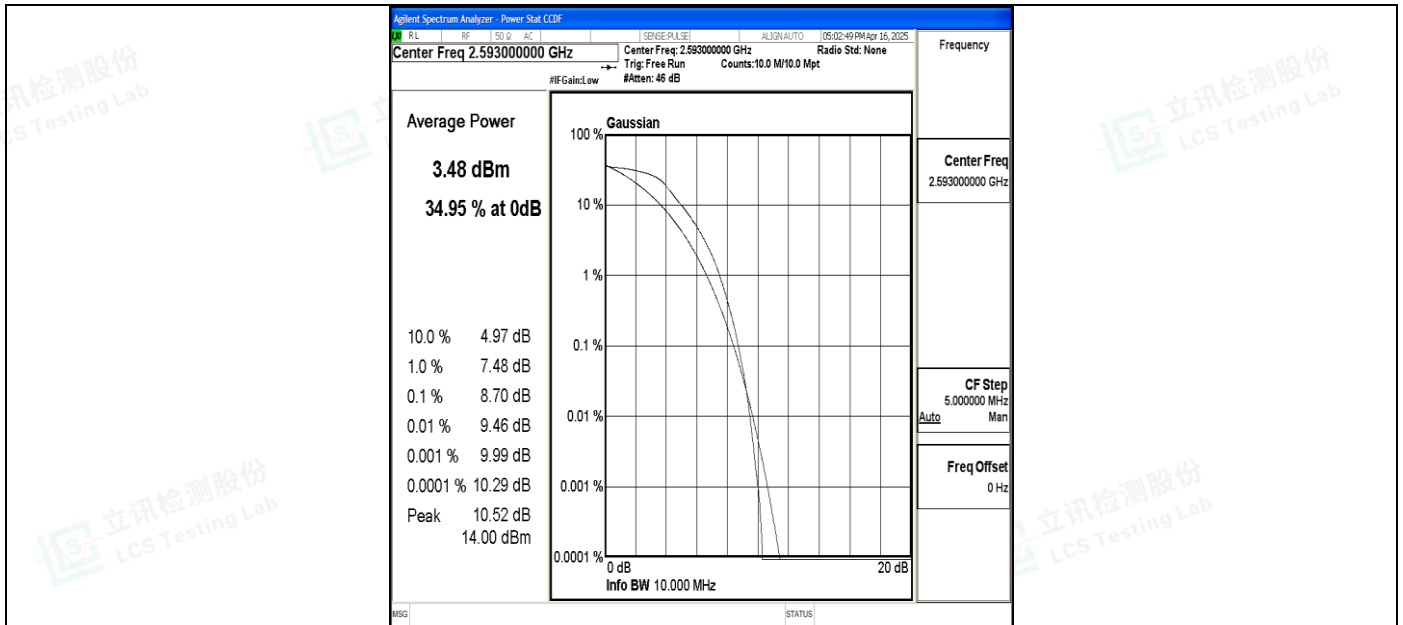


Band41-10MHz-QPSK-40620-50RB#0-PASS

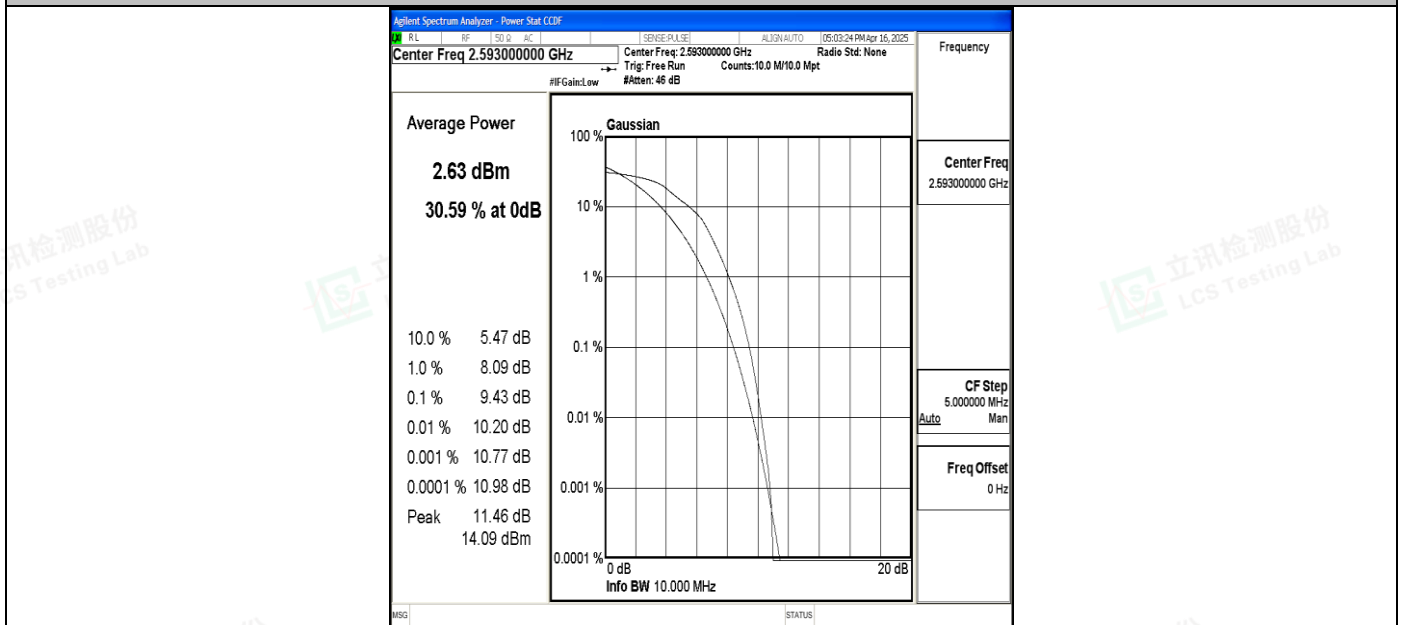


Band41-10MHz-16QAM-40620-50RB#0-PASS



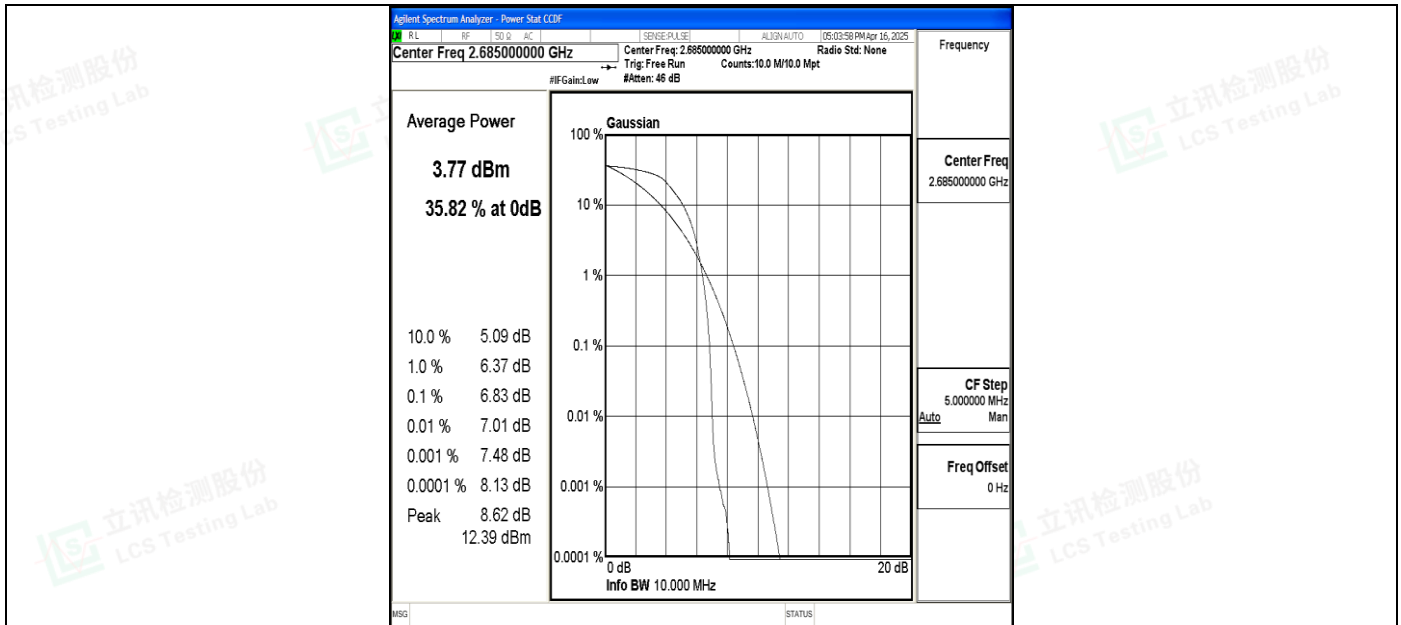


Band41-10MHz-QPSK-41540-1RB#0-PASS

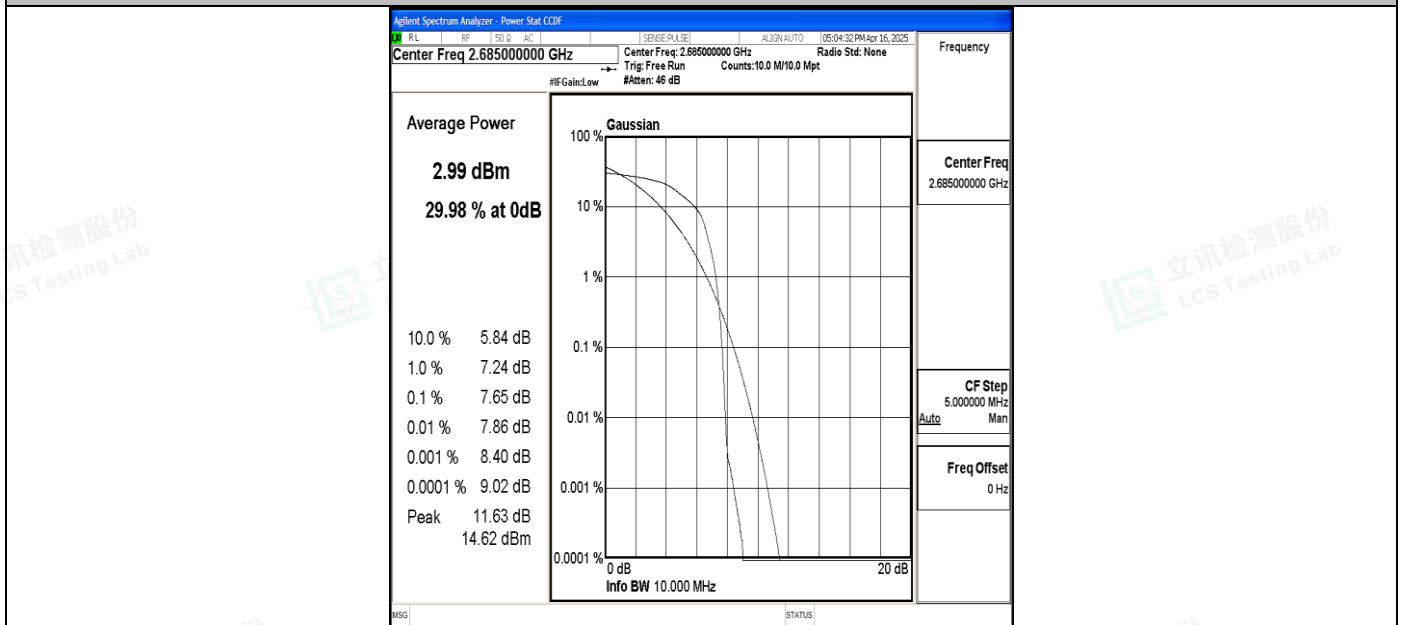


Band41-10MHz-16QAM-41540-1RB#0-PASS



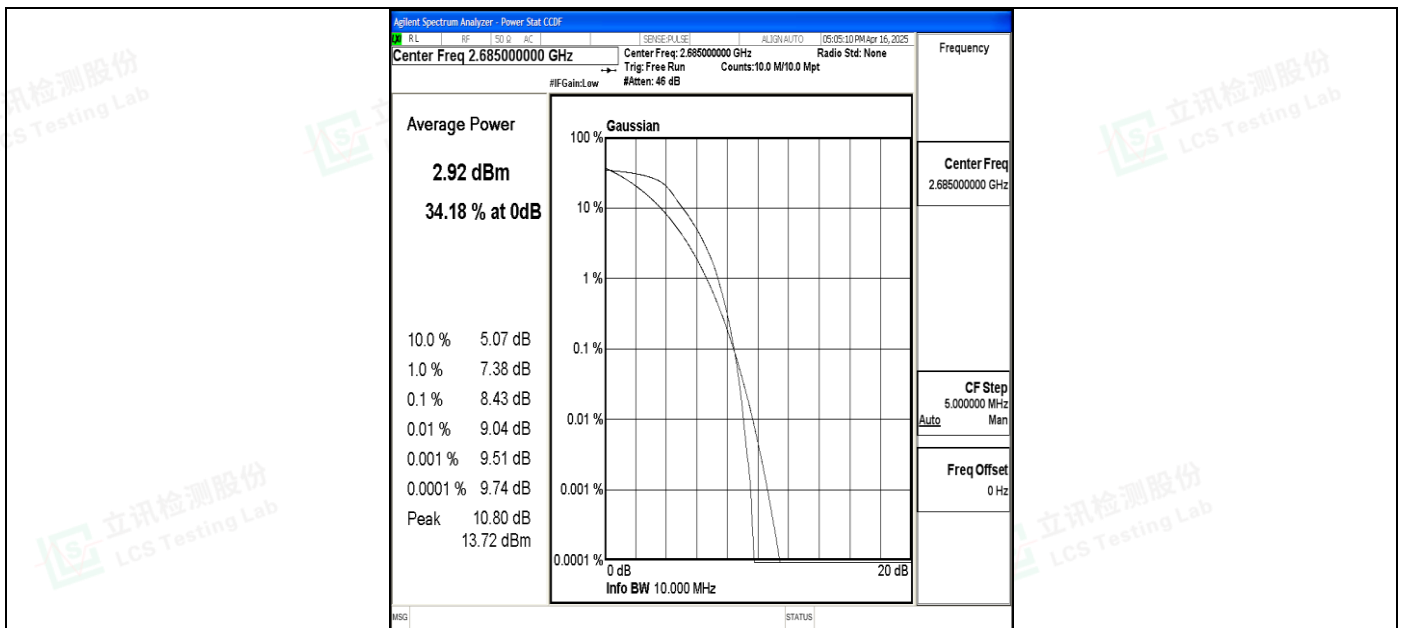


Band41-10MHz-QPSK-41540-50RB#0-PASS

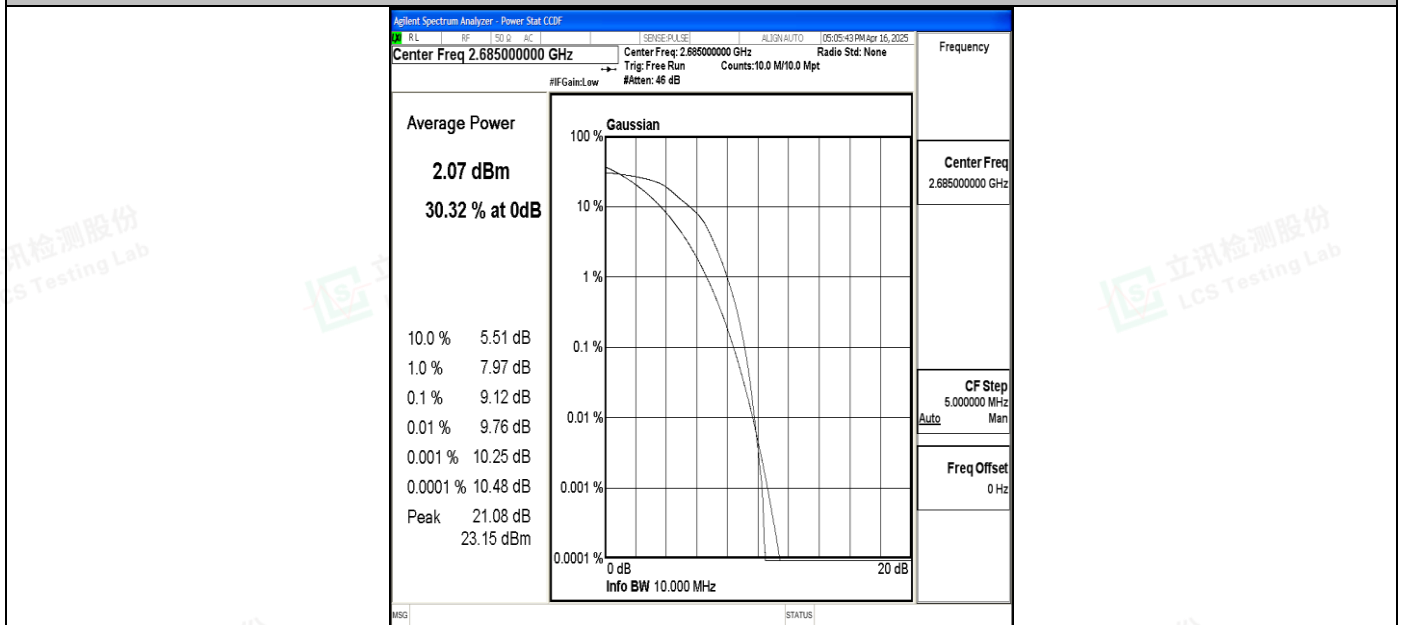


Band41-10MHz-16QAM-41540-50RB#0-PASS



Shenzhen LCS Compliance Testing Laboratory Ltd.
Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street,
Baoan District, Shenzhen, 518000, China
Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com
Scan code to check authenticity

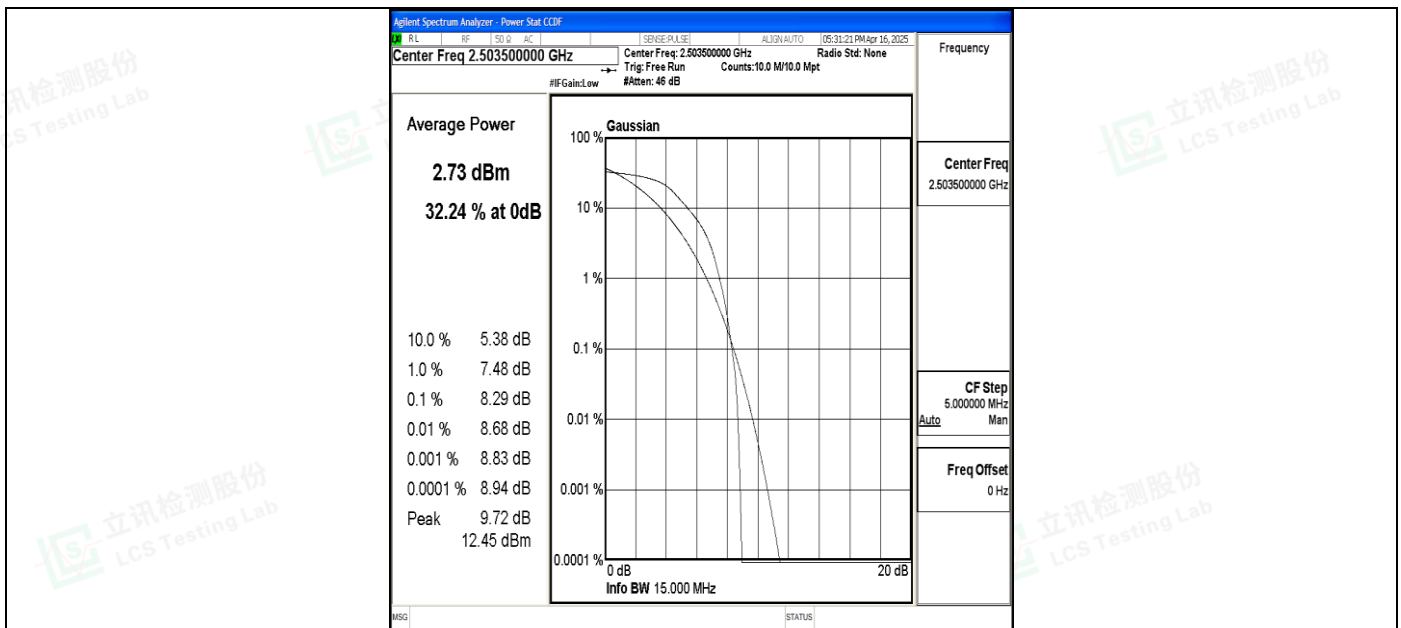


Band41-15MHz-QPSK-39725-1RB#0-PASS

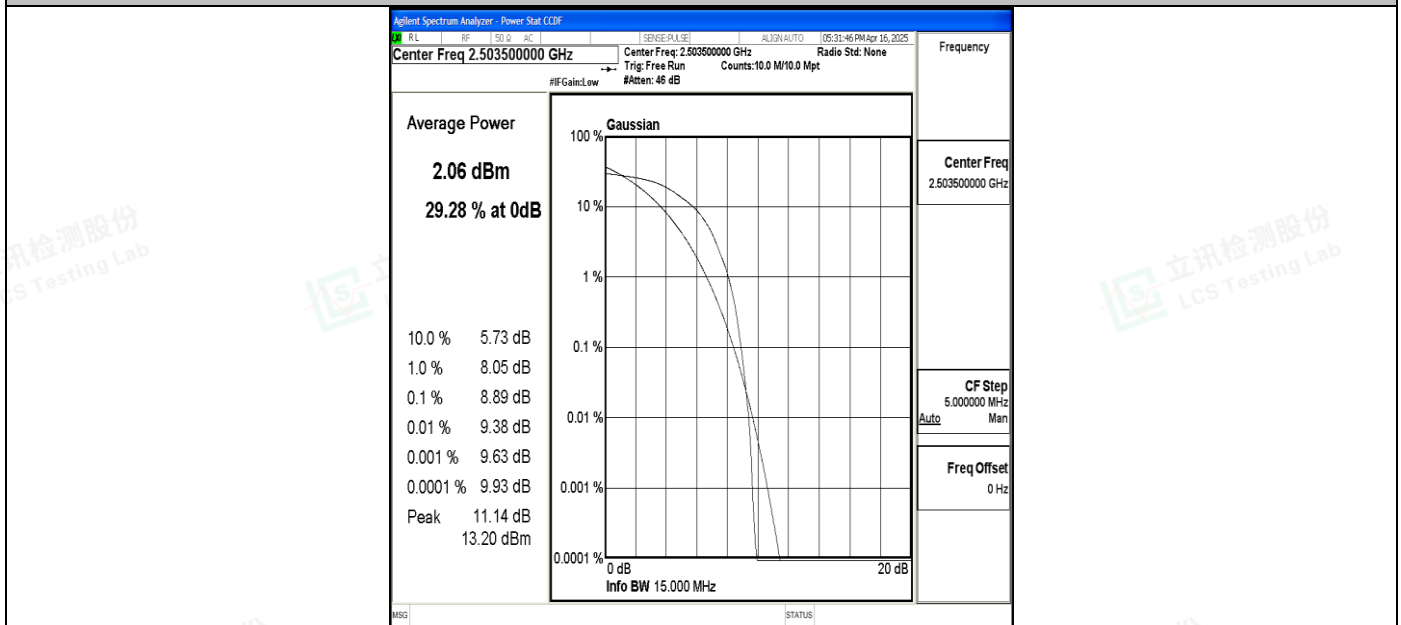


Band41-15MHz-16QAM-39725-1RB#0-PASS



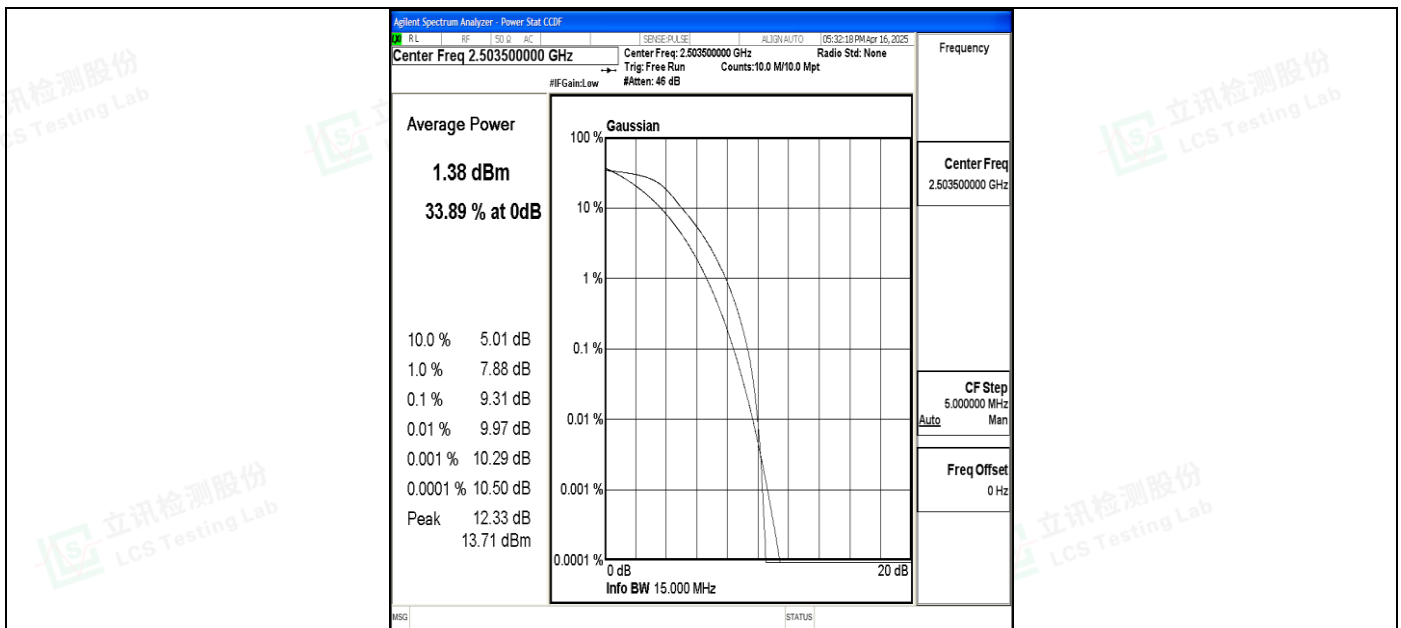


Band41-15MHz-QPSK-39725-75RB#0-PASS

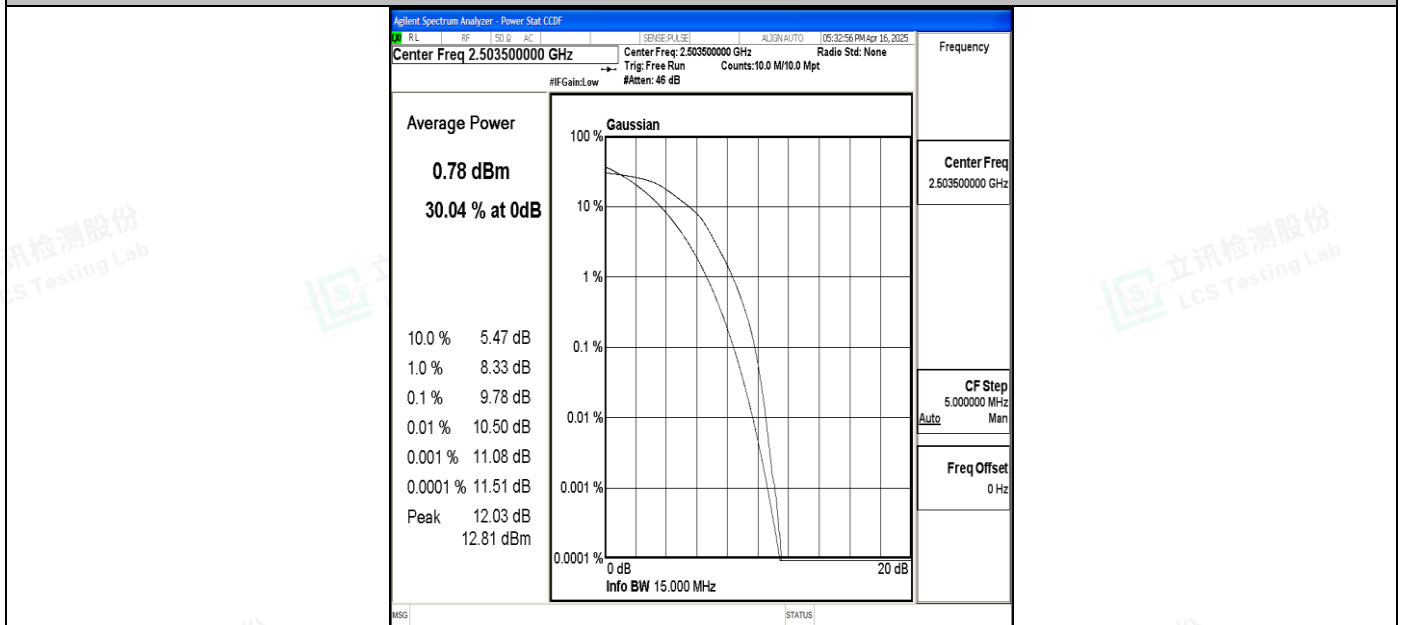


Band41-15MHz-16QAM-39725-75RB#0-PASS



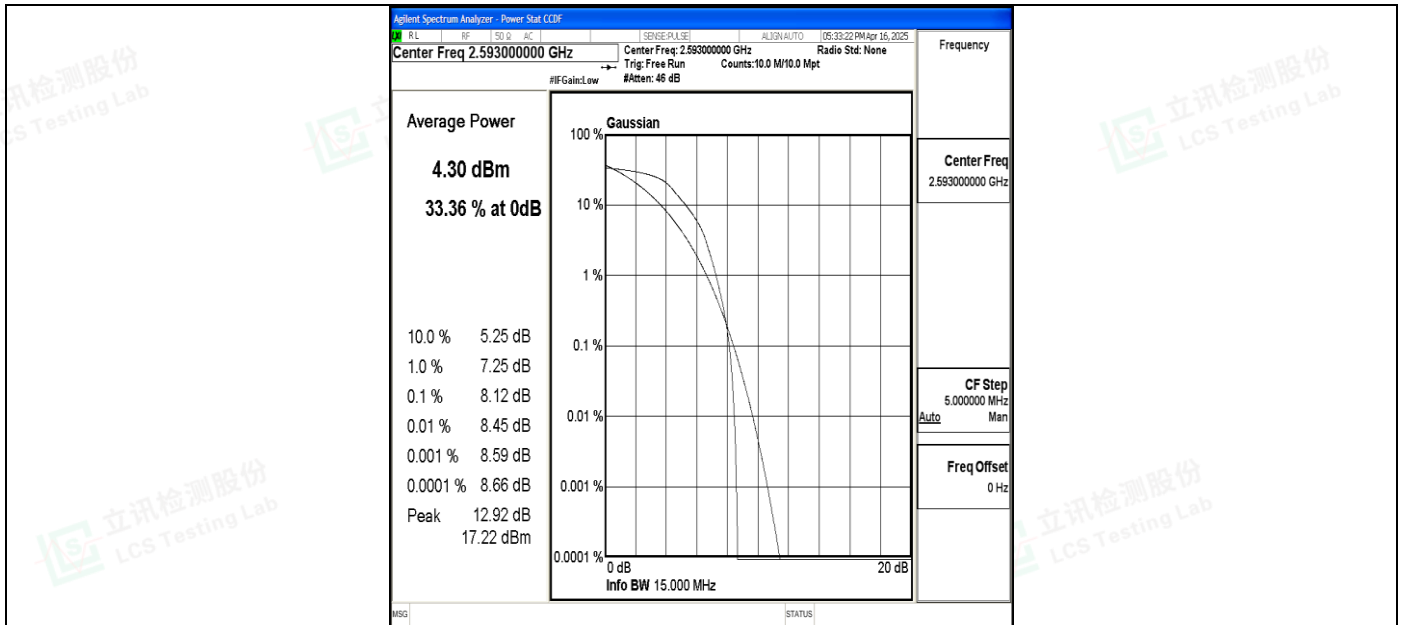


Band41-15MHz-QPSK-40620-1RB#0-PASS

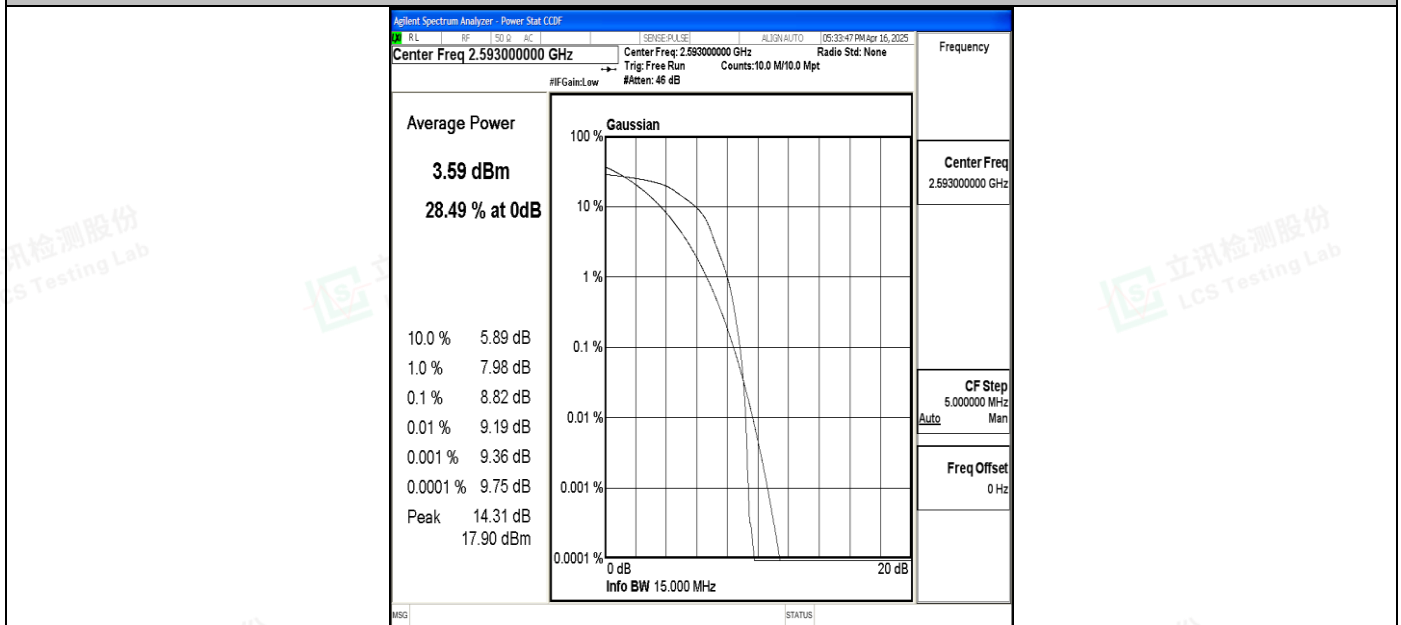


Band41-15MHz-16QAM-40620-1RB#0-PASS



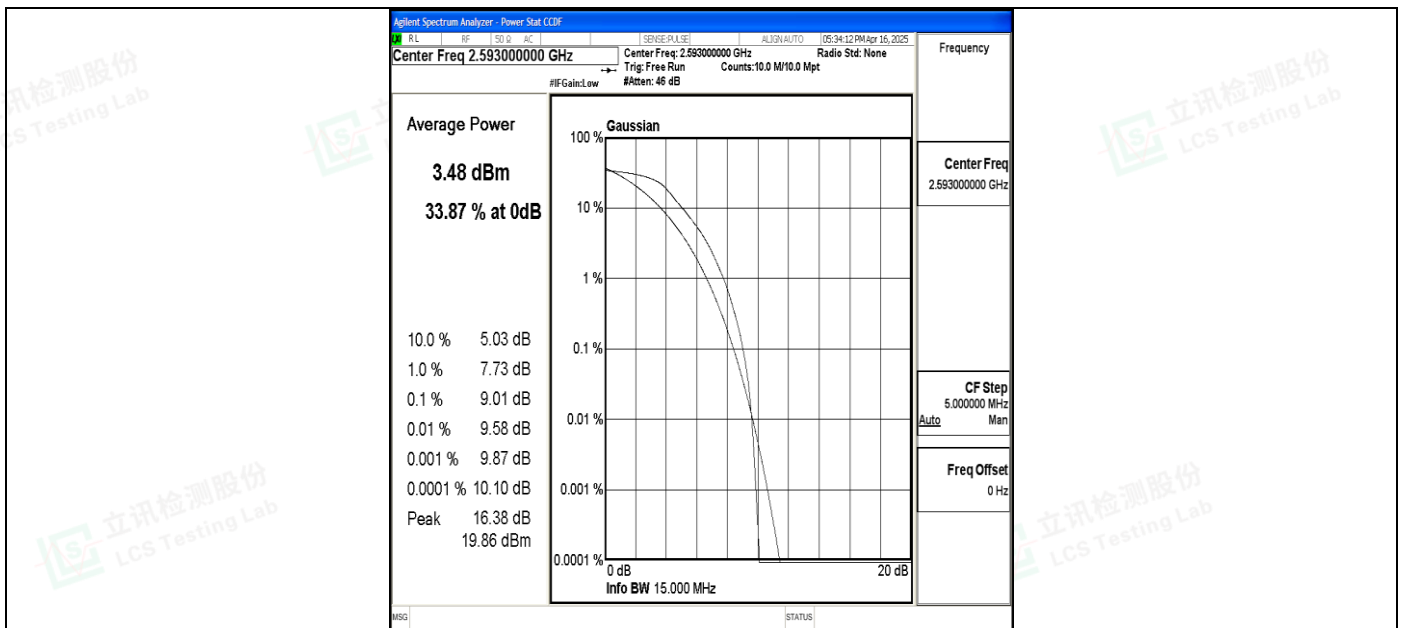


Band41-15MHz-QPSK-40620-75RB#0-PASS

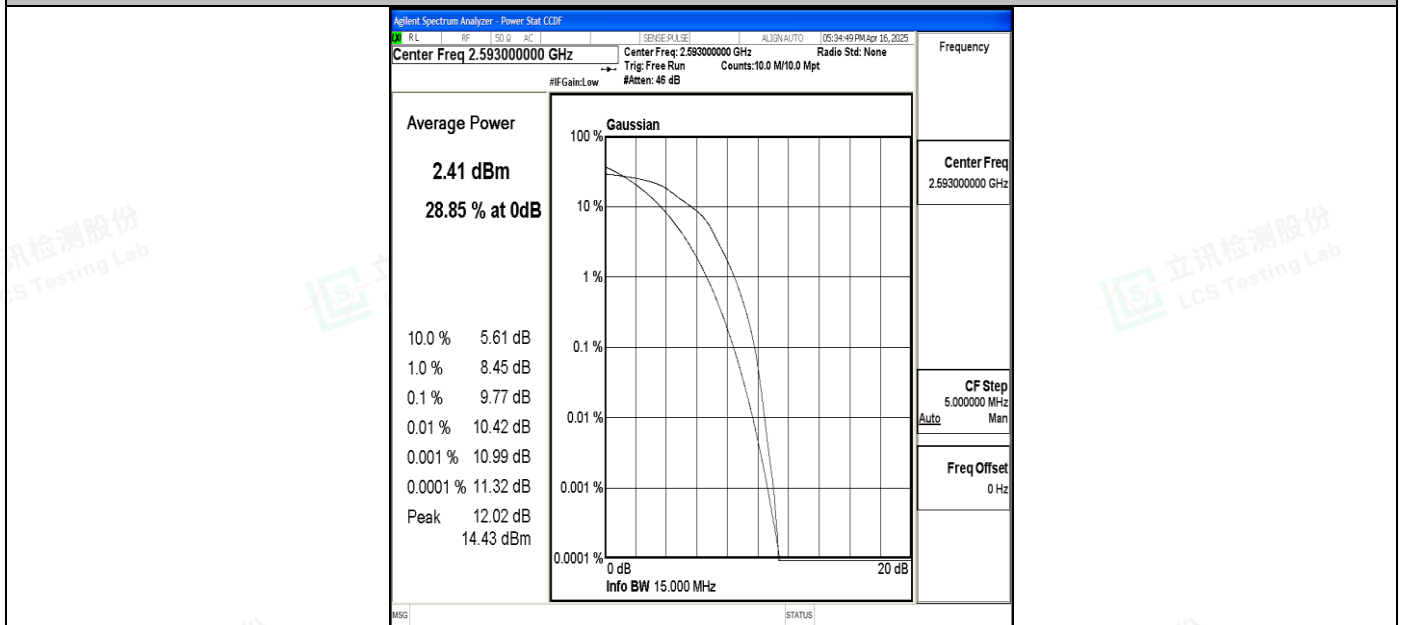


Band41-15MHz-16QAM-40620-75RB#0-PASS



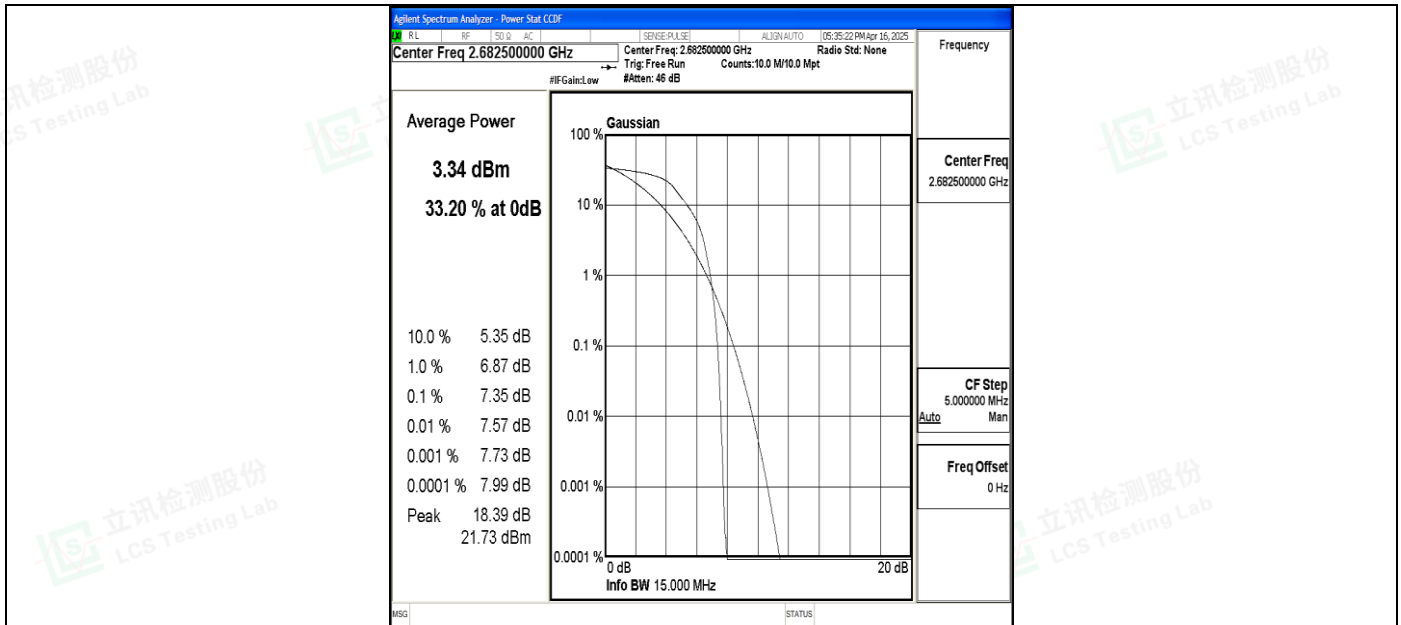


Band41-15MHz-QPSK-41515-1RB#0-PASS

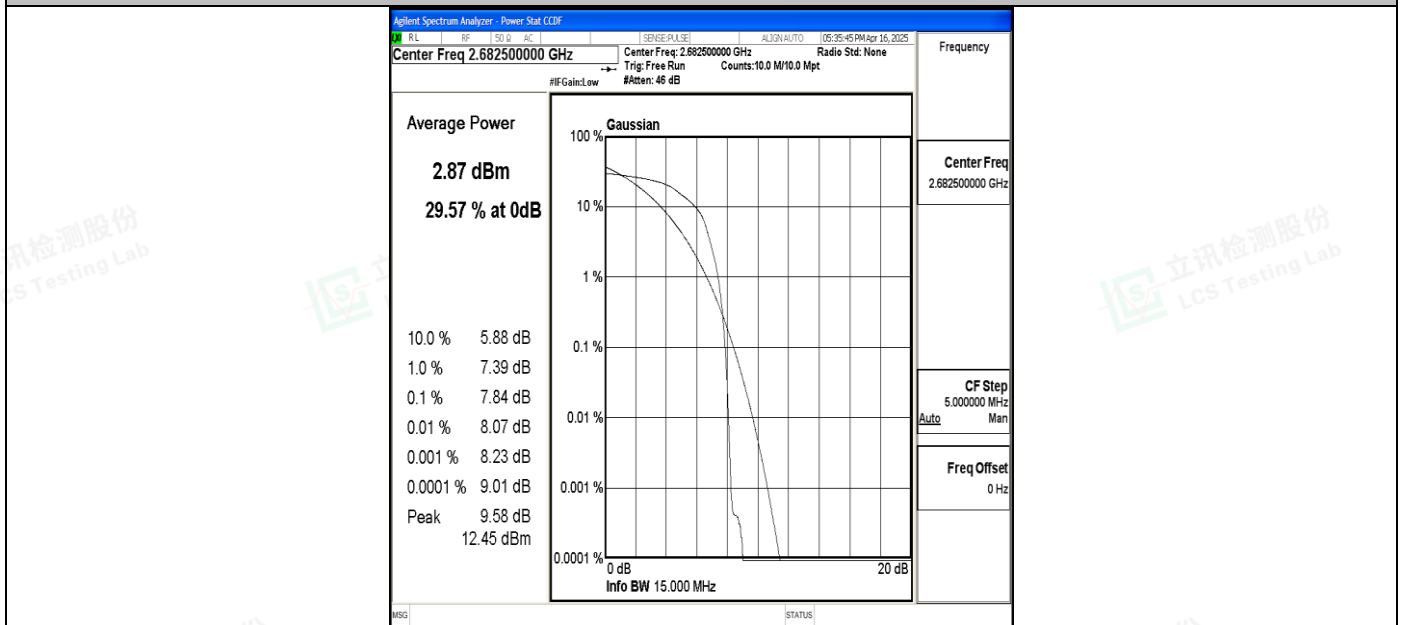


Band41-15MHz-16QAM-41515-1RB#0-PASS



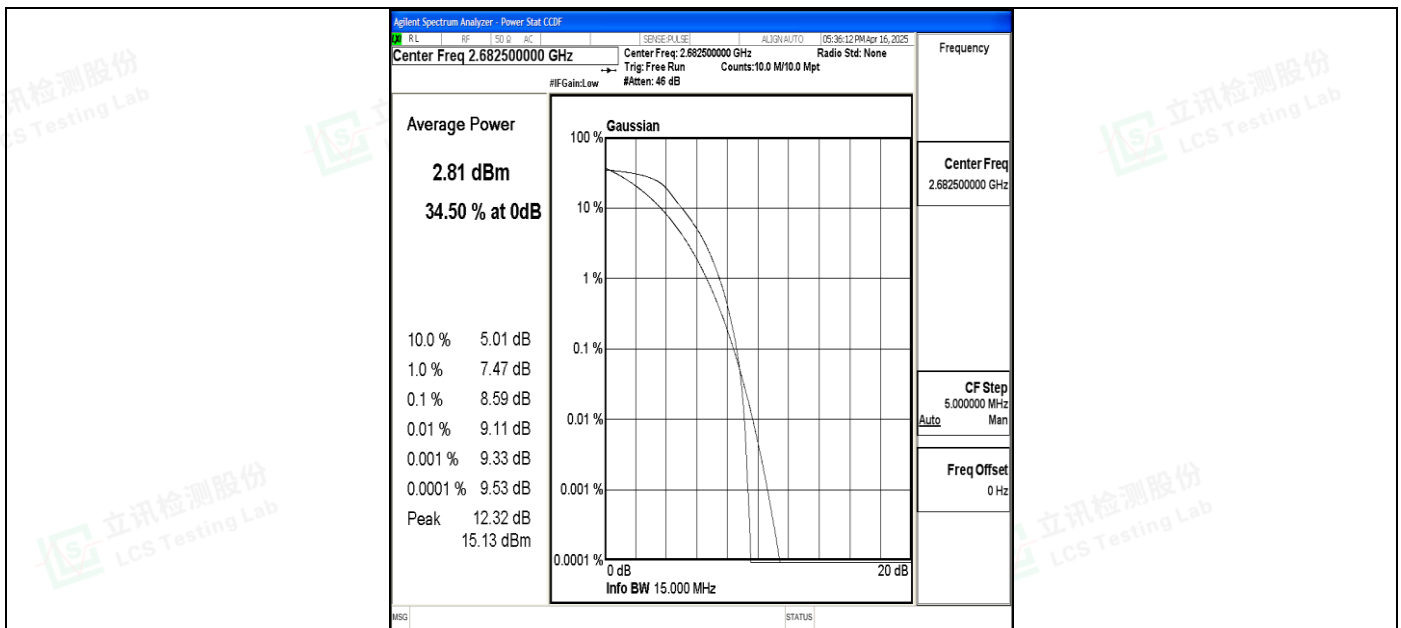


Band41-15MHz-QPSK-41515-75RB#0-PASS

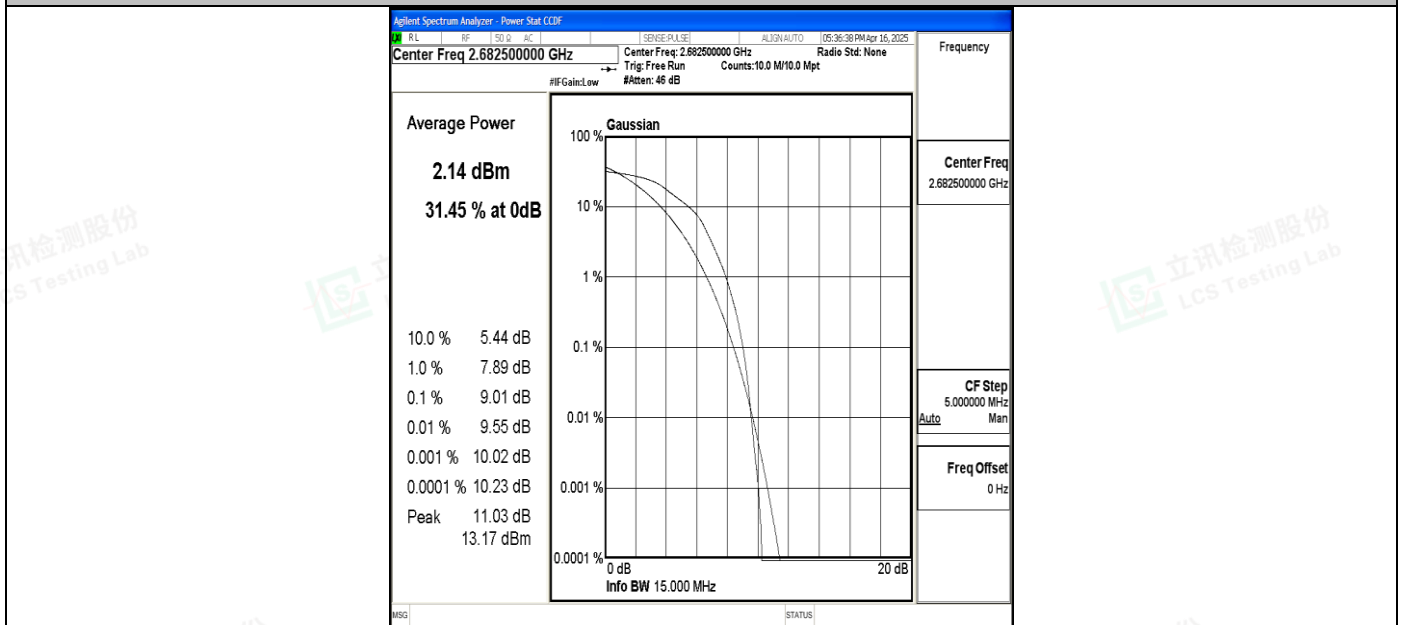


Band41-15MHz-16QAM-41515-75RB#0-PASS



Shenzhen LCS Compliance Testing Laboratory Ltd.
Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street,
Baoan District, Shenzhen, 518000, China
Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com
Scan code to check authenticity

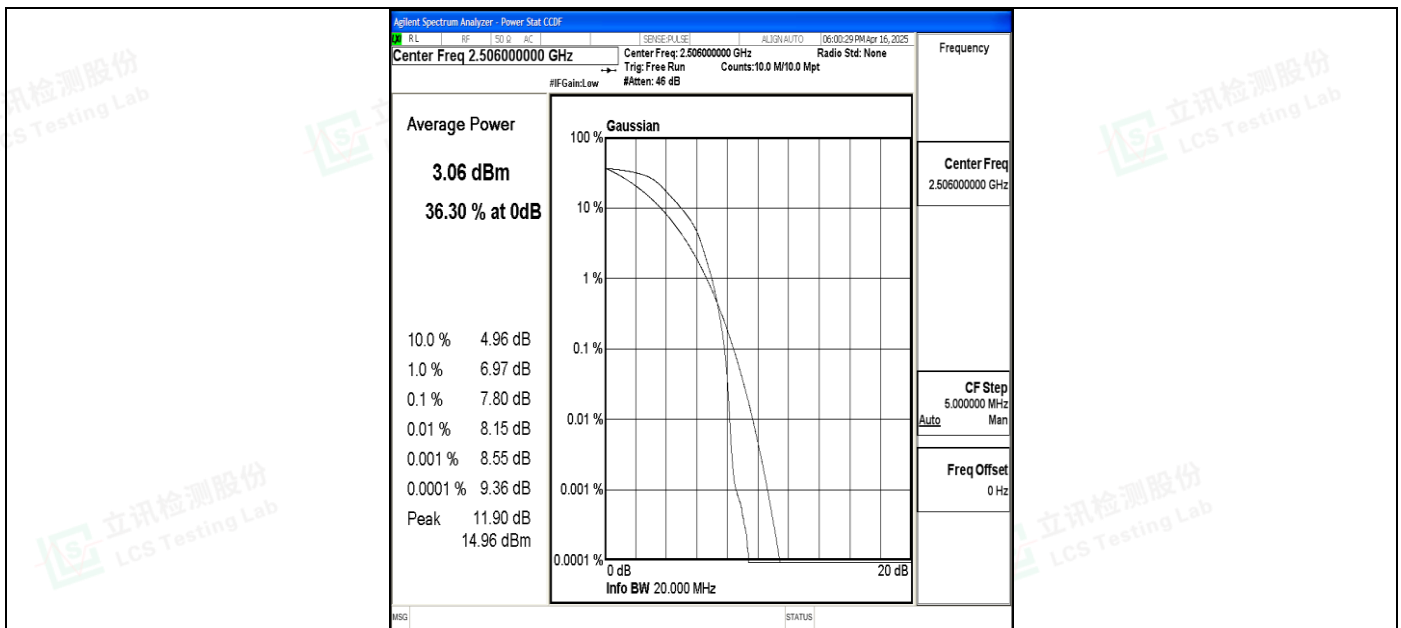


Band41-20MHz-QPSK-39750-1RB#0-PASS

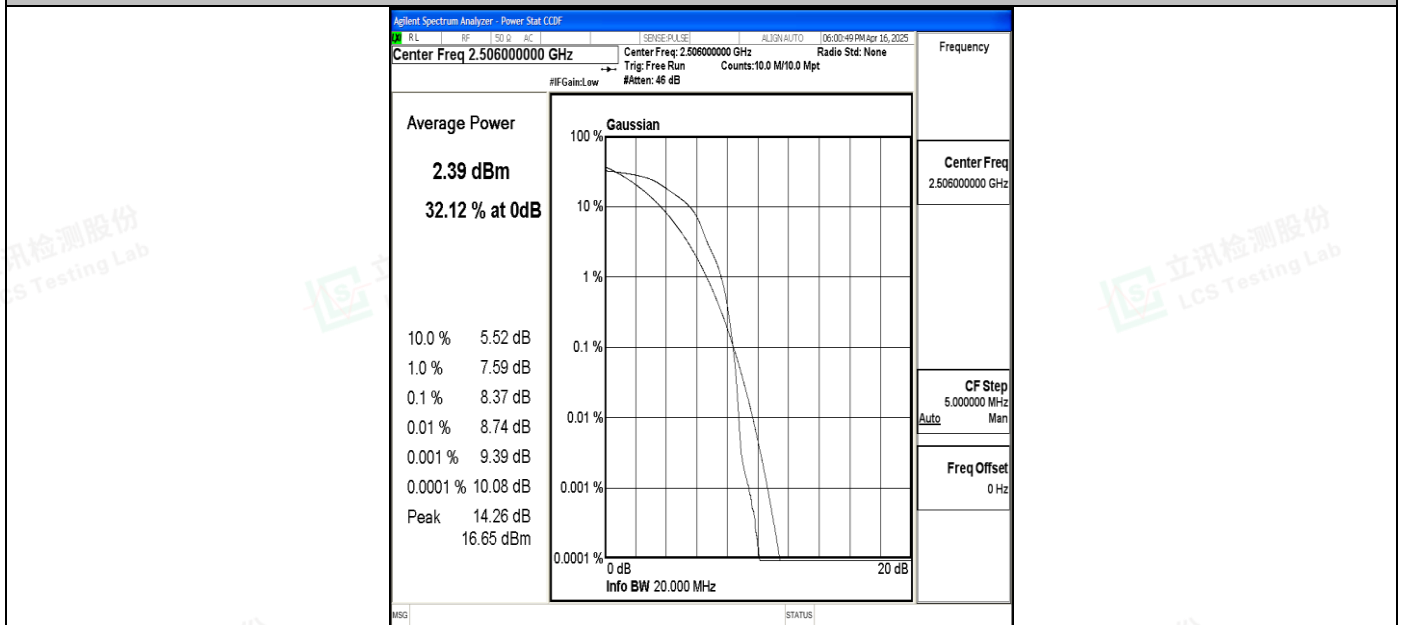


Band41-20MHz-16QAM-39750-1RB#0-PASS



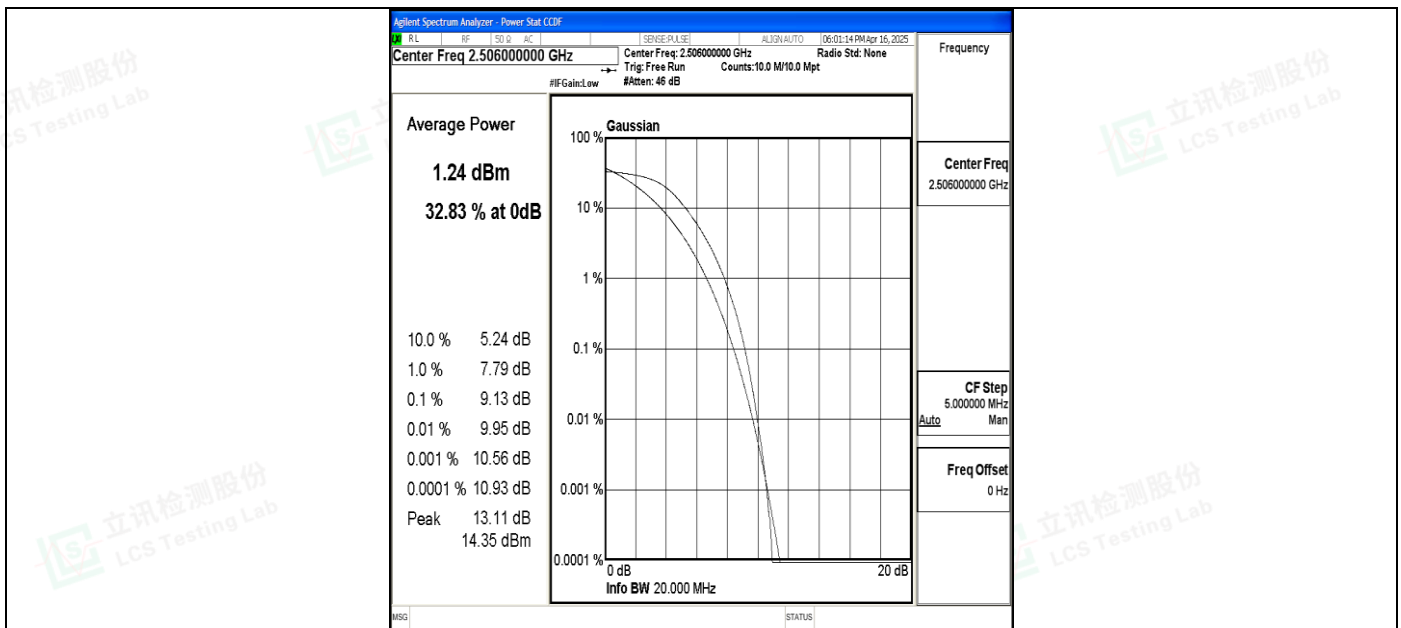


Band41-20MHz-QPSK-39750-100RB#0-PASS

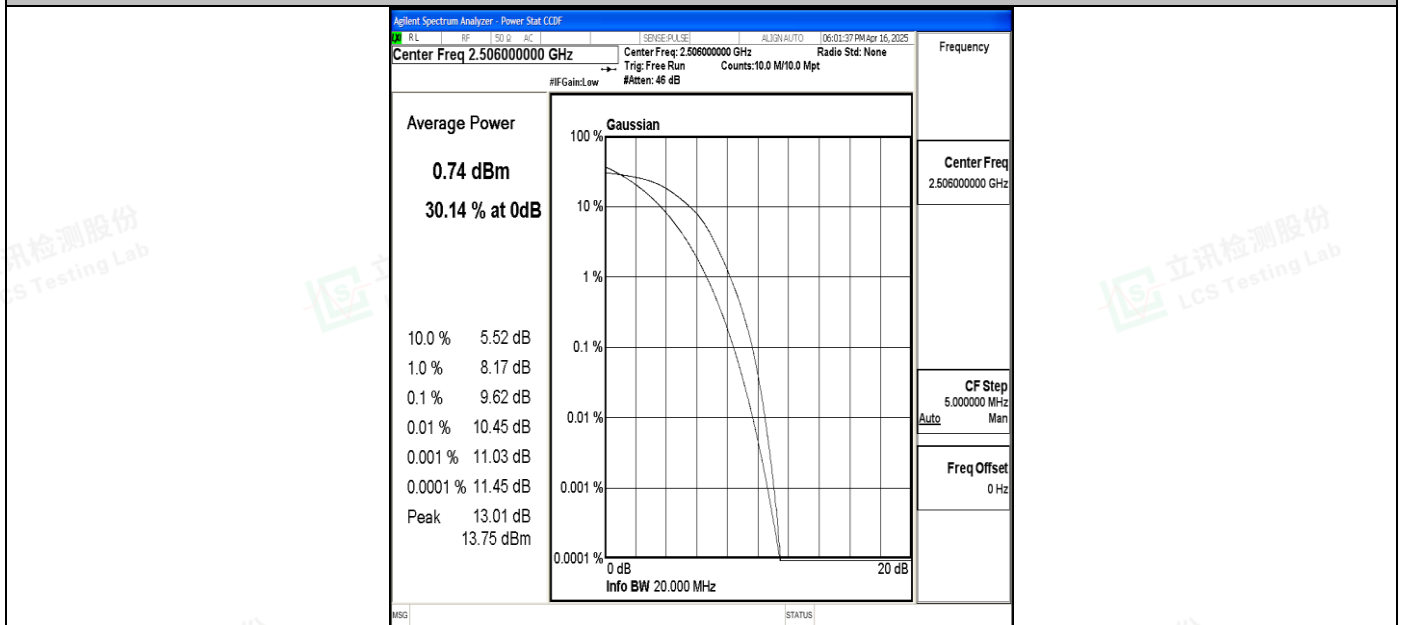


Band41-20MHz-16QAM-39750-100RB#0-PASS



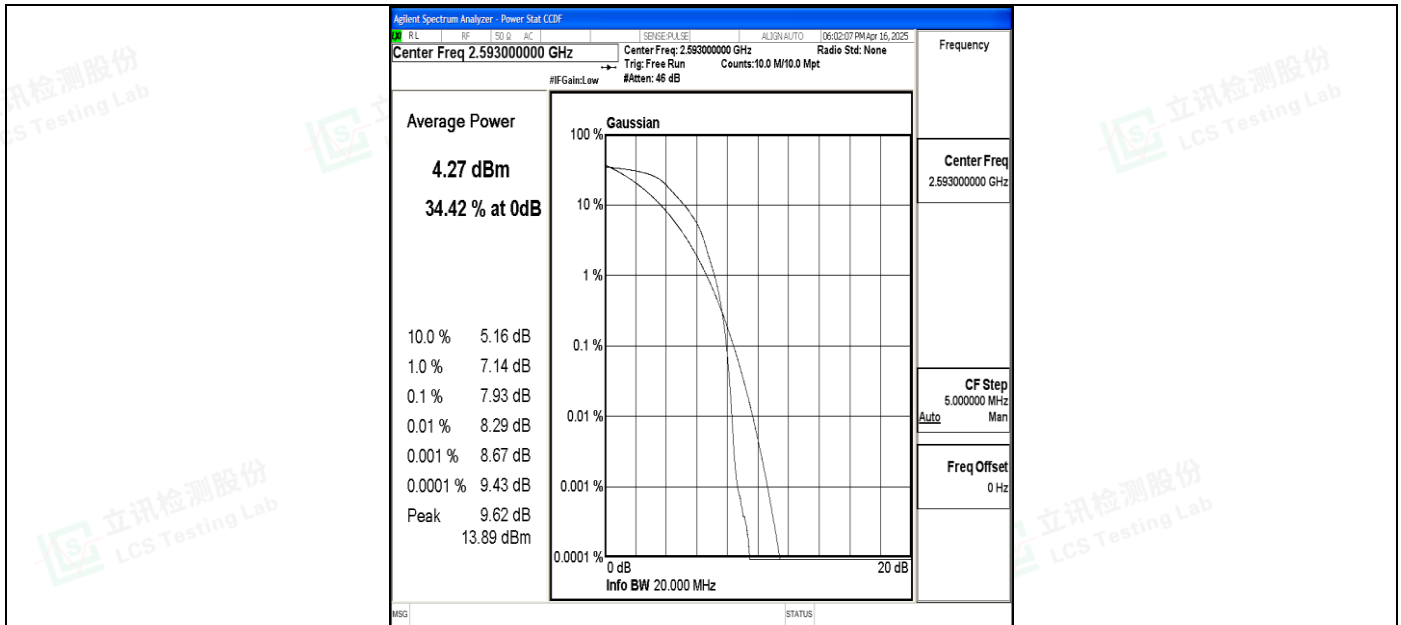


Band41-20MHz-QPSK-40620-1RB#0-PASS

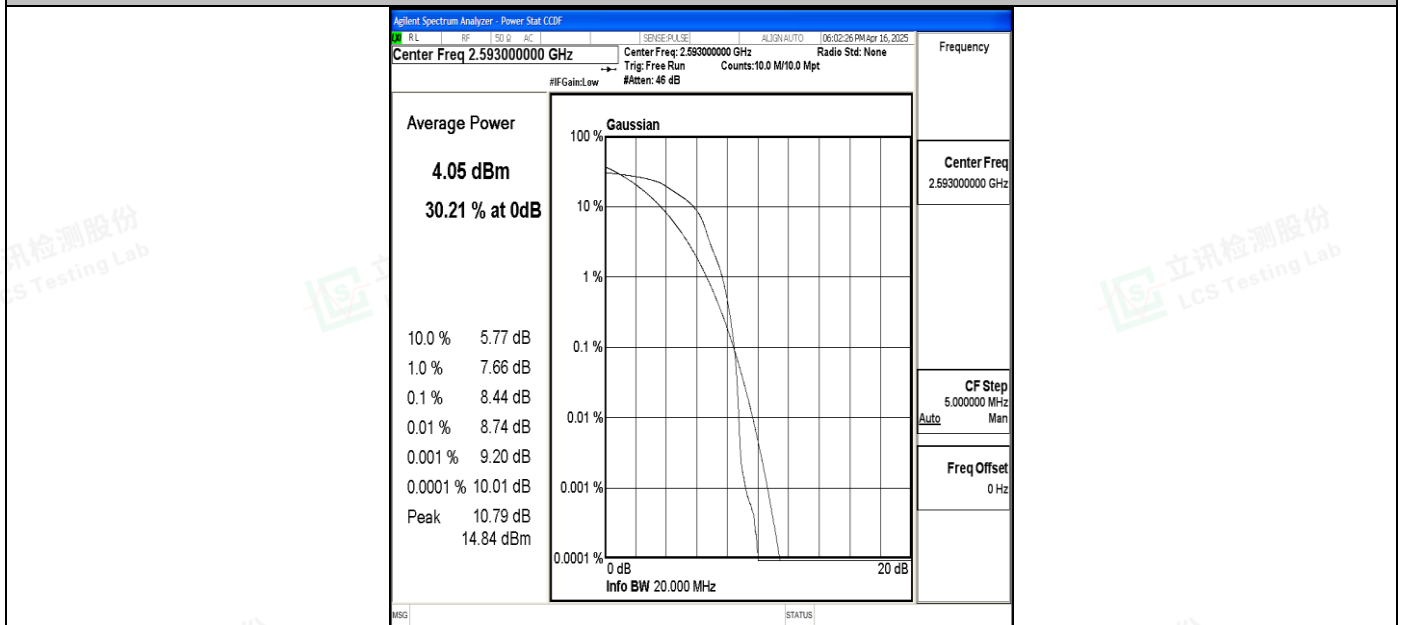


Band41-20MHz-16QAM-40620-1RB#0-PASS



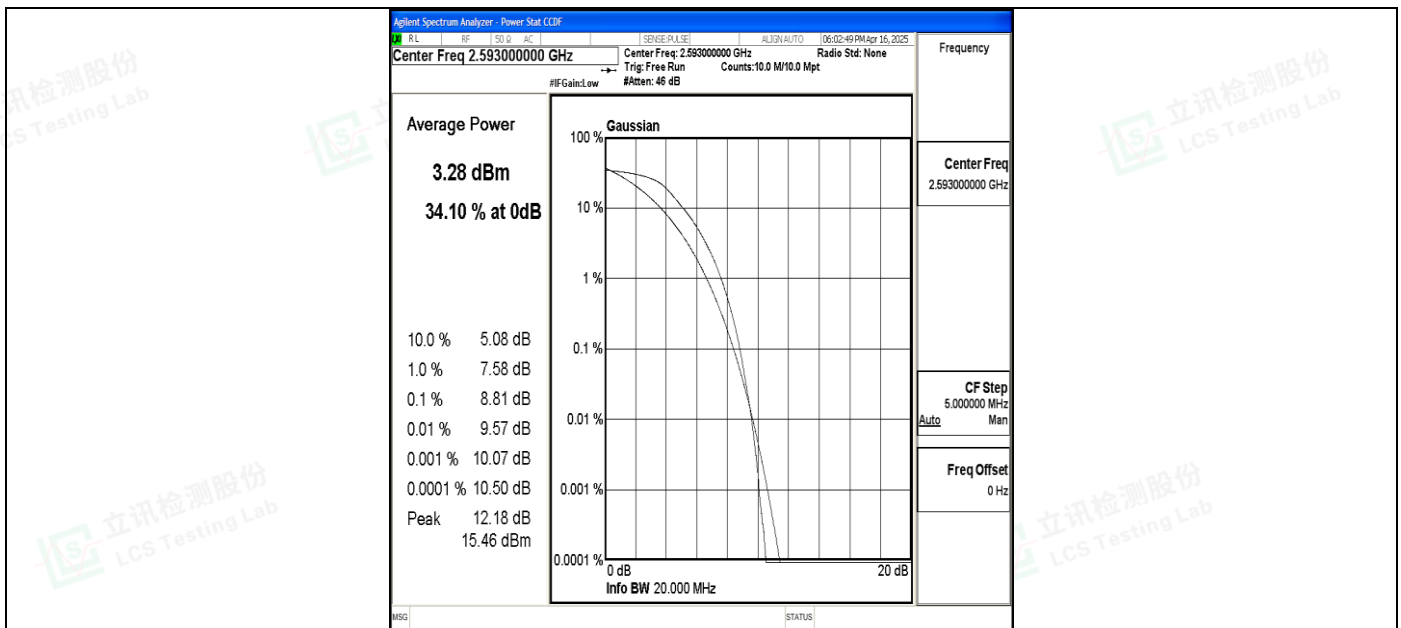


Band41-20MHz-QPSK-40620-100RB#0-PASS

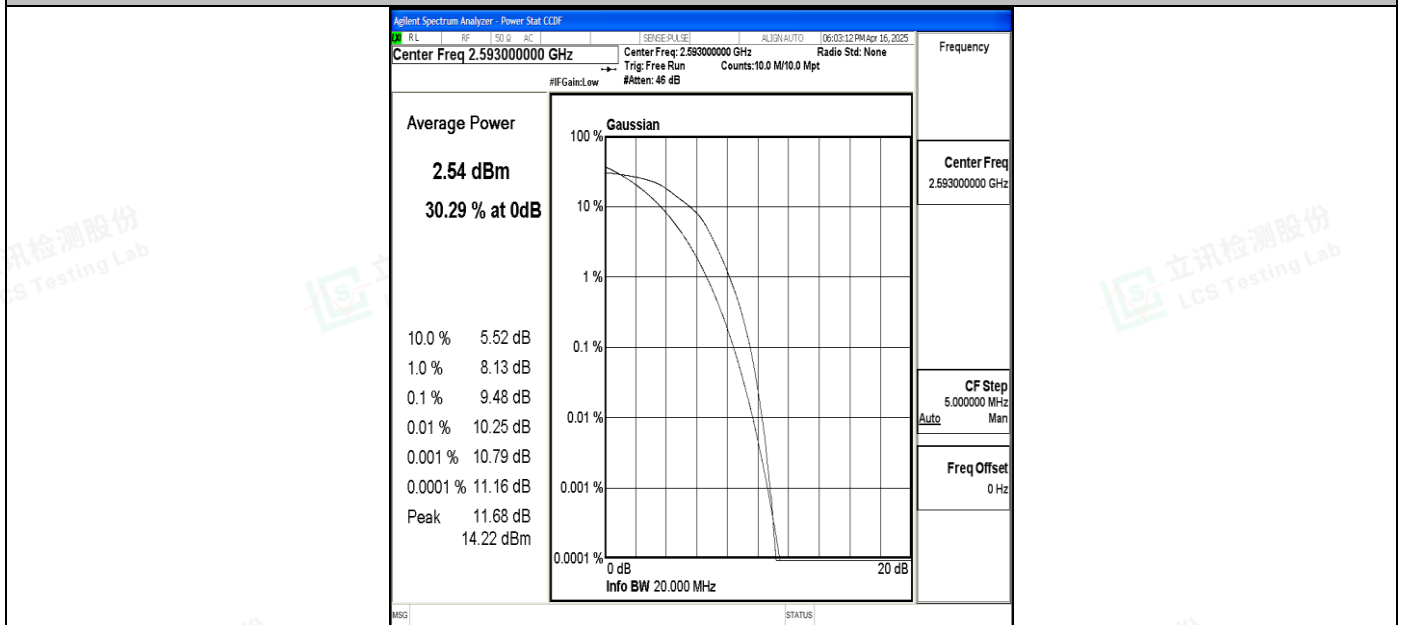


Band41-20MHz-16QAM-40620-100RB#0-PASS



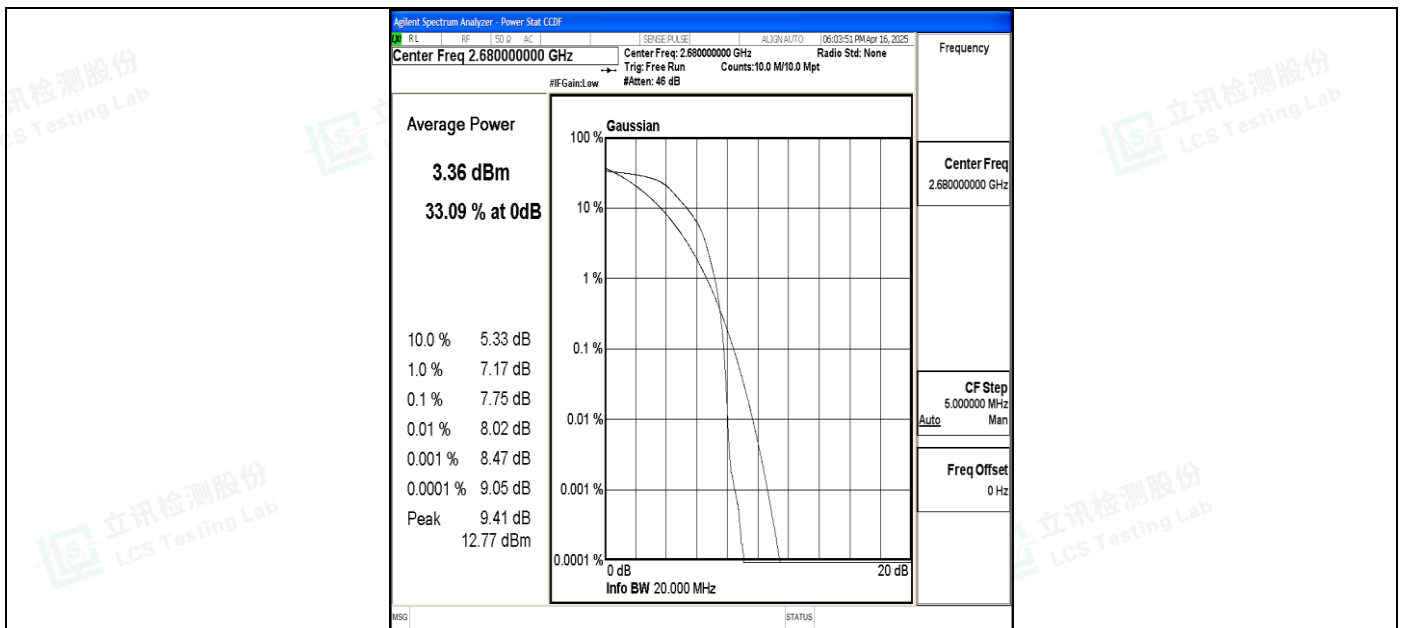


Band41-20MHz-QPSK-41490-1RB#0-PASS

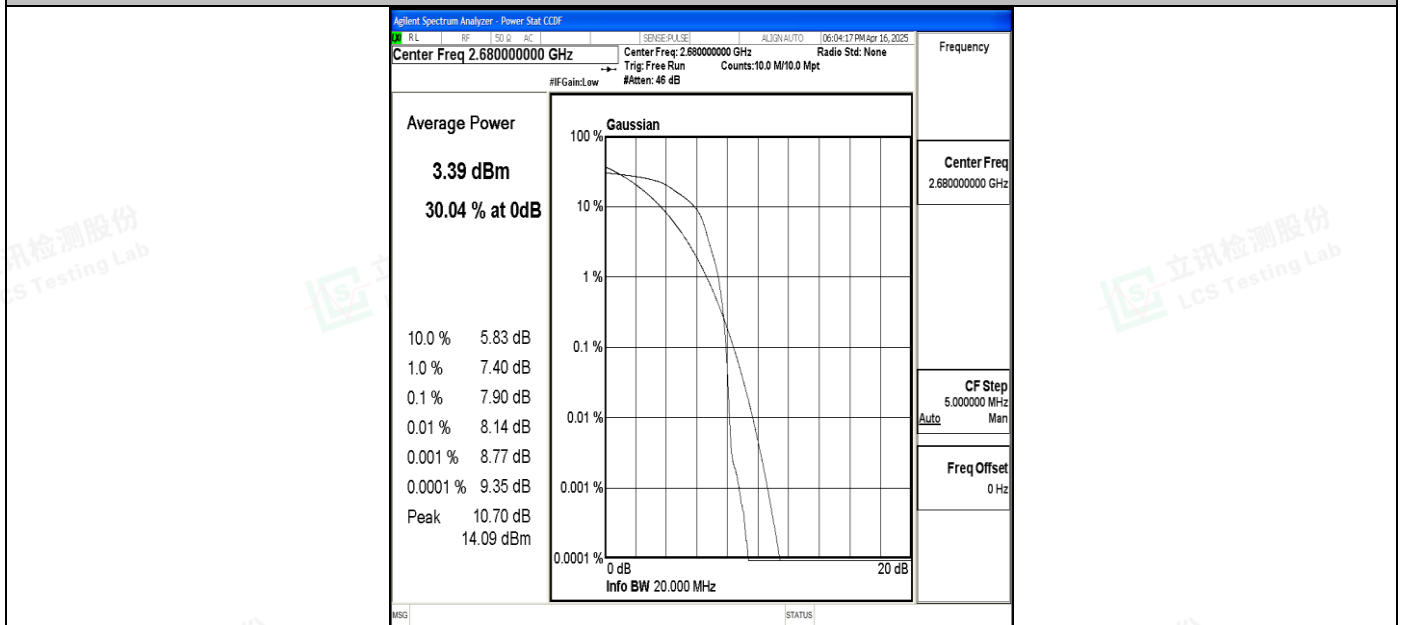


Band41-20MHz-16QAM-41490-1RB#0-PASS



Shenzhen LCS Compliance Testing Laboratory Ltd.
Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street,
Baoan District, Shenzhen, 518000, China
Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com
Scan code to check authenticity

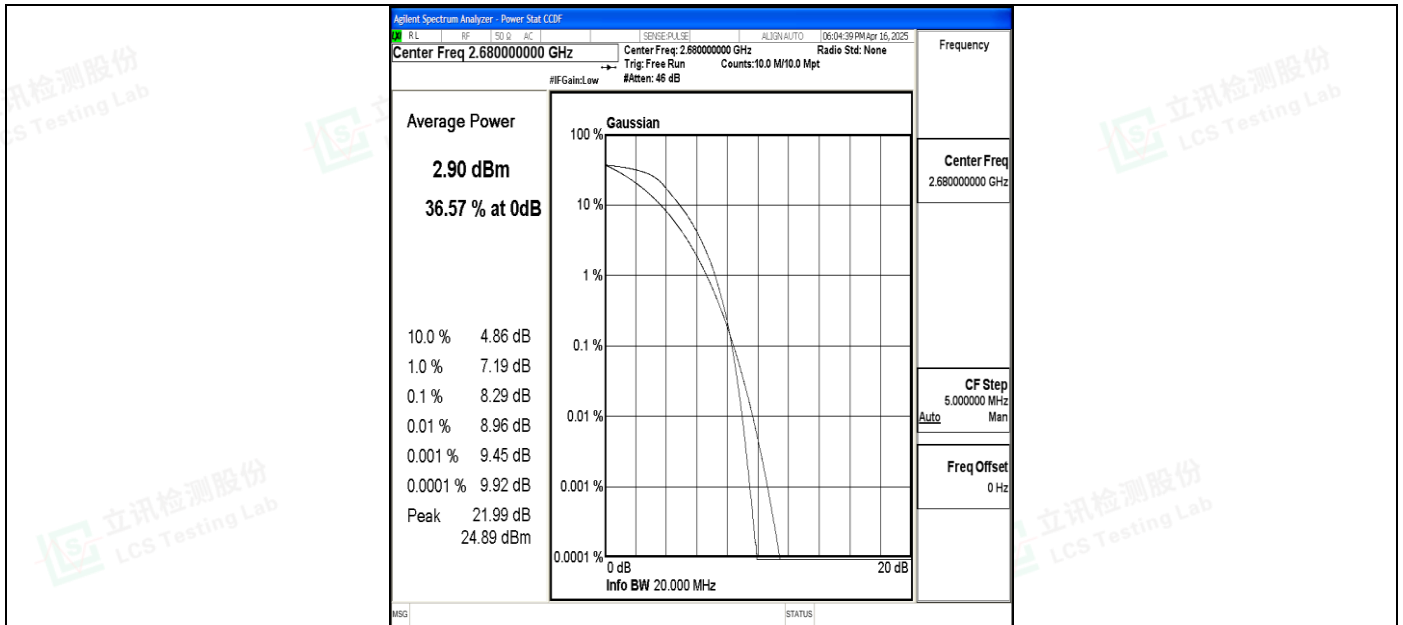

Band41-20MHz-QPSK-41490-100RB#0-PASS

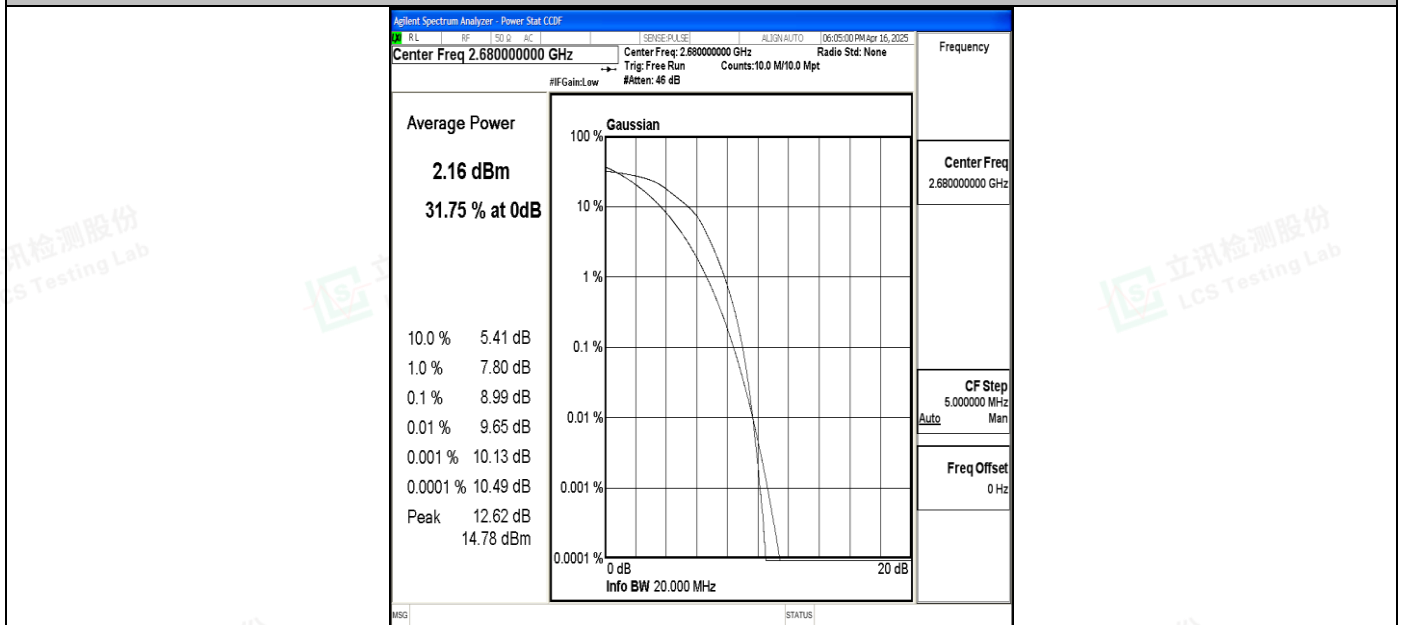

Band41-20MHz-16QAM-41490-100RB#0-PASS



Shenzhen LCS Compliance Testing Laboratory Ltd.
Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street,
Baoan District, Shenzhen, 518000, China
Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com
Scan code to check authenticity



N.3 26dB Bandwidth and Occupied Bandwidth

Test Result


Band	Bandwidth	Modulation	Channel	RB Configuration	Occupied Bandwidth (MHz)	26dB Bandwidth (MHz)	Verdict
Band41	5MHz	QPSK	39675	25RB#0	4.5159	5.283	PASS
Band41	5MHz	16QAM	39675	25RB#0	4.5070	5.404	PASS
Band41	5MHz	QPSK	40620	25RB#0	4.5176	5.223	PASS
Band41	5MHz	16QAM	40620	25RB#0	4.5133	5.722	PASS
Band41	5MHz	QPSK	41565	25RB#0	4.5028	5.033	PASS
Band41	5MHz	16QAM	41565	25RB#0	4.5078	5.234	PASS
Band41	10MHz	QPSK	39700	50RB#0	9.0034	9.866	PASS
Band41	10MHz	16QAM	39700	50RB#0	8.9848	10.05	PASS
Band41	10MHz	QPSK	40620	50RB#0	9.0054	9.979	PASS
Band41	10MHz	16QAM	40620	50RB#0	8.9914	9.934	PASS
Band41	10MHz	QPSK	41540	50RB#0	9.0124	9.924	PASS
Band41	10MHz	16QAM	41540	50RB#0	9.0190	11.88	PASS
Band41	15MHz	QPSK	39725	75RB#0	13.524	15.64	PASS
Band41	15MHz	16QAM	39725	75RB#0	13.534	15.23	PASS
Band41	15MHz	QPSK	40620	75RB#0	13.570	16.80	PASS
Band41	15MHz	16QAM	40620	75RB#0	13.507	15.40	PASS
Band41	15MHz	QPSK	41515	75RB#0	13.569	15.58	PASS
Band41	15MHz	16QAM	41515	75RB#0	13.521	16.10	PASS
Band41	20MHz	QPSK	39750	100RB#0	18.081	19.96	PASS
Band41	20MHz	16QAM	39750	100RB#0	17.970	20.28	PASS
Band41	20MHz	QPSK	40620	100RB#0	17.938	20.06	PASS
Band41	20MHz	16QAM	40620	100RB#0	17.958	20.27	PASS
Band41	20MHz	QPSK	41490	100RB#0	18.055	19.63	PASS
Band41	20MHz	16QAM	41490	100RB#0	18.051	21.76	PASS




Shenzhen LCS Compliance Testing Laboratory Ltd.
Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street,
Baoan District, Shenzhen, 518000, China
Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com
Scan code to check authenticity




Test Graphs

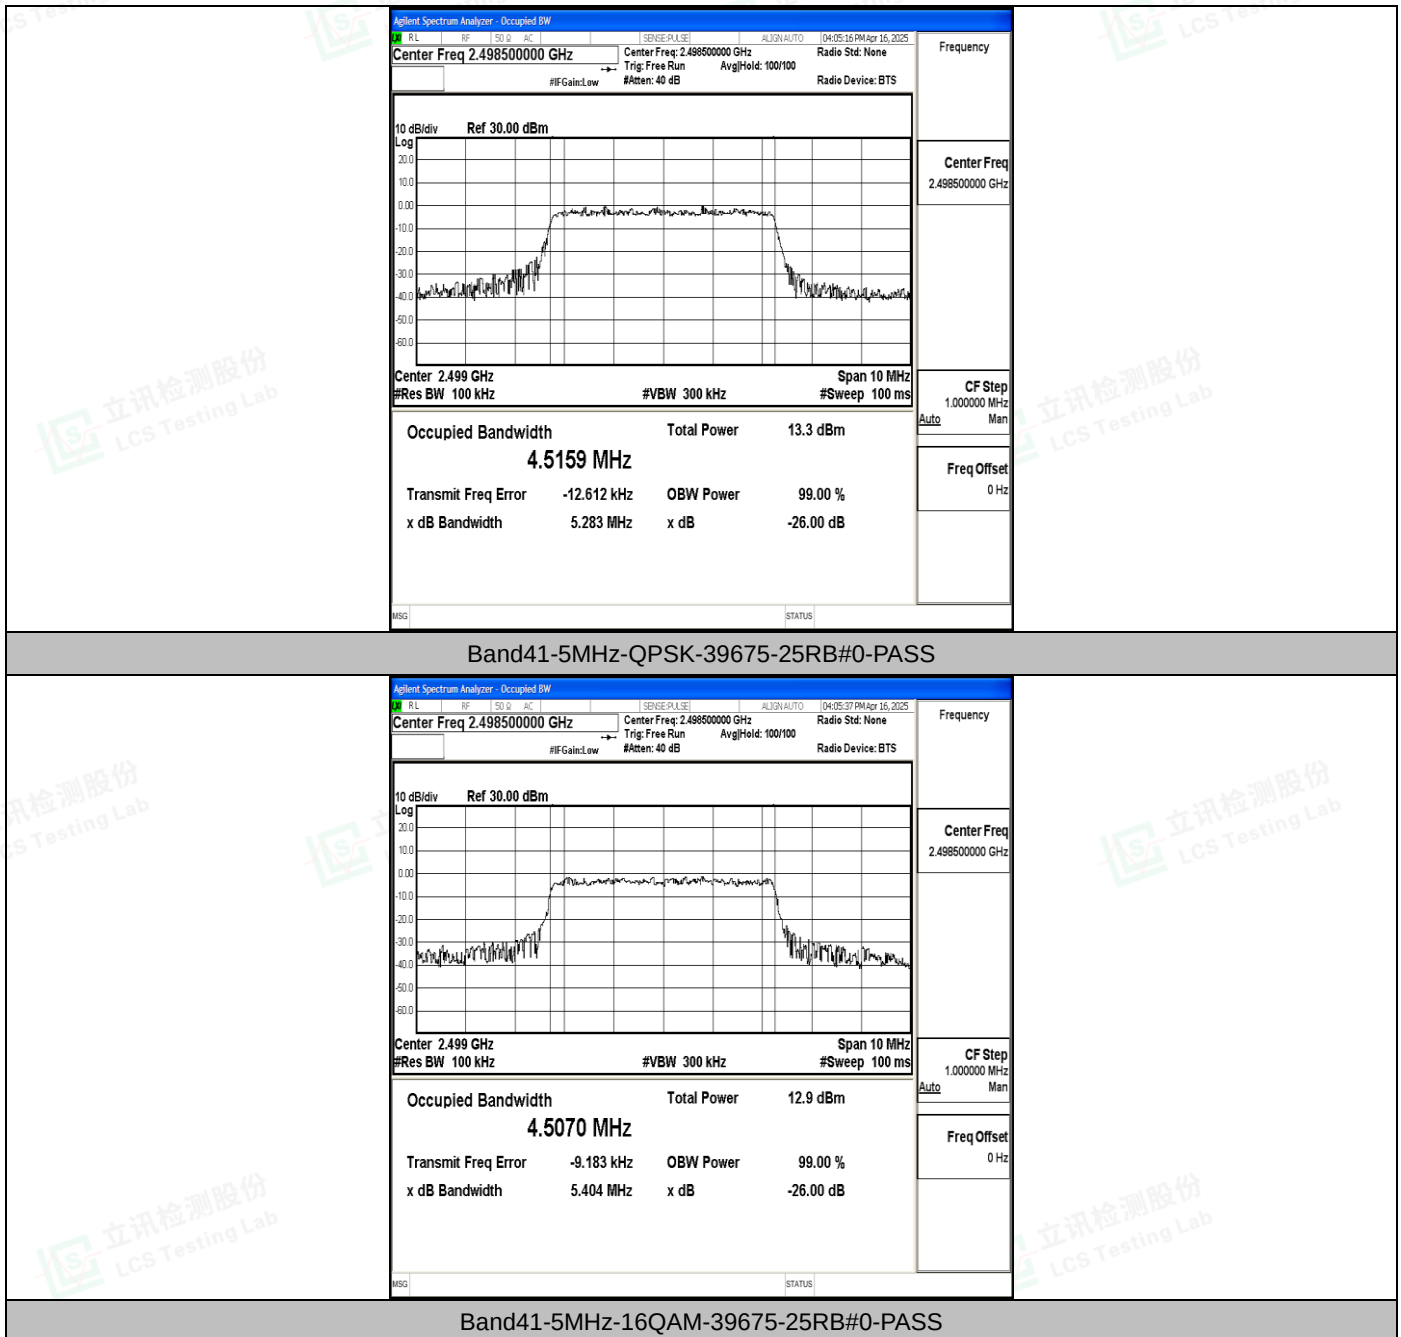

Shenzhen LCS Compliance Testing Laboratory Ltd.
Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street,
Baoan District, Shenzhen, 518000, China
Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com
Scan code to check authenticity

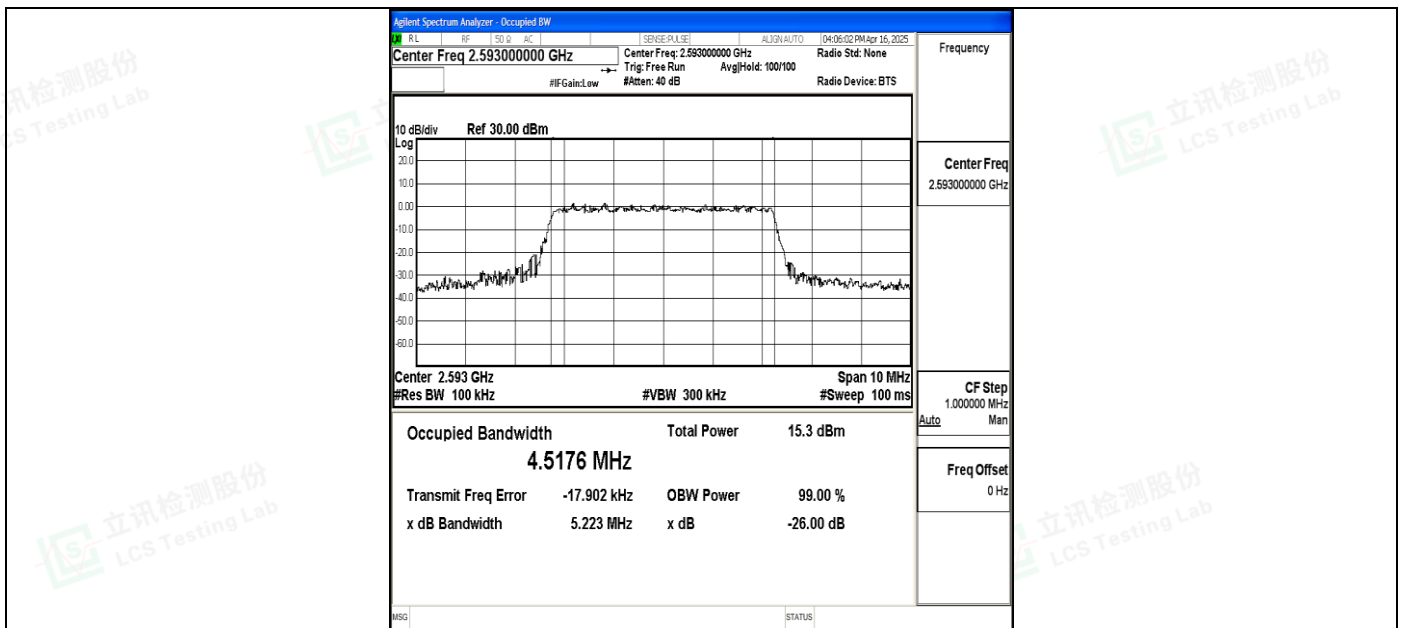


Band41-5MHz-QPSK-40620-25RB#0-PASS

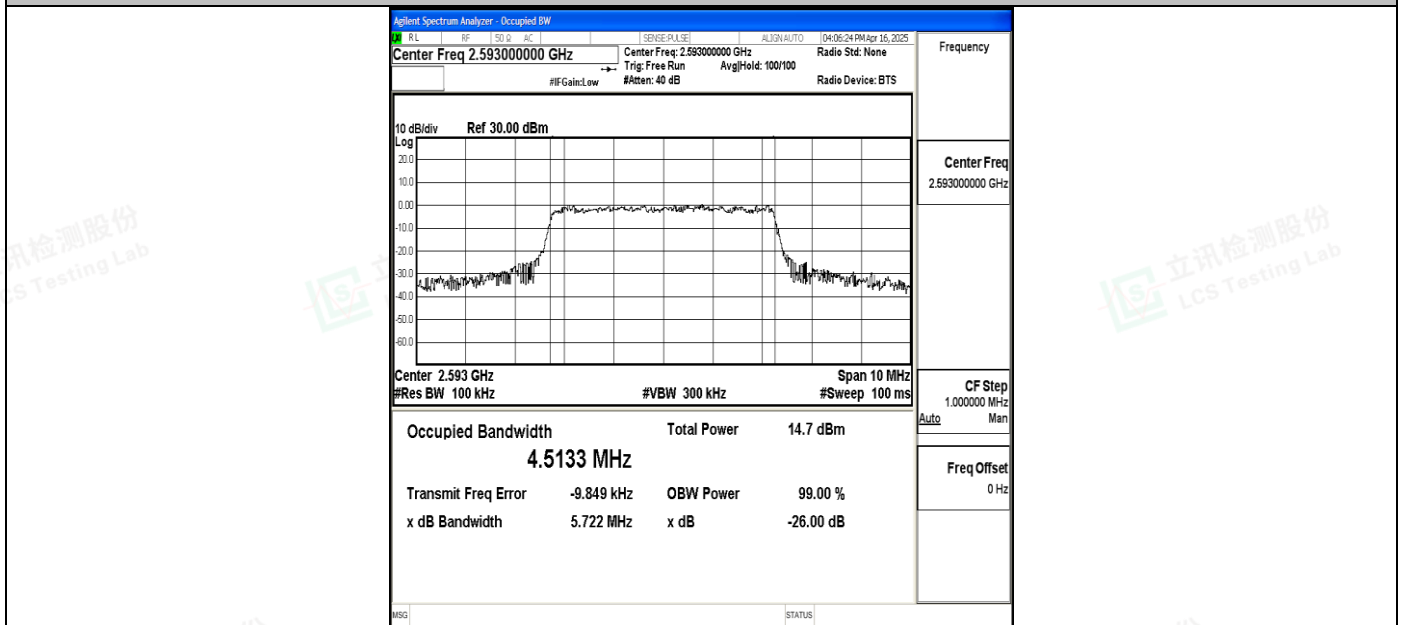


Band41-5MHz-16QAM-40620-25RB#0-PASS



Shenzhen LCS Compliance Testing Laboratory Ltd.
Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street,
Baoan District, Shenzhen, 518000, China
Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com
Scan code to check authenticity

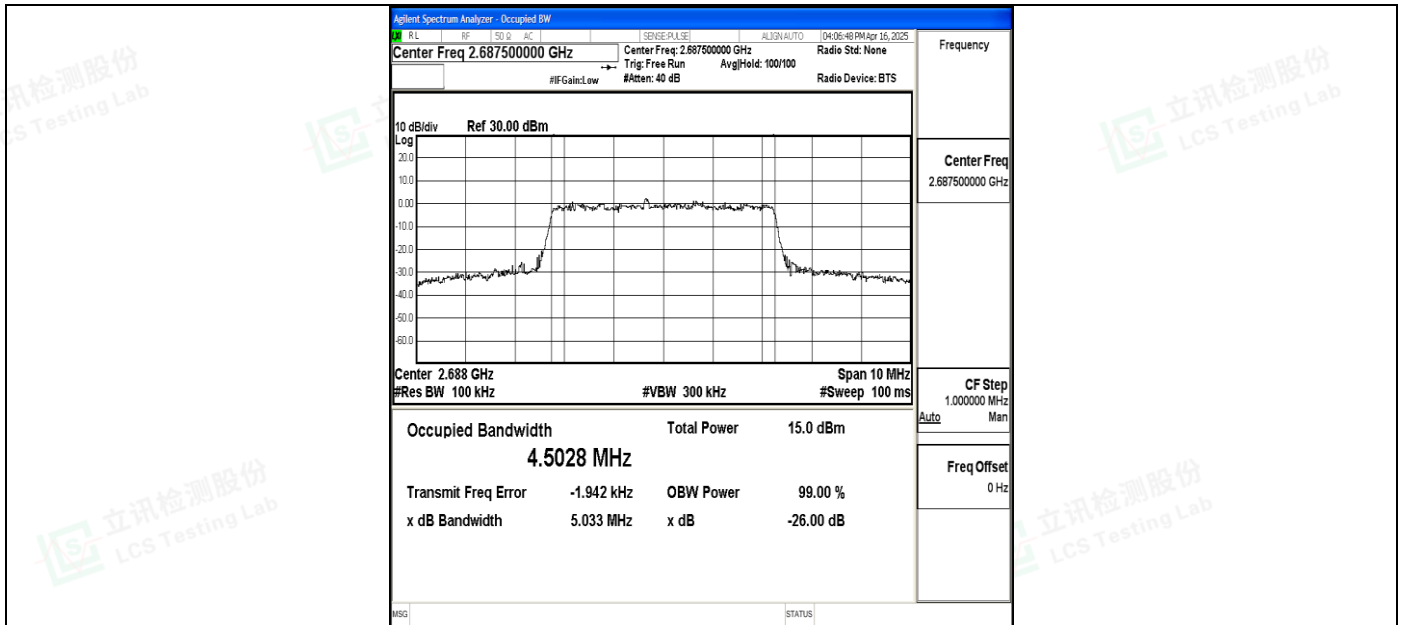


Band41-5MHz-QPSK-41565-25RB#0-PASS

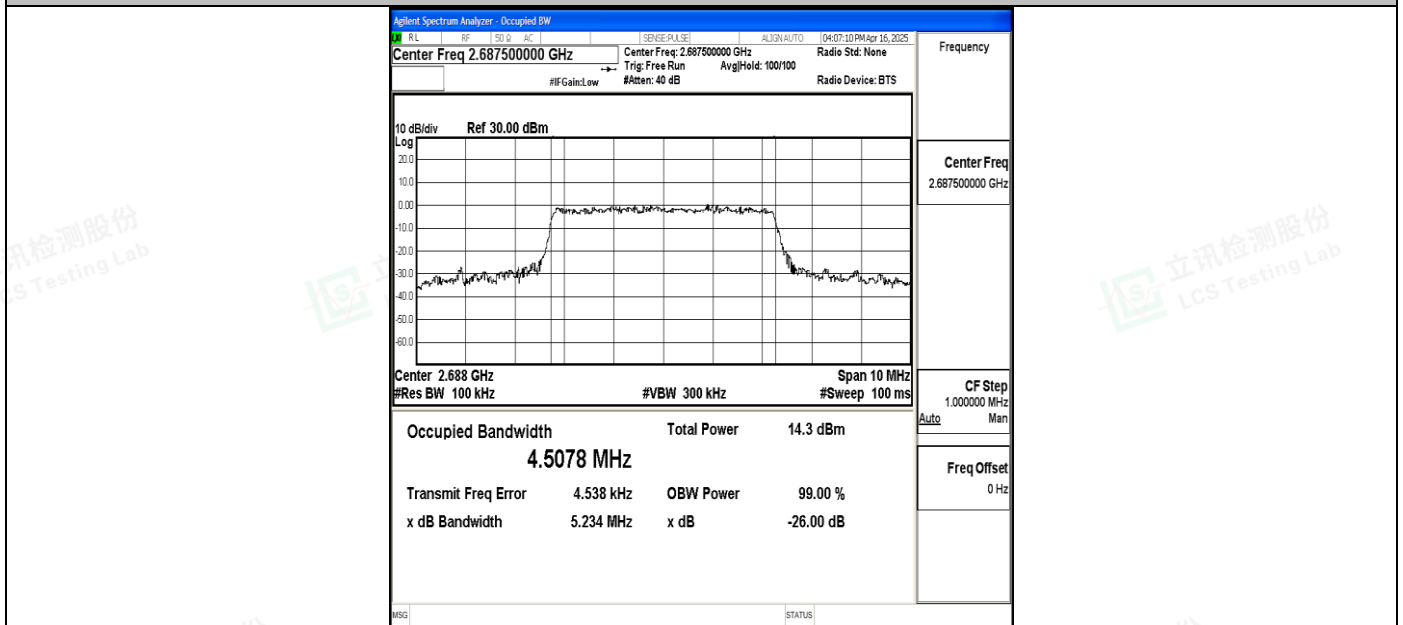


Band41-5MHz-16QAM-41565-25RB#0-PASS



Shenzhen LCS Compliance Testing Laboratory Ltd.
Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street,
Baoan District, Shenzhen, 518000, China
Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com
Scan code to check authenticity

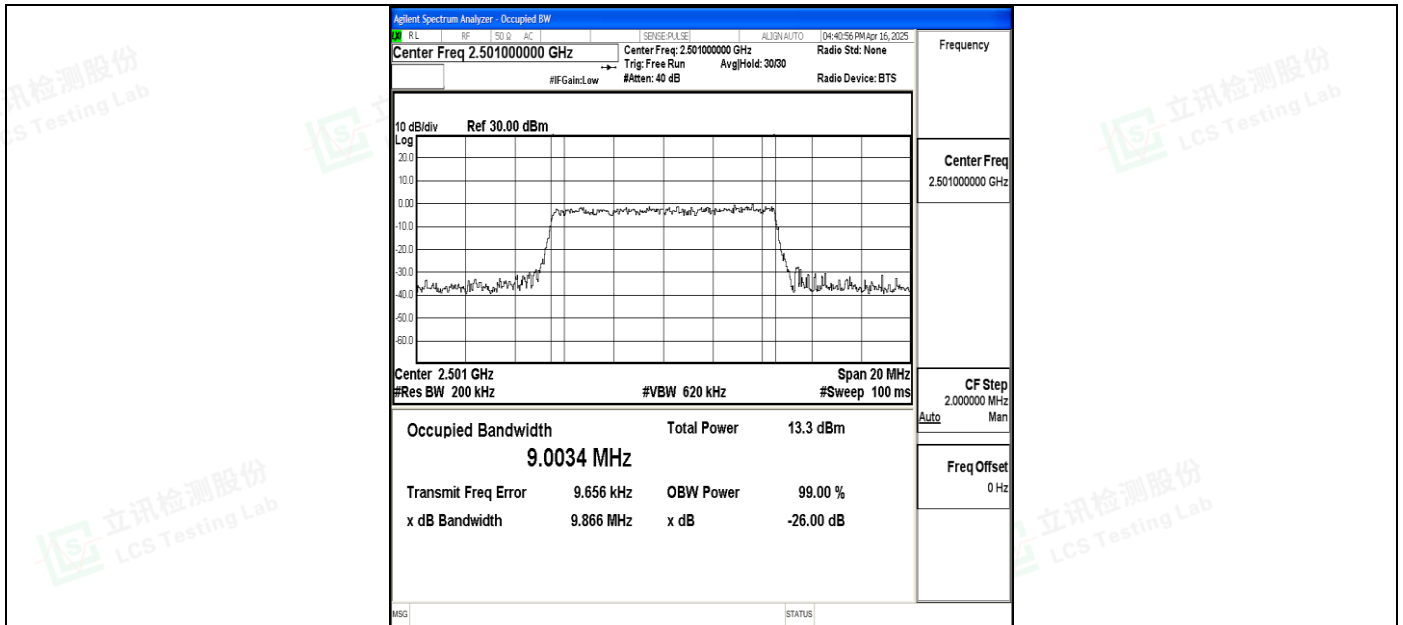


Band41-10MHz-QPSK-39700-50RB#0-PASS

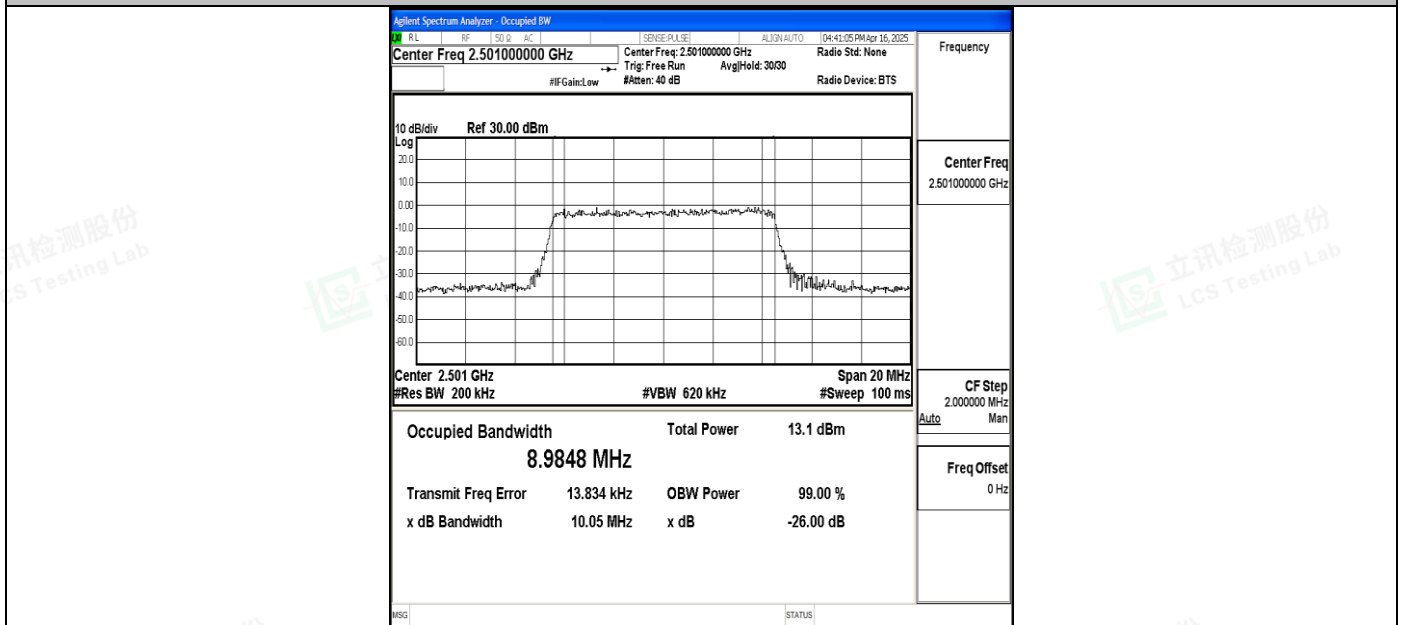


Band41-10MHz-16QAM-39700-50RB#0-PASS



Shenzhen LCS Compliance Testing Laboratory Ltd.
Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street,
Baoan District, Shenzhen, 518000, China
Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com
Scan code to check authenticity

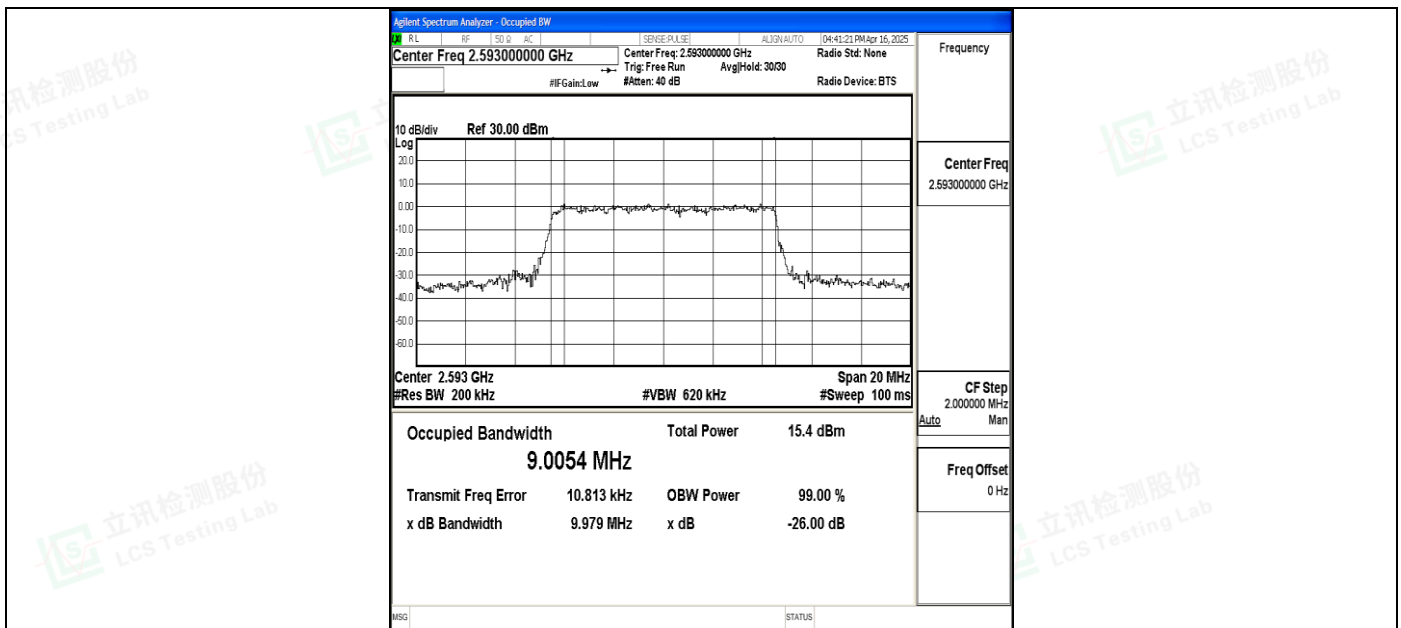


Band41-10MHz-QPSK-40620-50RB#0-PASS

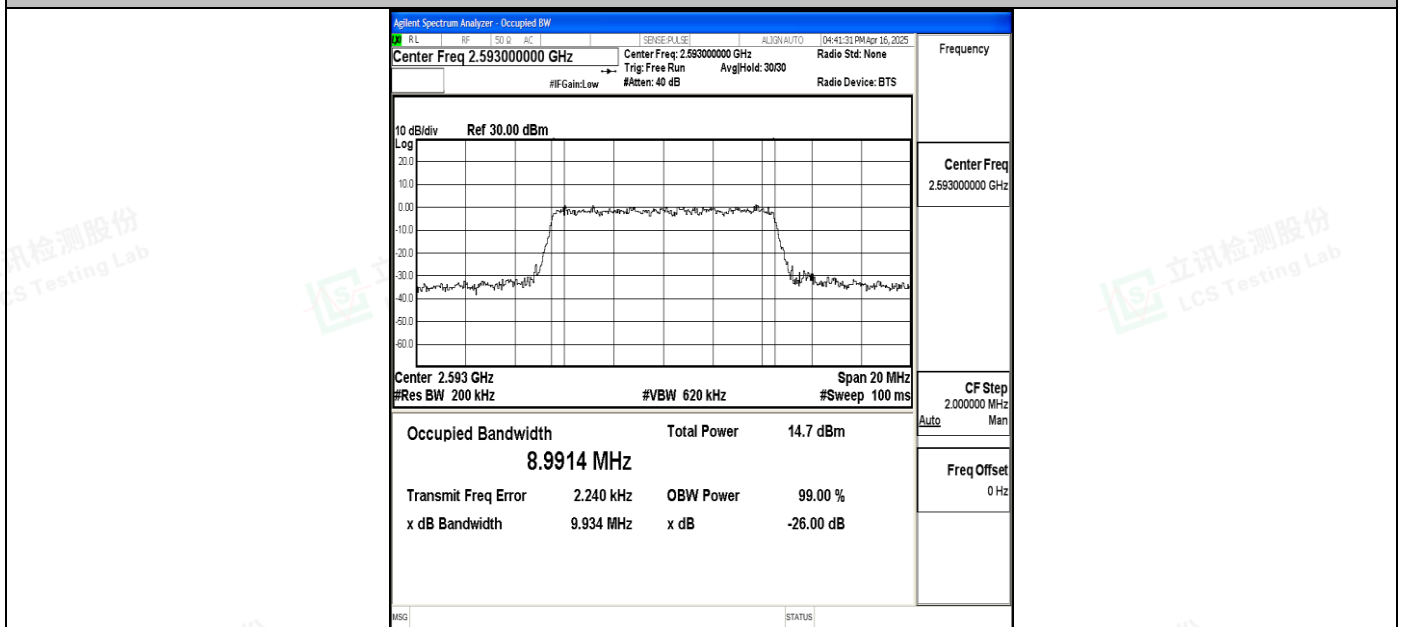


Band41-10MHz-16QAM-40620-50RB#0-PASS



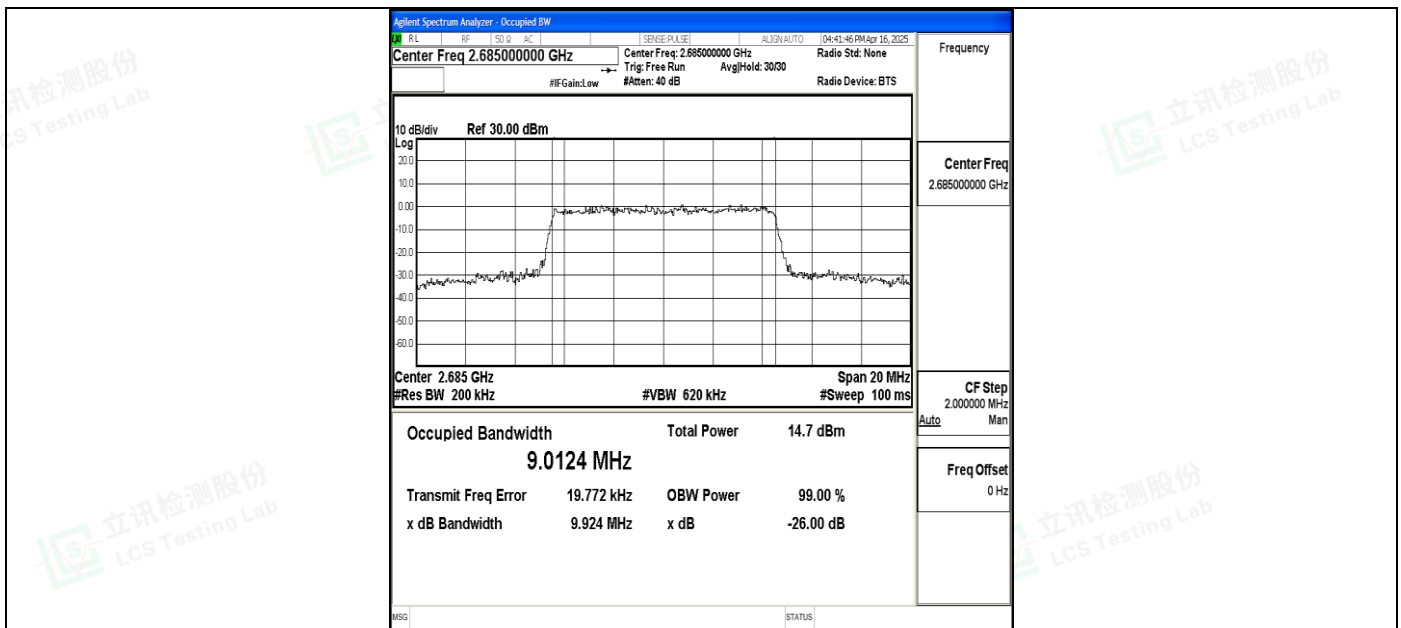


Band41-10MHz-QPSK-41540-50RB#0-PASS

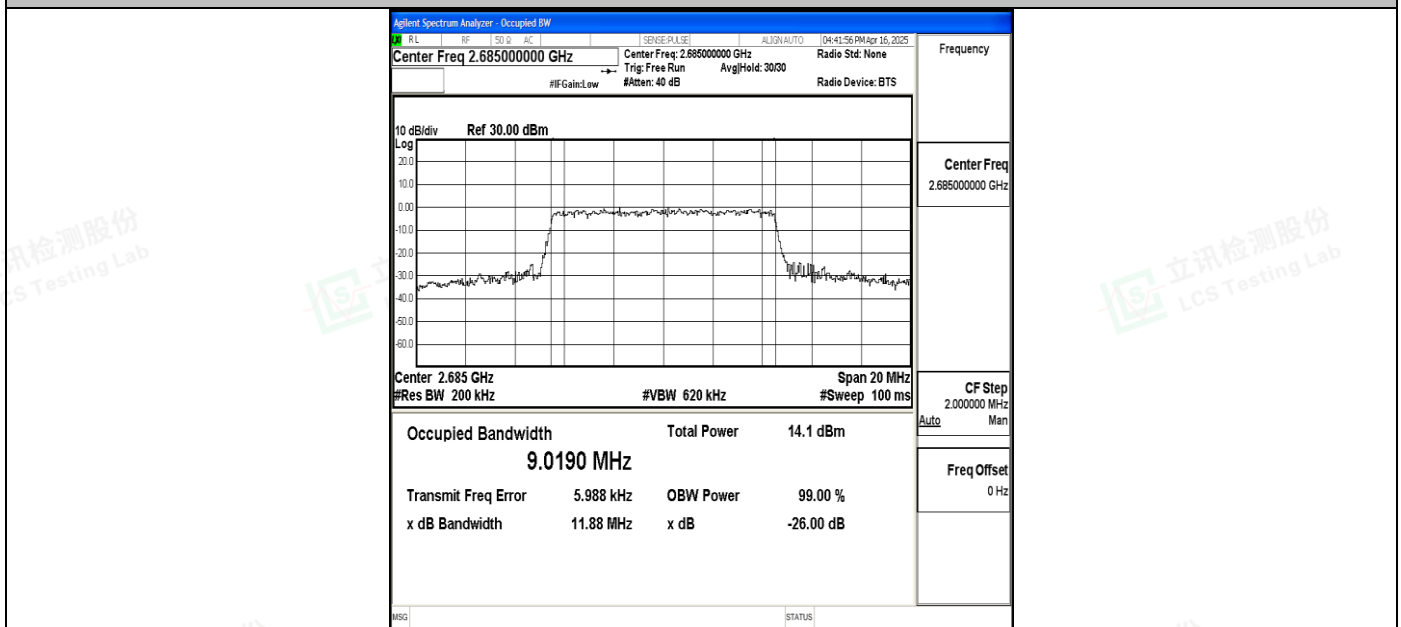


Band41-10MHz-16QAM-41540-50RB#0-PASS



Shenzhen LCS Compliance Testing Laboratory Ltd.
Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street,
Baoan District, Shenzhen, 518000, China
Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com
Scan code to check authenticity

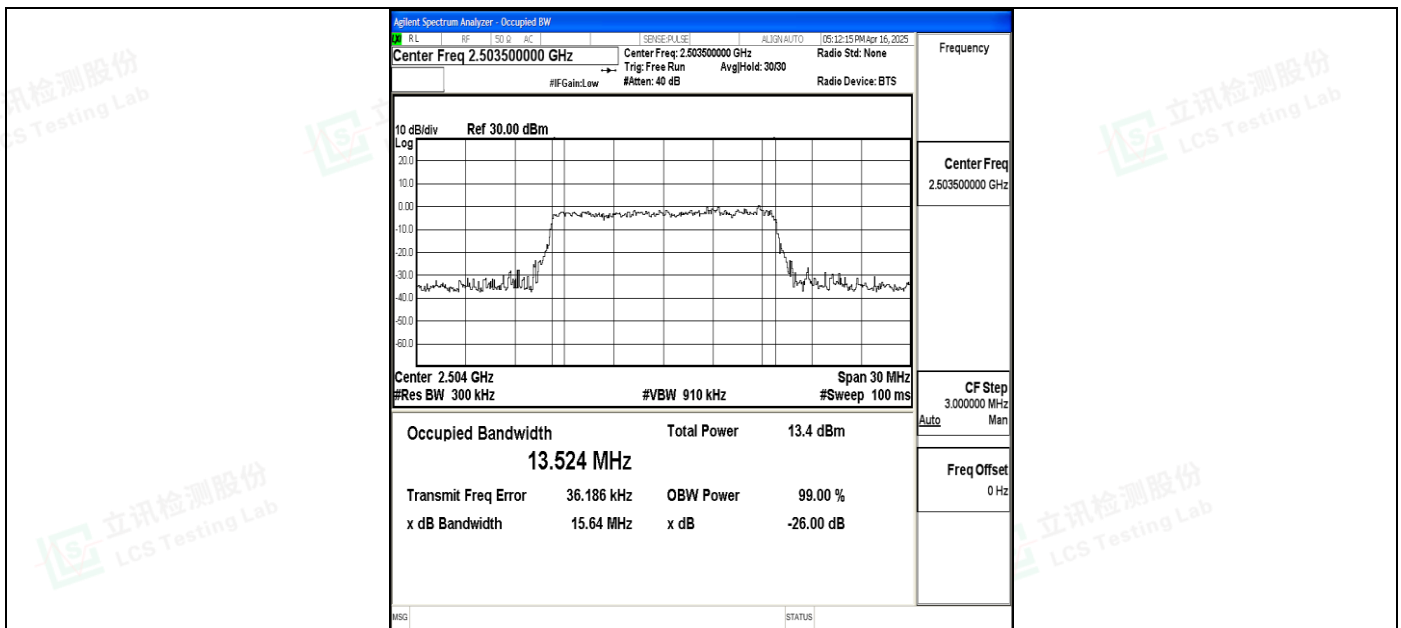


Band41-15MHz-QPSK-39725-75RB#0-PASS

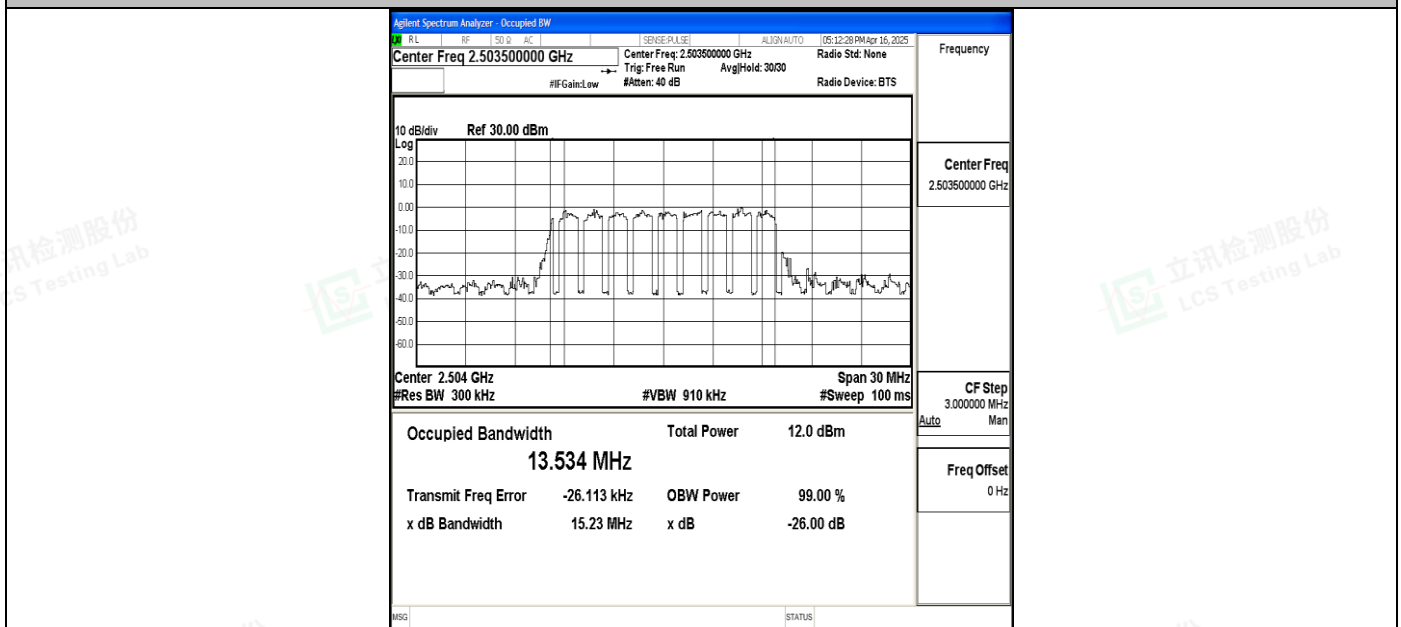


Band41-15MHz-16QAM-39725-75RB#0-PASS



Shenzhen LCS Compliance Testing Laboratory Ltd.
Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street,
Baoan District, Shenzhen, 518000, China
Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com
Scan code to check authenticity

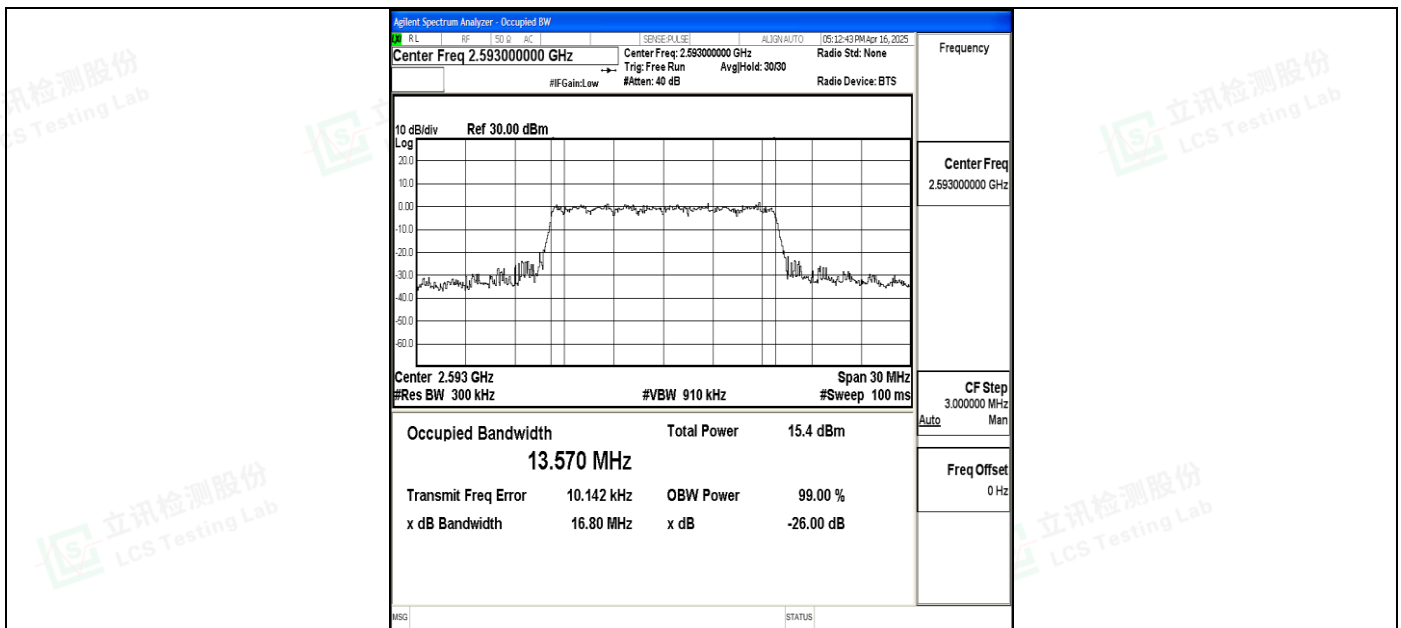


Band41-15MHz-QPSK-40620-75RB#0-PASS

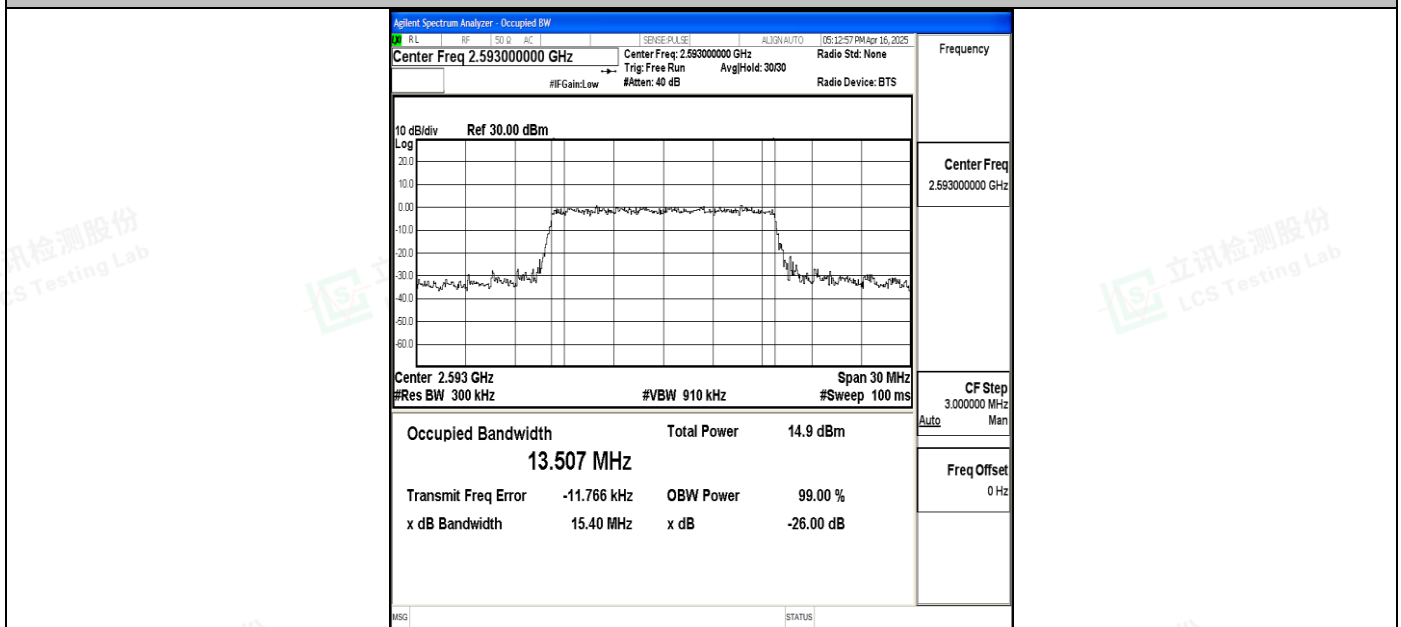


Band41-15MHz-16QAM-40620-75RB#0-PASS



Shenzhen LCS Compliance Testing Laboratory Ltd.
Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street,
Baoan District, Shenzhen, 518000, China
Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com
Scan code to check authenticity

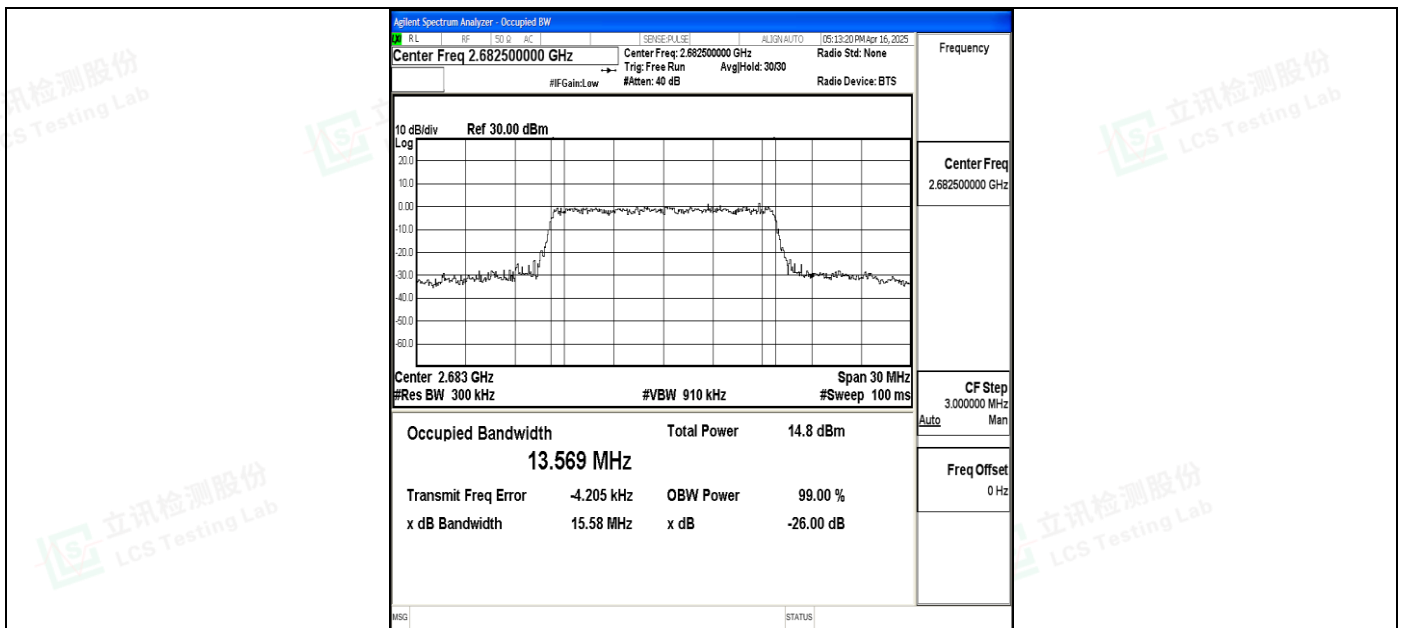


Band41-15MHz-QPSK-41515-75RB#0-PASS

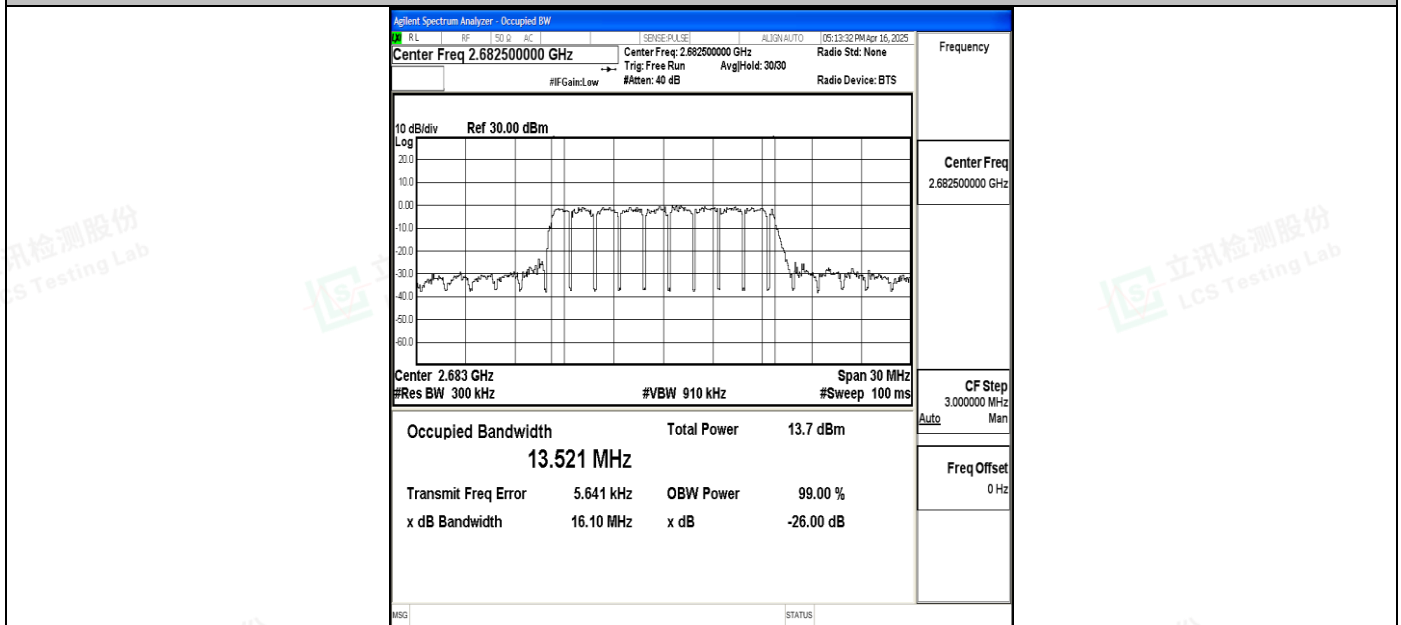


Band41-15MHz-16QAM-41515-75RB#0-PASS



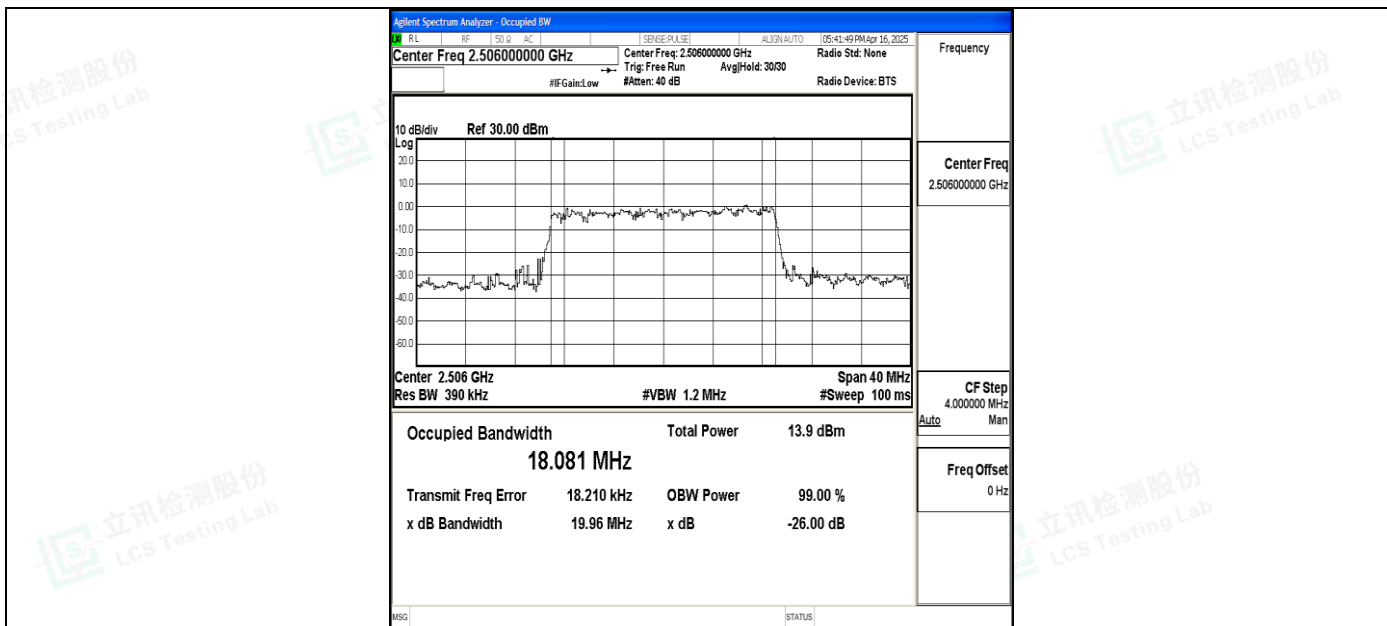


Band41-20MHz-QPSK-39750-100RB#0-PASS

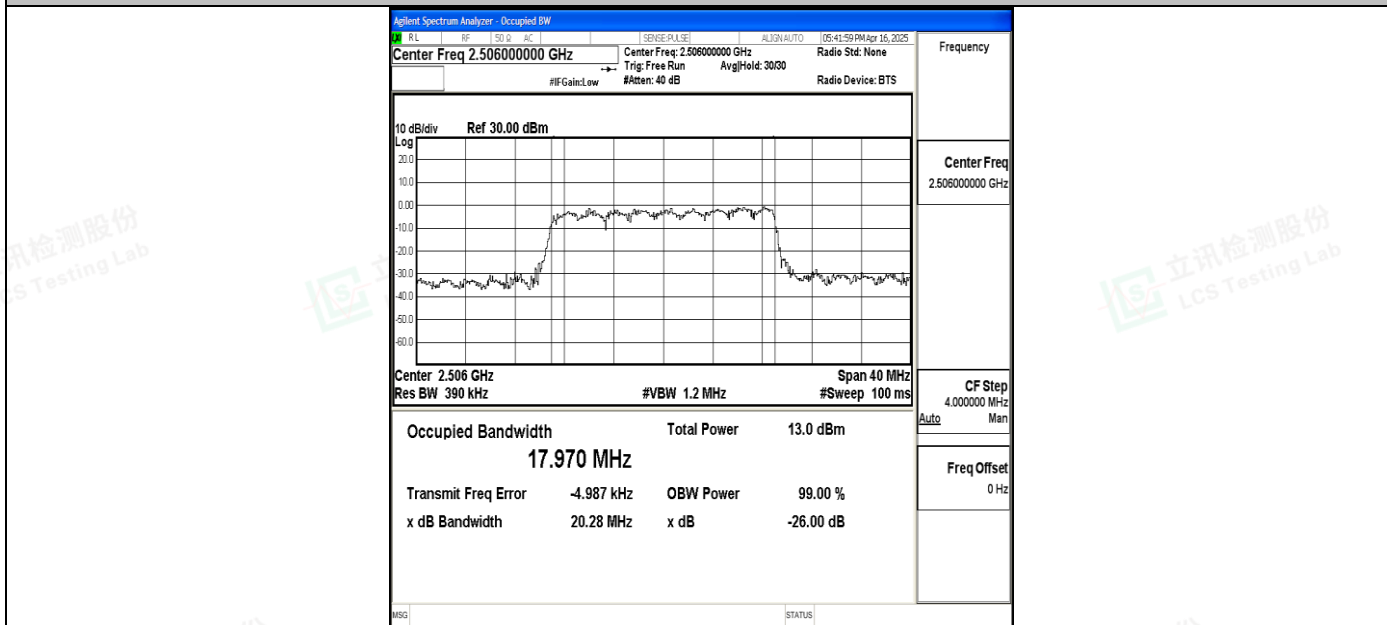


Band41-20MHz-16QAM-39750-100RB#0-PASS



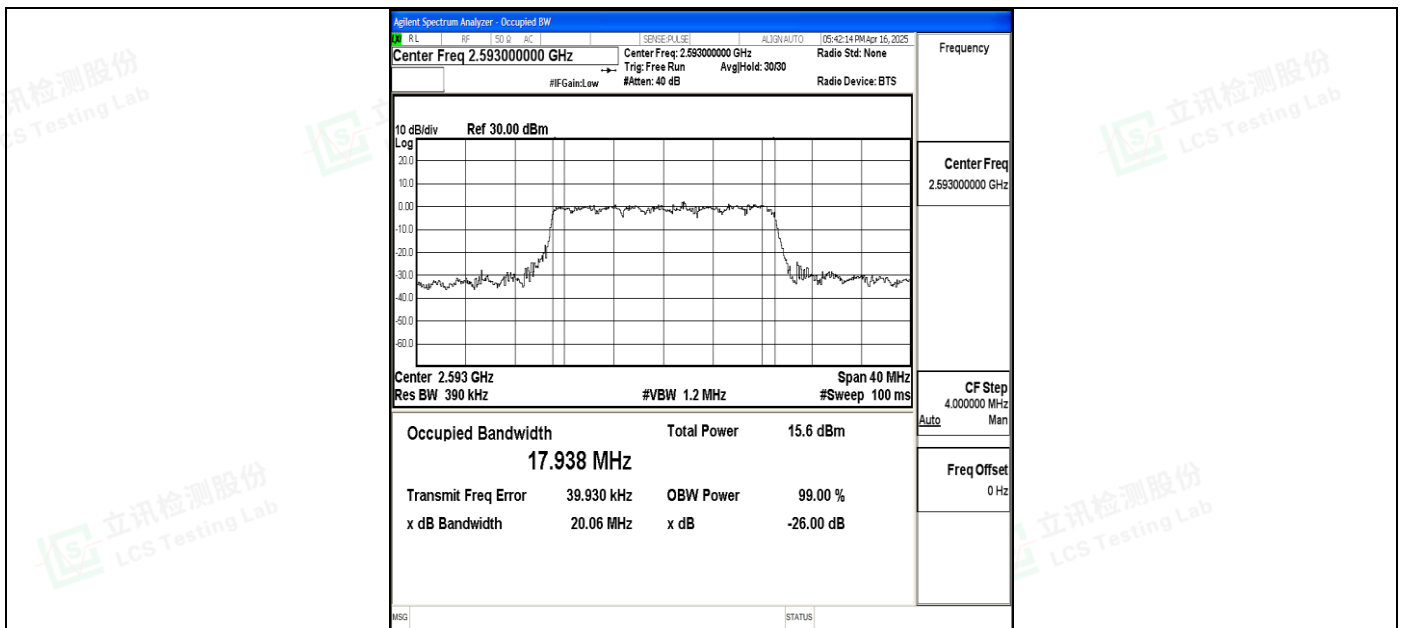


Band41-20MHz-QPSK-40620-100RB#0-PASS

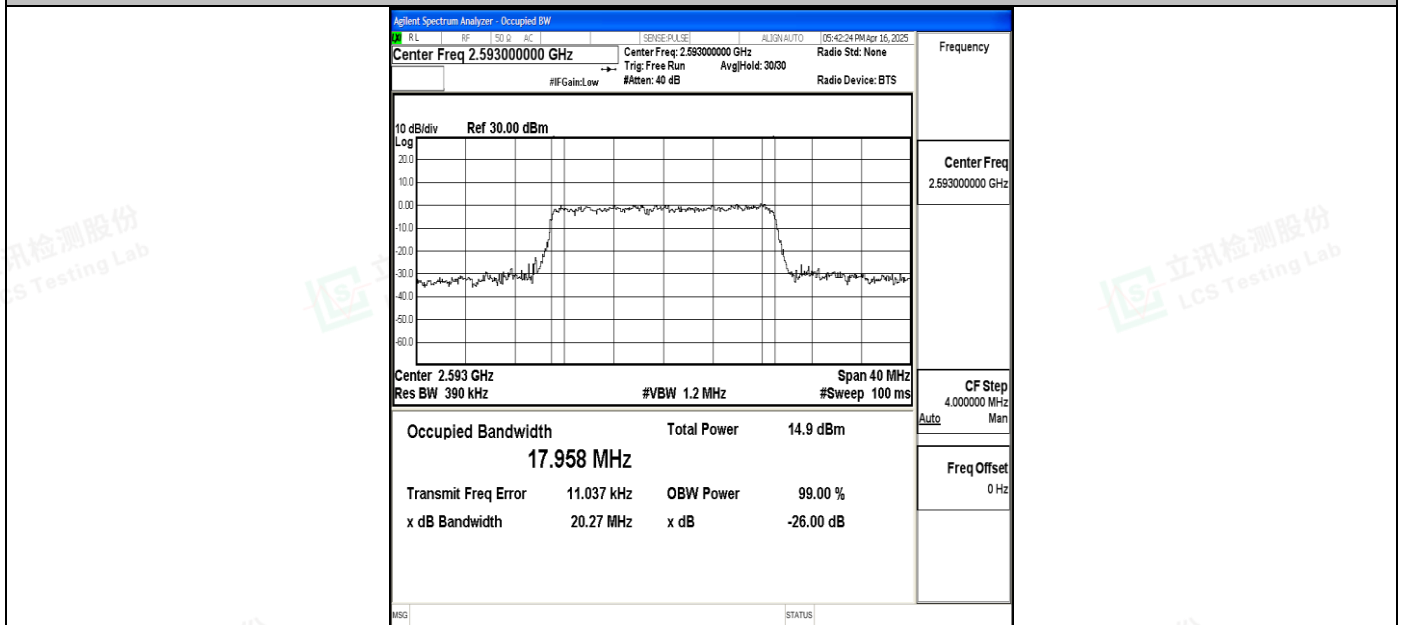


Band41-20MHz-16QAM-40620-100RB#0-PASS



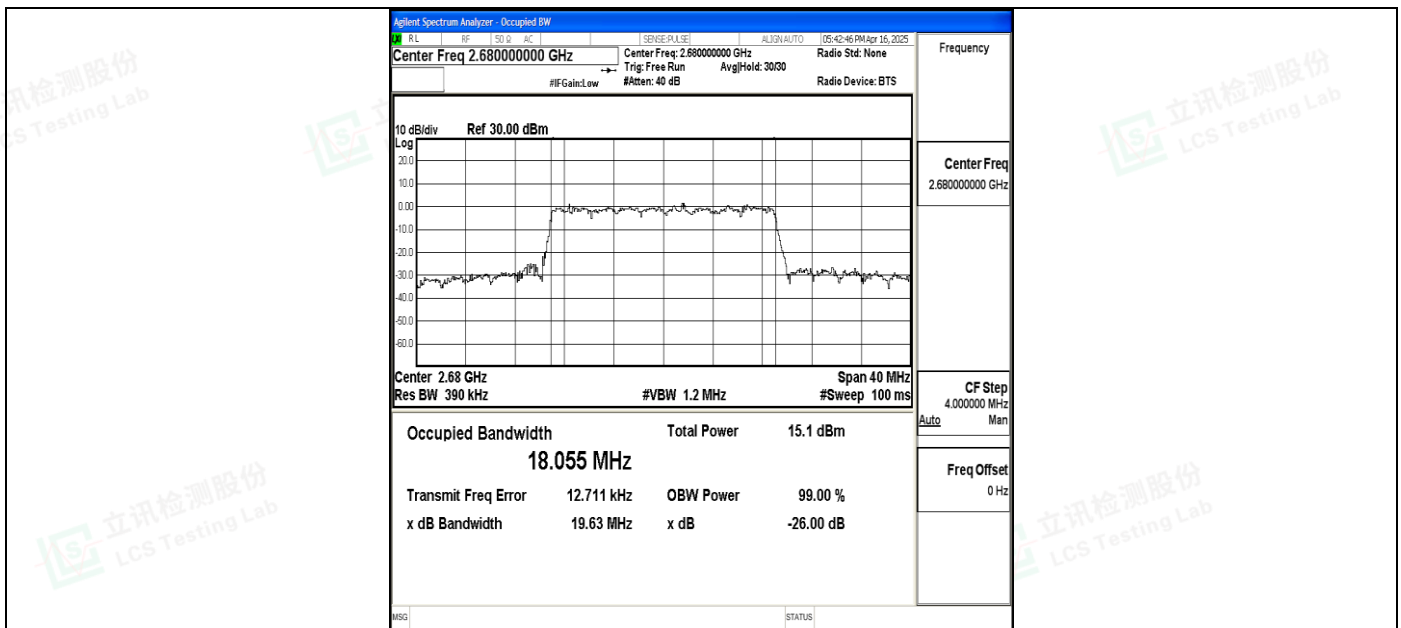

Band41-20MHz-QPSK-41490-100RB#0-PASS

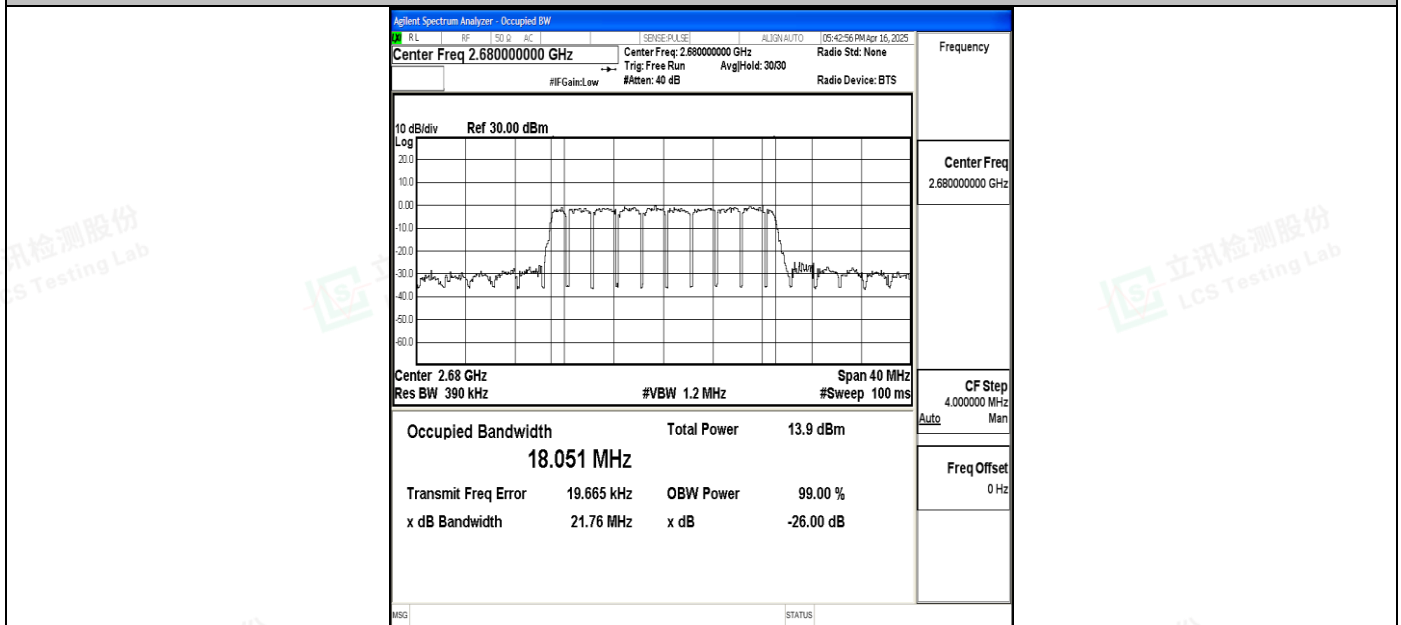

Band41-20MHz-16QAM-41490-100RB#0-PASS






N.4 Band Edge



Test Result


Band	Bandwidth	Modulation	Channel	RB Configuration	Peak Frequency	Result(dBm)	Verdict
Band41	5MHz	QPSK	39675	25RB#0	2489.03	-43.27	PASS
Band41	5MHz	16QAM	39675	25RB#0	2488.07	-43.67	PASS
Band41	5MHz	QPSK	41565	25RB#0	2696.25	-39.64	PASS
Band41	5MHz	16QAM	41565	25RB#0	2696.54	-39.79	PASS
Band41	10MHz	QPSK	39700	50RB#0	2489.67	-37.27	PASS
Band41	10MHz	16QAM	39700	50RB#0	2489.51	-38.36	PASS
Band41	10MHz	QPSK	41540	50RB#0	2700.28	-37.23	PASS
Band41	10MHz	16QAM	41540	50RB#0	2700.33	-35.82	PASS
Band41	15MHz	QPSK	39725	75RB#0	2489.56	-35.73	PASS
Band41	15MHz	16QAM	39725	75RB#0	2489.20	-34.52	PASS
Band41	15MHz	QPSK	41515	75RB#0	2709.51	-34.83	PASS
Band41	15MHz	16QAM	41515	75RB#0	2709.55	-34.53	PASS
Band41	20MHz	QPSK	39750	100RB#0	2488.22	-36.22	PASS
Band41	20MHz	16QAM	39750	100RB#0	2488.08	-34.81	PASS
Band41	20MHz	QPSK	41490	100RB#0	2710.28	-34.34	PASS
Band41	20MHz	16QAM	41490	100RB#0	2712.21	-33.90	PASS

Test Graphs

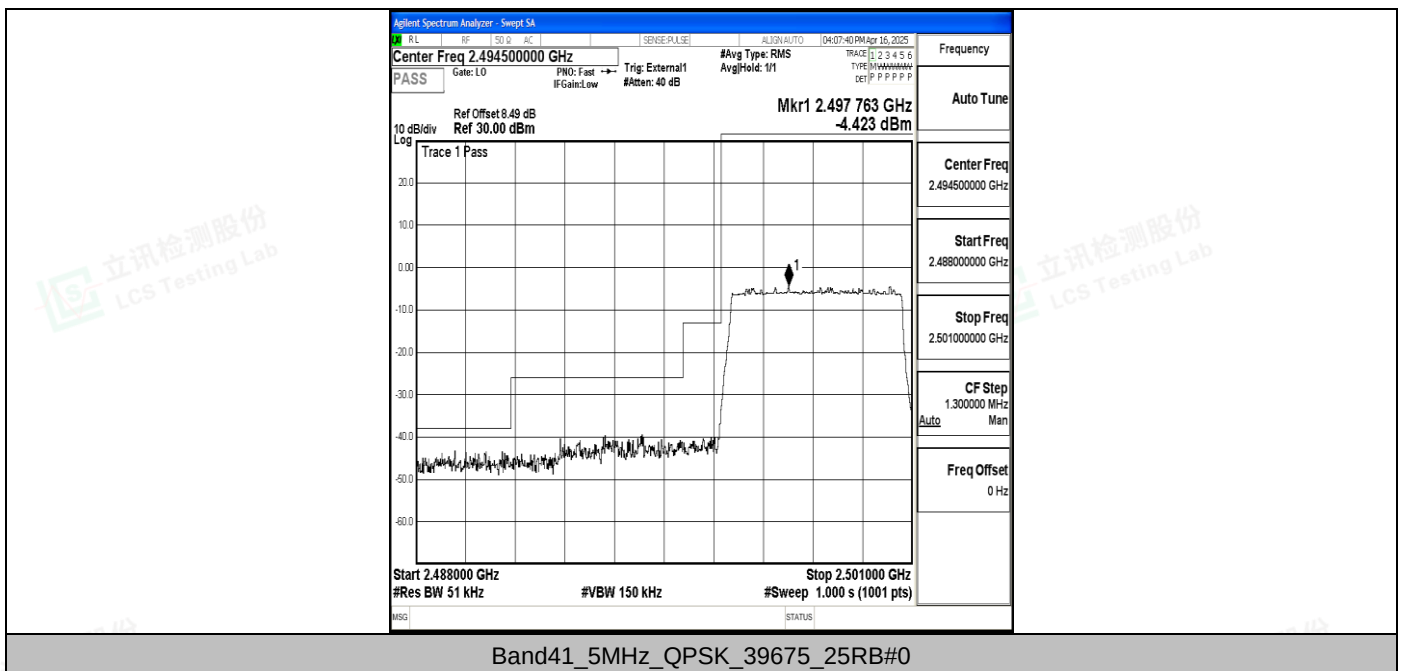


Shenzhen LCS Compliance Testing Laboratory Ltd.
Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street,
Baoan District, Shenzhen, 518000, China
Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com
Scan code to check authenticity

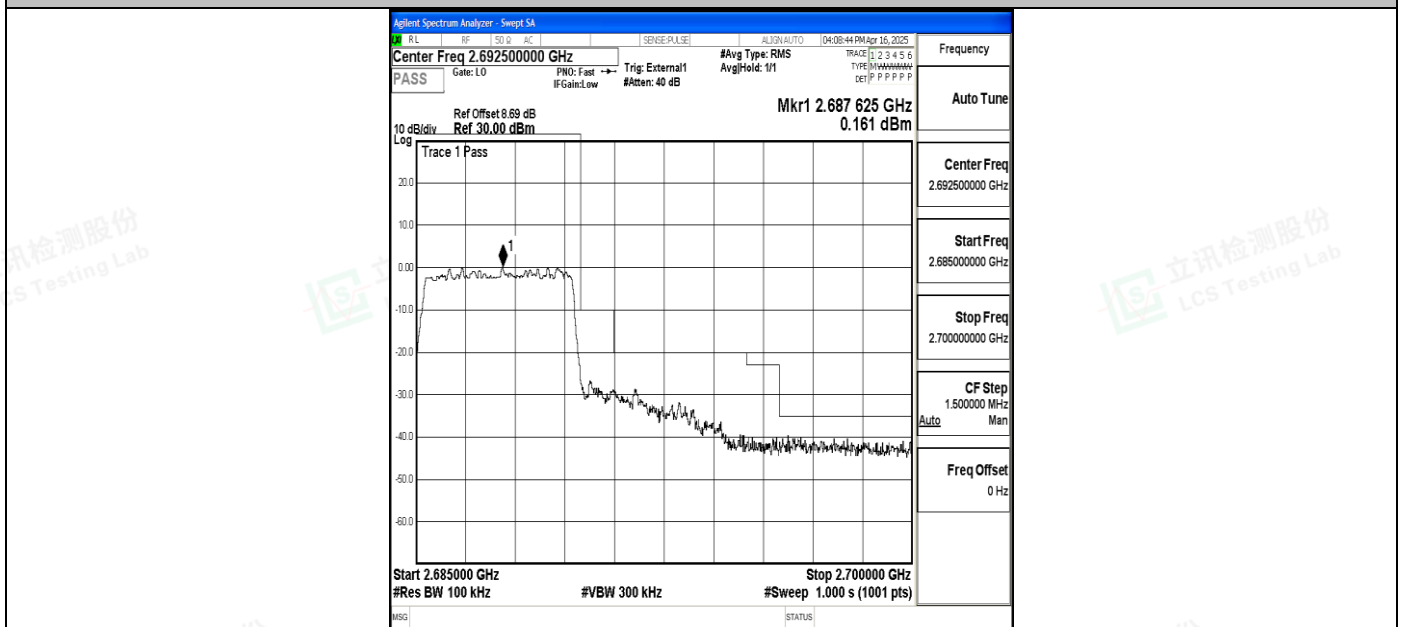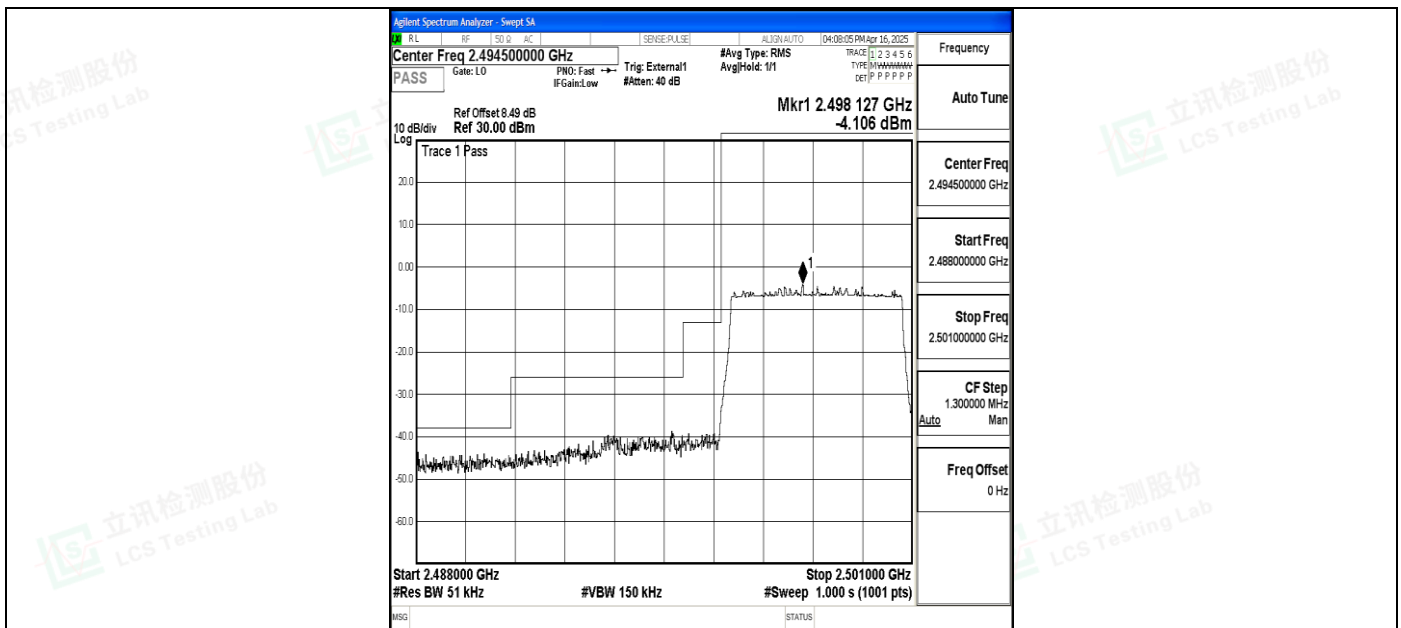

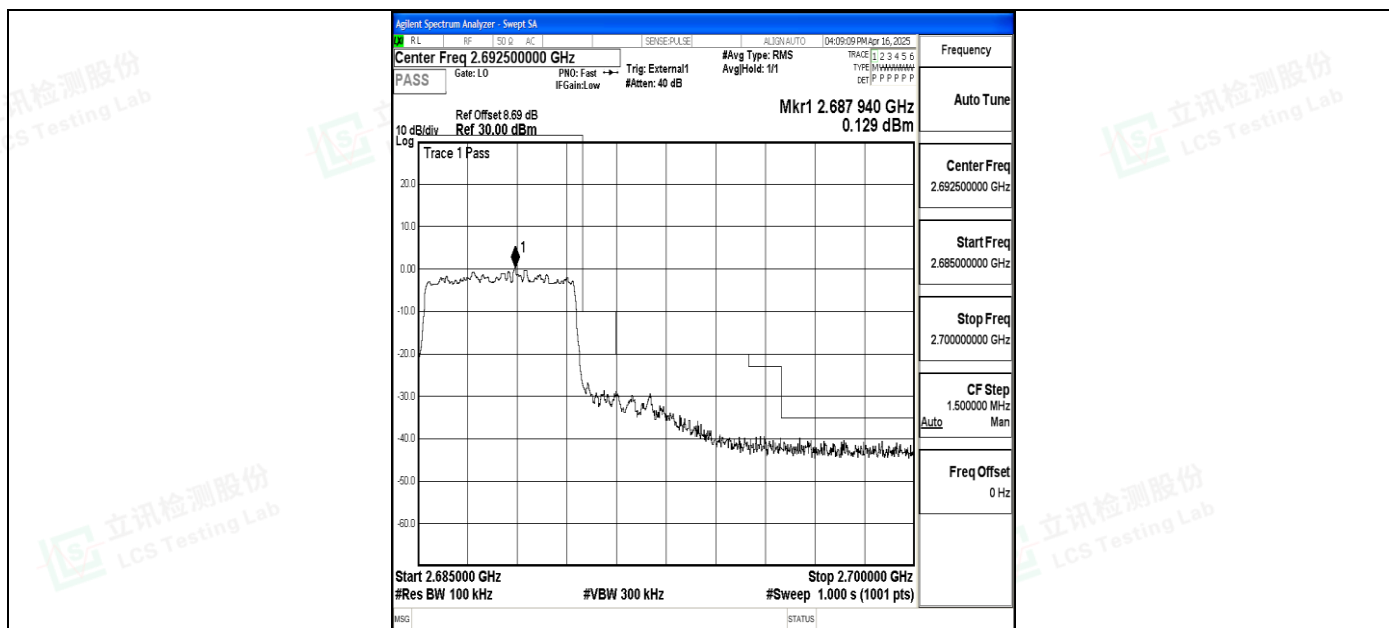


Band41_5MHz_16QAM_41565_25RB#0

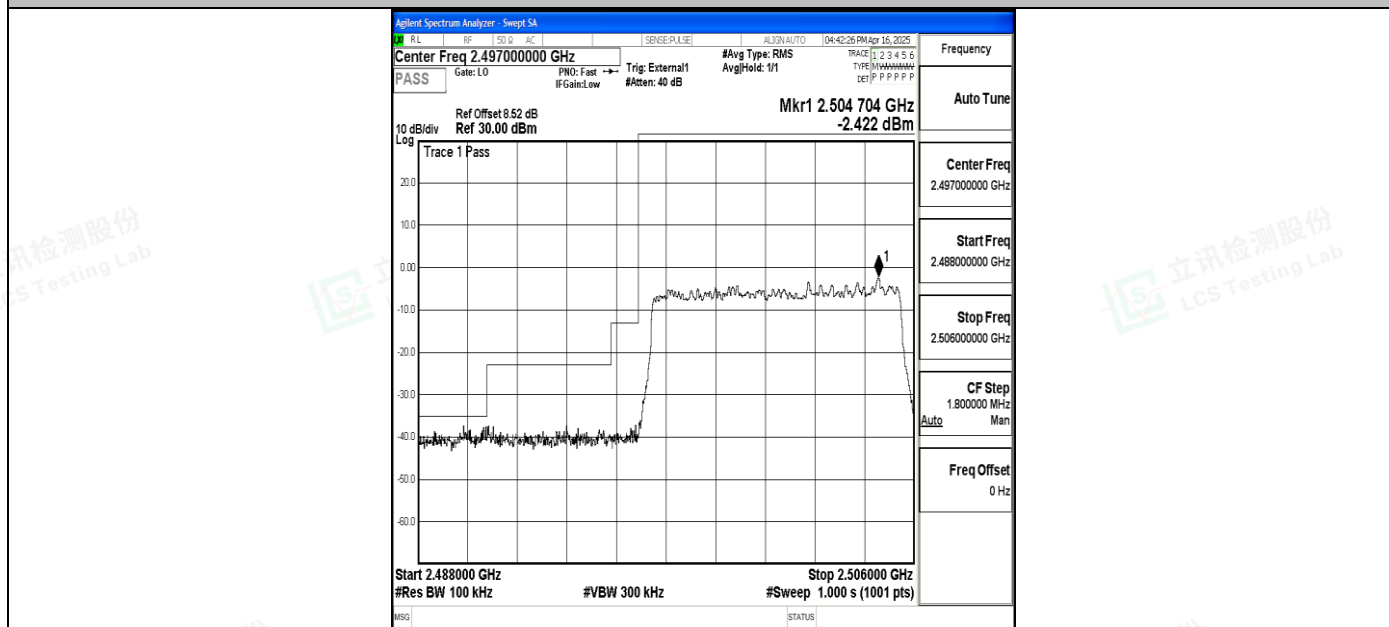


Band41_10MHz_QPSK_39700_50RB#0



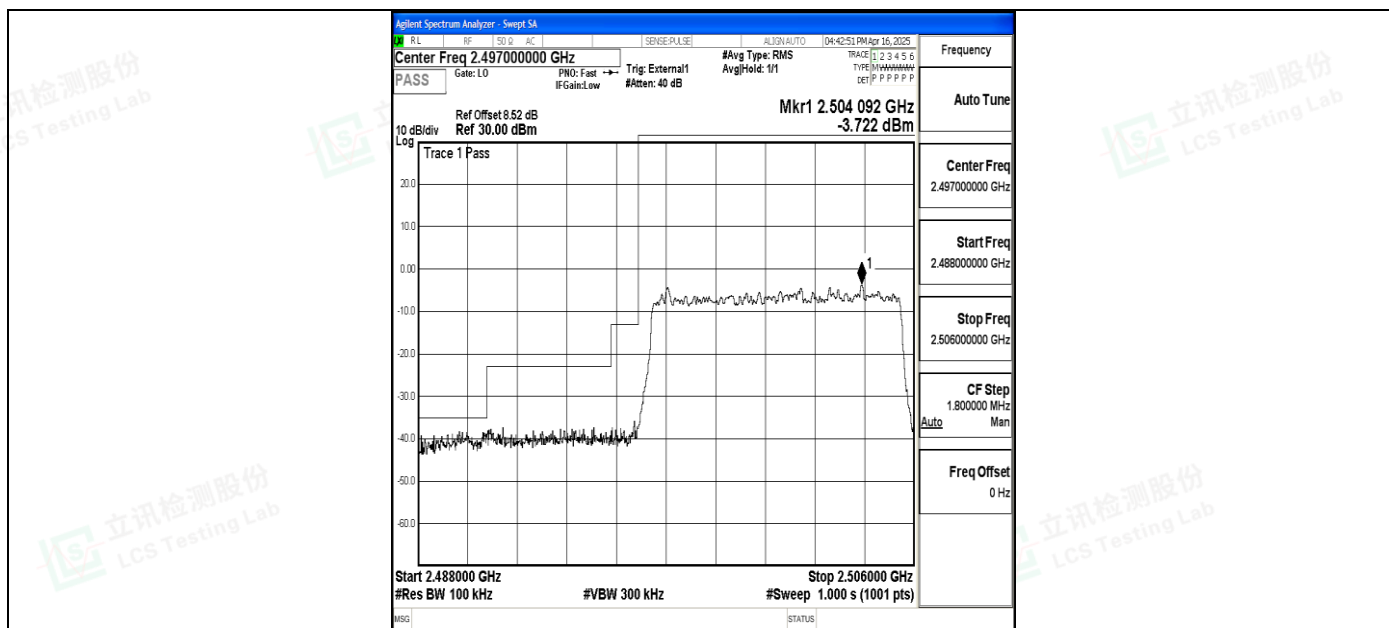


Band41_10MHz_16QAM_39700_50RB#0

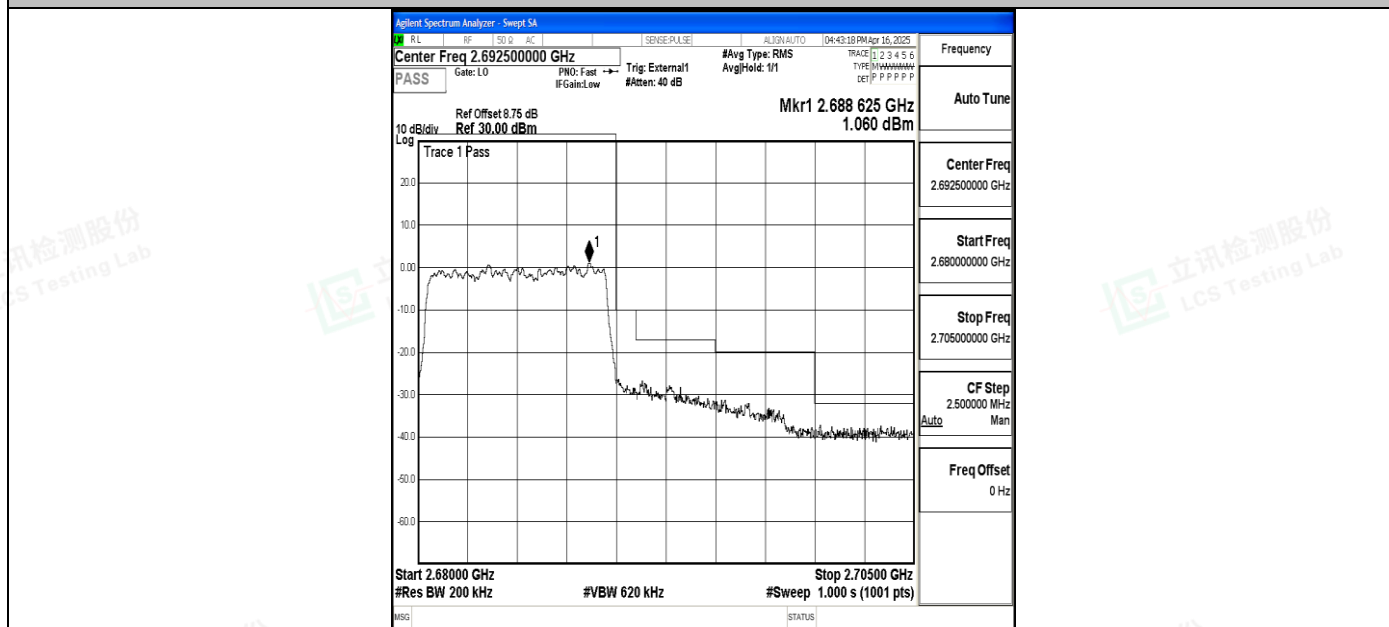


Band41_10MHz_QPSK_41540_50RB#0



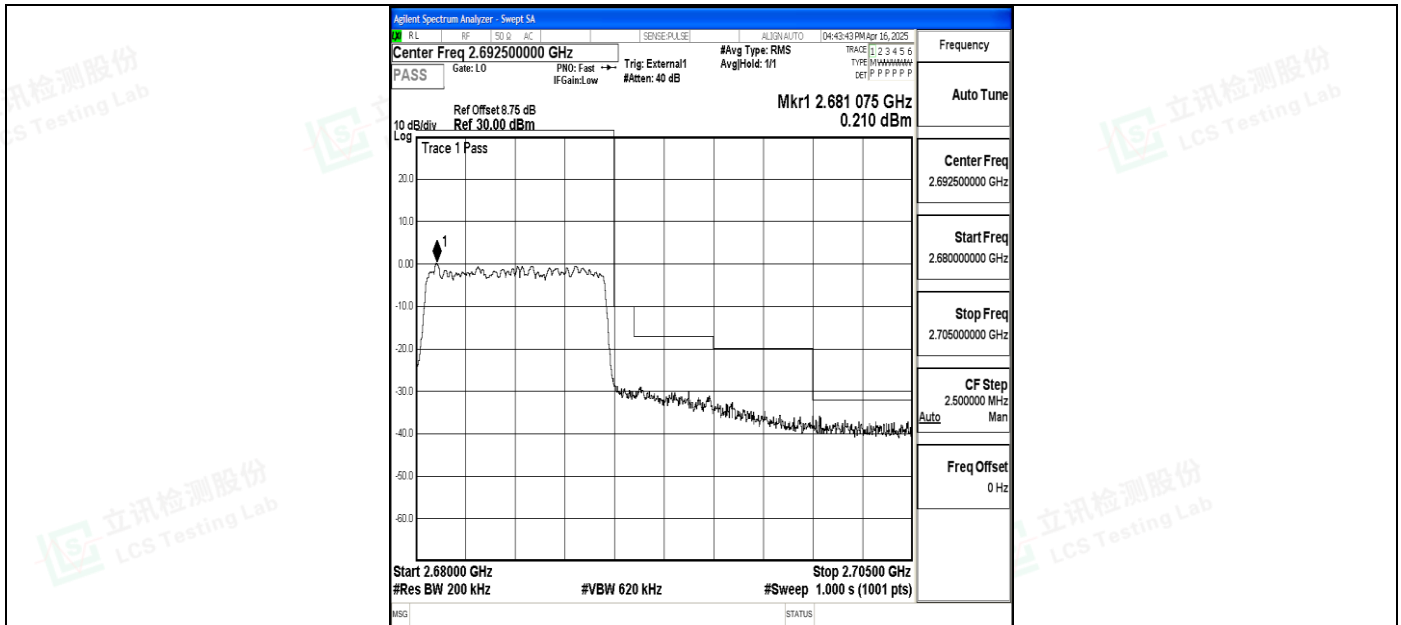


Band41_10MHz_16QAM_41540_50RB#0

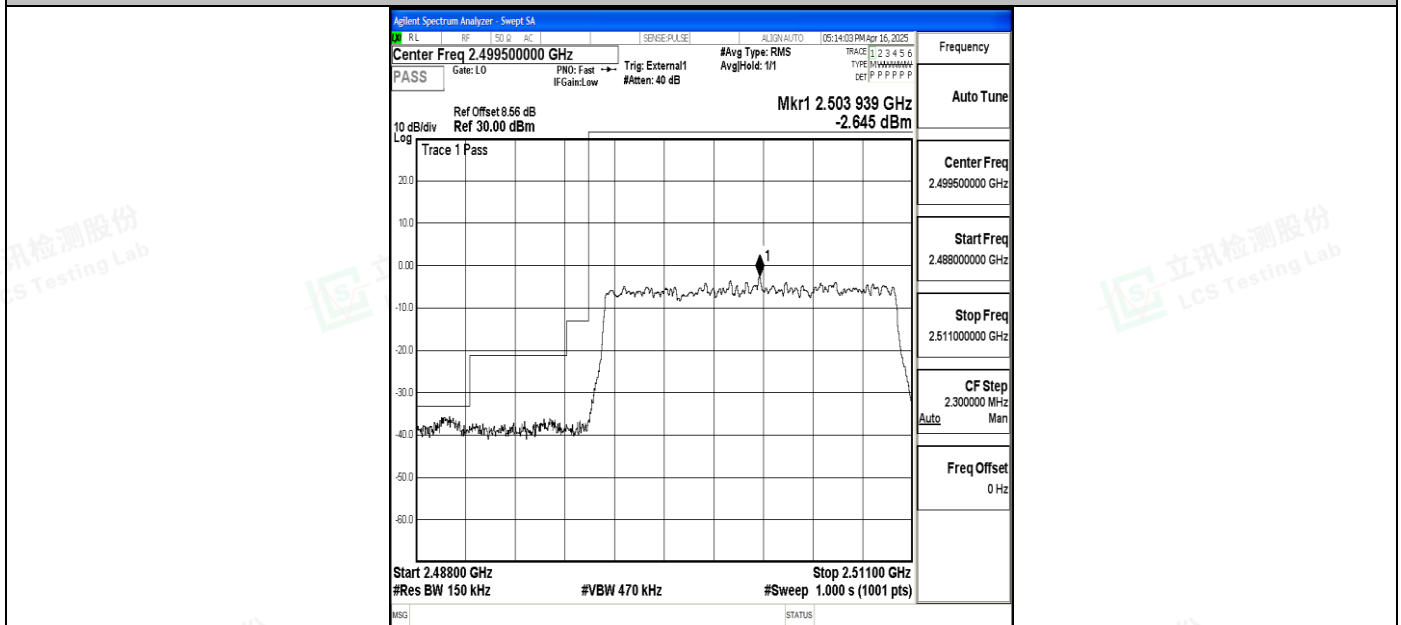


Band41_15MHz_QPSK_39725_75RB#0



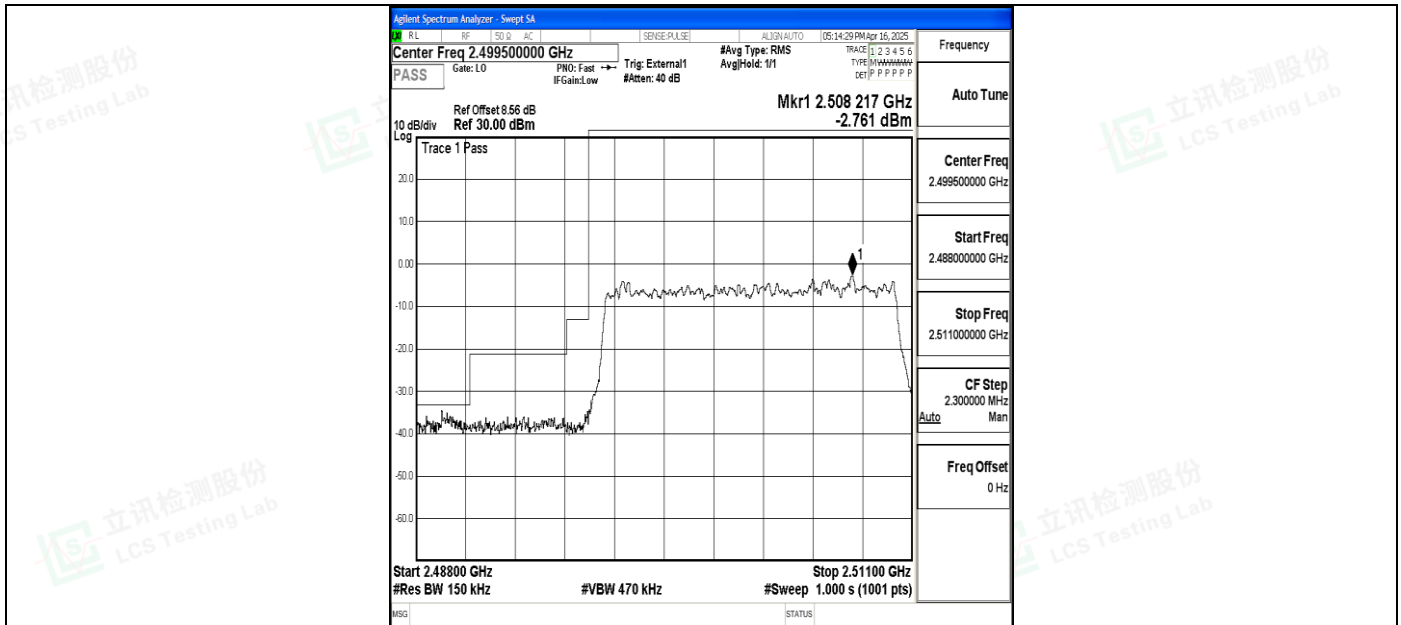


Band41_15MHz_16QAM_39725_75RB#0

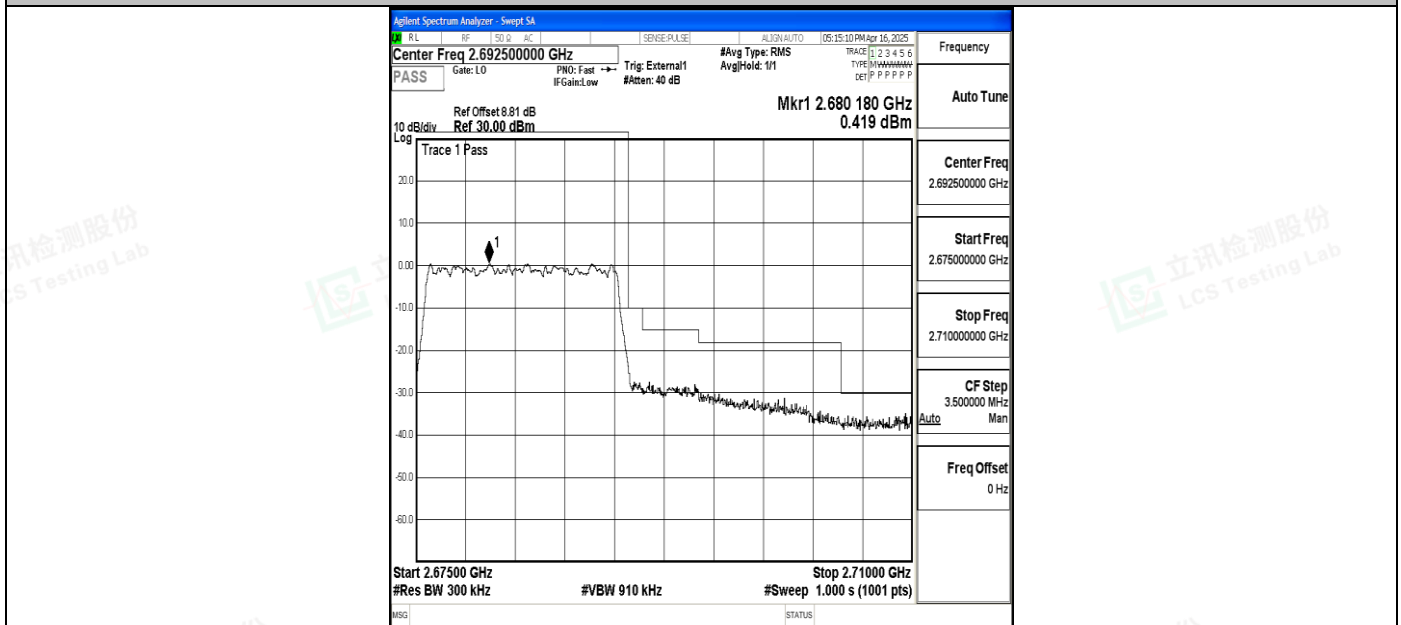


Band41_15MHz_QPSK_41515_75RB#0




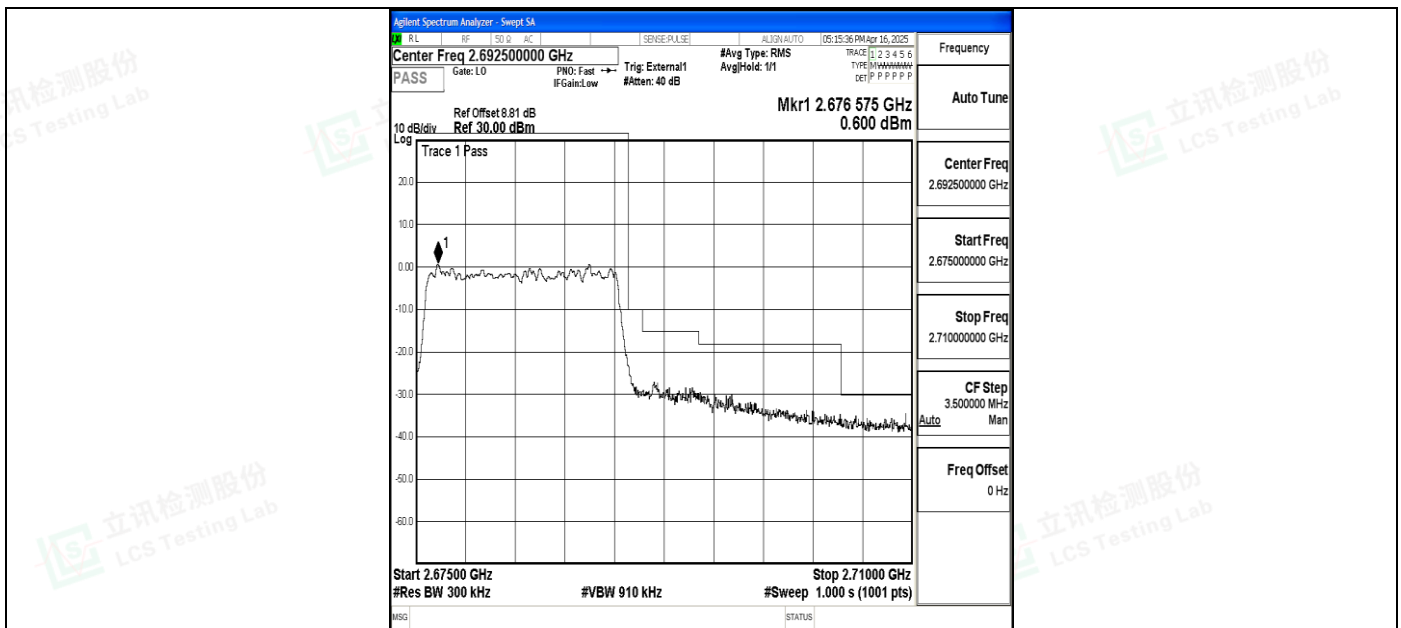



Band41_15MHz_16QAM_41515_75RB#0

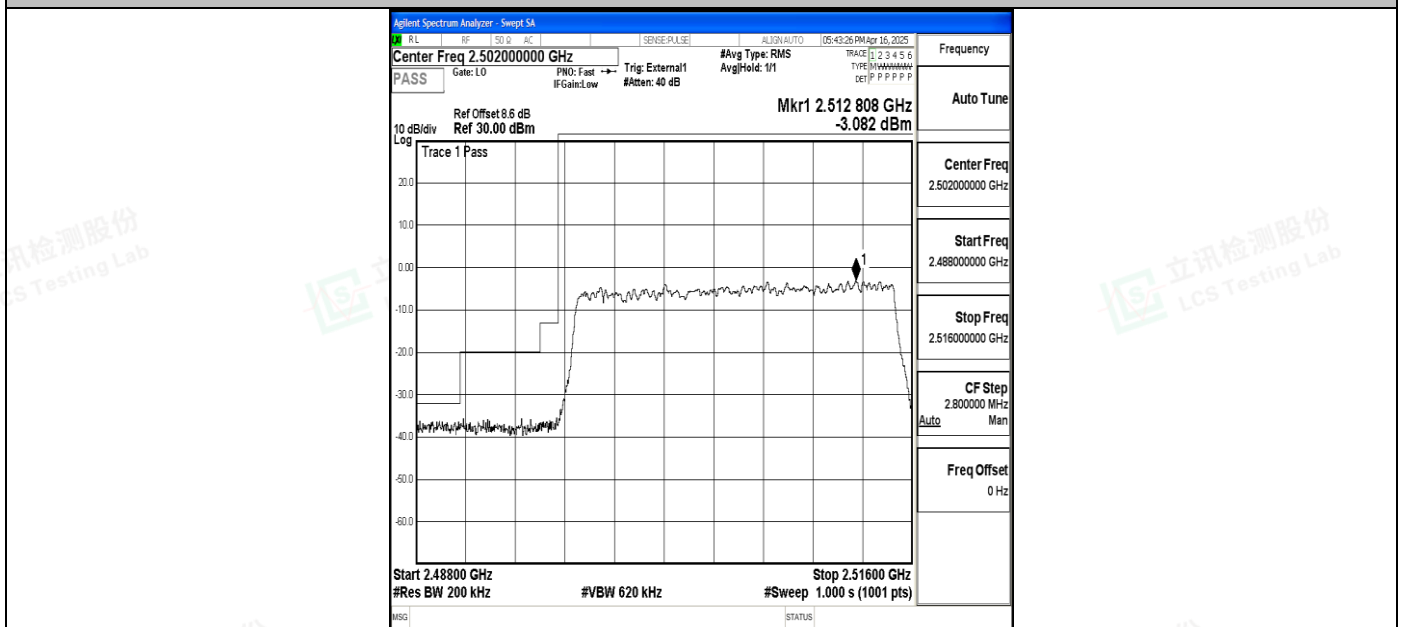

Band41_20MHz_QPSK_39750_100RB#0



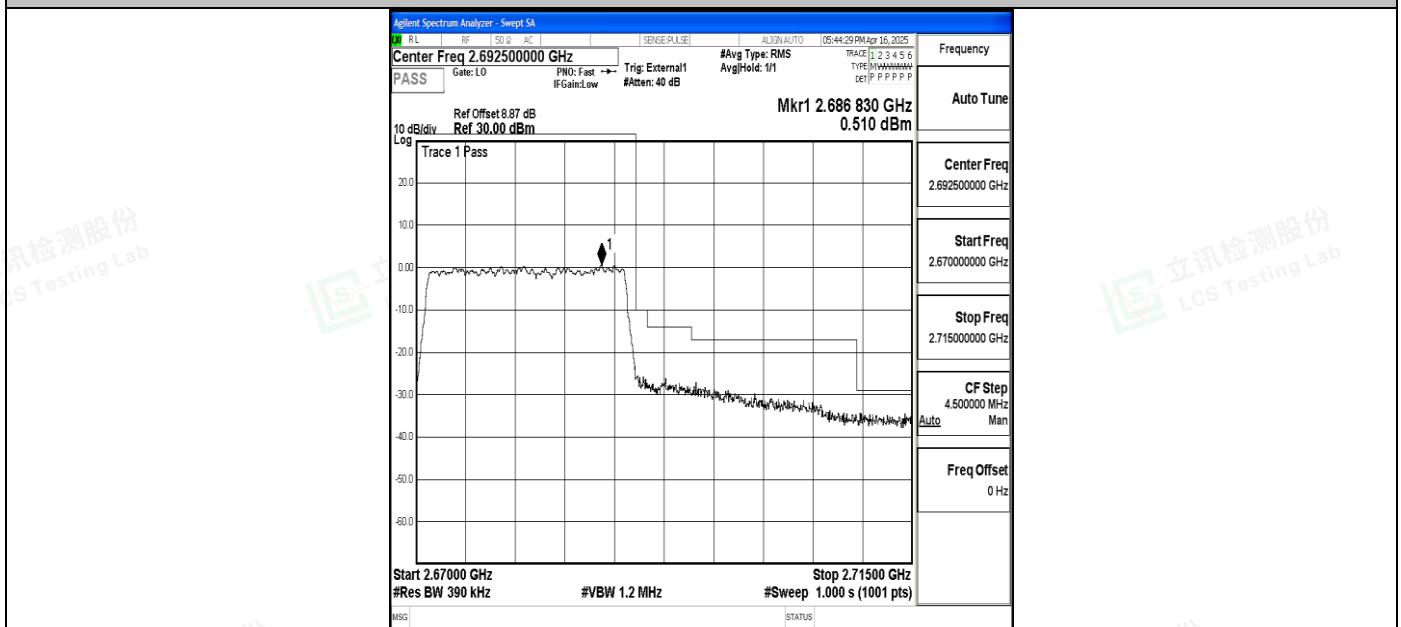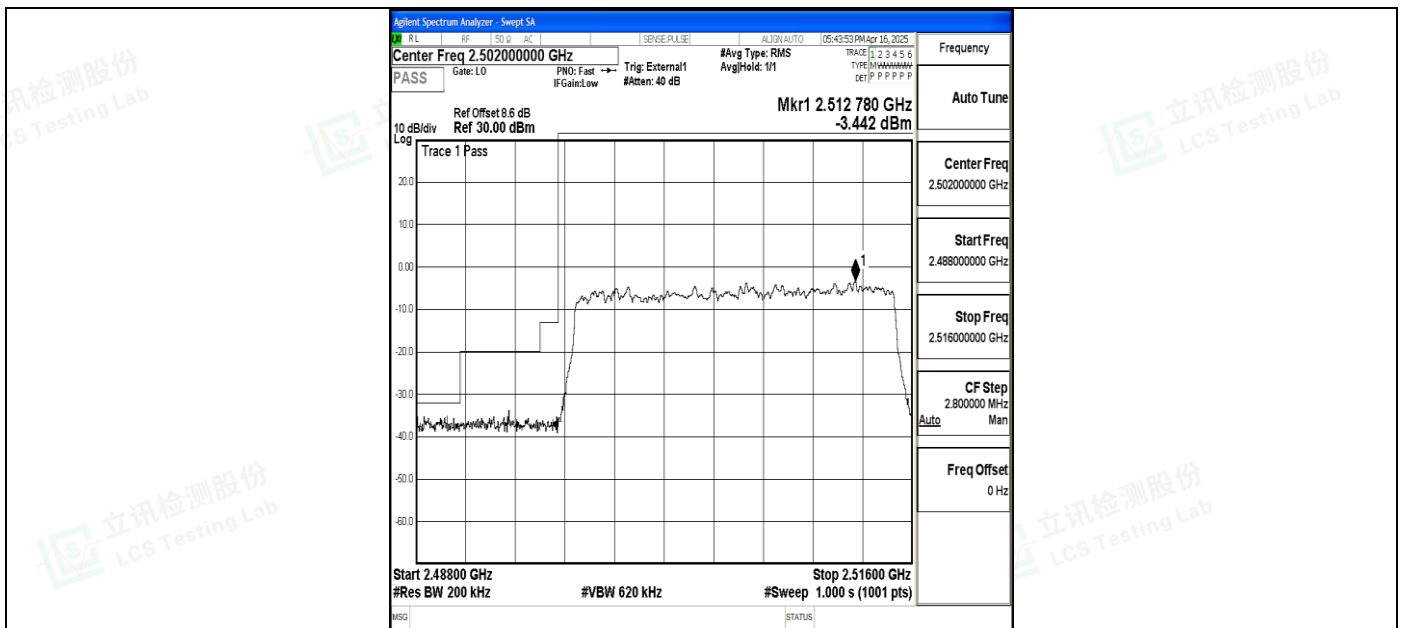

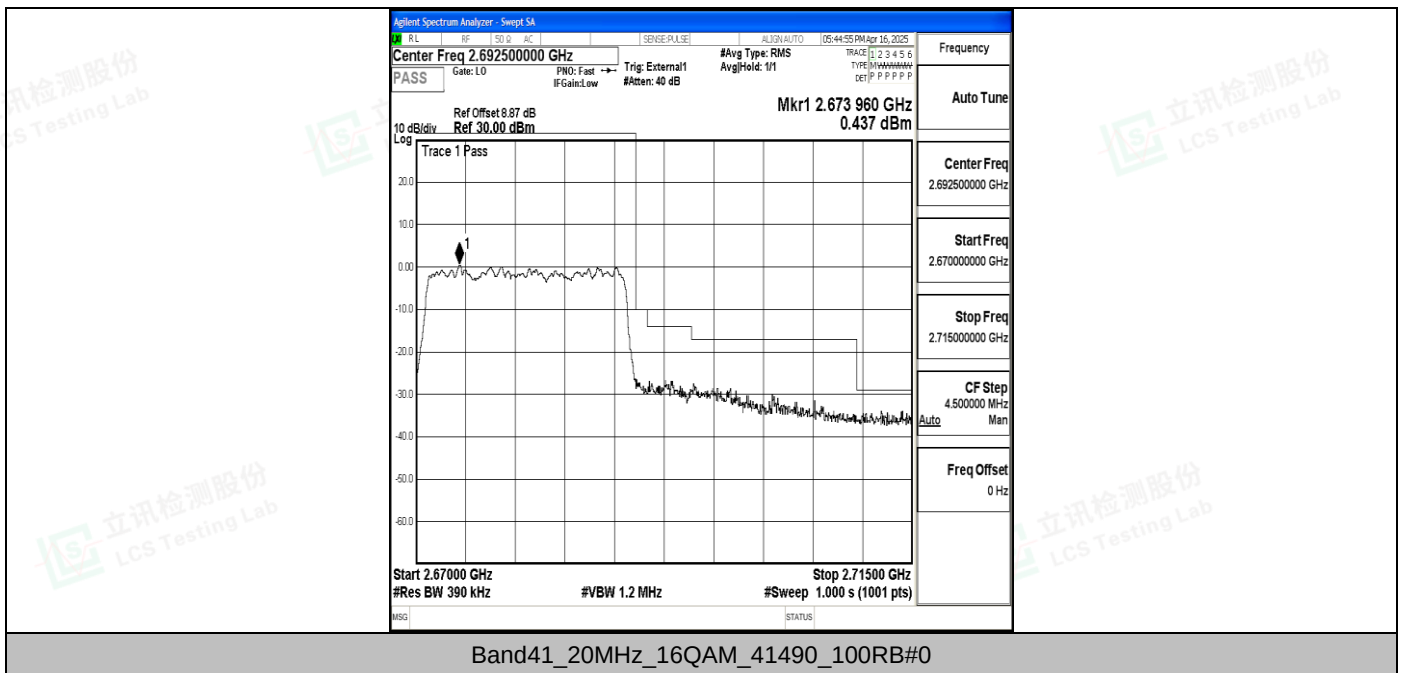

Shenzhen LCS Compliance Testing Laboratory Ltd.
Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street,
Baoan District, Shenzhen, 518000, China
Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com
Scan code to check authenticity



N.5 Conducted Spurious Emission

Test Result

Band	Bandwidth	Modulation	Channel	RB Configuration	Frequency Range	Result (dBm)	Verdict
Band41	5MHz	QPSK	39675	1RB#0	0.009~0.15	-63.97	PASS
Band41	5MHz	QPSK	39675	1RB#0	0.15~30	-50.59	PASS
Band41	5MHz	QPSK	39675	1RB#0	30~1000	-52.46	PASS
Band41	5MHz	QPSK	39675	1RB#0	1000~20000	-34.78	PASS
Band41	5MHz	QPSK	39675	1RB#0	20000~27000	-36.15	PASS
Band41	5MHz	16QAM	39675	1RB#0	0.009~0.15	-64.37	PASS
Band41	5MHz	16QAM	39675	1RB#0	0.15~30	-55.51	PASS
Band41	5MHz	16QAM	39675	1RB#0	30~1000	-52.84	PASS
Band41	5MHz	16QAM	39675	1RB#0	1000~20000	-34.26	PASS
Band41	5MHz	16QAM	39675	1RB#0	20000~27000	-35.77	PASS
Band41	5MHz	QPSK	40620	1RB#0	0.009~0.15	-63.34	PASS
Band41	5MHz	QPSK	40620	1RB#0	0.15~30	-50.78	PASS
Band41	5MHz	QPSK	40620	1RB#0	30~1000	-53.34	PASS
Band41	5MHz	QPSK	40620	1RB#0	1000~20000	-34.70	PASS
Band41	5MHz	QPSK	40620	1RB#0	20000~27000	-36.19	PASS
Band41	5MHz	16QAM	40620	1RB#0	0.009~0.15	-63.93	PASS
Band41	5MHz	16QAM	40620	1RB#0	0.15~30	-50.81	PASS
Band41	5MHz	16QAM	40620	1RB#0	30~1000	-52.49	PASS
Band41	5MHz	16QAM	40620	1RB#0	1000~20000	-34.36	PASS
Band41	5MHz	16QAM	40620	1RB#0	20000~27000	-35.58	PASS
Band41	5MHz	QPSK	41565	1RB#0	0.009~0.15	-63.92	PASS
Band41	5MHz	QPSK	41565	1RB#0	0.15~30	-53.79	PASS
Band41	5MHz	QPSK	41565	1RB#0	30~1000	-52.74	PASS
Band41	5MHz	QPSK	41565	1RB#0	1000~20000	-34.35	PASS
Band41	5MHz	QPSK	41565	1RB#0	20000~27000	-36.08	PASS
Band41	5MHz	16QAM	41565	1RB#0	0.009~0.15	-63.40	PASS
Band41	5MHz	16QAM	41565	1RB#0	0.15~30	-54.43	PASS
Band41	5MHz	16QAM	41565	1RB#0	30~1000	-52.73	PASS
Band41	5MHz	16QAM	41565	1RB#0	1000~20000	-34.26	PASS
Band41	5MHz	16QAM	41565	1RB#0	20000~27000	-35.51	PASS
Band41	10MHz	QPSK	39700	1RB#0	0.009~0.15	-63.38	PASS
Band41	10MHz	QPSK	39700	1RB#0	0.15~30	-53.85	PASS
Band41	10MHz	QPSK	39700	1RB#0	30~1000	-52.28	PASS
Band41	10MHz	QPSK	39700	1RB#0	1000~20000	-34.28	PASS



Shenzhen LCS Compliance Testing Laboratory Ltd.
Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street,
Baoan District, Shenzhen, 518000, China
Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com
Scan code to check authenticity



Band41	10MHz	QPSK	39700	1RB#0	20000~27000	-36.47	PASS
Band41	10MHz	16QAM	39700	1RB#0	0.009~0.15	-64.96	PASS
Band41	10MHz	16QAM	39700	1RB#0	0.15~30	-55.39	PASS
Band41	10MHz	16QAM	39700	1RB#0	30~1000	-52.06	PASS
Band41	10MHz	16QAM	39700	1RB#0	1000~20000	-34.26	PASS
Band41	10MHz	16QAM	39700	1RB#0	20000~27000	-35.93	PASS
Band41	10MHz	QPSK	40620	1RB#0	0.009~0.15	-64.14	PASS
Band41	10MHz	QPSK	40620	1RB#0	0.15~30	-53.63	PASS
Band41	10MHz	QPSK	40620	1RB#0	30~1000	-52.93	PASS
Band41	10MHz	QPSK	40620	1RB#0	1000~20000	-34.08	PASS
Band41	10MHz	QPSK	40620	1RB#0	20000~27000	-35.65	PASS
Band41	10MHz	16QAM	40620	1RB#0	0.009~0.15	-64.10	PASS
Band41	10MHz	16QAM	40620	1RB#0	0.15~30	-52.54	PASS
Band41	10MHz	16QAM	40620	1RB#0	30~1000	-53.13	PASS
Band41	10MHz	16QAM	40620	1RB#0	1000~20000	-34.07	PASS
Band41	10MHz	16QAM	40620	1RB#0	20000~27000	-35.75	PASS
Band41	10MHz	QPSK	41540	1RB#0	0.009~0.15	-63.45	PASS
Band41	10MHz	QPSK	41540	1RB#0	0.15~30	-53.50	PASS
Band41	10MHz	QPSK	41540	1RB#0	30~1000	-52.92	PASS
Band41	10MHz	QPSK	41540	1RB#0	1000~20000	-34.61	PASS
Band41	10MHz	QPSK	41540	1RB#0	20000~27000	-36.39	PASS
Band41	10MHz	16QAM	41540	1RB#0	0.009~0.15	-65.05	PASS
Band41	10MHz	16QAM	41540	1RB#0	0.15~30	-52.43	PASS
Band41	10MHz	16QAM	41540	1RB#0	30~1000	-40.73	PASS
Band41	10MHz	16QAM	41540	1RB#0	1000~20000	-33.52	PASS
Band41	10MHz	16QAM	41540	1RB#0	20000~27000	-35.48	PASS
Band41	15MHz	QPSK	39725	1RB#0	0.009~0.15	-64.16	PASS
Band41	15MHz	QPSK	39725	1RB#0	0.15~30	-54.25	PASS
Band41	15MHz	QPSK	39725	1RB#0	30~1000	-52.92	PASS
Band41	15MHz	QPSK	39725	1RB#0	1000~20000	-34.06	PASS
Band41	15MHz	QPSK	39725	1RB#0	20000~27000	-36.07	PASS
Band41	15MHz	16QAM	39725	1RB#0	0.009~0.15	-64.89	PASS
Band41	15MHz	16QAM	39725	1RB#0	0.15~30	-56.56	PASS
Band41	15MHz	16QAM	39725	1RB#0	30~1000	-52.82	PASS
Band41	15MHz	16QAM	39725	1RB#0	1000~20000	-34.75	PASS
Band41	15MHz	16QAM	39725	1RB#0	20000~27000	-35.94	PASS
Band41	15MHz	QPSK	40620	1RB#0	0.009~0.15	-64.86	PASS
Band41	15MHz	QPSK	40620	1RB#0	0.15~30	-51.16	PASS
Band41	15MHz	QPSK	40620	1RB#0	30~1000	-52.43	PASS
Band41	15MHz	QPSK	40620	1RB#0	1000~20000	-34.45	PASS






Band41	15MHz	QPSK	40620	1RB#0	20000~27000	-36.52	PASS
Band41	15MHz	16QAM	40620	1RB#0	0.009~0.15	-64.31	PASS
Band41	15MHz	16QAM	40620	1RB#0	0.15~30	-54.26	PASS
Band41	15MHz	16QAM	40620	1RB#0	30~1000	-53.32	PASS
Band41	15MHz	16QAM	40620	1RB#0	1000~20000	-34.80	PASS
Band41	15MHz	16QAM	40620	1RB#0	20000~27000	-36.12	PASS
Band41	15MHz	QPSK	41515	1RB#0	0.009~0.15	-65.82	PASS
Band41	15MHz	QPSK	41515	1RB#0	0.15~30	-53.29	PASS
Band41	15MHz	QPSK	41515	1RB#0	30~1000	-52.94	PASS
Band41	15MHz	QPSK	41515	1RB#0	1000~20000	-34.23	PASS
Band41	15MHz	QPSK	41515	1RB#0	20000~27000	-35.37	PASS
Band41	15MHz	16QAM	41515	1RB#0	0.009~0.15	-63.11	PASS
Band41	15MHz	16QAM	41515	1RB#0	0.15~30	-51.59	PASS
Band41	15MHz	16QAM	41515	1RB#0	30~1000	-52.22	PASS
Band41	15MHz	16QAM	41515	1RB#0	1000~20000	-33.71	PASS
Band41	15MHz	16QAM	41515	1RB#0	20000~27000	-36.37	PASS
Band41	20MHz	QPSK	39750	1RB#0	0.009~0.15	-64.67	PASS
Band41	20MHz	QPSK	39750	1RB#0	0.15~30	-52.62	PASS
Band41	20MHz	QPSK	39750	1RB#0	30~1000	-53.26	PASS
Band41	20MHz	QPSK	39750	1RB#0	1000~20000	-33.60	PASS
Band41	20MHz	QPSK	39750	1RB#0	20000~27000	-35.93	PASS
Band41	20MHz	16QAM	39750	1RB#0	0.009~0.15	-66.30	PASS
Band41	20MHz	16QAM	39750	1RB#0	0.15~30	-53.81	PASS
Band41	20MHz	16QAM	39750	1RB#0	30~1000	-52.74	PASS
Band41	20MHz	16QAM	39750	1RB#0	1000~20000	-35.00	PASS
Band41	20MHz	16QAM	39750	1RB#0	20000~27000	-36.49	PASS
Band41	20MHz	QPSK	40620	1RB#0	0.009~0.15	-64.38	PASS
Band41	20MHz	QPSK	40620	1RB#0	0.15~30	-51.42	PASS
Band41	20MHz	QPSK	40620	1RB#0	30~1000	-52.91	PASS
Band41	20MHz	QPSK	40620	1RB#0	1000~20000	-33.33	PASS
Band41	20MHz	QPSK	40620	1RB#0	20000~27000	-35.76	PASS
Band41	20MHz	16QAM	40620	1RB#0	0.009~0.15	-63.30	PASS
Band41	20MHz	16QAM	40620	1RB#0	0.15~30	-54.69	PASS
Band41	20MHz	16QAM	40620	1RB#0	30~1000	-52.73	PASS
Band41	20MHz	16QAM	40620	1RB#0	1000~20000	-34.54	PASS
Band41	20MHz	16QAM	40620	1RB#0	20000~27000	-36.32	PASS
Band41	20MHz	QPSK	41490	1RB#0	0.009~0.15	-65.73	PASS
Band41	20MHz	QPSK	41490	1RB#0	0.15~30	-54.41	PASS
Band41	20MHz	QPSK	41490	1RB#0	30~1000	-52.70	PASS
Band41	20MHz	QPSK	41490	1RB#0	1000~20000	-34.56	PASS





Band41	20MHz	QPSK	41490	1RB#0	20000~27000	-36.16	PASS
Band41	20MHz	16QAM	41490	1RB#0	0.009~0.15	-63.48	PASS
Band41	20MHz	16QAM	41490	1RB#0	0.15~30	-51.40	PASS
Band41	20MHz	16QAM	41490	1RB#0	30~1000	-52.37	PASS
Band41	20MHz	16QAM	41490	1RB#0	1000~20000	-29.77	PASS
Band41	20MHz	16QAM	41490	1RB#0	20000~27000	-35.93	PASS

Test Graphs

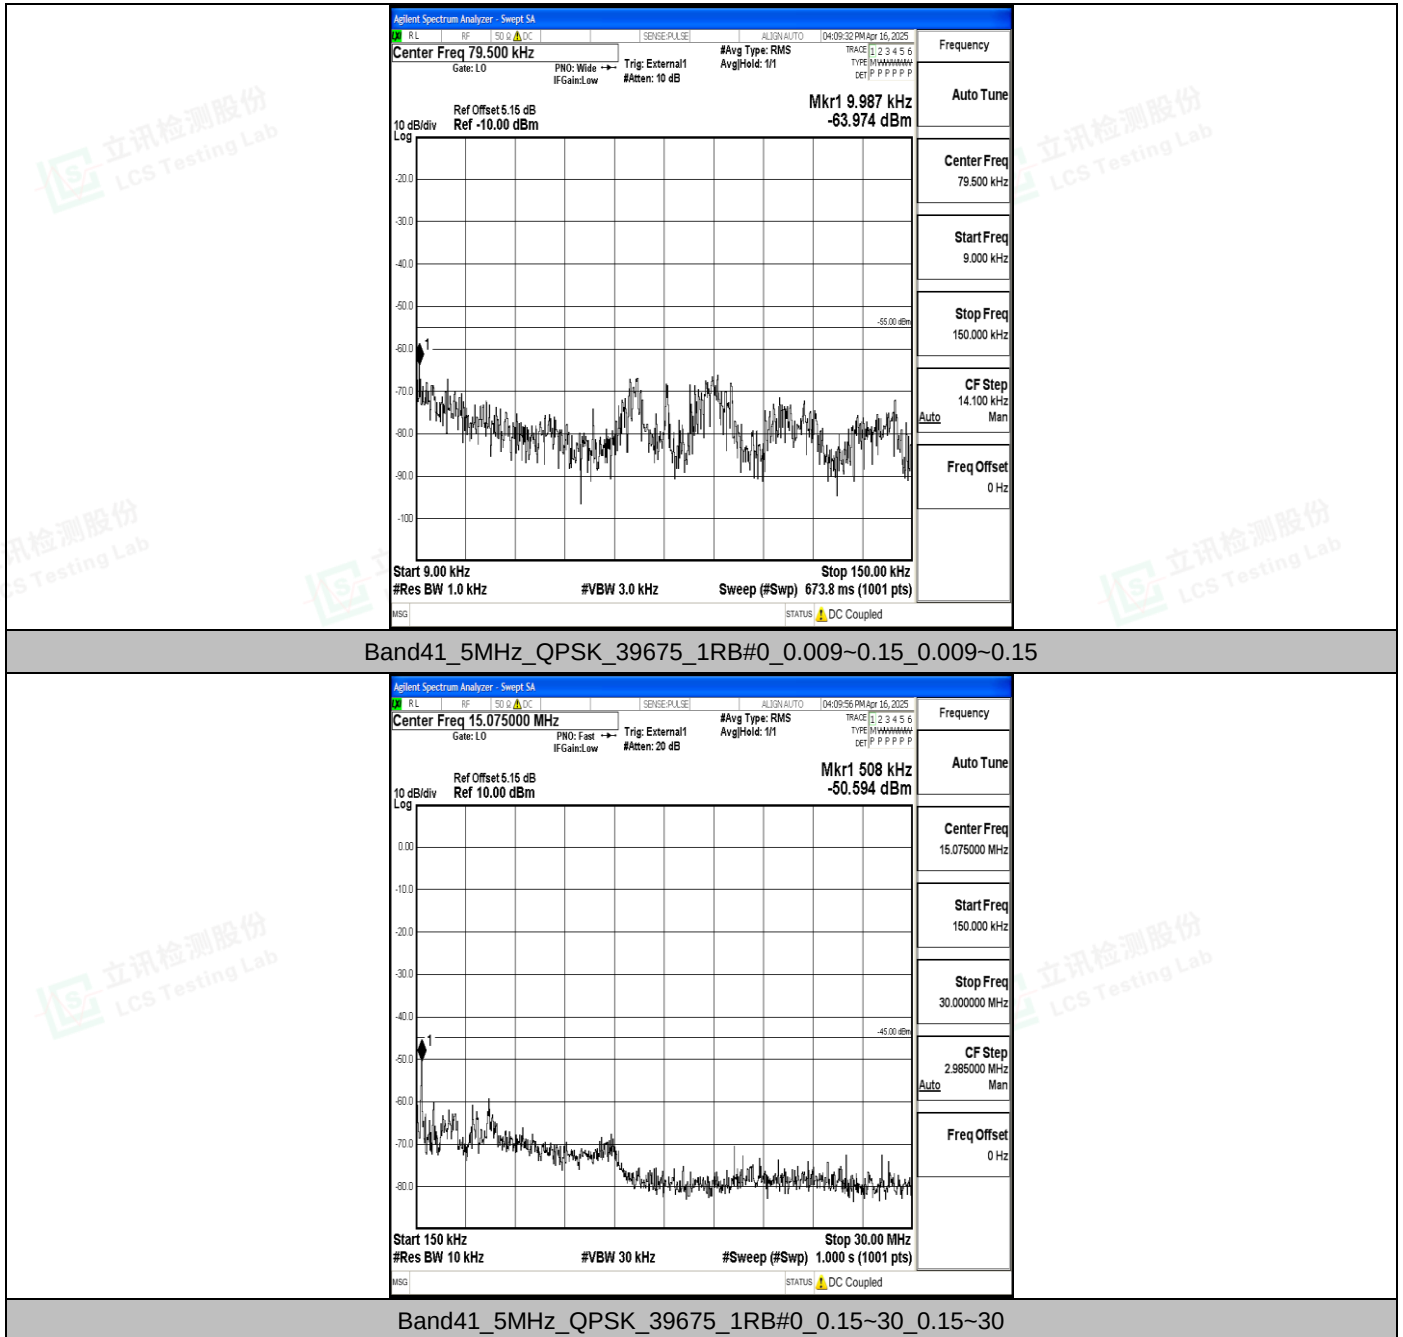

Shenzhen LCS Compliance Testing Laboratory Ltd.
Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street,
Baoan District, Shenzhen, 518000, China
Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com
Scan code to check authenticity