







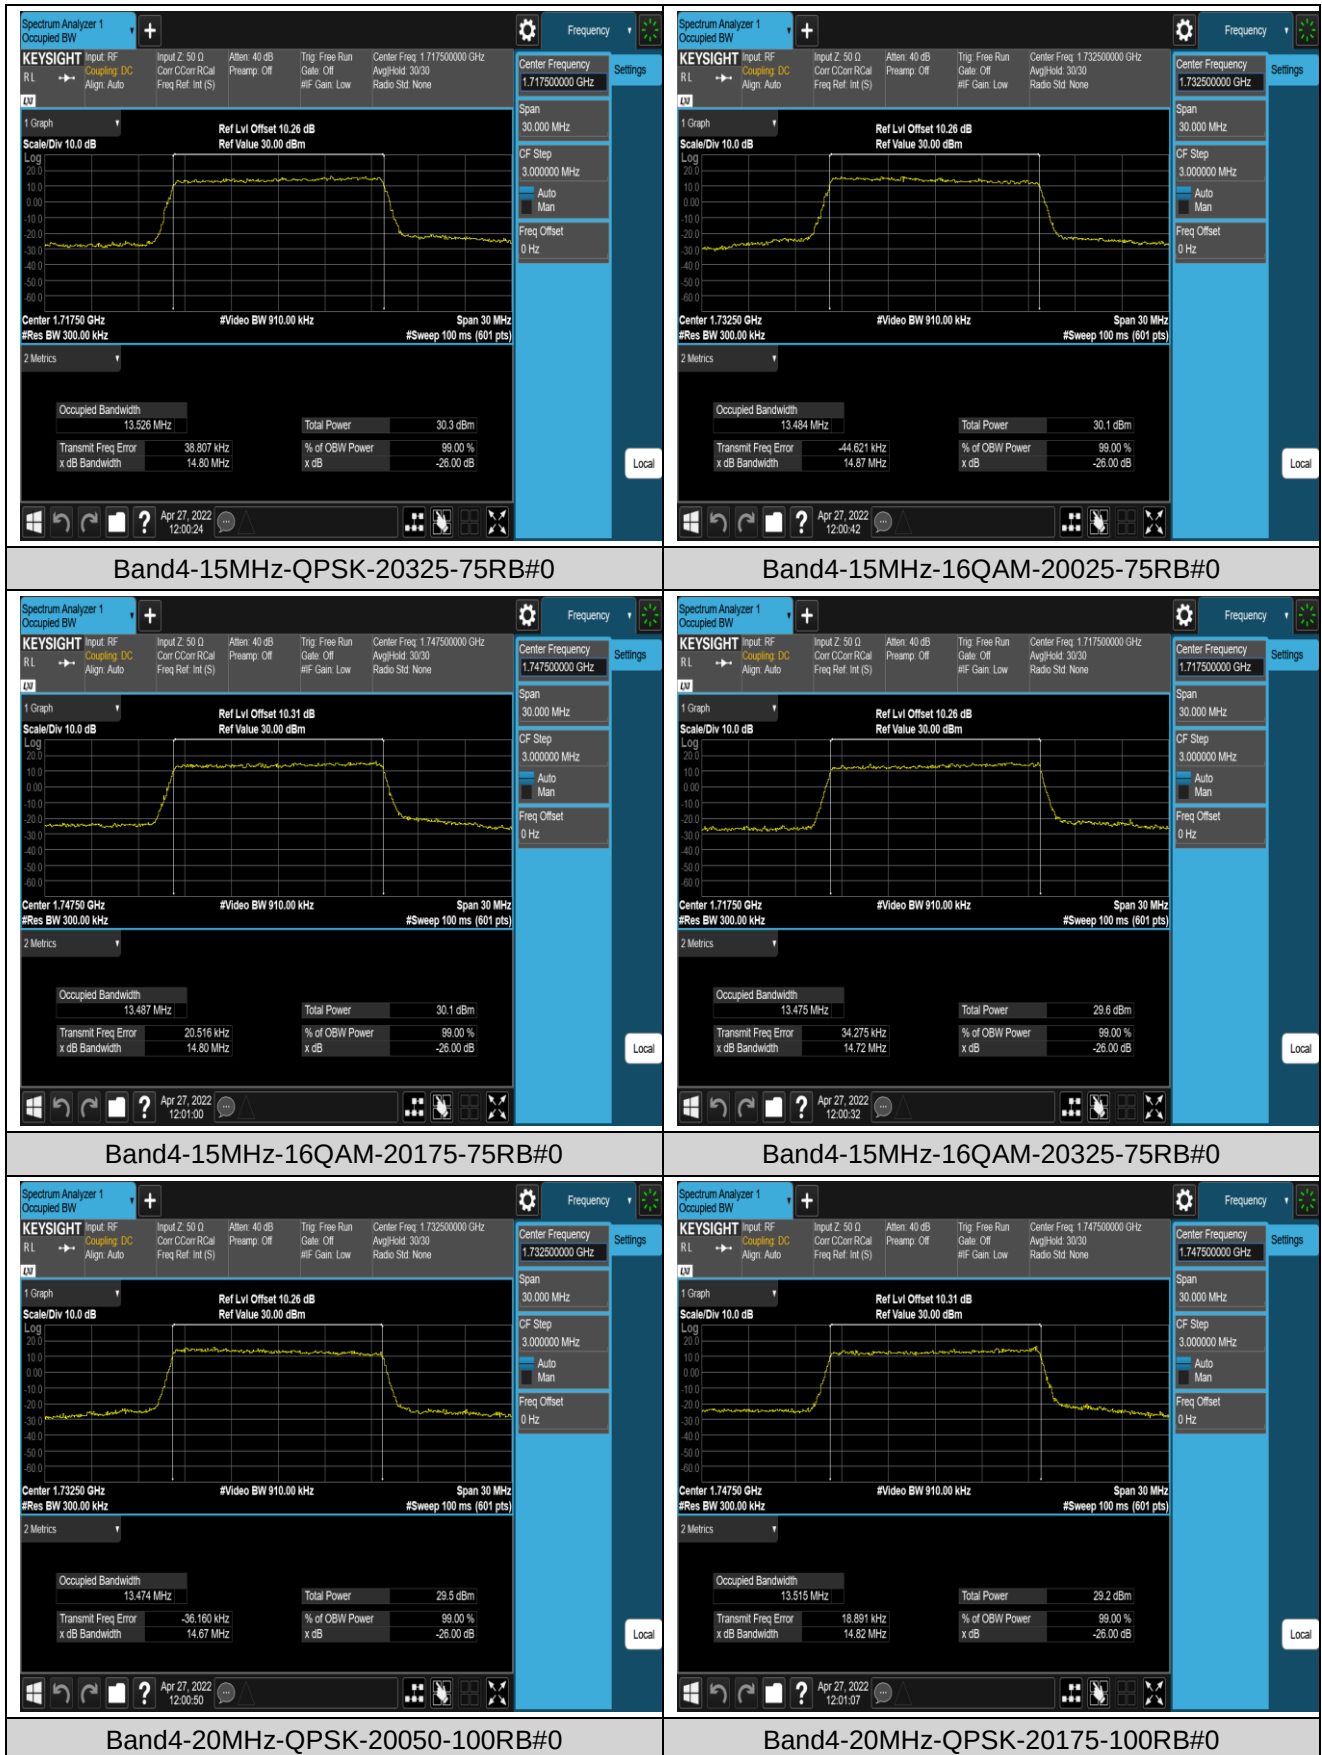

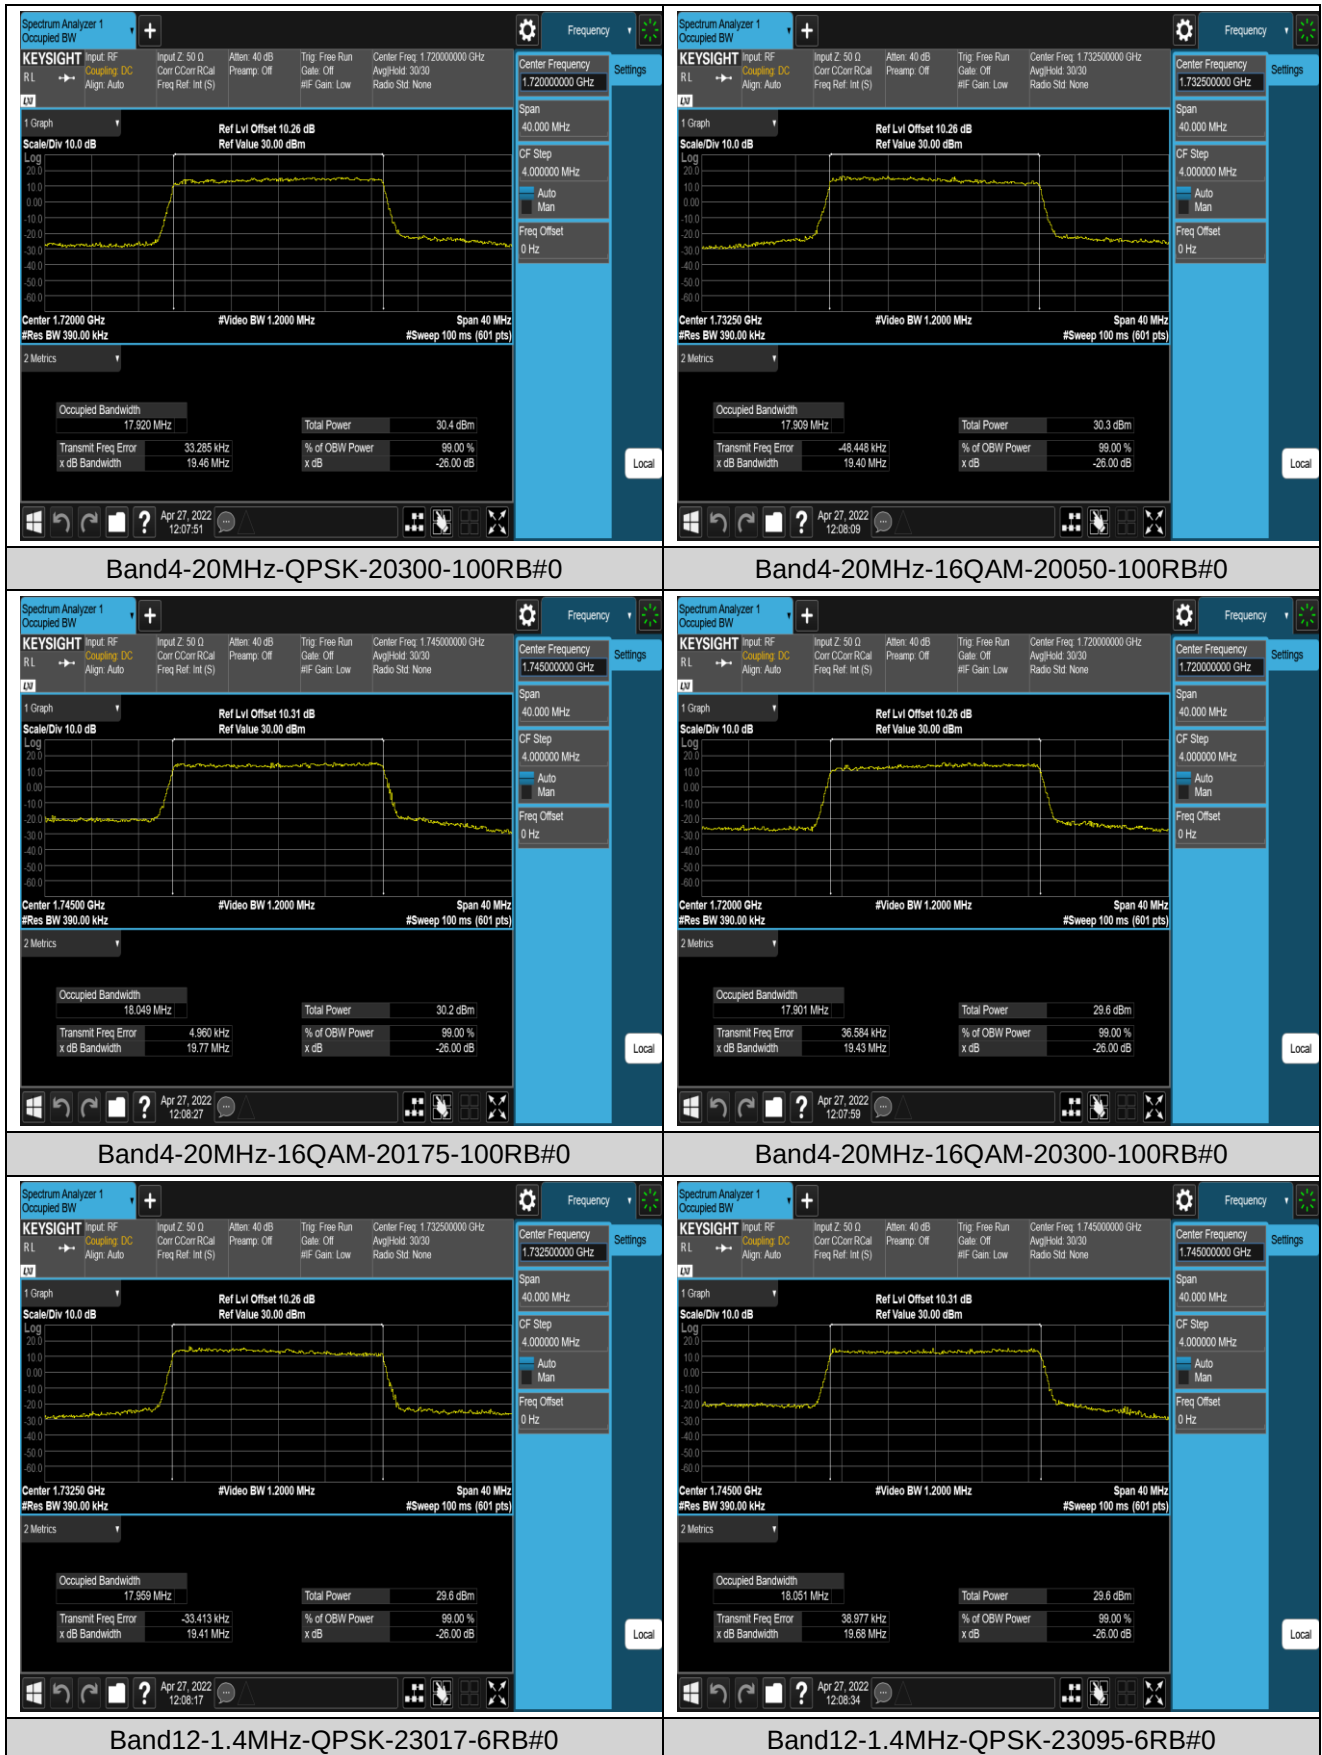

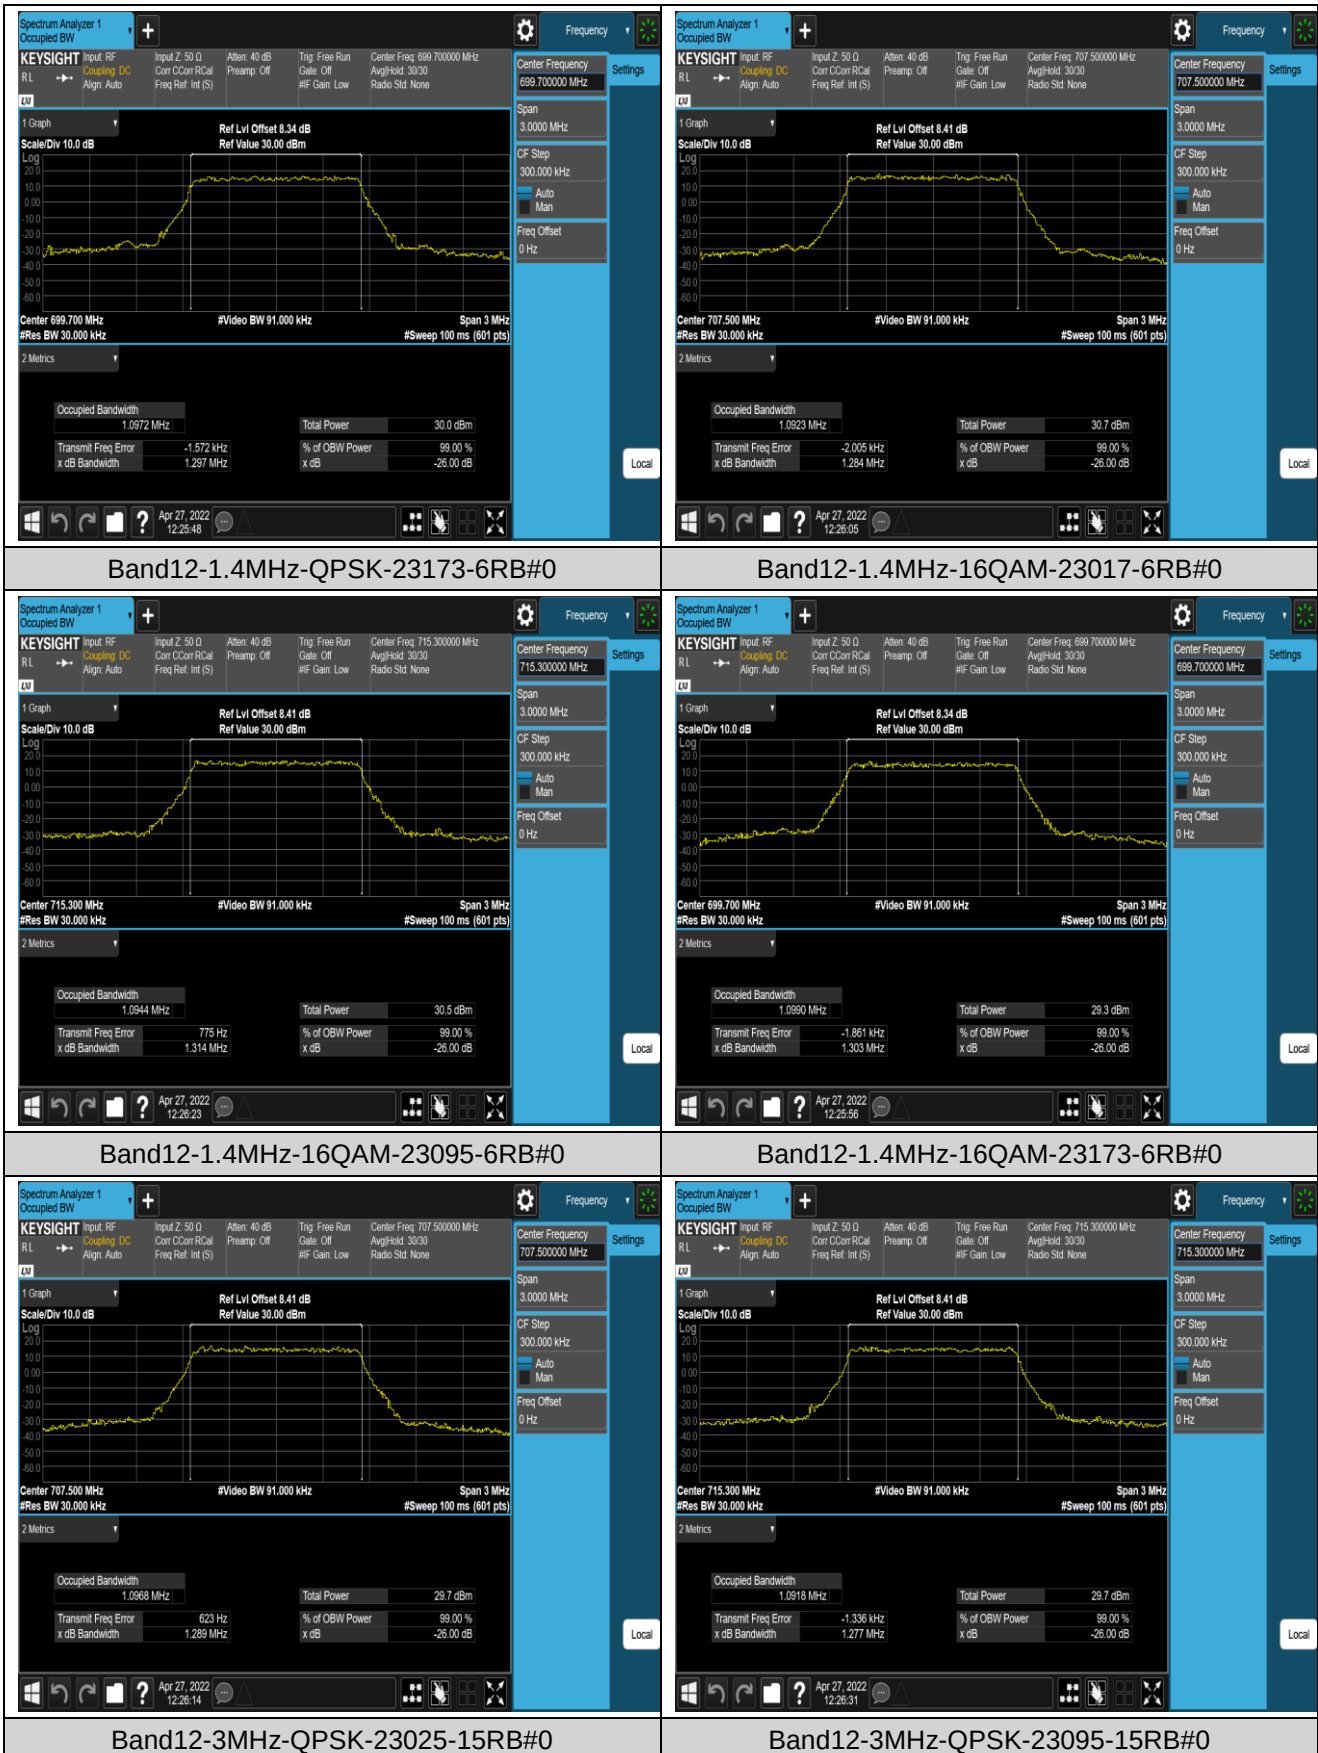

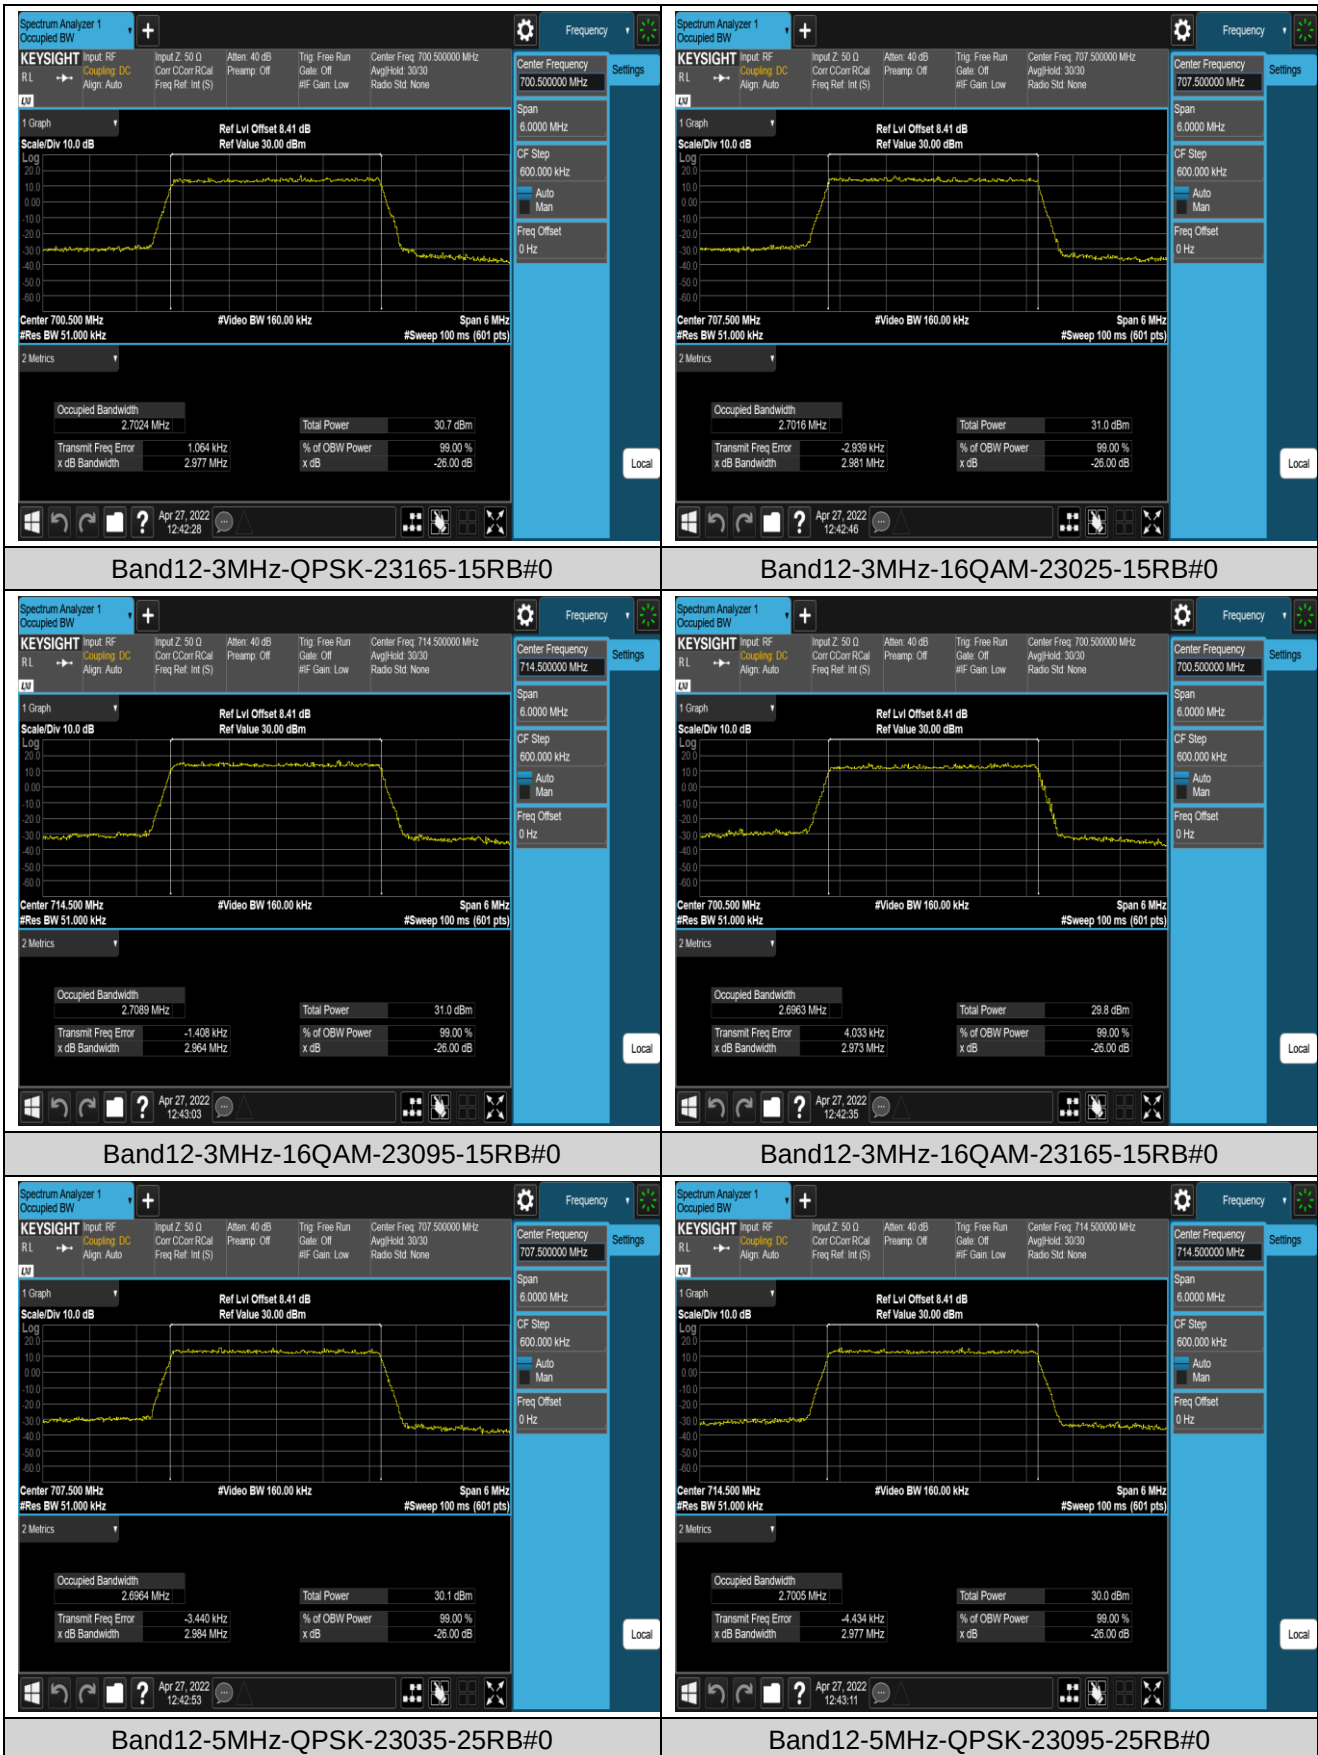



Appendix D: Band Edge


Test Result (worst case)

Band	Bandwidth	Modulation	Channel	RB Config.	Result (dBm)	Verdict
Band2	1.4MHz	QPSK	18607	1RB#0	-43.59,-51.12	PASS
Band2	1.4MHz	QPSK	18607	1RB#5	-54.73,-72.47	PASS
Band2	1.4MHz	QPSK	18607	6RB#0	-47.10,-49.02	PASS
Band2	1.4MHz	QPSK	19193	1RB#0	-71.54,-54.37	PASS
Band2	1.4MHz	QPSK	19193	1RB#5	-48.99,-41.76	PASS
Band2	1.4MHz	QPSK	19193	6RB#0	-46.24,-44.65	PASS
Band2	1.4MHz	16QAM	18607	1RB#0	-45.56,-54.59	PASS
Band2	1.4MHz	16QAM	18607	1RB#5	-54.83,-72.99	PASS
Band2	1.4MHz	16QAM	18607	6RB#0	-48.75,-50.33	PASS
Band2	1.4MHz	16QAM	19193	1RB#0	-72.32,-54.43	PASS
Band2	1.4MHz	16QAM	19193	1RB#5	-50.74,-43.67	PASS
Band2	1.4MHz	16QAM	19193	6RB#0	-47.49,-46.50	PASS
Band2	20MHz	QPSK	18700	1RB#0	-41.51,-51.80	PASS
Band2	20MHz	QPSK	18700	1RB#99	-54.08,-71.88	PASS
Band2	20MHz	QPSK	18700	100RB#0	-30.30,-33.68	PASS
Band2	20MHz	QPSK	19100	1RB#0	-71.54,-54.15	PASS
Band2	20MHz	QPSK	19100	1RB#99	-50.18,-39.69	PASS
Band2	20MHz	QPSK	19100	100RB#0	-32.67,-29.17	PASS
Band2	20MHz	16QAM	18700	1RB#0	-42.49,-50.26	PASS
Band2	20MHz	16QAM	18700	1RB#99	-54.21,-72.14	PASS
Band2	20MHz	16QAM	18700	100RB#0	-31.78,-35.40	PASS
Band2	20MHz	16QAM	19100	1RB#0	-72.11,-54.14	PASS
Band2	20MHz	16QAM	19100	1RB#99	-49.14,-41.38	PASS
Band2	20MHz	16QAM	19100	100RB#0	-34.77,-30.52	PASS
Band4	1.4MHz	QPSK	19957	1RB#0	-16.17,-27.11	PASS
Band4	1.4MHz	QPSK	19957	1RB#5	-39.91,-50.85	PASS
Band4	1.4MHz	QPSK	19957	6RB#0	-27.16,-23.32	PASS
Band4	1.4MHz	QPSK	20393	1RB#0	-52.48,-40.06	PASS
Band4	1.4MHz	QPSK	20393	1RB#5	-27.93,-18.59	PASS
Band4	1.4MHz	QPSK	20393	6RB#0	-23.31,-24.07	PASS
Band4	1.4MHz	16QAM	19957	1RB#0	-18.40,-27.86	PASS
Band4	1.4MHz	16QAM	19957	1RB#5	-41.05,-52.31	PASS
Band4	1.4MHz	16QAM	19957	6RB#0	-27.88,-25.30	PASS
Band4	1.4MHz	16QAM	20393	1RB#0	-53.61,-40.88	PASS
Band4	1.4MHz	16QAM	20393	1RB#5	-30.81,-21.61	PASS
Band4	1.4MHz	16QAM	20393	6RB#0	-25.06,-25.84	PASS

Band4	20MHz	QPSK	20050	1RB#0	-39.32,-48.94	PASS
Band4	20MHz	QPSK	20050	1RB#99	-46.76,-72.09	PASS
Band4	20MHz	QPSK	20050	100RB#0	-35.01,-38.02	PASS
Band4	20MHz	QPSK	20300	1RB#0	-70.83,-53.32	PASS
Band4	20MHz	QPSK	20300	1RB#99	-47.03,-40.62	PASS
Band4	20MHz	QPSK	20300	100RB#0	-31.62,-29.14	PASS
Band4	20MHz	16QAM	20050	1RB#0	-41.72,-49.79	PASS
Band4	20MHz	16QAM	20050	1RB#99	-48.49,-72.38	PASS
Band4	20MHz	16QAM	20050	100RB#0	-34.91,-38.39	PASS
Band4	20MHz	16QAM	20300	1RB#0	-71.69,-54.01	PASS
Band4	20MHz	16QAM	20300	1RB#99	-49.18,-42.13	PASS
Band4	20MHz	16QAM	20300	100RB#0	-34.77,-31.76	PASS
Band12	1.4MHz	QPSK	23017	1RB#0	-36.41,-28.49	PASS
Band12	1.4MHz	QPSK	23017	1RB#5	-43.89,-46.57	PASS
Band12	1.4MHz	QPSK	23017	6RB#0	-33.73,-32.53	PASS
Band12	1.4MHz	QPSK	23173	1RB#0	-46.08,-46.44	PASS
Band12	1.4MHz	QPSK	23173	1RB#5	-27.51,-35.01	PASS
Band12	1.4MHz	QPSK	23173	6RB#0	-32.42,-35.21	PASS
Band12	1.4MHz	16QAM	23017	1RB#0	-37.32,-30.00	PASS
Band12	1.4MHz	16QAM	23017	1RB#5	-46.02,-47.89	PASS
Band12	1.4MHz	16QAM	23017	6RB#0	-33.78,-33.44	PASS
Band12	1.4MHz	16QAM	23173	1RB#0	-47.56,-47.93	PASS
Band12	1.4MHz	16QAM	23173	1RB#5	-29.29,-36.15	PASS
Band12	1.4MHz	16QAM	23173	6RB#0	-33.62,-36.67	PASS
Band12	10MHz	QPSK	23060	1RB#0	-43.68,-40.52	PASS
Band12	10MHz	QPSK	23060	1RB#49	-59.60,-62.02	PASS
Band12	10MHz	QPSK	23060	50RB#0	-38.95,-40.57	PASS
Band12	10MHz	QPSK	23130	1RB#0	-61.52,-59.45	PASS
Band12	10MHz	QPSK	23130	1RB#49	-39.78,-43.16	PASS
Band12	10MHz	QPSK	23130	50RB#0	-39.80,-37.33	PASS
Band12	10MHz	16QAM	23060	1RB#0	-45.65,-41.71	PASS
Band12	10MHz	16QAM	23060	1RB#49	-60.16,-62.99	PASS
Band12	10MHz	16QAM	23060	50RB#0	-40.83,-42.91	PASS
Band12	10MHz	16QAM	23130	1RB#0	-62.68,-59.62	PASS
Band12	10MHz	16QAM	23130	1RB#49	-40.53,-44.36	PASS
Band12	10MHz	16QAM	23130	50RB#0	-42.03,-40.19	PASS

Remark: All bandwidth and all modulation had been tested, but only the worst case data displayed in this report.

Test Graphs

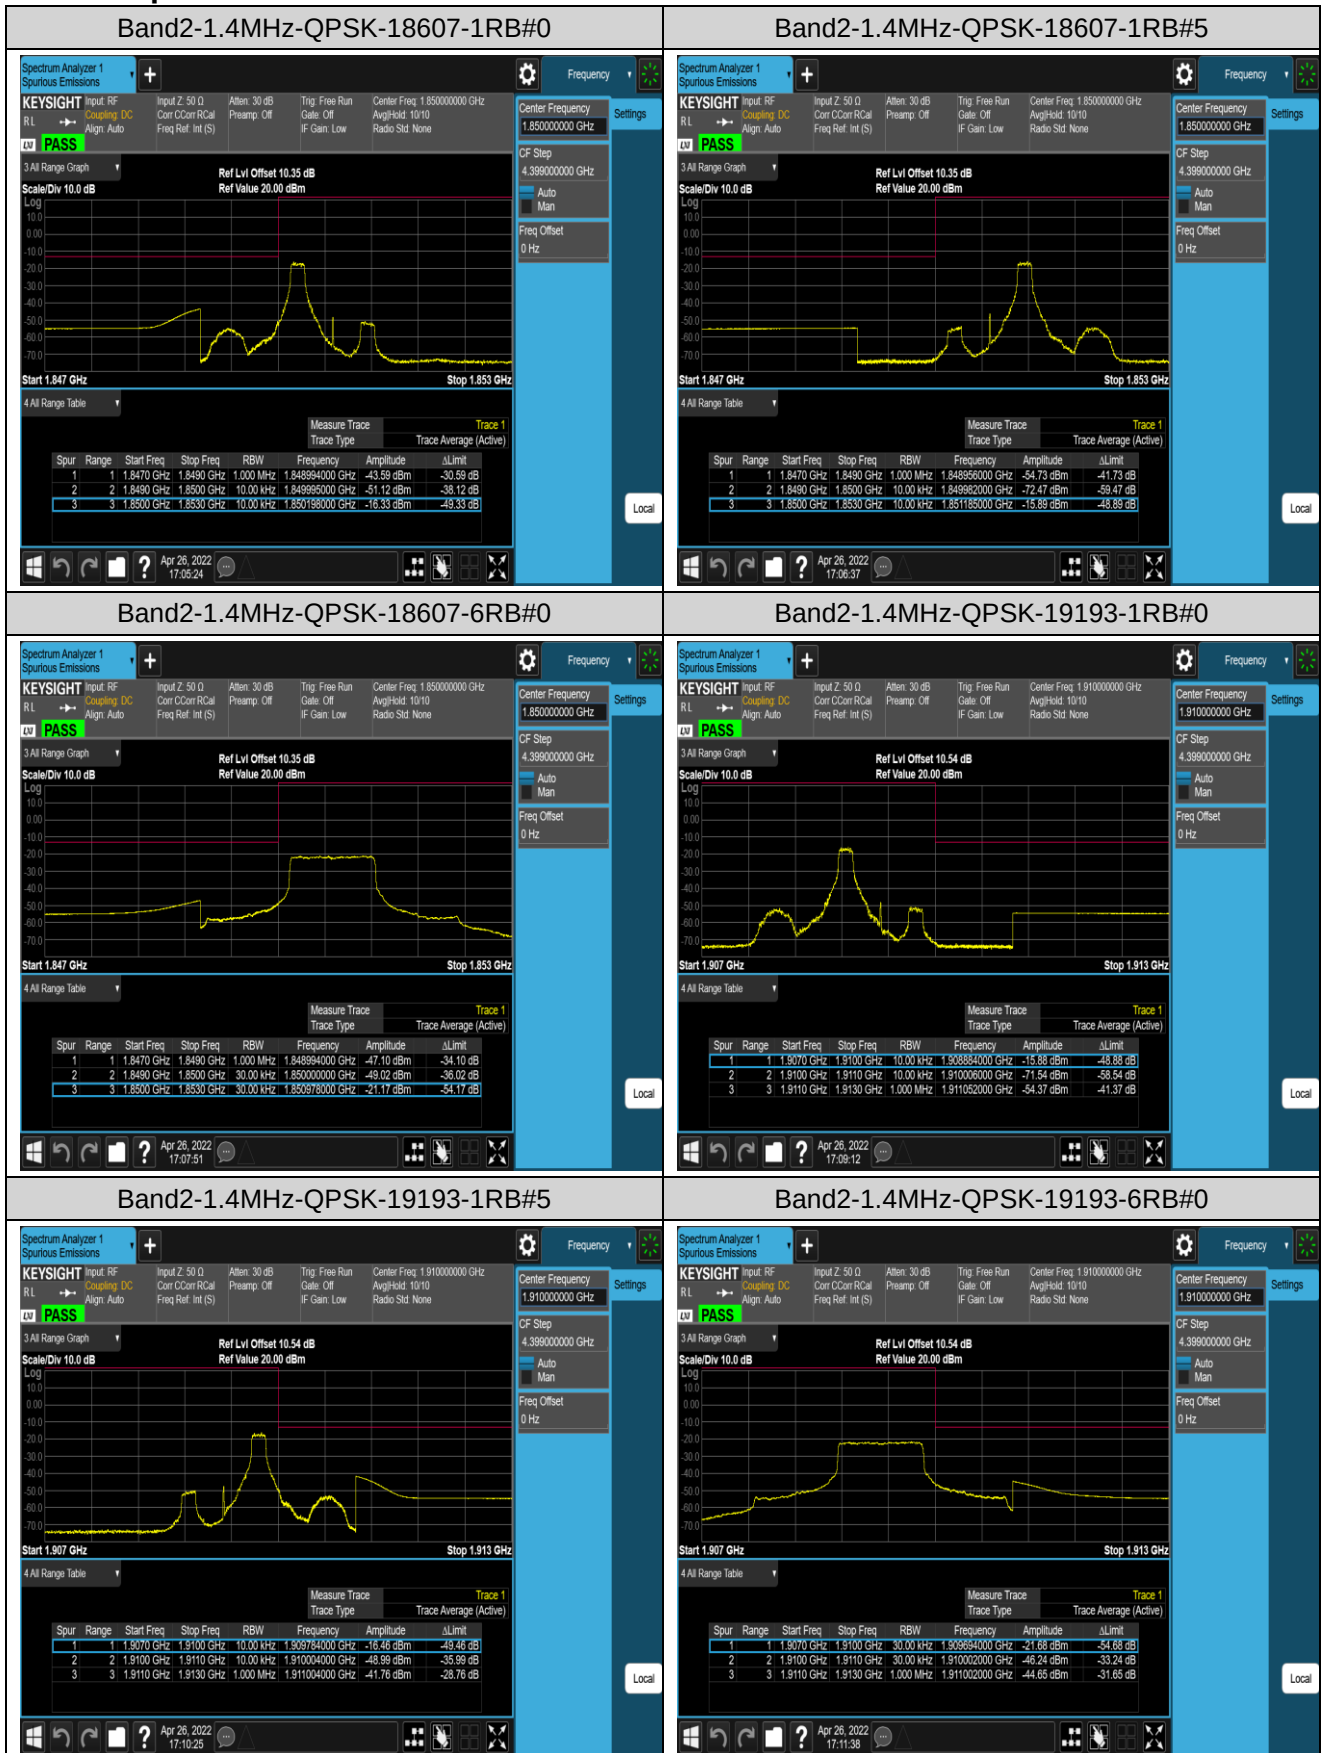

JianYan Testing Group Shenzhen Co., Ltd.

No.101, Building 8, Innovation Wisdom Port, No.155 Hongtian Road, Huangpu Community, Xinqiao Street, Bao'an District, Shenzhen, Guangdong, People's Republic of China.

Tel: +86-755-23118282, Fax: +86-755-23116366

Project No.: JYTSZR2204002

