



Appendix F

RF Test Data for 5.5GWIFI (Conducted Measurement)

Product Name: Cordless Wi-Fi Phone

Test Model: UCW10

Environmental Conditions

Temperature:	24.8° C
Relative Humidity:	53.6%
ATM Pressure:	100.0 kPa
Test Engineer:	Jerry Chu
Supervised by:	Can Kun





F.1 -26dB Bandwidth

Condition	Mode	Frequency (MHz)	Antenna	-26 dB Bandwidth (MHz)
NVNT	a	5500	Ant2	29.16
NVNT	a	5580	Ant2	29.21
NVNT	a	5700	Ant2	28.47
NVNT	n20	5500	Ant2	29.74
NVNT	n20	5580	Ant2	29.07
NVNT	n20	5700	Ant2	29.65
NVNT	n40	5510	Ant2	50.52
NVNT	n40	5550	Ant2	54.17
NVNT	n40	5670	Ant2	51.32
NVNT	ac20	5500	Ant2	29.48
NVNT	ac20	5580	Ant2	28.24
NVNT	ac20	5700	Ant2	29.48
NVNT	ac40	5510	Ant2	57.49
NVNT	ac40	5550	Ant2	56.25
NVNT	ac40	5670	Ant2	56.34
NVNT	ac80	5530	Ant2	86.81
NVNT	ac80	5610	Ant2	87.66
NVNT	ax20	5500	Ant2	29.53
NVNT	ax20	5580	Ant2	29.74
NVNT	ax20	5700	Ant2	29.14
NVNT	ax40	5510	Ant2	58.72
NVNT	ax40	5550	Ant2	56.88
NVNT	ax40	5670	Ant2	57.5
NVNT	ax80	5530	Ant2	90.37
NVNT	ax80	5610	Ant2	86.52




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

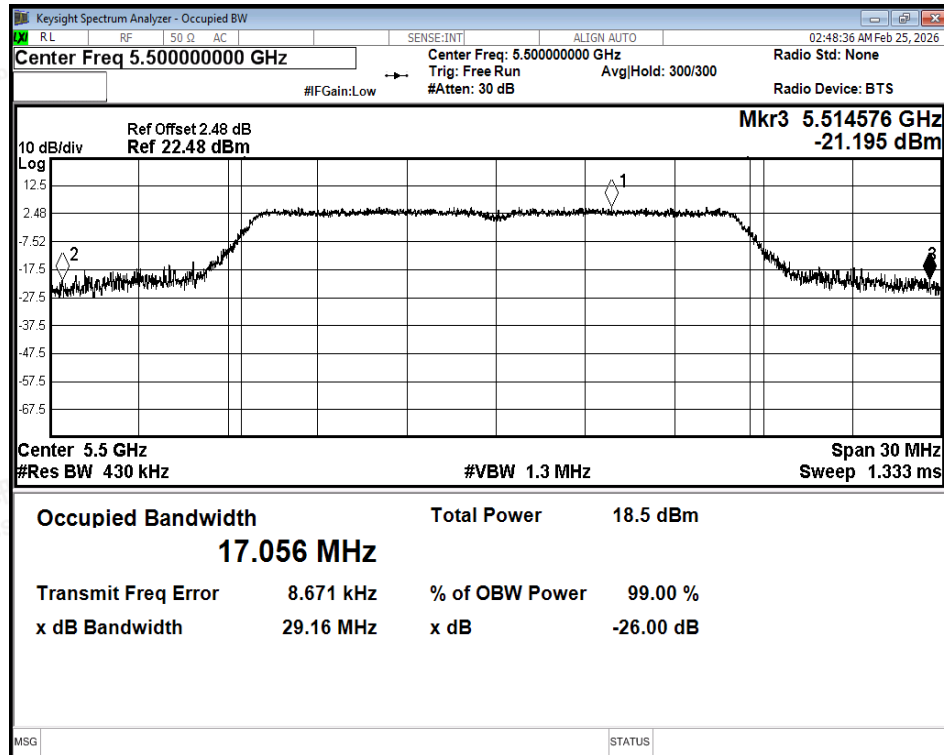


-26dB Bandwidth NVNT a 5500MHz Ant2

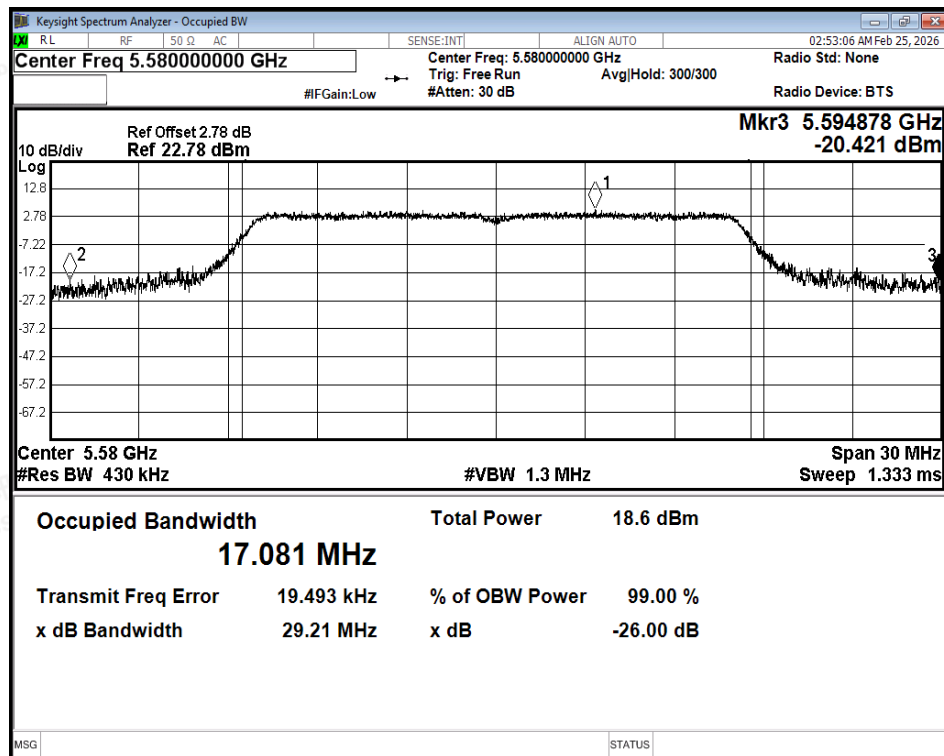


-26dB Bandwidth NVNT a 5580MHz Ant2



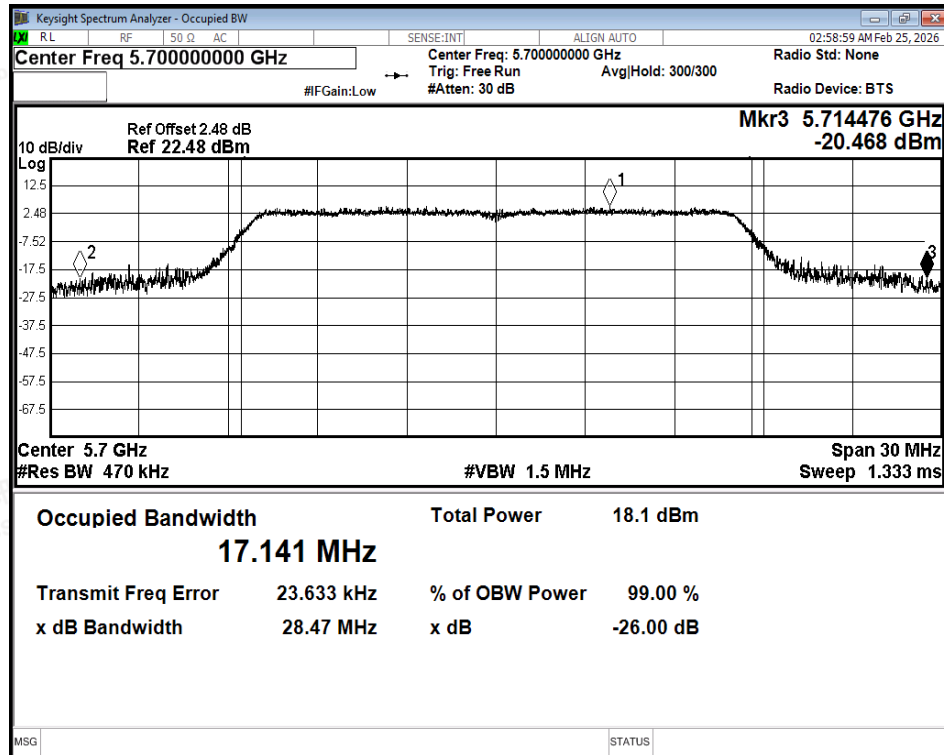


-26dB Bandwidth NVNT a 5700MHz Ant2

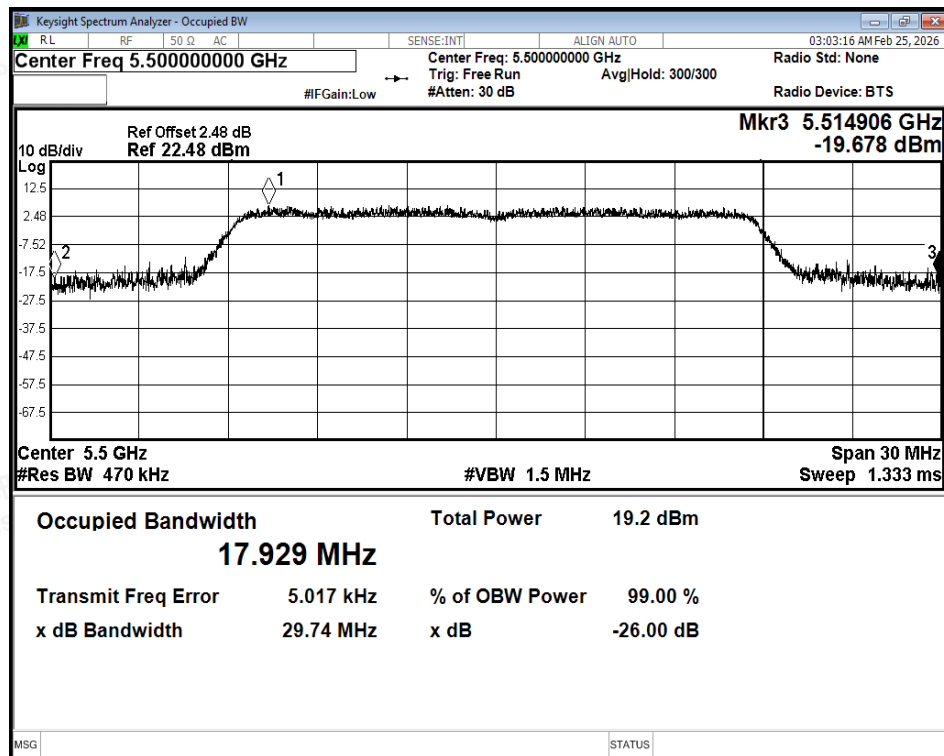


-26dB Bandwidth NVNT n20 5500MHz Ant2



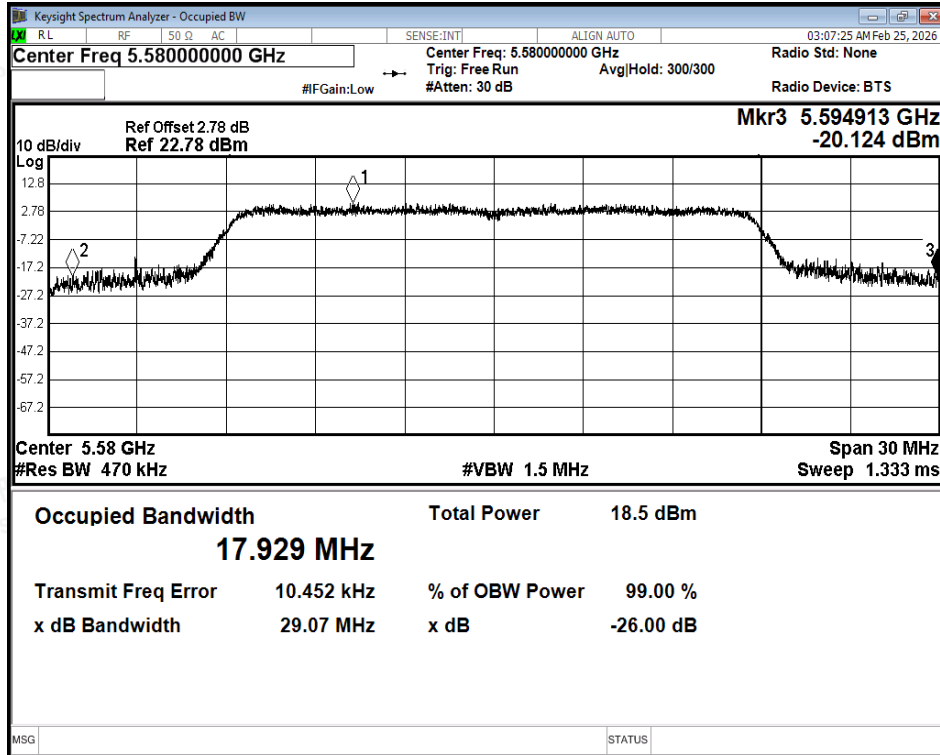


-26dB Bandwidth NVNT n20 5580MHz Ant2

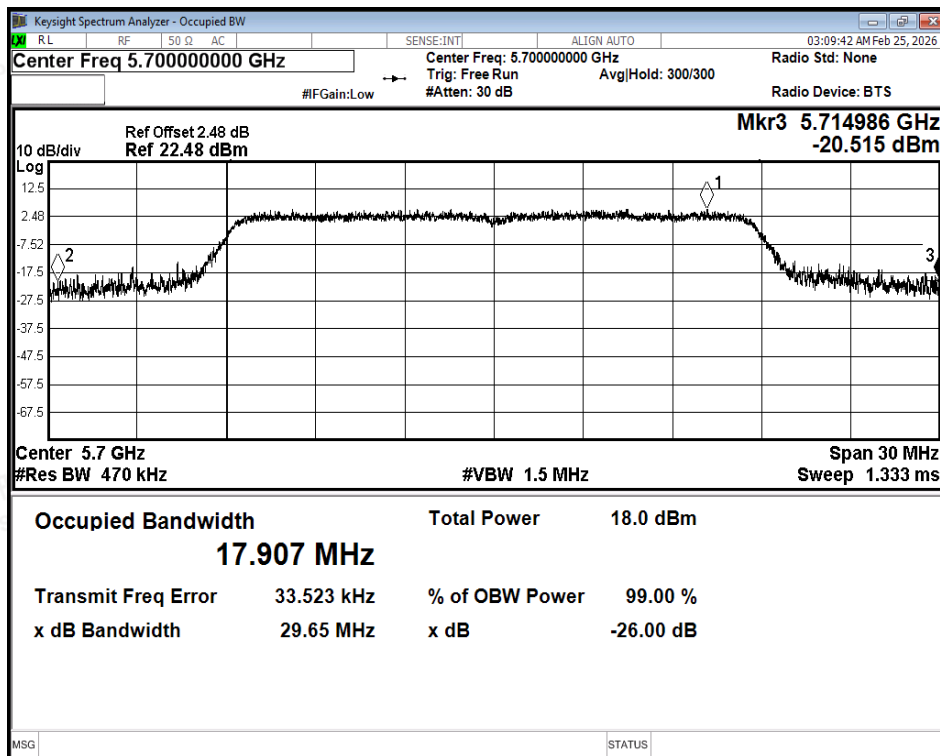


-26dB Bandwidth NVNT n20 5700MHz Ant2



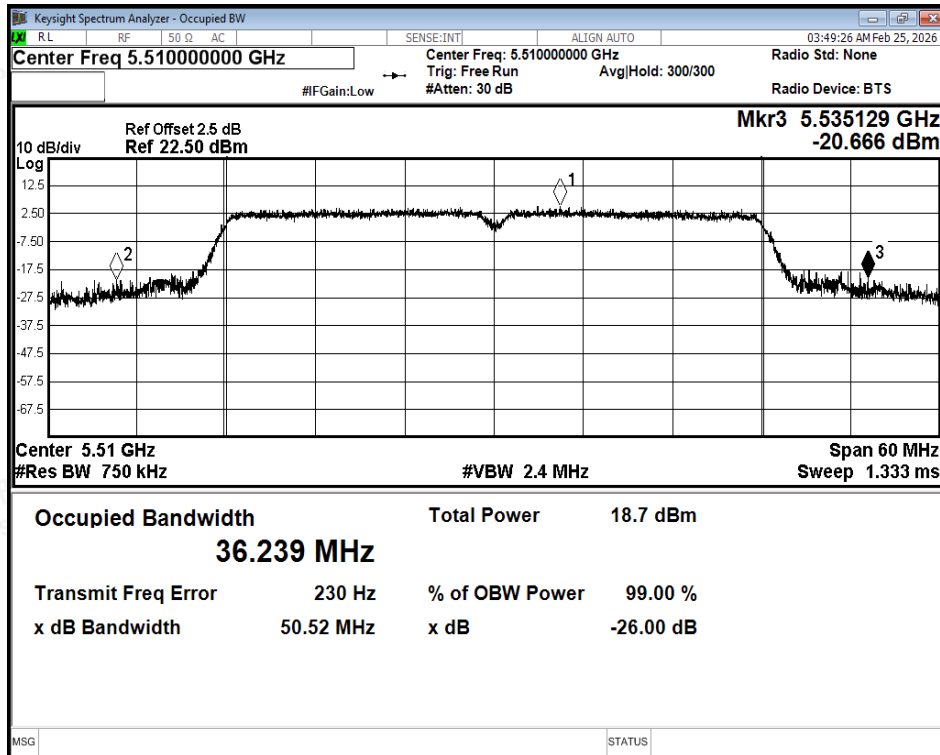


-26dB Bandwidth NVNT n40 5510MHz Ant2

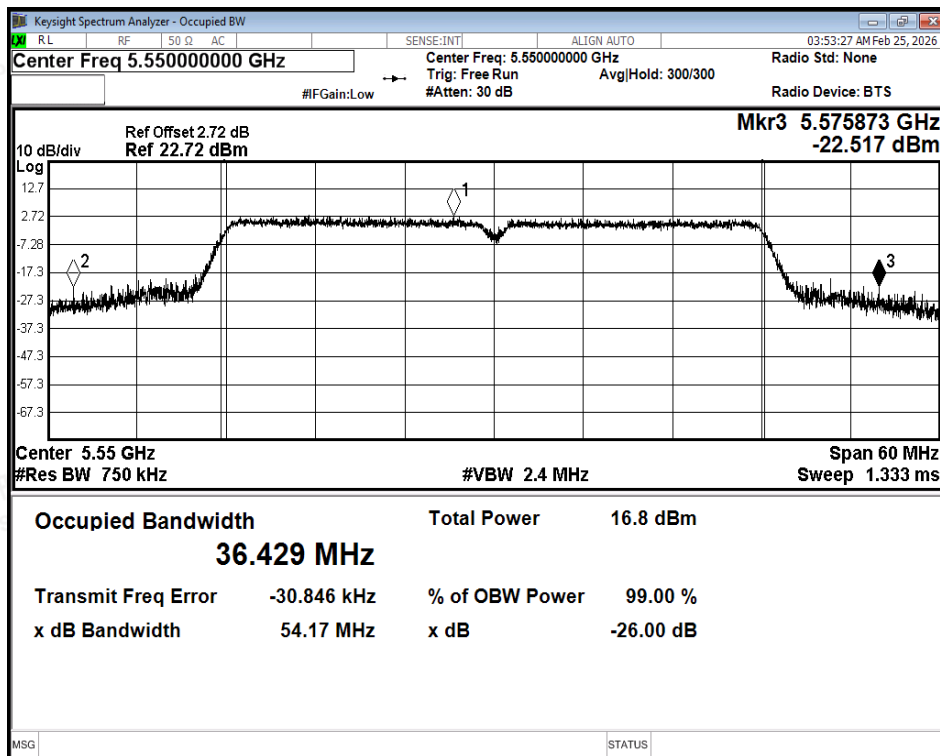


-26dB Bandwidth NVNT n40 5550MHz Ant2



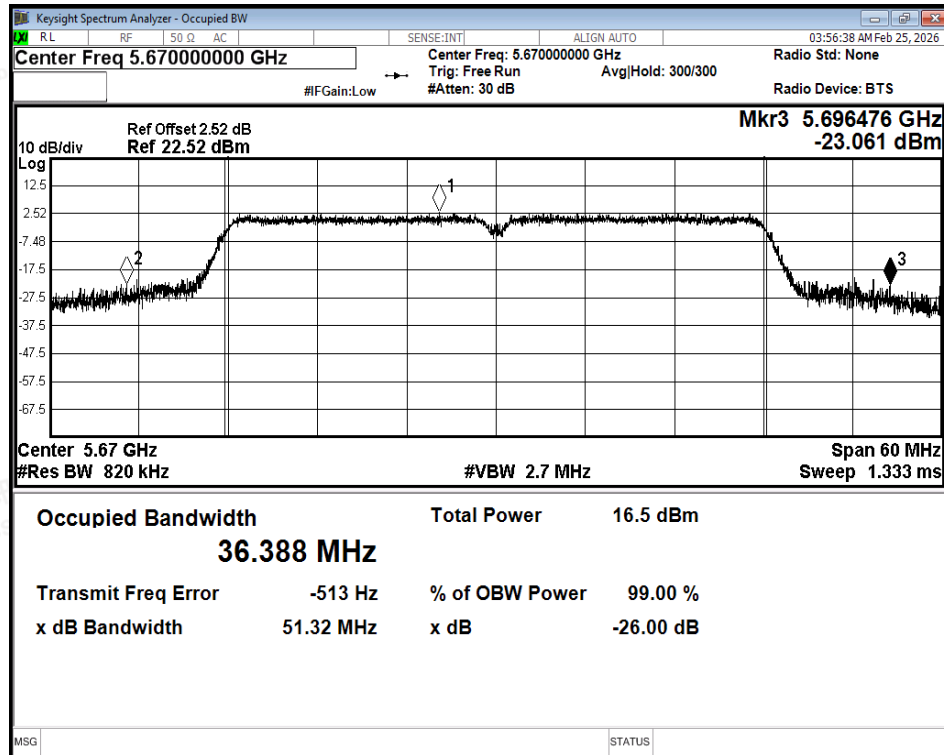


-26dB Bandwidth NVNT n40 5670MHz Ant2

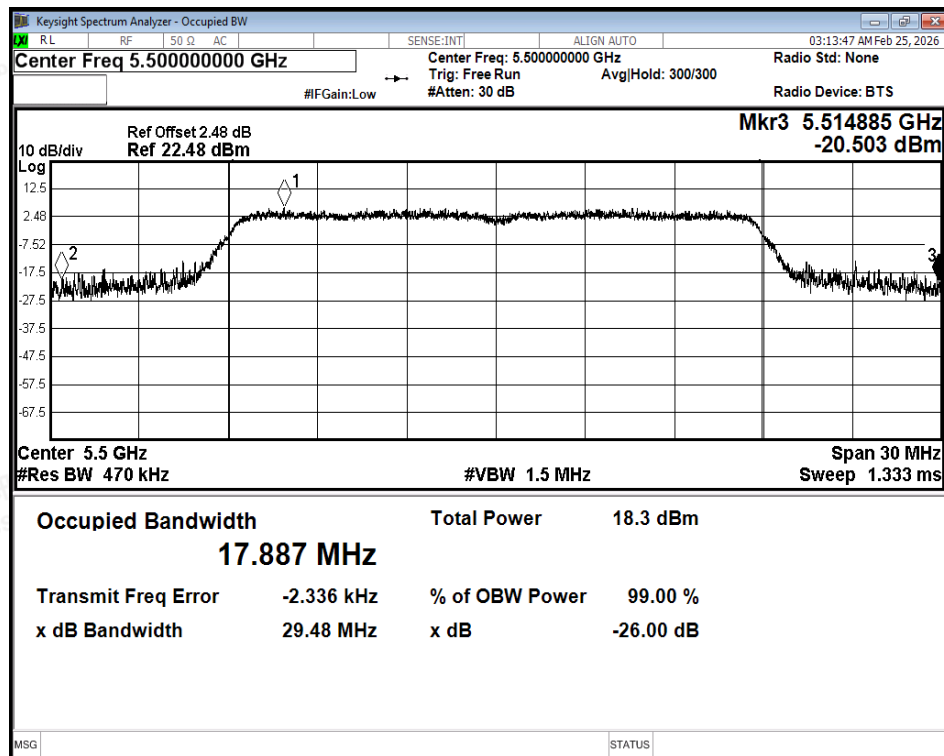


-26dB Bandwidth NVNT ac20 5500MHz Ant2



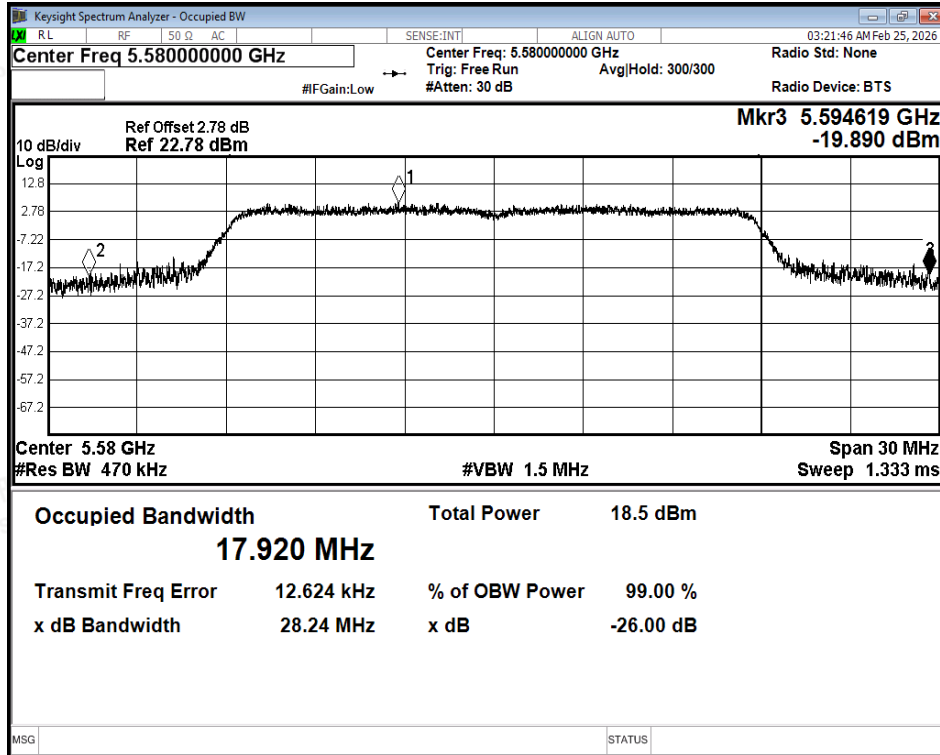


-26dB Bandwidth NVNT ac20 5580MHz Ant2

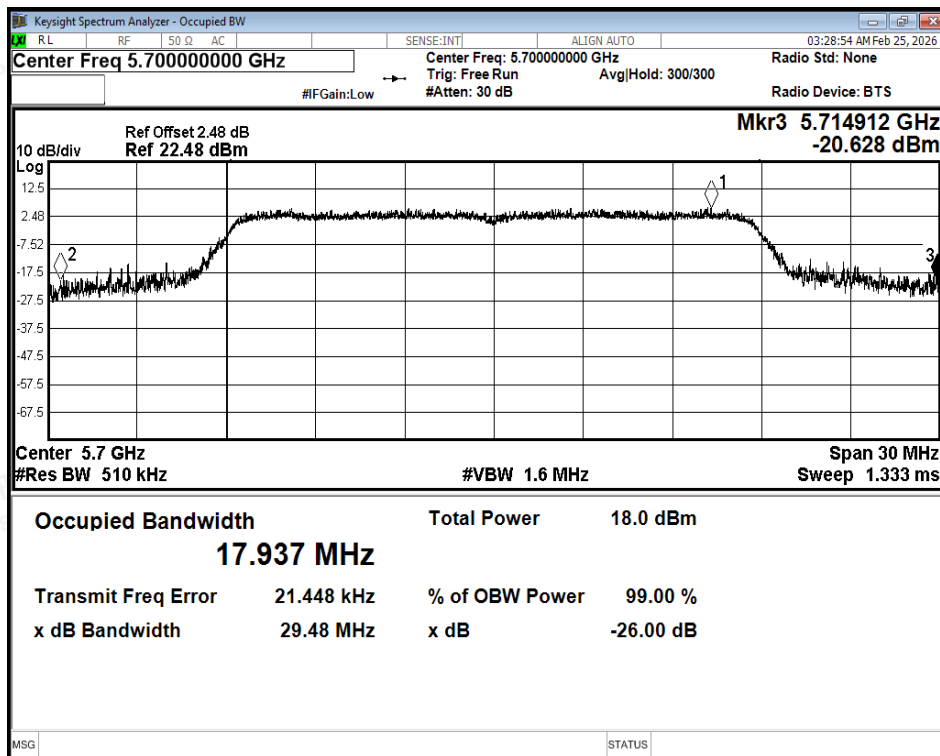


-26dB Bandwidth NVNT ac20 5700MHz Ant2



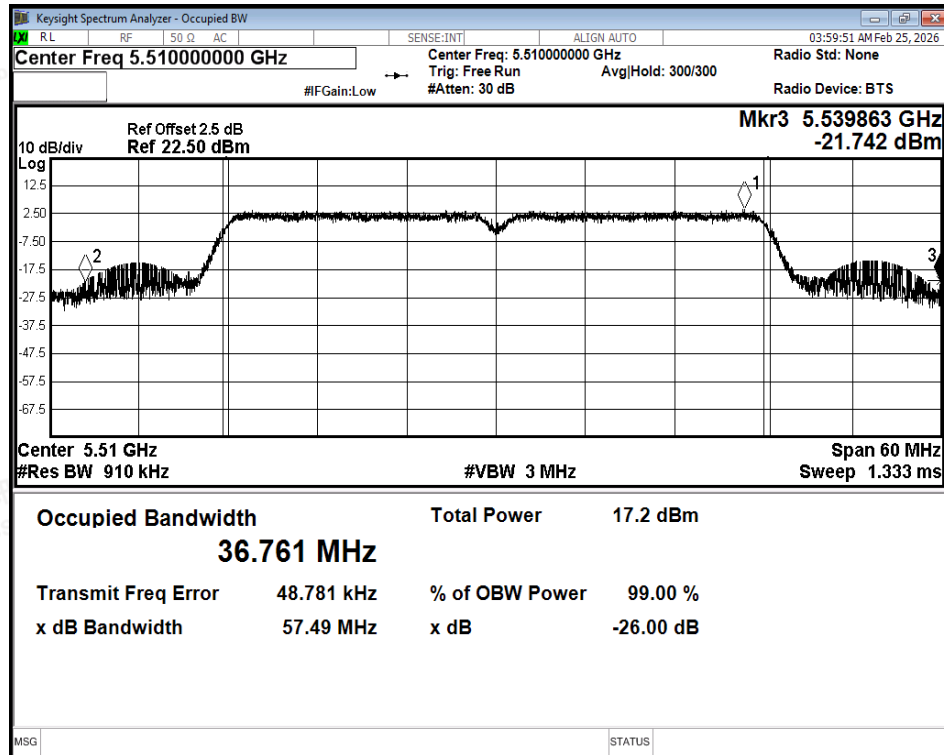


-26dB Bandwidth NVNT ac40 5510MHz Ant2

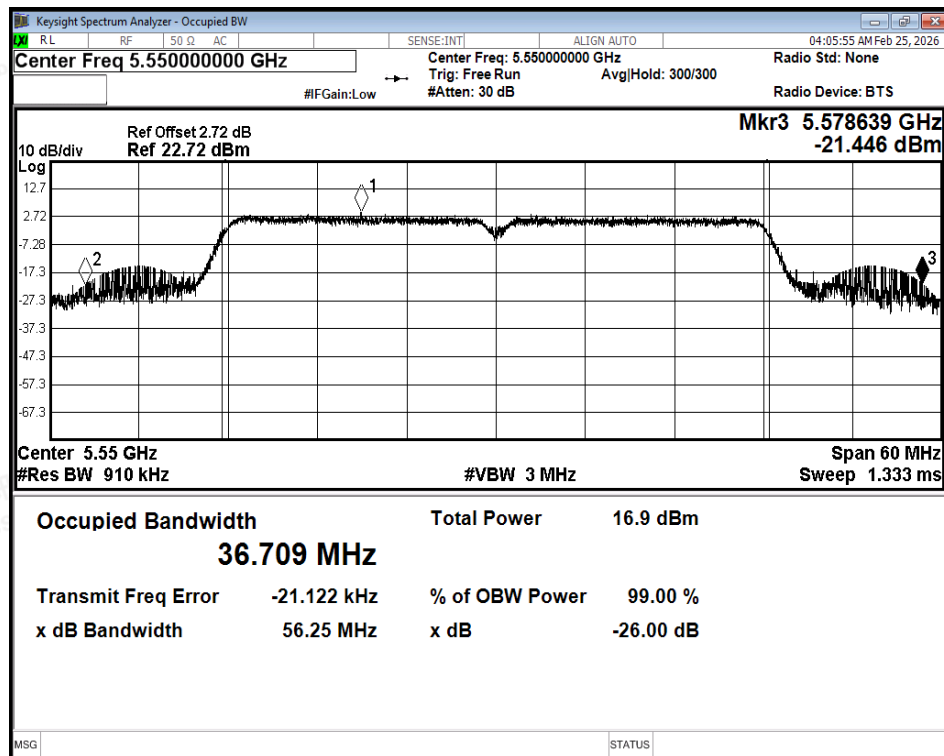


-26dB Bandwidth NVNT ac40 5550MHz Ant2



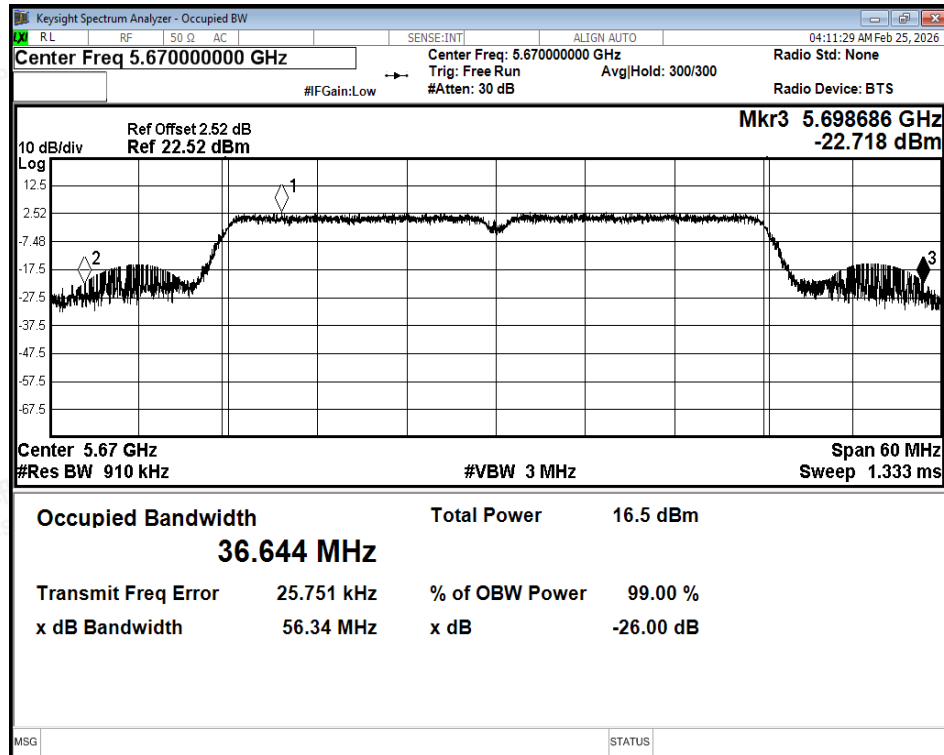

-26dB Bandwidth NVNT ac40 5670MHz Ant2

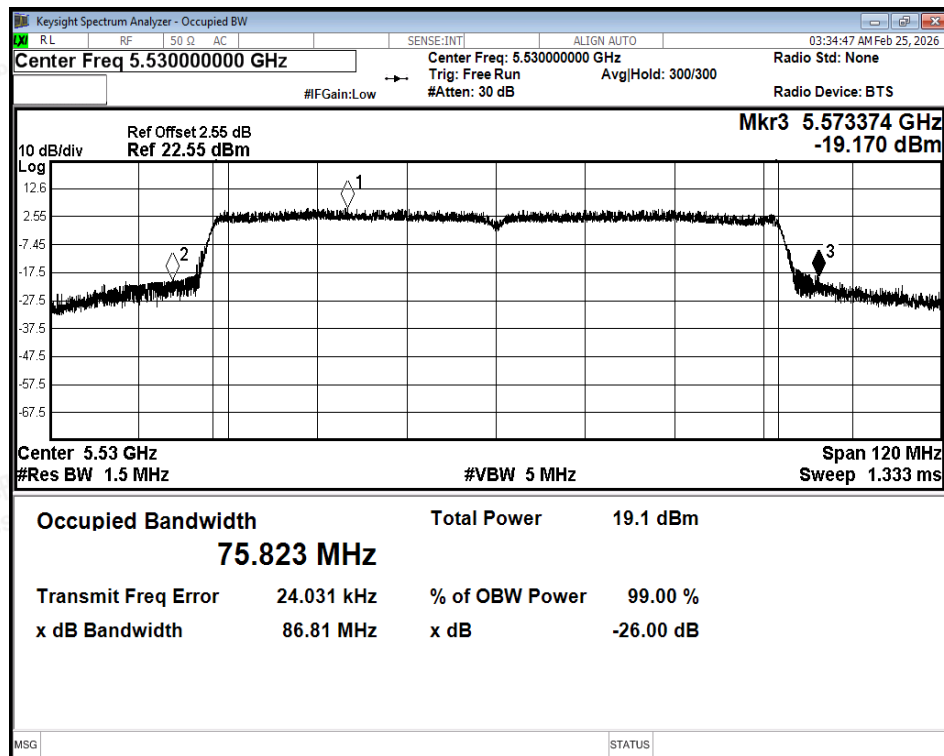

-26dB Bandwidth NVNT ac80 5530MHz Ant2




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

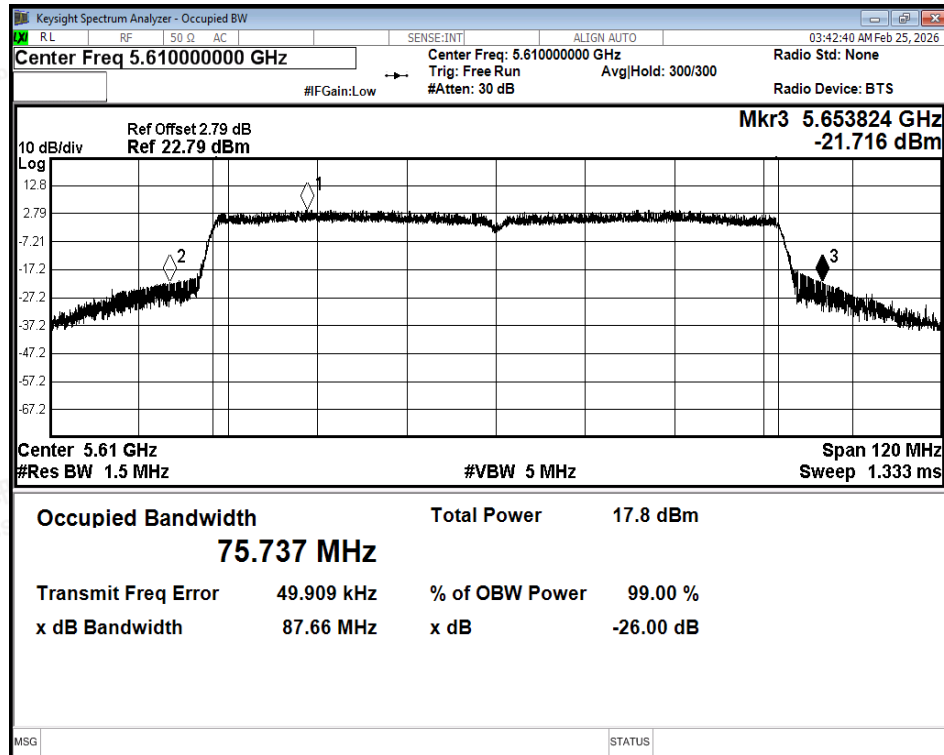

-26dB Bandwidth NVNT ac80 5610MHz Ant2

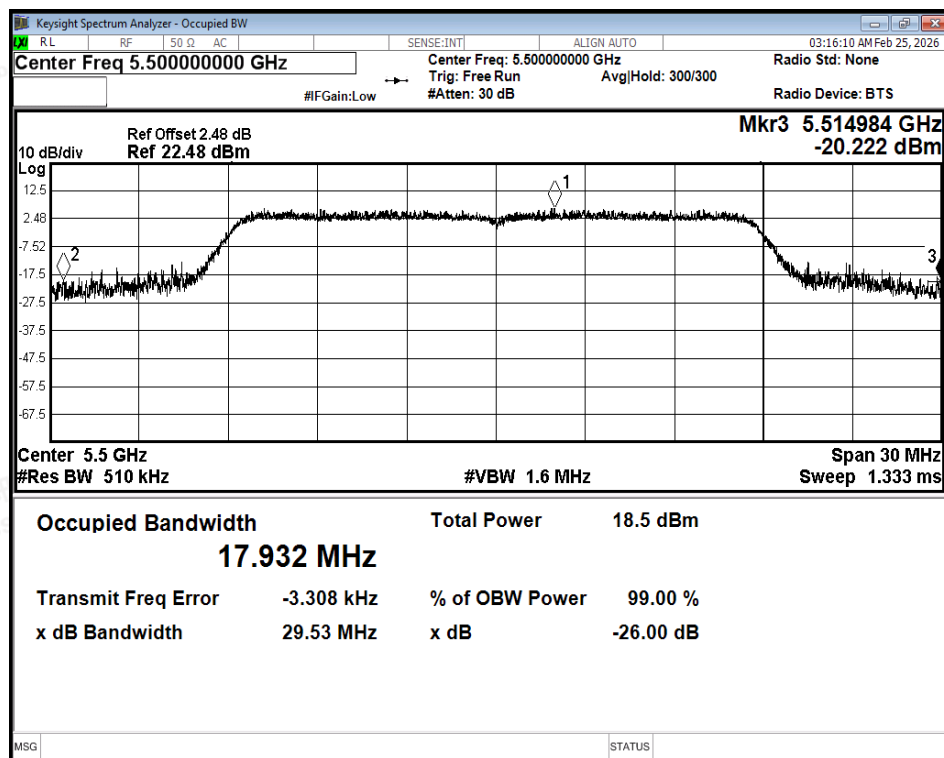

-26dB Bandwidth NVNT ax20 5500MHz Ant2




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

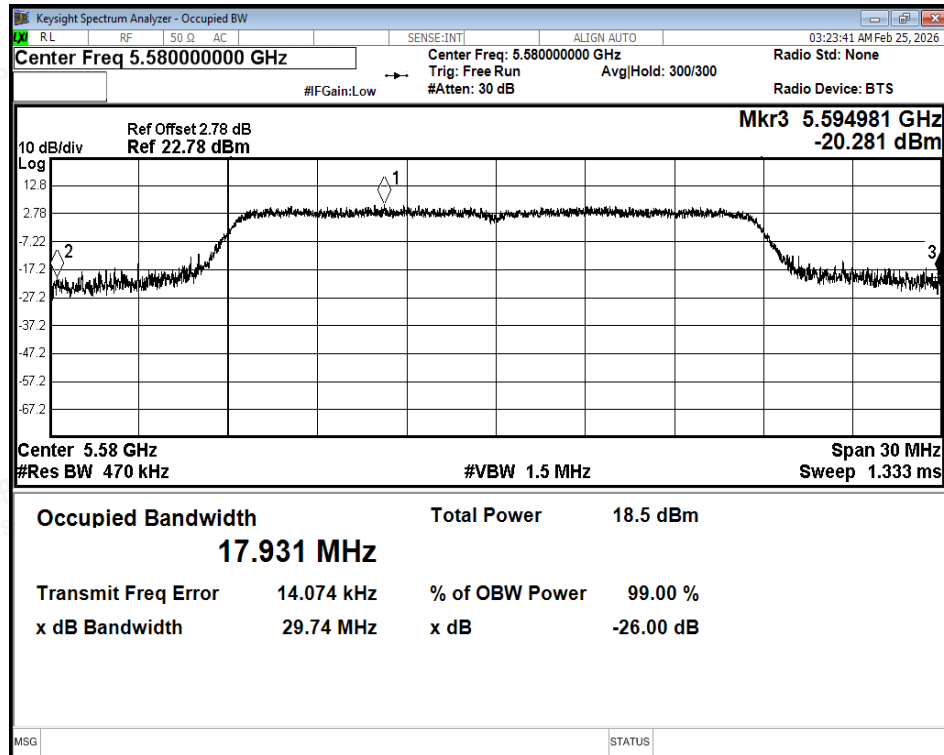

-26dB Bandwidth NVNT ax20 5580MHz Ant2

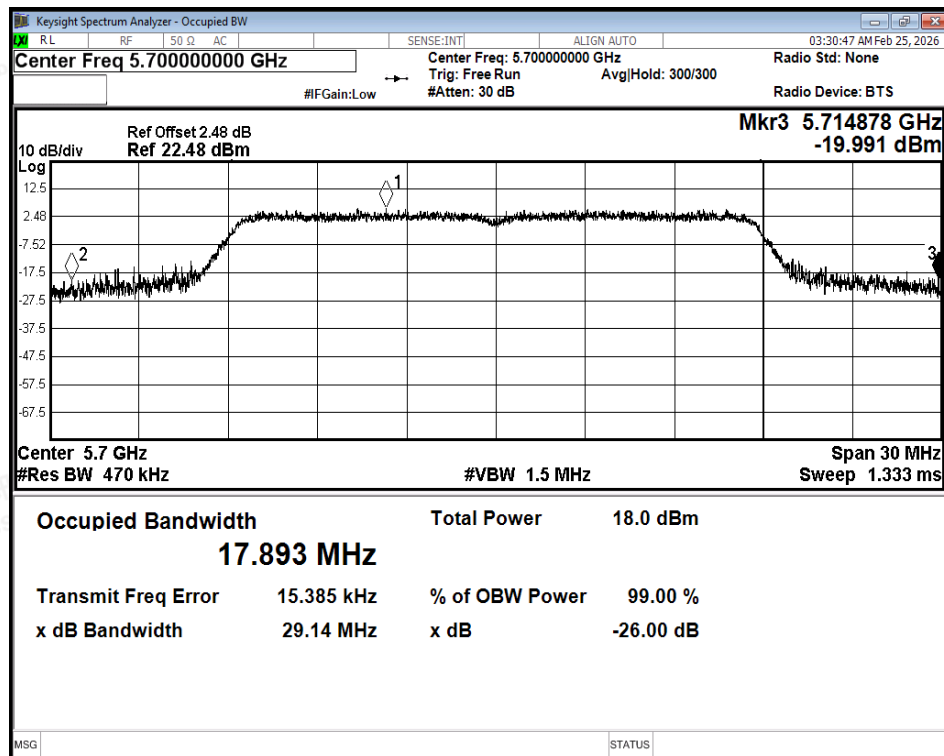

-26dB Bandwidth NVNT ax20 5700MHz Ant2




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

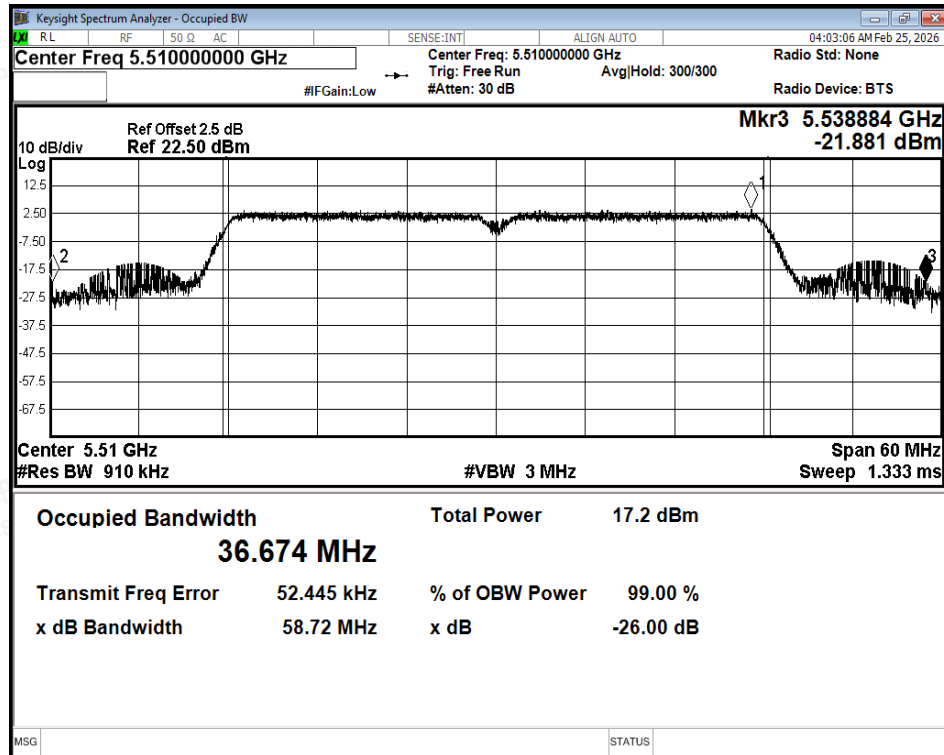

-26dB Bandwidth NVNT ax40 5510MHz Ant2

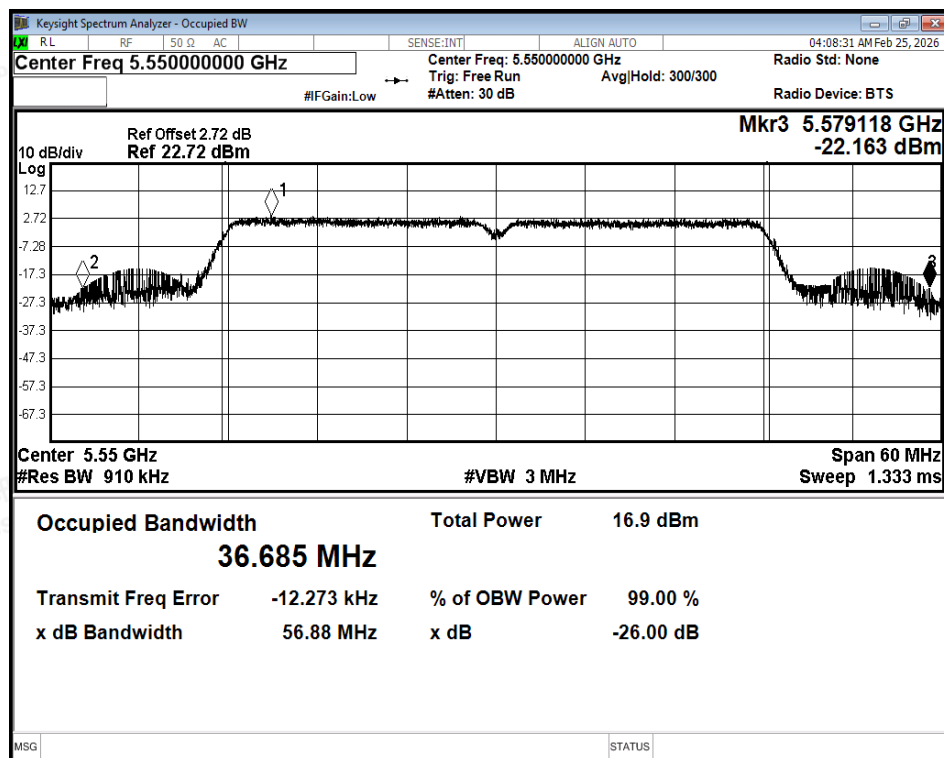

-26dB Bandwidth NVNT ax40 5550MHz Ant2




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

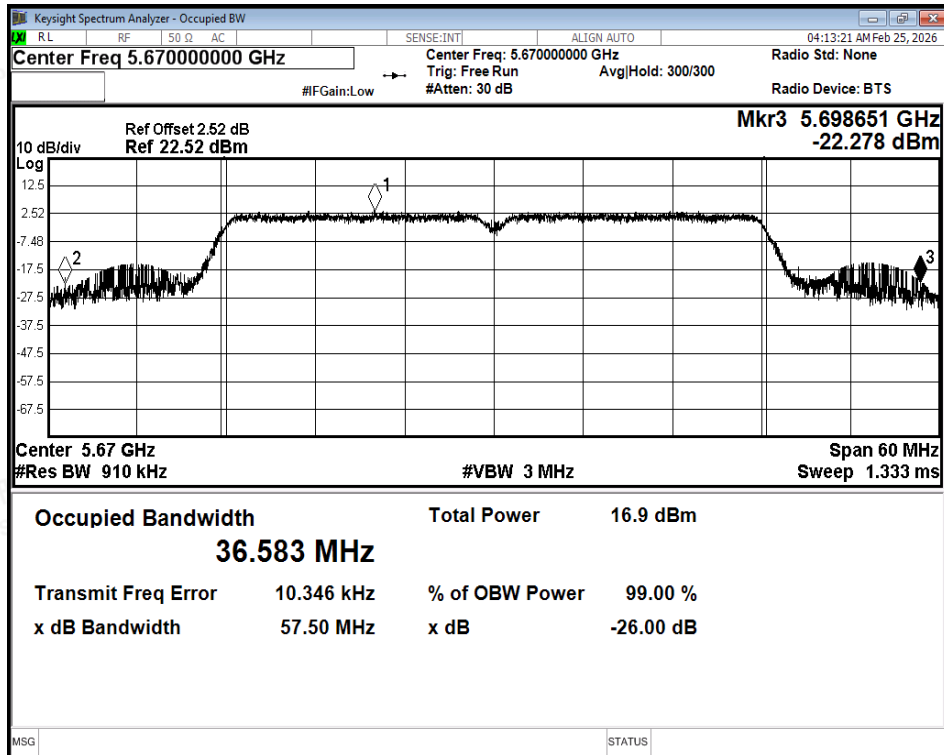

-26dB Bandwidth NVNT ax40 5670MHz Ant2

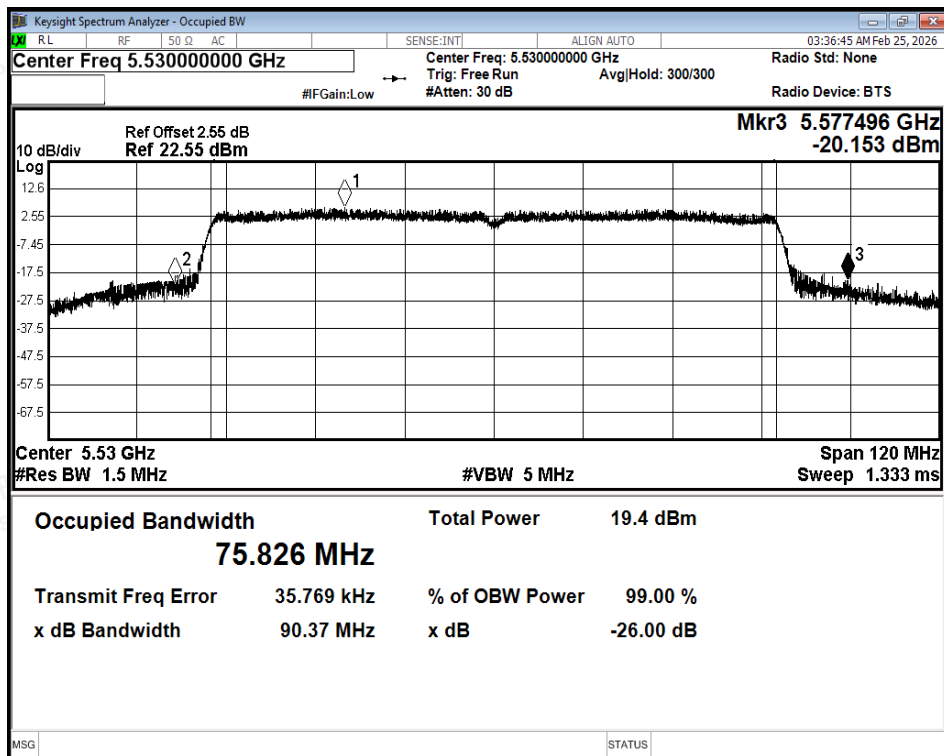

-26dB Bandwidth NVNT ax80 5530MHz Ant2




Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

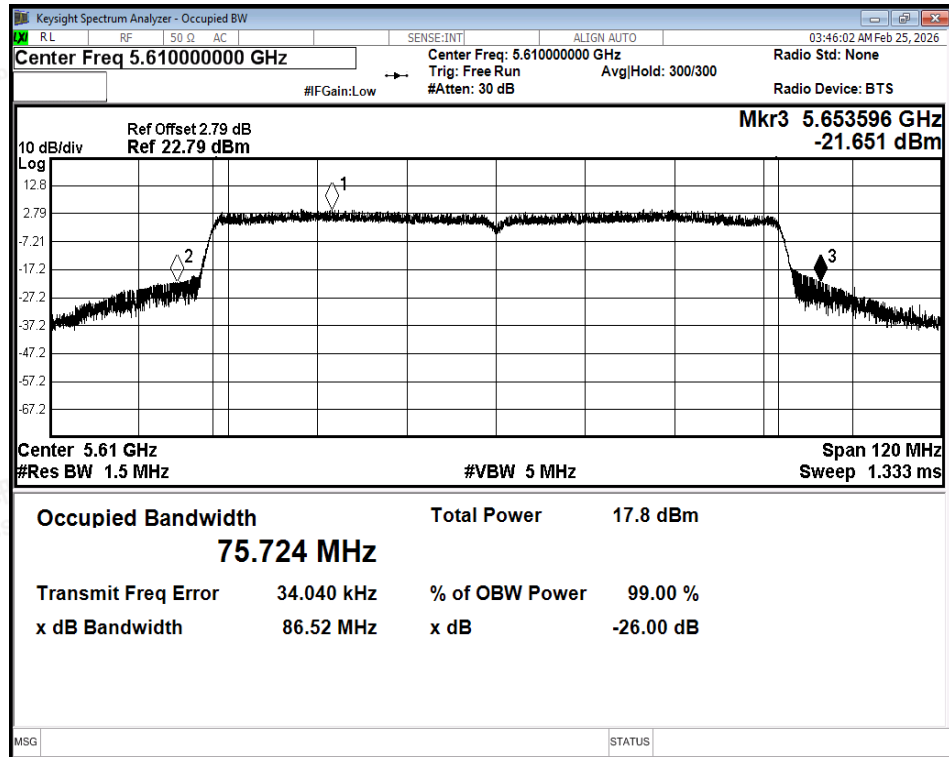

-26dB Bandwidth NVNT ax80 5610MHz Ant2



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



F.2 Maximum Conducted Output Power

Condition	Mode	Frequency (MHz)	Antenna	Conducted Power (dBm)	Duty Factor (dB)	Total Conducted Power (dBm)	Limit Conducted(dBm)	Verdict
NVNT	a	5500	Ant2	11.98	0.23	12.21	24	Pass
NVNT	a	5580	Ant2	12.22	0.23	12.45	24	Pass
NVNT	a	5700	Ant2	11.69	0.23	11.92	24	Pass
NVNT	n20	5500	Ant2	12.32	0.27	12.59	24	Pass
NVNT	n20	5580	Ant2	11.71	0.32	12.03	24	Pass
NVNT	n20	5700	Ant2	11.14	0.27	11.41	24	Pass
NVNT	n40	5510	Ant2	11.31	0.52	11.83	24	Pass
NVNT	n40	5550	Ant2	9.35	0.52	9.87	24	Pass
NVNT	n40	5670	Ant2	8.86	0.52	9.38	24	Pass
NVNT	ac20	5500	Ant2	11.51	0.31	11.82	24	Pass
NVNT	ac20	5580	Ant2	11.6	0.27	11.87	24	Pass
NVNT	ac20	5700	Ant2	11.03	0.27	11.3	24	Pass
NVNT	ac40	5510	Ant2	9.2	0.51	9.71	24	Pass
NVNT	ac40	5550	Ant2	9.29	0.6	9.89	24	Pass
NVNT	ac40	5670	Ant2	8.87	0.6	9.47	24	Pass
NVNT	ac80	5530	Ant2	11.08	0.93	12.01	24	Pass
NVNT	ac80	5610	Ant2	9.79	0.97	10.76	24	Pass
NVNT	ax20	5500	Ant2	11.46	0.31	11.77	24	Pass
NVNT	ax20	5580	Ant2	11.6	0.27	11.87	24	Pass
NVNT	ax20	5700	Ant2	11.09	0.31	11.4	24	Pass
NVNT	ax40	5510	Ant2	9.41	0.51	9.92	24	Pass
NVNT	ax40	5550	Ant2	9.31	0.51	9.82	24	Pass
NVNT	ax40	5670	Ant2	8.82	0.51	9.33	24	Pass
NVNT	ax80	5530	Ant2	11.12	0.97	12.09	24	Pass
NVNT	ax80	5610	Ant2	9.81	0.97	10.78	24	Pass







F.3 Maximum Power Spectral Density Level

Condition	Mode	Frequency (MHz)	Antenna	Conducted PSD (dBm/MHz)	Duty Factor (dB)	Total PSD (dBm/MHz)	Limit (dBm/MHz)	Verdict
NVNT	a	5500	Ant2	0.82	0.23	1.05	11	Pass
NVNT	a	5580	Ant2	1.11	0.23	1.34	11	Pass
NVNT	a	5700	Ant2	0.61	0.23	0.84	11	Pass
NVNT	n20	5500	Ant2	0.78	0.27	1.05	11	Pass
NVNT	n20	5580	Ant2	0.3	0.32	0.62	11	Pass
NVNT	n20	5700	Ant2	-0.24	0.27	0.03	11	Pass
NVNT	n40	5510	Ant2	-3.08	0.52	-2.56	11	Pass
NVNT	n40	5550	Ant2	-4.72	0.52	-4.2	11	Pass
NVNT	n40	5670	Ant2	-5.73	0.52	-5.21	11	Pass
NVNT	ac20	5500	Ant2	0.01	0.31	0.32	11	Pass
NVNT	ac20	5580	Ant2	0.33	0.27	0.6	11	Pass
NVNT	ac20	5700	Ant2	-0.32	0.27	-0.05	11	Pass
NVNT	ac40	5510	Ant2	-5.09	0.51	-4.58	11	Pass
NVNT	ac40	5550	Ant2	-4.89	0.6	-4.29	11	Pass
NVNT	ac40	5670	Ant2	-5.52	0.6	-4.92	11	Pass
NVNT	ac80	5530	Ant2	-6.53	0.93	-5.6	11	Pass
NVNT	ac80	5610	Ant2	-7.71	0.97	-6.74	11	Pass
NVNT	ax20	5500	Ant2	0.14	0.31	0.45	11	Pass
NVNT	ax20	5580	Ant2	0.32	0.27	0.59	11	Pass
NVNT	ax20	5700	Ant2	-0.34	0.31	-0.03	11	Pass
NVNT	ax40	5510	Ant2	-5.1	0.51	-4.59	11	Pass
NVNT	ax40	5550	Ant2	-4.73	0.51	-4.22	11	Pass
NVNT	ax40	5670	Ant2	-5.39	0.51	-4.88	11	Pass
NVNT	ax80	5530	Ant2	-6.48	0.97	-5.51	11	Pass
NVNT	ax80	5610	Ant2	-7.76	0.97	-6.79	11	Pass



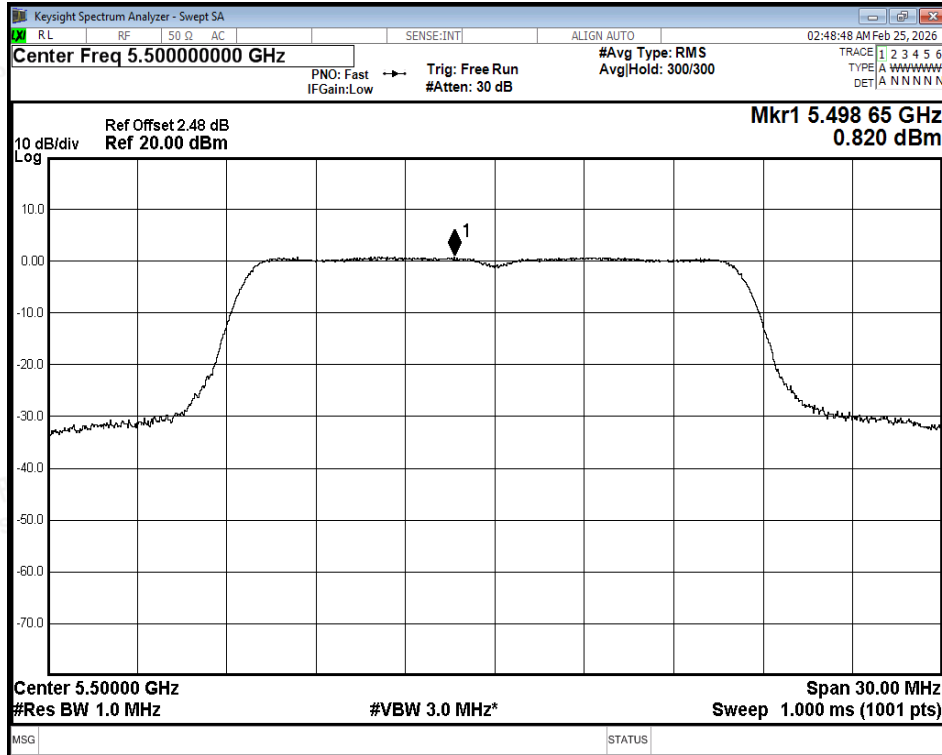

PSD NVNT a 5500MHz Ant2

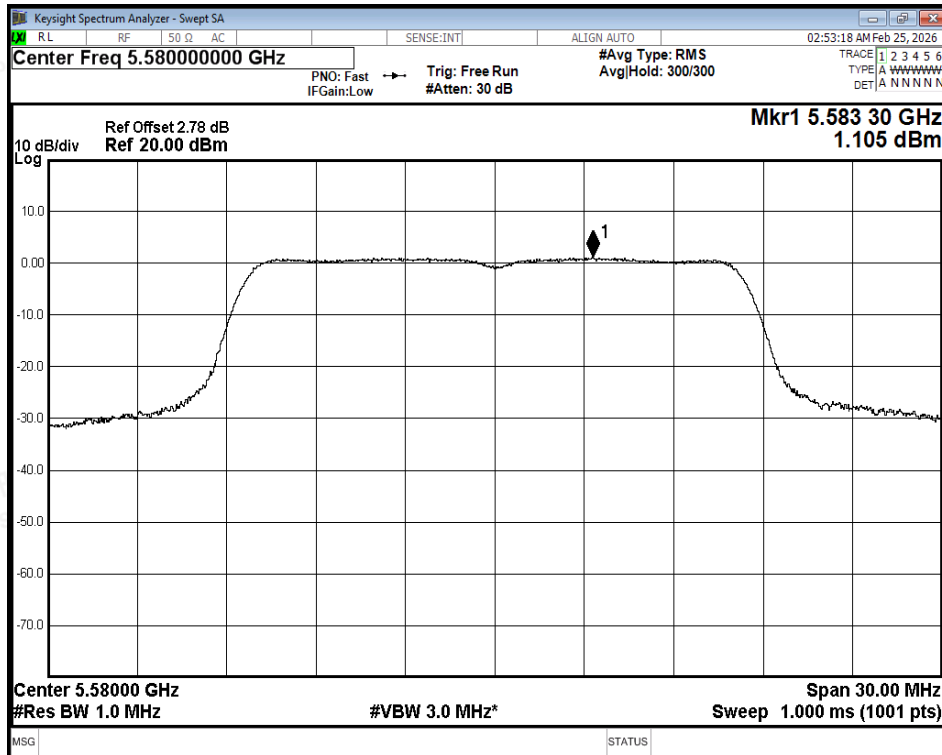

PSD NVNT a 5580MHz Ant2




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

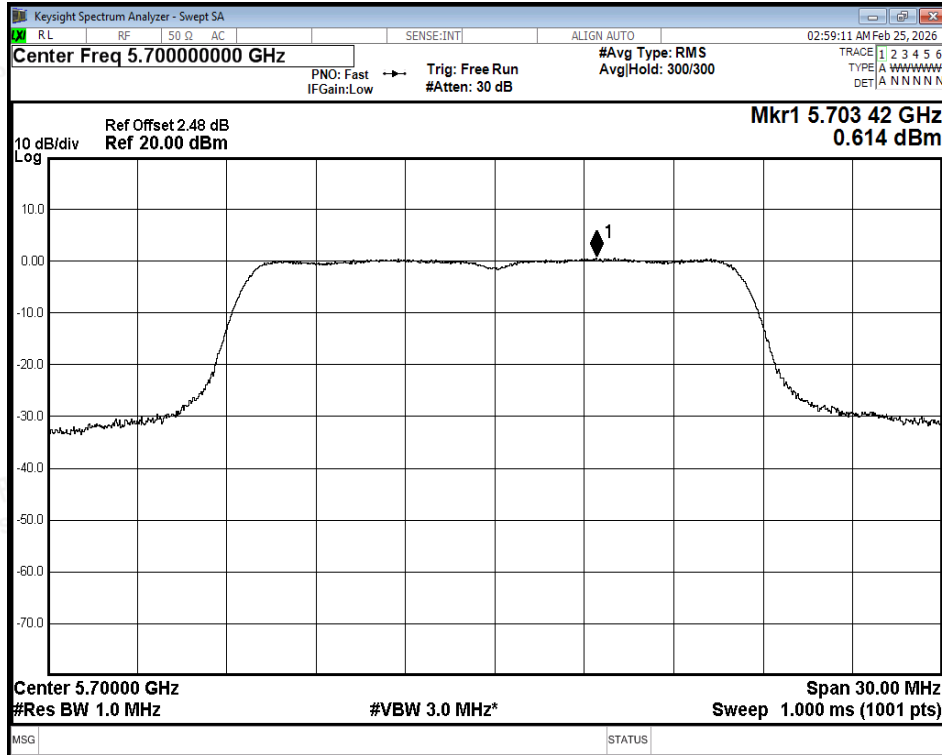

PSD NVNT a 5700MHz Ant2

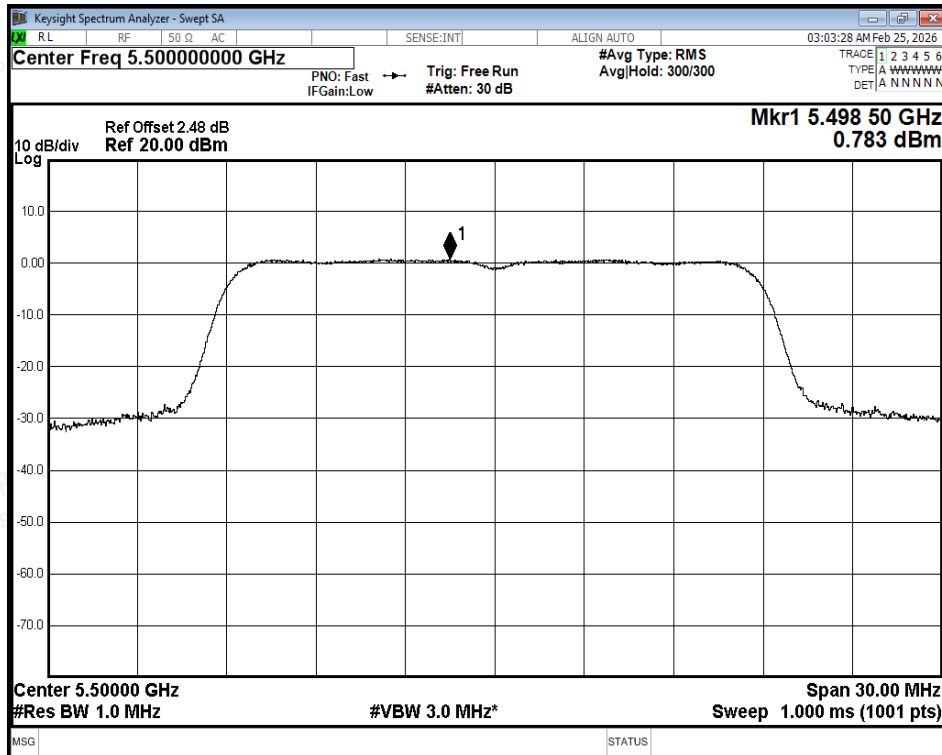

PSD NVNT n20 5500MHz Ant2




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

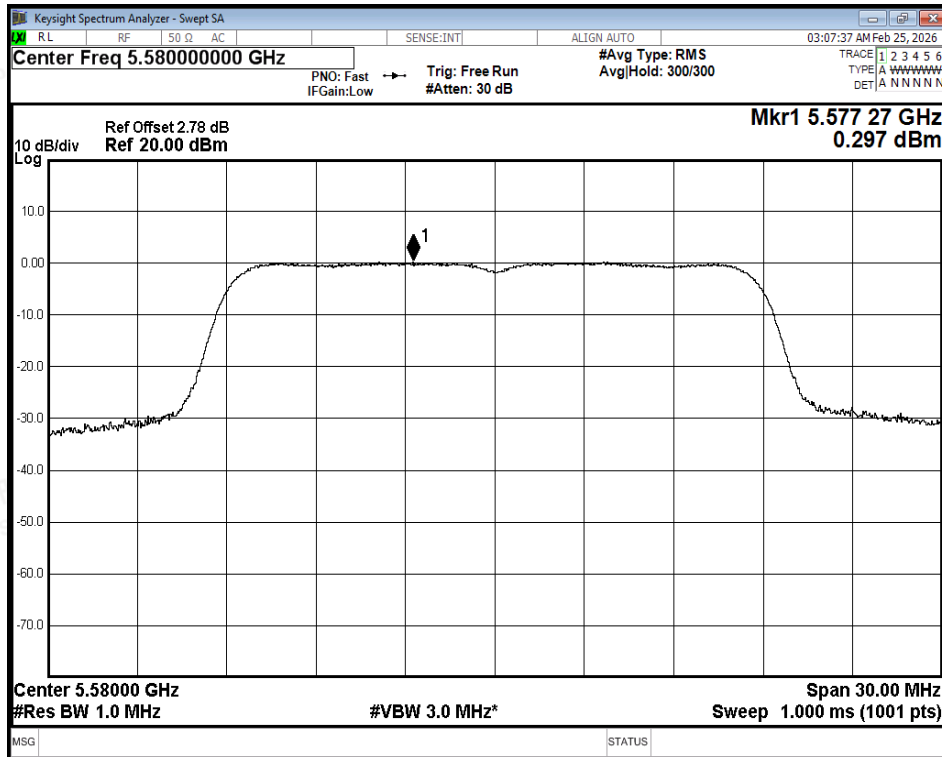

PSD NVNT n20 5580MHz Ant2

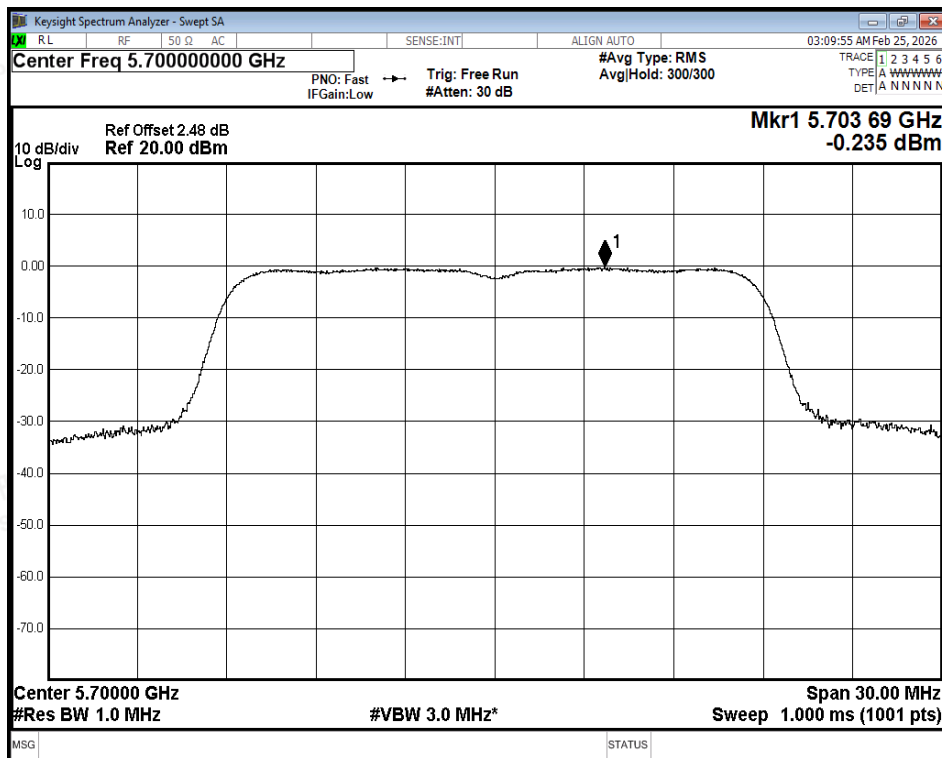

PSD NVNT n20 5700MHz Ant2




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

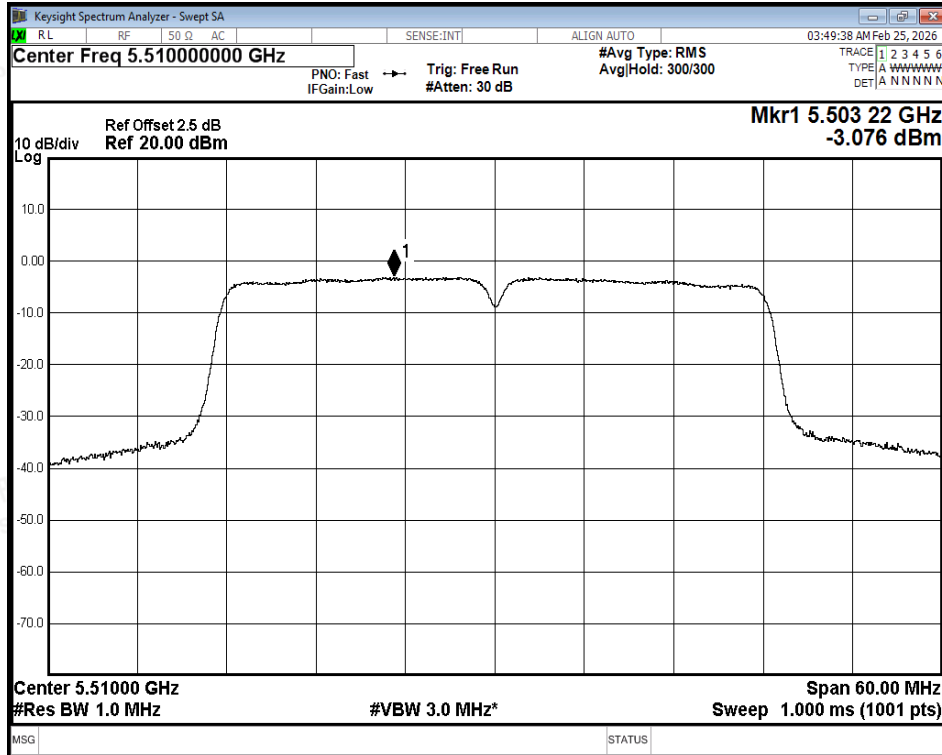

PSD NVNT n40 5510MHz Ant2

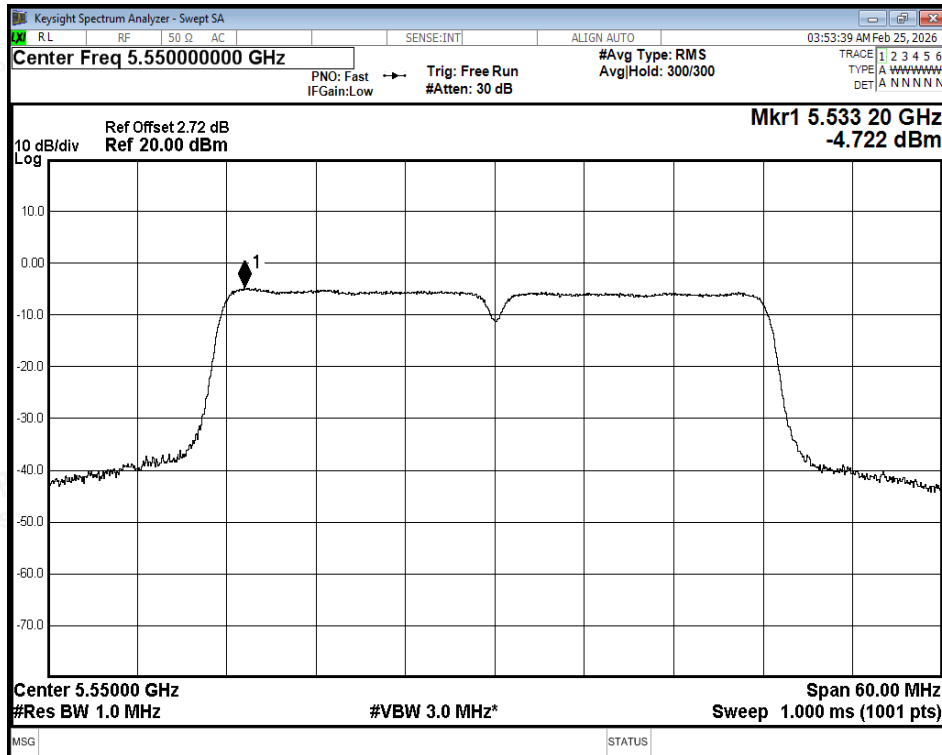

PSD NVNT n40 5550MHz Ant2




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

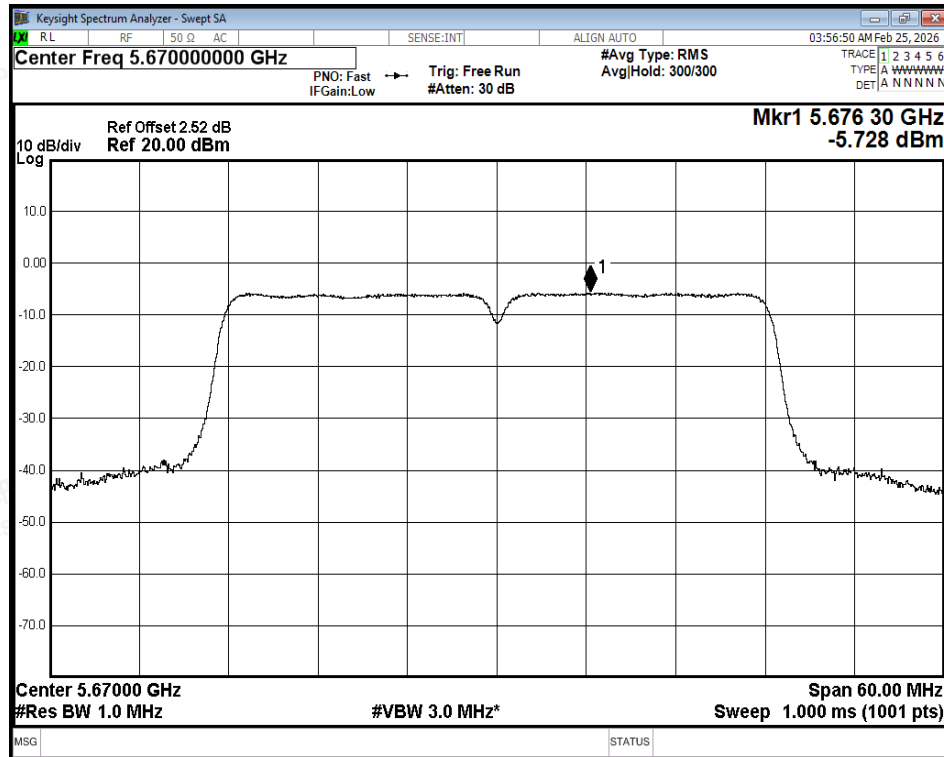

PSD NVNT n40 5670MHz Ant2

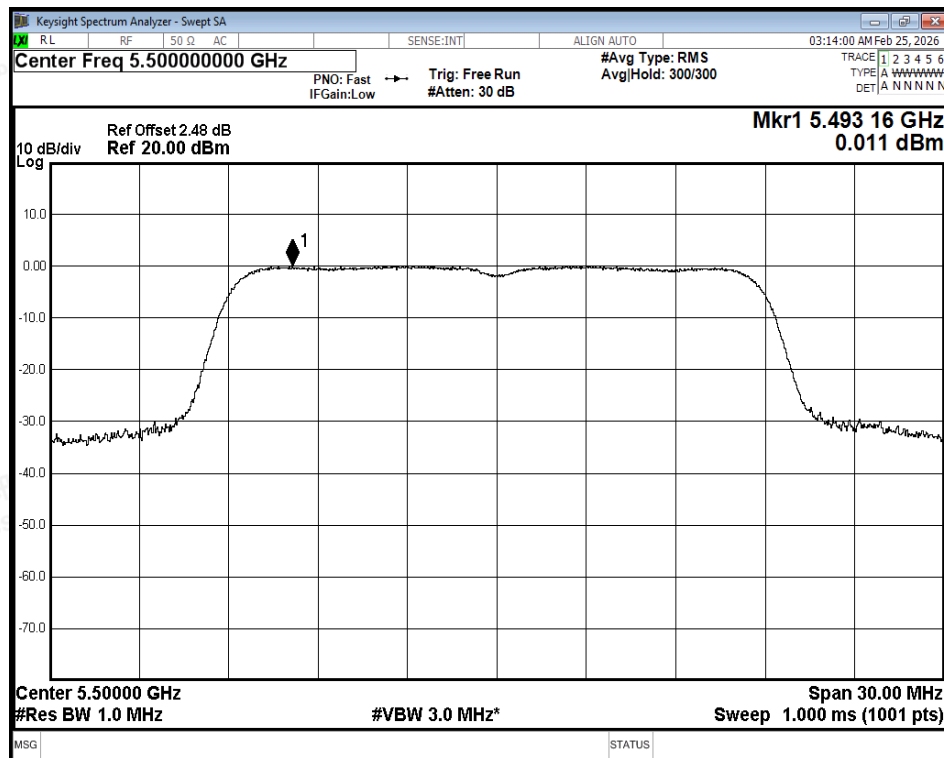

PSD NVNT ac20 5500MHz Ant2




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

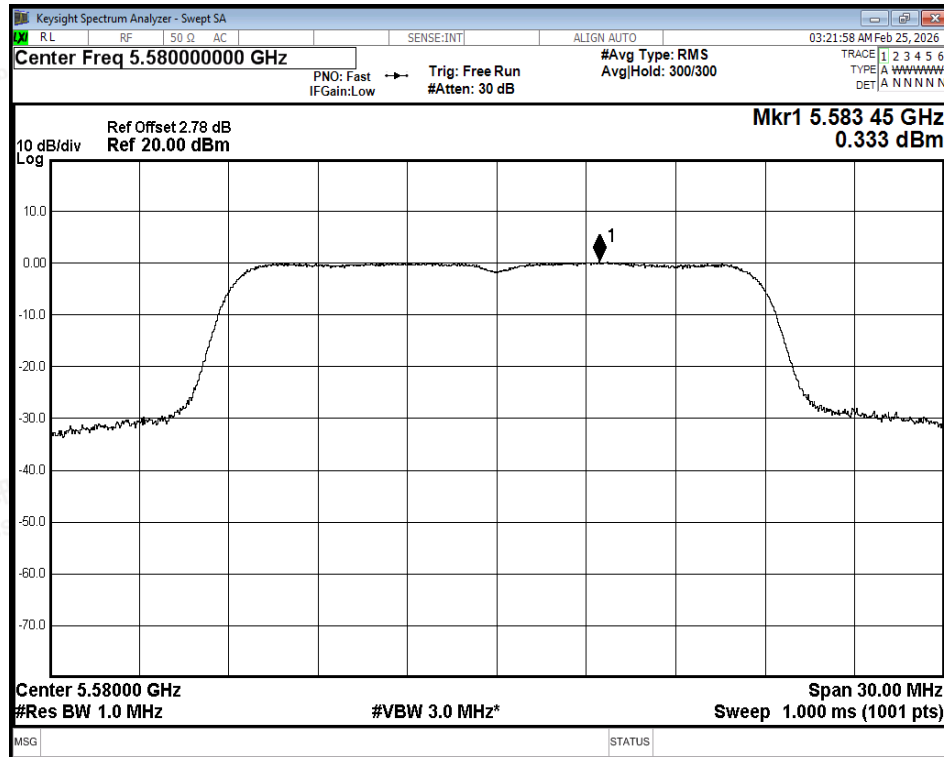

PSD NVNT ac20 5580MHz Ant2

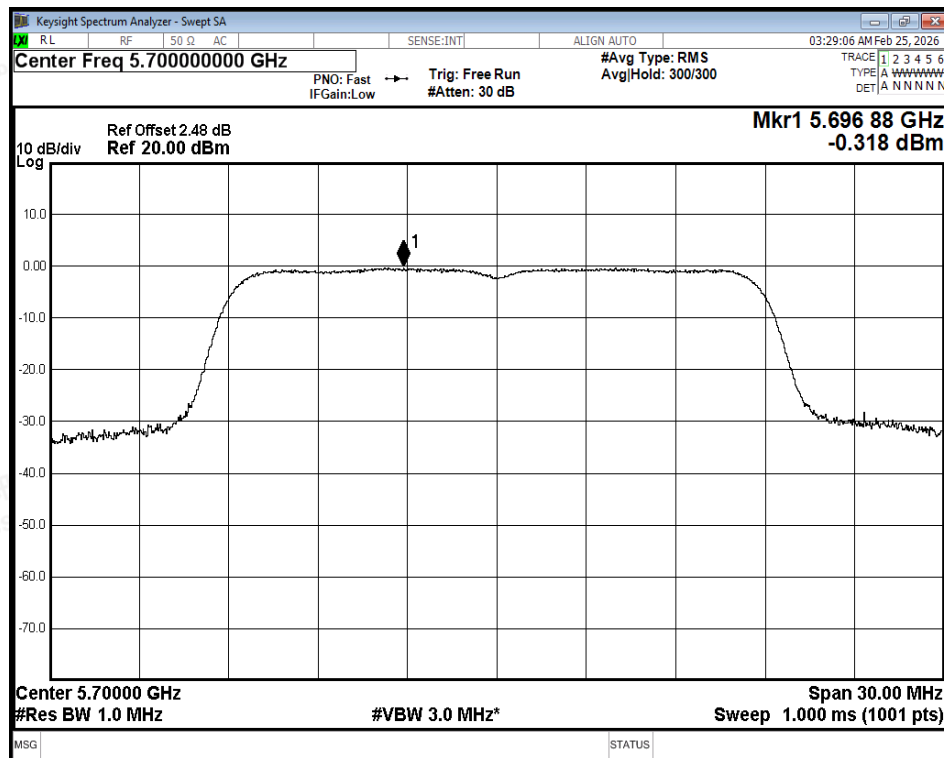

PSD NVNT ac20 5700MHz Ant2




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

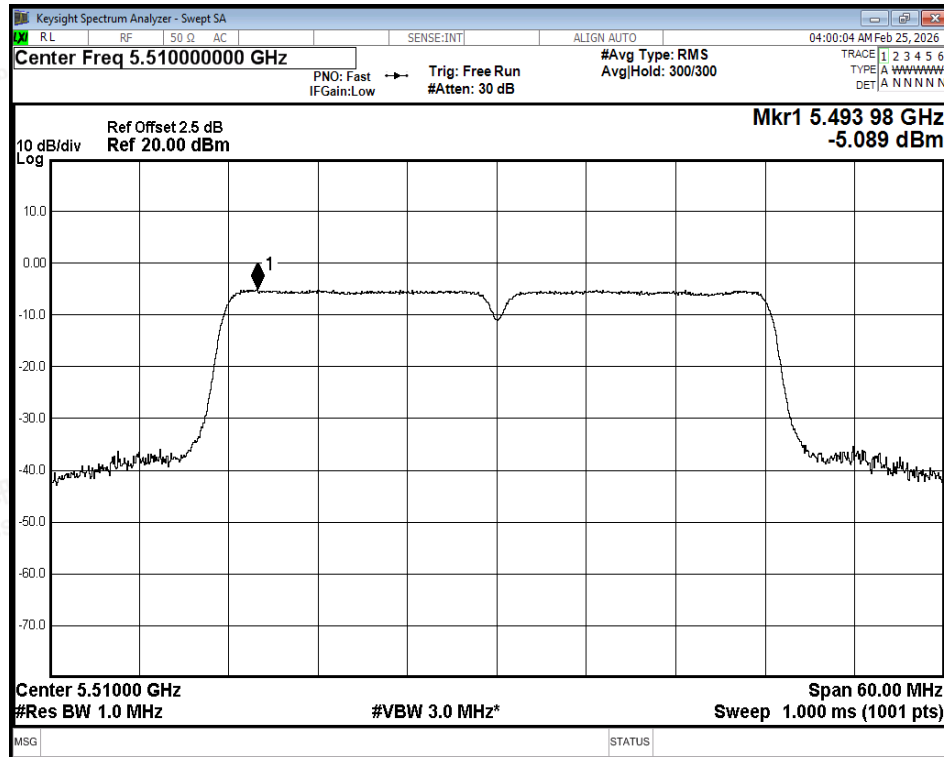

PSD NVNT ac40 5510MHz Ant2

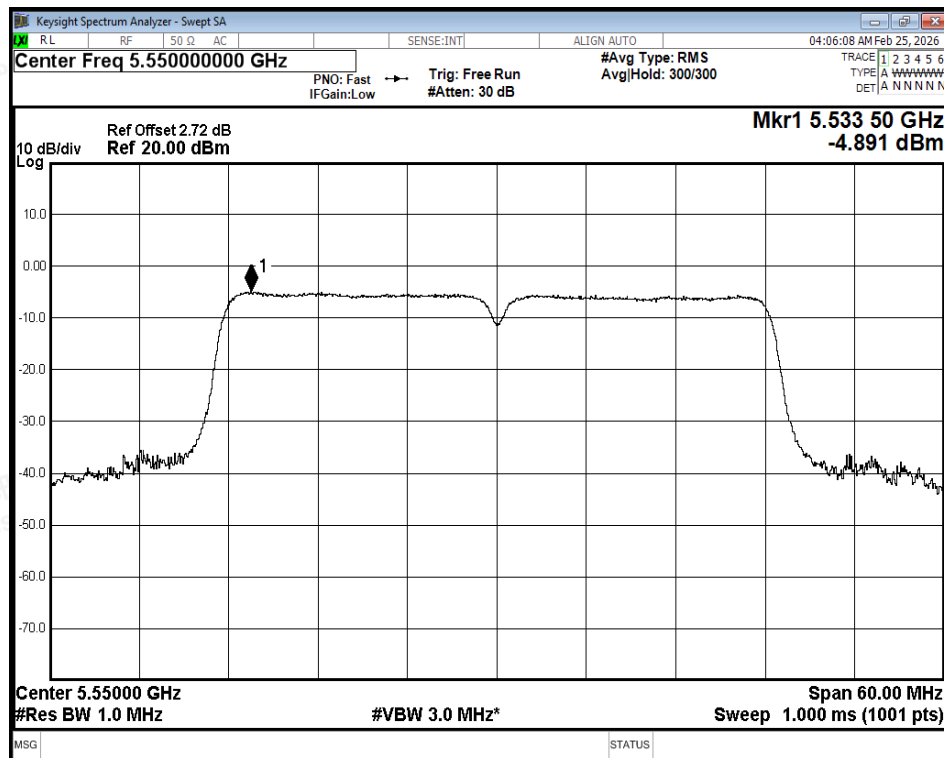

PSD NVNT ac40 5550MHz Ant2




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

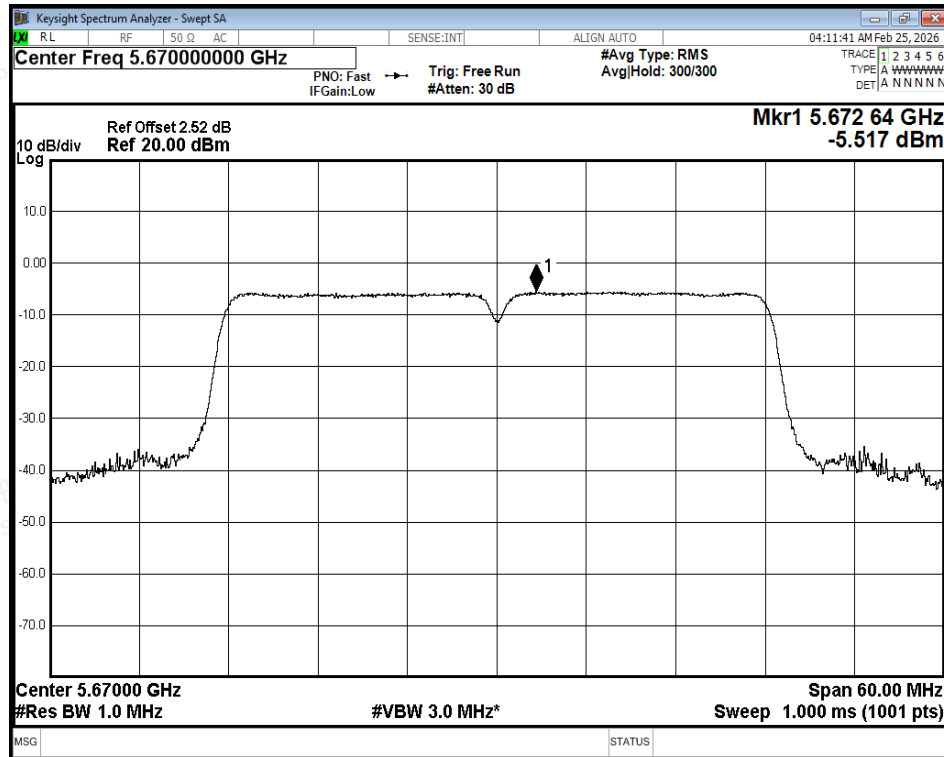

PSD NVNT ac40 5670MHz Ant2

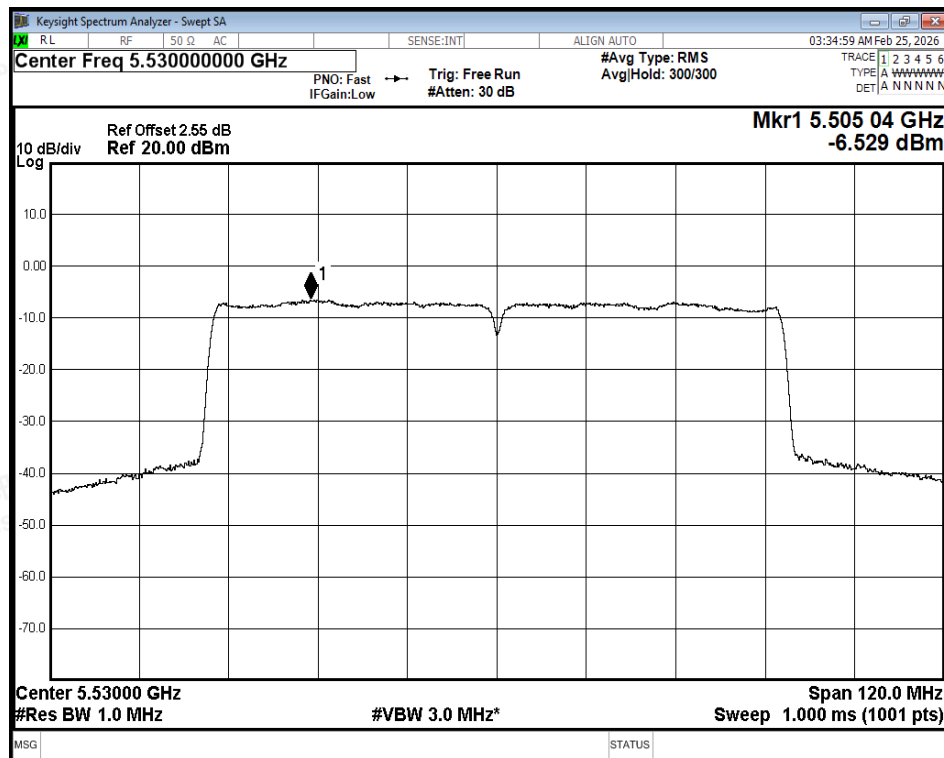

PSD NVNT ac80 5530MHz Ant2




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

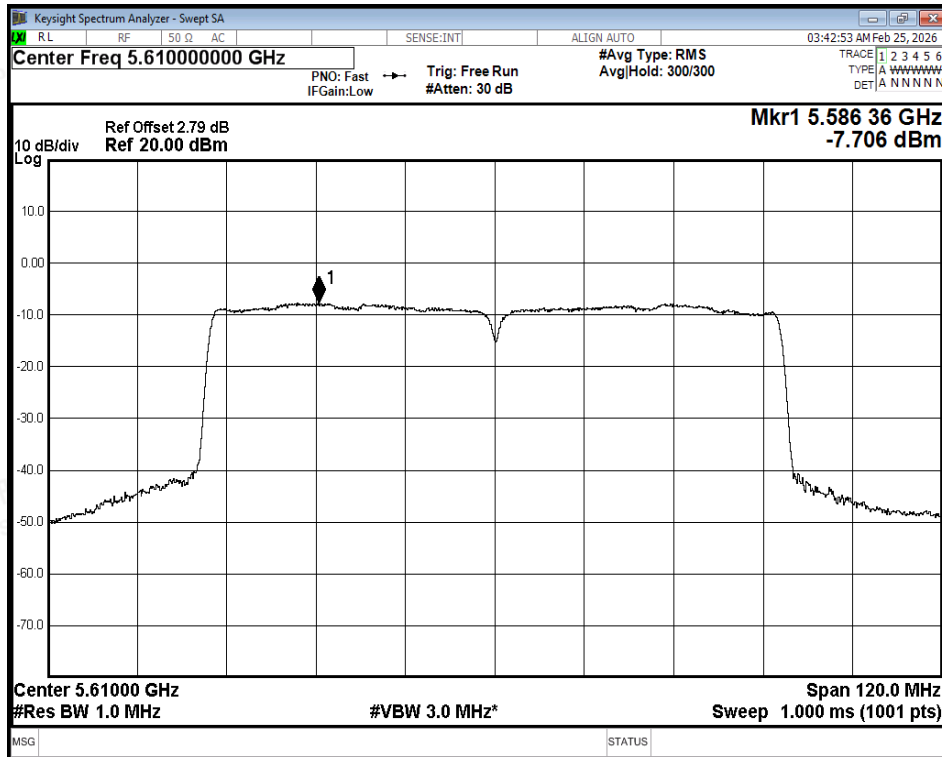

PSD NVNT ac80 5610MHz Ant2

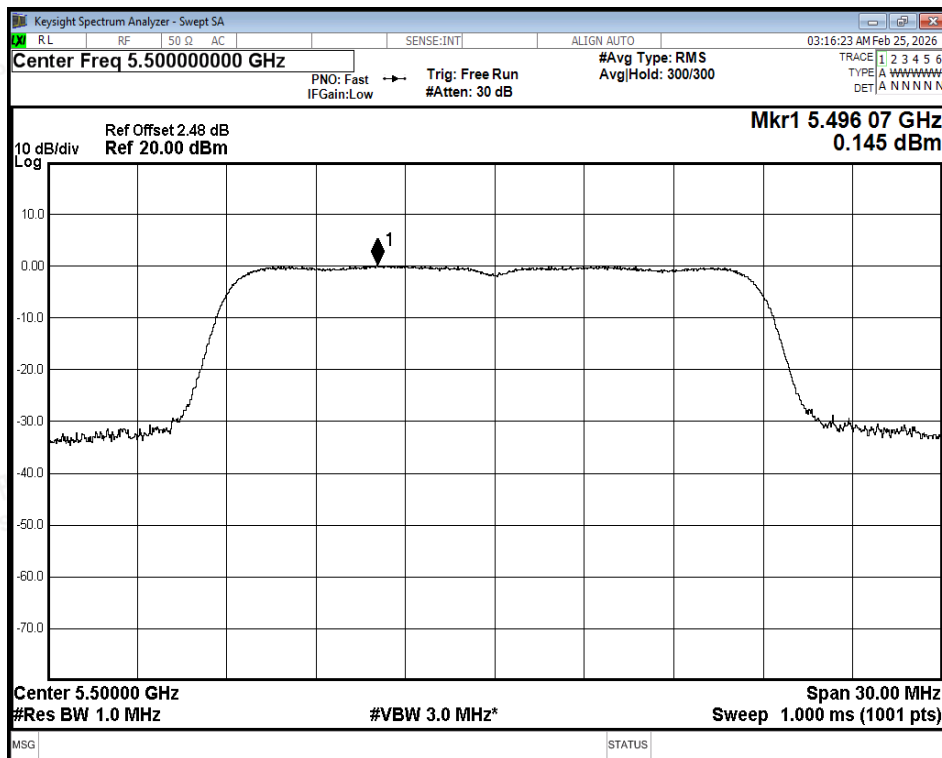

PSD NVNT ax20 5500MHz Ant2




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

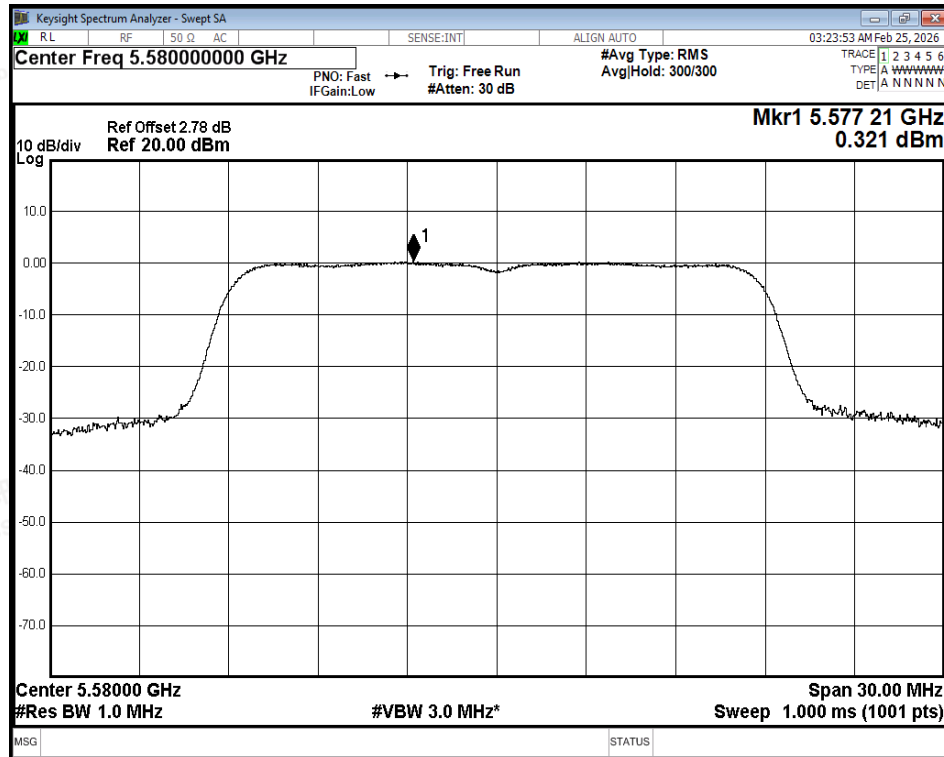

PSD NVNT ax20 5580MHz Ant2

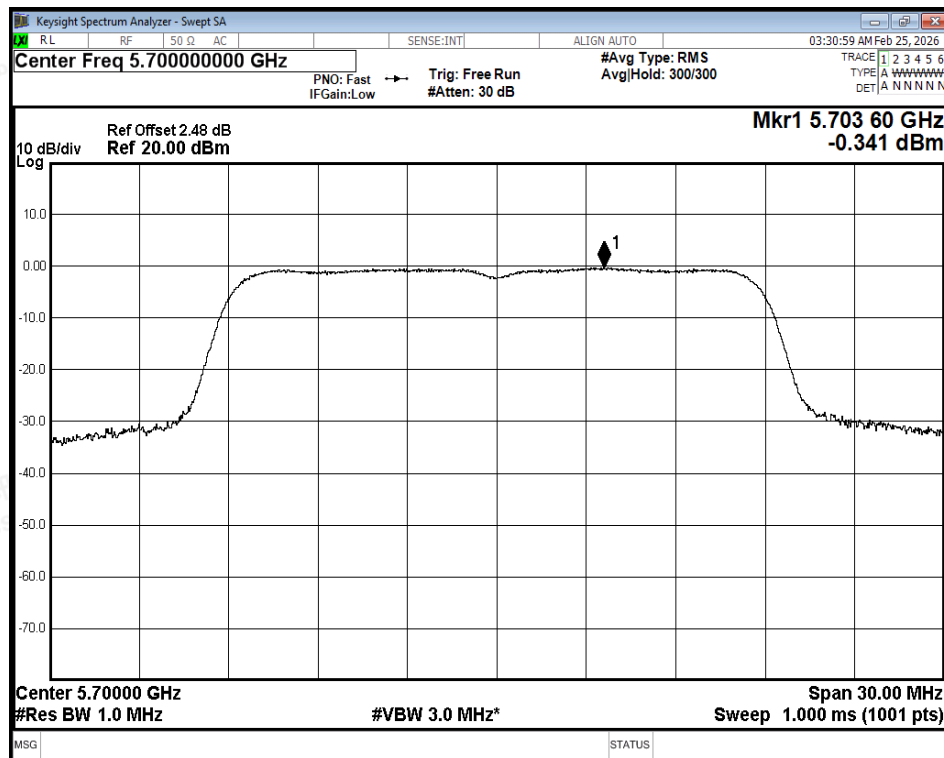

PSD NVNT ax20 5700MHz Ant2




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

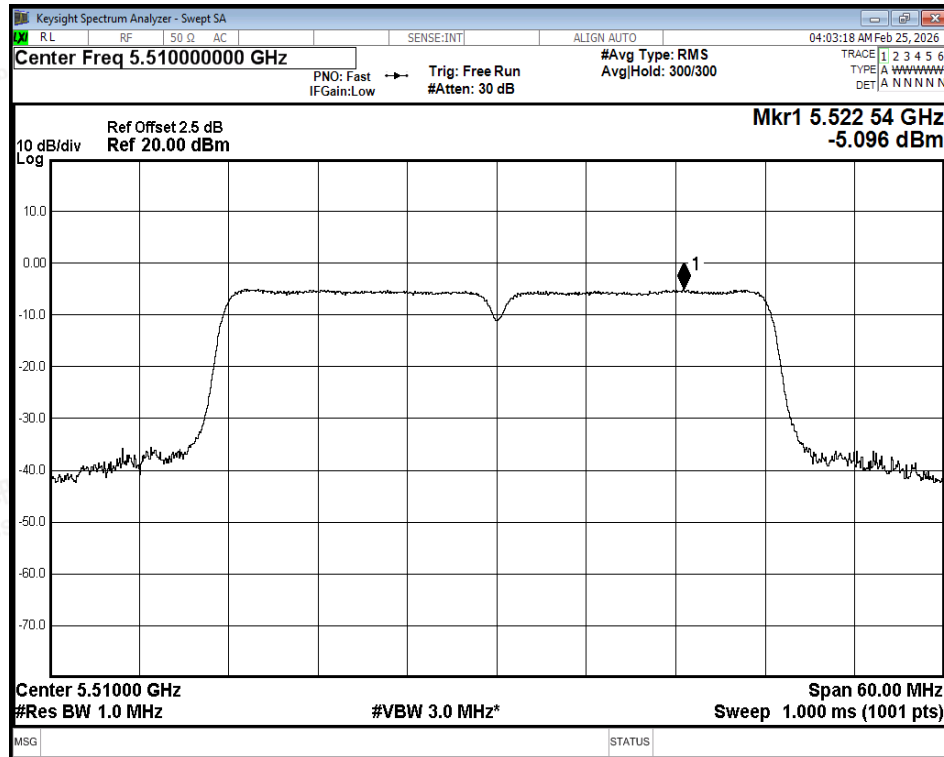

PSD NVNT ax40 5510MHz Ant2

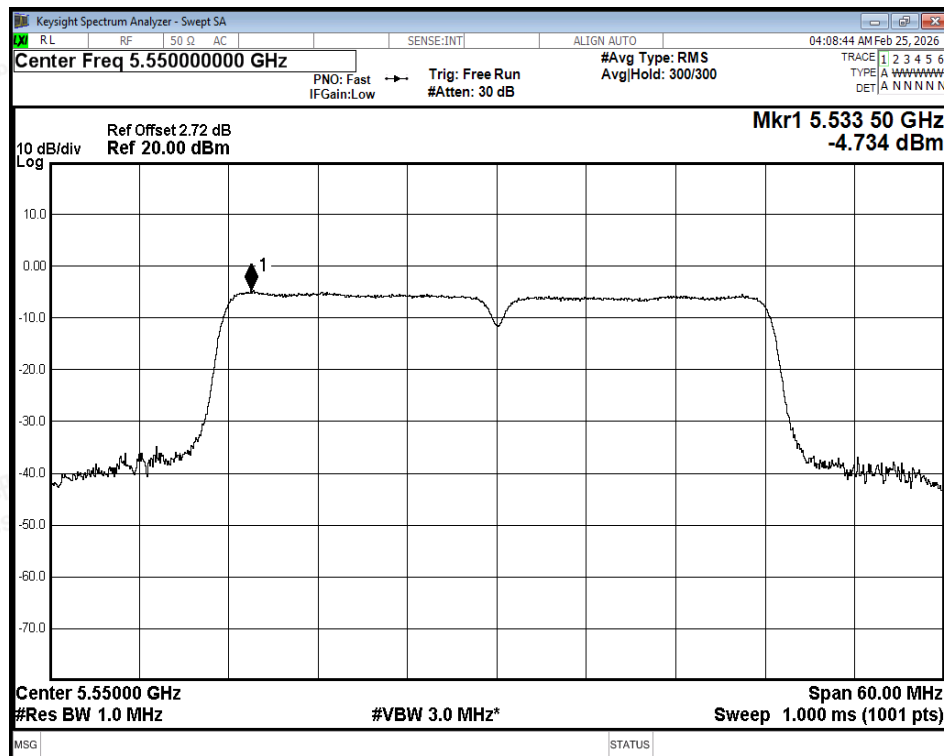

PSD NVNT ax40 5550MHz Ant2




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

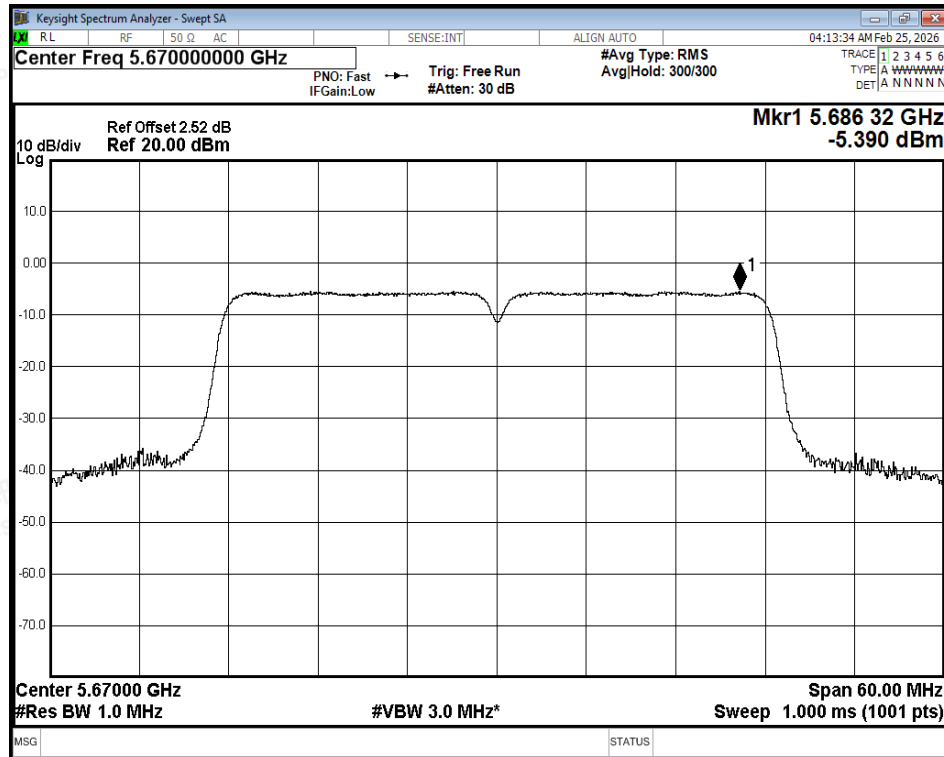

PSD NVNT ax40 5670MHz Ant2

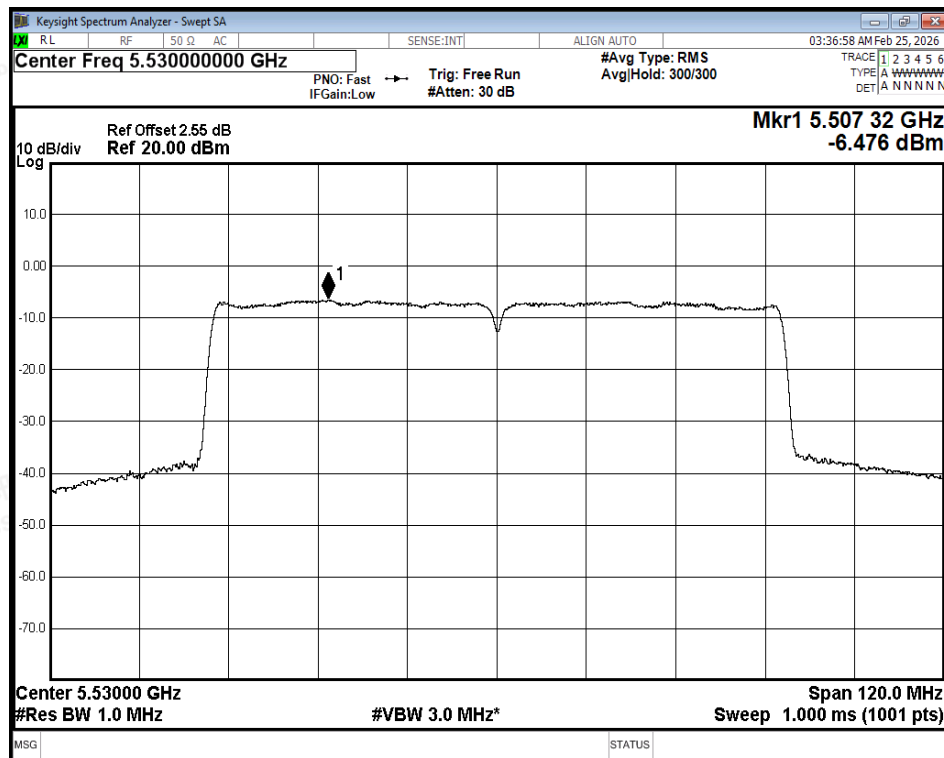

PSD NVNT ax80 5530MHz Ant2




Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

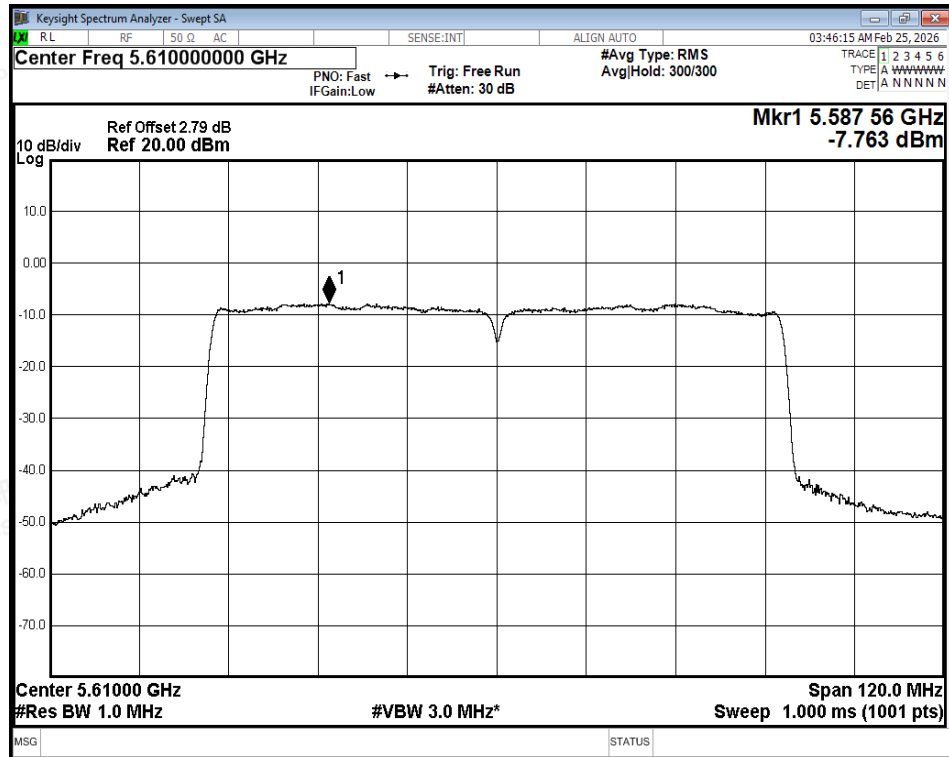

PSD NVNT ax80 5610MHz Ant2



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



F.4 Restrict Band

Condition	Mode	Frequency (MHz)	Antenna	Spur Freq (MHz)	Power (dBm)	Gain (dBi)	E (dBuV/m)	Detector	Limit (dBuV/m)	Verdict
NVNT	a	5500	Ant2	5460	-39.04	4.2	60.39	Peak	68.2	Pass
NVNT	a	5500	Ant2	5460	-50.89	4.2	48.54	Average	54	Pass
NVNT	a	5500	Ant2	5470	-33.37	4.2	66.06	Peak	68.2	Pass
NVNT	a	5500	Ant2	5470	-44.36	4.2	53.62	Average	54	Pass
NVNT	a	5500	Ant2	5470	-33.37	4.2	66.06	Peak	68.2	Pass
NVNT	a	5500	Ant2	5470	-44.36	4.2	53.07	Average	54	Pass
NVNT	a	5700	Ant2	5725	-33.33	4.2	66.10	Peak	68.2	Pass
NVNT	a	5700	Ant2	5725	-46.29	4.2	53.14	Average	54	Pass
NVNT	a	5700	Ant2	5725	-33.33	4.2	66.10	Peak	68.2	Pass
NVNT	a	5700	Ant2	5725	-46.29	4.2	53.14	Average	54	Pass
NVNT	a	5700	Ant2	5735	-44.15	4.2	55.28	Peak	68.2	Pass
NVNT	a	5700	Ant2	5735	-53.52	4.2	45.91	Average	54	Pass
NVNT	n20	5500	Ant2	5460	-40.19	4.2	59.24	Peak	68.2	Pass
NVNT	n20	5500	Ant2	5460	-50.6	4.2	48.83	Average	54	Pass
NVNT	n20	5500	Ant2	5468.8	-32.82	4.2	66.61	Peak	68.2	Pass
NVNT	n20	5500	Ant2	5470	-44.4	4.2	53.03	Average	54	Pass
NVNT	n20	5500	Ant2	5470	-34.92	4.2	64.51	Peak	68.2	Pass
NVNT	n20	5500	Ant2	5470	-44.4	4.2	53.03	Average	54	Pass
NVNT	n20	5700	Ant2	5725	-34.76	4.2	64.67	Peak	68.2	Pass
NVNT	n20	5700	Ant2	5725	-43.87	4.2	53.56	Average	54	Pass
NVNT	n20	5700	Ant2	5725.8	-32.18	4.2	67.25	Peak	68.2	Pass
NVNT	n20	5700	Ant2	5725	-43.87	4.2	53.56	Average	54	Pass
NVNT	n20	5700	Ant2	5735	-44.68	4.2	54.75	Peak	68.2	Pass
NVNT	n20	5700	Ant2	5735	-53.66	4.2	45.77	Average	54	Pass
NVNT	n40	5510	Ant2	5460	-42.4	4.2	57.03	Peak	68.2	Pass
NVNT	n40	5510	Ant2	5460	-48.82	4.2	50.61	Average	54	Pass
NVNT	n40	5510	Ant2	5466.6	-31.63	4.2	67.80	Peak	68.2	Pass
NVNT	n40	5510	Ant2	5469.8	-44.16	4.2	53.27	Average	54	Pass
NVNT	n40	5510	Ant2	5470	-36.35	4.2	63.08	Peak	68.2	Pass
NVNT	n40	5510	Ant2	5470	-44.2	4.2	53.23	Average	54	Pass
NVNT	n40	5670	Ant2	5725	-47.14	4.2	52.29	Peak	68.2	Pass
NVNT	n40	5670	Ant2	5725	-53.44	4.2	45.99	Average	54	Pass
NVNT	n40	5670	Ant2	5727.8	-44.16	4.2	55.27	Peak	68.2	Pass
NVNT	n40	5670	Ant2	5725.4	-53.12	4.2	46.31	Average	54	Pass
NVNT	n40	5670	Ant2	5735	-46.11	4.2	53.32	Peak	68.2	Pass
NVNT	n40	5670	Ant2	5735	-54.72	4.2	44.71	Average	54	Pass
NVNT	ac20	5500	Ant2	5460	-40	4.2	59.43	Peak	68.2	Pass
NVNT	ac20	5500	Ant2	5460	-50.71	4.2	48.72	Average	54	Pass
NVNT	ac20	5500	Ant2	5469.4	-34.95	4.2	64.48	Peak	68.2	Pass
NVNT	ac20	5500	Ant2	5470	-44.3	4.2	53.13	Average	54	Pass



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity




NVNT	ac20	5500	Ant2	5470	-36.2	4.2	63.23	Peak	68.2	Pass
NVNT	ac20	5500	Ant2	5470	-44.3	4.2	53.13	Average	54	Pass
NVNT	ac20	5700	Ant2	5725	-30.75	4.2	66.68	Peak	68.2	Pass
NVNT	ac20	5700	Ant2	5725	-44.12	4.2	53.31	Average	54	Pass
NVNT	ac20	5700	Ant2	5725	-30.75	4.2	66.68	Peak	68.2	Pass
NVNT	ac20	5700	Ant2	5725	-44.12	4.2	53.31	Average	54	Pass
NVNT	ac20	5700	Ant2	5735	-44.41	4.2	55.02	Peak	68.2	Pass
NVNT	ac20	5700	Ant2	5735	-53.56	4.2	45.87	Average	54	Pass
NVNT	ac40	5510	Ant2	5460	-41.02	4.2	58.41	Peak	68.2	Pass
NVNT	ac40	5510	Ant2	5460	-48.91	4.2	50.52	Average	54	Pass
NVNT	ac40	5510	Ant2	5469.2	-32.04	4.2	67.39	Peak	68.2	Pass
NVNT	ac40	5510	Ant2	5468.4	-43.61	4.2	53.82	Average	54	Pass
NVNT	ac40	5510	Ant2	5470	-36	4.2	63.43	Peak	68.2	Pass
NVNT	ac40	5510	Ant2	5470	-44.85	4.2	53.58	Average	54	Pass
NVNT	ac40	5670	Ant2	5725	-45.63	4.2	53.80	Peak	68.2	Pass
NVNT	ac40	5670	Ant2	5725	-53.35	4.2	46.08	Average	54	Pass
NVNT	ac40	5670	Ant2	5728.4	-42.88	4.2	56.55	Peak	68.2	Pass
NVNT	ac40	5670	Ant2	5725.6	-53.18	4.2	46.25	Average	54	Pass
NVNT	ac40	5670	Ant2	5735	-47	4.2	52.43	Peak	68.2	Pass
NVNT	ac40	5670	Ant2	5735	-54.84	4.2	44.59	Average	54	Pass
NVNT	ac80	5530	Ant2	5460	-42.09	4.2	57.34	Peak	68.2	Pass
NVNT	ac80	5530	Ant2	5460	-47.38	4.2	52.05	Average	54	Pass
NVNT	ac80	5530	Ant2	5468.2	-37.1	4.2	62.33	Peak	68.2	Pass
NVNT	ac80	5530	Ant2	5470	-45.62	4.2	53.81	Average	54	Pass
NVNT	ac80	5530	Ant2	5470	-37.13	4.2	62.30	Peak	68.2	Pass
NVNT	ac80	5530	Ant2	5470	-45.62	4.2	53.81	Average	54	Pass
NVNT	ac80	5610	Ant2	5725	-46.12	4.2	53.31	Peak	68.2	Pass
NVNT	ac80	5610	Ant2	5725	-53.75	4.2	45.68	Average	54	Pass
NVNT	ac80	5610	Ant2	5729.055	-45.71	4.2	53.72	Peak	68.2	Pass
NVNT	ac80	5610	Ant2	5725.16	-53.75	4.2	45.68	Average	54	Pass
NVNT	ac80	5610	Ant2	5735	-48.5	4.2	50.93	Peak	68.2	Pass
NVNT	ac80	5610	Ant2	5735	-54.96	4.2	44.47	Average	54	Pass
NVNT	ax20	5500	Ant2	5460	-42.6	4.2	56.83	Peak	68.2	Pass
NVNT	ax20	5500	Ant2	5460	-50.71	4.2	48.72	Average	54	Pass
NVNT	ax20	5500	Ant2	5469	-33.11	4.2	66.32	Peak	68.2	Pass
NVNT	ax20	5500	Ant2	5470	-44.36	4.2	53.07	Average	54	Pass
NVNT	ax20	5500	Ant2	5470	-34.43	4.2	65.00	Peak	68.2	Pass
NVNT	ax20	5500	Ant2	5470	-44.36	4.2	53.07	Average	54	Pass
NVNT	ax20	5700	Ant2	5725	-32.68	4.2	66.75	Peak	68.2	Pass
NVNT	ax20	5700	Ant2	5725	-44.45	4.2	53.98	Average	54	Pass
NVNT	ax20	5700	Ant2	5725.4	-32.05	4.2	67.38	Peak	68.2	Pass
NVNT	ax20	5700	Ant2	5725.2	-44.35	4.2	53.08	Average	54	Pass
NVNT	ax20	5700	Ant2	5735	-44	4.2	55.43	Peak	68.2	Pass
NVNT	ax20	5700	Ant2	5735	-53.54	4.2	45.89	Average	54	Pass






NVNT	ax40	5510	Ant2	5460	-42.34	4.2	57.09	Peak	68.2	Pass
NVNT	ax40	5510	Ant2	5460	-48.52	4.2	50.91	Average	54	Pass
NVNT	ax40	5510	Ant2	5469	-29.72	4.2	67.71	Peak	68.2	Pass
NVNT	ax40	5510	Ant2	5470	-44.02	4.2	53.41	Average	54	Pass
NVNT	ax40	5510	Ant2	5470	-33.17	4.2	66.26	Peak	68.2	Pass
NVNT	ax40	5510	Ant2	5470	-44.02	4.2	53.41	Average	54	Pass
NVNT	ax40	5670	Ant2	5725	-43.37	4.2	56.06	Peak	68.2	Pass
NVNT	ax40	5670	Ant2	5725	-53.21	4.2	46.22	Average	54	Pass
NVNT	ax40	5670	Ant2	5725.6	-41.03	4.2	58.40	Peak	68.2	Pass
NVNT	ax40	5670	Ant2	5726	-53.18	4.2	46.25	Average	54	Pass
NVNT	ax40	5670	Ant2	5735	-48.76	4.2	50.67	Peak	68.2	Pass
NVNT	ax40	5670	Ant2	5735	-54.76	4.2	44.67	Average	54	Pass
NVNT	ax80	5530	Ant2	5460	-40.88	4.2	58.55	Peak	68.2	Pass
NVNT	ax80	5530	Ant2	5460	-47	4.2	52.43	Average	54	Pass
NVNT	ax80	5530	Ant2	5470	-34.75	4.2	64.68	Peak	68.2	Pass
NVNT	ax80	5530	Ant2	5467	-45.87	4.2	53.56	Average	54	Pass
NVNT	ax80	5530	Ant2	5470	-34.75	4.2	64.68	Peak	68.2	Pass
NVNT	ax80	5530	Ant2	5470	-46.1	4.2	53.33	Average	54	Pass
NVNT	ax80	5610	Ant2	5725	-47.17	4.2	52.26	Peak	68.2	Pass
NVNT	ax80	5610	Ant2	5725	-54.48	4.2	44.95	Average	54	Pass
NVNT	ax80	5610	Ant2	5734.59	-44.96	4.2	54.47	Peak	68.2	Pass
NVNT	ax80	5610	Ant2	5727.005	-54.04	4.2	45.39	Average	54	Pass
NVNT	ax80	5610	Ant2	5735	-48.03	4.2	51.40	Peak	68.2	Pass
NVNT	ax80	5610	Ant2	5735	-54.95	4.2	44.48	Average	54	Pass



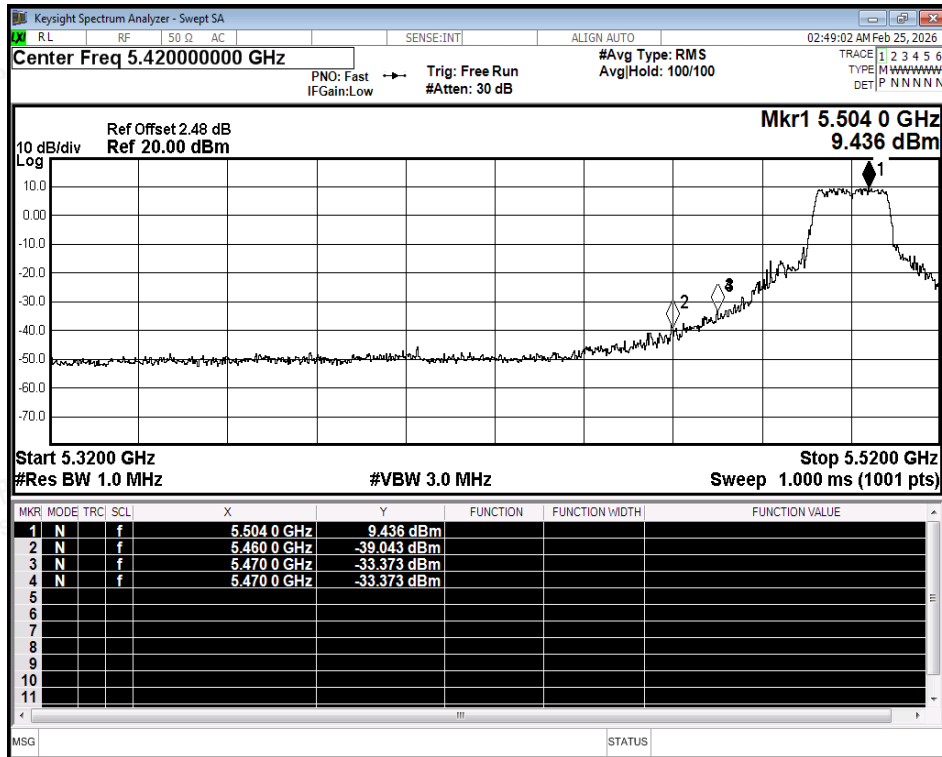

Restrict Band NVNT a 5500MHz Ant2 Peak

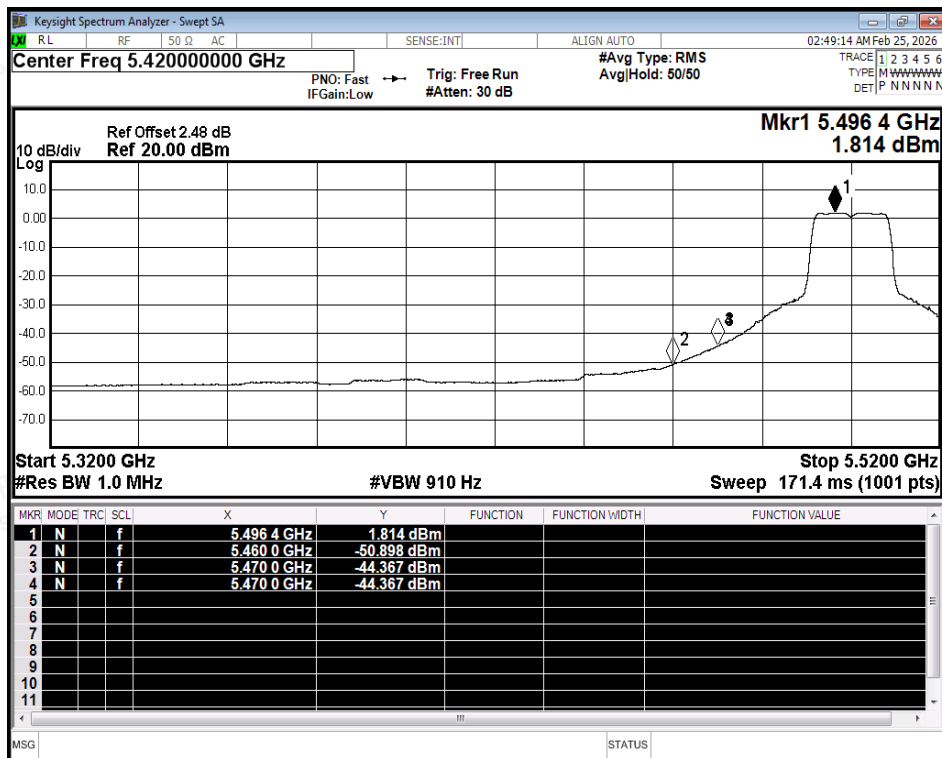

Restrict Band NVNT a 5500MHz Ant2 Average




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

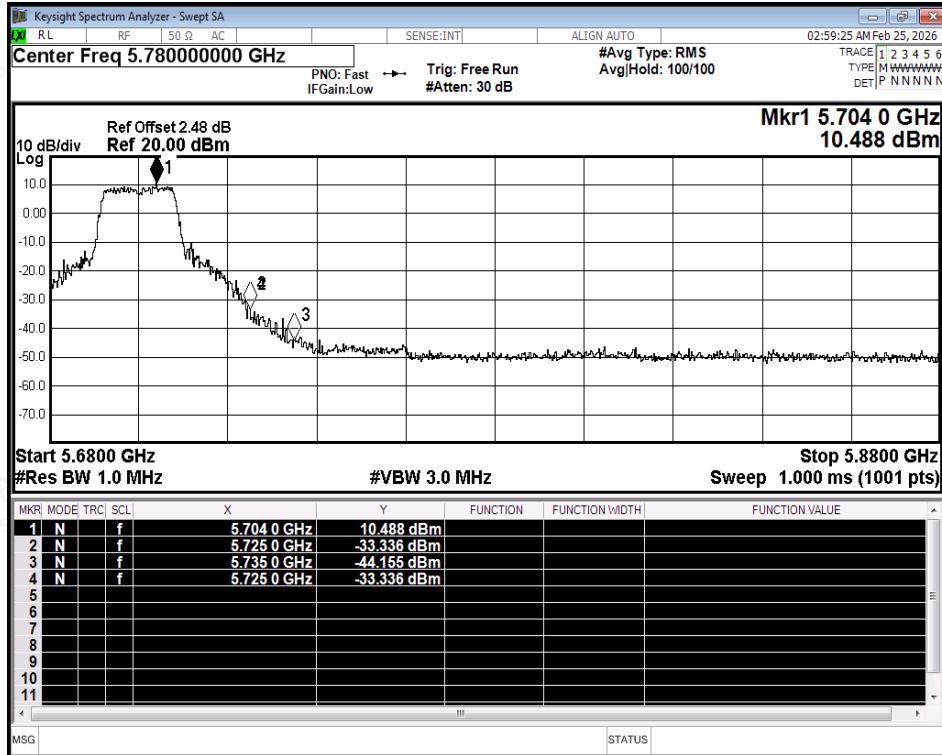

Restrict Band NVNT a 5700MHz Ant2 Peak

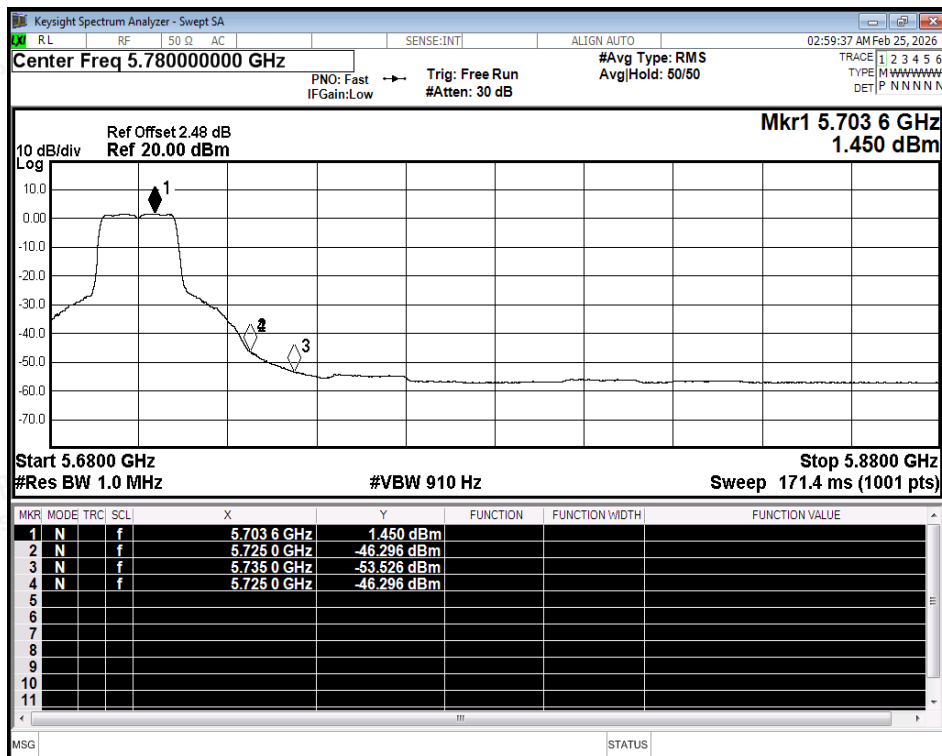

Restrict Band NVNT a 5700MHz Ant2 Average




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

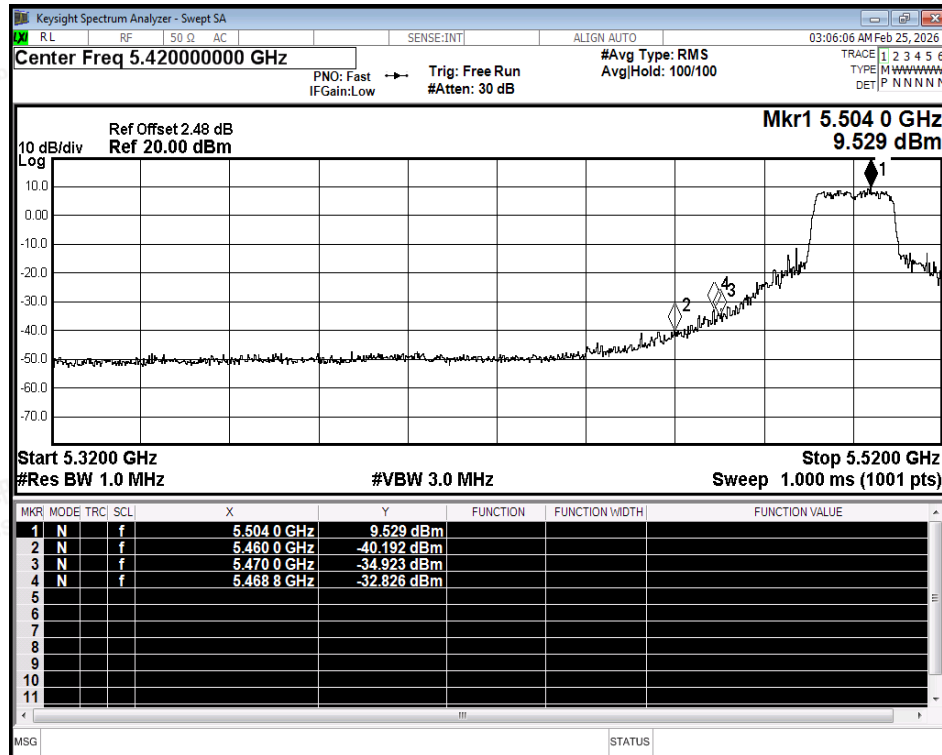

Restrict Band NVNT n20 5500MHz Ant2 Peak

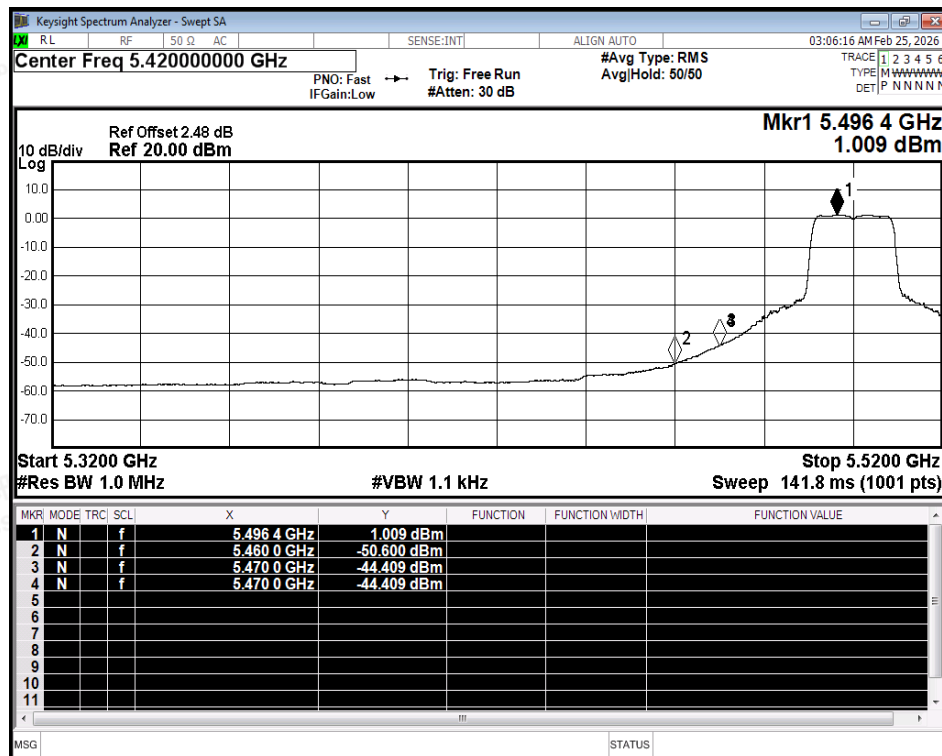

Restrict Band NVNT n20 5500MHz Ant2 Average




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

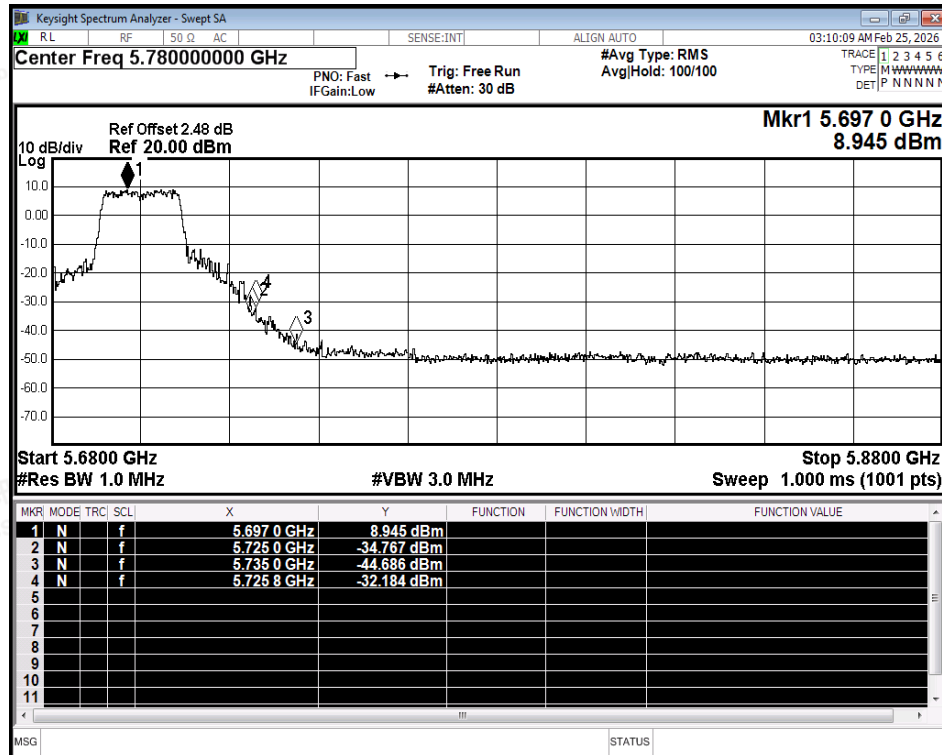

Restrict Band NVNT n20 5700MHz Ant2 Peak

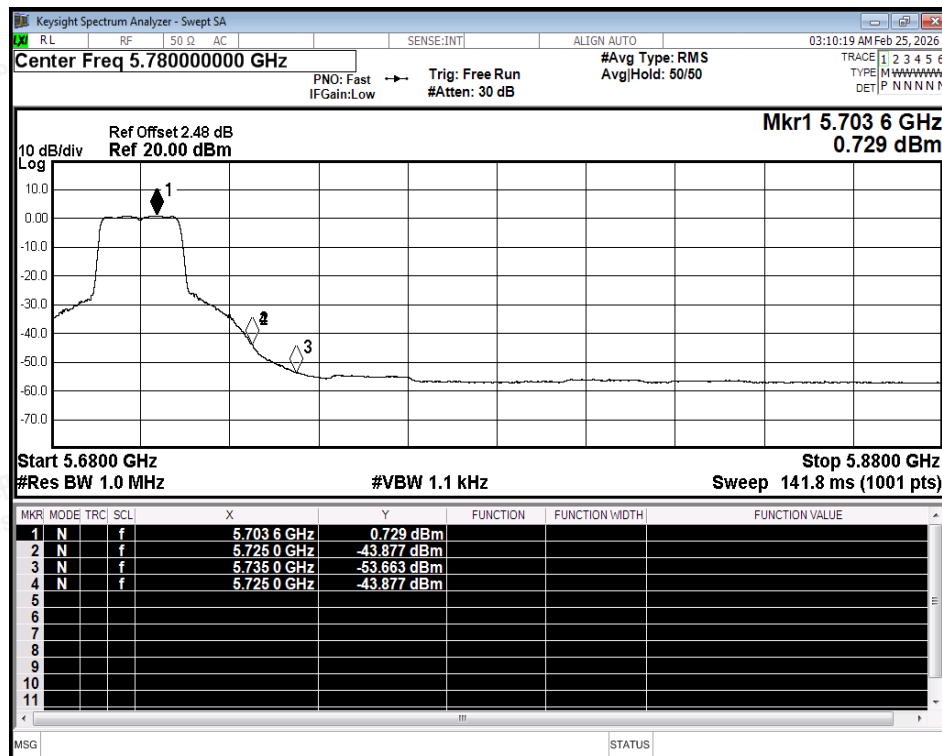

Restrict Band NVNT n20 5700MHz Ant2 Average




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

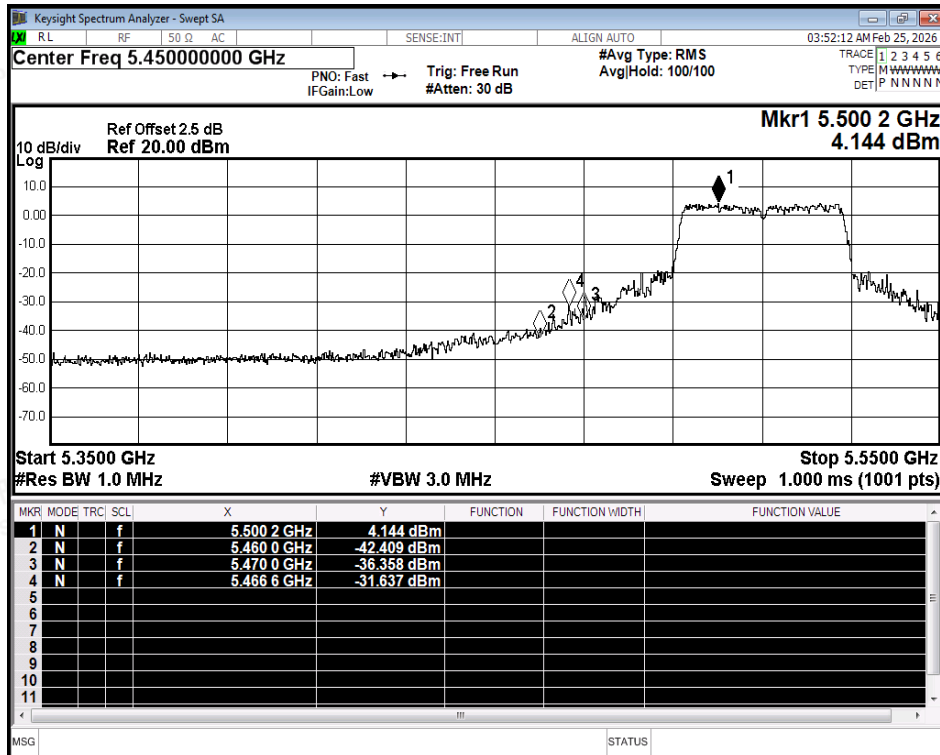

Restrict Band NVNT n40 5510MHz Ant2 Peak

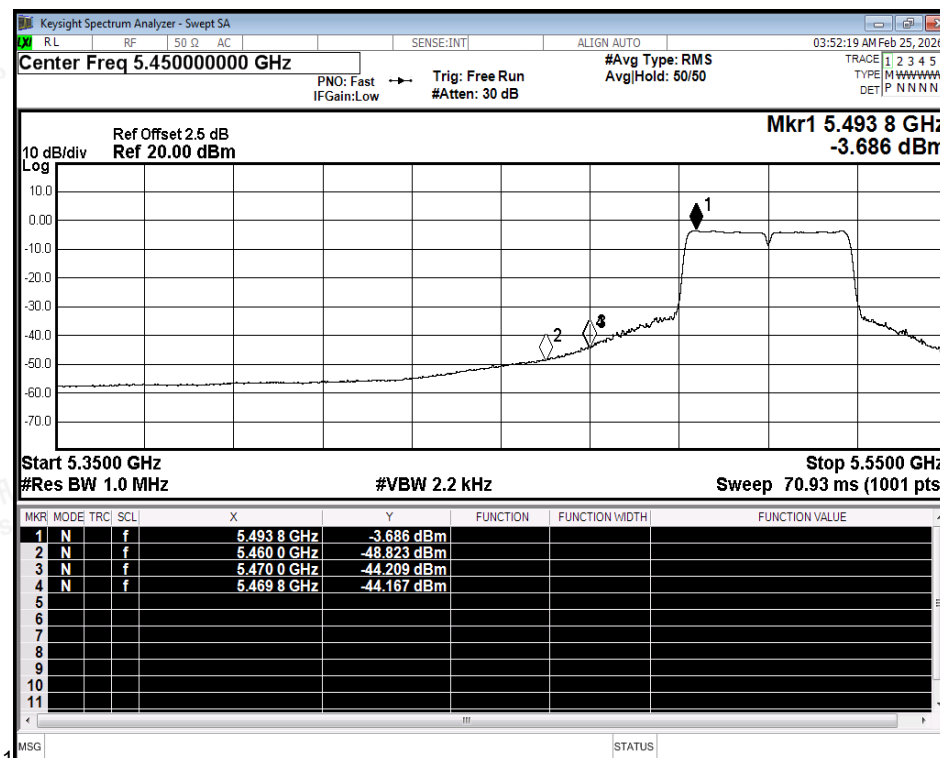

Restrict Band NVNT n40 5510MHz Ant2 Average




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

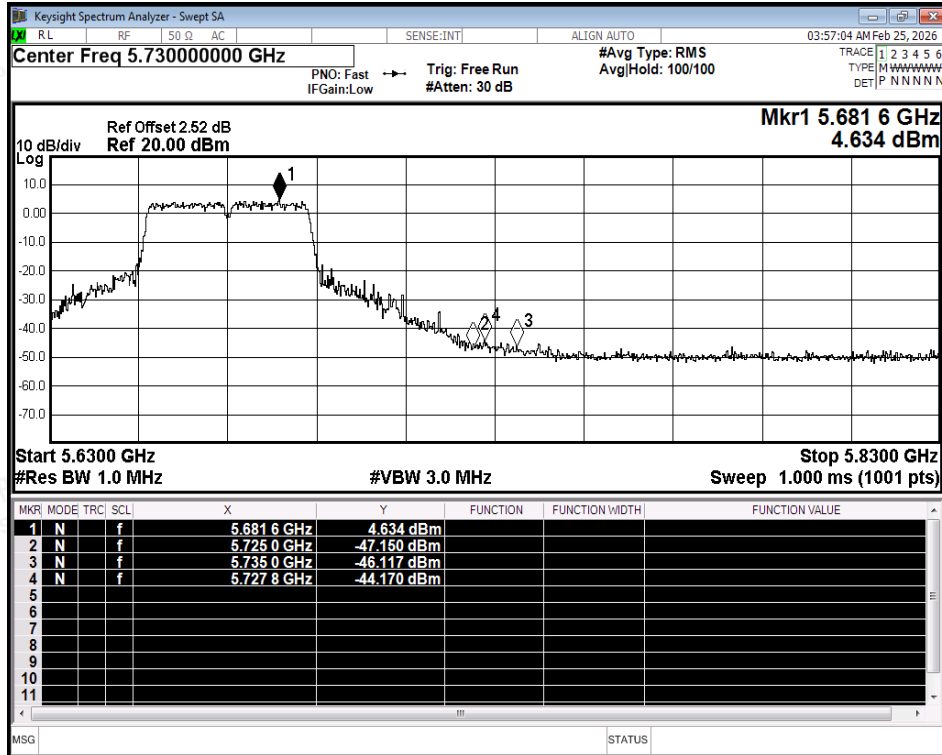

Restrict Band NVNT n40 5670MHz Ant2 Peak

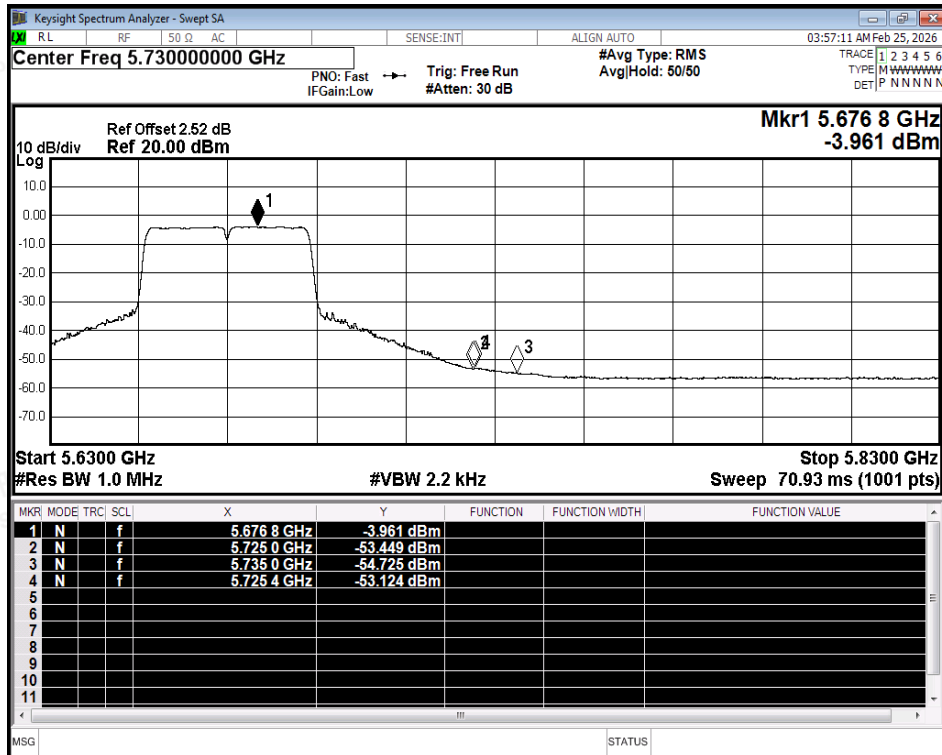

Restrict Band NVNT n40 5670MHz Ant2 Average




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

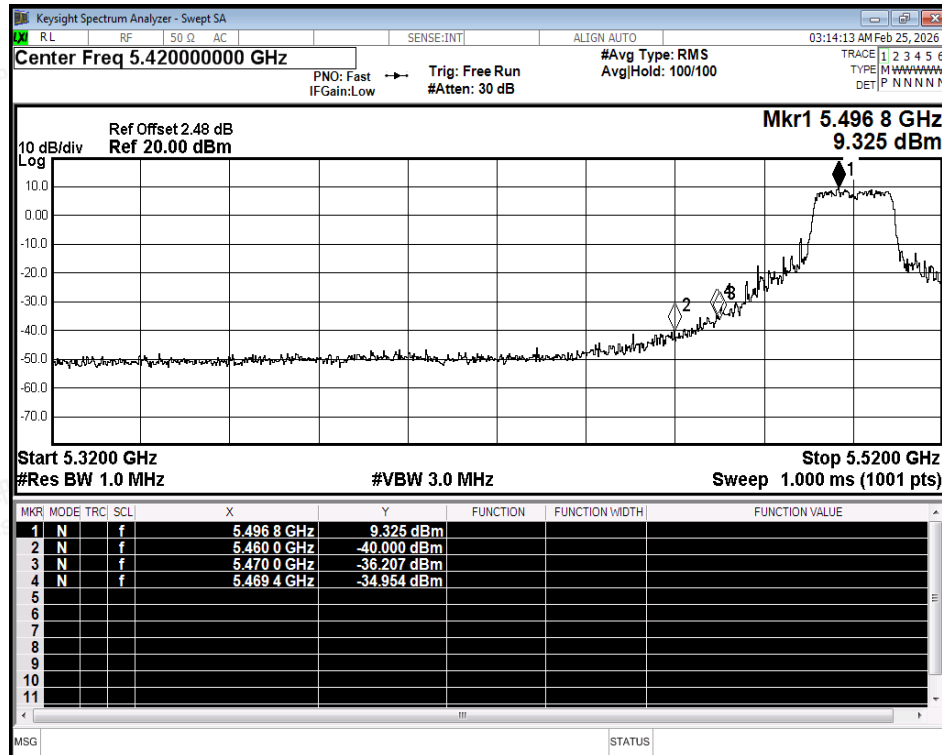

Restrict Band NVNT ac20 5500MHz Ant2 Peak

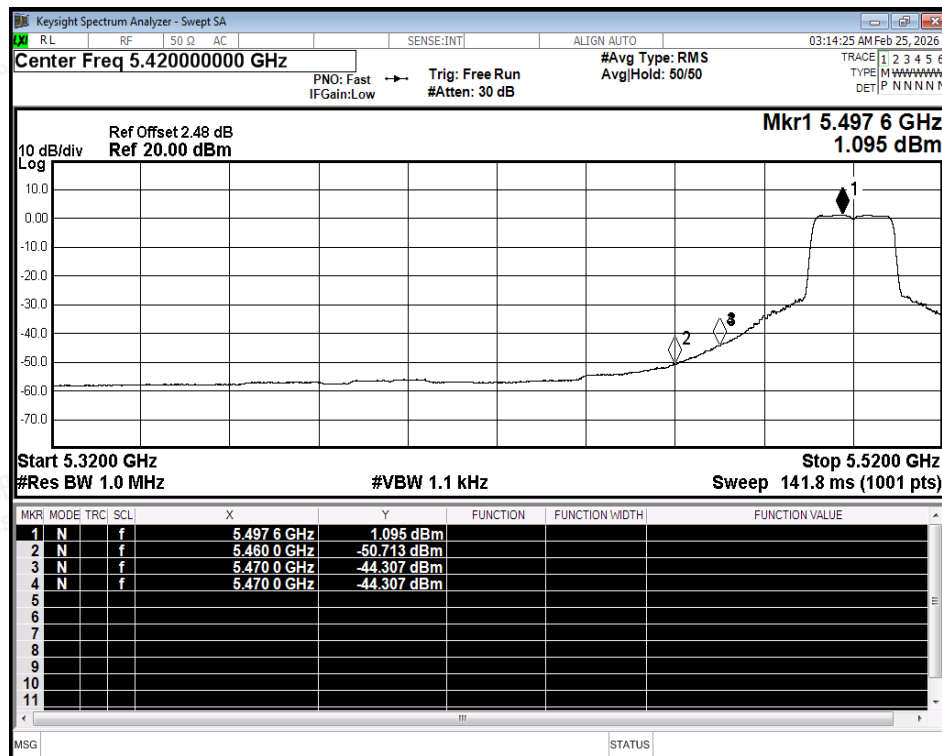

Restrict Band NVNT ac20 5500MHz Ant2 Average

